

Appendix Test Data

Report No.:	1812C40114912506	Test Sample No.:	1-2-2
Start Test Date:	2024.10.25	Finish Test Date:	2024.10.31
Test Engineer:	Joker Wang	Auditor:	Justin Feng
Temperature:	24.3℃	Relative Humidity:	57 %
Pressure:	101 kPa		

Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	22.69	PASS
Band38	5MHz	16QAM	37775	1RB#0	22.32	PASS
Band38	5MHz	QPSK	37775	1RB#12	23.00	PASS
Band38	5MHz	16QAM	37775	1RB#12	22.50	PASS
Band38	5MHz	QPSK	37775	1RB#24	22.94	PASS
Band38	5MHz	16QAM	37775	1RB#24	22.59	PASS
Band38	5MHz	QPSK	37775	12RB#0	22.05	PASS
Band38	5MHz	16QAM	37775	12RB#0	20.94	PASS
Band38	5MHz	QPSK	37775	12RB#6	21.95	PASS
Band38	5MHz	16QAM	37775	12RB#6	20.94	PASS
Band38	5MHz	QPSK	37775	12RB#13	22.00	PASS
Band38	5MHz	16QAM	37775	12RB#13	21.09	PASS
Band38	5MHz	QPSK	37775	25RB#0	22.01	PASS
Band38	5MHz	16QAM	37775	25RB#0	21.00	PASS
Band38	5MHz	QPSK	38000	1RB#0	22.85	PASS
Band38	5MHz	16QAM	38000	1RB#0	21.89	PASS
Band38	5MHz	QPSK	38000	1RB#12	22.99	PASS
Band38	5MHz	16QAM	38000	1RB#12	22.06	PASS
Band38	5MHz	QPSK	38000	1RB#24	23.02	PASS
Band38	5MHz	16QAM	38000	1RB#24	21.97	PASS
Band38	5MHz	QPSK	38000	12RB#0	22.07	PASS
Band38	5MHz	16QAM	38000	12RB#0	21.09	PASS
Band38	5MHz	QPSK	38000	12RB#6	22.07	PASS
Band38	5MHz	16QAM	38000	12RB#6	21.09	PASS
Band38	5MHz	QPSK	38000	12RB#13	22.15	PASS
Band38	5MHz	16QAM	38000	12RB#13	21.15	PASS



Band38	5MHz	QPSK	38000	25RB#0	22.11	PASS
Band38	5MHz	16QAM	38000	25RB#0	21.15	PASS
Band38	5MHz	QPSK	38225	1RB#0	23.00	PASS
Band38	5MHz	16QAM	38225	1RB#0	22.40	PASS
Band38	5MHz	QPSK	38225	1RB#12	23.06	PASS
Band38	5MHz	16QAM	38225	1RB#12	22.50	PASS
Band38	5MHz	QPSK	38225	1RB#24	23.05	PASS
Band38	5MHz	16QAM	38225	1RB#24	22.38	PASS
Band38	5MHz	QPSK	38225	12RB#0	22.17	PASS
Band38	5MHz	16QAM	38225	12RB#0	21.14	PASS
Band38	5MHz	QPSK	38225	12RB#6	22.09	PASS
Band38	5MHz	16QAM	38225	12RB#6	21.15	PASS
Band38	5MHz	QPSK	38225	12RB#13	22.20	PASS
Band38	5MHz	16QAM	38225	12RB#13	21.17	PASS
Band38	5MHz	QPSK	38225	25RB#0	22.11	PASS
Band38	5MHz	16QAM	38225	25RB#0	21.23	PASS
Band38	10MHz	QPSK	37800	1RB#0	22.78	PASS
Band38	10MHz	16QAM	37800	1RB#0	22.25	PASS
Band38	10MHz	QPSK	37800	1RB#24	22.95	PASS
Band38	10MHz	16QAM	37800	1RB#24	22.15	PASS
Band38	10MHz	QPSK	37800	1RB#49	22.93	PASS
Band38	10MHz	16QAM	37800	1RB#49	22.28	PASS
Band38	10MHz	QPSK	37800	25RB#0	21.93	PASS
Band38	10MHz	16QAM	37800	25RB#0	20.91	PASS
Band38	10MHz	QPSK	37800	25RB#12	21.94	PASS
Band38	10MHz	16QAM	37800	25RB#12	21.02	PASS
Band38	10MHz	QPSK	37800	25RB#25	21.85	PASS
Band38	10MHz	16QAM	37800	25RB#25	21.05	PASS
Band38	10MHz	QPSK	37800	50RB#0	21.99	PASS
Band38	10MHz	16QAM	37800	50RB#0	21.10	PASS
Band38	10MHz	QPSK	38000	1RB#0	22.96	PASS
Band38	10MHz	16QAM	38000	1RB#0	22.23	PASS
Band38	10MHz	QPSK	38000	1RB#24	23.09	PASS
Band38	10MHz	16QAM	38000	1RB#24	22.57	PASS
Band38	10MHz	QPSK	38000	1RB#49	23.14	PASS
Band38	10MHz	16QAM	38000	1RB#49	22.45	PASS
Band38	10MHz	QPSK	38000	25RB#0	22.01	PASS
Band38	10MHz	16QAM	38000	25RB#0	21.13	PASS
Band38	10MHz	QPSK	38000	25RB#12	22.02	PASS
Band38	10MHz	16QAM	38000	25RB#12	21.13	PASS
Band38	10MHz	QPSK	38000	25RB#25	22.23	PASS
Band38	10MHz	16QAM	38000	25RB#25	21.27	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



Band38	10MHz	QPSK	38000	50RB#0	22.20	PASS
Band38	10MHz	16QAM	38000	50RB#0	21.21	PASS
Band38	10MHz	QPSK	38200	1RB#0	23.41	PASS
Band38	10MHz	16QAM	38200	1RB#0	22.55	PASS
Band38	10MHz	QPSK	38200	1RB#24	23.36	PASS
Band38	10MHz	16QAM	38200	1RB#24	22.63	PASS
Band38	10MHz	QPSK	38200	1RB#49	23.26	PASS
Band38	10MHz	16QAM	38200	1RB#49	22.92	PASS
Band38	10MHz	QPSK	38200	25RB#0	22.17	PASS
Band38	10MHz	16QAM	38200	25RB#0	21.33	PASS
Band38	10MHz	QPSK	38200	25RB#12	22.19	PASS
Band38	10MHz	16QAM	38200	25RB#12	21.23	PASS
Band38	10MHz	QPSK	38200	25RB#25	22.09	PASS
Band38	10MHz	16QAM	38200	25RB#25	21.33	PASS
Band38	10MHz	QPSK	38200	50RB#0	22.20	PASS
Band38	10MHz	16QAM	38200	50RB#0	21.30	PASS
Band38	15MHz	QPSK	37825	1RB#0	22.81	PASS
Band38	15MHz	16QAM	37825	1RB#0	22.15	PASS
Band38	15MHz	QPSK	37825	1RB#38	22.68	PASS
Band38	15MHz	16QAM	37825	1RB#38	21.99	PASS
Band38	15MHz	QPSK	37825	1RB#74	22.85	PASS
Band38	15MHz	16QAM	37825	1RB#74	22.23	PASS
Band38	15MHz	QPSK	37825	38RB#0	21.99	PASS
Band38	15MHz	16QAM	37825	38RB#0	21.98	PASS
Band38	15MHz	QPSK	37825	38RB#18	21.97	PASS
Band38	15MHz	16QAM	37825	38RB#18	21.97	PASS
Band38	15MHz	QPSK	37825	38RB#37	21.97	PASS
Band38	15MHz	16QAM	37825	38RB#37	21.96	PASS
Band38	15MHz	QPSK	37825	75RB#0	21.96	PASS
Band38	15MHz	16QAM	37825	75RB#0	21.01	PASS
Band38	15MHz	QPSK	38000	1RB#0	22.89	PASS
Band38	15MHz	16QAM	38000	1RB#0	21.95	PASS
Band38	15MHz	QPSK	38000	1RB#38	22.99	PASS
Band38	15MHz	16QAM	38000	1RB#38	22.02	PASS
Band38	15MHz	QPSK	38000	1RB#74	23.13	PASS
Band38	15MHz	16QAM	38000	1RB#74	22.15	PASS
Band38	15MHz	QPSK	38000	38RB#0	22.13	PASS
Band38	15MHz	16QAM	38000	38RB#0	22.12	PASS
Band38	15MHz	QPSK	38000	38RB#18	22.12	PASS
Band38	15MHz	16QAM	38000	38RB#18	22.12	PASS
Band38	15MHz	QPSK	38000	38RB#37	22.12	PASS
Band38	15MHz	16QAM	38000	38RB#37	22.12	PASS



Band38	15MHz	QPSK	38000	75RB#0	22.11	PASS
Band38	15MHz	16QAM	38000	75RB#0	21.16	PASS
Band38	15MHz	QPSK	38175	1RB#0	23.18	PASS
Band38	15MHz	16QAM	38175	1RB#0	22.30	PASS
Band38	15MHz	QPSK	38175	1RB#38	23.25	PASS
Band38	15MHz	16QAM	38175	1RB#38	22.72	PASS
Band38	15MHz	QPSK	38175	1RB#74	23.19	PASS
Band38	15MHz	16QAM	38175	1RB#74	22.36	PASS
Band38	15MHz	QPSK	38175	38RB#0	22.28	PASS
Band38	15MHz	16QAM	38175	38RB#0	22.28	PASS
Band38	15MHz	QPSK	38175	38RB#18	22.28	PASS
Band38	15MHz	16QAM	38175	38RB#18	22.28	PASS
Band38	15MHz	QPSK	38175	38RB#37	22.28	PASS
Band38	15MHz	16QAM	38175	38RB#37	22.28	PASS
Band38	15MHz	QPSK	38175	75RB#0	22.28	PASS
Band38	15MHz	16QAM	38175	75RB#0	21.40	PASS
Band38	20MHz	QPSK	37850	1RB#0	22.68	PASS
Band38	20MHz	16QAM	37850	1RB#0	22.41	PASS
Band38	20MHz	QPSK	37850	1RB#49	22.97	PASS
Band38	20MHz	16QAM	37850	1RB#49	22.67	PASS
Band38	20MHz	QPSK	37850	1RB#99	22.81	PASS
Band38	20MHz	16QAM	37850	1RB#99	22.62	PASS
Band38	20MHz	QPSK	37850	50RB#0	21.96	PASS
Band38	20MHz	16QAM	37850	50RB#0	21.12	PASS
Band38	20MHz	QPSK	37850	50RB#25	21.97	PASS
Band38	20MHz	16QAM	37850	50RB#25	21.12	PASS
Band38	20MHz	QPSK	37850	50RB#50	22.09	PASS
Band38	20MHz	16QAM	37850	50RB#50	21.23	PASS
Band38	20MHz	QPSK	37850	100RB#0	22.17	PASS
Band38	20MHz	16QAM	37850	100RB#0	21.19	PASS
Band38	20MHz	QPSK	38000	1RB#0	23.03	PASS
Band38	20MHz	16QAM	38000	1RB#0	22.05	PASS
Band38	20MHz	QPSK	38000	1RB#49	23.45	PASS
Band38	20MHz	16QAM	38000	1RB#49	22.40	PASS
Band38	20MHz	QPSK	38000	1RB#99	23.22	PASS
Band38	20MHz	16QAM	38000	1RB#99	22.28	PASS
Band38	20MHz	QPSK	38000	50RB#0	22.01	PASS
Band38	20MHz	16QAM	38000	50RB#0	21.16	PASS
Band38	20MHz	QPSK	38000	50RB#25	22.10	PASS
Band38	20MHz	16QAM	38000	50RB#25	21.16	PASS
Band38	20MHz	QPSK	38000	50RB#50	22.34	PASS
Band38	20MHz	16QAM	38000	50RB#50	21.20	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500

www.anbotech.com



Band38	20MHz	QPSK	38000	100RB#0	22.09	PASS
Band38	20MHz	16QAM	38000	100RB#0	21.21	PASS
Band38	20MHz	QPSK	38150	1RB#0	23.01	PASS
Band38	20MHz	16QAM	38150	1RB#0	21.95	PASS
Band38	20MHz	QPSK	38150	1RB#49	23.34	PASS
Band38	20MHz	16QAM	38150	1RB#49	22.19	PASS
Band38	20MHz	QPSK	38150	1RB#99	23.00	PASS
Band38	20MHz	16QAM	38150	1RB#99	21.96	PASS
Band38	20MHz	QPSK	38150	50RB#0	22.22	PASS
Band38	20MHz	16QAM	38150	50RB#0	21.31	PASS
Band38	20MHz	QPSK	38150	50RB#25	22.23	PASS
Band38	20MHz	16QAM	38150	50RB#25	21.32	PASS
Band38	20MHz	QPSK	38150	50RB#50	22.28	PASS
Band38	20MHz	16QAM	38150	50RB#50	21.27	PASS
Band38	20MHz	QPSK	38150	100RB#0	22.21	PASS
Band38	20MHz	16QAM	38150	100RB#0	21.35	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	8.85	13	PASS
Band38	5MHz	16QAM	37775	1RB#0	8.98	13	PASS
Band38	5MHz	QPSK	37775	25RB#0	8.91	13	PASS
Band38	5MHz	16QAM	37775	25RB#0	9.73	13	PASS
Band38	5MHz	QPSK	38000	1RB#0	8.47	13	PASS
Band38	5MHz	16QAM	38000	1RB#0	9.05	13	PASS
Band38	5MHz	QPSK	38000	25RB#0	9.07	13	PASS
Band38	5MHz	16QAM	38000	25RB#0	9.78	13	PASS
Band38	5MHz	QPSK	38225	1RB#0	9.07	13	PASS
Band38	5MHz	16QAM	38225	1RB#0	9.18	13	PASS
Band38	5MHz	QPSK	38225	25RB#0	9.27	13	PASS
Band38	5MHz	16QAM	38225	25RB#0	9.81	13	PASS
Band38	10MHz	QPSK	37800	1RB#0	8.24	13	PASS
Band38	10MHz	16QAM	37800	1RB#0	9.21	13	PASS
Band38	10MHz	QPSK	37800	50RB#0	8.57	13	PASS
Band38	10MHz	16QAM	37800	50RB#0	9.70	13	PASS
Band38	10MHz	QPSK	38000	1RB#0	8.83	13	PASS
Band38	10MHz	16QAM	38000	1RB#0	9.07	13	PASS
Band38	10MHz	QPSK	38000	50RB#0	8.66	13	PASS
Band38	10MHz	16QAM	38000	50RB#0	9.51	13	PASS
Band38	10MHz	QPSK	38200	1RB#0	8.40	13	PASS
Band38	10MHz	16QAM	38200	1RB#0	9.35	13	PASS
Band38	10MHz	QPSK	38200	50RB#0	8.87	13	PASS
Band38	10MHz	16QAM	38200	50RB#0	9.86	13	PASS
Band38	15MHz	QPSK	37825	1RB#0	8.63	13	PASS
Band38	15MHz	16QAM	37825	1RB#0	9.15	13	PASS
Band38	15MHz	QPSK	37825	75RB#0	9.28	13	PASS
Band38	15MHz	16QAM	37825	75RB#0	9.90	13	PASS
Band38	15MHz	QPSK	38000	1RB#0	8.38	13	PASS
Band38	15MHz	16QAM	38000	1RB#0	9.34	13	PASS
Band38	15MHz	QPSK	38000	75RB#0	9.05	13	PASS
Band38	15MHz	16QAM	38000	75RB#0	9.70	13	PASS
Band38	15MHz	QPSK	38175	1RB#0	8.22	13	PASS
Band38	15MHz	16QAM	38175	1RB#0	9.13	13	PASS
Band38	15MHz	QPSK	38175	75RB#0	8.80	13	PASS
Band38	15MHz	16QAM	38175	75RB#0	9.67	13	PASS
Band38	20MHz	QPSK	37850	1RB#0	8.20	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



Band38	20MHz	16QAM	37850	1RB#0	9.72	13	PASS
Band38	20MHz	QPSK	37850	100RB#0	8.34	13	PASS
Band38	20MHz	16QAM	37850	100RB#0	10.11	13	PASS
Band38	20MHz	QPSK	38000	1RB#0	8.54	13	PASS
Band38	20MHz	16QAM	38000	1RB#0	8.92	13	PASS
Band38	20MHz	QPSK	38000	100RB#0	8.68	13	PASS
Band38	20MHz	16QAM	38000	100RB#0	9.34	13	PASS
Band38	20MHz	QPSK	38150	1RB#0	8.25	13	PASS
Band38	20MHz	16QAM	38150	1RB#0	9.21	13	PASS
Band38	20MHz	QPSK	38150	100RB#0	8.54	13	PASS
Band38	20MHz	16QAM	38150	100RB#0	9.69	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com





Hotline
400-003-0500
www.anbotek.com





Test Graphs

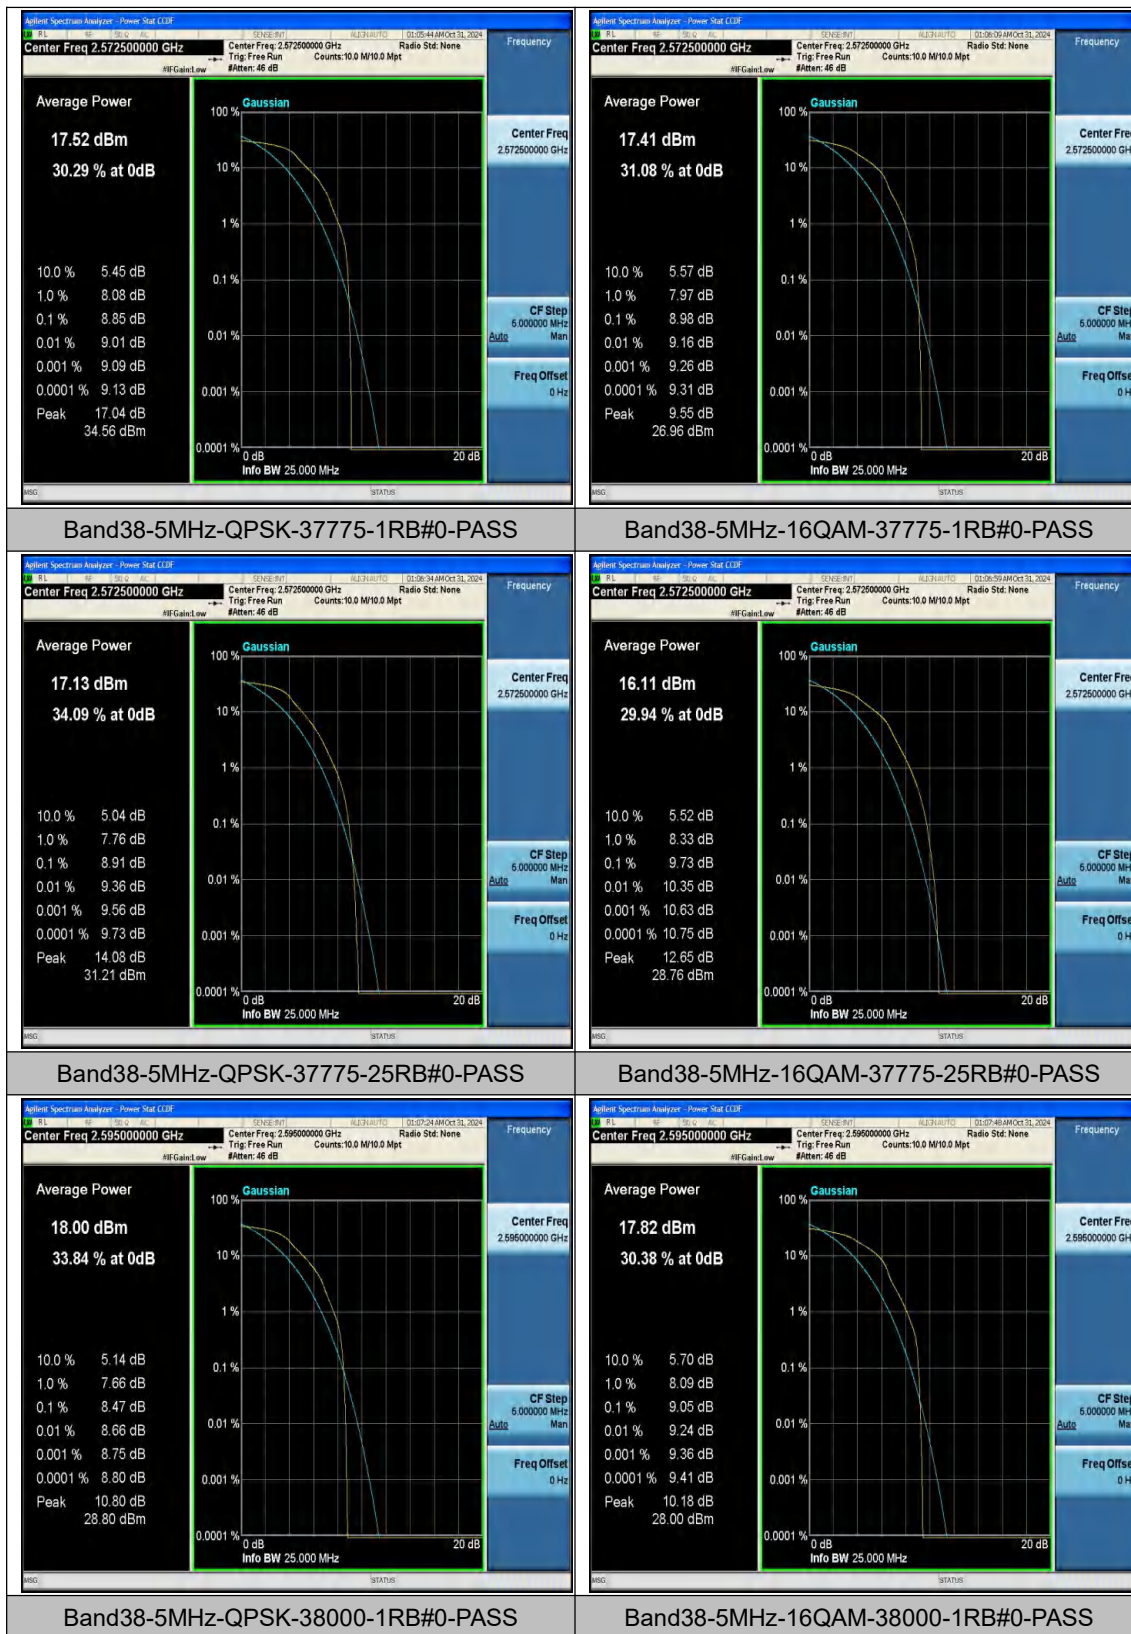


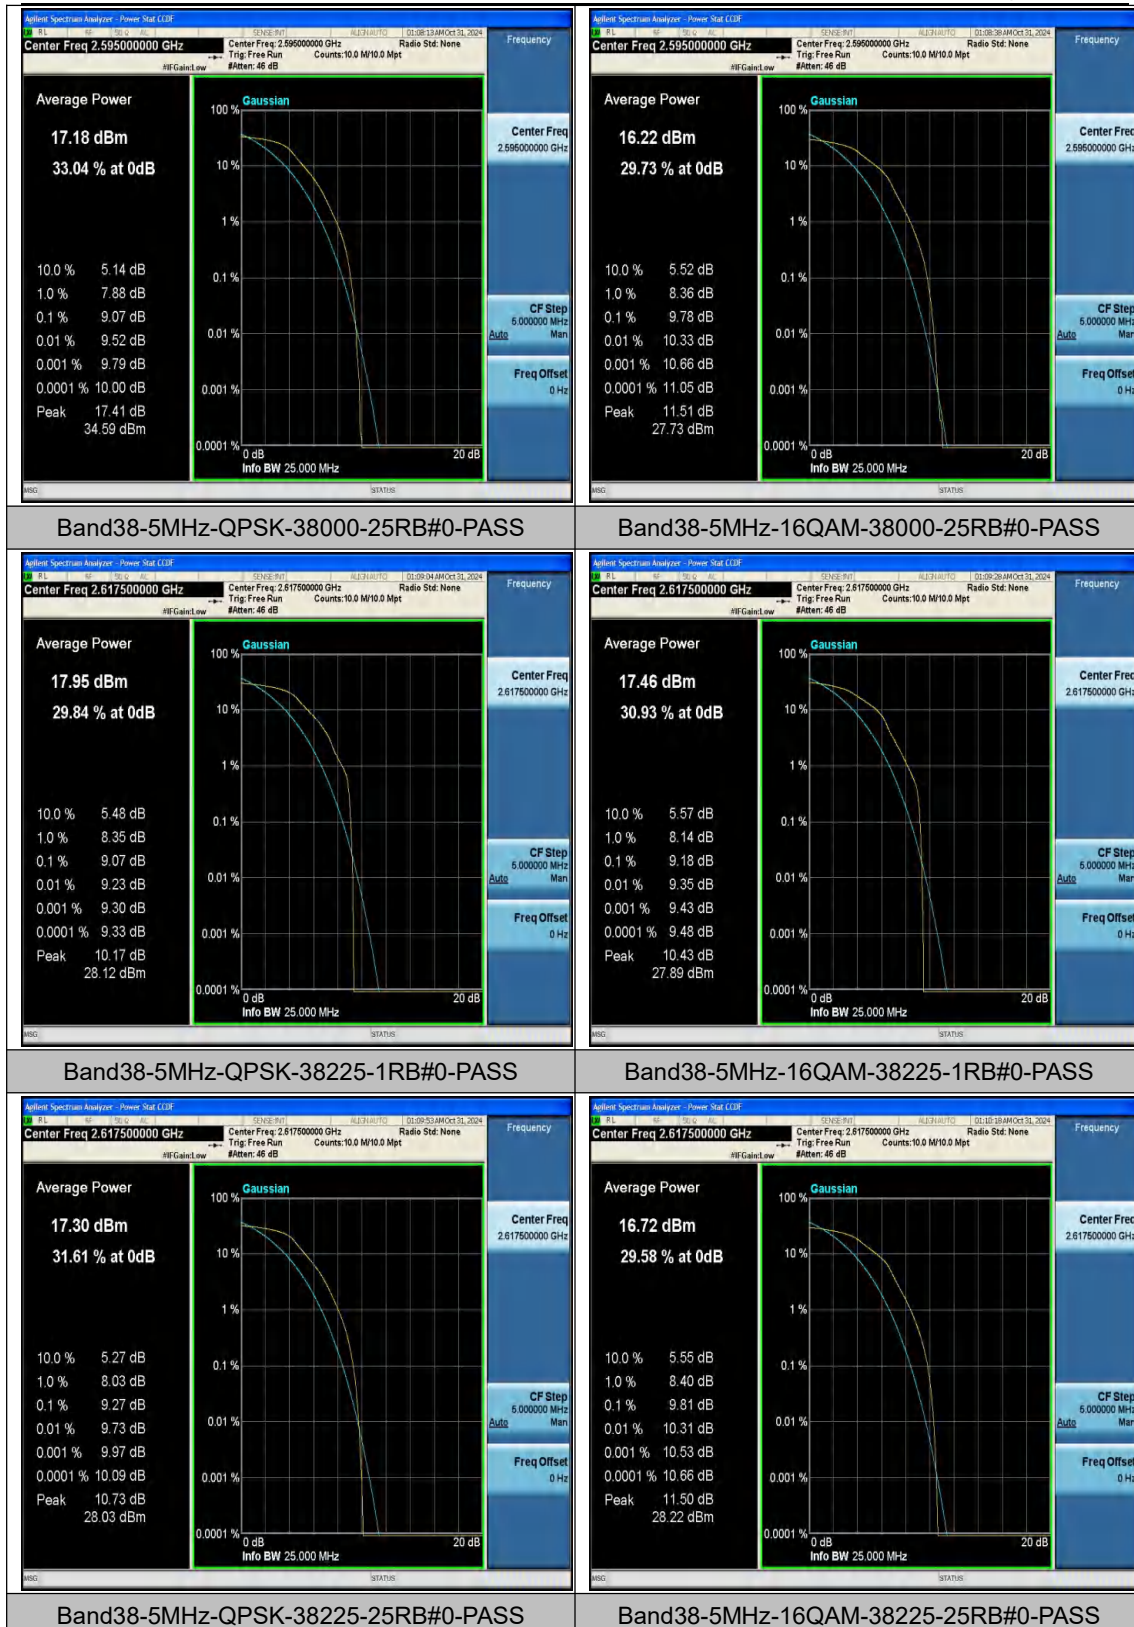


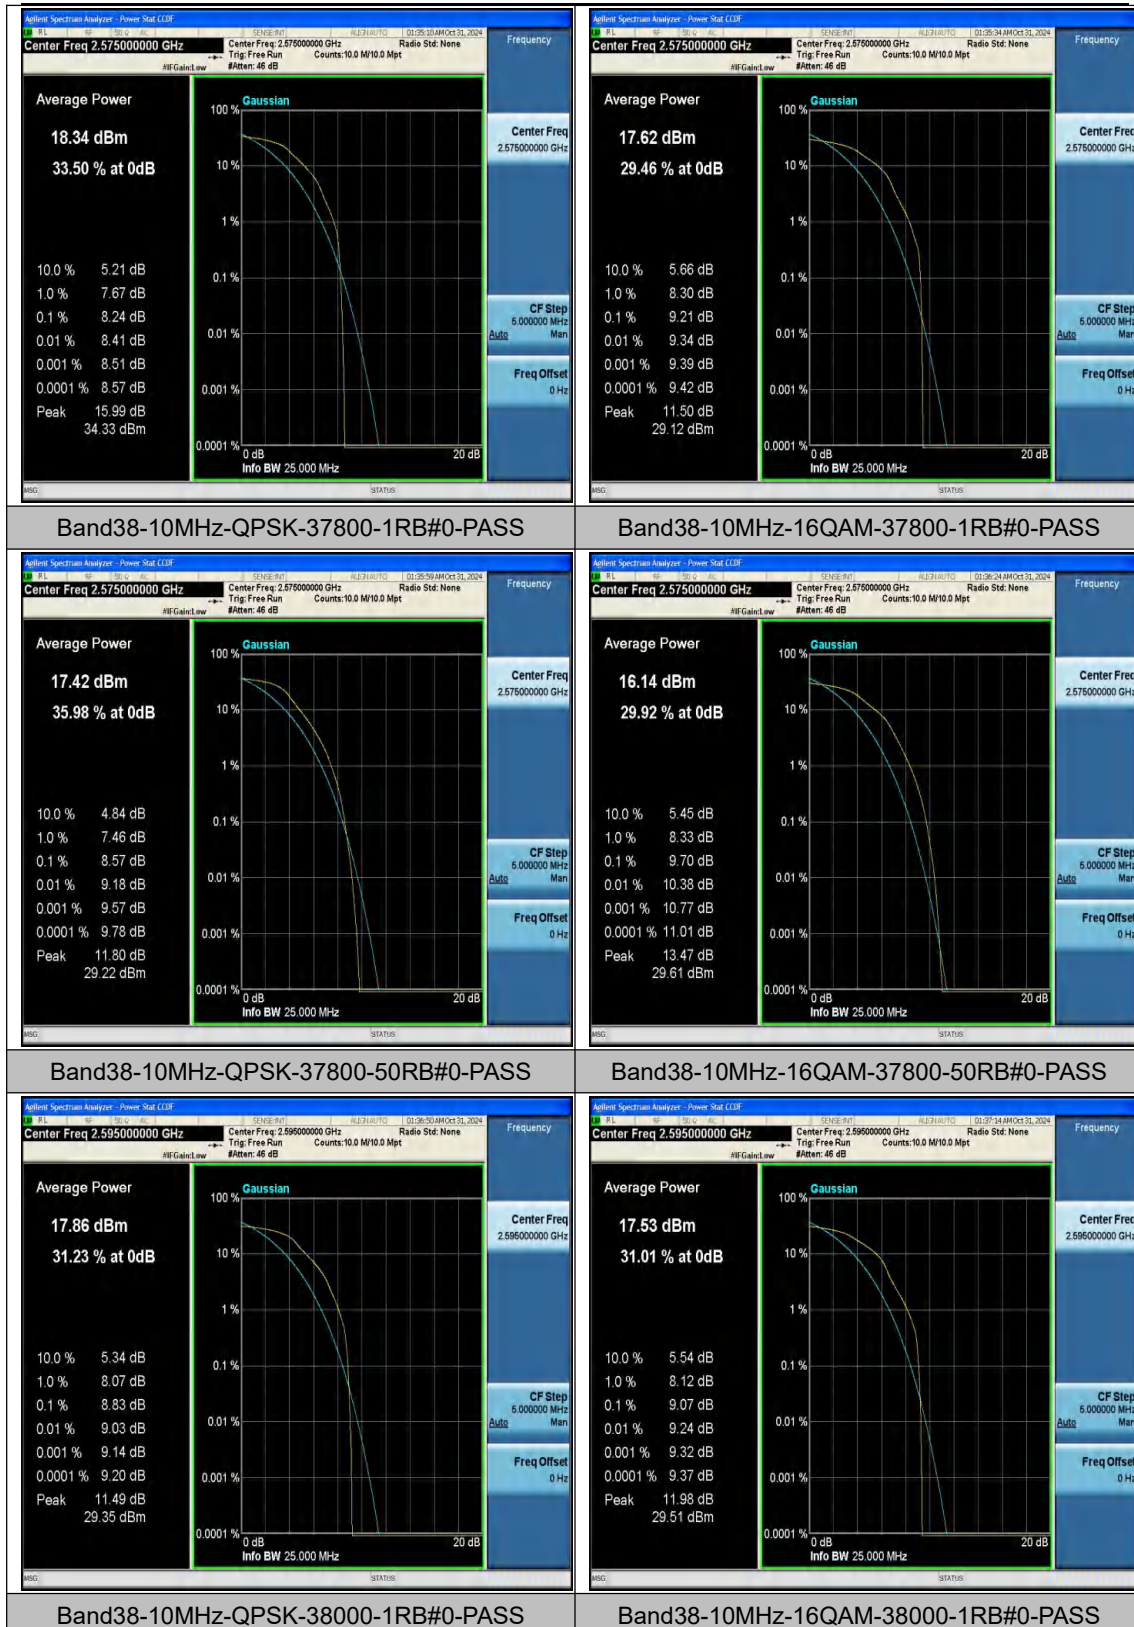


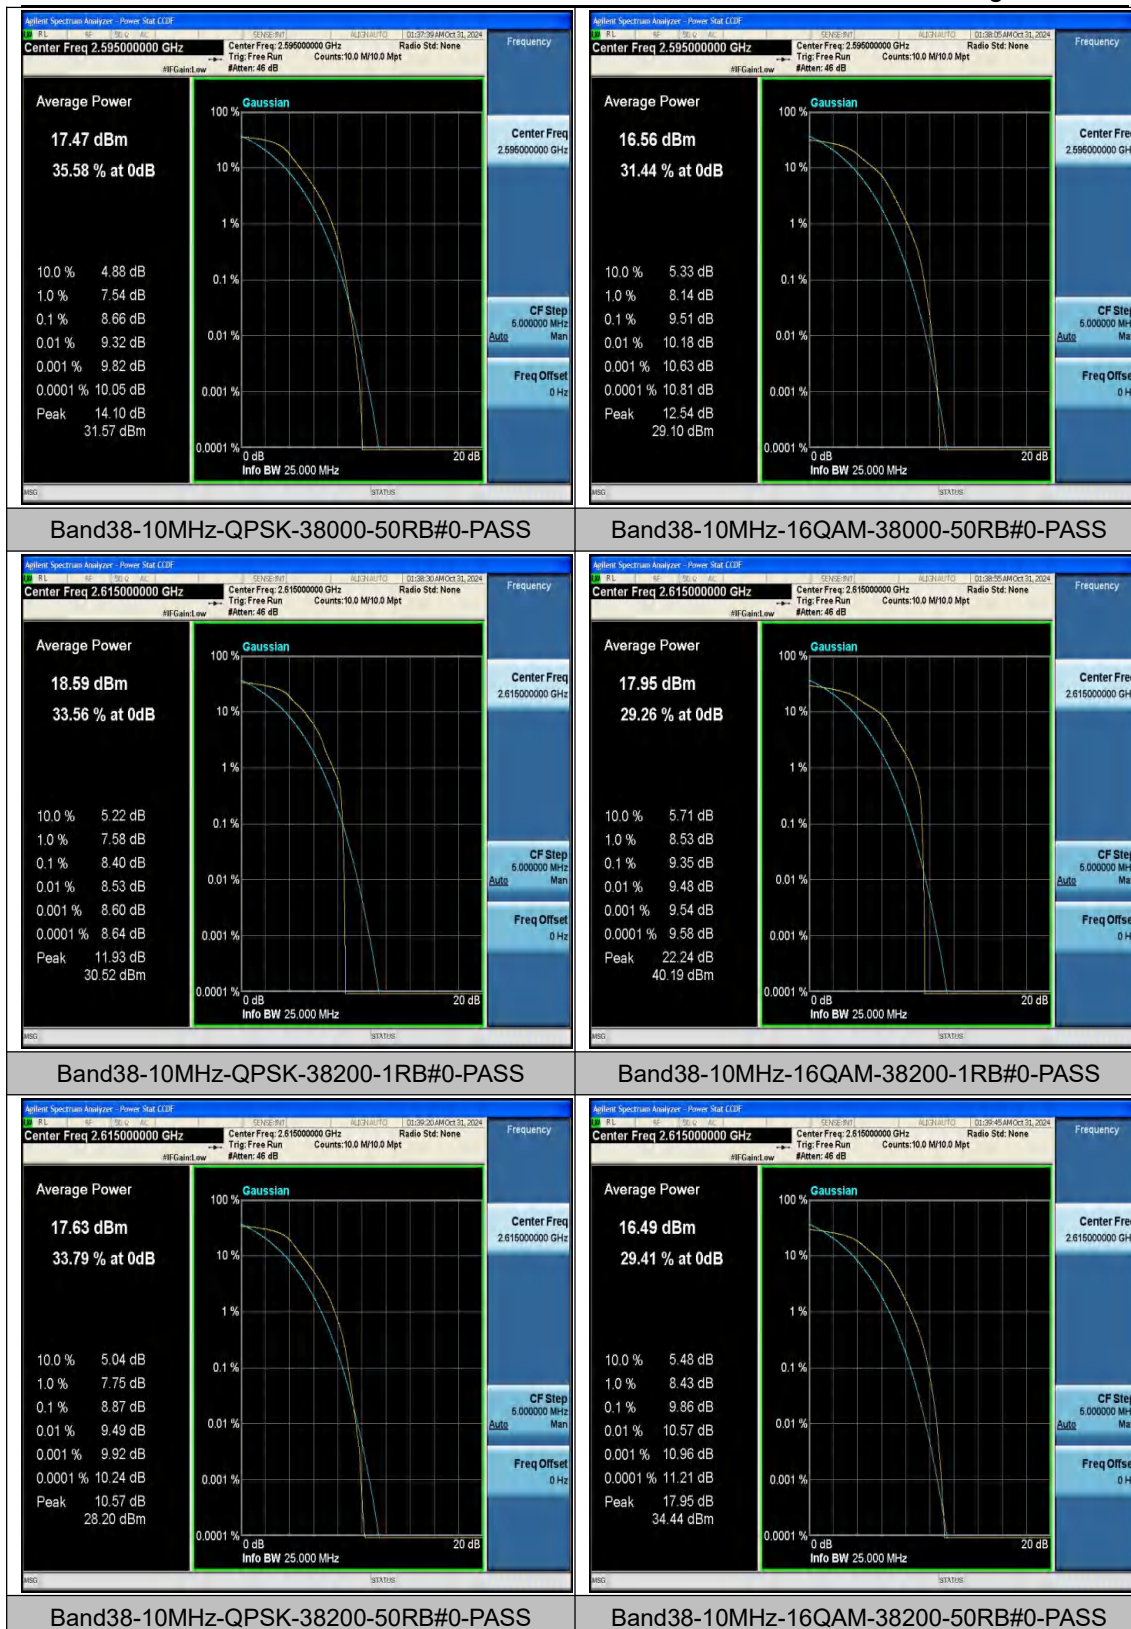

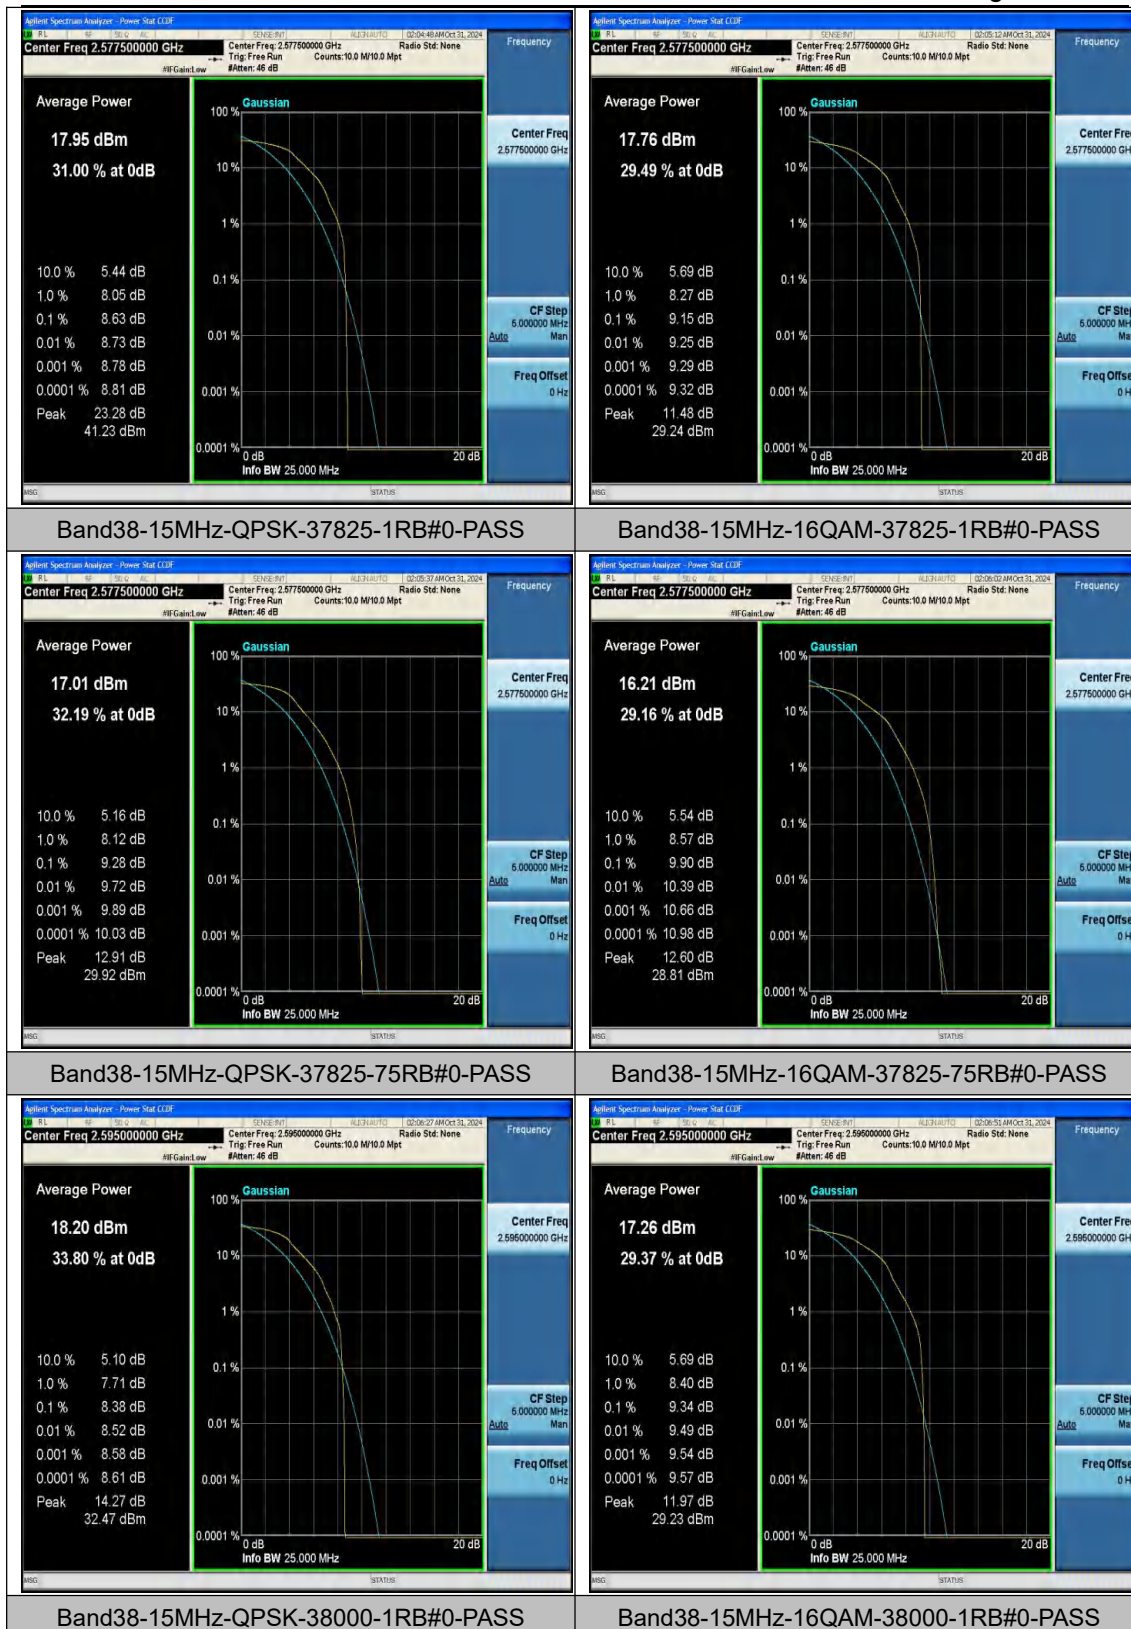

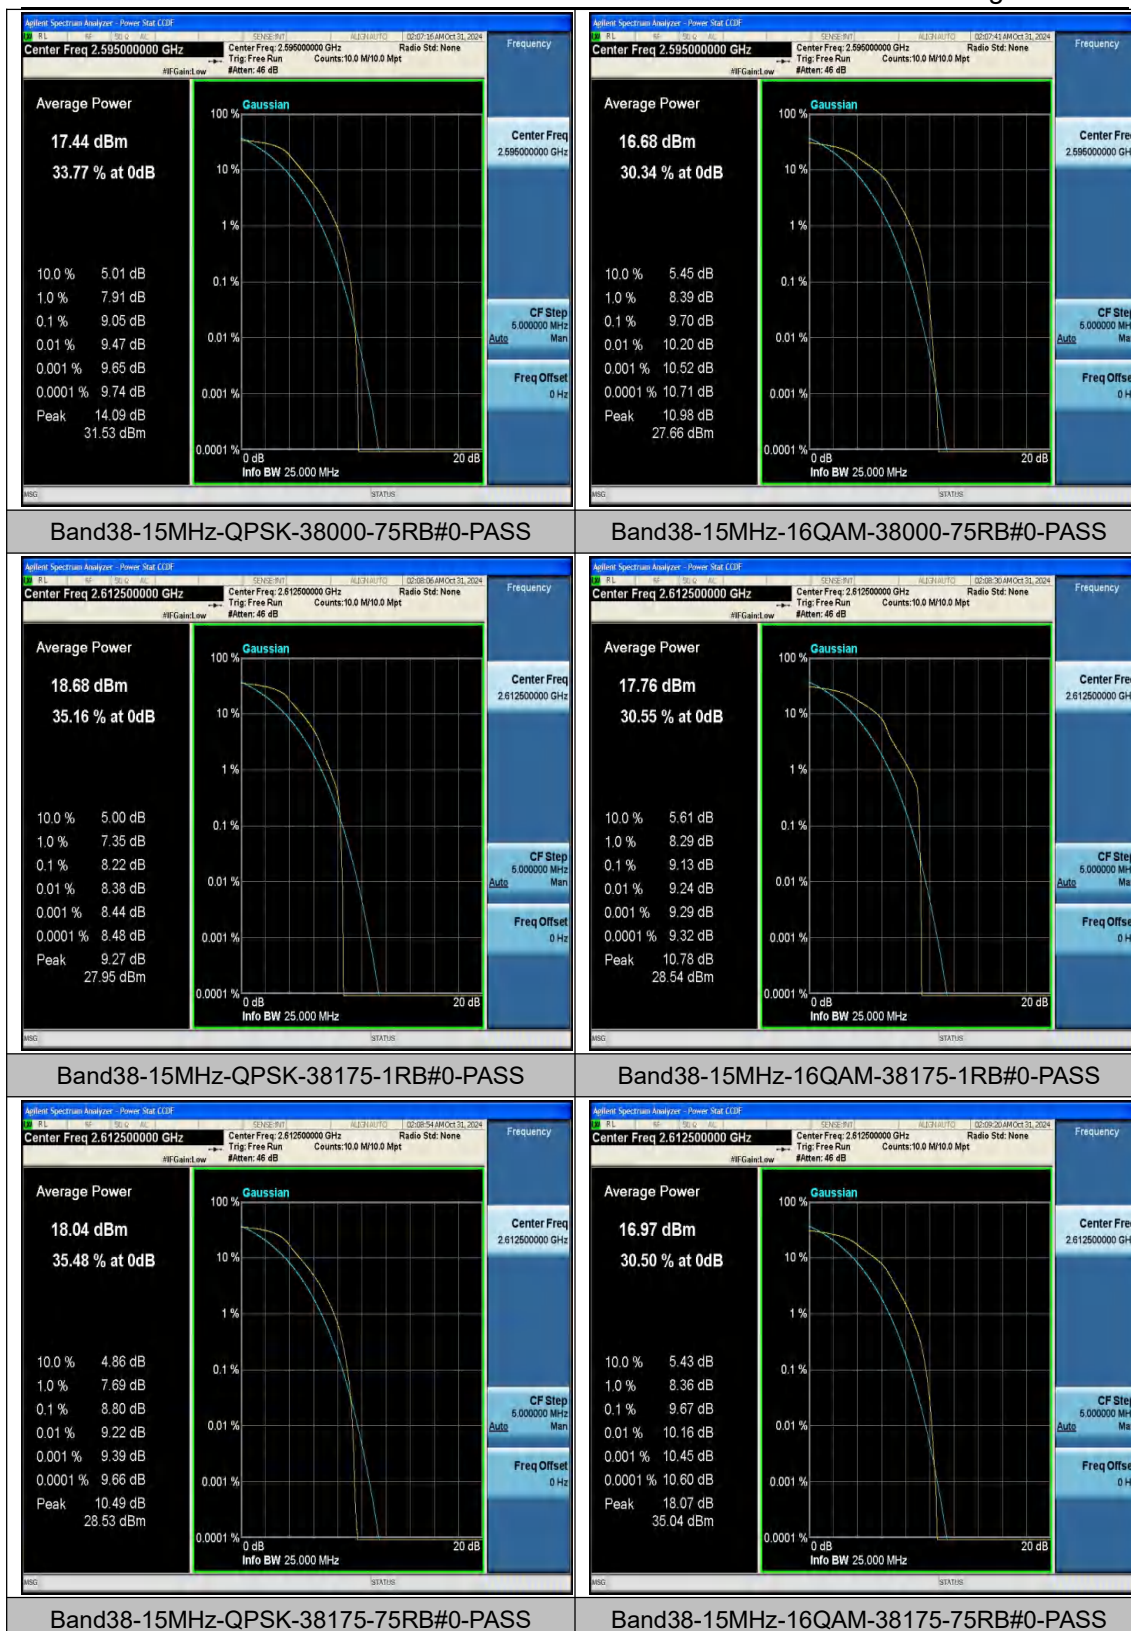

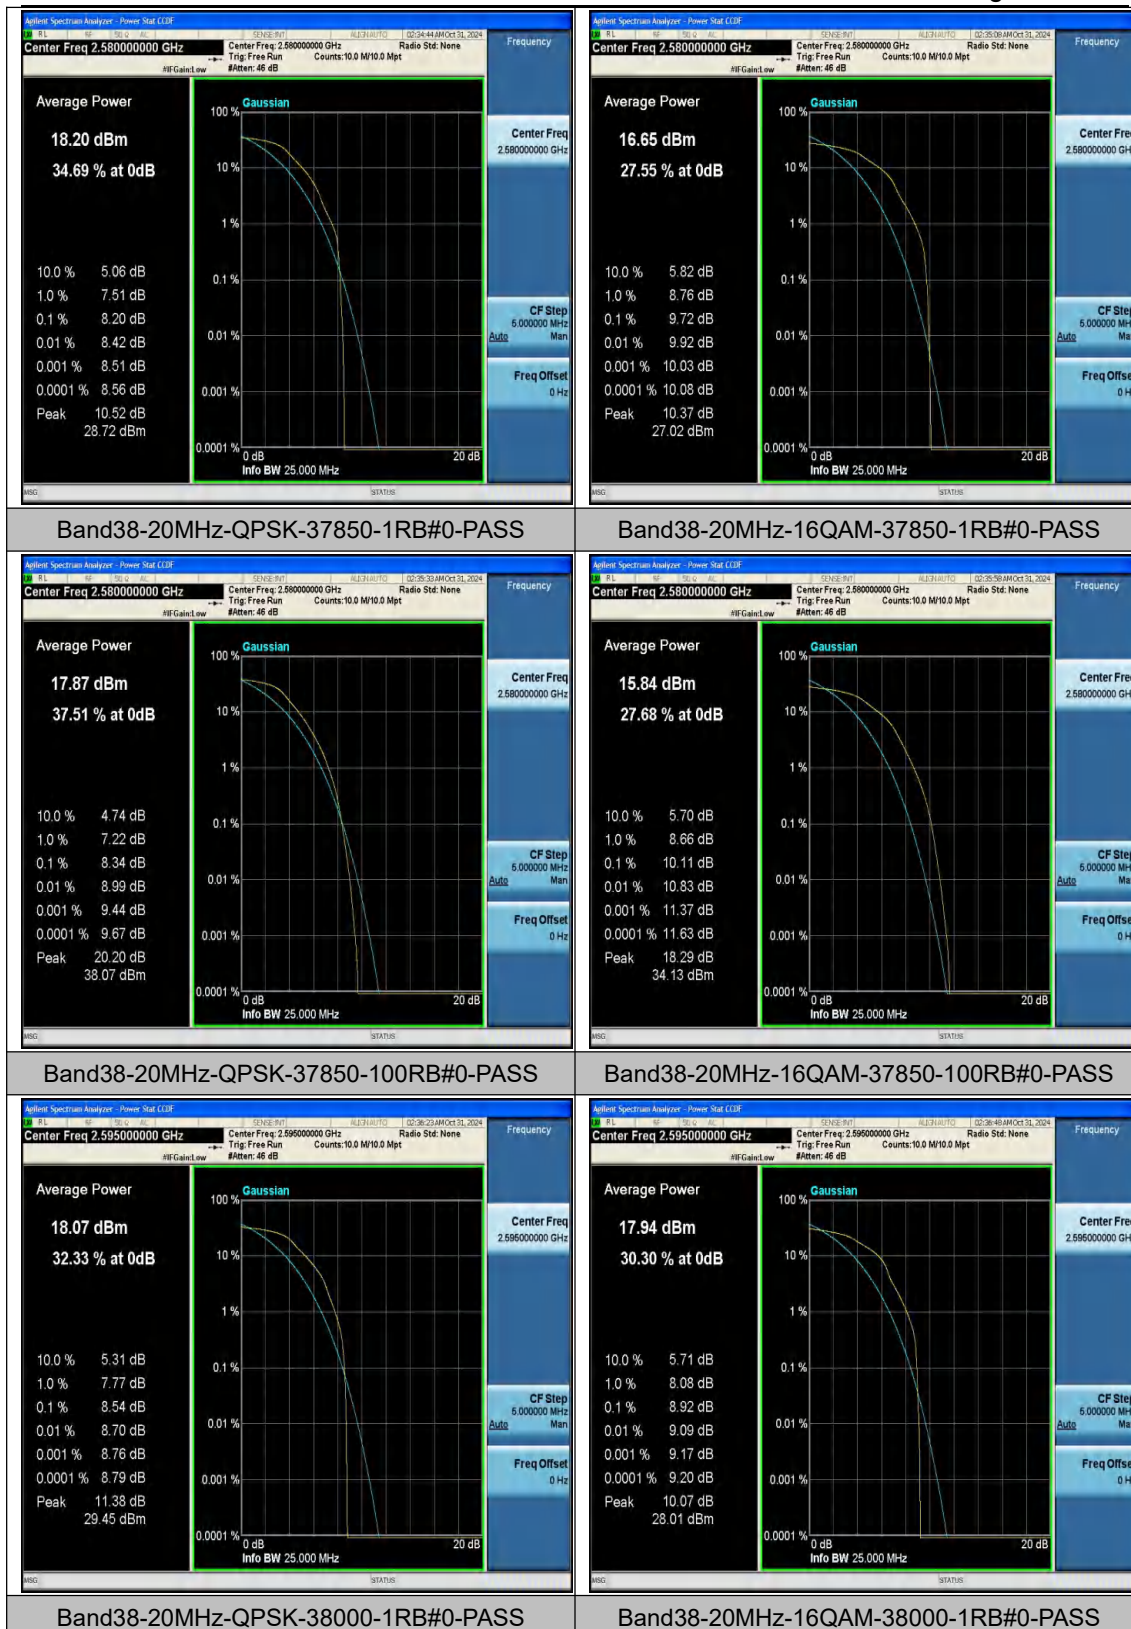

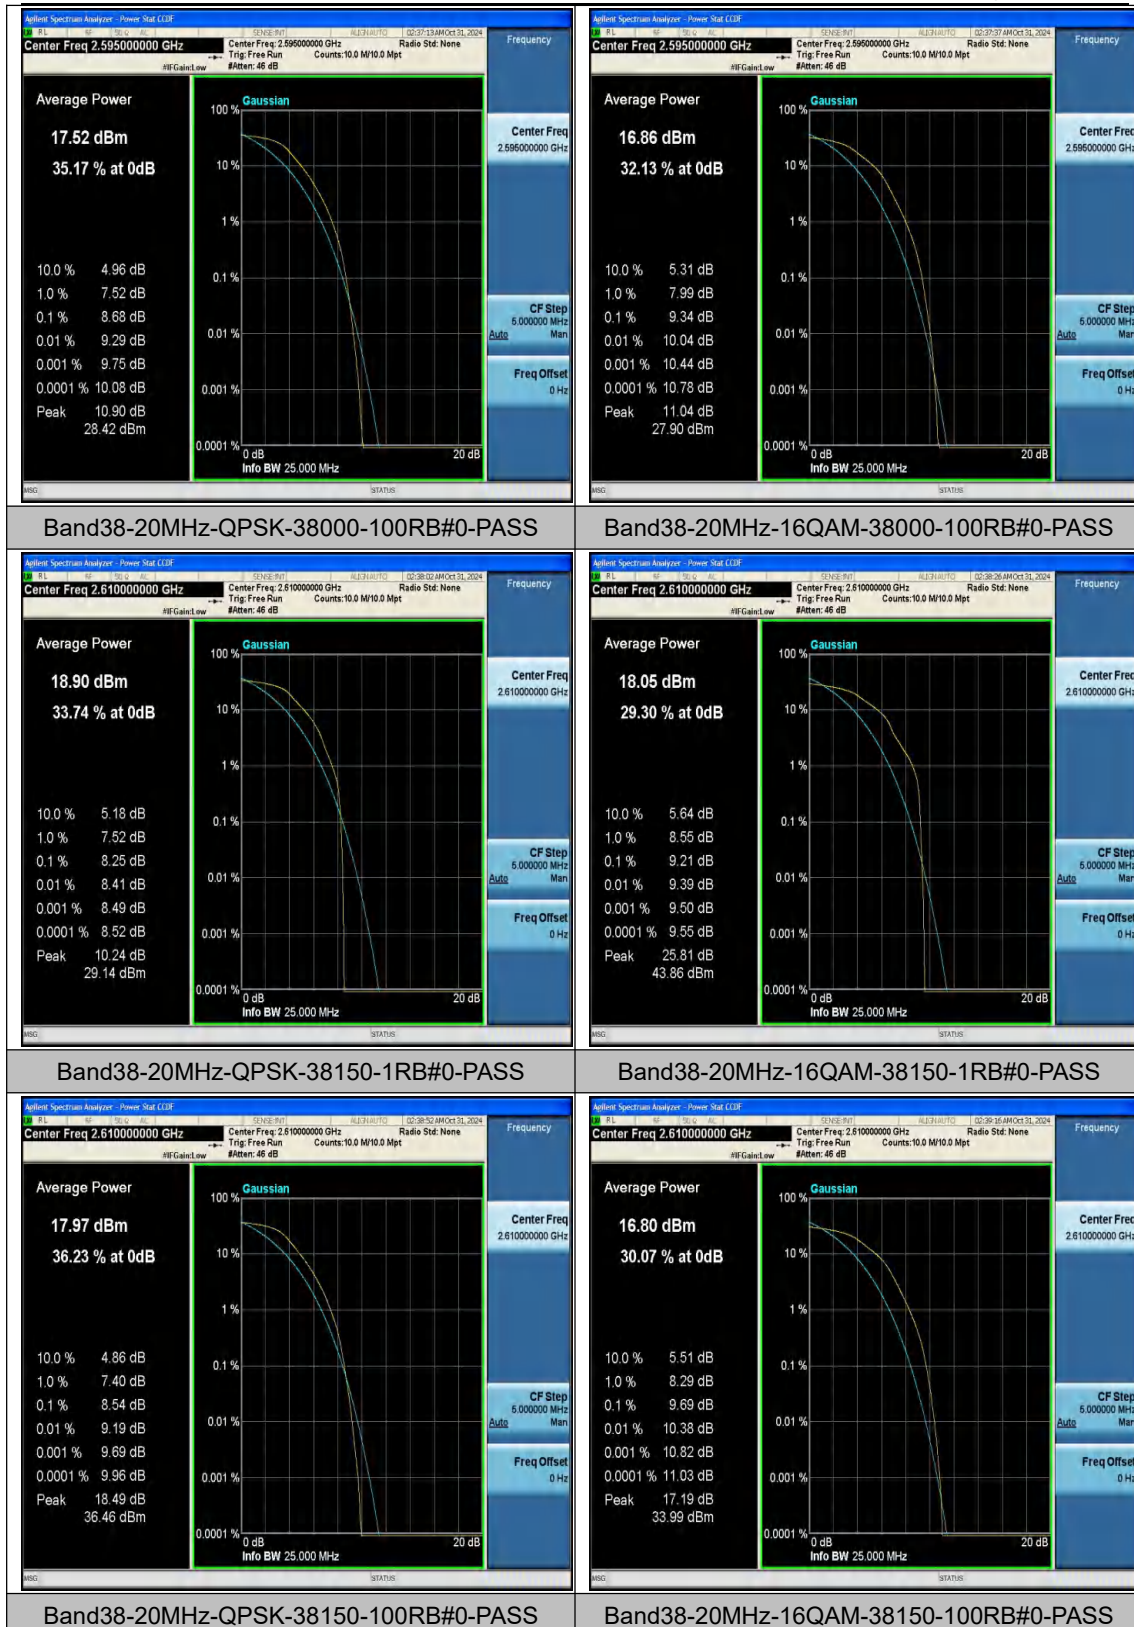


Appendix C: 26dB Bandwidth and Occupied Bandwidth


Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	4.5001	4.924	PASS
Band38	5MHz	16QAM	37775	25RB#0	4.4902	4.968	PASS
Band38	5MHz	QPSK	38000	25RB#0	4.4969	4.979	PASS
Band38	5MHz	16QAM	38000	25RB#0	4.4828	4.995	PASS
Band38	5MHz	QPSK	38225	25RB#0	4.4911	4.944	PASS
Band38	5MHz	16QAM	38225	25RB#0	4.4911	4.972	PASS
Band38	10MHz	QPSK	37800	50RB#0	8.9715	9.820	PASS
Band38	10MHz	16QAM	37800	50RB#0	8.9608	9.791	PASS
Band38	10MHz	QPSK	38000	50RB#0	8.9472	9.658	PASS
Band38	10MHz	16QAM	38000	50RB#0	8.9618	9.756	PASS
Band38	10MHz	QPSK	38200	50RB#0	8.9471	9.840	PASS
Band38	10MHz	16QAM	38200	50RB#0	8.9441	9.715	PASS
Band38	15MHz	QPSK	37825	75RB#0	13.452	15.02	PASS
Band38	15MHz	16QAM	37825	75RB#0	13.466	15.01	PASS
Band38	15MHz	QPSK	38000	75RB#0	13.491	15.18	PASS
Band38	15MHz	16QAM	38000	75RB#0	13.426	14.75	PASS
Band38	15MHz	QPSK	38175	75RB#0	13.418	14.58	PASS
Band38	15MHz	16QAM	38175	75RB#0	13.413	14.86	PASS
Band38	20MHz	QPSK	37850	100RB#0	17.895	19.46	PASS
Band38	20MHz	16QAM	37850	100RB#0	17.892	20.33	PASS
Band38	20MHz	QPSK	38000	100RB#0	17.908	19.64	PASS
Band38	20MHz	16QAM	38000	100RB#0	17.932	19.54	PASS
Band38	20MHz	QPSK	38150	100RB#0	17.901	20.54	PASS
Band38	20MHz	16QAM	38150	100RB#0	17.924	20.48	PASS




Test Graphs

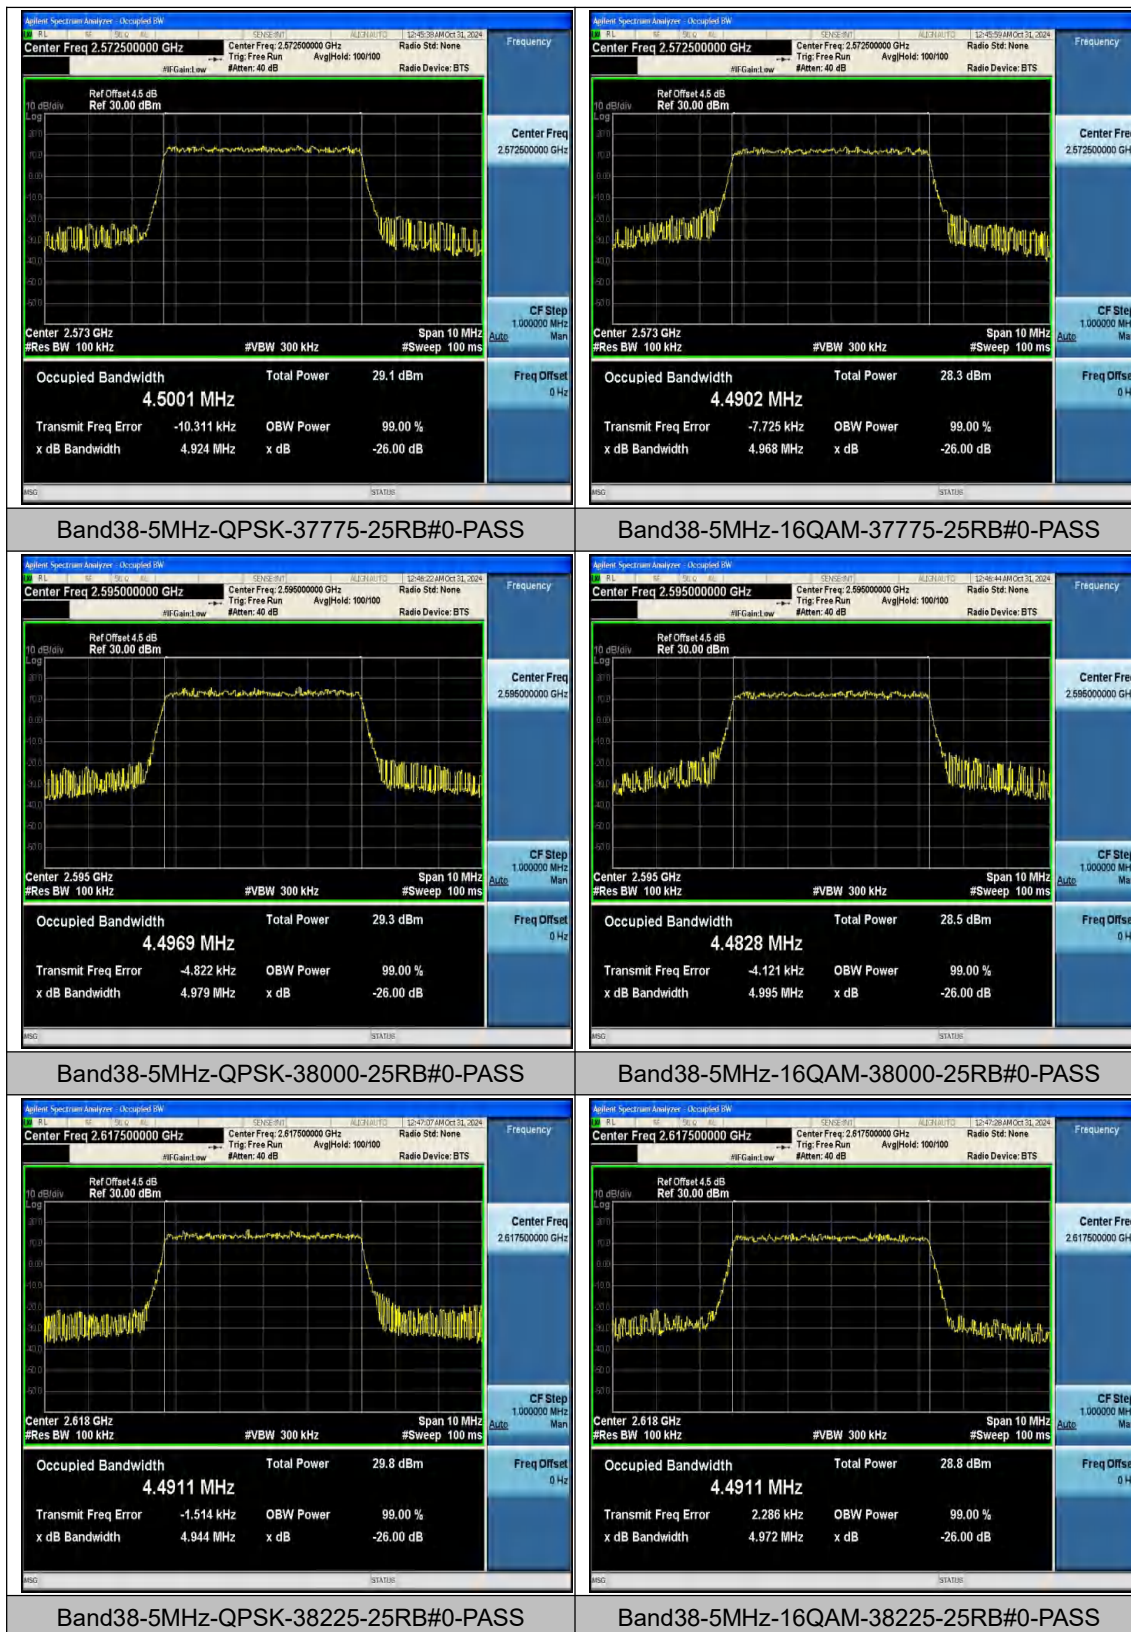

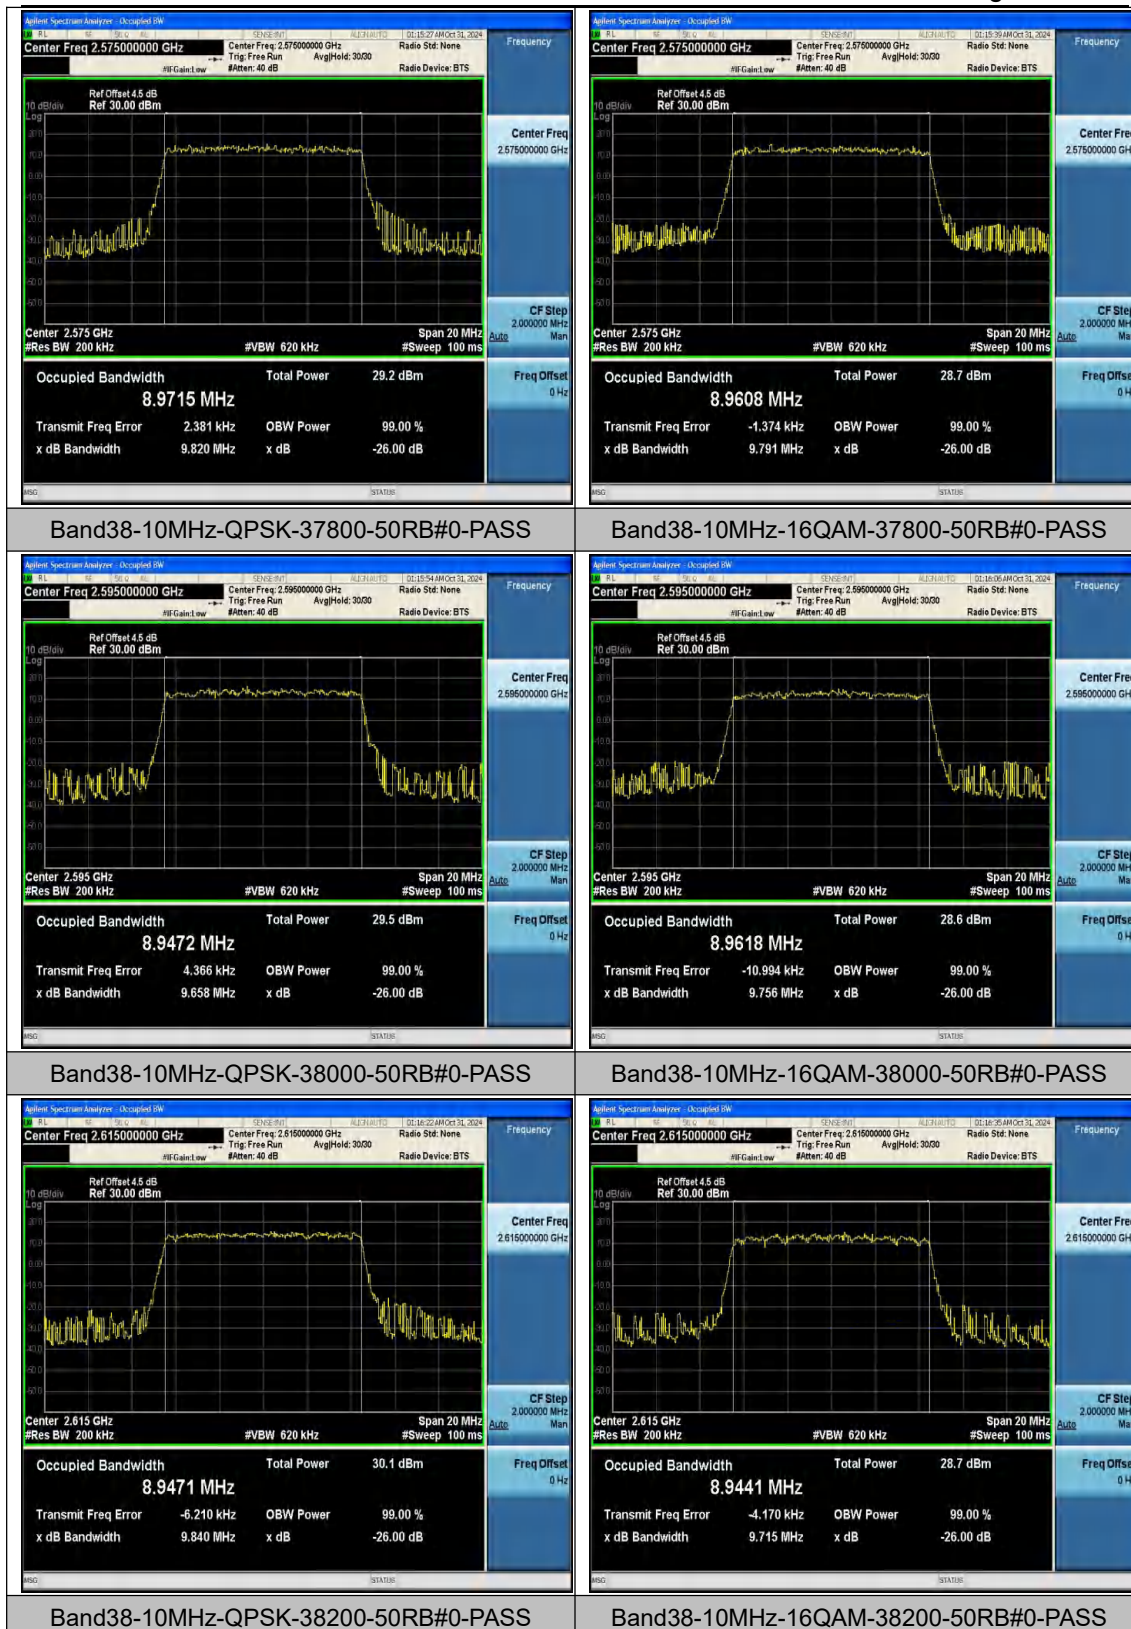

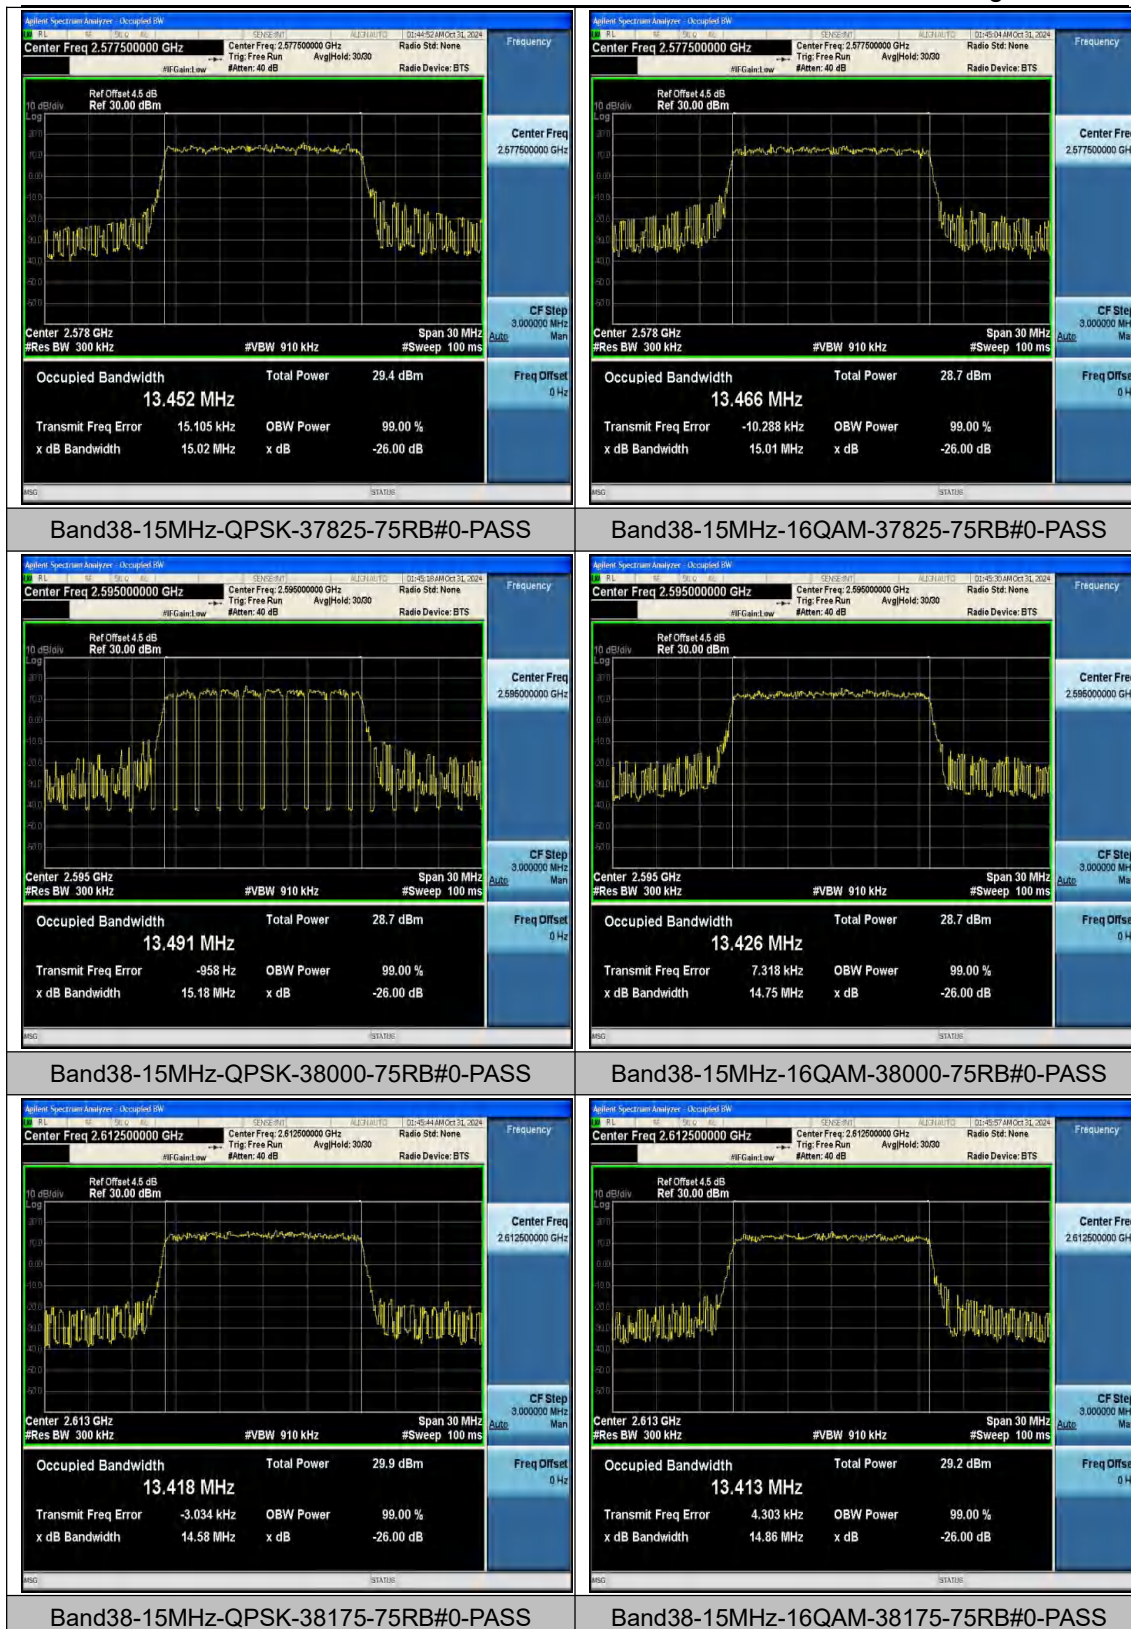

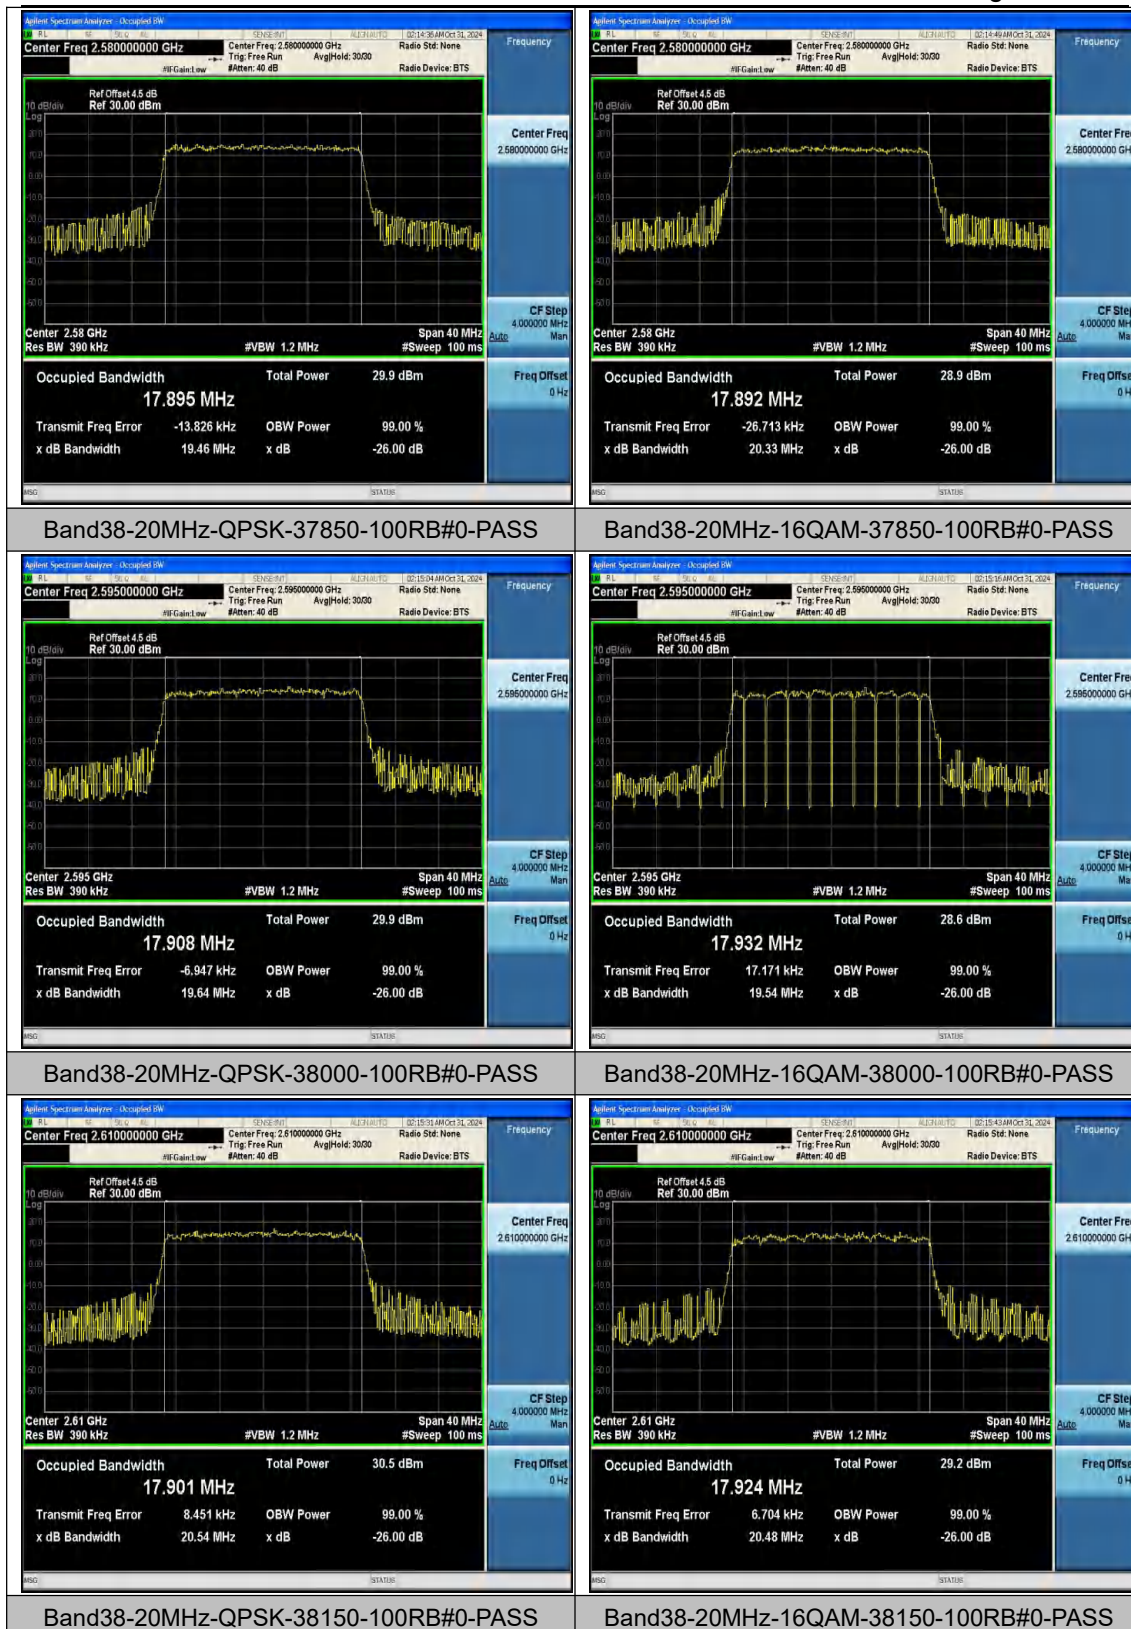

Appendix D: Band Edge


Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	-19.79	PASS
Band38	5MHz	16QAM	37775	1RB#0	-18.43	PASS
Band38	5MHz	QPSK	37775	1RB#24	-32.18	PASS
Band38	5MHz	16QAM	37775	1RB#24	-29.54	PASS
Band38	5MHz	QPSK	37775	25RB#0	-49.56	PASS
Band38	5MHz	16QAM	37775	25RB#0	-50.14	PASS
Band38	5MHz	QPSK	38225	1RB#0	-27.52	PASS
Band38	5MHz	16QAM	38225	1RB#0	-31.73	PASS
Band38	5MHz	QPSK	38225	1RB#24	-17.58	PASS
Band38	5MHz	16QAM	38225	1RB#24	-20.45	PASS
Band38	5MHz	QPSK	38225	25RB#0	-49.39	PASS
Band38	5MHz	16QAM	38225	25RB#0	-51.27	PASS
Band38	10MHz	QPSK	37800	1RB#0	-27.39	PASS
Band38	10MHz	16QAM	37800	1RB#0	-27.50	PASS
Band38	10MHz	QPSK	37800	1RB#49	-26.11	PASS
Band38	10MHz	16QAM	37800	1RB#49	-28.43	PASS
Band38	10MHz	QPSK	37800	50RB#0	-48.95	PASS
Band38	10MHz	16QAM	37800	50RB#0	-49.63	PASS
Band38	10MHz	QPSK	38200	1RB#0	-30.69	PASS
Band38	10MHz	16QAM	38200	1RB#0	-30.21	PASS
Band38	10MHz	QPSK	38200	1RB#49	-25.30	PASS
Band38	10MHz	16QAM	38200	1RB#49	-25.05	PASS
Band38	10MHz	QPSK	38200	50RB#0	-48.03	PASS
Band38	10MHz	16QAM	38200	50RB#0	-48.45	PASS
Band38	15MHz	QPSK	37825	1RB#0	-24.10	PASS
Band38	15MHz	16QAM	37825	1RB#0	-24.85	PASS
Band38	15MHz	QPSK	37825	1RB#74	-27.84	PASS
Band38	15MHz	16QAM	37825	1RB#74	-30.09	PASS
Band38	15MHz	QPSK	37825	75RB#0	-47.19	PASS
Band38	15MHz	16QAM	37825	75RB#0	-47.66	PASS
Band38	15MHz	QPSK	38175	1RB#0	-28.26	PASS
Band38	15MHz	16QAM	38175	1RB#0	-29.54	PASS
Band38	15MHz	QPSK	38175	1RB#74	-24.11	PASS
Band38	15MHz	16QAM	38175	1RB#74	-26.78	PASS
Band38	15MHz	QPSK	38175	75RB#0	-45.38	PASS
Band38	15MHz	16QAM	38175	75RB#0	-45.84	PASS
Band38	20MHz	QPSK	37850	1RB#0	-25.33	PASS



Band38	20MHz	16QAM	37850	1RB#0	-28.80	PASS
Band38	20MHz	QPSK	37850	1RB#99	-26.30	PASS
Band38	20MHz	16QAM	37850	1RB#99	-27.20	PASS
Band38	20MHz	QPSK	37850	100RB#0	-47.80	PASS
Band38	20MHz	16QAM	37850	100RB#0	-47.82	PASS
Band38	20MHz	QPSK	38150	1RB#0	-22.87	PASS
Band38	20MHz	16QAM	38150	1RB#0	-23.78	PASS
Band38	20MHz	QPSK	38150	1RB#99	-26.95	PASS
Band38	20MHz	16QAM	38150	1RB#99	-29.12	PASS
Band38	20MHz	QPSK	38150	100RB#0	-46.19	PASS
Band38	20MHz	16QAM	38150	100RB#0	-45.93	PASS

Test Graphs

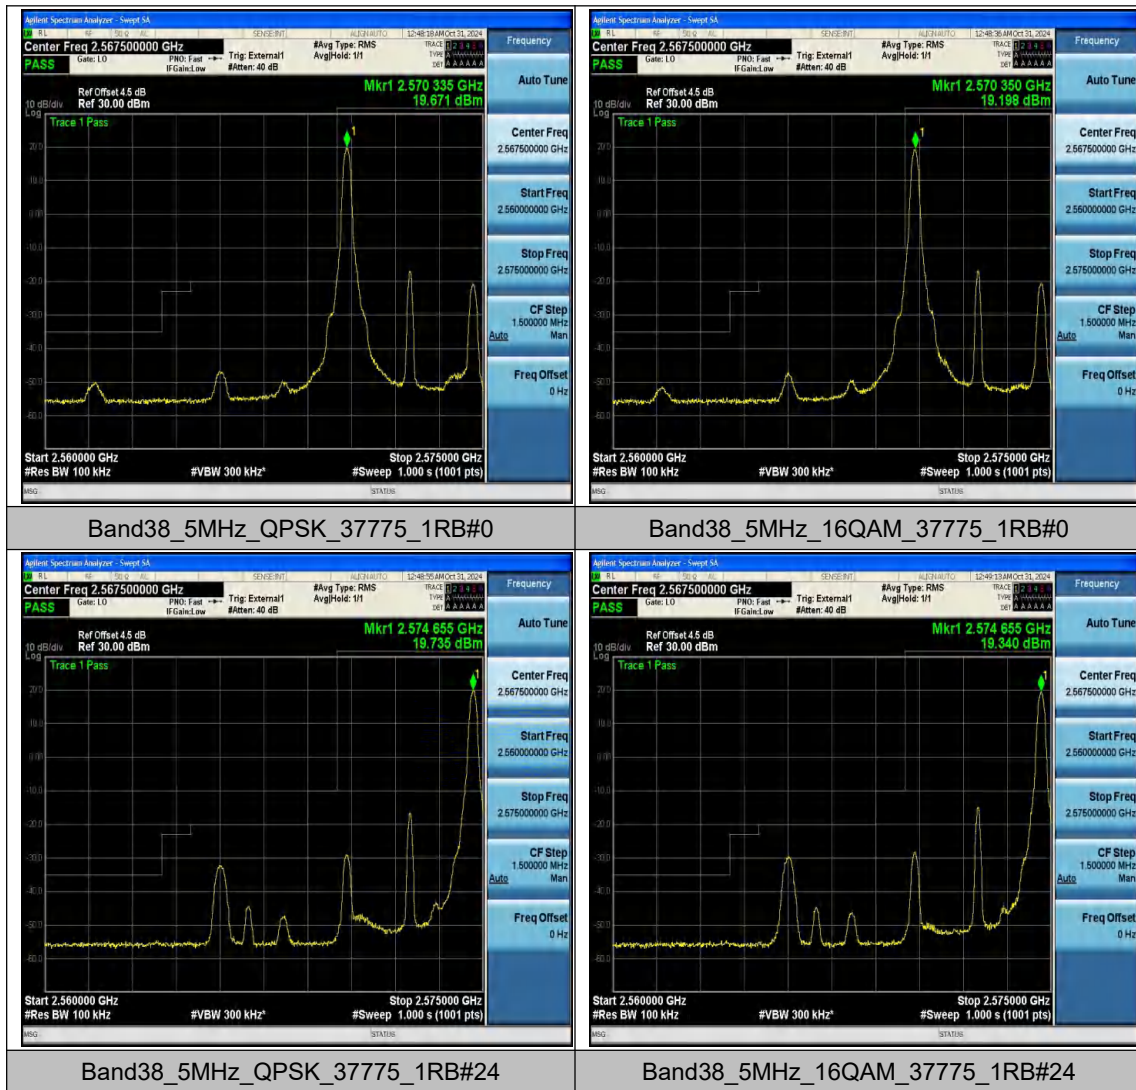

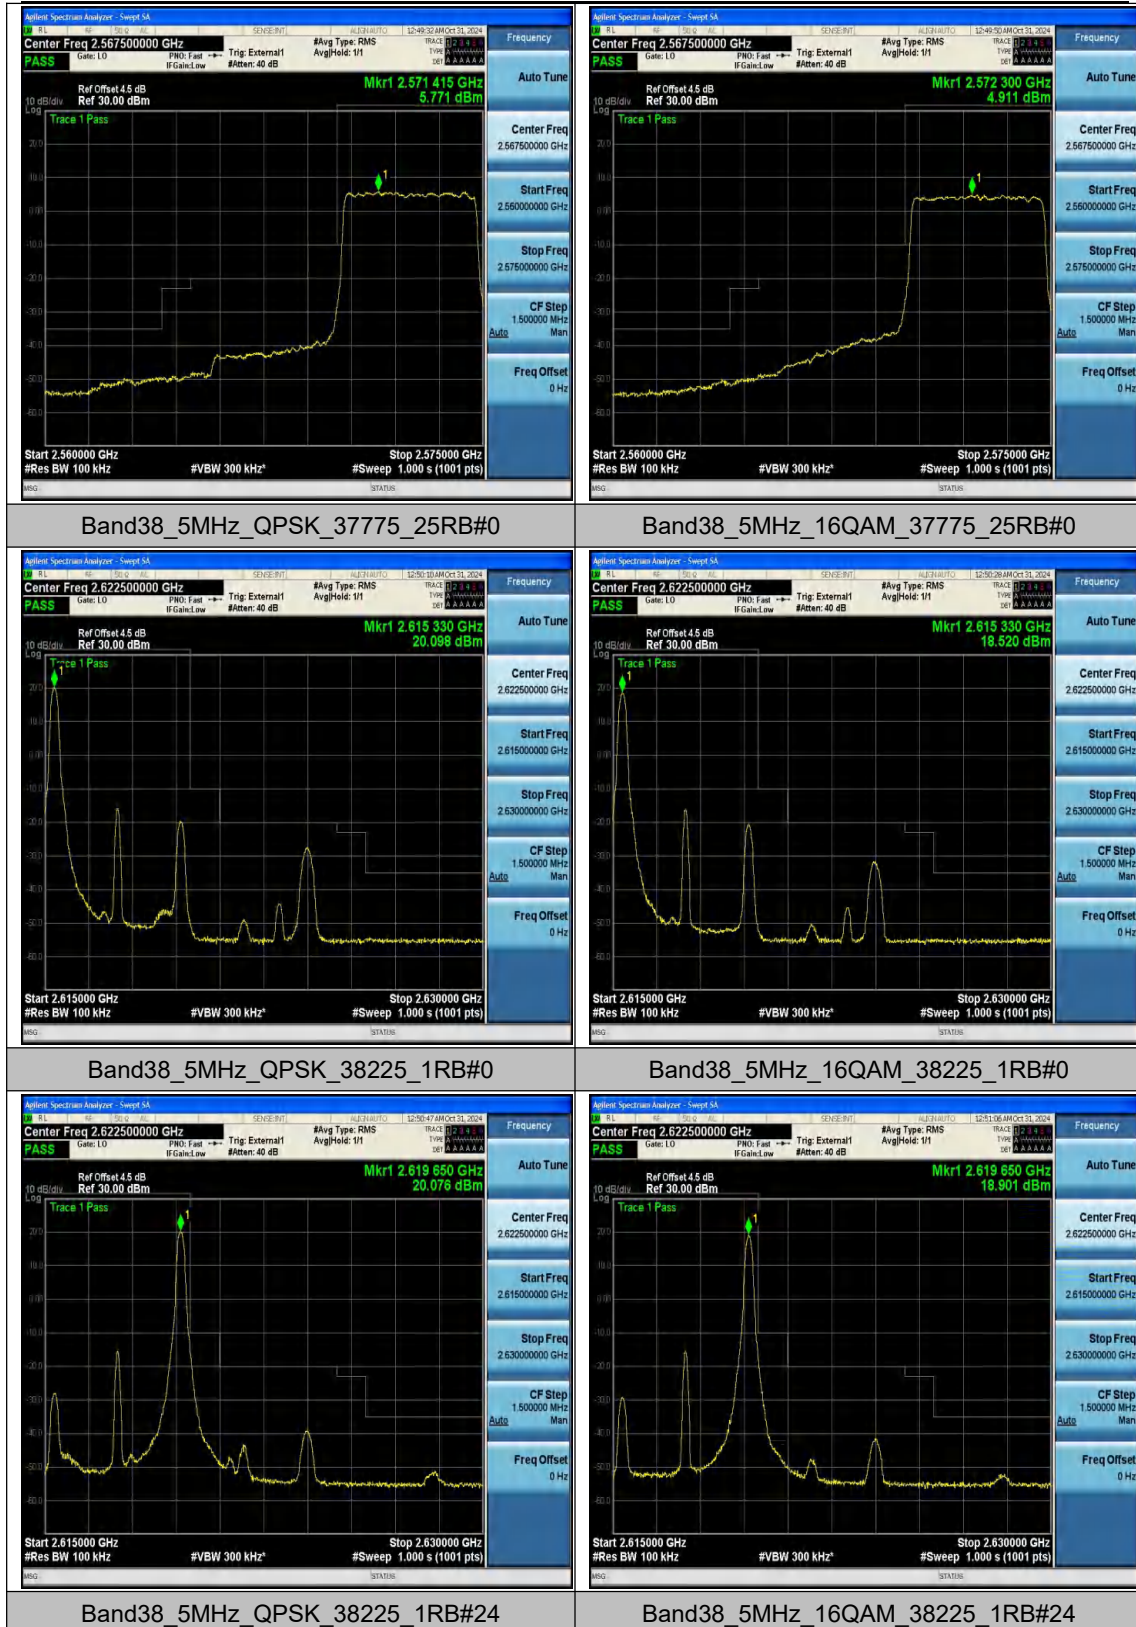

Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



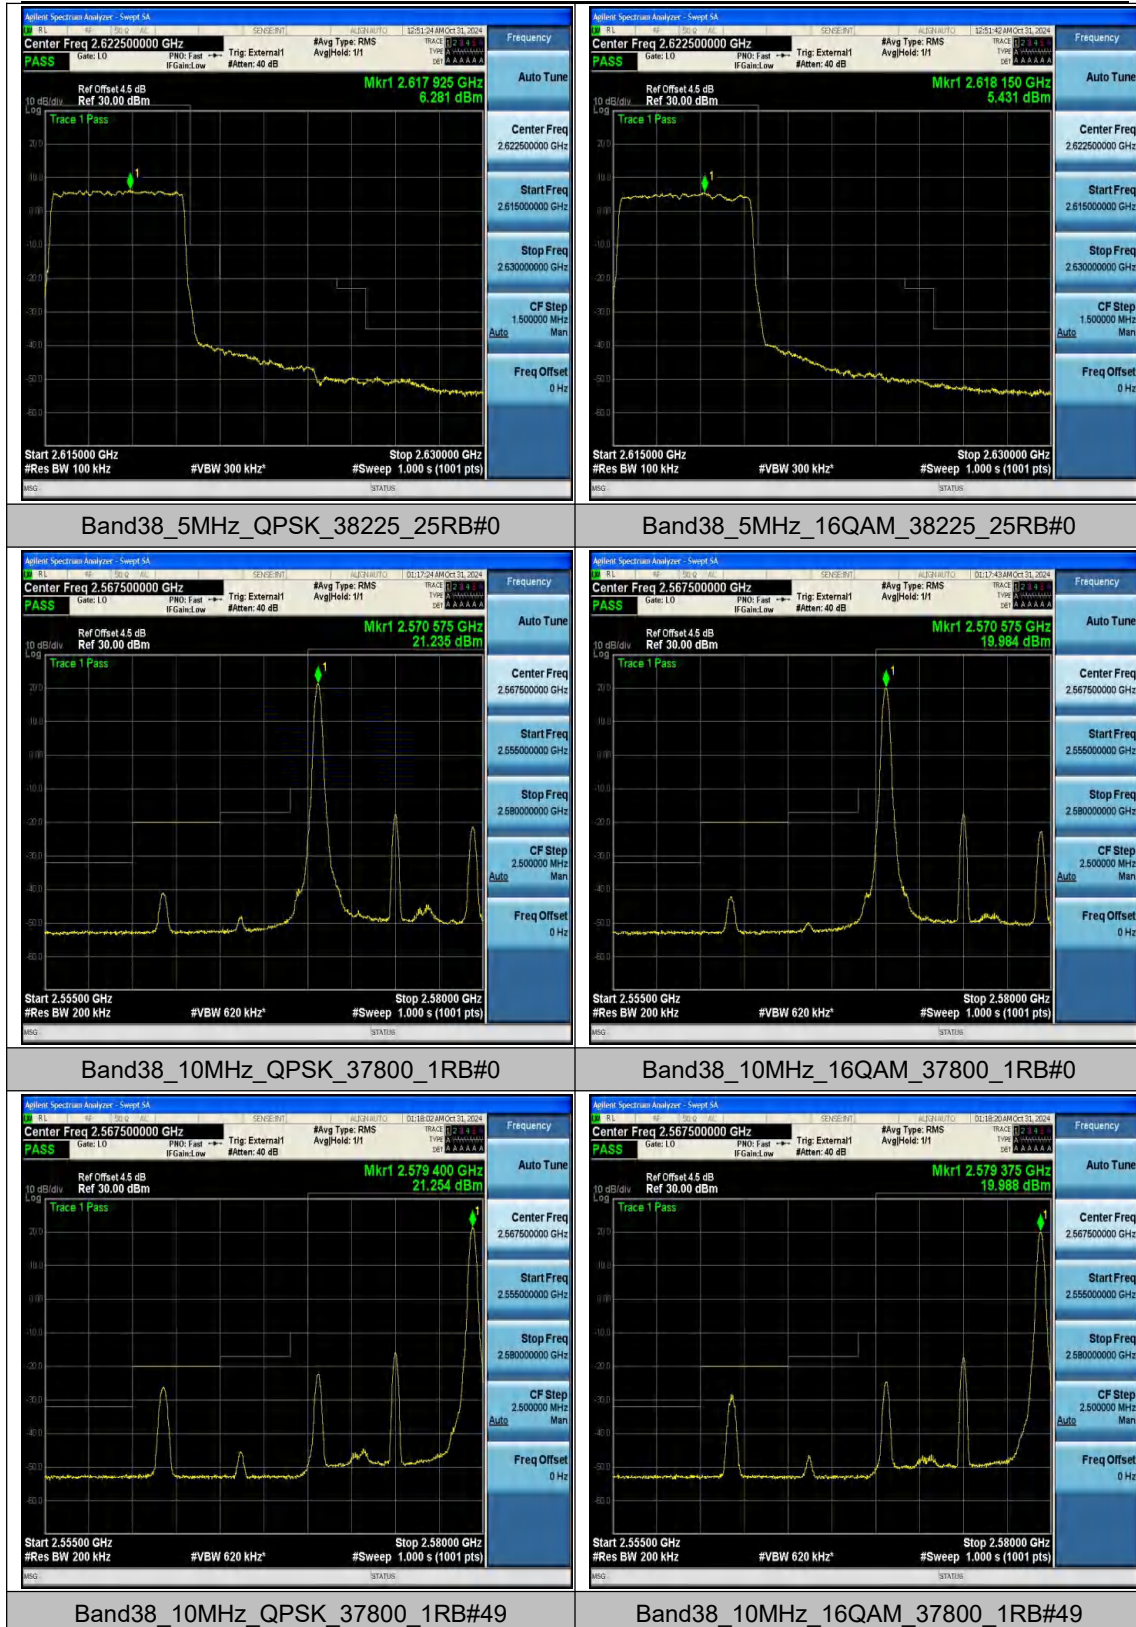


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



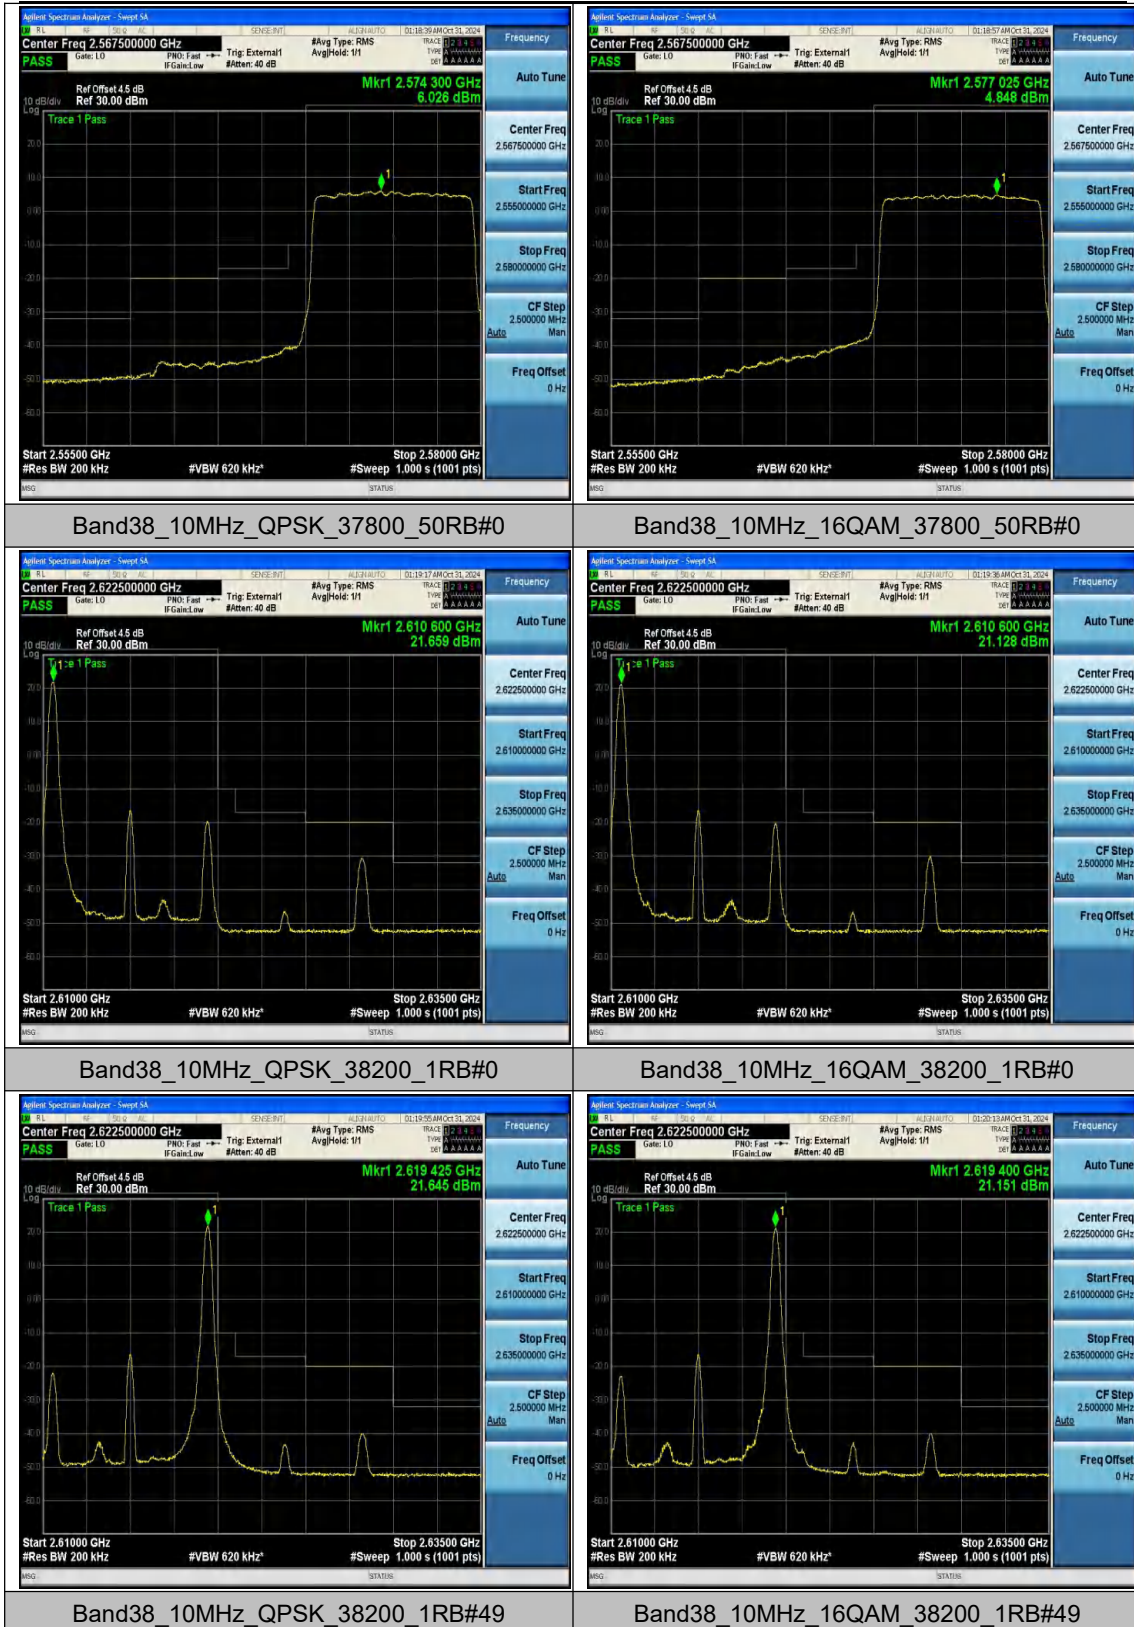


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



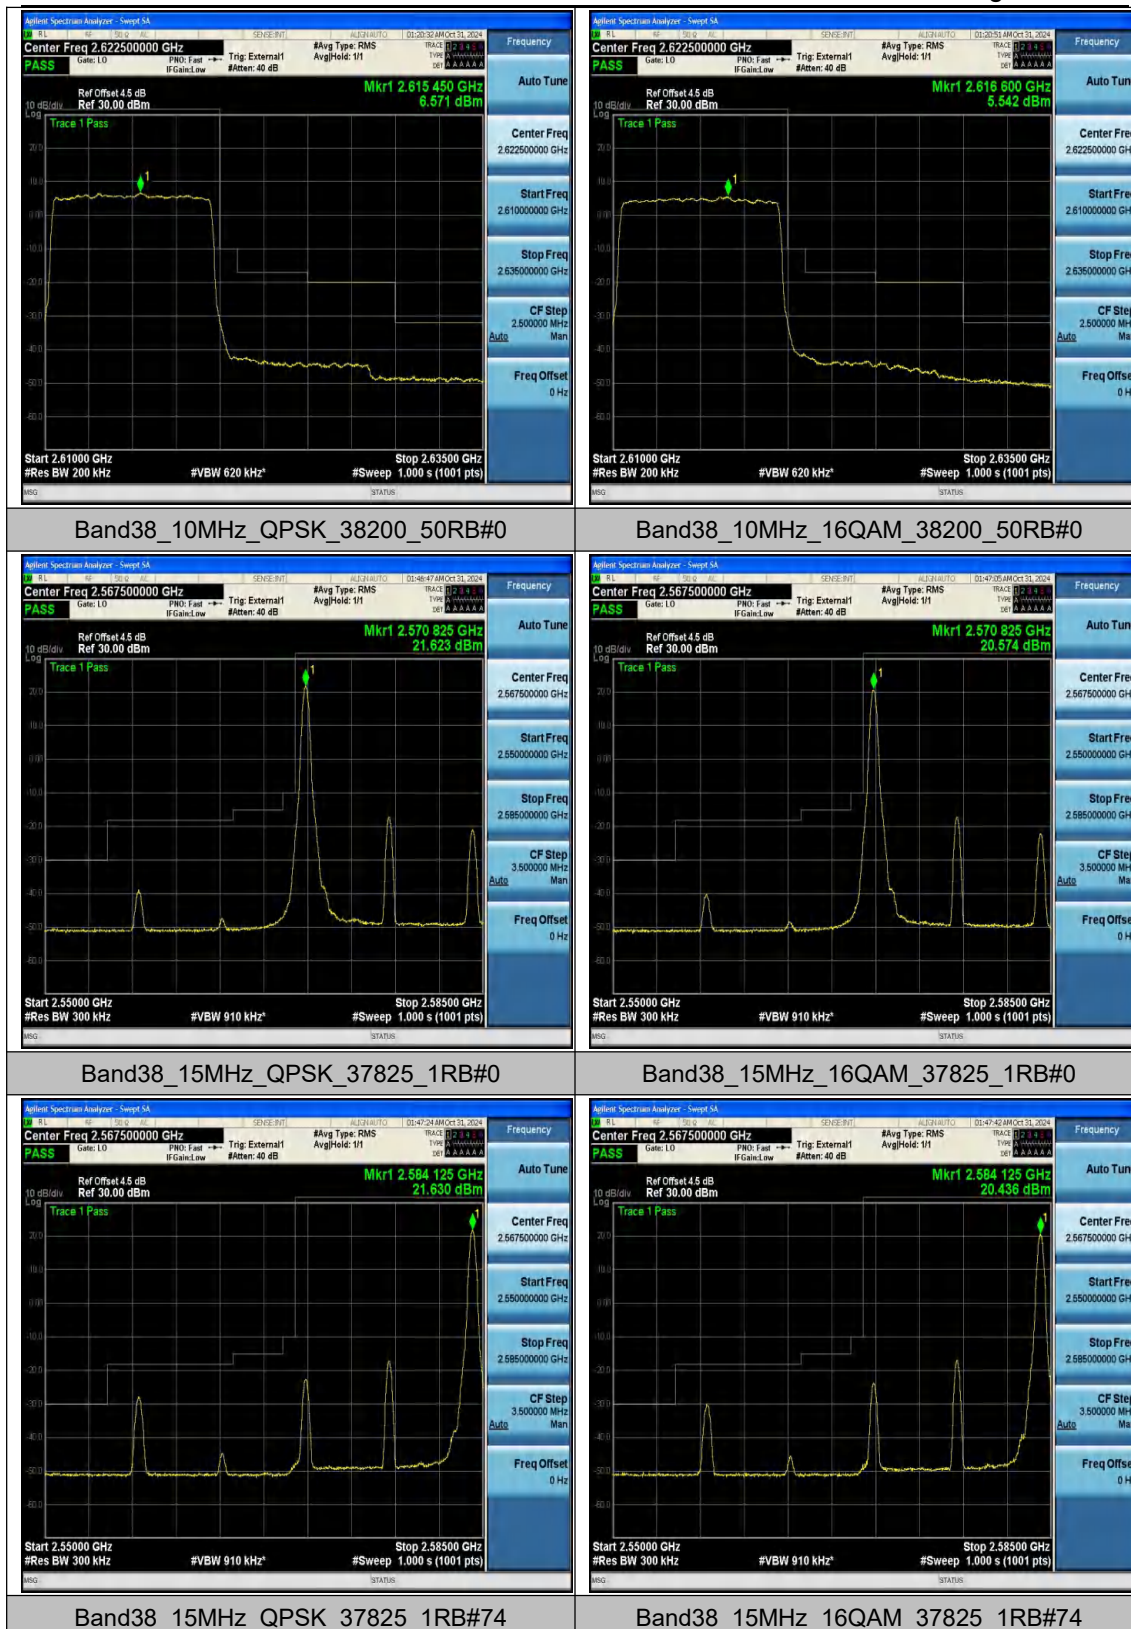

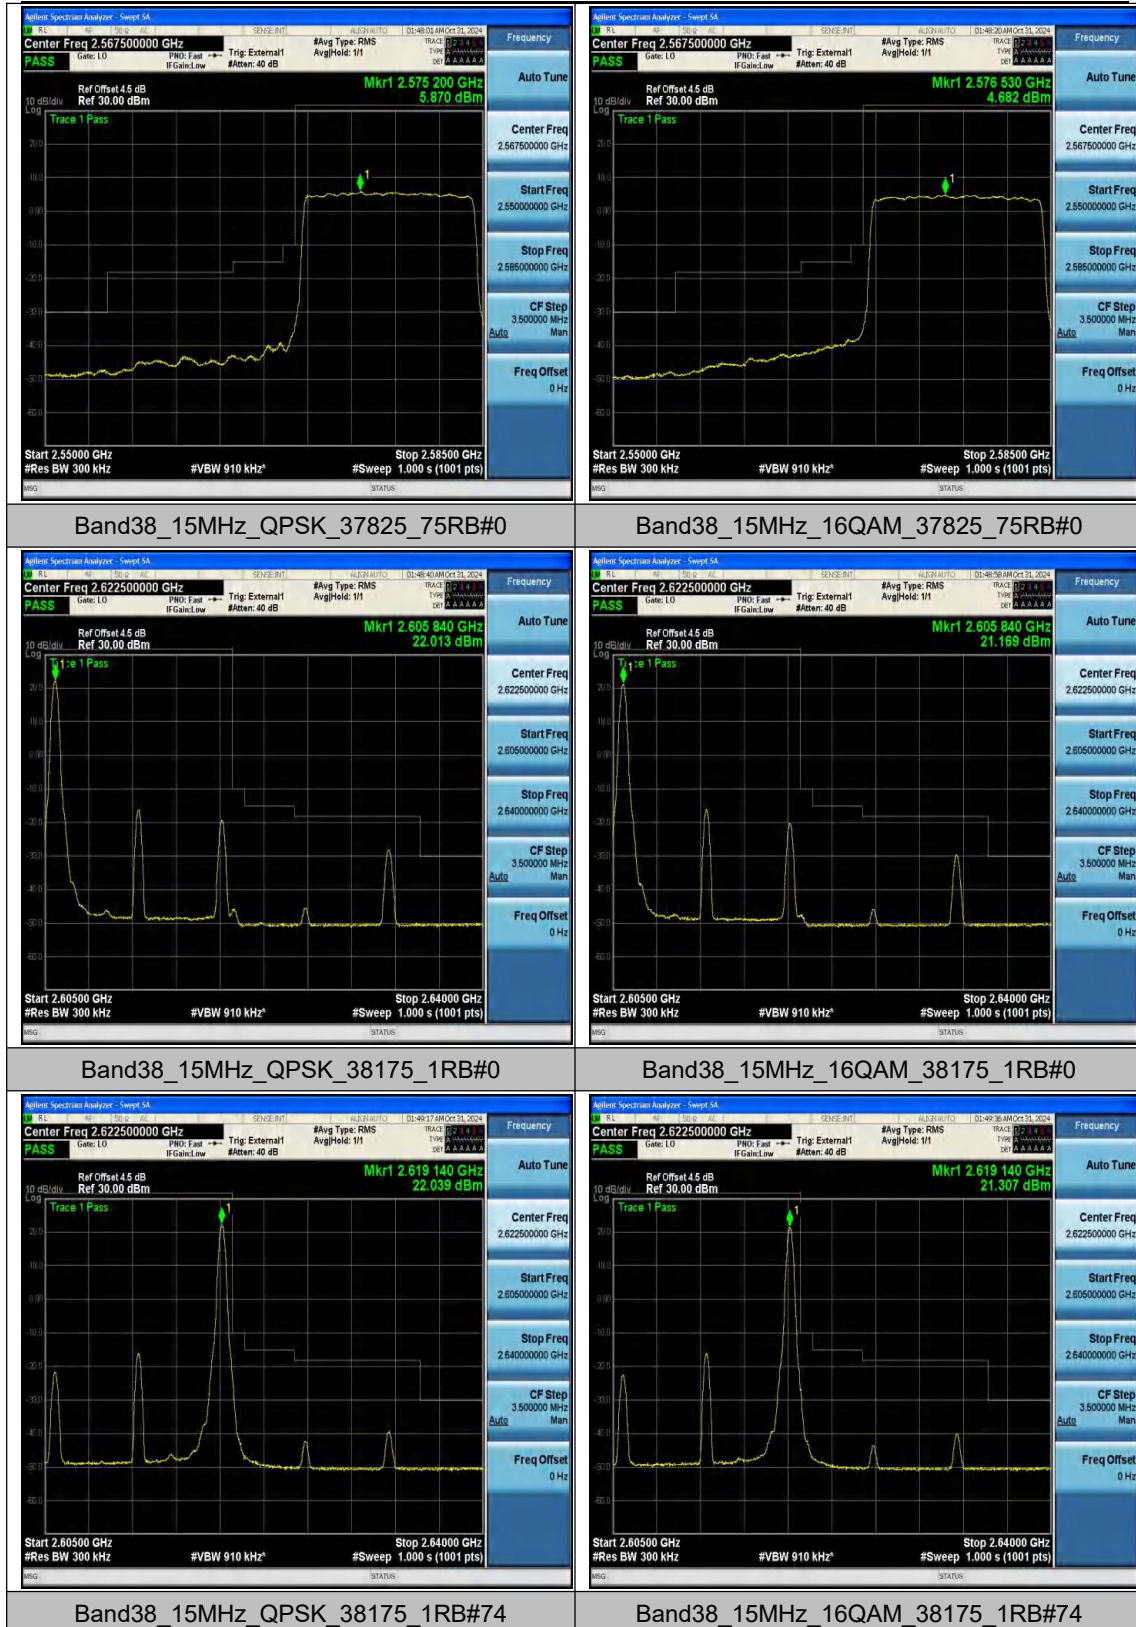

Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline
400-003-0500

www.anbotek.com



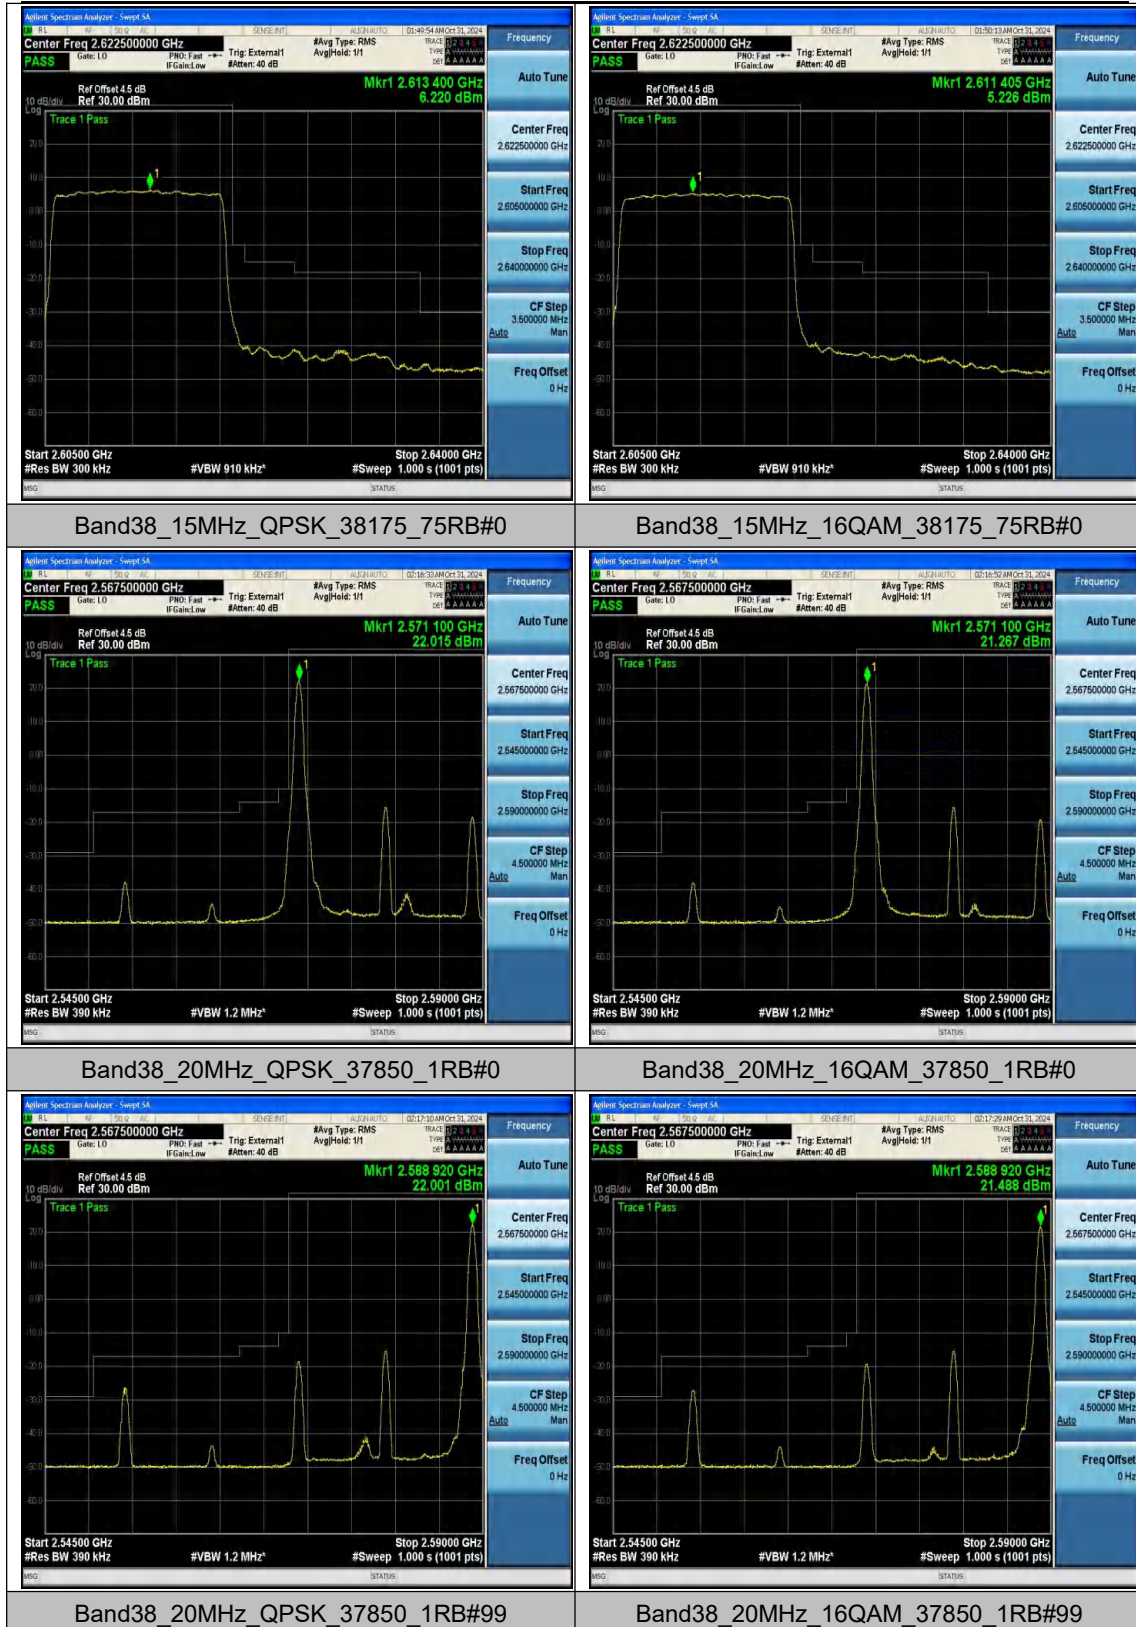

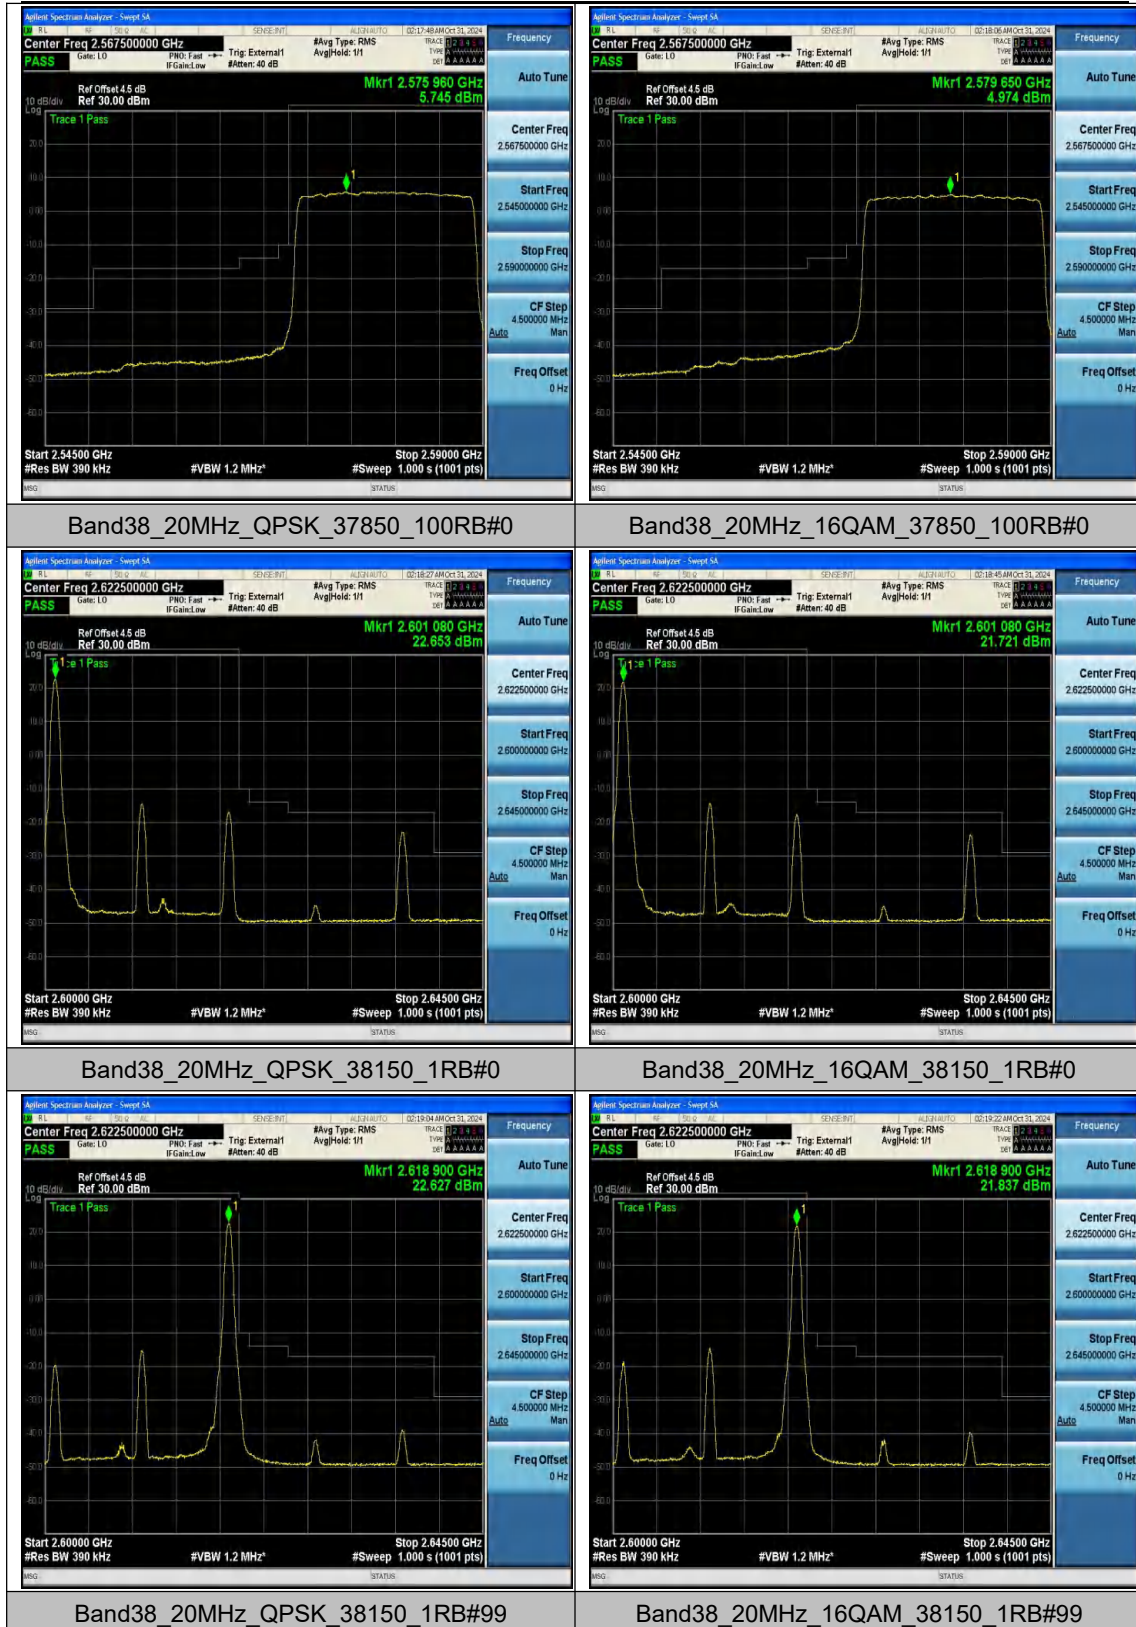

Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



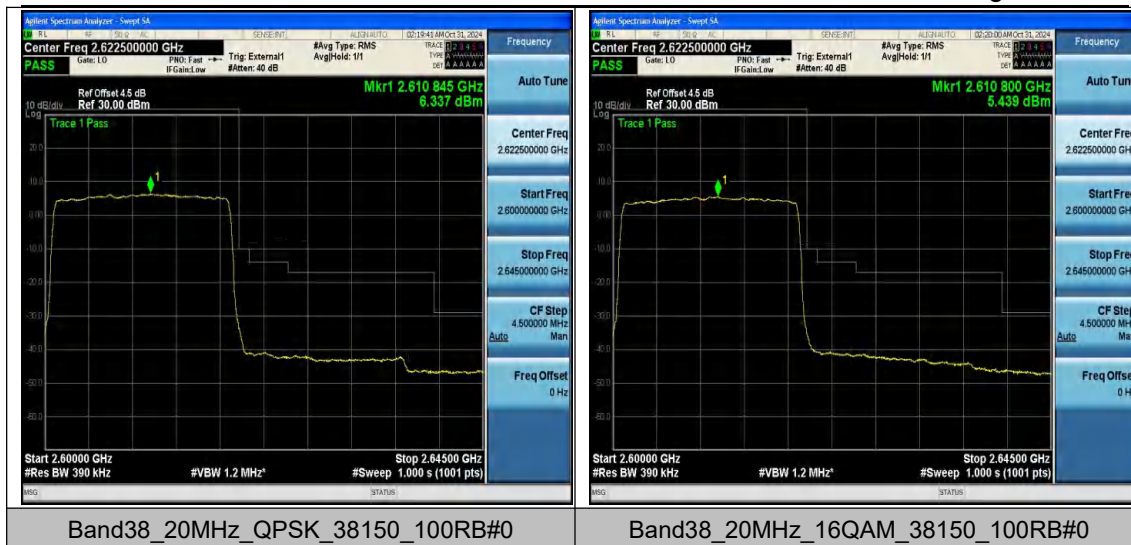

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
y.anbotek.com



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	0.009~0.15	-61.94	PASS
Band38	5MHz	QPSK	37775	1RB#0	0.15~30	-59.88	PASS
Band38	5MHz	QPSK	37775	1RB#0	30~1000	-66.31	PASS
Band38	5MHz	QPSK	37775	1RB#0	20000~27000	-41.54	PASS
Band38	5MHz	16QAM	37775	1RB#0	0.009~0.15	-64.86	PASS
Band38	5MHz	16QAM	37775	1RB#0	0.15~30	-60.23	PASS
Band38	5MHz	16QAM	37775	1RB#0	30~1000	-66.28	PASS
Band38	5MHz	16QAM	37775	1RB#0	20000~27000	-41.69	PASS
Band38	5MHz	QPSK	38000	1RB#0	0.009~0.15	-63.80	PASS
Band38	5MHz	QPSK	38000	1RB#0	0.15~30	-63.16	PASS
Band38	5MHz	QPSK	38000	1RB#0	30~1000	-62.61	PASS
Band38	5MHz	QPSK	38000	1RB#0	20000~27000	-41.55	PASS
Band38	5MHz	16QAM	38000	1RB#0	0.009~0.15	-60.10	PASS
Band38	5MHz	16QAM	38000	1RB#0	0.15~30	-65.29	PASS
Band38	5MHz	16QAM	38000	1RB#0	30~1000	-62.82	PASS
Band38	5MHz	16QAM	38000	1RB#0	20000~27000	-41.57	PASS
Band38	5MHz	QPSK	38225	1RB#0	0.009~0.15	-64.06	PASS
Band38	5MHz	QPSK	38225	1RB#0	0.15~30	-64.33	PASS
Band38	5MHz	QPSK	38225	1RB#0	30~1000	-61.98	PASS
Band38	5MHz	QPSK	38225	1RB#0	20000~27000	-41.75	PASS
Band38	5MHz	16QAM	38225	1RB#0	0.009~0.15	-62.94	PASS
Band38	5MHz	16QAM	38225	1RB#0	0.15~30	-64.17	PASS
Band38	5MHz	16QAM	38225	1RB#0	30~1000	-64.31	PASS
Band38	5MHz	16QAM	38225	1RB#0	20000~27000	-41.68	PASS
Band38	10MHz	QPSK	37800	1RB#0	0.009~0.15	-63.92	PASS
Band38	10MHz	QPSK	37800	1RB#0	0.15~30	-57.83	PASS
Band38	10MHz	QPSK	37800	1RB#0	30~1000	-66.32	PASS
Band38	10MHz	QPSK	37800	1RB#0	20000~27000	-41.41	PASS
Band38	10MHz	16QAM	37800	1RB#0	0.009~0.15	-63.92	PASS
Band38	10MHz	16QAM	37800	1RB#0	0.15~30	-58.93	PASS
Band38	10MHz	16QAM	37800	1RB#0	30~1000	-66.44	PASS
Band38	10MHz	16QAM	37800	1RB#0	20000~27000	-41.71	PASS
Band38	10MHz	QPSK	38000	1RB#0	0.009~0.15	-63.93	PASS
Band38	10MHz	QPSK	38000	1RB#0	0.15~30	-58.42	PASS
Band38	10MHz	QPSK	38000	1RB#0	30~1000	-66.28	PASS
Band38	10MHz	QPSK	38000	1RB#0	20000~27000	-41.62	PASS
Band38	10MHz	16QAM	38000	1RB#0	0.009~0.15	-63.75	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



Band38	10MHz	16QAM	38000	1RB#0	0.15~30	-60.73	PASS
Band38	10MHz	16QAM	38000	1RB#0	30~1000	-66.27	PASS
Band38	10MHz	16QAM	38000	1RB#0	20000~27000	-41.64	PASS
Band38	10MHz	QPSK	38200	1RB#0	0.009~0.15	-62.94	PASS
Band38	10MHz	QPSK	38200	1RB#0	0.15~30	-61.85	PASS
Band38	10MHz	QPSK	38200	1RB#0	30~1000	-62.40	PASS
Band38	10MHz	QPSK	38200	1RB#0	20000~27000	-41.58	PASS
Band38	10MHz	16QAM	38200	1RB#0	0.009~0.15	-61.78	PASS
Band38	10MHz	16QAM	38200	1RB#0	0.15~30	-63.63	PASS
Band38	10MHz	16QAM	38200	1RB#0	30~1000	-63.83	PASS
Band38	10MHz	16QAM	38200	1RB#0	20000~27000	-41.68	PASS
Band38	15MHz	QPSK	37825	1RB#0	0.009~0.15	-63.08	PASS
Band38	15MHz	QPSK	37825	1RB#0	0.15~30	-58.52	PASS
Band38	15MHz	QPSK	37825	1RB#0	30~1000	-66.27	PASS
Band38	15MHz	QPSK	37825	1RB#0	20000~27000	-41.63	PASS
Band38	15MHz	16QAM	37825	1RB#0	0.009~0.15	-62.96	PASS
Band38	15MHz	16QAM	37825	1RB#0	0.15~30	-60.61	PASS
Band38	15MHz	16QAM	37825	1RB#0	30~1000	-66.40	PASS
Band38	15MHz	16QAM	37825	1RB#0	20000~27000	-41.64	PASS
Band38	15MHz	QPSK	38000	1RB#0	0.009~0.15	-63.66	PASS
Band38	15MHz	QPSK	38000	1RB#0	0.15~30	-57.14	PASS
Band38	15MHz	QPSK	38000	1RB#0	30~1000	-66.47	PASS
Band38	15MHz	QPSK	38000	1RB#0	20000~27000	-41.72	PASS
Band38	15MHz	16QAM	38000	1RB#0	0.009~0.15	-63.07	PASS
Band38	15MHz	16QAM	38000	1RB#0	0.15~30	-60.43	PASS
Band38	15MHz	16QAM	38000	1RB#0	30~1000	-66.14	PASS
Band38	15MHz	16QAM	38000	1RB#0	20000~27000	-41.28	PASS
Band38	15MHz	QPSK	38175	1RB#0	0.009~0.15	-62.82	PASS
Band38	15MHz	QPSK	38175	1RB#0	0.15~30	-66.23	PASS
Band38	15MHz	QPSK	38175	1RB#0	30~1000	-62.39	PASS
Band38	15MHz	QPSK	38175	1RB#0	20000~27000	-41.61	PASS
Band38	15MHz	16QAM	38175	1RB#0	0.009~0.15	-62.21	PASS
Band38	15MHz	16QAM	38175	1RB#0	0.15~30	-64.09	PASS
Band38	15MHz	16QAM	38175	1RB#0	30~1000	-63.29	PASS
Band38	15MHz	16QAM	38175	1RB#0	20000~27000	-41.61	PASS
Band38	20MHz	QPSK	37850	1RB#0	0.009~0.15	-64.98	PASS
Band38	20MHz	QPSK	37850	1RB#0	0.15~30	-58.71	PASS
Band38	20MHz	QPSK	37850	1RB#0	30~1000	-66.26	PASS
Band38	20MHz	QPSK	37850	1RB#0	20000~27000	-41.72	PASS
Band38	20MHz	16QAM	37850	1RB#0	0.009~0.15	-63.93	PASS
Band38	20MHz	16QAM	37850	1RB#0	0.15~30	-61.32	PASS
Band38	20MHz	16QAM	37850	1RB#0	30~1000	-66.48	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline
400-003-0500


www.anbotek.com





Band38	20MHz	16QAM	37850	1RB#0	20000~27000	-41.62	PASS
Band38	20MHz	QPSK	38000	1RB#0	0.009~0.15	-63.94	PASS
Band38	20MHz	QPSK	38000	1RB#0	0.15~30	-56.80	PASS
Band38	20MHz	QPSK	38000	1RB#0	30~1000	-66.04	PASS
Band38	20MHz	QPSK	38000	1RB#0	20000~27000	-41.76	PASS
Band38	20MHz	16QAM	38000	1RB#0	0.009~0.15	-63.06	PASS
Band38	20MHz	16QAM	38000	1RB#0	0.15~30	-58.44	PASS
Band38	20MHz	16QAM	38000	1RB#0	30~1000	-66.29	PASS
Band38	20MHz	16QAM	38000	1RB#0	20000~27000	-41.62	PASS
Band38	20MHz	QPSK	38150	1RB#0	0.009~0.15	-64.14	PASS
Band38	20MHz	QPSK	38150	1RB#0	0.15~30	-64.36	PASS
Band38	20MHz	QPSK	38150	1RB#0	30~1000	-62.52	PASS
Band38	20MHz	QPSK	38150	1RB#0	20000~27000	-41.57	PASS
Band38	20MHz	16QAM	38150	1RB#0	0.009~0.15	-62.32	PASS
Band38	20MHz	16QAM	38150	1RB#0	0.15~30	-65.58	PASS
Band38	20MHz	16QAM	38150	1RB#0	30~1000	-62.50	PASS
Band38	20MHz	16QAM	38150	1RB#0	20000~27000	-41.39	PASS


Test Graphs

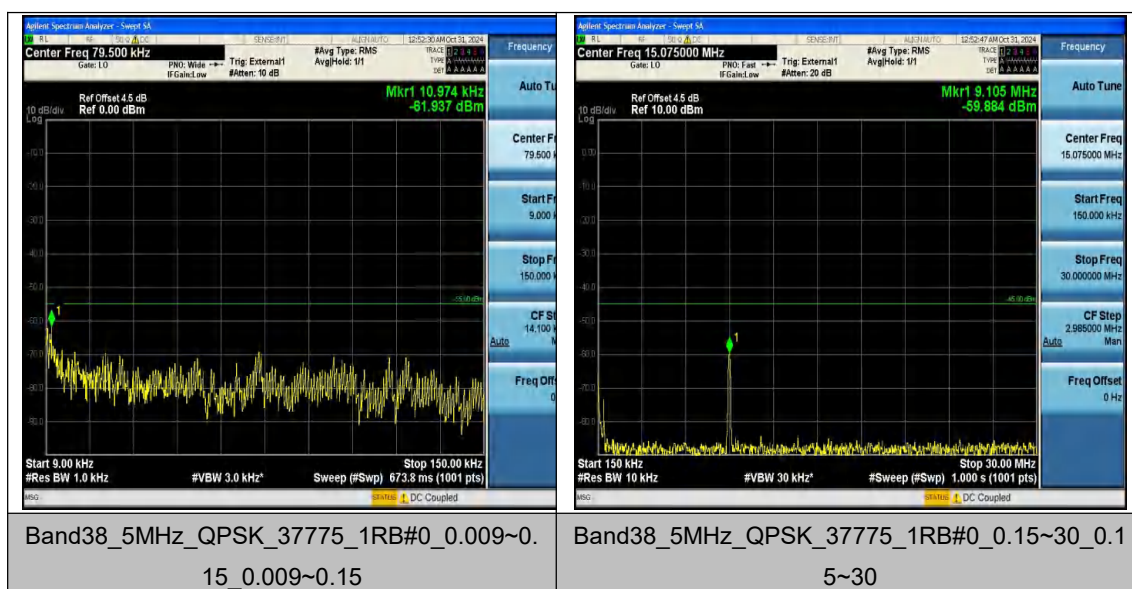


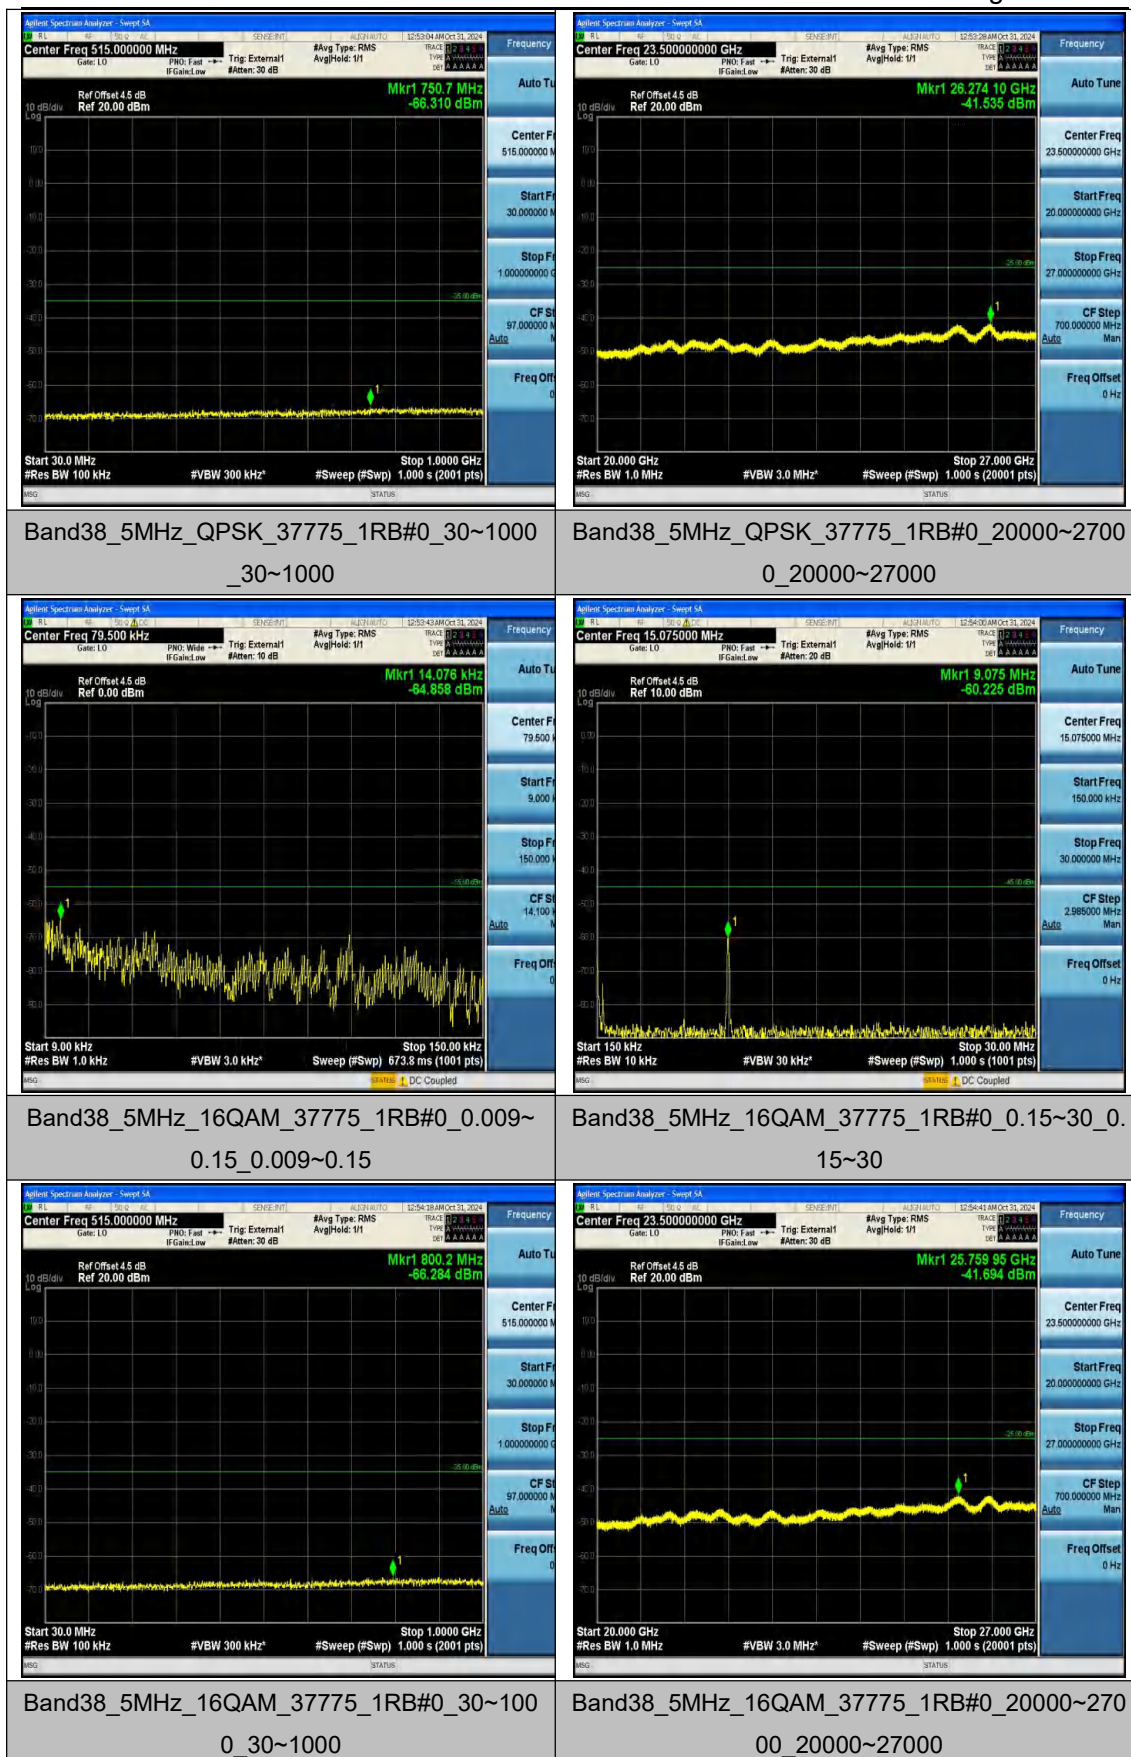


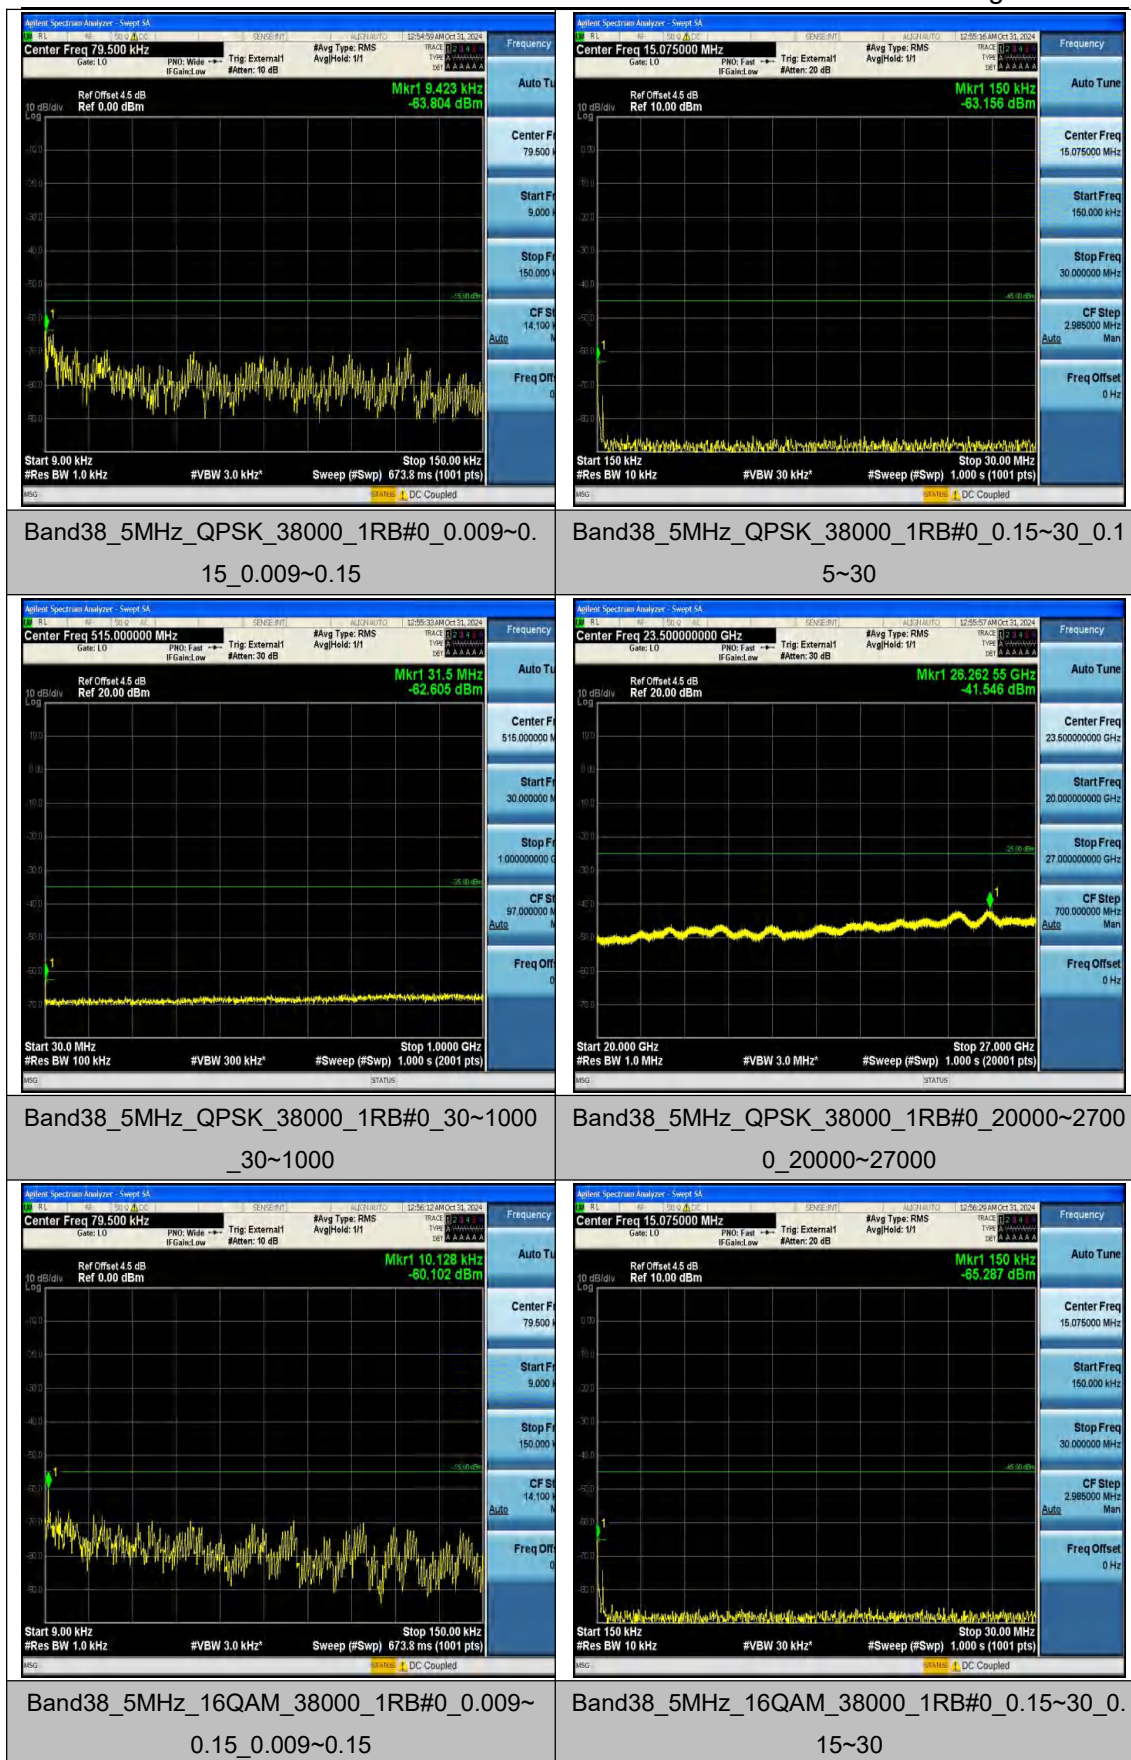


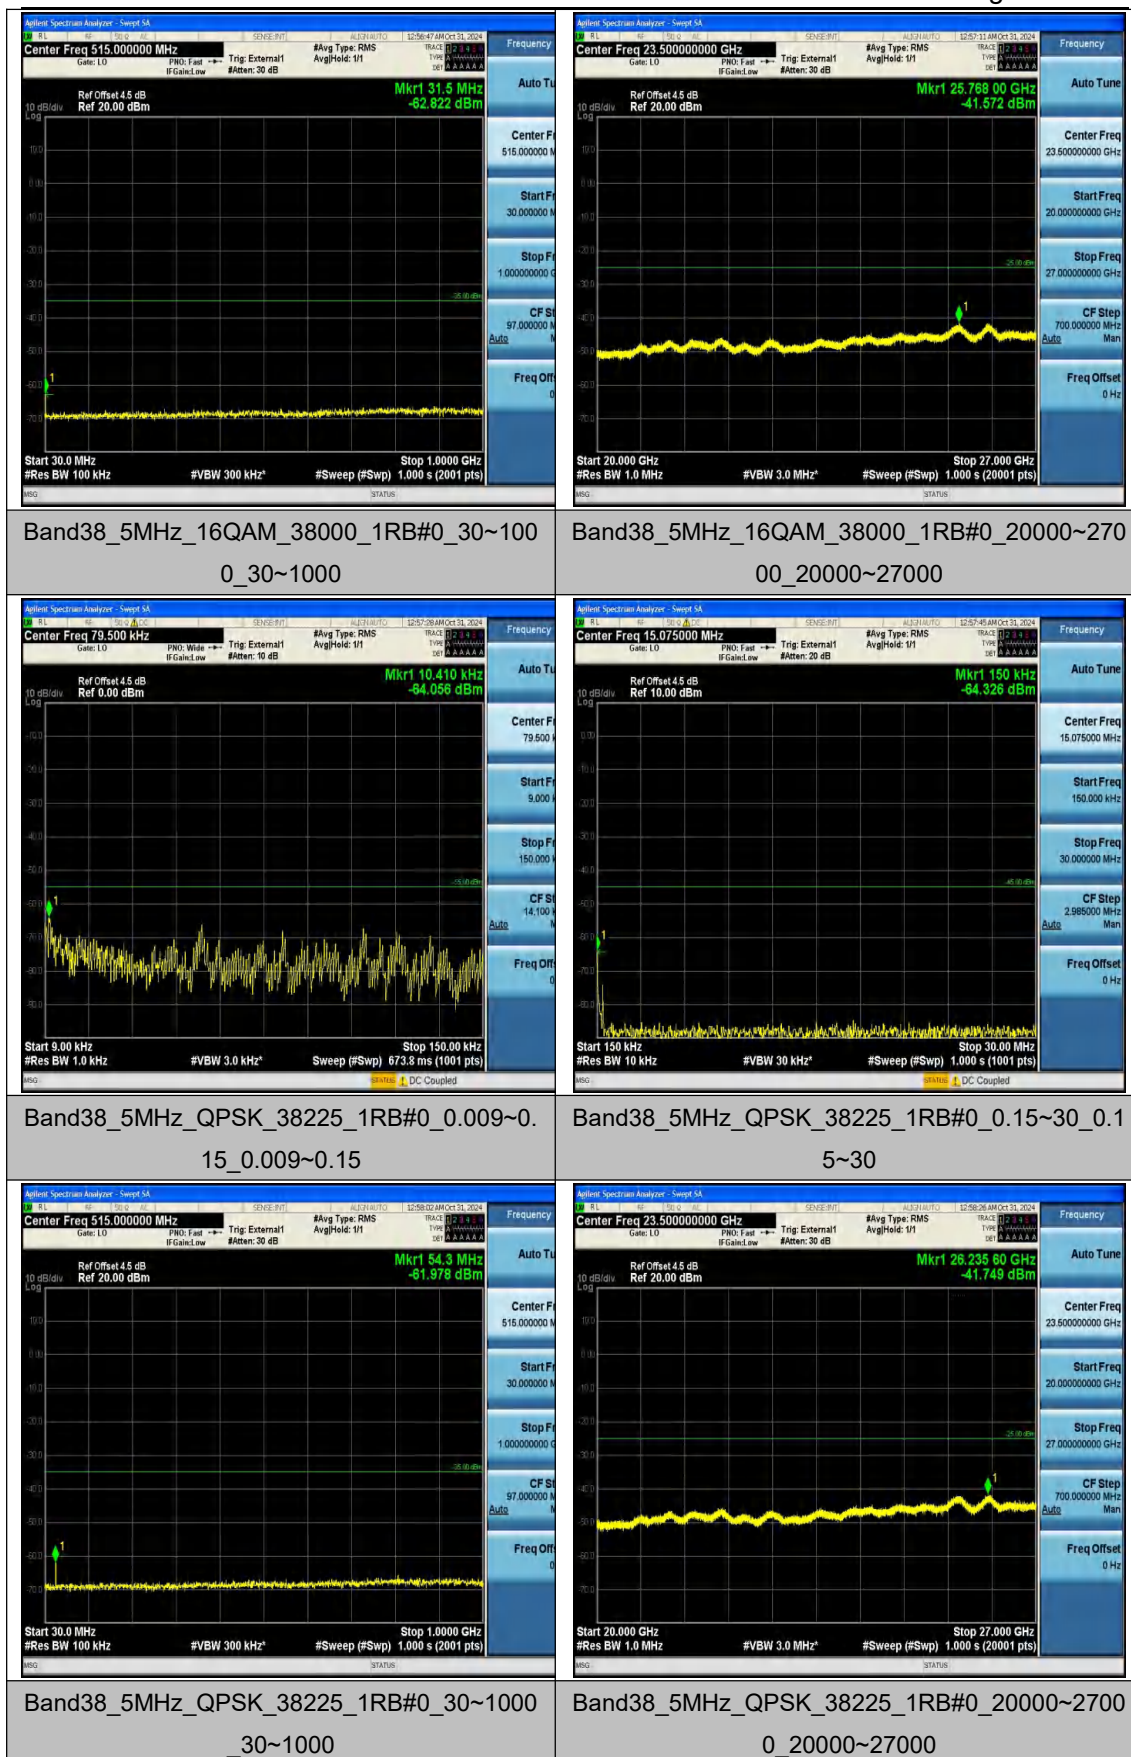


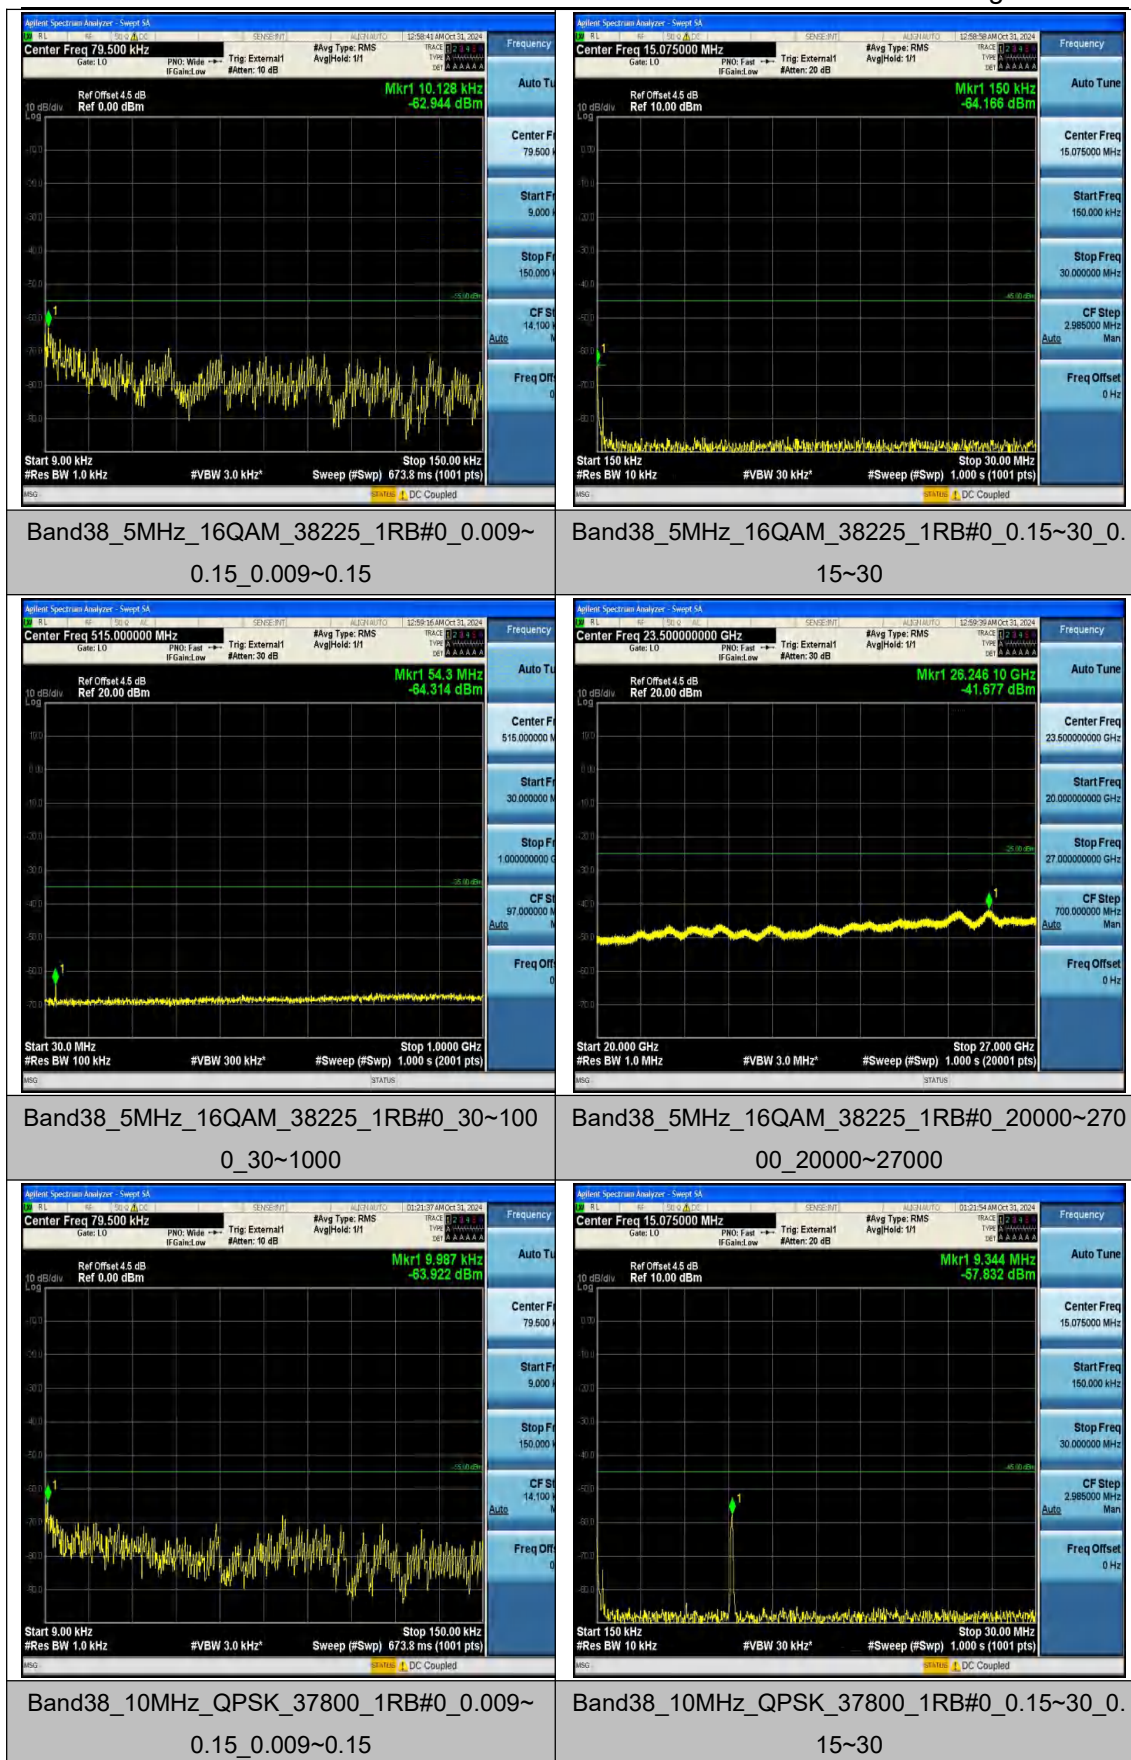


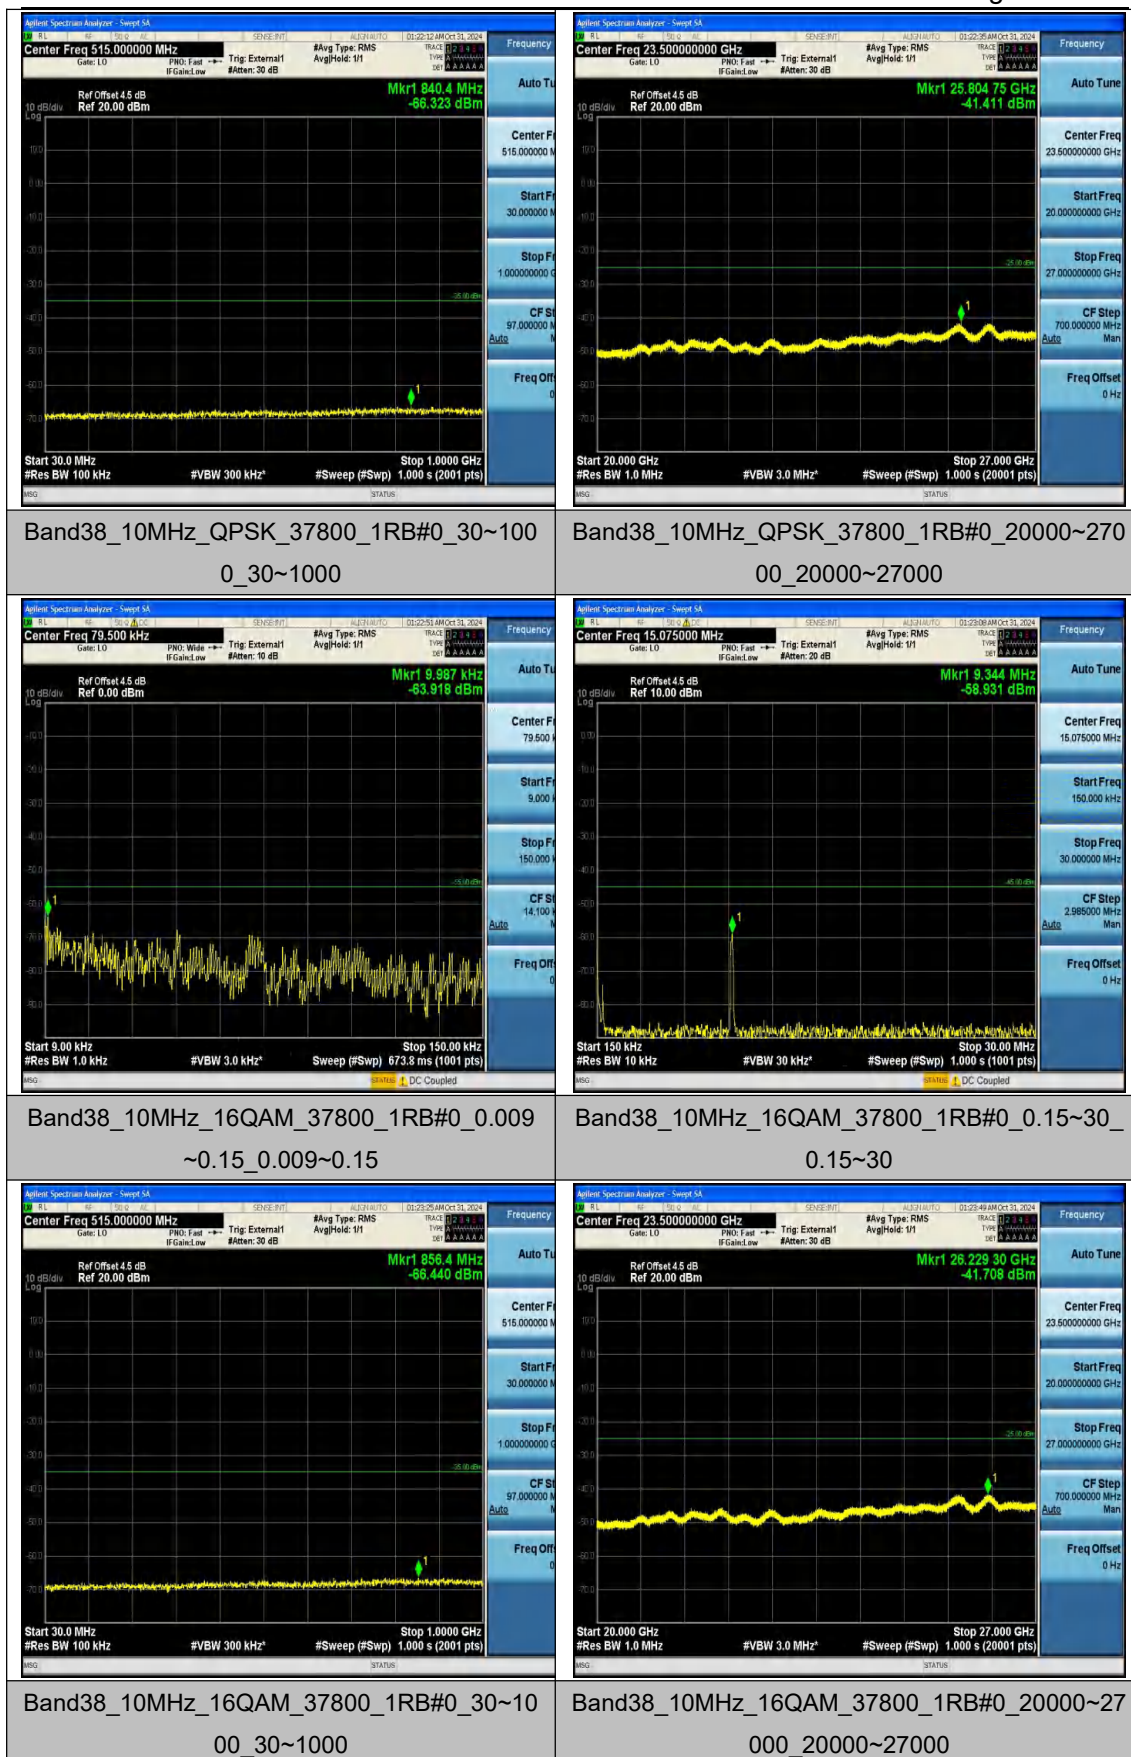


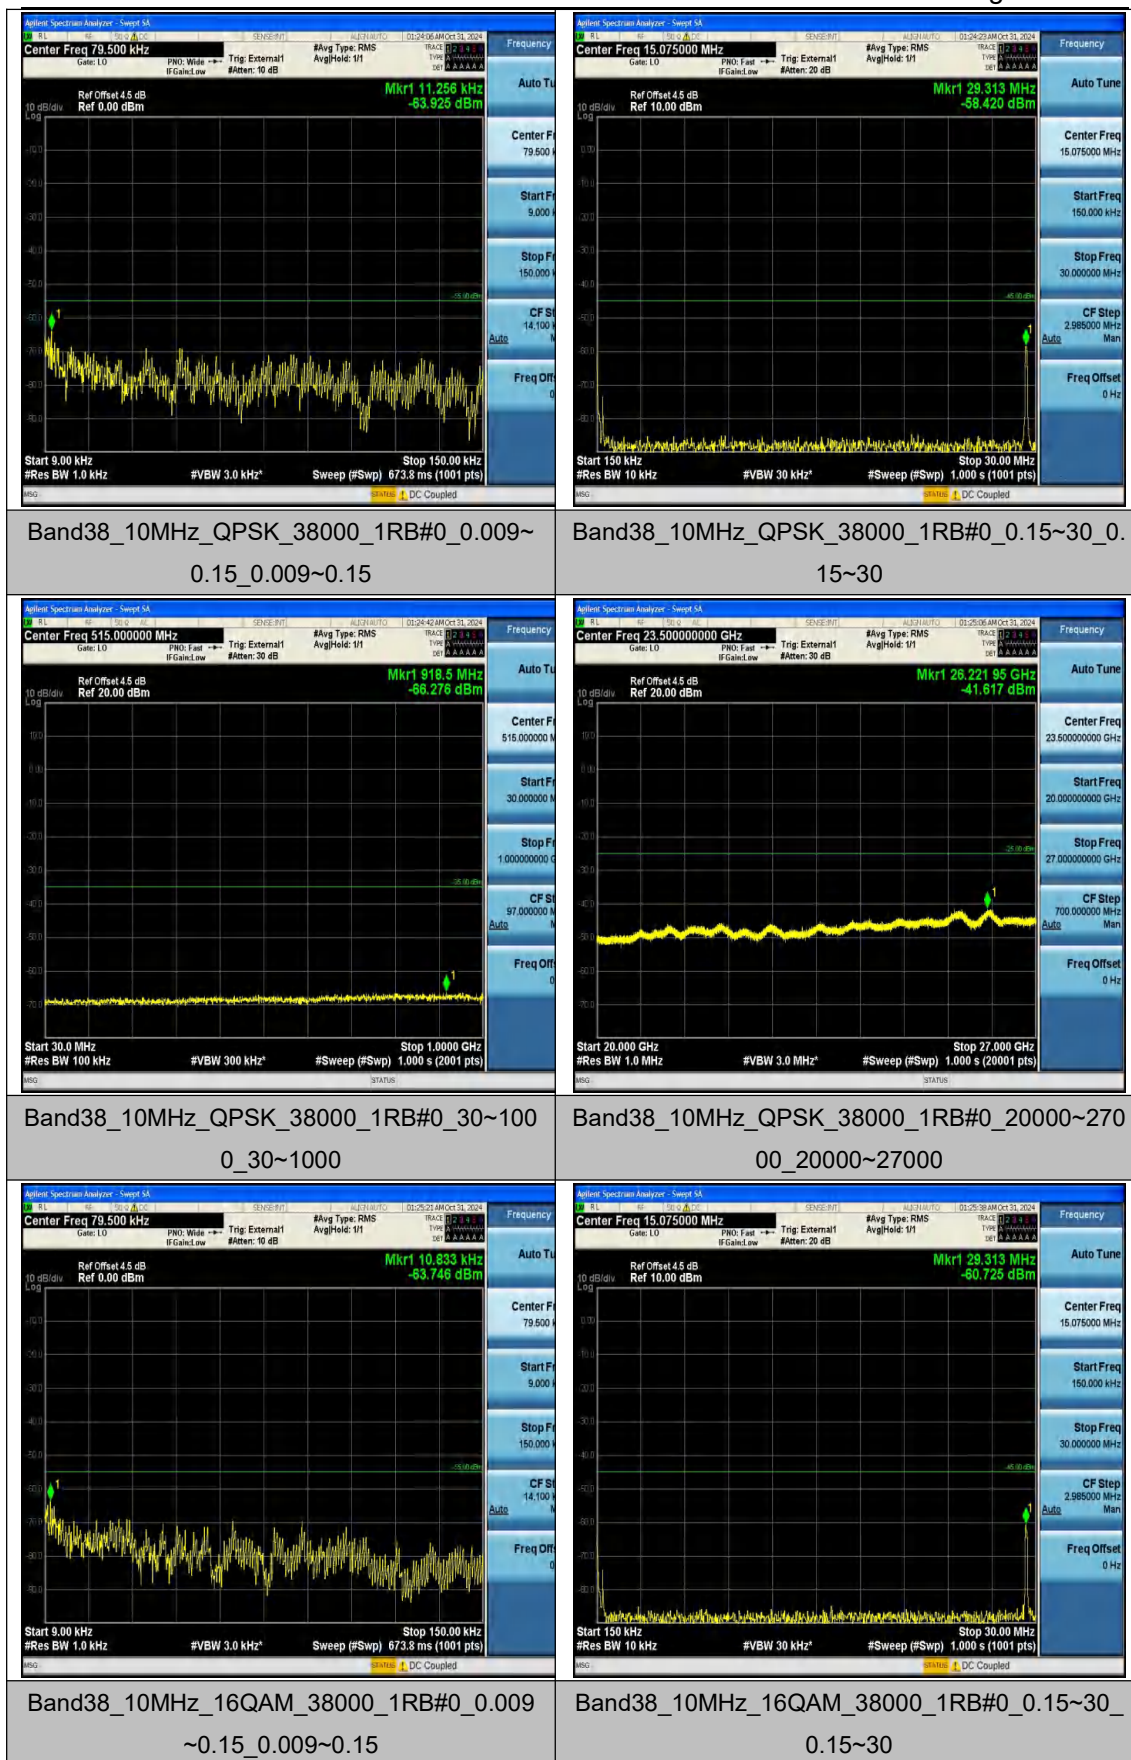

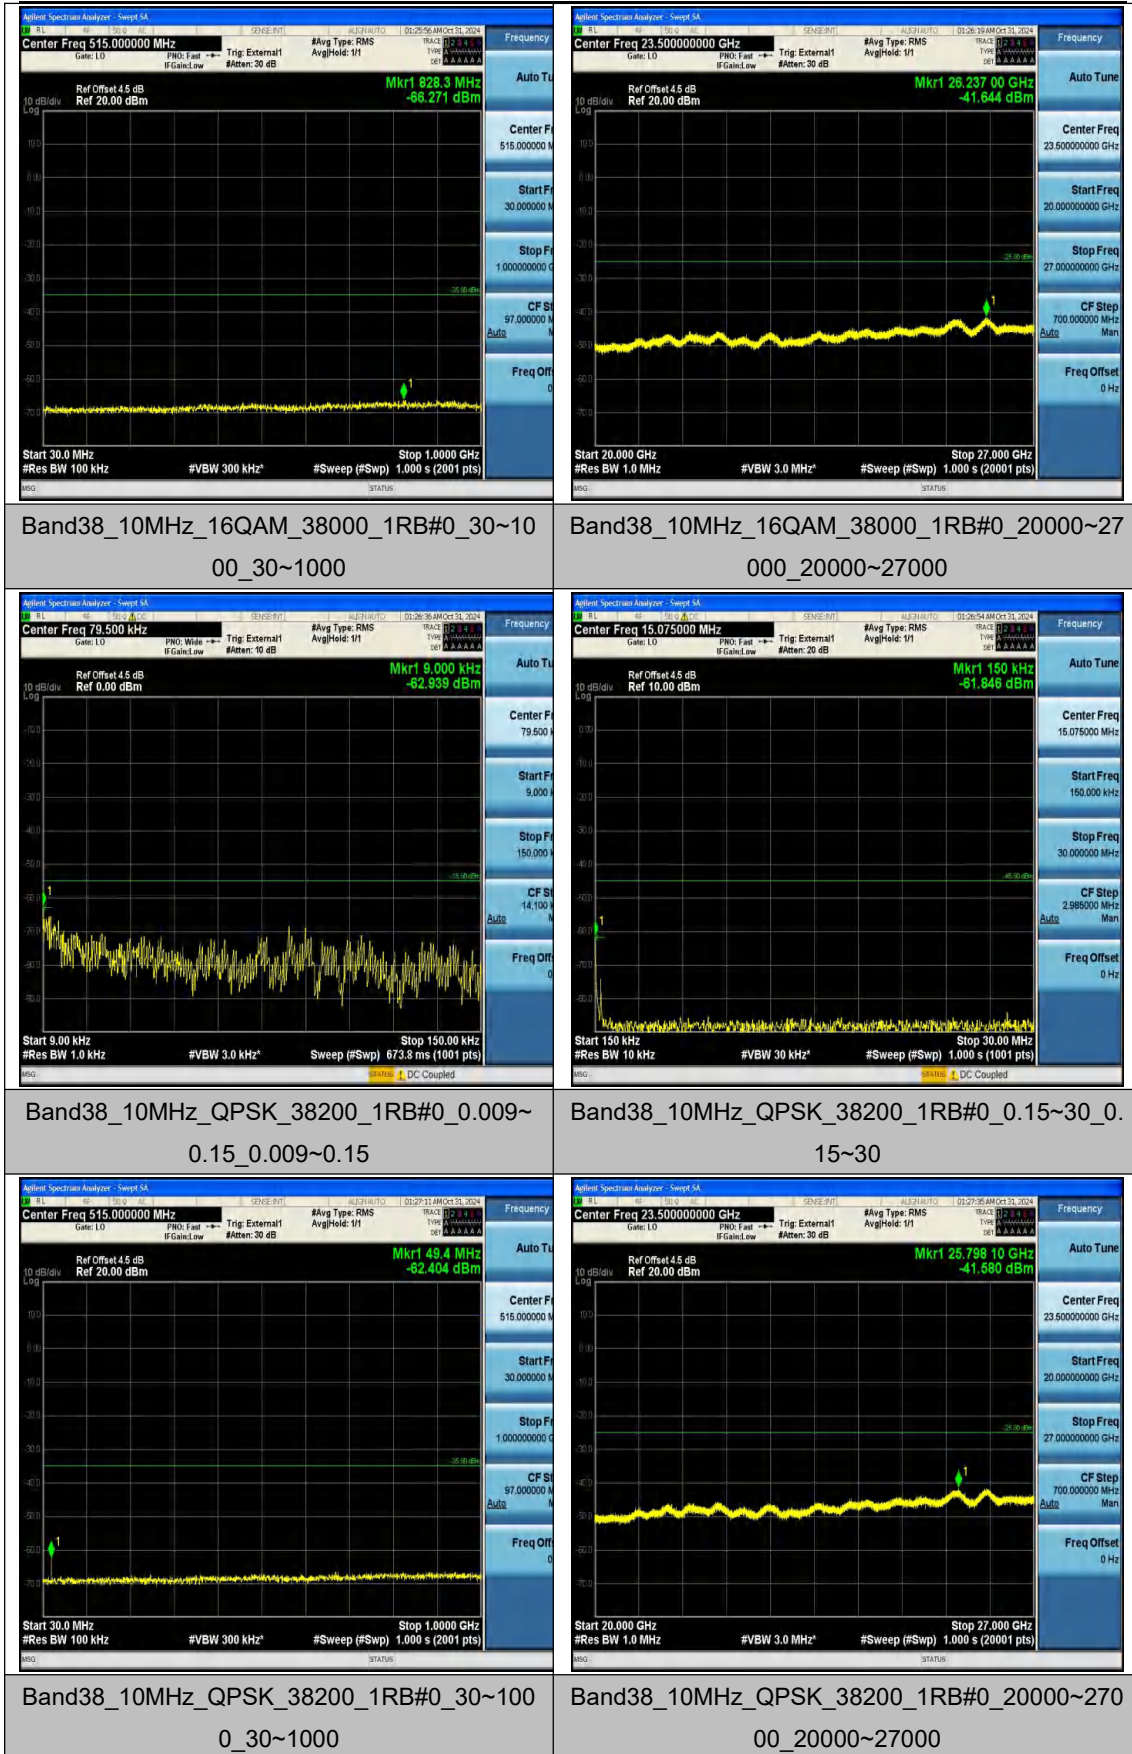

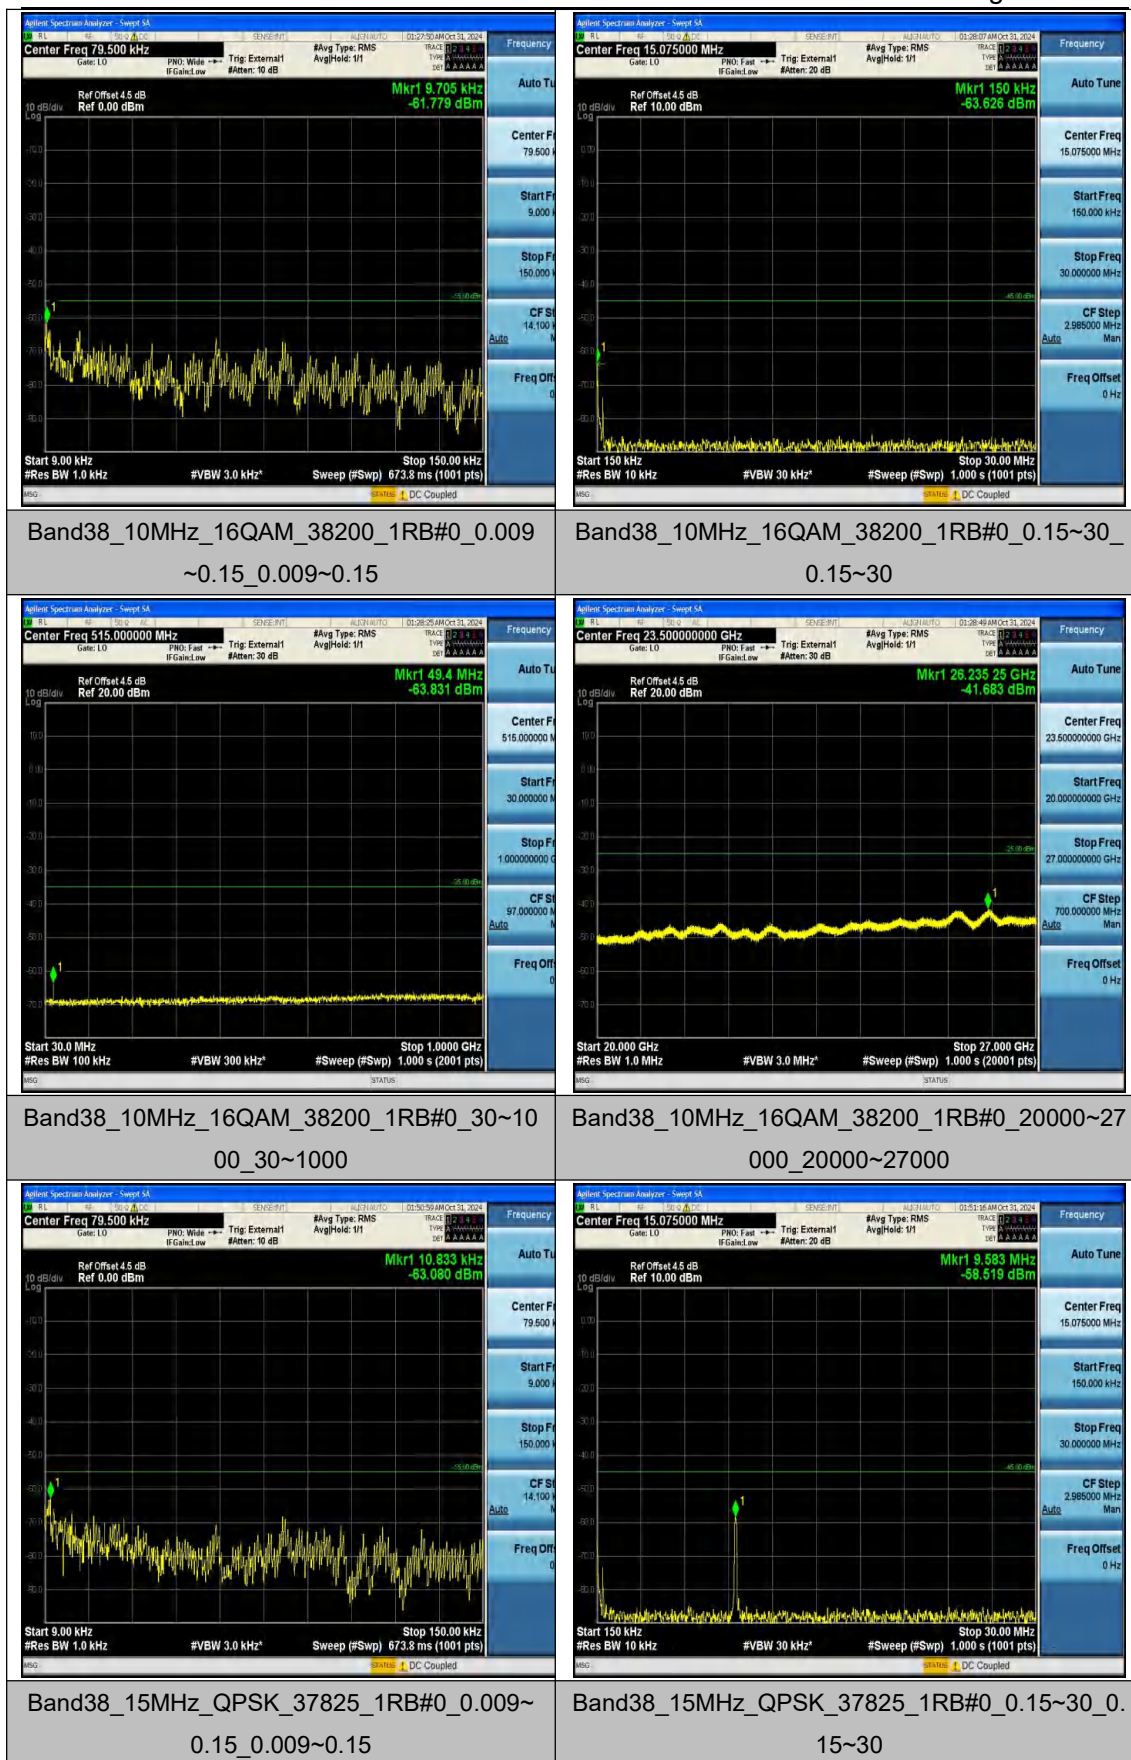

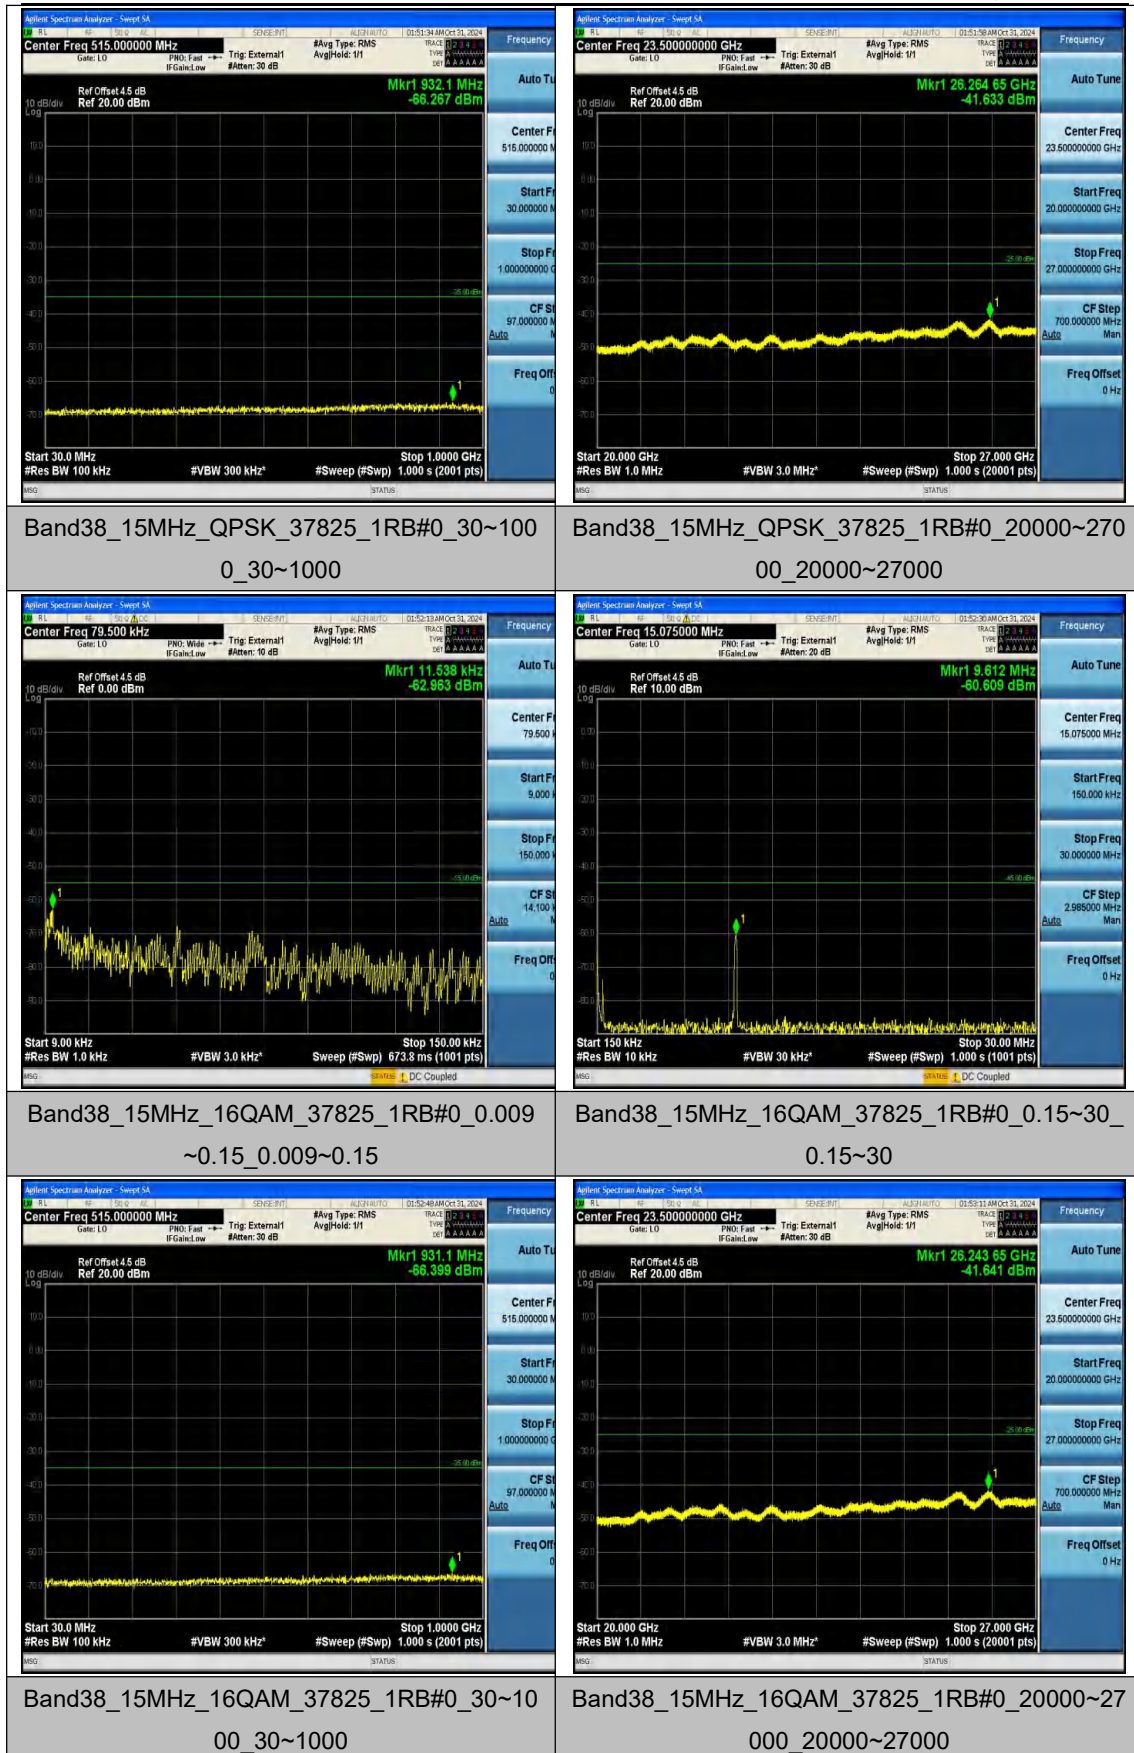

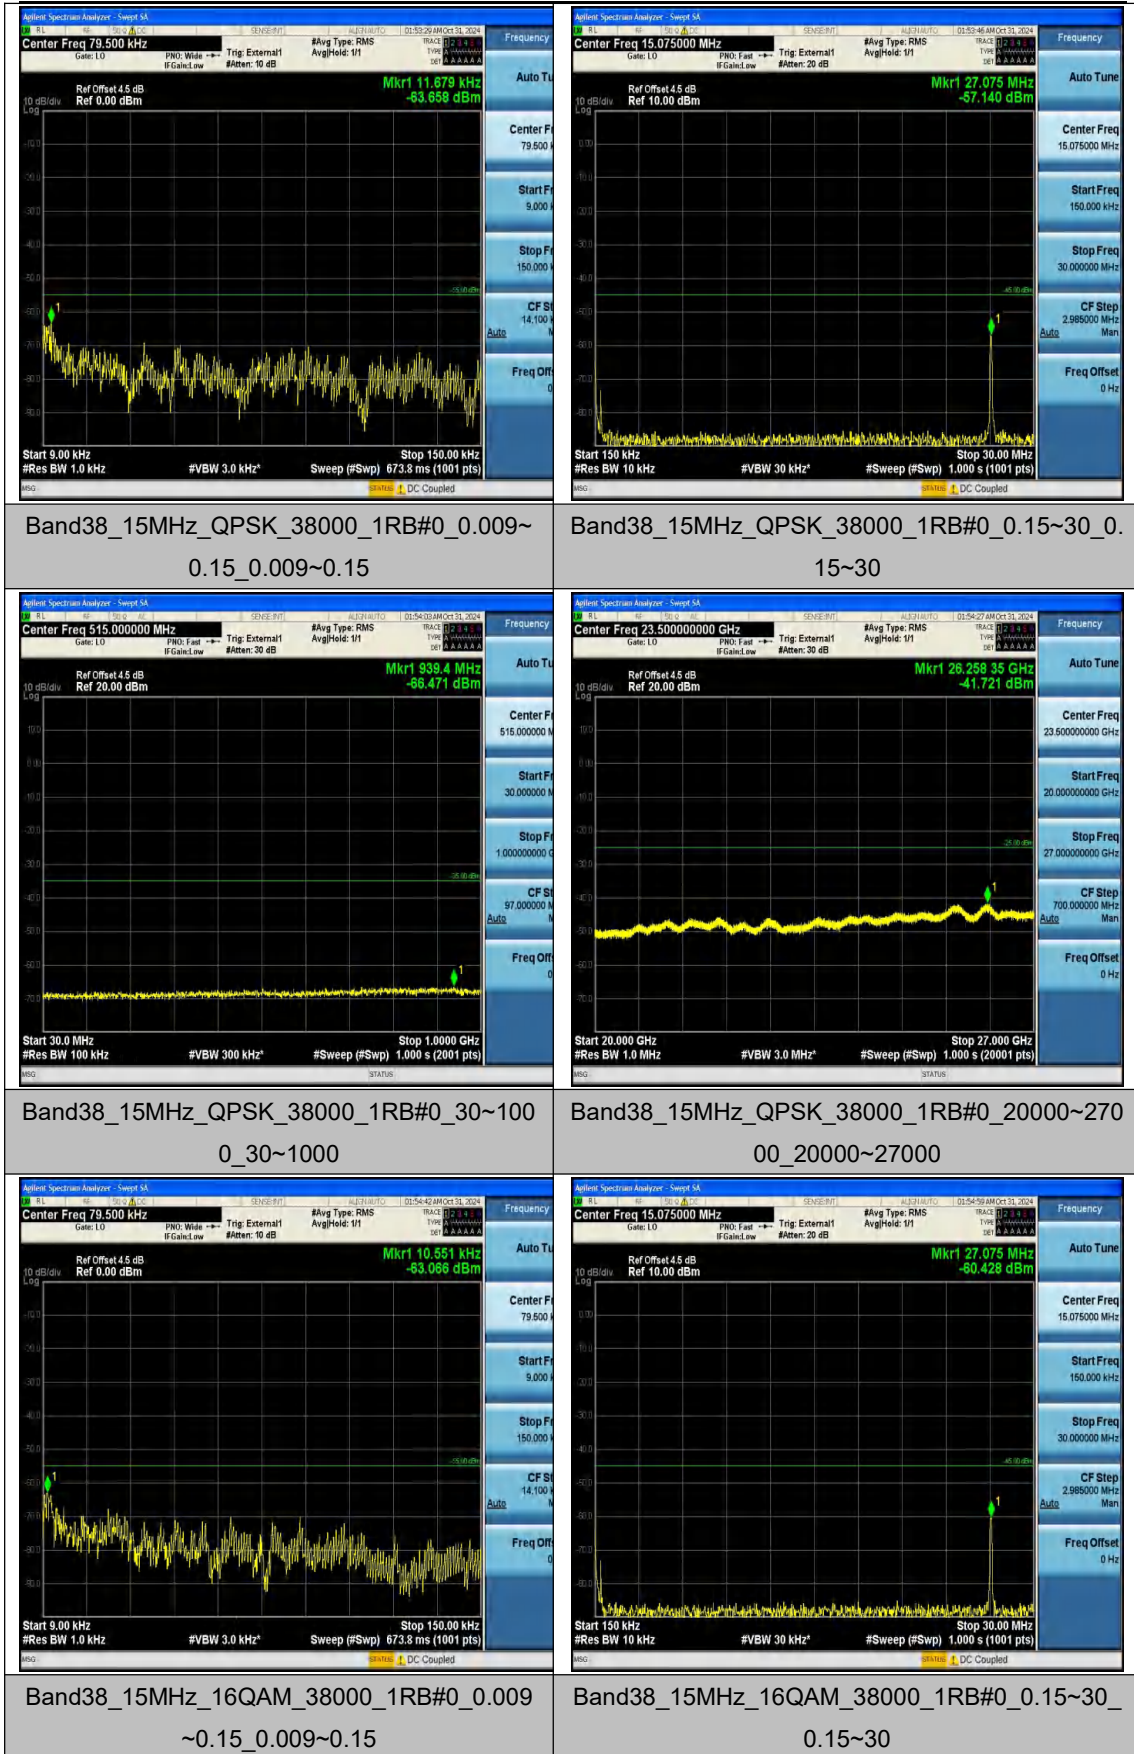


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com





Hotline
400-003-0500
www.anbotek.com




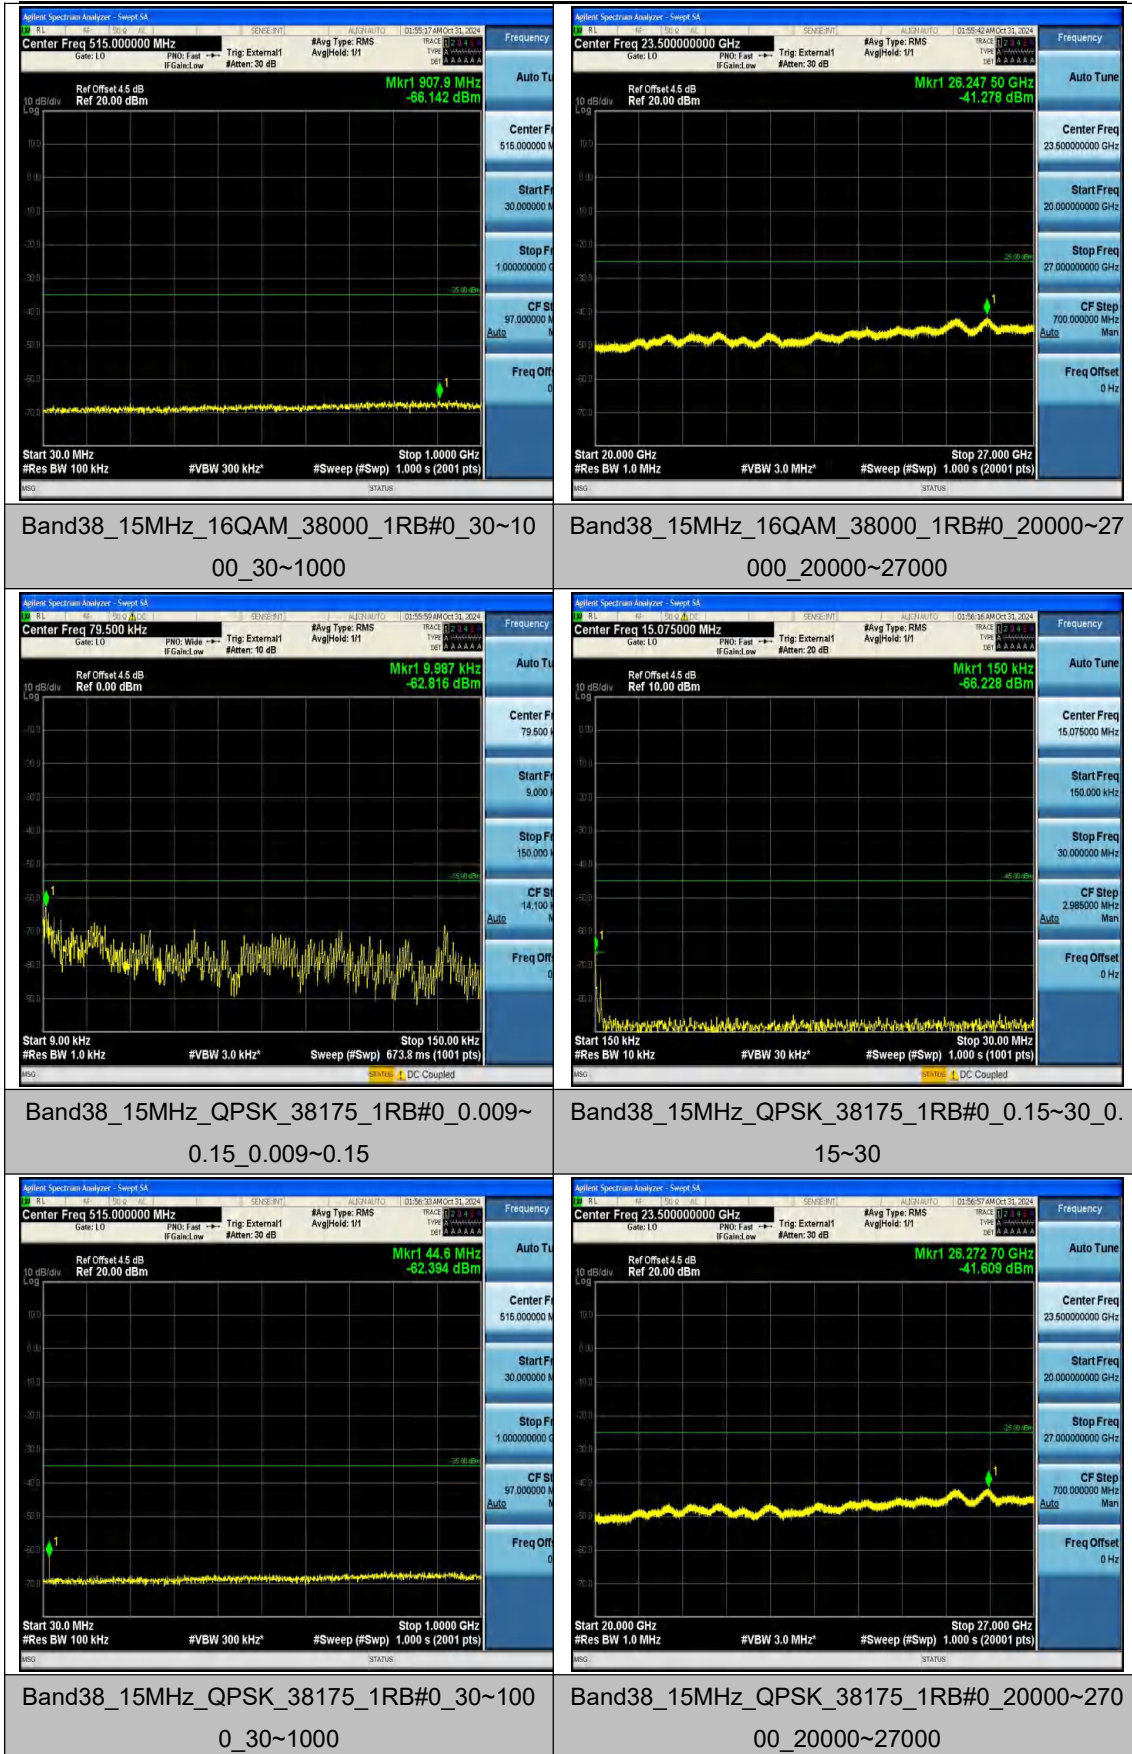


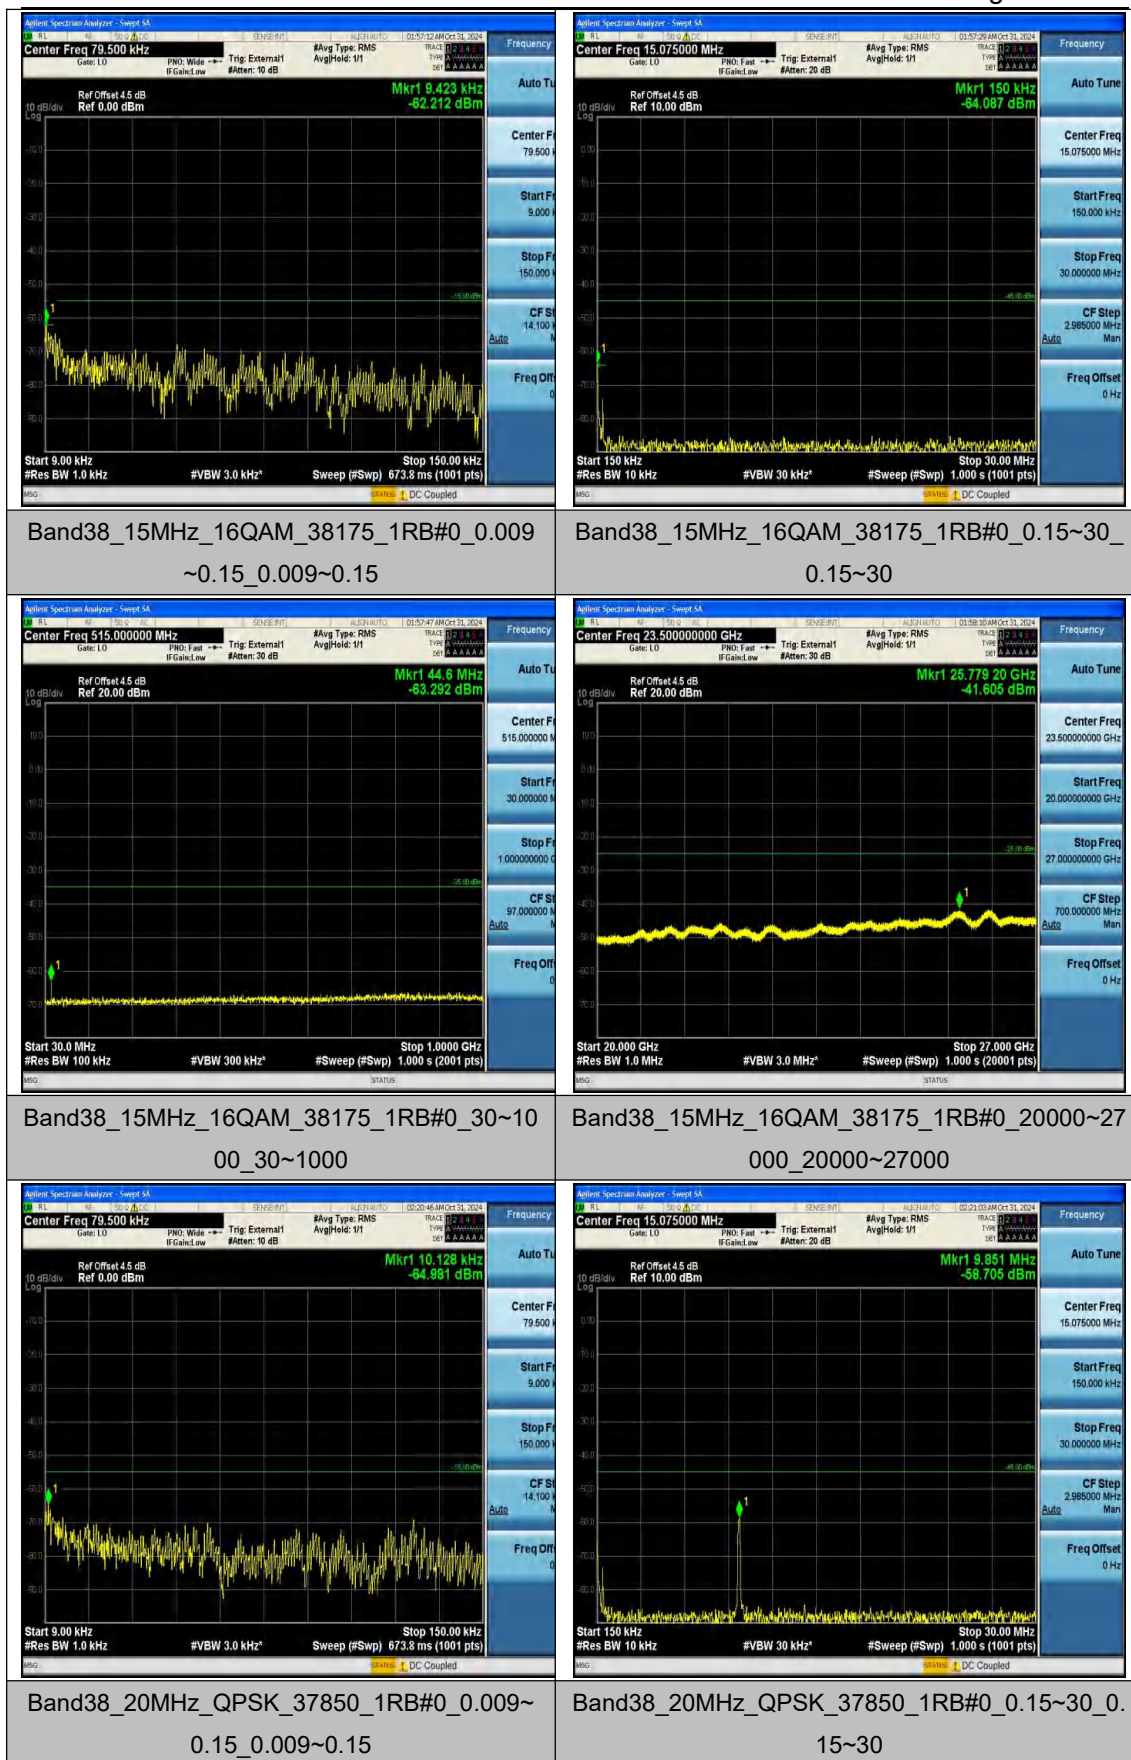

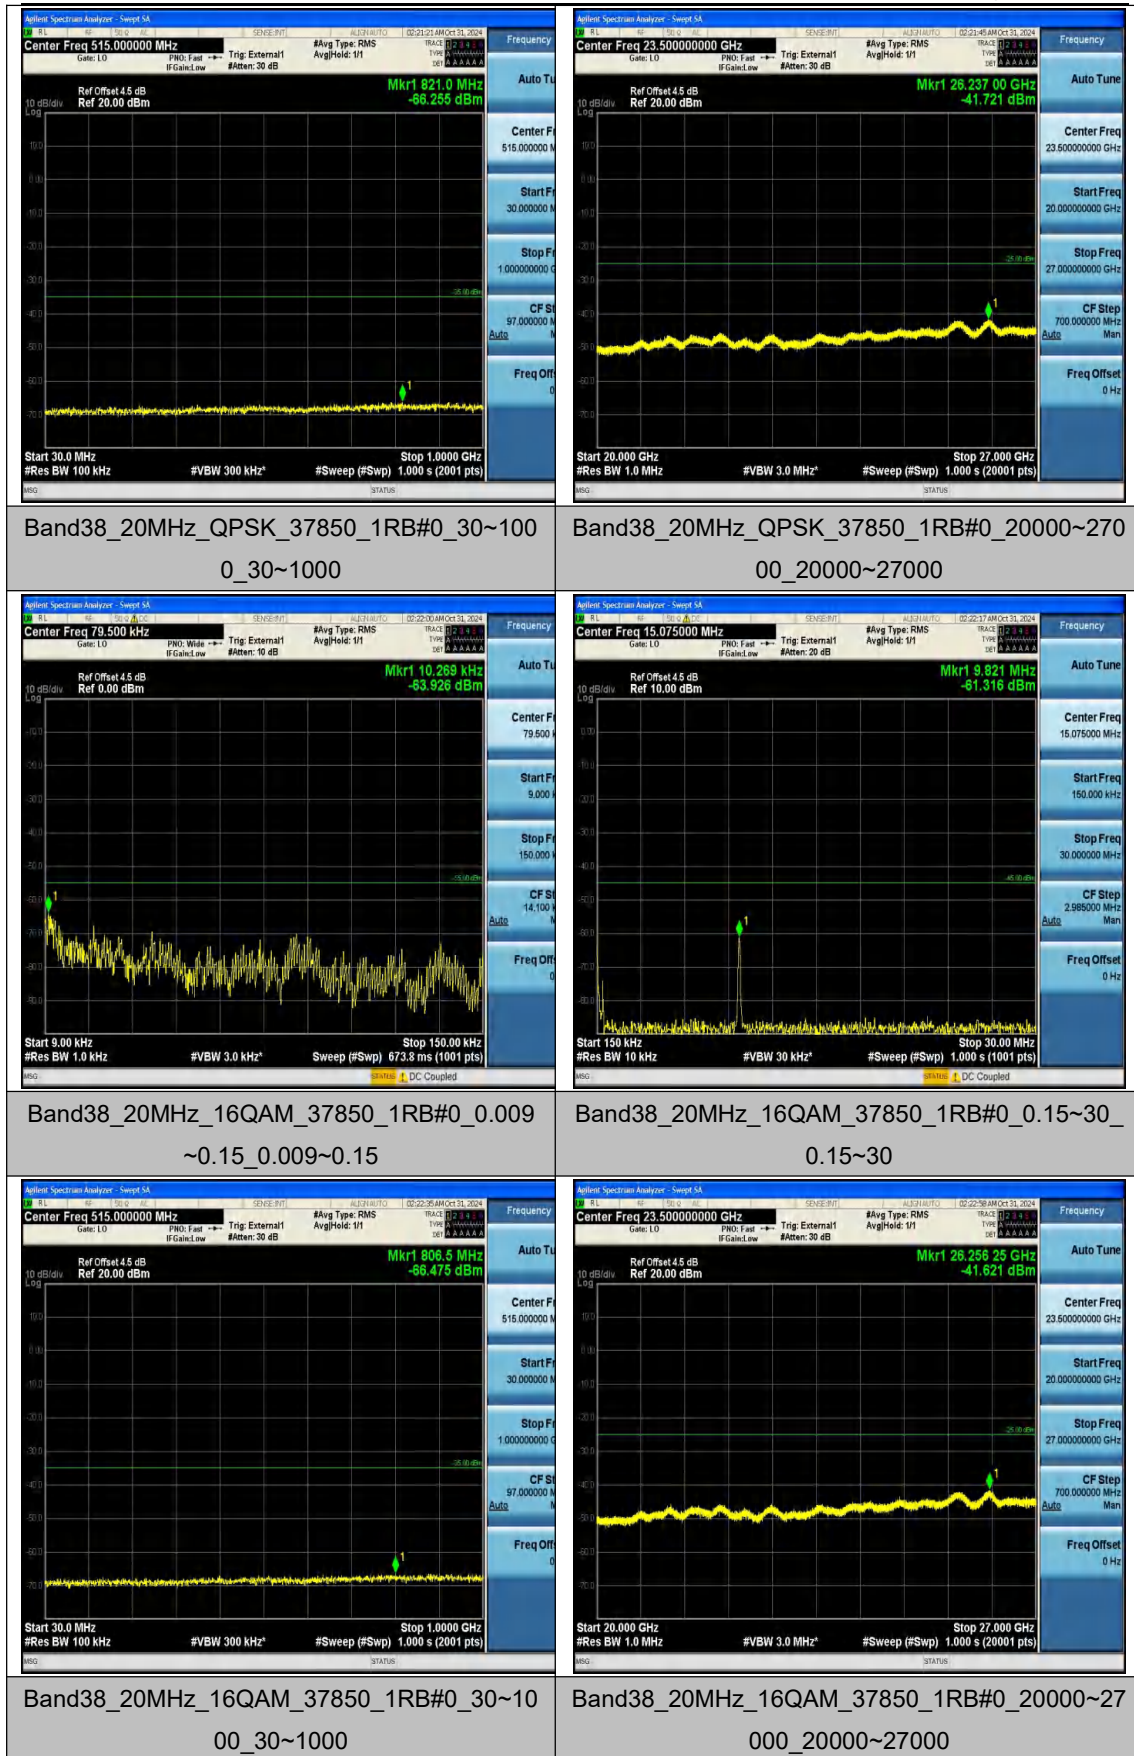

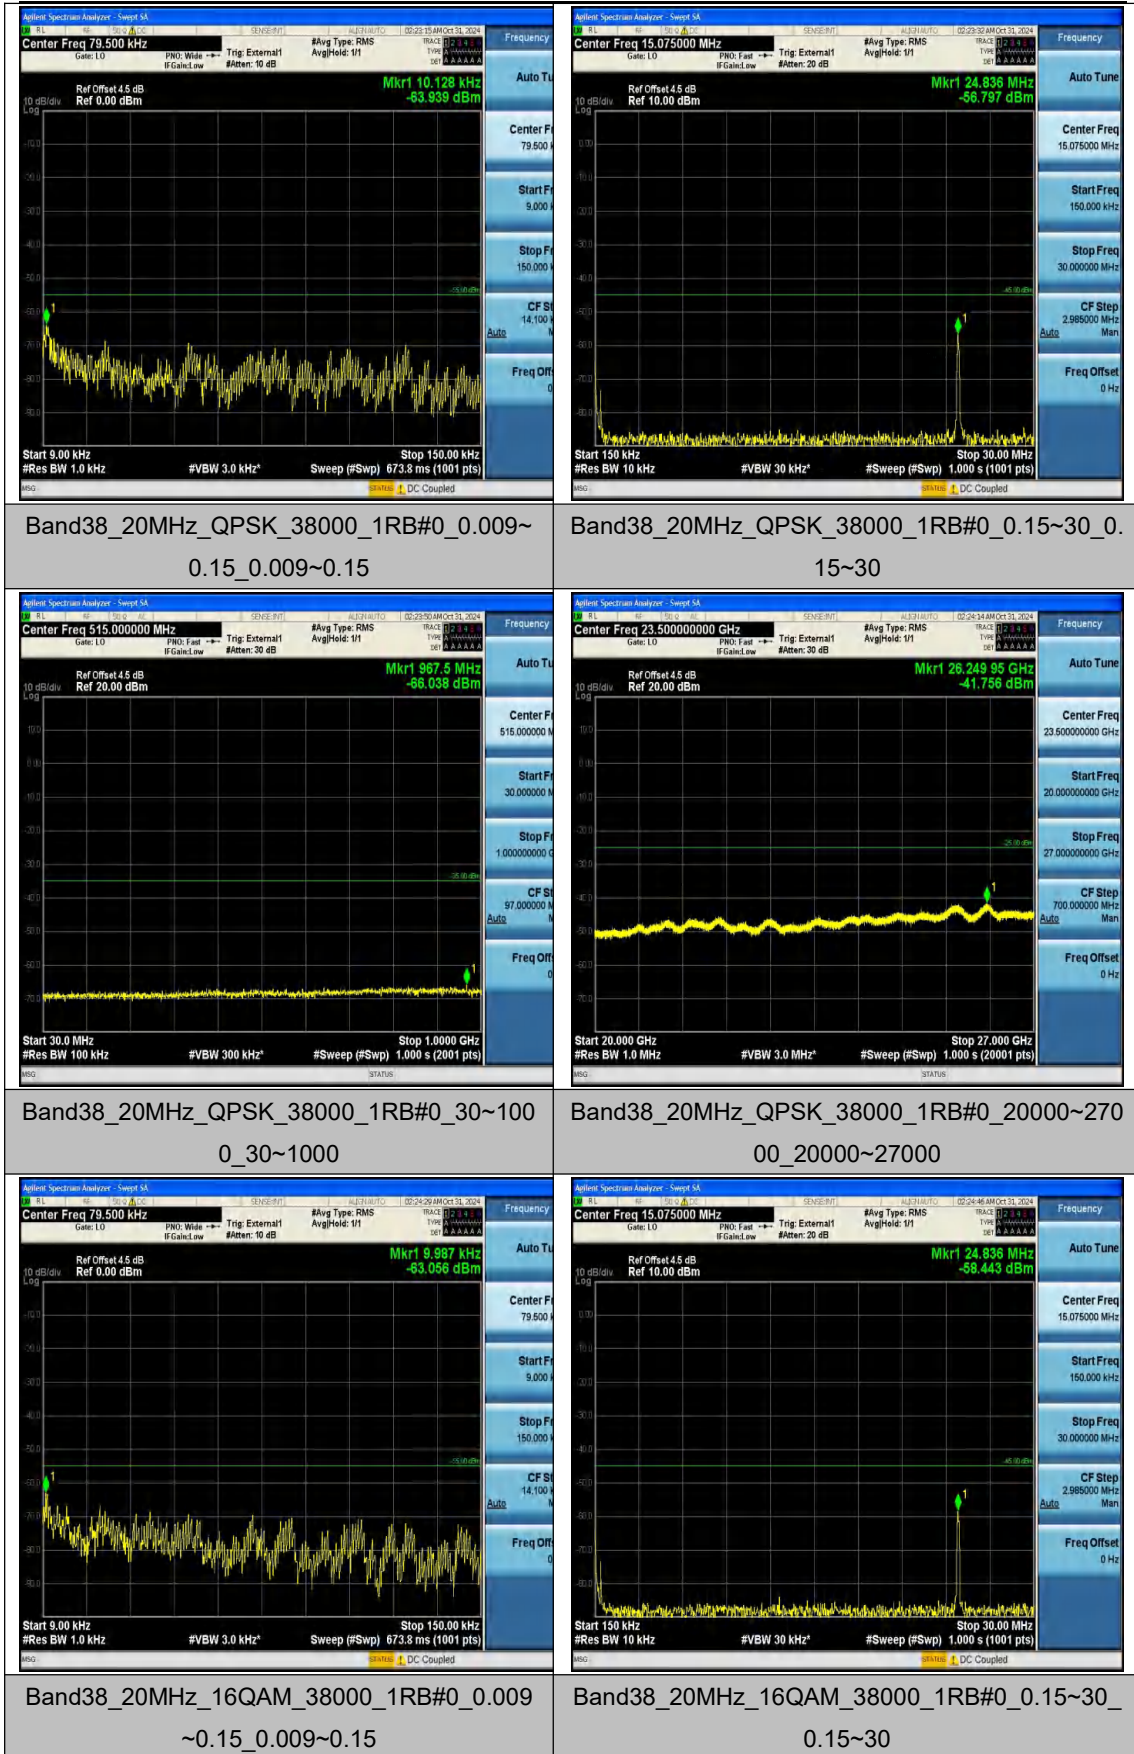

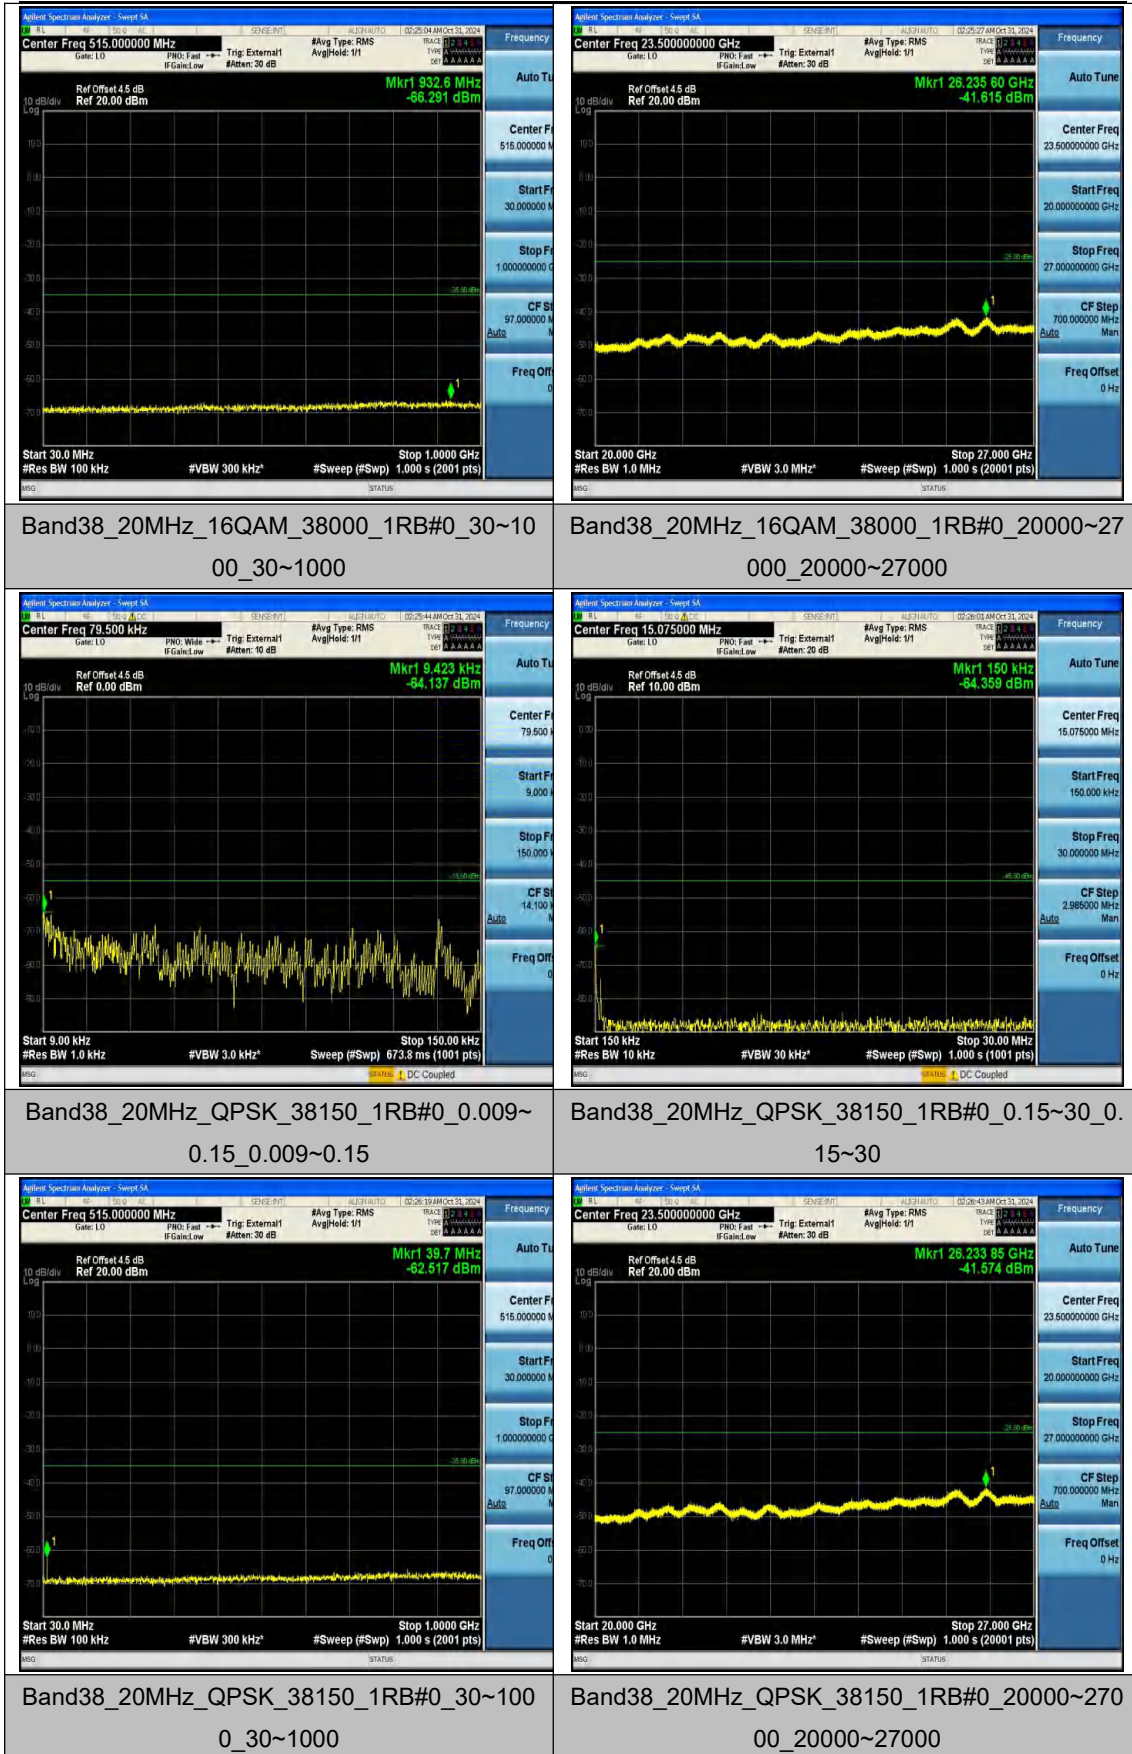

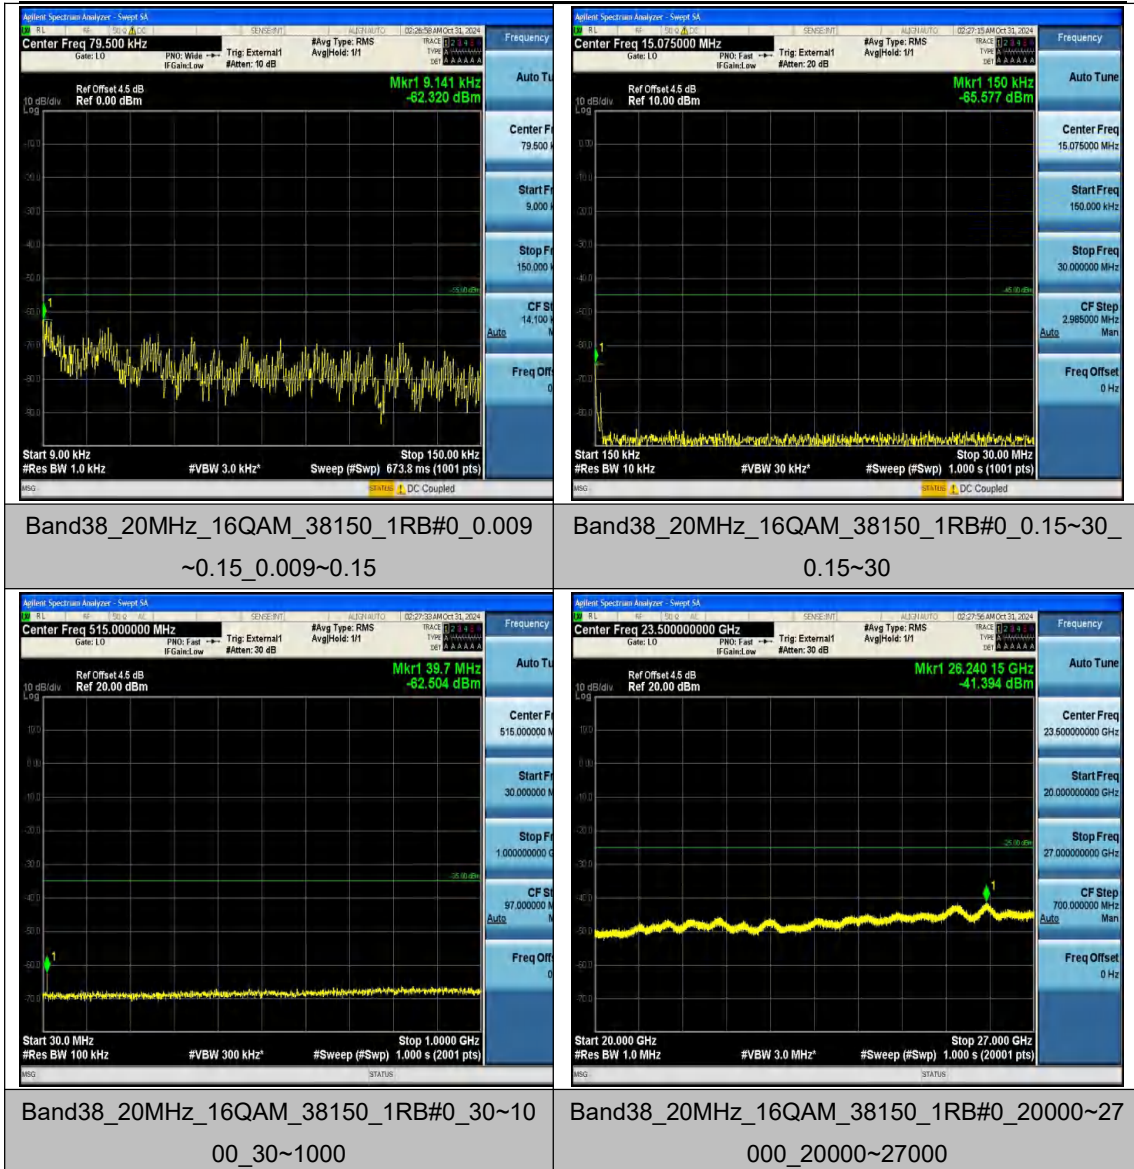

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500

www.anbotech.com



Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band38	5MHz	QPSK	37775	25RB#0	VN	NT	-9.06	-0.003522	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	VL	NT	-10.27	-0.003992	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	VH	NT	-10.79	-0.004194	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VN	NT	-11.24	-0.004369	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VL	NT	5.79	0.002251	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VH	NT	3.52	0.001368	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VN	NT	-7.24	-0.002790	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VL	NT	-11.79	-0.004543	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VH	NT	-9.04	-0.003484	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VN	NT	-9.61	-0.003703	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VL	NT	4.75	0.001830	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VH	NT	-6.01	-0.002316	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VN	NT	-13.07	-0.004993	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VL	NT	-9.67	-0.003694	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VH	NT	-9.03	-0.003450	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VN	NT	-9.70	-0.003706	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VL	NT	-8.00	-0.003056	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VH	NT	-8.10	-0.003095	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VN	NT	-10.64	-0.004132	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VL	NT	-8.34	-0.003239	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VH	NT	-8.21	-0.003188	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VN	NT	-6.88	-0.002672	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VL	NT	10.00	0.003883	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VH	NT	6.49	0.002520	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VN	NT	-6.14	-0.002366	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VL	NT	-10.30	-0.003969	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VH	NT	-8.25	-0.003179	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VN	NT	-8.71	-0.003356	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VL	NT	-10.46	-0.004031	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VH	NT	-9.58	-0.003692	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VN	NT	9.90	0.003786	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VL	NT	8.65	0.003308	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VH	NT	-7.88	-0.003013	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VN	NT	6.08	0.002325	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VL	NT	5.38	0.002057	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86)0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



Band38	10MHz	16QAM	38200	50RB#0	VH	NT	8.96	0.003426	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VN	NT	-5.49	-0.002130	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VL	NT	7.91	0.003069	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VH	NT	9.84	0.003818	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VN	NT	8.96	0.003476	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VL	NT	10.51	0.004078	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VH	NT	6.94	0.002693	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VN	NT	-9.37	-0.003611	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VL	NT	-5.34	-0.002058	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VH	NT	-6.95	-0.002678	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VN	NT	-14.12	-0.005441	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VL	NT	6.64	0.002559	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VH	NT	-9.28	-0.003576	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VN	NT	-10.49	-0.004015	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VL	NT	-4.96	-0.001899	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VH	NT	-7.17	-0.002744	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VN	NT	-11.01	-0.004214	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VL	NT	9.77	0.003740	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VH	NT	6.54	0.002503	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VN	NT	-9.28	-0.003597	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VL	NT	-10.26	-0.003977	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VH	NT	-6.48	-0.002512	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VN	NT	-9.86	-0.003822	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VL	NT	-74.70	-0.028953	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VH	NT	-12.76	-0.004946	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VN	NT	-6.91	-0.002663	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VL	NT	-14.35	-0.005530	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VH	NT	-4.56	-0.001757	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VN	NT	4.94	0.001904	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VL	NT	-9.24	-0.003561	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VH	NT	-4.56	-0.001757	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VN	NT	-10.10	-0.003870	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VL	NT	-6.04	-0.002314	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VH	NT	-8.53	-0.003268	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VN	NT	-9.83	-0.003766	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VL	NT	-6.12	-0.002345	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VH	NT	-10.50	-0.004023	±2.5	PASS



Appendix G: Frequency stability VS Temperature

measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	NV	-30	-13.16	-0.005116	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-20	-11.19	-0.004350	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-10	-11.04	-0.004292	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	0	-5.85	-0.002274	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	10	-4.32	-0.001679	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	20	-9.38	-0.003646	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	30	-10.74	-0.004175	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	40	-11.22	-0.004362	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	50	-10.30	-0.004004	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-30	-14.46	-0.005621	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-20	-9.90	-0.003848	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-10	-4.76	-0.001850	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	0	-9.28	-0.003607	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	10	-10.64	-0.004136	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	20	-14.10	-0.005481	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	30	-9.48	-0.003685	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	40	-5.85	-0.002274	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	50	-11.90	-0.004626	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-30	-5.88	-0.002266	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-20	-14.51	-0.005592	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-10	-8.58	-0.003306	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	0	-9.61	-0.003703	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	10	-4.53	-0.001746	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	20	-9.86	-0.003800	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	30	-7.02	-0.002705	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	40	5.85	0.002254	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	50	-8.14	-0.003137	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-30	-11.24	-0.004331	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-20	-7.21	-0.002778	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-10	-6.51	-0.002509	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	0	-6.97	-0.002686	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	10	-5.32	-0.002050	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



Band38	5MHz	16QAM	38000	25RB#0	NV	20	-11.29	-0.004351	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	30	-9.64	-0.003715	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	40	-8.30	-0.003198	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	50	-5.81	-0.002239	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-30	-12.72	-0.004860	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-20	-15.76	-0.006021	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-10	-9.71	-0.003710	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	0	-5.51	-0.002105	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	10	-8.87	-0.003389	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	20	-7.74	-0.002957	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	30	8.88	0.003393	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	40	-11.33	-0.004329	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	50	-8.63	-0.003297	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-30	-8.47	-0.003236	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-20	-5.84	-0.002231	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-10	-9.03	-0.003450	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	0	-13.56	-0.005181	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	10	-5.48	-0.002094	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	20	-13.20	-0.005043	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	30	-10.74	-0.004103	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	40	-12.62	-0.004821	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	50	-15.45	-0.005903	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-30	6.27	0.002435	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-20	-7.20	-0.002796	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-10	-4.39	-0.001705	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	0	-8.28	-0.003216	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	10	-4.41	-0.001713	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	20	11.80	0.004583	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	30	5.58	0.002167	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	40	4.11	0.001596	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	50	-5.31	-0.002062	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-30	-5.64	-0.002190	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-20	7.20	0.002796	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-10	-4.46	-0.001732	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	0	-4.13	-0.001604	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	10	-7.74	-0.003006	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	20	9.87	0.003833	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	30	-8.97	-0.003483	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	40	7.47	0.002901	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	50	5.36	0.002082	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-30	-11.19	-0.004312	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



Band38	10MHz	QPSK	38000	50RB#0	NV	-20	-11.33	-0.004366	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-10	-8.03	-0.003094	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	0	-8.04	-0.003098	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	10	-7.48	-0.002882	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	20	-8.03	-0.003094	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	30	-9.51	-0.003665	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	40	-6.12	-0.002358	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	50	-6.58	-0.002536	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-30	-8.67	-0.003341	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-20	-6.22	-0.002397	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-10	4.82	0.001857	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	0	-8.63	-0.003326	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	10	-8.27	-0.003187	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	20	-9.78	-0.003769	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	30	-14.72	-0.005672	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	40	-8.03	-0.003094	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	50	-6.69	-0.002578	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-30	-5.82	-0.002226	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-20	6.19	0.002367	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-10	7.31	0.002795	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	0	5.24	0.002004	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	10	9.23	0.003530	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	20	6.28	0.002402	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	30	9.21	0.003522	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	40	9.53	0.003644	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	50	12.32	0.004711	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-30	-6.58	-0.002516	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-20	-5.51	-0.002107	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-10	4.95	0.001893	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	0	8.20	0.003136	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	10	9.37	0.003583	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	20	8.53	0.003262	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	30	-7.72	-0.002952	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	40	10.94	0.004184	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	50	7.02	0.002685	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-30	6.82	0.002646	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-20	7.85	0.003046	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-10	6.32	0.002452	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	0	-6.38	-0.002475	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	10	-4.69	-0.001820	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	20	3.65	0.001416	±2.5	PASS



Band38	15MHz	QPSK	37825	75RB#0	NV	30	9.21	0.003573	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	40	7.57	0.002937	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	50	6.82	0.002646	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-30	6.78	0.002630	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-20	8.47	0.003286	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-10	7.67	0.002976	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	0	-4.76	-0.001847	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	10	7.12	0.002762	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	20	10.47	0.004062	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	30	-6.32	-0.002452	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	40	12.43	0.004823	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	50	-9.26	-0.003593	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-30	-12.32	-0.004748	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-20	-11.73	-0.004520	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-10	-10.83	-0.004173	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	0	-10.43	-0.004019	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	10	-7.44	-0.002867	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	20	-5.74	-0.002212	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	30	5.94	0.002289	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	40	-9.54	-0.003676	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	50	4.91	0.001892	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-30	-8.57	-0.003303	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-20	-5.75	-0.002216	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-10	-12.96	-0.004994	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	0	-6.69	-0.002578	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	10	-9.56	-0.003684	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	20	-6.59	-0.002539	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	30	3.30	0.001272	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	40	-9.23	-0.003557	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	50	-6.09	-0.002347	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-30	-8.51	-0.003257	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-20	-8.71	-0.003334	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-10	6.47	0.002477	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	0	8.10	0.003100	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	10	-8.65	-0.003311	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	20	-5.08	-0.001944	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	30	-6.95	-0.002660	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	40	-8.23	-0.003150	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	50	-6.79	-0.002599	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-30	-7.91	-0.003028	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-20	-8.94	-0.003422	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



Band38	15MHz	16QAM	38175	75RB#0	NV	-10	-7.97	-0.003051	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	0	-10.27	-0.003931	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	10	10.31	0.003946	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	20	-6.15	-0.002354	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	30	9.16	0.003506	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	40	4.91	0.001879	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	50	5.71	0.002186	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-30	-11.34	-0.004395	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-20	-8.57	-0.003322	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-10	-9.93	-0.003849	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	0	6.14	0.002380	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	10	-4.98	-0.001930	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	20	-7.15	-0.002771	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	30	-68.84	-0.026682	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	40	-6.61	-0.002562	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	50	4.36	0.001690	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-30	-11.79	-0.004570	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-20	-8.00	-0.003101	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-10	-13.20	-0.005116	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	0	-9.14	-0.003543	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	10	-8.20	-0.003178	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	20	7.11	0.002756	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	30	-11.40	-0.004419	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	40	-5.78	-0.002240	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	50	-7.61	-0.002950	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-30	-8.91	-0.003434	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-20	-10.40	-0.004008	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-10	-8.43	-0.003249	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	0	-7.75	-0.002987	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	10	-8.60	-0.003314	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	20	-12.16	-0.004686	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	30	-12.07	-0.004651	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	40	-10.07	-0.003881	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	50	-7.55	-0.002909	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-30	-6.31	-0.002432	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-20	-9.08	-0.003499	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-10	-10.97	-0.004227	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	0	-7.41	-0.002855	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	10	-8.57	-0.003303	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	20	-5.76	-0.002220	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	30	-9.31	-0.003588	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band38	20MHz	16QAM	38000	100RB#0	NV	40	-6.34	-0.002443	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	50	-12.97	-0.004998	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-30	-10.19	-0.003904	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-20	-11.23	-0.004303	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-10	-7.70	-0.002950	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	0	-4.81	-0.001843	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	10	-8.05	-0.003084	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	20	-8.17	-0.003130	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	30	-11.76	-0.004506	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	40	-13.52	-0.005180	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	50	-12.52	-0.004797	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-30	-10.54	-0.004038	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-20	-6.01	-0.002303	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-10	-15.22	-0.005831	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	0	-10.40	-0.003985	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	10	-10.97	-0.004203	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	20	-7.52	-0.002881	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	30	-13.63	-0.005222	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	40	-10.93	-0.004188	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	50	-8.87	-0.003398	±2.5	PASS

---END---

