





Tx. Spurious NVNT 1-DH5 2480MHz Ant1 Ref

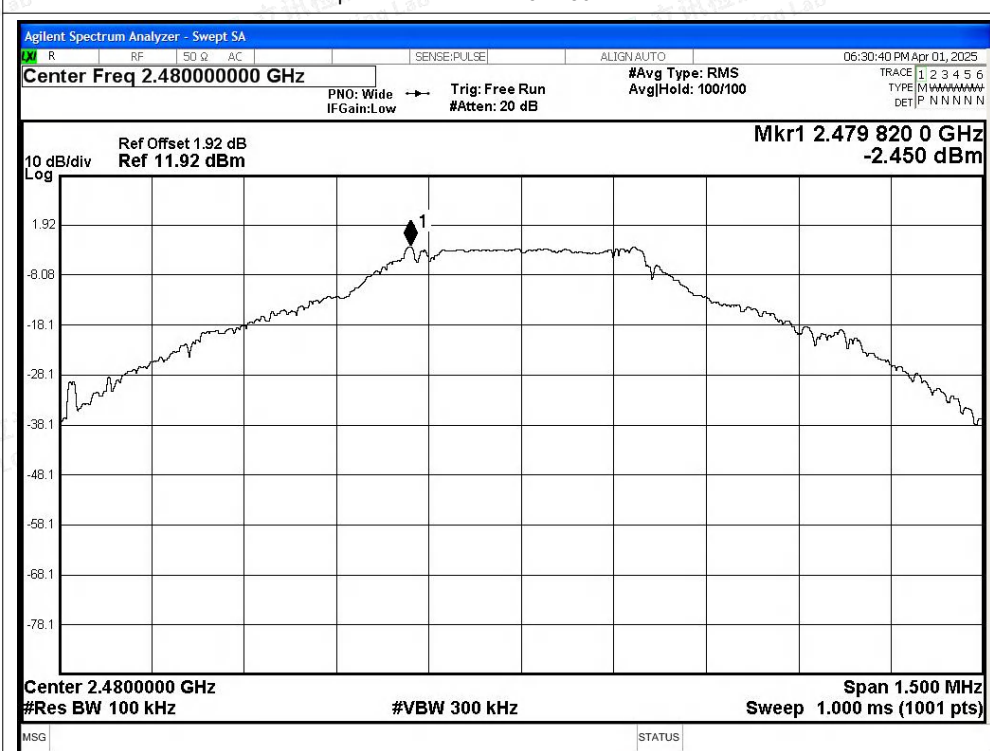

Tx. Spurious NVNT 1-DH5 2480MHz Ant1 Emission

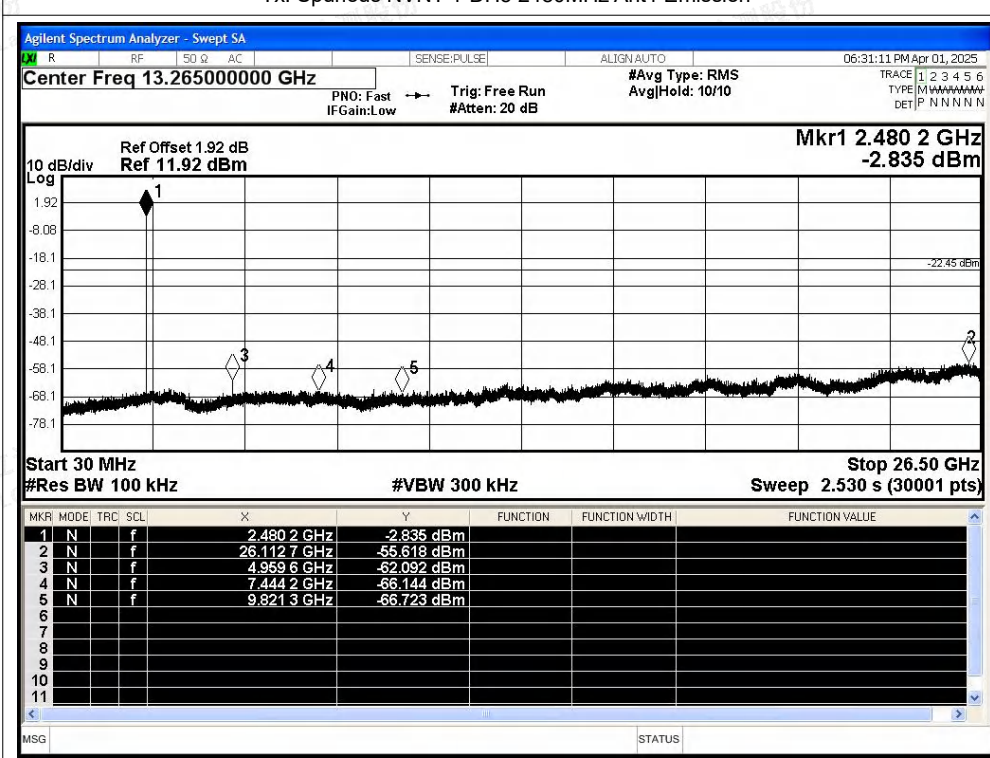

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Ref

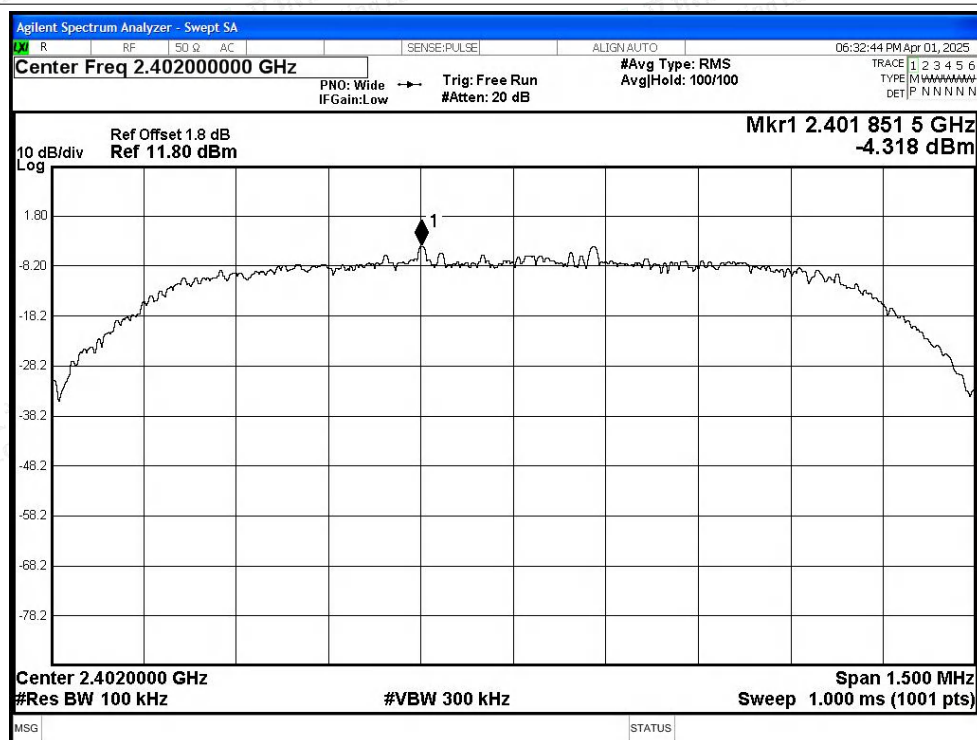

Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Emission

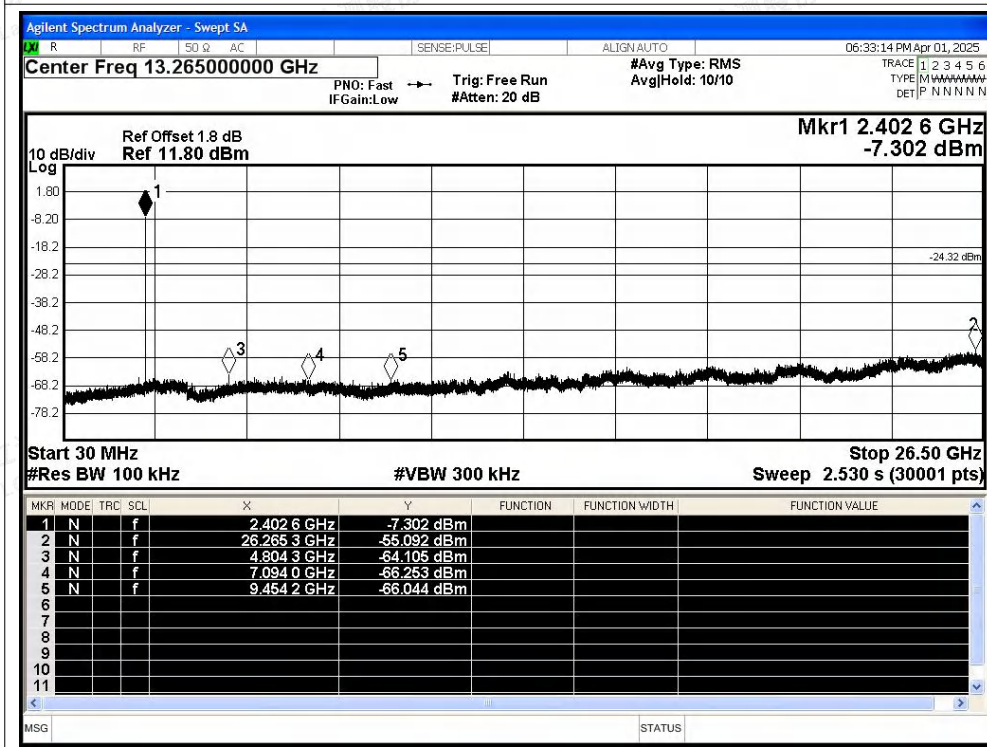

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Ref

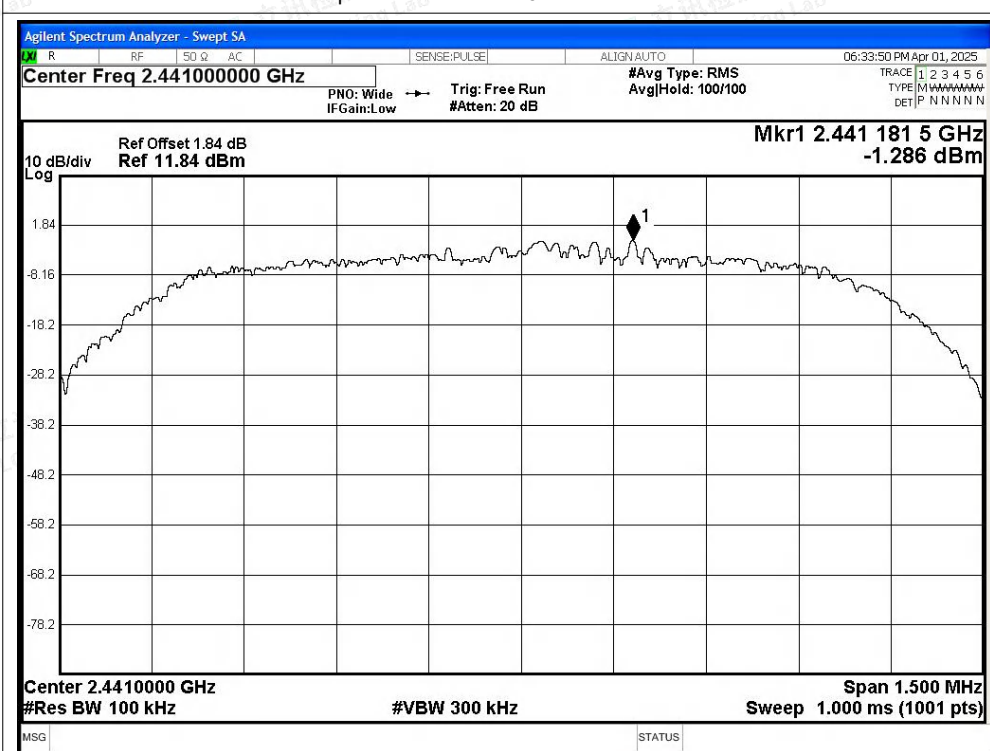

Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Emission

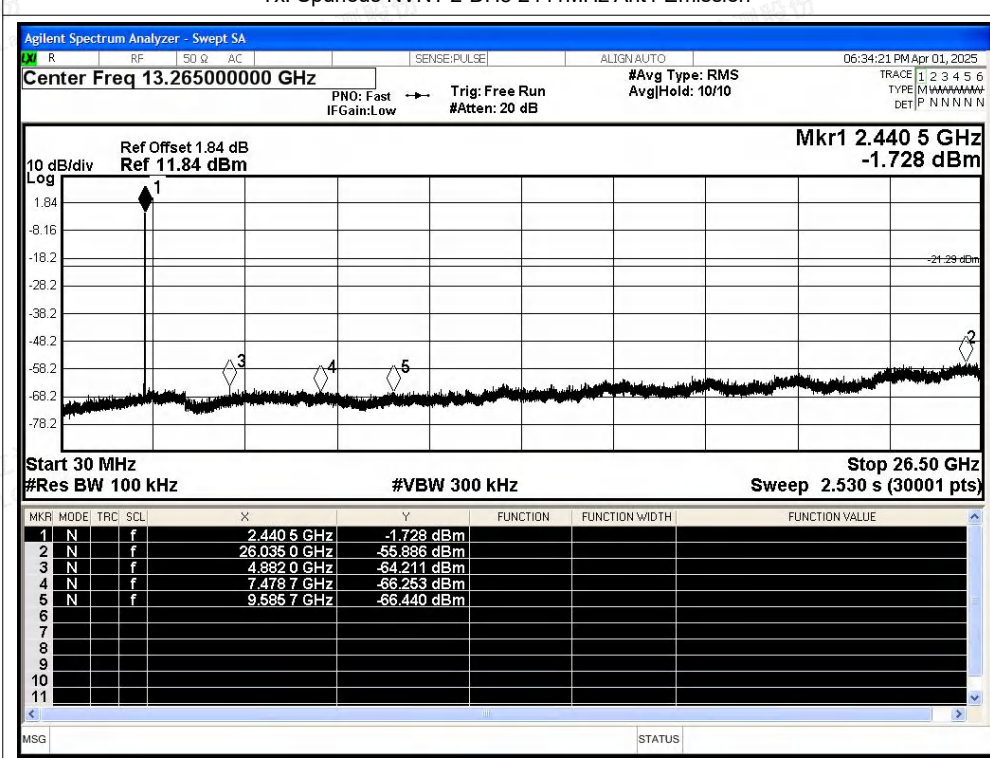

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Ref

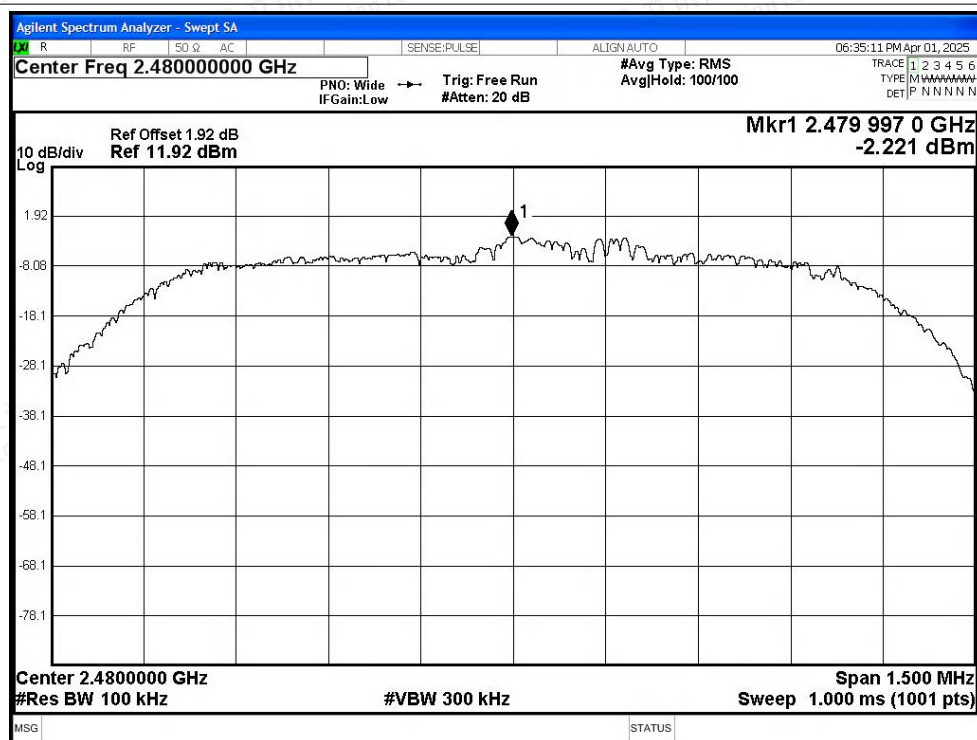

Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Emission

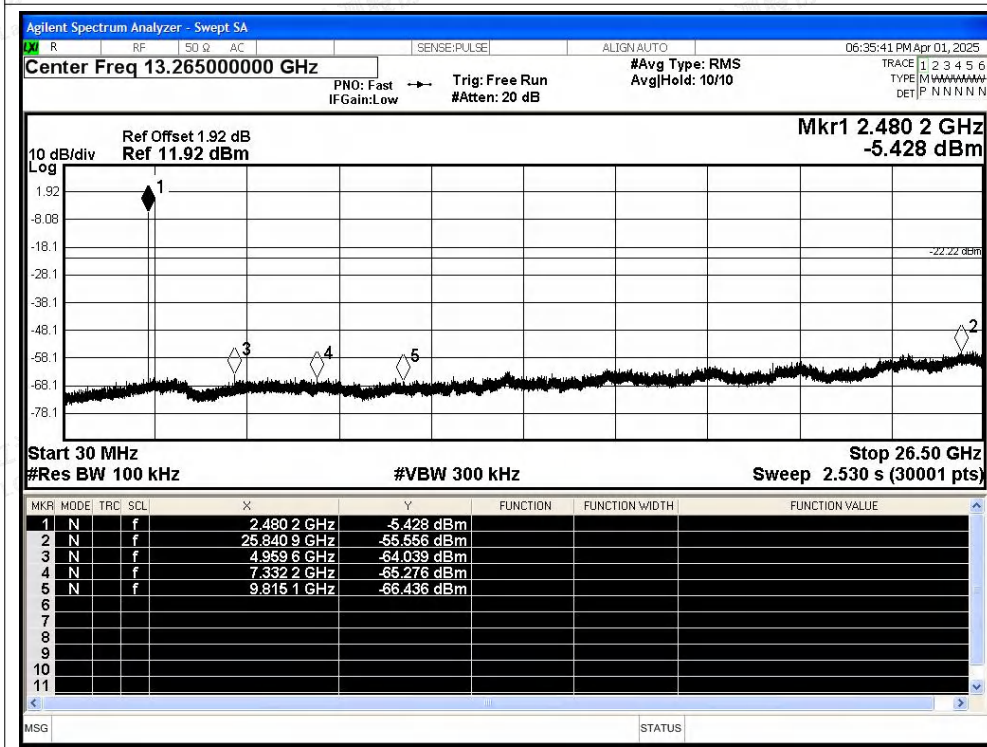

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Ref

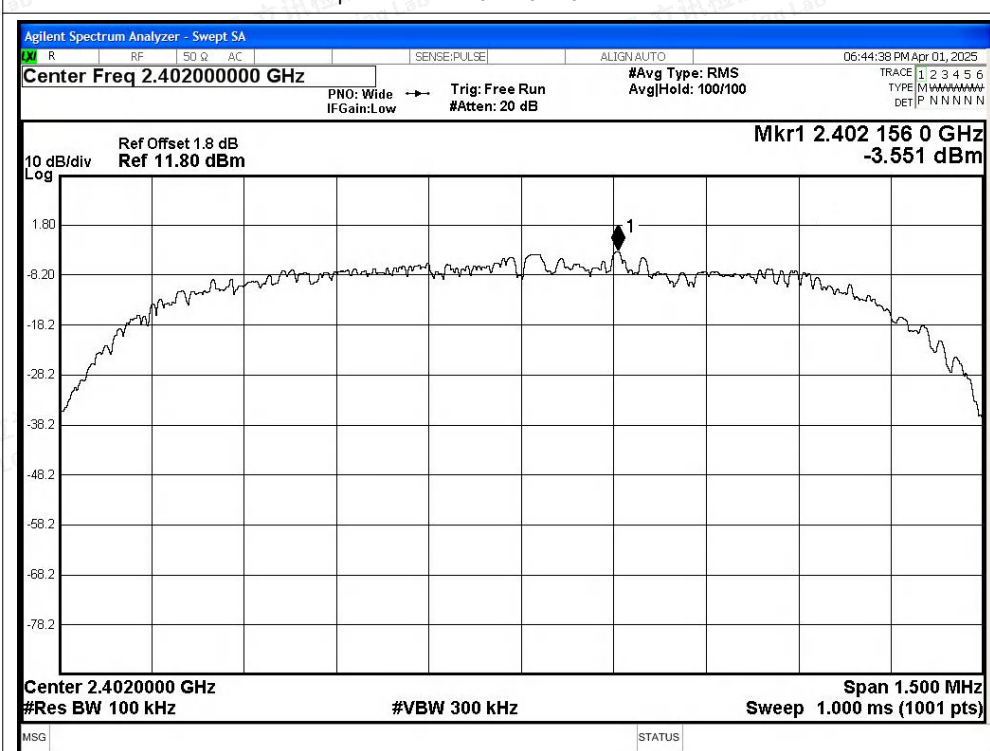

Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Emission

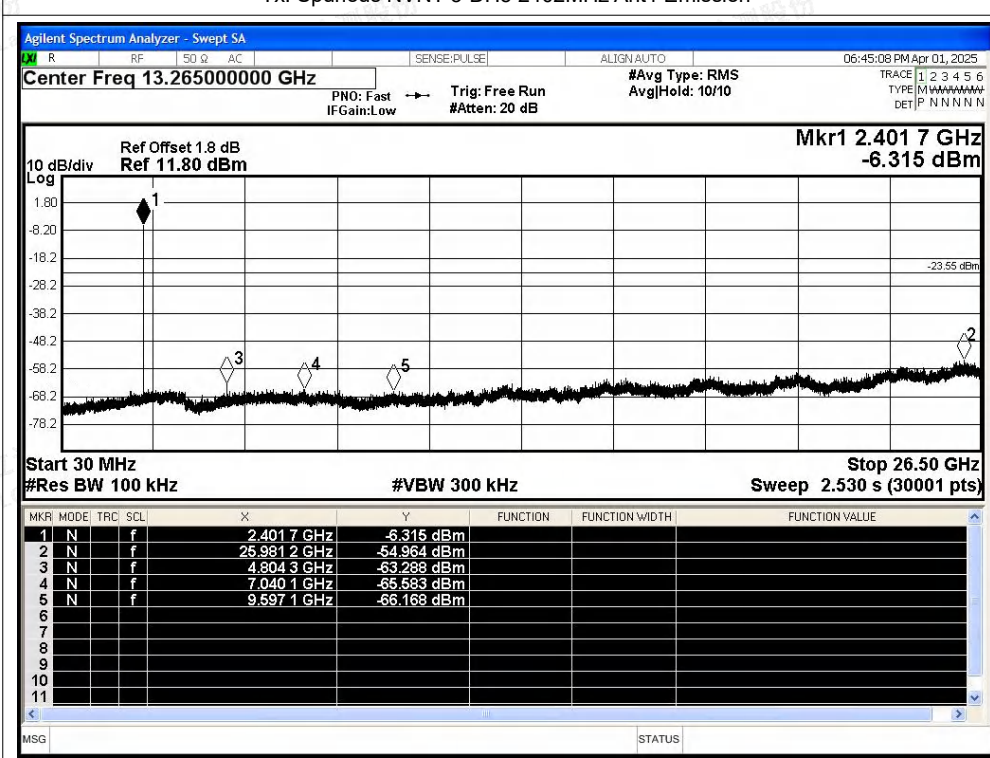

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Ref

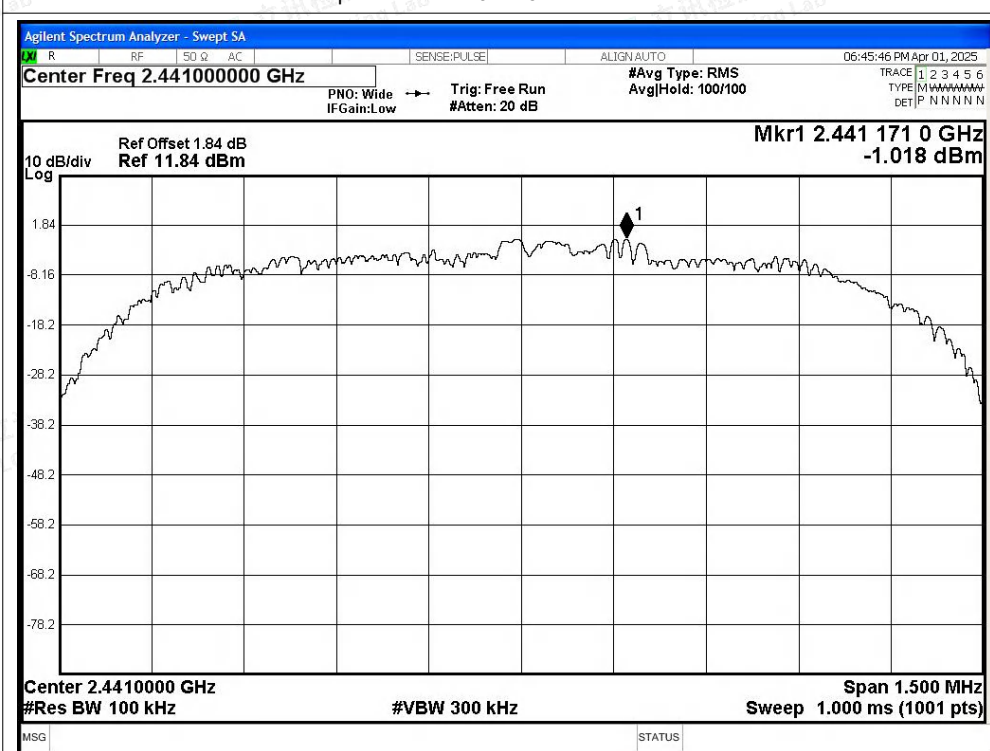

Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Emission

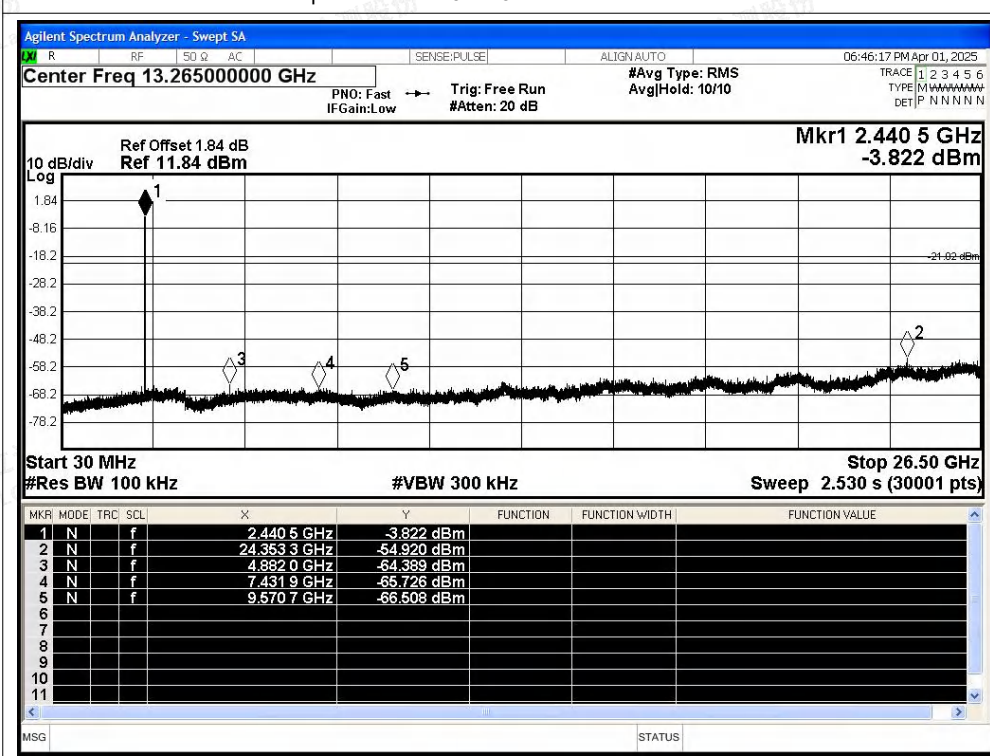

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Ref

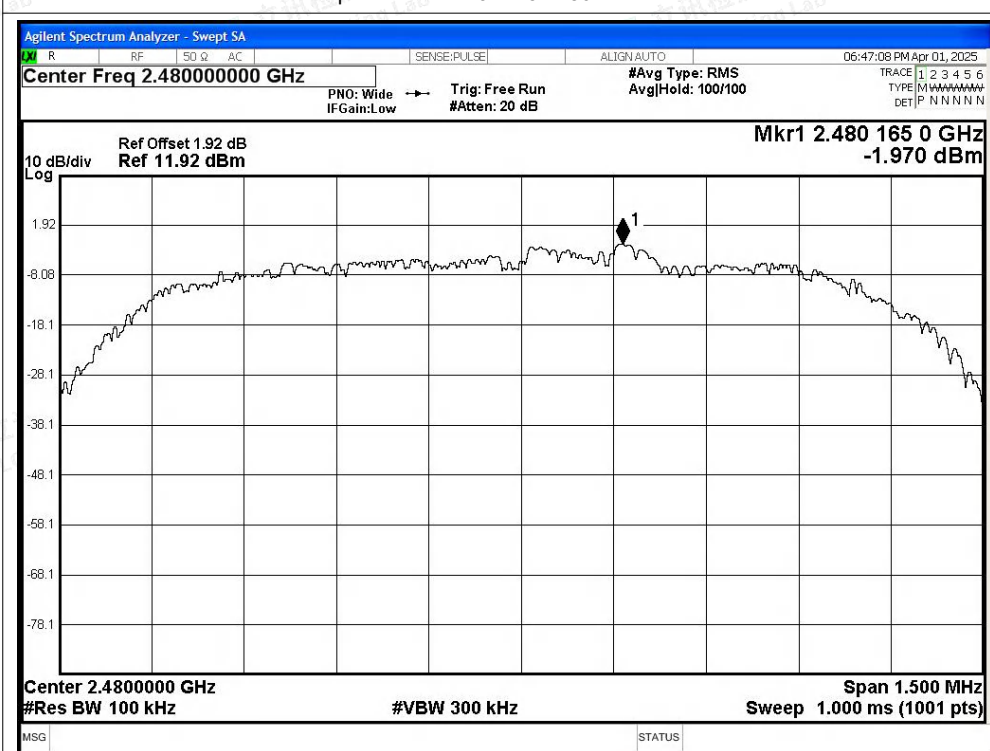

Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Emission

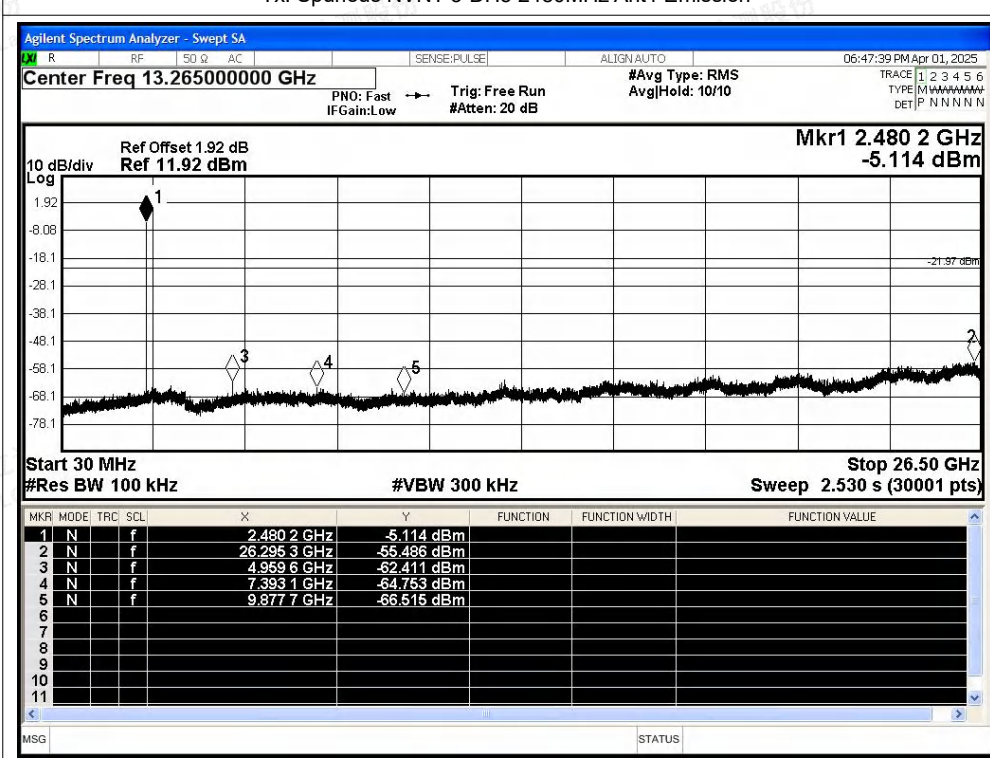

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.8 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	1-DH5	2402	Ant1	77.63	1.1	0.34
NVNT	1-DH5	2441	Ant1	77.63	1.1	0.34
NVNT	1-DH5	2480	Ant1	77.6	1.1	0.34
NVNT	2-DH5	2402	Ant1	77.28	1.12	0.35
NVNT	2-DH5	2441	Ant1	77.28	1.12	0.35
NVNT	2-DH5	2480	Ant1	77.33	1.12	0.34
NVNT	3-DH5	2402	Ant1	77.28	1.12	0.35
NVNT	3-DH5	2441	Ant1	77.28	1.12	0.35
NVNT	3-DH5	2480	Ant1	77.23	1.12	0.35



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT 1-DH5 2402MHz Ant1

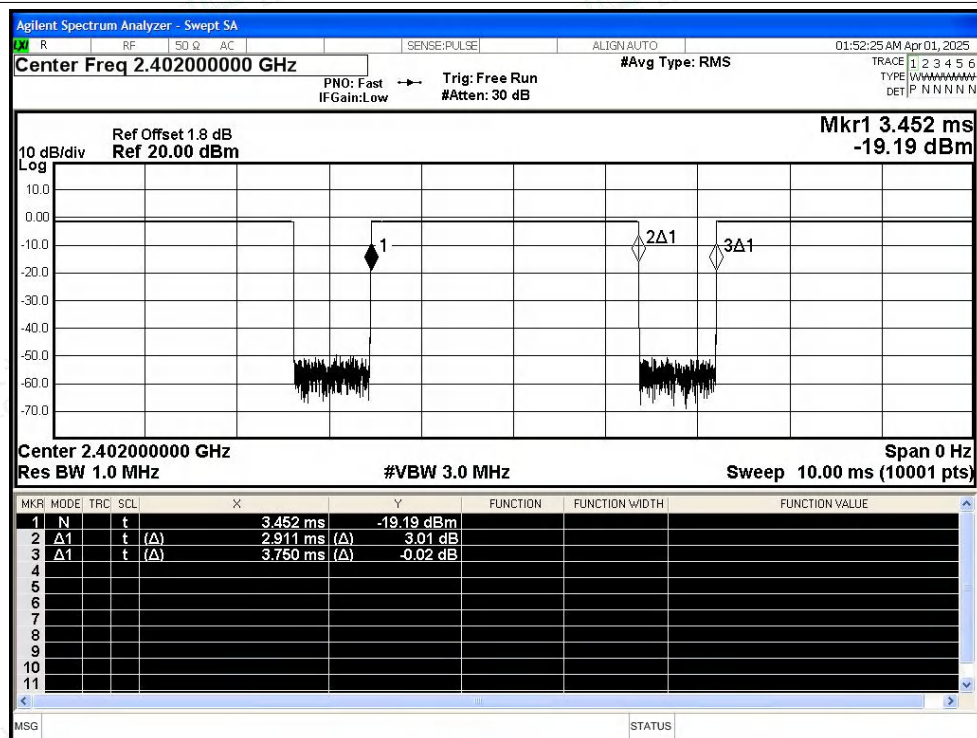

Duty Cycle NVNT 1-DH5 2441MHz Ant1

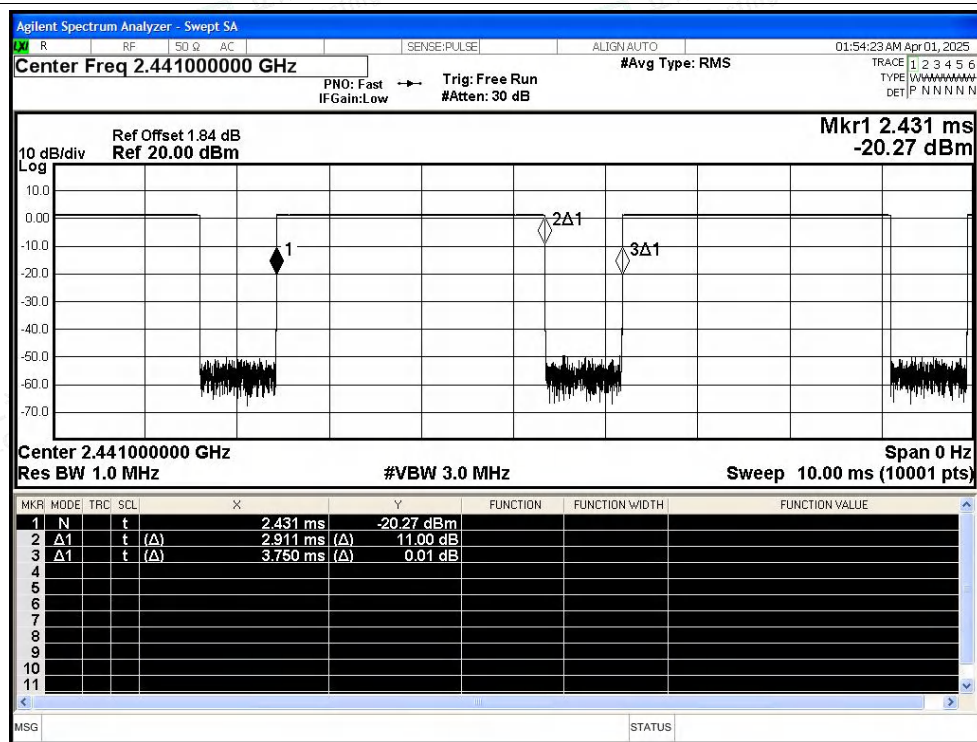

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 1-DH5 2480MHz Ant1

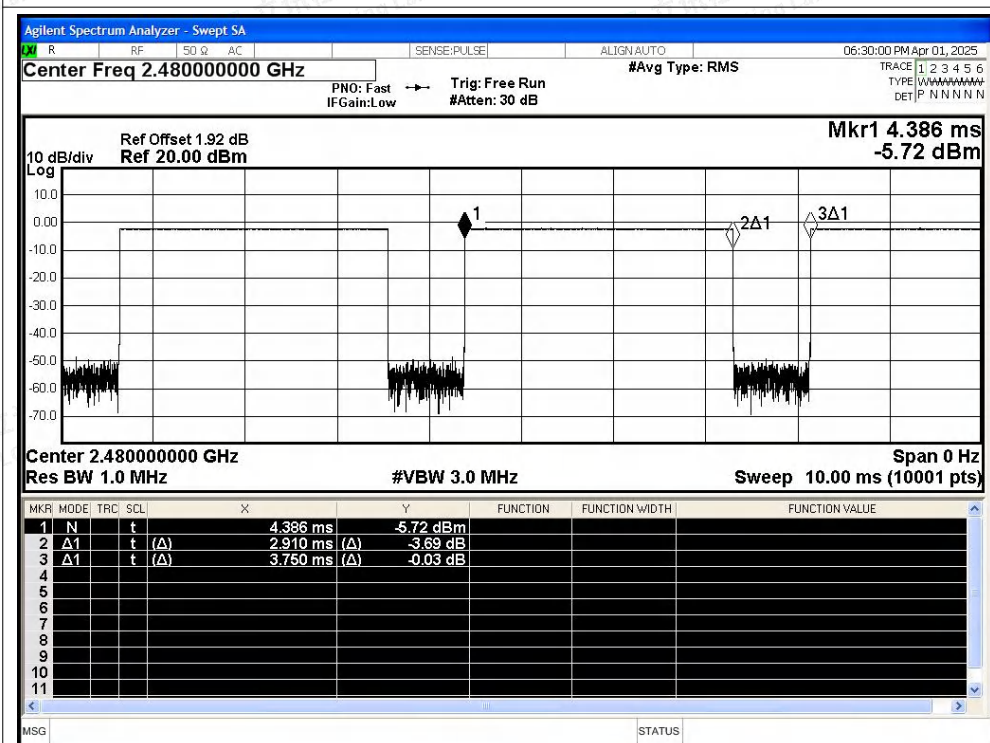

Duty Cycle NVNT 2-DH5 2402MHz Ant1

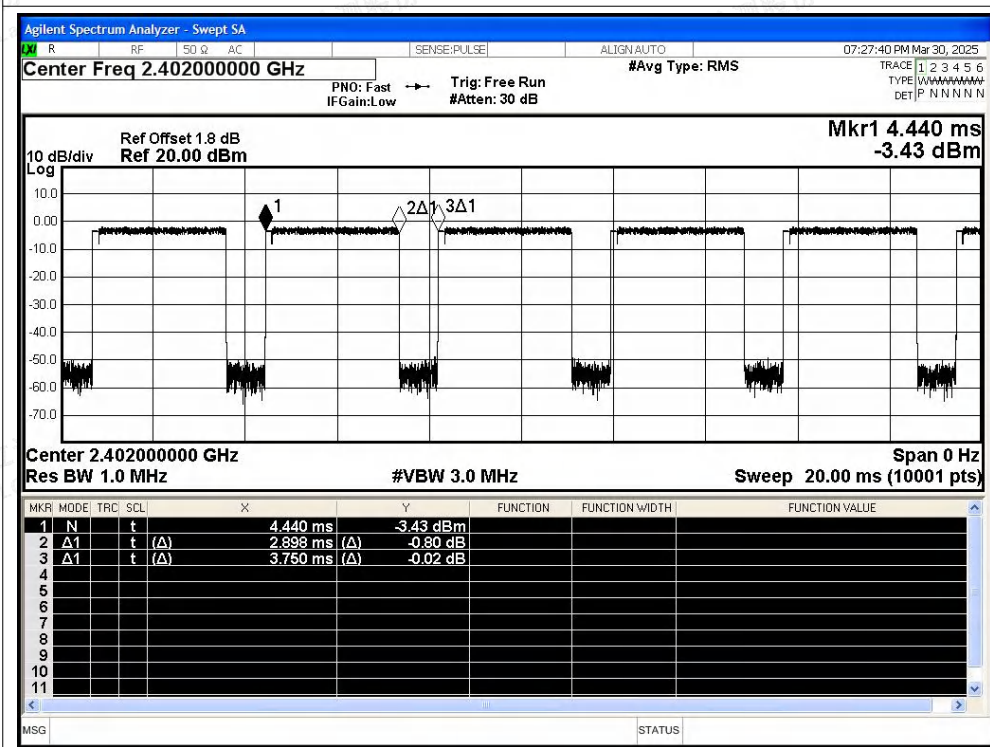

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 2-DH5 2441MHz Ant1

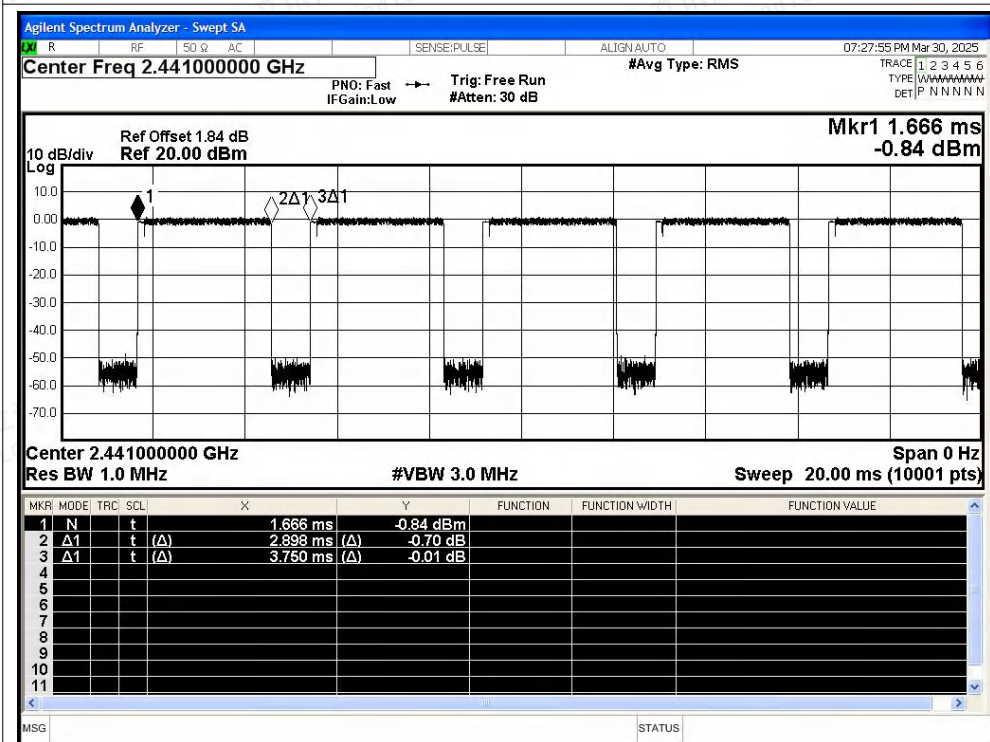

Duty Cycle NVNT 2-DH5 2480MHz Ant1

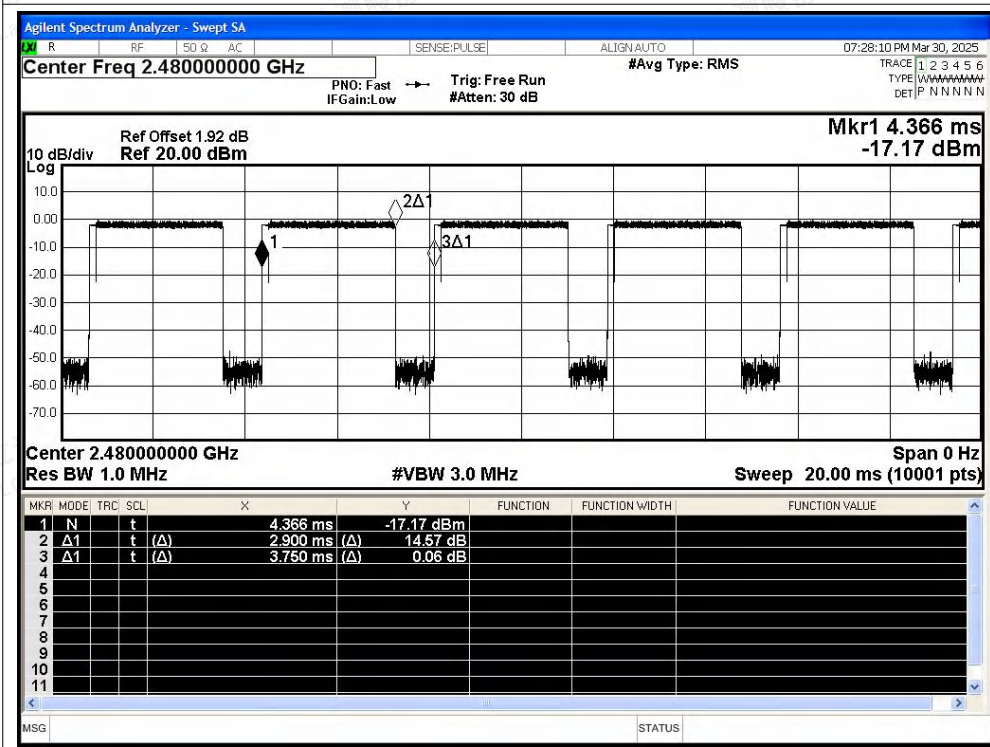

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 3-DH5 2402MHz Ant1

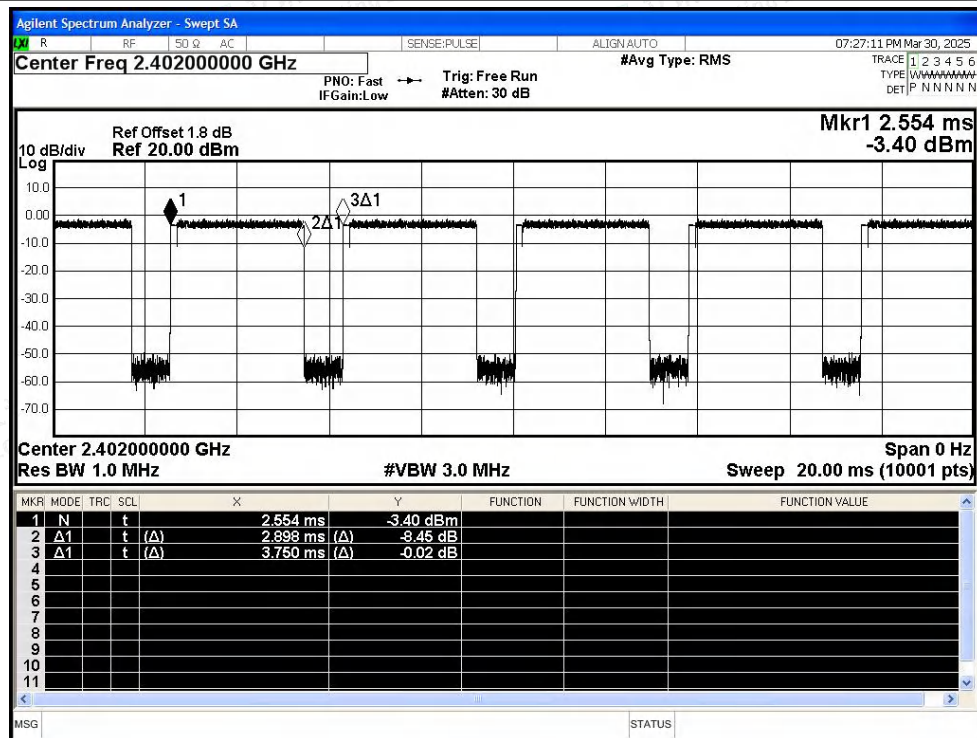

Duty Cycle NVNT 3-DH5 2441MHz Ant1

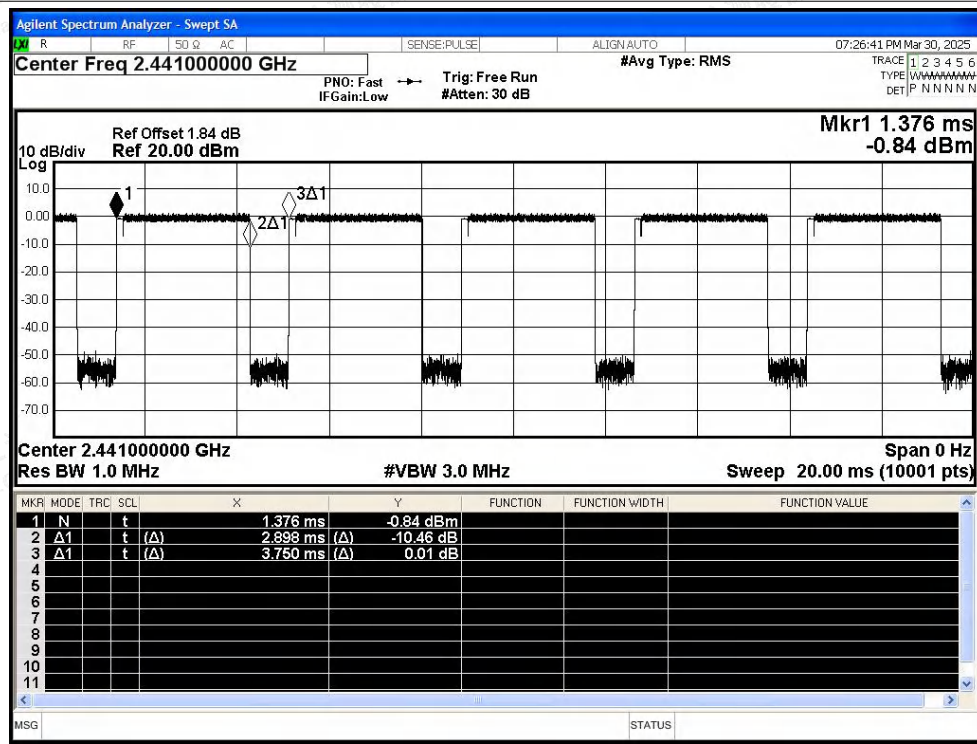


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

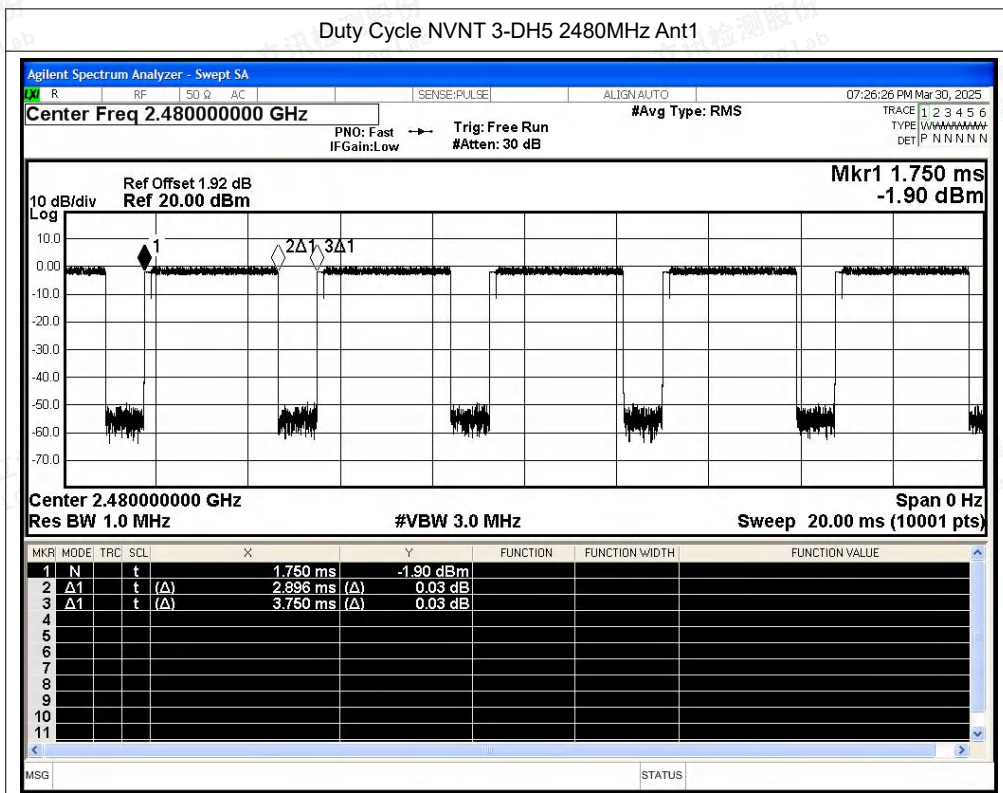

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.9 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-50.93	2	-	46.33	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-59.06	2	1.1	39.3	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2352.624	-48.2	2	-	49.06	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2387.568	-57.89	2	1.1	40.47	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-50.31	2	-	46.95	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-58.34	2	1.1	40.02	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-50.49	2	-	46.77	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-58.35	2	1.1	40.01	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2484.904	-46.28	2	-	50.98	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.632	-57.49	2	1.1	40.87	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-49.56	2	-	47.7	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-58.91	2	1.1	39.45	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-51.88	2	-	45.38	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-58.71	2	0	38.55	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2328.432	-47.97	2	-	49.29	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2382.96	-57.92	2	0	39.34	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-50.88	2	-	46.38	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-58.65	2	0	38.61	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-48.84	2	-	48.42	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-57.58	2	0	39.68	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2491	-47.05	2	-	50.21	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.704	-57.22	2	0	40.04	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-49.77	2	-	47.49	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-58.24	2	0	39.02	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-50.97	2	-	46.29	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-59.2	2	0	38.06	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2328.24	-47.21	2	-	50.05	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2385.84	-57.71	2	0	39.55	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-51.24	2	-	46.02	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-58.63	2	0	38.63	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-49.39	2	-	47.87	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-57.22	2	0	40.04	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2484.376	-46.32	2	-	50.94	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.512	-57.22	2	0	40.04	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-48.6	2	-	48.66	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-58.1	2	0	39.16	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Peak

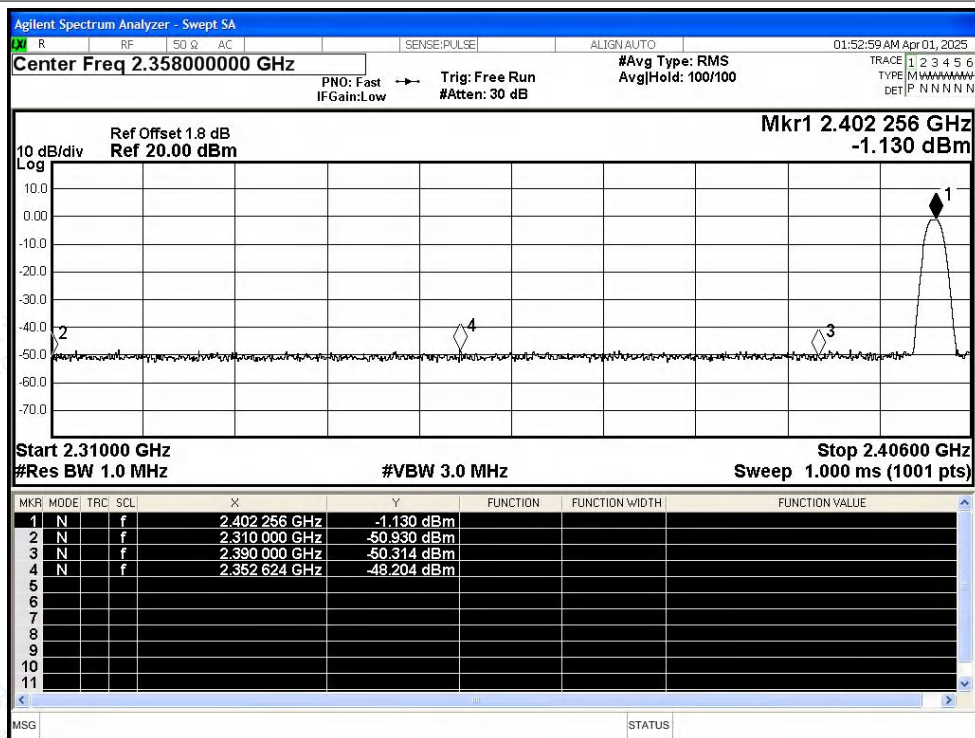

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Average

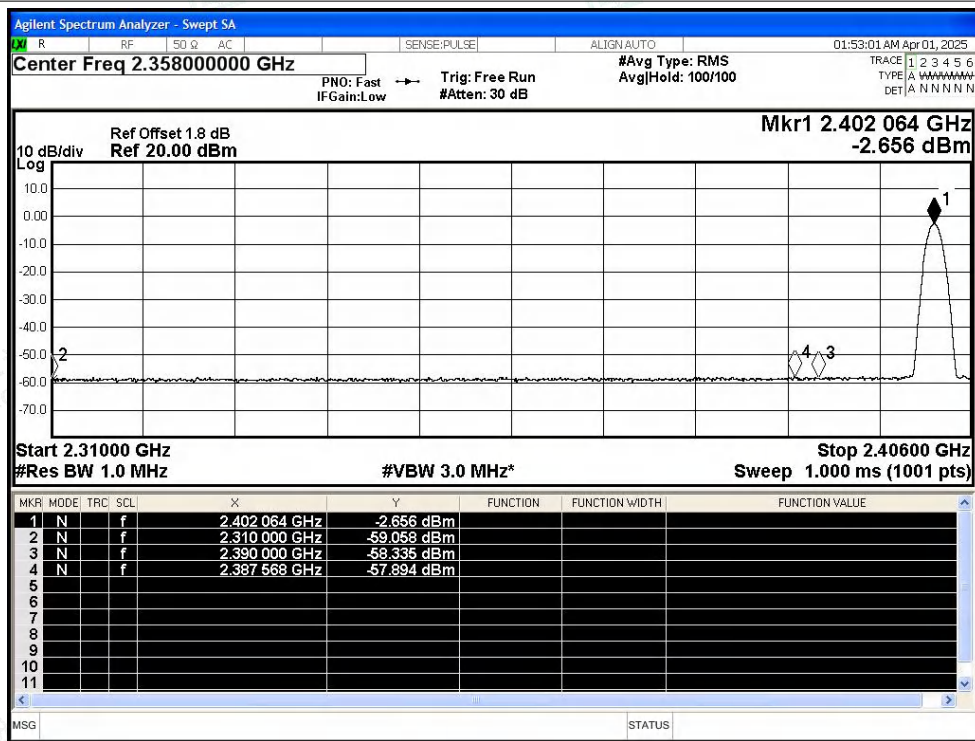

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Peak

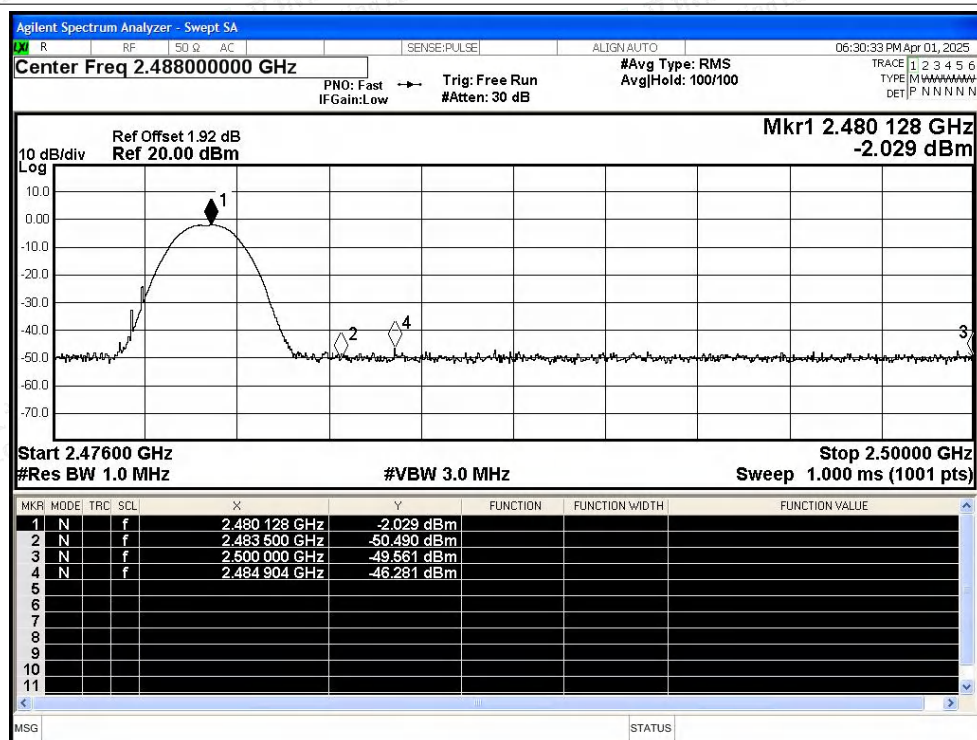

Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Average

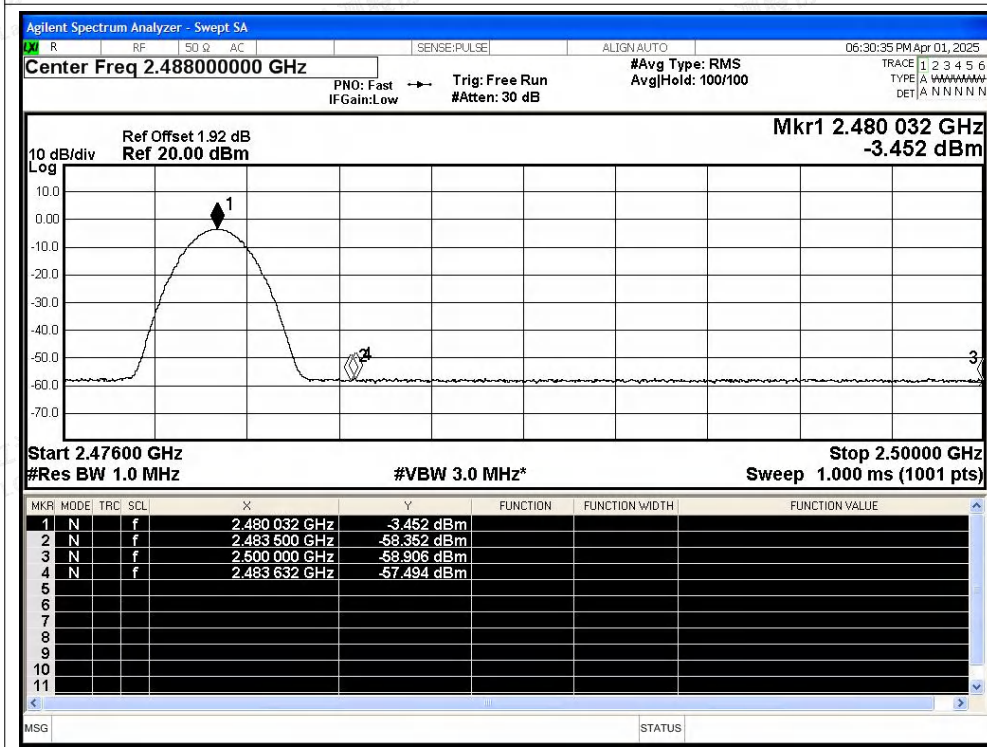

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Peak

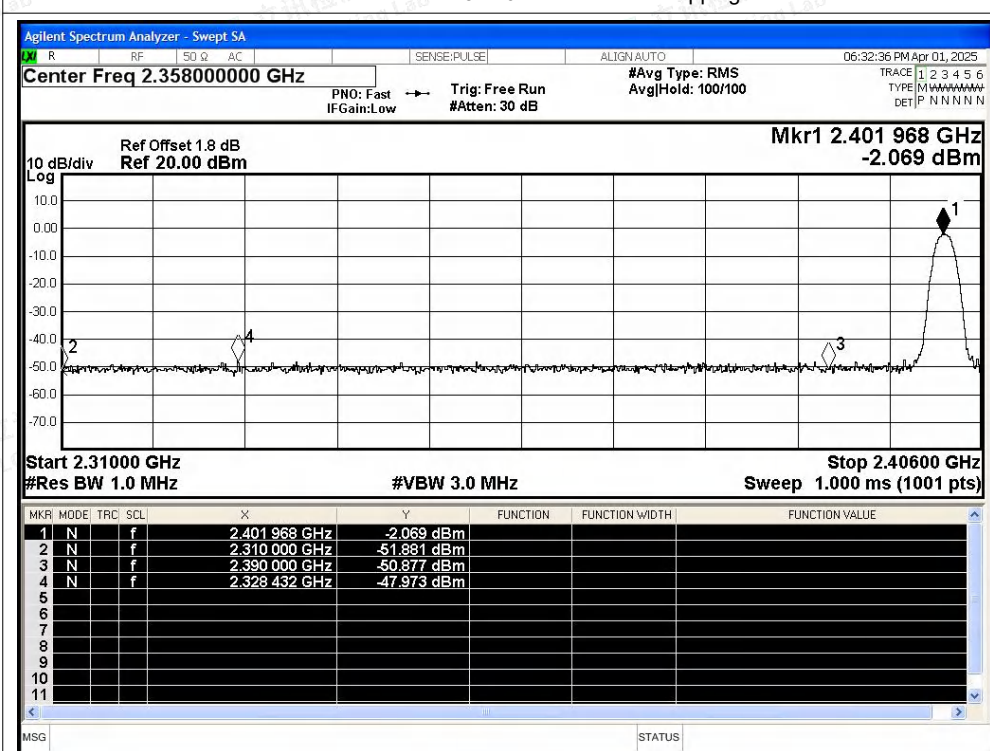

Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Average

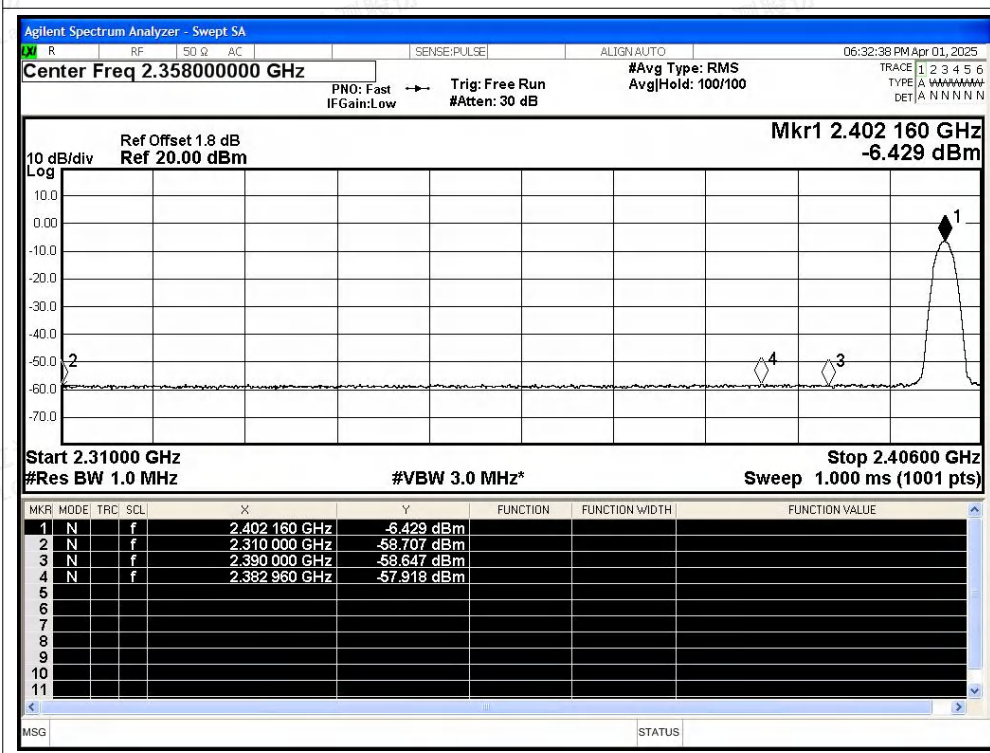

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Peak

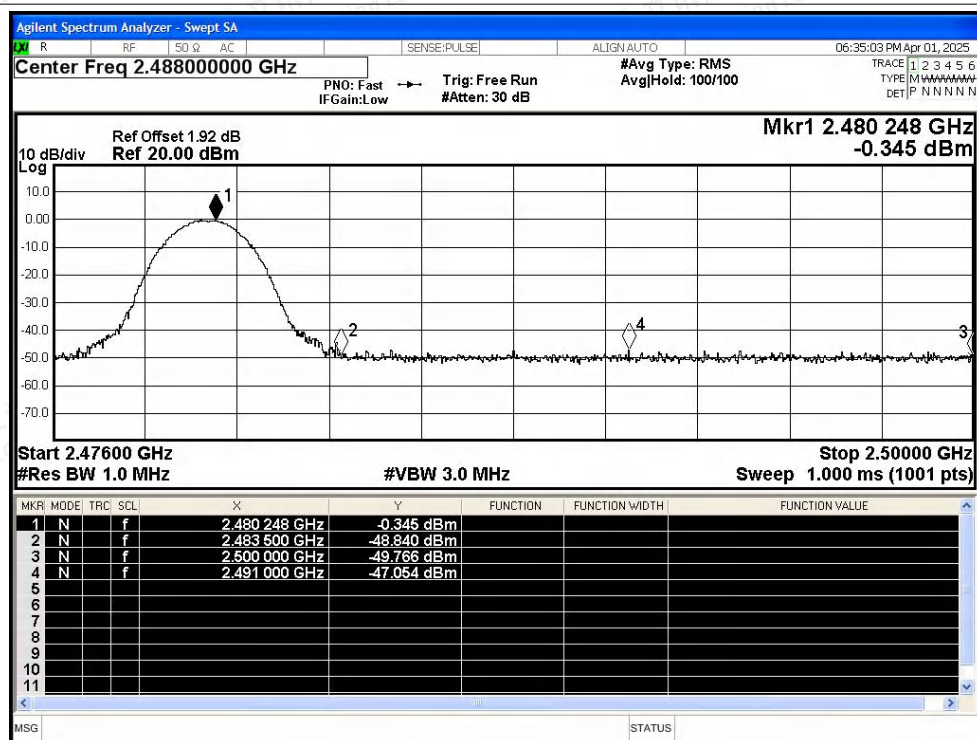

Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Average

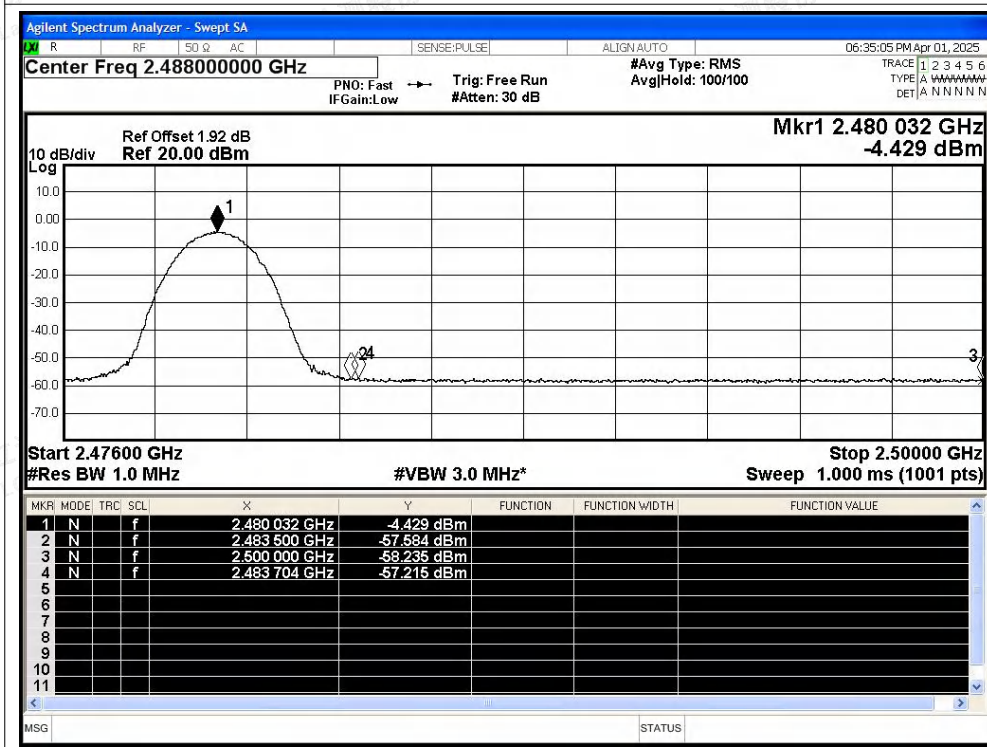

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Peak

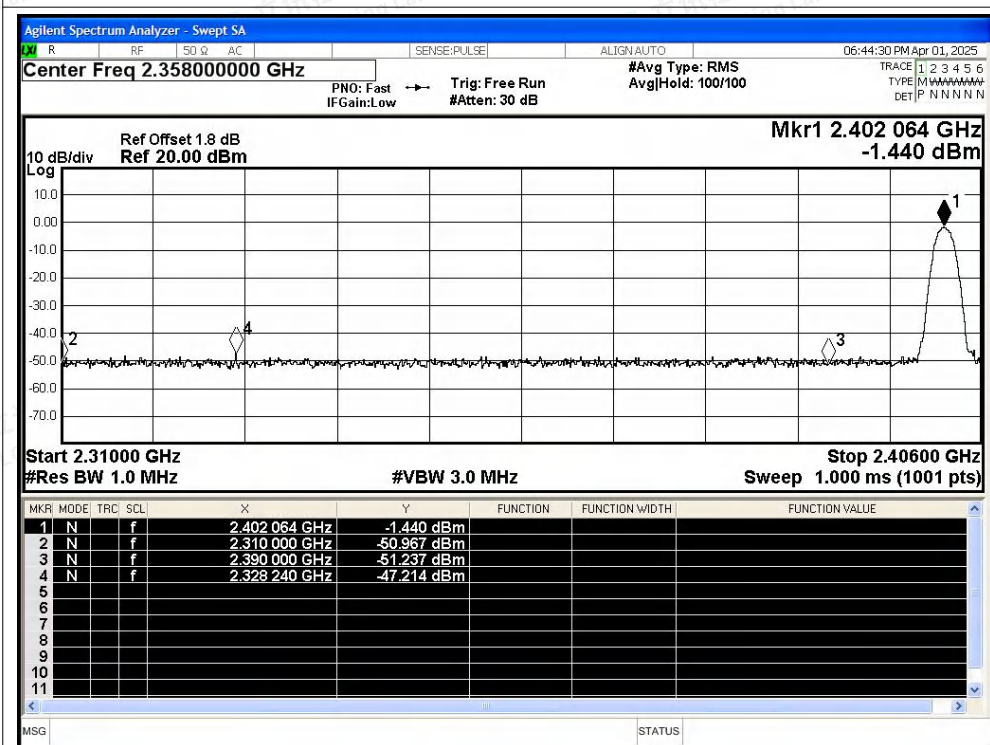

Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Average

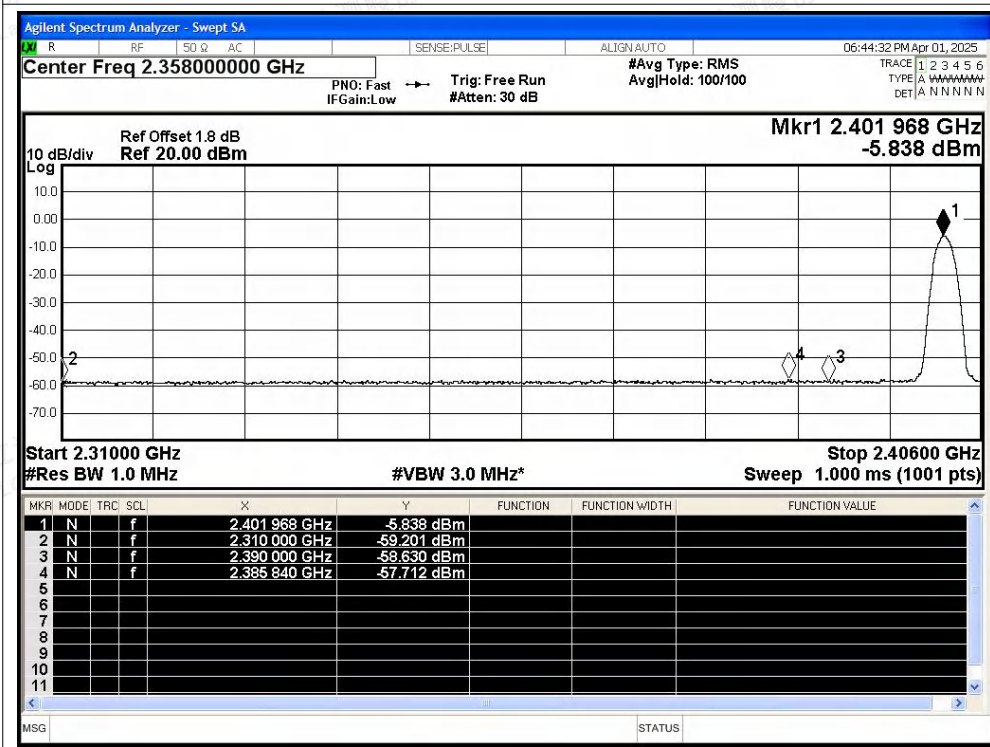

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Peak

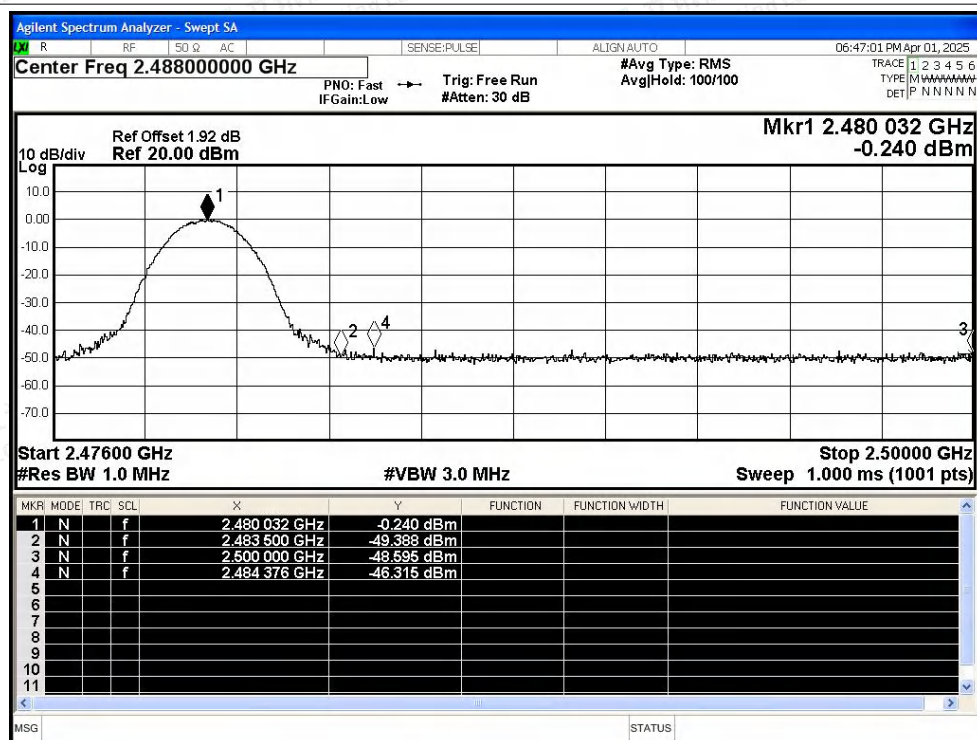

Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Average

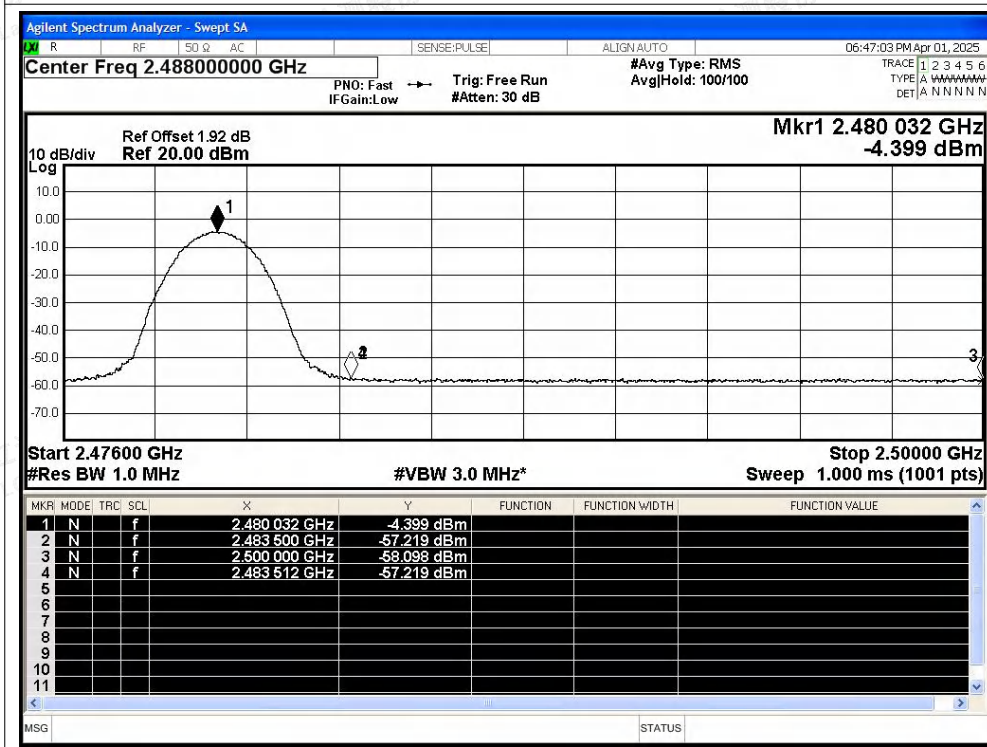

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity