


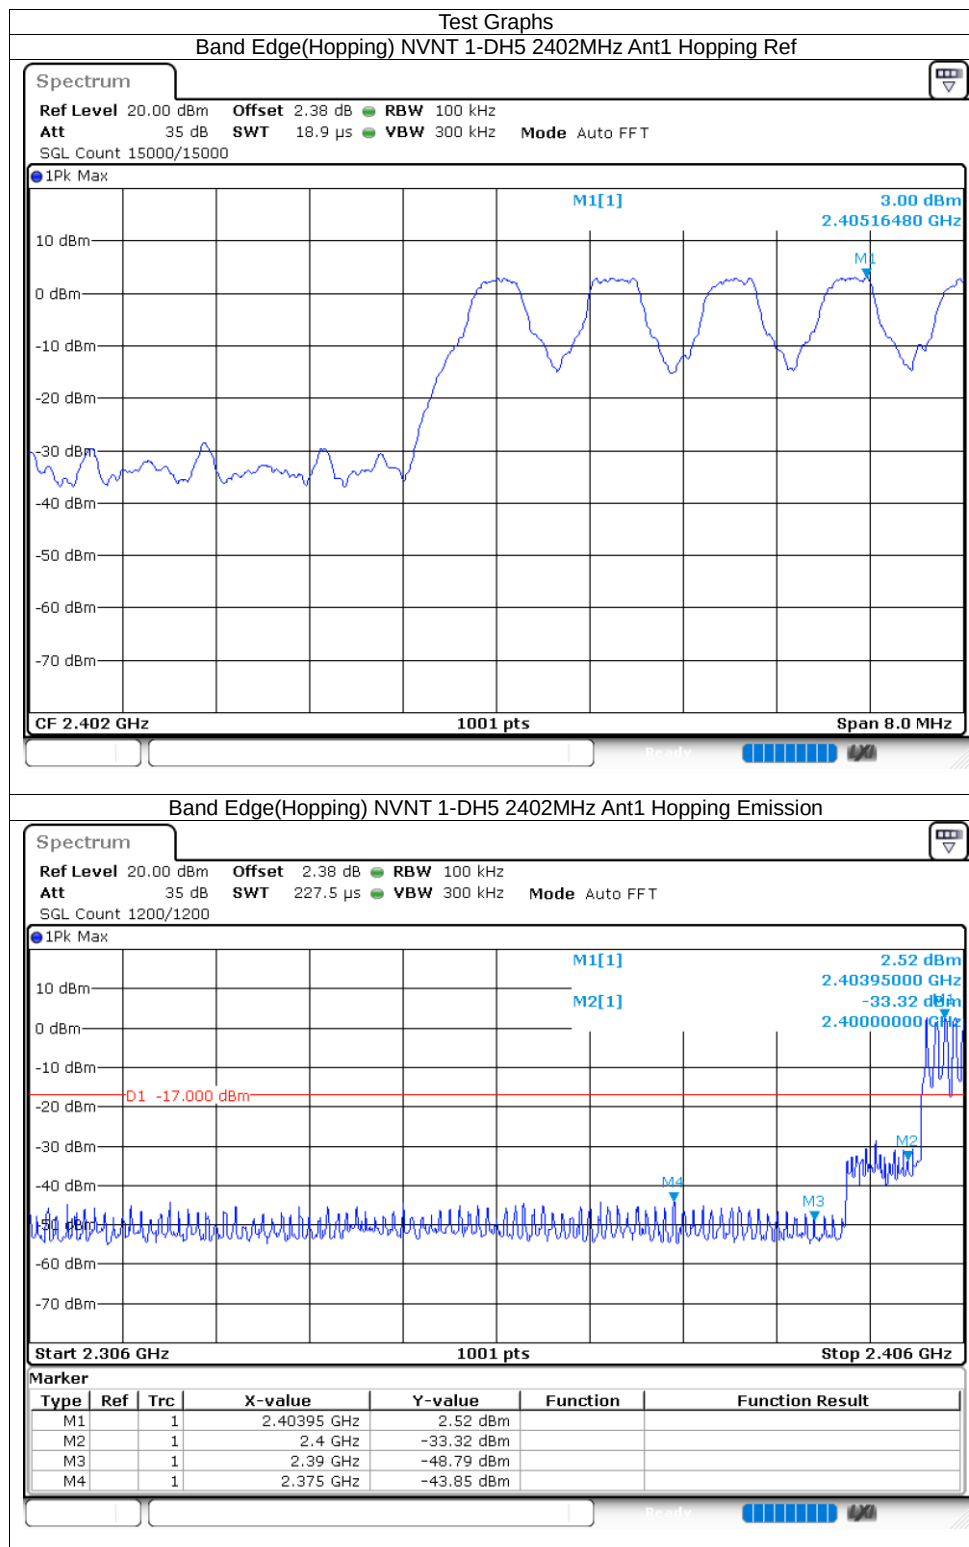
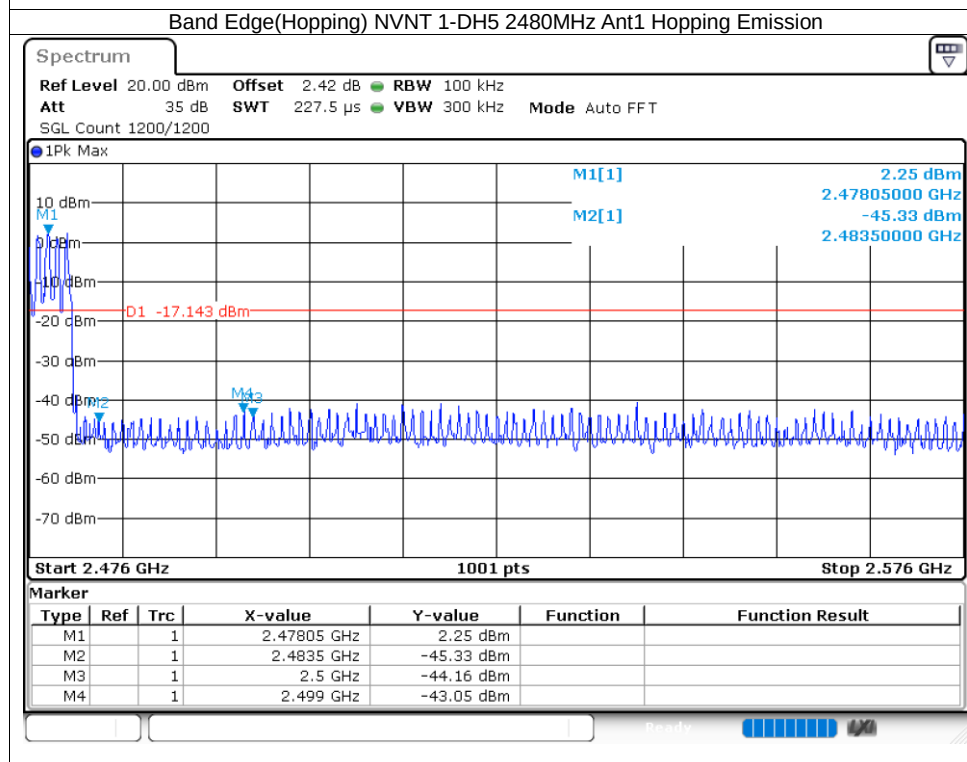




8.7 Band Edge(Hopping)



Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	1-DH5	2402	Ant1	Hopping	-46.85	-20	Pass
NVNT	1-DH5	2480	Ant1	Hopping	-45.9	-20	Pass
NVNT	2-DH5	2402	Ant1	Hopping	-48.88	-20	Pass
NVNT	2-DH5	2480	Ant1	Hopping	-45.24	-20	Pass
NVNT	3-DH5	2402	Ant1	Hopping	-48.41	-20	Pass
NVNT	3-DH5	2480	Ant1	Hopping	-44.11	-20	Pass


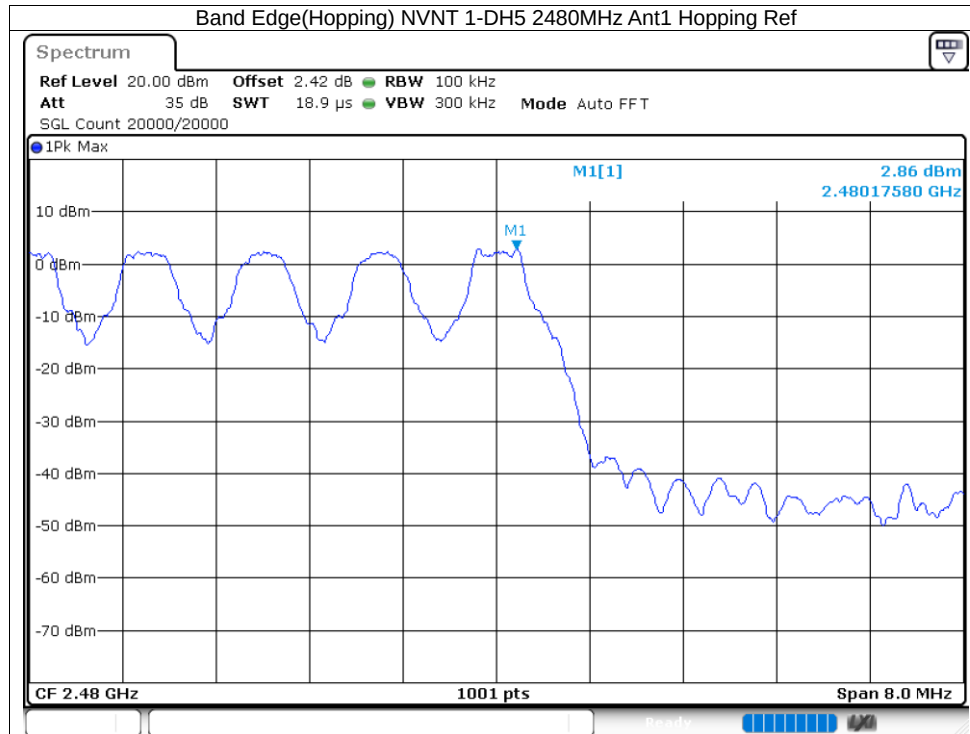


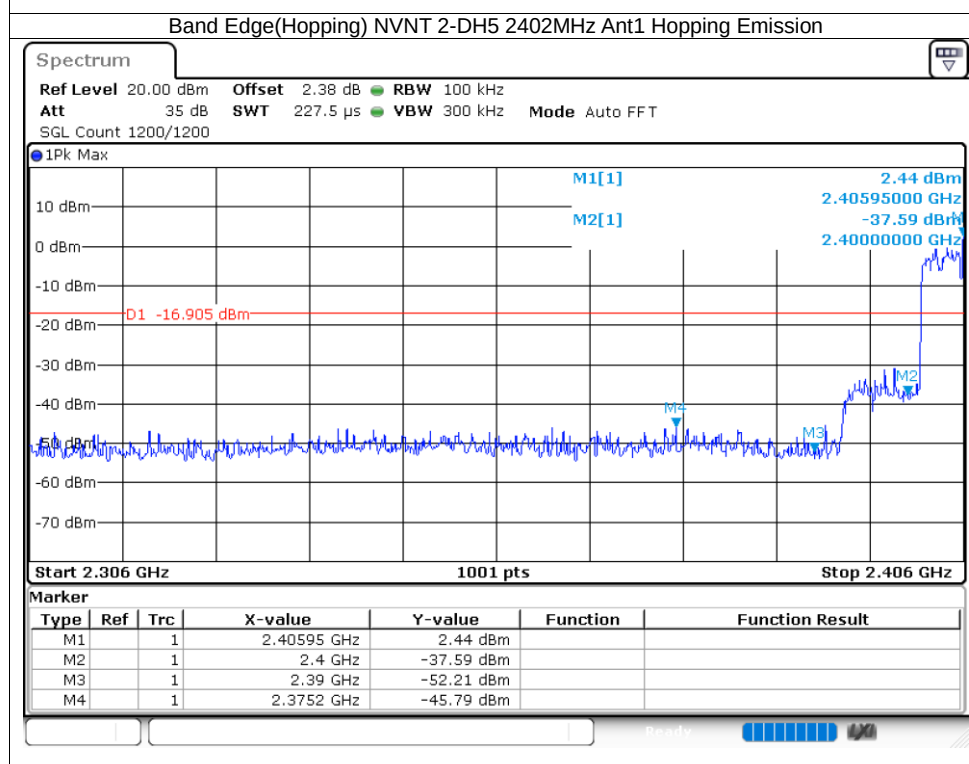

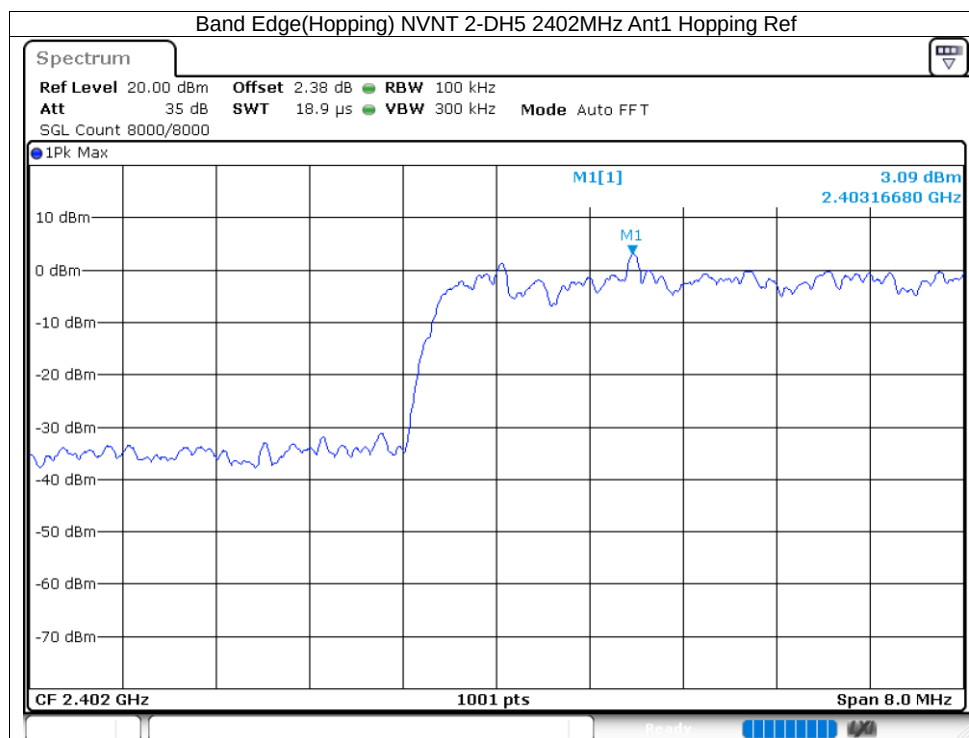

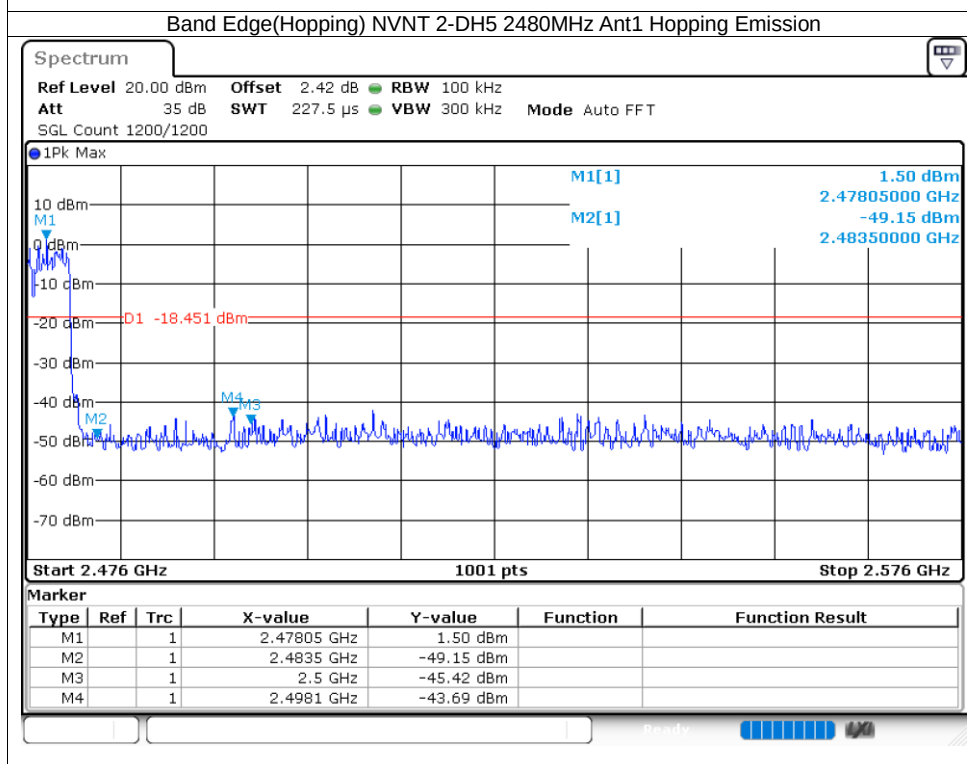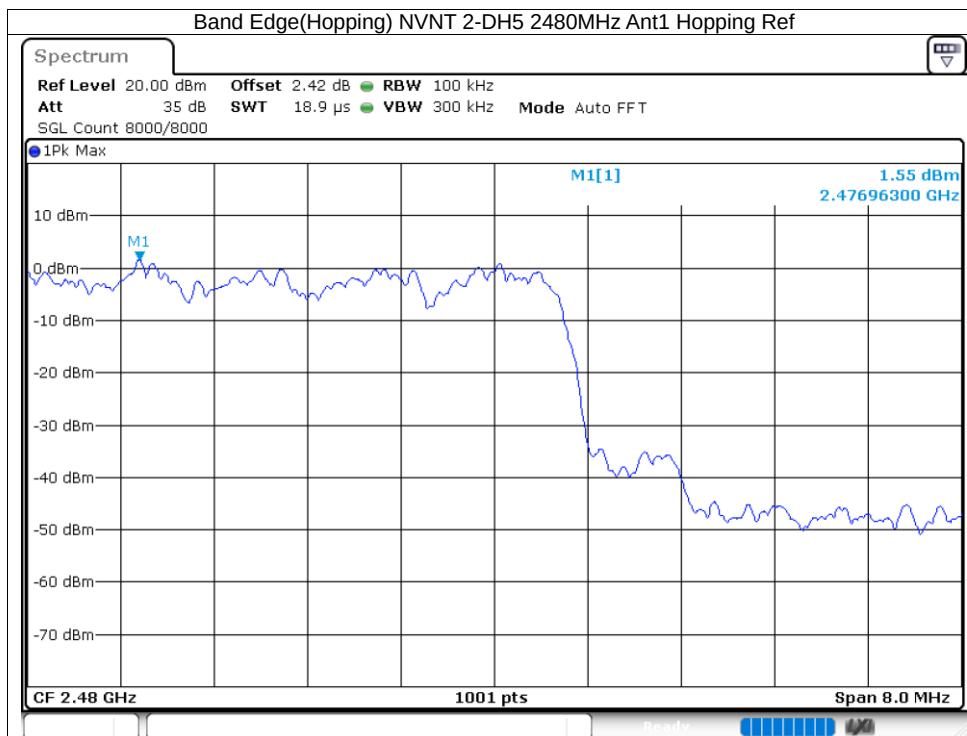


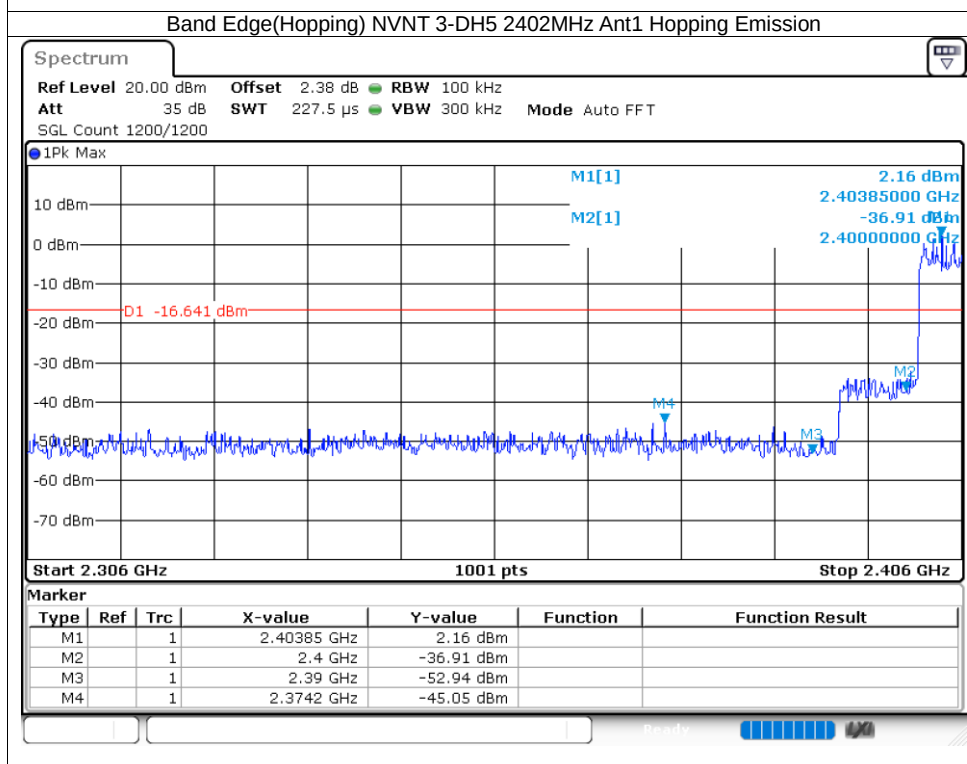
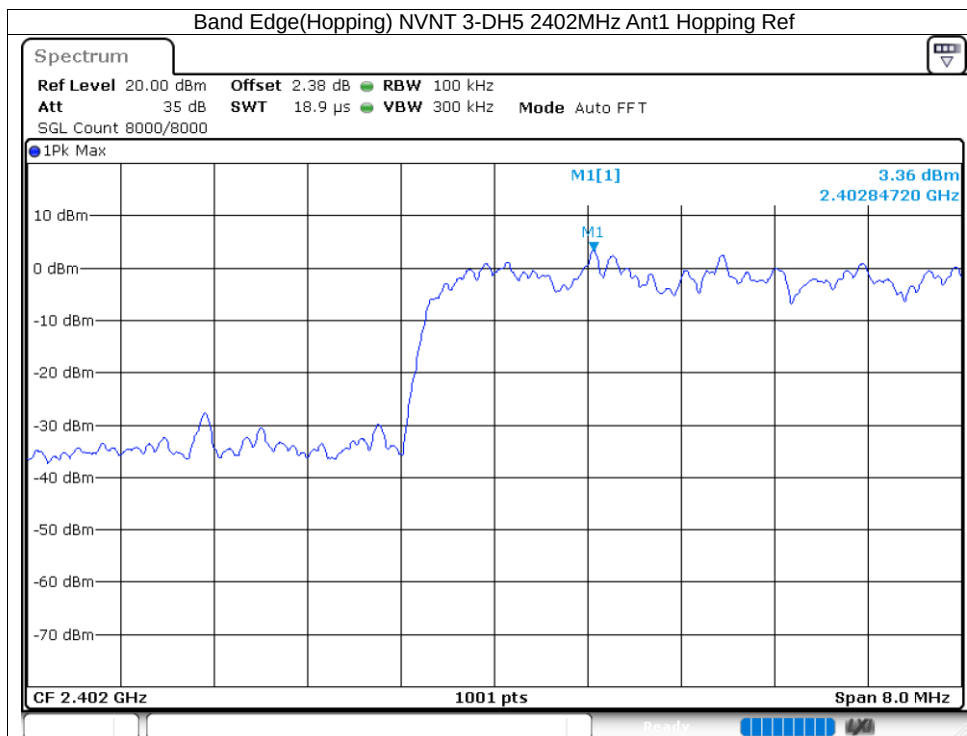


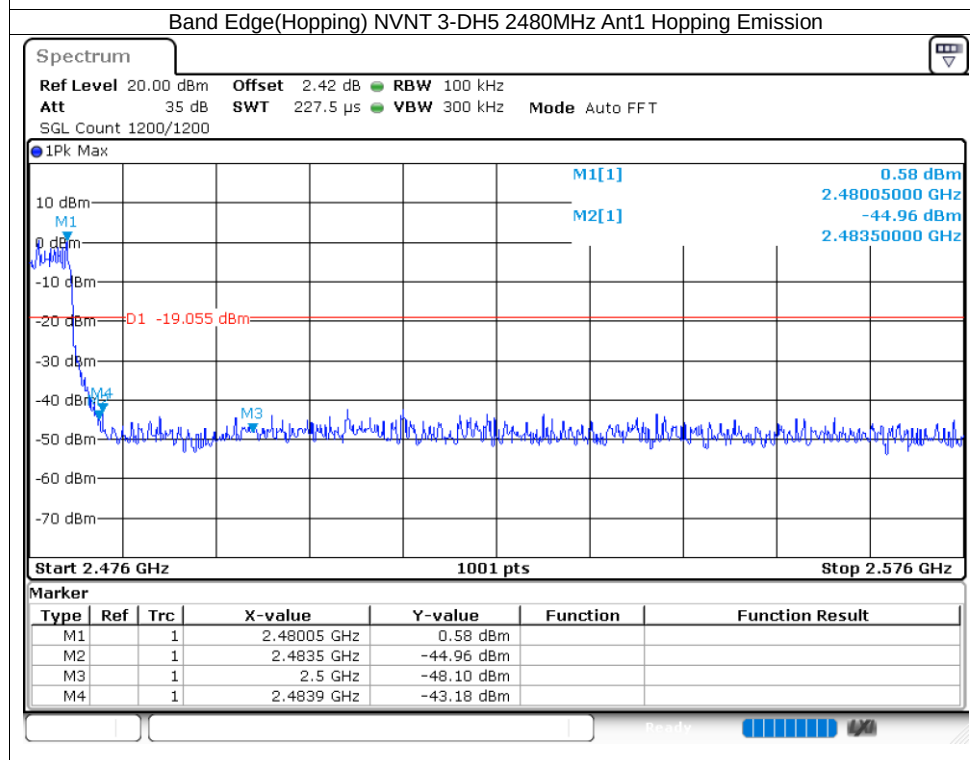
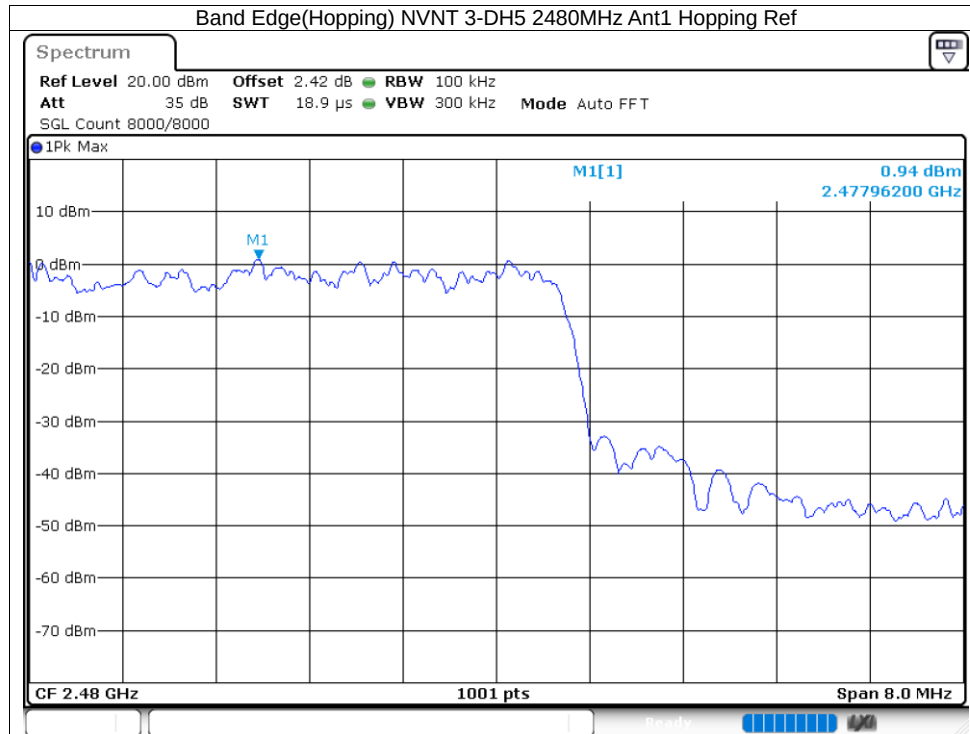




8.8 Conducted RF Spurious Emission



Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	1-DH5	2402	Ant1	-40.36	-20	Pass
NVNT	1-DH5	2441	Ant1	-42.35	-20	Pass
NVNT	1-DH5	2480	Ant1	-38.67	-20	Pass
NVNT	2-DH5	2402	Ant1	-42.16	-20	Pass
NVNT	2-DH5	2441	Ant1	-41.12	-20	Pass
NVNT	2-DH5	2480	Ant1	-41.62	-20	Pass
NVNT	3-DH5	2402	Ant1	-43.76	-20	Pass
NVNT	3-DH5	2441	Ant1	-43.86	-20	Pass
NVNT	3-DH5	2480	Ant1	-41.17	-20	Pass


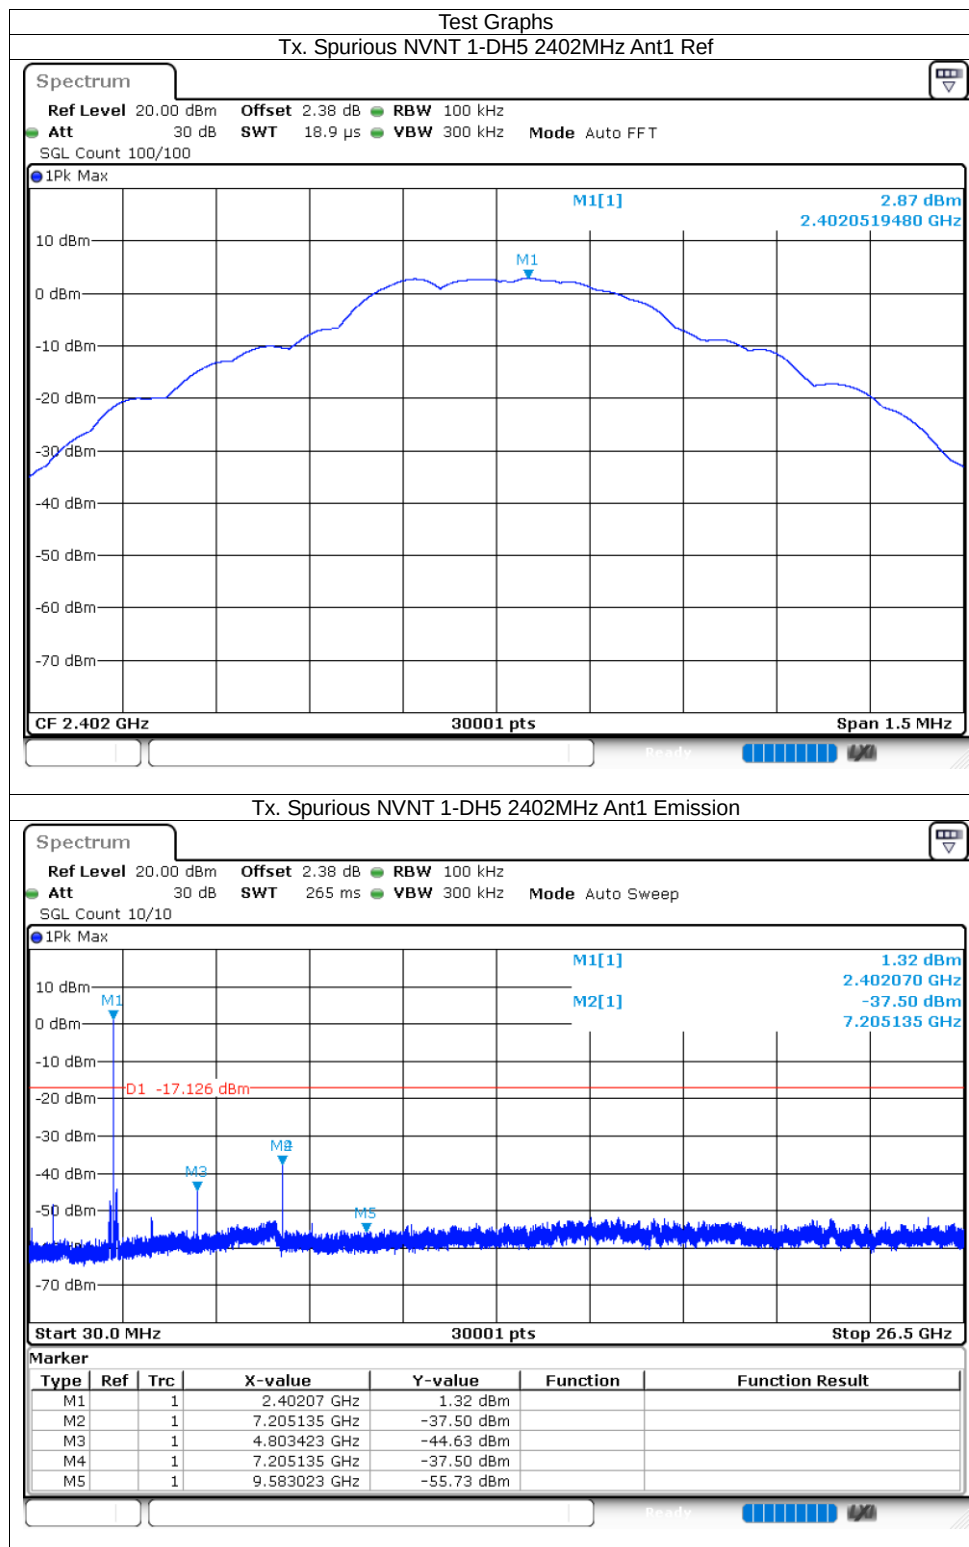


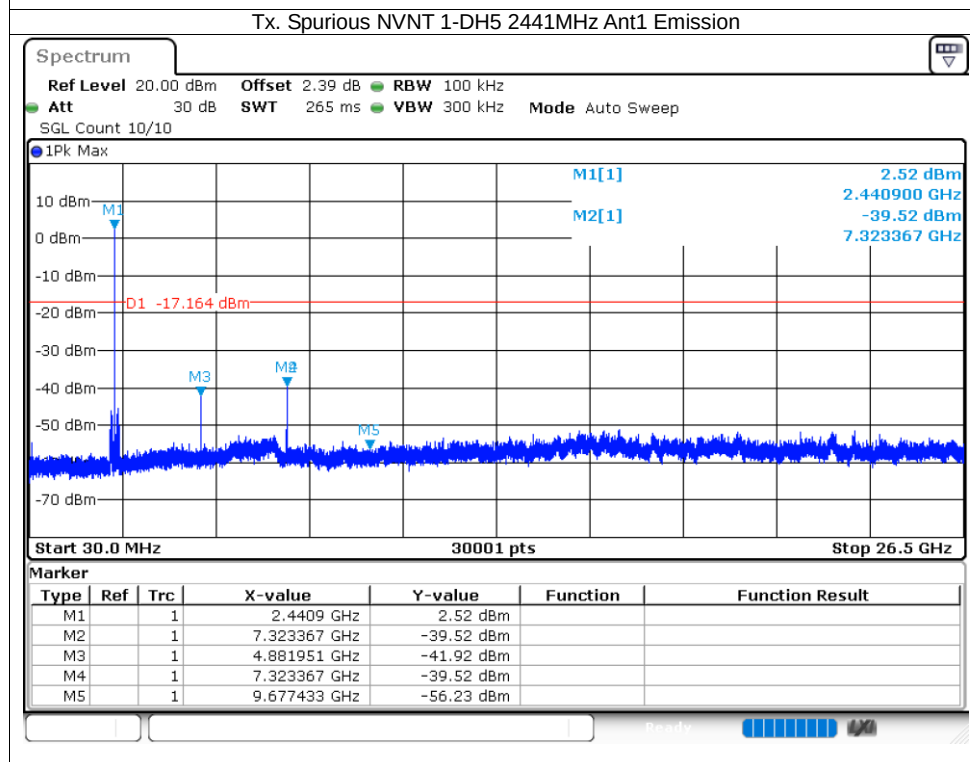
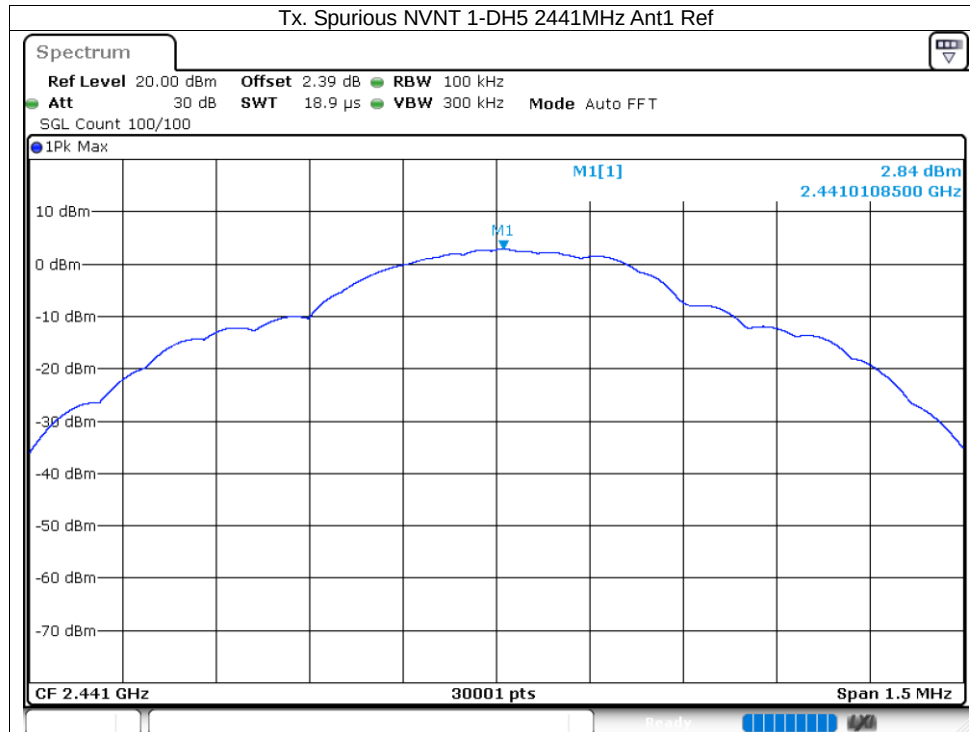


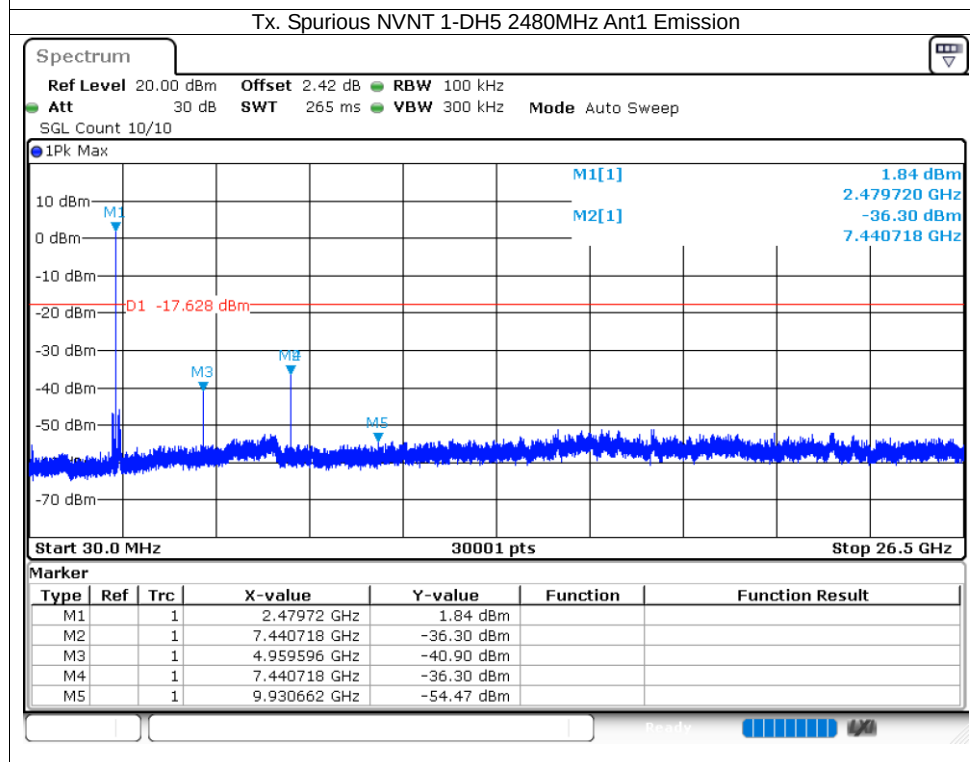
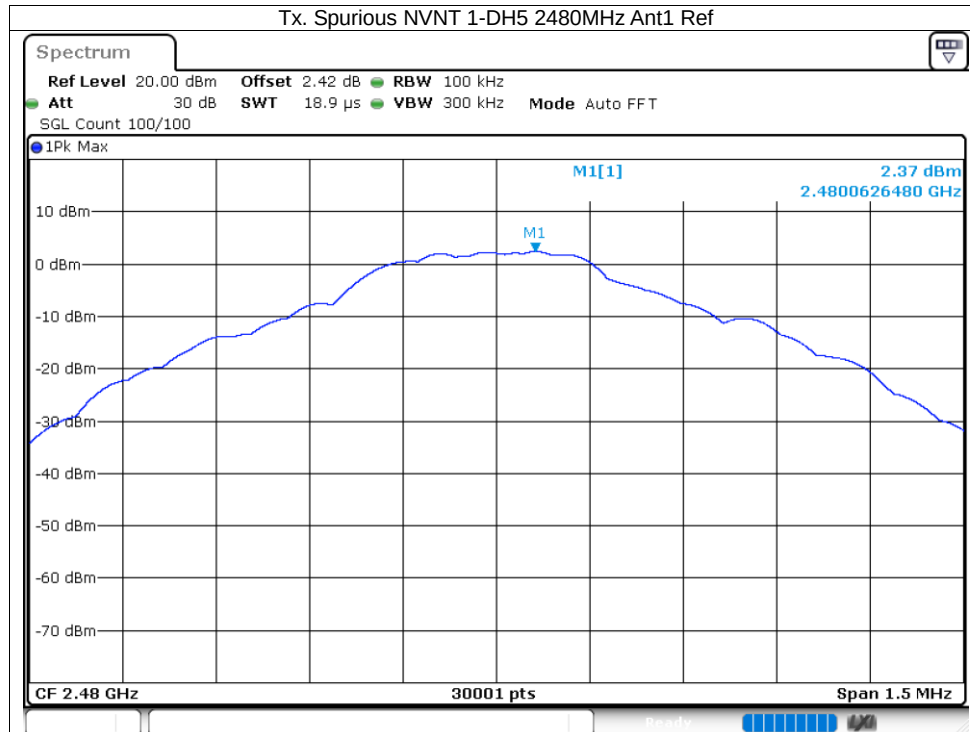


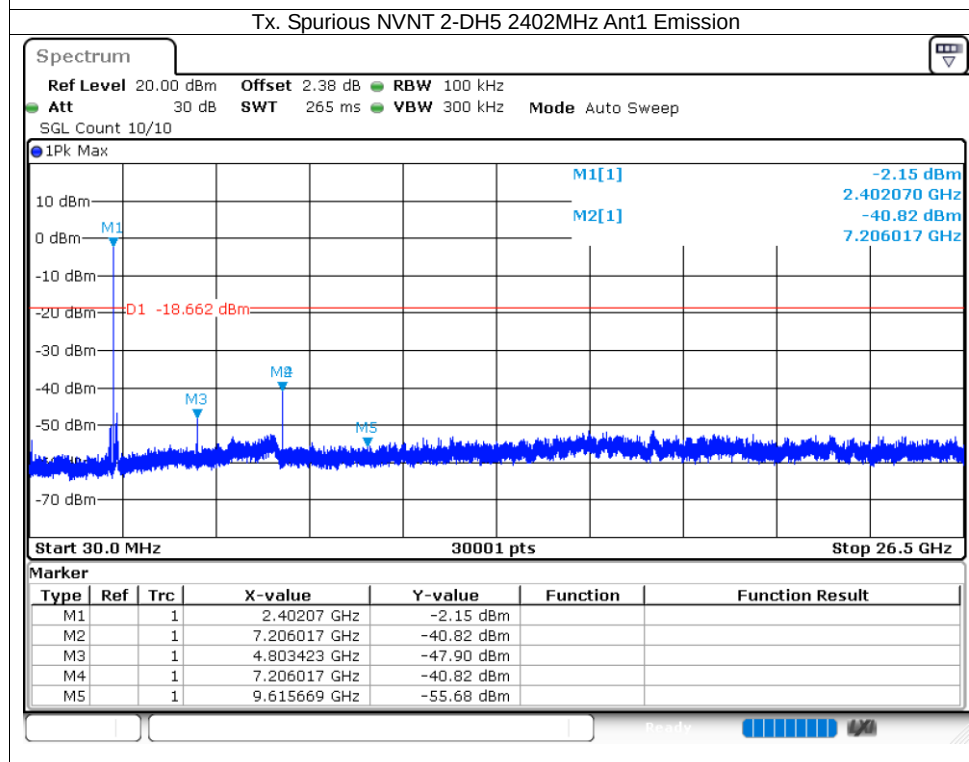
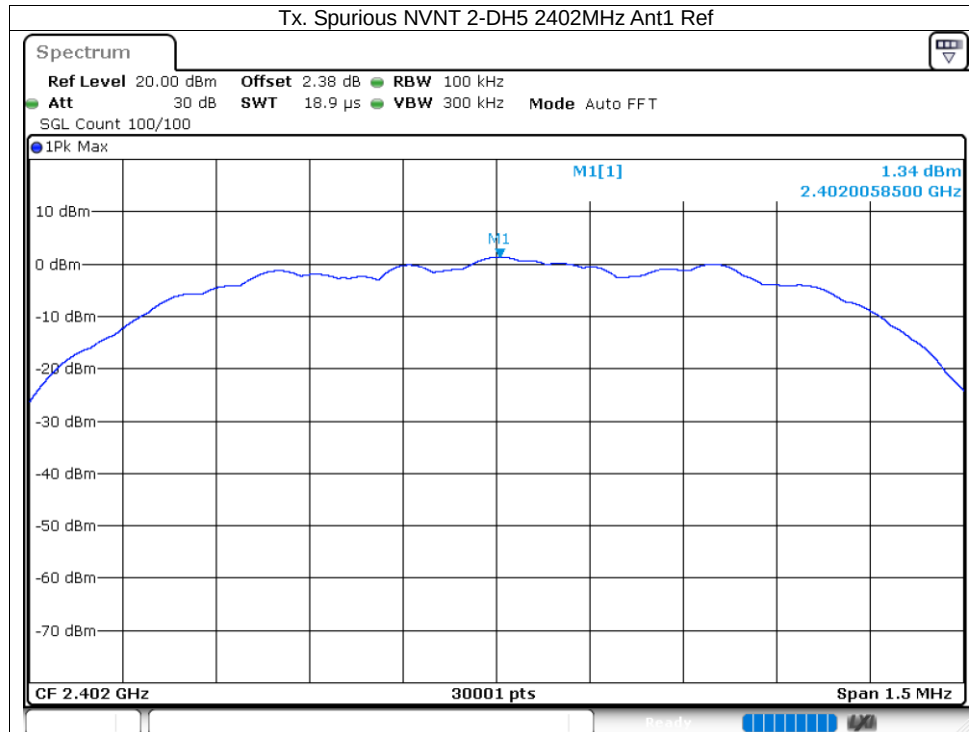


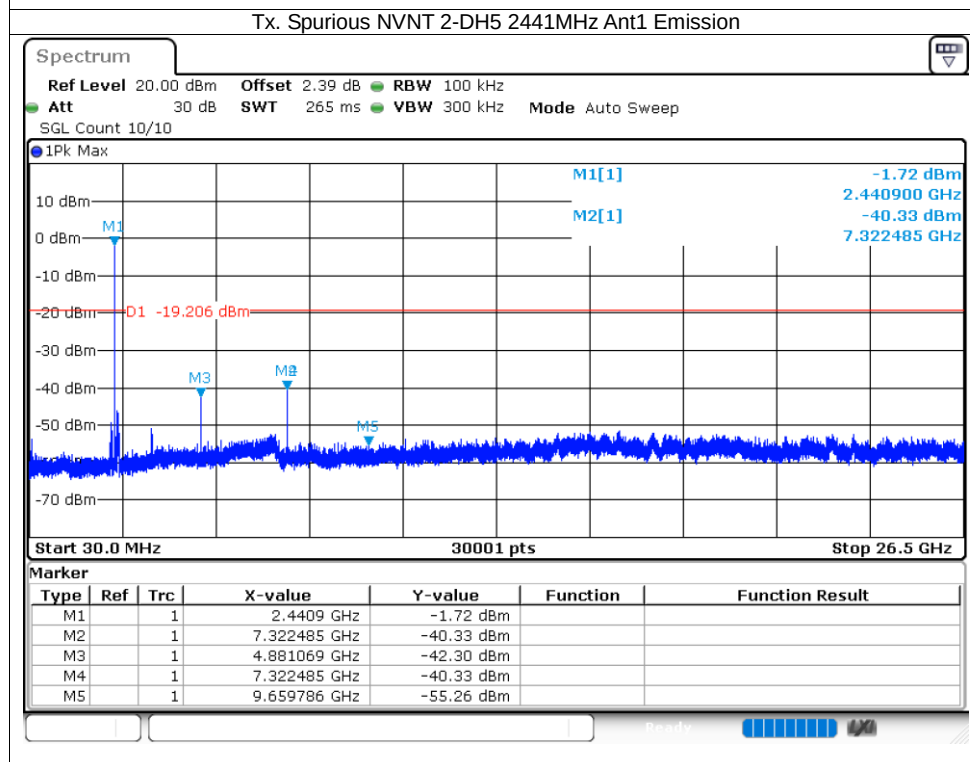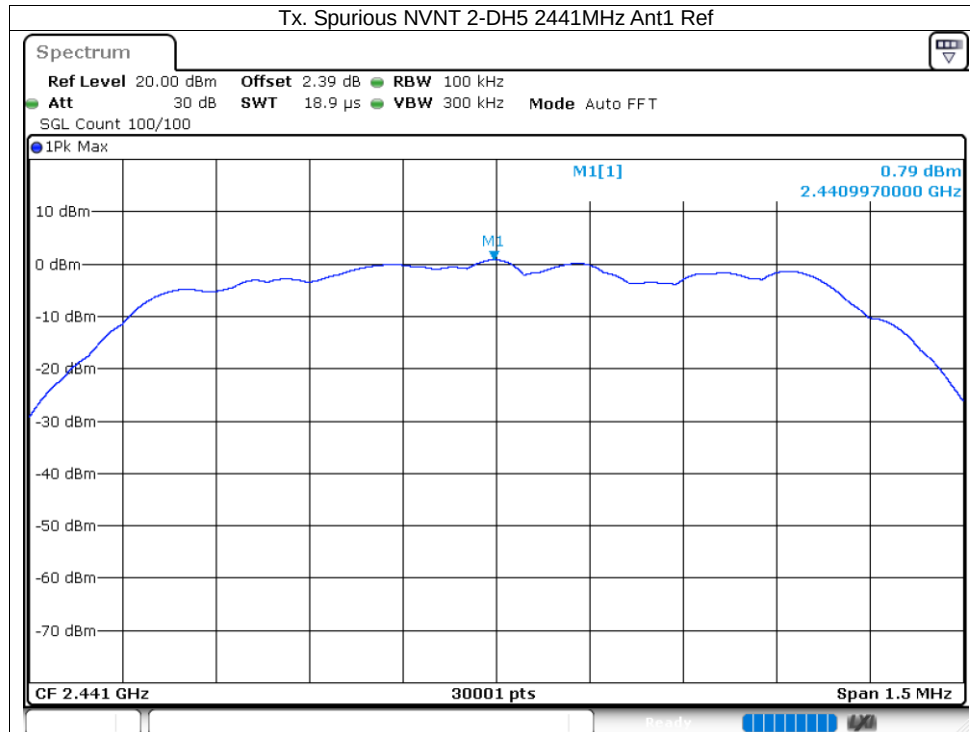

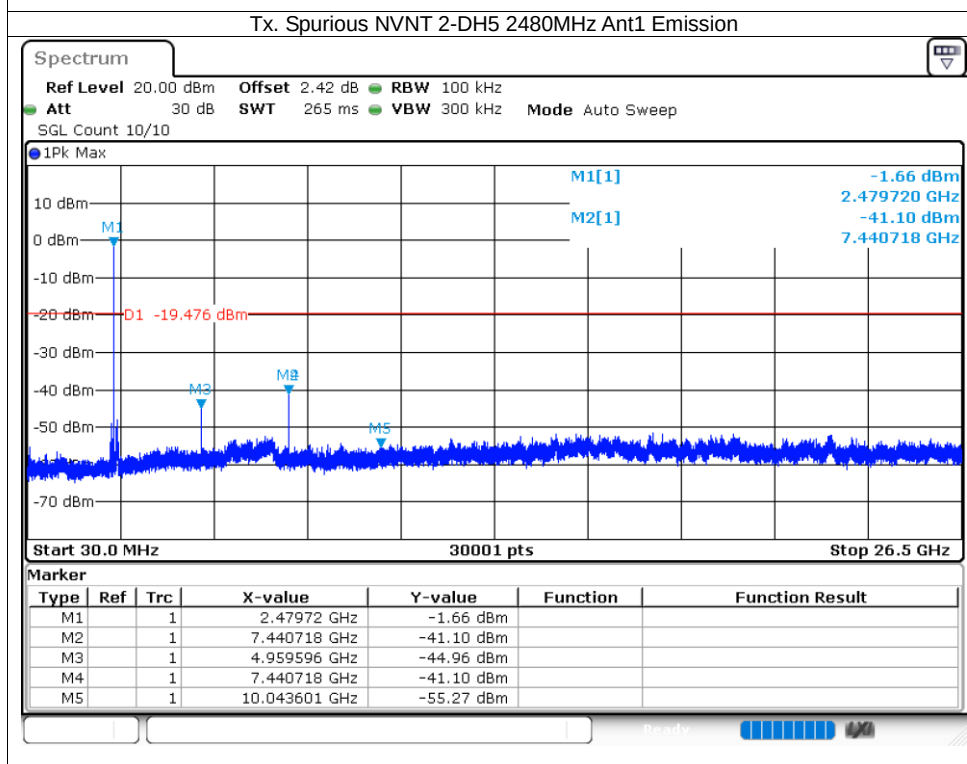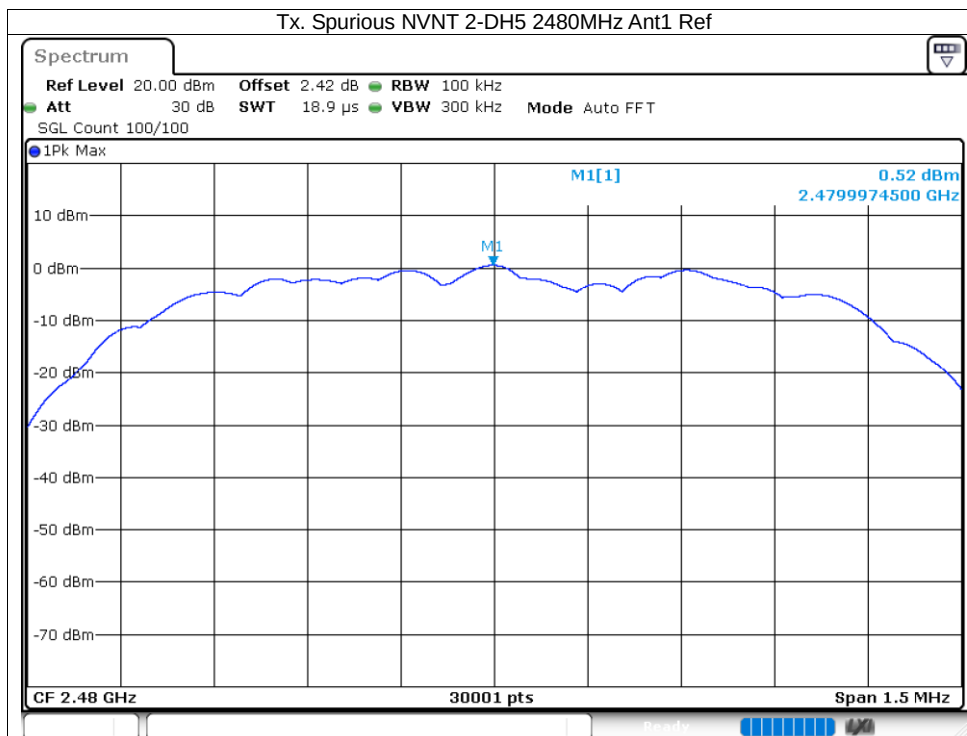

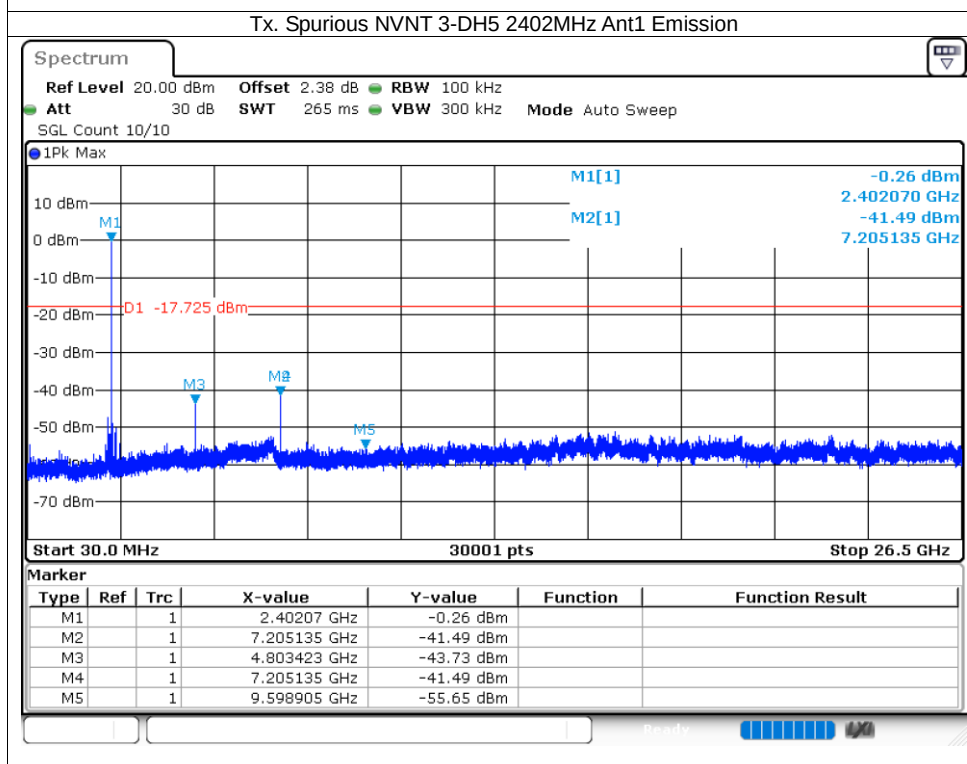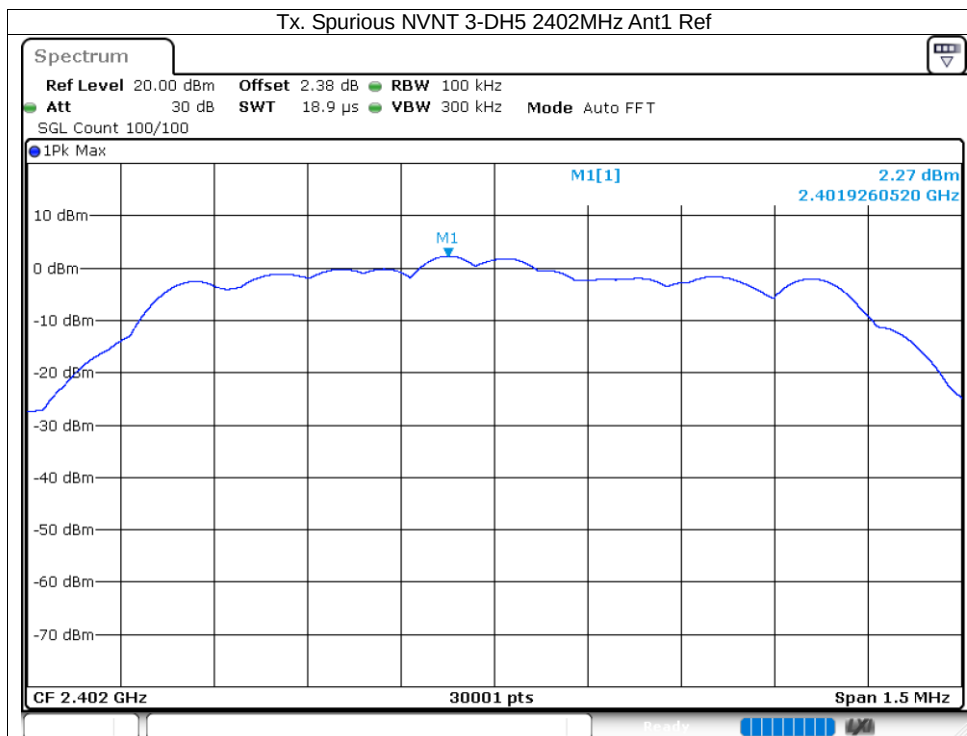

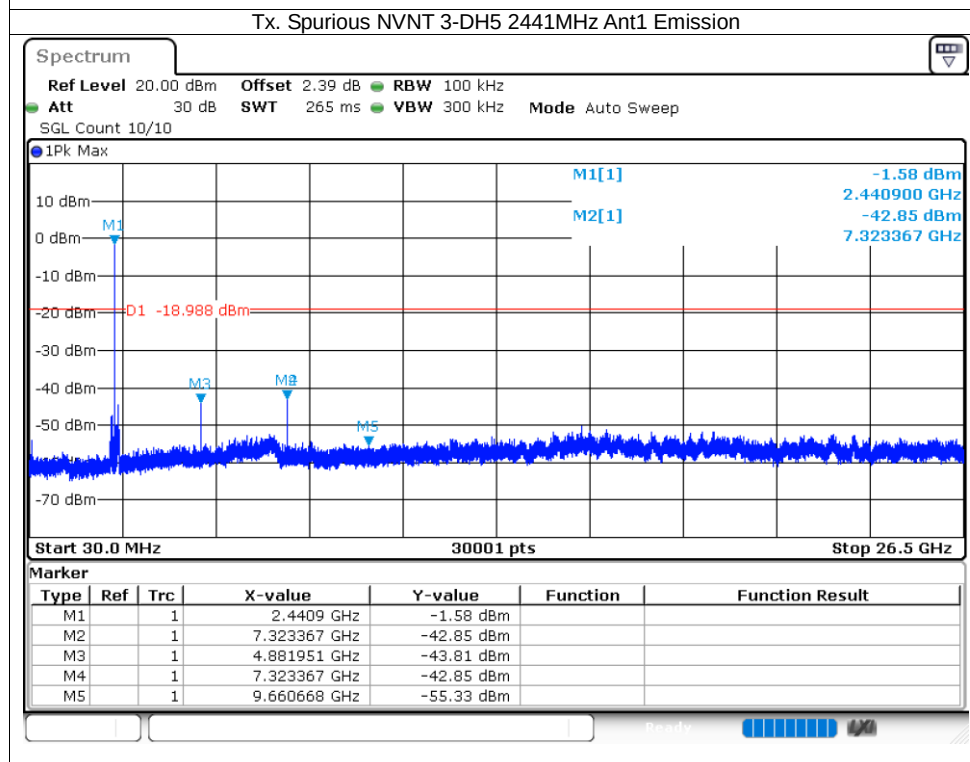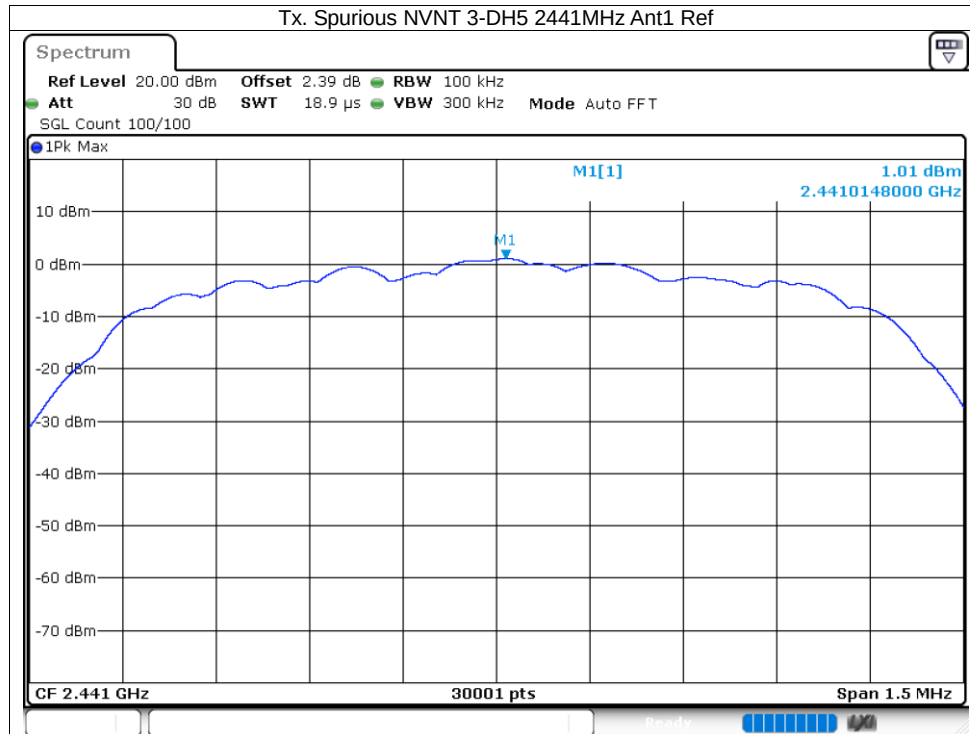

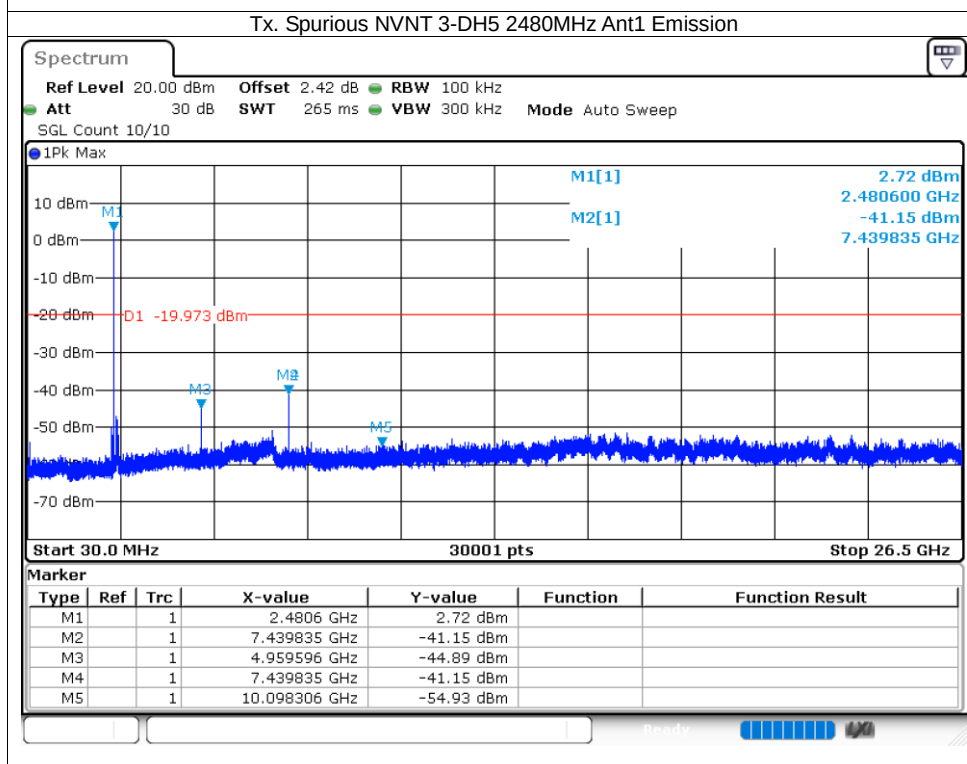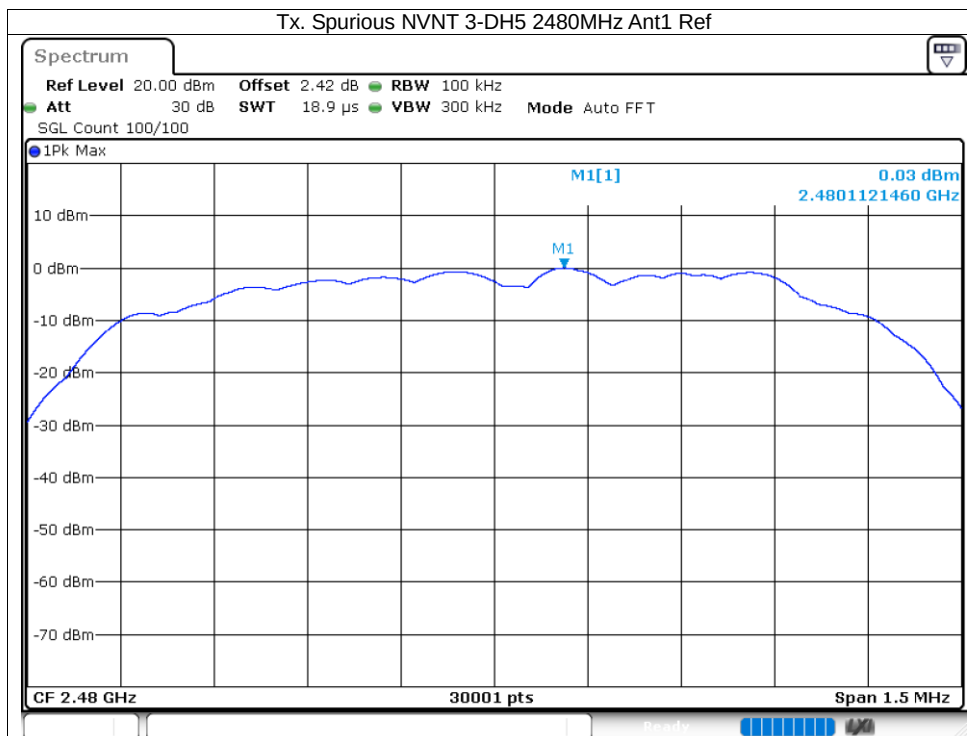

END OF REPORT