



Appendix B: Test Data for E-UTRA Band 41

Product Name: Handheld 3D Laser Scanner brochure

Test Model: RobotSLAM

Environmental Conditions

Temperature:	23.8° C
Relative Humidity:	52.1%
ATM Pressure:	100.0 kPa
Test Engineer:	Paddi Chen
Supervised by:	Nick Peng





C.1 Conducted Output Power Data Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	24.35	PASS
Band41	5MHz	16QAM	39675	1RB#0	23.63	PASS
Band41	5MHz	QPSK	39675	1RB#12	24.53	PASS
Band41	5MHz	16QAM	39675	1RB#12	23.78	PASS
Band41	5MHz	QPSK	39675	1RB#24	24.41	PASS
Band41	5MHz	16QAM	39675	1RB#24	23.72	PASS
Band41	5MHz	QPSK	39675	12RB#0	23.46	PASS
Band41	5MHz	16QAM	39675	12RB#0	22.40	PASS
Band41	5MHz	QPSK	39675	12RB#6	23.46	PASS
Band41	5MHz	16QAM	39675	12RB#6	22.41	PASS
Band41	5MHz	QPSK	39675	12RB#13	23.50	PASS
Band41	5MHz	16QAM	39675	12RB#13	22.44	PASS
Band41	5MHz	QPSK	39675	25RB#0	23.50	PASS
Band41	5MHz	16QAM	39675	25RB#0	22.48	PASS
Band41	5MHz	QPSK	40620	1RB#0	24.47	PASS
Band41	5MHz	16QAM	40620	1RB#24	23.73	PASS
Band41	5MHz	QPSK	40620	12RB#0	23.57	PASS
Band41	5MHz	16QAM	40620	12RB#0	22.55	PASS
Band41	5MHz	QPSK	40620	12RB#6	23.57	PASS
Band41	5MHz	16QAM	40620	12RB#6	22.52	PASS
Band41	5MHz	QPSK	40620	12RB#13	23.53	PASS
Band41	5MHz	16QAM	40620	12RB#13	22.51	PASS
Band41	5MHz	16QAM	40620	25RB#0	22.60	PASS
Band41	5MHz	QPSK	41565	1RB#0	23.93	PASS
Band41	5MHz	16QAM	41565	1RB#0	23.25	PASS
Band41	5MHz	16QAM	40620	1RB#0	23.79	PASS
Band41	5MHz	QPSK	40620	1RB#12	24.61	PASS
Band41	5MHz	QPSK	41565	1RB#12	24.03	PASS
Band41	5MHz	16QAM	41565	1RB#12	23.34	PASS
Band41	5MHz	QPSK	41565	1RB#24	23.87	PASS
Band41	5MHz	16QAM	41565	1RB#24	23.18	PASS
Band41	5MHz	QPSK	41565	12RB#0	23.02	PASS
Band41	5MHz	16QAM	41565	12RB#0	22.01	PASS
Band41	5MHz	16QAM	41565	12RB#6	21.98	PASS
Band41	5MHz	QPSK	41565	12RB#13	22.97	PASS
Band41	5MHz	16QAM	40620	1RB#12	23.91	PASS
Band41	5MHz	QPSK	40620	1RB#24	24.45	PASS
Band41	5MHz	QPSK	40620	25RB#0	23.56	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	QPSK	41565	12RB#6	23.03	PASS
Band41	5MHz	16QAM	41565	12RB#13	21.93	PASS
Band41	5MHz	QPSK	41565	25RB#0	23.01	PASS
Band41	5MHz	16QAM	41565	25RB#0	22.04	PASS
Band41	10MHz	QPSK	39700	1RB#0	24.53	PASS
Band41	10MHz	16QAM	39700	1RB#0	23.63	PASS
Band41	10MHz	QPSK	39700	1RB#24	24.85	PASS
Band41	10MHz	16QAM	39700	1RB#24	23.97	PASS
Band41	10MHz	QPSK	39700	1RB#49	24.62	PASS
Band41	10MHz	16QAM	39700	1RB#49	23.75	PASS
Band41	10MHz	QPSK	39700	25RB#0	23.59	PASS
Band41	10MHz	16QAM	39700	25RB#0	22.64	PASS
Band41	10MHz	QPSK	39700	25RB#12	23.61	PASS
Band41	10MHz	16QAM	39700	25RB#12	22.65	PASS
Band41	10MHz	QPSK	39700	25RB#25	23.62	PASS
Band41	10MHz	16QAM	39700	25RB#25	22.70	PASS
Band41	10MHz	QPSK	39700	50RB#0	23.58	PASS
Band41	10MHz	16QAM	39700	50RB#0	22.58	PASS
Band41	10MHz	QPSK	40620	1RB#0	24.62	PASS
Band41	10MHz	16QAM	40620	1RB#0	23.77	PASS
Band41	10MHz	QPSK	40620	1RB#24	24.84	PASS
Band41	10MHz	16QAM	40620	1RB#24	23.98	PASS
Band41	10MHz	QPSK	40620	1RB#49	24.58	PASS
Band41	10MHz	16QAM	40620	1RB#49	23.73	PASS
Band41	10MHz	QPSK	40620	25RB#0	23.67	PASS
Band41	10MHz	16QAM	40620	25RB#0	22.74	PASS
Band41	10MHz	QPSK	40620	25RB#12	23.67	PASS
Band41	10MHz	16QAM	40620	25RB#12	22.77	PASS
Band41	10MHz	QPSK	40620	25RB#25	23.62	PASS
Band41	10MHz	16QAM	40620	25RB#25	22.69	PASS
Band41	10MHz	QPSK	40620	50RB#0	23.63	PASS
Band41	10MHz	16QAM	40620	50RB#0	22.67	PASS
Band41	10MHz	QPSK	41540	1RB#0	24.22	PASS
Band41	10MHz	16QAM	41540	1RB#0	23.39	PASS
Band41	10MHz	QPSK	41540	1RB#24	24.35	PASS
Band41	10MHz	16QAM	41540	1RB#24	23.49	PASS
Band41	10MHz	QPSK	41540	1RB#49	24.06	PASS
Band41	10MHz	16QAM	41540	1RB#49	23.18	PASS
Band41	10MHz	QPSK	41540	25RB#0	23.19	PASS
Band41	10MHz	16QAM	41540	25RB#0	22.30	PASS
Band41	10MHz	QPSK	41540	25RB#12	23.23	PASS
Band41	10MHz	16QAM	41540	25RB#12	22.34	PASS





Band41	10MHz	QPSK	41540	25RB#25	23.09	PASS
Band41	10MHz	16QAM	41540	25RB#25	22.16	PASS
Band41	10MHz	QPSK	41540	50RB#0	23.15	PASS
Band41	10MHz	16QAM	41540	50RB#0	22.19	PASS
Band41	15MHz	QPSK	39725	1RB#0	24.46	PASS
Band41	15MHz	16QAM	39725	1RB#0	23.55	PASS
Band41	15MHz	QPSK	39725	1RB#38	24.68	PASS
Band41	15MHz	16QAM	39725	1RB#38	23.76	PASS
Band41	15MHz	QPSK	39725	1RB#74	24.52	PASS
Band41	15MHz	16QAM	39725	1RB#74	23.66	PASS
Band41	15MHz	QPSK	39725	38RB#0	23.64	PASS
Band41	15MHz	16QAM	39725	38RB#0	23.66	PASS
Band41	15MHz	QPSK	39725	38RB#18	23.64	PASS
Band41	15MHz	16QAM	39725	38RB#18	23.64	PASS
Band41	15MHz	QPSK	39725	38RB#37	23.62	PASS
Band41	15MHz	16QAM	39725	38RB#37	23.66	PASS
Band41	15MHz	QPSK	39725	75RB#0	23.66	PASS
Band41	15MHz	16QAM	39725	75RB#0	22.63	PASS
Band41	15MHz	QPSK	40620	1RB#0	24.55	PASS
Band41	15MHz	16QAM	40620	1RB#0	23.73	PASS
Band41	15MHz	QPSK	40620	1RB#38	24.62	PASS
Band41	15MHz	16QAM	40620	1RB#38	23.79	PASS
Band41	15MHz	QPSK	40620	1RB#74	24.46	PASS
Band41	15MHz	16QAM	40620	1RB#74	23.61	PASS
Band41	15MHz	QPSK	40620	38RB#0	23.66	PASS
Band41	15MHz	16QAM	40620	38RB#0	23.68	PASS
Band41	15MHz	QPSK	40620	38RB#18	23.66	PASS
Band41	15MHz	16QAM	40620	38RB#18	23.68	PASS
Band41	15MHz	QPSK	40620	38RB#37	23.66	PASS
Band41	15MHz	16QAM	40620	38RB#37	23.70	PASS
Band41	15MHz	QPSK	40620	75RB#0	23.66	PASS
Band41	15MHz	16QAM	40620	75RB#0	22.65	PASS
Band41	15MHz	QPSK	41515	1RB#0	24.27	PASS
Band41	15MHz	16QAM	41515	1RB#0	23.43	PASS
Band41	15MHz	QPSK	41515	1RB#38	24.17	PASS
Band41	15MHz	16QAM	41515	1RB#38	23.33	PASS
Band41	15MHz	QPSK	41515	1RB#74	23.96	PASS
Band41	15MHz	16QAM	41515	1RB#74	23.12	PASS
Band41	15MHz	QPSK	41515	38RB#0	23.18	PASS
Band41	15MHz	16QAM	41515	38RB#0	23.17	PASS
Band41	15MHz	QPSK	41515	38RB#18	23.18	PASS
Band41	15MHz	16QAM	41515	38RB#18	23.18	PASS





Band41	15MHz	QPSK	41515	38RB#37	23.17	PASS
Band41	15MHz	16QAM	41515	38RB#37	23.22	PASS
Band41	15MHz	QPSK	41515	75RB#0	23.19	PASS
Band41	15MHz	16QAM	41515	75RB#0	22.17	PASS
Band41	20MHz	QPSK	39750	1RB#0	24.34	PASS
Band41	20MHz	16QAM	39750	1RB#0	23.30	PASS
Band41	20MHz	QPSK	39750	1RB#49	24.80	PASS
Band41	20MHz	16QAM	39750	1RB#49	23.77	PASS
Band41	20MHz	QPSK	39750	1RB#99	24.37	PASS
Band41	20MHz	16QAM	39750	1RB#99	23.33	PASS
Band41	20MHz	QPSK	39750	50RB#0	23.56	PASS
Band41	20MHz	16QAM	39750	50RB#0	22.55	PASS
Band41	20MHz	QPSK	39750	50RB#25	23.54	PASS
Band41	20MHz	16QAM	39750	50RB#25	22.55	PASS
Band41	20MHz	QPSK	39750	50RB#50	23.56	PASS
Band41	20MHz	16QAM	39750	50RB#50	22.57	PASS
Band41	20MHz	QPSK	39750	100RB#0	23.56	PASS
Band41	20MHz	16QAM	39750	100RB#0	22.55	PASS
Band41	20MHz	QPSK	40620	1RB#0	24.42	PASS
Band41	20MHz	16QAM	40620	1RB#0	23.42	PASS
Band41	20MHz	QPSK	40620	1RB#49	24.80	PASS
Band41	20MHz	16QAM	40620	1RB#49	23.77	PASS
Band41	20MHz	QPSK	40620	1RB#99	24.36	PASS
Band41	20MHz	16QAM	40620	1RB#99	23.34	PASS
Band41	20MHz	QPSK	40620	50RB#0	23.64	PASS
Band41	20MHz	16QAM	40620	50RB#0	22.65	PASS
Band41	20MHz	QPSK	40620	50RB#25	23.63	PASS
Band41	20MHz	16QAM	40620	50RB#25	22.65	PASS
Band41	20MHz	QPSK	40620	50RB#50	23.58	PASS
Band41	20MHz	16QAM	40620	50RB#50	22.61	PASS
Band41	20MHz	QPSK	40620	100RB#0	23.58	PASS
Band41	20MHz	16QAM	40620	100RB#0	22.61	PASS
Band41	20MHz	QPSK	41490	1RB#0	24.25	PASS
Band41	20MHz	16QAM	41490	1RB#0	23.25	PASS
Band41	20MHz	QPSK	41490	1RB#49	24.40	PASS
Band41	20MHz	16QAM	41490	1RB#49	23.38	PASS
Band41	20MHz	QPSK	41490	1RB#99	23.81	PASS
Band41	20MHz	16QAM	41490	1RB#99	22.80	PASS
Band41	20MHz	QPSK	41490	50RB#0	23.29	PASS
Band41	20MHz	16QAM	41490	50RB#0	22.35	PASS
Band41	20MHz	QPSK	41490	50RB#25	23.28	PASS
Band41	20MHz	16QAM	41490	50RB#25	22.33	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	41490	50RB#50	23.08	PASS
Band41	20MHz	16QAM	41490	50RB#50	22.10	PASS
Band41	20MHz	QPSK	41490	100RB#0	23.17	PASS
Band41	20MHz	16QAM	41490	100RB#0	22.22	PASS





C.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	7.98	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	8.84	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	8.89	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	9.82	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	8.00	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	8.85	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	9.13	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	9.87	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	8.33	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	8.99	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	9.23	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	9.80	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	7.94	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	8.78	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.11	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.73	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	8.20	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	9.08	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.19	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.90	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	8.11	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	9.39	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.23	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.96	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	8.00	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	8.65	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	9.60	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	9.98	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	7.83	13	PASS
Band41	15MHz	16QAM	40620	1RB#0	8.94	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	9.18	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	10.17	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	7.75	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	8.94	13	PASS
Band41	15MHz	QPSK	41515	75RB#0	9.47	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	9.92	13	PASS





Band41	20MHz	QPSK	39750	1RB#0	7.68	13	PASS
Band41	20MHz	16QAM	39750	1RB#0	8.47	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	8.90	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	9.92	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	8.00	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	8.59	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	9.05	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	9.76	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	8.08	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	9.12	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	9.22	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	10.25	13	PASS





Test Graphs




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

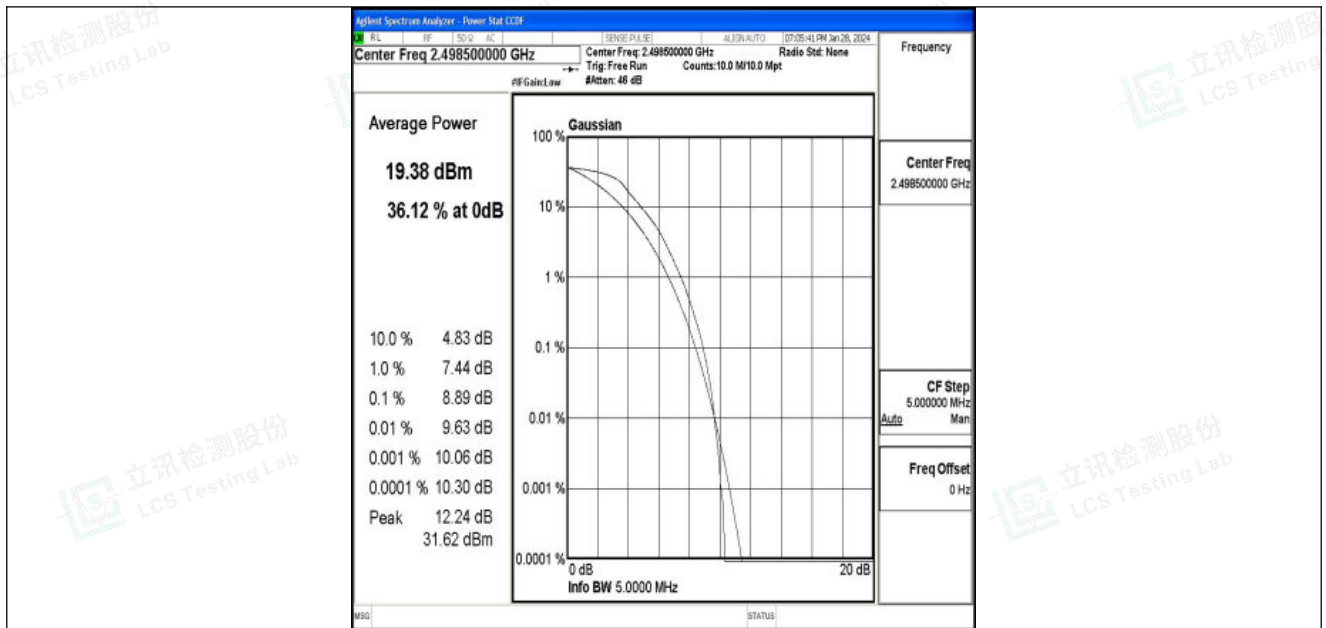

Band41-5MHz-QPSK-39675-25RB#0-PASS

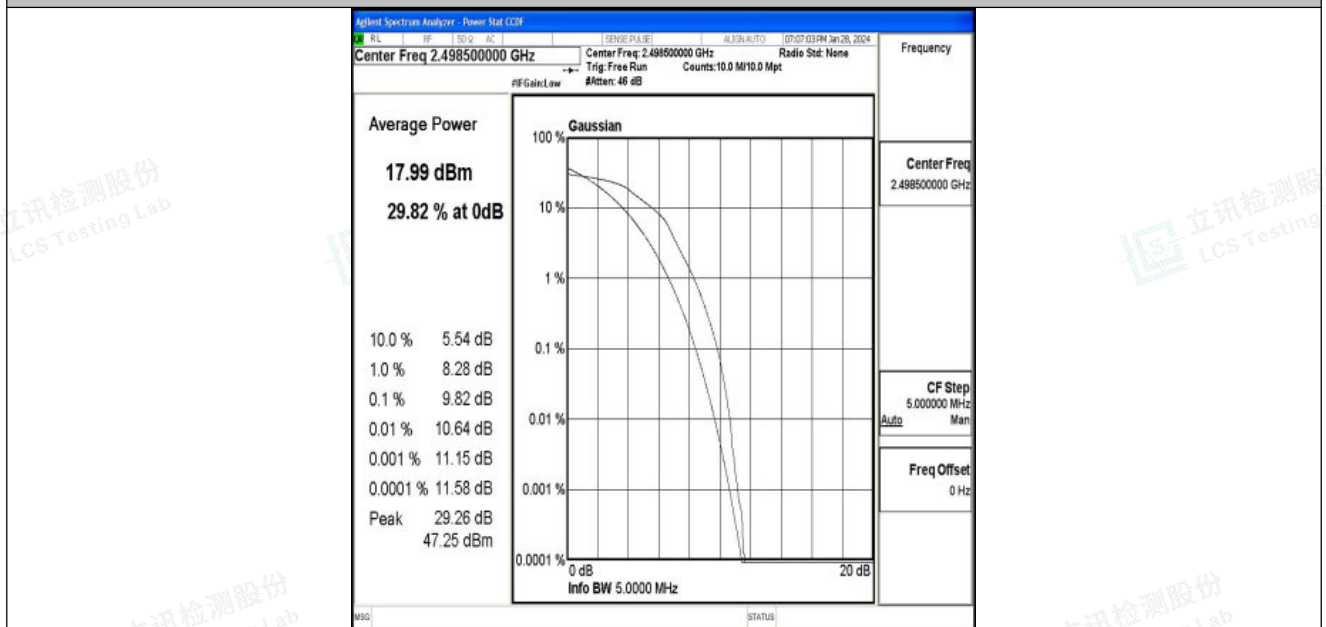

Band41-5MHz-16QAM-39675-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

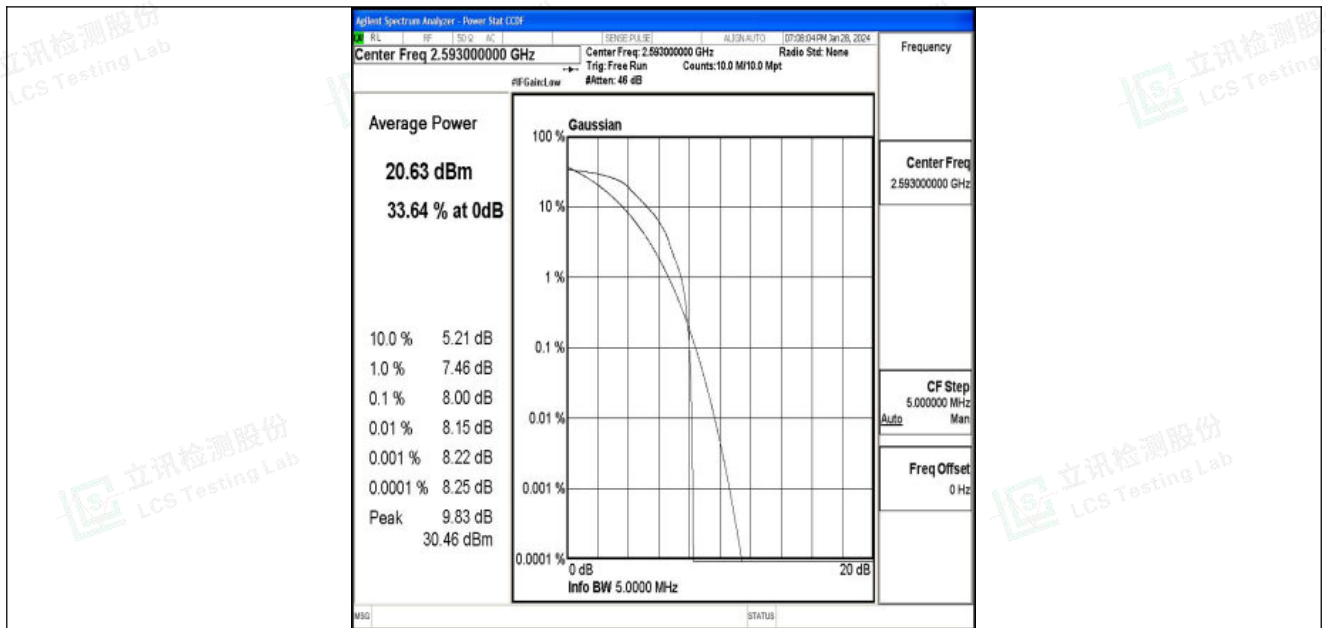

Band41-5MHz-QPSK-40620-1RB#0-PASS

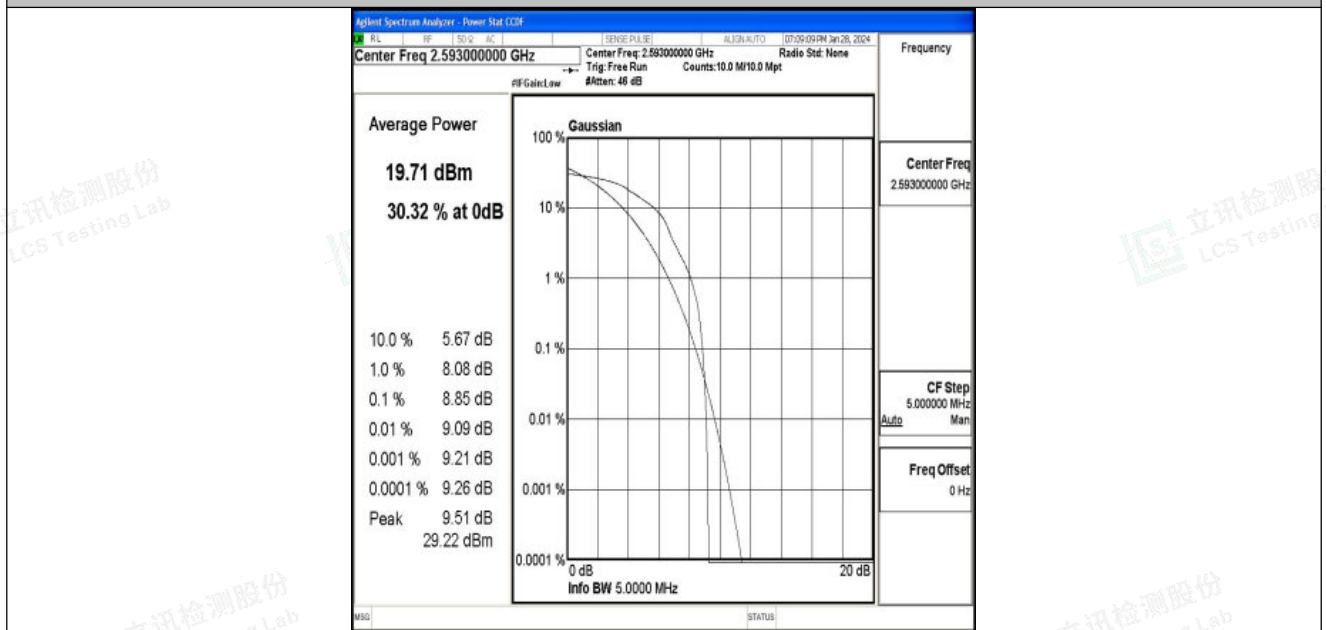

Band41-5MHz-16QAM-40620-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

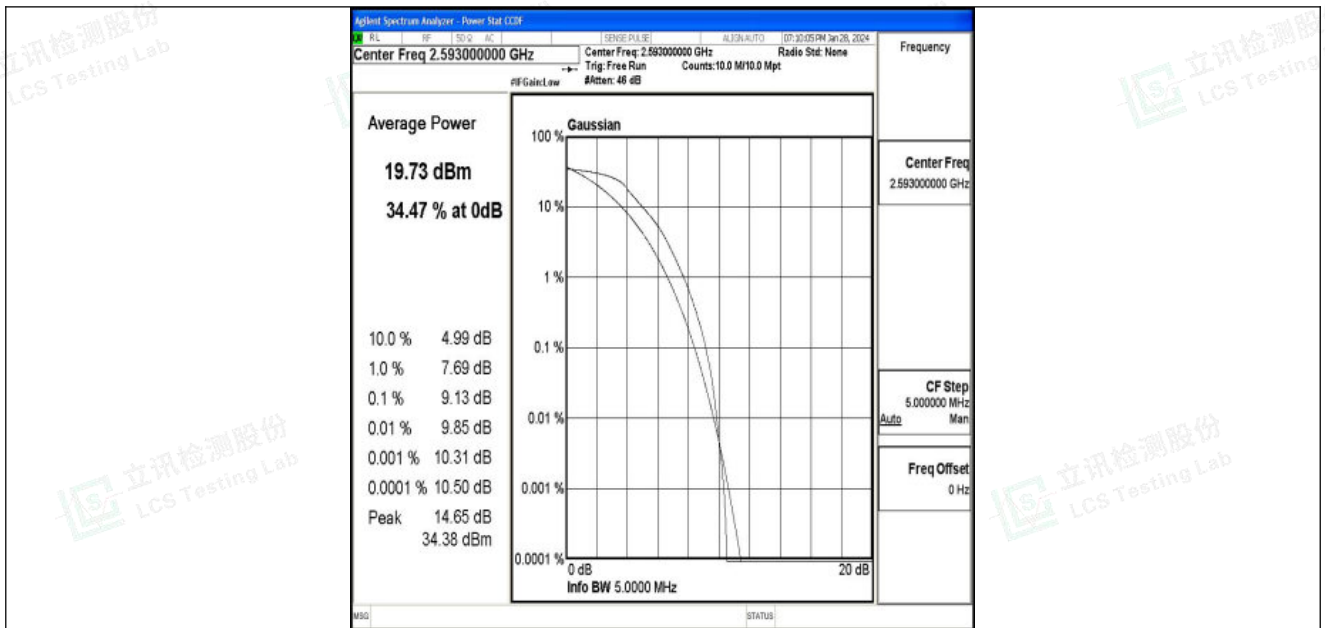

Band41-5MHz-QPSK-40620-25RB#0-PASS

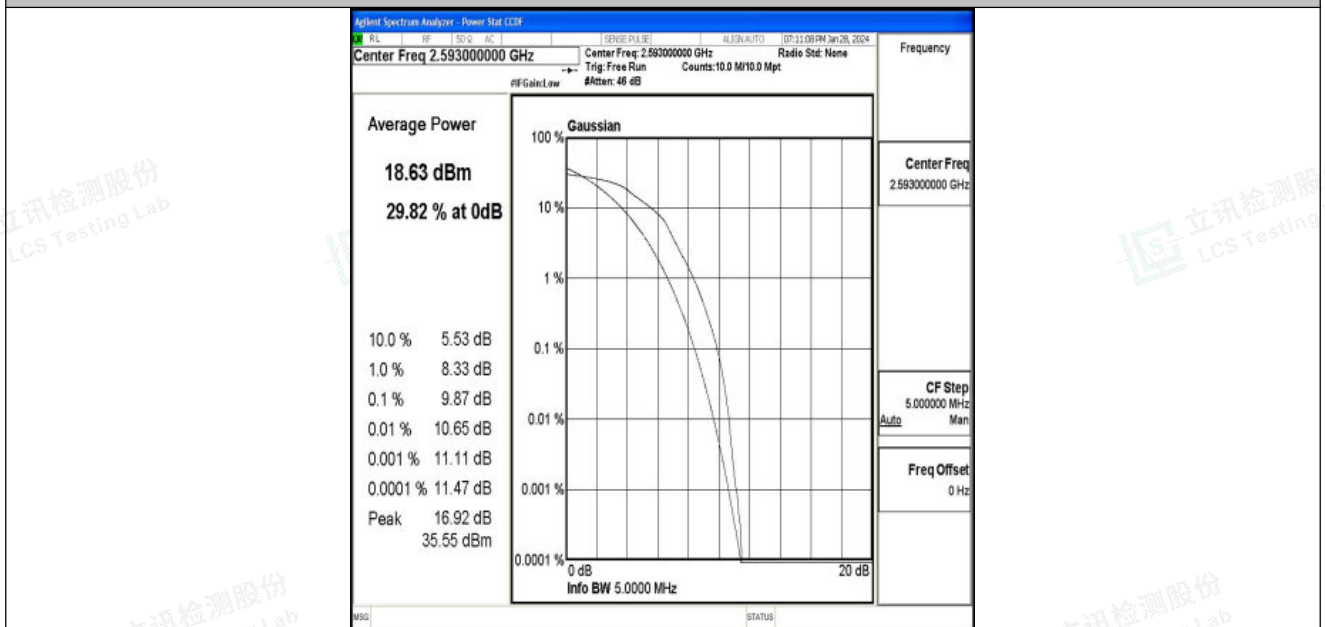

Band41-5MHz-16QAM-40620-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

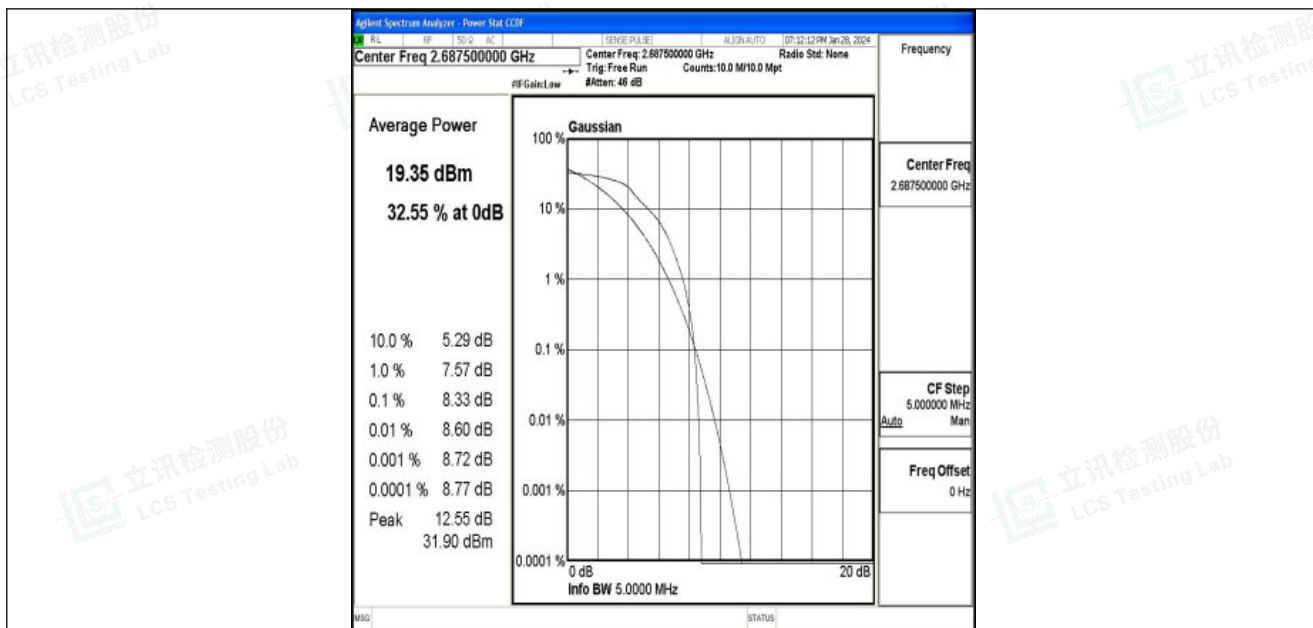

Band41-5MHz-QPSK-41565-1RB#0-PASS

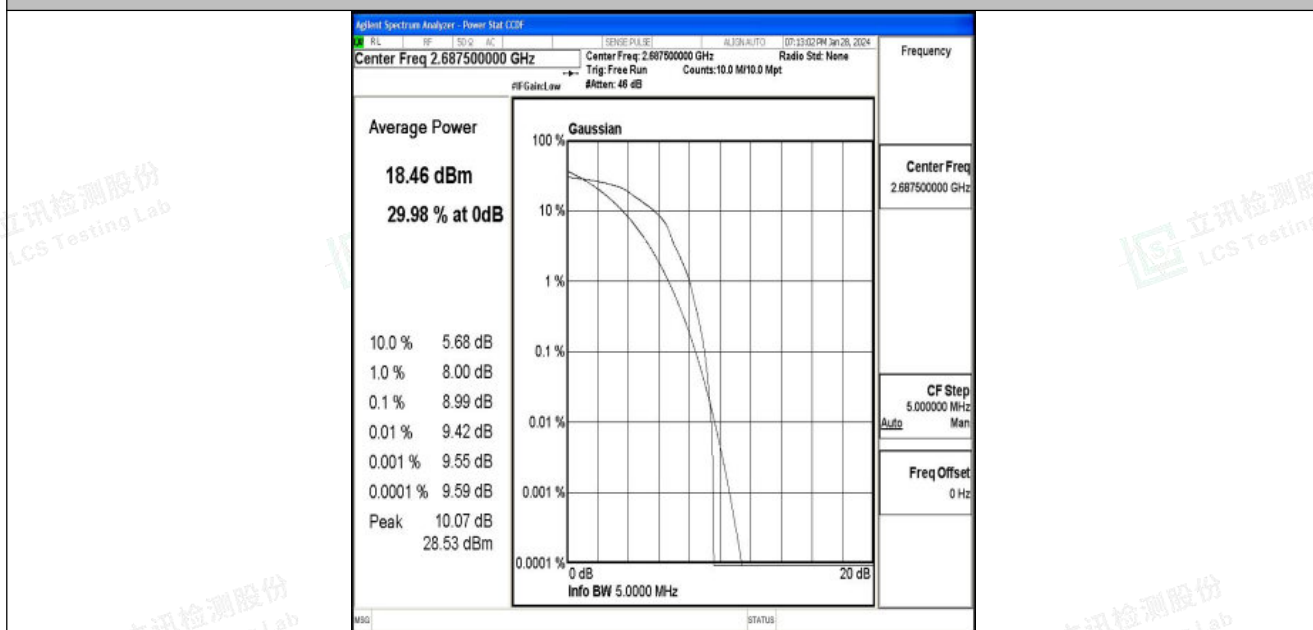

Band41-5MHz-16QAM-41565-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

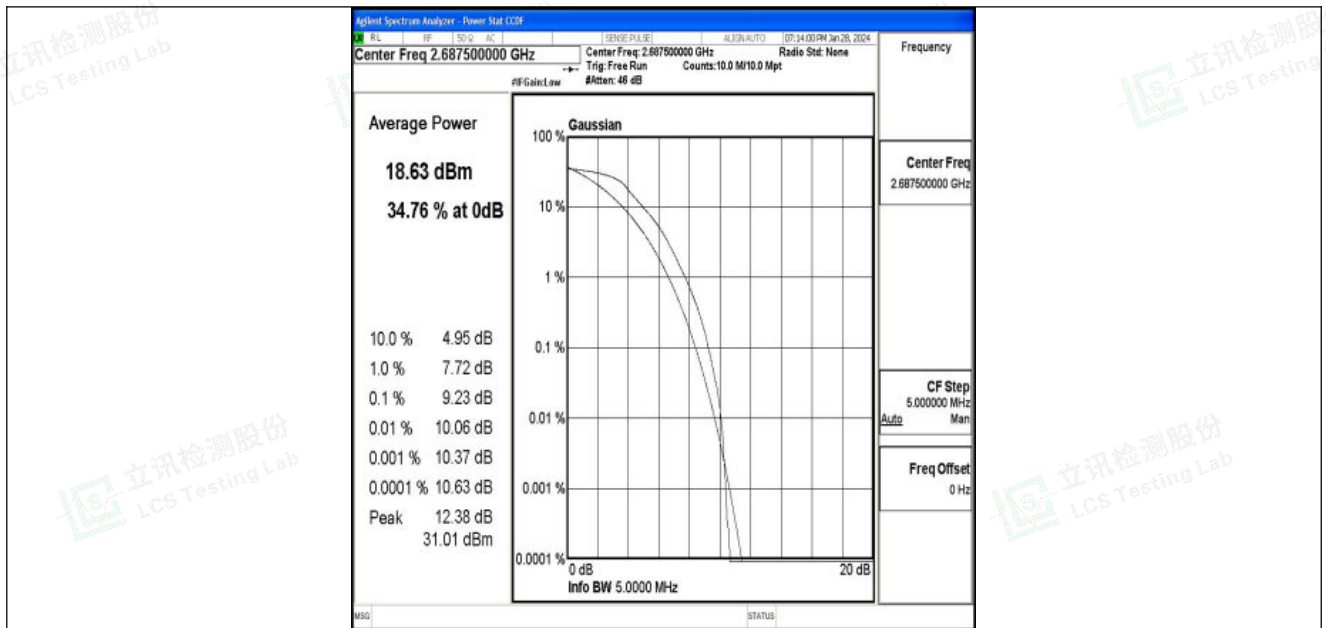

Band41-5MHz-QPSK-41565-25RB#0-PASS

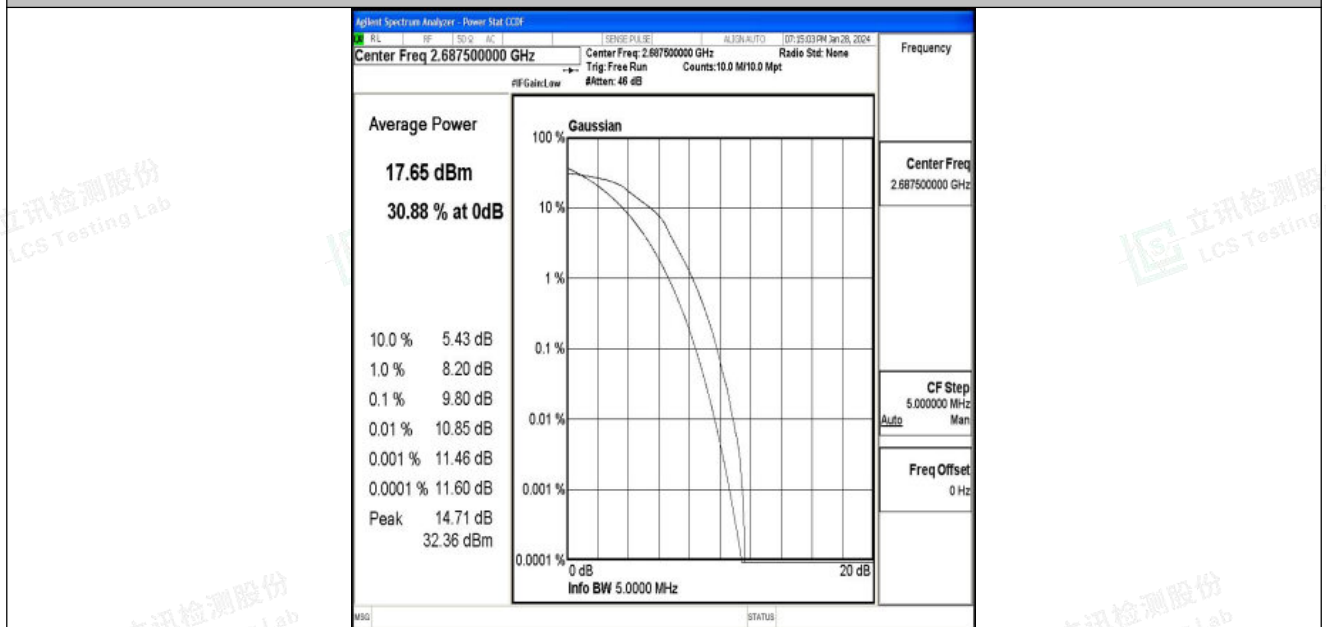

Band41-5MHz-16QAM-41565-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

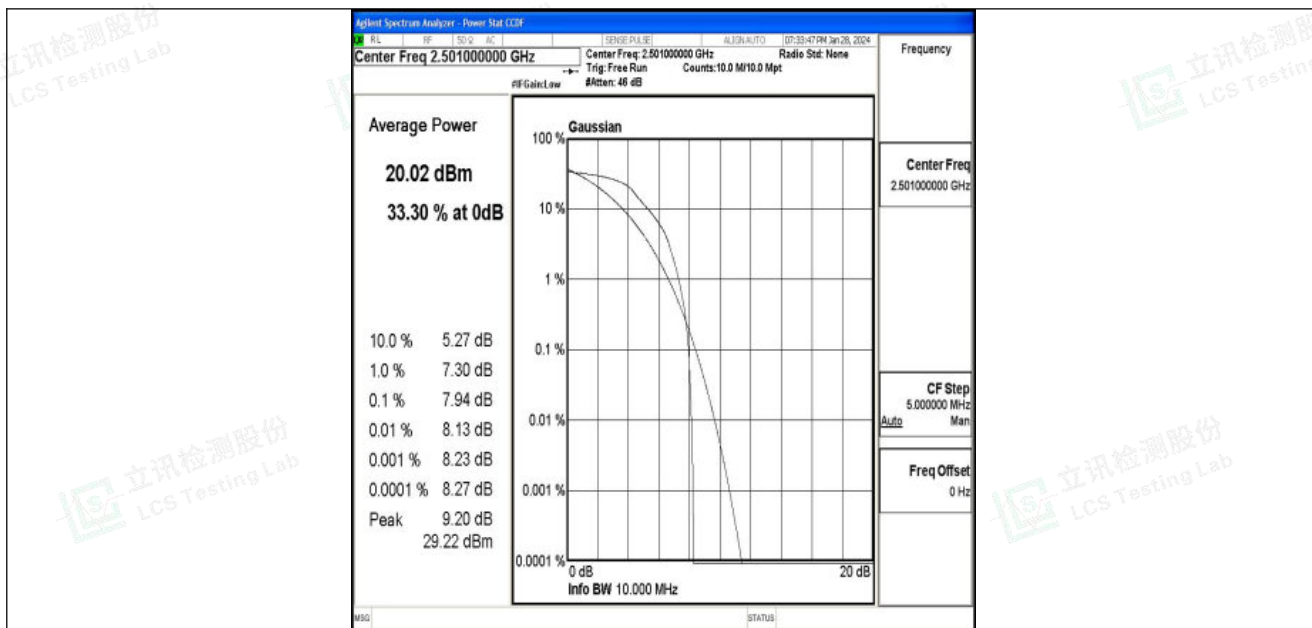

Band41-10MHz-QPSK-39700-1RB#0-PASS

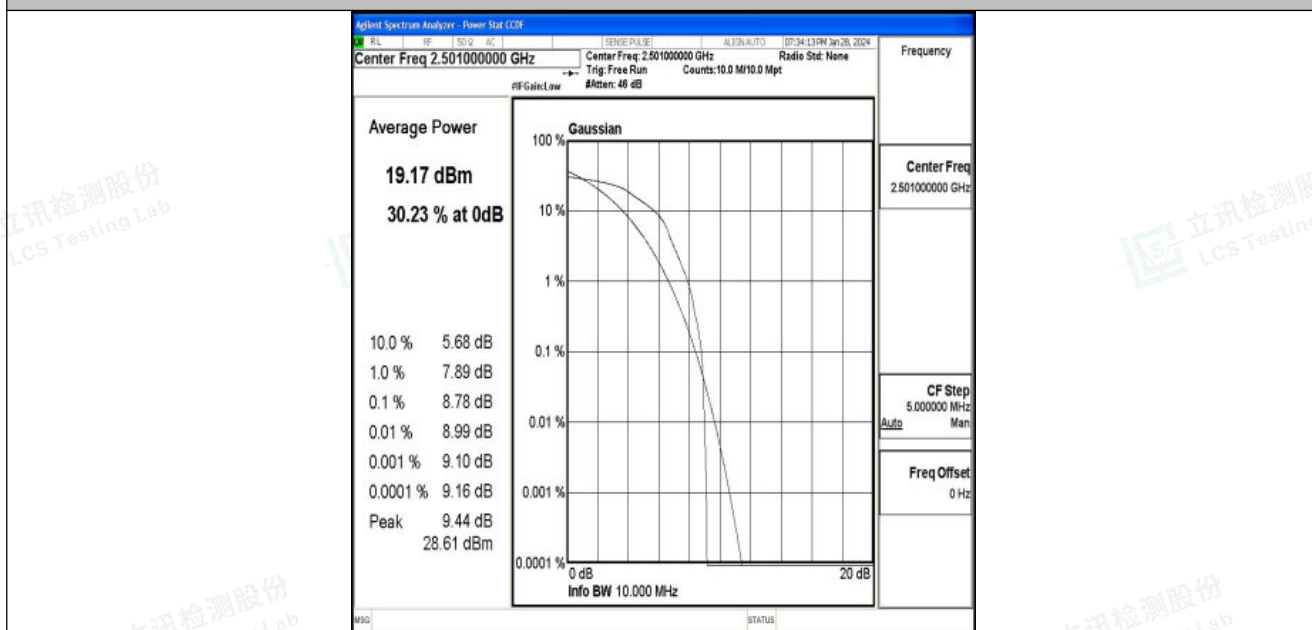

Band41-10MHz-16QAM-39700-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

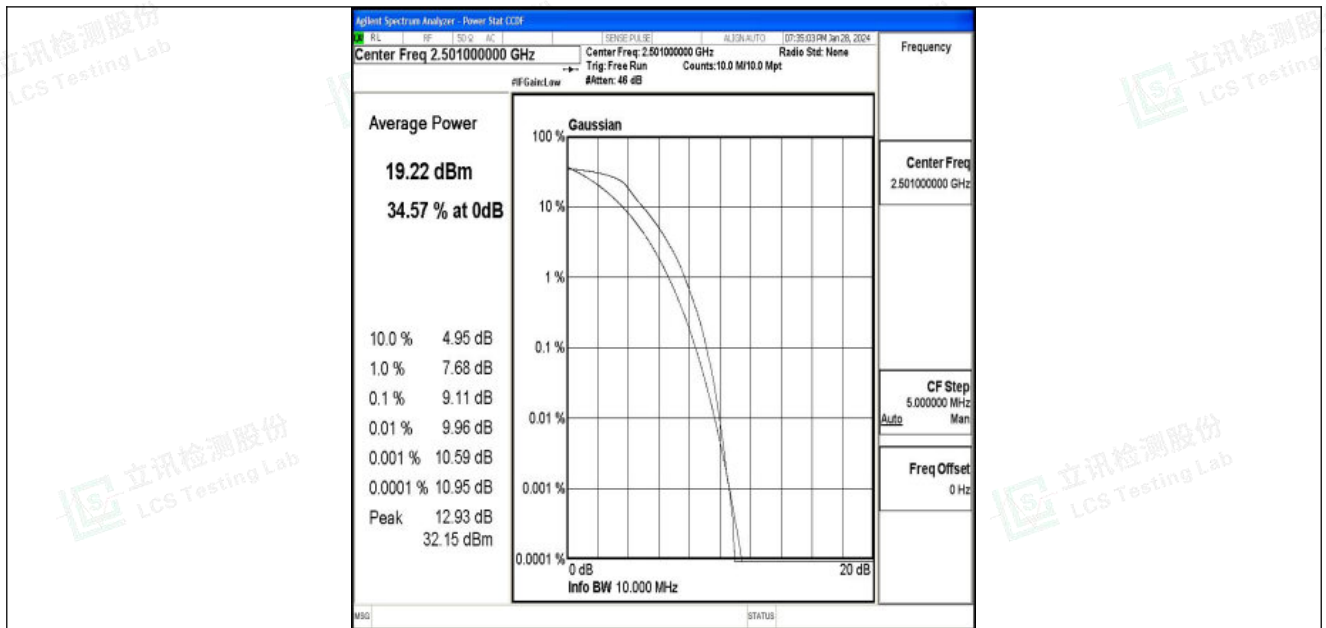

Band41-10MHz-QPSK-39700-50RB#0-PASS

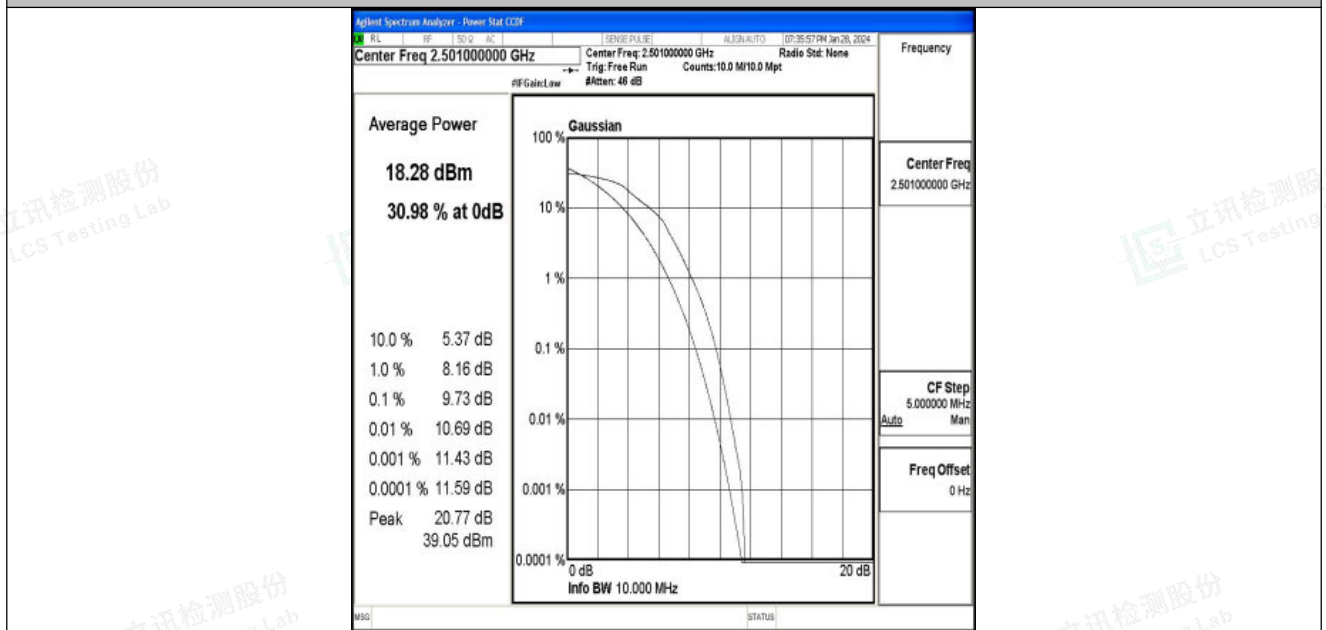

Band41-10MHz-16QAM-39700-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

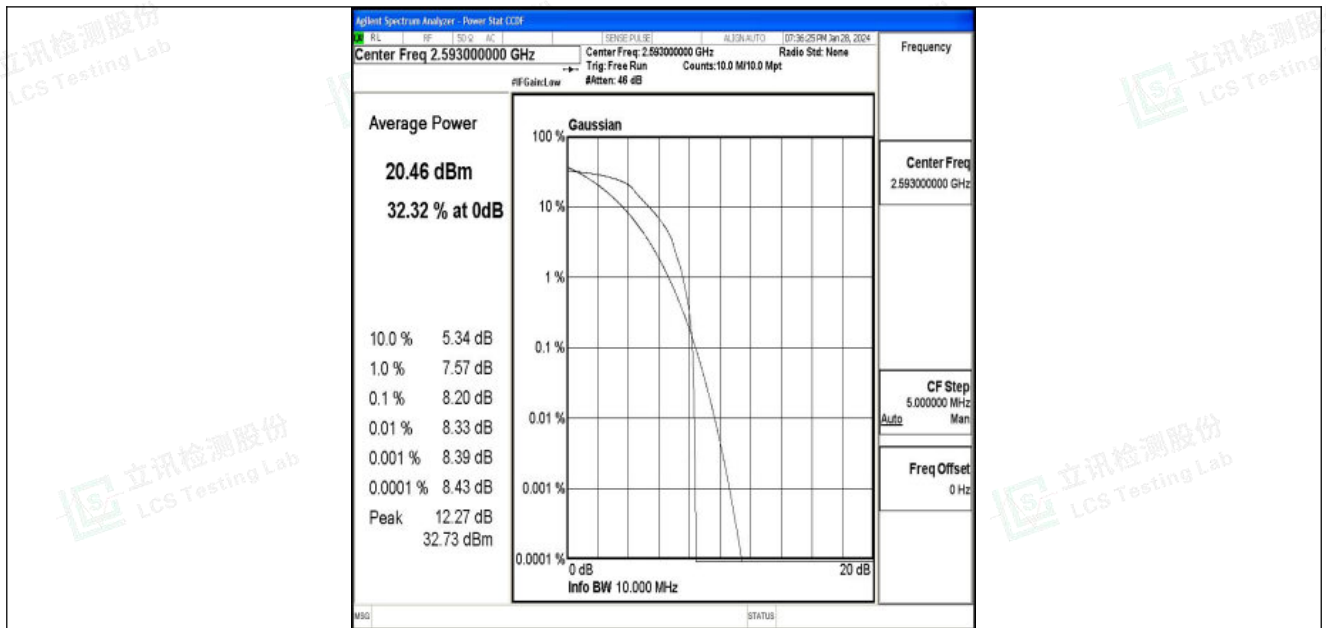

Band41-10MHz-QPSK-40620-1RB#0-PASS

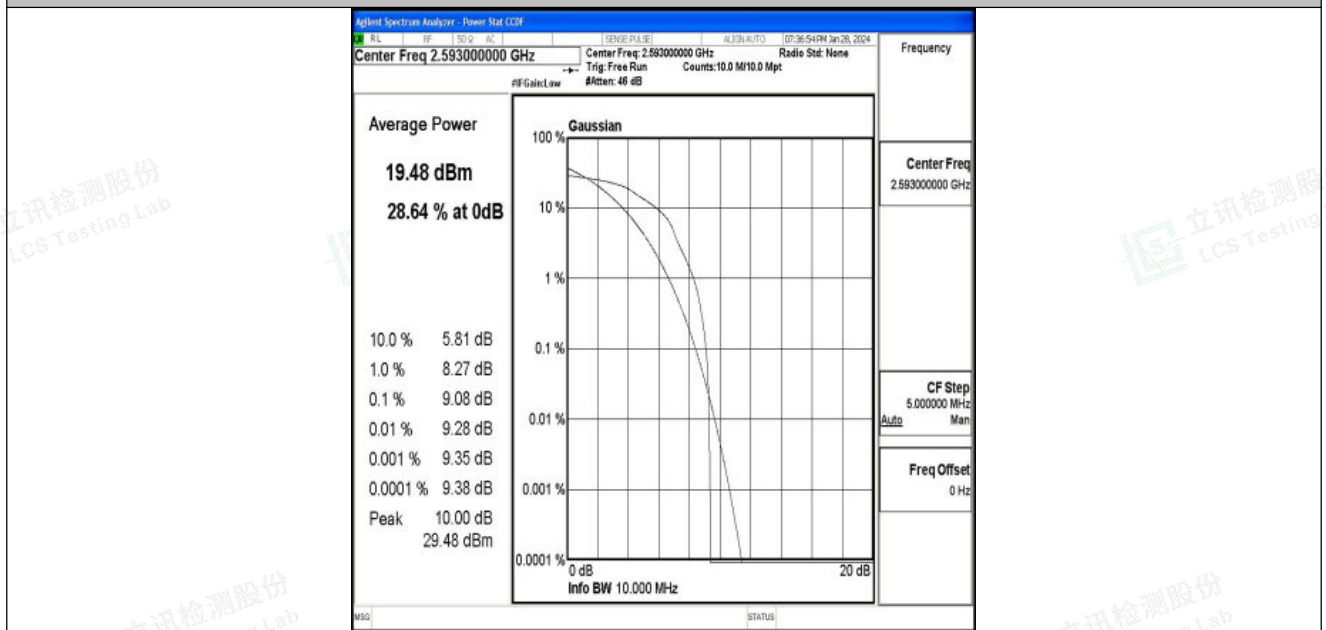

Band41-10MHz-16QAM-40620-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

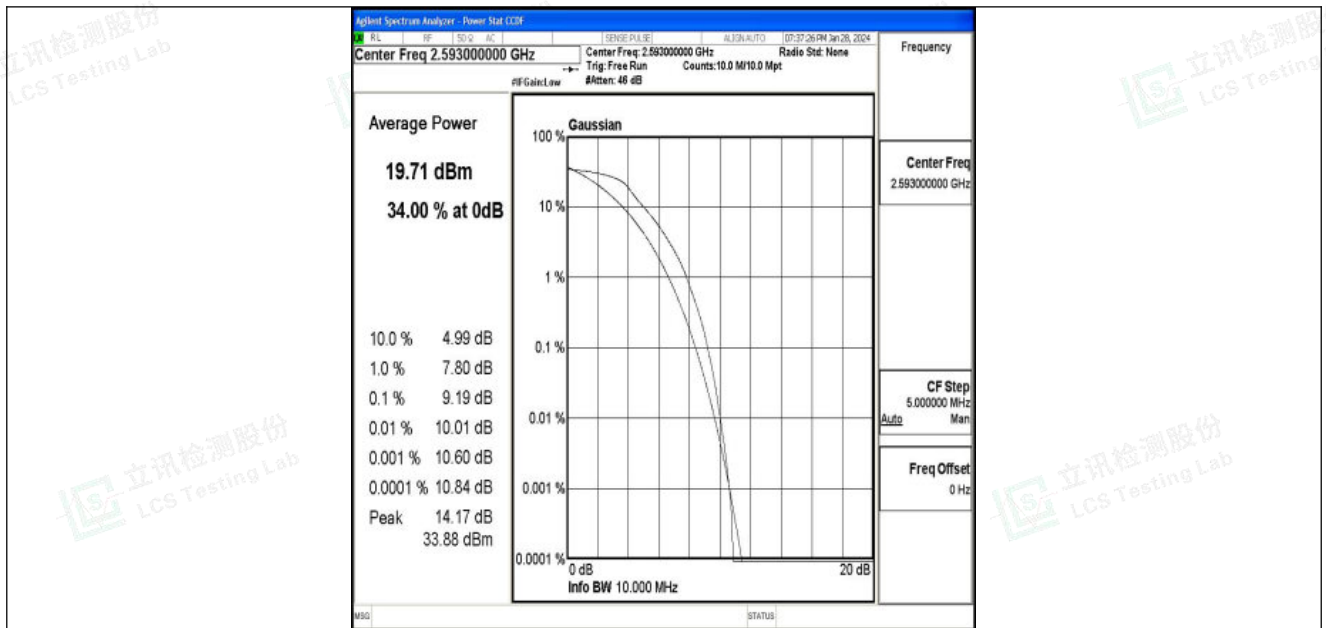

Band41-10MHz-QPSK-40620-50RB#0-PASS

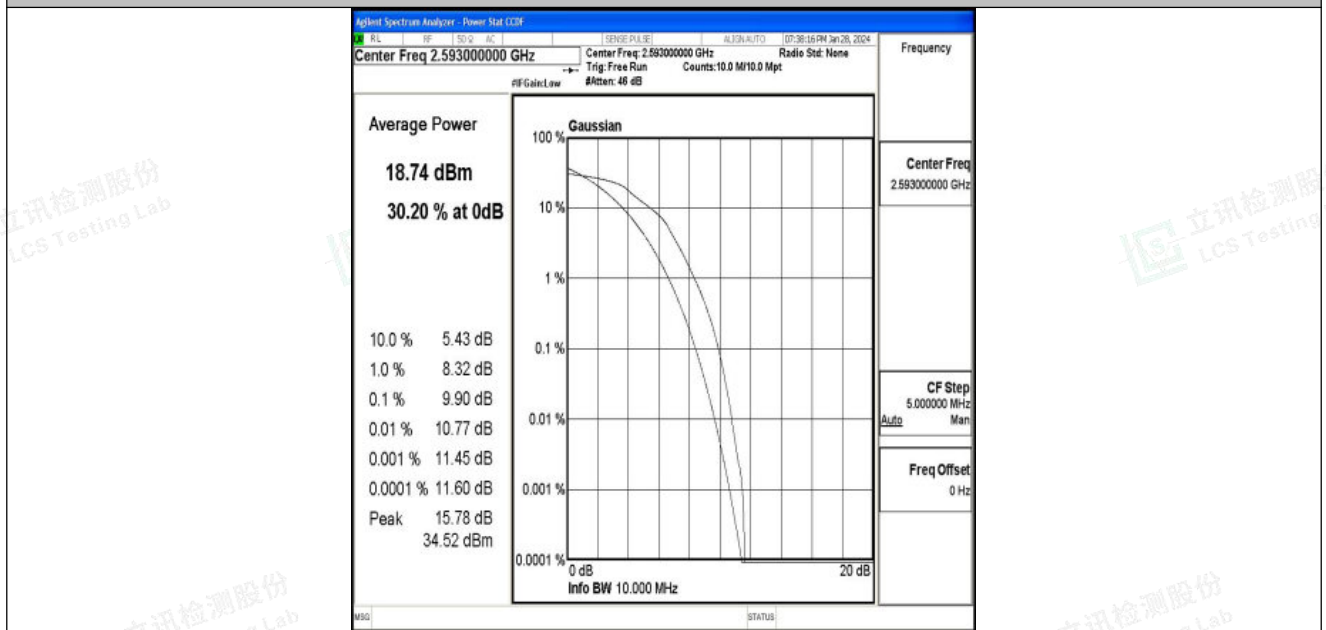

Band41-10MHz-16QAM-40620-50RB#0-PASS






Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

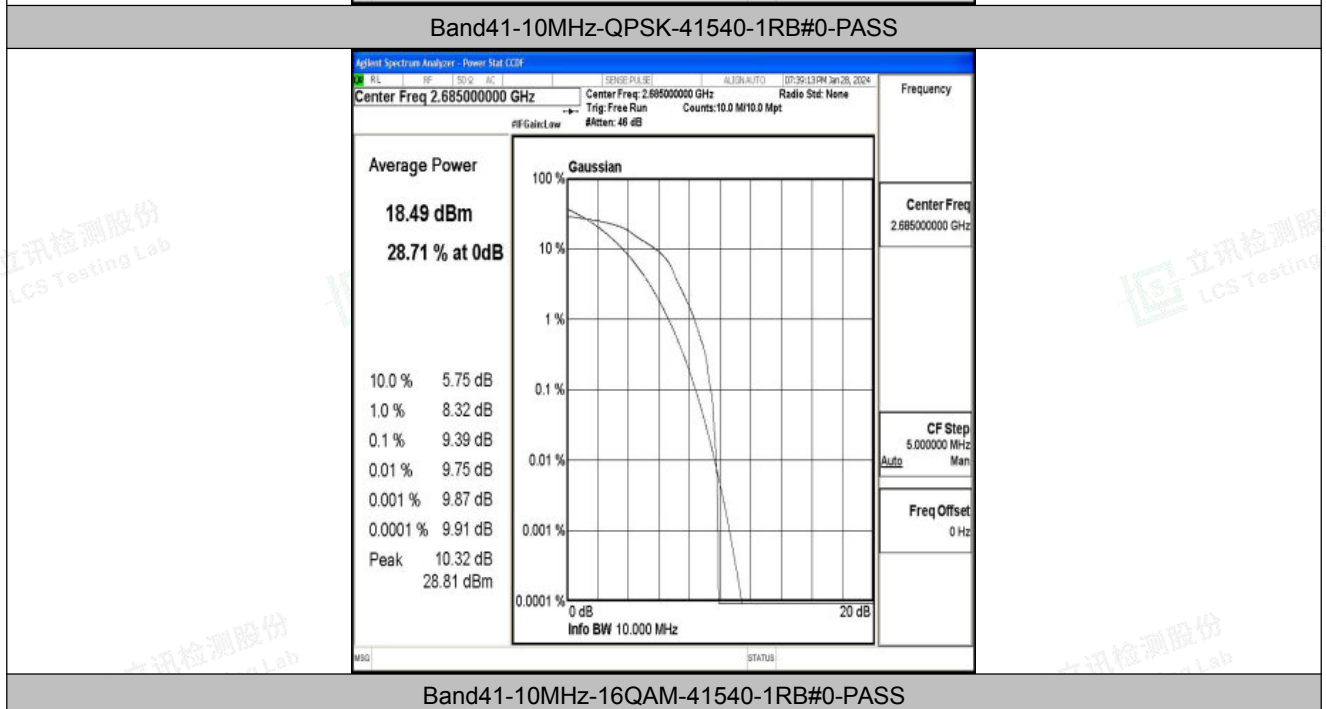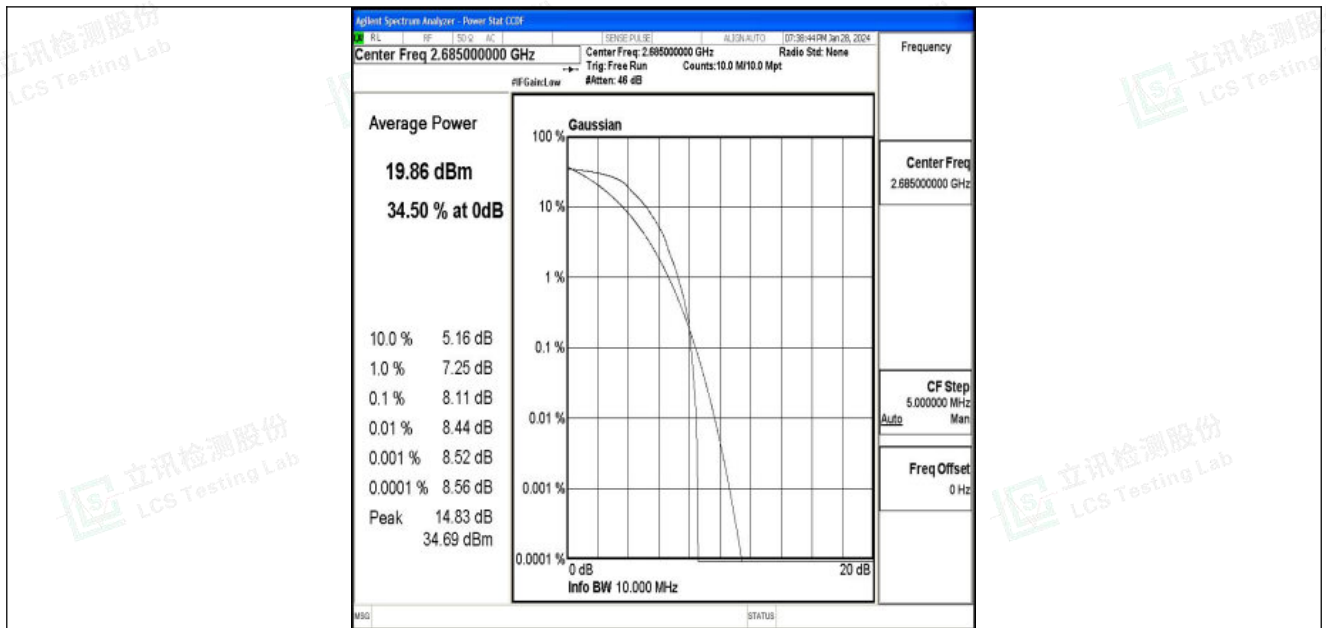

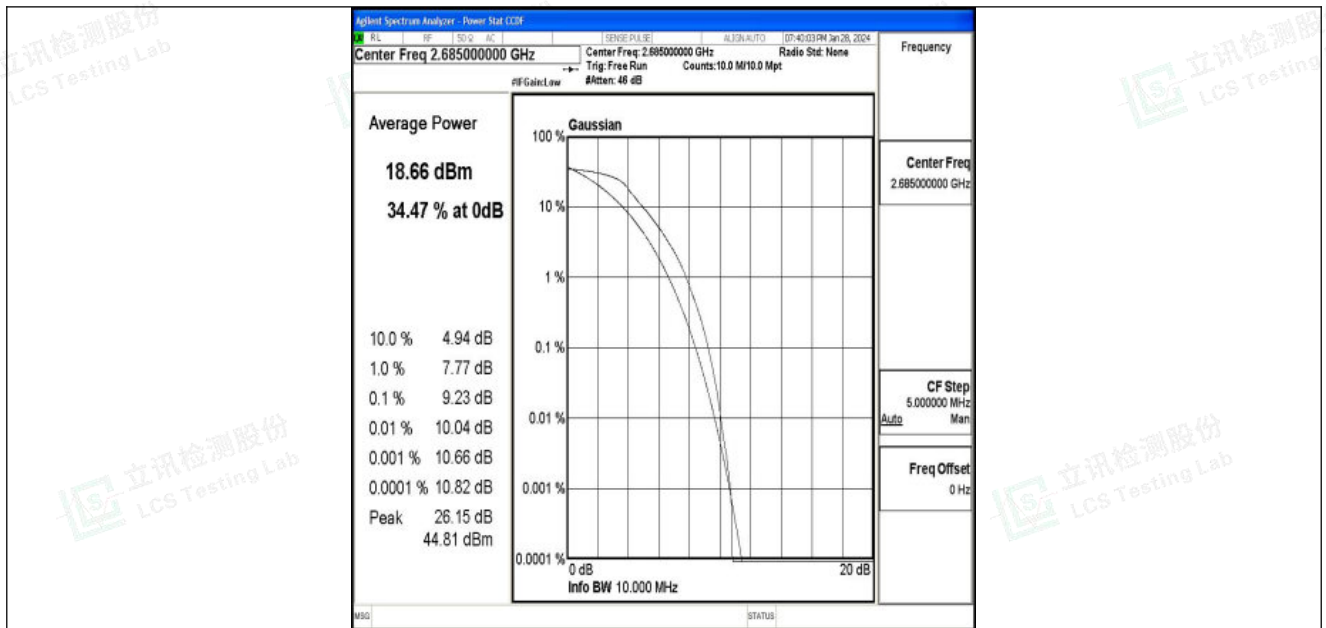

Band41-10MHz-QPSK-41540-50RB#0-PASS

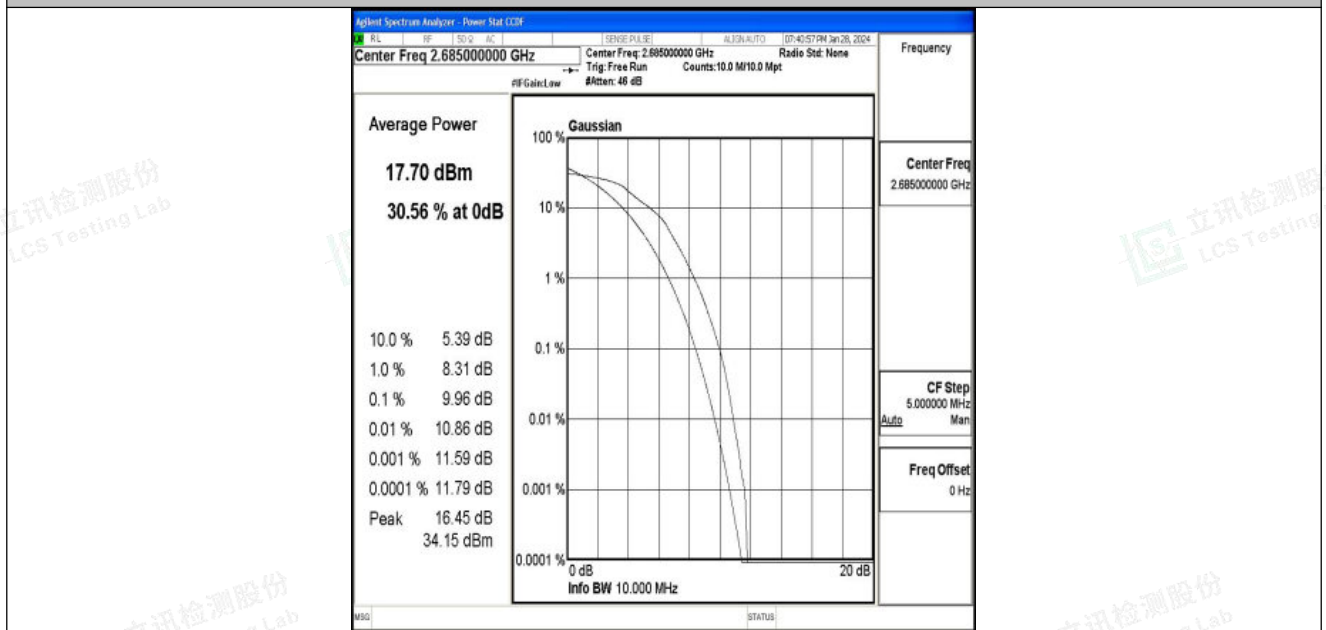

Band41-10MHz-16QAM-41540-50RB#0-PASS






Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

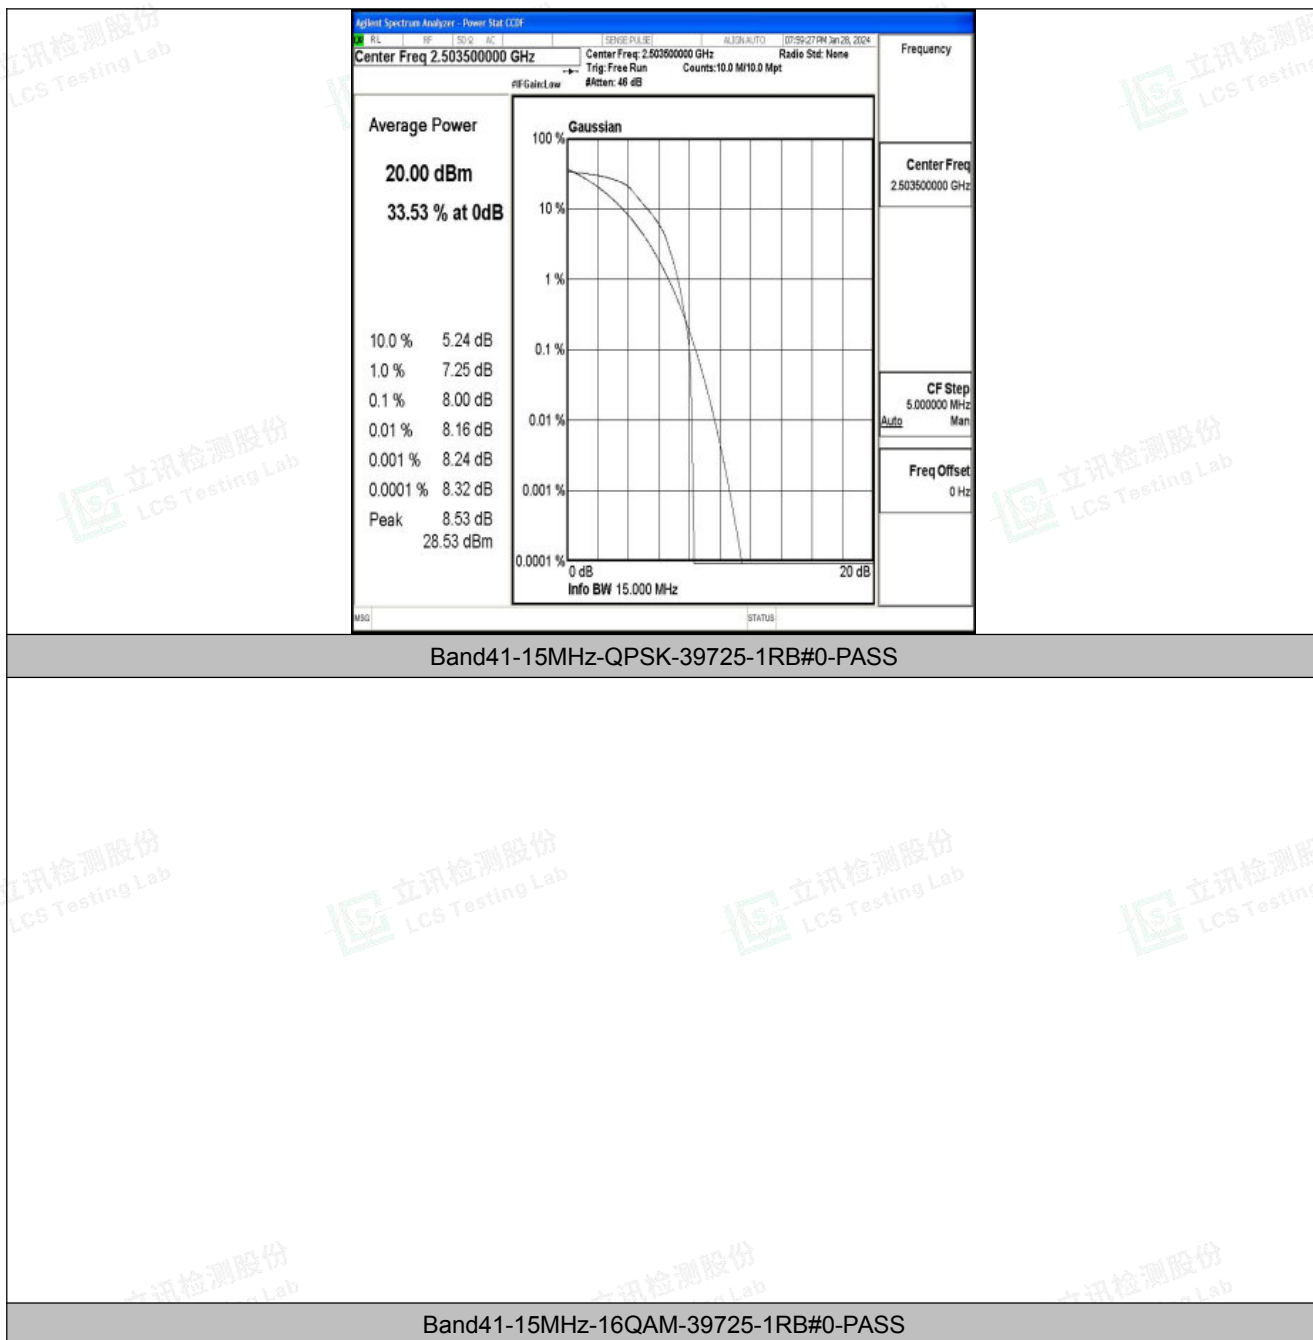

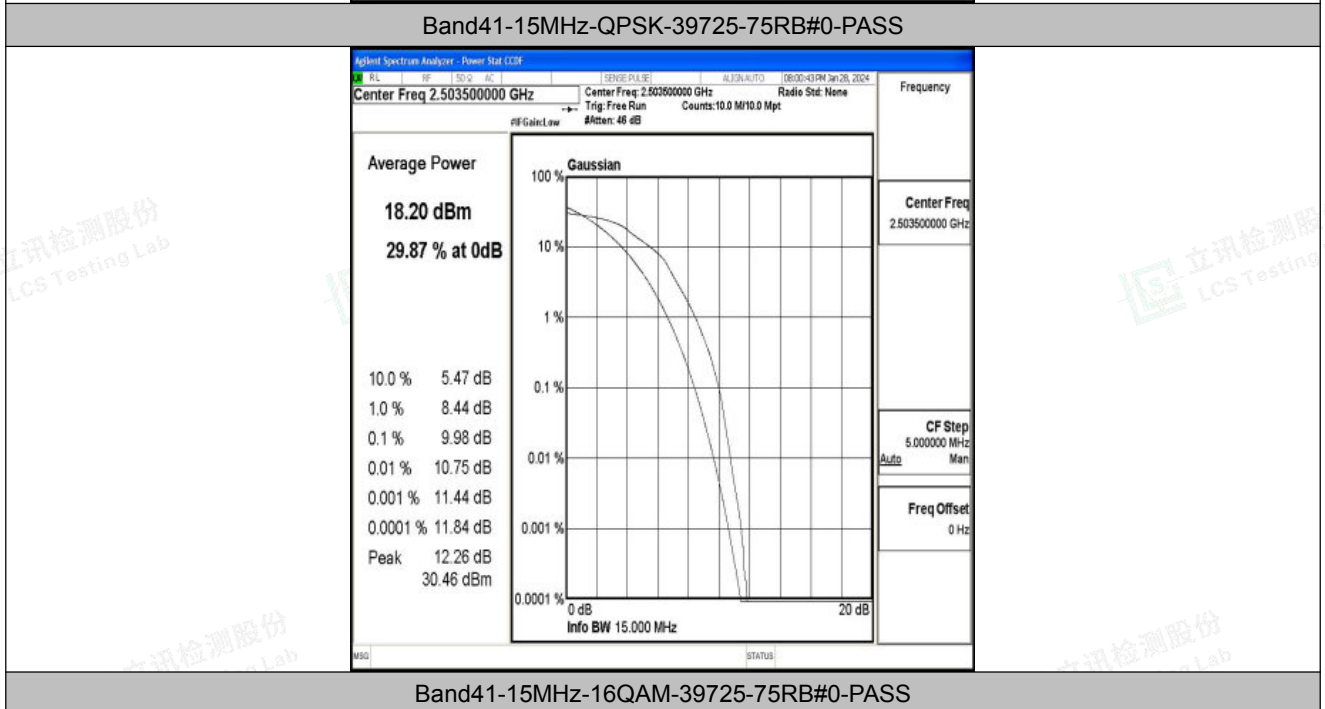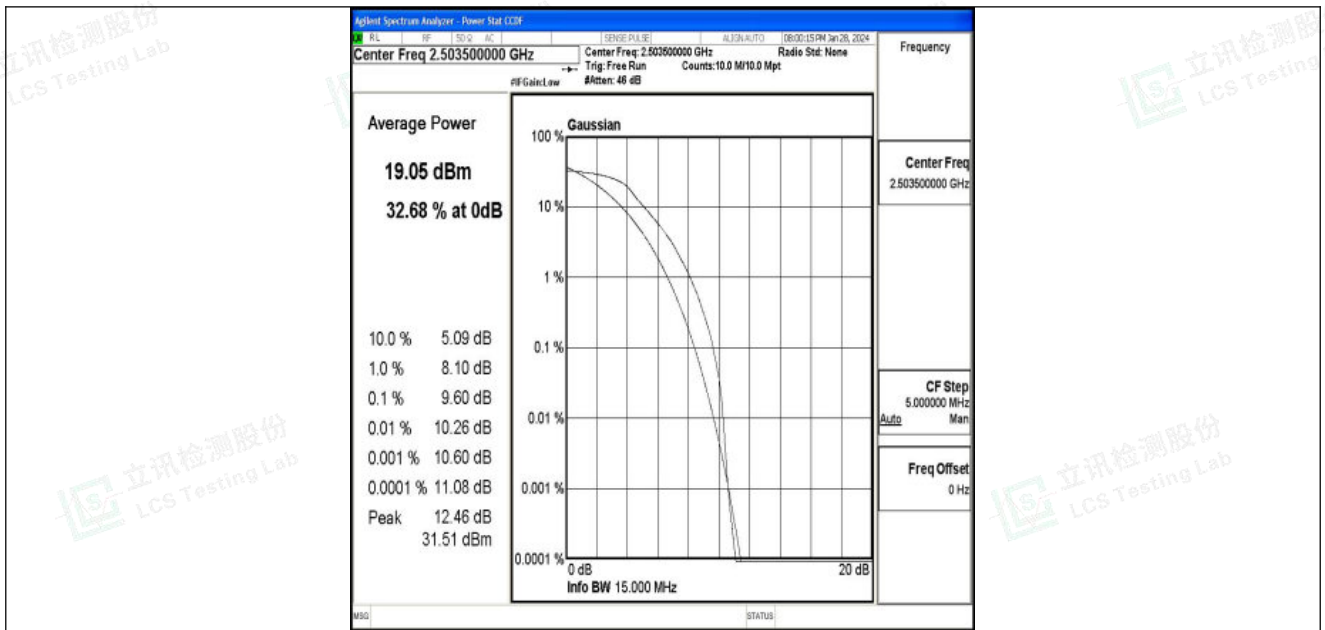

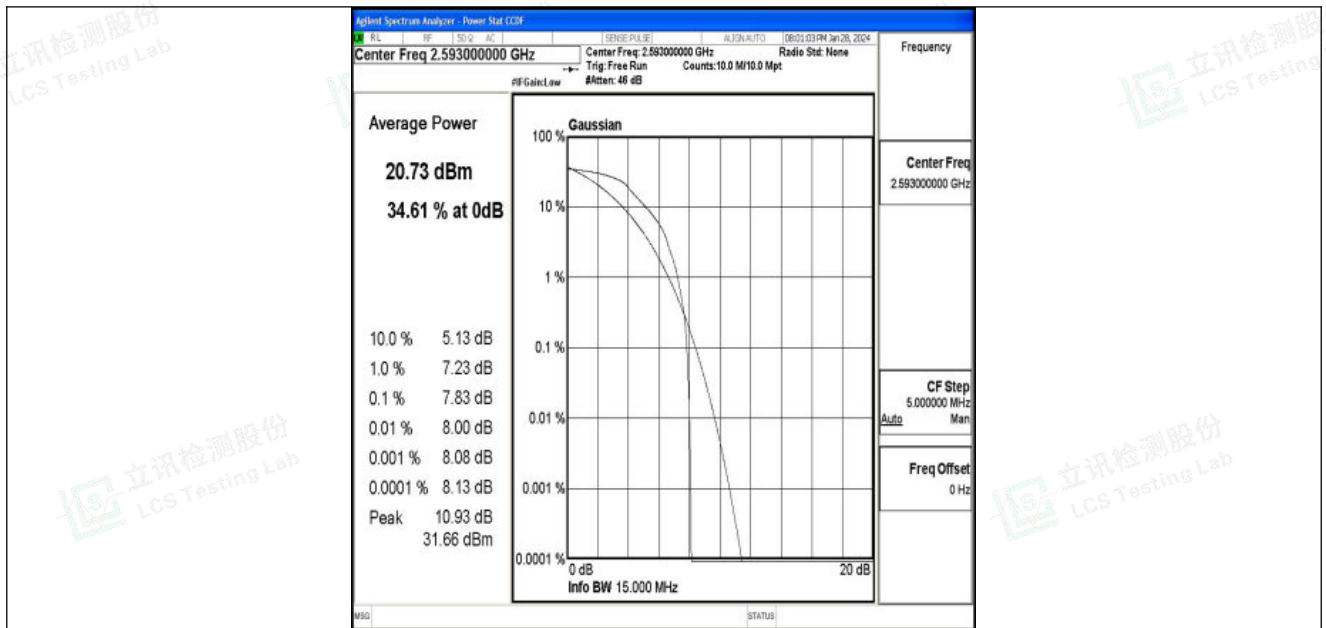

Band41-15MHz-QPSK-40620-1RB#0-PASS

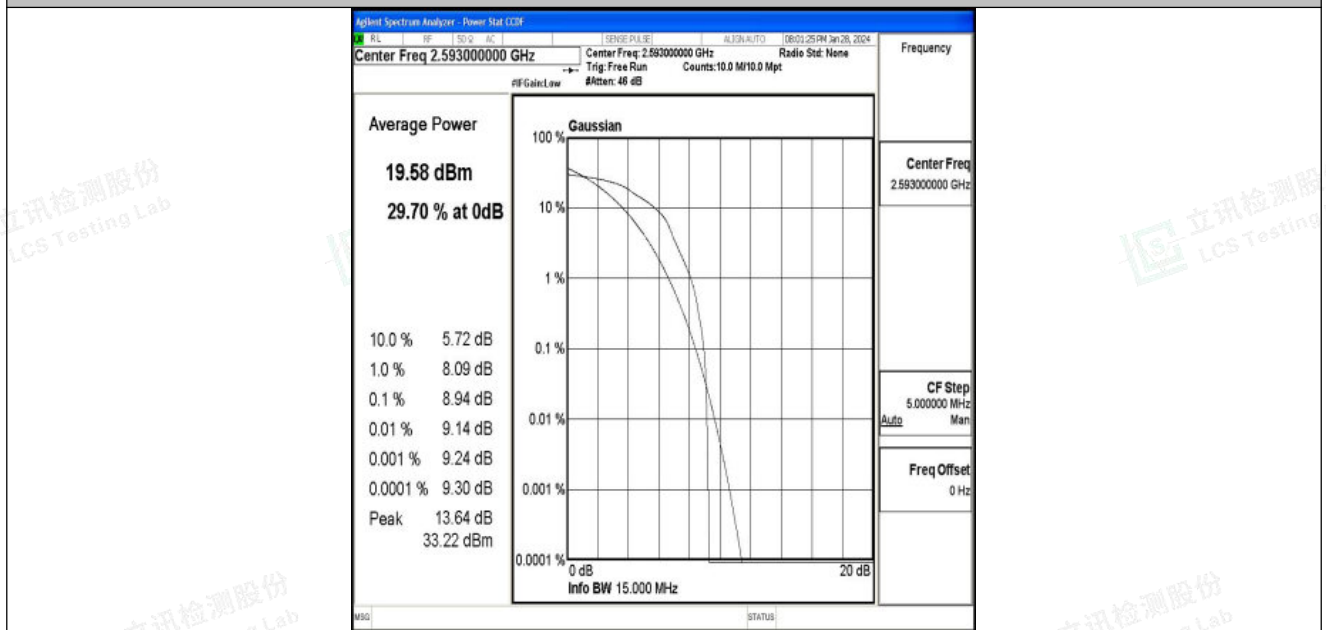

Band41-15MHz-16QAM-40620-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

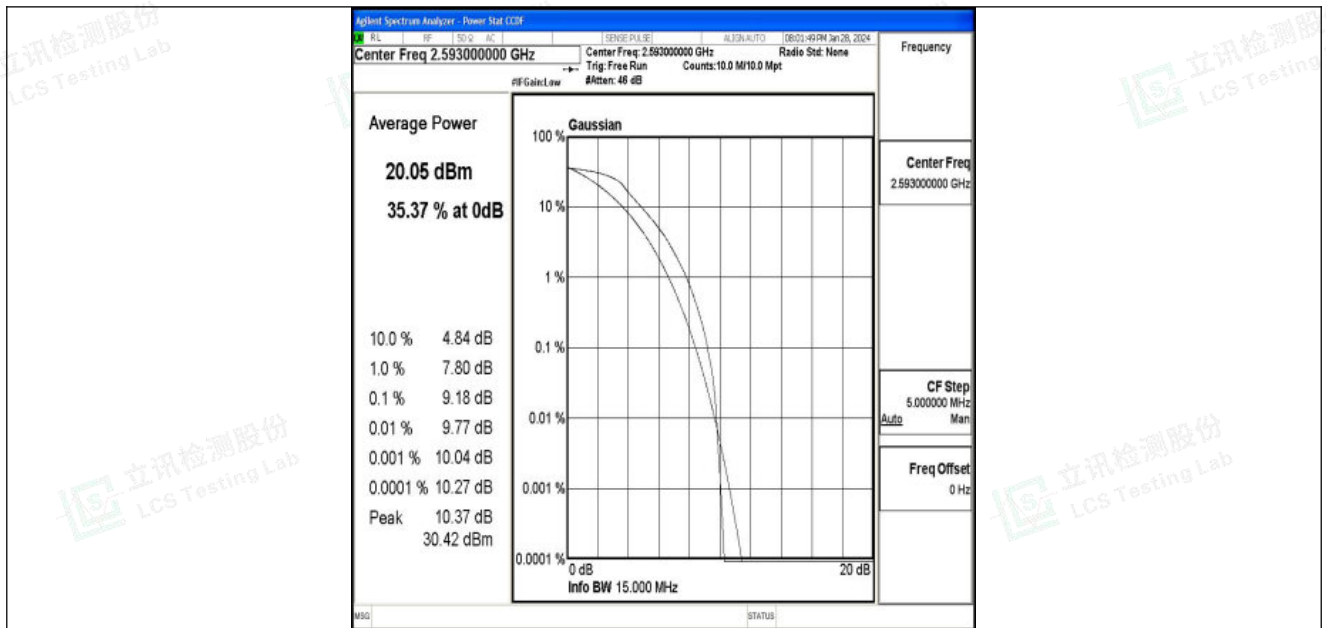

Band41-15MHz-QPSK-40620-75RB#0-PASS

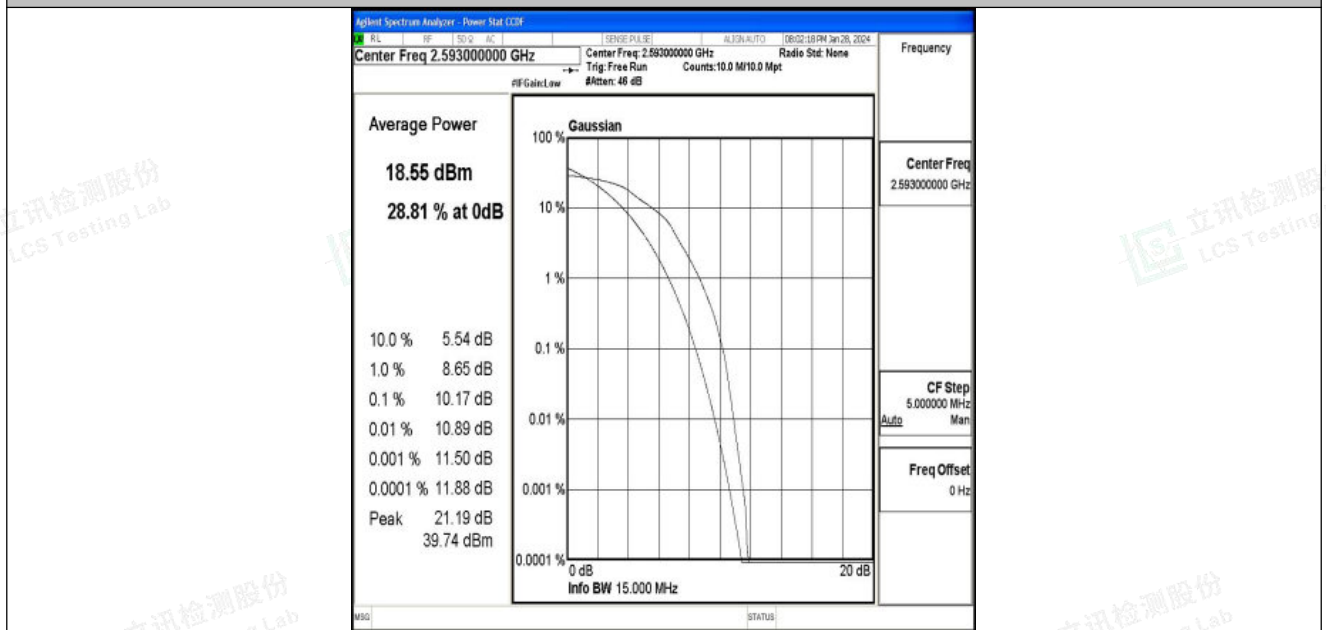

Band41-15MHz-16QAM-40620-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

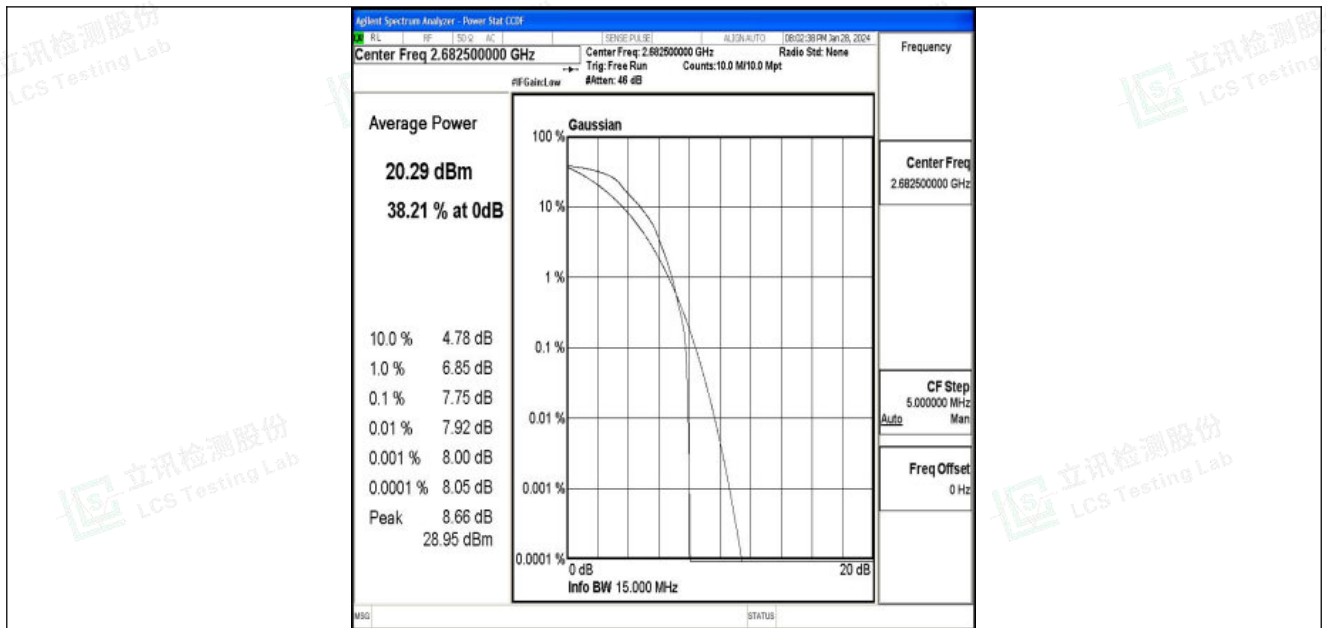

Band41-15MHz-QPSK-41515-1RB#0-PASS

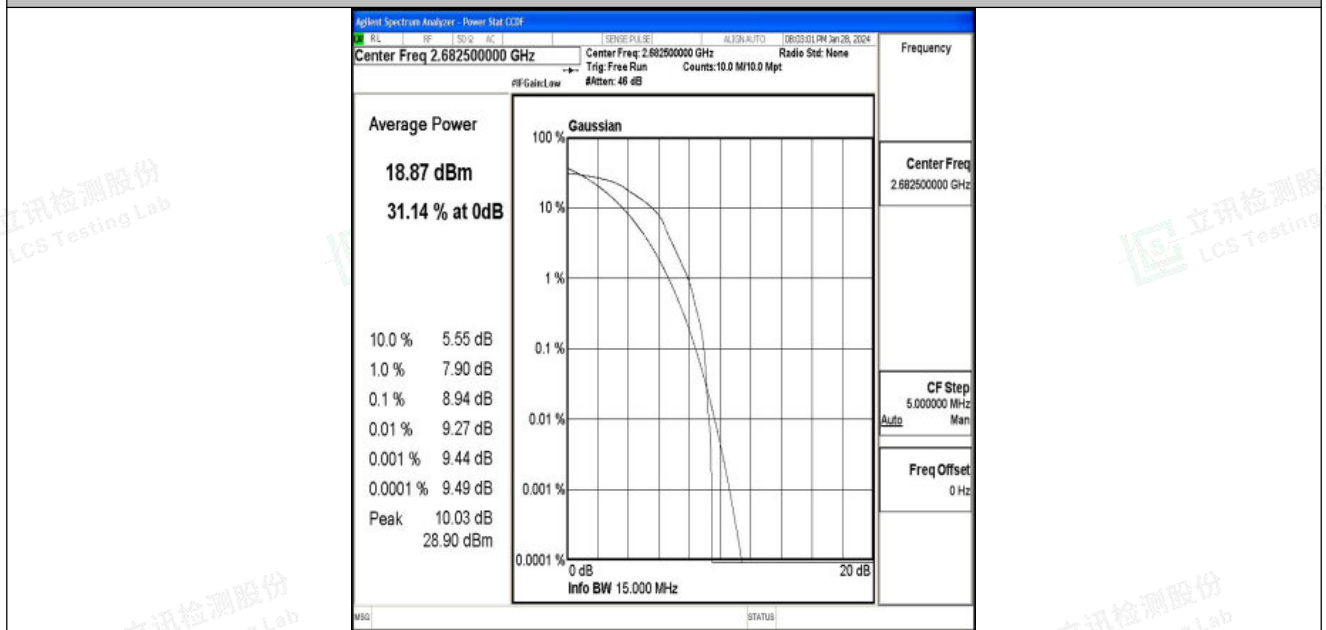

Band41-15MHz-16QAM-41515-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

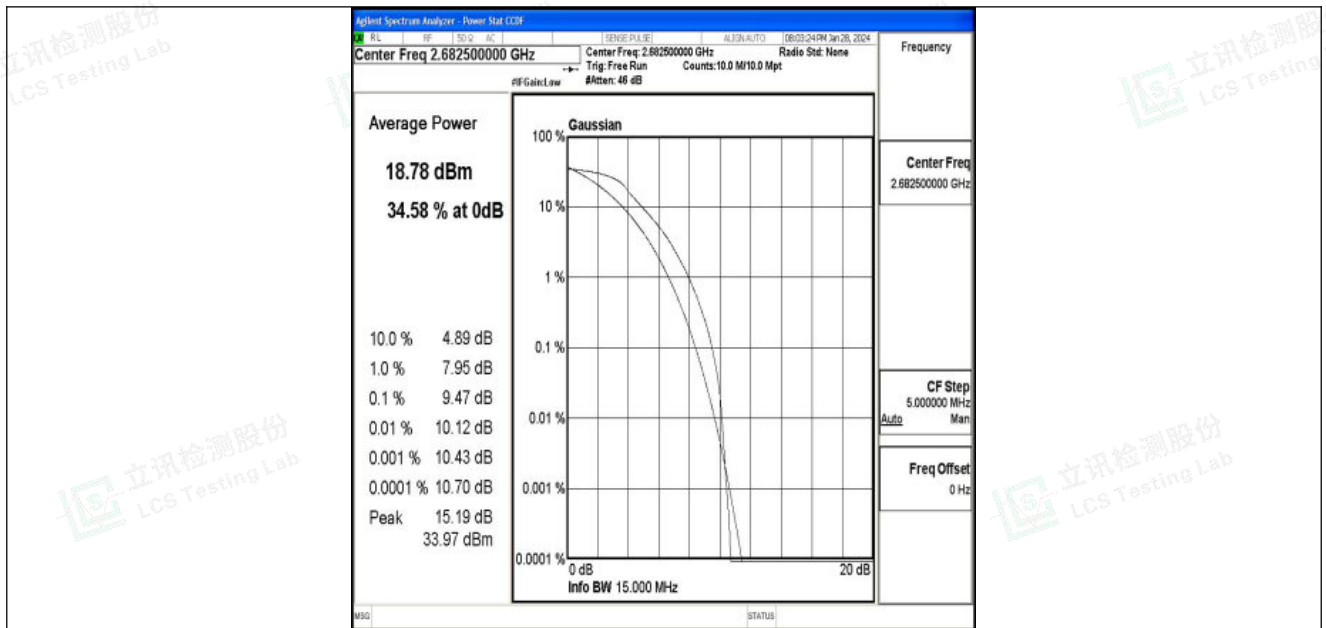

Band41-15MHz-QPSK-41515-75RB#0-PASS

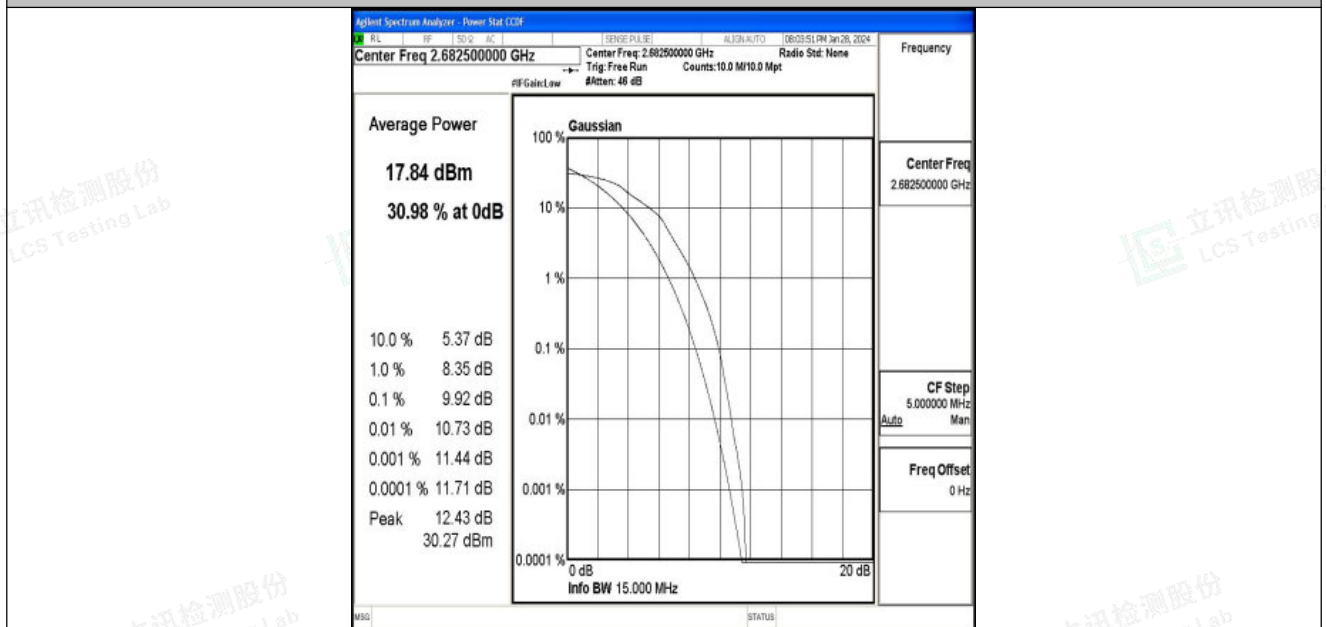

Band41-15MHz-16QAM-41515-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

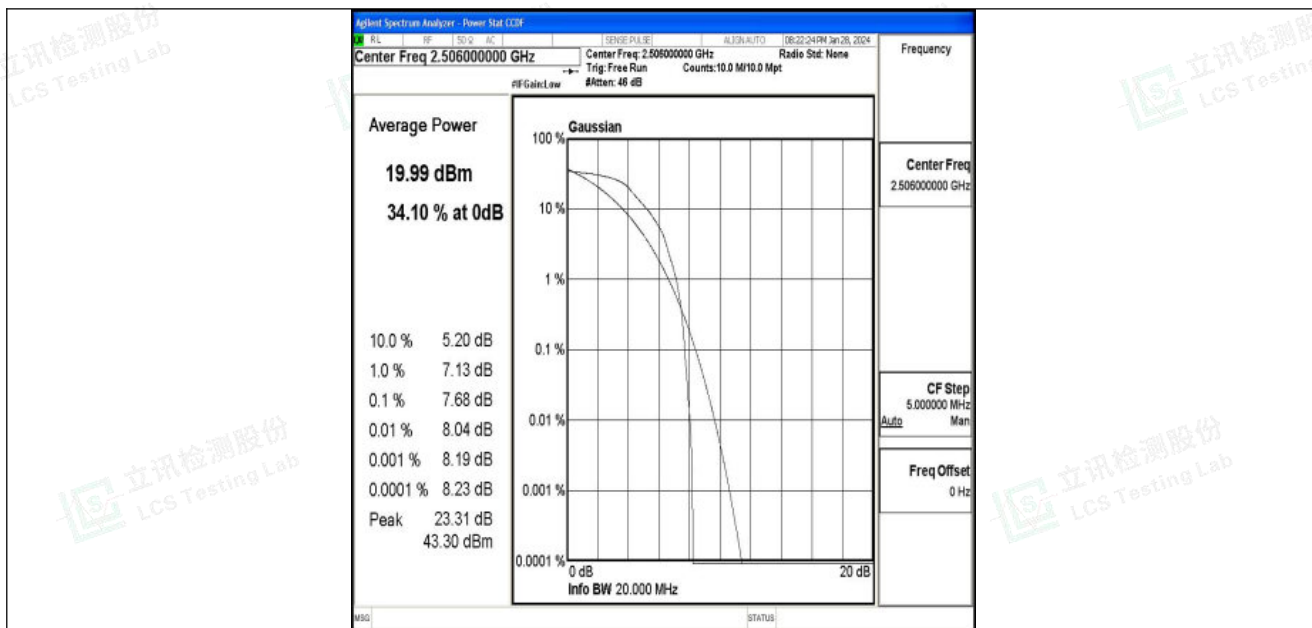

Band41-20MHz-QPSK-39750-1RB#0-PASS

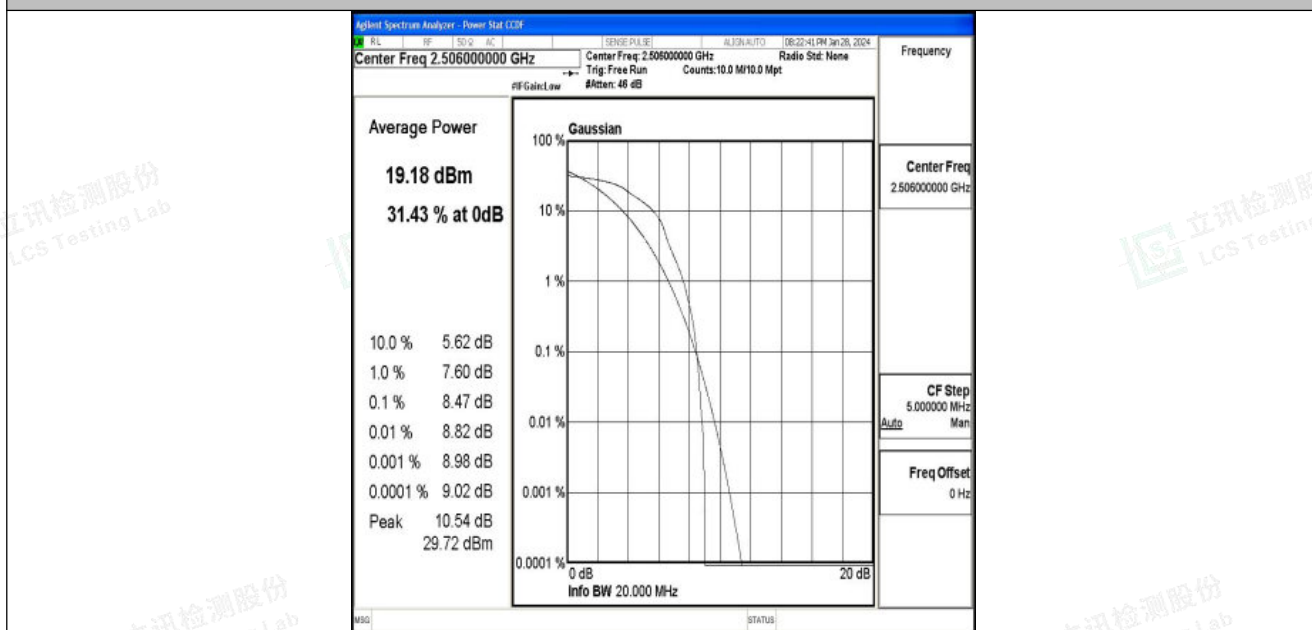

Band41-20MHz-16QAM-39750-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

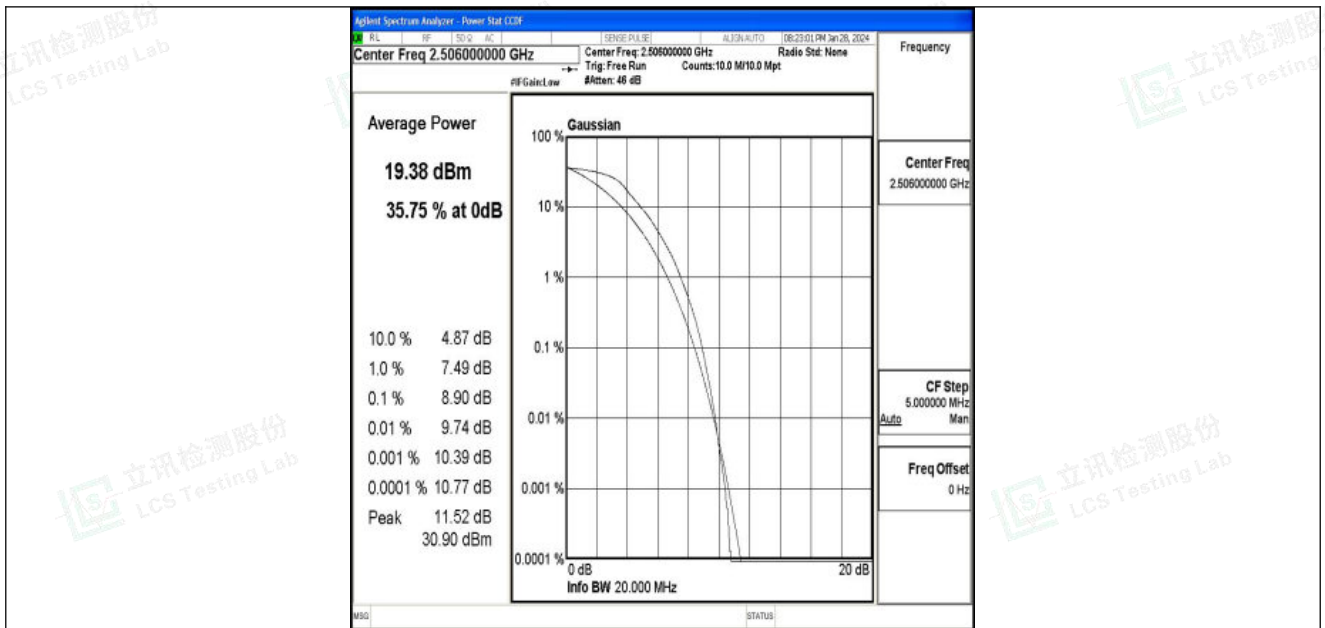

Band41-20MHz-QPSK-39750-100RB#0-PASS

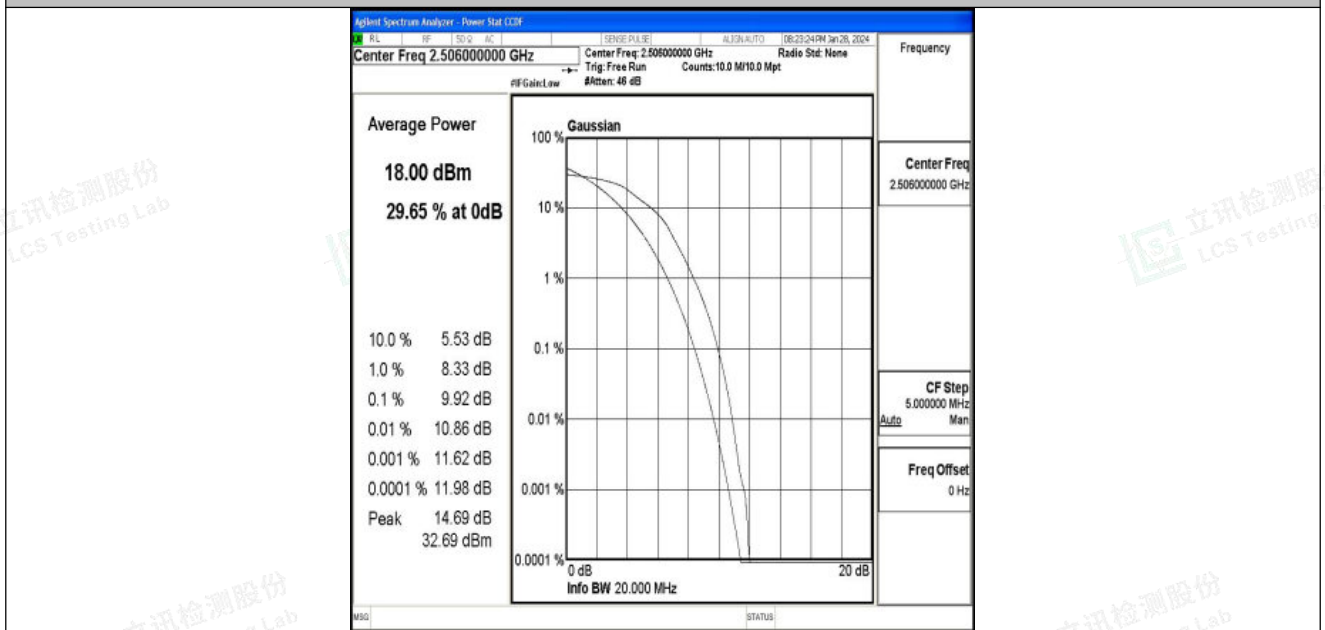

Band41-20MHz-16QAM-39750-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

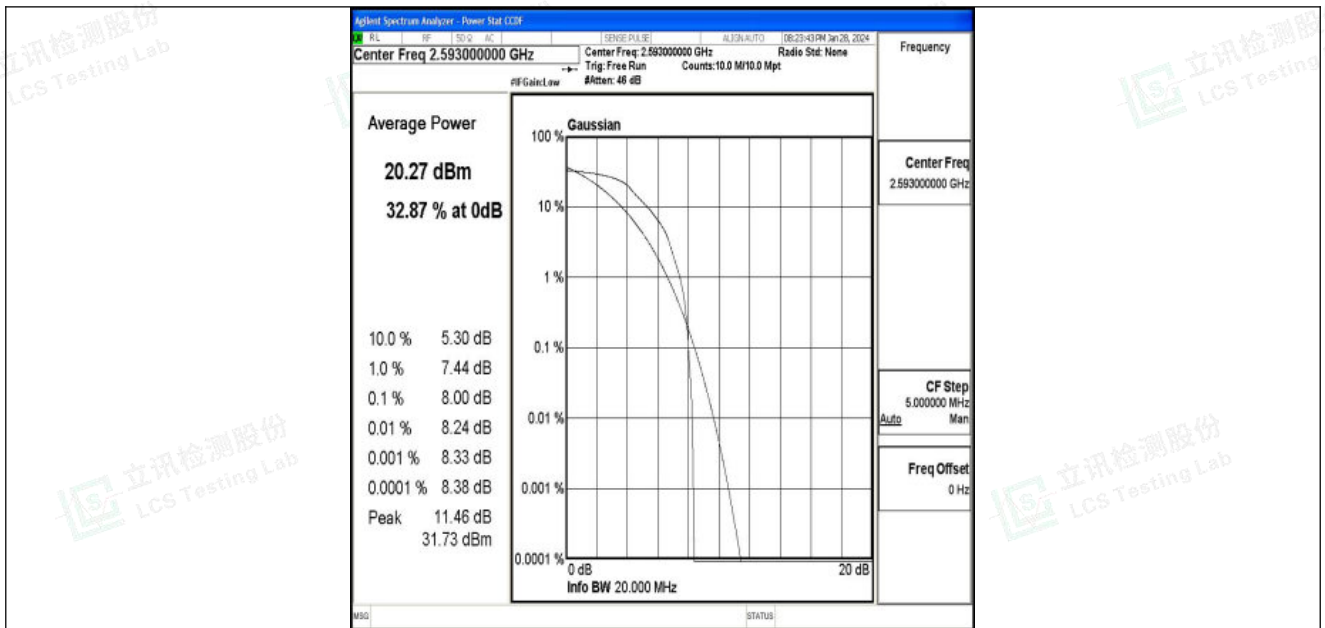

Band41-20MHz-QPSK-40620-1RB#0-PASS

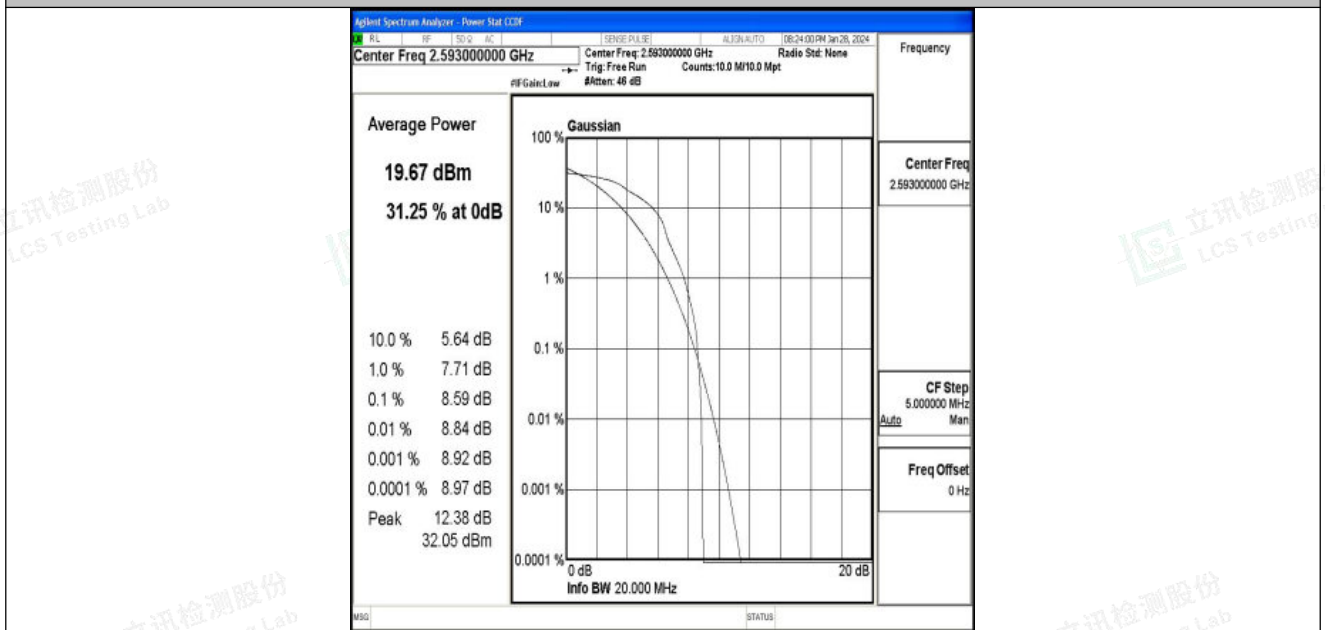

Band41-20MHz-16QAM-40620-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

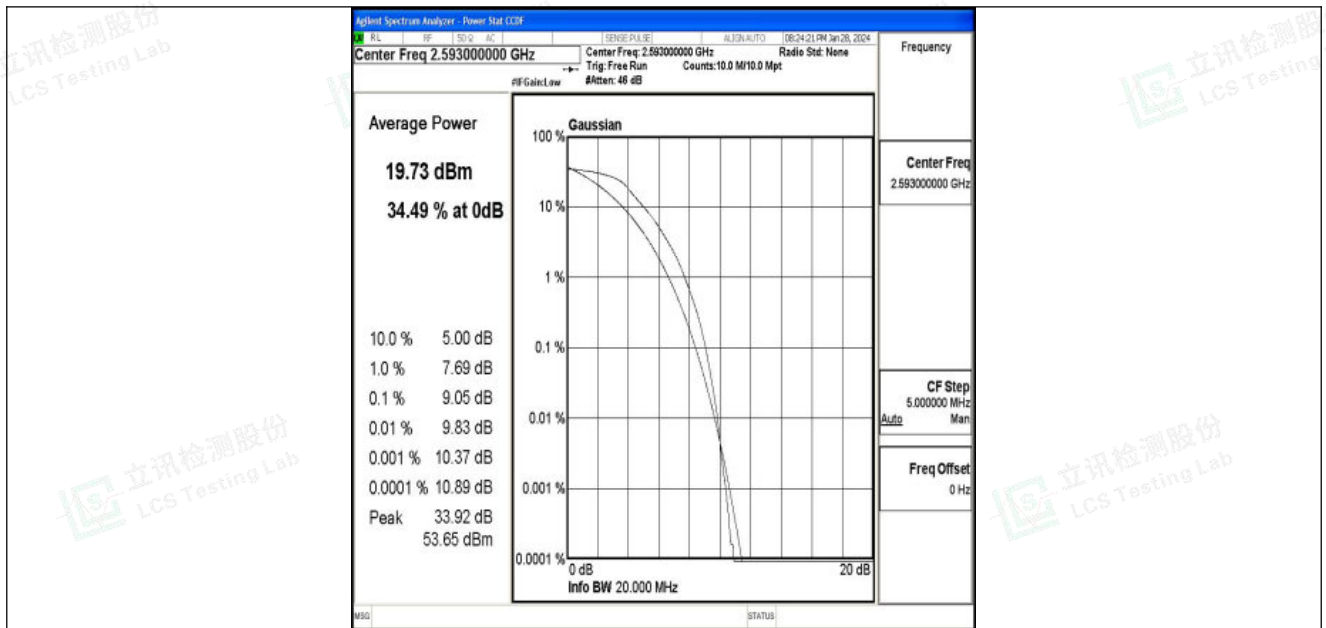

Band41-20MHz-QPSK-40620-100RB#0-PASS

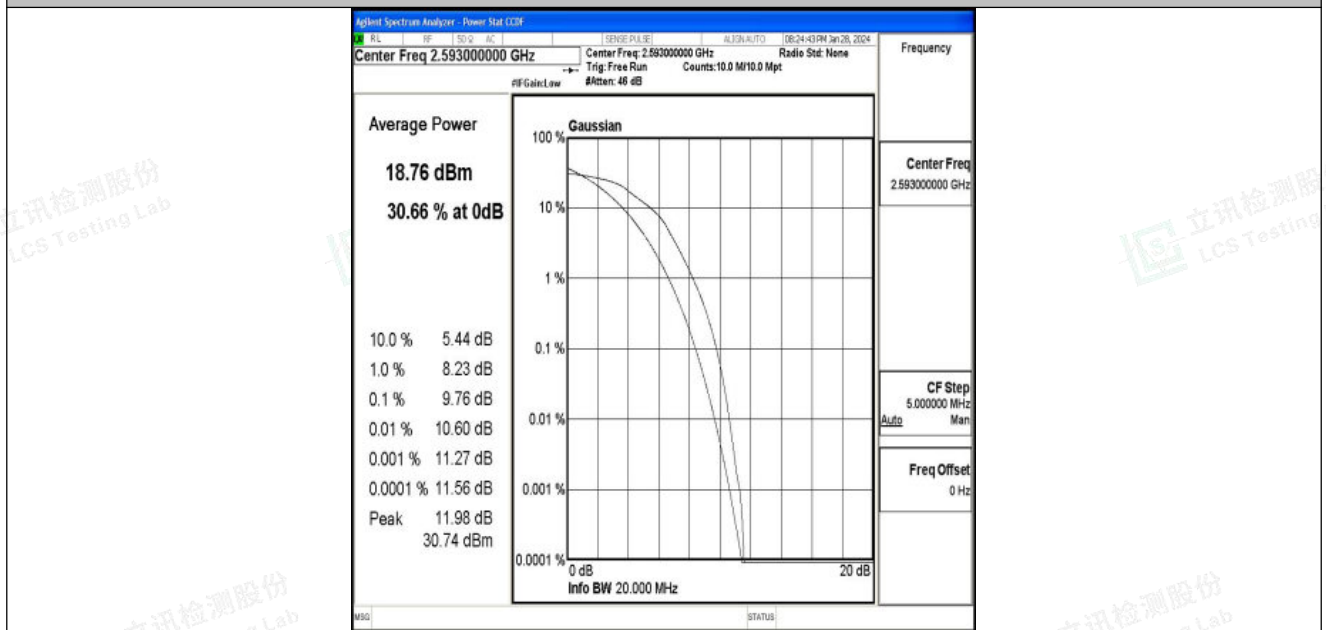

Band41-20MHz-16QAM-40620-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

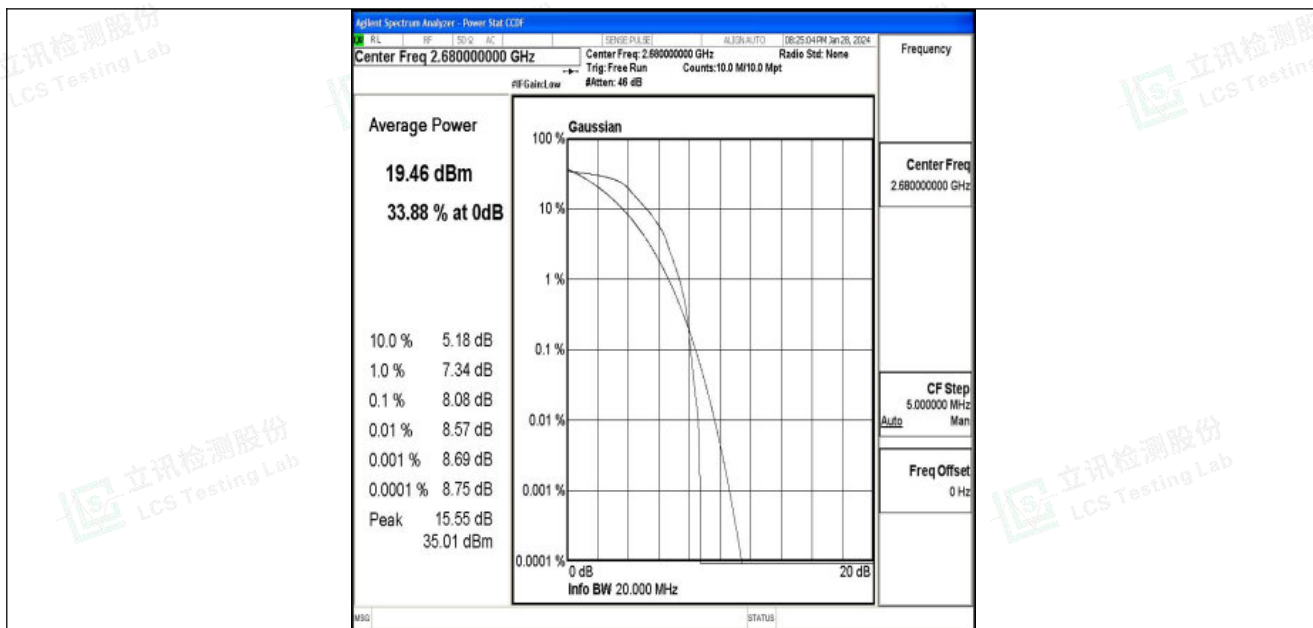

Band41-20MHz-QPSK-41490-1RB#0-PASS

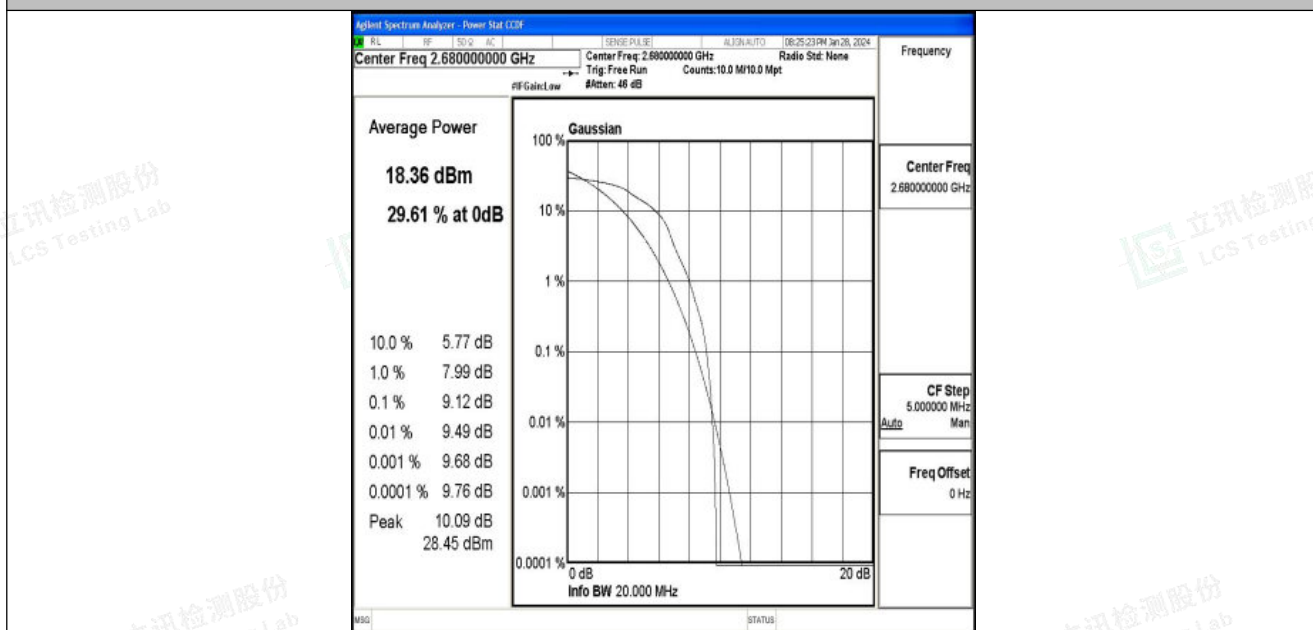

Band41-20MHz-16QAM-41490-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

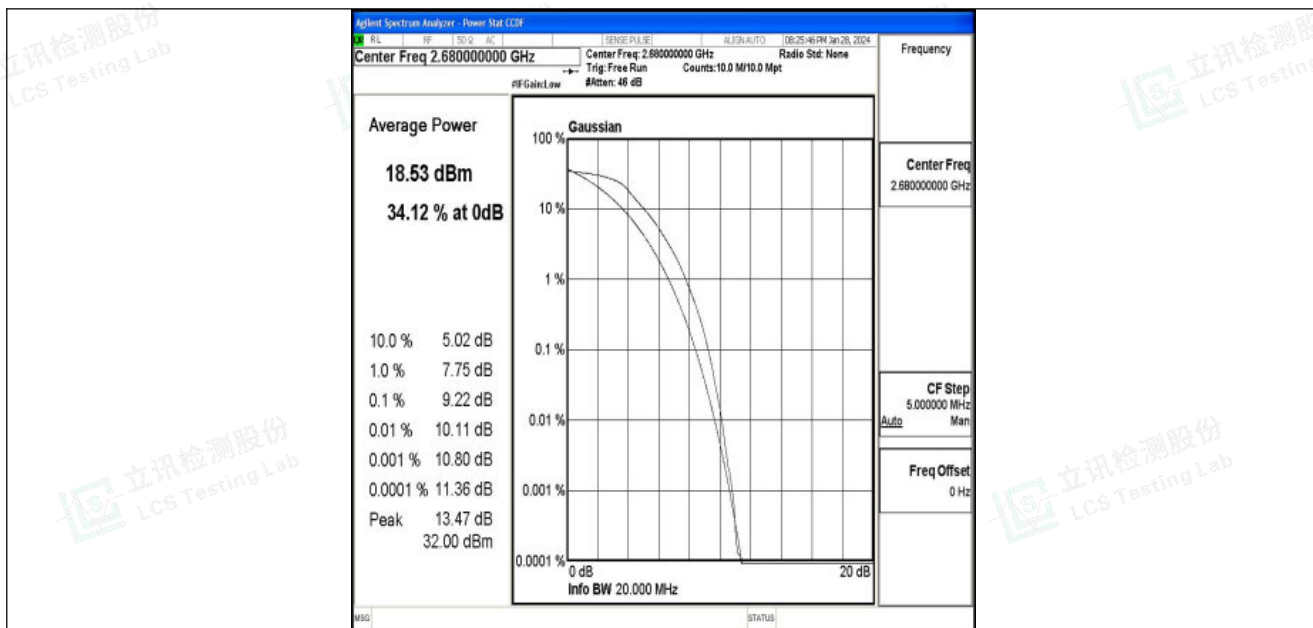

Band41-20MHz-QPSK-41490-100RB#0-PASS

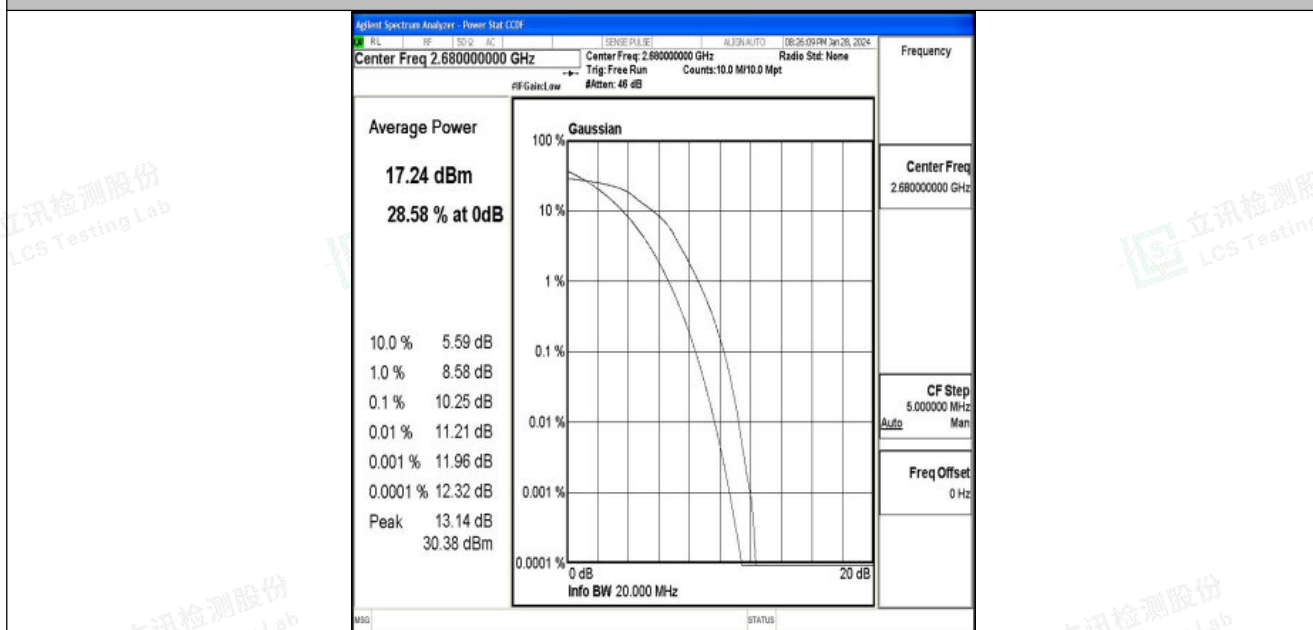

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



C.3 26dB Bandwidth and Occupied Bandwidth


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5011	4.943	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.4914	5.253	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.4930	4.902	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.4955	5.113	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4966	5.113	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.4862	5.097	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.9907	10.64	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9788	9.900	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.9751	10.58	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9756	9.807	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.9728	10.000	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.0003	10.42	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.473	16.44	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.555	17.67	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.492	15.18	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.478	15.20	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.514	15.16	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.498	15.16	PASS
Band41	20MHz	QPSK	39750	100RB#0	18.013	19.66	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.941	20.44	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.945	19.84	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.904	19.77	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.931	19.85	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.933	19.36	PASS






Test Graphs

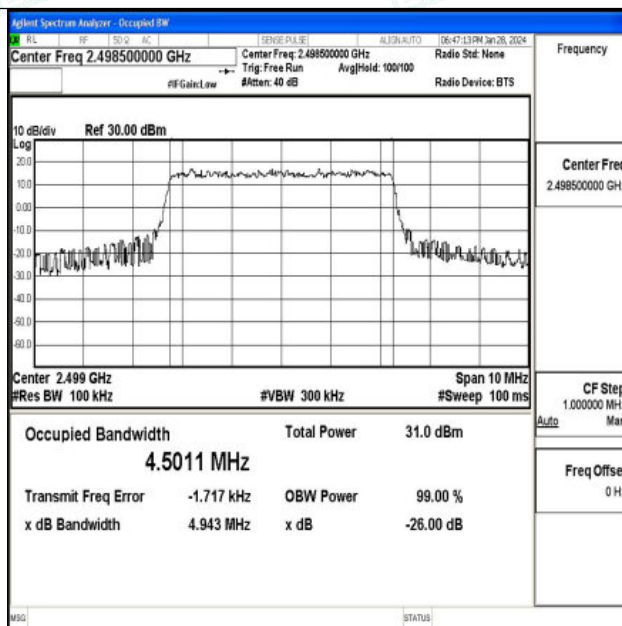

Band41-5MHz-QPSK-39675-25RB#0-PASS

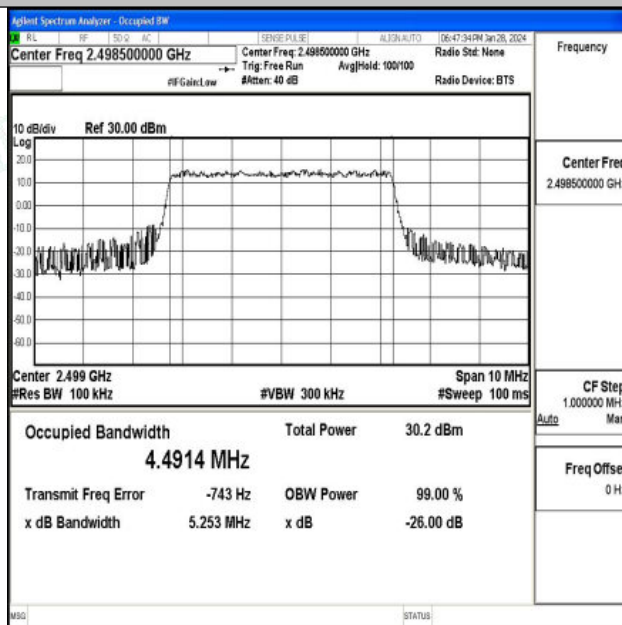

Band41-5MHz-16QAM-39675-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

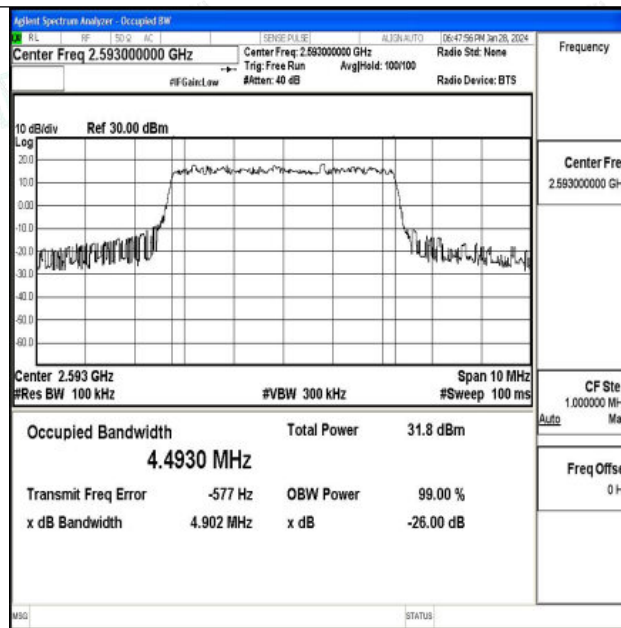

Band41-5MHz-QPSK-40620-25RB#0-PASS

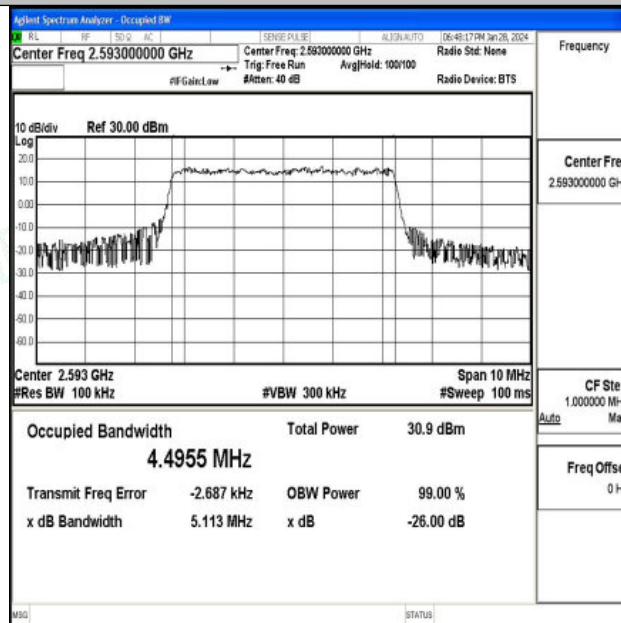

Band41-5MHz-16QAM-40620-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

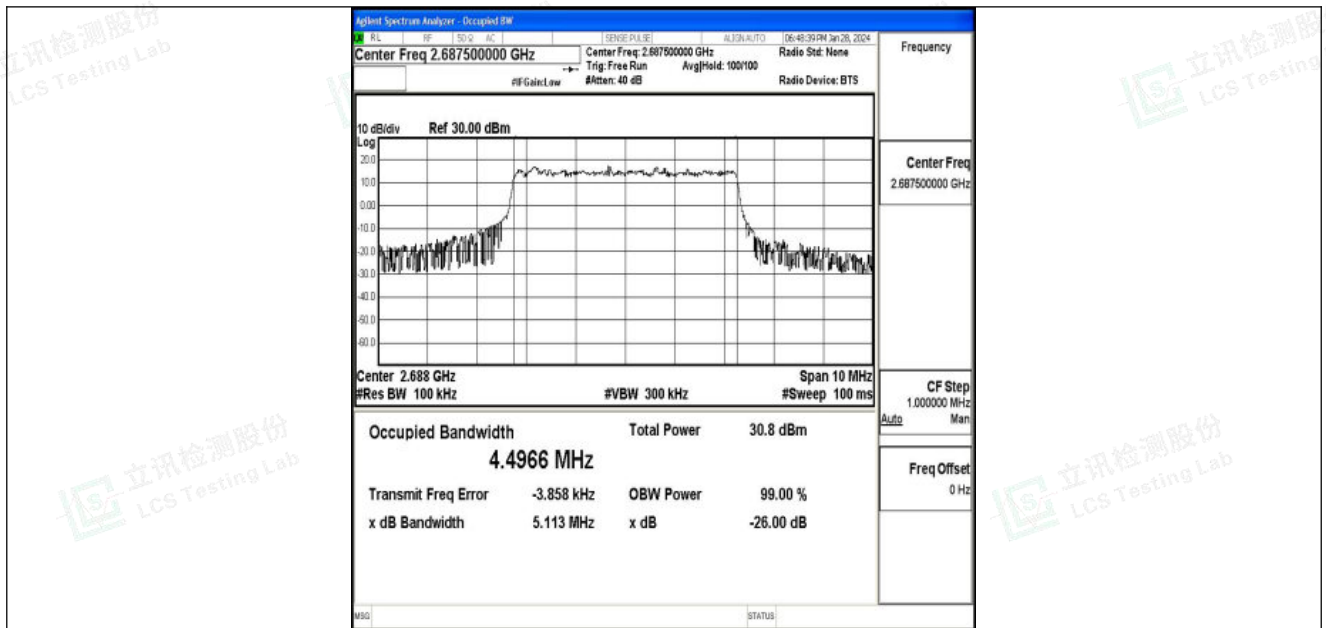

Band41-5MHz-QPSK-41565-25RB#0-PASS

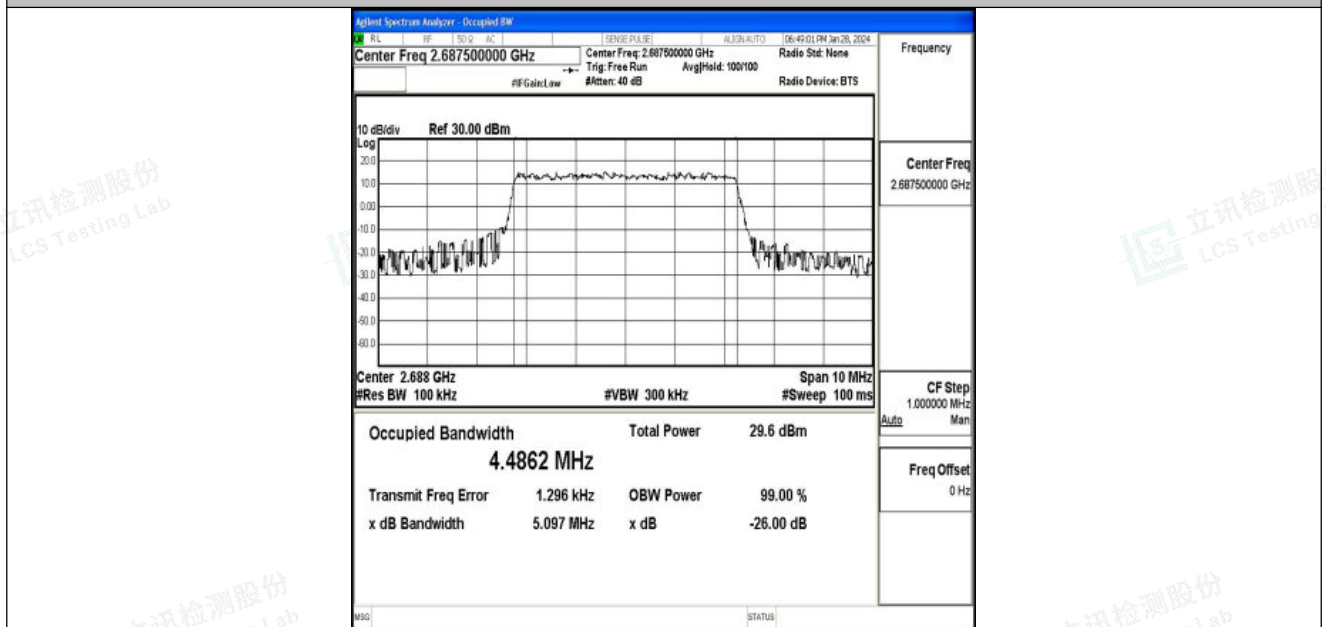

Band41-5MHz-16QAM-41565-25RB#0-PASS





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

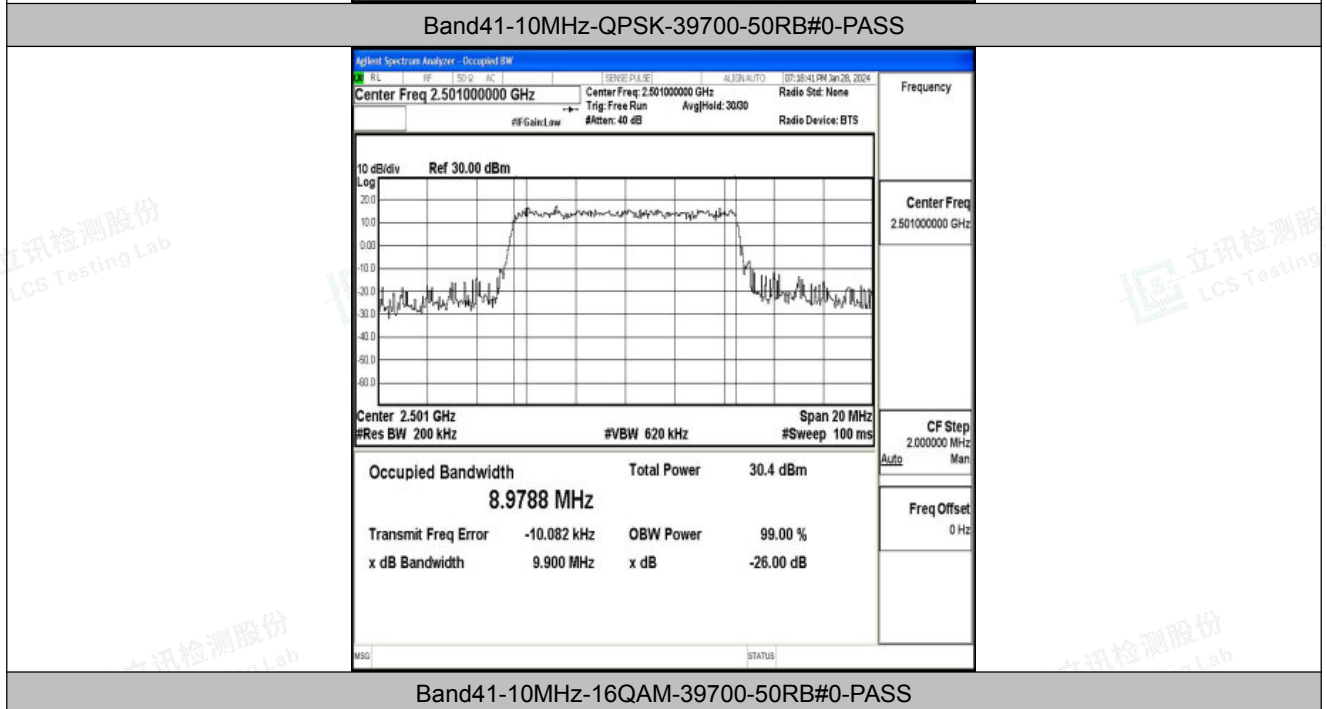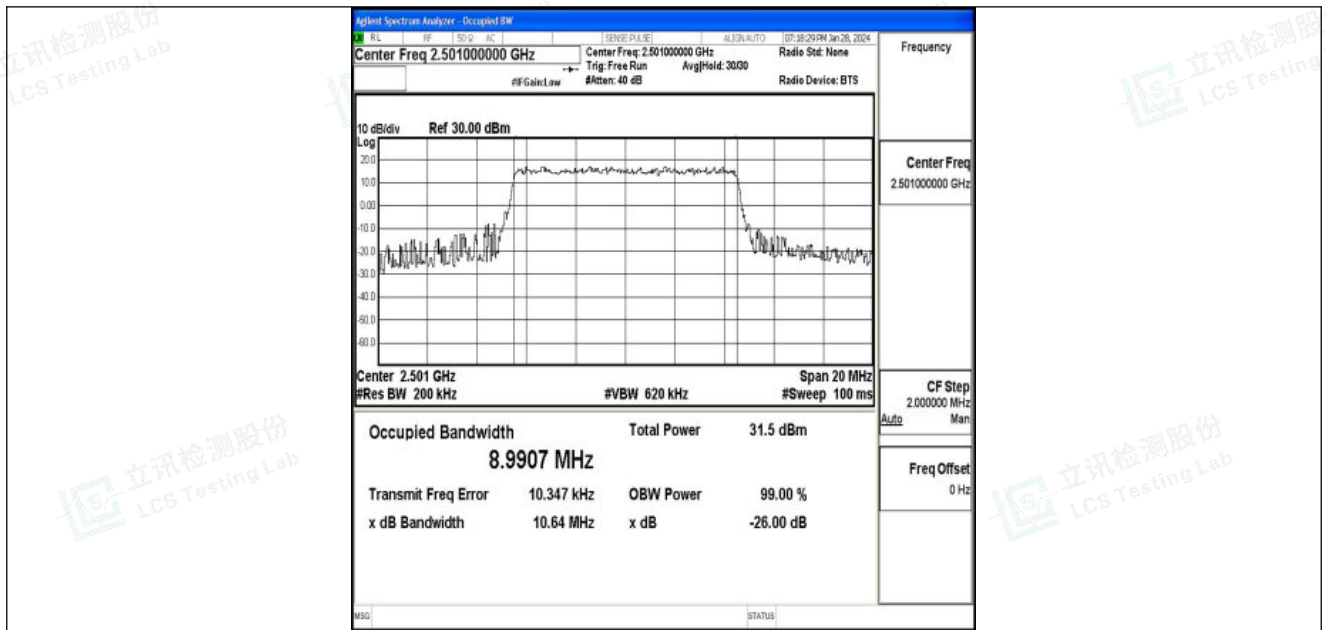


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

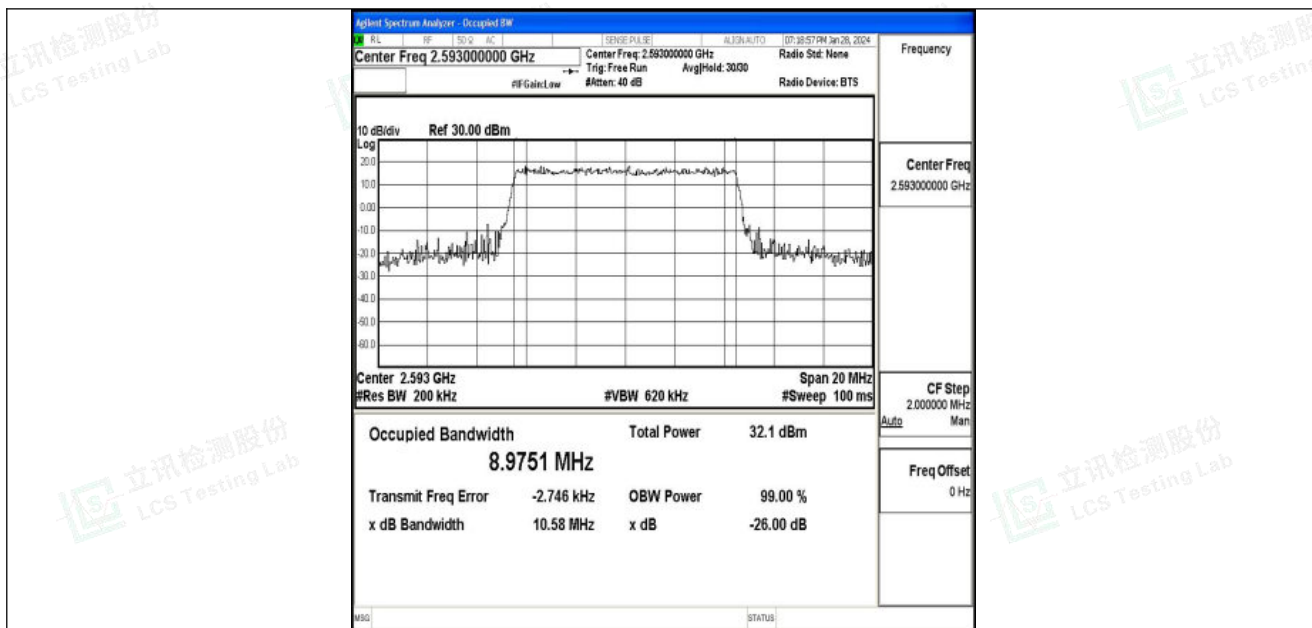

Band41-10MHz-QPSK-40620-50RB#0-PASS

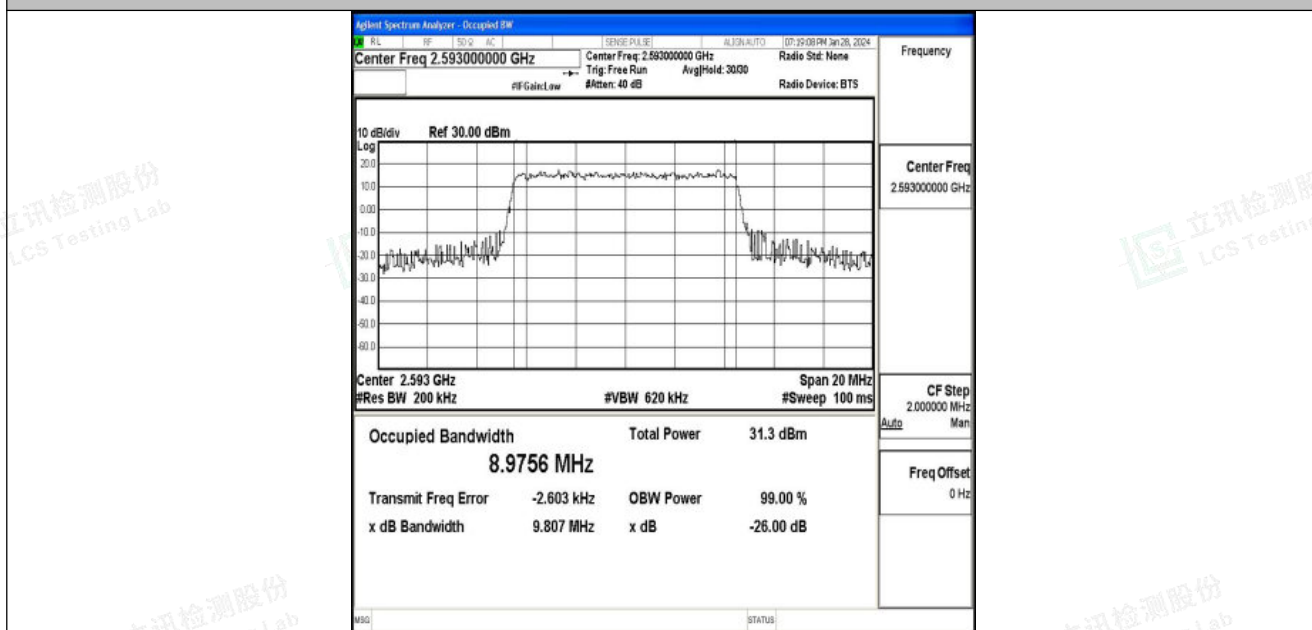

Band41-10MHz-16QAM-40620-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

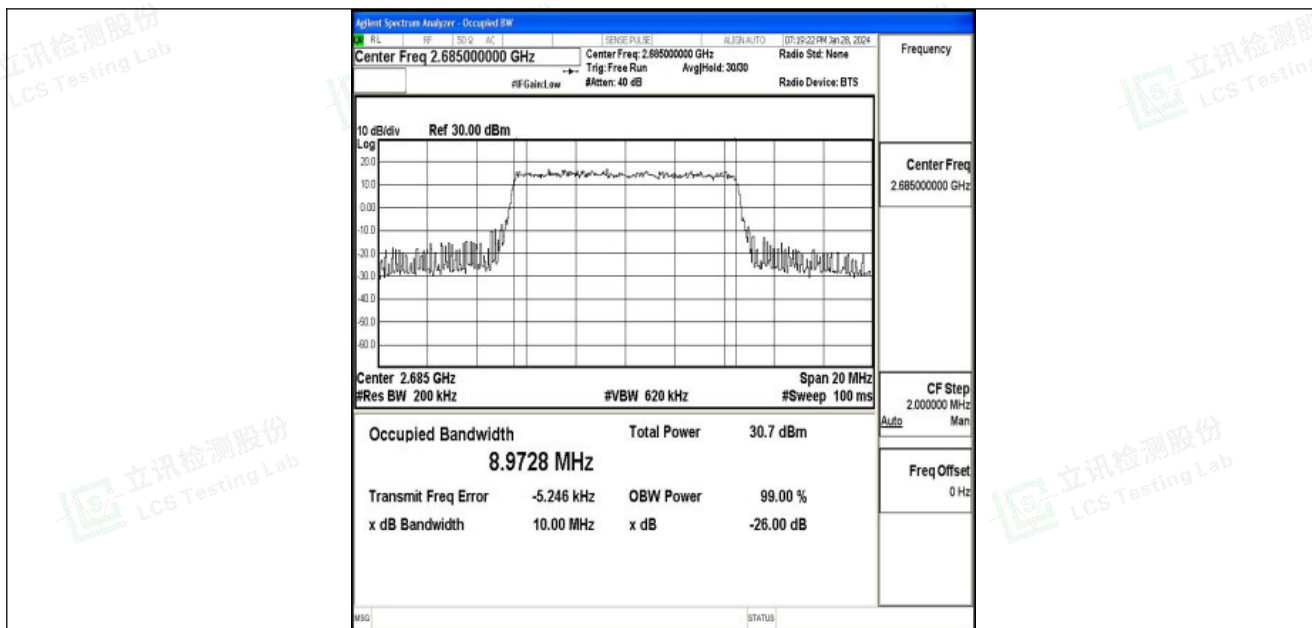

Band41-10MHz-QPSK-41540-50RB#0-PASS

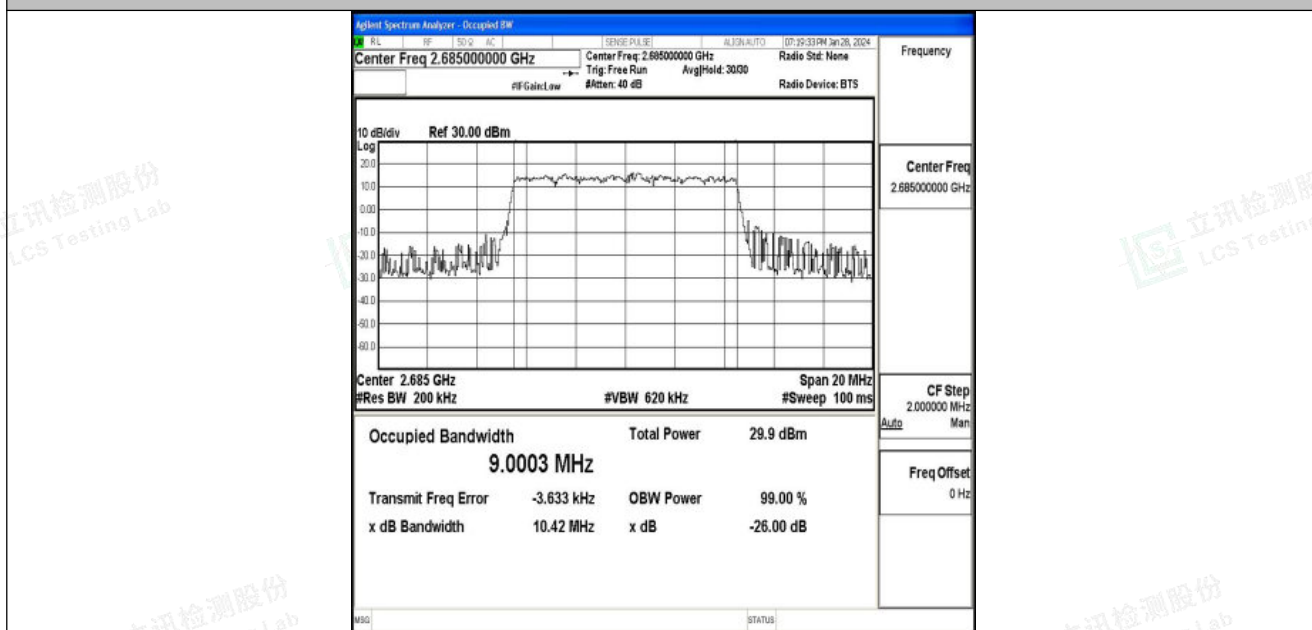

Band41-10MHz-16QAM-41540-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

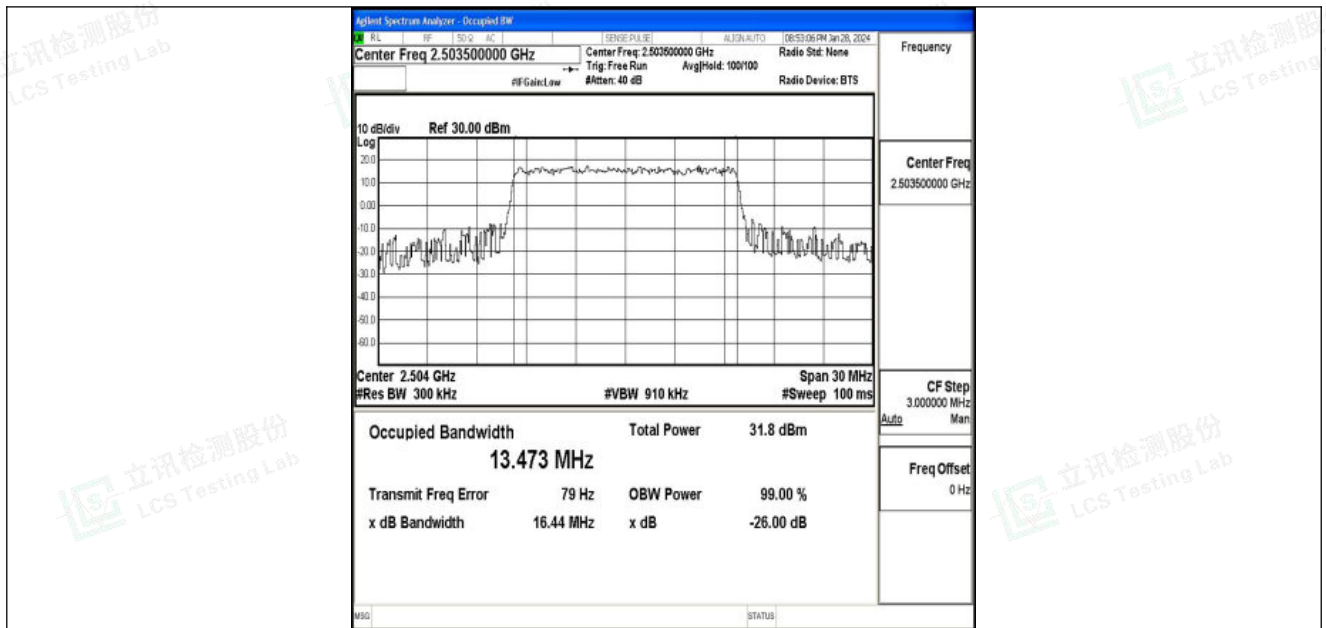


Band41-15MHz-QPSK-39725-75RB#0-PASS

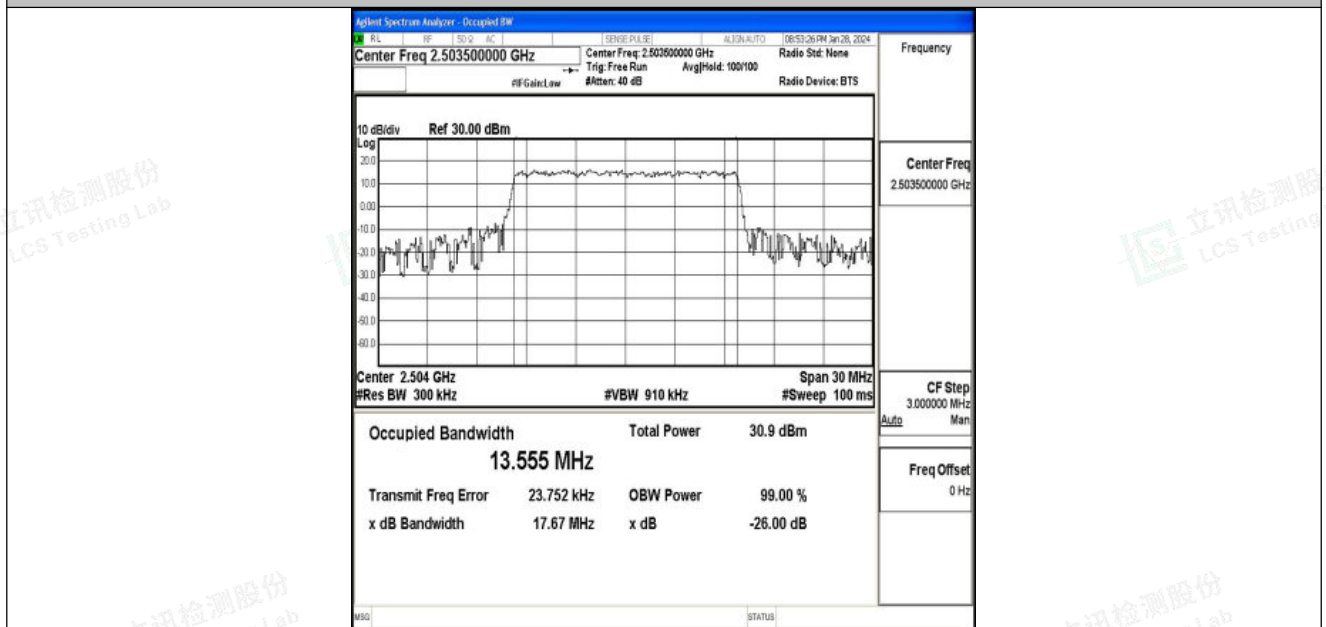


Band41-15MHz-16QAM-39725-75RB#0-PASS



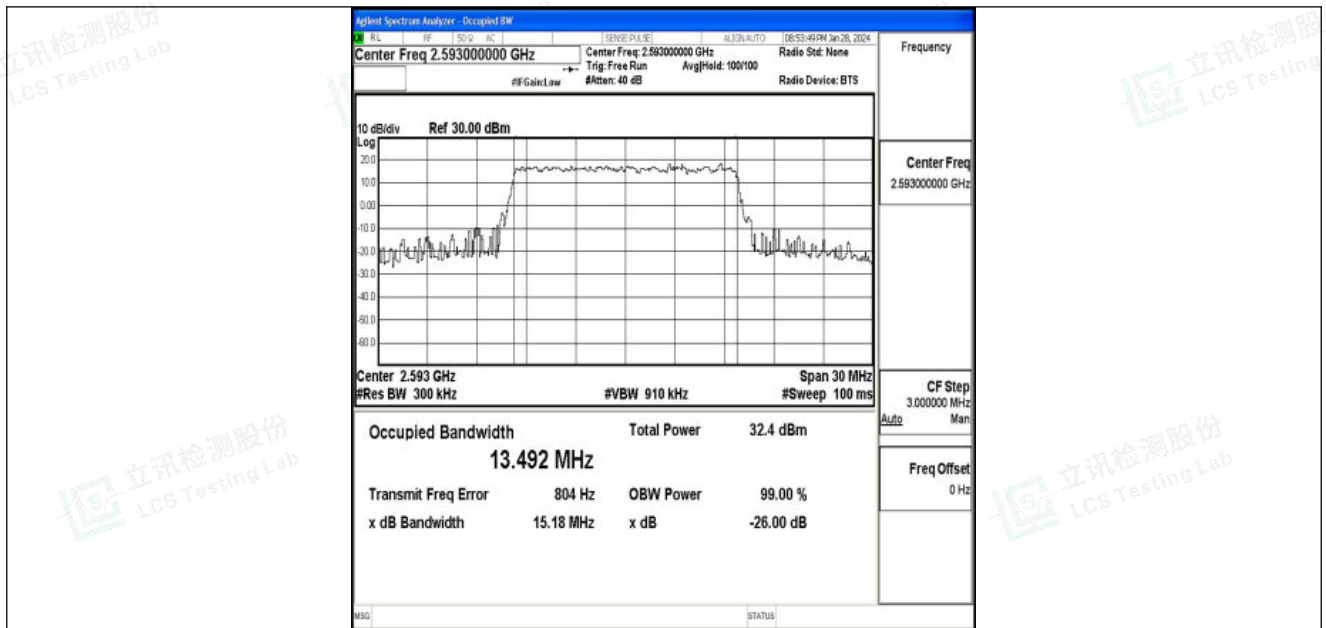

Band41-15MHz-QPSK-40620-75RB#0-PASS

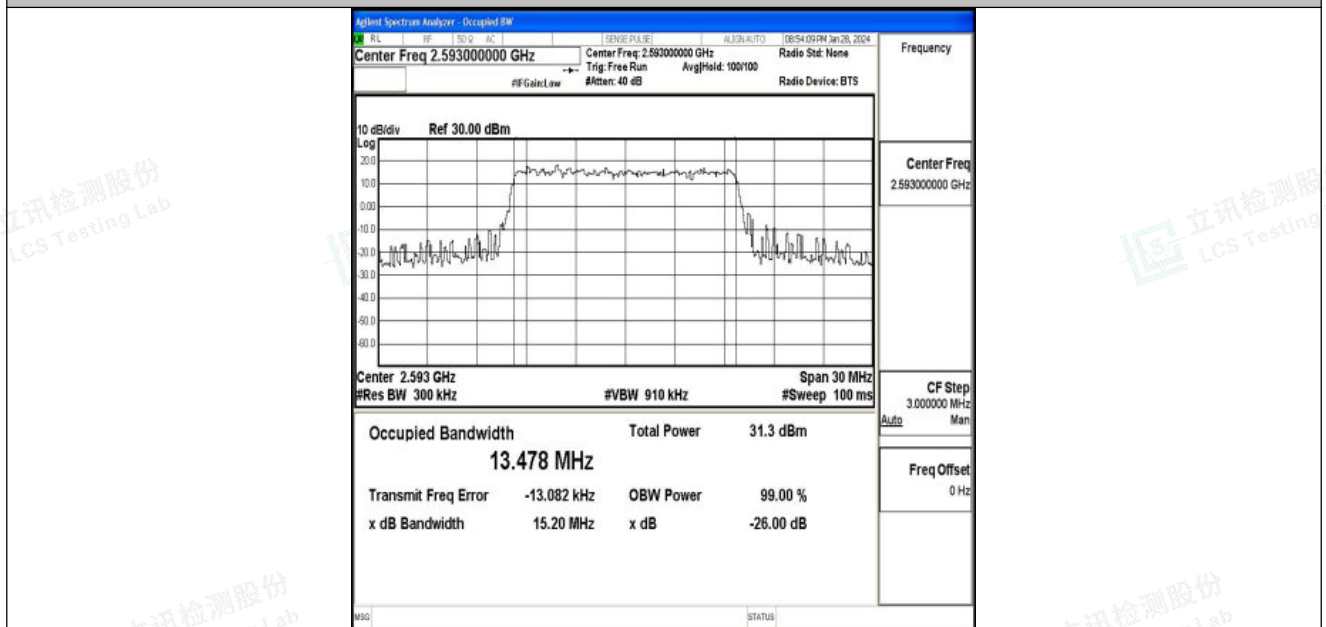

Band41-15MHz-16QAM-40620-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

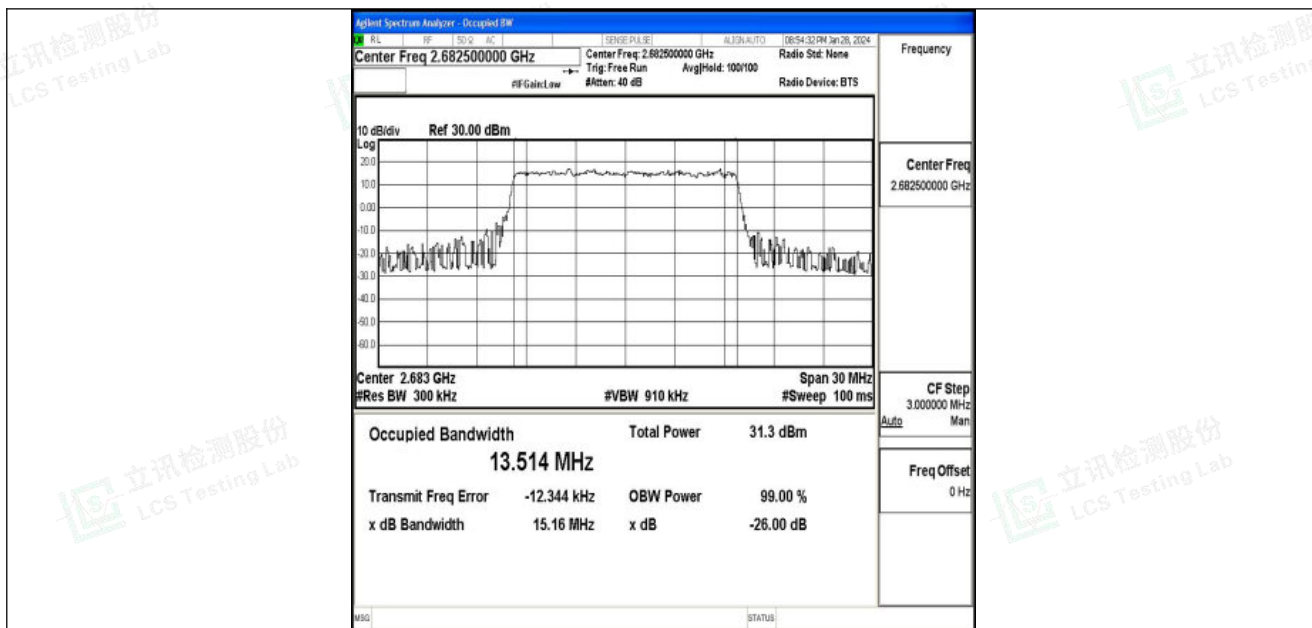

Band41-15MHz-QPSK-41515-75RB#0-PASS

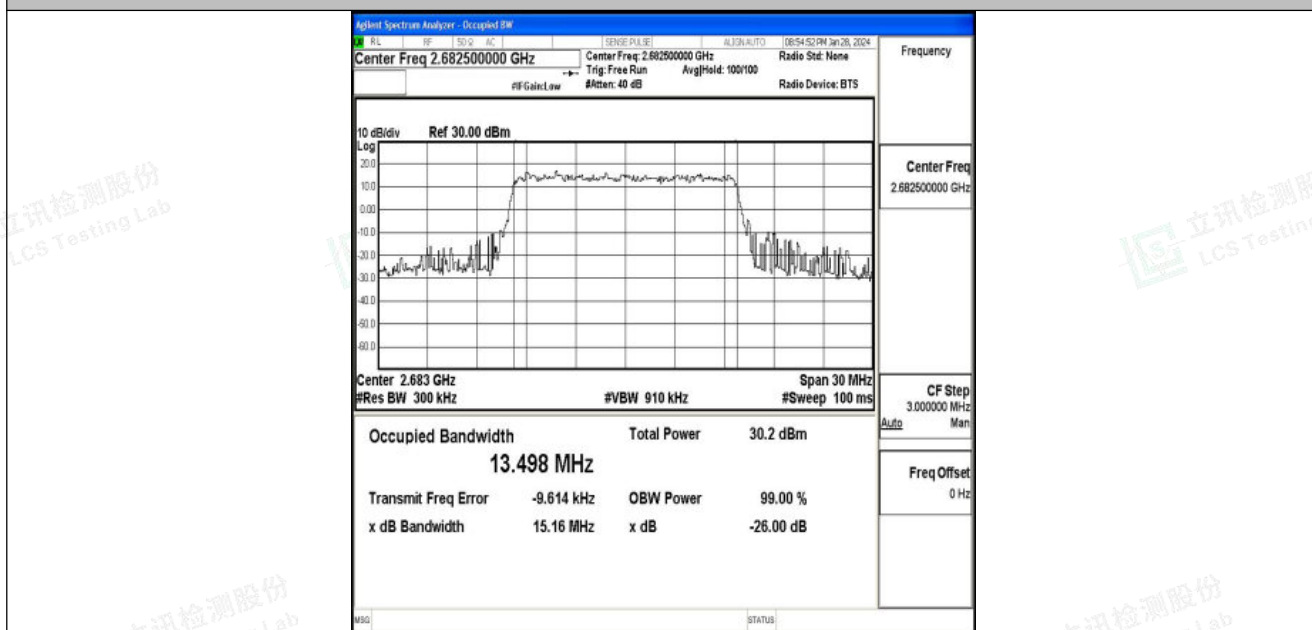

Band41-15MHz-16QAM-41515-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

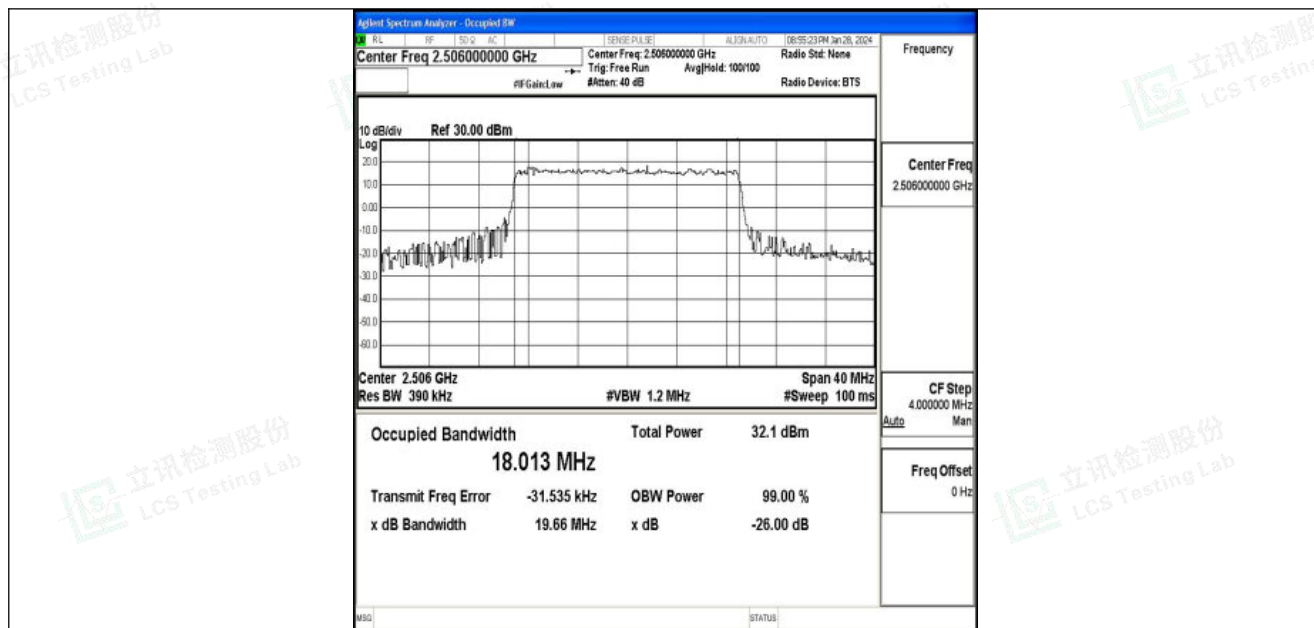

Band41-20MHz-QPSK-39750-100RB#0-PASS

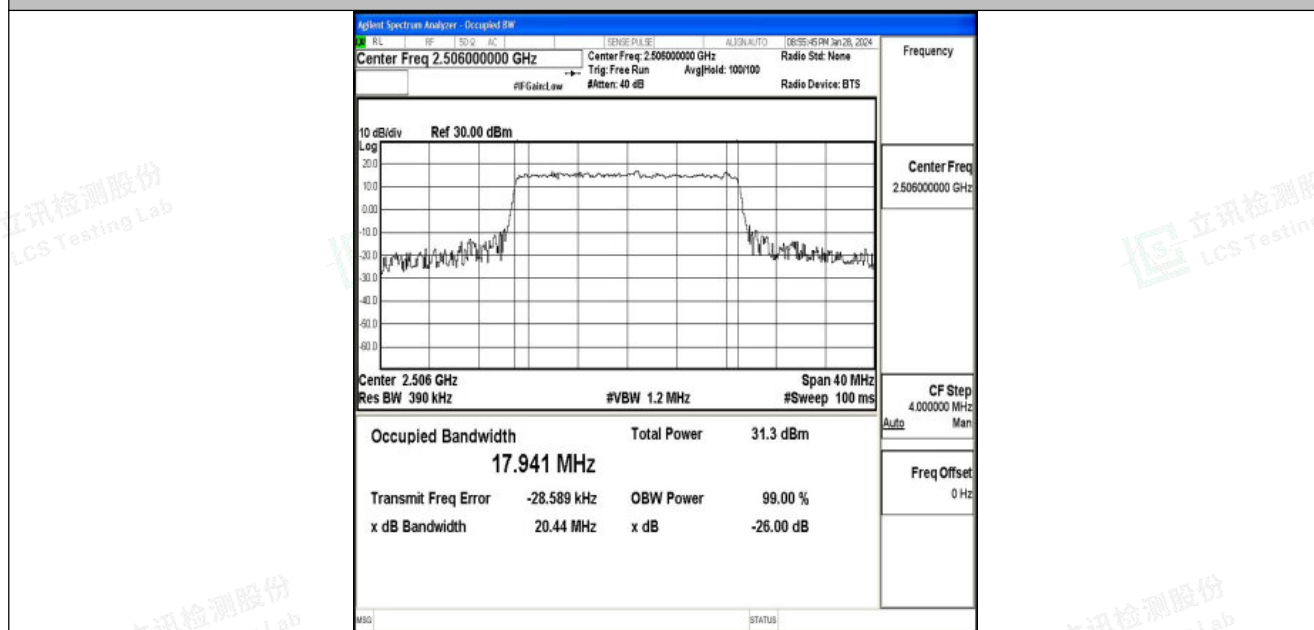

Band41-20MHz-16QAM-39750-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

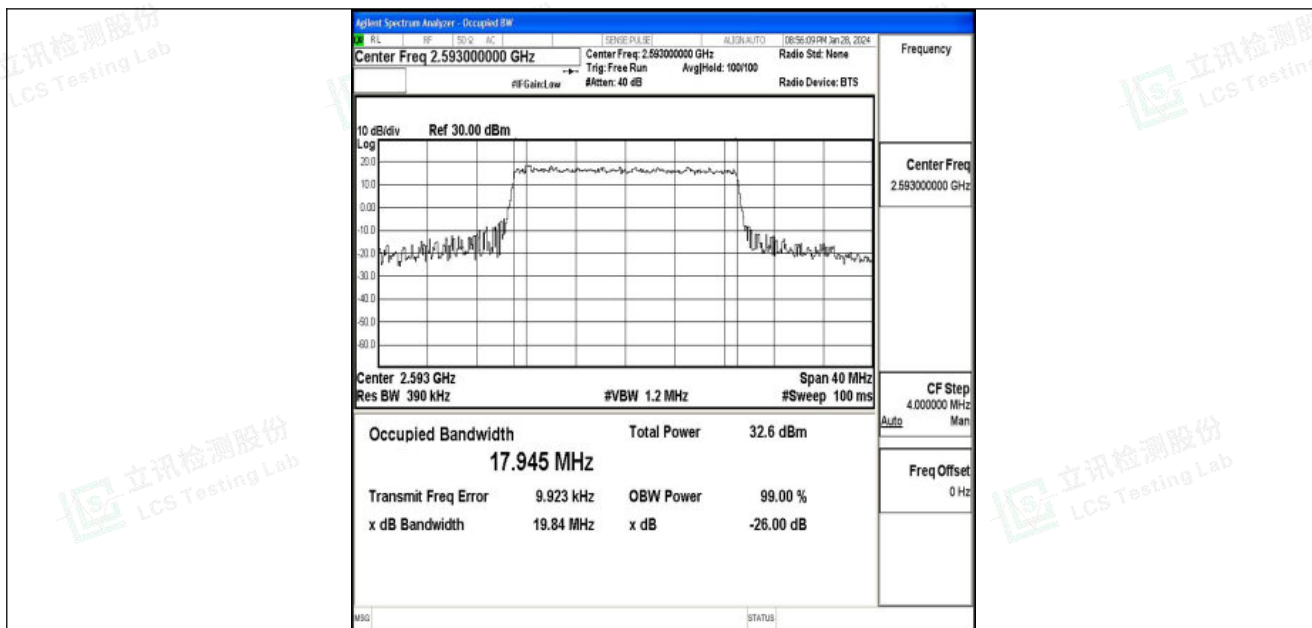

Band41-20MHz-QPSK-40620-100RB#0-PASS

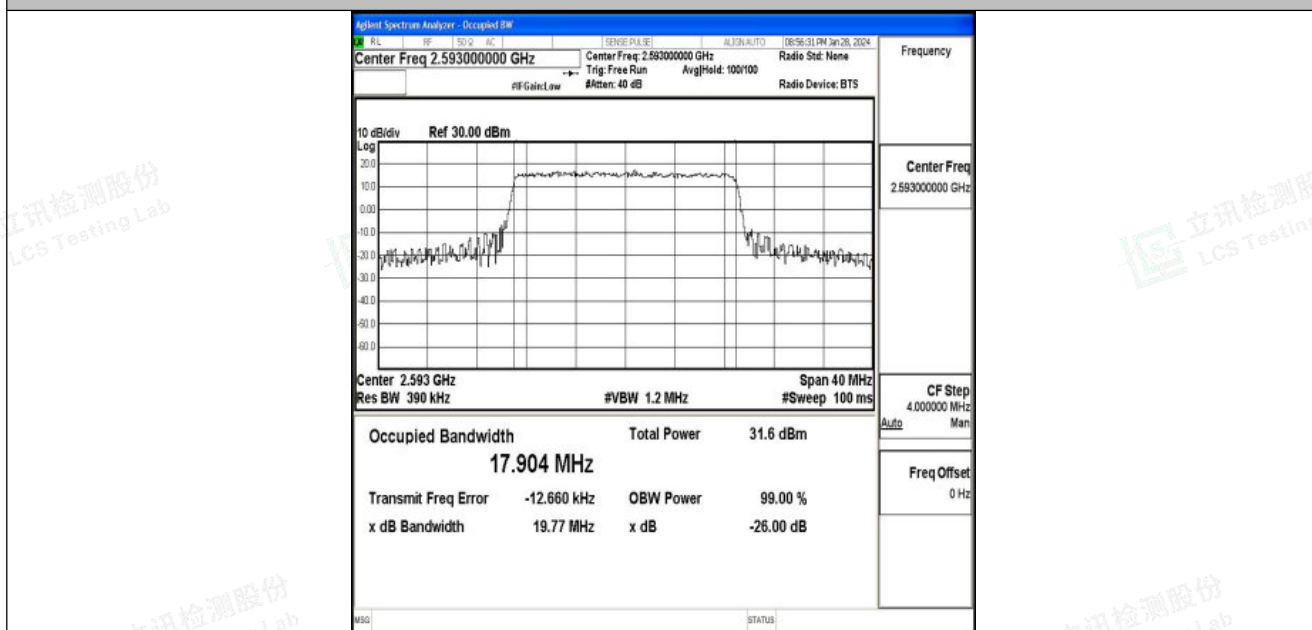

Band41-20MHz-16QAM-40620-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

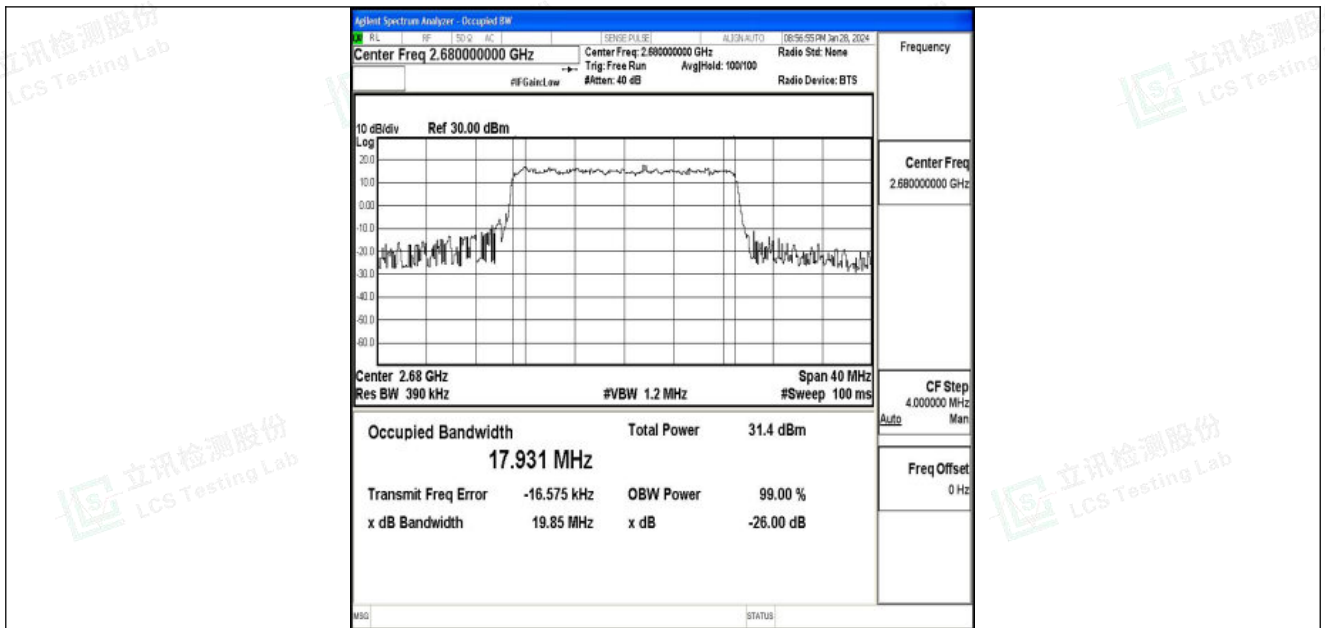

Band41-20MHz-QPSK-41490-100RB#0-PASS

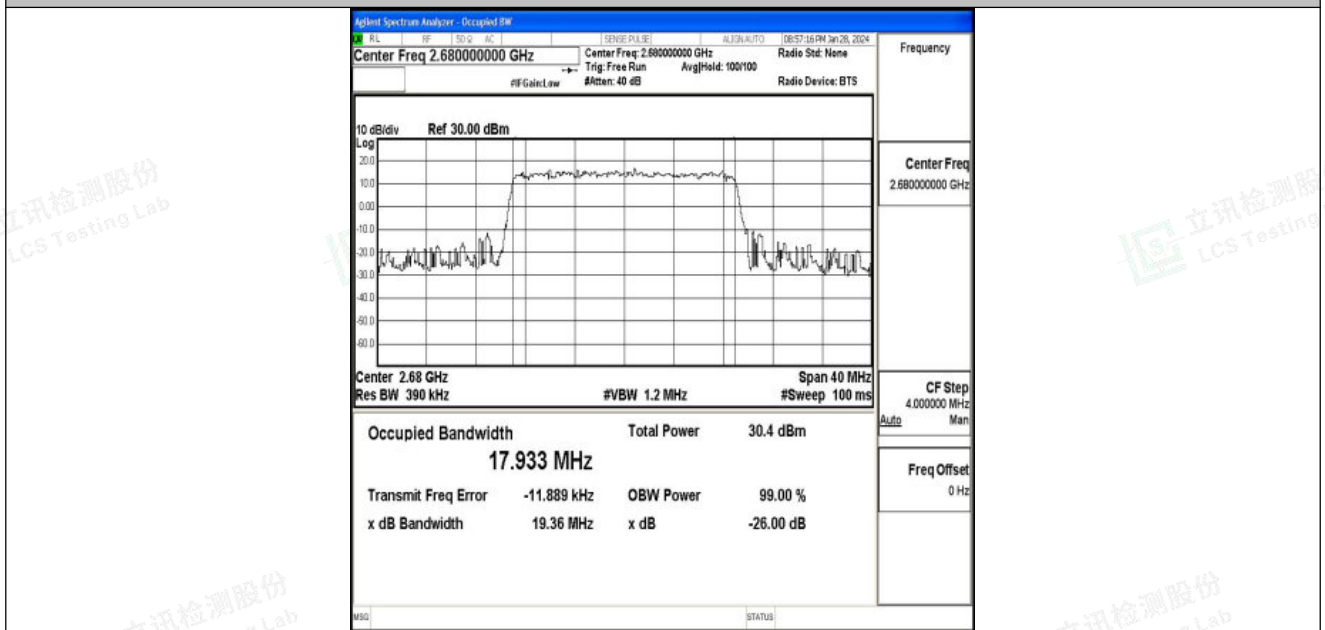

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity





C.4 Band Edge

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Peak Frequency	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	2490.37	-47.79	PASS
Band41	5MHz	16QAM	39675	25RB#0	2490.38	-48.48	PASS
Band41	5MHz	QPSK	41565	25RB#0	2697.23	-44.83	PASS
Band41	5MHz	16QAM	41565	25RB#0	2696.27	-45.60	PASS
Band41	10MHz	QPSK	39700	50RB#0	2490.38	-40.34	PASS
Band41	10MHz	16QAM	39700	50RB#0	2490.34	-41.30	PASS
Band41	10MHz	QPSK	41540	50RB#0	2700.23	-43.43	PASS
Band41	10MHz	16QAM	41540	50RB#0	2700.10	-43.97	PASS
Band41	15MHz	QPSK	39725	75RB#0	2489.75	-37.82	PASS
Band41	15MHz	16QAM	39725	75RB#0	2488.09	-38.91	PASS
Band41	15MHz	QPSK	41515	75RB#0	2706.40	-41.78	PASS
Band41	15MHz	16QAM	41515	75RB#0	2706.50	-42.80	PASS
Band41	20MHz	QPSK	39750	100RB#0	2488.98	-38.47	PASS
Band41	20MHz	16QAM	39750	100RB#0	2489.51	-39.02	PASS
Band41	20MHz	QPSK	41490	100RB#0	2710.05	-42.50	PASS
Band41	20MHz	16QAM	41490	100RB#0	2712.03	-42.66	PASS

Test Graphs

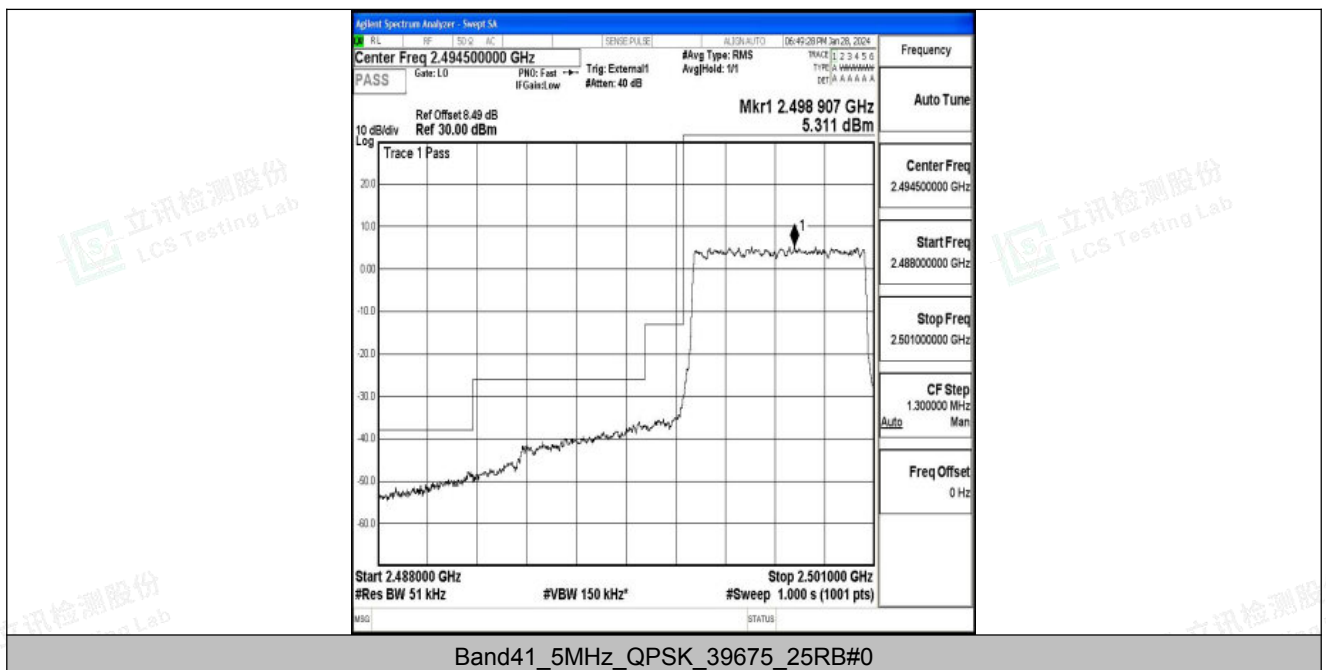

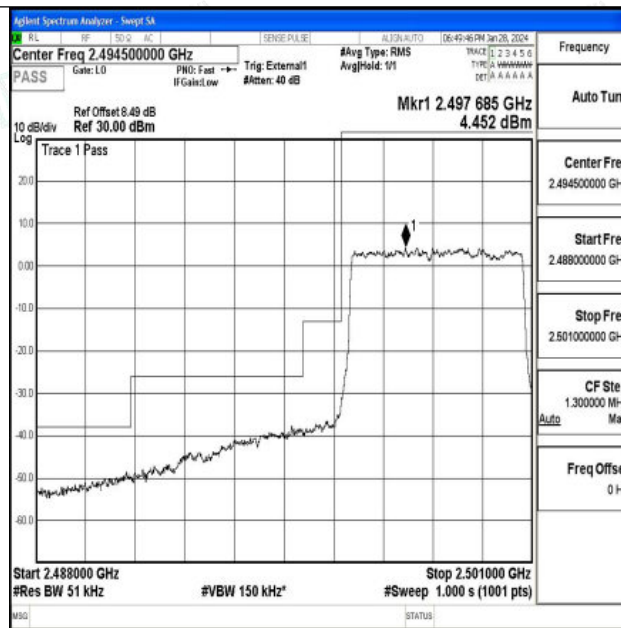


Band41_5MHz_16QAM_39675_25RB#0

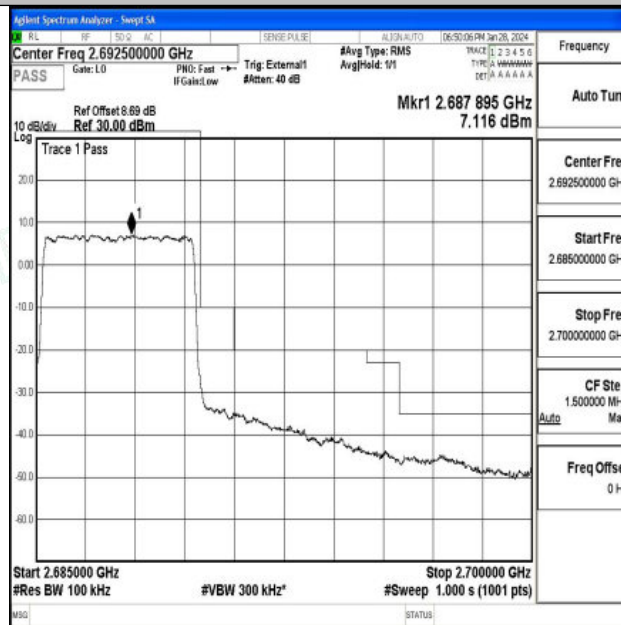


Band41_5MHz_QPSK_41565_25RB#0



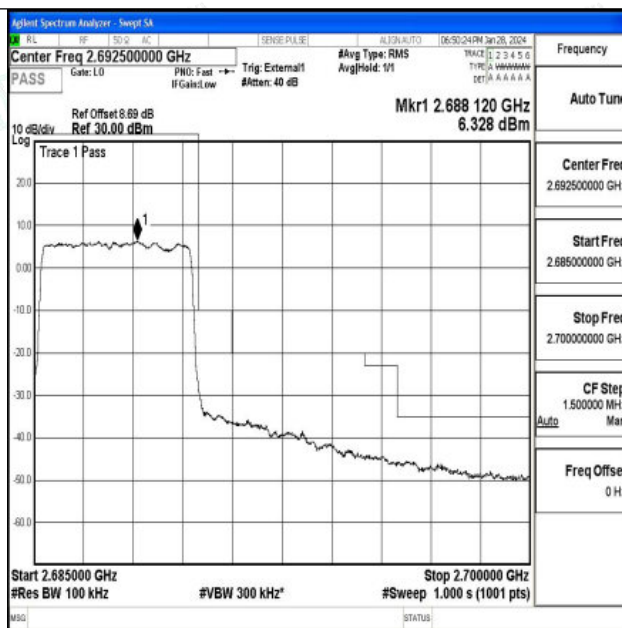

Band41_5MHz_16QAM_41565_25RB#0

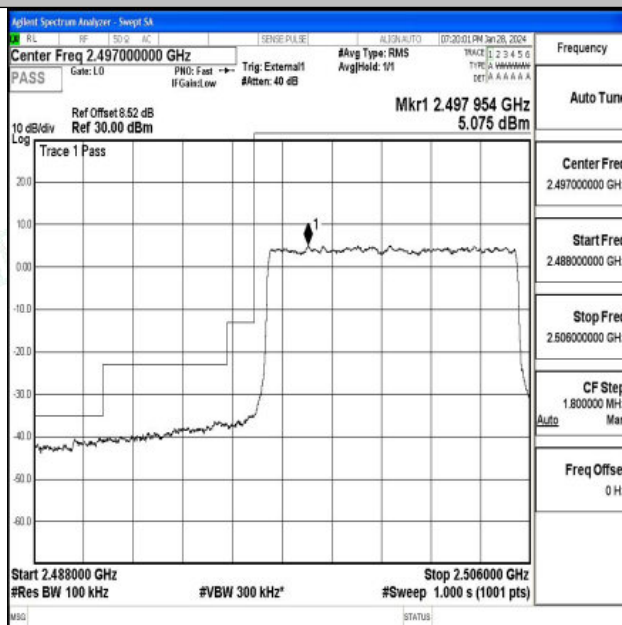

Band41_10MHz_QPSK_39700_50RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

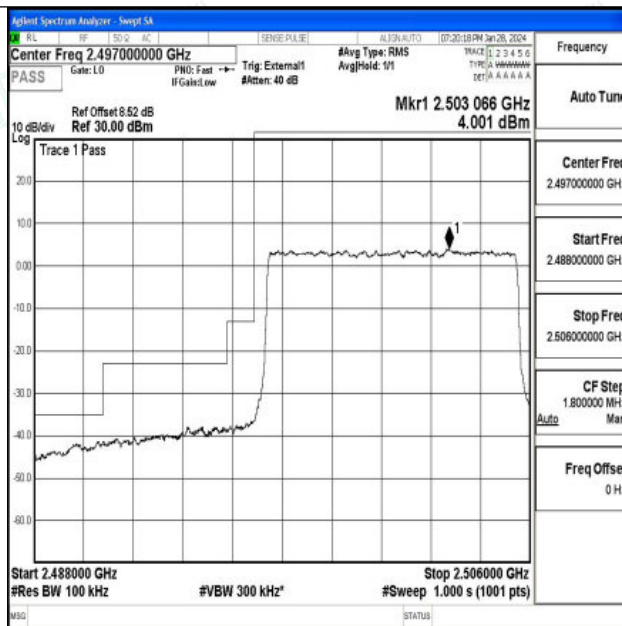


Band41_10MHz_16QAM_39700_50RB#0

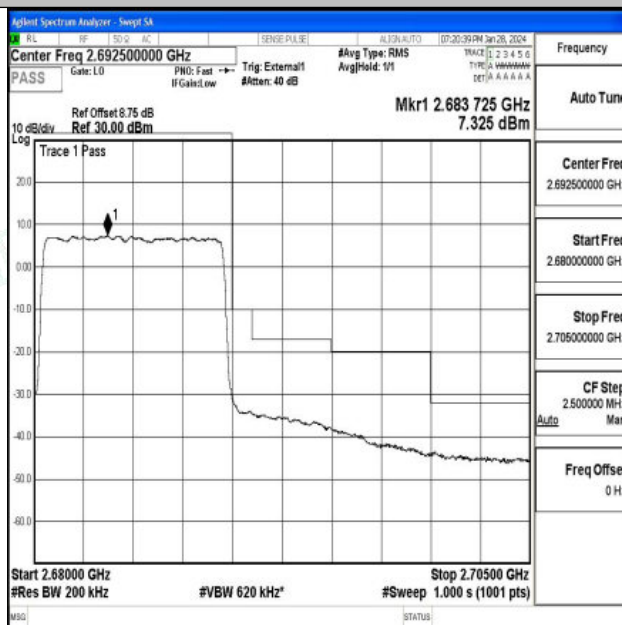


Band41_10MHz_QPSK_41540_50RB#0



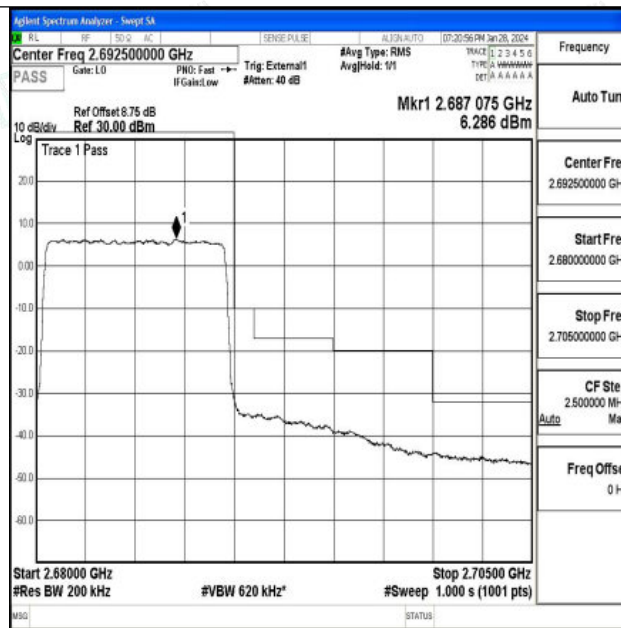

Band41_10MHz_16QAM_41540_50RB#0

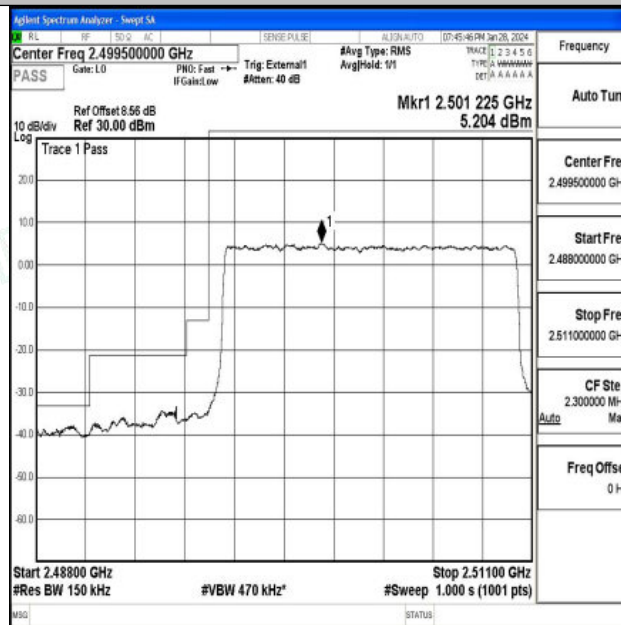

Band41_15MHz_QPSK_39725_75RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

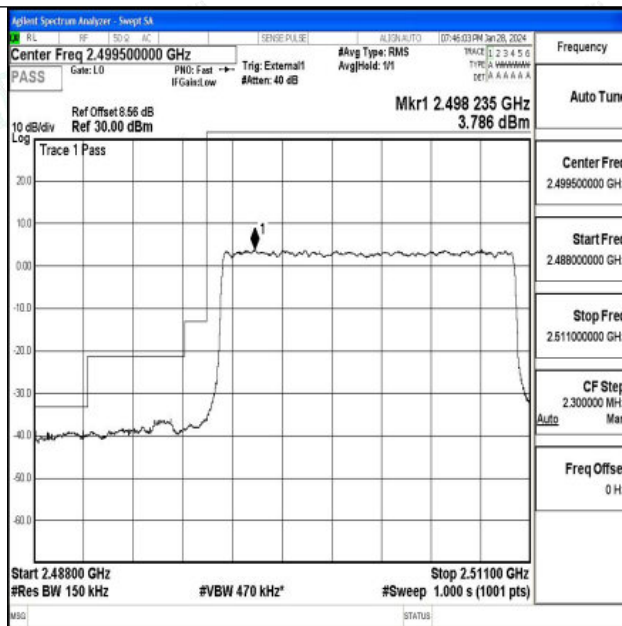


Band41_15MHz_16QAM_39725_75RB#0

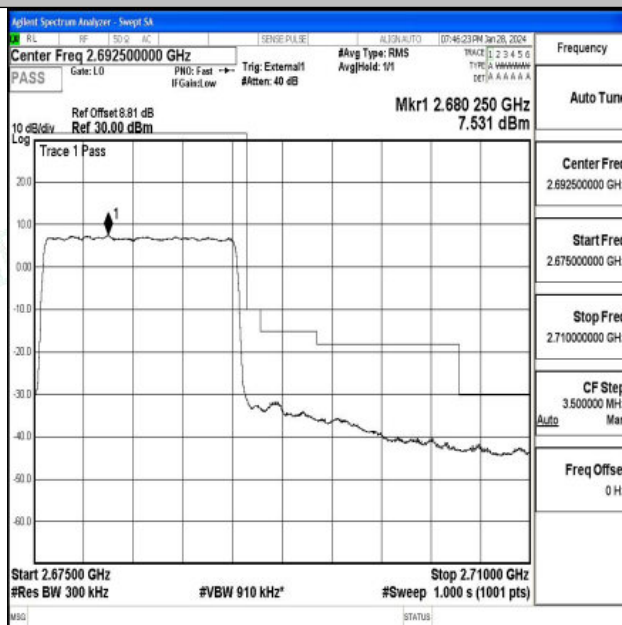


Band41_15MHz_QPSK_41515_75RB#0



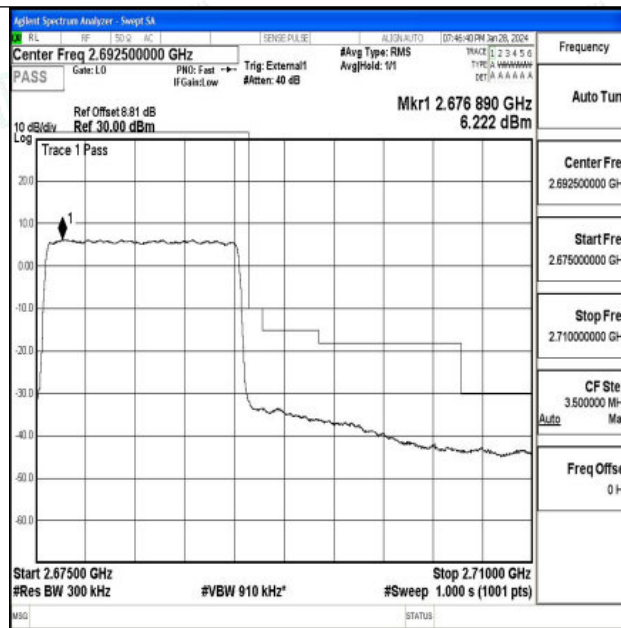


Band41_15MHz_16QAM_41515_75RB#0

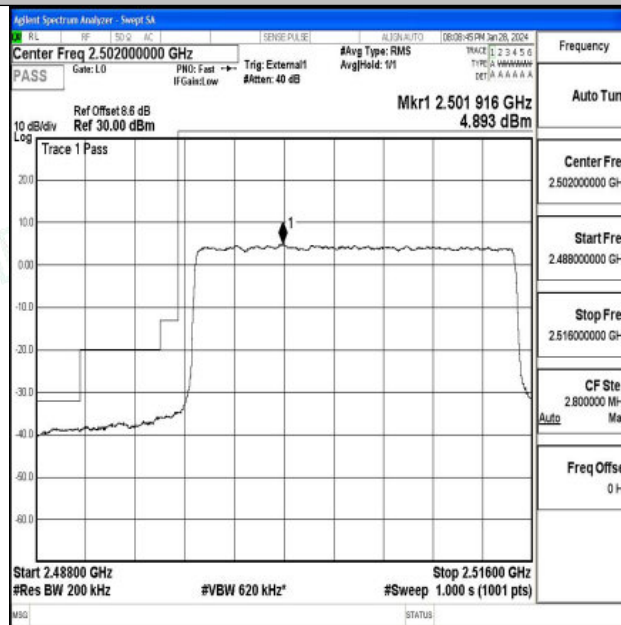


Band41_20MHz_QPSK_39750_100RB#0



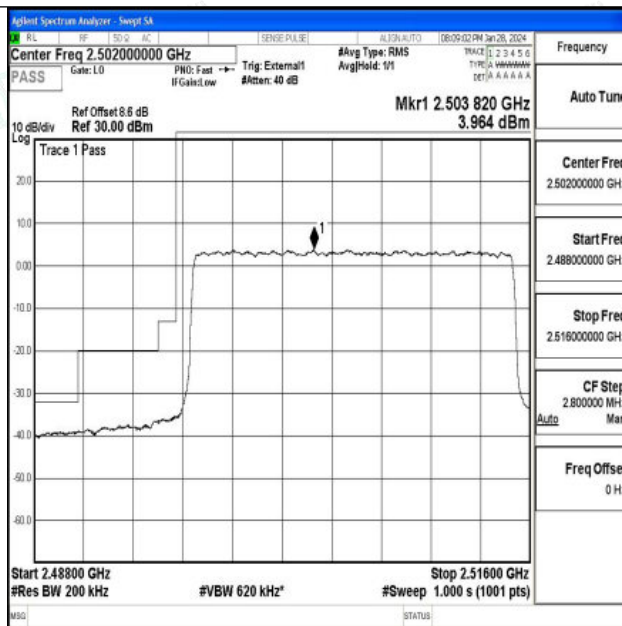


Band41_20MHz_16QAM_39750_100RB#0

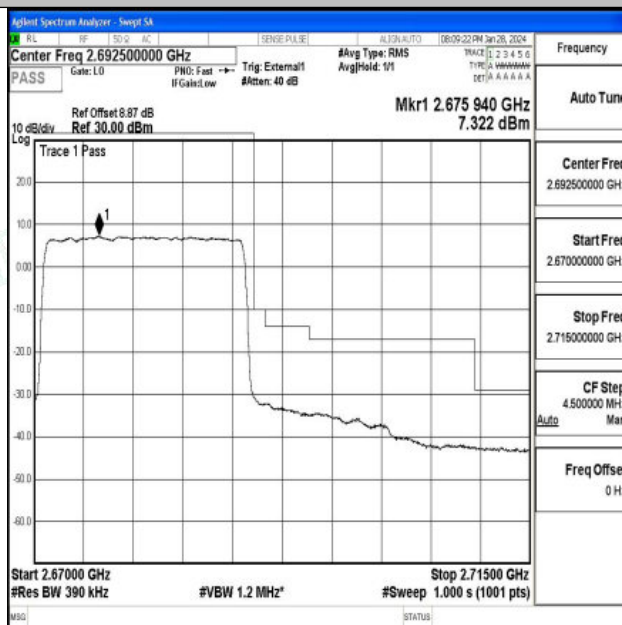

Band41_20MHz_QPSK_41490_100RB#0



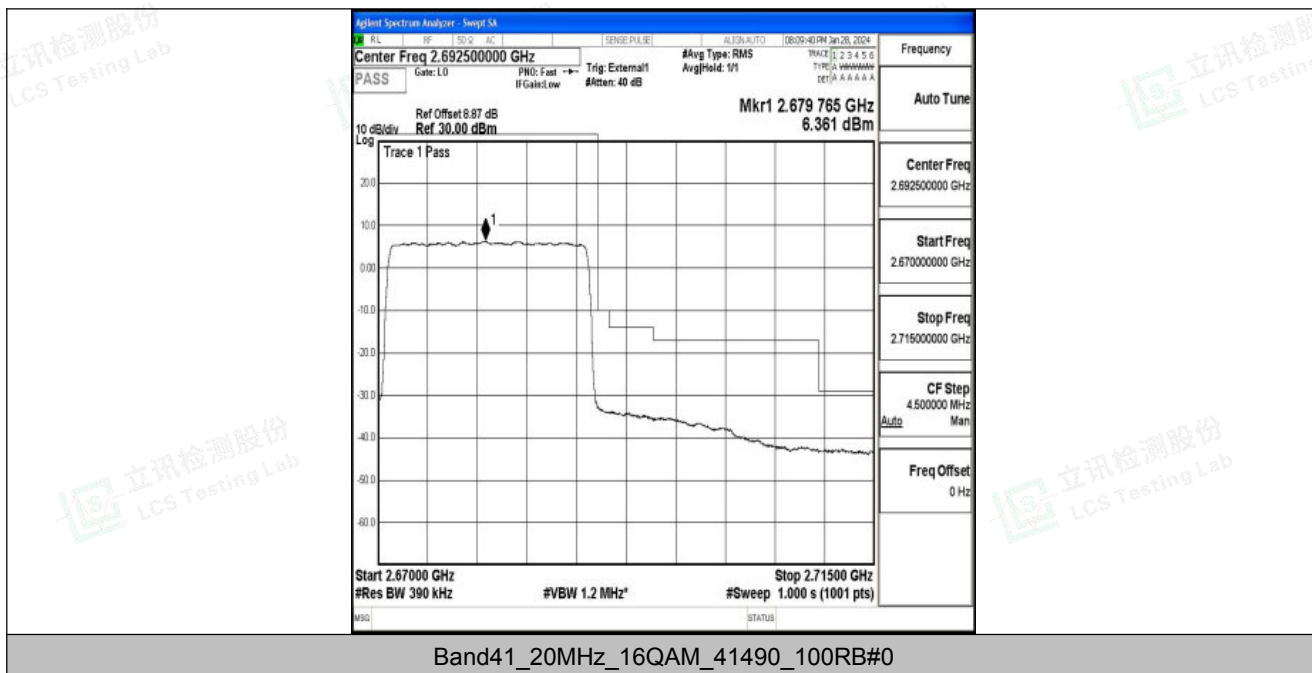

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



C.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-67.87	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-61.53	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-61.96	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-33.06	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-35.27	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-67.97	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-62.79	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-62.14	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-33.16	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-35.00	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-68.45	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-61.20	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-62.24	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-33.17	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-35.36	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-67.90	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-58.92	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-62.02	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-33.10	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-35.19	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-68.09	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-61.29	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-62.18	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-33.20	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-35.37	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-65.52	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-61.42	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-62.02	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-32.90	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-35.44	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-67.05	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-61.95	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-62.40	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-32.79	PASS
Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-35.24	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-66.81	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-61.15	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-61.98	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-32.55	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-35.34	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-67.91	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-60.35	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-62.22	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-32.98	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-35.26	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-68.55	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-61.08	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-62.13	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-33.09	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-35.13	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-68.57	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-60.72	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-62.08	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-33.22	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-35.22	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-66.67	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-62.65	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-62.18	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-66.28	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-58.97	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-62.14	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-33.39	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-32.99	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-35.17	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-35.41	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-69.61	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-59.71	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-62.39	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-33.18	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-35.15	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-67.25	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-62.28	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-62.27	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-33.10	PASS
Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-34.98	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-65.47	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-59.32	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	40620	1RB#0	30~1000	-62.36	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-33.18	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-35.45	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-68.40	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-63.70	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-62.14	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-33.16	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-35.43	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-64.93	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-63.60	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-62.39	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-33.08	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-34.69	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-67.87	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-60.85	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-62.24	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-33.30	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-35.31	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-67.83	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-64.68	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-62.27	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-32.84	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-35.22	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-66.77	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-61.27	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-62.09	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-33.37	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-35.10	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-68.44	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-59.01	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-62.30	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-33.20	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-35.18	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-64.93	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-59.53	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-62.27	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-32.54	PASS
Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-35.20	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-67.04	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-60.33	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-61.94	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-33.40	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-35.19	PASS
--------	-------	-------	-------	-------	-------------	--------	------

Test Graphs

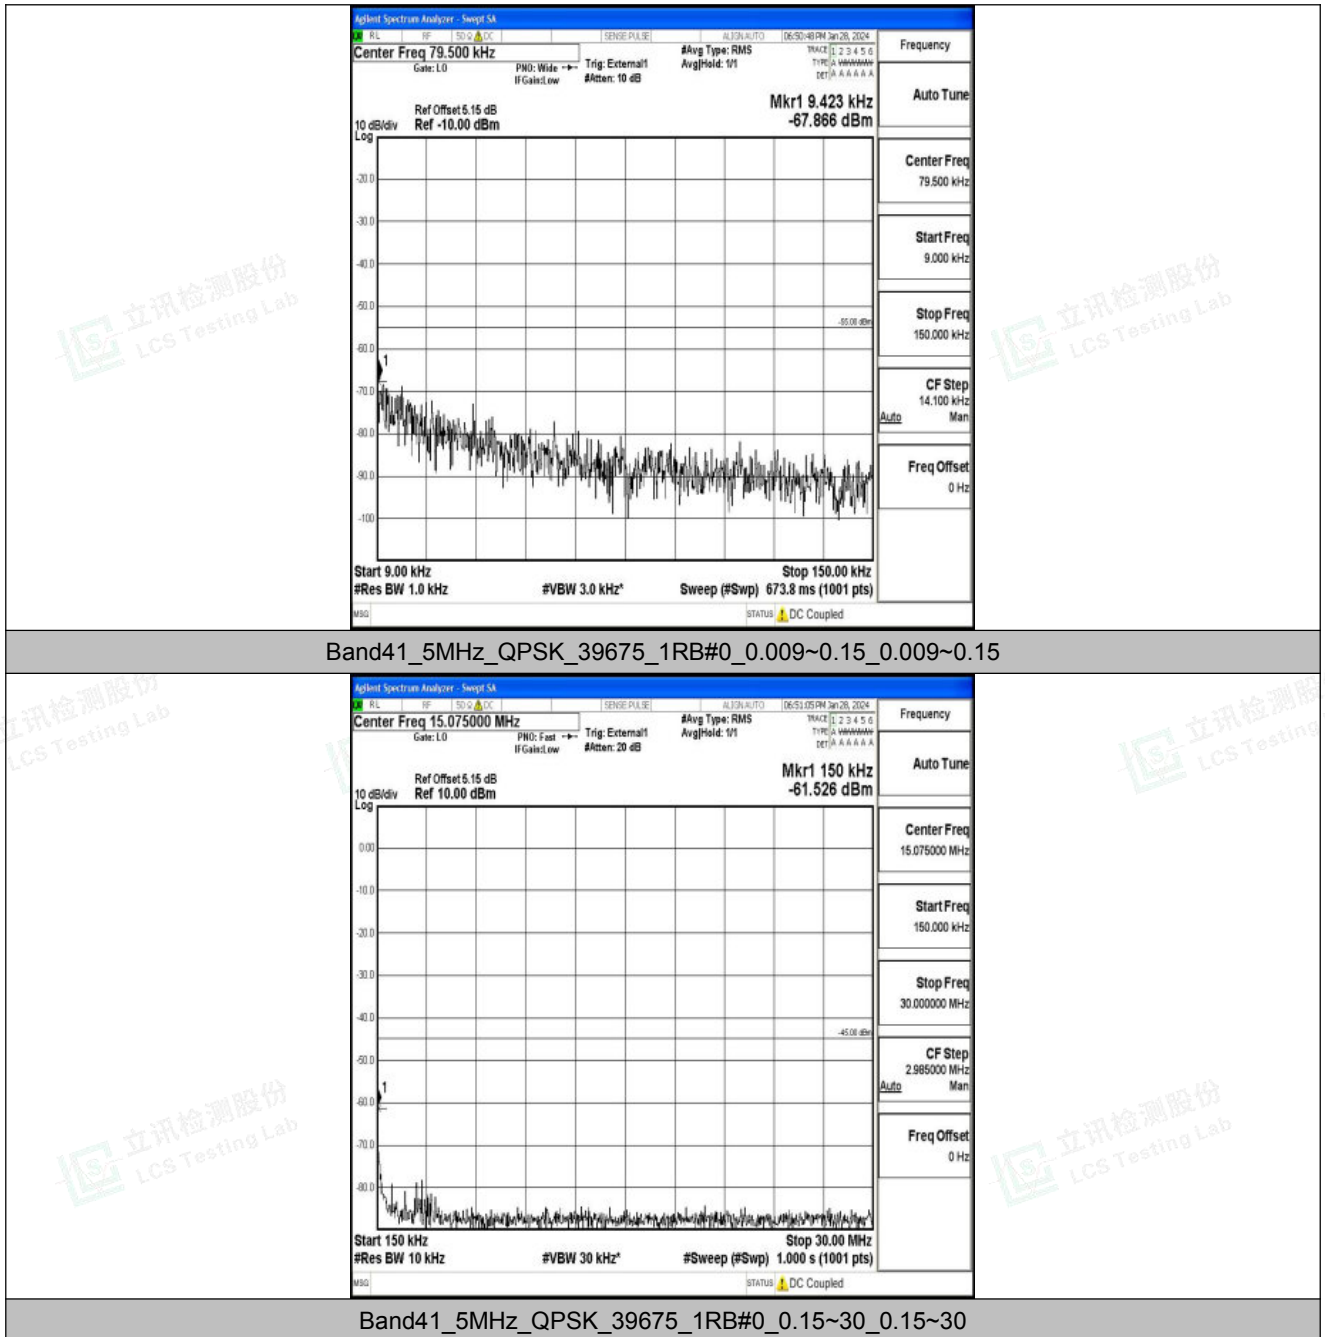

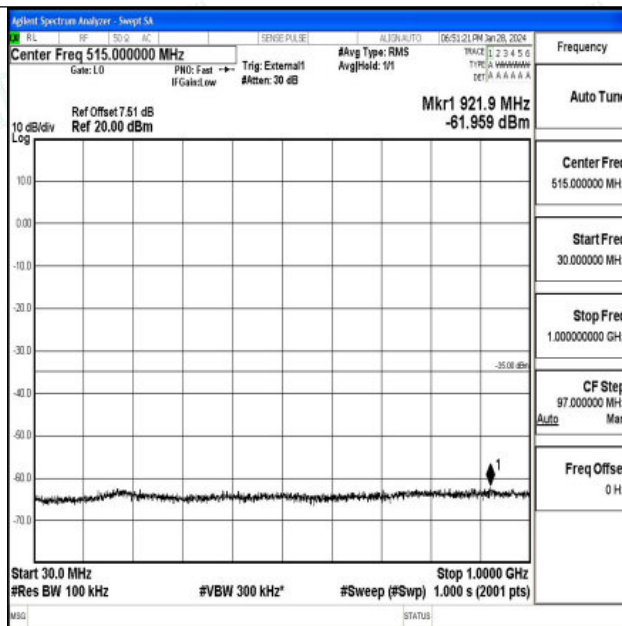

Band41_5MHz_QPSK_39675_1RB#0_30~1000_30~1000

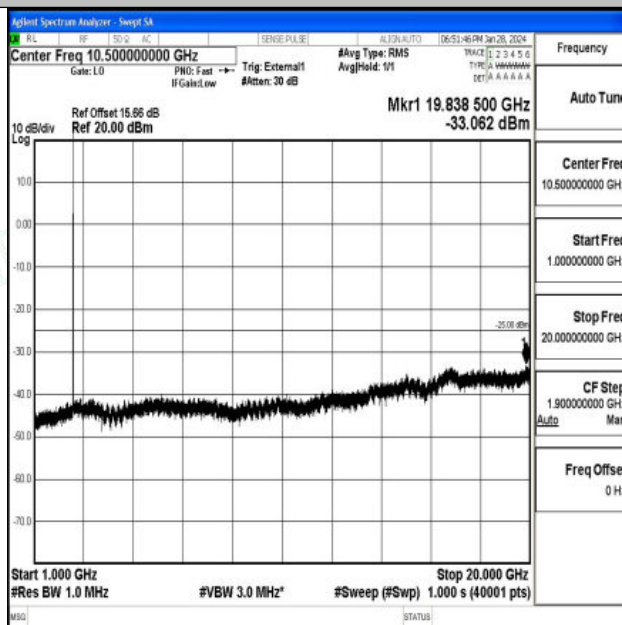

Band41_5MHz_QPSK_39675_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

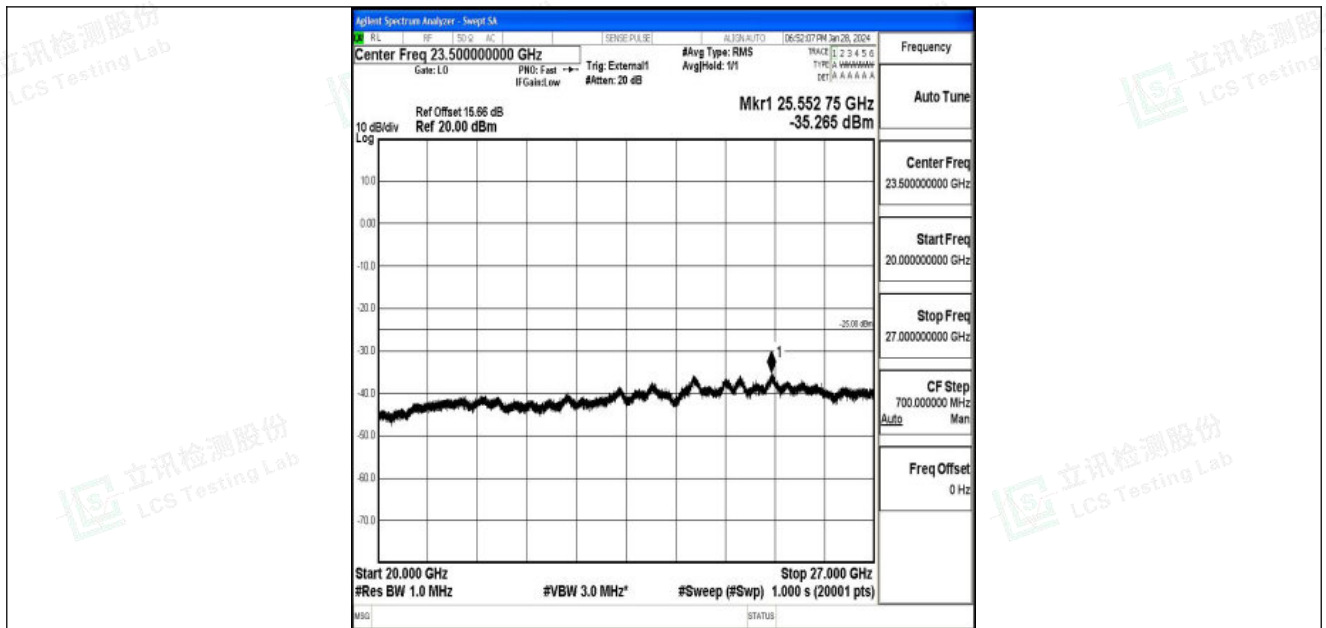


Band41_5MHz_QPSK_39675_1RB#0_20000~27000_20000~27000

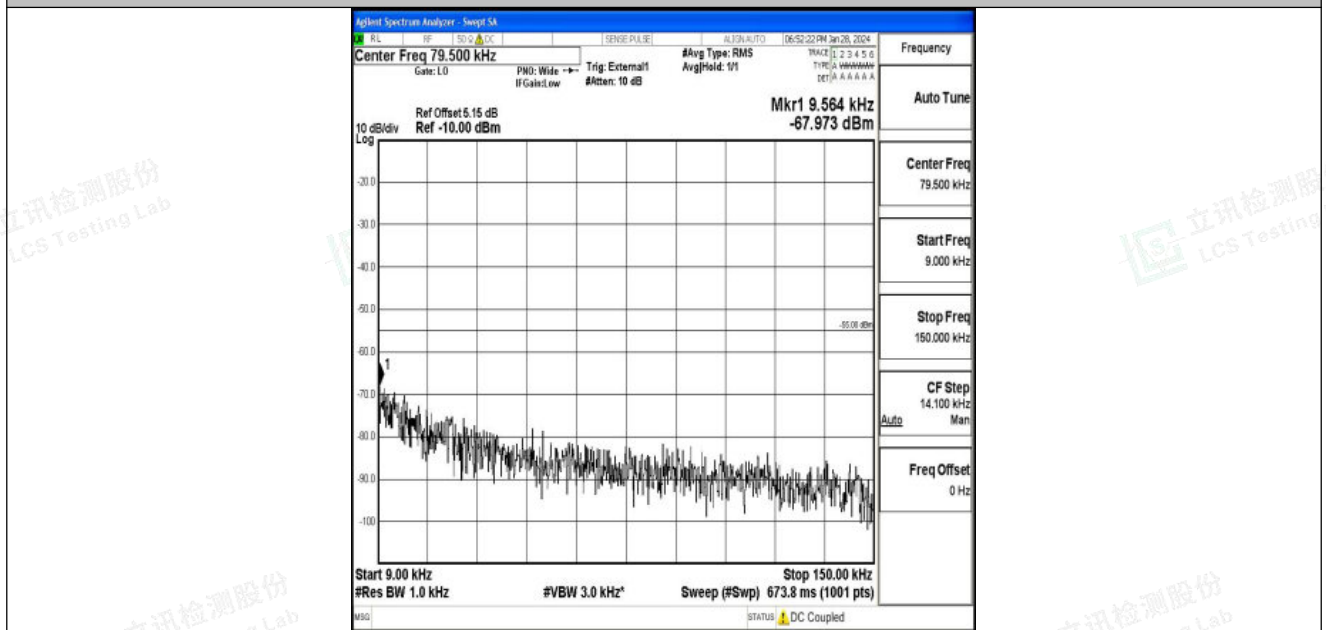


Band41_5MHz_16QAM_39675_1RB#0_0.009~0.15_0.009~0.15



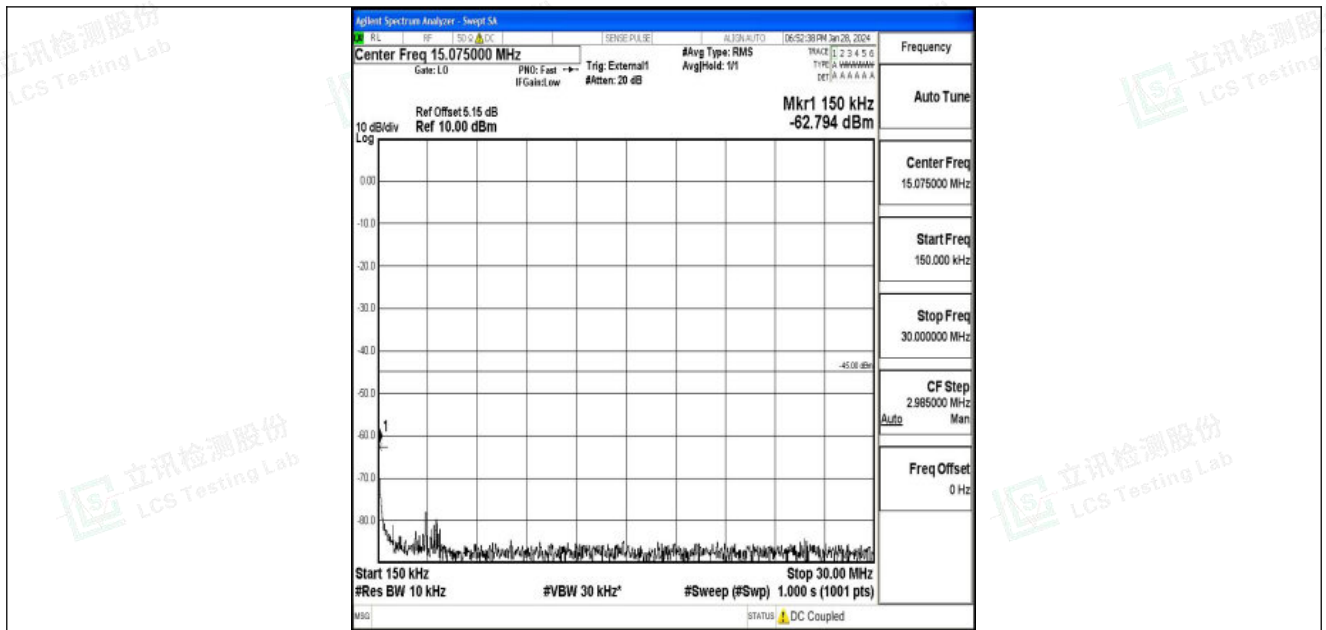

Band41_5MHz_16QAM_39675_1RB#0_0.15~30_0.15~30

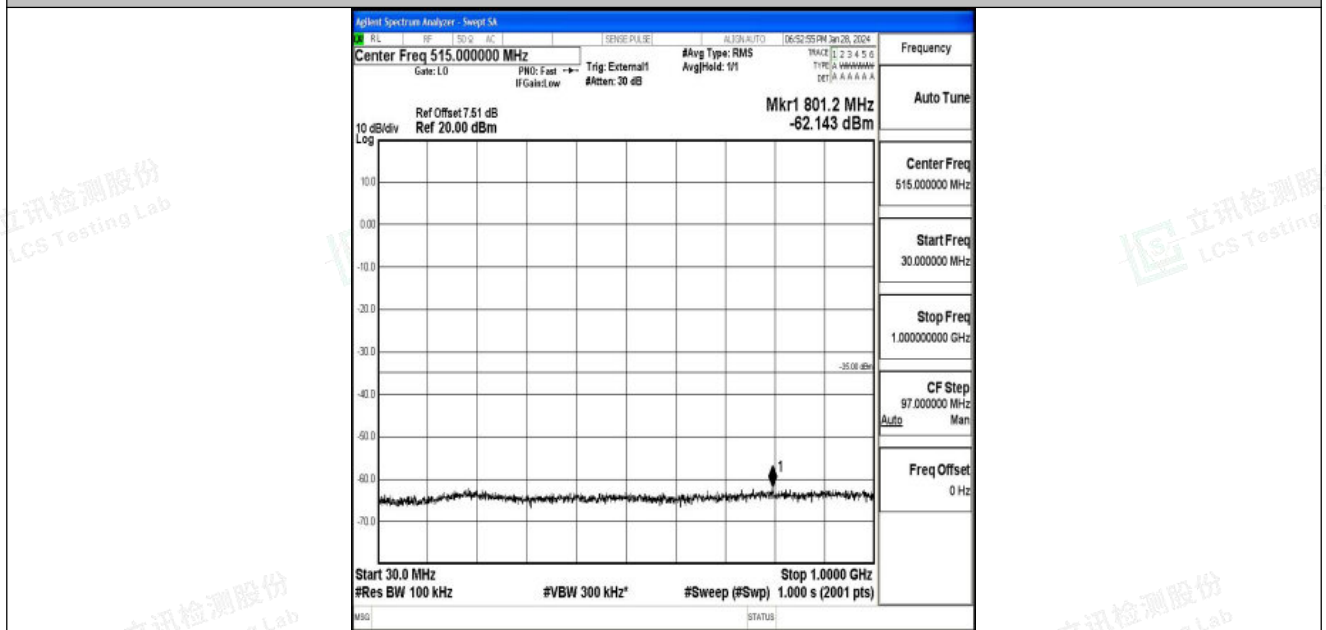

Band41_5MHz_16QAM_39675_1RB#0_30~1000_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

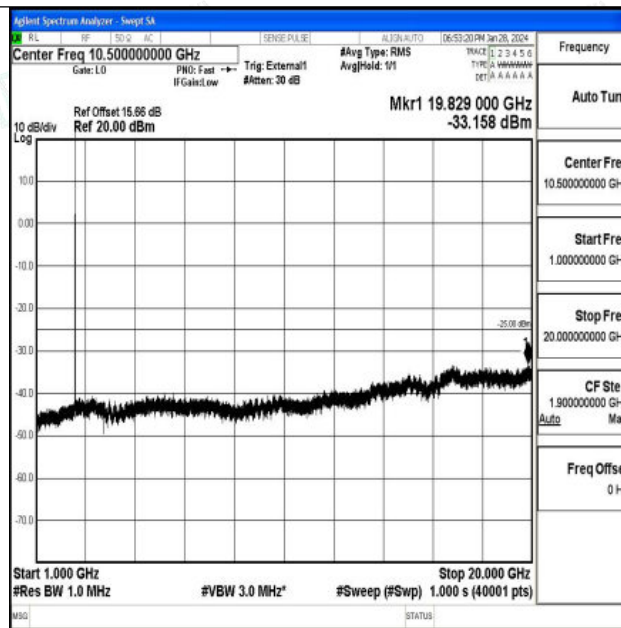


Band41_5MHz_16QAM_39675_1RB#0_1000~20000_1000~20000

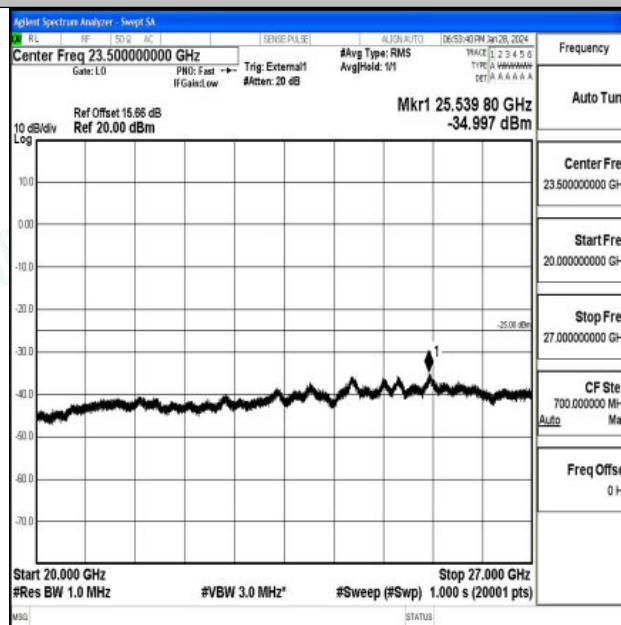


Band41_5MHz_16QAM_39675_1RB#0_20000~27000_20000~27000



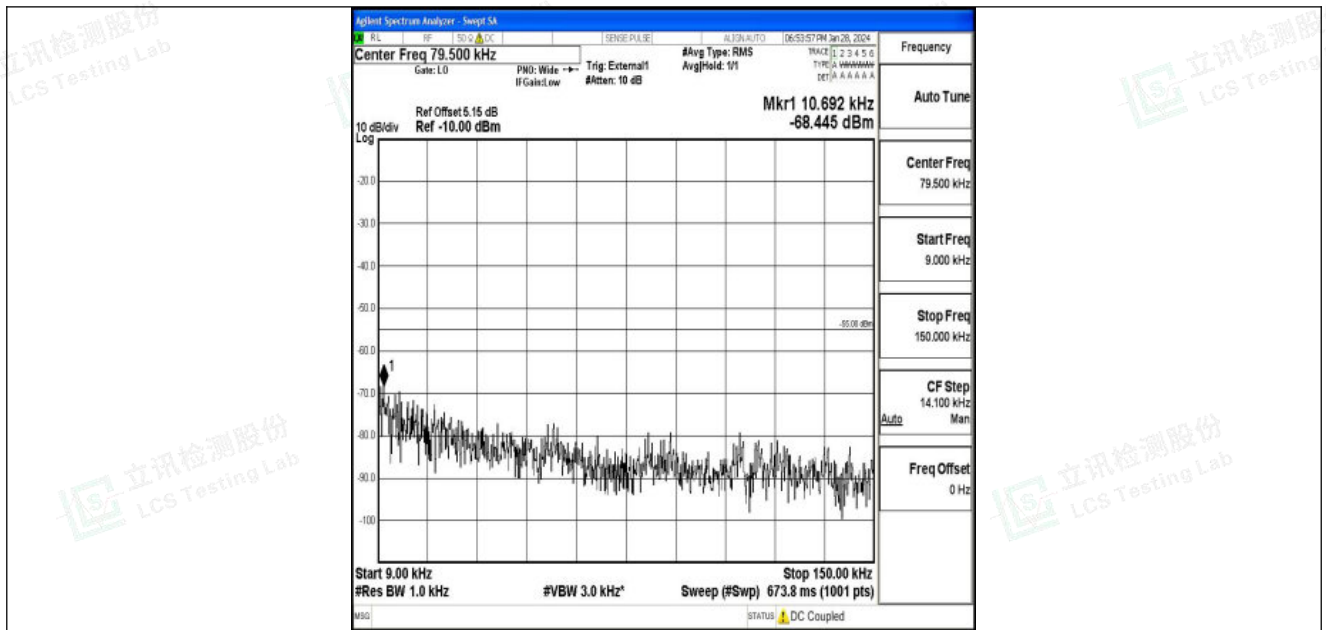


Band41_5MHz_QPSK_40620_1RB#0_0.009~0.15_0.009~0.15

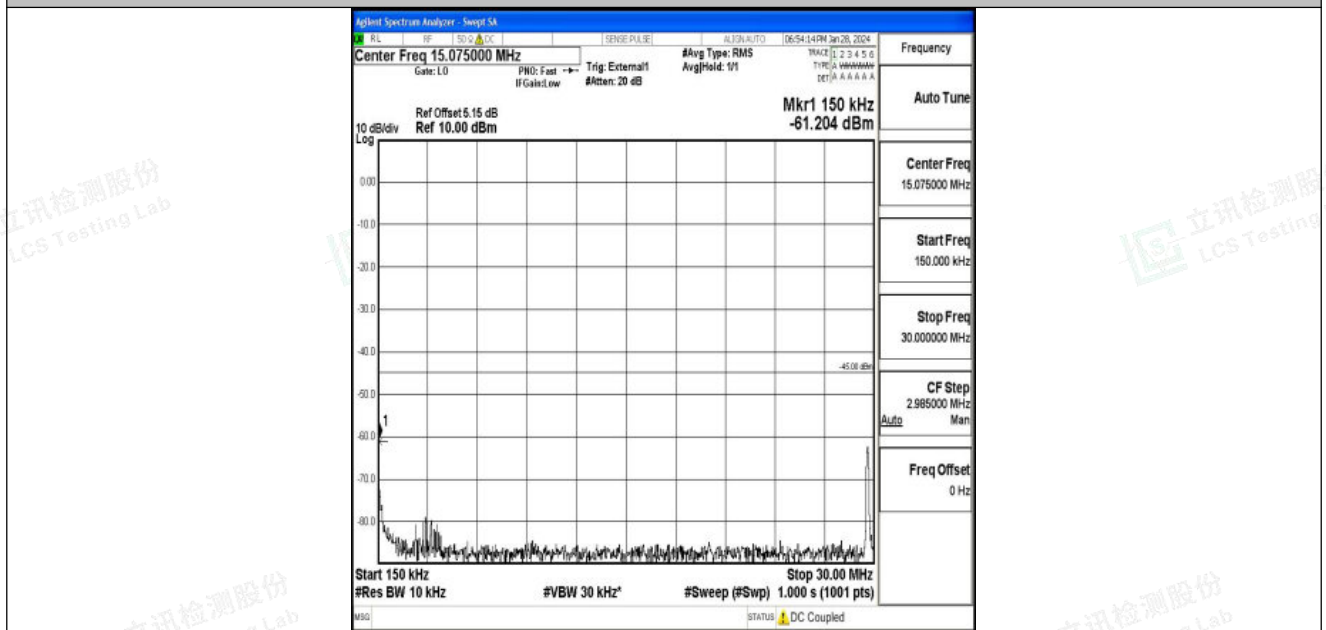


Band41_5MHz_QPSK_40620_1RB#0_0.15~30_0.15~30



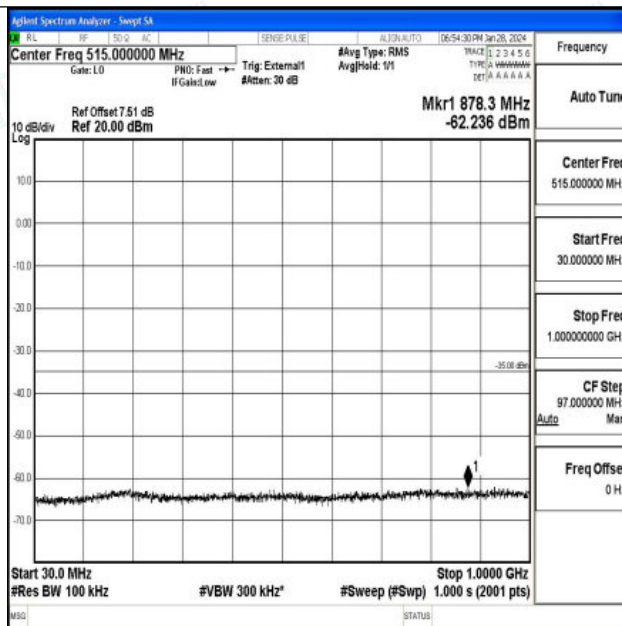

Band41_5MHz_QPSK_40620_1RB#0_30~1000_30~1000

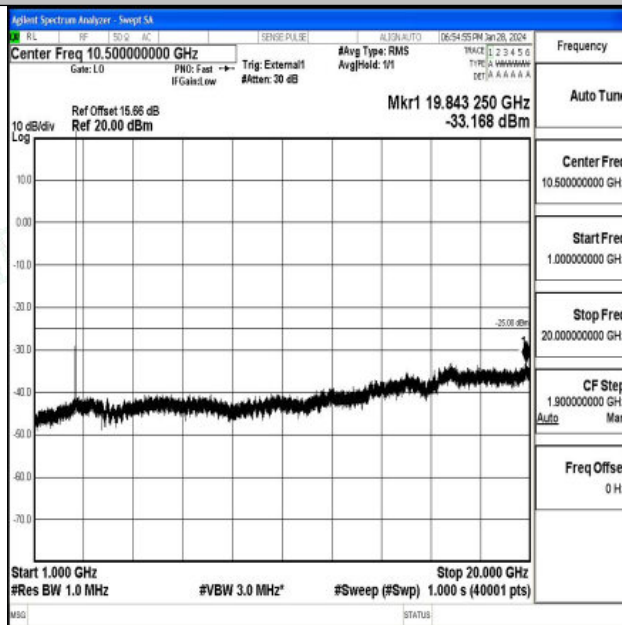

Band41_5MHz_QPSK_40620_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

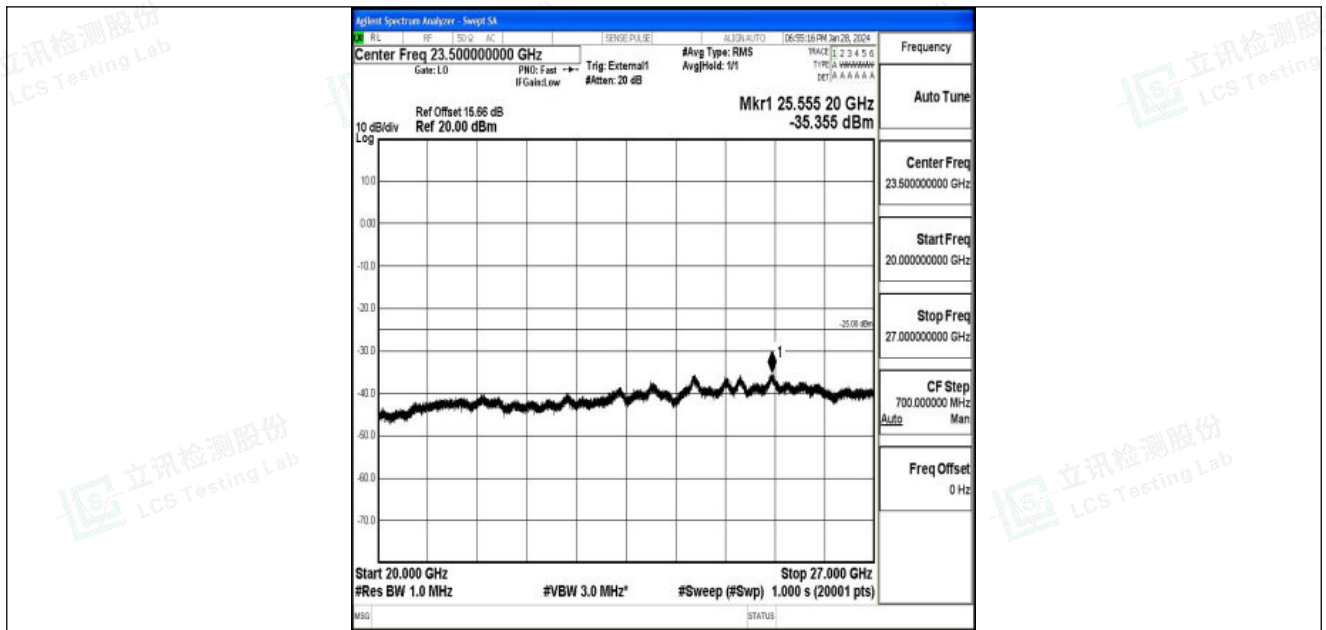

Band41_5MHz_QPSK_40620_1RB#0_20000~27000_20000~27000

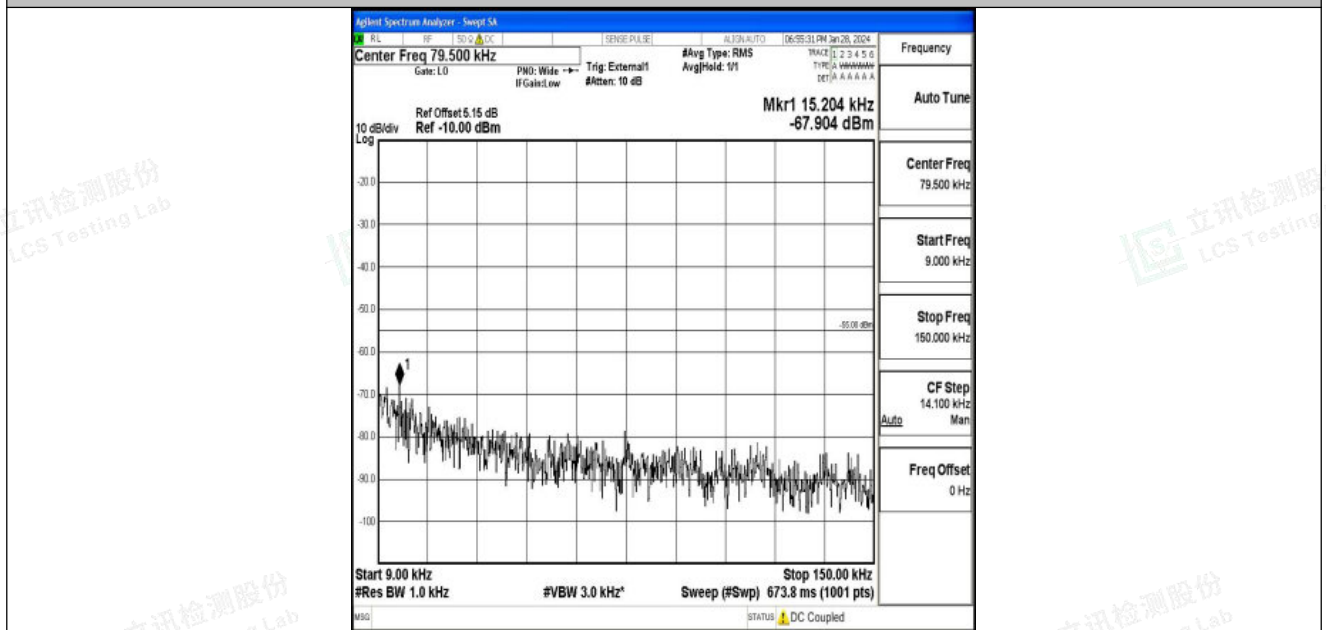

Band41_5MHz_16QAM_40620_1RB#0_0.009~0.15_0.009~0.15



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity