






11G_Ant1_High_2462

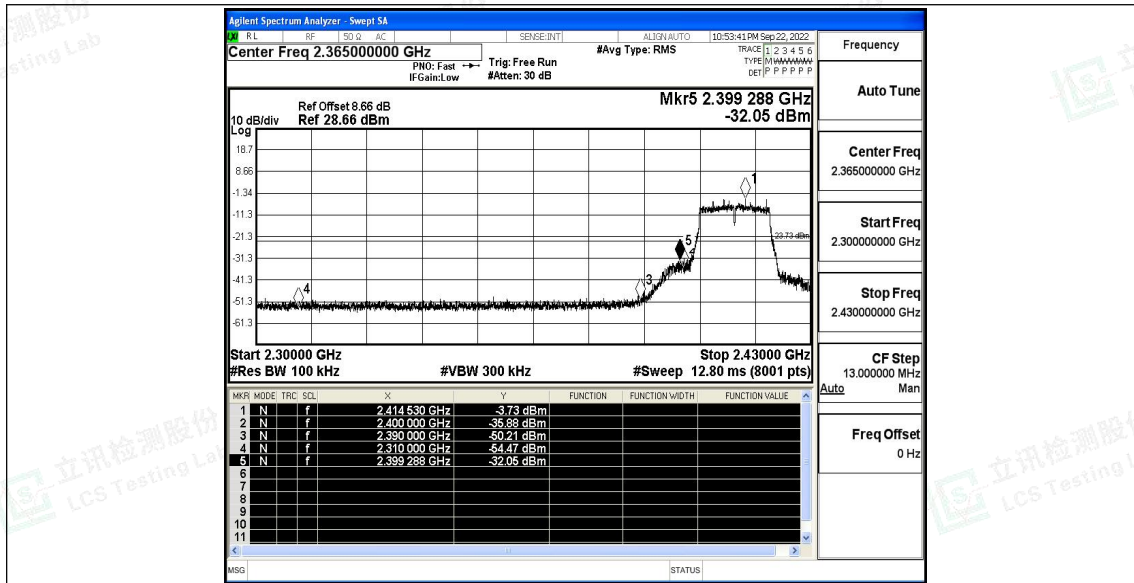


11N20SISO_Ant1_Low_2412

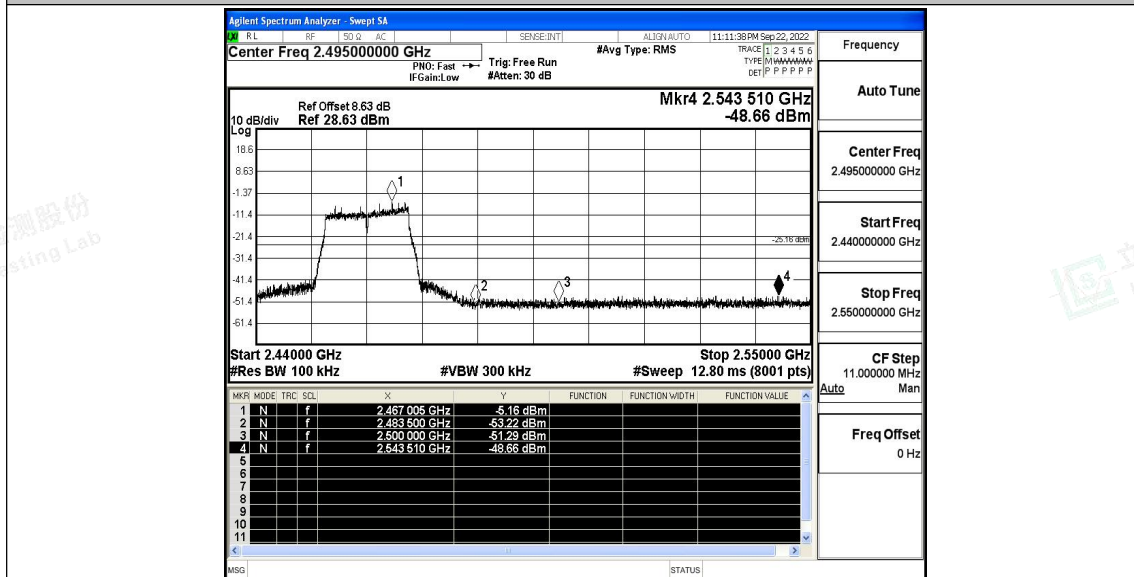

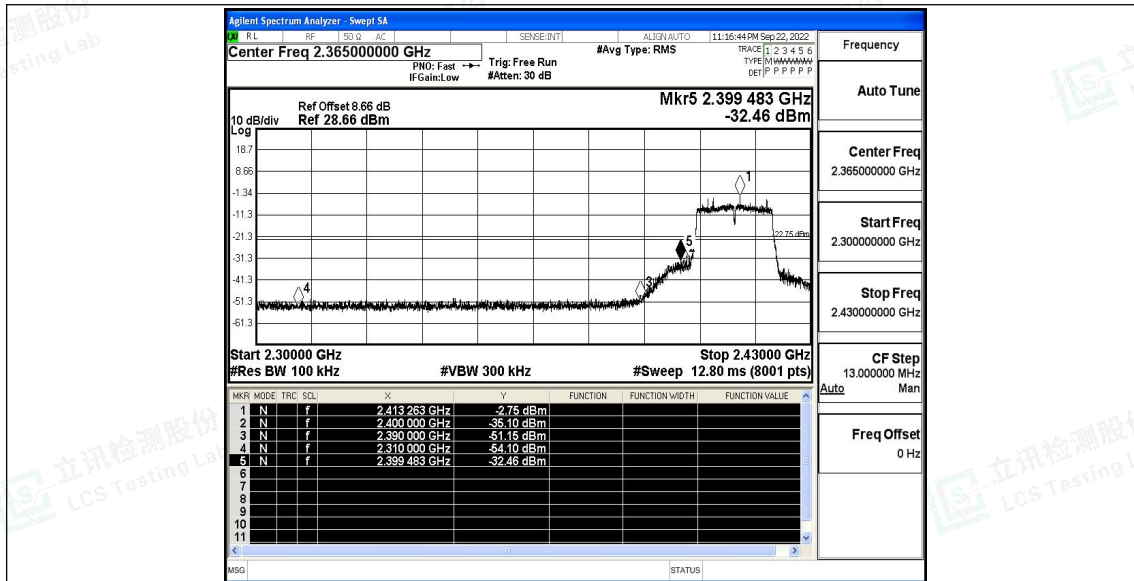

11N20SISO_Ant1_High_2462

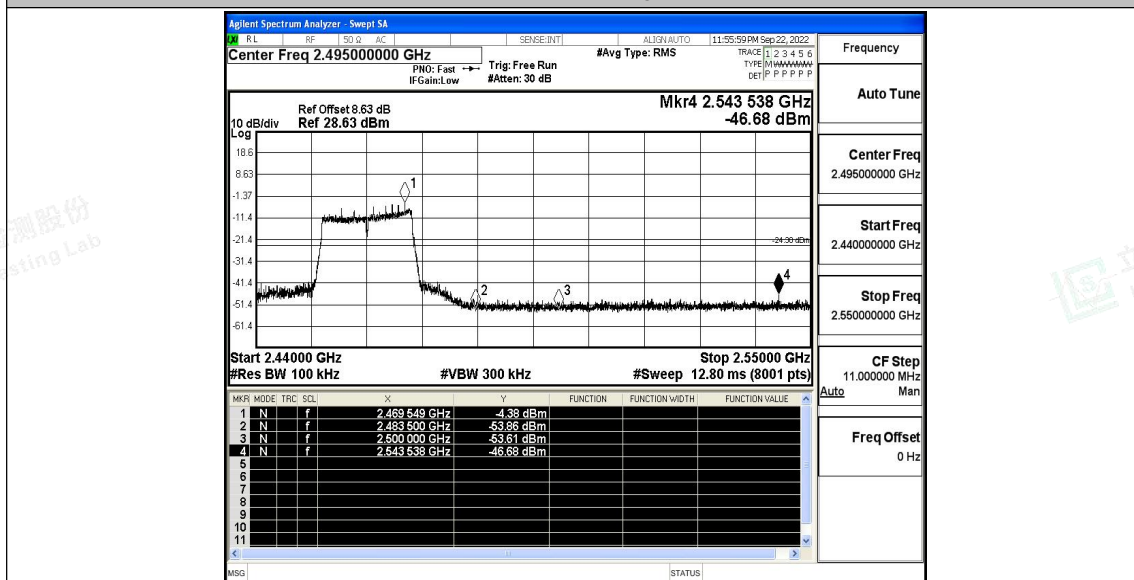

11N40SISO_Ant1_Low_2422




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Building A and 301 Building C, Juji Industrial Park, Yabianxueziwei Shajing Street, Baoan District, Shenzhen, 518000, P.R.C.

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

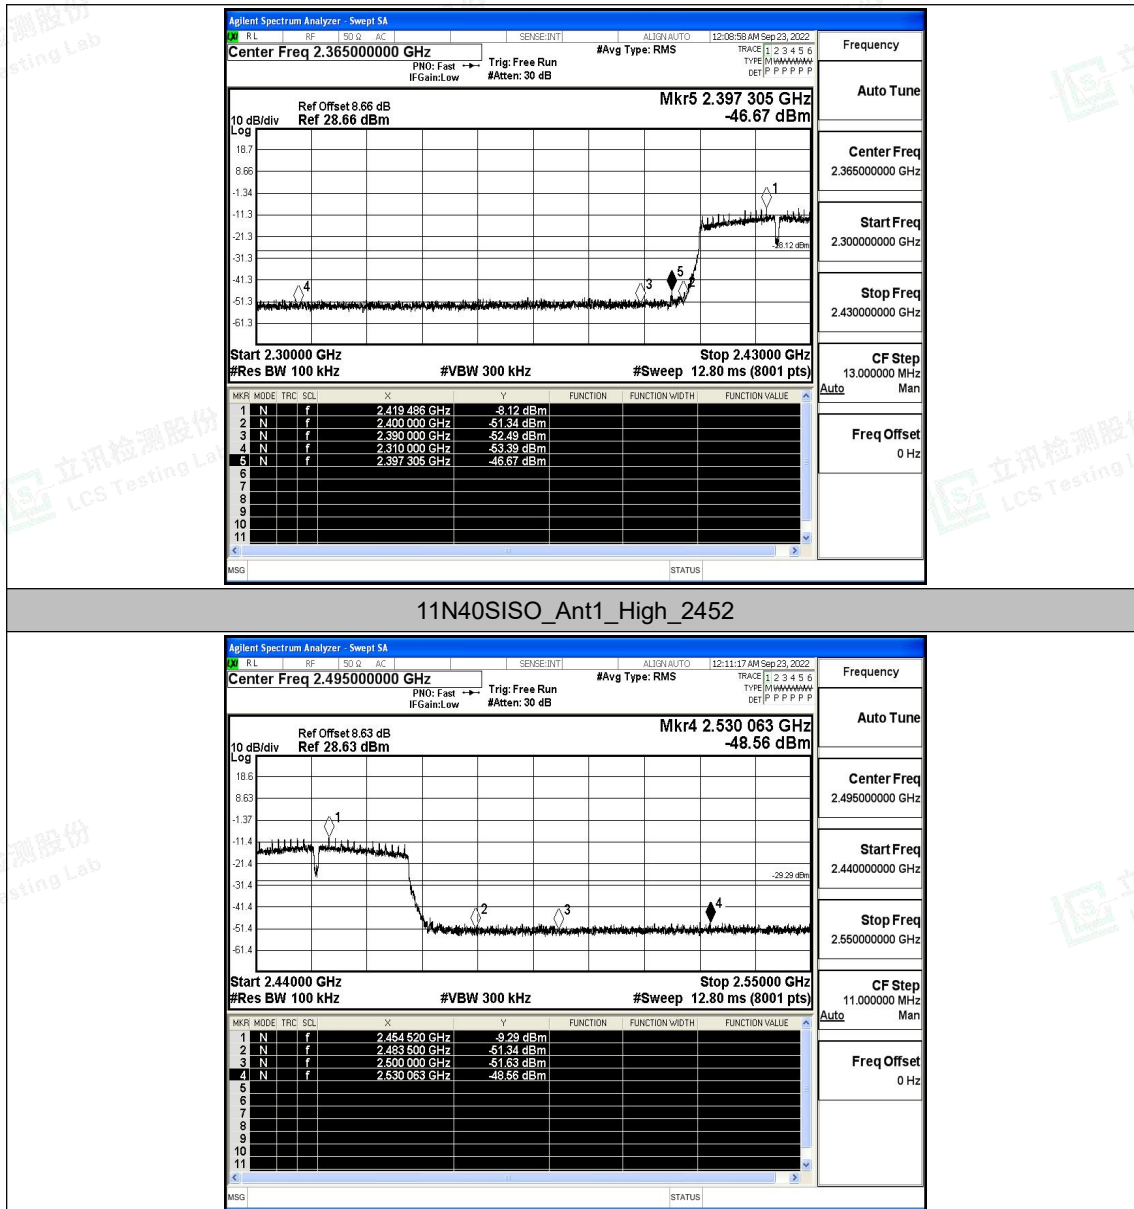

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Building A and 301 Building C, Juji Industrial Park, Yabianxueziwei Shajing Street, Baoan District, Shenzhen, 518000, P.R.C.

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



C.6 Conducted Spurious Emission

Test Result

TestMode	Antenna	Freq(MHz)	FreqRange [Mhz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant1	2412	Reference	0.59	0.59	---	PASS
			30~1000	0.59	-60.53	≤-19.41	PASS
			1000~26500	0.59	-45.99	≤-19.41	PASS
		2437	Reference	2.32	2.32	---	PASS
			30~1000	2.32	-60.84	≤-17.68	PASS
			1000~26500	2.32	-42.21	≤-17.68	PASS
		2462	Reference	0.39	0.39	---	PASS
			30~1000	0.39	-60.46	≤-19.61	PASS
			1000~26500	0.39	-41.65	≤-19.61	PASS
11G	Ant1	2412	Reference	-3.91	-3.91	---	PASS
			30~1000	-3.91	-60.85	≤-23.91	PASS
			1000~26500	-3.91	-45.65	≤-23.91	PASS
		2437	Reference	-4.71	-4.71	---	PASS
			30~1000	-4.71	-60.35	≤-24.71	PASS
			1000~26500	-4.71	-45.99	≤-24.71	PASS
		2462	Reference	-7.33	-7.33	---	PASS
			30~1000	-7.33	-60.76	≤-27.33	PASS
			1000~26500	-7.33	-45.8	≤-27.33	PASS
11N20SISO	Ant1	2412	Reference	-3.38	-3.38	---	PASS
			30~1000	-3.38	-59.73	≤-23.38	PASS
			1000~26500	-3.38	-45.68	≤-23.38	PASS
		2437	Reference	-2.03	-2.03	---	PASS
			30~1000	-2.03	-60.96	≤-22.03	PASS
			1000~26500	-2.03	-44.94	≤-22.03	PASS
		2462	Reference	-8.09	-8.09	---	PASS
			30~1000	-8.09	-60.91	≤-28.09	PASS
			1000~26500	-8.09	-45.7	≤-28.09	PASS
11N40SISO	Ant1	2422	Reference	-7.21	-7.21	---	PASS
			30~1000	-7.21	-60.77	≤-27.21	PASS
			1000~26500	-7.21	-45.4	≤-27.21	PASS
		2437	Reference	-8.24	-8.24	---	PASS
			30~1000	-8.24	-60.95	≤-28.24	PASS
			1000~26500	-8.24	-46.43	≤-28.24	PASS
		2452	Reference	-7.34	-7.34	---	PASS
			30~1000	-7.34	-60.76	≤-27.34	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Building A and 301 Building C, Juji Industrial Park, Yabianxueziwei Shajing Street, Baoan District, Shenzhen, 518000, P.R.C.

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




			1000~26500	-7.34	-45.72	≤-27.34	PASS
--	--	--	------------	-------	--------	---------	------




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Building A and 301 Building C, Juji Industrial Park, Yabianxueziwei Shajing Street, Baoan District,
Shenzhen, 518000, P.R.C.
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

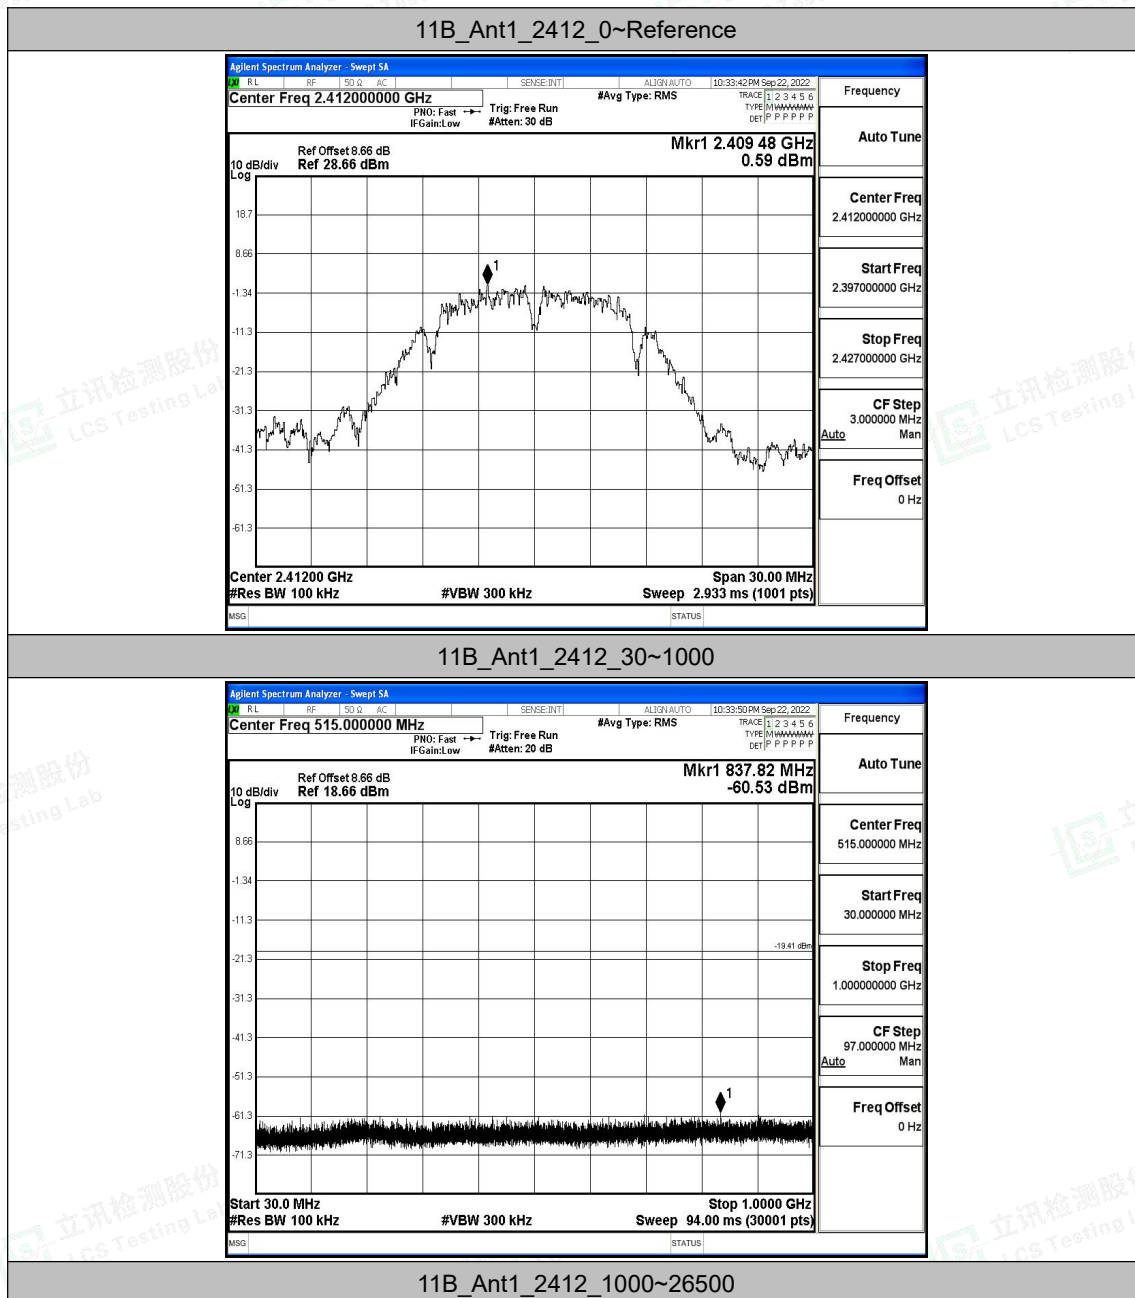

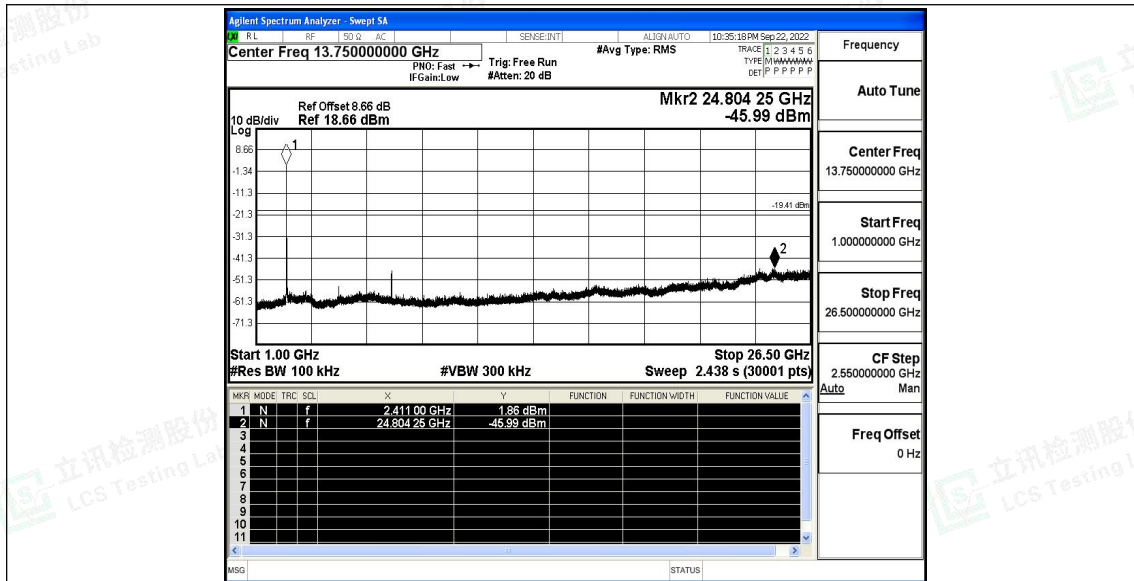

11B_Ant1_2437_0~Reference

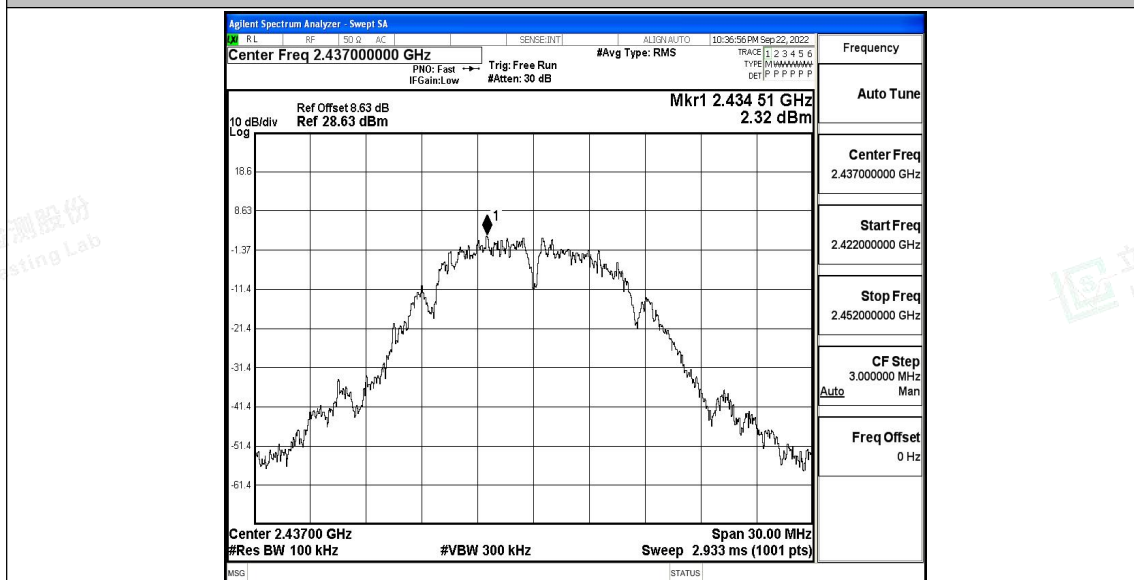

11B_Ant1_2437_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Building A and 301 Building C, Juji Industrial Park, Yabianxueziwei Shajing Street, Baoan District, Shenzhen, 518000, P.R.C.

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity


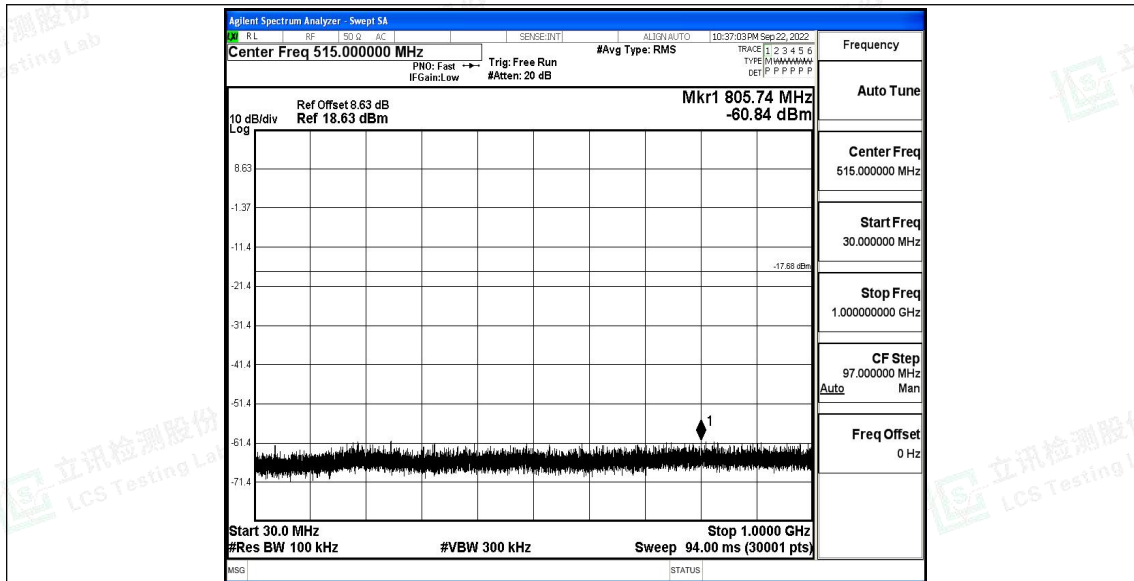



11B_Ant1_2437_1000~26500

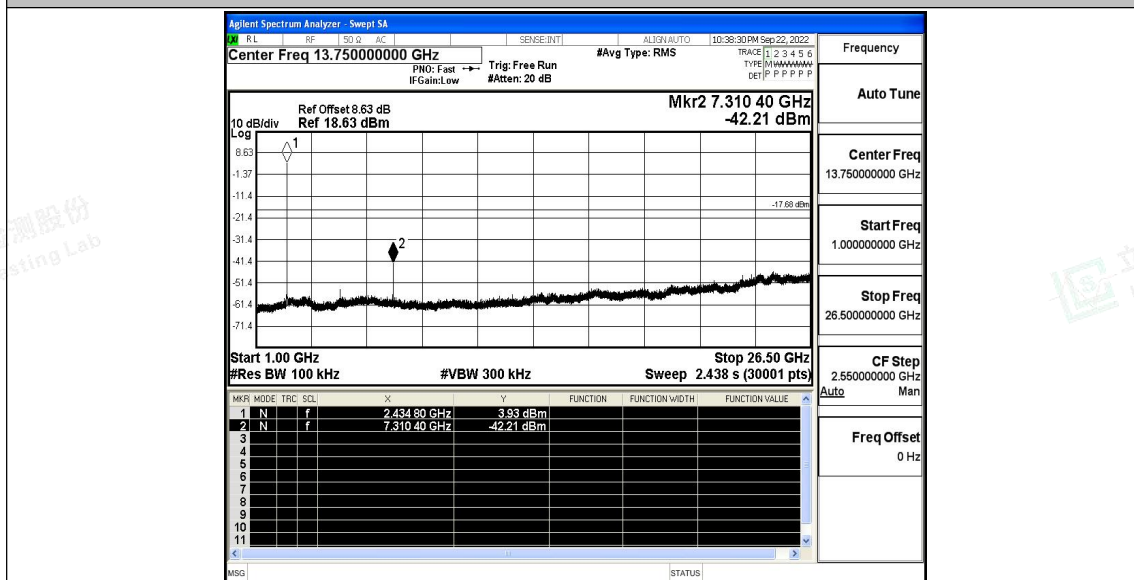


11B_Ant1_2462_0~Reference



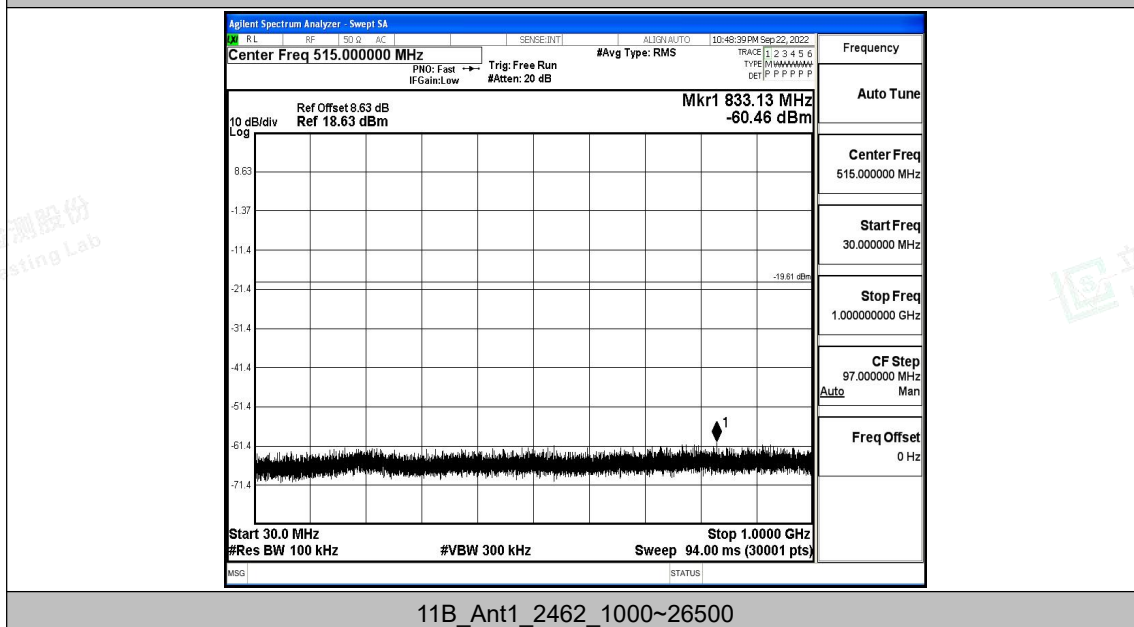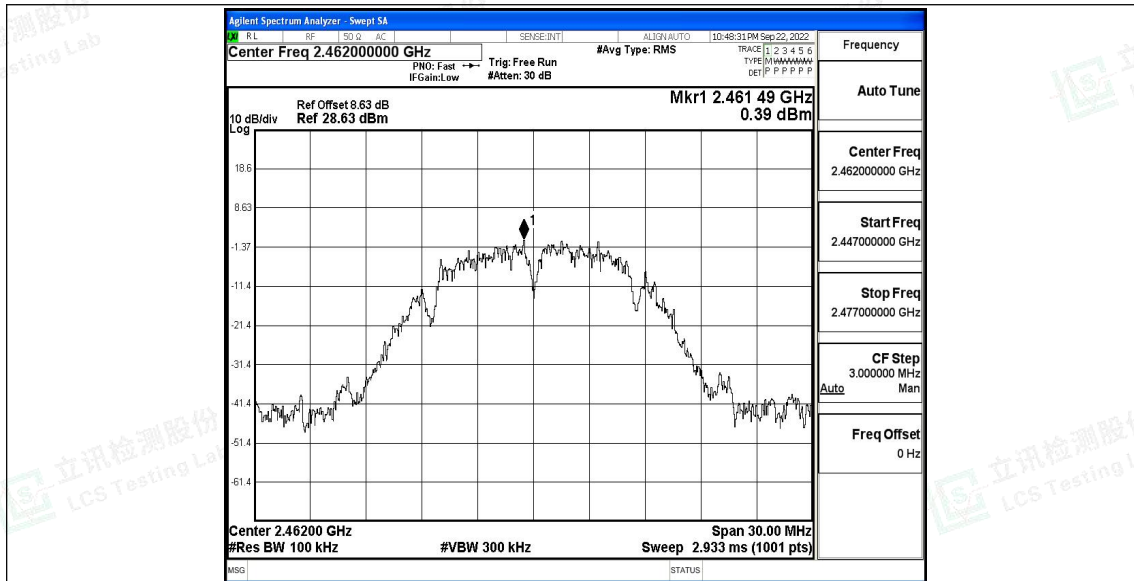

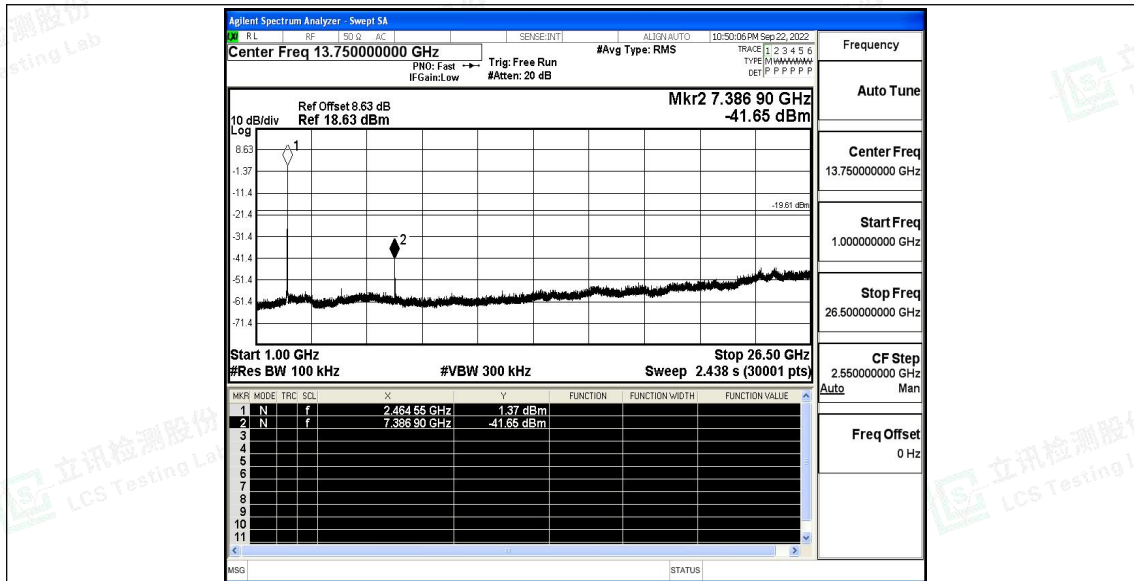

11G_Ant1_2412_0~Reference

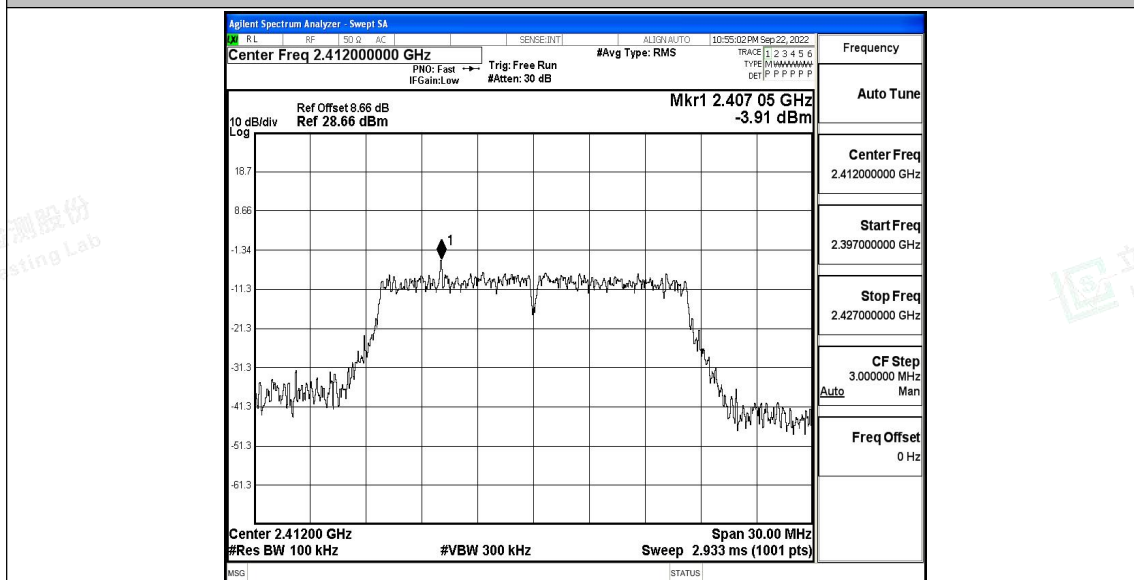

11G_Ant1_2412_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Building A and 301 Building C, Juji Industrial Park, Yabianxueziwei Shajing Street, Baoan District, Shenzhen, 518000, P.R.C.

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

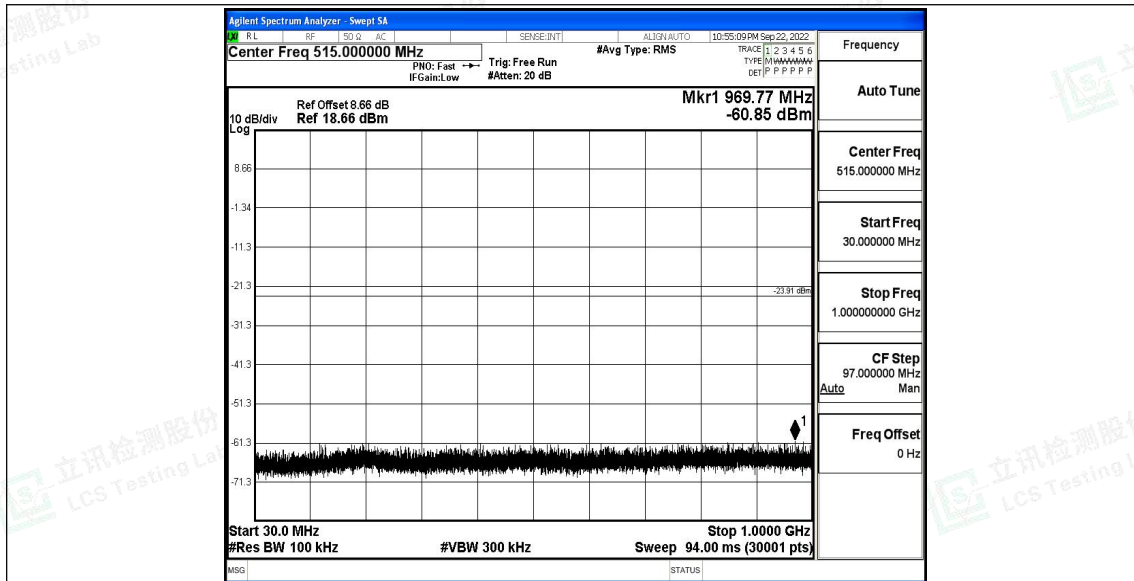



11G_Ant1_2412_1000~26500

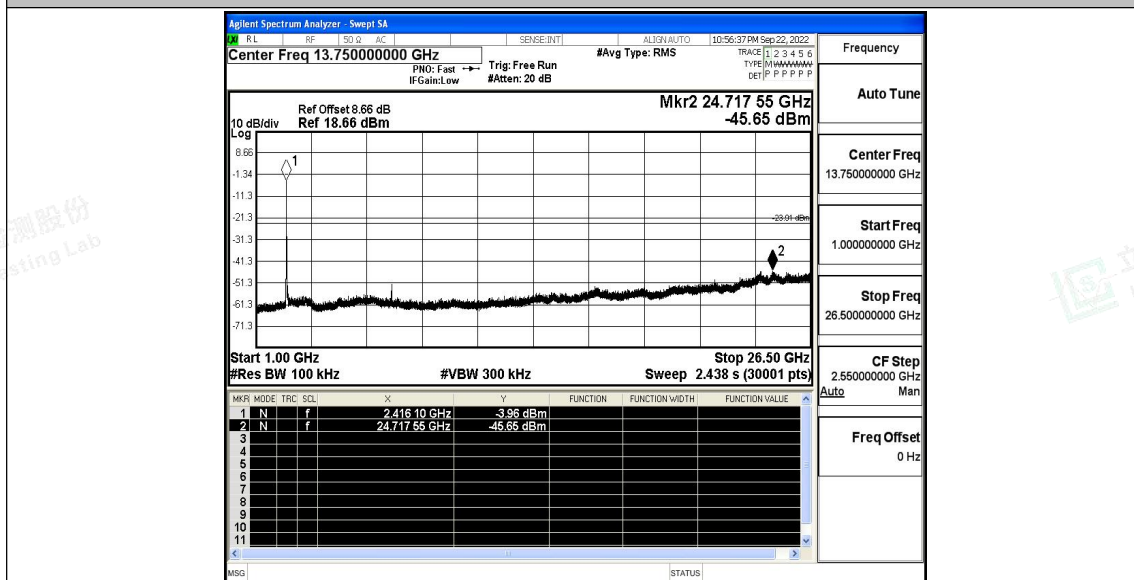


11G_Ant1_2437_0~Reference



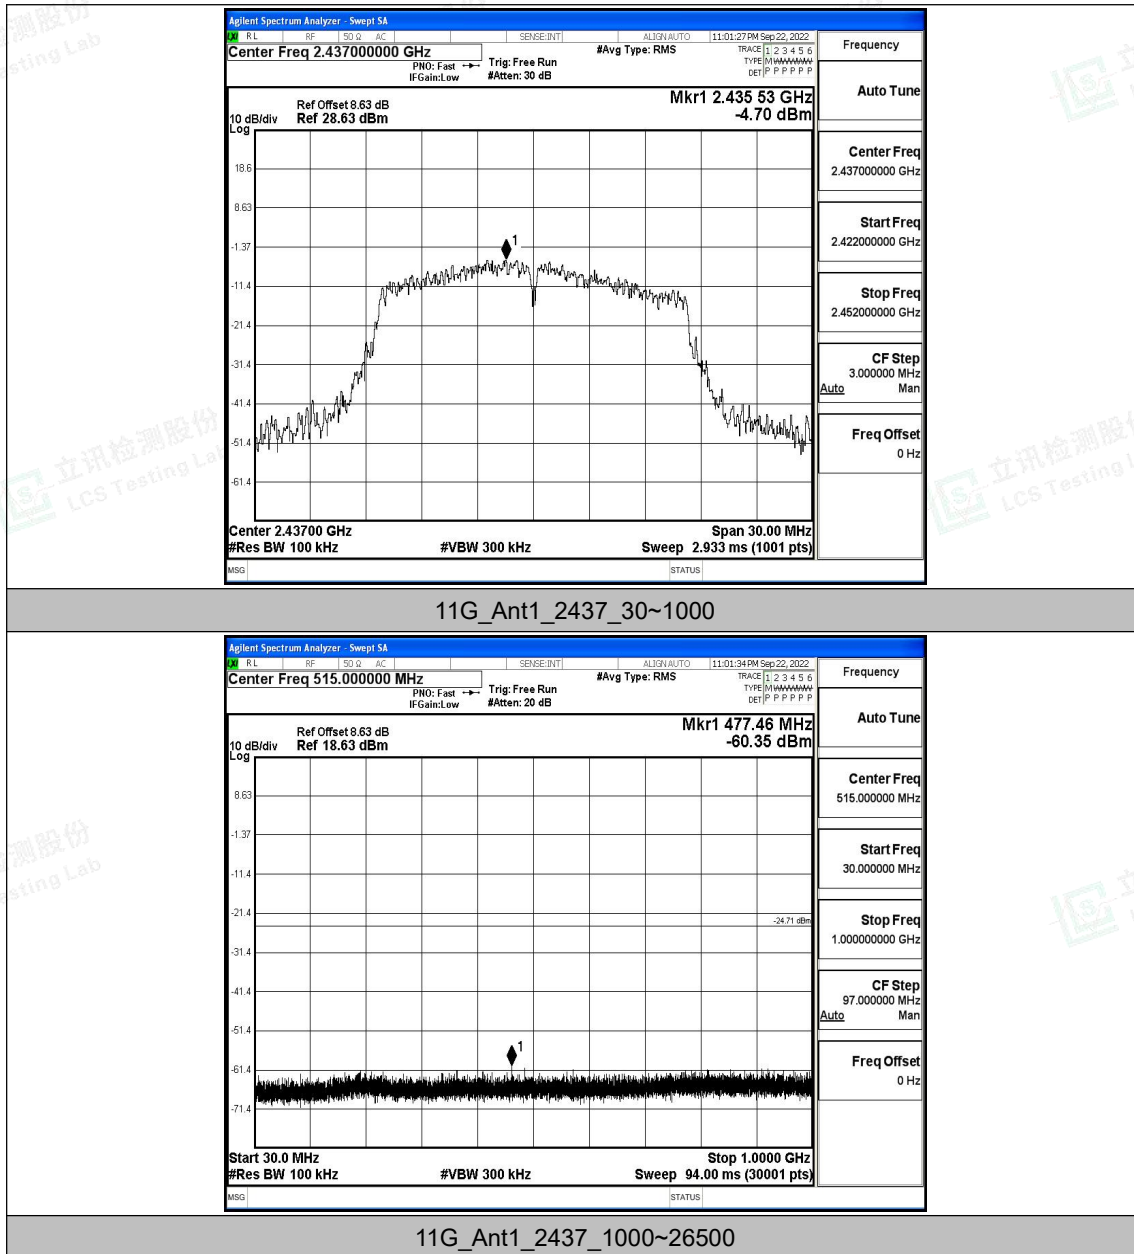

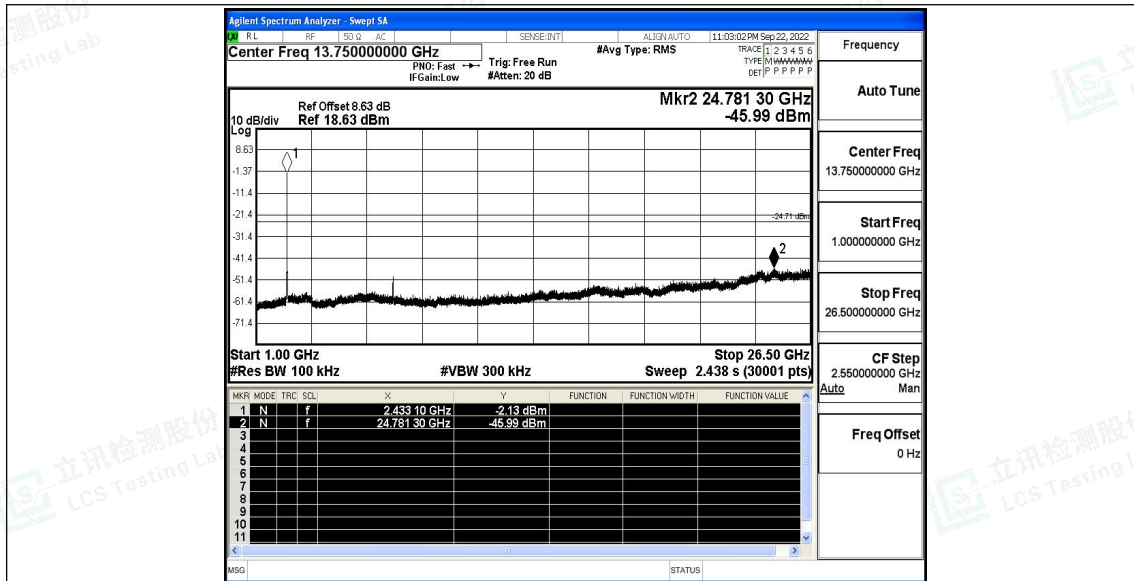


11G_Ant1_2462_0~Reference

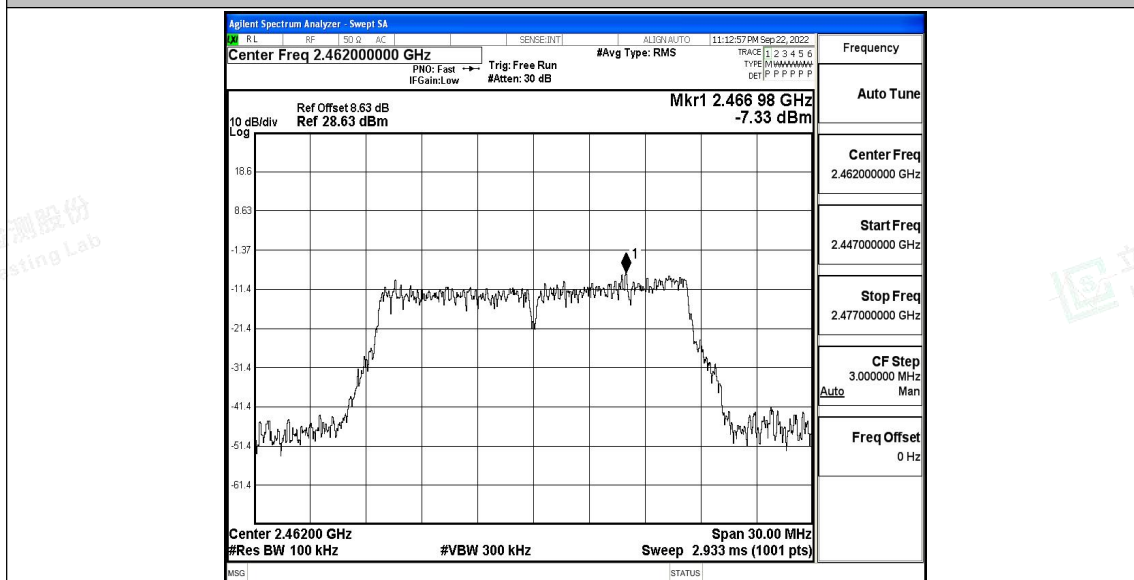


11G_Ant1_2462_30~1000



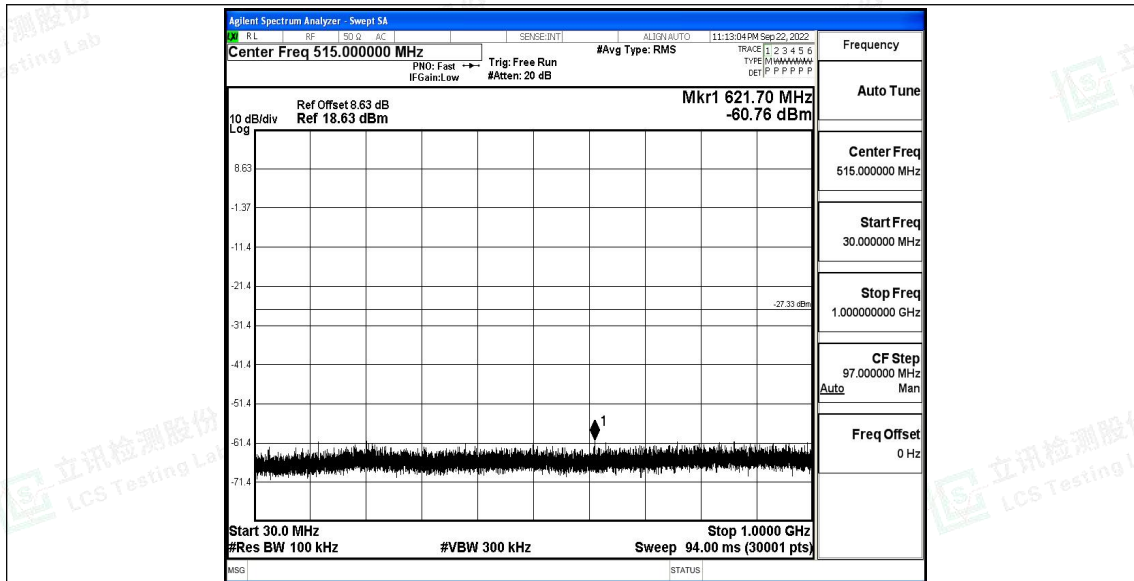



11G_Ant1_2462_1000~26500

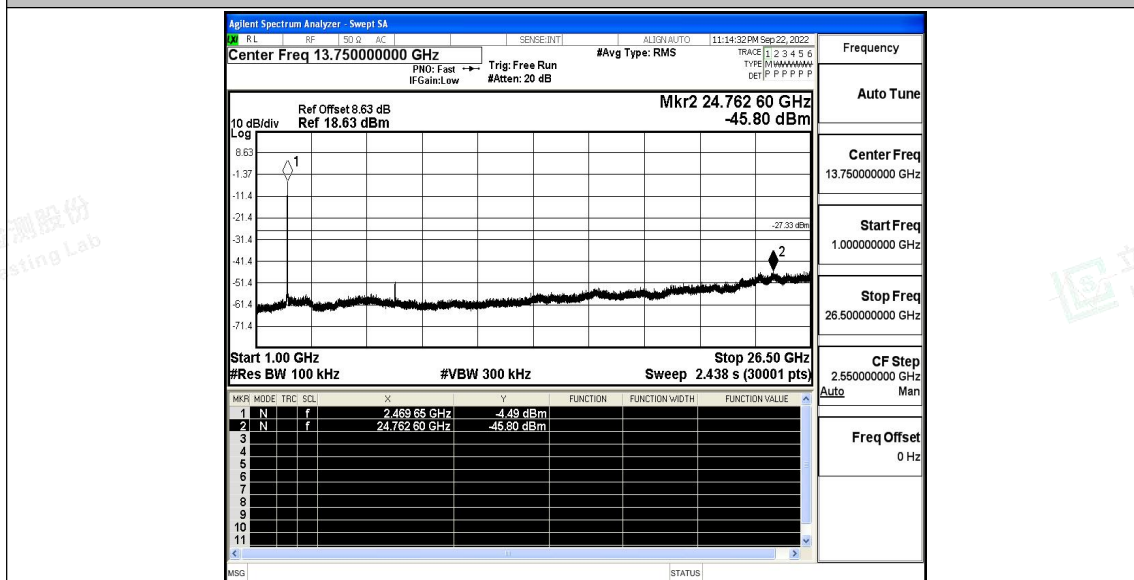


11N20SISO_Ant1_2412_0~Reference



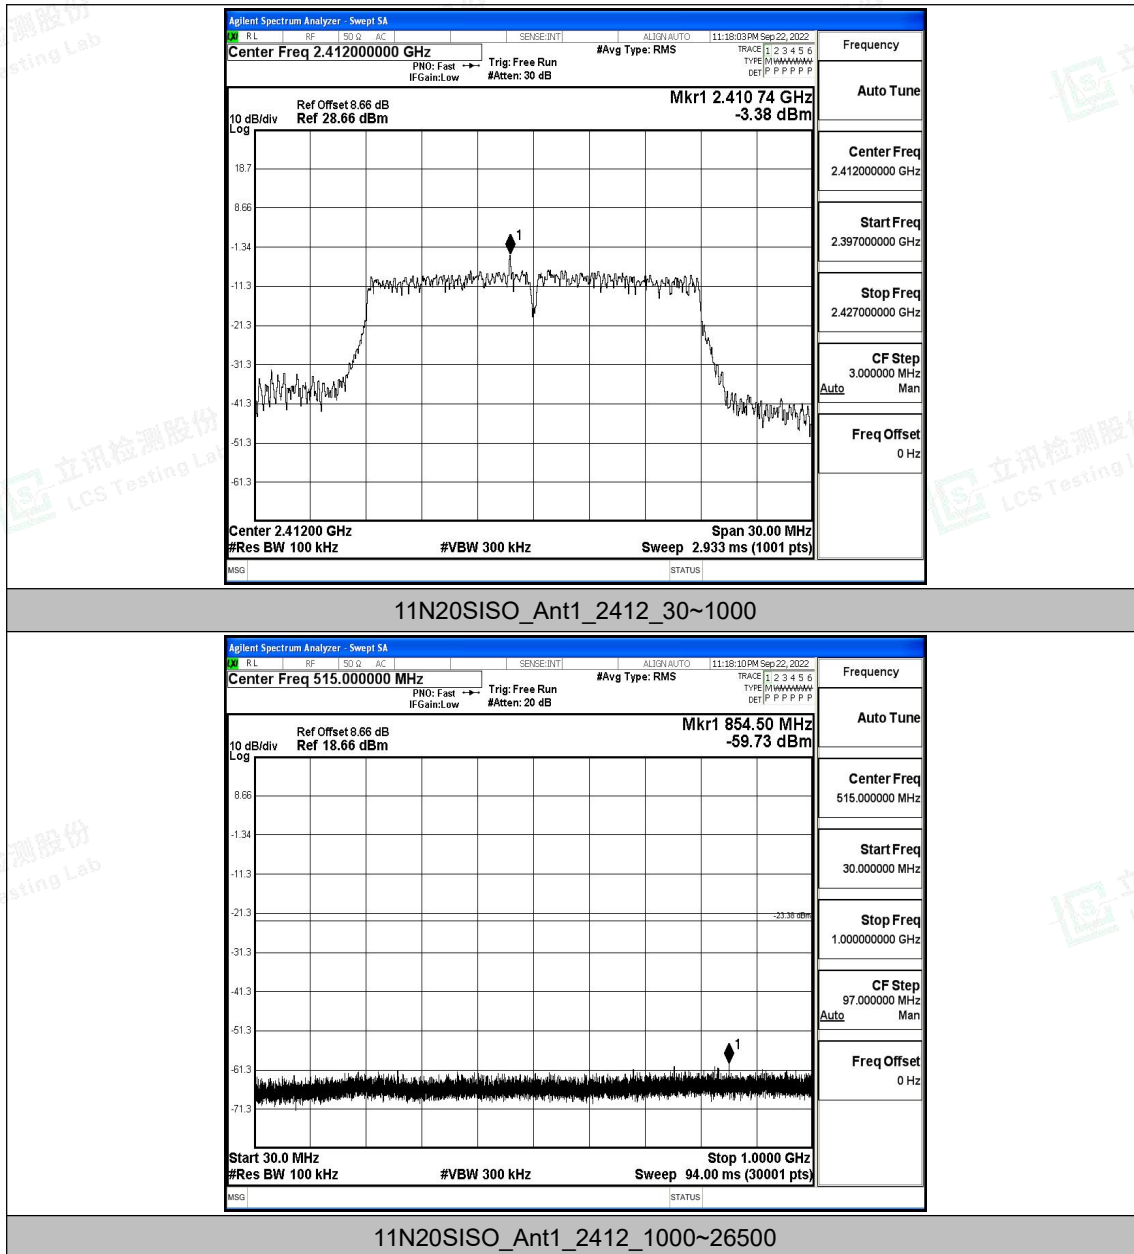

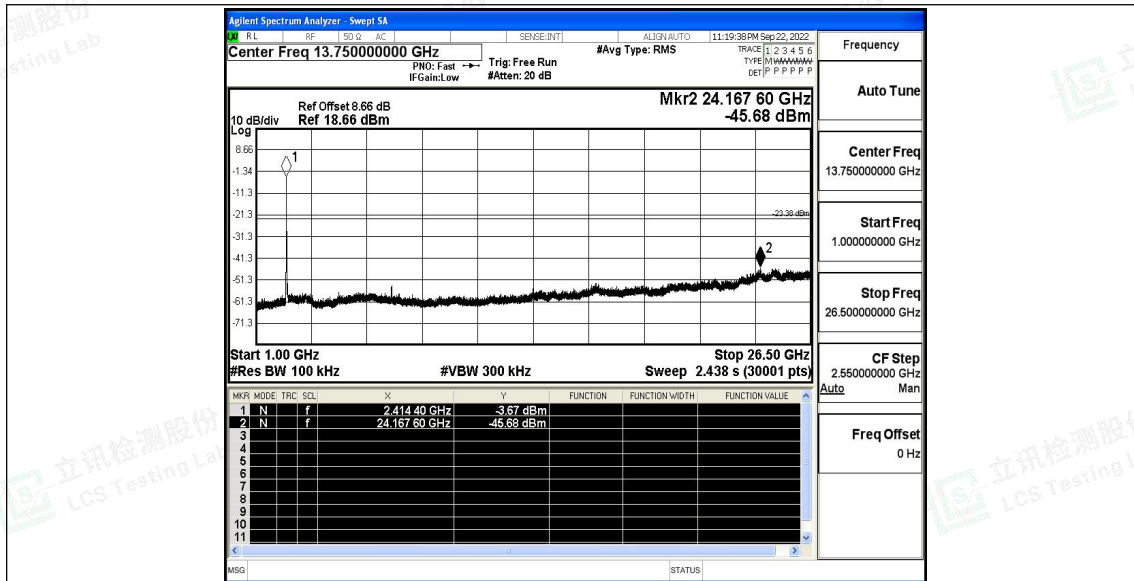

11N20SISO_Ant1_2437_0~Reference

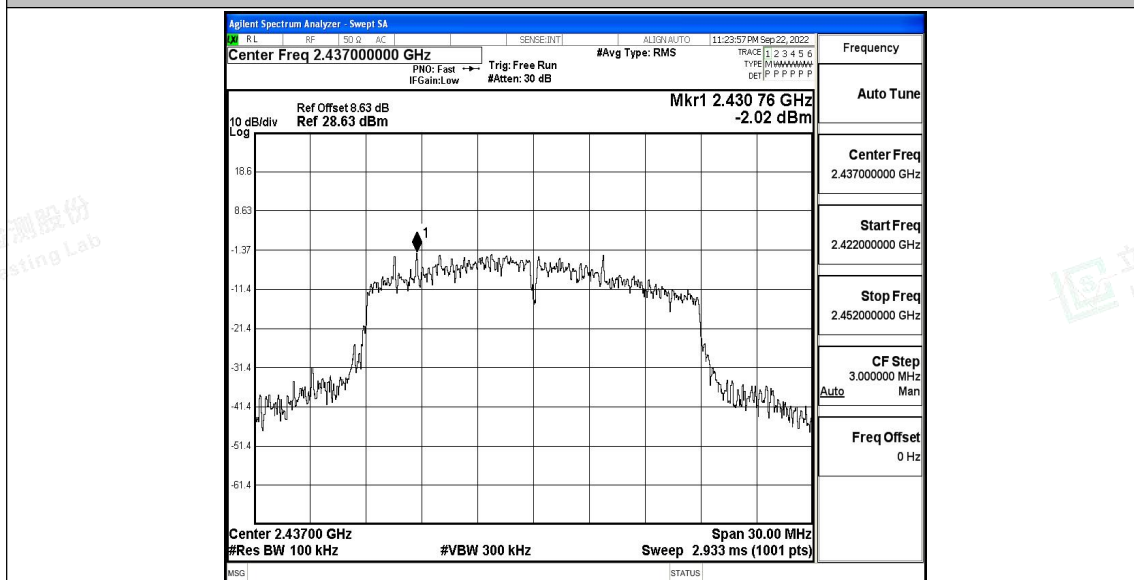

11N20SISO_Ant1_2437_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Building A and 301 Building C, Juji Industrial Park, Yabianxueziwei Shajing Street, Baoan District, Shenzhen, 518000, P.R.C.

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

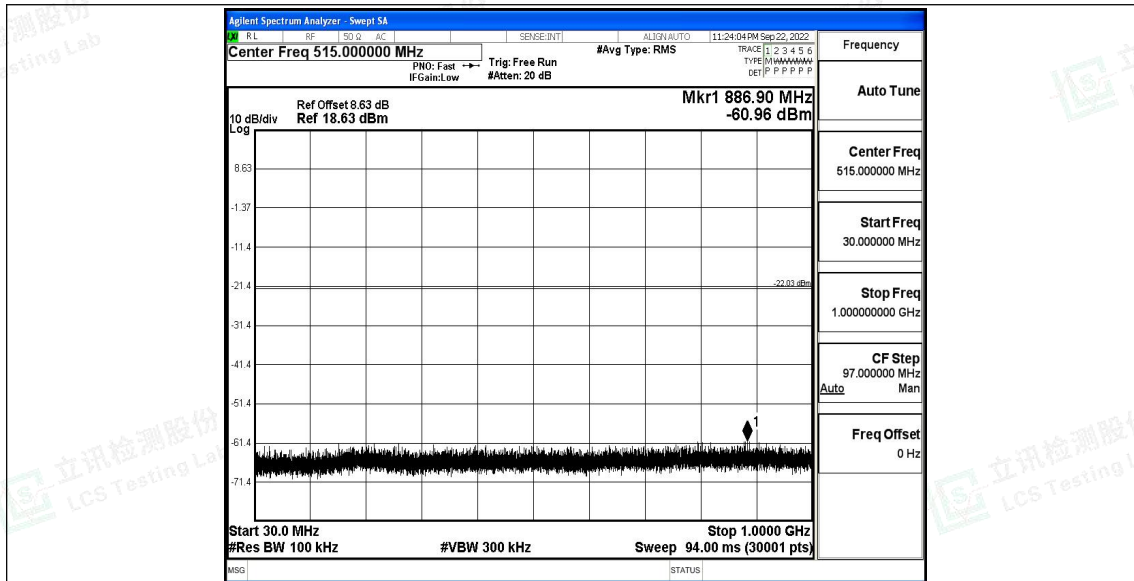



11N20SISO_Ant1_2437_1000~26500

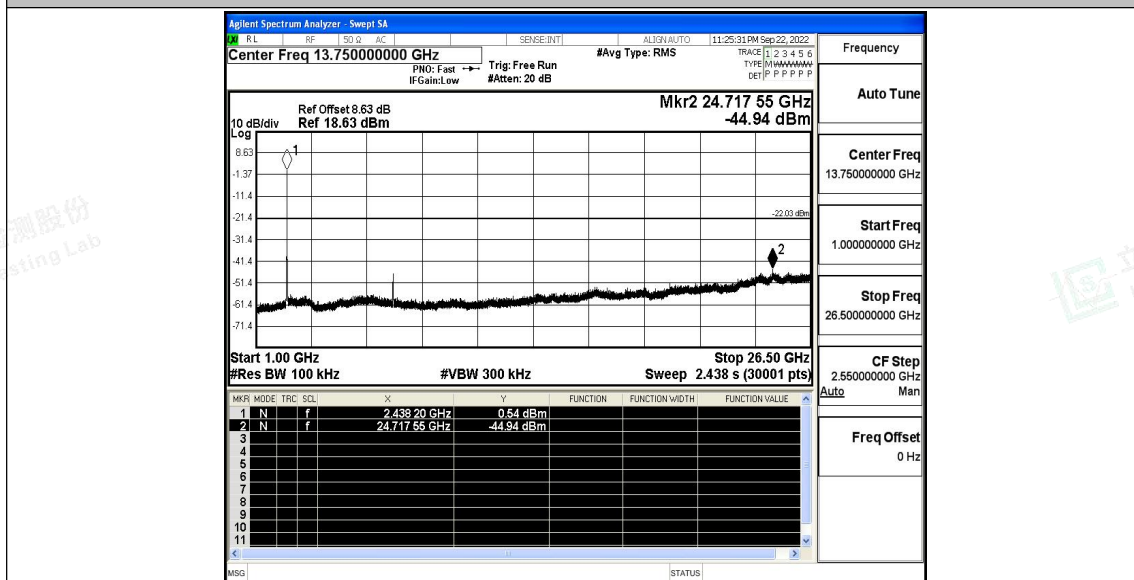


11N20SISO_Ant1_2462_0~Reference



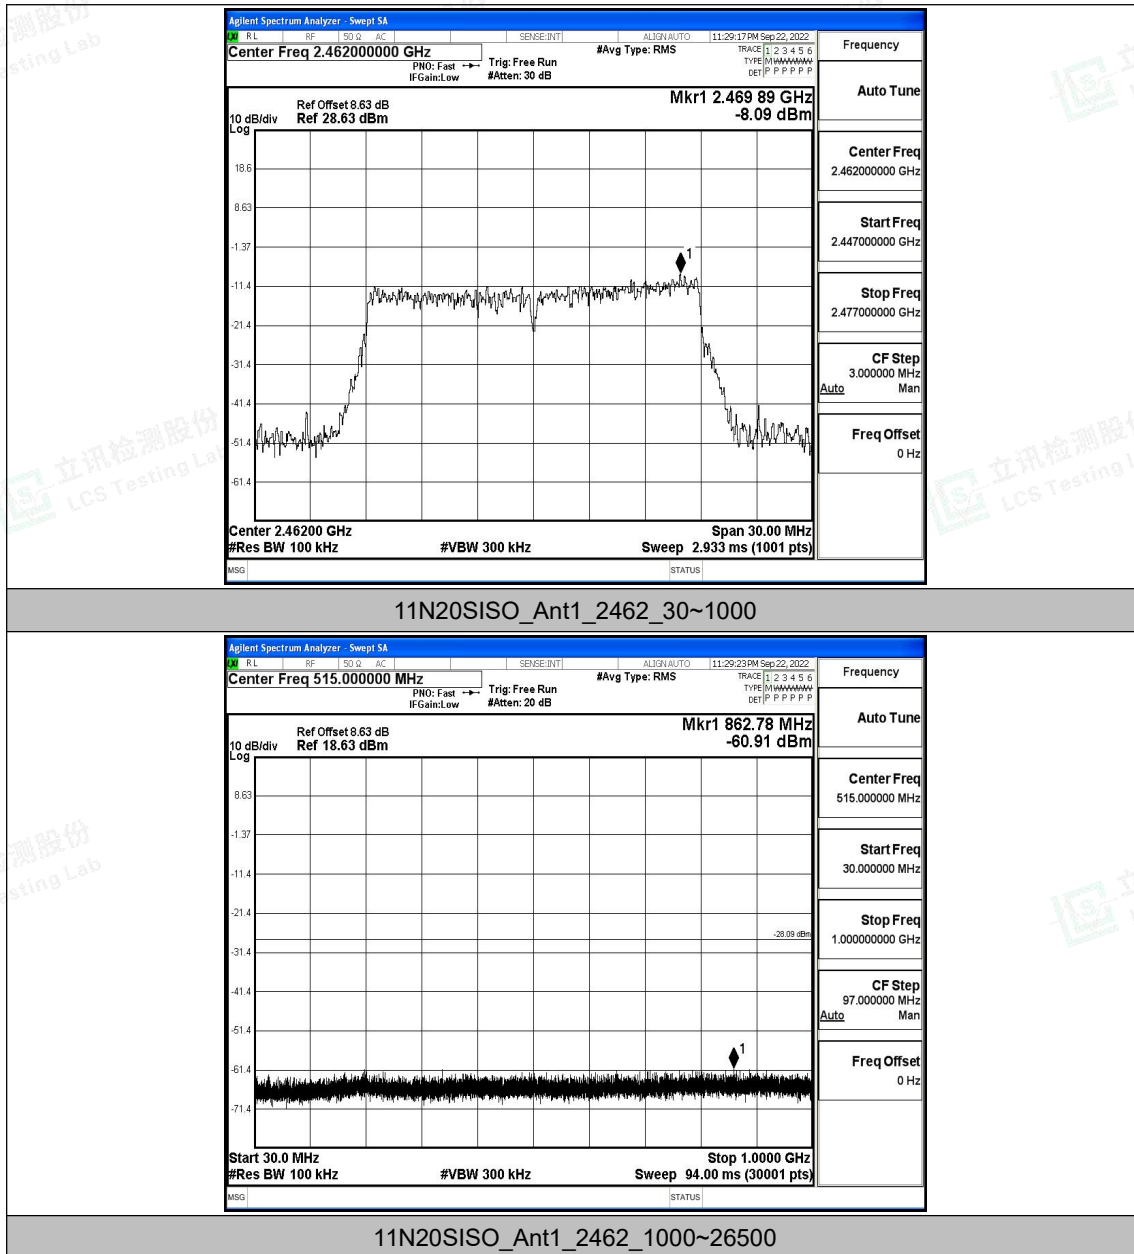

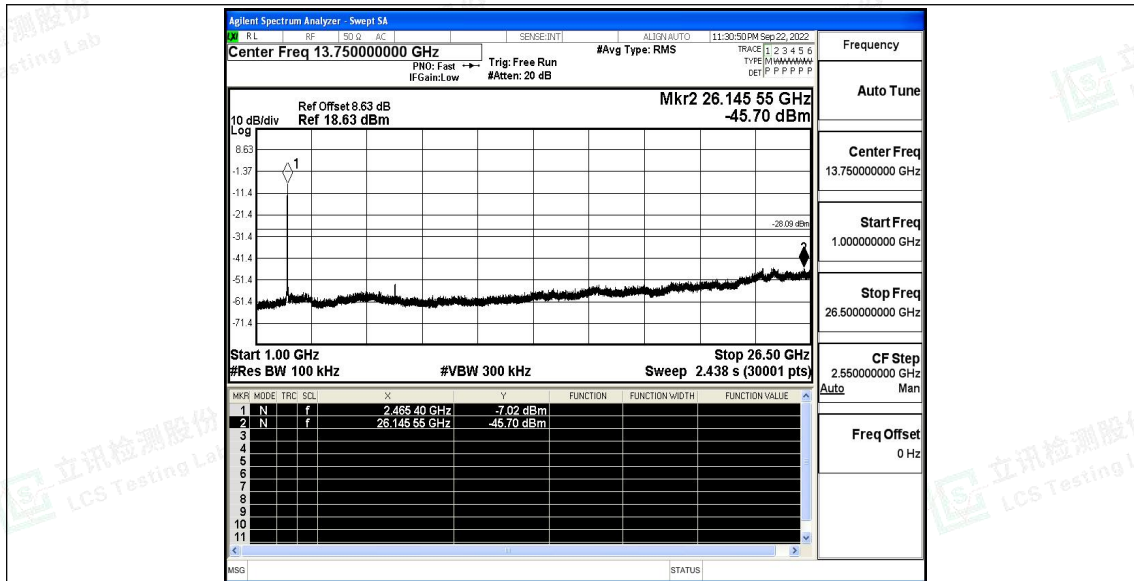

11N40SISO_Ant1_2422_0~Reference

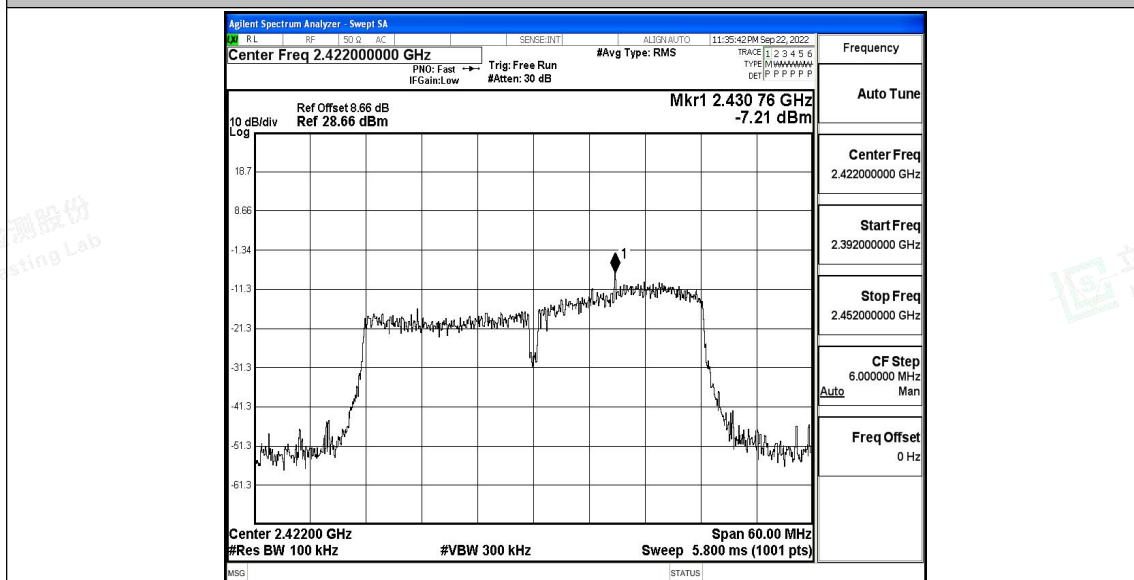

11N40SISO_Ant1_2422_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Building A and 301 Building C, Juji Industrial Park, Yabianxueziwei Shajing Street, Baoan District, Shenzhen, 518000, P.R.C.

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

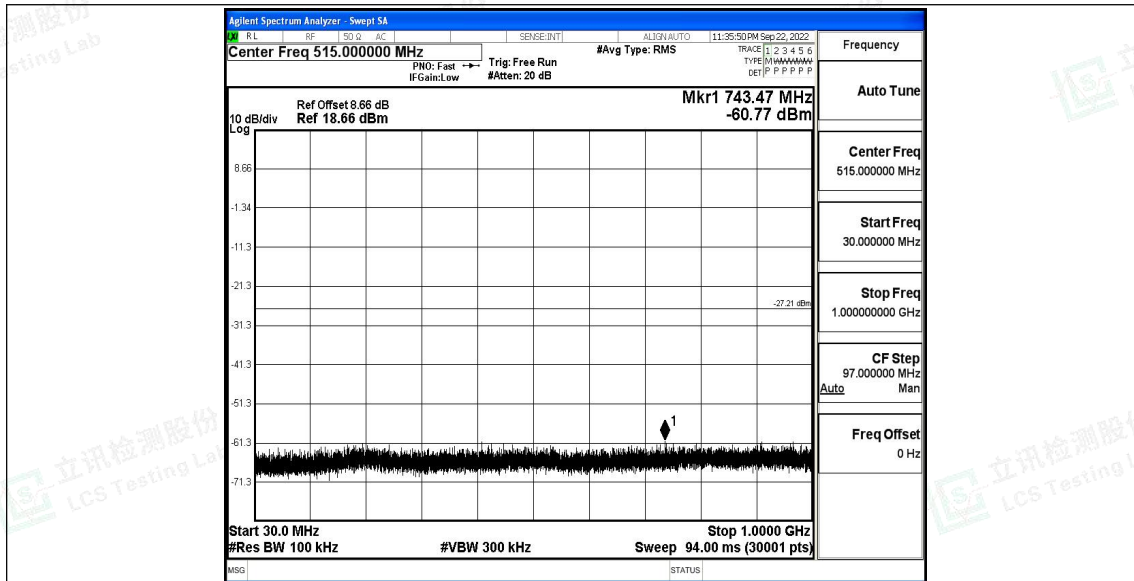

11N40SISO_Ant1_2422_1000~26500

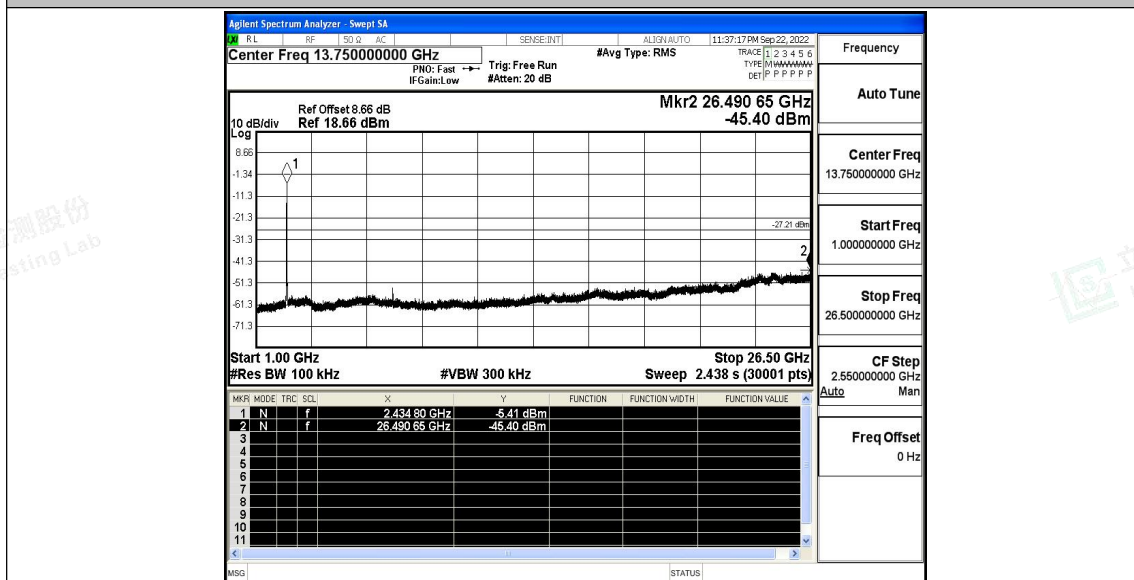

11N40SISO_Ant1_2437_0~Reference



