





Tx. Spurious NVNT ax20 2462MHz Ant1 Ref

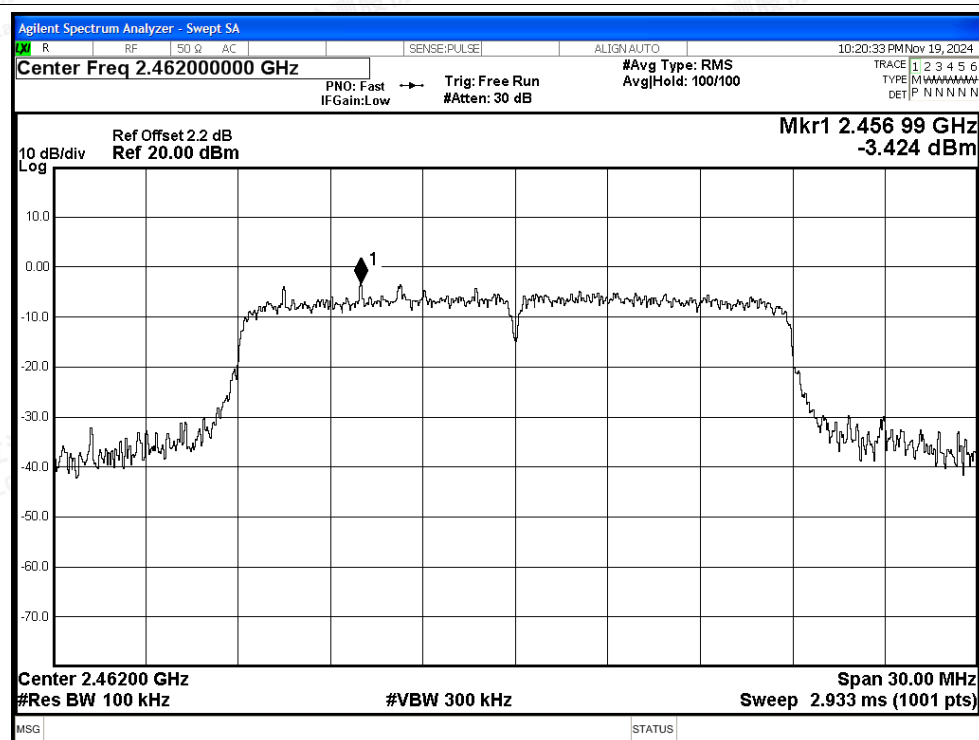

Tx. Spurious NVNT ax20 2462MHz Ant1 Emission

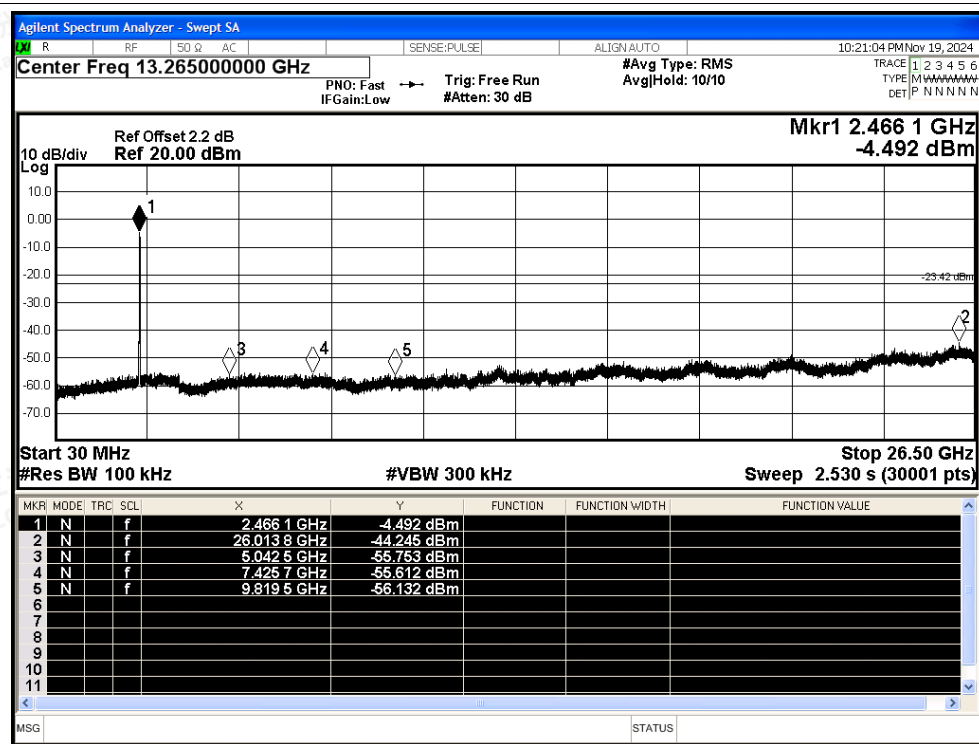

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT ax40 2422MHz Ant1 Ref

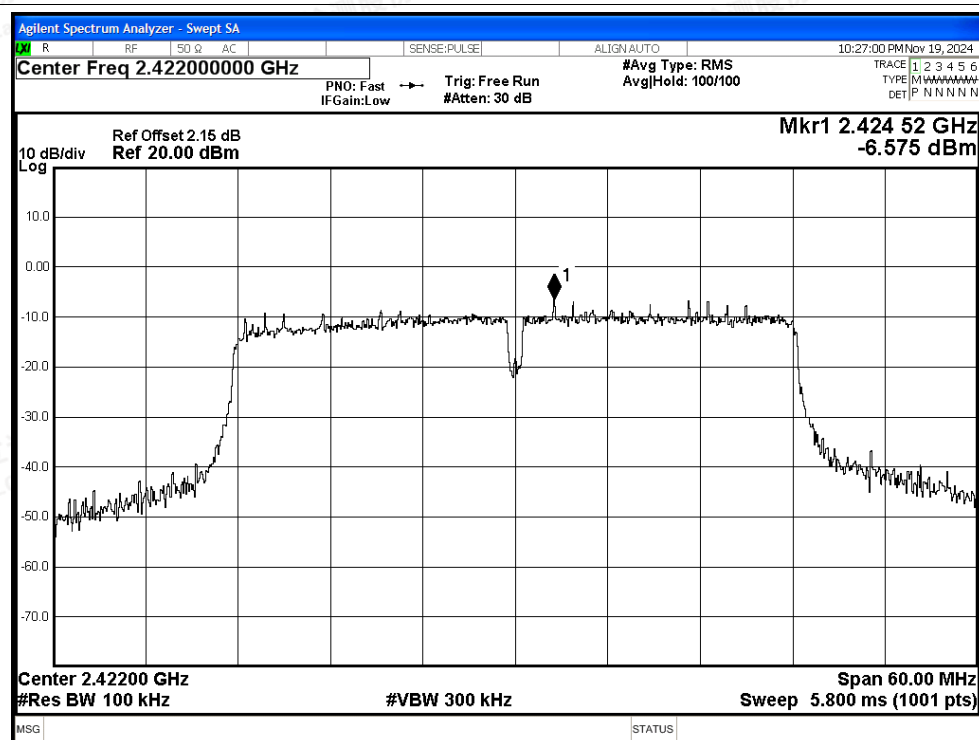

Tx. Spurious NVNT ax40 2422MHz Ant1 Emission

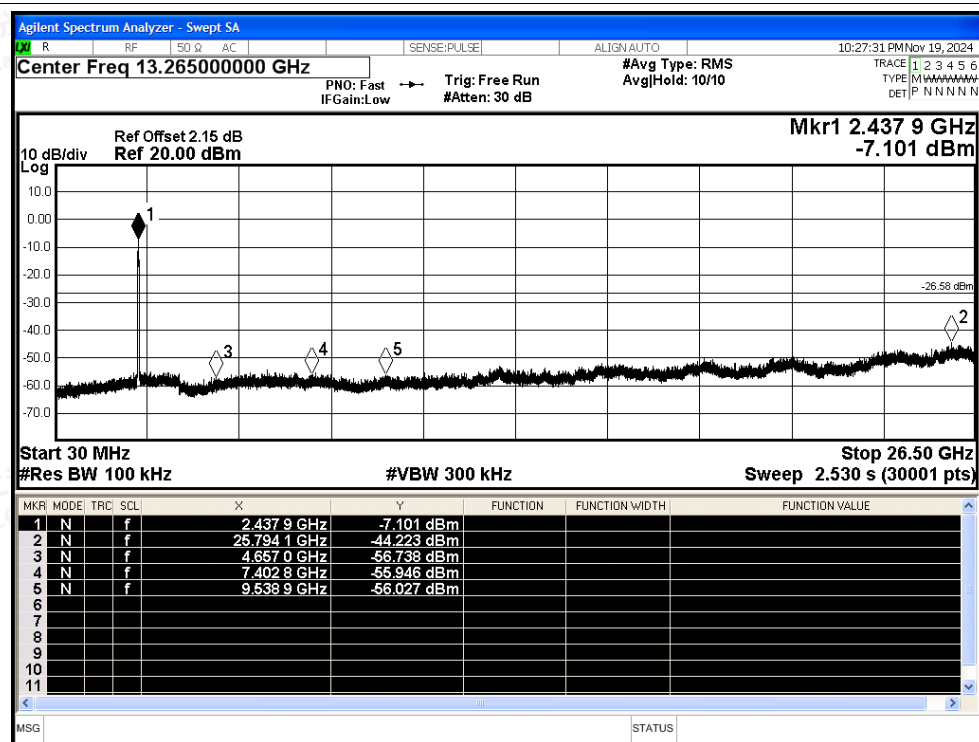

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT ax40 2437MHz Ant1 Ref

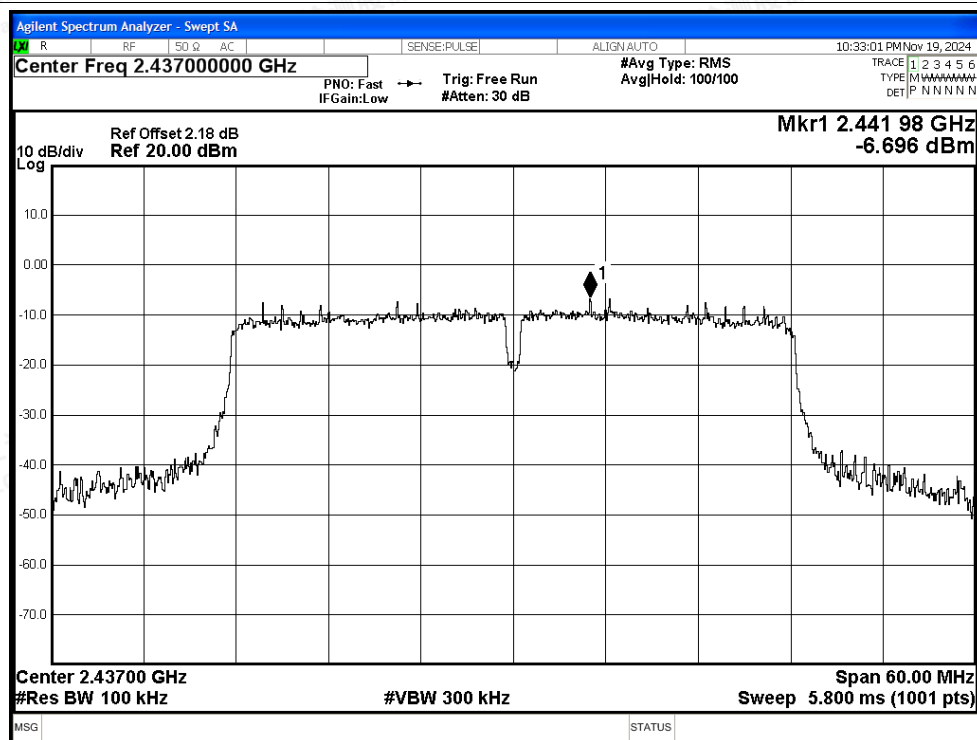

Tx. Spurious NVNT ax40 2437MHz Ant1 Emission

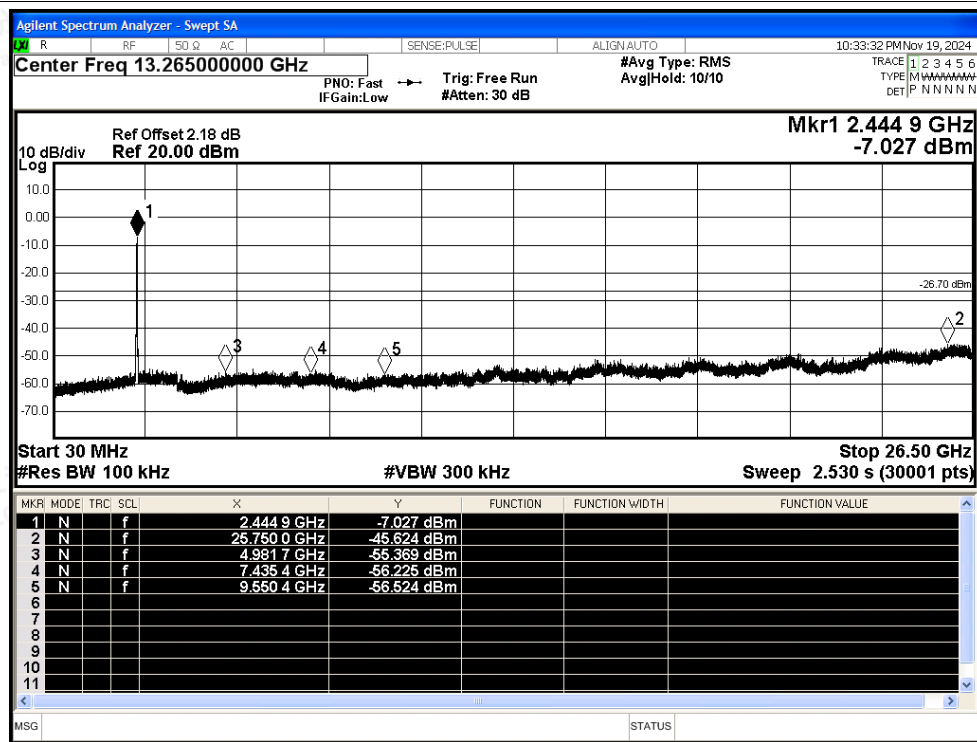

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT ax40 2452MHz Ant1 Ref

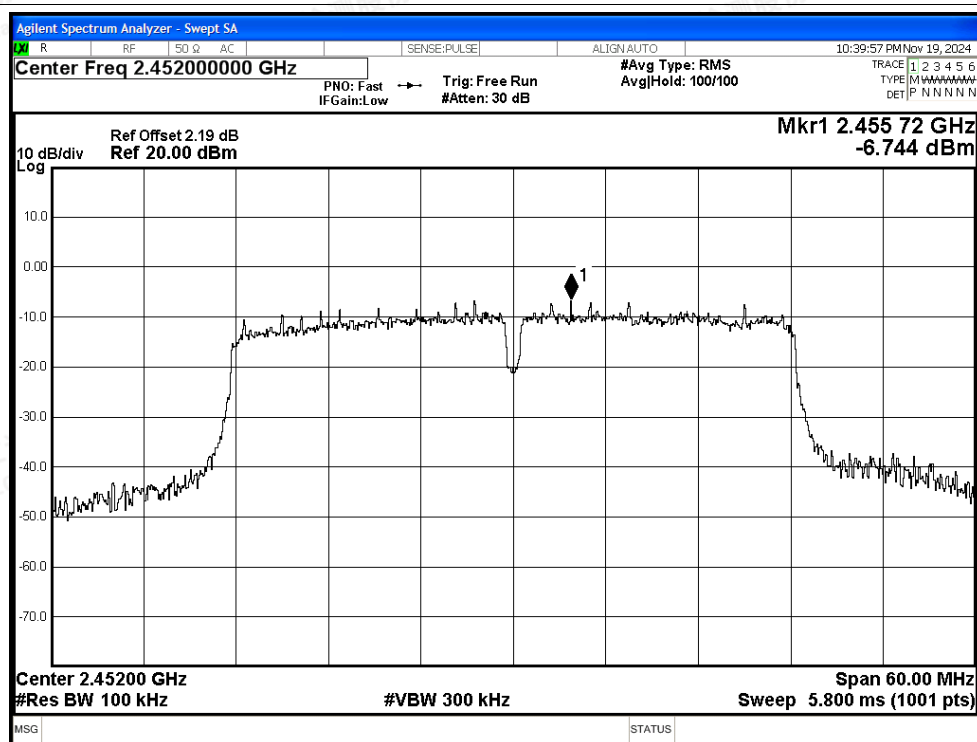

Tx. Spurious NVNT ax40 2452MHz Ant1 Emission

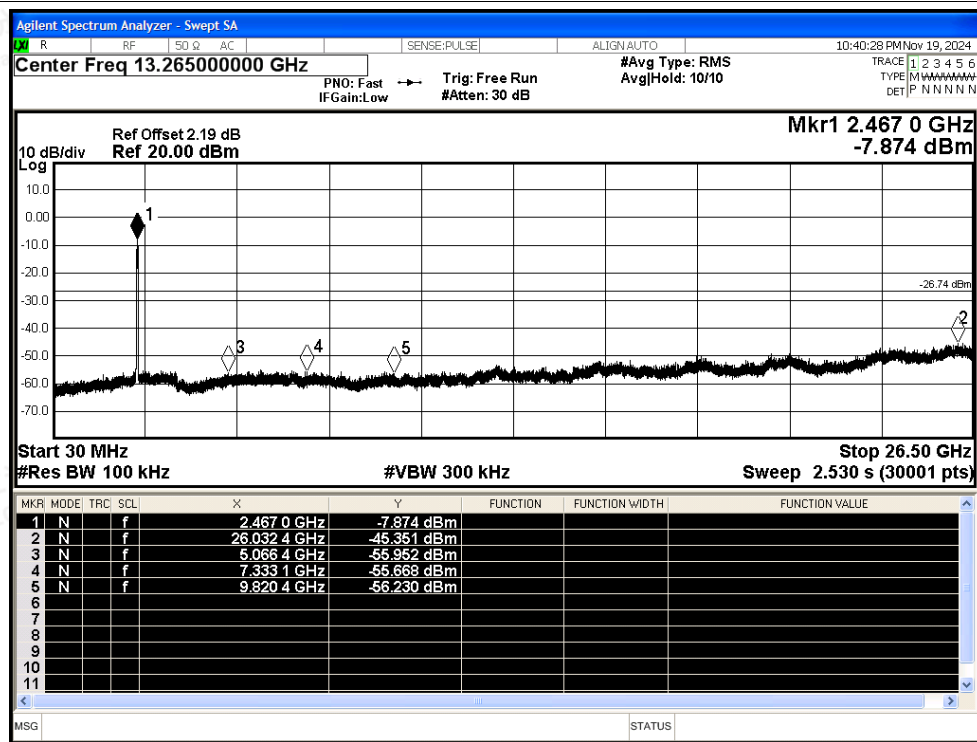

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



C.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	b	2412	Ant1	99.13	0	0.15
NVNT	b	2437	Ant1	99.13	0	0.15
NVNT	b	2462	Ant1	99.16	0	0.15
NVNT	g	2412	Ant1	97.75	0.1	0.37
NVNT	g	2437	Ant1	97.75	0.1	0.37
NVNT	g	2462	Ant1	97.75	0.1	0.37
NVNT	n20	2412	Ant1	97.33	0.12	0.44
NVNT	n20	2437	Ant1	97.33	0.12	0.44
NVNT	n20	2462	Ant1	97.25	0.12	0.44
NVNT	n40	2422	Ant1	94.71	0.24	0.9
NVNT	n40	2437	Ant1	94.71	0.24	0.9
NVNT	n40	2452	Ant1	94.7	0.24	0.9
NVNT	ax20	2412	Ant1	97.33	0.12	0.44
NVNT	ax20	2437	Ant1	97.33	0.12	0.44
NVNT	ax20	2462	Ant1	97.33	0.12	0.44
NVNT	ax40	2422	Ant1	94.71	0.24	0.9
NVNT	ax40	2437	Ant1	94.71	0.24	0.9
NVNT	ax40	2452	Ant1	94.71	0.24	0.9



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT b 2412MHz Ant1

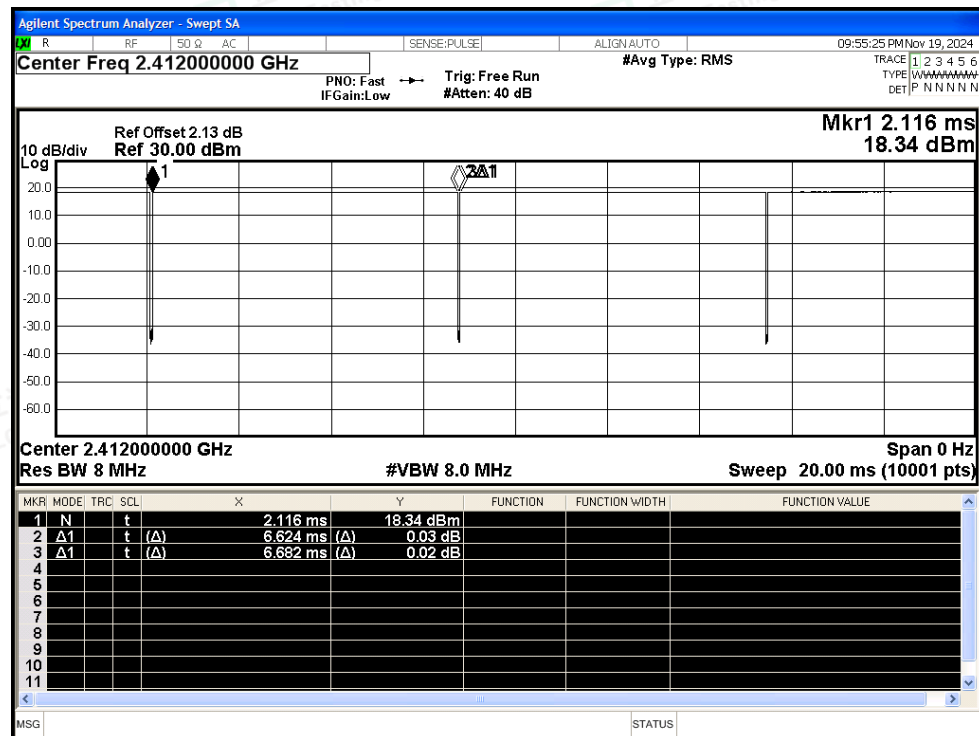

Duty Cycle NVNT b 2437MHz Ant1

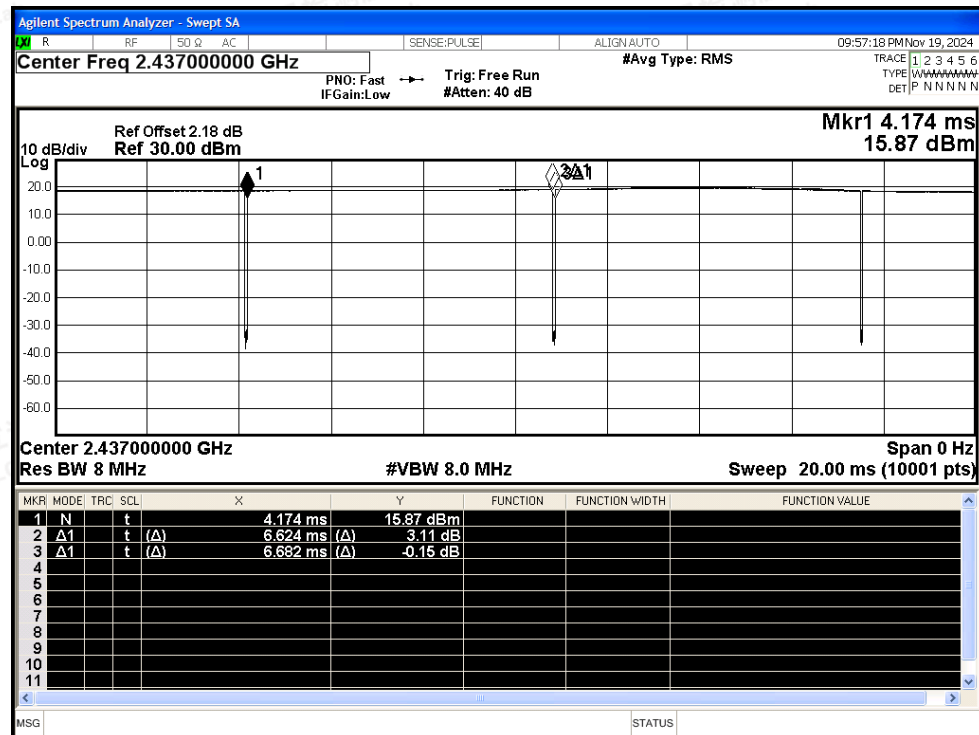

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT b 2462MHz Ant1

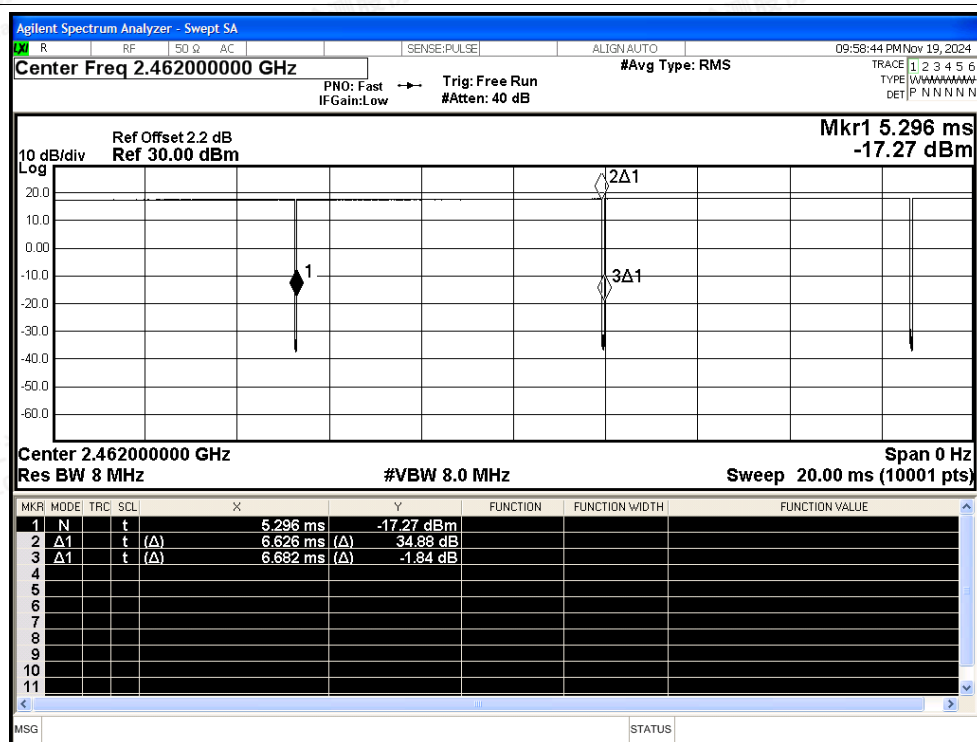

Duty Cycle NVNT g 2412MHz Ant1

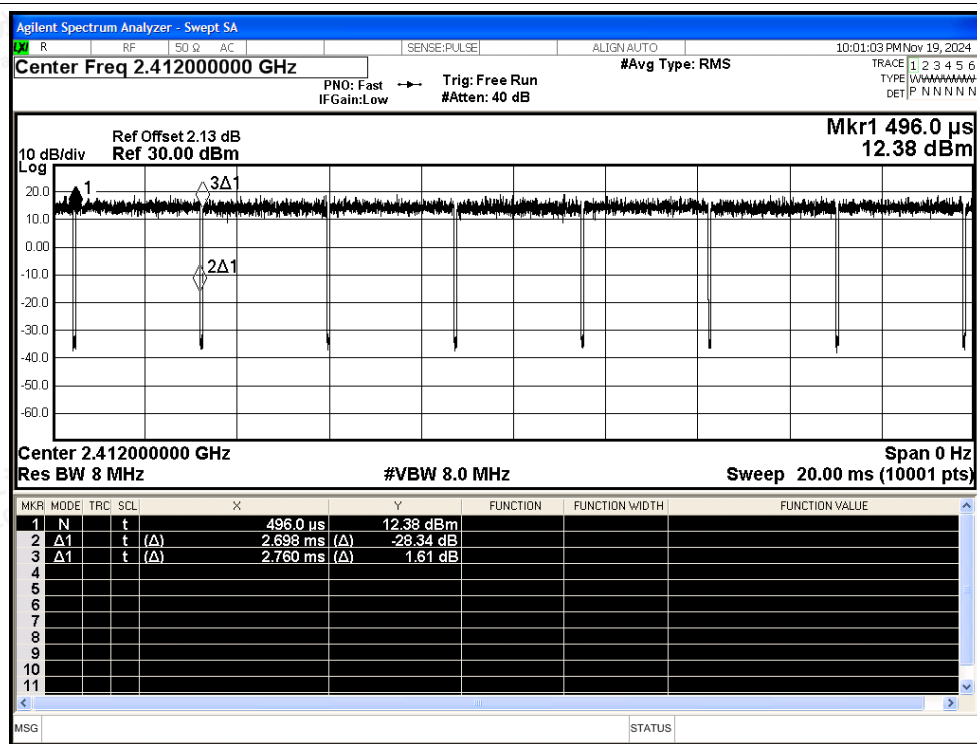

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT g 2437MHz Ant1

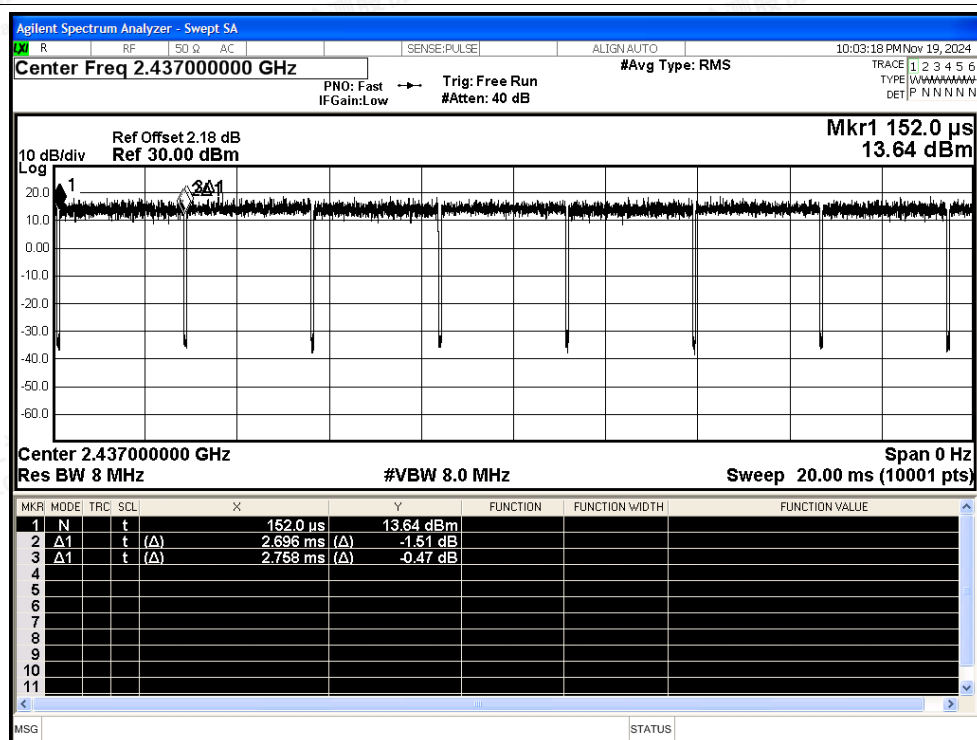

Duty Cycle NVNT g 2462MHz Ant1

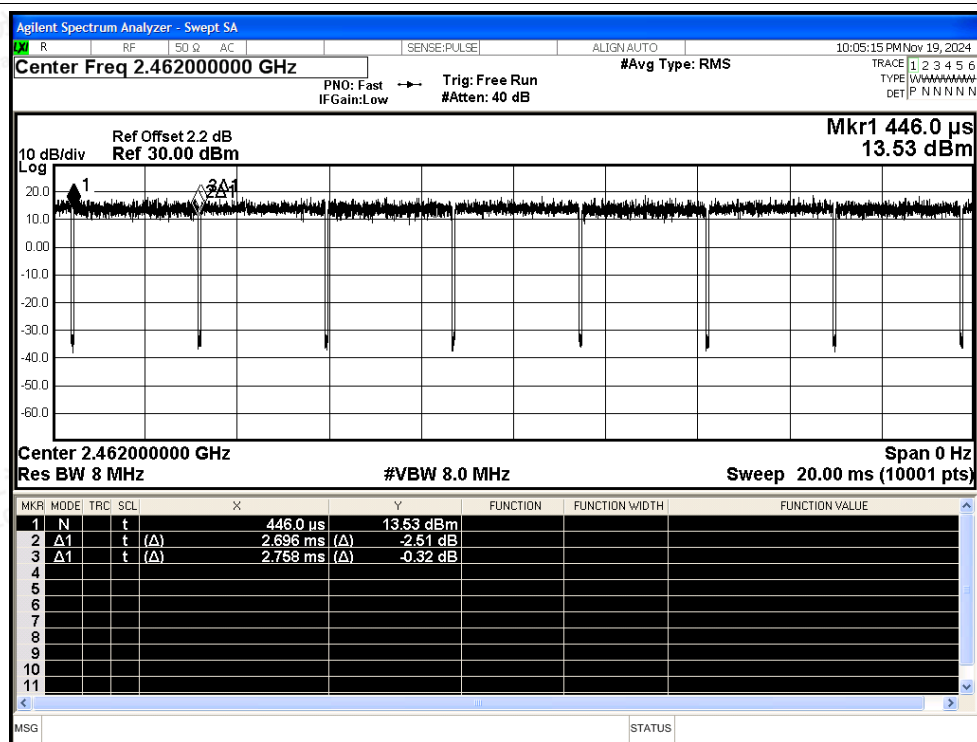

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 2412MHz Ant1

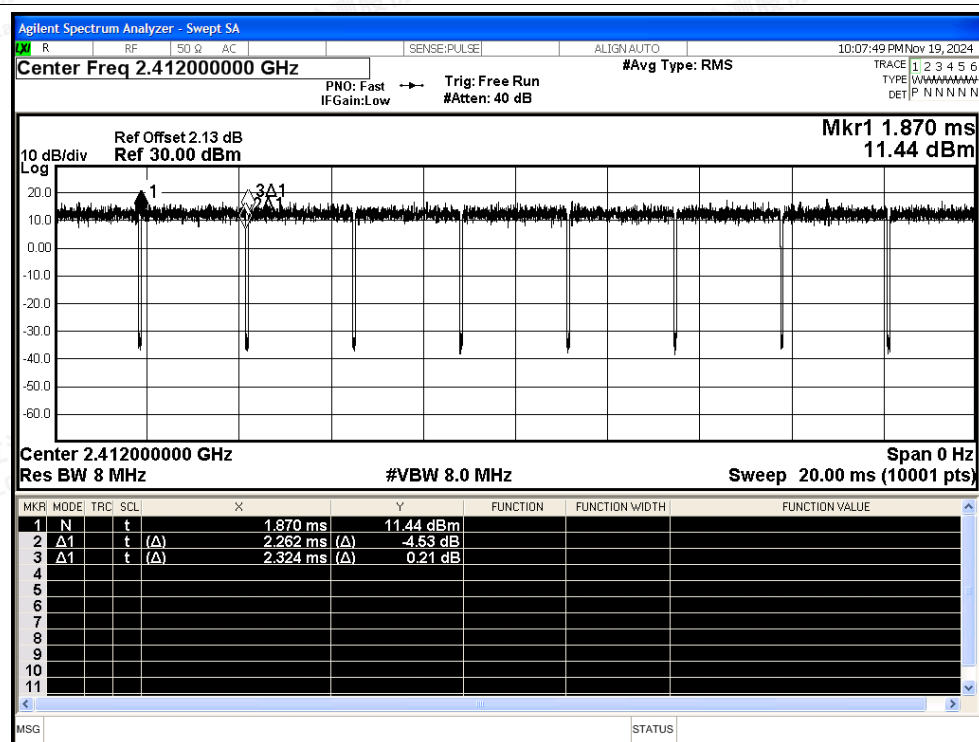

Duty Cycle NVNT n20 2437MHz Ant1

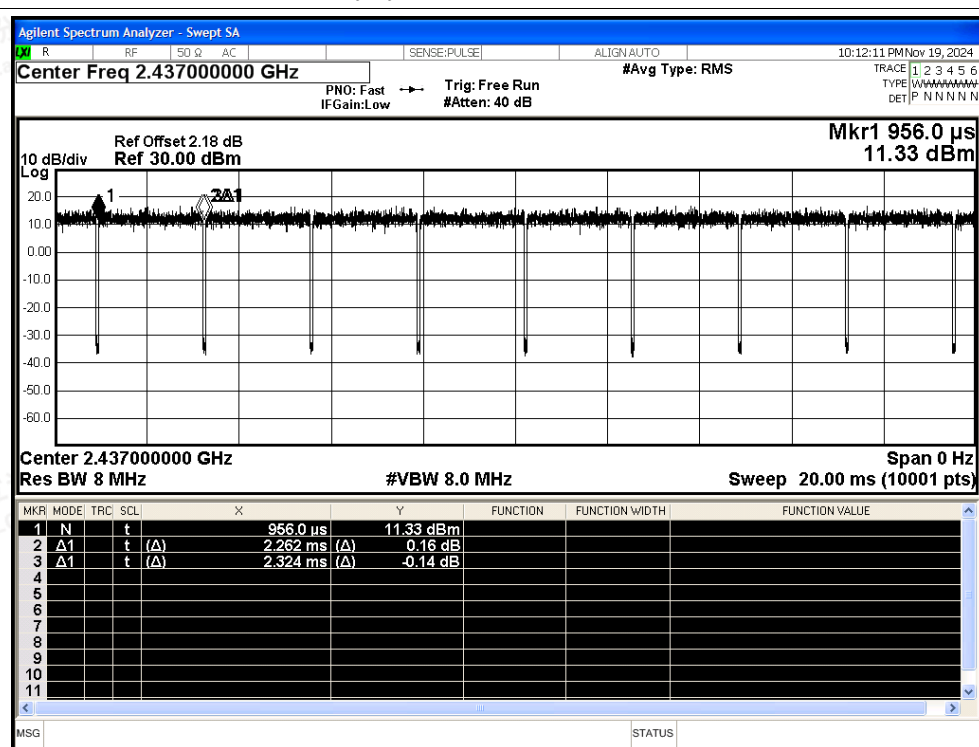

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 2462MHz Ant1

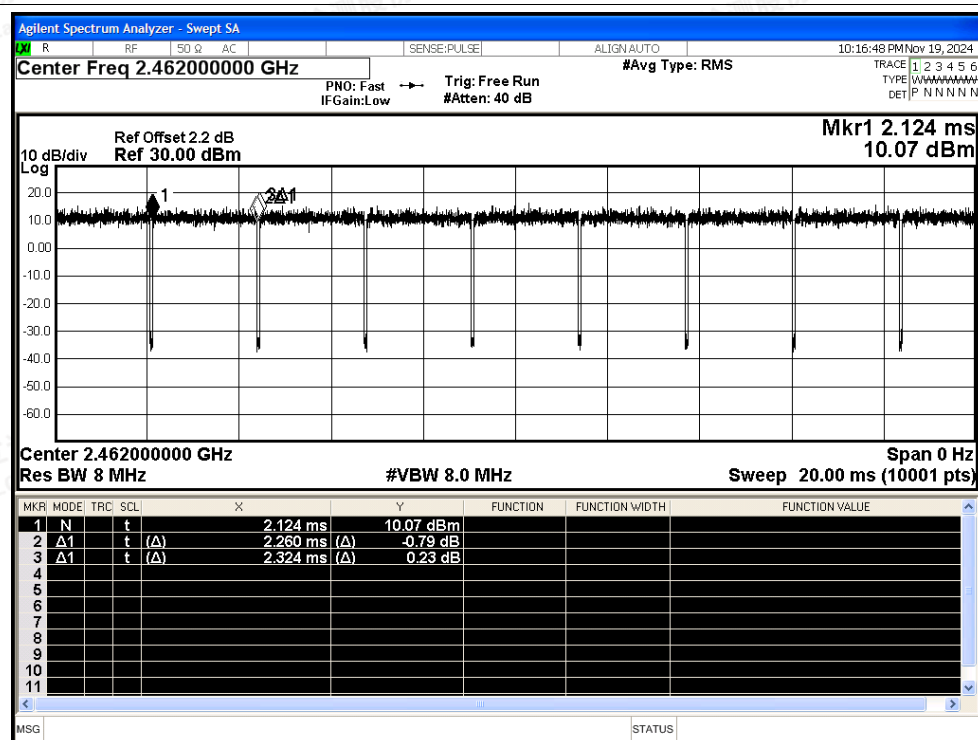

Duty Cycle NVNT n40 2422MHz Ant1


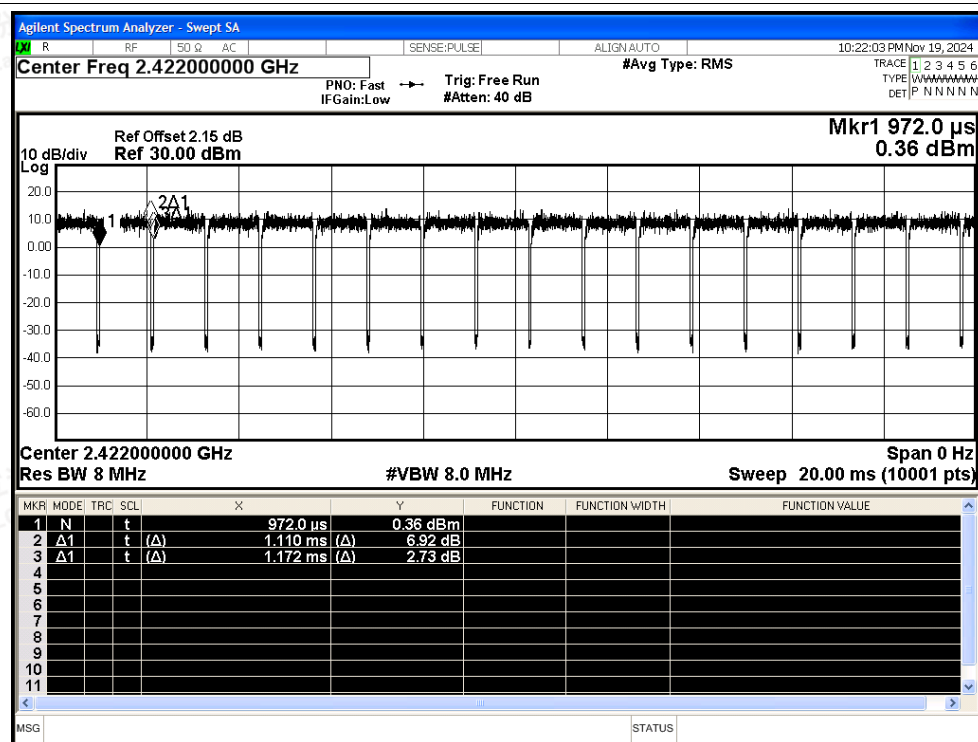


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

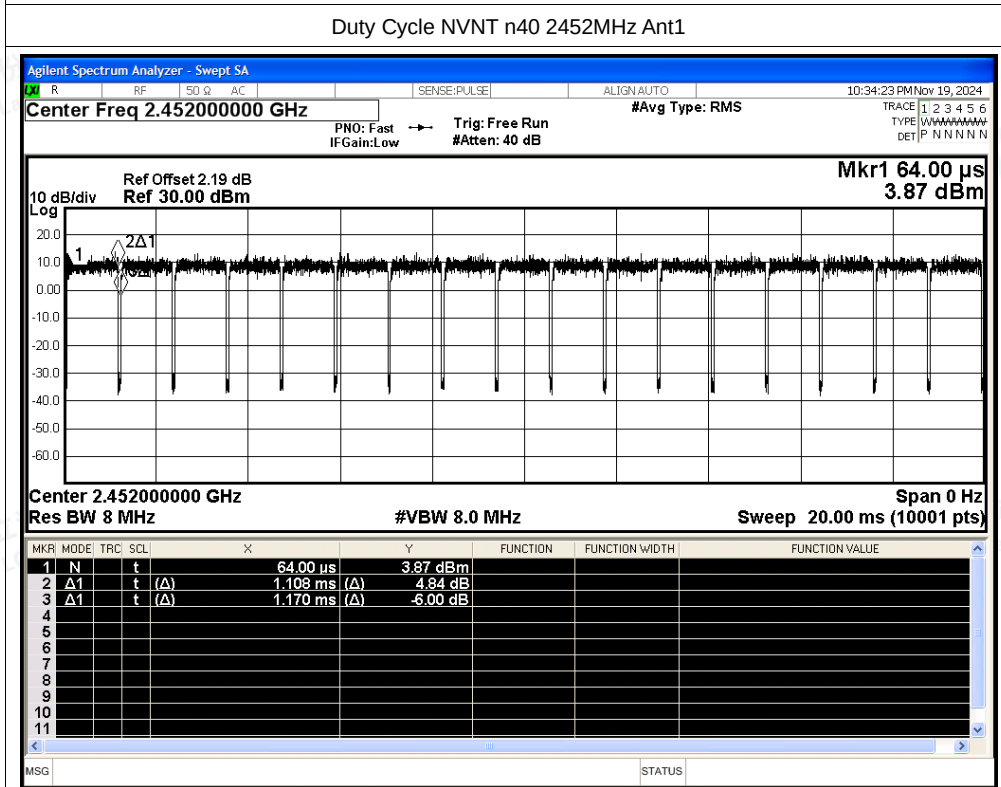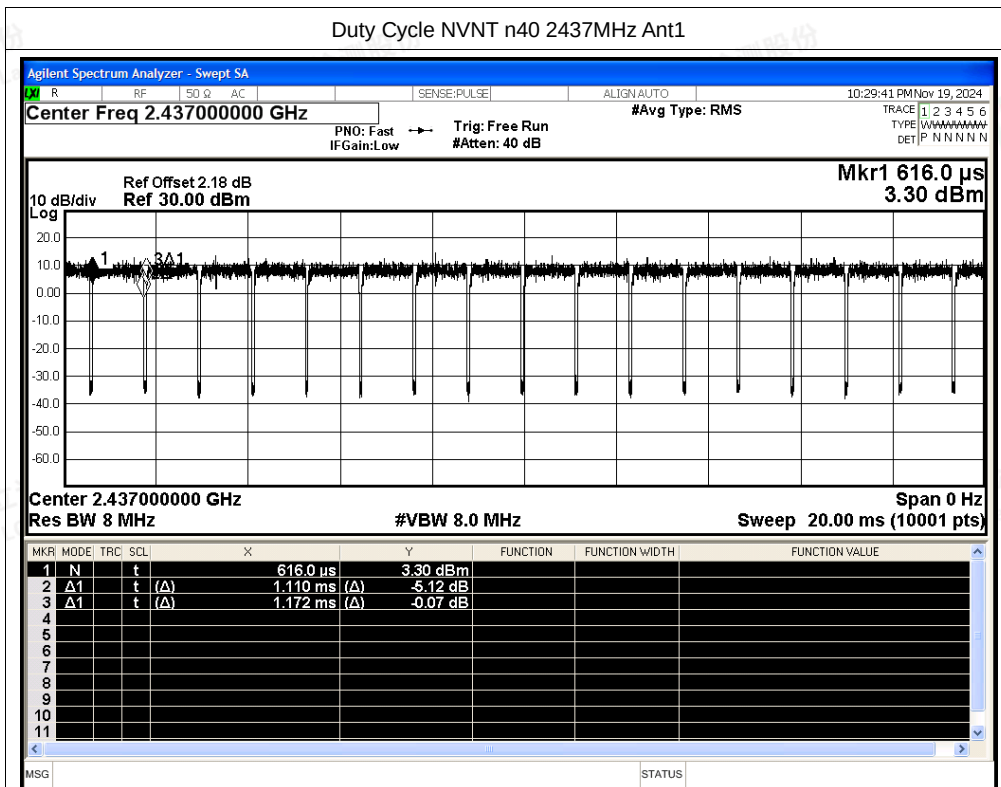

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 2412MHz Ant1

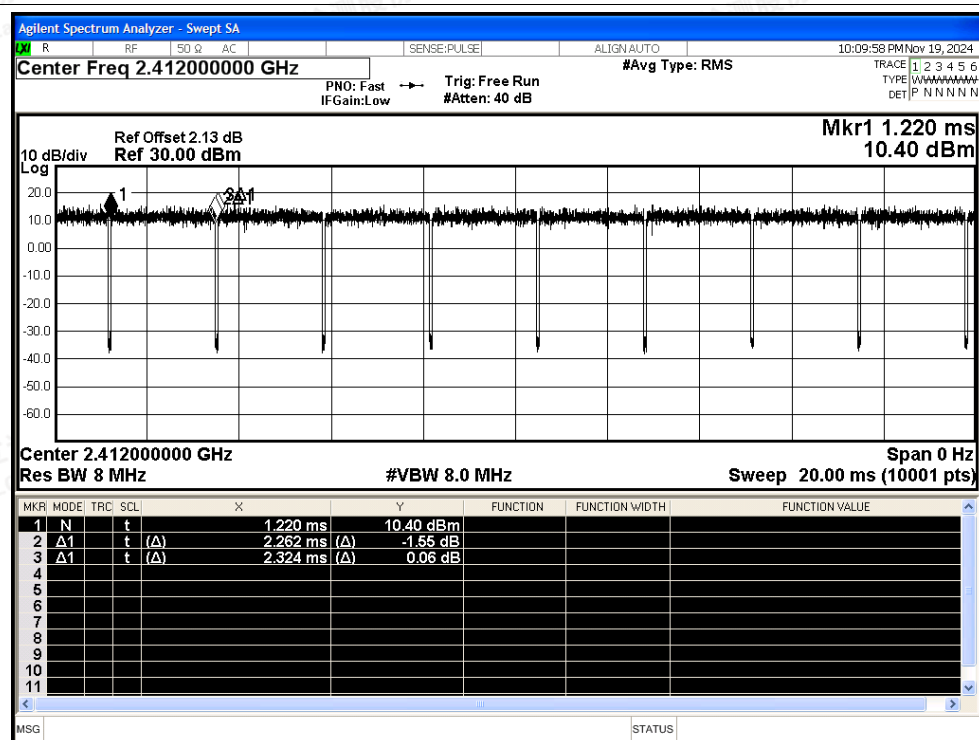

Duty Cycle NVNT ax20 2437MHz Ant1

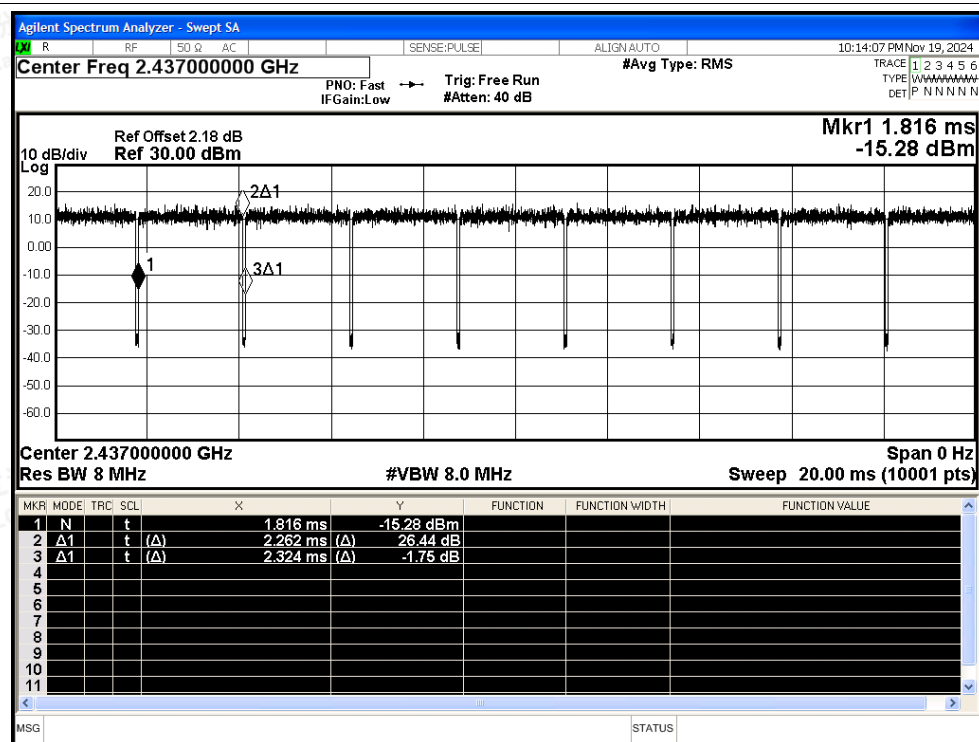

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 2462MHz Ant1

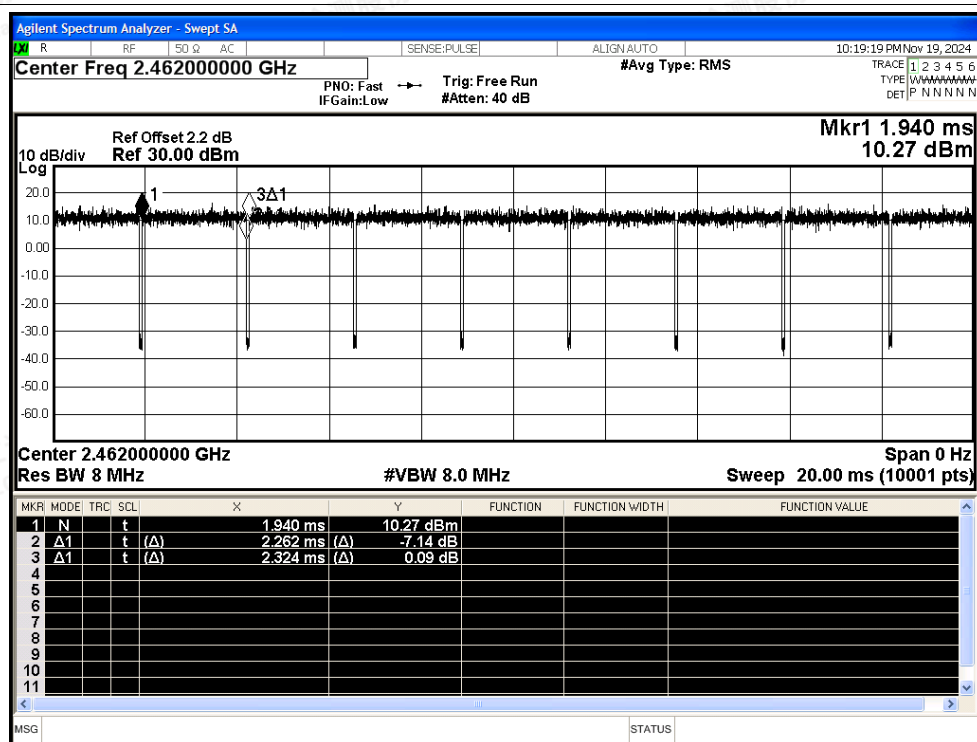

Duty Cycle NVNT ax40 2422MHz Ant1

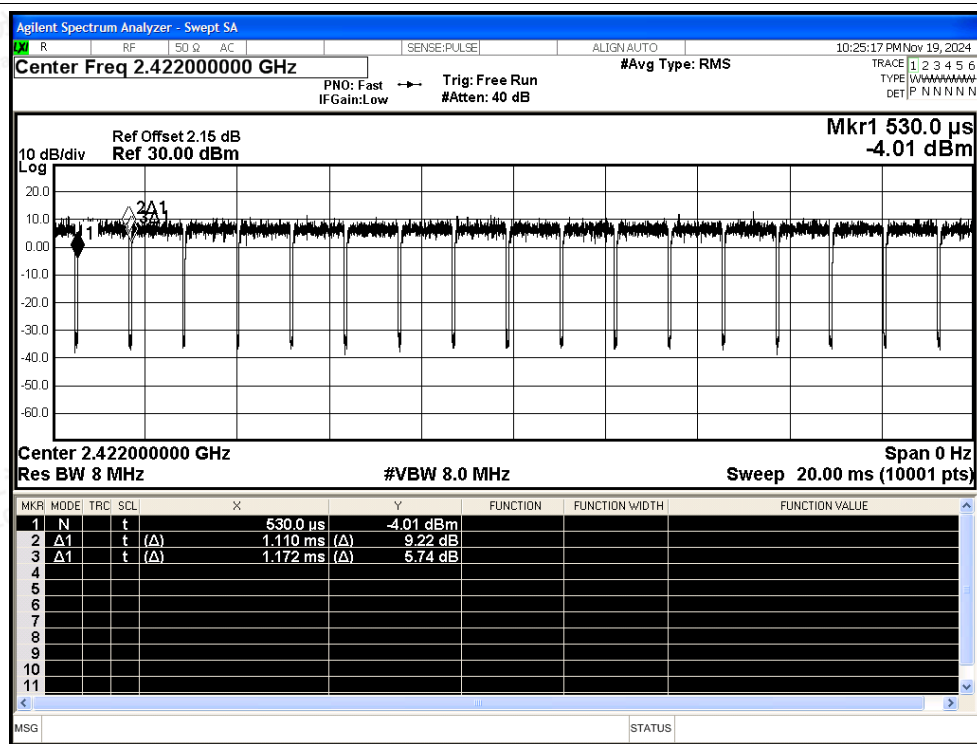

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 2437MHz Ant1

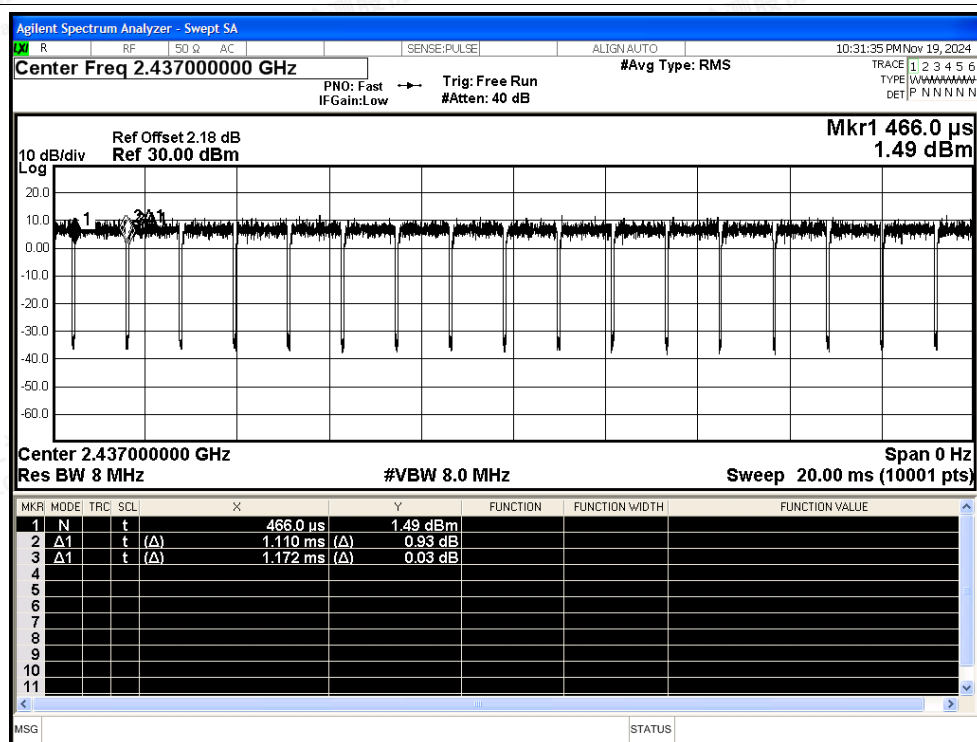

Duty Cycle NVNT ax40 2452MHz Ant1

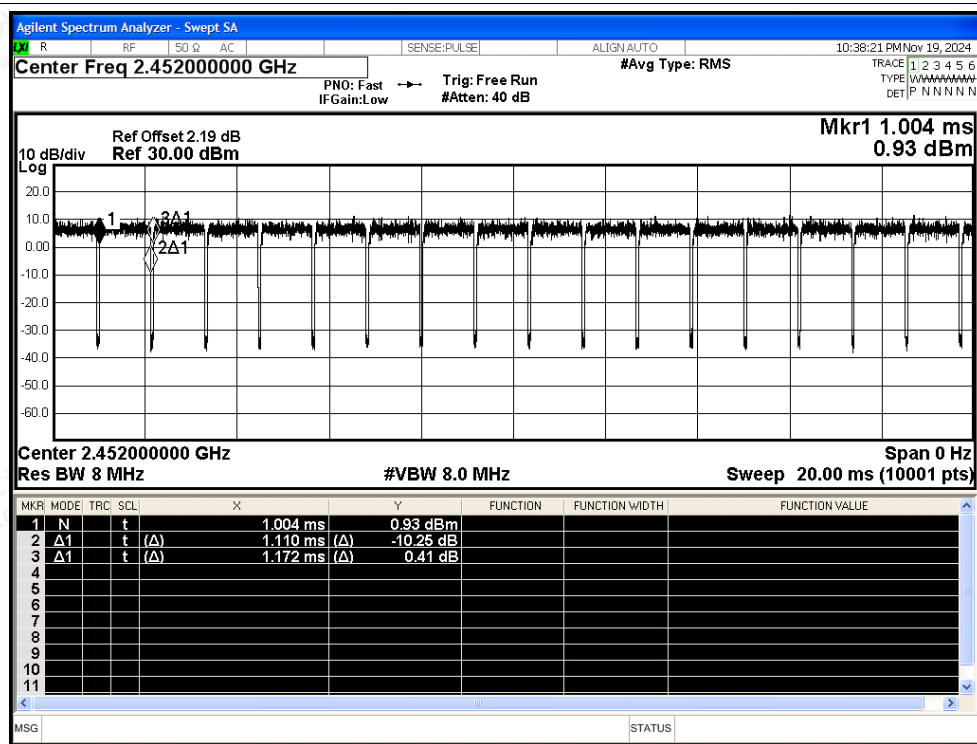

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



C.7 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	b	2412	Ant1	2310	-51.02	2.79	-	47.03	Peak	74	Pass
NVNT	b	2412	Ant1	2310	-58.68	2.79	0	39.37	Average	54	Pass
NVNT	b	2412	Ant1	2388.975	-45.64	2.79	-	52.41	Peak	74	Pass
NVNT	b	2412	Ant1	2389.911	-55.9	2.79	0	42.15	Average	54	Pass
NVNT	b	2412	Ant1	2390	-48.24	2.79	-	49.81	Peak	74	Pass
NVNT	b	2412	Ant1	2390	-55.66	2.79	0	42.39	Average	54	Pass
NVNT	b	2462	Ant1	2483.5	-45.08	2.79	-	52.97	Peak	74	Pass
NVNT	b	2462	Ant1	2483.5	-54.25	2.79	0	43.8	Average	54	Pass
NVNT	b	2462	Ant1	2484.259	-41.51	2.79	-	56.54	Peak	74	Pass
NVNT	b	2462	Ant1	2483.782	-53.46	2.79	0	44.59	Average	54	Pass
NVNT	b	2462	Ant1	2500	-50.23	2.79	-	47.82	Peak	74	Pass
NVNT	b	2462	Ant1	2500	-57.98	2.79	0	40.07	Average	54	Pass
NVNT	g	2412	Ant1	2310	-51.01	2.79	-	47.04	Peak	74	Pass
NVNT	g	2412	Ant1	2310	-58.32	2.79	0.1	39.83	Average	54	Pass
NVNT	g	2412	Ant1	2389.209	-36.86	2.79	-	61.19	Peak	74	Pass
NVNT	g	2412	Ant1	2389.794	-54.27	2.79	0.1	43.88	Average	54	Pass
NVNT	g	2412	Ant1	2390	-42.83	2.79	-	55.22	Peak	74	Pass
NVNT	g	2412	Ant1	2390	-55.35	2.79	0.1	42.8	Average	54	Pass
NVNT	g	2462	Ant1	2483.5	-38.98	2.79	-	59.07	Peak	74	Pass
NVNT	g	2462	Ant1	2483.5	-54.05	2.79	0.1	44.1	Average	54	Pass
NVNT	g	2462	Ant1	2483.57	-38.89	2.79	-	59.16	Peak	74	Pass
NVNT	g	2462	Ant1	2483.517	-54.05	2.79	0.1	44.1	Average	54	Pass
NVNT	g	2462	Ant1	2500	-50.07	2.79	-	47.98	Peak	74	Pass
NVNT	g	2462	Ant1	2500	-57.7	2.79	0.1	40.45	Average	54	Pass
NVNT	n20	2412	Ant1	2310	-50.56	2.79	-	47.49	Peak	74	Pass
NVNT	n20	2412	Ant1	2310	-58.51	2.79	0.12	39.66	Average	54	Pass
NVNT	n20	2412	Ant1	2389.911	-38.67	2.79	-	59.38	Peak	74	Pass
NVNT	n20	2412	Ant1	2389.56	-51.95	2.79	0.12	46.22	Average	54	Pass
NVNT	n20	2412	Ant1	2390	-38.25	2.79	-	59.8	Peak	74	Pass
NVNT	n20	2412	Ant1	2390	-52.8	2.79	0.12	45.37	Average	54	Pass
NVNT	n20	2462	Ant1	2483.5	-40.5	2.79	-	57.55	Peak	74	Pass
NVNT	n20	2462	Ant1	2483.5	-53.64	2.79	0.12	44.53	Average	54	Pass
NVNT	n20	2462	Ant1	2484.365	-36.98	2.79	-	61.07	Peak	74	Pass
NVNT	n20	2462	Ant1	2483.729	-51.95	2.79	0.12	46.22	Average	54	Pass
NVNT	n20	2462	Ant1	2500	-50.69	2.79	-	47.36	Peak	74	Pass
NVNT	n20	2462	Ant1	2500	-57.66	2.79	0.12	40.51	Average	54	Pass
NVNT	n40	2422	Ant1	2310	-52	2.79	-	46.05	Peak	74	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	2422	Ant1	2310	-58.76	2.79	0.24	39.53	Average	54	Pass
NVNT	n40	2422	Ant1	2388.384	-39.65	2.79	-	58.4	Peak	74	Pass
NVNT	n40	2422	Ant1	2389.946	-53.56	2.79	0.24	44.73	Average	54	Pass
NVNT	n40	2422	Ant1	2390	-41.05	2.79	-	57	Peak	74	Pass
NVNT	n40	2422	Ant1	2390	-53.56	2.79	0.24	44.73	Average	54	Pass
NVNT	n40	2452	Ant1	2483.5	-37.94	2.79	-	60.11	Peak	74	Pass
NVNT	n40	2452	Ant1	2483.5	-53.71	2.79	0.24	44.58	Average	54	Pass
NVNT	n40	2452	Ant1	2484.4	-36.48	2.79	-	61.57	Peak	74	Pass
NVNT	n40	2452	Ant1	2483.542	-51.88	2.79	0.24	46.41	Average	54	Pass
NVNT	n40	2452	Ant1	2500	-49.05	2.79	-	49	Peak	74	Pass
NVNT	n40	2452	Ant1	2500	-58.05	2.79	0.24	40.24	Average	54	Pass
NVNT	ax20	2412	Ant1	2310	-50.9	2.79	-	47.15	Peak	74	Pass
NVNT	ax20	2412	Ant1	2310	-58.13	2.79	0.12	40.04	Average	54	Pass
NVNT	ax20	2412	Ant1	2389.794	-38.27	2.79	-	59.78	Peak	74	Pass
NVNT	ax20	2412	Ant1	2389.56	-51.89	2.79	0.12	46.28	Average	54	Pass
NVNT	ax20	2412	Ant1	2390	-37.63	2.79	-	60.42	Peak	74	Pass
NVNT	ax20	2412	Ant1	2390	-52.69	2.79	0.12	45.48	Average	54	Pass
NVNT	ax20	2462	Ant1	2483.5	-41.11	2.79	-	56.94	Peak	74	Pass
NVNT	ax20	2462	Ant1	2483.5	-53.37	2.79	0.12	44.8	Average	54	Pass
NVNT	ax20	2462	Ant1	2483.835	-35.55	2.79	-	62.5	Peak	74	Pass
NVNT	ax20	2462	Ant1	2483.835	-52.48	2.79	0.12	45.69	Average	54	Pass
NVNT	ax20	2462	Ant1	2500	-50.89	2.79	-	47.16	Peak	74	Pass
NVNT	ax20	2462	Ant1	2500	-57.76	2.79	0.12	40.41	Average	54	Pass
NVNT	ax40	2422	Ant1	2310	-50.21	2.79	-	47.84	Peak	74	Pass
NVNT	ax40	2422	Ant1	2310	-58.46	2.79	0.24	39.83	Average	54	Pass
NVNT	ax40	2422	Ant1	2388.952	-38.8	2.79	-	59.25	Peak	74	Pass
NVNT	ax40	2422	Ant1	2389.52	-53.48	2.79	0.24	44.81	Average	54	Pass
NVNT	ax40	2422	Ant1	2390	-40.74	2.79	-	57.31	Peak	74	Pass
NVNT	ax40	2422	Ant1	2390	-53.74	2.79	0.24	44.55	Average	54	Pass
NVNT	ax40	2452	Ant1	2483.5	-41.49	2.79	-	56.56	Peak	74	Pass
NVNT	ax40	2452	Ant1	2483.5	-52.21	2.79	0.24	46.08	Average	54	Pass
NVNT	ax40	2452	Ant1	2483.776	-31.22	2.79	-	66.83	Peak	74	Pass
NVNT	ax40	2452	Ant1	2485.102	-51.74	2.79	0.24	46.55	Average	54	Pass
NVNT	ax40	2452	Ant1	2500	-49.37	2.79	-	48.68	Peak	74	Pass
NVNT	ax40	2452	Ant1	2500	-57.75	2.79	0.24	40.54	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT b 2412MHz Ant1 Peak

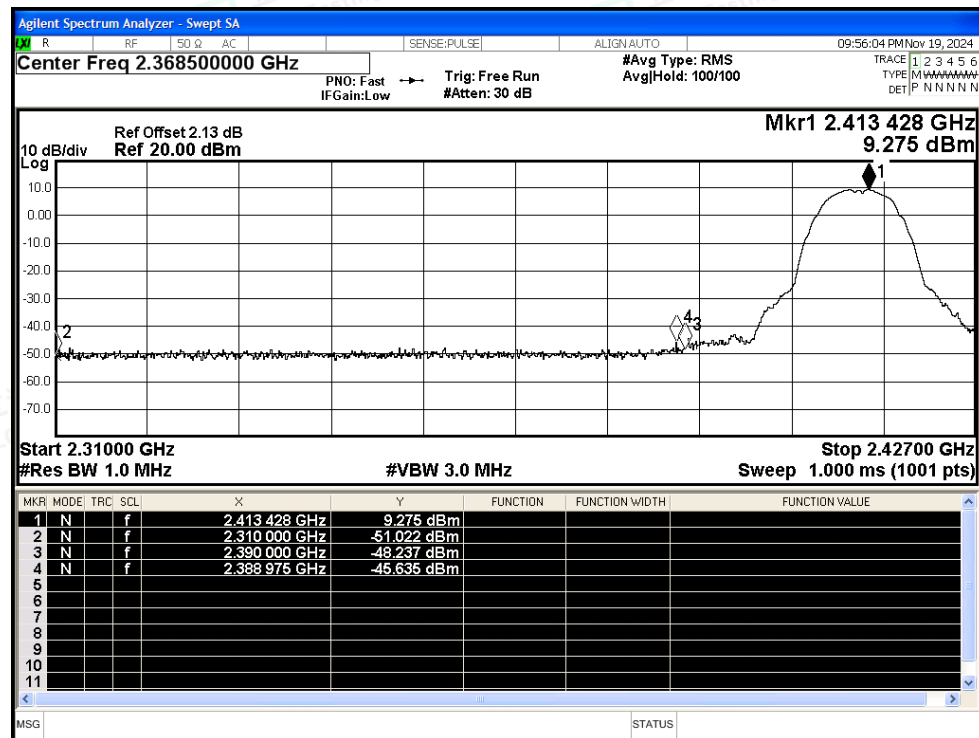

Restrict Band NVNT b 2412MHz Ant1 Average

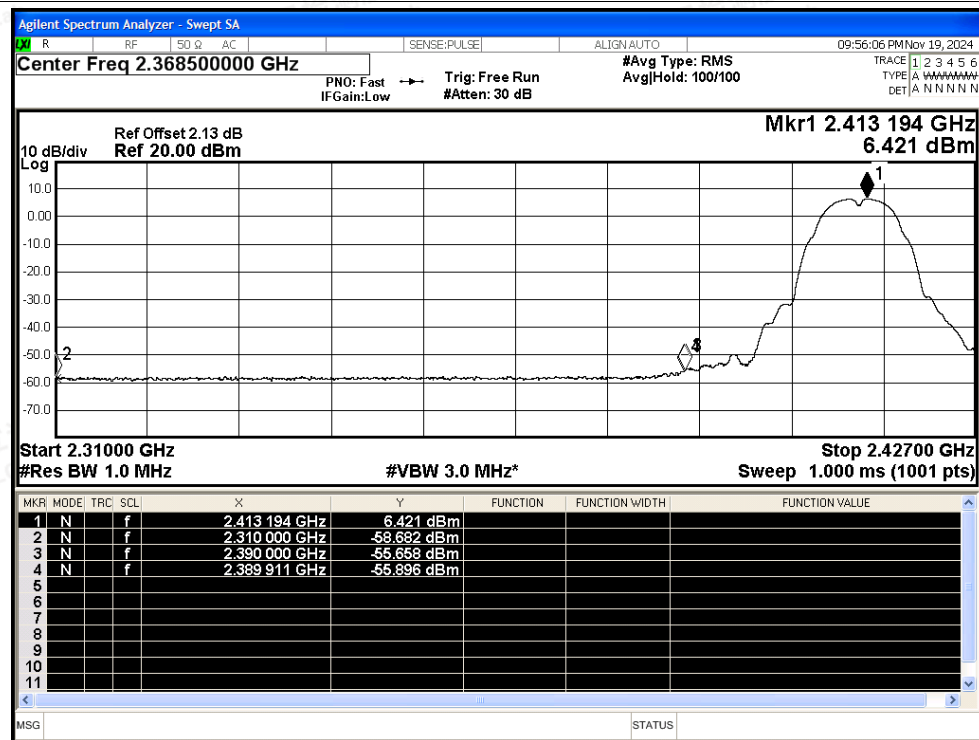

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT b 2462MHz Ant1 Peak

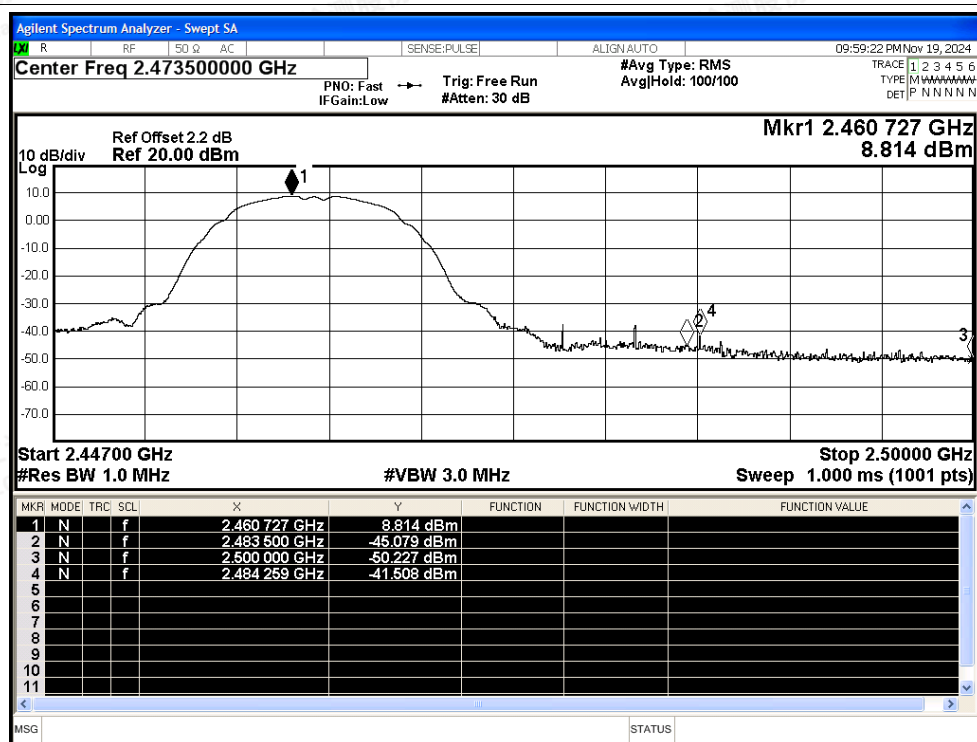

Restrict Band NVNT b 2462MHz Ant1 Average

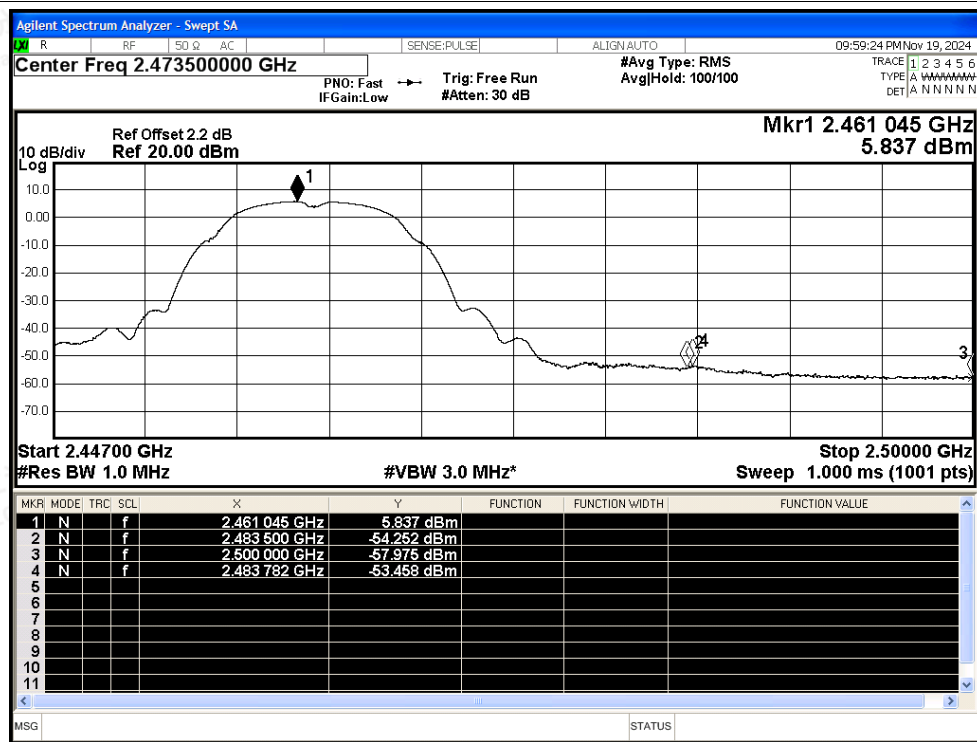

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT g 2412MHz Ant1 Peak

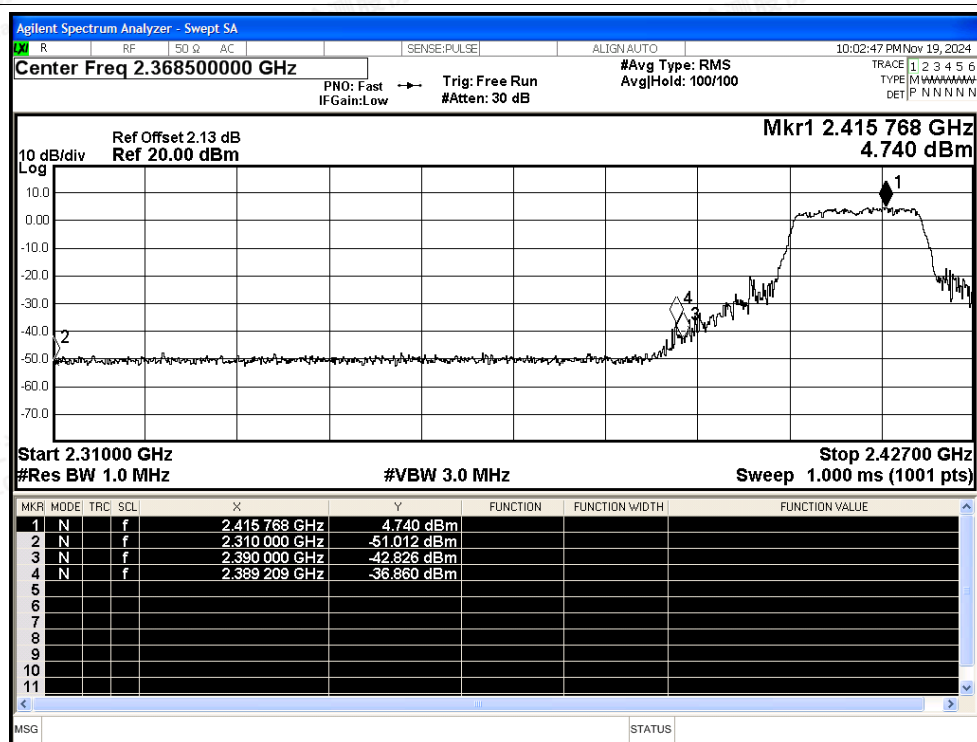

Restrict Band NVNT g 2412MHz Ant1 Average

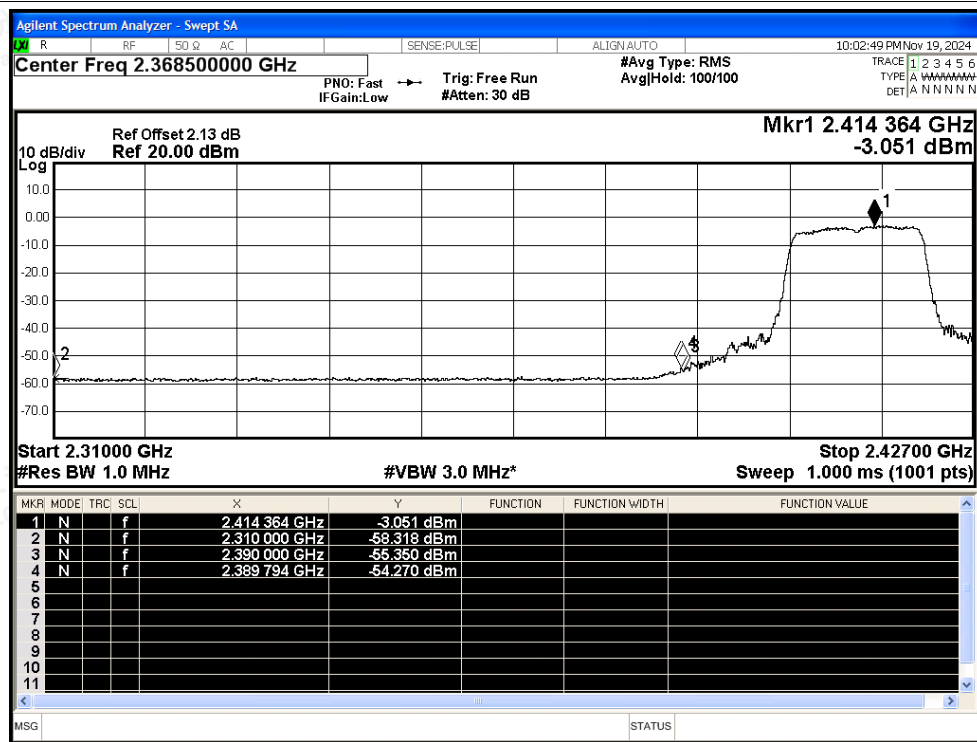

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT g 2462MHz Ant1 Peak

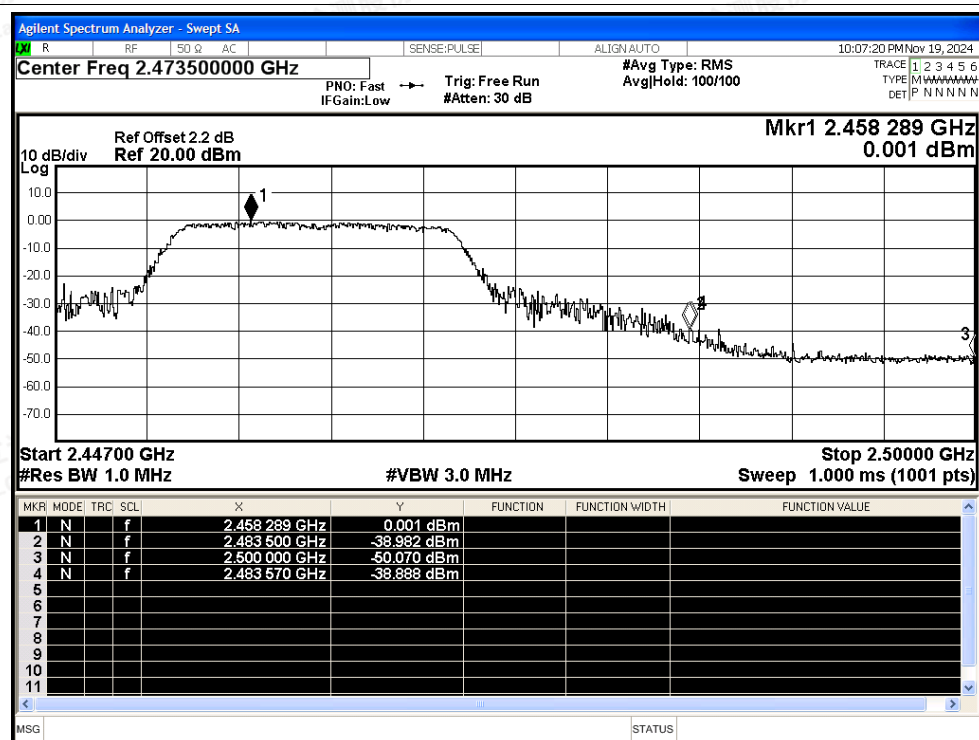

Restrict Band NVNT g 2462MHz Ant1 Average

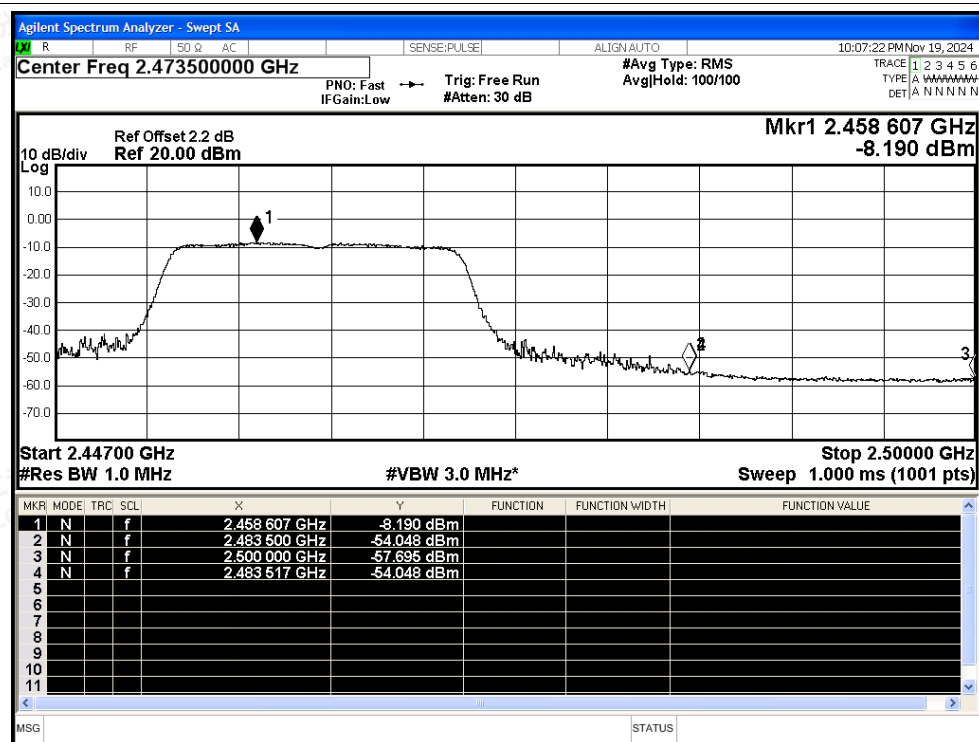

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 2412MHz Ant1 Peak

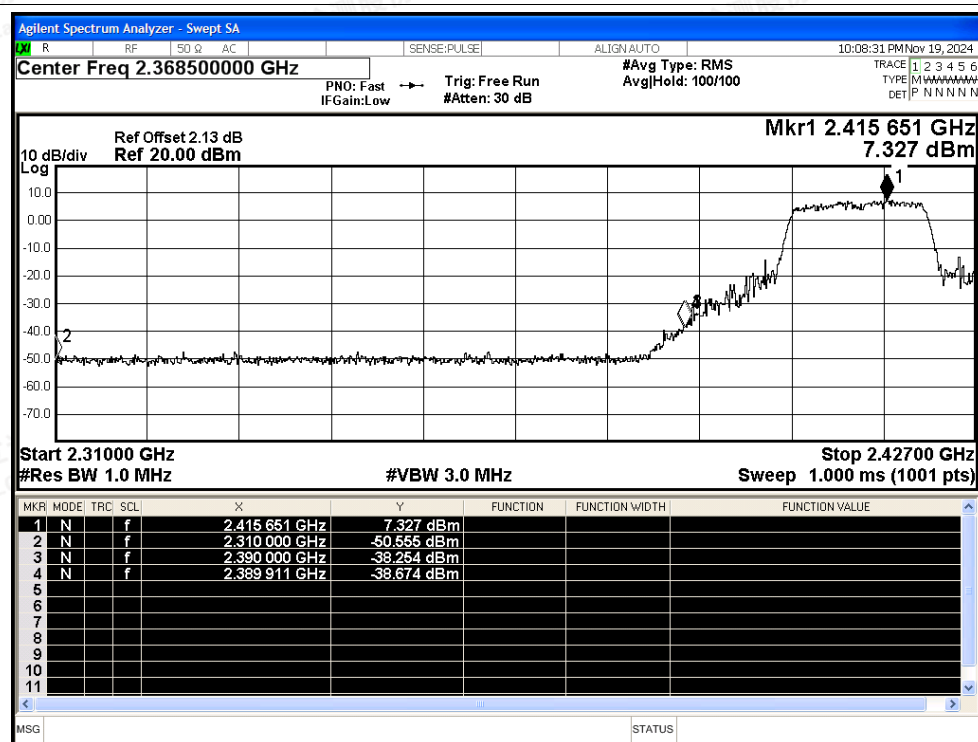

Restrict Band NVNT n20 2412MHz Ant1 Average

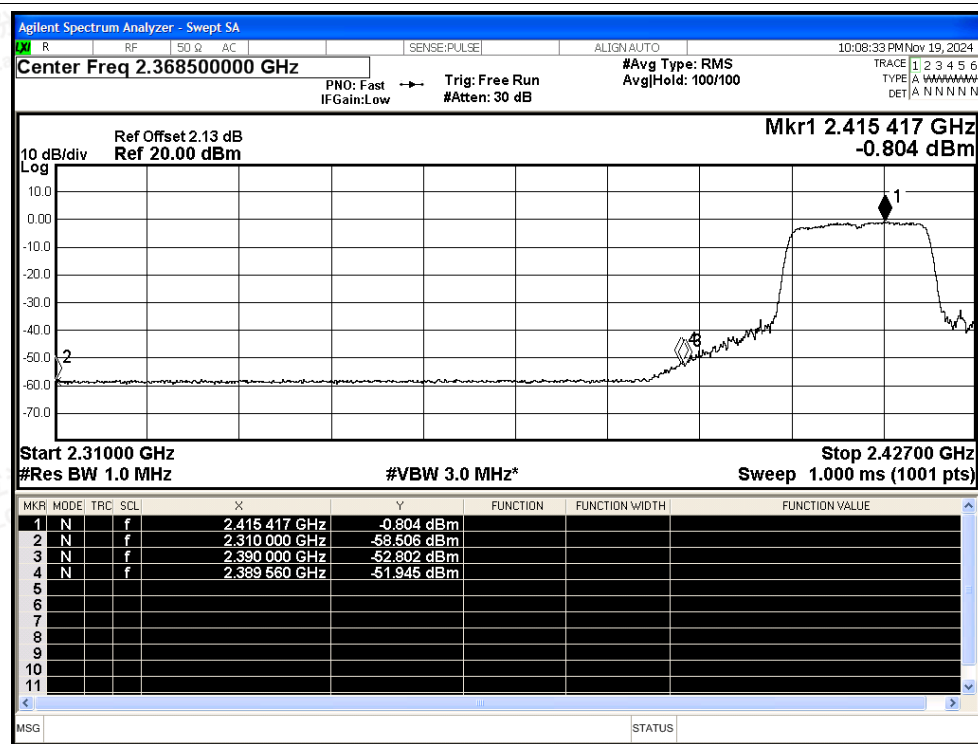

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 2462MHz Ant1 Peak

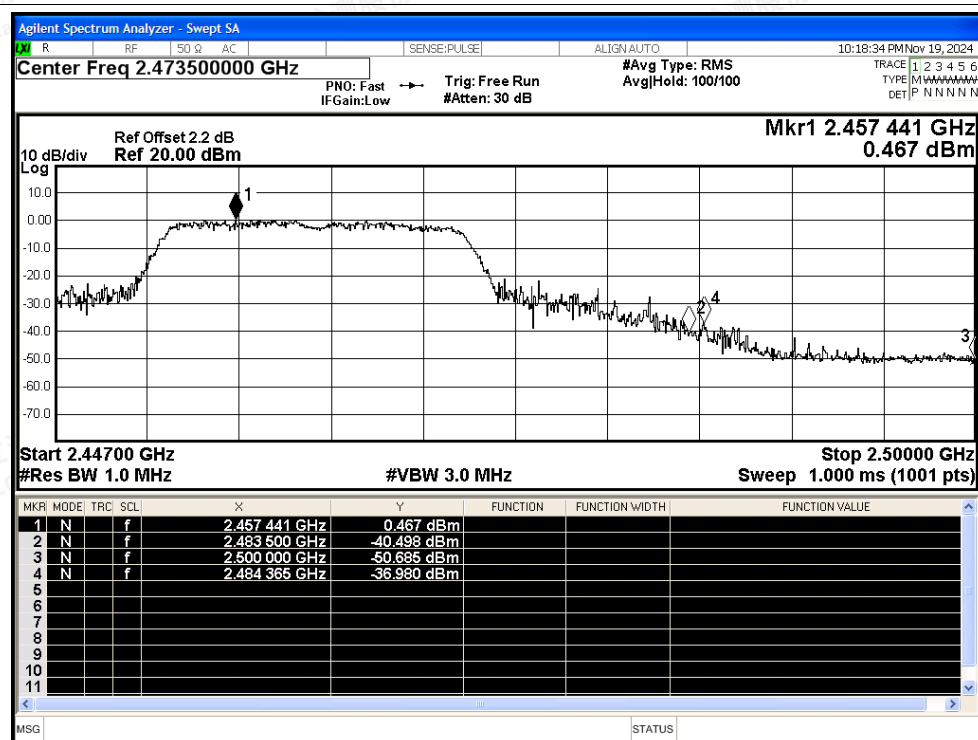

Restrict Band NVNT n20 2462MHz Ant1 Average

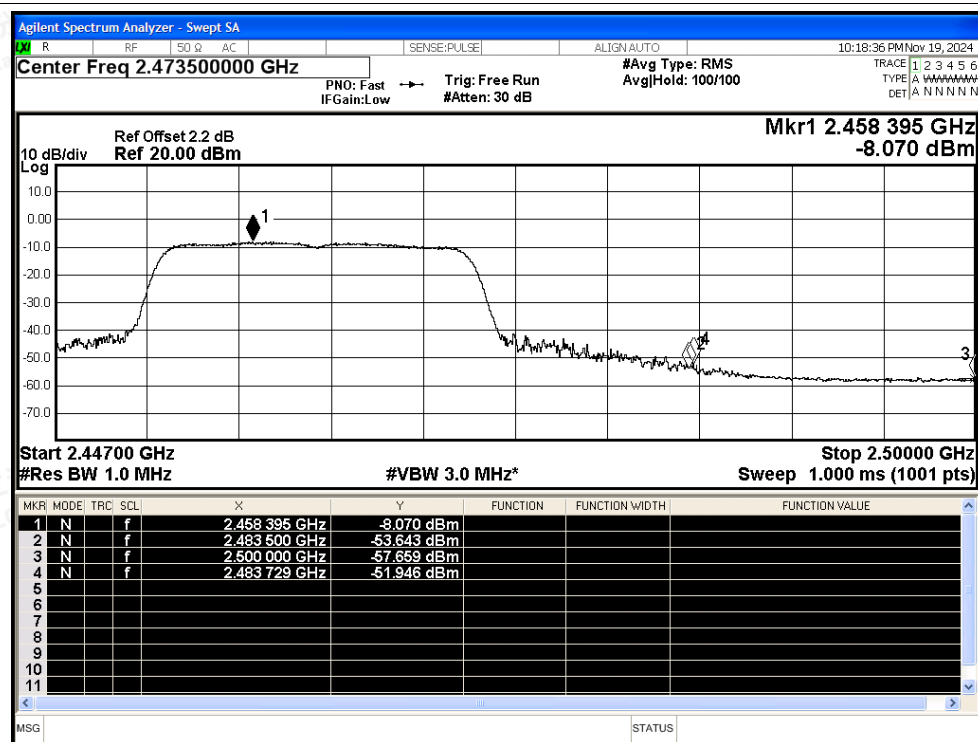

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 2422MHz Ant1 Peak

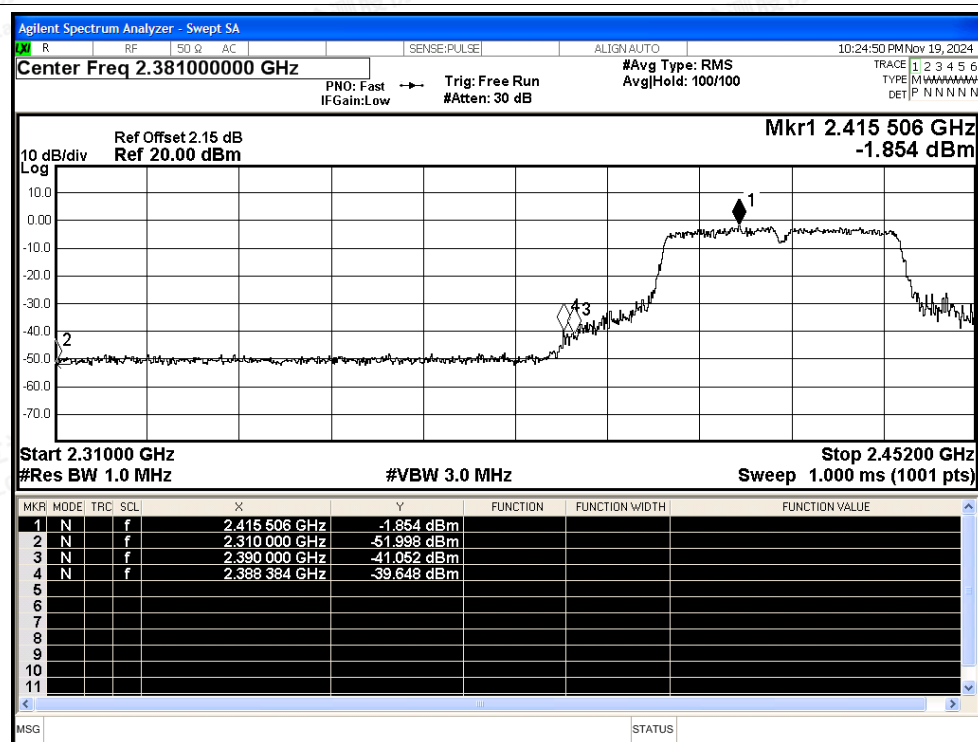

Restrict Band NVNT n40 2422MHz Ant1 Average

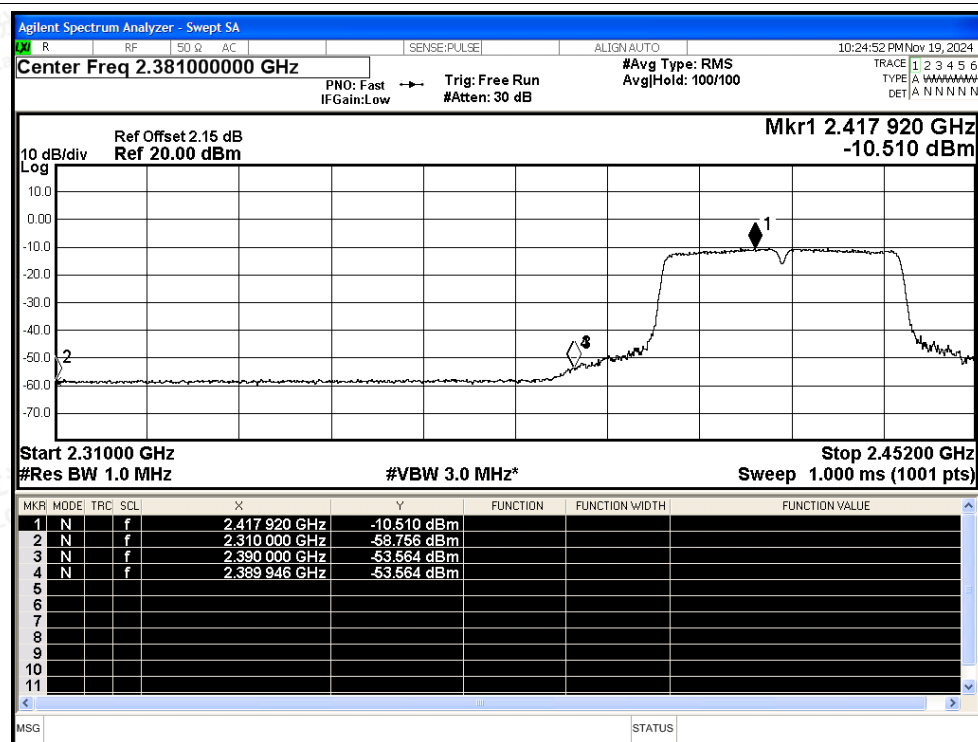

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 2452MHz Ant1 Peak

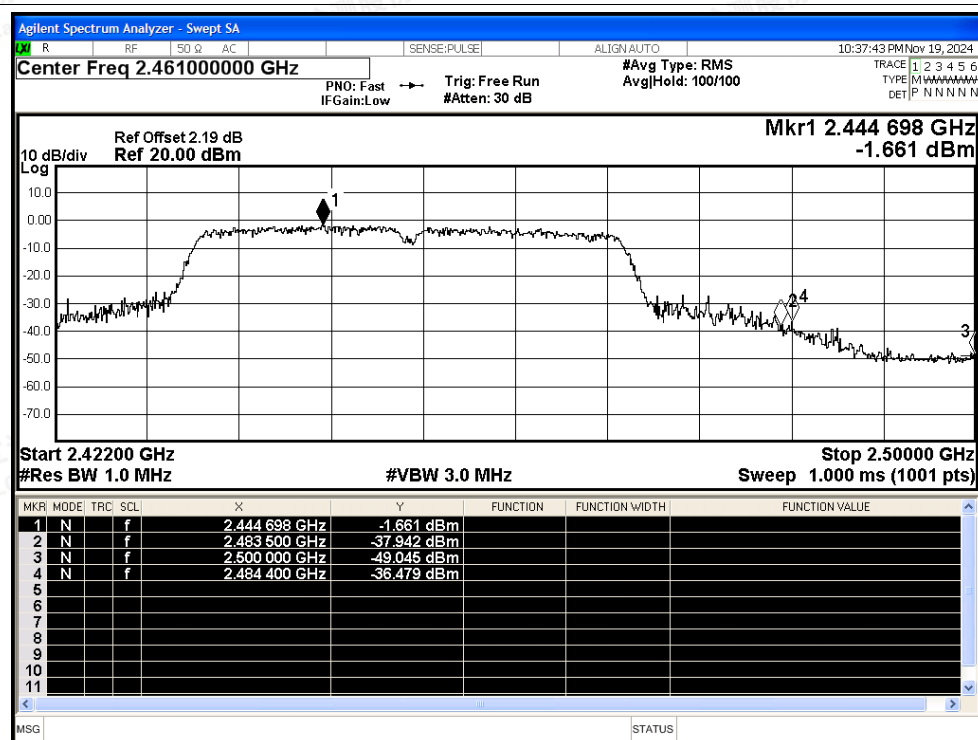

Restrict Band NVNT n40 2452MHz Ant1 Average

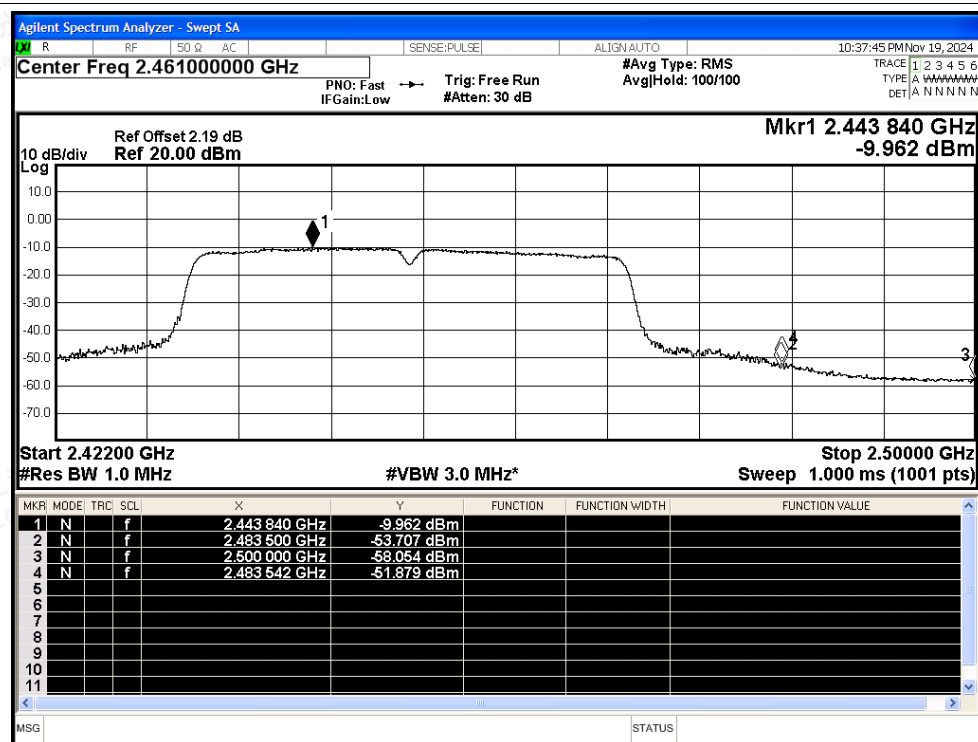

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 2412MHz Ant1 Peak

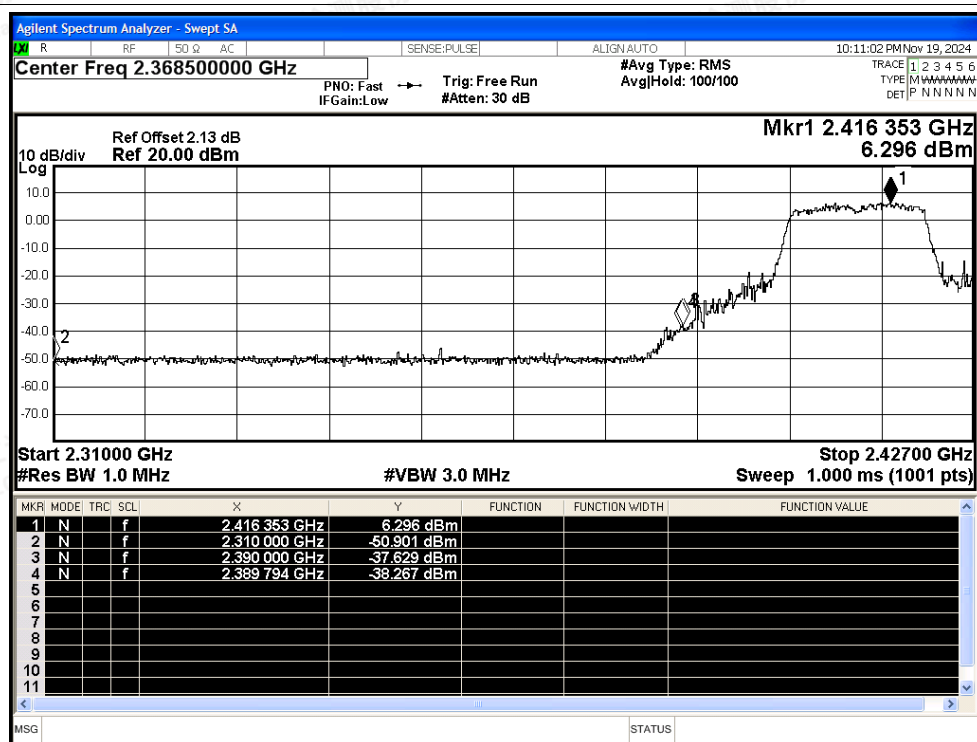

Restrict Band NVNT ax20 2412MHz Ant1 Average

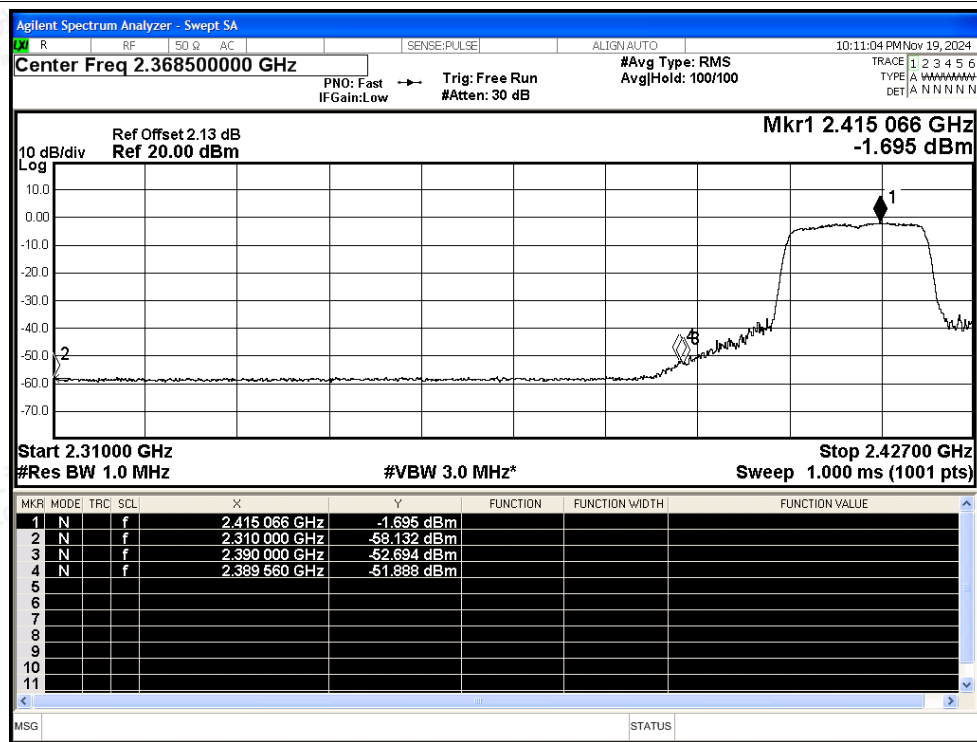

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 2462MHz Ant1 Peak

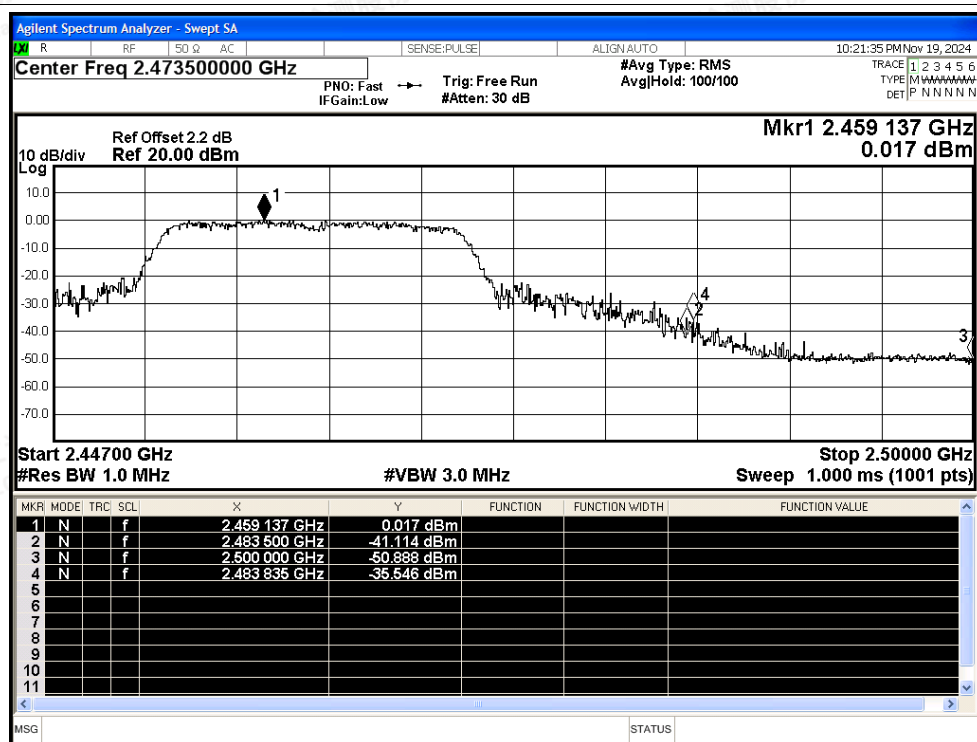

Restrict Band NVNT ax20 2462MHz Ant1 Average

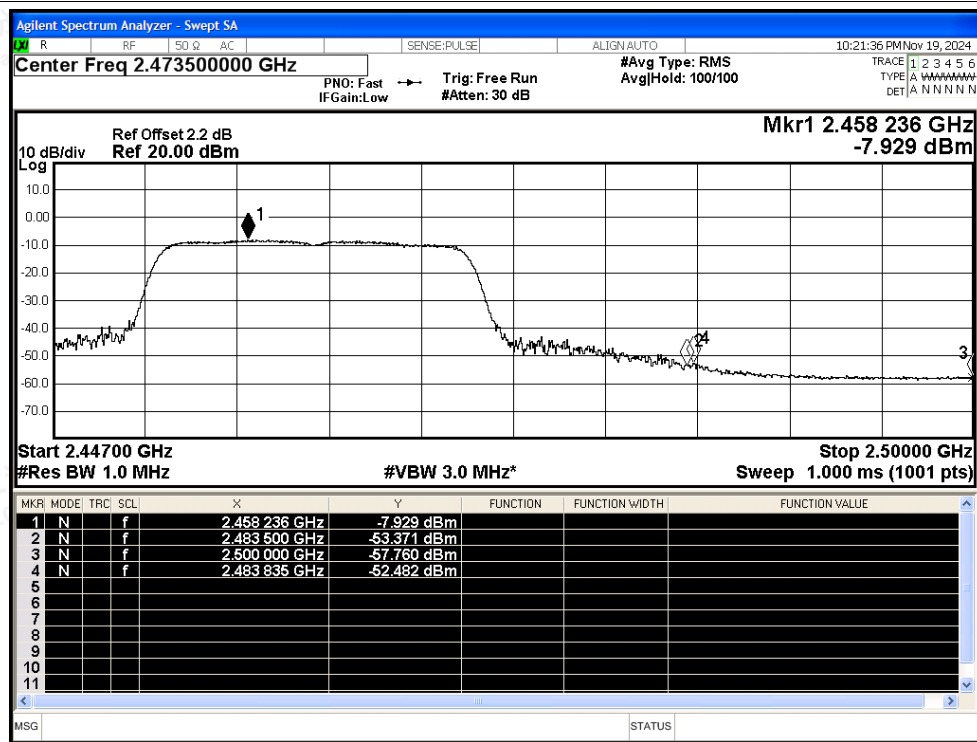

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 2422MHz Ant1 Peak

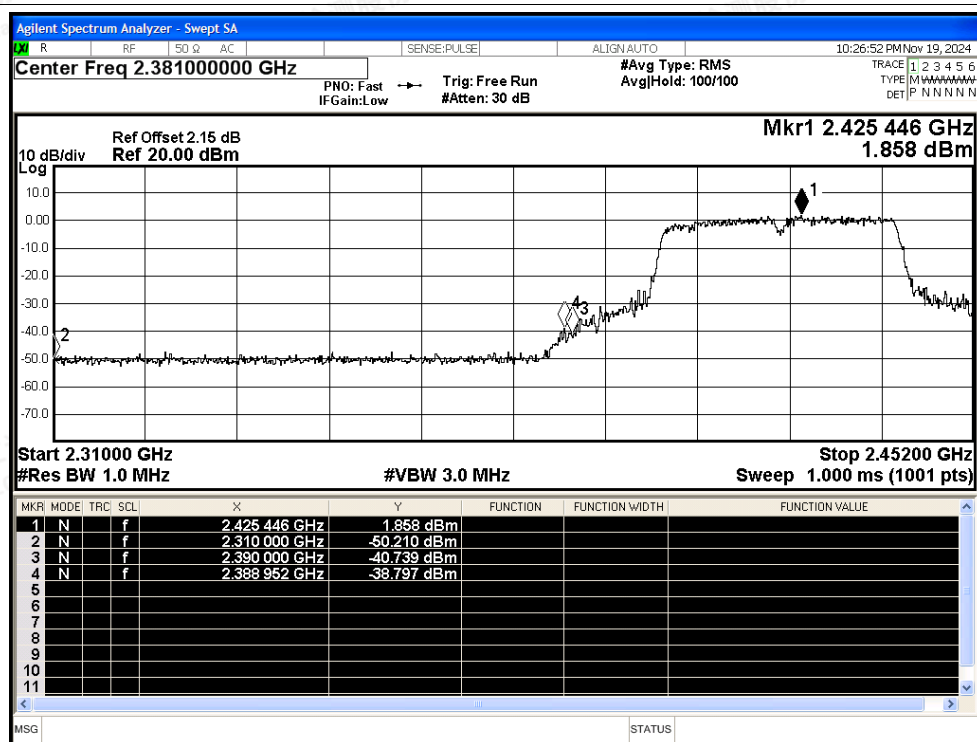

Restrict Band NVNT ax40 2422MHz Ant1 Average

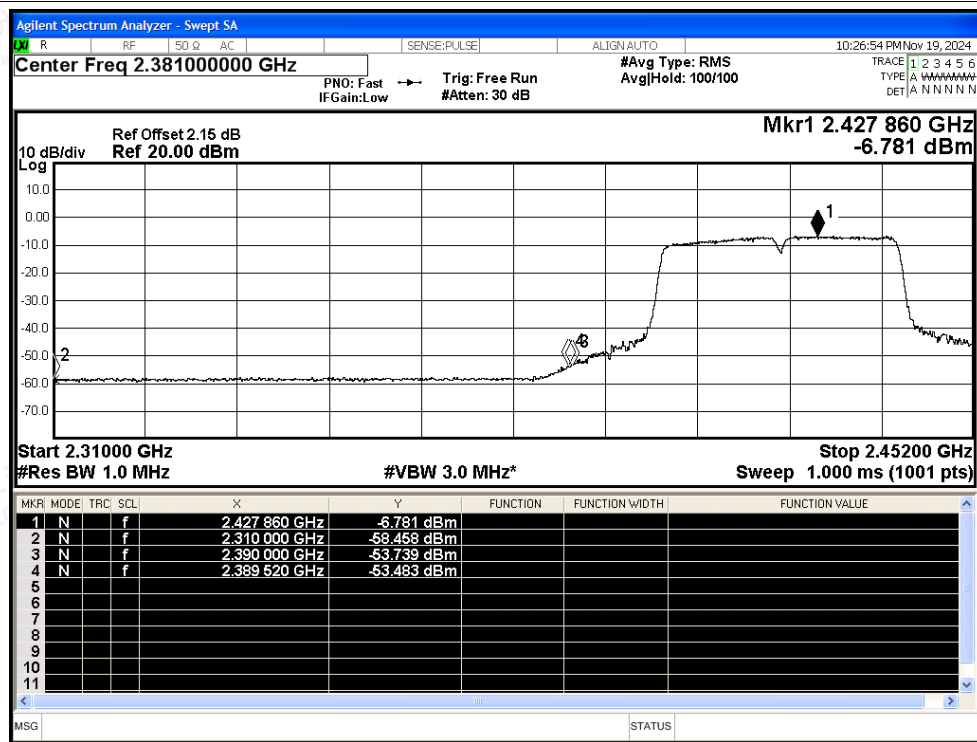

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 2452MHz Ant1 Peak

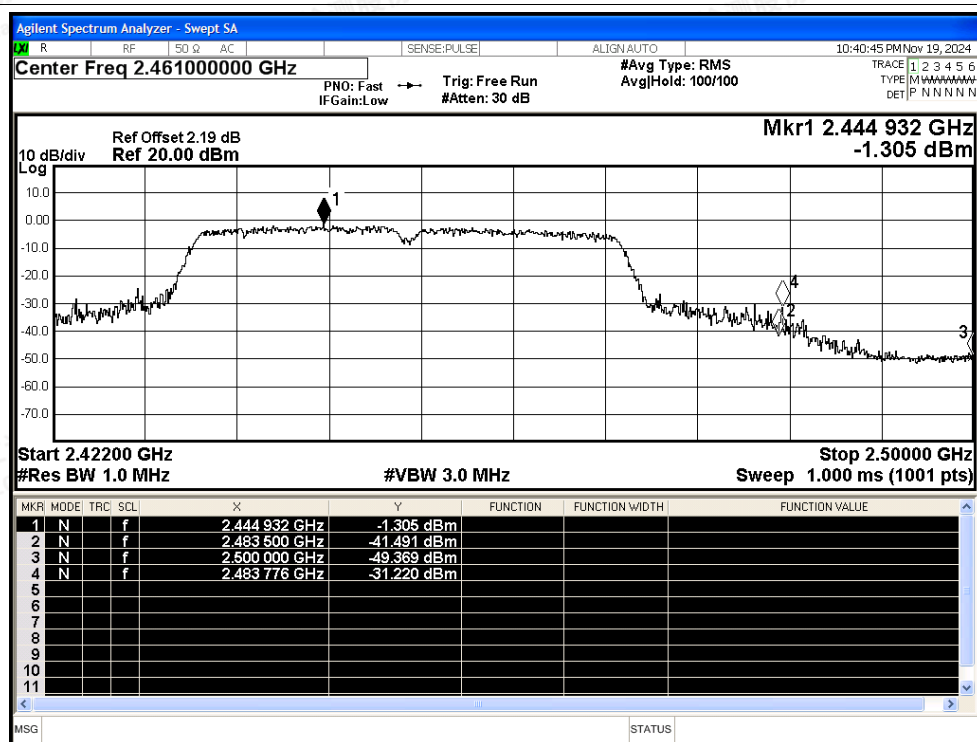

Restrict Band NVNT ax40 2452MHz Ant1 Average

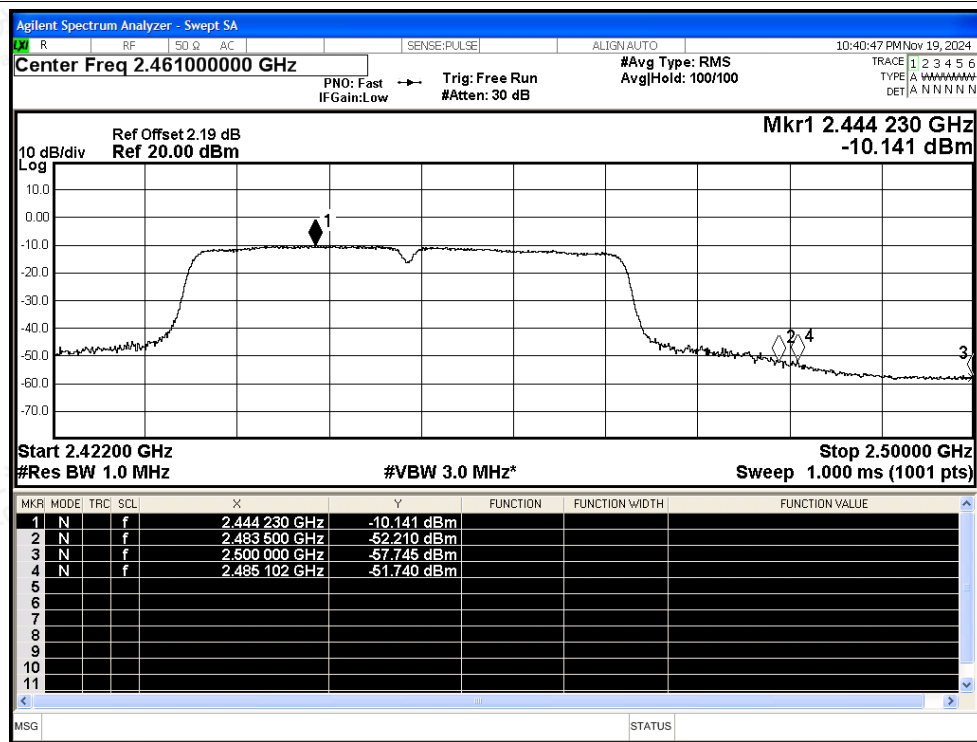

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity