


No.	Mk	. Freq.	Reading Level	Correct Factor	Measure- ment	Limit	Over	
		MHz	dBuV	dB	dBuV/m	dBuV/m	dB	Detector
1		4884.000	38.03	6.45	44.48	74.00	-29.52	peak
2		6005.500	39.96	5.84	45.80	74.00	-28.20	peak
3		7326.000	35.44	10.21	45.65	74.00	-28.35	peak
4		9213.250	34.99	12.77	47.76	74.00	-26.24	peak
5	*	9768.000	35.28	13.75	49.03	74.00	-24.97	peak
6		12139.00	35.81	10.22	46.03	74.00	-27.97	peak

BlueAsia of Technical Services (Shenzhen) Co.,Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



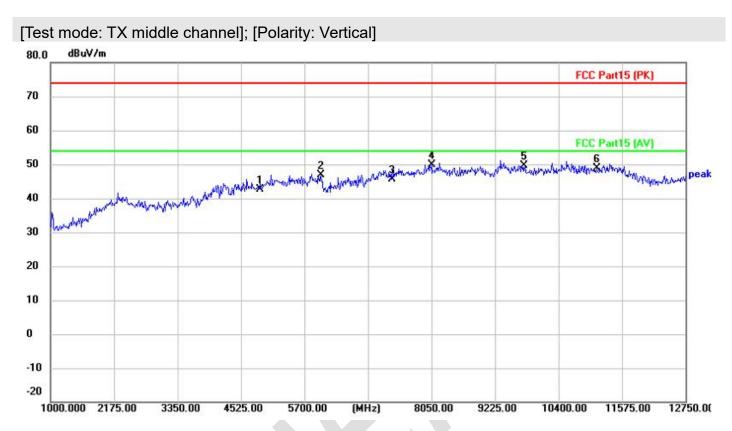


No.	Mk	. Freq.	Reading Level	Correct Factor	Measure- ment	Limit	Over	
		MHz	dBuV	dB	dBuV/m	dBuV/m	dB	Detector
1		4884.000	36.16	6.45	42.61	74.00	-31.39	peak
2		6005.500	41.06	5.84	46.90	74.00	-27.10	peak
3		7326.000	35.41	10.21	45.62	74.00	-28.38	peak
4	*	8050.000	38.06	11.70	49.76	74.00	-24.24	peak
5		9768.000	35.87	13.75	49.62	74.00	-24.38	peak
6		11105.00	35.35	13.57	48.92	74.00	-25.08	peak

BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



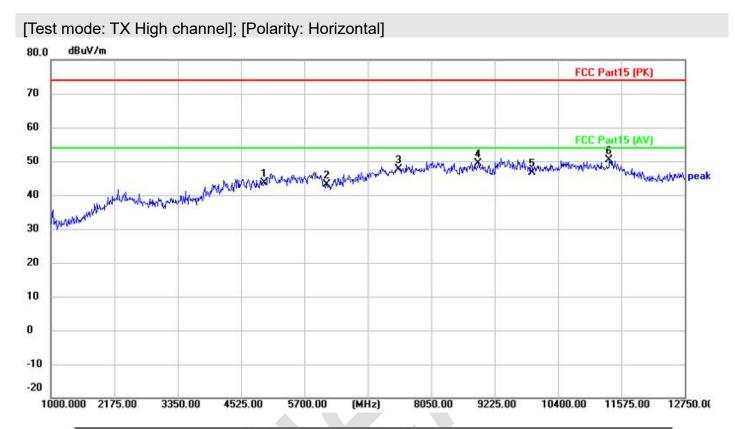


No.	Mk	. Freq.	Reading Level	Correct Factor	Measure- ment	Limit	Over	
		MHz	dBuV	dB	dBuV/m	dBuV/m	dB	Detector
1	(4960.000	36.28	7.41	43.69	74.00	-30.31	peak
2		6111.250	36.59	6.53	43.12	74.00	-30.88	peak
3	- 6	7440.000	36.69	11.03	47.72	74.00	-26.28	peak
4		8919.500	37.05	12.38	49.43	74.00	-24.57	peak
5		9920.000	33.53	13.16	46.69	74.00	-27.31	peak
6	*	11351.75	37.26	13.00	50.26	74.00	-23.74	peak

BlueAsia of Technical Services (Shenzhen) Co.,Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



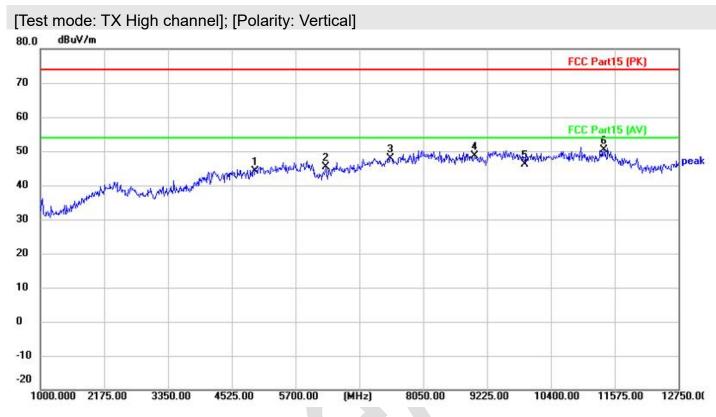

No.	Mk	. Freq.	Reading Level	Correct Factor	Measure- ment	Limit	Over	
		MHz	dBuV	dB	dBuV/m	dBuV/m	dB	Detector
1	- 1	4960.000	36.74	7.41	44.15	74.00	-29.85	peak
2		6252.250	38.31	7.05	45.36	74.00	-28.64	peak
3	- 1	7440.000	36.81	11.03	47.84	74.00	-26.16	peak
4		8990.000	36.45	12.21	48.66	74.00	-25.34	peak
5		9920.000	32.98	13.16	46.14	74.00	-27.86	peak
6	*	11375.25	37.33	13.16	50.49	74.00	-23.51	peak

BlueAsia of Technical Services (Shenzhen) Co.,Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



6.9 Radiated emissions which fall in the restricted bands

Test Standard	47 CFR Part 15, Subpart C 15.247			
Test Method	ANSI C63.10 (2013) Section 6.10.5			
Test Mode (Pre-Scan)	TX			
Test Mode (Final Test)	TX			

6.9.1 Limit

Frequency(MHz)	Field strength(microvolts/meter)	Measurement distance(meters)
0.009-0.490	2400/F(kHz)	300
0.490-1.705	24000/F(kHz)	30
1.705-30.0	30	30
30-88	100	3
88-216	150	3
216-960	200	3
Above 960	500	3

Remark: The emission limits shown in the above table are based on measurements employing a CISPR quasi-peak detector except for the frequency bands 9-90kHz, 110-490kHz and above 1000 MHz. Radiated emission limits in these three bands are based on measurements employing an average detector, the peak field strength of any emission shall not exceed the maximum permitted average limits specified above by more than 20 dB under any condition of modulation.

BlueAsia of Technical Services (Shenzhen) Co.,Ltd.


Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com




6.9.2 Test setup

Below 1GHz:

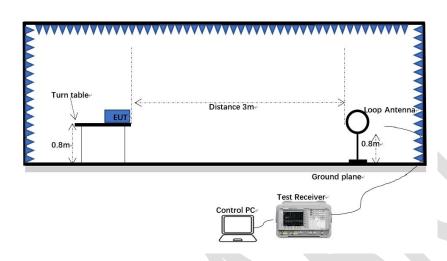

30MHz-1GHz:

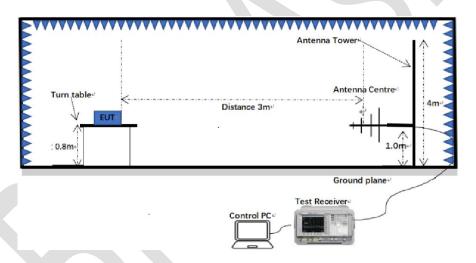


Above 1GHz:

BlueAsia of Technical Services (Shenzhen) Co.,Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



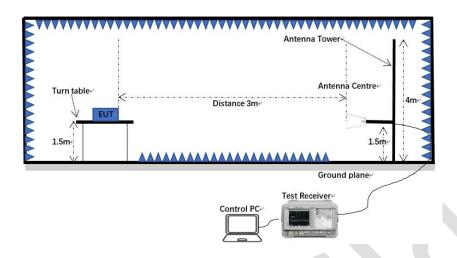

6.9.3 Procedure

- a) For below 1GHz, the EUT was placed on the top of a rotating table 0.8 meters above the ground at a 3 or 10 meter semi-anechoic chamber. The table was rotated 360 degrees to determine the position of the highest radiation.
- b) For above 1GHz, the EUT was placed on the top of a rotating table 1.5 meters above the ground at a 3 meter fully-anechoic chamber. The table was rotated 360 degrees to determine the position of the highest radiation.
- c) The EUT was set 3 or 10 meters away from the interference-receiving antenna, which was mounted on the top of a variable-height antenna tower.
- d) The antenna height is varied from one meter to four meters above the ground to determine the maximum value of the field strength. Both horizontal and vertical polarizations of the antenna are set to make the measurement.
- e) For each suspected emission, the EUT was arranged to its worst case and then the antenna was tuned to heights from 1 meter to 4 meters (for the test frequency of below 30MHz, the antenna was tuned to heights 1 meter) and the rotatable table was turned from 0 degrees to 360 degrees to find the maximum reading.
- f) The test-receiver system was set to Peak Detect Function and Specified Bandwidth with Maximum Hold Mode.
- g) If the emission level of the EUT in peak mode was 10dB lower than the limit specified, then testing could be stopped and the peak values of the EUT would be reported. Otherwise the emissions that did not have 10dB margin would be re-tested one by one using peak, quasi-peak or average method as specified and then reported in a data sheet.
- h) Test the EUT in the lowest channel, the middle channel, the highest channel.
- i) The radiation measurements are performed in X, Y, Z axis positioning for Transmitting mode, and

BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com





Page 38 of 86

found the X axis positioning which it is the worst case.

j) Repeat above procedures until all frequencies measured was complete.

Note 1: Level (dBuV) = Reading (dBuV) + Factor (dB/m)

Note 2: For frequencies above 1GHz, the field strength limits are based on average limits. However, the peak field strength of any emission shall not exceed the maximum permitted average limits specified above by more than 20 dB under any condition of modulation. For the emissions whose peak level is lower than the average limit, only the peak measurement is shown in the report.



BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481


Email: marketing@cblueasia.com www.cblueasia.com



6.9.4 Test data

Remark: During the test, pre-scan the BLE1M/BLE2M mode, and found the BLE1M mode which it is worse case.

[Test mode: TX low channel]; [Polarity: Horizontal]

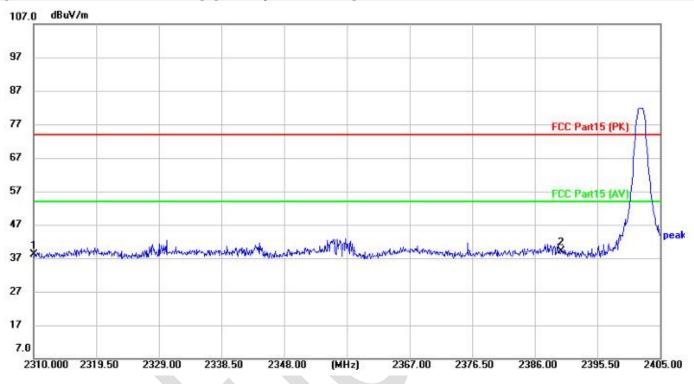

No.	Mk	Freq.	Reading Level	Correct Factor	Measure- ment	Limit	Over	
		MHz	dBuV	dB	dBuV/m	dBuV/m	dB	Detector
1		2310.000	41.00	-2.87	38.13	74.00	-35.87	peak
2	*	2390.000	41.51	-2.44	39.07	74.00	-34.93	peak


Test Result: Pass

BlueAsia of Technical Services (Shenzhen) Co.,Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



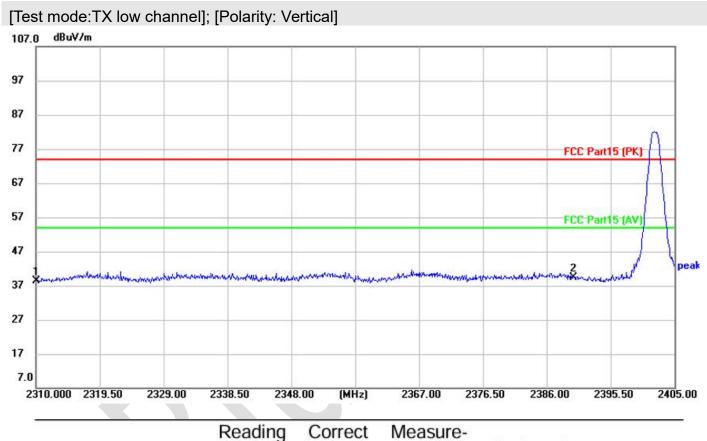


No.	Mk	. Freq.	Reading Level	Correct Factor	Measure- ment	Limit	Over	
		MHz	dBuV	dB	dBuV/m	dBuV/m	dB	Detector
1		2310.000	41.35	-2.87	38.48	74.00	-35.52	peak
2	*	2390.000	41.76	-2.44	39.32	74.00	-34.68	peak

BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



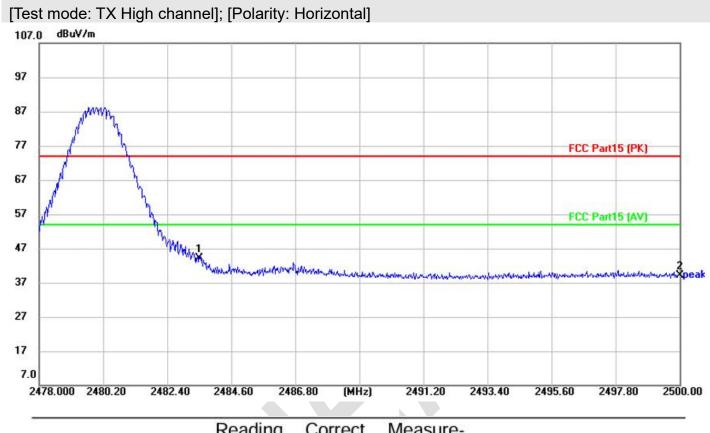

N	Mk		Freq.	Reading Level	Correct Factor	Measure- ment	Limit	Over	
			MHz	dBuV	dB	dBuV/m	dBuV/m	dB	Detector
1	*	24	183.500	47.14	-2.91	44.23	74.00	-29.77	peak
		25	00.000	42.01	-3.00	39.01	74.00	-34.99	peak
					0.00	00.01	,	000	


BlueAsia of Technical Services (Shenzhen) Co.,Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



[Test mode:TX High channel]; [Polarity: Vertical]

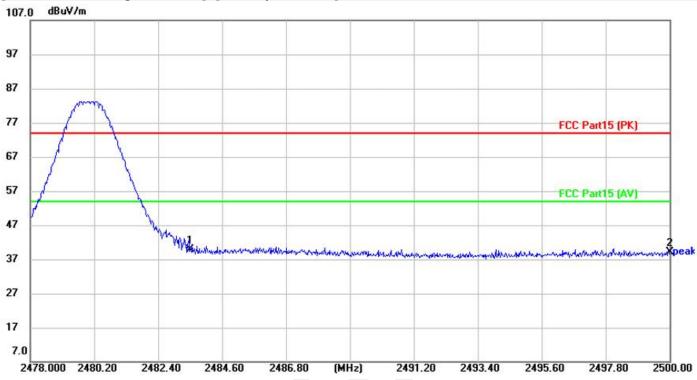

No.	M	ζ.	Freq.	Reading Level	Correct Factor	Measure- ment	Limit	Over		
			MHz	dBuV	dB	dBuV/m	dBuV/m	dB	Detector	
1	*	24	183.500	42.85	-2.91	39.94	74.00	-34.06	peak	
2		25	500.000	42.13	-3.00	39.13	74.00	-34.87	peak	

Test Result: Pass

BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



7 Appendix A

7.1 Maximum Conducted Output Power

Condition	Mode	Frequency	Antenna	Conducted Power	Limit	Verdict
		(MHz)		(dBm)	(dBm)	
NVNT	BLE 1M	2402	Ant1	0.752	30	Pass
NVNT	BLE 1M	2442	Ant1	0.211	30	Pass
NVNT	BLE 1M	2480	Ant1	-0.178	30	Pass
NVNT	BLE 2M	2402	Ant1	0.805	30	Pass
NVNT	BLE 2M	2442	Ant1	0.355	30	Pass
NVNT	BLE 2M	2480	Ant1	-0.003	30	Pass

Power NVNT BLE 1M 2402MHz Ant1




BlueAsia of Technical Services (Shenzhen) Co.,Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



Power NVNT BLE 1M 2442MHz Ant1

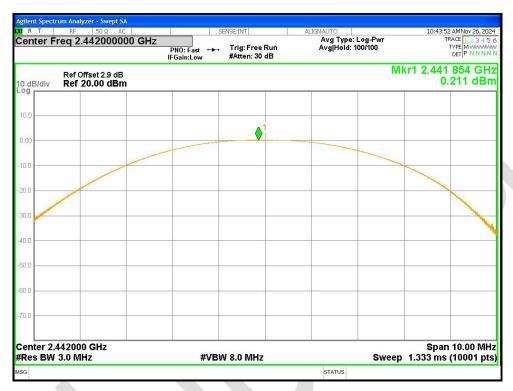

Power NVNT BLE 1M 2480MHz Ant1

BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com





Power NVNT BLE 2M 2402MHz Ant1



BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481


Email: marketing@cblueasia.com www.cblueasia.com



Power NVNT BLE 2M 2442MHz Ant1



Power NVNT BLE 2M 2480MHz Ant1

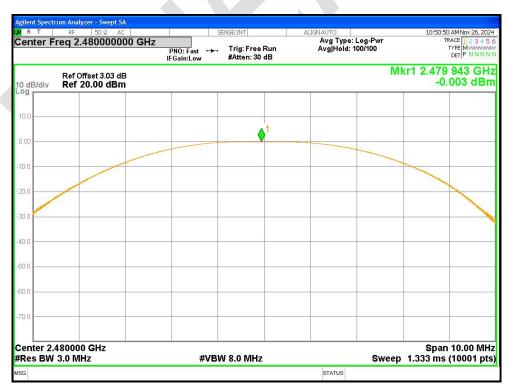

BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com





BlueAsia of Technical Services (Shenzhen) Co.,Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



7.2-6dB Bandwidth

Condition	Mode	Frequency	Antenna	-6 dB Bandwidth	Limit -6 dB	Verdict
		(MHz)		(MHz)	Bandwidth (MHz)	
NVNT	BLE 1M	2402	Ant1	0.657	0.5	Pass
NVNT	BLE 1M	2442	Ant1	0.653	0.5	Pass
NVNT	BLE 1M	2480	Ant1	0.66	0.5	Pass
NVNT	BLE 2M	2402	Ant1	1.108	0.5	Pass
NVNT	BLE 2M	2442	Ant1	1.103	0.5	Pass
NVNT	BLE 2M	2480	Ant1	1.095	0.5	Pass

-6dB Bandwidth NVNT BLE 1M 2402MHz Ant1



BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



-6dB Bandwidth NVNT BLE 1M 2442MHz Ant1



-6dB Bandwidth NVNT BLE 1M 2480MHz Ant1

BlueAsia of Technical Services (Shenzhen) Co.,Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com





-6dB Bandwidth NVNT BLE 2M 2402MHz Ant1



BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com

version:v i.s



-6dB Bandwidth NVNT BLE 2M 2442MHz Ant1



-6dB Bandwidth NVNT BLE 2M 2480MHz Ant1

BlueAsia of Technical Services (Shenzhen) Co.,Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com





Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



7.3 Occupied Channel Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	99% OBW (MHz)
NVNT	BLE 1M	2402	Ant1	1.0221
NVNT	BLE 1M	2442	Ant1	1.0176
NVNT	BLE 1M	2480	Ant1	1.0361
NVNT	BLE 2M	2402	Ant1	2.0135
NVNT	BLE 2M	2442	Ant1	2.0439
NVNT	BLE 2M	2480	Ant1	2.0008

OBW NVNT BLE 1M 2402MHz Ant1



Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com





OBW NVNT BLE 1M 2442MHz Ant1



OBW NVNT BLE 1M 2480MHz Ant1

BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com





OBW NVNT BLE 2M 2402MHz Ant1

BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com





OBW NVNT BLE 2M 2442MHz Ant1



BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



OBW NVNT BLE 2M 2480MHz Ant1



Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



7.4 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Max PSD (dBm)	Limit (dBm)	Verdict
NVNT	BLE 1M	2402	Ant1	-10.793	8	Pass
NVNT	BLE 1M	2442	Ant1	-11.278	8	Pass
NVNT	BLE 1M	2480	Ant1	-11.44	8	Pass
NVNT	BLE 2M	2402	Ant1	-11.263	8	Pass
NVNT	BLE 2M	2442	Ant1	-11.809	8	Pass
NVNT	BLE 2M	2480	Ant1	-11.862	8	Pass

PSD NVNT BLE 1M 2402MHz Ant1




BlueAsia of Technical Services (Shenzhen) Co.,Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com



PSD NVNT BLE 1M 2442MHz Ant1

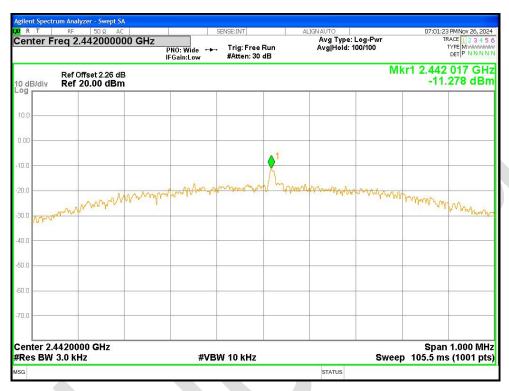

PSD NVNT BLE 1M 2480MHz Ant1

BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com





PSD NVNT BLE 2M 2402MHz Ant1



BlueAsia of Technical Services (Shenzhen) Co., Ltd.

Tel: +86-755-23059481

Email: marketing@cblueasia.com www.cblueasia.com