




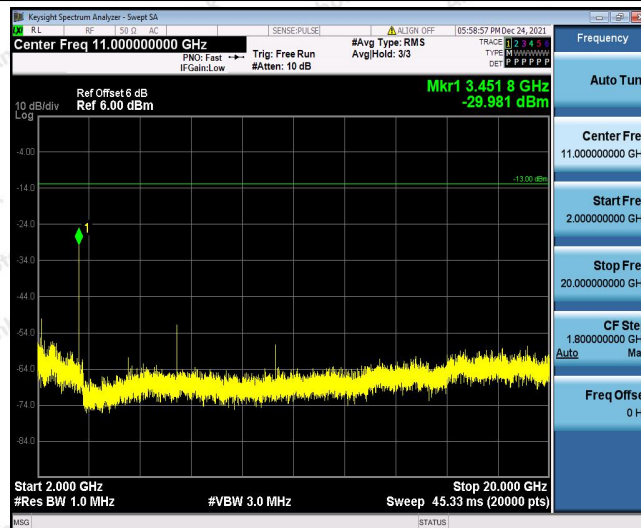

Band4-15MHz-16QAM-20325-1RB#0-Range1:30~1000MHz

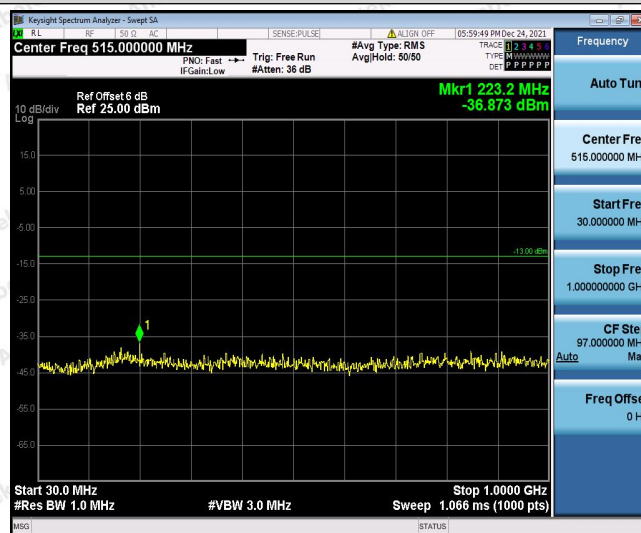

Band4-15MHz-16QAM-20325-1RB#0-Range2:1000~2000MHz

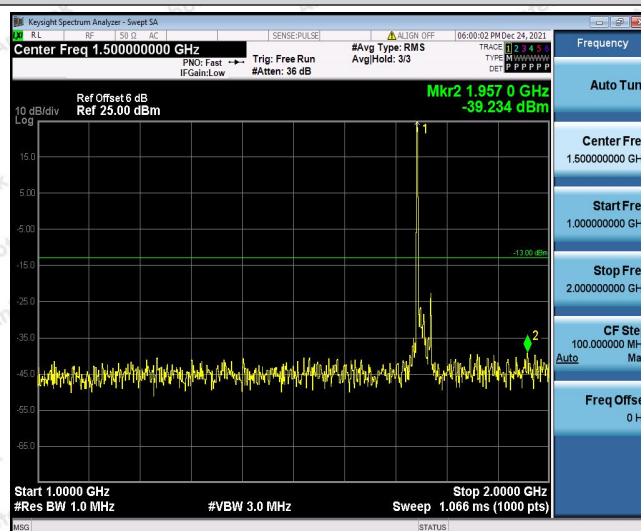


Band4-15MHz-16QAM-20325-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

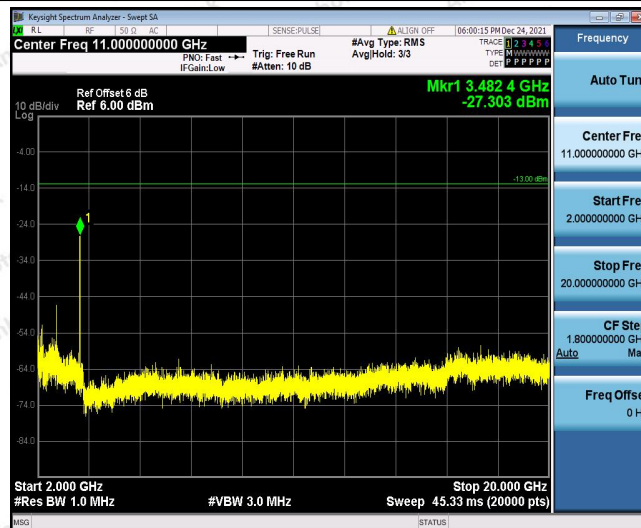

Band4-20MHz-QPSK-20050-1RB#0-Range1:30~1000MHz

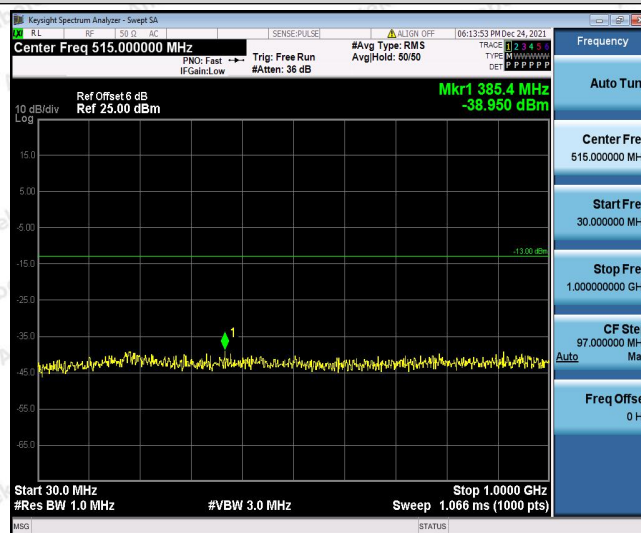

Band4-20MHz-QPSK-20050-1RB#0-Range2:1000~2000MHz

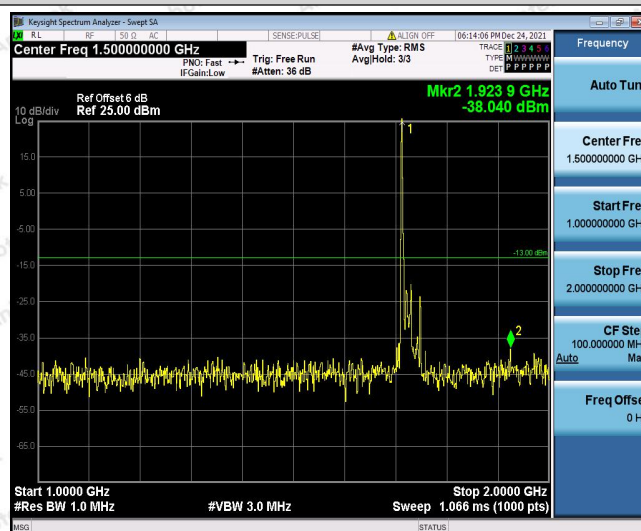


Band4-20MHz-QPSK-20050-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

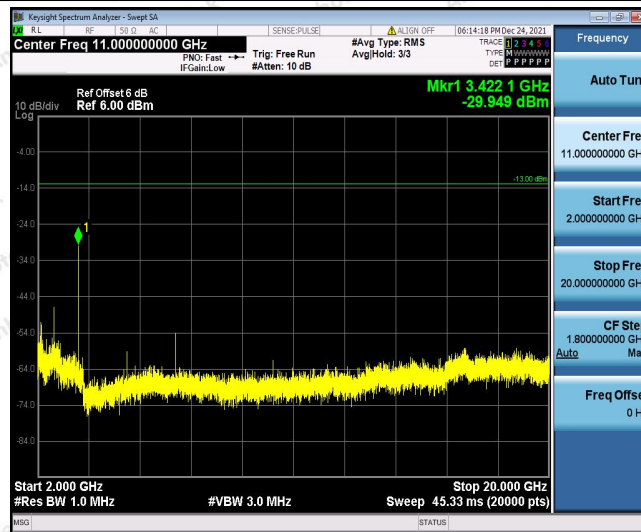

Band4-20MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

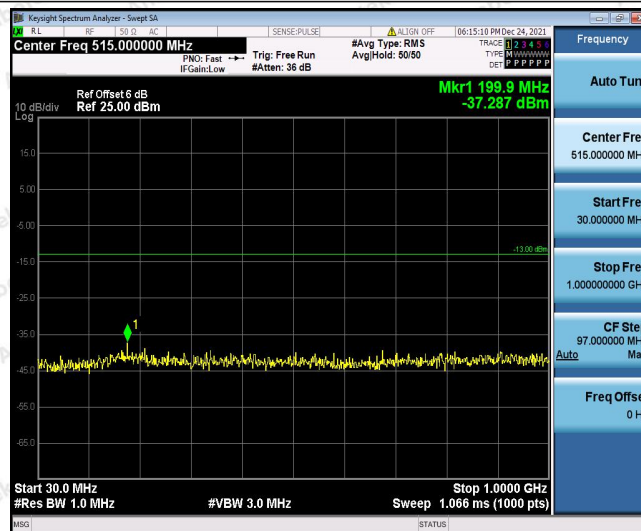

Band4-20MHz-QPSK-20175-1RB#0-Range2:1000~2000MHz

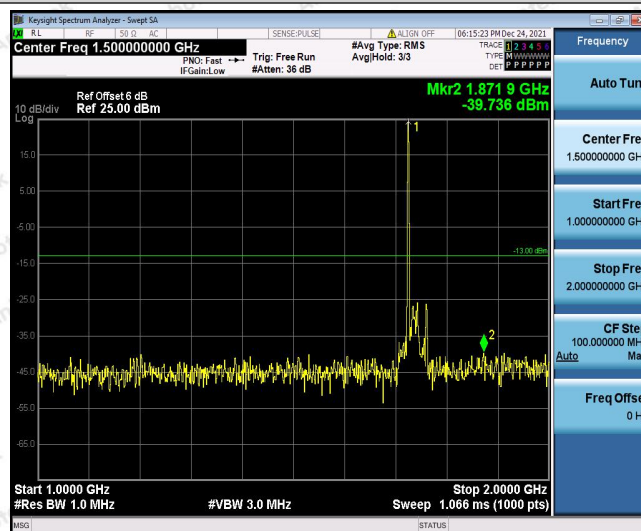

Band4-20MHz-QPSK-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline

400-003-0500


www.anbotech.com

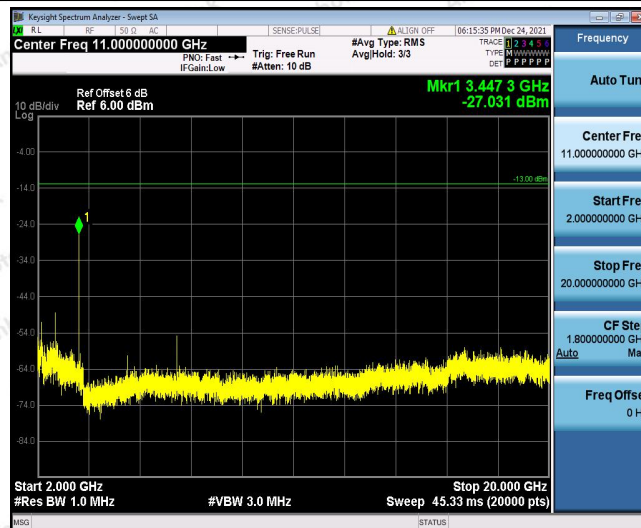

Band4-20MHz-QPSK-20300-1RB#0-Range1:30~1000MHz

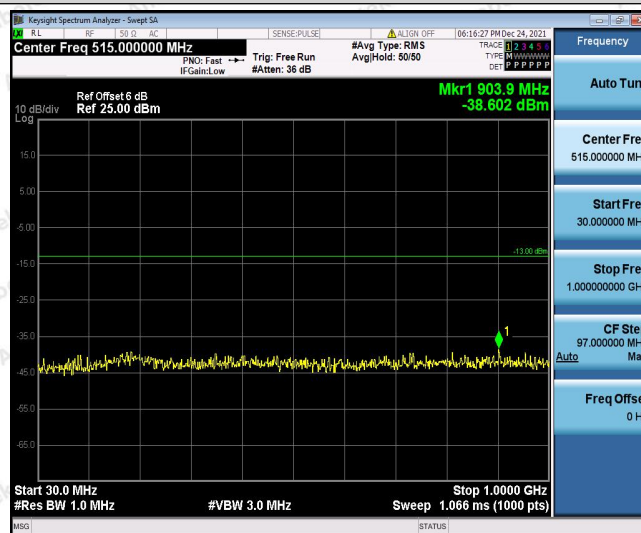

Band4-20MHz-QPSK-20300-1RB#0-Range2:1000~2000MHz

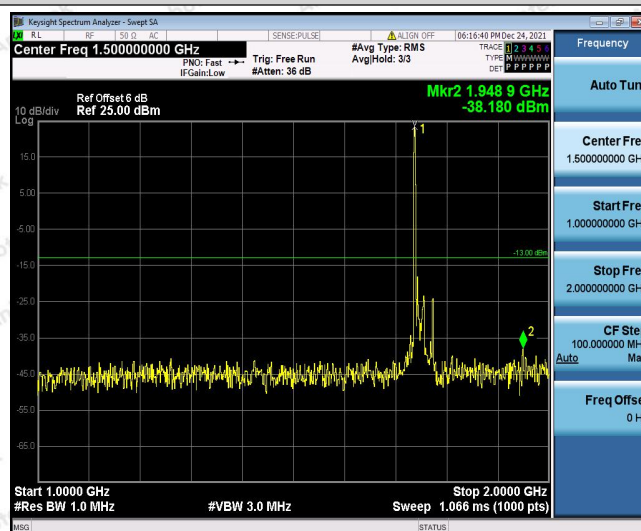


Band4-20MHz-QPSK-20300-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

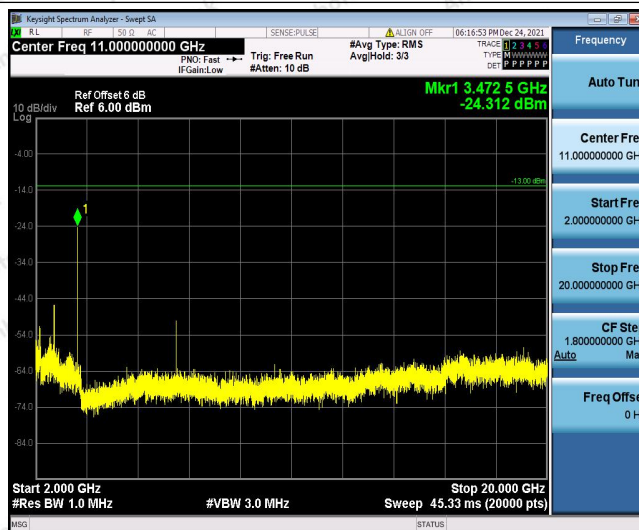

Band4-20MHz-16QAM-20050-1RB#0-Range1:30~1000MHz

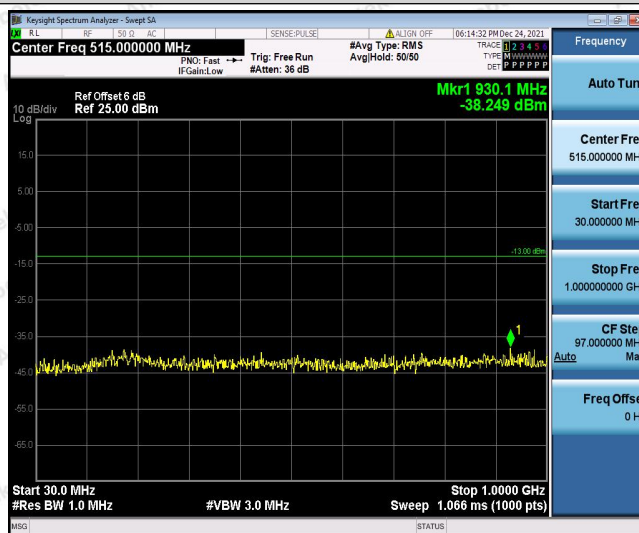

Band4-20MHz-16QAM-20050-1RB#0-Range2:1000~2000MHz

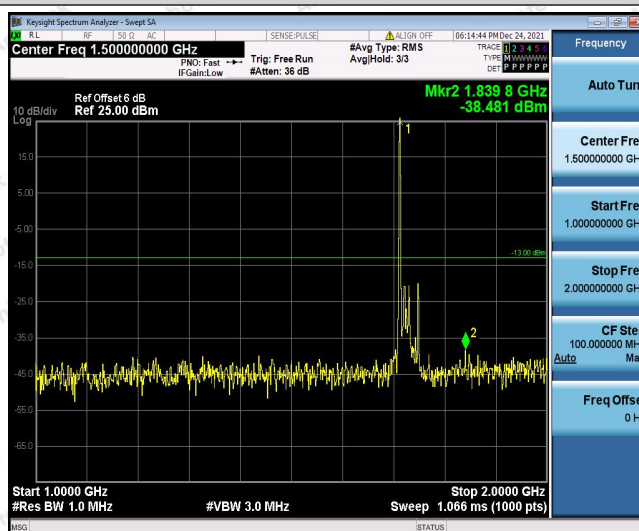


Band4-20MHz-16QAM-20050-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

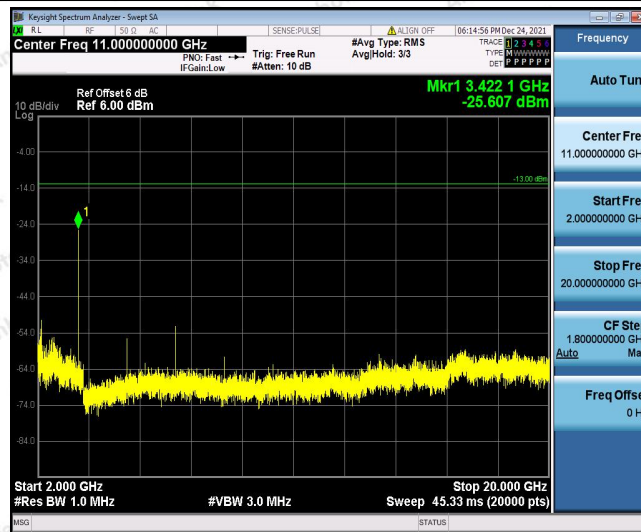

Band4-20MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

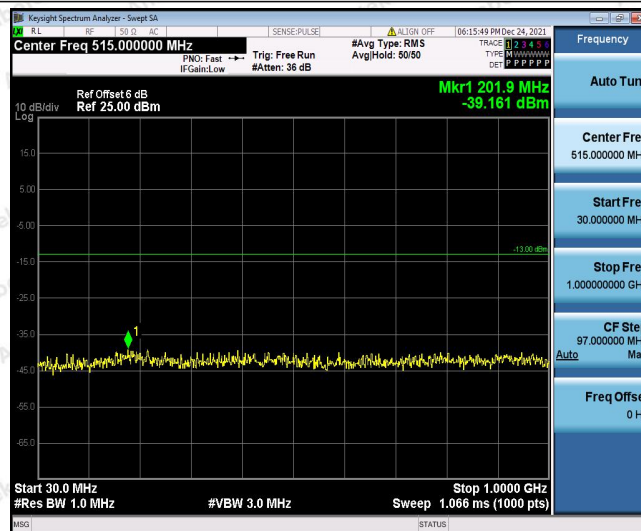

Band4-20MHz-16QAM-20175-1RB#0-Range2:1000~2000MHz

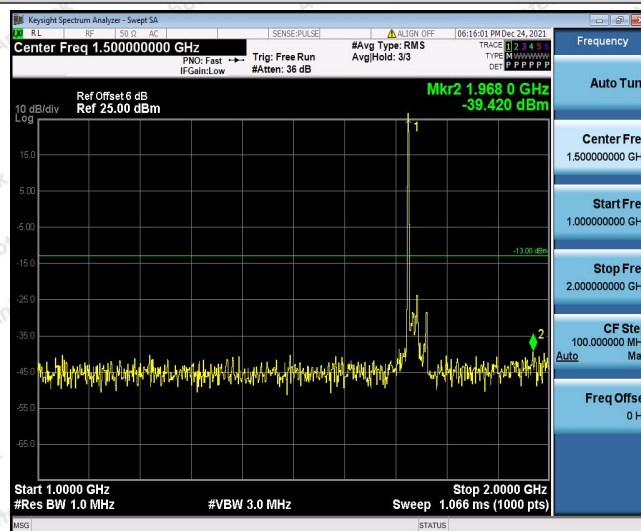

Band4-20MHz-16QAM-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline

400-003-0500


www.anbotech.com

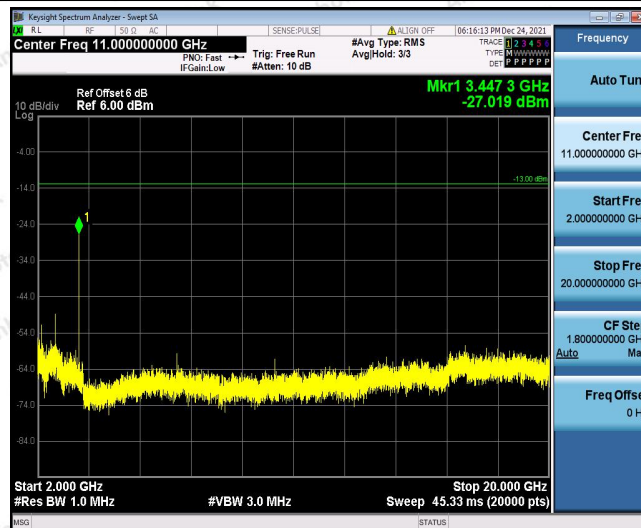

Band4-20MHz-16QAM-20300-1RB#0-Range1:30~1000MHz

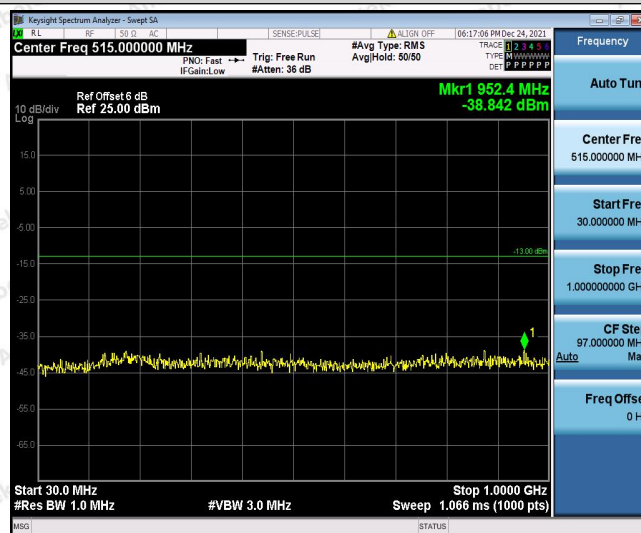

Band4-20MHz-16QAM-20300-1RB#0-Range2:1000~2000MHz

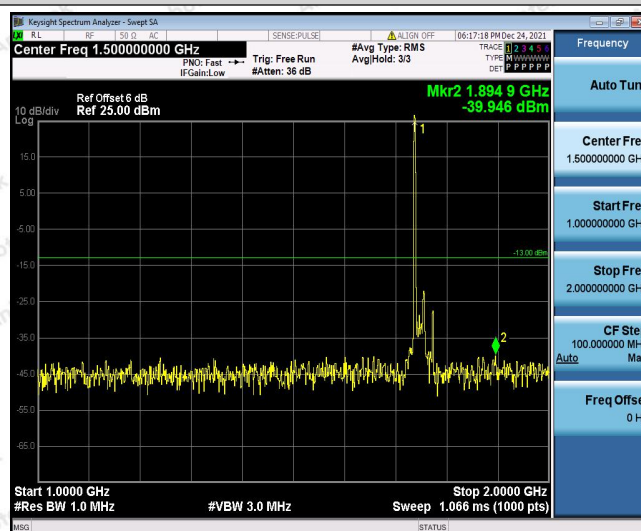


Band4-20MHz-16QAM-20300-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

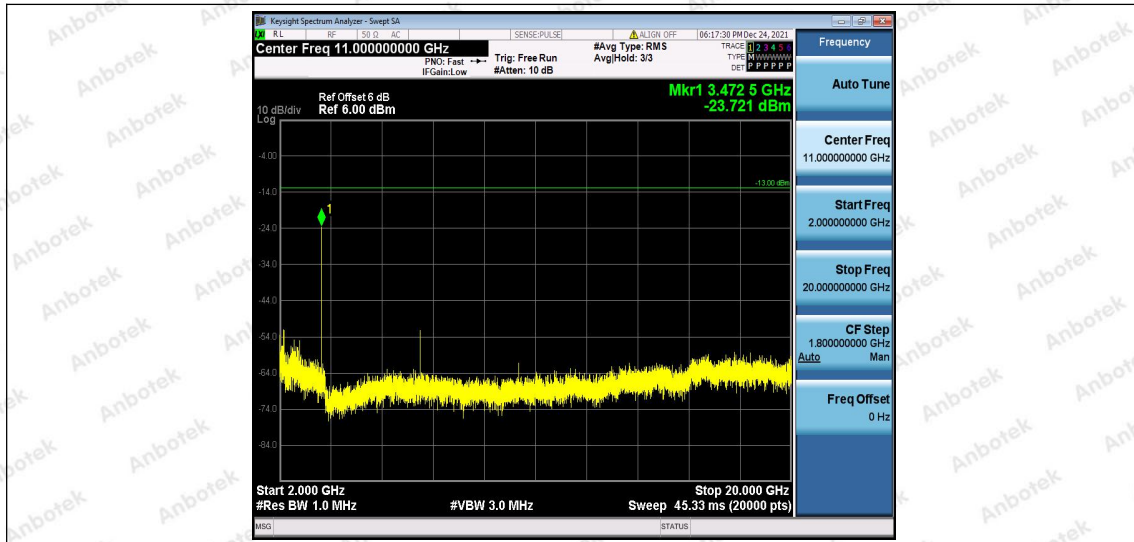**Shenzhen Anbotech Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

Appendix F: Frequency Stability VS Voltage

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage					
					Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	VL	NT	-16.54	-0.009669	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VN	NT	12.13	0.007091	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VH	NT	-13.75	-0.008038	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VL	NT	-12.10	-0.006984	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VN	NT	17.97	0.010372	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VH	NT	-16.85	-0.009726	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VL	NT	-13.25	-0.007553	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VN	NT	27.55	0.015704	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VH	NT	-4.72	-0.002691	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VL	NT	-13.43	-0.007851	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VN	NT	1.65	0.000965	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VH	NT	3.99	0.002332	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VL	NT	-15.01	-0.008664	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VN	NT	-13.92	-0.008035	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VH	NT	-3.45	-0.001991	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VL	NT	-17.68	-0.010078	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VN	NT	-3.12	-0.001778	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VH	NT	-17.31	-0.009867	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VL	NT	-11.94	-0.006976	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VN	NT	13.25	0.007742	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VH	NT	-13.58	-0.007935	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VL	NT	-12.10	-0.006984	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VN	NT	7.27	0.004196	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VH	NT	-11.49	-0.006632	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VL	NT	-17.60	-0.010037	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VN	NT	-9.93	-0.005663	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VH	NT	-17.40	-0.009923	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VL	NT	-12.99	-0.007590	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VN	NT	-14.32	-0.008367	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VH	NT	-11.19	-0.006538	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VL	NT	-13.83	-0.007983	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VN	NT	-19.27	-0.011123	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VH	NT	-4.11	-0.002372	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

Band4	3MHz	16QAM	20385	15RB#0	VL	NT	3.73	0.002127	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VN	NT	-12.00	-0.006843	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VH	NT	3.59	0.002047	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VL	NT	-16.06	-0.009378	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VN	NT	9.98	0.005828	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VH	NT	-12.59	-0.007352	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VL	NT	-16.01	-0.009241	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VN	NT	-5.56	-0.003209	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VH	NT	-3.03	-0.001749	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VL	NT	-4.01	-0.002288	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VN	NT	20.03	0.011429	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VH	NT	-18.40	-0.010499	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VL	NT	4.49	0.002622	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VN	NT	-11.00	-0.006423	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VH	NT	-3.42	-0.001997	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VL	NT	-12.86	-0.007423	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VN	NT	-15.68	-0.009051	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VH	NT	-14.16	-0.008173	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VL	NT	-16.98	-0.009689	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VN	NT	-11.56	-0.006596	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VH	NT	-5.41	-0.003087	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VL	NT	2.65	0.001545	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VN	NT	-10.19	-0.005942	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VH	NT	-17.19	-0.010023	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VL	NT	-11.54	-0.006661	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VN	NT	10.41	0.006009	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VH	NT	8.50	0.004906	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VL	NT	-14.55	-0.008314	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VN	NT	3.75	0.002143	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VH	NT	-17.09	-0.009766	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VL	NT	6.15	0.003586	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VN	NT	-16.24	-0.009469	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VH	NT	-12.07	-0.007038	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VL	NT	-14.23	-0.008214	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VN	NT	-10.81	-0.006240	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VH	NT	-12.07	-0.006967	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VL	NT	-9.90	-0.005657	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VN	NT	-19.71	-0.011263	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VH	NT	-14.33	-0.008189	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VL	NT	-12.70	-0.007394	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VN	NT	-14.79	-0.008611	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

Band4	15MHz	QPSK	20025	75RB#0	VH	NT	-13.76	-0.008012	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VL	NT	6.87	0.003965	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VN	NT	-13.10	-0.007561	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VH	NT	-14.95	-0.008629	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VL	NT	-12.69	-0.007262	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VN	NT	-9.14	-0.005230	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VH	NT	-13.62	-0.007794	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VL	NT	-10.54	-0.006137	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VN	NT	-6.44	-0.003750	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VH	NT	8.03	0.004675	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VL	NT	7.40	0.004271	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VN	NT	5.82	0.003359	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VH	NT	-14.43	-0.008329	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VL	NT	-11.47	-0.006564	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VN	NT	-14.85	-0.008498	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VH	NT	2.17	0.001242	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VL	NT	-4.81	-0.002797	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VN	NT	-13.29	-0.007727	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VH	NT	-15.64	-0.009093	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VL	NT	-12.10	-0.006984	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VN	NT	-12.99	-0.007498	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VH	NT	-15.52	-0.008958	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VL	NT	-13.79	-0.007903	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VN	NT	-8.41	-0.004819	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VH	NT	-3.72	-0.002132	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VL	NT	-6.42	-0.003733	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VN	NT	-12.95	-0.007529	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VH	NT	-15.62	-0.009081	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VL	NT	-15.86	-0.009154	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VN	NT	-11.59	-0.006690	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VH	NT	5.84	0.003371	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VL	NT	-5.56	-0.003186	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VN	NT	-11.84	-0.006785	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VH	NT	-10.74	-0.006155	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

Appendix G: Frequency Stability VS Temperature

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-30	-14.08	-0.008231	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-20	-16.81	-0.009826	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	0	-4.29	-0.002508	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	10	3.95	0.002309	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	20	-15.84	-0.009259	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-30	-8.33	-0.004808	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-20	-13.42	-0.007746	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	0	-15.12	-0.008727	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	10	-13.73	-0.007925	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	20	-14.15	-0.008167	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-30	-10.84	-0.006179	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-20	-15.34	-0.008744	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	0	-17.47	-0.009958	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	10	-18.20	-0.010375	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	20	-11.69	-0.006664	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-30	-9.10	-0.005319	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-20	-9.36	-0.005471	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	0	-11.97	-0.006997	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	10	-8.40	-0.004910	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	20	-8.96	-0.005238	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-30	-13.58	-0.007838	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-20	-13.49	-0.007786	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	0	-17.50	-0.010101	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	10	-13.07	-0.007544	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	20	-13.39	-0.007729	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-30	-15.23	-0.008682	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-20	2.17	0.001237	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	0	-11.83	-0.006743	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	10	-5.45	-0.003107	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	20	-11.10	-0.006327	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-30	-2.83	-0.001654	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-20	-11.01	-0.006433	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	0	-13.53	-0.007905	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

Band4	3MHz	QPSK	19965	15RB#0	NV	10	-4.59	-0.002682	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	20	4.32	0.002524	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-30	-14.33	-0.008271	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-20	2.17	0.001253	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	0	-14.76	-0.008519	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	10	-19.47	-0.011238	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	20	-13.89	-0.008017	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-30	-12.97	-0.007397	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-20	-2.72	-0.001551	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	0	-9.30	-0.005304	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	10	-5.54	-0.003159	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	20	-2.95	-0.001682	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-30	-14.26	-0.008332	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-20	-13.65	-0.007975	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	0	-17.04	-0.009956	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	10	4.56	0.002664	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	20	-5.72	-0.003342	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-30	-17.54	-0.010124	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-20	-12.30	-0.007100	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	0	2.79	0.001610	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	10	-13.83	-0.007983	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	20	9.07	0.005235	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-30	6.52	0.003718	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-20	-11.50	-0.006558	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	0	-4.05	-0.002310	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	10	-13.19	-0.007522	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	20	-11.93	-0.006804	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-30	-12.04	-0.007031	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-20	-12.86	-0.007509	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	0	-9.08	-0.005302	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	10	-9.48	-0.005536	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	20	3.33	0.001945	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-30	-13.23	-0.007636	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-20	-12.80	-0.007388	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	0	9.54	0.005506	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	10	-22.56	-0.013022	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	20	-15.25	-0.008802	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-30	-14.95	-0.008531	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-20	-19.34	-0.011036	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	0	-15.42	-0.008799	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	10	-13.22	-0.007544	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

Band4	5MHz	QPSK	20375	25RB#0	NV	20	-13.02	-0.007429	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-30	-11.13	-0.006499	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-20	-15.56	-0.009086	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	0	5.66	0.003305	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	10	-10.01	-0.005845	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	20	-14.33	-0.008368	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-30	-15.75	-0.009091	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-20	-18.44	-0.010644	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	0	-13.69	-0.007902	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	10	-15.34	-0.008854	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	20	-15.13	-0.008733	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-30	-15.45	-0.008816	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-20	-1.42	-0.000810	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	0	-14.02	-0.008000	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	10	4.94	0.002819	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	20	-12.99	-0.007412	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-30	-13.55	-0.007901	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-20	-17.32	-0.010099	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	0	-15.16	-0.008840	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	10	-17.27	-0.010070	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	20	-15.94	-0.009294	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-30	-9.87	-0.005697	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-20	-4.29	-0.002476	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	0	6.35	0.003665	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	10	-4.08	-0.002355	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	20	-18.68	-0.010782	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-30	-7.95	-0.004543	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-20	7.84	0.004480	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	0	-16.09	-0.009194	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	10	-17.91	-0.010234	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	20	-6.42	-0.003669	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-30	-17.65	-0.010292	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-20	-14.03	-0.008181	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	0	-4.51	-0.002630	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	10	3.50	0.002041	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	20	-13.65	-0.007959	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-30	-10.20	-0.005887	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-20	4.16	0.002401	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	0	-18.48	-0.010667	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	10	-14.25	-0.008225	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	20	-13.60	-0.007850	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

Band4	10MHz	16QAM	20350	50RB#0	NV	-30	-14.06	-0.008034	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-20	-4.58	-0.002617	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	0	-4.82	-0.002754	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	10	-12.66	-0.007234	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	20	-6.87	-0.003926	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-30	-11.77	-0.006853	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-20	-11.69	-0.006806	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	0	-17.14	-0.009980	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	10	-11.76	-0.006847	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	20	-11.07	-0.006445	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-30	-7.84	-0.004525	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-20	-15.89	-0.009172	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	0	-3.08	-0.001778	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	10	-13.59	-0.007844	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	20	-10.03	-0.005789	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-30	-15.45	-0.008841	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-20	-15.71	-0.008990	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	0	-13.48	-0.007714	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	10	-11.50	-0.006581	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	20	-11.37	-0.006506	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-30	-13.02	-0.007581	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-20	-16.81	-0.009787	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	0	-11.59	-0.006748	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	10	-15.06	-0.008769	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	20	-16.19	-0.009426	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-30	-9.53	-0.005501	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-20	-6.98	-0.004029	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	0	-19.07	-0.011007	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	10	-12.90	-0.007446	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	20	-18.74	-0.010817	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-30	-14.82	-0.008481	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-20	-17.58	-0.010060	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	0	-3.45	-0.001974	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	10	-12.70	-0.007268	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	20	-10.80	-0.006180	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-30	-11.06	-0.006430	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-20	1.96	0.001140	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	0	-6.15	-0.003576	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	10	-16.16	-0.009395	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	20	-13.03	-0.007576	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-30	-16.79	-0.009691	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

Band4	20MHz	QPSK	20175	100RB#0	NV	-20	4.56	0.002632	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	0	-10.33	-0.005962	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	10	-12.92	-0.007457	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	20	-2.60	-0.001501	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-30	-9.70	-0.005559	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-20	-14.76	-0.008458	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	0	-6.82	-0.003908	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	10	-15.85	-0.009083	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	20	-12.65	-0.007249	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-30	-2.82	-0.001640	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-20	-13.62	-0.007919	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	0	-12.92	-0.007512	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	10	-16.87	-0.009808	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	20	-12.80	-0.007442	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-30	7.35	0.004242	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-20	-18.11	-0.010453	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	0	-13.13	-0.007579	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	10	-11.47	-0.006620	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	20	-16.77	-0.009680	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-30	-17.85	-0.010229	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-20	-6.48	-0.003713	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	0	-11.50	-0.006590	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	10	-9.08	-0.005203	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	20	-9.03	-0.005175	±2.5	PASS

---End---

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com