


EMC Technologies Report Number: M050215_Cert_WLL4070_11abg_DTS_BT

APPENDIX K1
Harmonics - WLL4070 802.11a



Harmonics – Channel 149 (low)

Marker 1 [T1] RBW 100 kHz RF Att 30 dB
Ref Lvl -1.14 dBm VBW 300 kHz
17.5 dBm 5.68937876 GHz SWT 9.8 s Unit dBm

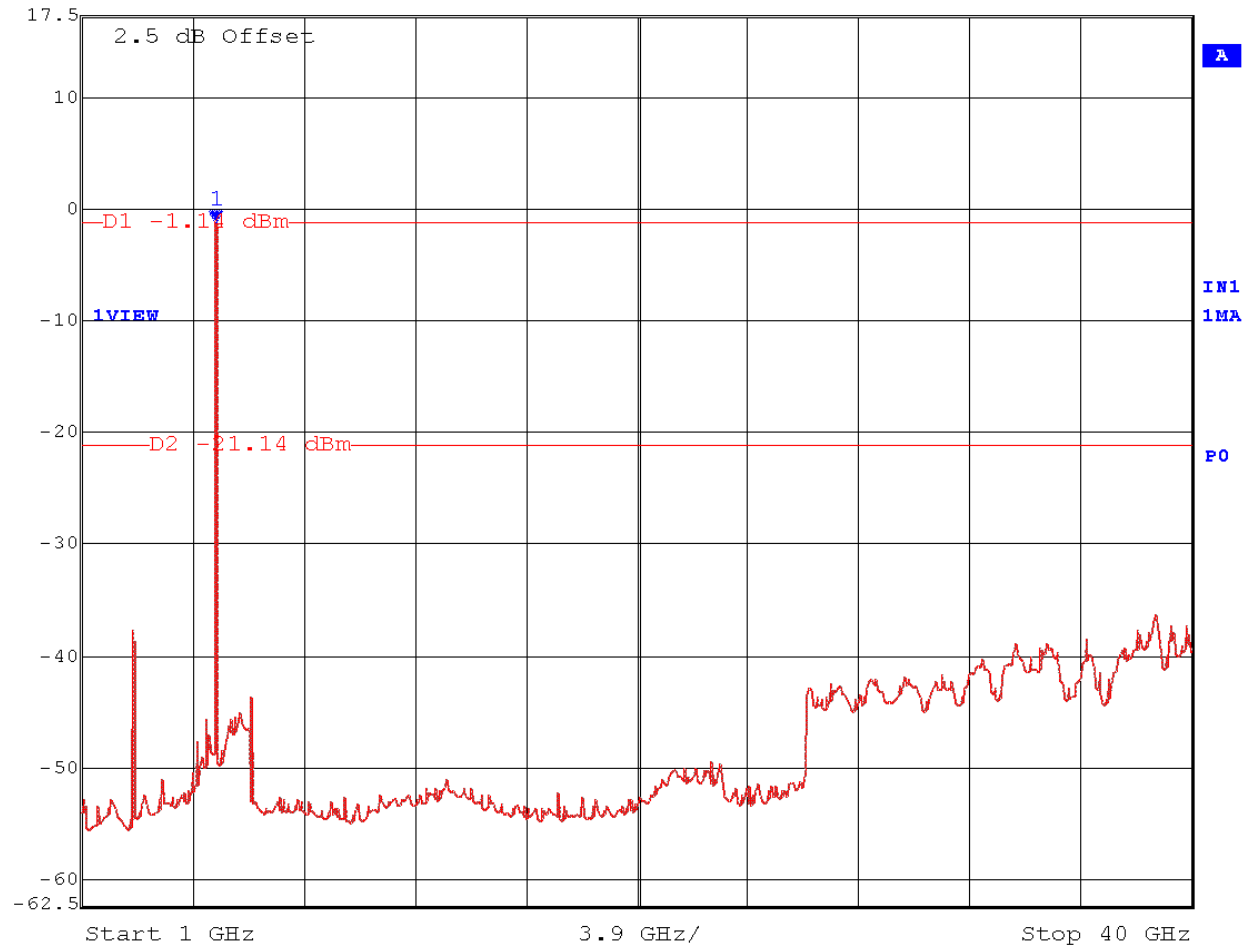


Date: 16.FEB.2005 13:56:58



Harmonics - Channel 157 (Middle)

 Marker 1 [T1] RBW 100 kHz RF Att 30 dB
Ref Lvl -0.78 dBm VBW 300 kHz
17.5 dBm 5.76753507 GHz SWT 9.8 s Unit dBm

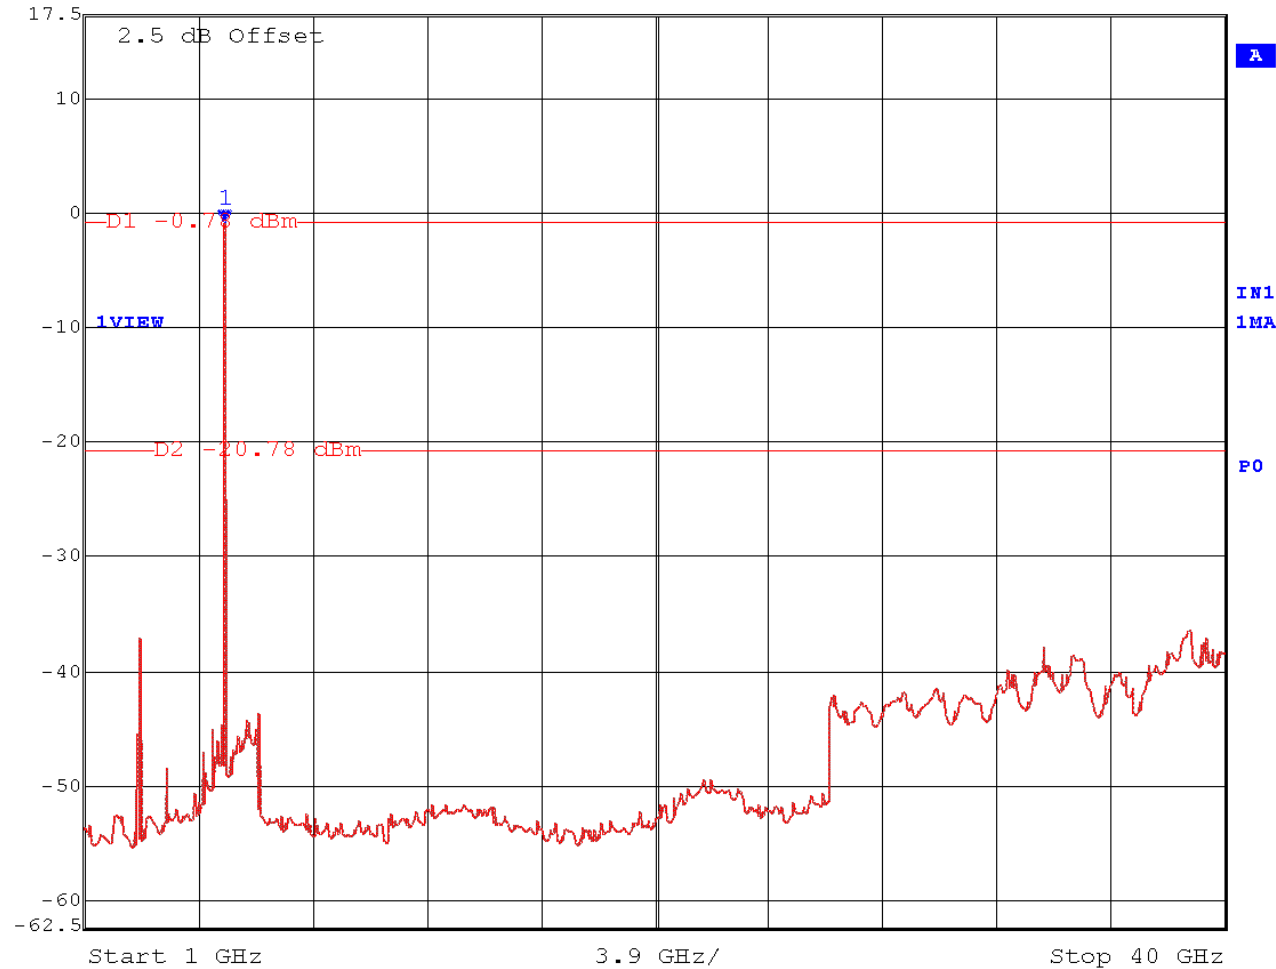


Date: 16.FEB.2005 14:00:46



Harmonics - Channel 165 (High)

Marker 1 [T1] RBW 100 kHz RF Att 30 dB
Ref Lvl -0.54 dBm VBW 300 kHz
17.5 dBm 5.76753507 GHz SWT 9.8 s Unit dBm

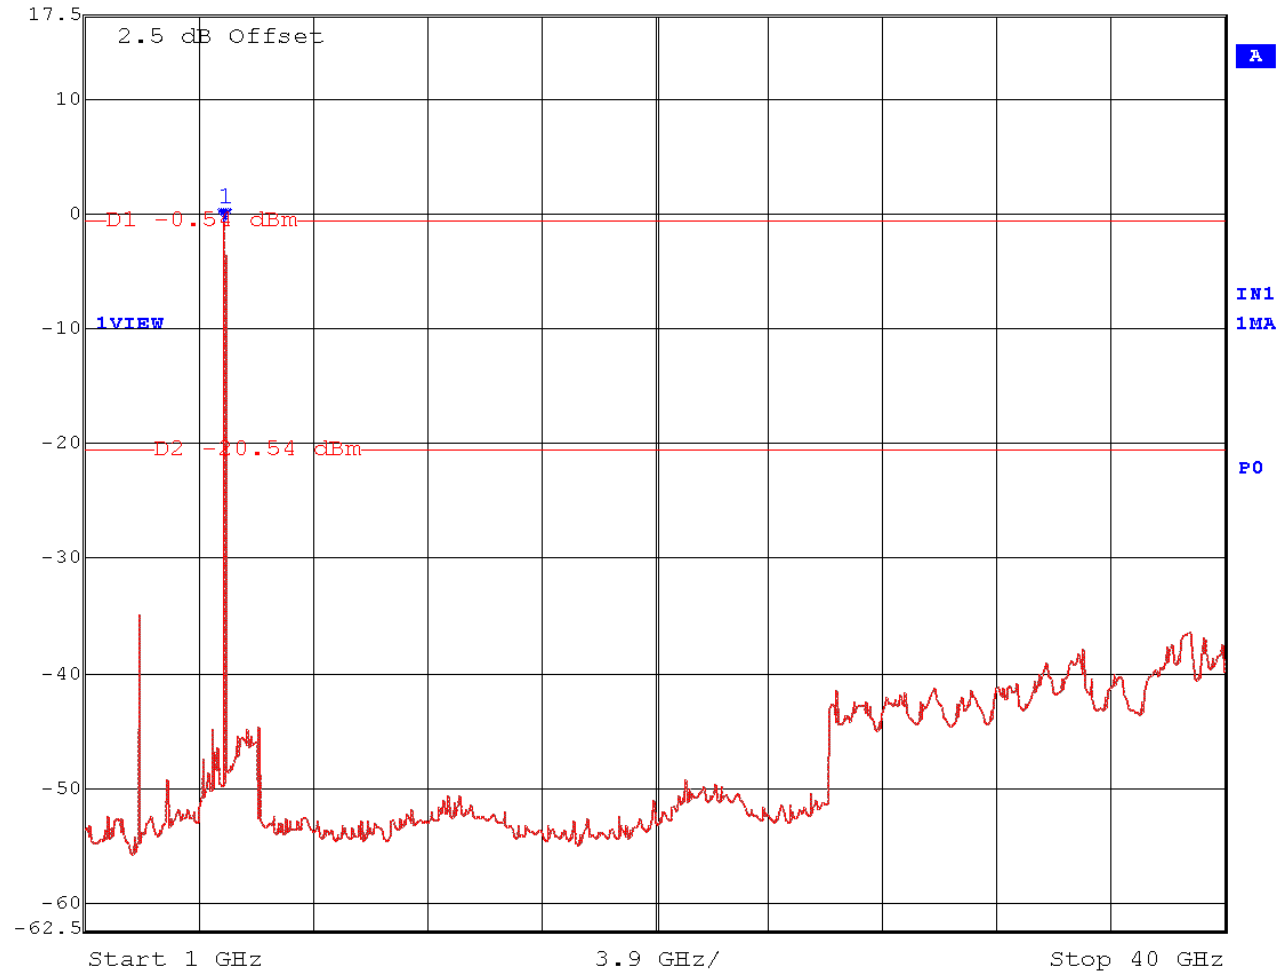


Date: 16.FEB.2005 14:04:58



Harmonics - Channel 152 (Turbo)

 Ref Lvl Marker 1 [T1] RBW 100 kHz RF Att 30 dB
17.5 dBm -0.07 dBm VBW 300 kHz
5.68937876 GHz SWT 9.8 s Unit dBm

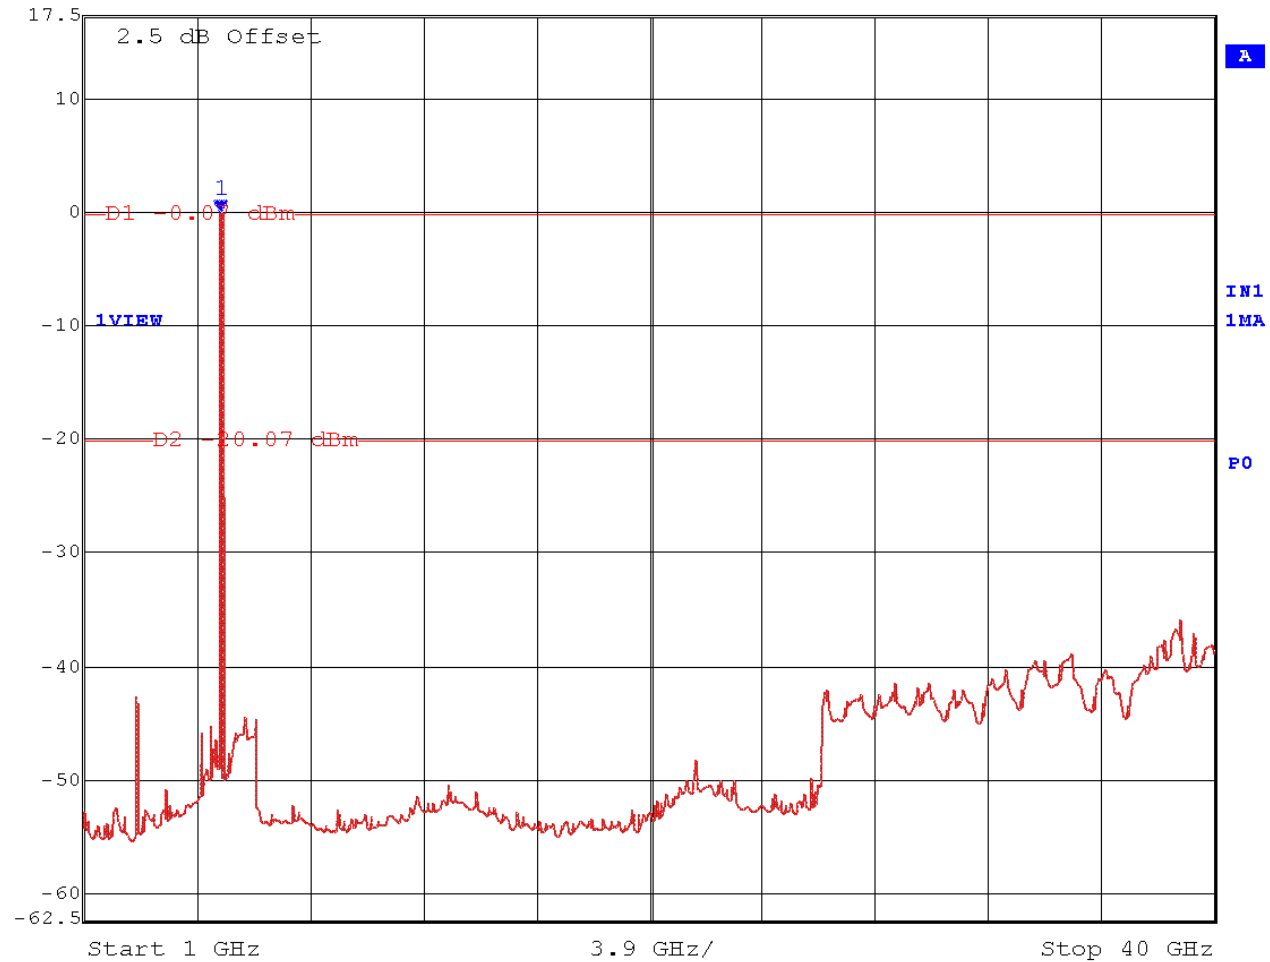

Date: 16.FEB.2005 14:10:09



Harmonics - Channel 160 (Turbo)

Marker 1 [T1]

RBW 100 kHz RF Att 30 dB

Ref Lvl

0.06 dBm

VBW 300 kHz

17.5 dBm


5.76753507 GHz

SWT

9.8 s

Unit

dBm

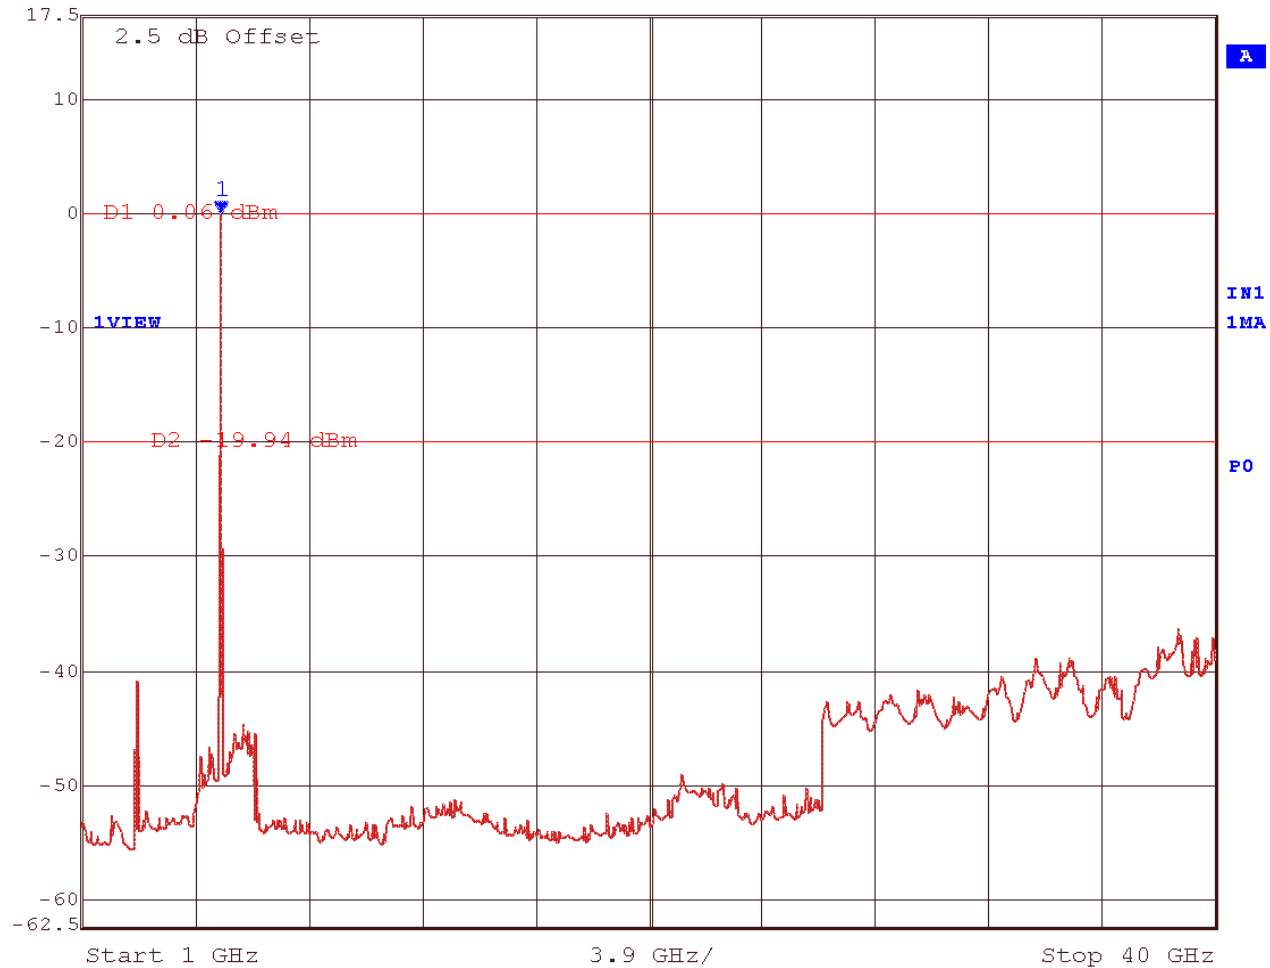

Date: 16.FEB.2005 14:07:20

