

Test Information:

Sample No.:	2UGH-1	Test Date:	2024/12/07~2024/12/16
Test Site:	RF	Test Mode:	Transmitting
Tester:	Kungfumaster Liang	Test Result:	Pass

Environmental Conditions:

Temperature: (°C):	22.1-25.7	Relative Humidity: (%)	46-53	ATM Pressure: (kPa)	100.9-101
-----------------------	-----------	---------------------------	-------	------------------------	-----------

Spurious Emissions at Antenna Terminal

FCC Part 96

n77_2

Mode	Value (dBm)	Limit	Verdict
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-47.76	-40	Pass
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@23	-47.53	-40	Pass
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-47.63	-40	Pass
n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.46	-40	Pass
n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@23	-47.86	-40	Pass
n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB24@0	-47.39	-40	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@0	-47.64	-40	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-47.72	-40	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-48.32	-40	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-47.66	-40	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@37	-47.64	-40	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-47.88	-40	Pass
n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.61	-40	Pass
n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@37	-47.92	-40	Pass
n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB36@0	-46.95	-40	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@0	-47.45	-40	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-47.77	-40	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-47.74	-40	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-47.33	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@50	-47.62	-40	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-47.83	-40	Pass
n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.91	-40	Pass
n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@50	-47.53	-40	Pass
n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB50@0	-47.77	-40	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@0	-47.51	-40	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-47.75	-40	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-47.86	-40	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-47.76	-40	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@77	-47.67	-40	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-47.51	-40	Pass
n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.60	-40	Pass
n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@77	-47.50	-40	Pass
n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB75@0	-48.08	-40	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@0	-47.58	-40	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-47.41	-40	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-47.77	-40	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-47.66	-40	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-47.74	-40	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@105	-47.52	-40	Pass
n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB100@0	-47.45	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.44	-40	Pass
n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@105	-47.84	-40	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-47.51	-40	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@0	-47.24	-40	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-47.65	-40	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-47.35	-40	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-47.78	-40	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@132	-46.91	-40	Pass
n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB128@0	-47.59	-40	Pass
n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-46.96	-40	Pass
n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@132	-47.48	-40	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-47.78	-40	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@0	-47.56	-40	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-47.46	-40	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-47.36	-40	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-47.17	-40	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@161	-47.57	-40	Pass
n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB162@0	-46.67	-40	Pass
n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-45.29	-40	Pass
n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@161	-47.58	-40	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-47.67	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@0	-47.65	-40	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-47.12	-40	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-44.70	-40	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-44.33	-40	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@188	-47.76	-40	Pass
n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB180@0	-47.57	-40	Pass
n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-45.78	-40	Pass
n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@188	-46.19	-40	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-47.39	-40	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@0	-47.22	-40	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-46.88	-40	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-47.58	-40	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@216	-44.58	-40	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-47.34	-40	Pass
n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.47	-40	Pass
n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@216	-46.96	-40	Pass
n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB216@0	-47.68	-40	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@0	-47.03	-40	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-47.52	-40	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-47.36	-40	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-46.50	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@244	-45.98	-40	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-47.67	-40	Pass
n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.65	-40	Pass
n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@244	-46.11	-40	Pass
n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB243@0	-46.63	-40	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@0	-47.26	-40	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-45.22	-40	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-47.21	-40	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-44.14	-40	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@272	-44.03	-40	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-47.59	-40	Pass
n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.13	-40	Pass
n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@272	-47.80	-40	Pass
n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB270@0	-47.24	-40	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@0	-44.55	-40	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-47.39	-40	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-47.36	-40	Pass

n78_2

Mode	Value (dBm)	Limit	Verdict
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-47.03	-40	Pass
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@23	-47.51	-40	Pass
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-47.51	-40	Pass
n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.12	-40	Pass
n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@23	-47.47	-40	Pass
n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB24@0	-47.53	-40	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@0	-47.19	-40	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-46.91	-40	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-47.59	-40	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-47.62	-40	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@37	-47.10	-40	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-47.54	-40	Pass
n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.75	-40	Pass
n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@37	-47.68	-40	Pass
n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB36@0	-47.35	-40	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@0	-46.96	-40	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-47.18	-40	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-47.06	-40	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-47.22	-40	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@50	-47.37	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-47.61	-40	Pass
n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.29	-40	Pass
n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@50	-47.88	-40	Pass
n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB50@0	-47.12	-40	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@0	-47.73	-40	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-47.40	-40	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-47.94	-40	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-47.81	-40	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@77	-46.81	-40	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-47.19	-40	Pass
n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-46.99	-40	Pass
n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@77	-47.60	-40	Pass
n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB75@0	-47.05	-40	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@0	-47.65	-40	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-47.79	-40	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-45.86	-40	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-46.90	-40	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-47.08	-40	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@105	-46.97	-40	Pass
n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB100@0	-47.40	-40	Pass
n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.43	-40	Pass


Mode	Value (dBm)	Limit	Verdict
n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@105	-47.13	-40	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-47.52	-40	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@0	-47.74	-40	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-47.09	-40	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-44.64	-40	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-47.57	-40	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@132	-47.14	-40	Pass
n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB128@0	-47.36	-40	Pass
n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.16	-40	Pass
n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@132	-47.22	-40	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-47.48	-40	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@0	-47.33	-40	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-47.38	-40	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-47.39	-40	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-47.64	-40	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@161	-47.66	-40	Pass
n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB162@0	-47.45	-40	Pass
n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.91	-40	Pass
n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@161	-47.45	-40	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-47.45	-40	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@0	-47.20	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-47.41	-40	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-44.21	-40	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-46.91	-40	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@188	-47.81	-40	Pass
n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB180@0	-47.35	-40	Pass
n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-46.19	-40	Pass
n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@188	-47.12	-40	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-47.39	-40	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@0	-47.51	-40	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-47.81	-40	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-47.61	-40	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@216	-47.04	-40	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-47.34	-40	Pass
n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.15	-40	Pass
n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@216	-47.38	-40	Pass
n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB216@0	-47.46	-40	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@0	-47.63	-40	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-47.07	-40	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-47.30	-40	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-47.49	-40	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@244	-47.18	-40	Pass


Mode	Value (dBm)	Limit	Verdict
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-47.26	-40	Pass
n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.05	-40	Pass
n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@244	-47.36	-40	Pass
n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB243@0	-47.17	-40	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@0	-46.77	-40	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-45.58	-40	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-47.45	-40	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-47.18	-40	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@272	-44.30	-40	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-47.01	-40	Pass
n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.46	-40	Pass
n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@272	-47.62	-40	Pass
n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB270@0	-47.45	-40	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@0	-47.57	-40	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-44.55	-40	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-47.05	-40	Pass

n77_2


n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@0 -47.76dBm

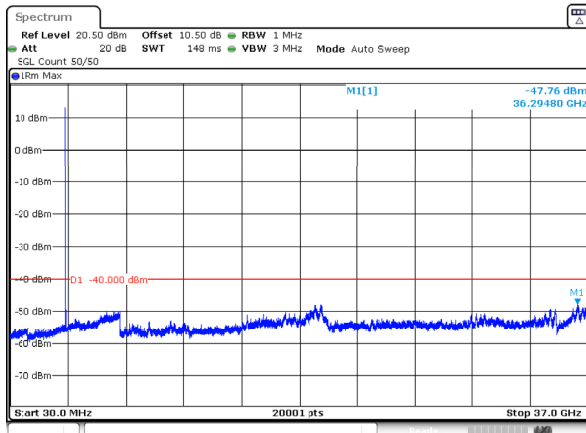


n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@23 -47.53dBm

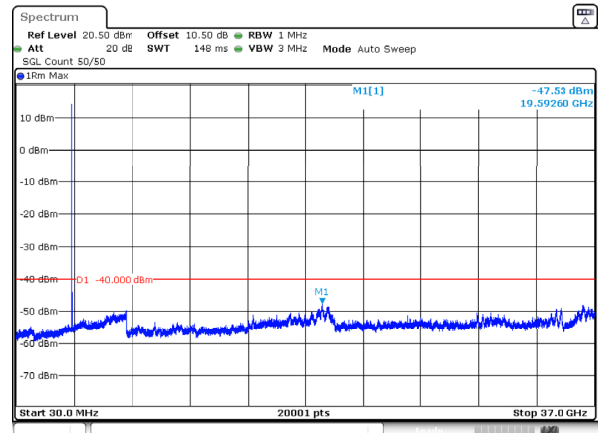


n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB24@0 -47.63dBm

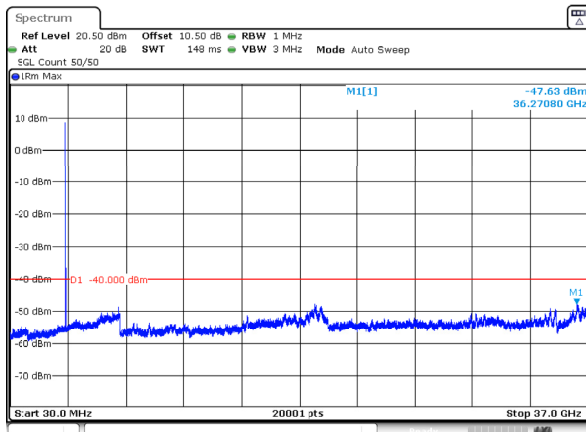


n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.46dBm

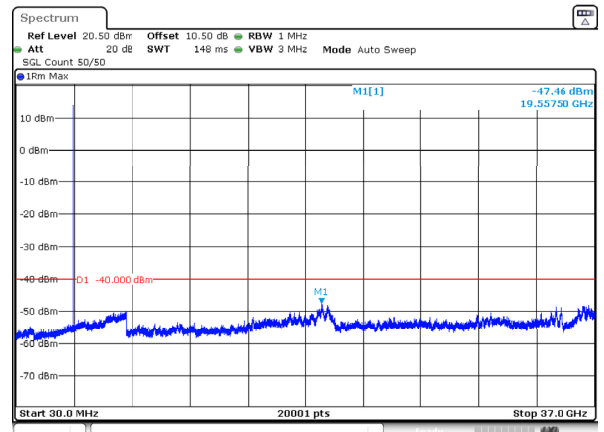


n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@23 -47.86dBm

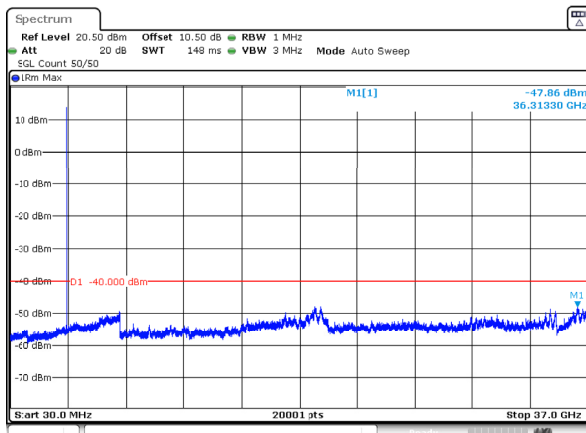


n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB24@0 -47.39dBm

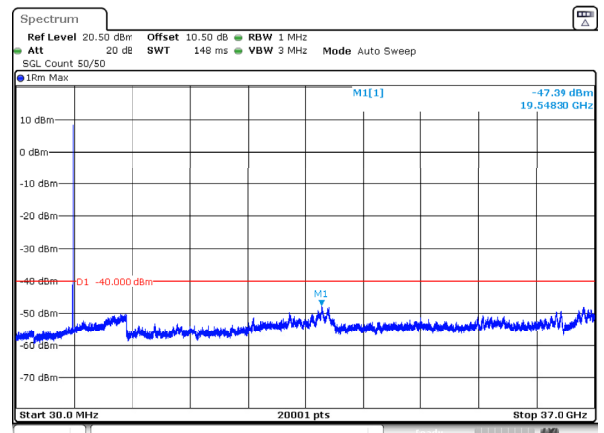


n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@0 -47.64dBm

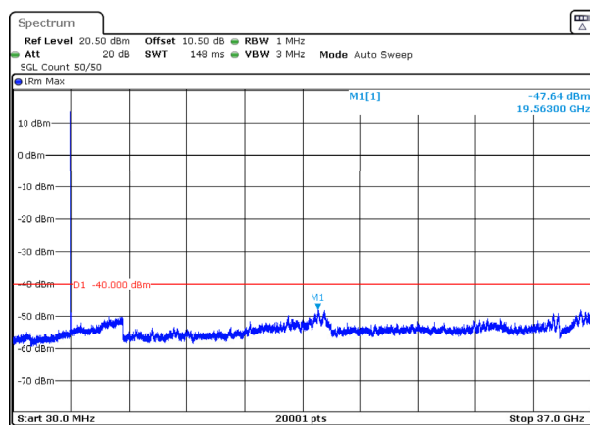


n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@23 -47.72dBm

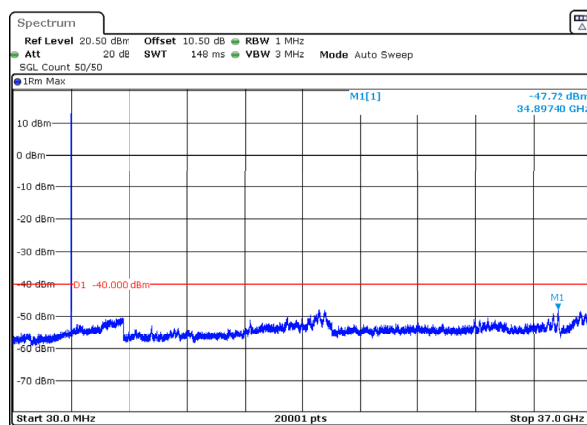


n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB24@0 -48.32dBm

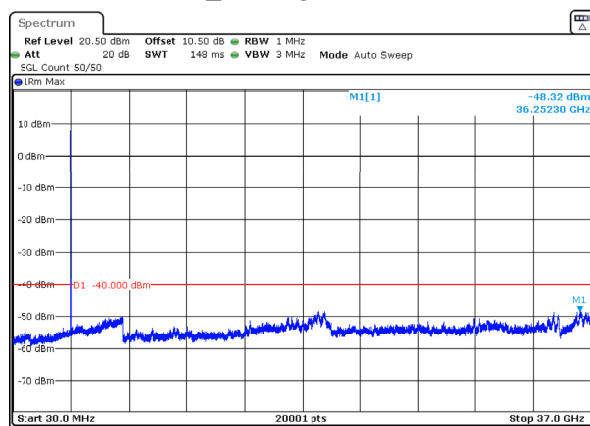


n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0 -47.66dBm

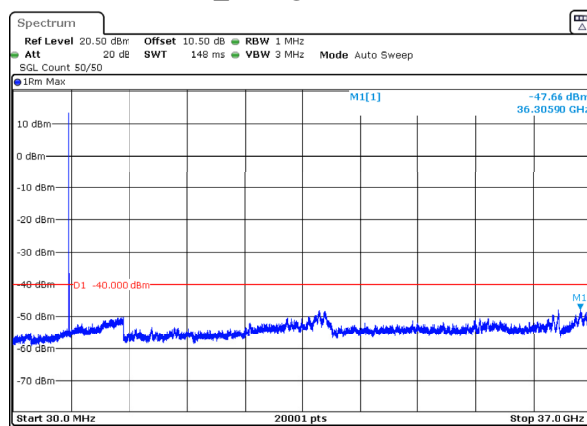


n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@37 -47.64dBm

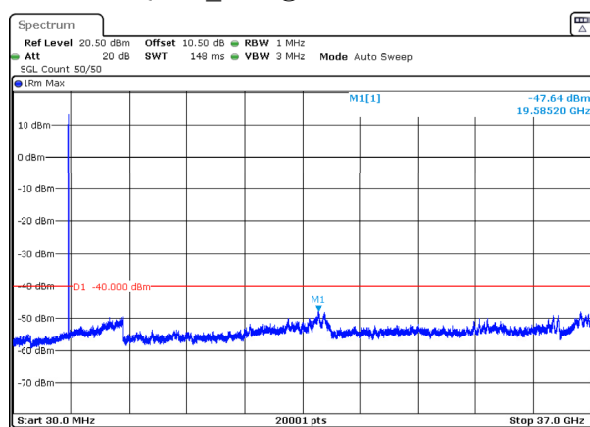

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0 -47.88dBm

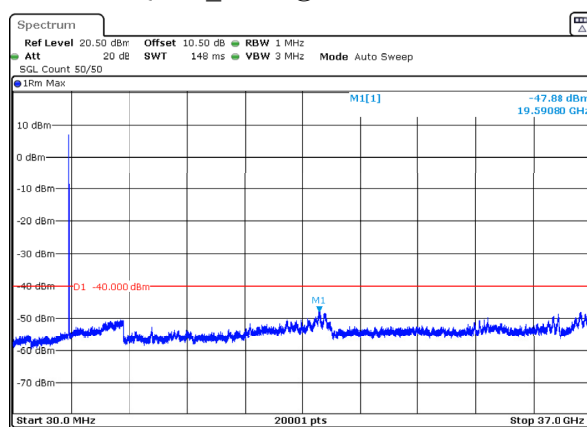


n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.61dBm

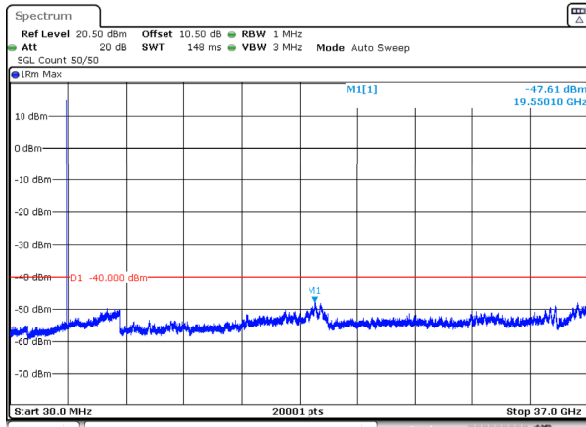


ProjectNo.:2401Z104805E-RF Testset:Rungfunaster Liang
Date: 7.DEC.2024 15:35:37

n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@37 -47.92dBm

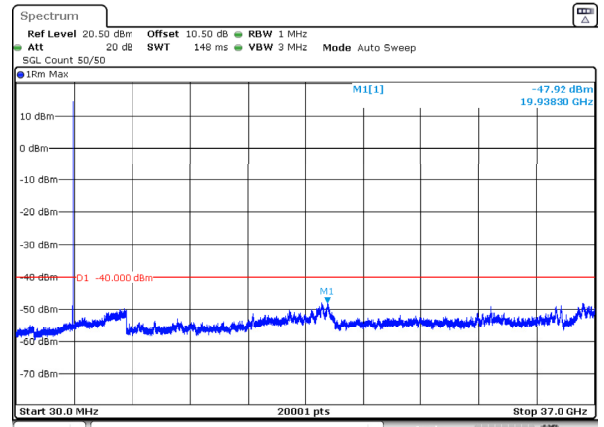


ProjectNo.:2401Z104805E-RF Testset:Rungfunaster Liang
Date: 7.DEC.2024 15:36:42

n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB36@0 -46.95dBm

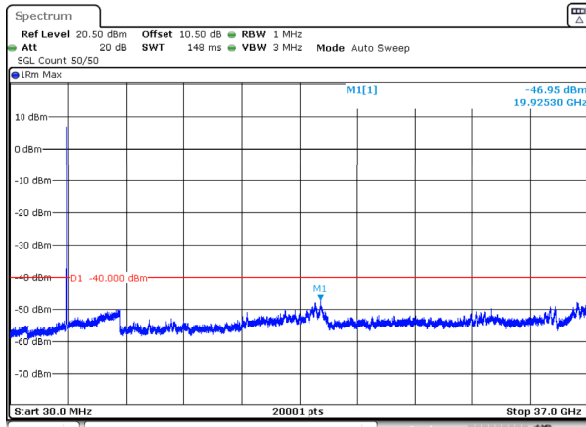


ProjectNo.:2401Z104805E-RF Testset:Rungfunaster Liang
Date: 7.DEC.2024 15:37:45

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@0 -47.45dBm

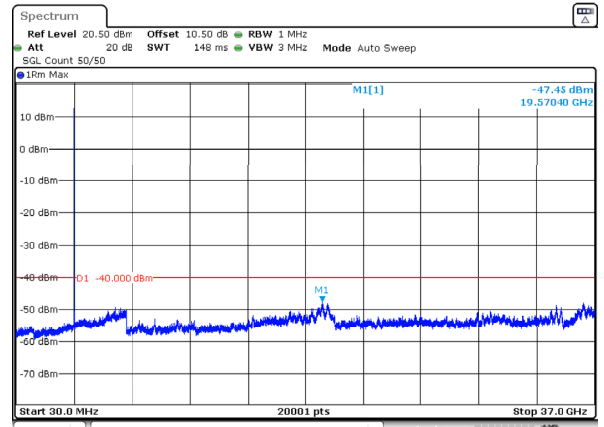


ProjectNo.:2401Z104805E-RF Testset:Rungfunaster Liang
Date: 7.DEC.2024 15:38:56

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@37 -47.77dBm

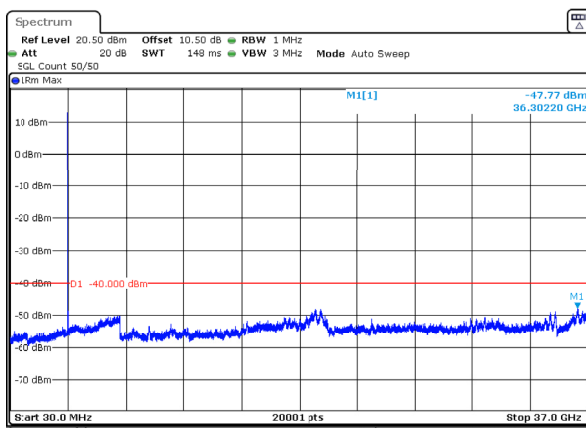


ProjectNo.:2401Z104805E-RF Testset:Rungfunaster Liang
Date: 7.DEC.2024 15:40:02

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB36@0 -47.74dBm

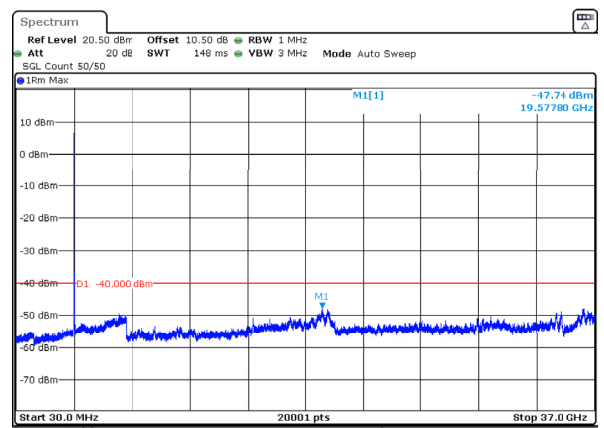


ProjectNo.:2401Z104805E-RF Testset:Rungfunaster Liang
Date: 7.DEC.2024 15:41:06

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@0 -47.33dBm

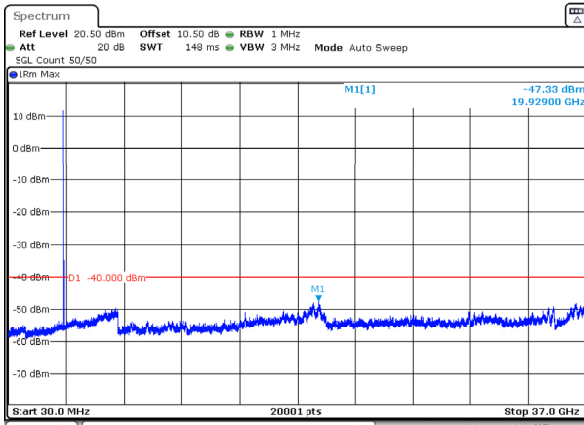


ProjectNo.:2401Z104805E-RF Testert:Rungfunaster Liang
Date: 7.DEC.2024 15:58:13

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@50 -47.62dBm

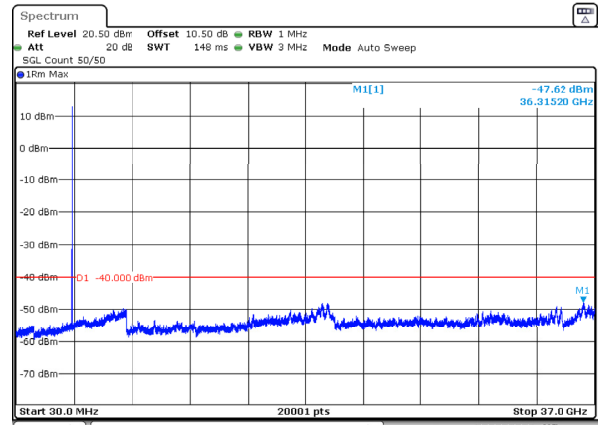


ProjectNo.:2401Z104805E-RF Testert:Rungfunaster Liang
Date: 7.DEC.2024 15:59:18

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB50@0 -47.83dBm

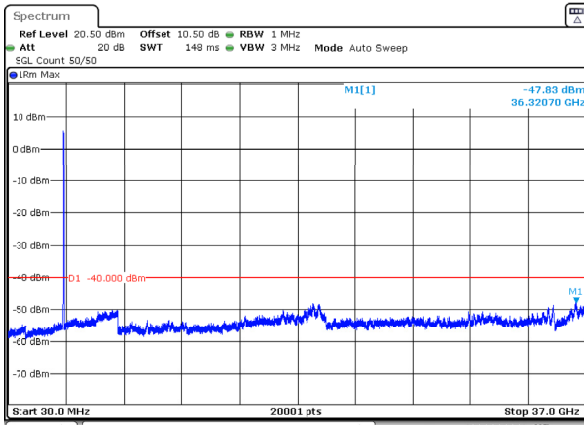


ProjectNo.:2401Z104805E-RF Testert:Rungfunaster Liang
Date: 7.DEC.2024 16:00:22

n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.91dBm

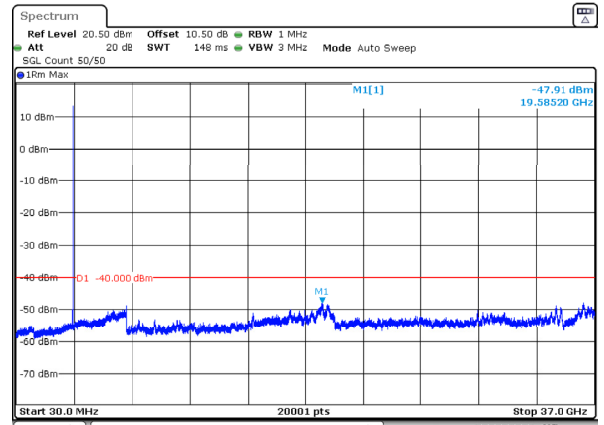


ProjectNo.:2401Z104805E-RF Testert:Rungfunaster Liang
Date: 7.DEC.2024 16:01:33

n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@50 -47.53dBm

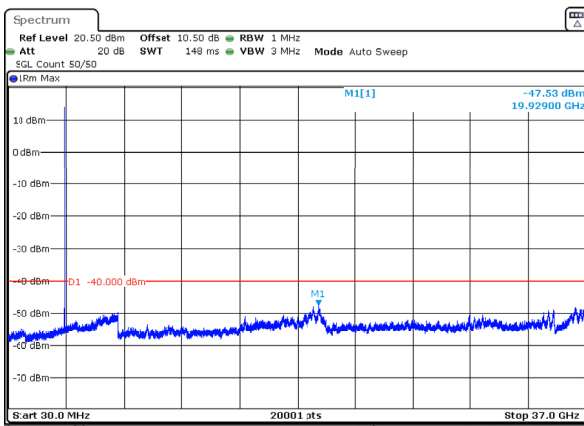


ProjectNo.:2401Z104805E-RF Testert:Rungfunaster Liang
Date: 7.DEC.2024 16:02:38

n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB50@0 -47.77dBm

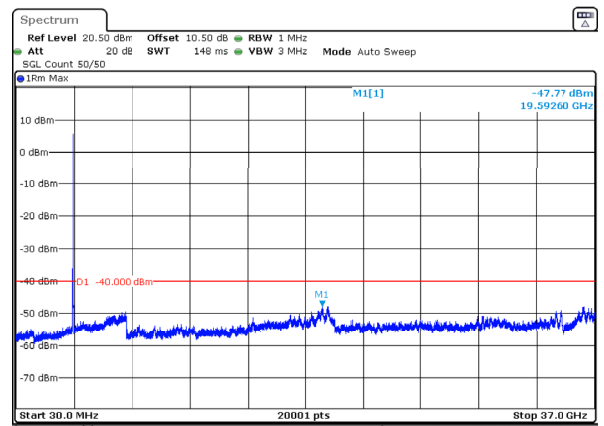


ProjectNo.:2401Z104805E-RF Testert:Rungfunaster Liang
Date: 7.DEC.2024 16:03:43


n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@0 -47.51dBm

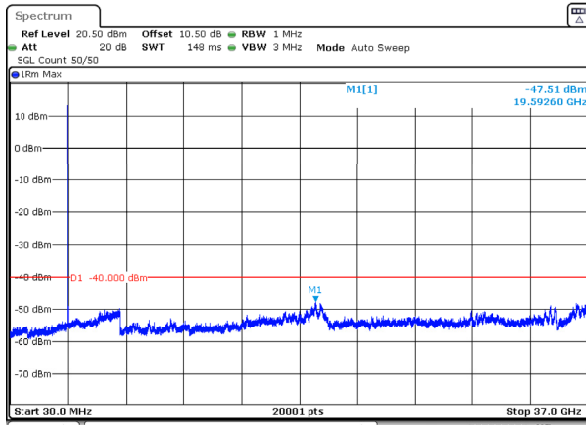


n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@50 -47.75dBm

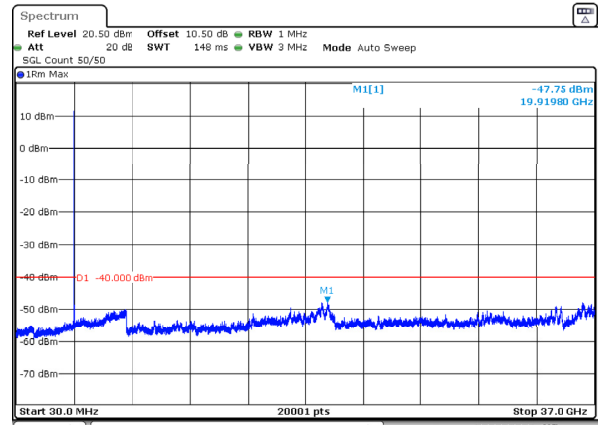


n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB50@0 -47.86dBm

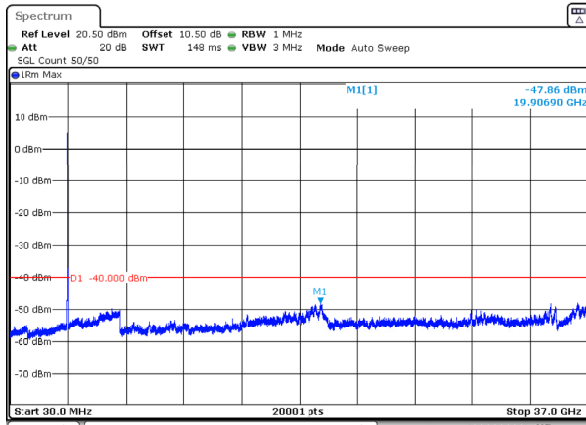


n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@0 -47.76dBm

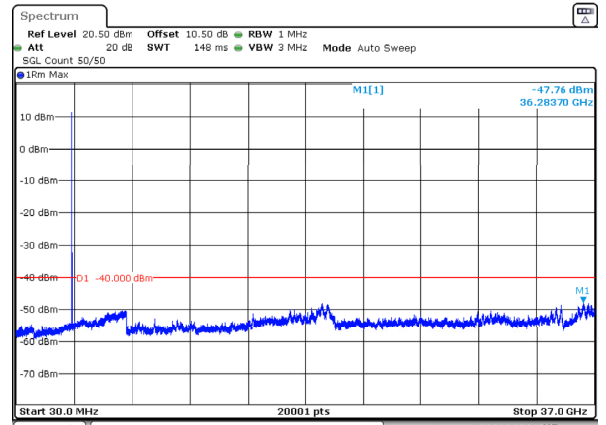


n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@77 -47.67dBm

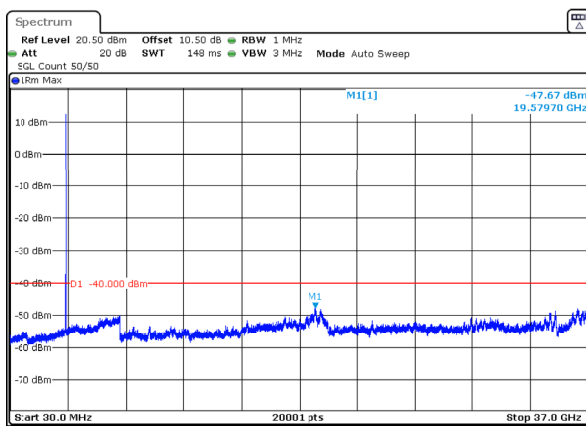


n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB75@0 -47.51dBm

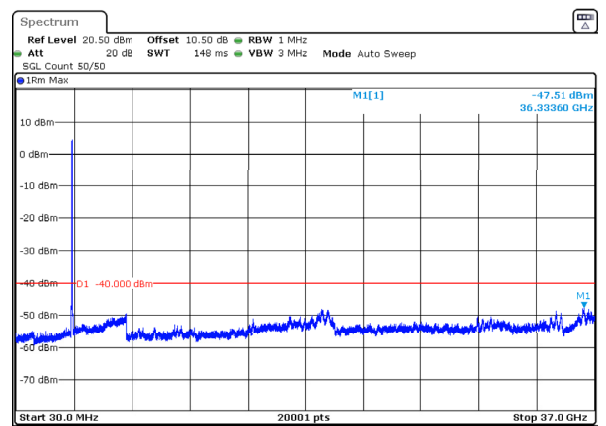


n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.60dBm

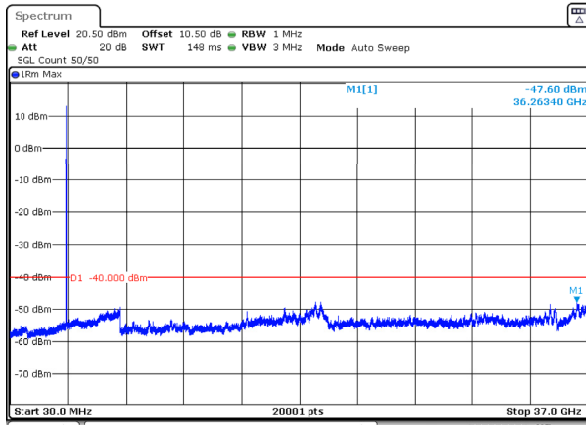


n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@77 -47.50dBm

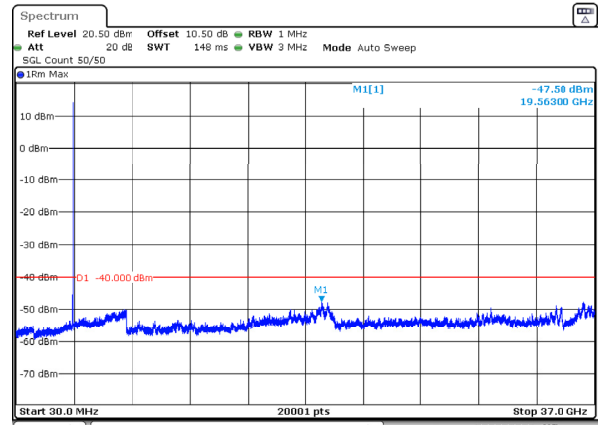


n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB75@0 -48.08dBm

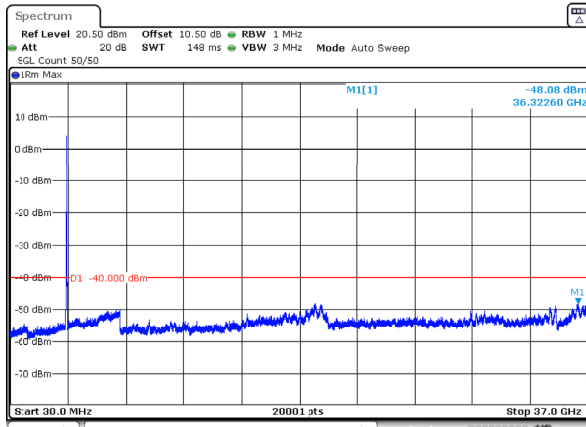


n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@0 -47.58dBm

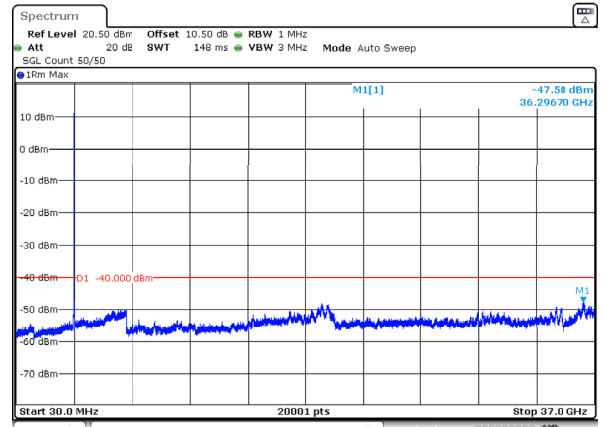


n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@77 -47.41dBm

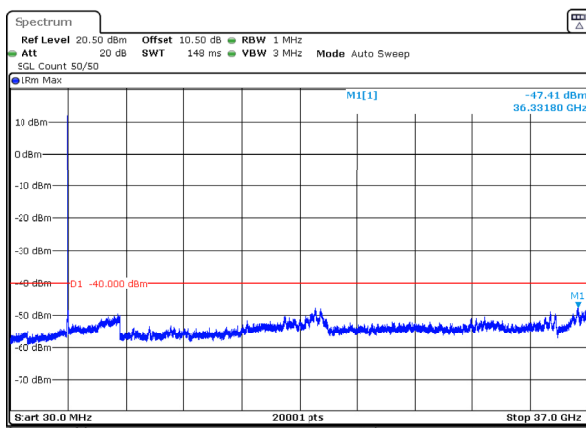


n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB75@0 -47.77dBm

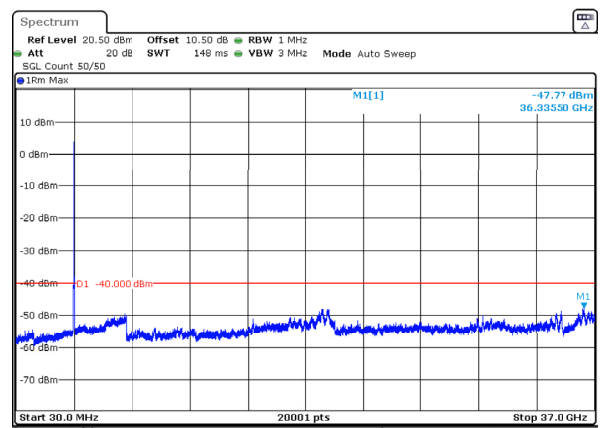


n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB100@0 -47.66dBm

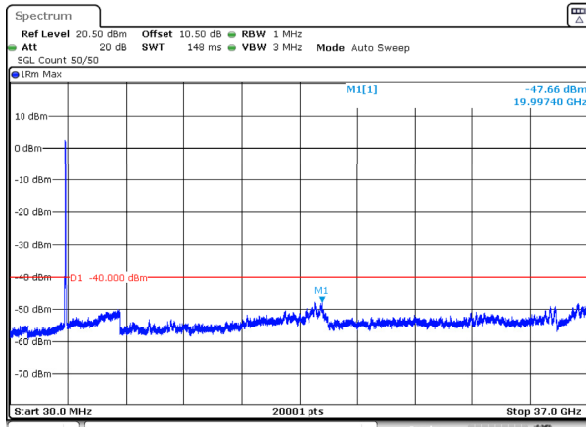


n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@0 -47.74dBm

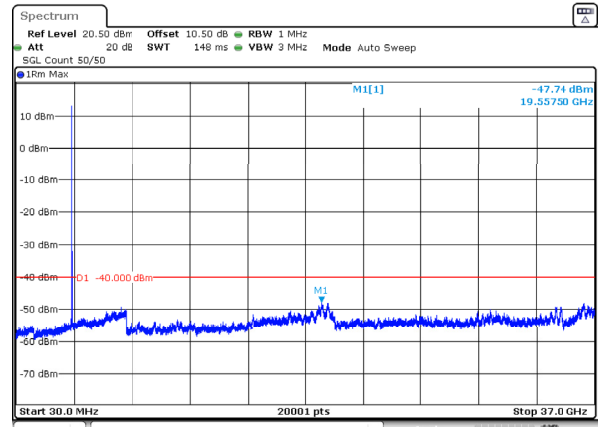


n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@105 -47.52dBm

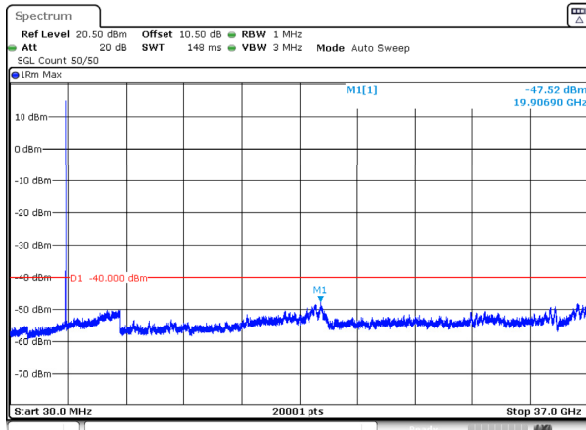


n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB100@0 -47.45dBm

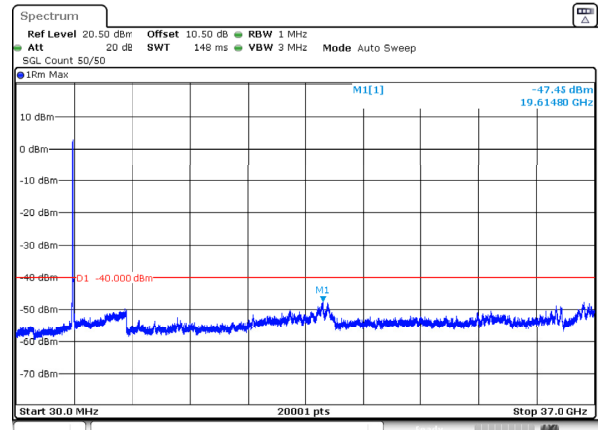


n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.44dBm

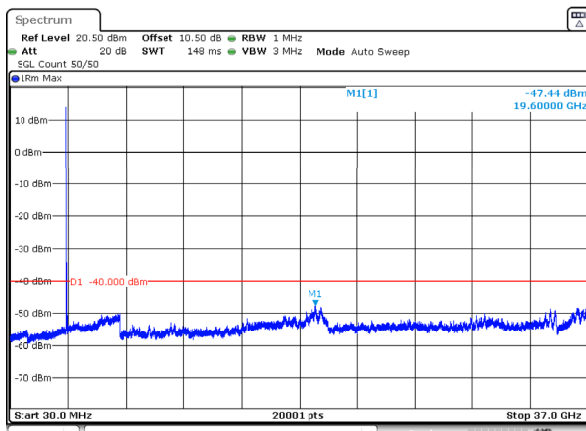

n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@105 -47.84dBm

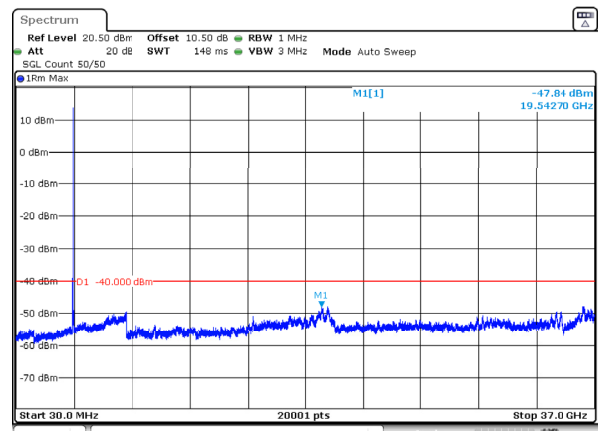


n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB100@0 -47.51dBm

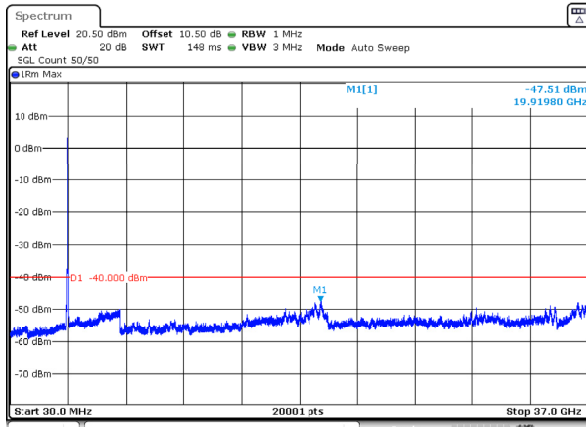


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:08:55

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@0 -47.24dBm

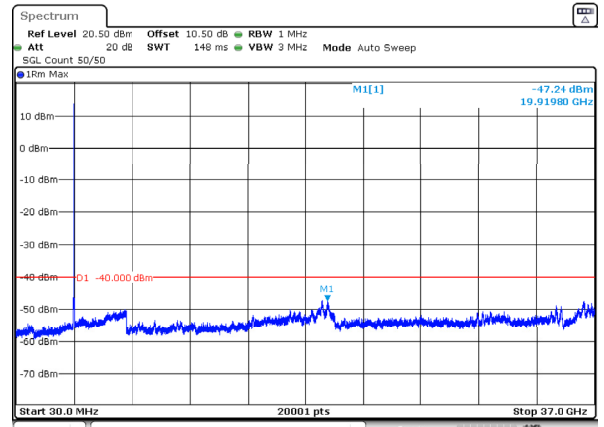


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:07:08

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@105 -47.65dBm

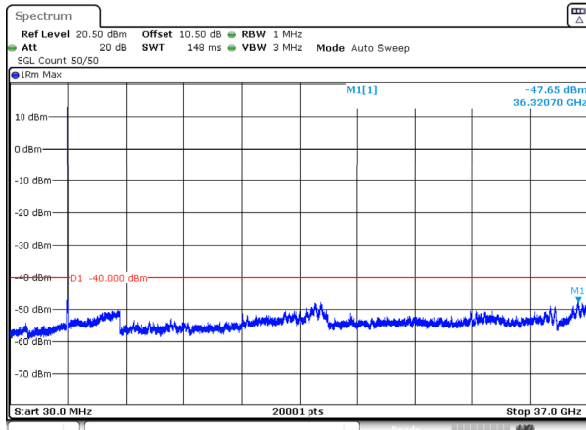


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:08:03

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0 -47.35dBm

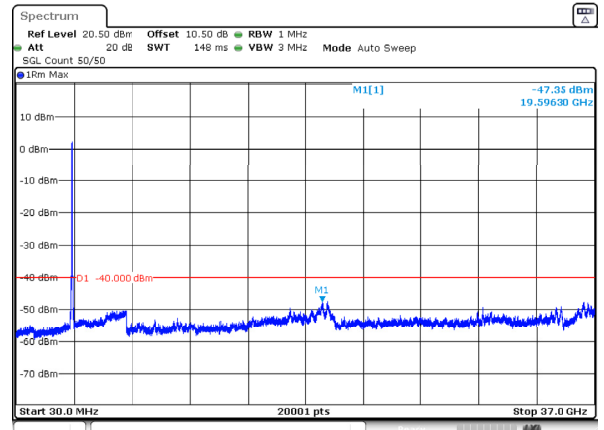


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:11:46

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@0 -47.78dBm

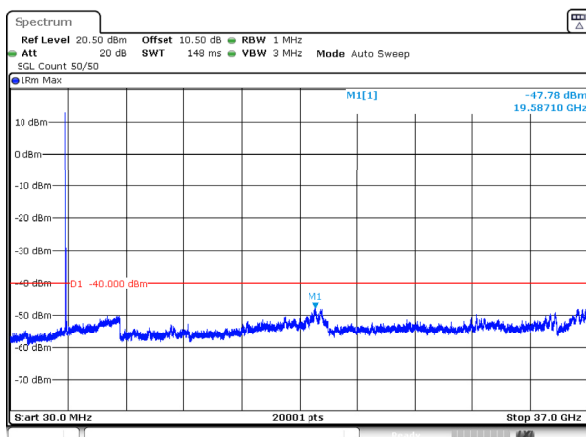


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:09:59

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@132 -46.91dBm

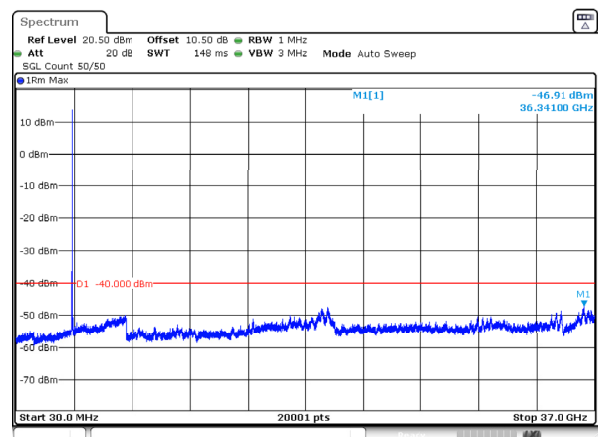


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:10:53

n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB128@0 -47.59dBm

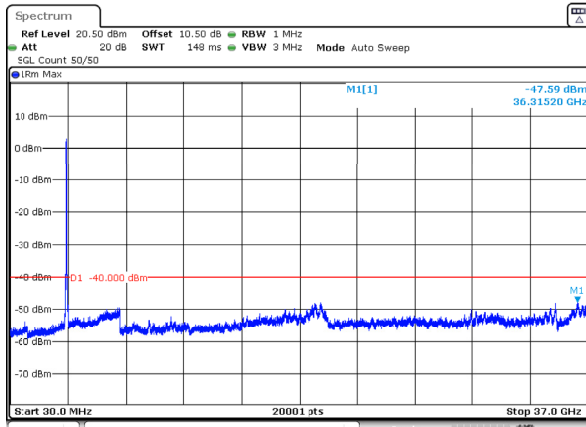


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:14:32

n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -46.96dBm

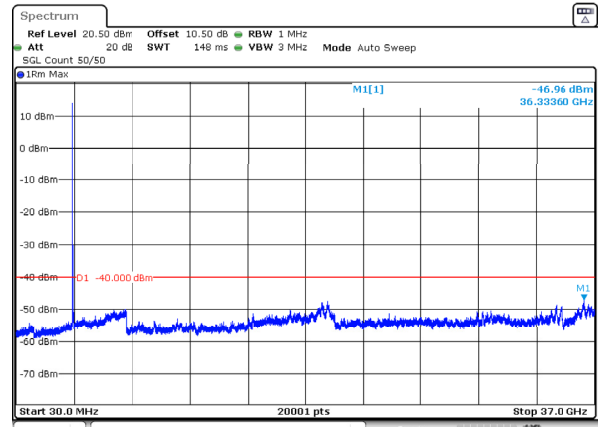


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:12:46

n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@132 -47.48dBm

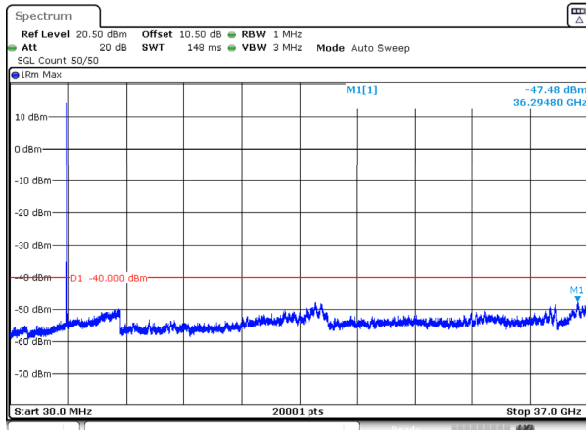


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:13:39

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0 -47.78dBm

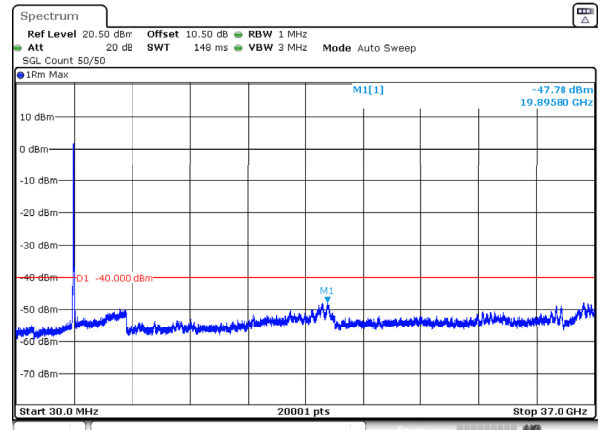


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:17:20

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@0 -47.56dBm

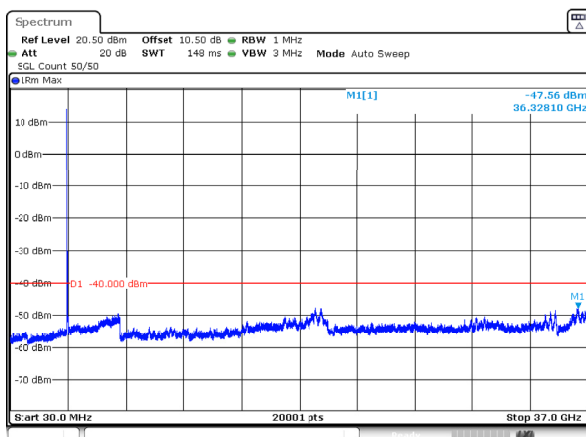


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:15:33

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132 -47.46dBm

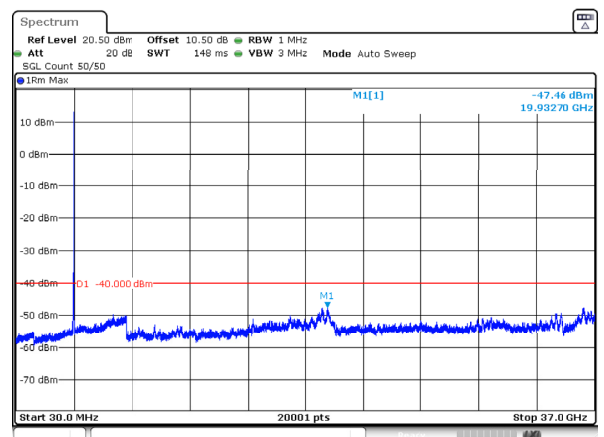


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:16:28

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0 -47.36dBm

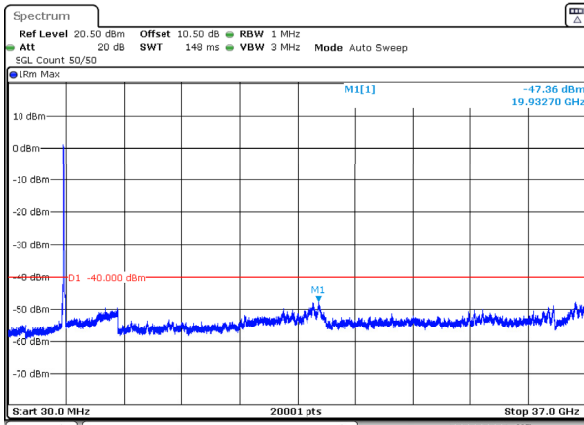


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:20:12

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@0 -47.17dBm

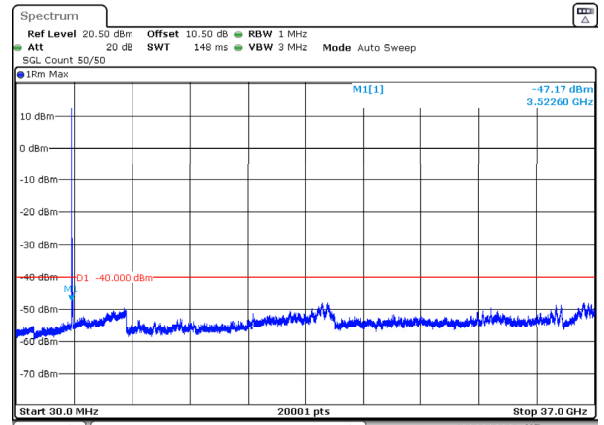


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:18:24

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@161 -47.57dBm

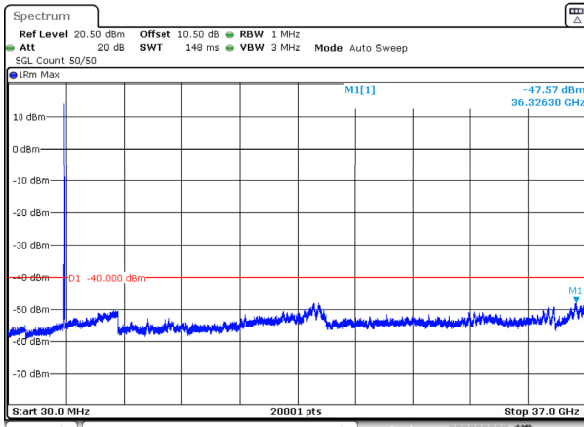


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:19:19

n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB162@0 -46.67dBm

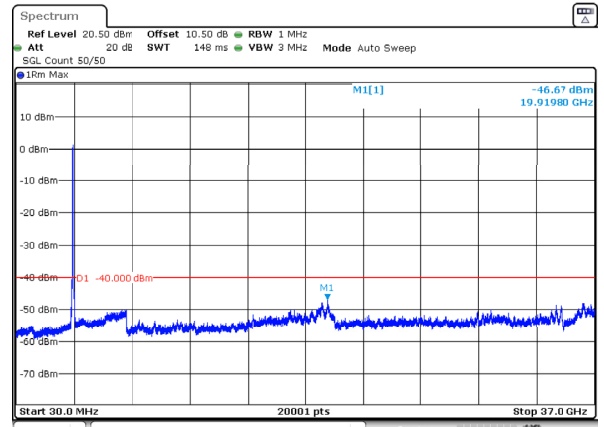


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:23:00

n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -45.29dBm

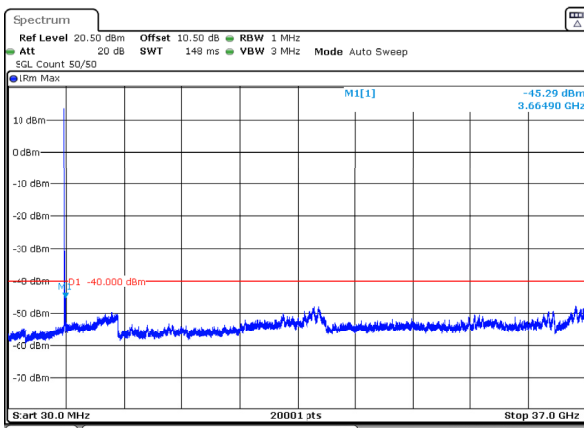


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:21:12

n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@161 -47.58dBm

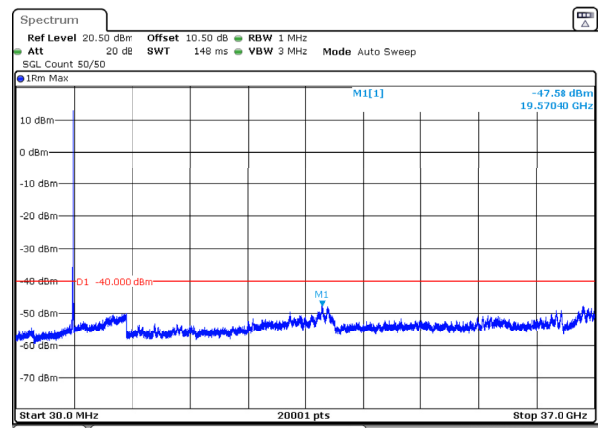


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:22:07

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB162@0 -47.67dBm

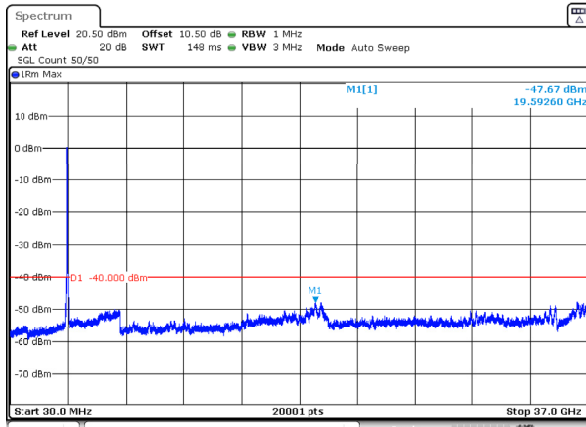


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:25:47

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@0 -47.65dBm

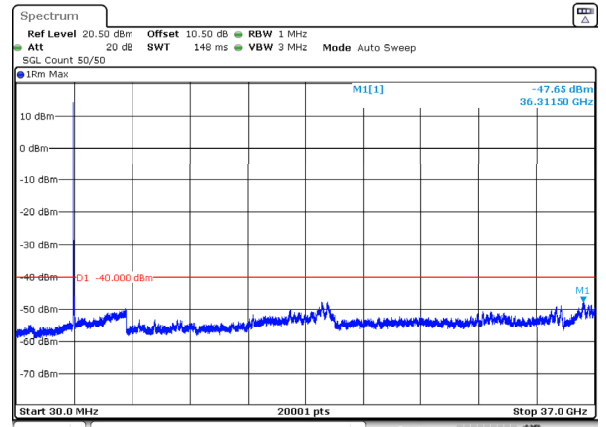


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:23:59

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@161 -47.12dBm

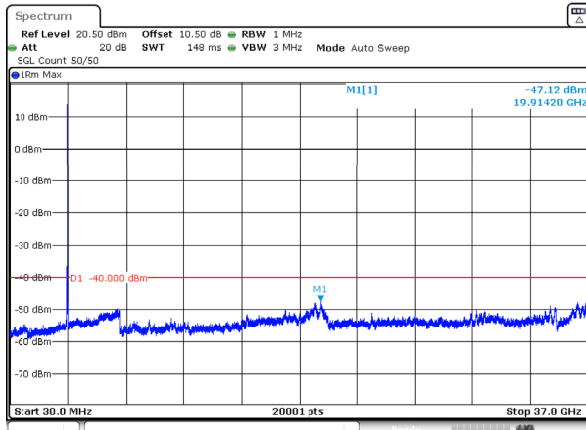


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:24:54

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB180@0 -44.70dBm

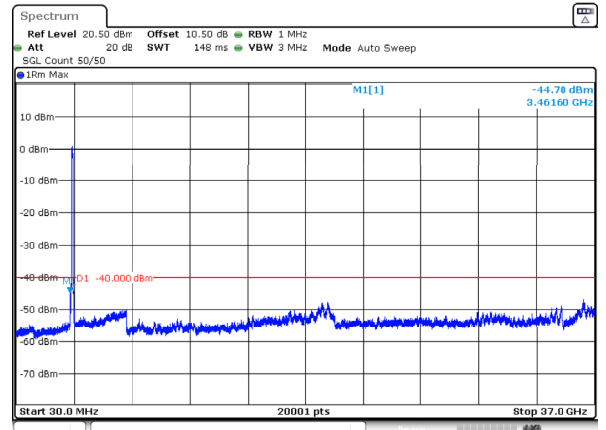


ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:28:39

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@0 -44.33dBm

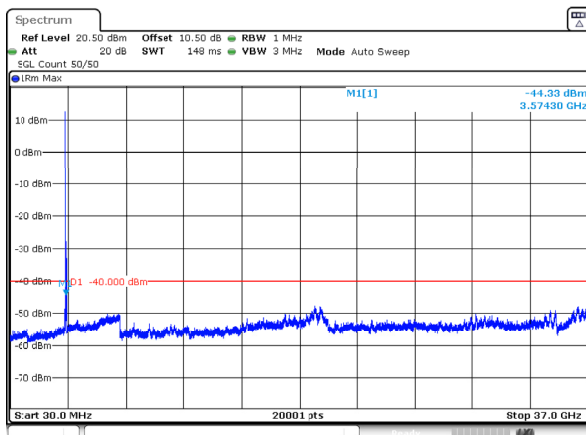

ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:26:50

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@188 -47.76dBm

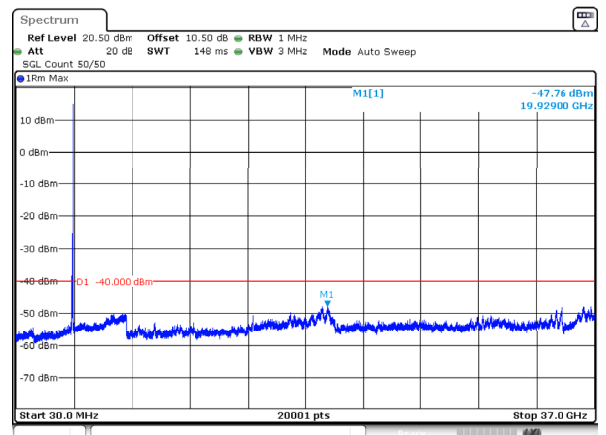

ProjectNo.:2401Z104805E-RF Tester:Kungfumaster Liang
Date: 9.DEC.2024 08:27:45