





Restrict Band NVNT n40 5795MHz Ant3 Peak

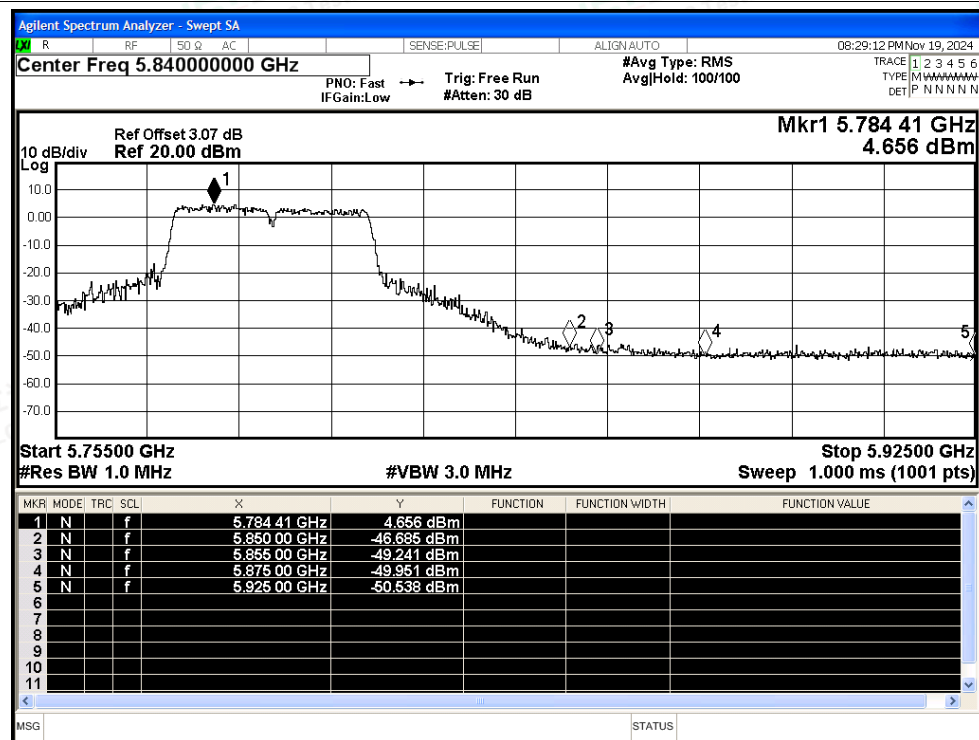


Restrict Band NVNT n40 5795MHz Ant3 Average

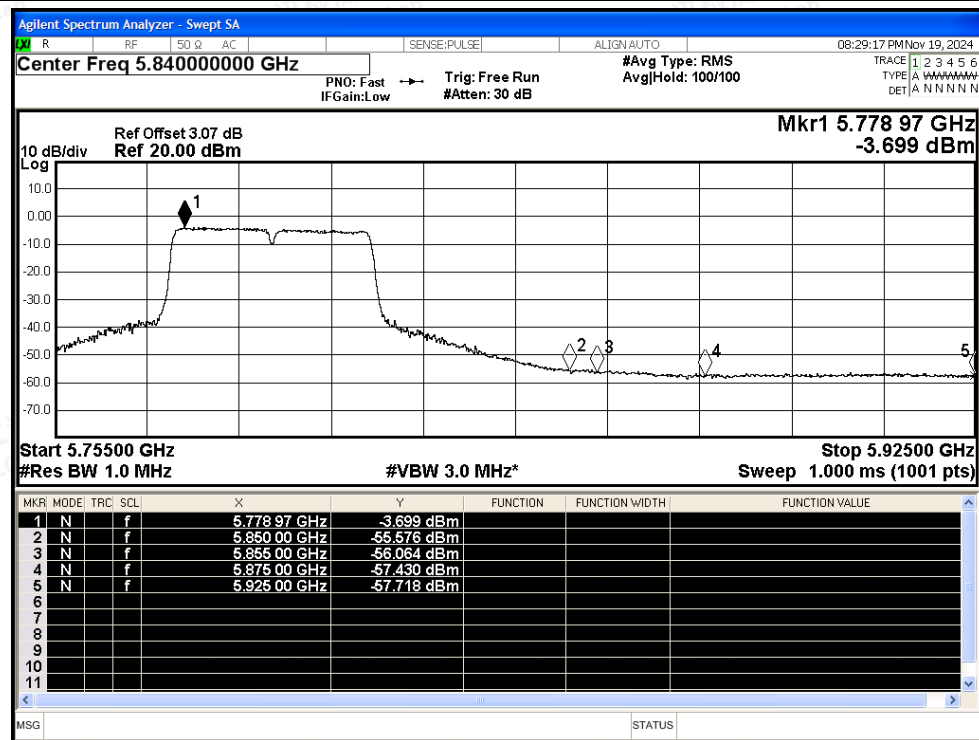


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant3 Peak

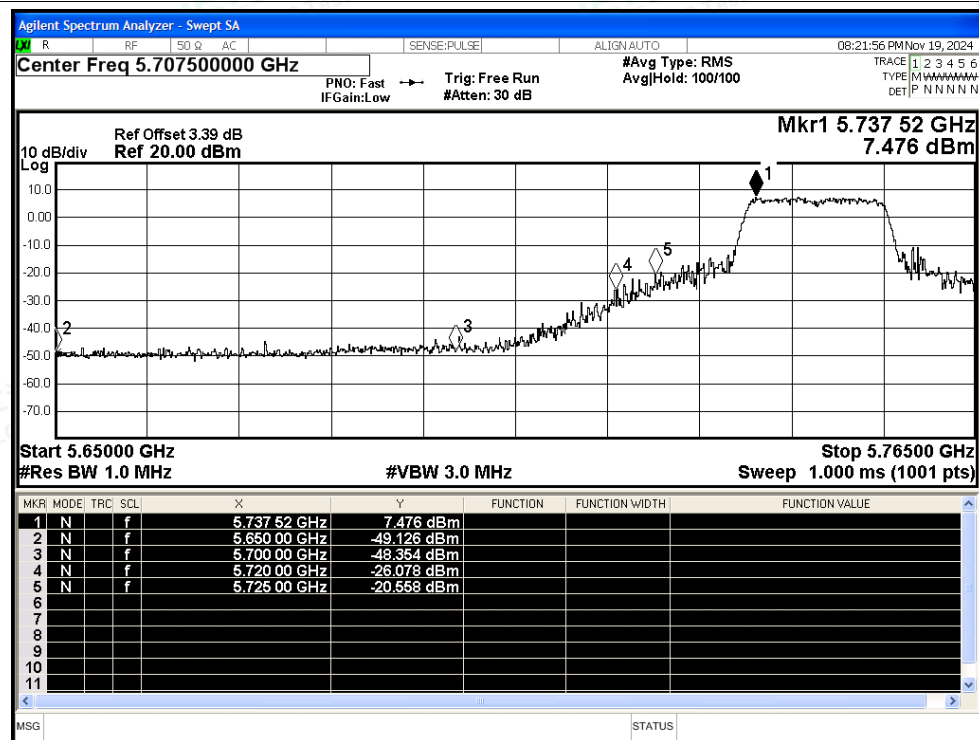


Restrict Band NVNT ac20 5745MHz Ant3 Average

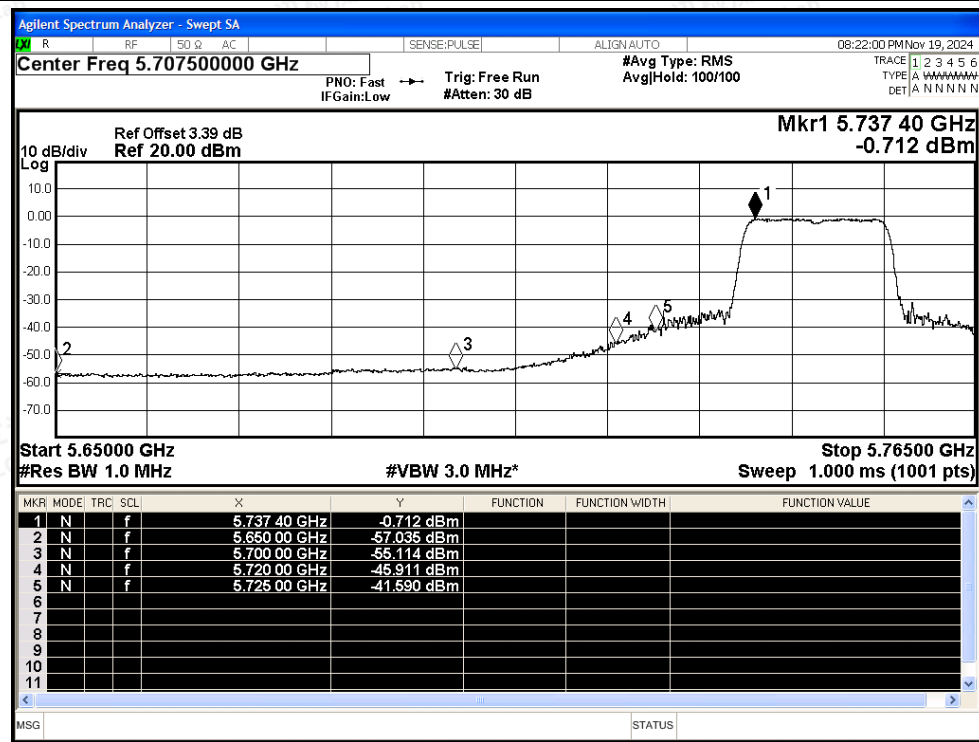


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac20 5825MHz Ant3 Peak

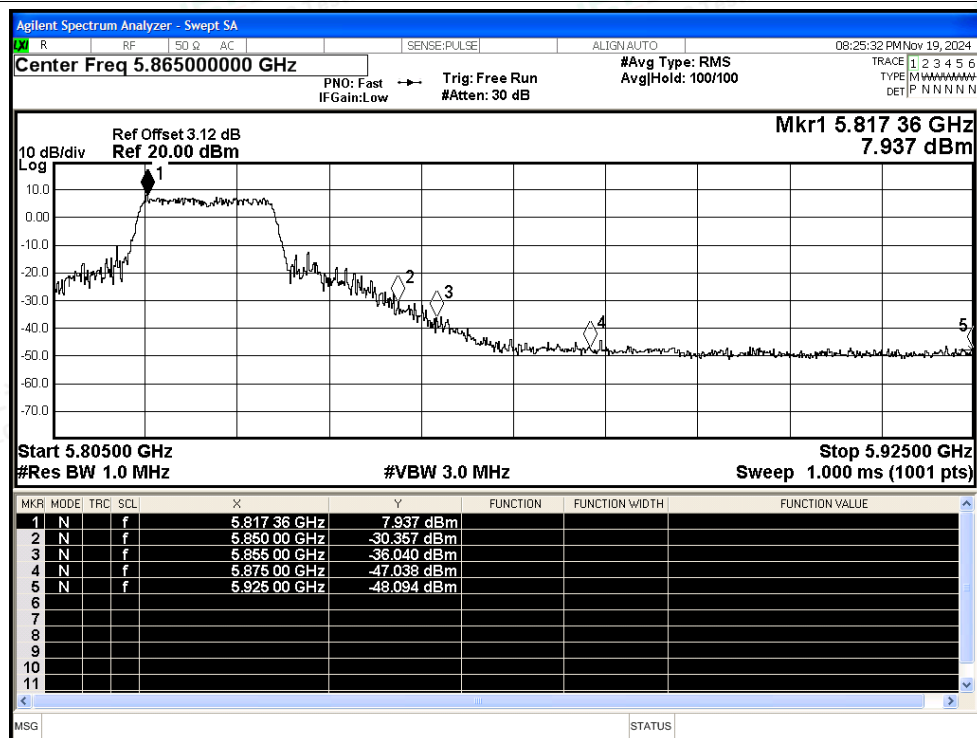


Restrict Band NVNT ac20 5825MHz Ant3 Average

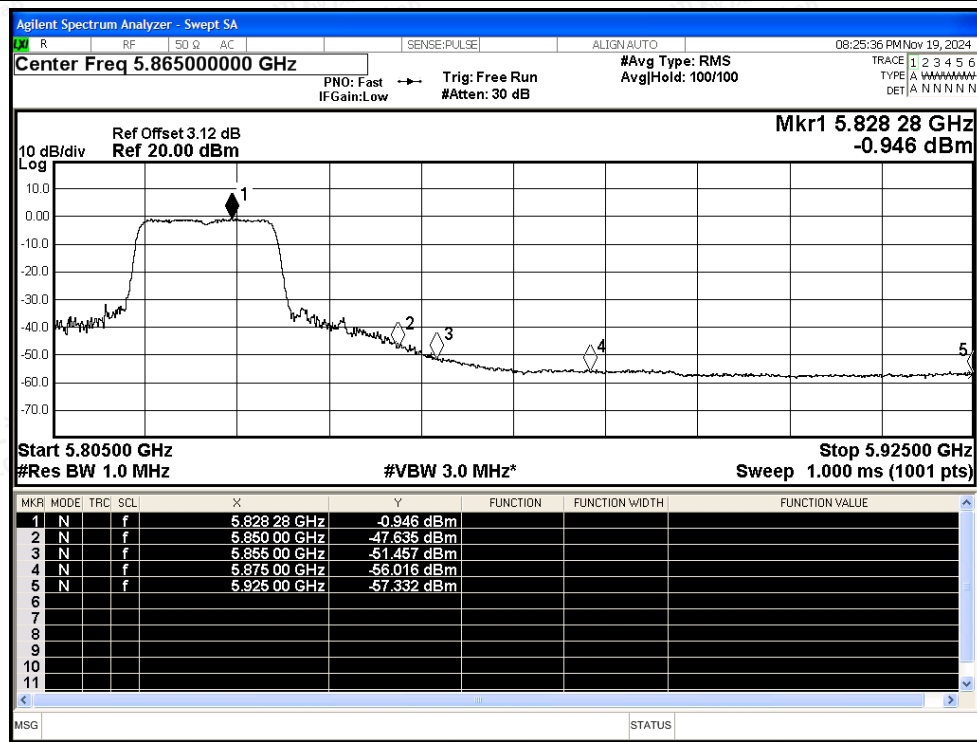


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant3 Peak

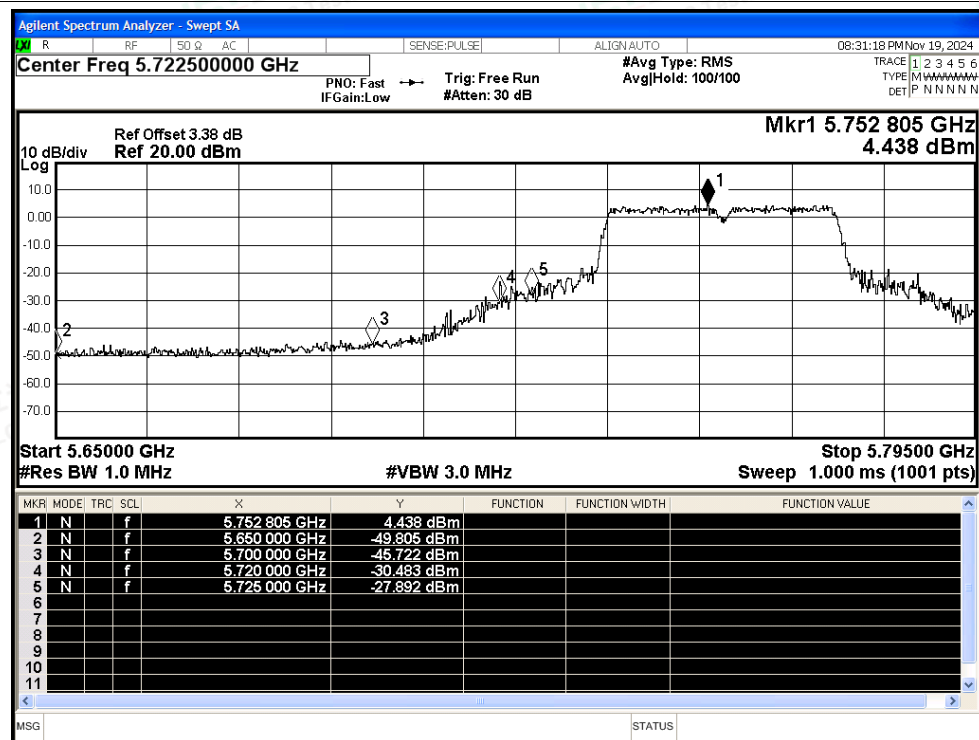


Restrict Band NVNT ac40 5755MHz Ant3 Average

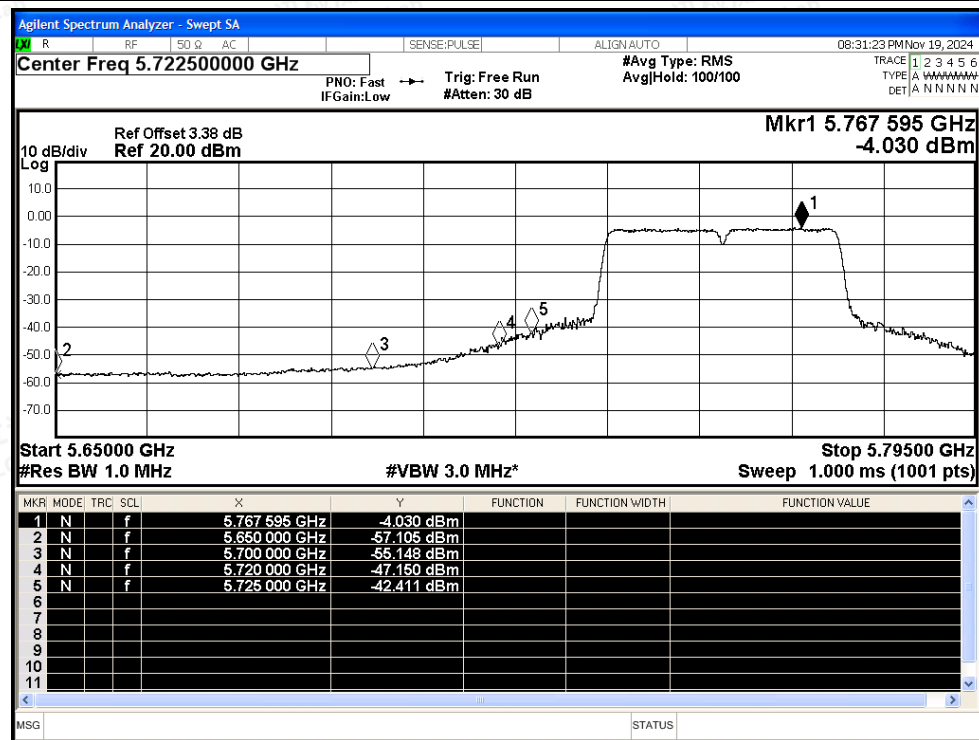


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant3 Peak

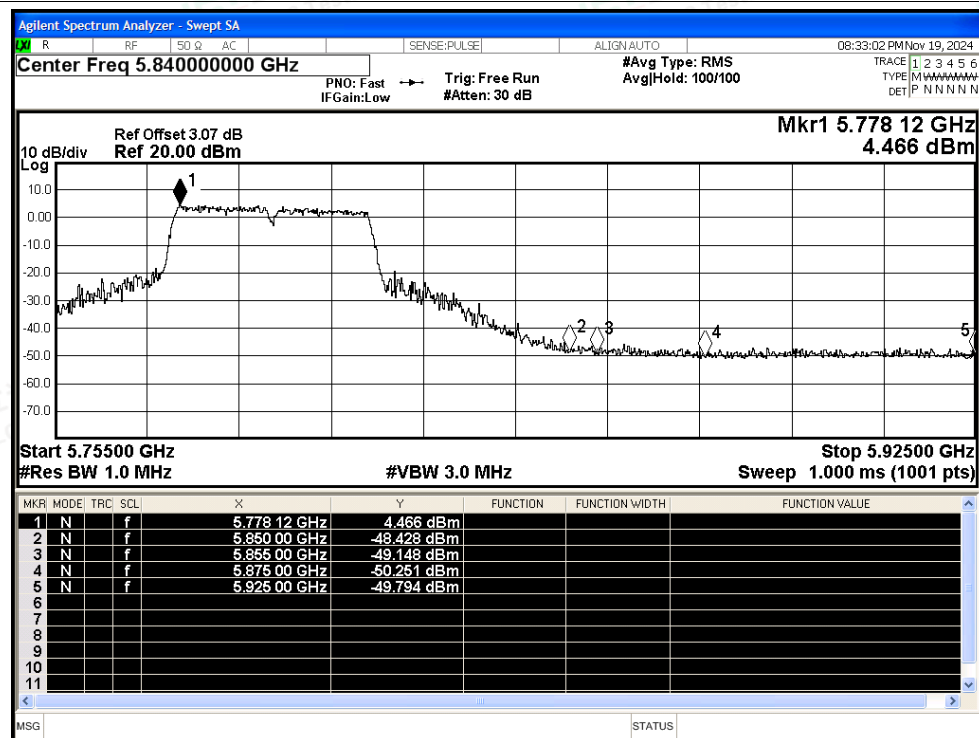


Restrict Band NVNT ac40 5795MHz Ant3 Average

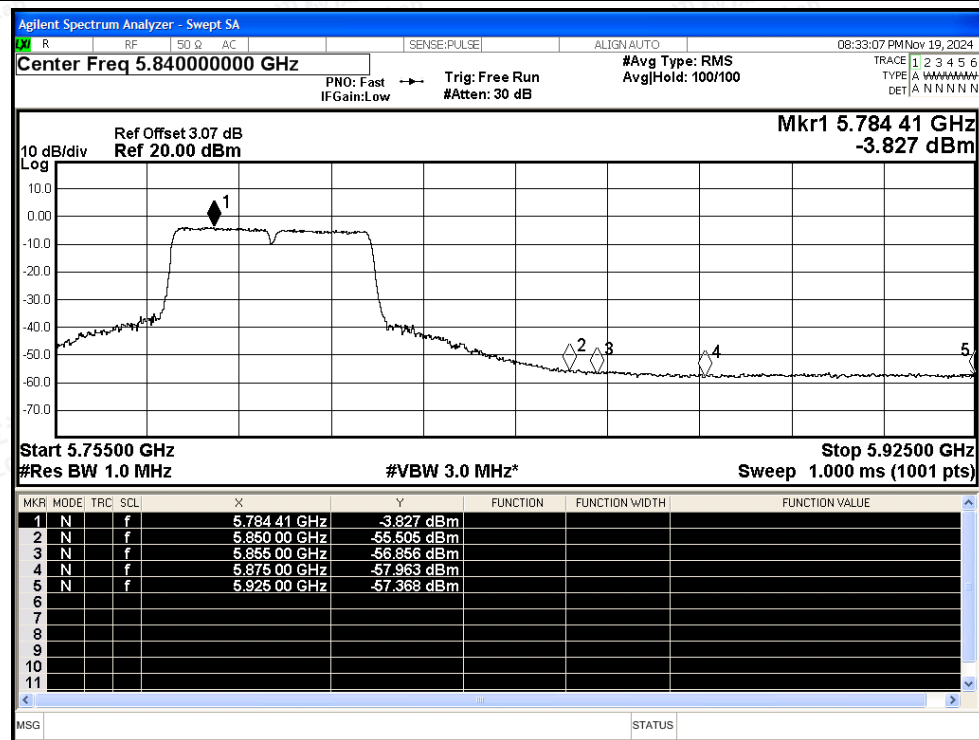


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant3 Peak

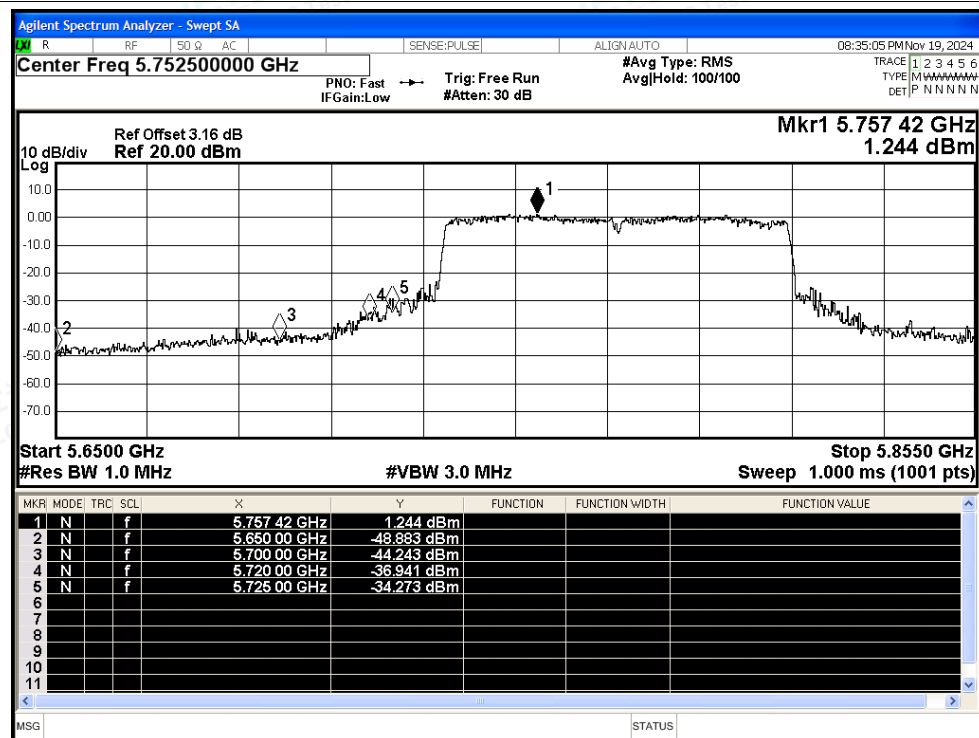


Restrict Band NVNT ac80 5775MHz Ant3 Average

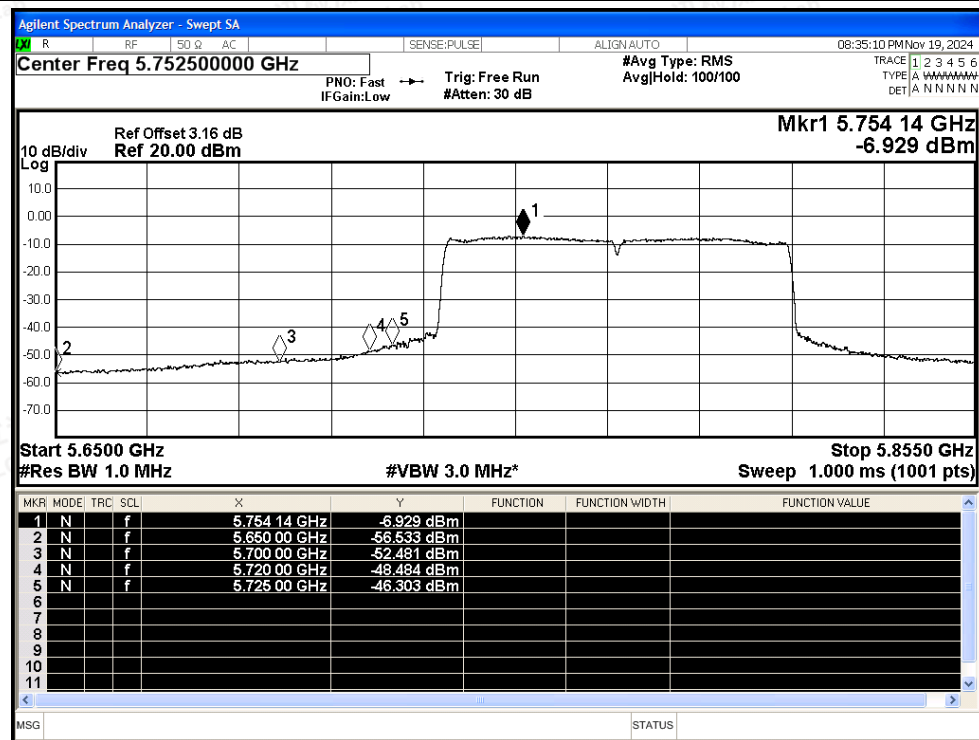


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant3 Peak

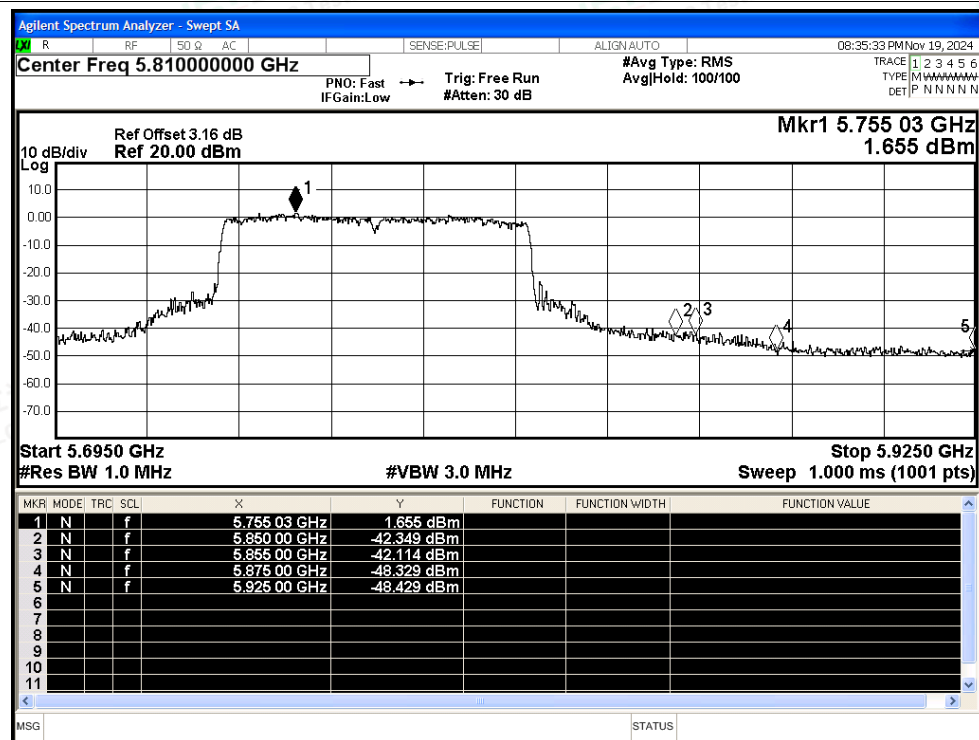

Restrict Band NVNT ac80 5775MHz Ant3 Average

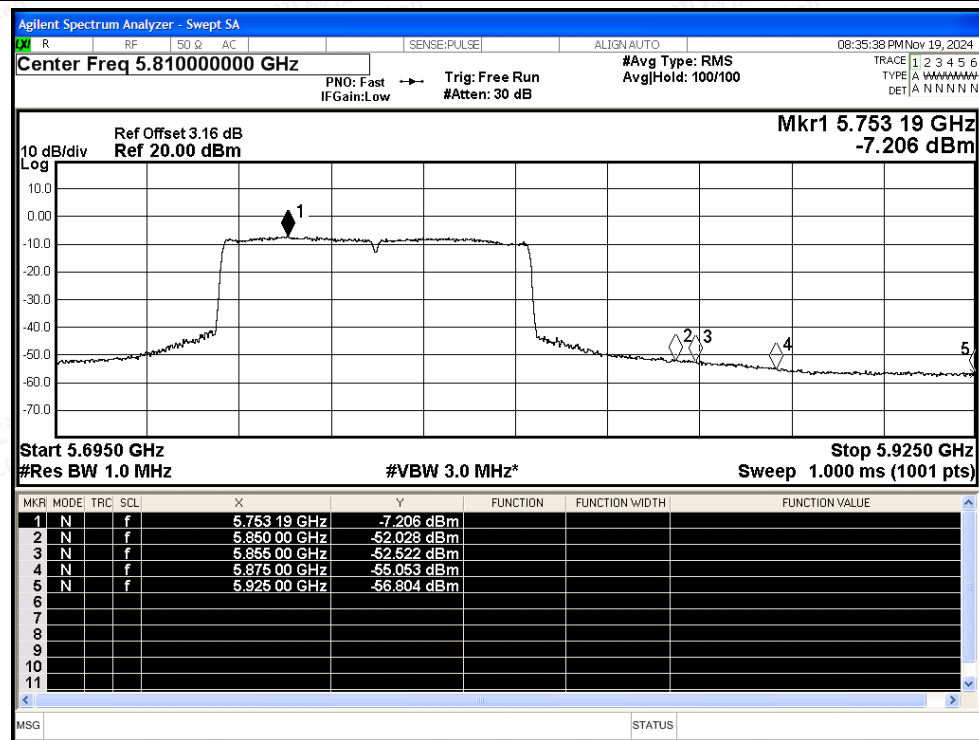



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant4	5650	-49.59	3.96	-	-45.63	Peak	-27	Pass
NVNT	a	5745	Ant4	5650	-57.04	3.96	0.24	-52.84	Average	-27	Pass
NVNT	a	5745	Ant4	5700	-46.65	3.96	-	-42.69	Peak	10	Pass
NVNT	a	5745	Ant4	5700	-55.02	3.96	0.24	-50.82	Average	10	Pass
NVNT	a	5745	Ant4	5720	-32.94	3.96	-	-28.98	Peak	15.6	Pass
NVNT	a	5745	Ant4	5720	-48.57	3.96	0.24	-44.37	Average	15.6	Pass
NVNT	a	5745	Ant4	5725	-24.15	3.96	-	-20.19	Peak	27	Pass
NVNT	a	5745	Ant4	5725	-44.77	3.96	0.24	-40.57	Average	27	Pass
NVNT	a	5825	Ant4	5850	-35.77	3.96	-	-31.81	Peak	27	Pass
NVNT	a	5825	Ant4	5850	-49.29	3.96	0.24	-45.09	Average	27	Pass
NVNT	a	5825	Ant4	5855	-41.42	3.96	-	-37.46	Peak	15.6	Pass
NVNT	a	5825	Ant4	5855	-52.61	3.96	0.24	-48.41	Average	15.6	Pass
NVNT	a	5825	Ant4	5875	-48.28	3.96	-	-44.32	Peak	10	Pass
NVNT	a	5825	Ant4	5875	-55.59	3.96	0.24	-51.39	Average	10	Pass
NVNT	a	5825	Ant4	5925	-48.59	3.96	-	-44.63	Peak	-27	Pass
NVNT	a	5825	Ant4	5925	-57.13	3.96	0.24	-52.93	Average	-27	Pass
NVNT	n20	5745	Ant4	5650	-49.05	3.96	-	-45.09	Peak	-27	Pass
NVNT	n20	5745	Ant4	5650	-56.99	3.96	0.12	-52.91	Average	-27	Pass
NVNT	n20	5745	Ant4	5700	-46.69	3.96	-	-42.73	Peak	10	Pass
NVNT	n20	5745	Ant4	5700	-55.4	3.96	0.12	-51.32	Average	10	Pass
NVNT	n20	5745	Ant4	5720	-32.07	3.96	-	-28.11	Peak	15.6	Pass
NVNT	n20	5745	Ant4	5720	-46.92	3.96	0.12	-42.84	Average	15.6	Pass
NVNT	n20	5745	Ant4	5725	-25.29	3.96	-	-21.33	Peak	27	Pass
NVNT	n20	5745	Ant4	5725	-42.01	3.96	0.12	-37.93	Average	27	Pass
NVNT	n20	5825	Ant4	5850	-33.51	3.96	-	-29.55	Peak	27	Pass
NVNT	n20	5825	Ant4	5850	-47.45	3.96	0.12	-43.37	Average	27	Pass
NVNT	n20	5825	Ant4	5855	-38.67	3.96	-	-34.71	Peak	15.6	Pass
NVNT	n20	5825	Ant4	5855	-52.67	3.96	0.12	-48.59	Average	15.6	Pass
NVNT	n20	5825	Ant4	5875	-47.42	3.96	-	-43.46	Peak	10	Pass
NVNT	n20	5825	Ant4	5875	-55.74	3.96	0.12	-51.66	Average	10	Pass
NVNT	n20	5825	Ant4	5925	-49.42	3.96	-	-45.46	Peak	-27	Pass
NVNT	n20	5825	Ant4	5925	-57.15	3.96	0.12	-53.07	Average	-27	Pass
NVNT	n40	5755	Ant4	5650	-49.78	3.96	-	-45.82	Peak	-27	Pass
NVNT	n40	5755	Ant4	5650	-56.97	3.96	0.24	-52.77	Average	-27	Pass
NVNT	n40	5755	Ant4	5700	-47.8	3.96	-	-43.84	Peak	10	Pass
NVNT	n40	5755	Ant4	5700	-55.27	3.96	0.24	-51.07	Average	10	Pass
NVNT	n40	5755	Ant4	5720	-34.63	3.96	-	-30.67	Peak	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	n40	5755	Ant4	5720	-46.7	3.96	0.24	-42.50	Average	15.6	Pass
NVNT	n40	5755	Ant4	5725	-29.61	3.96	-	-25.65	Peak	27	Pass
NVNT	n40	5755	Ant4	5725	-41.15	3.96	0.24	-36.95	Average	27	Pass
NVNT	n40	5795	Ant4	5850	-48.67	3.96	-	-44.71	Peak	27	Pass
NVNT	n40	5795	Ant4	5850	-56.14	3.96	0.23	-51.95	Average	27	Pass
NVNT	n40	5795	Ant4	5855	-48.32	3.96	-	-44.36	Peak	15.6	Pass
NVNT	n40	5795	Ant4	5855	-56.48	3.96	0.23	-52.29	Average	15.6	Pass
NVNT	n40	5795	Ant4	5875	-47.88	3.96	-	-43.92	Peak	10	Pass
NVNT	n40	5795	Ant4	5875	-57.78	3.96	0.23	-53.59	Average	10	Pass
NVNT	n40	5795	Ant4	5925	-49.17	3.96	-	-45.21	Peak	-27	Pass
NVNT	n40	5795	Ant4	5925	-57.61	3.96	0.23	-53.42	Average	-27	Pass
NVNT	ac20	5745	Ant4	5650	-48.61	3.96	-	-44.65	Peak	-27	Pass
NVNT	ac20	5745	Ant4	5650	-57.11	3.96	0.12	-53.03	Average	-27	Pass
NVNT	ac20	5745	Ant4	5700	-47.66	3.96	-	-43.70	Peak	10	Pass
NVNT	ac20	5745	Ant4	5700	-55.91	3.96	0.12	-51.83	Average	10	Pass
NVNT	ac20	5745	Ant4	5720	-33.12	3.96	-	-29.16	Peak	15.6	Pass
NVNT	ac20	5745	Ant4	5720	-44.87	3.96	0.12	-40.79	Average	15.6	Pass
NVNT	ac20	5745	Ant4	5725	-21.66	3.96	-	-17.70	Peak	27	Pass
NVNT	ac20	5745	Ant4	5725	-41.91	3.96	0.12	-37.83	Average	27	Pass
NVNT	ac20	5825	Ant4	5850	-32.51	3.96	-	-28.55	Peak	27	Pass
NVNT	ac20	5825	Ant4	5850	-47.53	3.96	0.12	-43.45	Average	27	Pass
NVNT	ac20	5825	Ant4	5855	-40.24	3.96	-	-36.28	Peak	15.6	Pass
NVNT	ac20	5825	Ant4	5855	-51.06	3.96	0.12	-46.98	Average	15.6	Pass
NVNT	ac20	5825	Ant4	5875	-47.25	3.96	-	-43.29	Peak	10	Pass
NVNT	ac20	5825	Ant4	5875	-56.34	3.96	0.12	-52.26	Average	10	Pass
NVNT	ac20	5825	Ant4	5925	-49.16	3.96	-	-45.20	Peak	-27	Pass
NVNT	ac20	5825	Ant4	5925	-57.23	3.96	0.12	-53.15	Average	-27	Pass
NVNT	ac40	5755	Ant4	5650	-50.07	3.96	-	-46.11	Peak	-27	Pass
NVNT	ac40	5755	Ant4	5650	-57.95	3.96	0.23	-53.76	Average	-27	Pass
NVNT	ac40	5755	Ant4	5700	-45.71	3.96	-	-41.75	Peak	10	Pass
NVNT	ac40	5755	Ant4	5700	-55.3	3.96	0.23	-51.11	Average	10	Pass
NVNT	ac40	5755	Ant4	5720	-31.77	3.96	-	-27.81	Peak	15.6	Pass
NVNT	ac40	5755	Ant4	5720	-46.91	3.96	0.23	-42.72	Average	15.6	Pass
NVNT	ac40	5755	Ant4	5725	-26.98	3.96	-	-23.02	Peak	27	Pass
NVNT	ac40	5755	Ant4	5725	-42.63	3.96	0.23	-38.44	Average	27	Pass
NVNT	ac40	5795	Ant4	5850	-48.42	3.96	-	-44.46	Peak	27	Pass
NVNT	ac40	5795	Ant4	5850	-55.96	3.96	0.24	-51.76	Average	27	Pass
NVNT	ac40	5795	Ant4	5855	-48.03	3.96	-	-44.07	Peak	15.6	Pass
NVNT	ac40	5795	Ant4	5855	-57.15	3.96	0.24	-52.95	Average	15.6	Pass
NVNT	ac40	5795	Ant4	5875	-50.06	3.96	-	-46.10	Peak	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac40	5795	Ant4	5875	-57.98	3.96	0.24	-53.78	Average	10	Pass
NVNT	ac40	5795	Ant4	5925	-49.43	3.96	-	-45.47	Peak	-27	Pass
NVNT	ac40	5795	Ant4	5925	-57.76	3.96	0.24	-53.56	Average	-27	Pass
NVNT	ac80	5775	Ant4	5650	-49.91	3.96	-	-45.95	Peak	-27	Pass
NVNT	ac80	5775	Ant4	5650	-56.97	3.96	0.25	-52.76	Average	-27	Pass
NVNT	ac80	5775	Ant4	5700	-43.02	3.96	-	-39.06	Peak	10	Pass
NVNT	ac80	5775	Ant4	5700	-52.46	3.96	0.25	-48.25	Average	10	Pass
NVNT	ac80	5775	Ant4	5720	-38.76	3.96	-	-34.80	Peak	15.6	Pass
NVNT	ac80	5775	Ant4	5720	-49.62	3.96	0.25	-45.41	Average	15.6	Pass
NVNT	ac80	5775	Ant4	5725	-36.29	3.96	-	-32.33	Peak	27	Pass
NVNT	ac80	5775	Ant4	5725	-47.87	3.96	0.25	-43.66	Average	27	Pass
NVNT	ac80	5775	Ant4	5850	-44.71	3.96	-	-40.75	Peak	27	Pass
NVNT	ac80	5775	Ant4	5850	-53.88	3.96	0.25	-49.67	Average	27	Pass
NVNT	ac80	5775	Ant4	5855	-45.65	3.96	-	-41.69	Peak	15.6	Pass
NVNT	ac80	5775	Ant4	5855	-54.07	3.96	0.25	-49.86	Average	15.6	Pass
NVNT	ac80	5775	Ant4	5875	-45.57	3.96	-	-41.61	Peak	10	Pass
NVNT	ac80	5775	Ant4	5875	-56.85	3.96	0.25	-52.64	Average	10	Pass
NVNT	ac80	5775	Ant4	5925	-48.67	3.96	-	-44.71	Peak	-27	Pass
NVNT	ac80	5775	Ant4	5925	-57.49	3.96	0.25	-53.28	Average	-27	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5745MHz Ant4 Peak

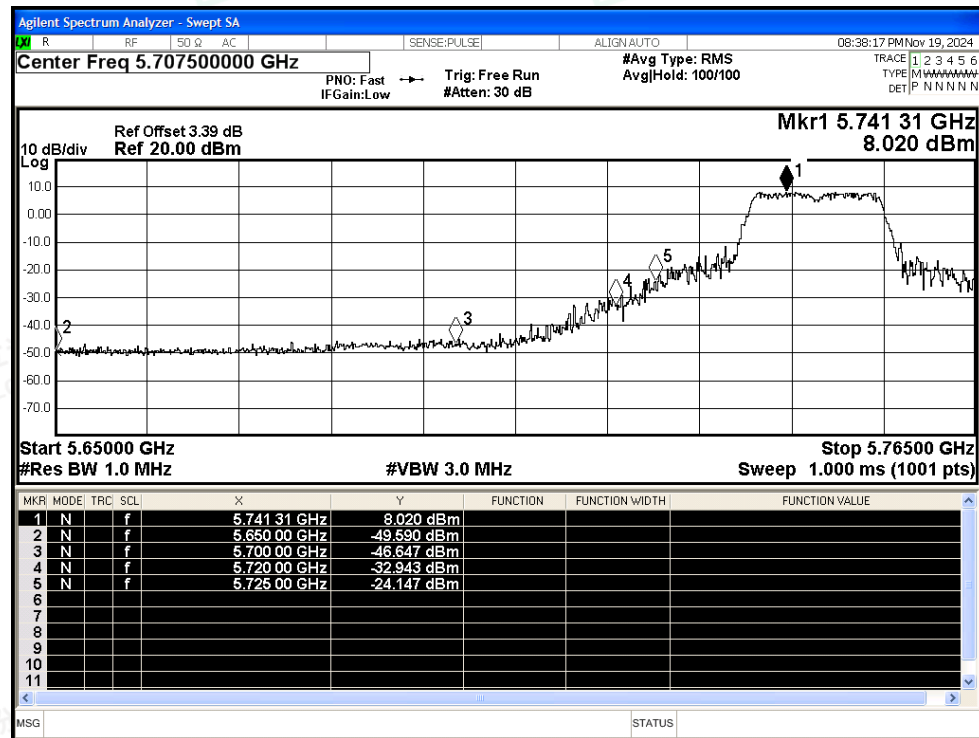


Restrict Band NVNT a 5745MHz Ant4 Average

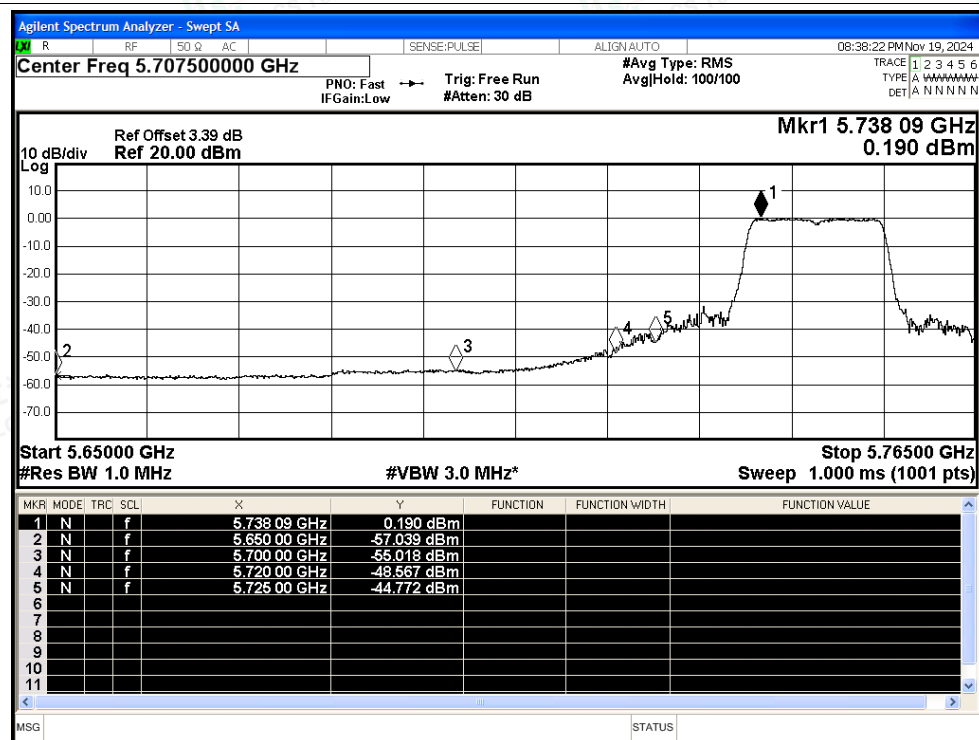




Restrict Band NVNT a 5825MHz Ant4 Peak

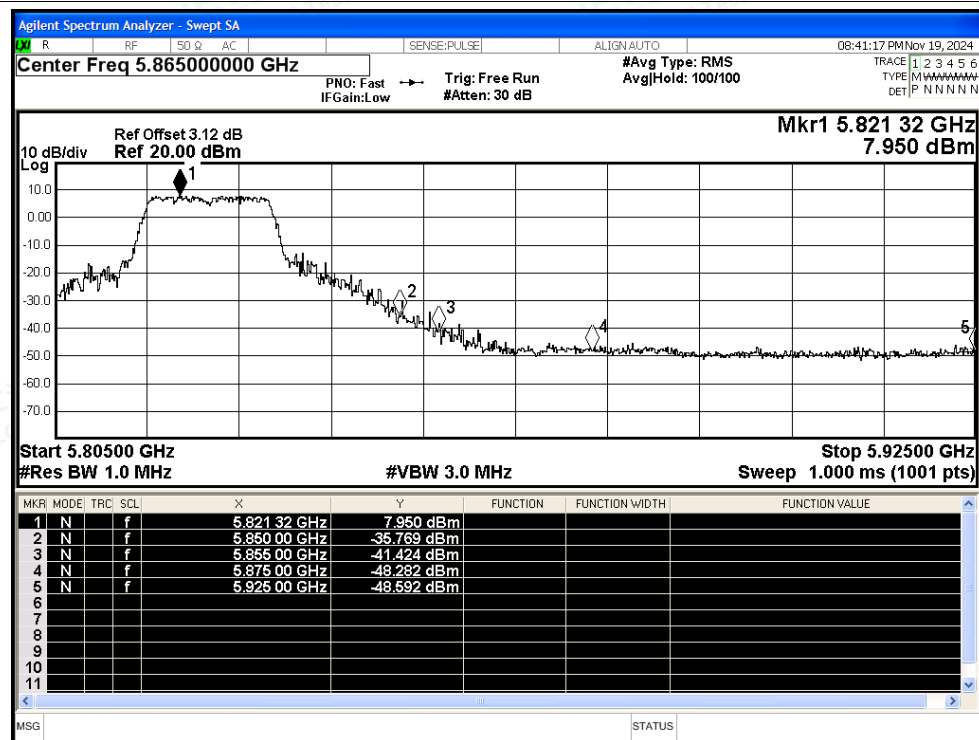


Restrict Band NVNT a 5825MHz Ant4 Average

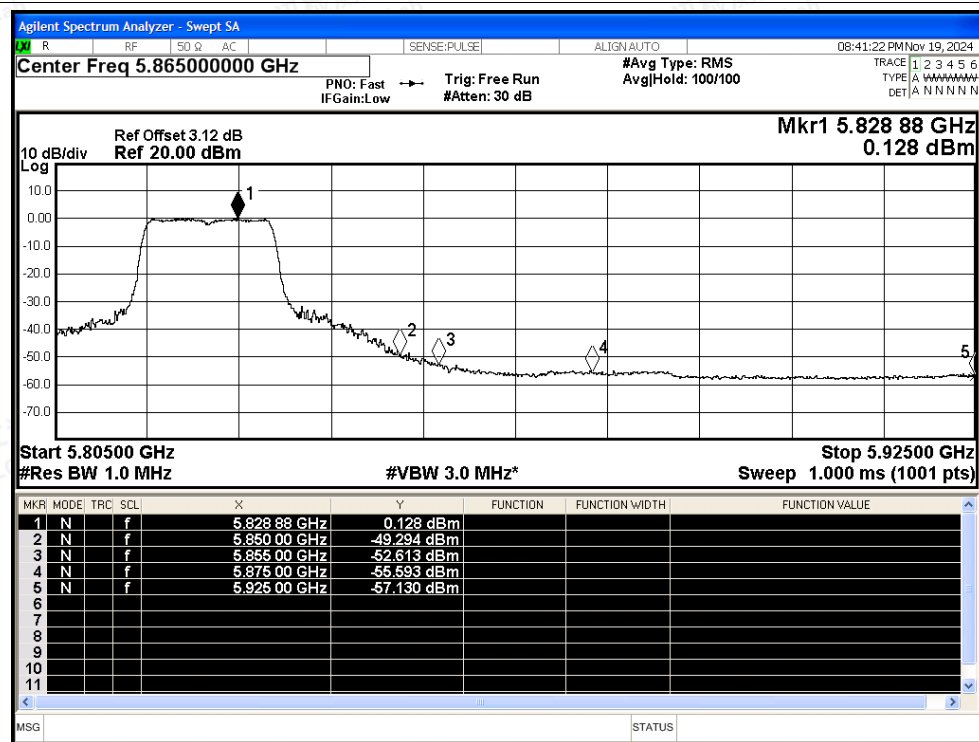


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT n20 5745MHz Ant4 Peak

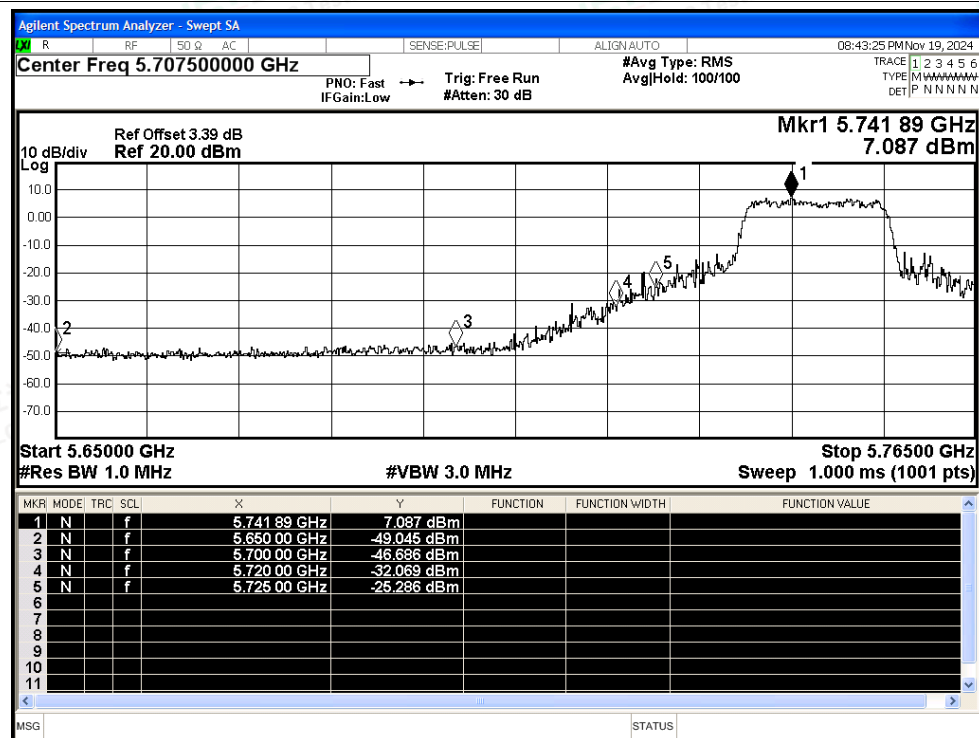


Restrict Band NVNT n20 5745MHz Ant4 Average

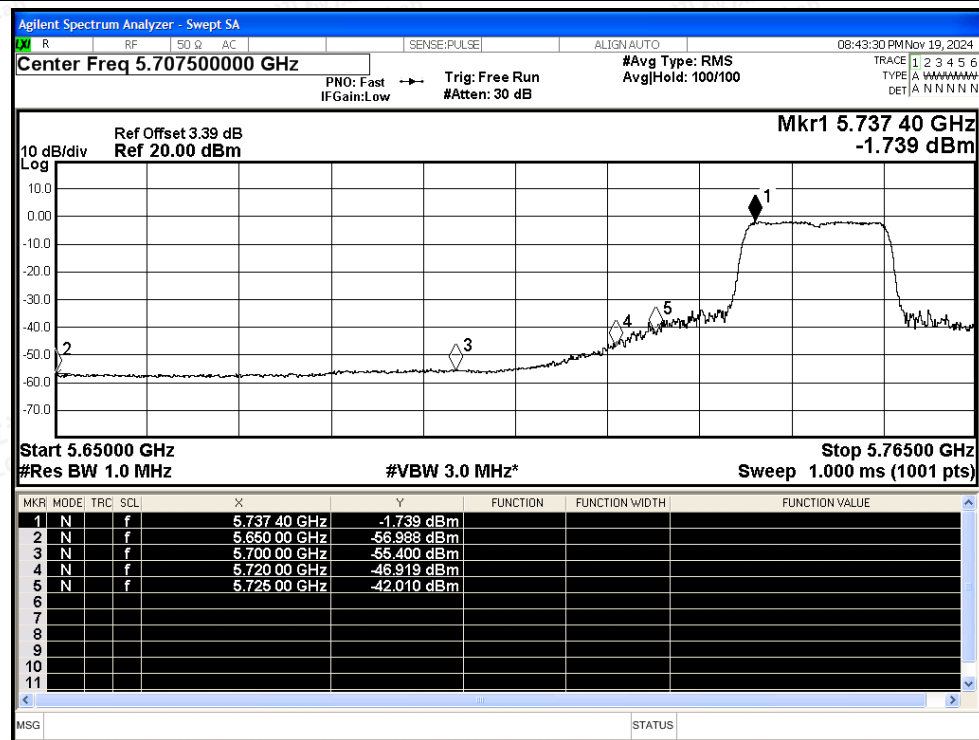


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant4 Peak

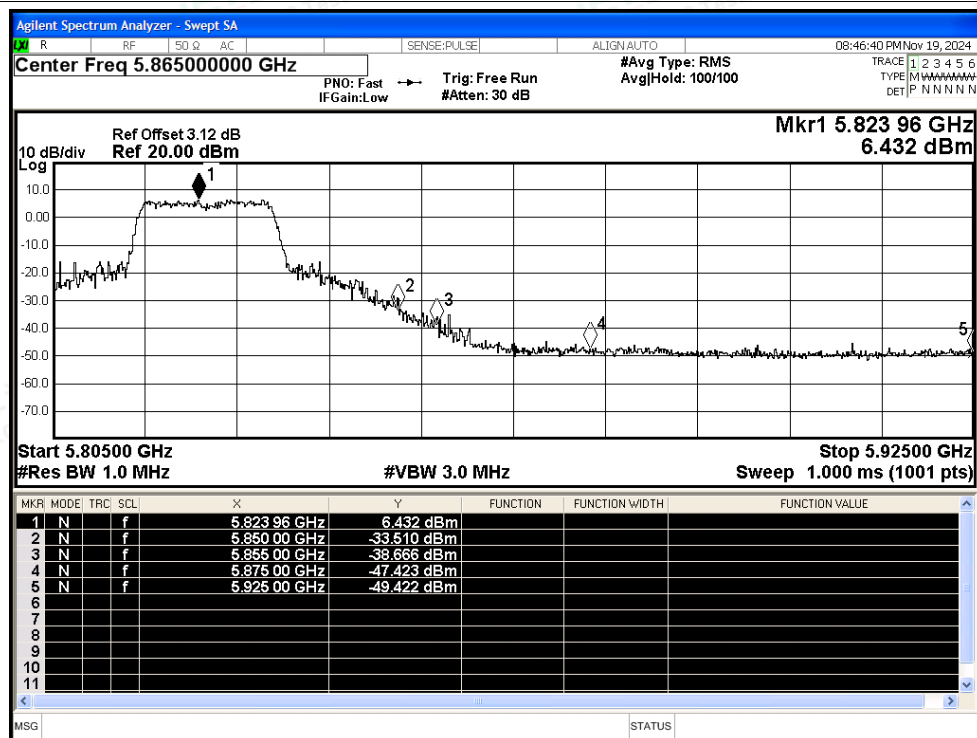


Restrict Band NVNT n20 5825MHz Ant4 Average

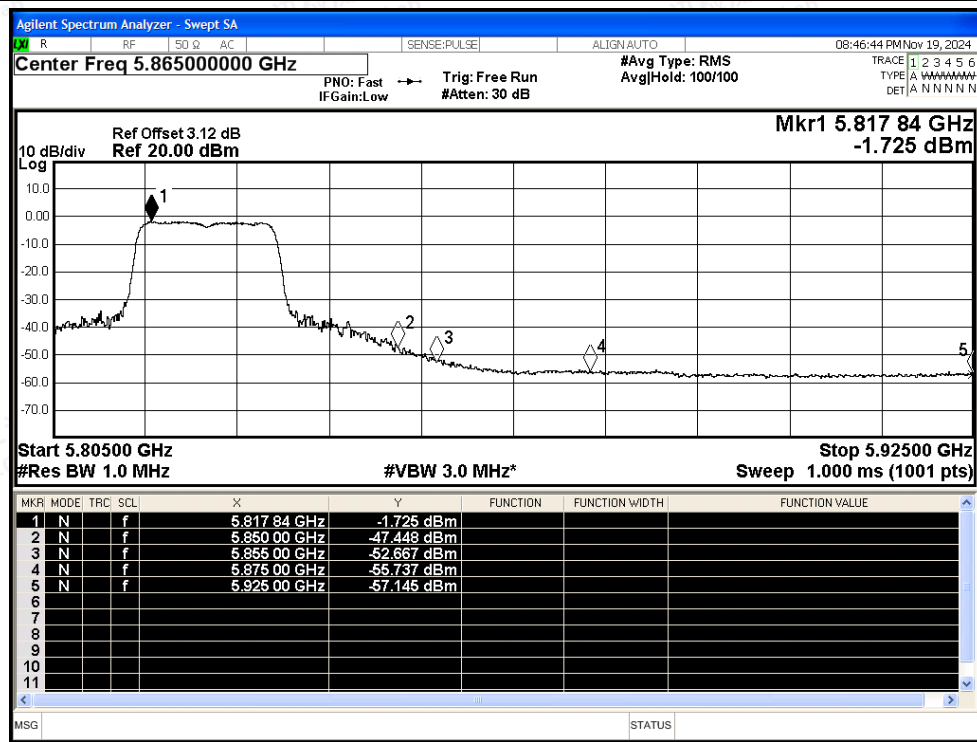


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT n40 5755MHz Ant4 Peak

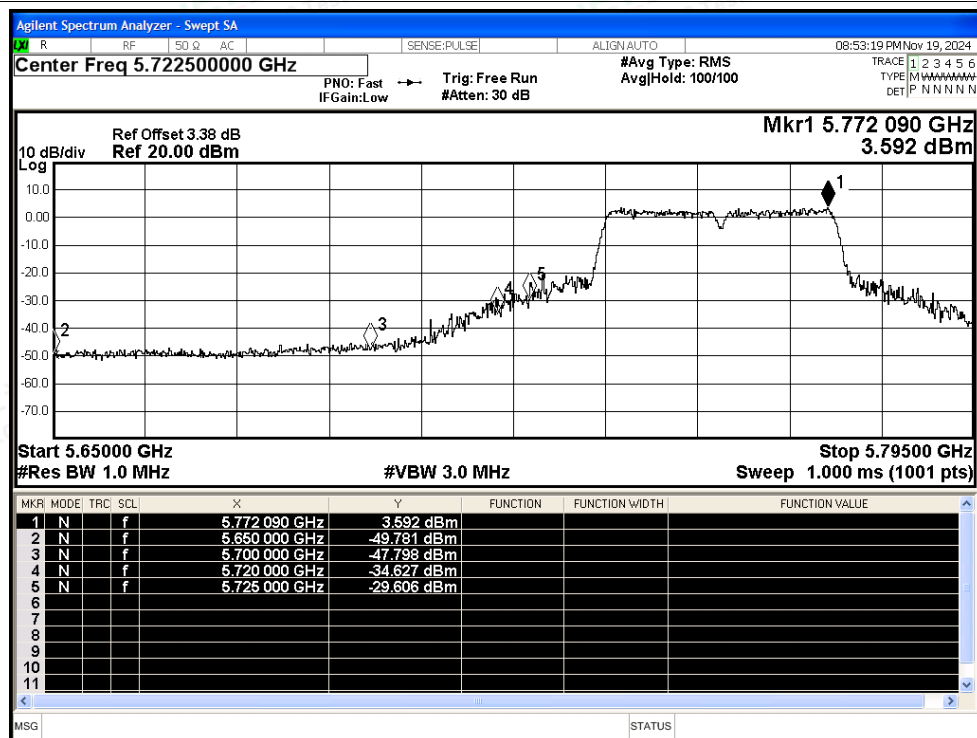


Restrict Band NVNT n40 5755MHz Ant4 Average

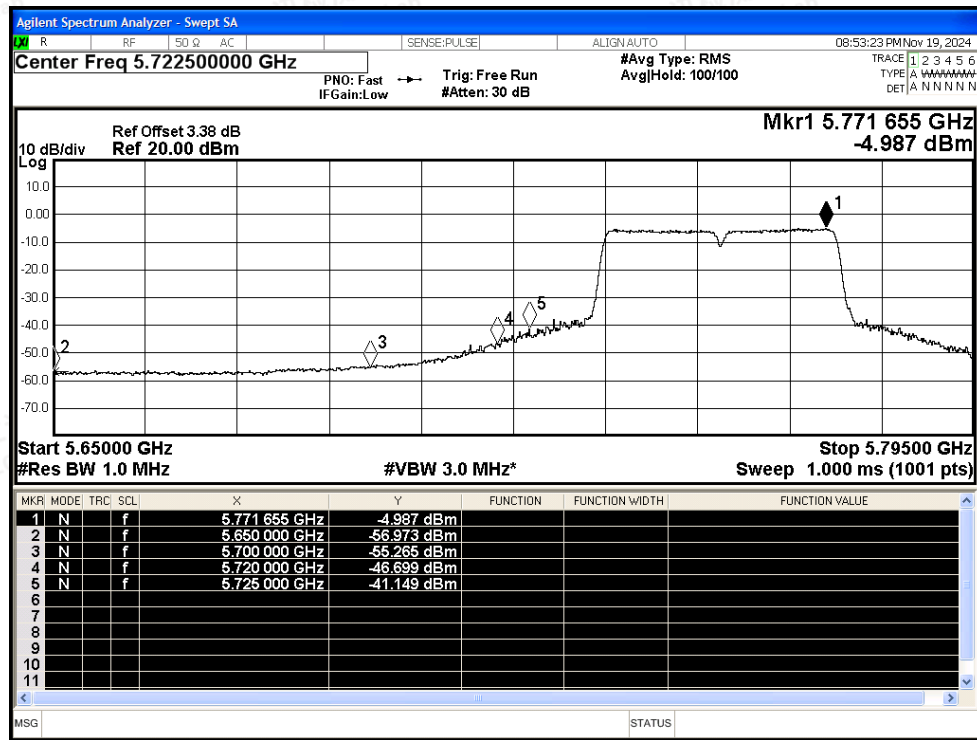


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant4 Peak

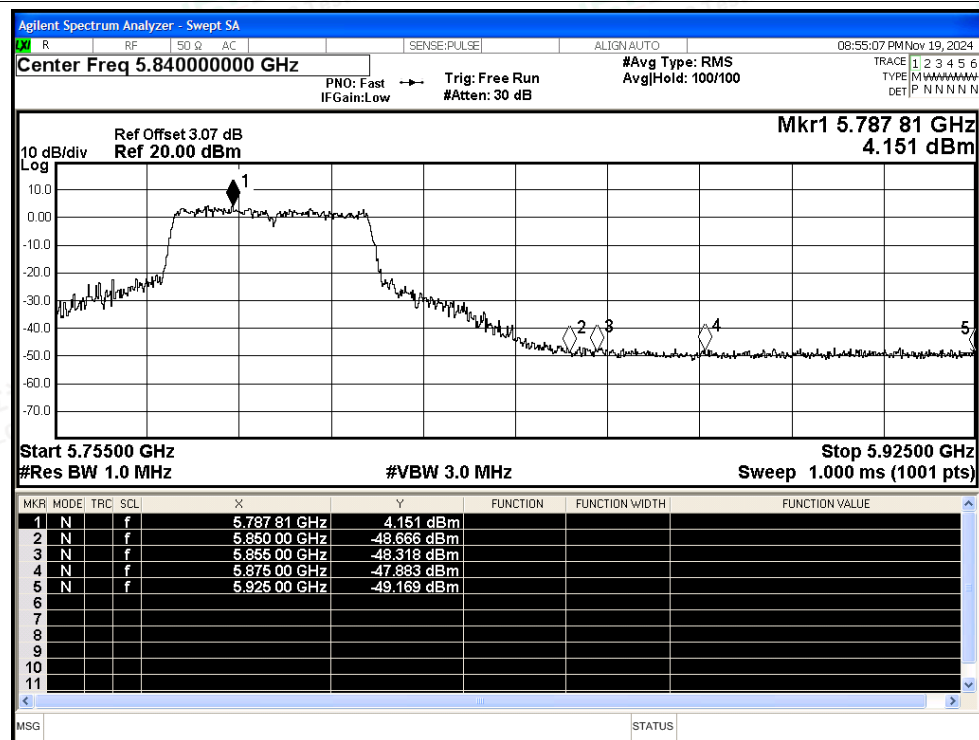


Restrict Band NVNT n40 5795MHz Ant4 Average

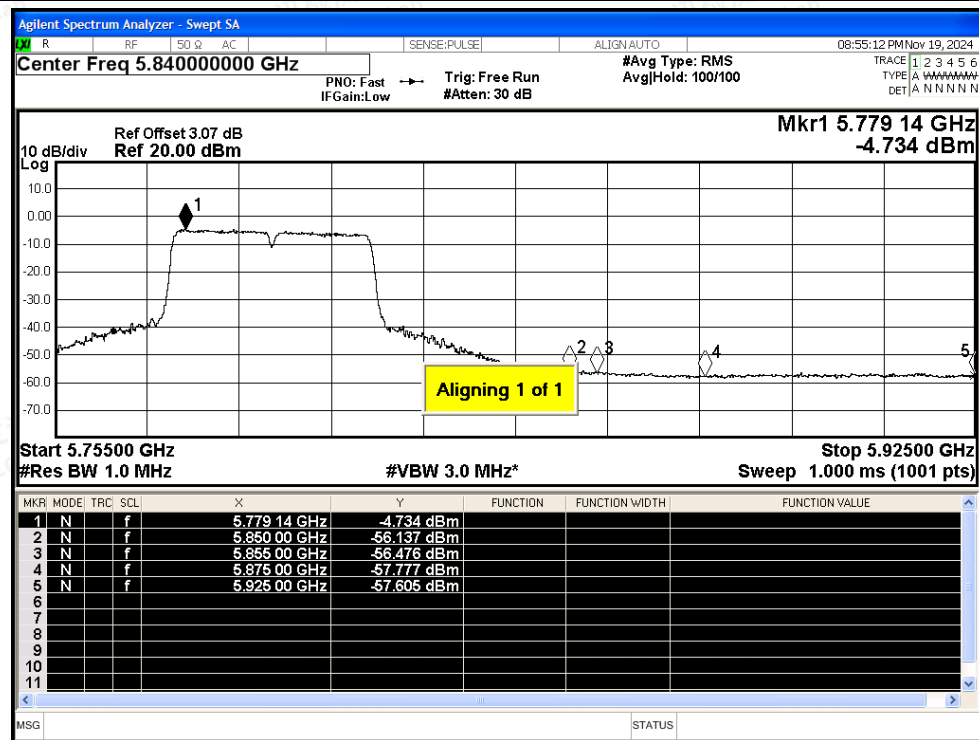


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant4 Peak

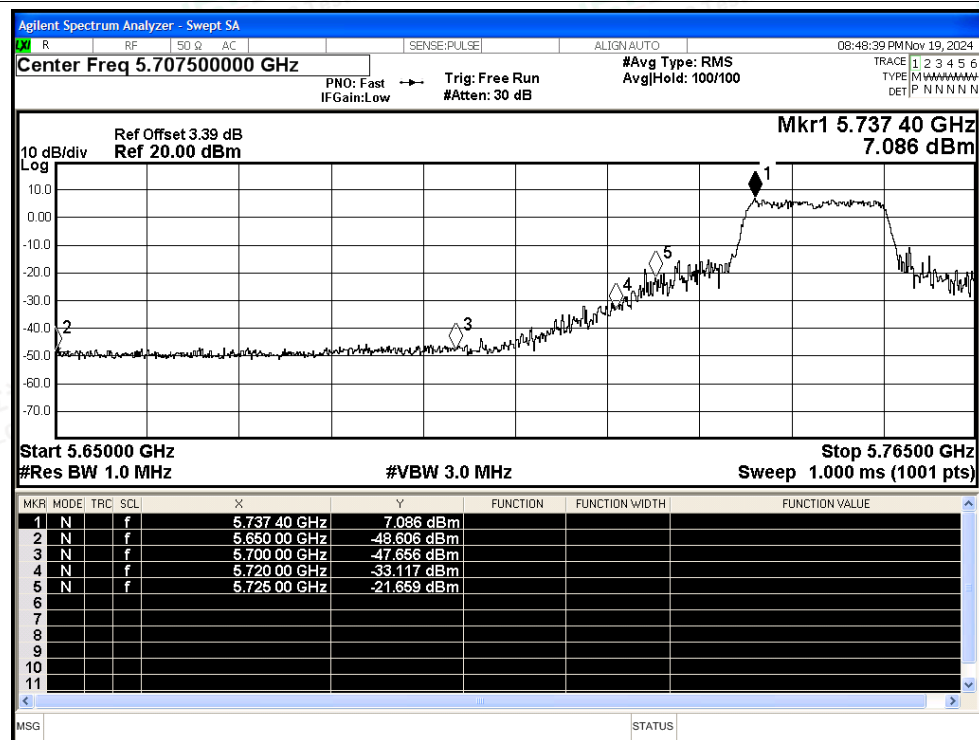


Restrict Band NVNT ac20 5745MHz Ant4 Average

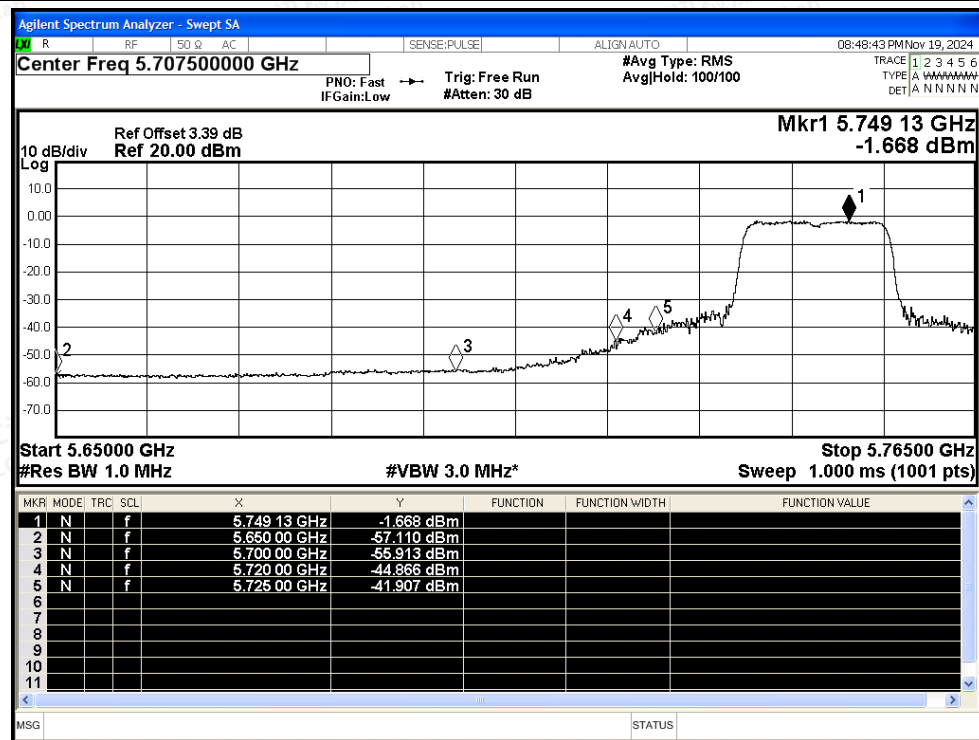


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac20 5825MHz Ant4 Peak

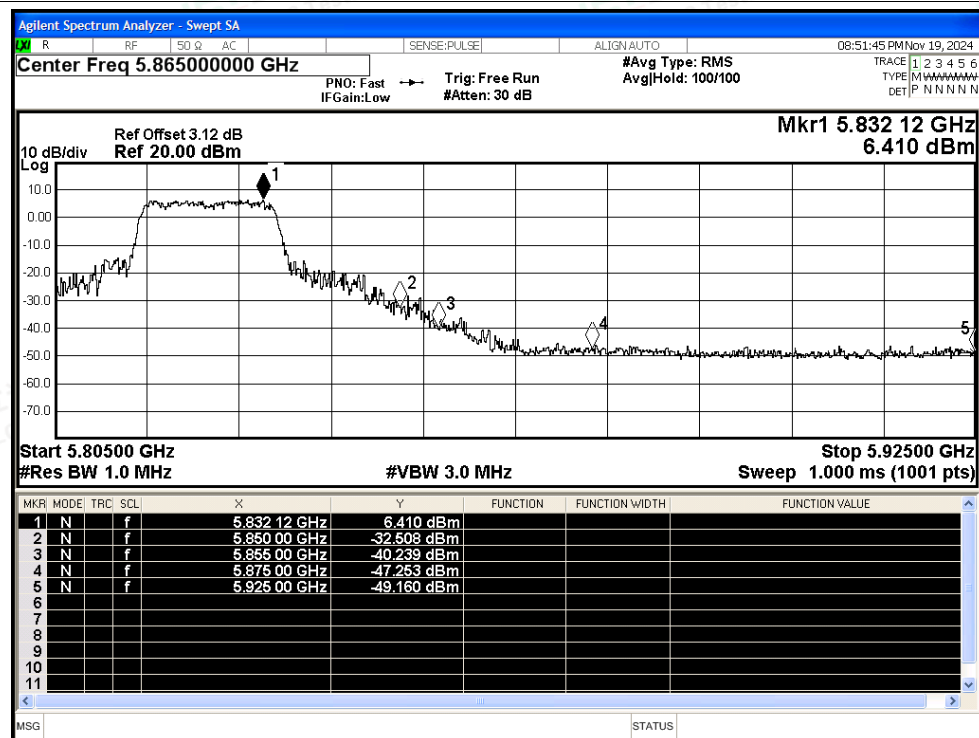


Restrict Band NVNT ac20 5825MHz Ant4 Average

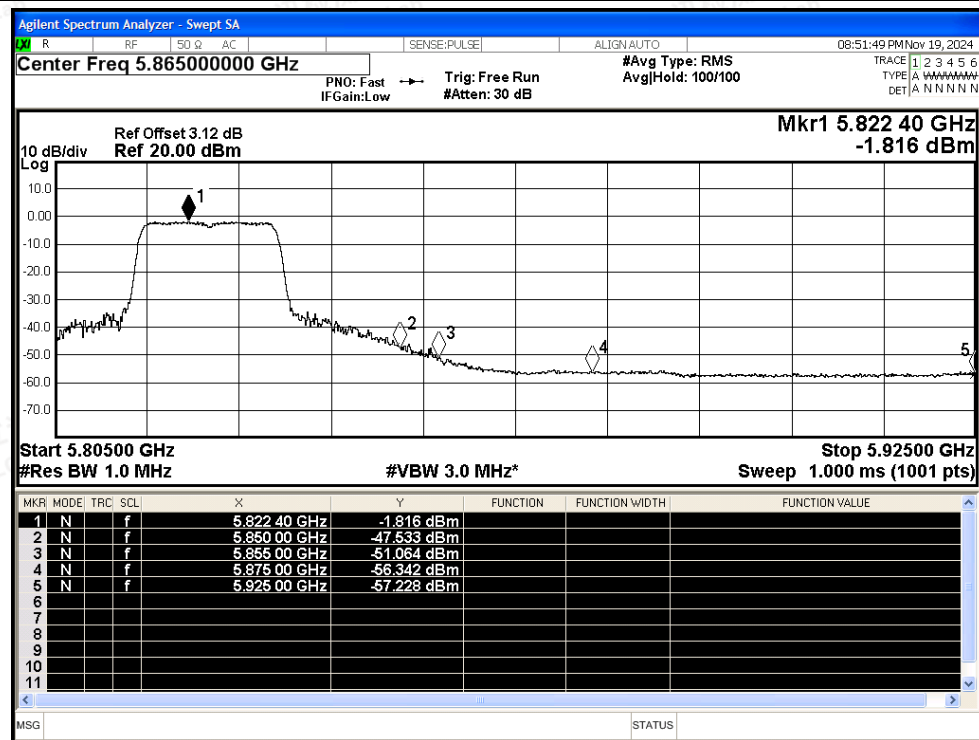


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant4 Peak

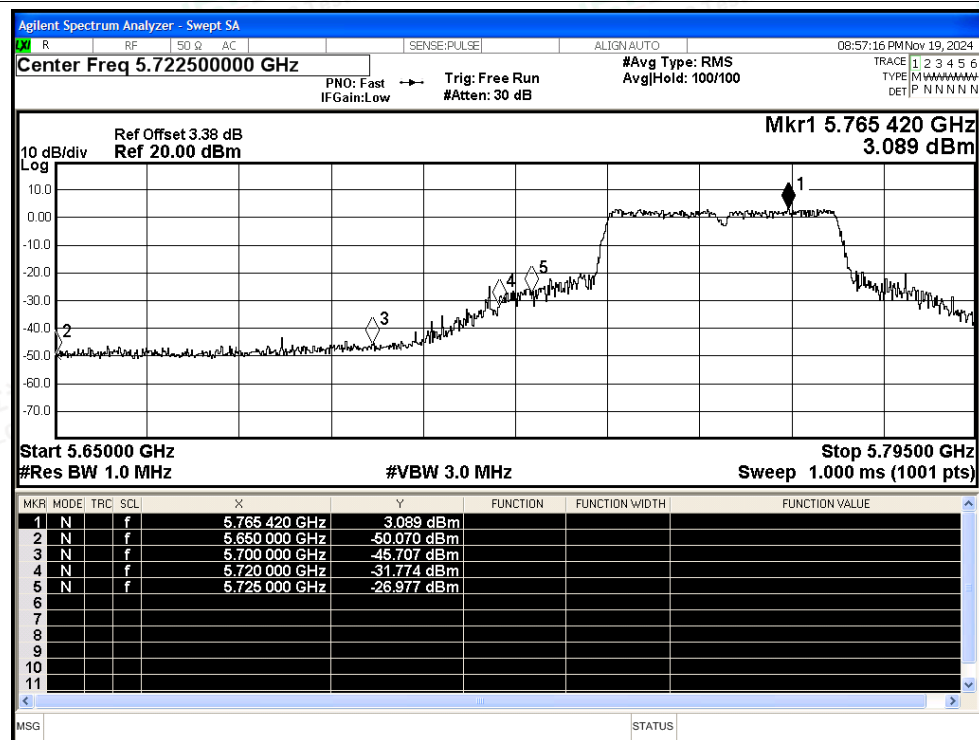


Restrict Band NVNT ac40 5755MHz Ant4 Average

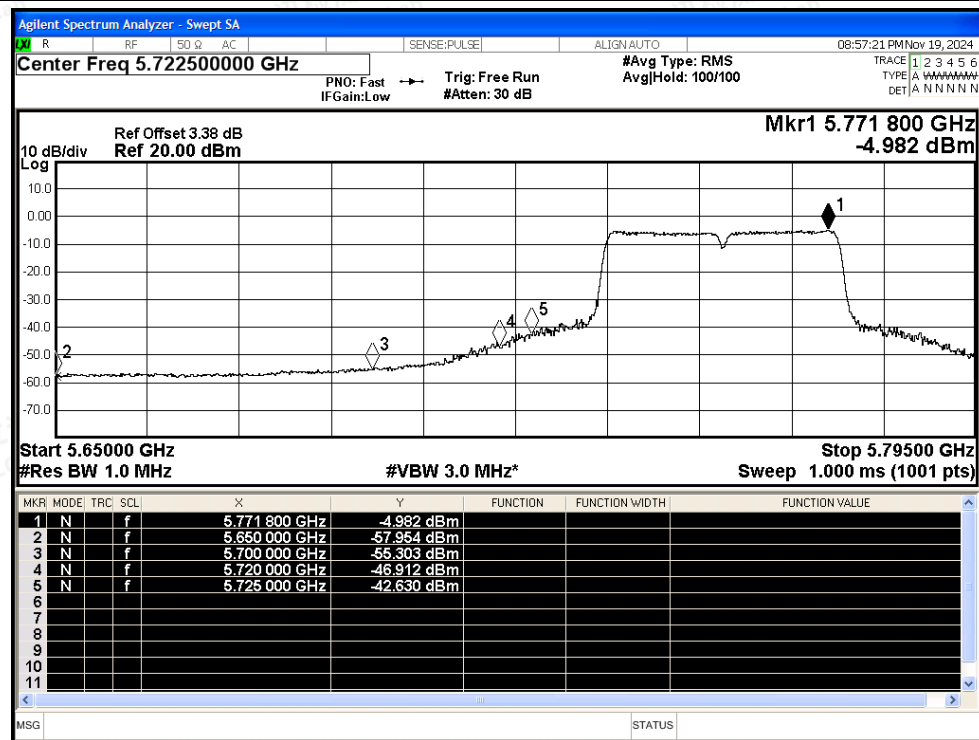


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant4 Peak

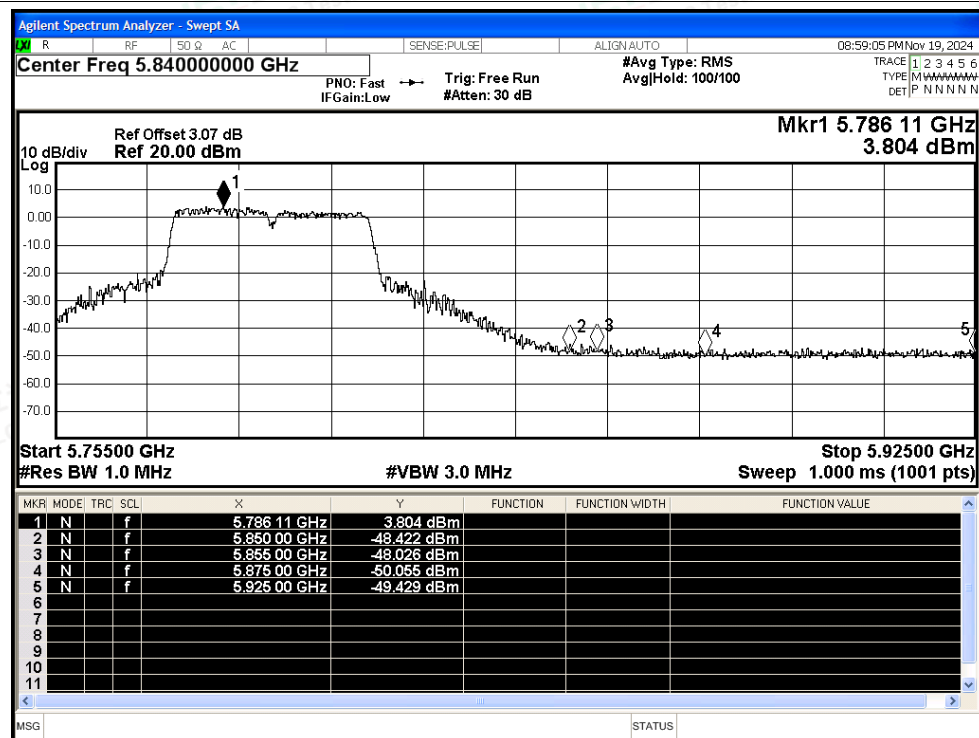


Restrict Band NVNT ac40 5795MHz Ant4 Average

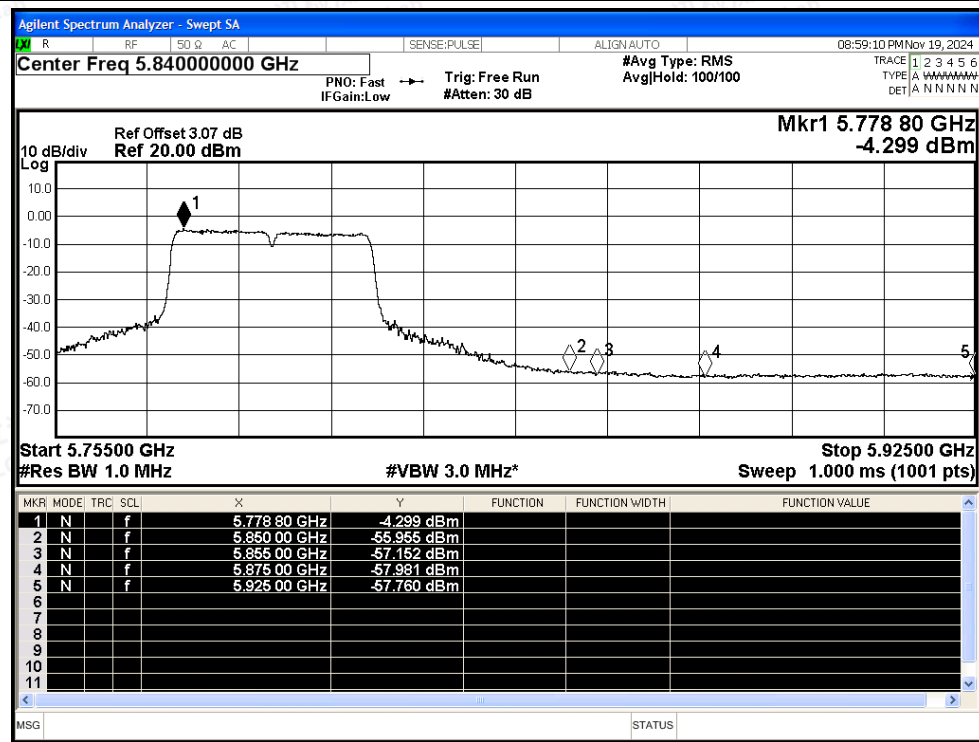


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant4 Peak

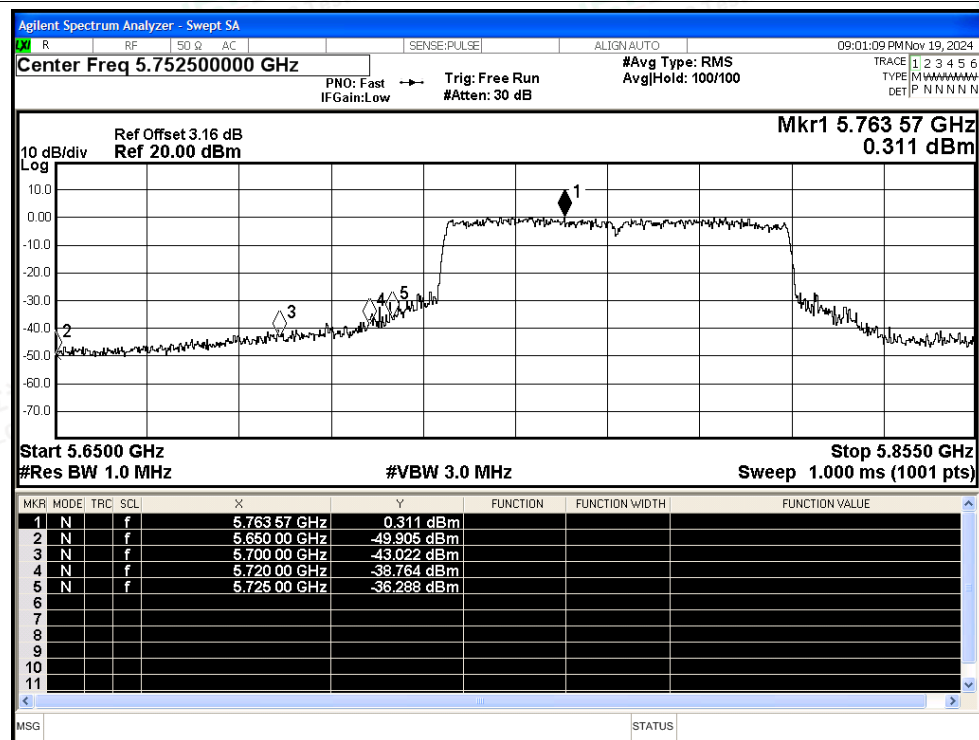


Restrict Band NVNT ac80 5775MHz Ant4 Average

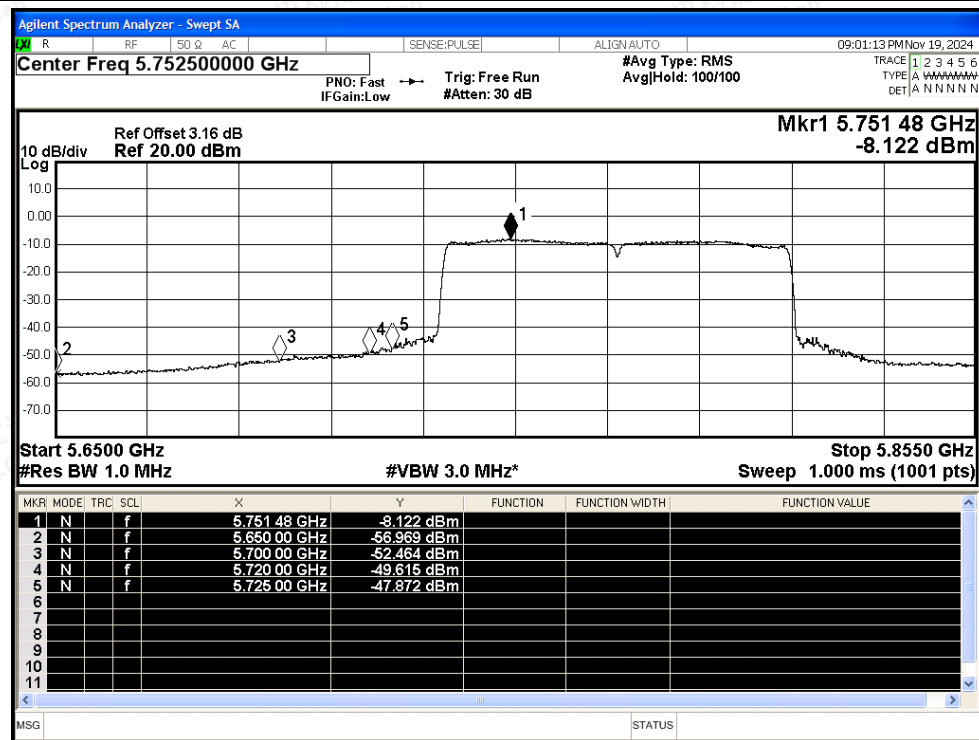


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant4 Peak

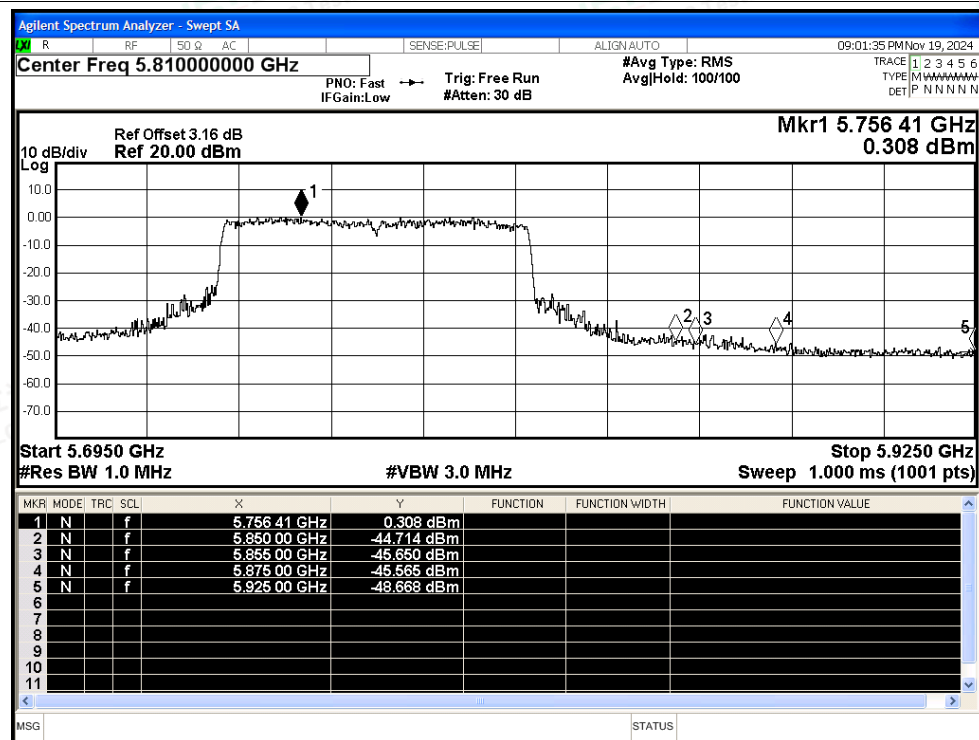

Restrict Band NVNT ac80 5775MHz Ant4 Average

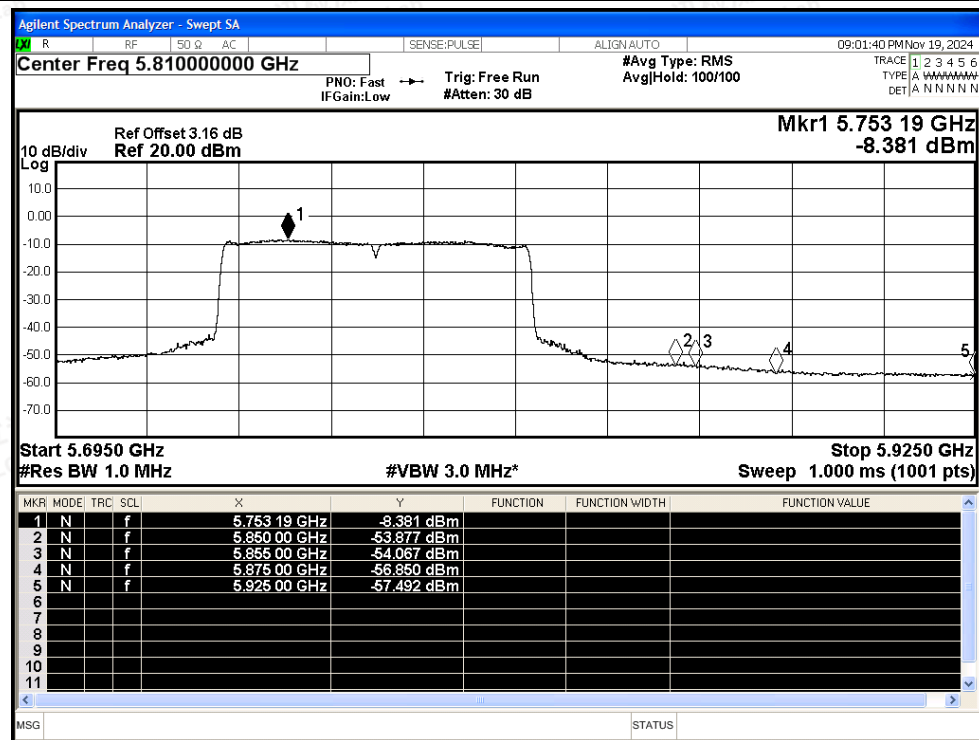

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Gain (dBi)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	n20	5745	-48.02	-49.05	6.98	-38.51	Peak	-27	Pass
NVNT	n20	5745	-57.07	-56.99	6.98	-47.04	Average	-27	Pass
NVNT	n20	5745	-47.66	-46.69	6.98	-37.16	Peak	10	Pass
NVNT	n20	5745	-55.17	-55.4	6.98	-45.29	Average	10	Pass
NVNT	n20	5745	-31.29	-32.07	6.98	-21.67	Peak	15.6	Pass
NVNT	n20	5745	-46.15	-46.92	6.98	-36.53	Average	15.6	Pass
NVNT	n20	5745	-27.66	-25.29	6.98	-16.32	Peak	27	Pass
NVNT	n20	5745	-40.96	-42.01	6.98	-31.46	Average	27	Pass
NVNT	n20	5825	-32.86	-33.51	6.98	-23.18	Peak	27	Pass
NVNT	n20	5825	-47.9	-47.45	6.98	-37.68	Average	27	Pass
NVNT	n20	5825	-39.46	-38.67	6.98	-29.06	Peak	15.6	Pass
NVNT	n20	5825	-51.34	-52.67	6.98	-41.96	Average	15.6	Pass
NVNT	n20	5825	-48.55	-47.42	6.98	-37.96	Peak	10	Pass
NVNT	n20	5825	-55.75	-55.74	6.98	-45.75	Average	10	Pass
NVNT	n20	5825	-50.04	-49.42	6.98	-39.73	Peak	-27	Pass
NVNT	n20	5825	-56.47	-57.15	6.98	-46.81	Average	-27	Pass
NVNT	n40	5755	-48.88	-49.78	6.98	-39.32	Peak	-27	Pass
NVNT	n40	5755	-57.02	-56.97	6.98	-47.00	Average	-27	Pass
NVNT	n40	5755	-45.89	-47.8	6.98	-36.75	Peak	10	Pass
NVNT	n40	5755	-54.66	-55.27	6.98	-44.96	Average	10	Pass
NVNT	n40	5755	-31.31	-34.63	6.98	-22.67	Peak	15.6	Pass
NVNT	n40	5755	-46.74	-46.7	6.98	-36.73	Average	15.6	Pass
NVNT	n40	5755	-26.74	-29.61	6.98	-17.95	Peak	27	Pass
NVNT	n40	5755	-42.86	-41.15	6.98	-31.93	Average	27	Pass
NVNT	n40	5795	-46.69	-48.67	6.98	-37.58	Peak	27	Pass
NVNT	n40	5795	-55.58	-56.14	6.98	-45.86	Average	27	Pass
NVNT	n40	5795	-49.24	-48.32	6.98	-38.77	Peak	15.6	Pass
NVNT	n40	5795	-56.06	-56.48	6.98	-46.27	Average	15.6	Pass
NVNT	n40	5795	-49.95	-47.88	6.98	-38.80	Peak	10	Pass
NVNT	n40	5795	-57.43	-57.78	6.98	-47.61	Average	10	Pass
NVNT	n40	5795	-50.54	-49.17	6.98	-39.81	Peak	-27	Pass
NVNT	n40	5795	-57.72	-57.61	6.98	-47.67	Average	-27	Pass
NVNT	ac20	5745	-49.13	-48.61	6.98	-38.87	Peak	-27	Pass
NVNT	ac20	5745	-57.04	-57.11	6.98	-47.08	Average	-27	Pass
NVNT	ac20	5745	-48.35	-47.66	6.98	-38.00	Peak	10	Pass
NVNT	ac20	5745	-55.11	-55.91	6.98	-45.50	Average	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac20	5745	-26.08	-33.12	6.98	-18.32	Peak	15.6	Pass
NVNT	ac20	5745	-45.91	-44.87	6.98	-35.37	Average	15.6	Pass
NVNT	ac20	5745	-20.56	-21.66	6.98	-11.08	Peak	27	Pass
NVNT	ac20	5745	-41.59	-41.91	6.98	-31.76	Average	27	Pass
NVNT	ac20	5825	-30.36	-32.51	6.98	-21.31	Peak	27	Pass
NVNT	ac20	5825	-47.64	-47.53	6.98	-37.59	Average	27	Pass
NVNT	ac20	5825	-36.04	-40.24	6.98	-27.66	Peak	15.6	Pass
NVNT	ac20	5825	-51.46	-51.06	6.98	-41.27	Average	15.6	Pass
NVNT	ac20	5825	-47.04	-47.25	6.98	-37.15	Peak	10	Pass
NVNT	ac20	5825	-56.02	-56.34	6.98	-46.19	Average	10	Pass
NVNT	ac20	5825	-48.09	-49.16	6.98	-38.60	Peak	-27	Pass
NVNT	ac20	5825	-57.33	-57.23	6.98	-47.29	Average	-27	Pass
NVNT	ac40	5755	-49.81	-50.07	6.98	-39.95	Peak	-27	Pass
NVNT	ac40	5755	-57.11	-57.95	6.98	-47.52	Average	-27	Pass
NVNT	ac40	5755	-45.72	-45.71	6.98	-35.72	Peak	10	Pass
NVNT	ac40	5755	-55.15	-55.3	6.98	-45.23	Average	10	Pass
NVNT	ac40	5755	-30.48	-31.77	6.98	-21.09	Peak	15.6	Pass
NVNT	ac40	5755	-47.15	-46.91	6.98	-37.04	Average	15.6	Pass
NVNT	ac40	5755	-27.89	-26.98	6.98	-17.42	Peak	27	Pass
NVNT	ac40	5755	-42.41	-42.63	6.98	-32.53	Average	27	Pass
NVNT	ac40	5795	-48.43	-48.42	6.98	-38.43	Peak	27	Pass
NVNT	ac40	5795	-55.51	-55.96	6.98	-45.74	Average	27	Pass
NVNT	ac40	5795	-49.15	-48.03	6.98	-38.56	Peak	15.6	Pass
NVNT	ac40	5795	-56.86	-57.15	6.98	-47.01	Average	15.6	Pass
NVNT	ac40	5795	-50.25	-50.06	6.98	-40.16	Peak	10	Pass
NVNT	ac40	5795	-57.96	-57.98	6.98	-47.98	Average	10	Pass
NVNT	ac40	5795	-49.79	-49.43	6.98	-39.62	Peak	-27	Pass
NVNT	ac40	5795	-57.37	-57.76	6.98	-47.57	Average	-27	Pass
NVNT	ac80	5775	-48.88	-49.91	6.98	-39.37	Peak	-27	Pass
NVNT	ac80	5775	-56.53	-56.97	6.98	-46.75	Average	-27	Pass
NVNT	ac80	5775	-44.24	-43.02	6.98	-33.60	Peak	10	Pass
NVNT	ac80	5775	-52.48	-52.46	6.98	-42.48	Average	10	Pass
NVNT	ac80	5775	-36.94	-38.76	6.98	-27.77	Peak	15.6	Pass
NVNT	ac80	5775	-48.48	-49.62	6.98	-39.02	Average	15.6	Pass
NVNT	ac80	5775	-34.27	-36.29	6.98	-25.17	Peak	27	Pass
NVNT	ac80	5775	-46.3	-47.87	6.98	-37.02	Average	27	Pass
NVNT	ac80	5775	-42.35	-44.71	6.98	-33.38	Peak	27	Pass
NVNT	ac80	5775	-52.03	-53.88	6.98	-42.87	Average	27	Pass
NVNT	ac80	5775	-42.11	-45.65	6.98	-33.54	Peak	15.6	Pass
NVNT	ac80	5775	-52.52	-54.07	6.98	-43.24	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac80	5775	-48.33	-45.57	6.98	-36.74	Peak	10	Pass
NVNT	ac80	5775	-55.05	-56.85	6.98	-45.87	Average	10	Pass
NVNT	ac80	5775	-48.43	-48.67	6.98	-38.56	Peak	-27	Pass
NVNT	ac80	5775	-56.8	-57.49	6.98	-47.14	Average	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant3	5745	0	0	25	Pass
NVNT	a	5785	Ant3	5784.98	-20000	-3.46	25	Pass
NVNT	a	5825	Ant3	5825	0	0	25	Pass
NVNT	n20	5745	Ant3	5744.98	-20000	-3.48	25	Pass
NVNT	n20	5785	Ant3	5784.98	-20000	-3.46	25	Pass
NVNT	n20	5825	Ant3	5824.98	-20000	-3.43	25	Pass
NVNT	n40	5755	Ant3	5754.96	-40000	-6.95	25	Pass
NVNT	n40	5795	Ant3	5795	0	0	25	Pass
NVNT	ac20	5745	Ant3	5744.96	-40000	-6.96	25	Pass
NVNT	ac20	5785	Ant3	5785	0	0	25	Pass
NVNT	ac20	5825	Ant3	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant3	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant3	5795	0	0	25	Pass
NVNT	ac80	5775	Ant3	5775	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5745MHz Ant3

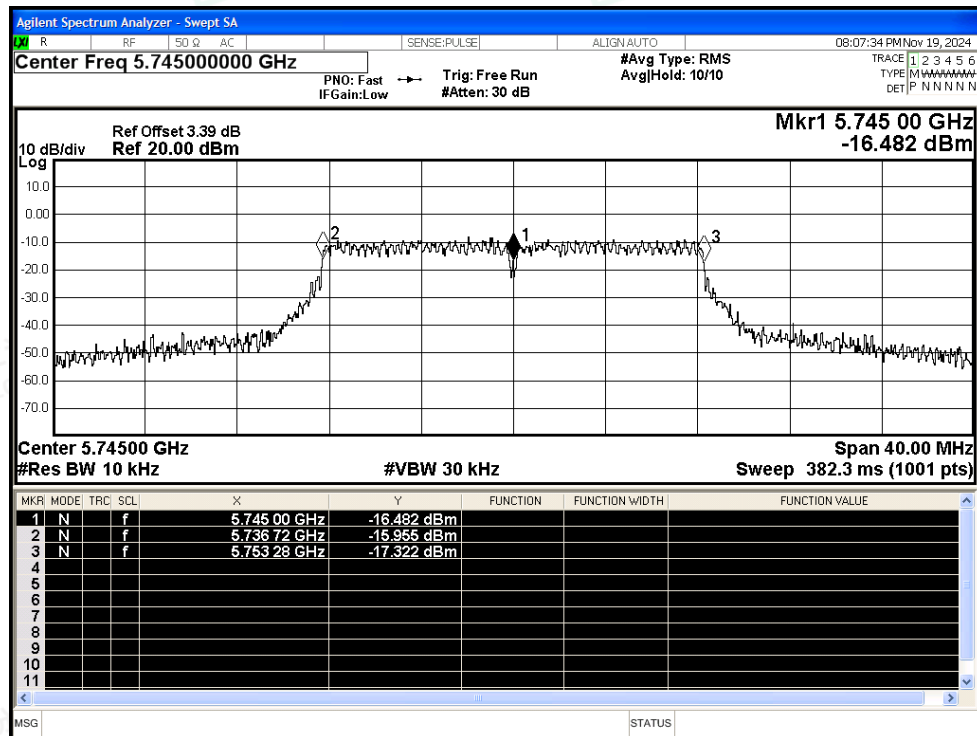


Freq. Stability NVNT a 5785MHz Ant3

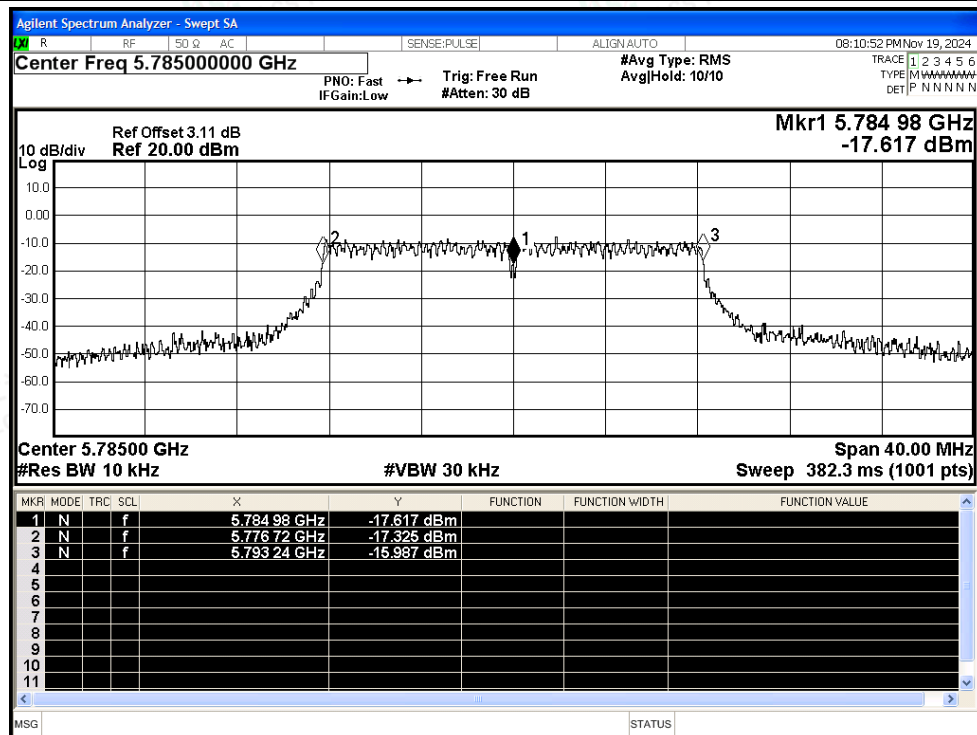


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant3

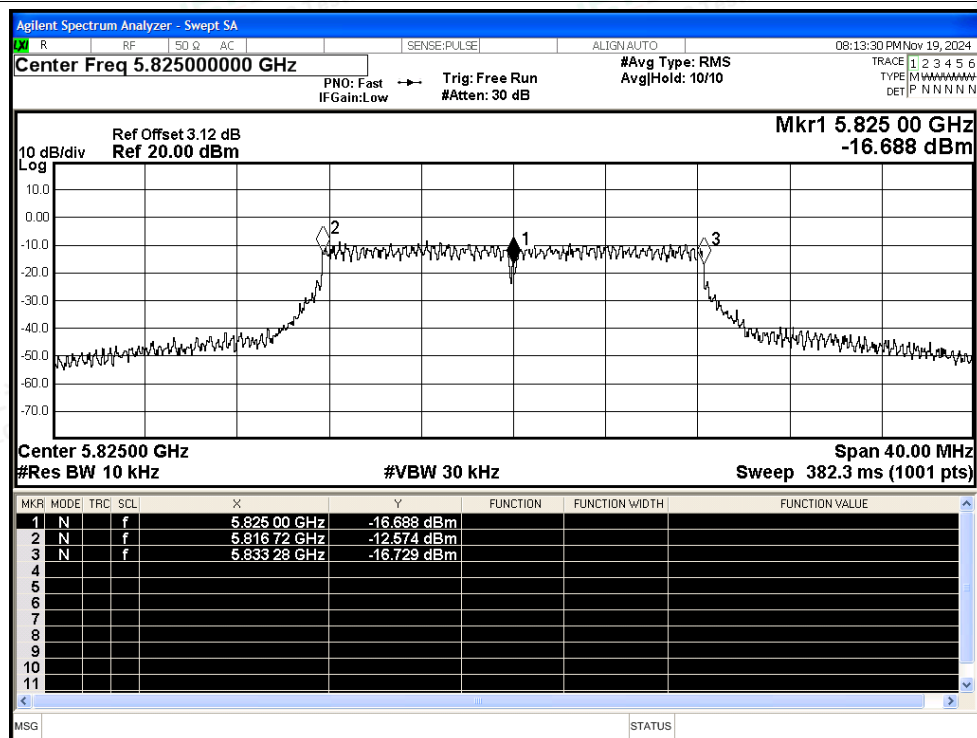


Freq. Stability NVNT n20 5745MHz Ant3

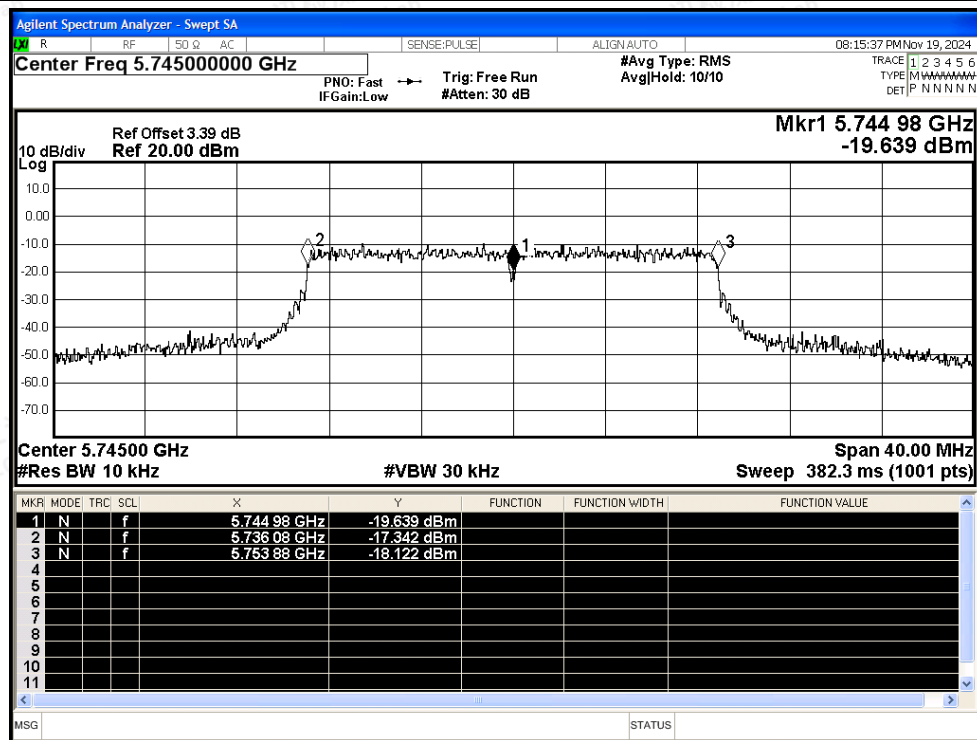


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant3

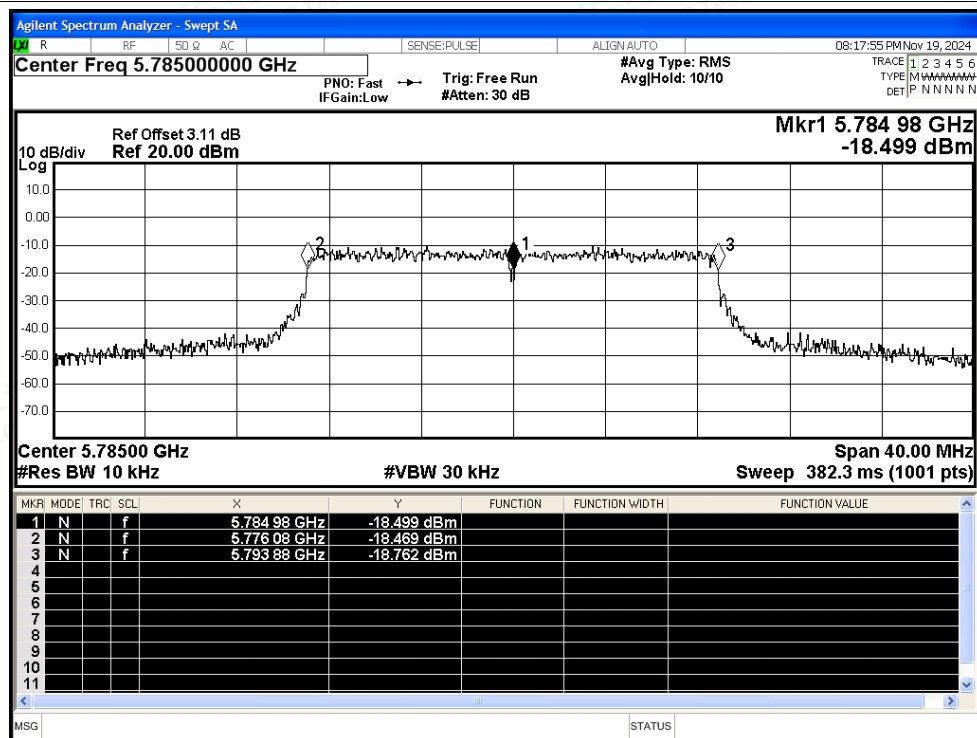


Freq. Stability NVNT n20 5825MHz Ant3

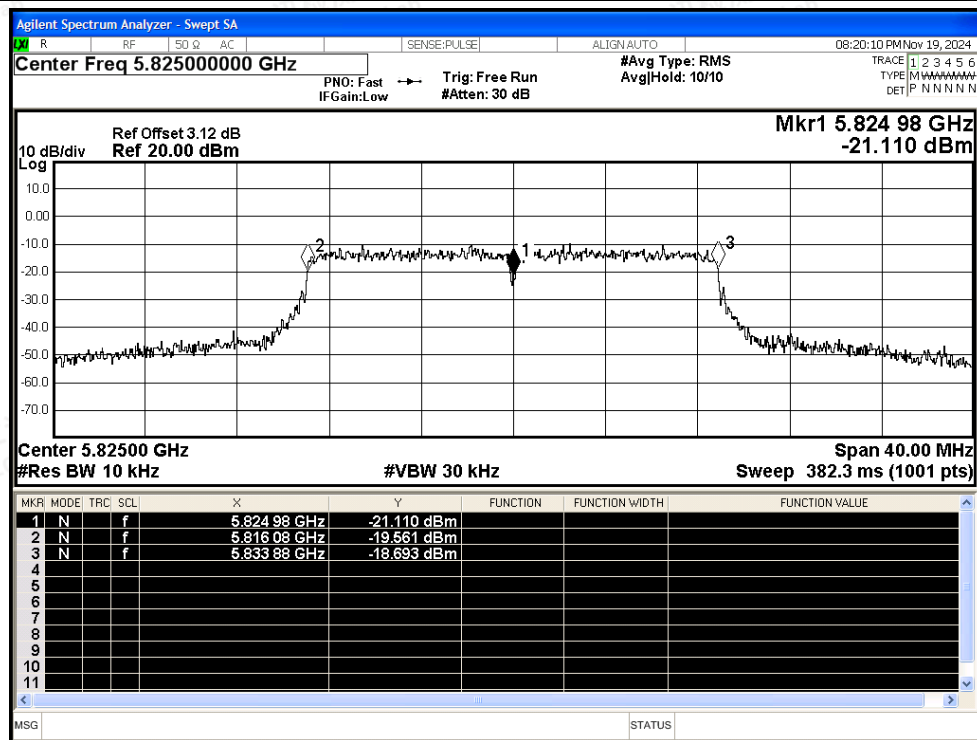


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant3

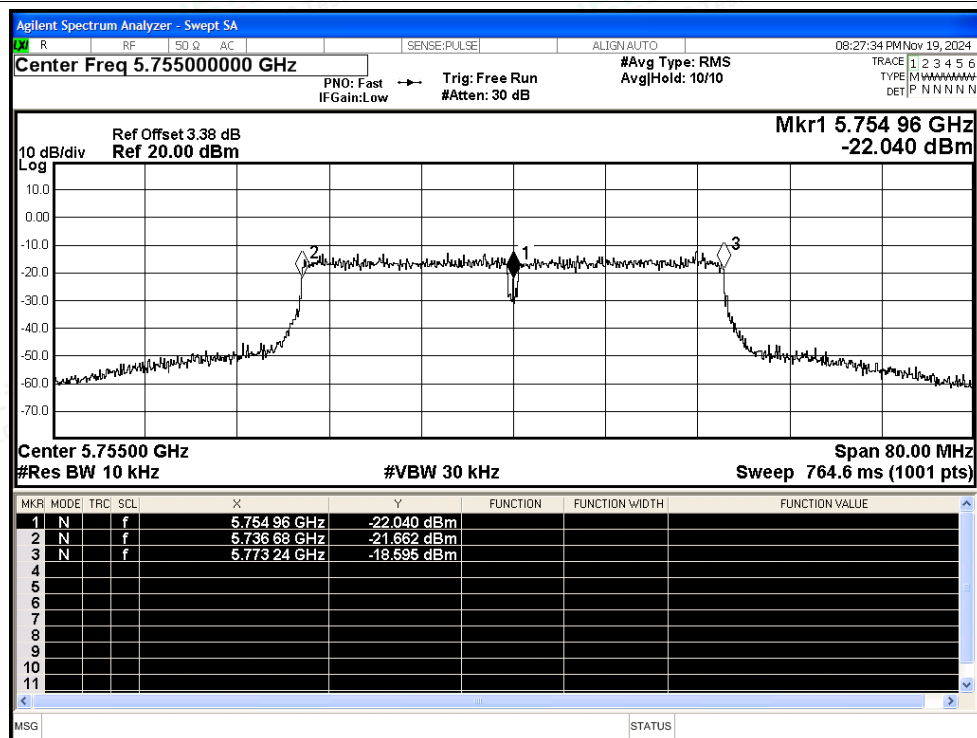


Freq. Stability NVNT n40 5795MHz Ant3

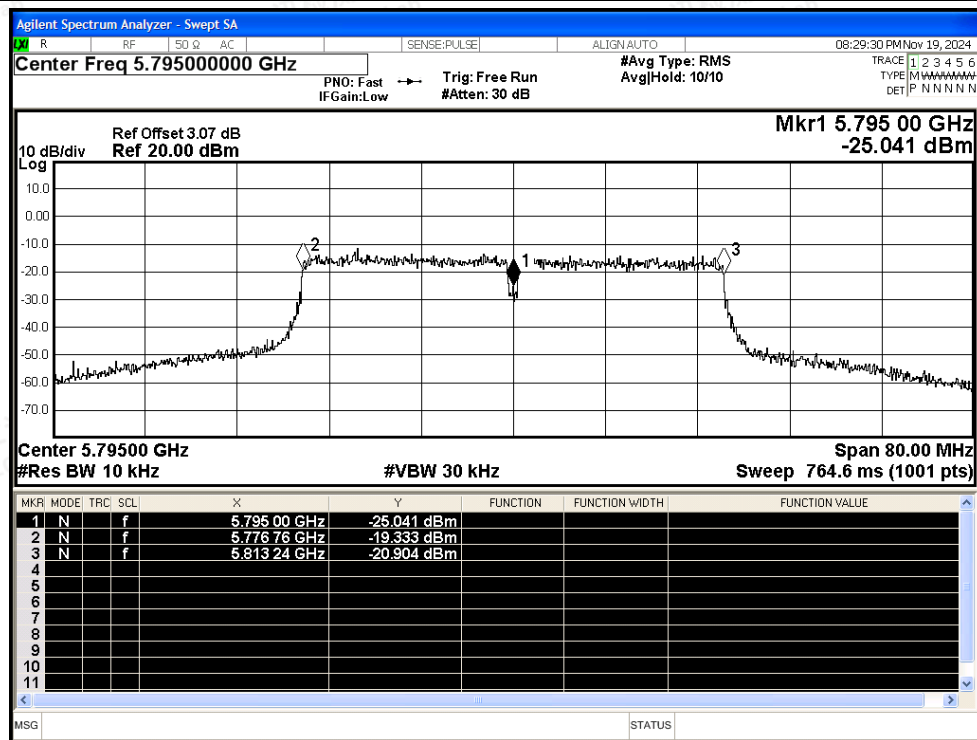




Freq. Stability NVNT ac20 5745MHz Ant3

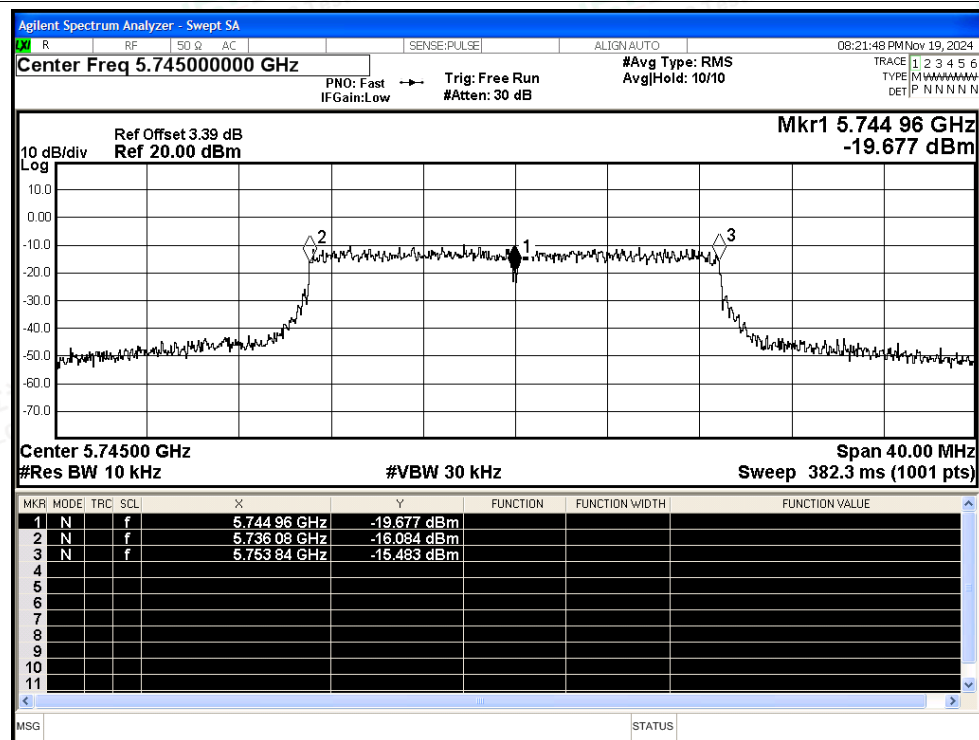


Freq. Stability NVNT ac20 5785MHz Ant3

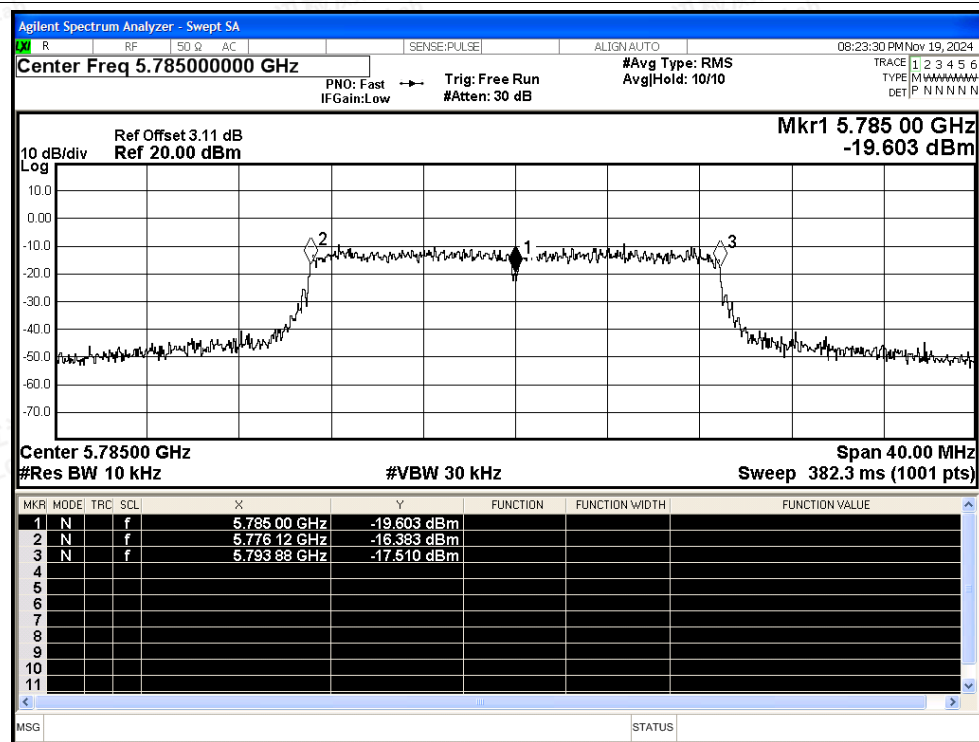


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant3

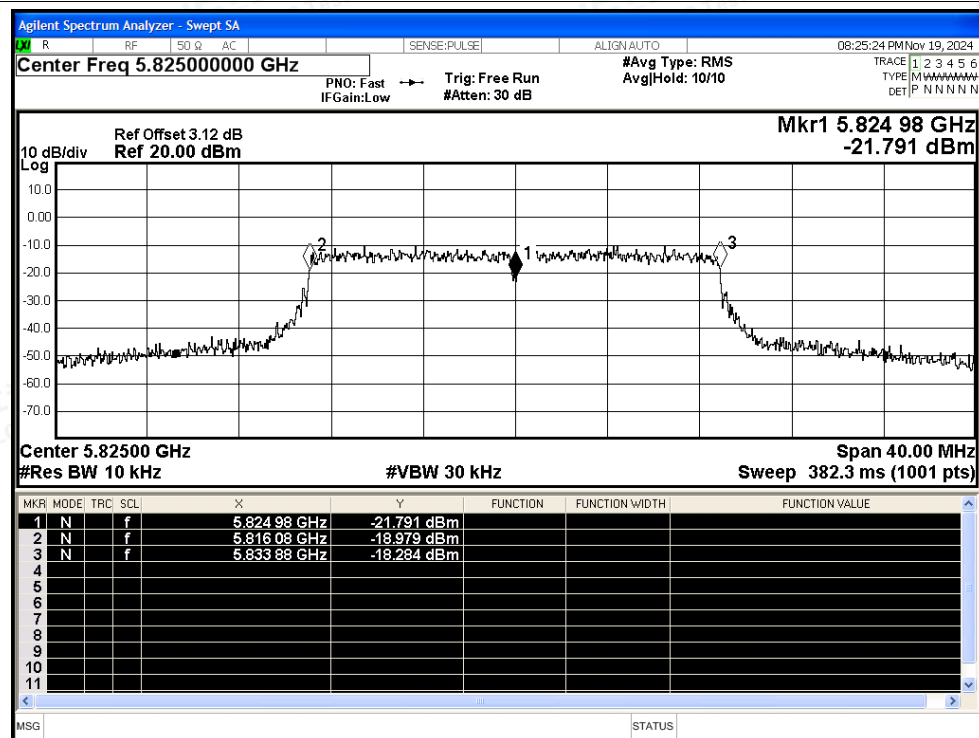


Freq. Stability NVNT ac40 5755MHz Ant3

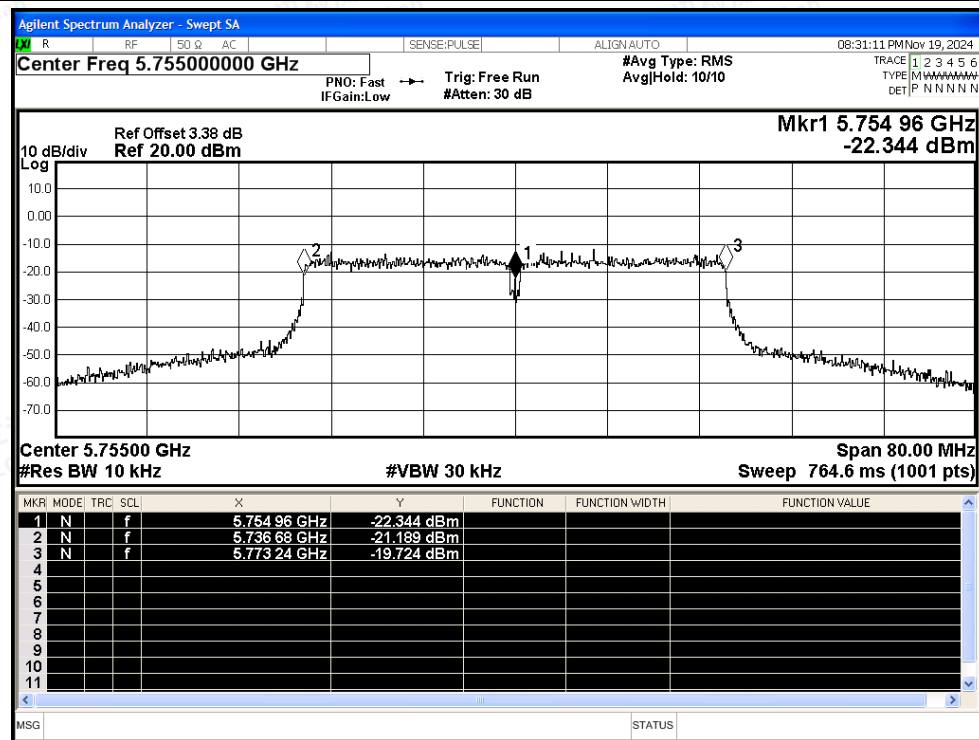


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Freq. Stability NVNT ac40 5795MHz Ant3

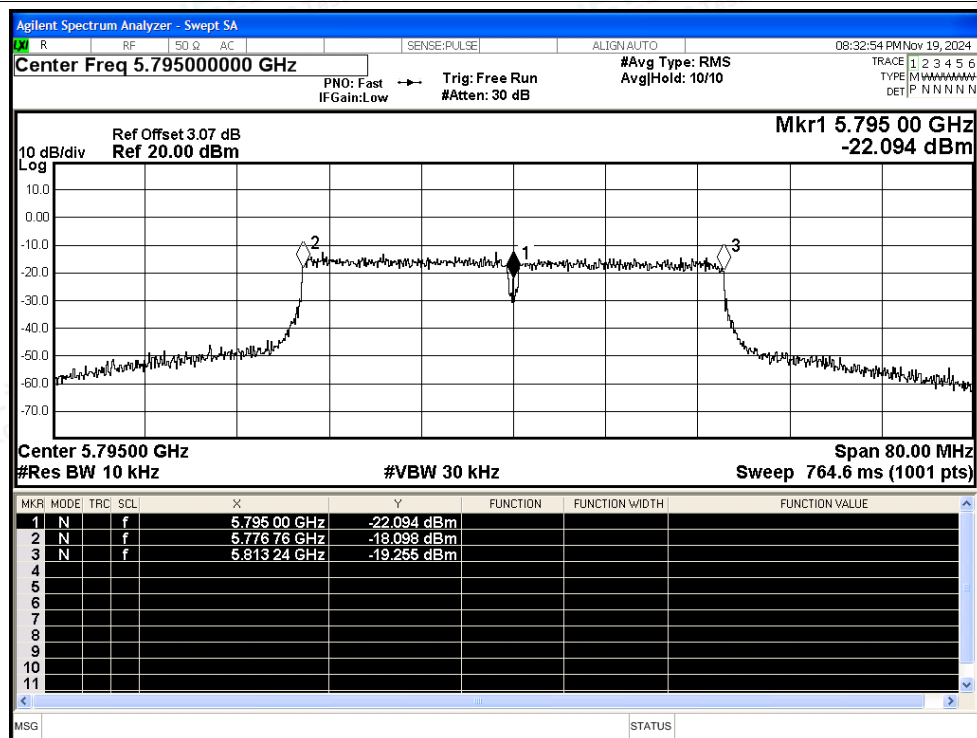

Freq. Stability NVNT ac80 5775MHz Ant3

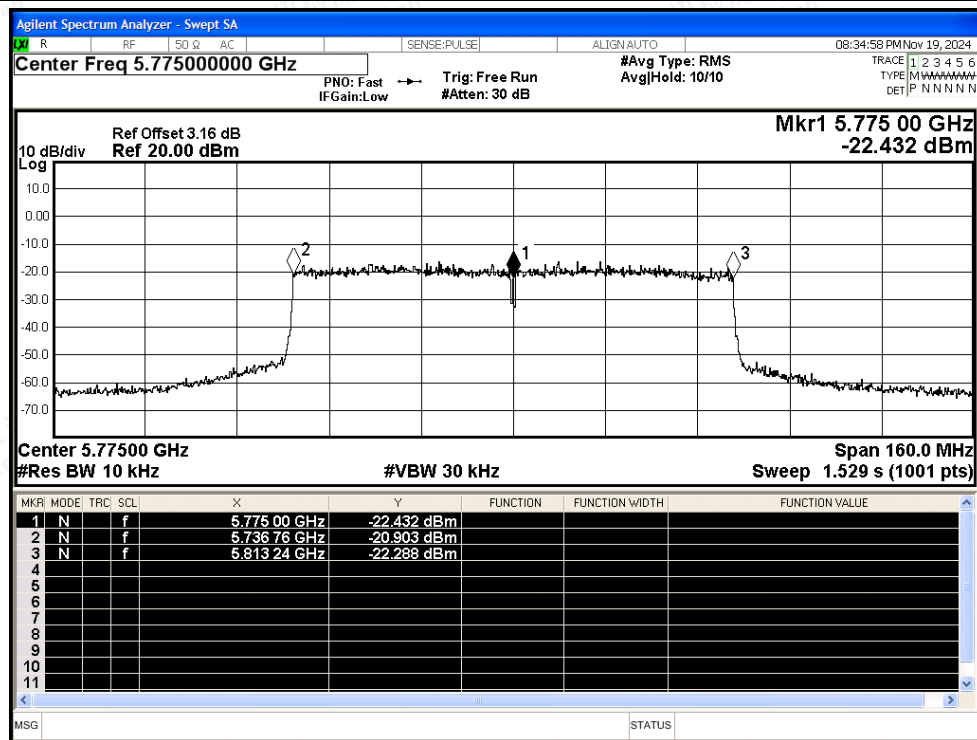

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



D.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant3	94.56	0.24	0.91
NVNT	a	5785	Ant3	94.56	0.24	0.91
NVNT	a	5825	Ant3	94.65	0.24	0.91
NVNT	n20	5745	Ant3	97.29	0.12	0.44
NVNT	n20	5785	Ant3	97.29	0.12	0.44
NVNT	n20	5825	Ant3	97.33	0.12	0.44
NVNT	n40	5755	Ant3	94.71	0.24	0.9
NVNT	n40	5795	Ant3	94.71	0.24	0.9
NVNT	ac20	5745	Ant3	97.34	0.12	0.44
NVNT	ac20	5785	Ant3	97.34	0.12	0.44
NVNT	ac20	5825	Ant3	97.34	0.12	0.44
NVNT	ac40	5755	Ant3	94.72	0.24	0.9
NVNT	ac40	5795	Ant3	94.72	0.24	0.9
NVNT	ac80	5775	Ant3	94.41	0.25	0.97




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5745MHz Ant3

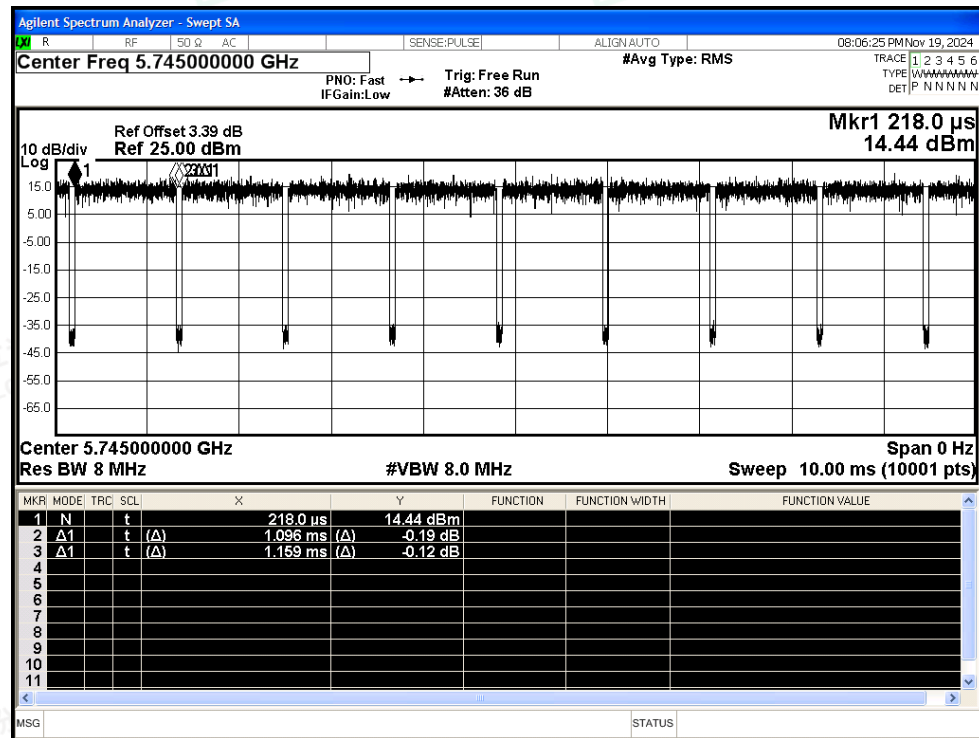


Duty Cycle NVNT a 5785MHz Ant3

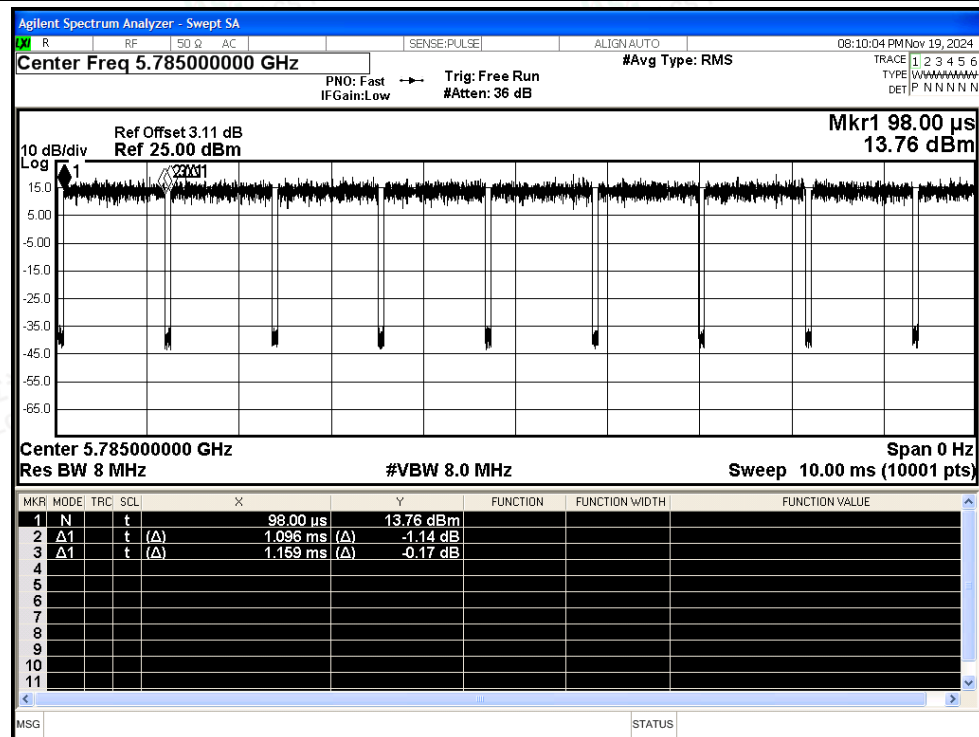




Duty Cycle NVNT a 5825MHz Ant3

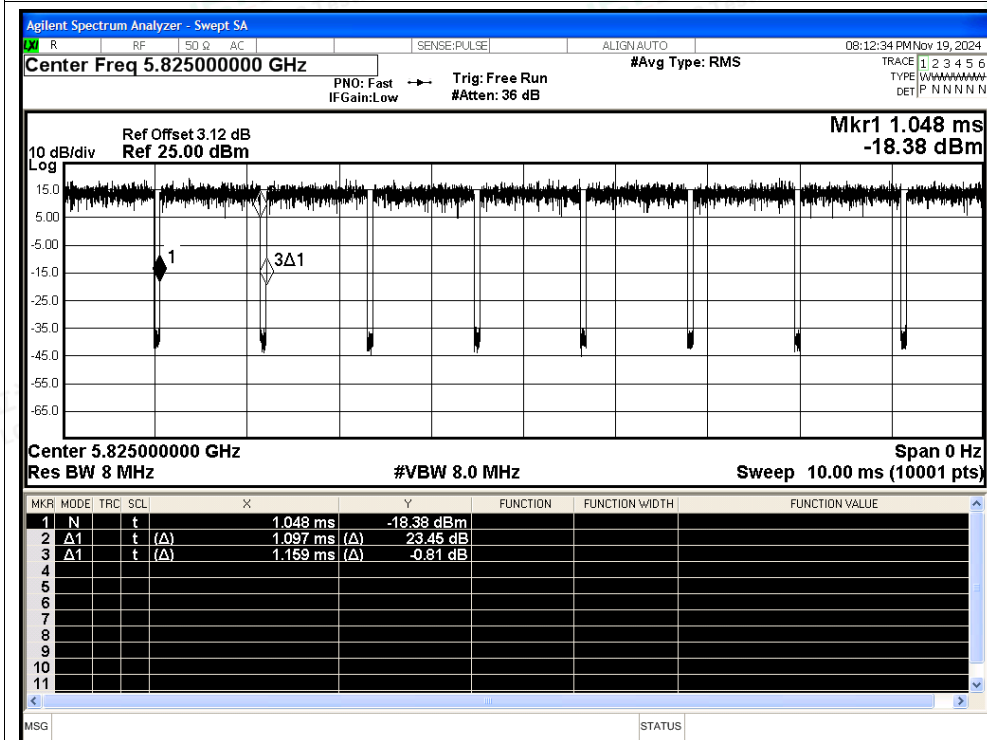


Duty Cycle NVNT n20 5745MHz Ant3

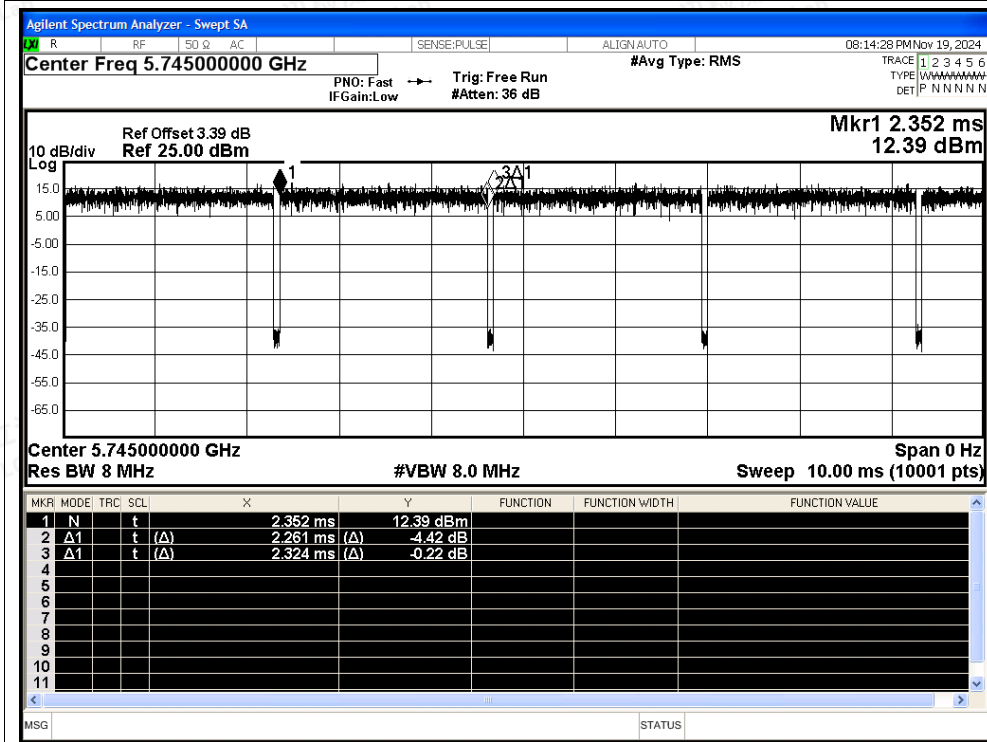


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Duty Cycle NVNT n20 5785MHz Ant3

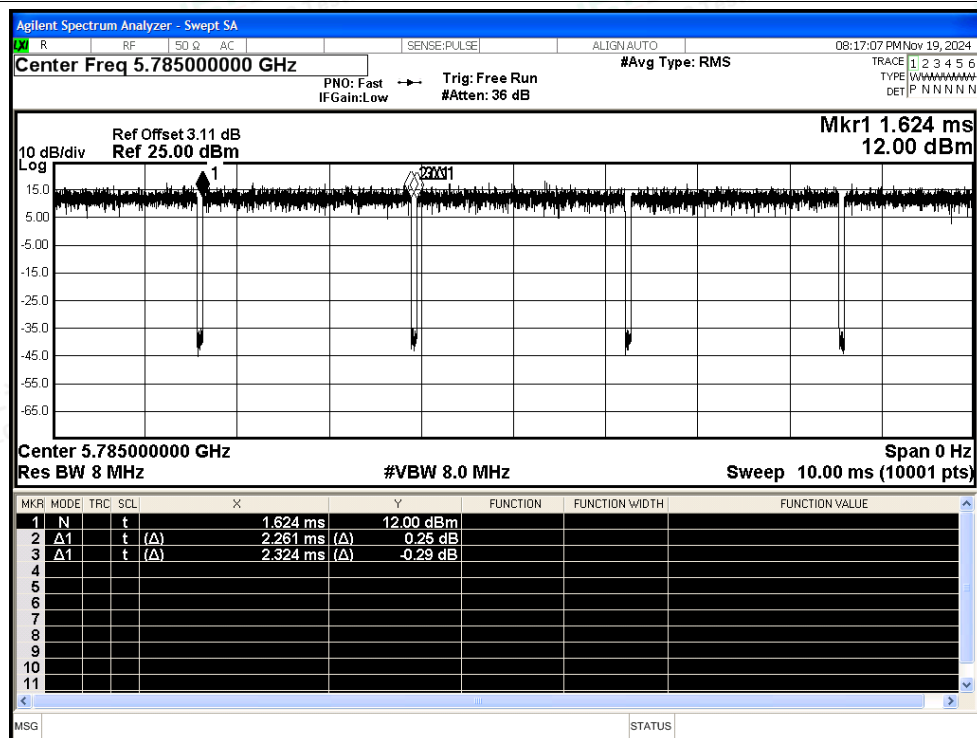


Duty Cycle NVNT n20 5825MHz Ant3

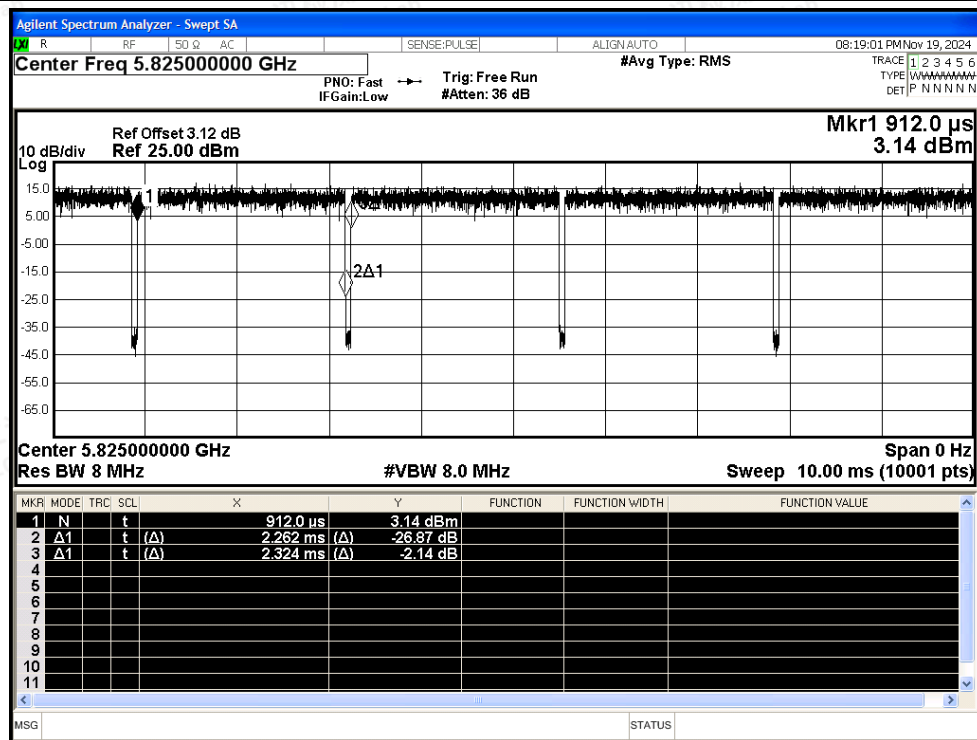


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Duty Cycle NVNT n40 5755MHz Ant3

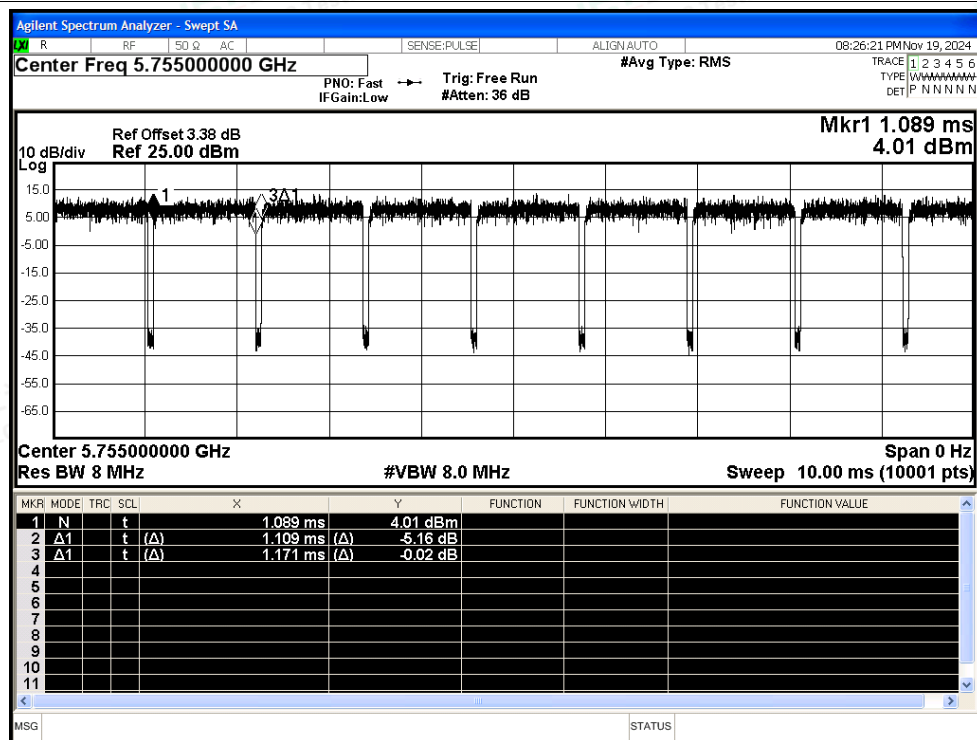


Duty Cycle NVNT n40 5795MHz Ant3

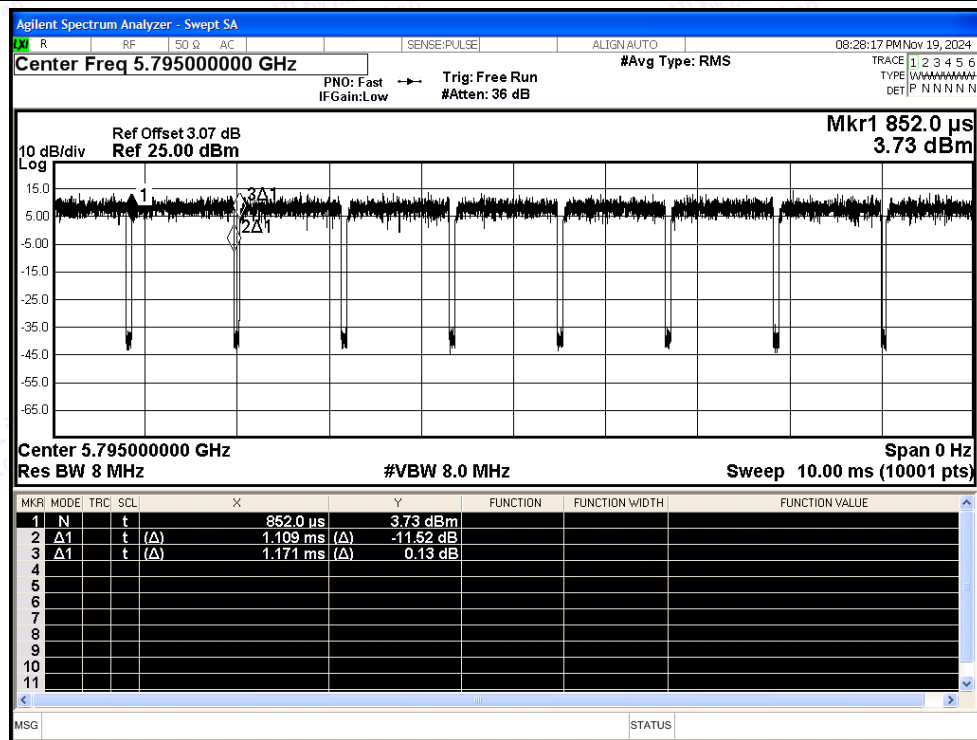




Duty Cycle NVNT ac20 5745MHz Ant3

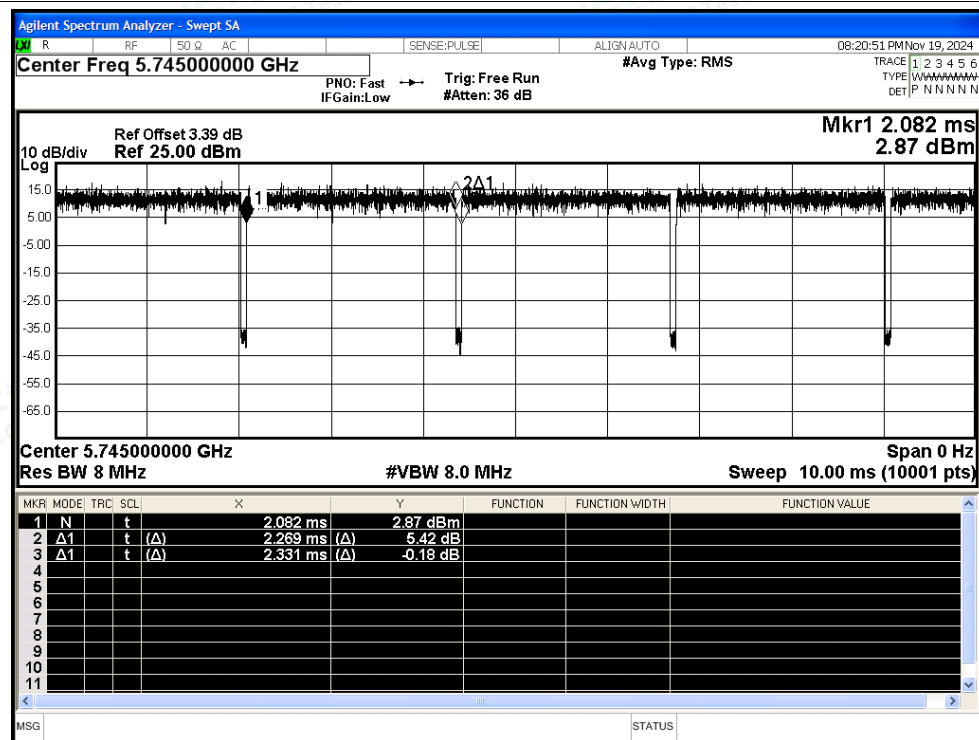


Duty Cycle NVNT ac20 5785MHz Ant3

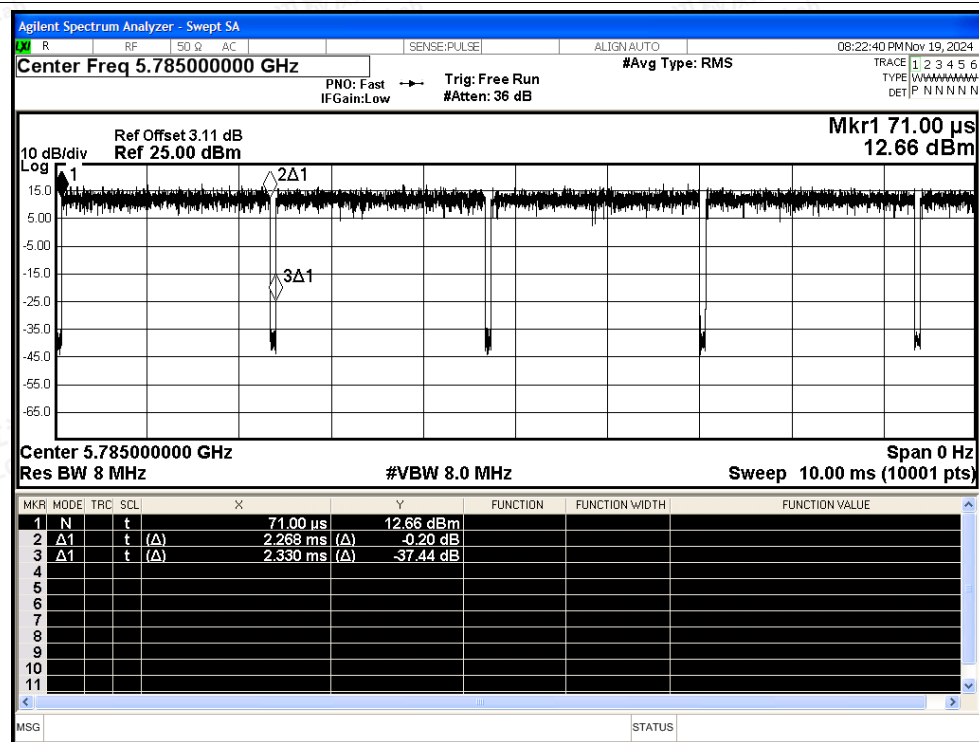


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Duty Cycle NVNT ac20 5825MHz Ant3

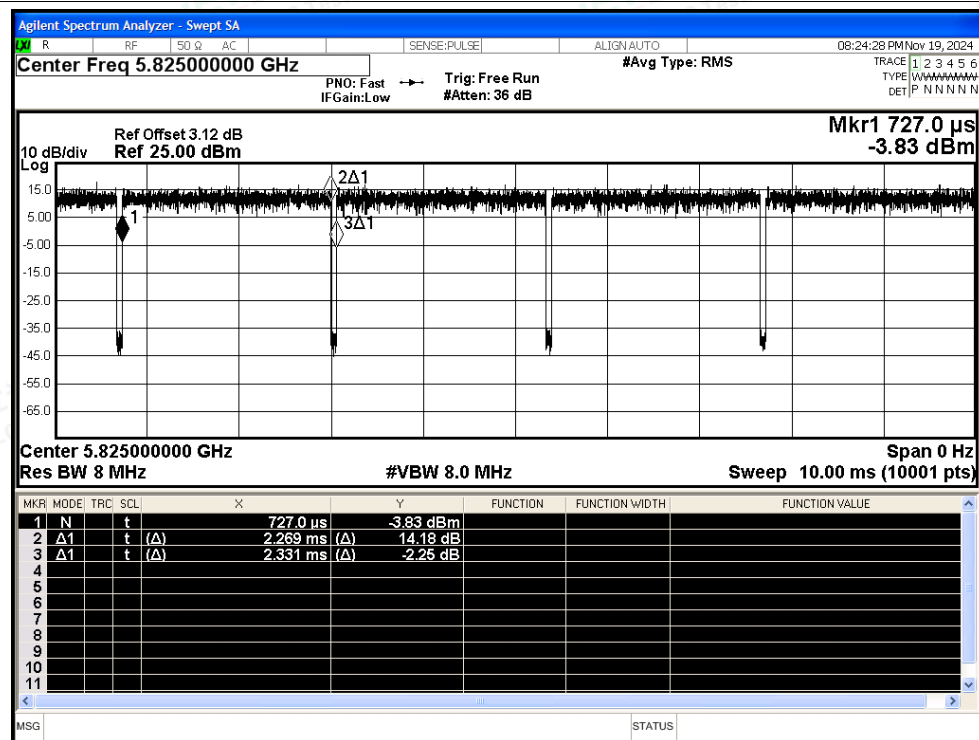


Duty Cycle NVNT ac40 5755MHz Ant3

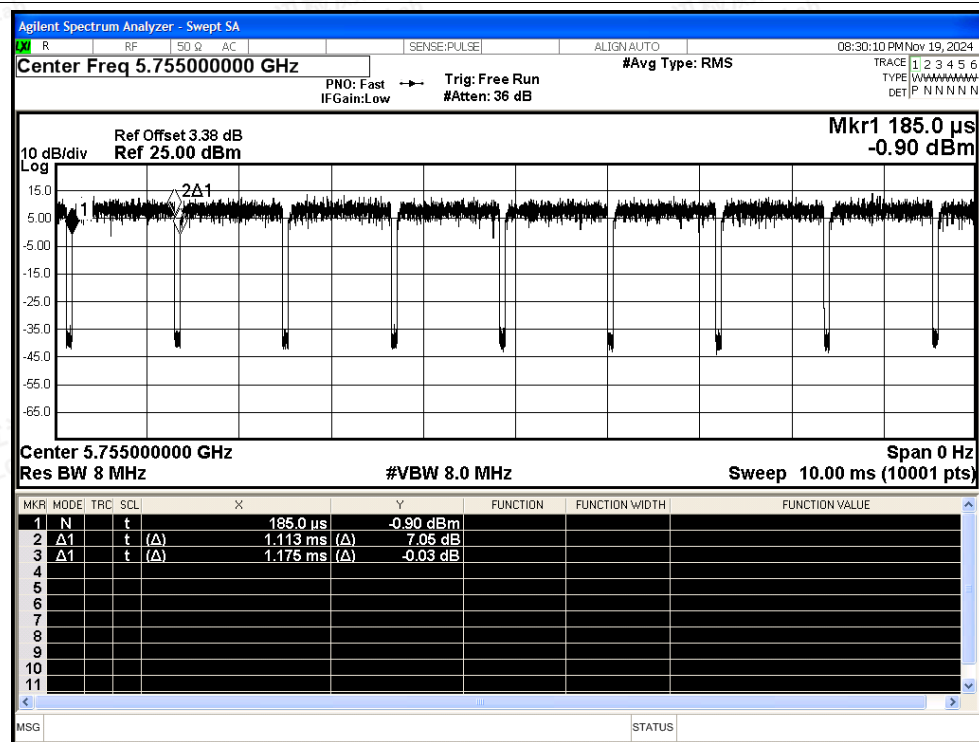


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Duty Cycle NVNT ac40 5795MHz Ant3

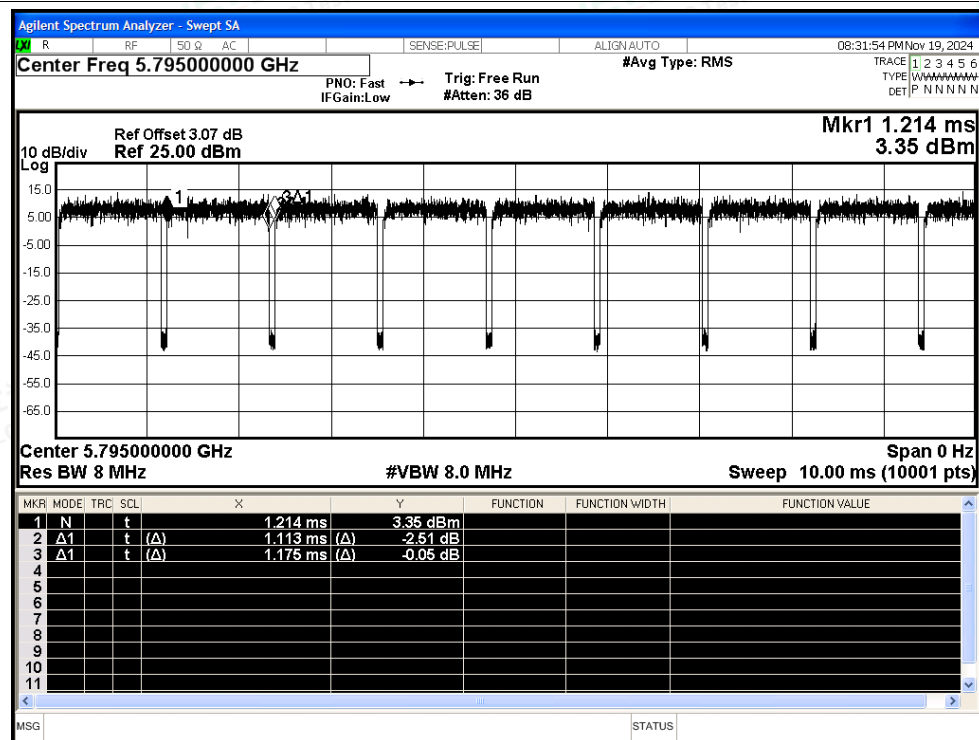

Duty Cycle NVNT ac80 5775MHz Ant3

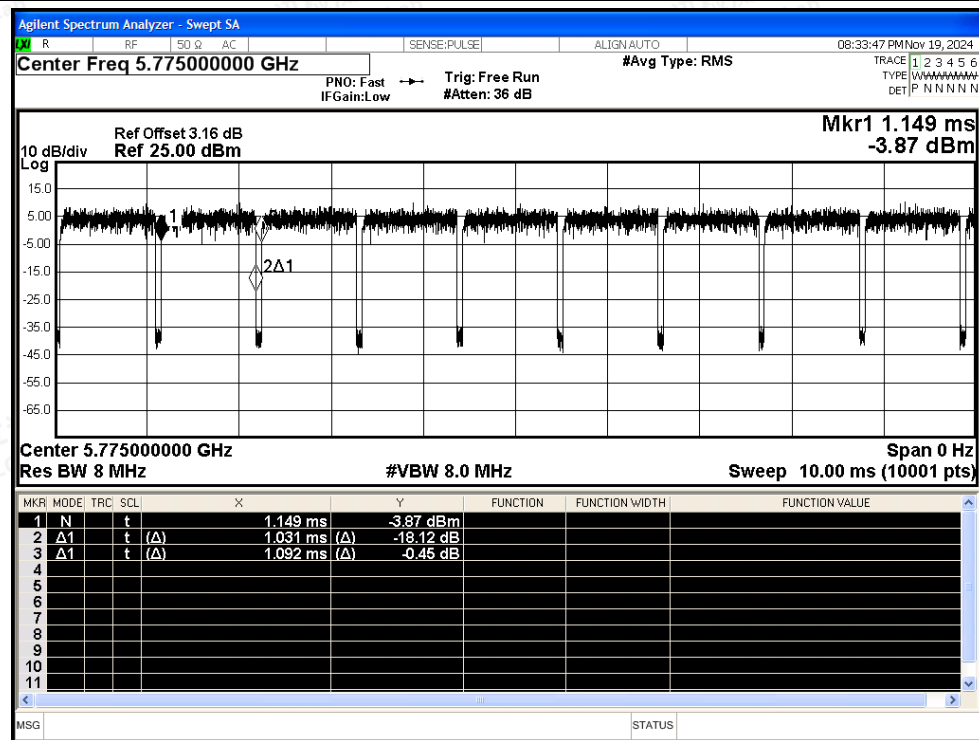

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant4	94.56	0.24	0.91
NVNT	a	5785	Ant4	94.65	0.24	0.91
NVNT	a	5825	Ant4	94.56	0.24	0.91
NVNT	n20	5745	Ant4	97.29	0.12	0.44
NVNT	n20	5785	Ant4	97.33	0.12	0.44
NVNT	n20	5825	Ant4	97.33	0.12	0.44
NVNT	n40	5755	Ant4	94.71	0.24	0.9
NVNT	n40	5795	Ant4	94.79	0.23	0.9
NVNT	ac20	5745	Ant4	97.34	0.12	0.44
NVNT	ac20	5785	Ant4	97.34	0.12	0.44
NVNT	ac20	5825	Ant4	97.3	0.12	0.44
NVNT	ac40	5755	Ant4	94.81	0.23	0.9
NVNT	ac40	5795	Ant4	94.72	0.24	0.9
NVNT	ac80	5775	Ant4	94.41	0.25	0.97




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5745MHz Ant4

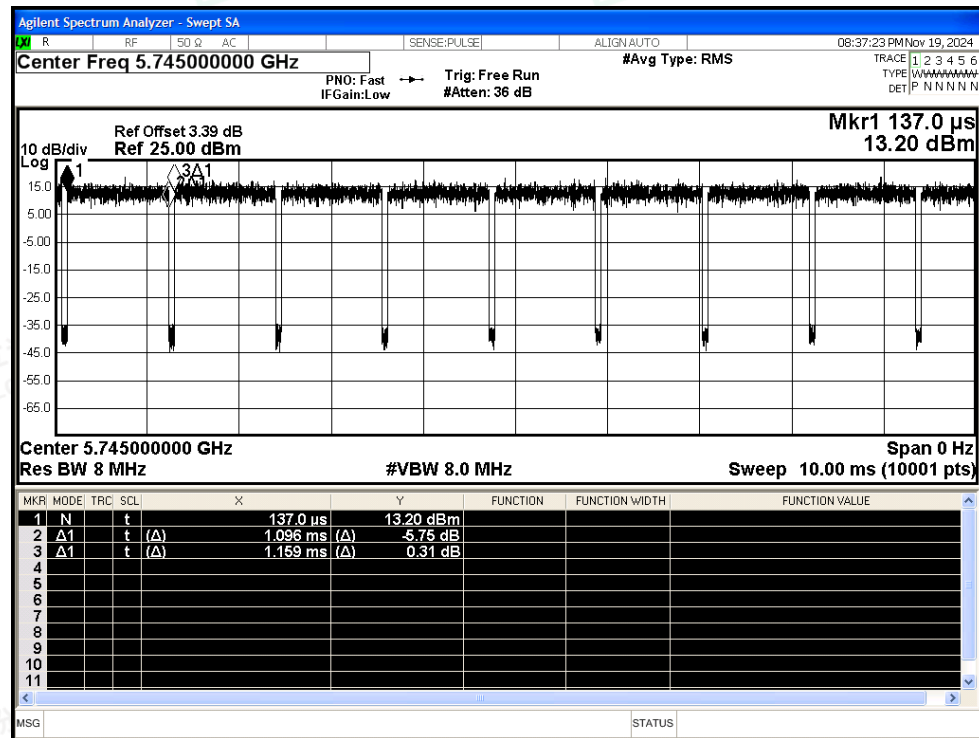


Duty Cycle NVNT a 5785MHz Ant4

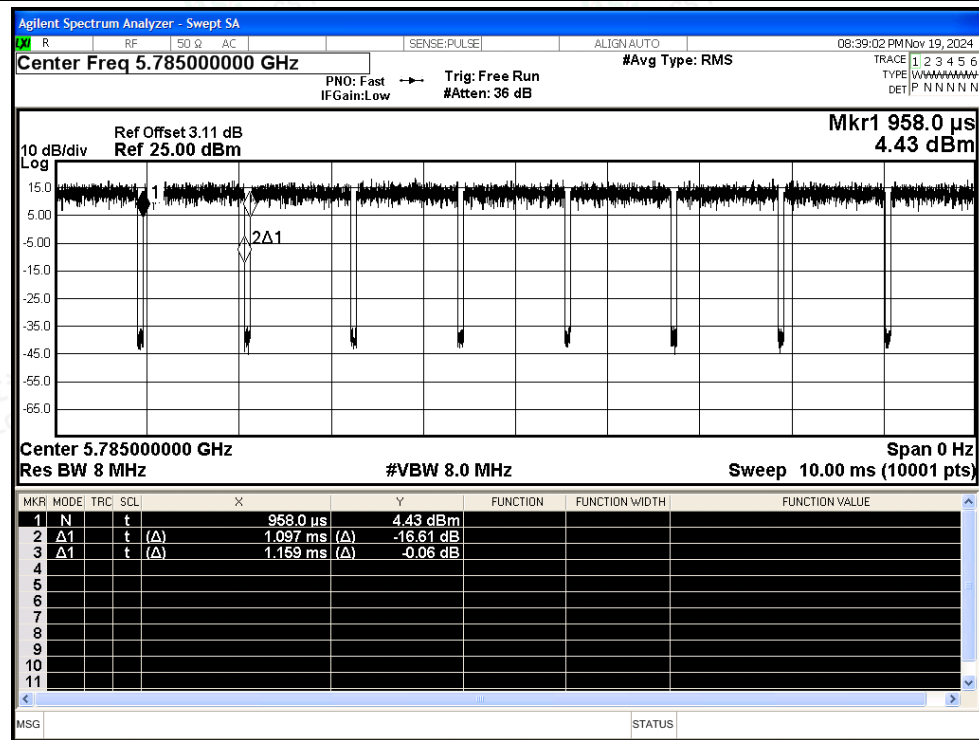




Duty Cycle NVNT a 5825MHz Ant4

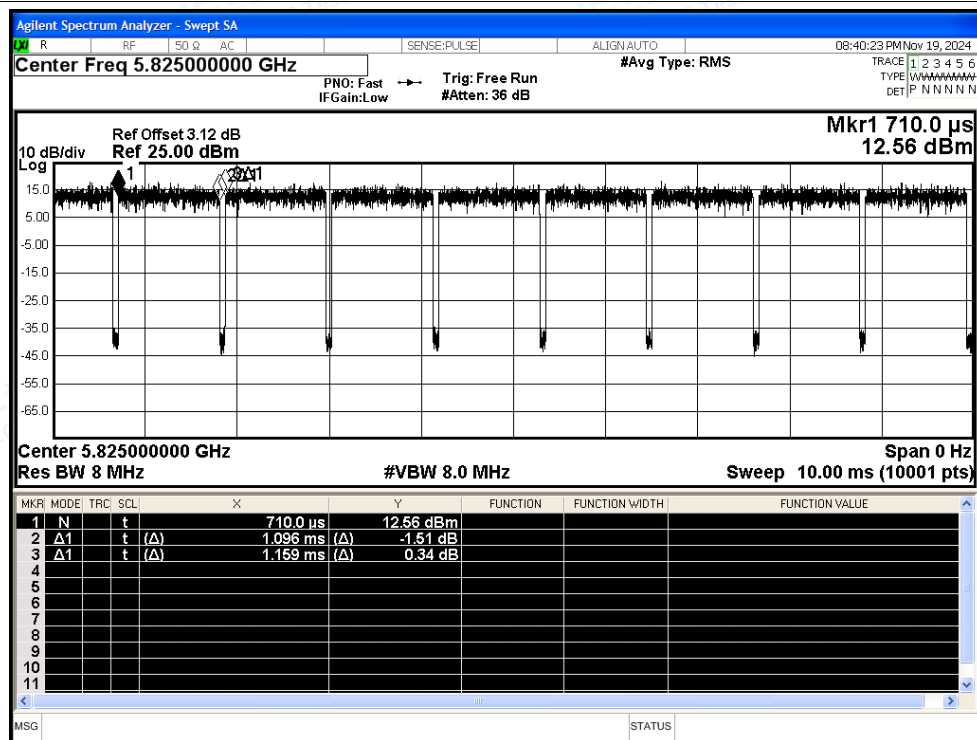


Duty Cycle NVNT n20 5745MHz Ant4

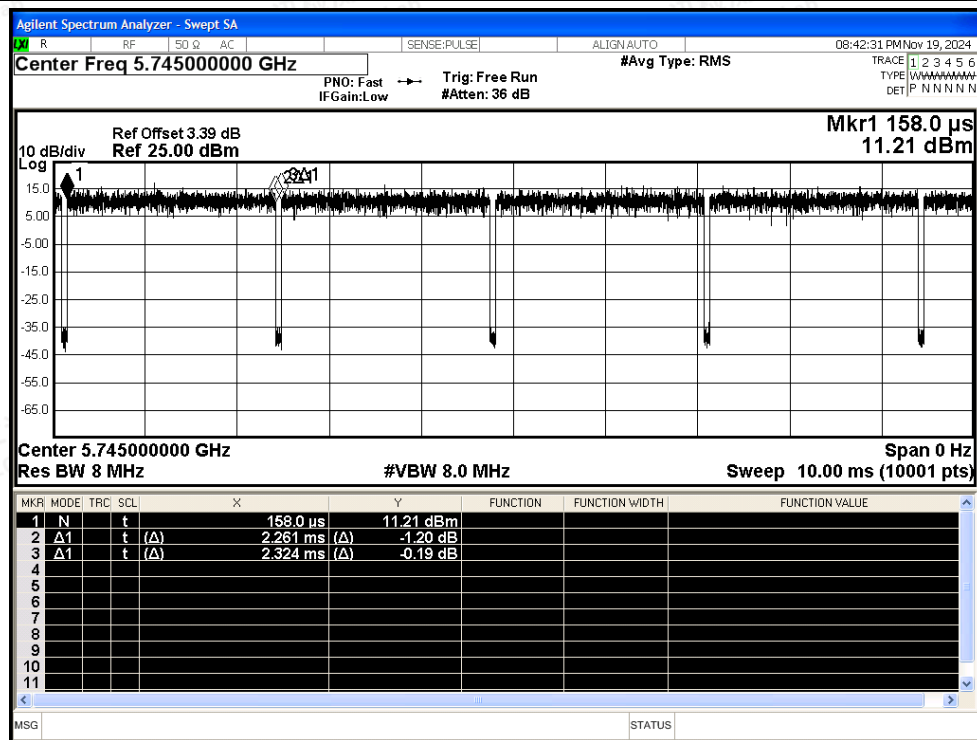


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Duty Cycle NVNT n20 5785MHz Ant4

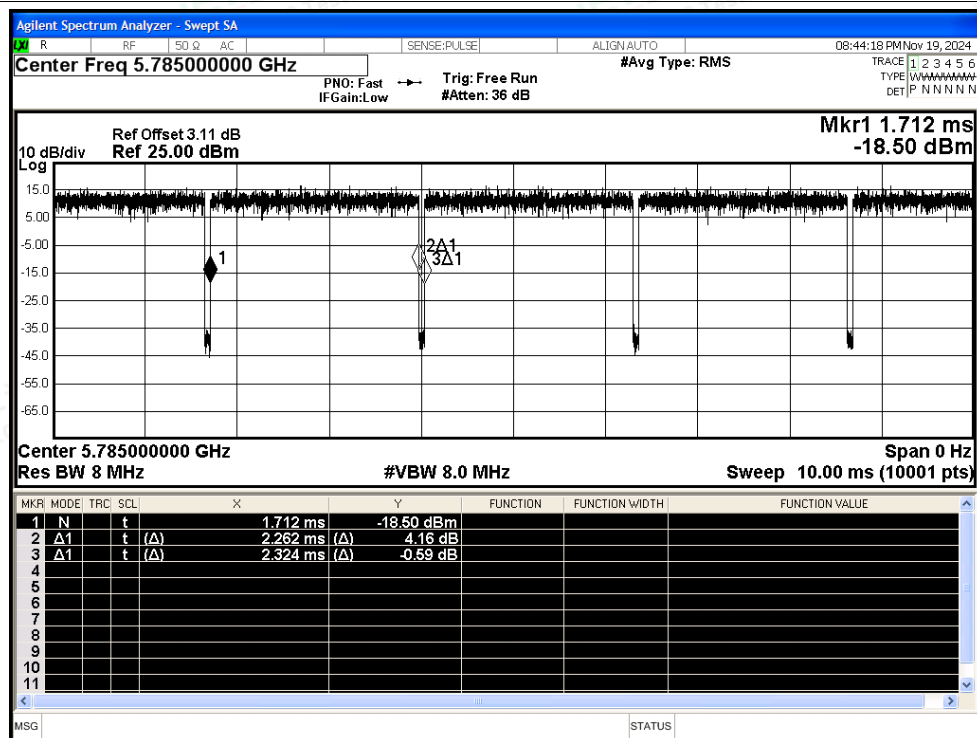


Duty Cycle NVNT n20 5825MHz Ant4

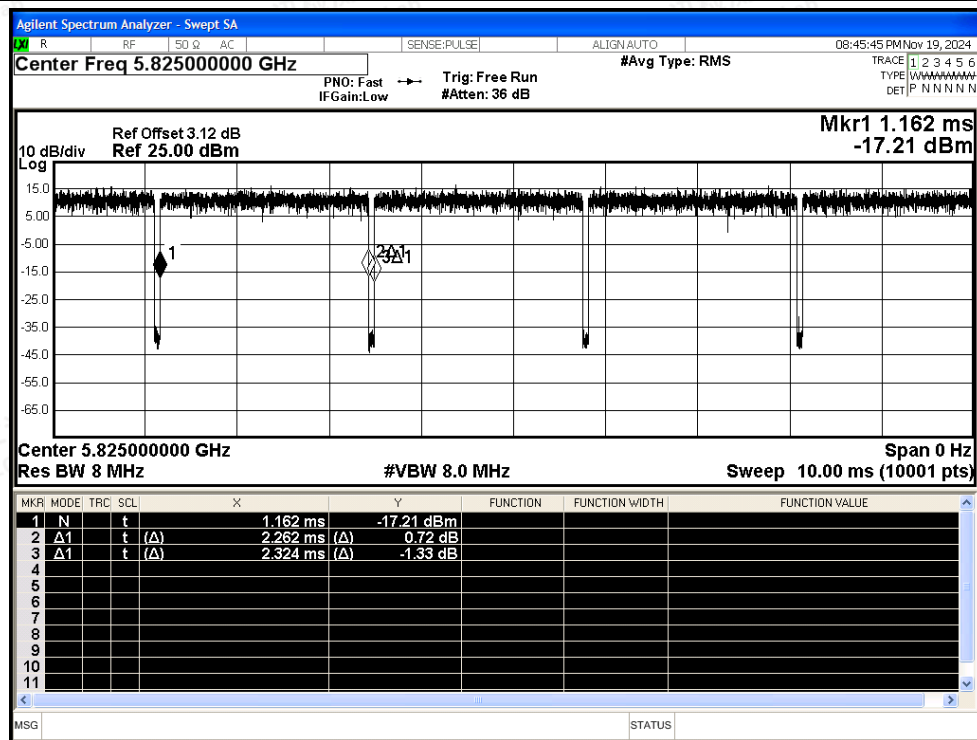


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Duty Cycle NVNT n40 5755MHz Ant4

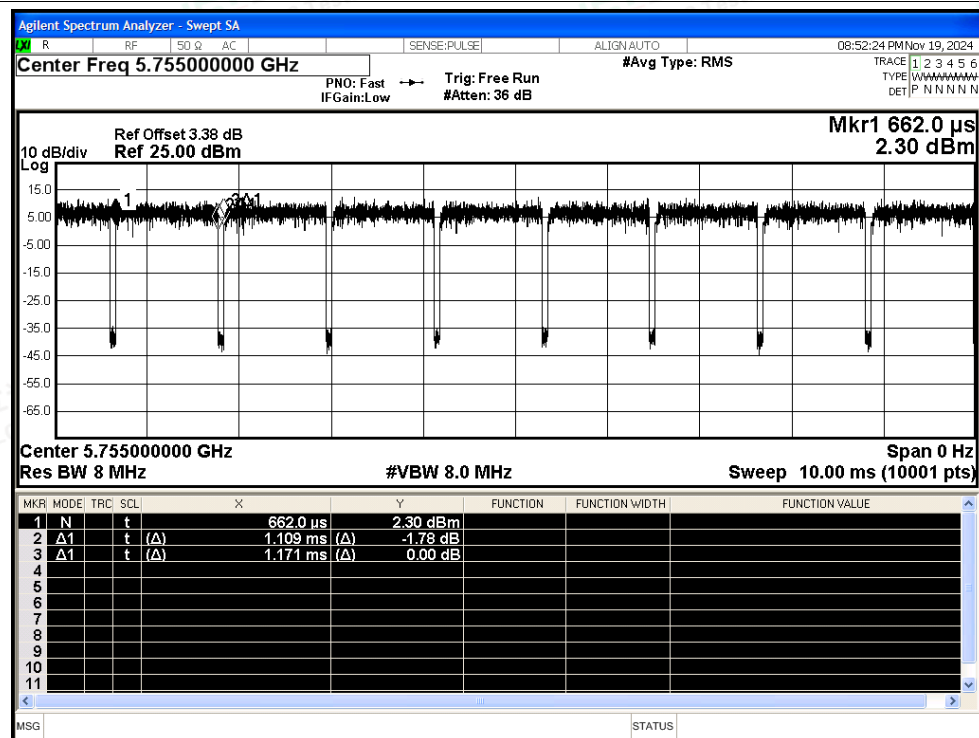


Duty Cycle NVNT n40 5795MHz Ant4

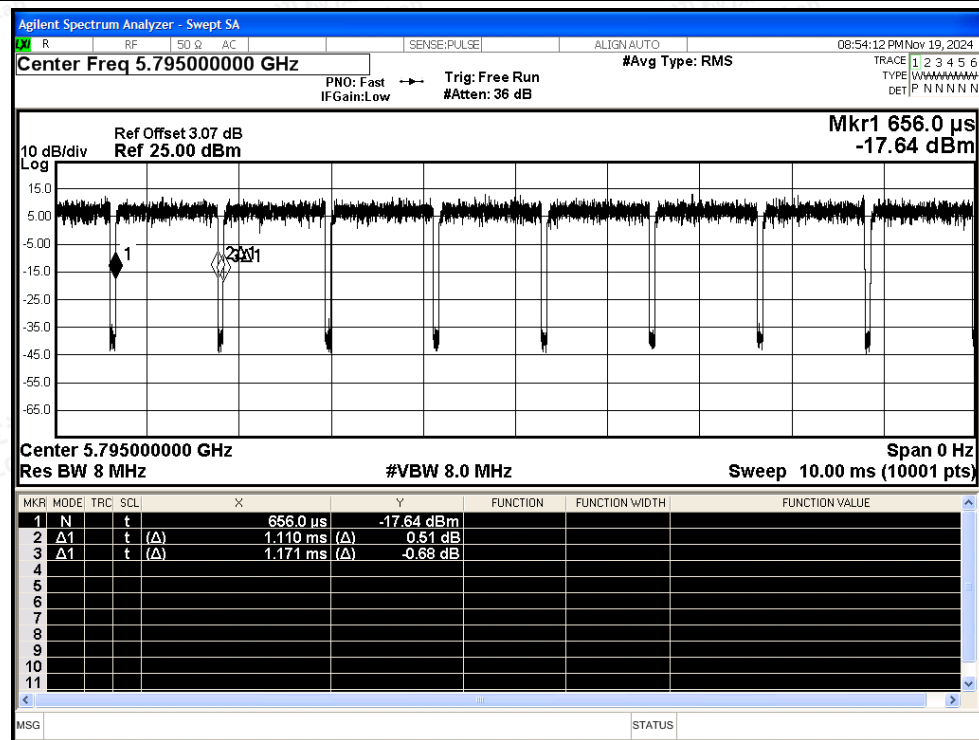


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Duty Cycle NVNT ac20 5745MHz Ant4

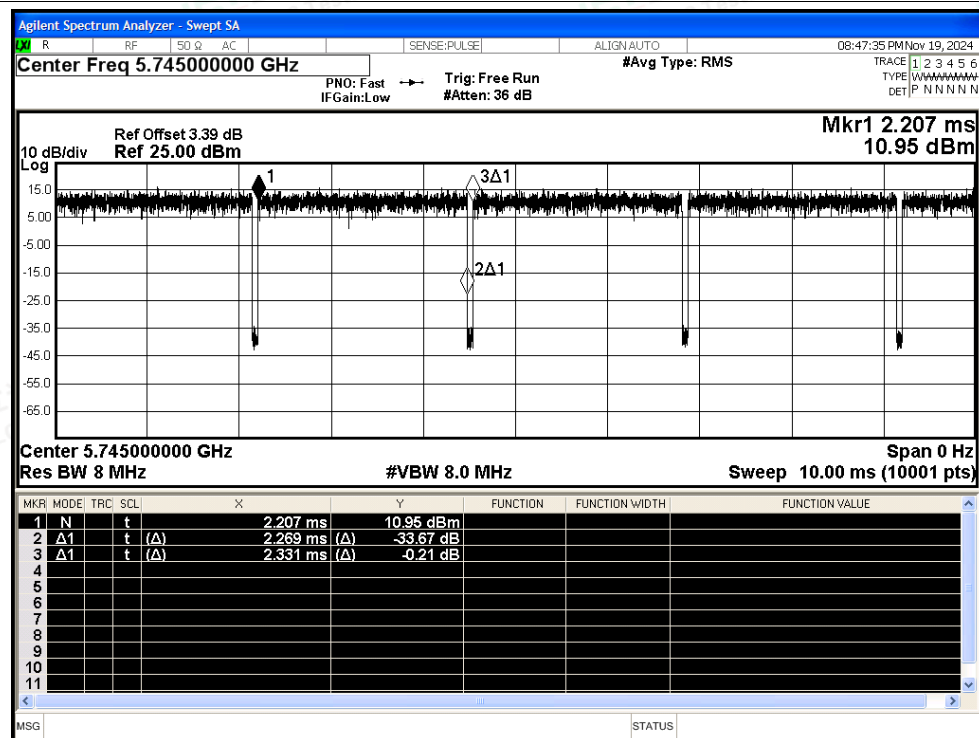


Duty Cycle NVNT ac20 5785MHz Ant4

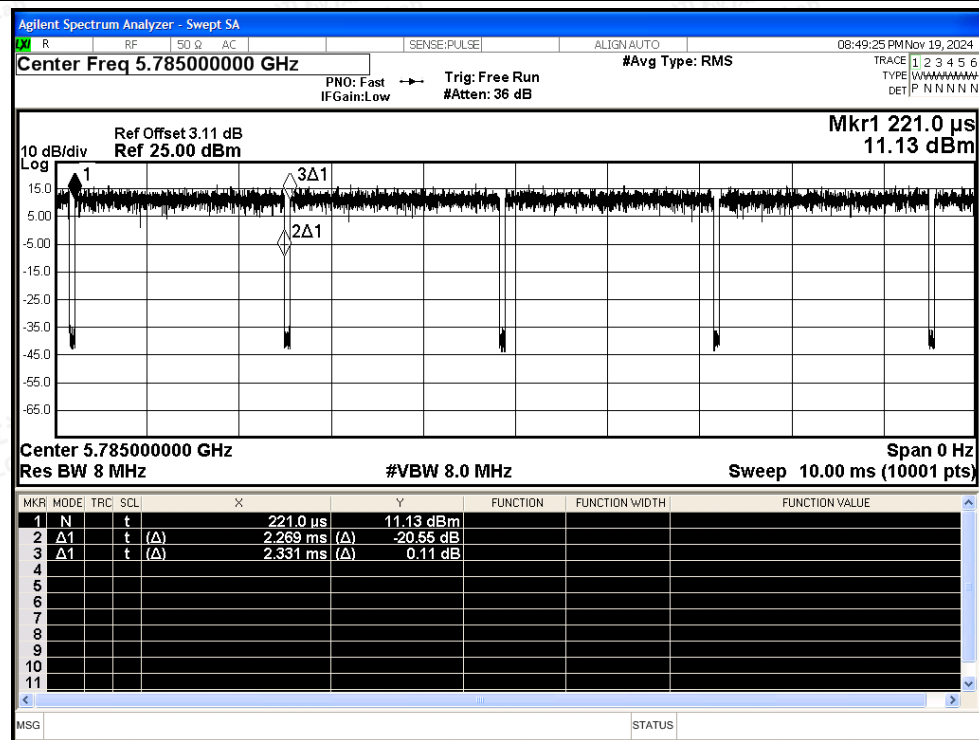


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Duty Cycle NVNT ac20 5825MHz Ant4

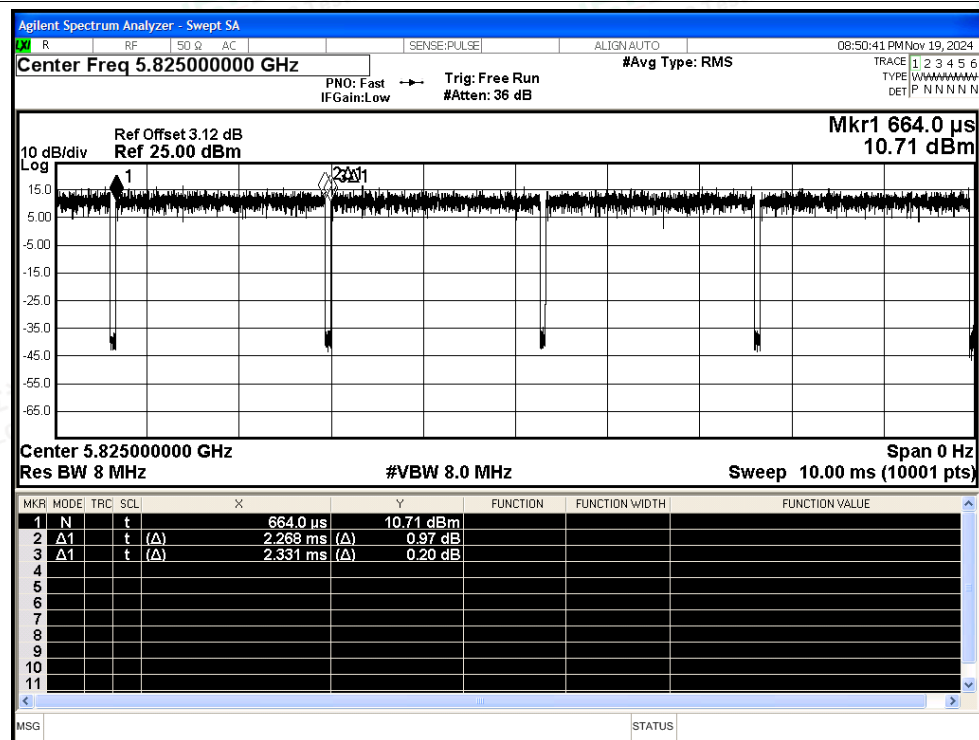


Duty Cycle NVNT ac40 5755MHz Ant4

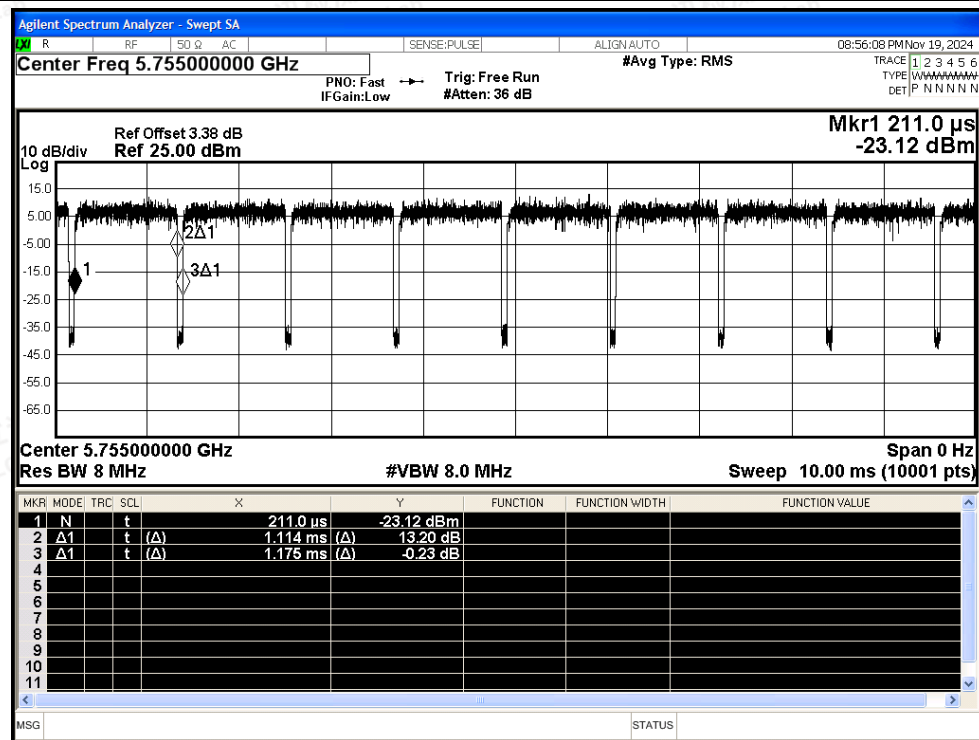


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Duty Cycle NVNT ac40 5795MHz Ant4

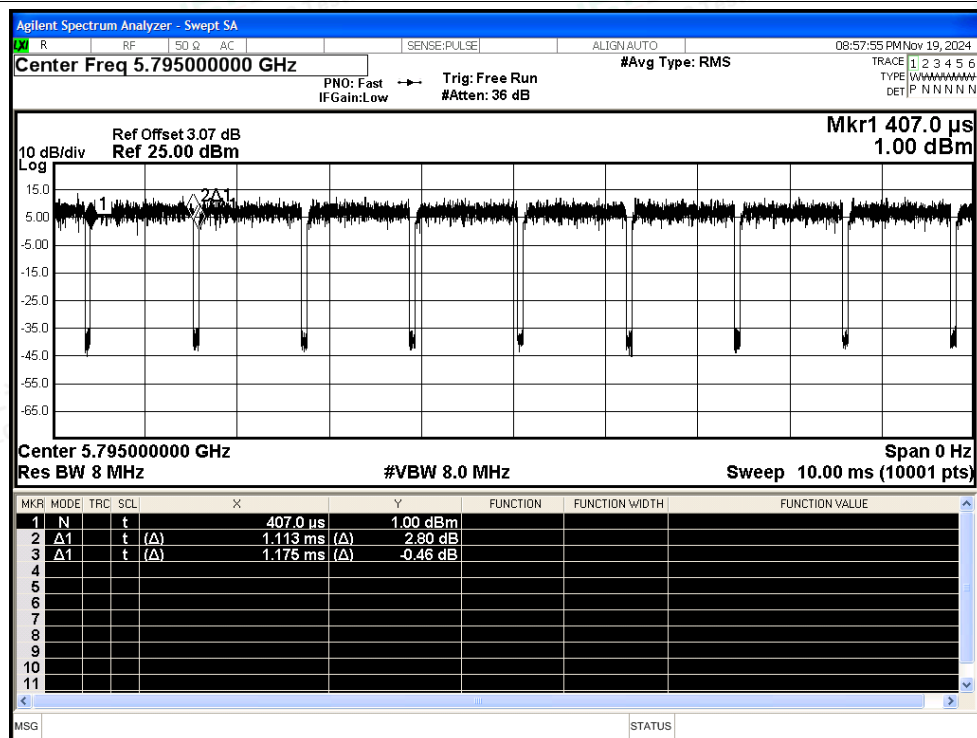

Duty Cycle NVNT ac80 5775MHz Ant4

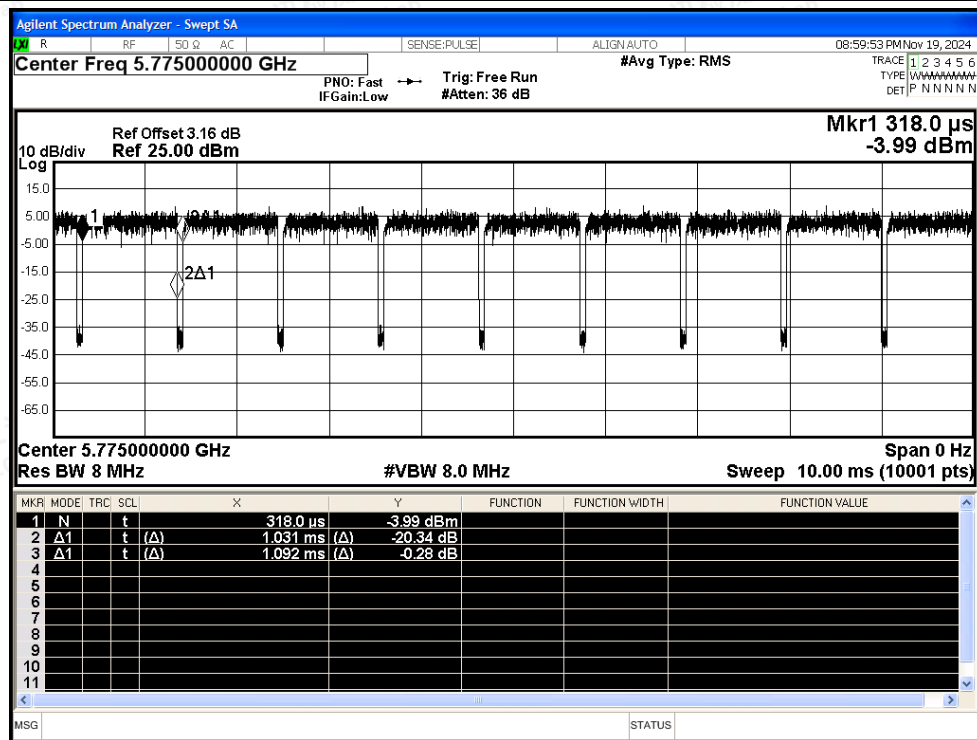

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity