


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

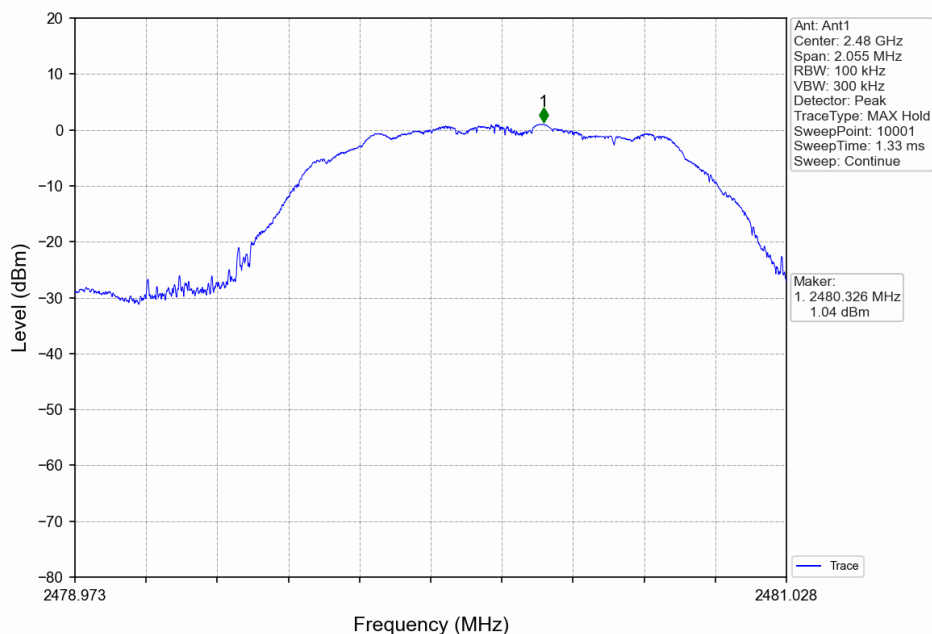


6.2 CSE

6.2.1 Test Result

Mode	TX Type	Frequency (MHz)	Packet Type	Ant	Level of Reference (dBm)	Limit (dBm)	Verdict
GFSK	SISO	2402	DH5	1	2.58	-17.42	Pass
		2441	DH5	1	2.58	-17.42	Pass
		2480	DH5	1	2.58	-17.42	Pass
		HOPP	DH5	1	2.58	-17.42	Pass
Pi/4DQPSK	SISO	2402	2DH5	1	1.21	-18.79	Pass
		2441	2DH5	1	1.21	-18.79	Pass
		2480	2DH5	1	1.21	-18.79	Pass
		HOPP	2DH5	1	1.21	-18.79	Pass
8DPSK	SISO	2402	3DH5	1	1.04	-18.96	Pass
		2441	3DH5	1	1.04	-18.96	Pass
		2480	3DH5	1	1.04	-18.96	Pass
		HOPP	3DH5	1	1.04	-18.96	Pass

Note1: Refer to FCC Part 15.247 (d) and ANSI C63.10-2013, the channel contains the maximum PSD level was used to establish the reference level.


6.2.2 Test Graph

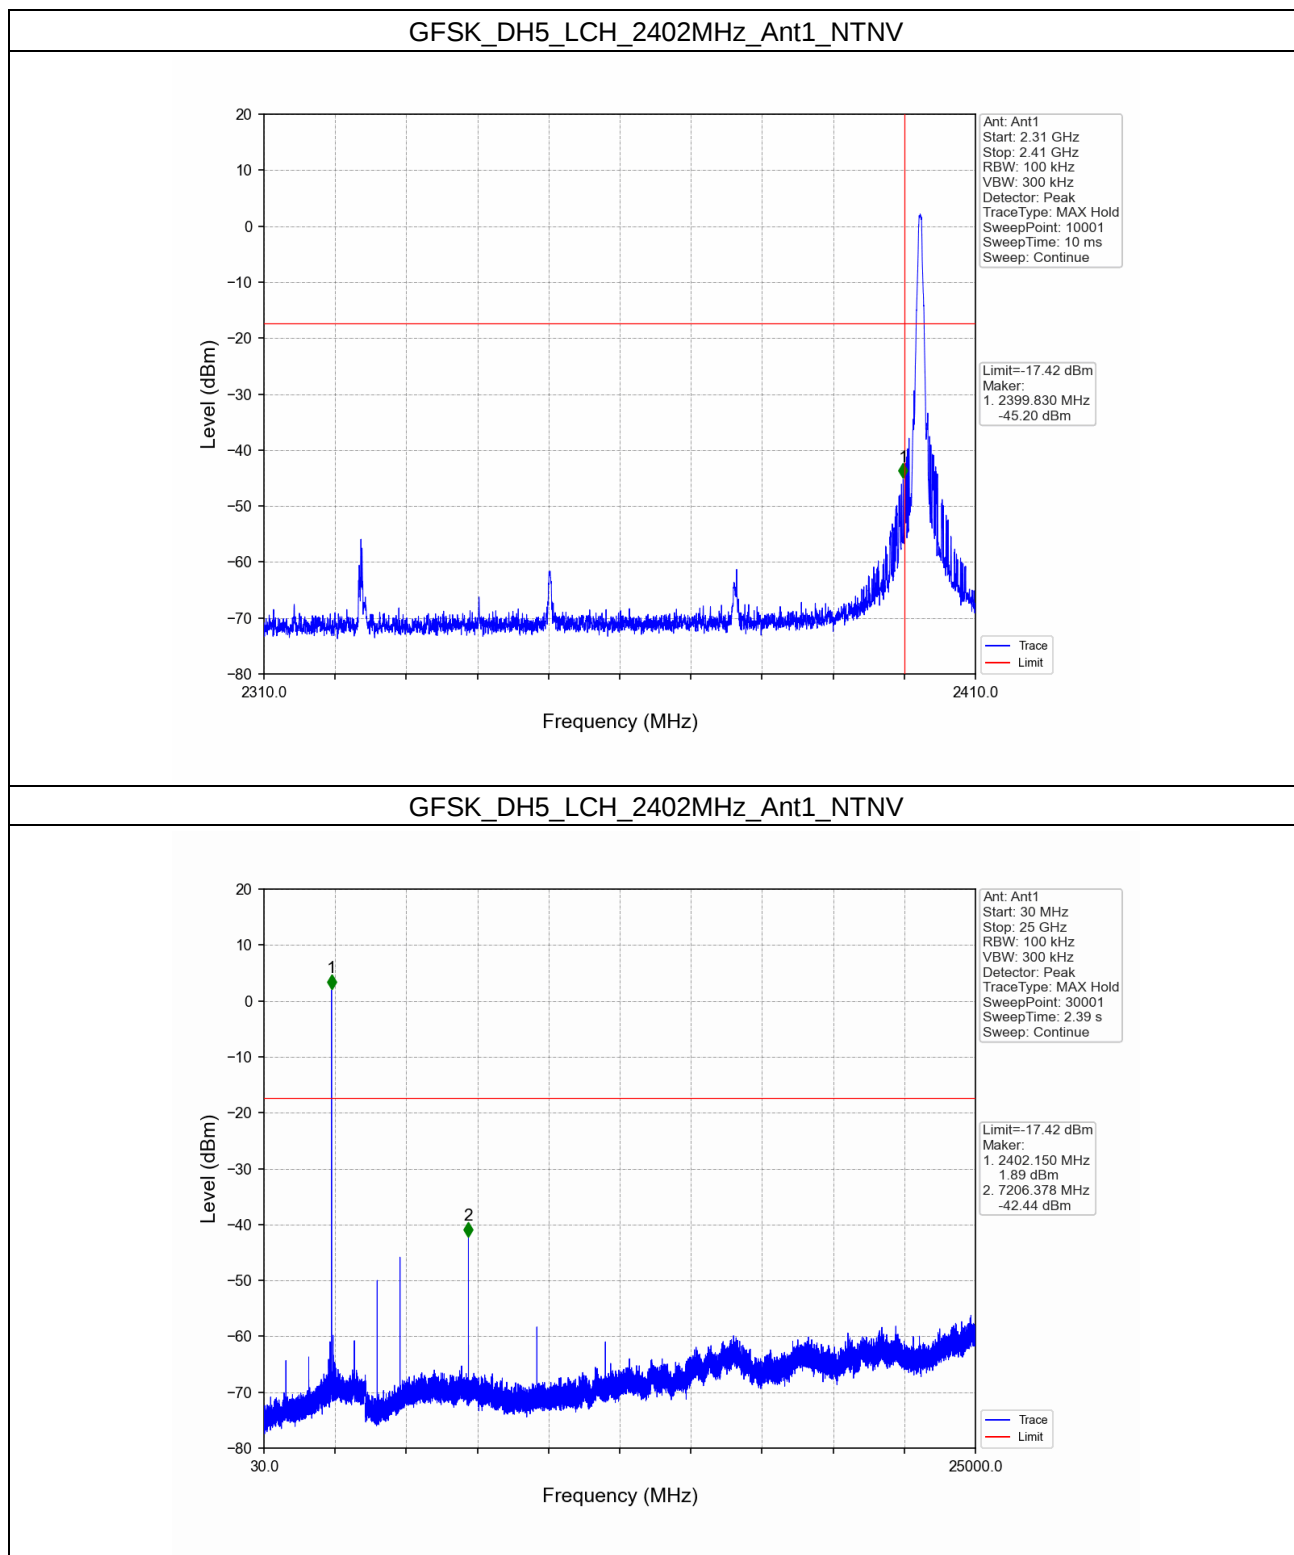


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


GFSK_DH5_MCH_2441MHz_Ant1_NTNV

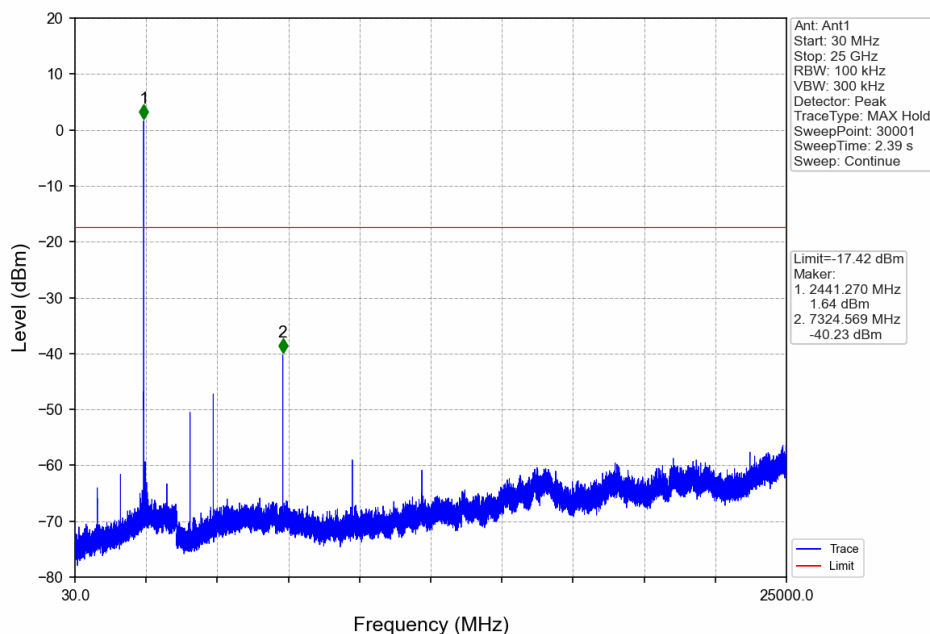


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

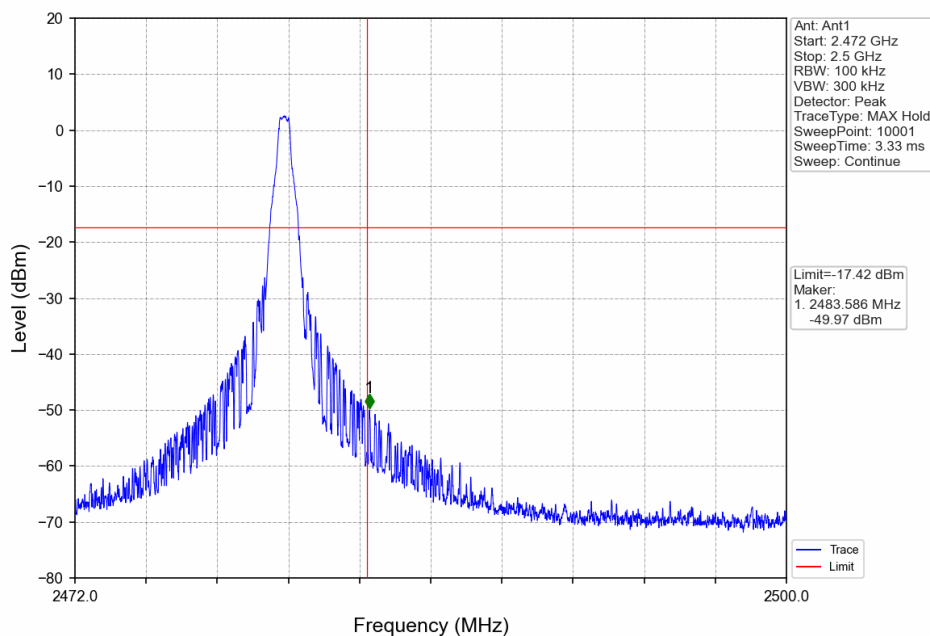


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

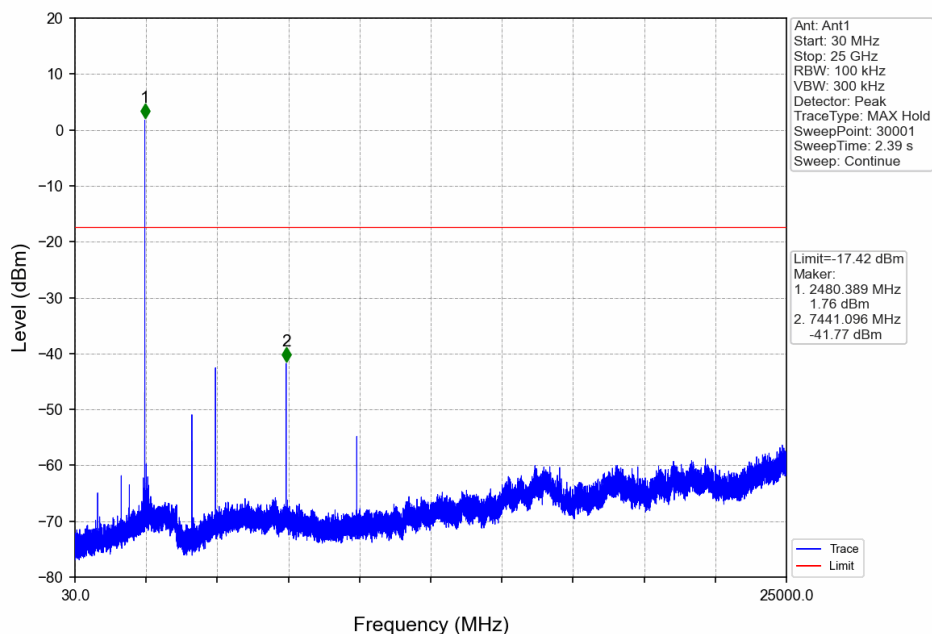


GFSK_DH5_HOPP_Ant1_NTNV

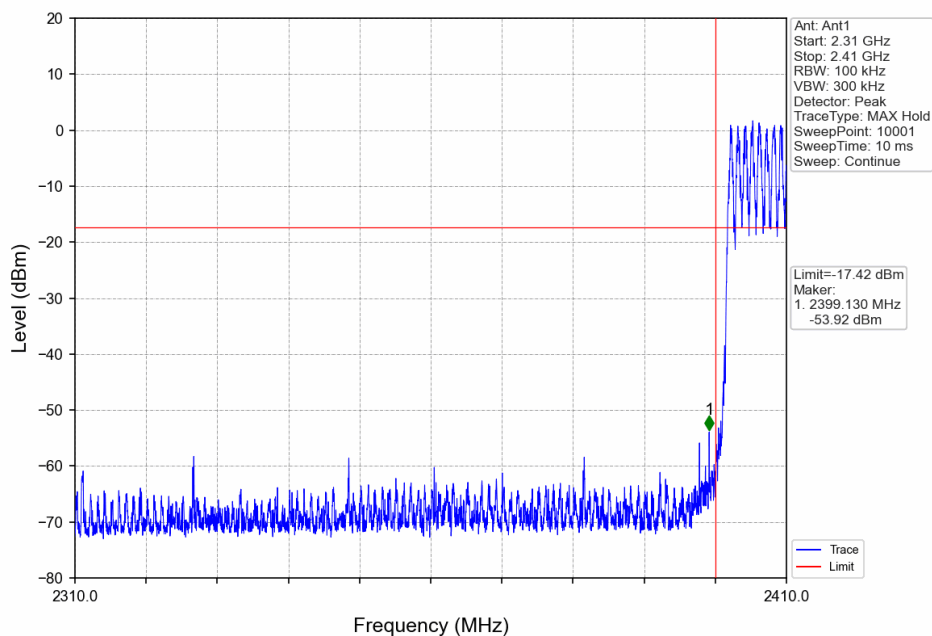


GFSK_DH5_HOPP_Ant1_NTNV

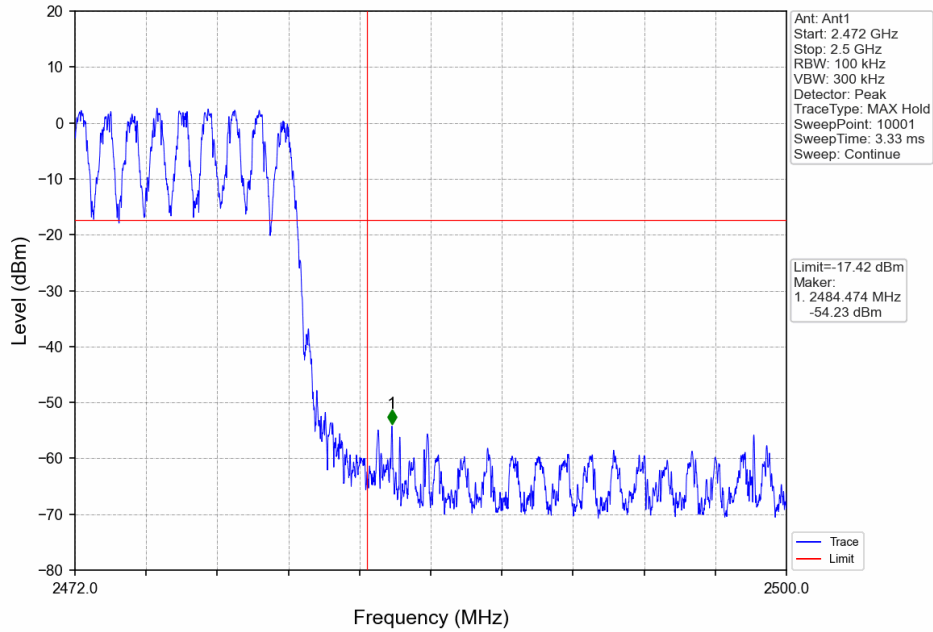


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

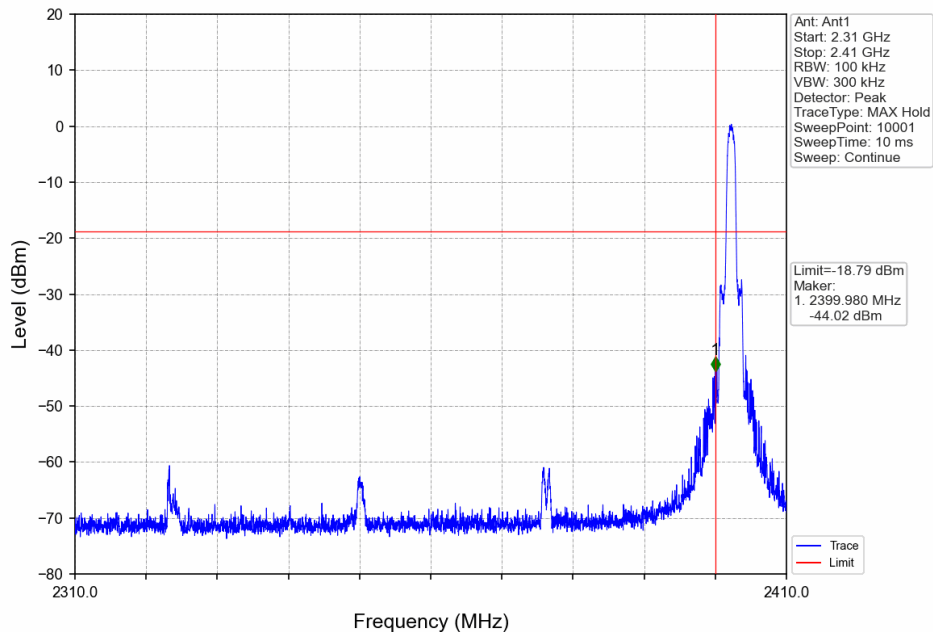


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

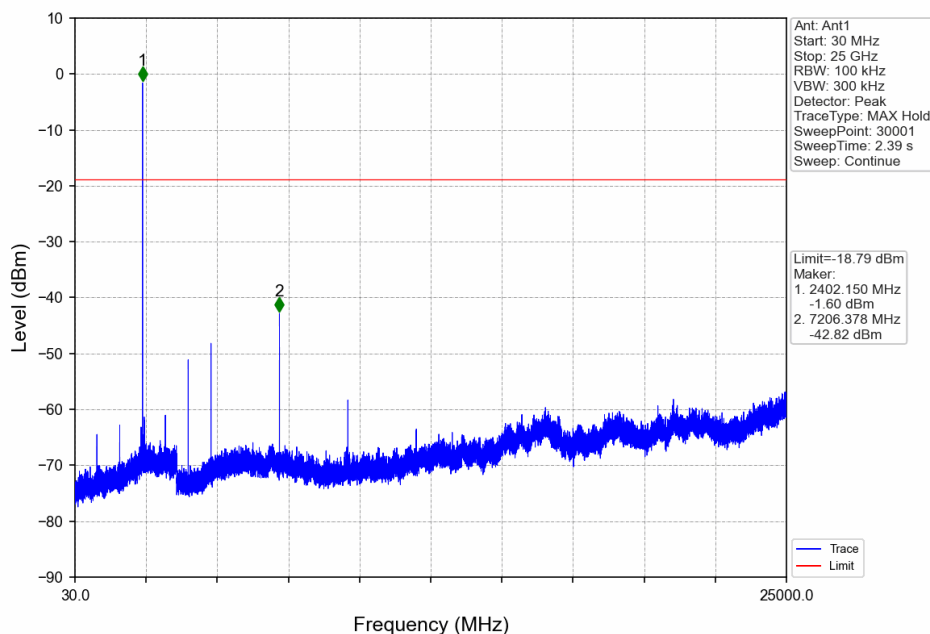


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

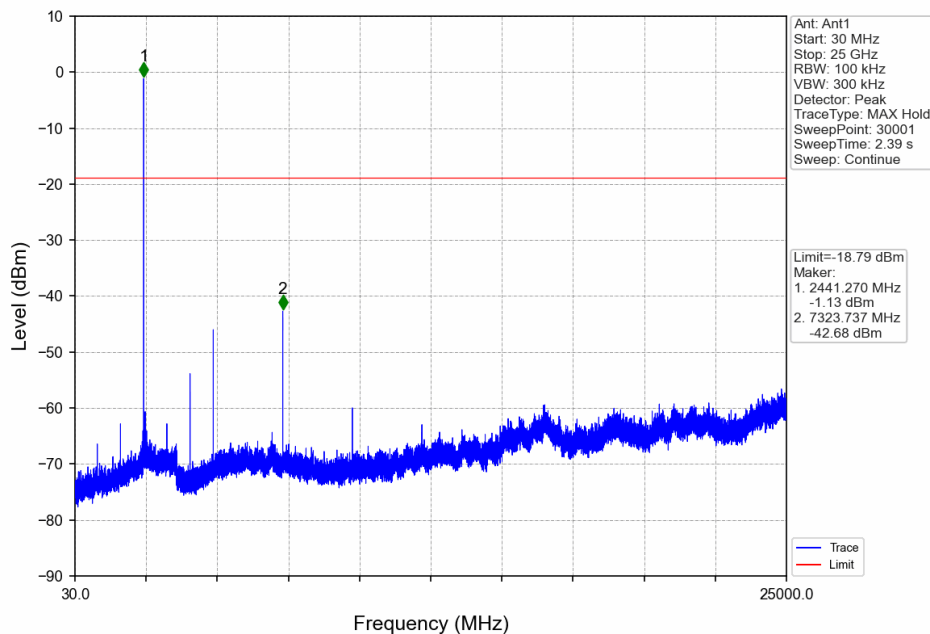


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

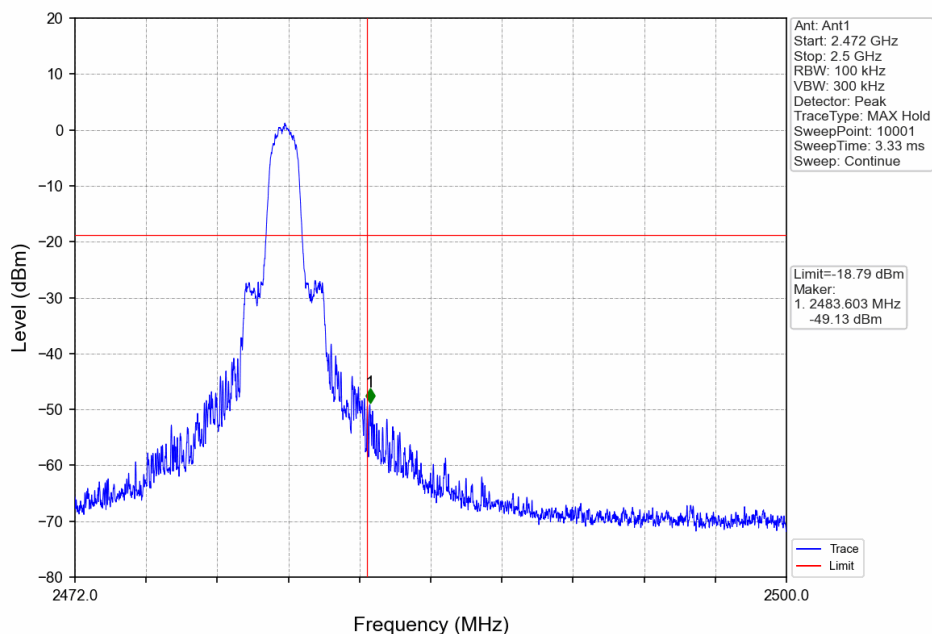


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

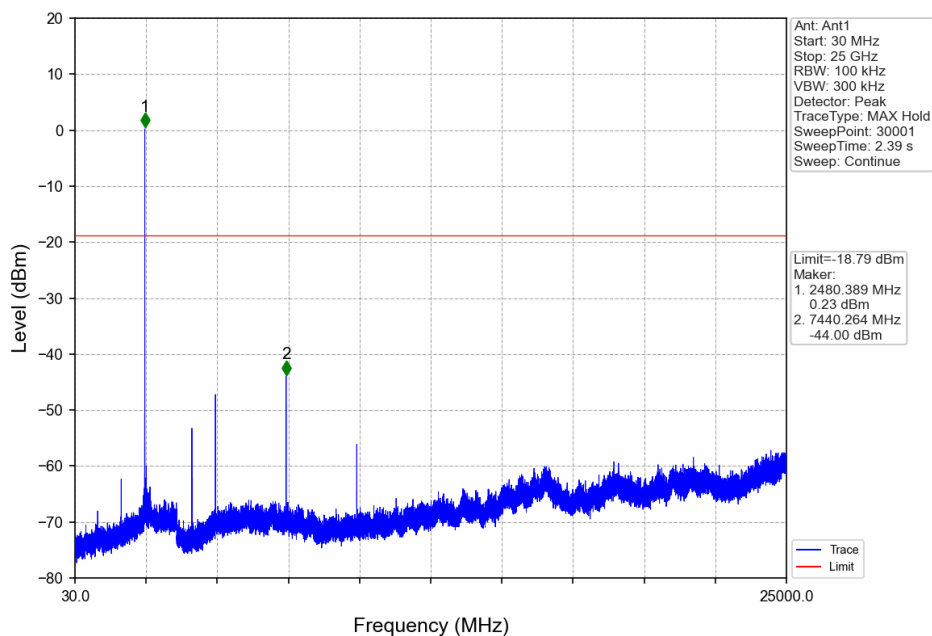


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

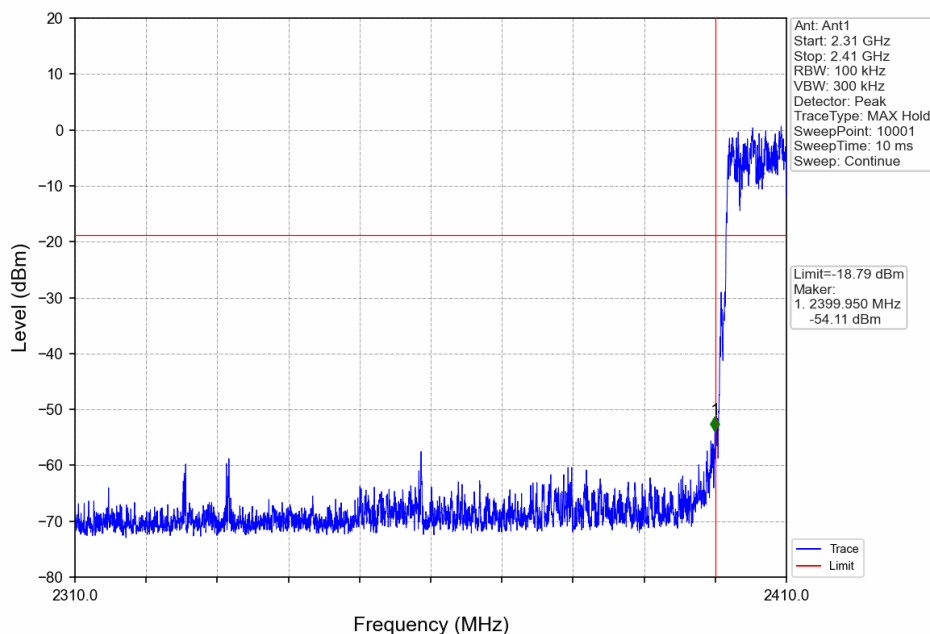


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

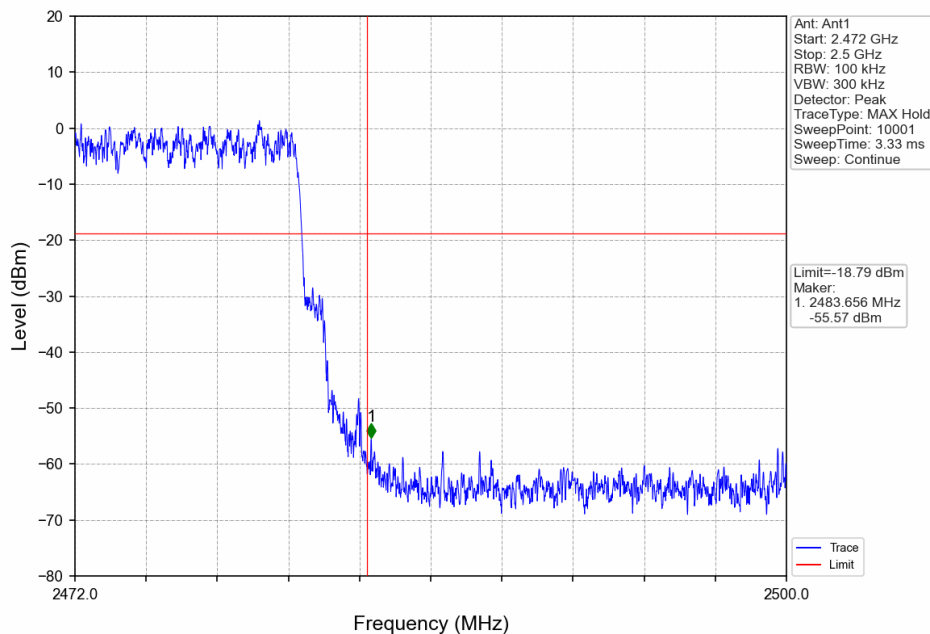


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

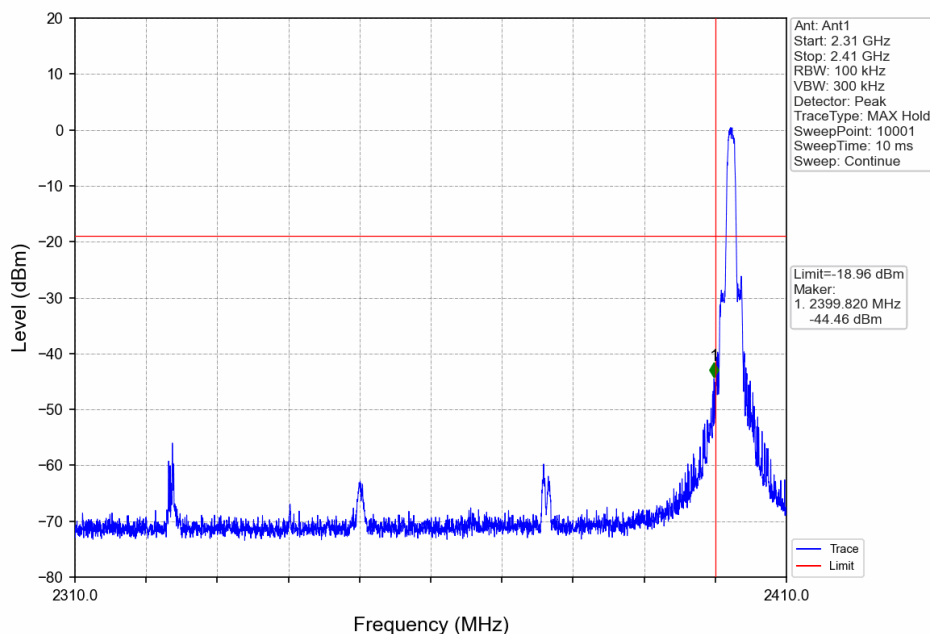


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

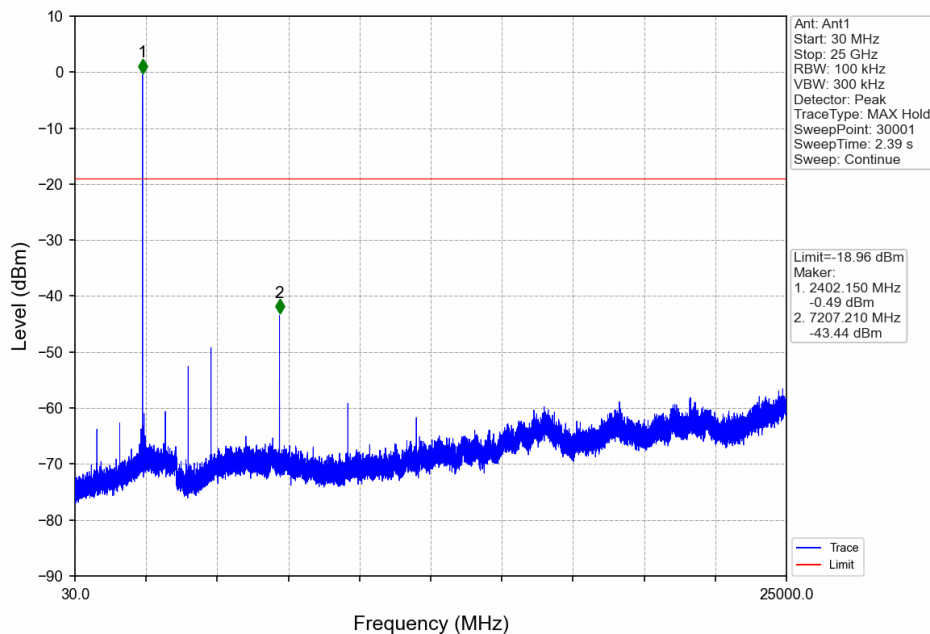


8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

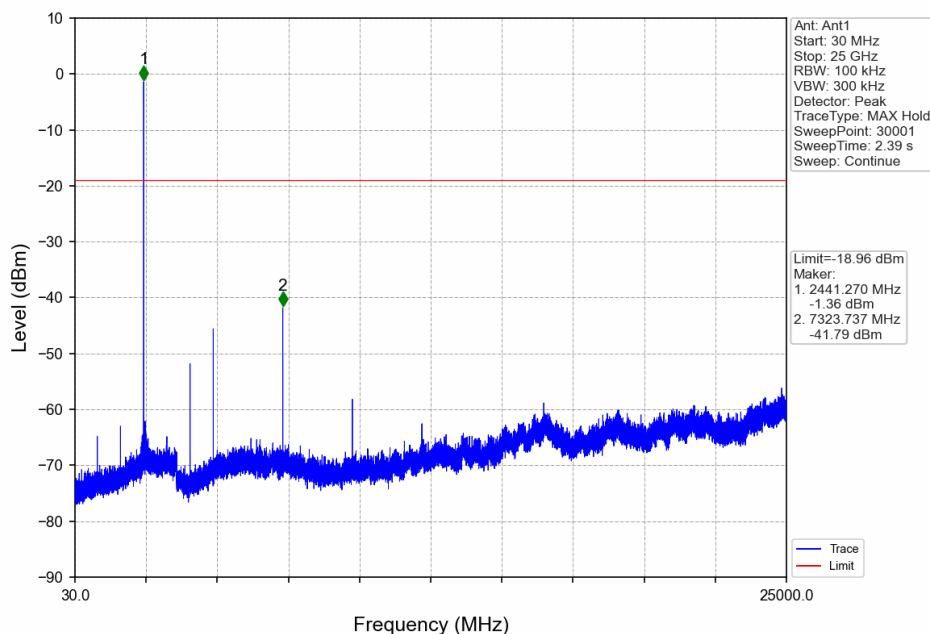


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

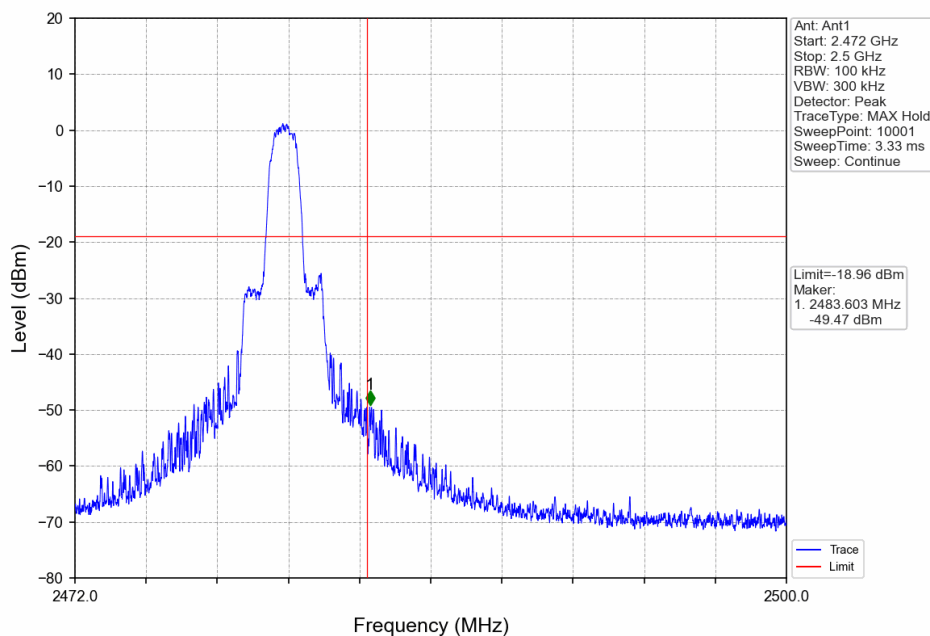


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

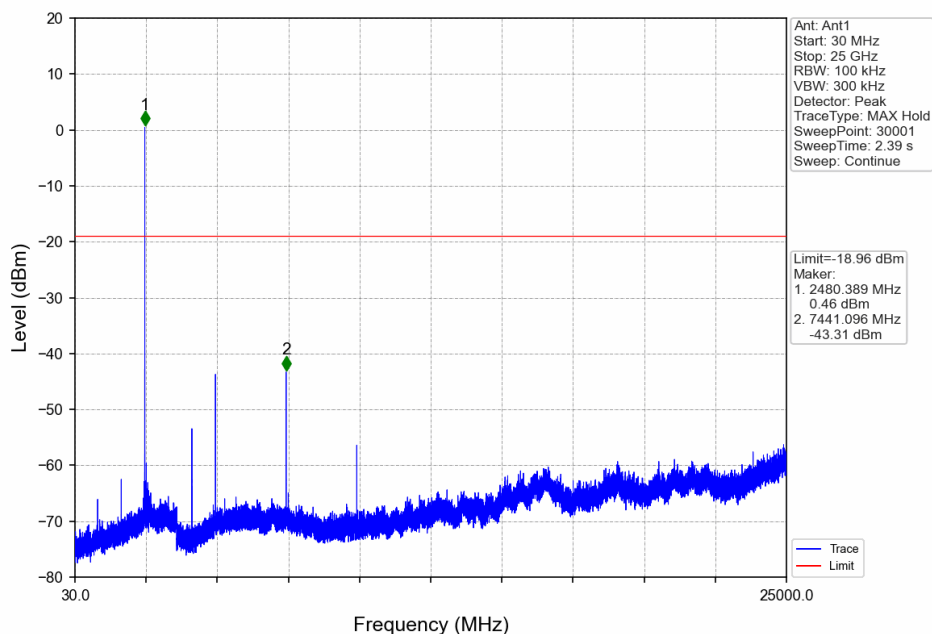

8DPSK_3DH5_HOPP_Ant1_NTNV

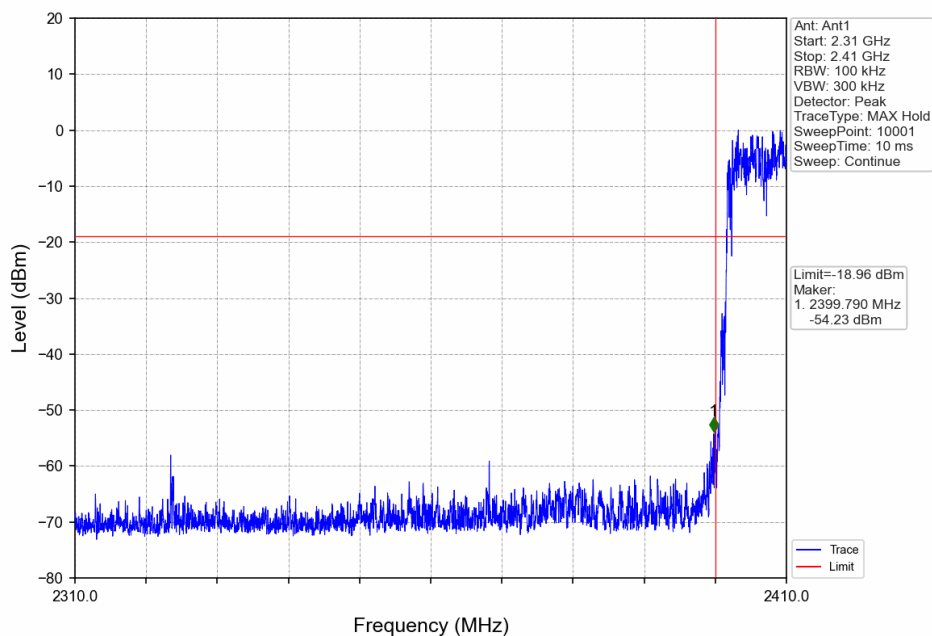

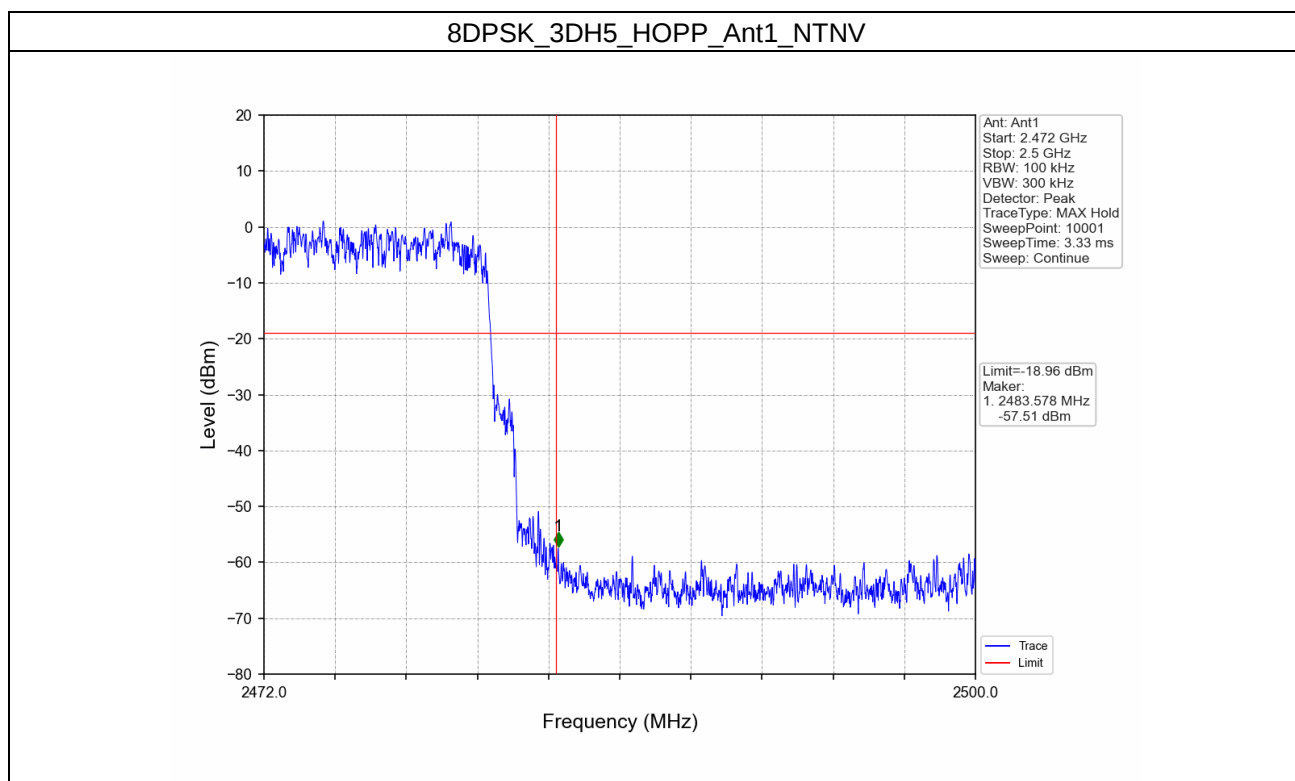

- End of the Report -