





Restrict Band NVNT n20 5260MHz Ant1 Peak

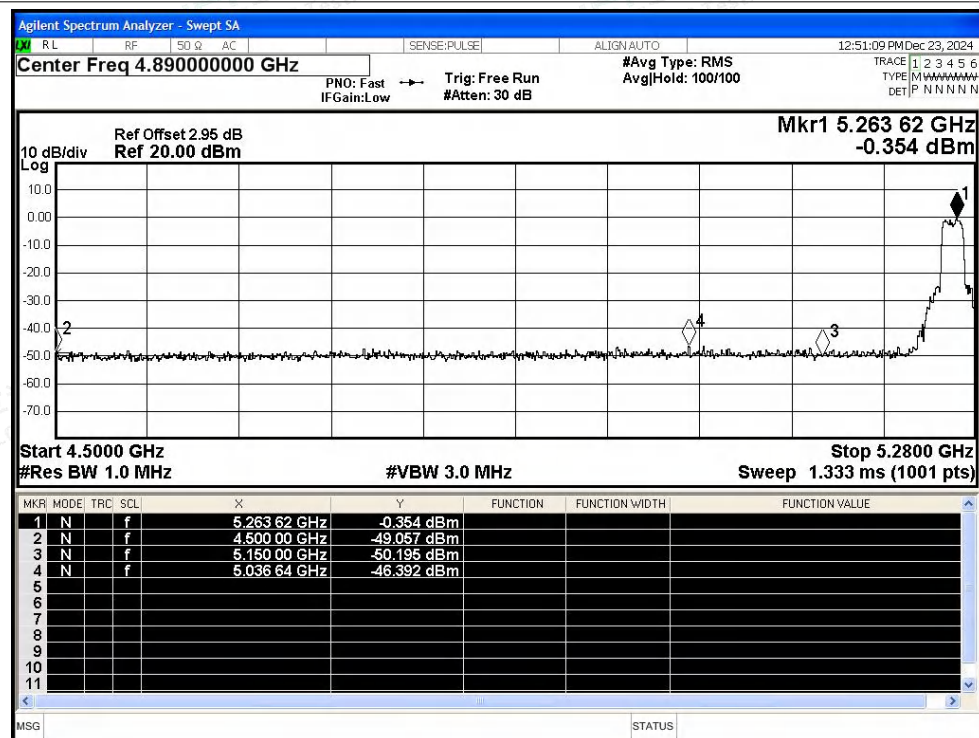

Restrict Band NVNT n20 5260MHz Ant1 Average

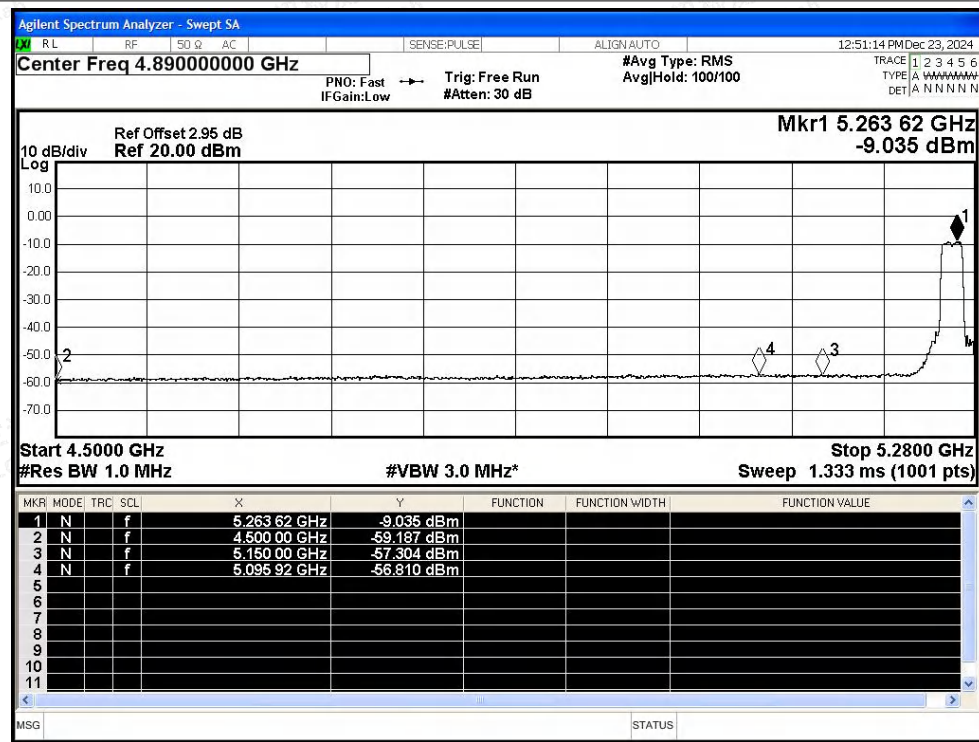

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant1 Peak

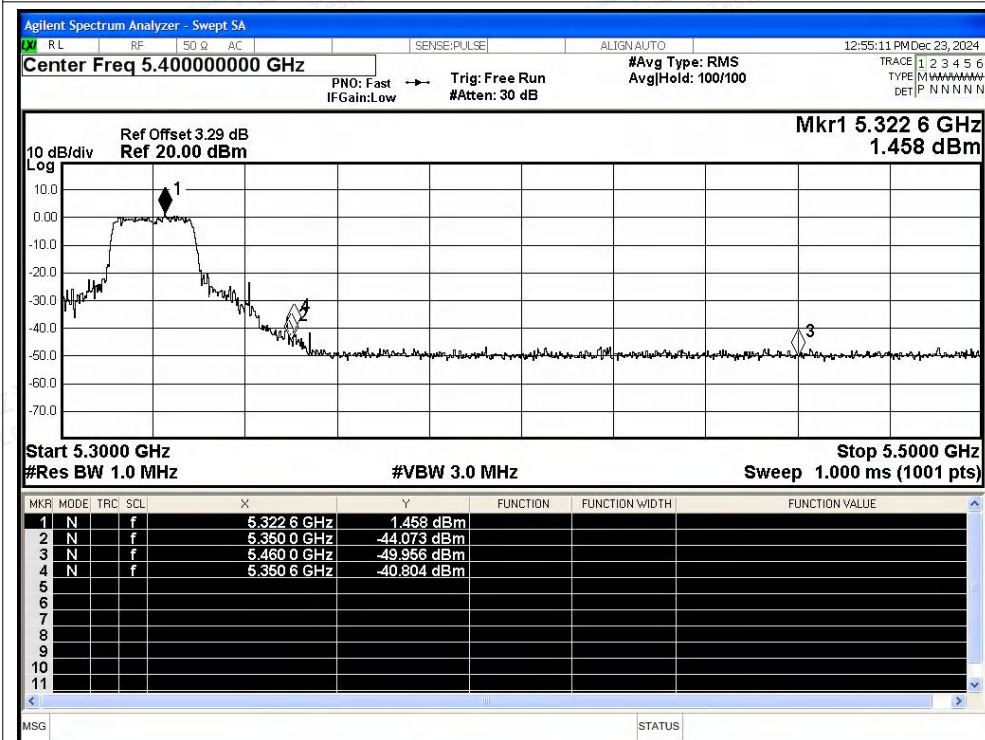

Restrict Band NVNT n20 5320MHz Ant1 Average

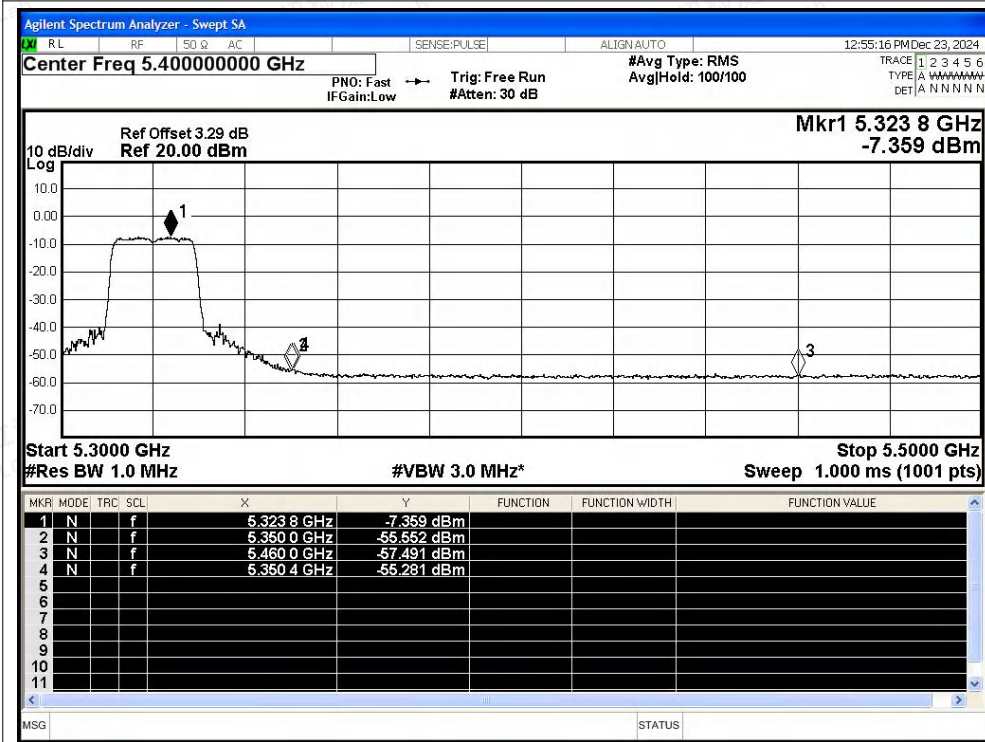

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant1 Peak

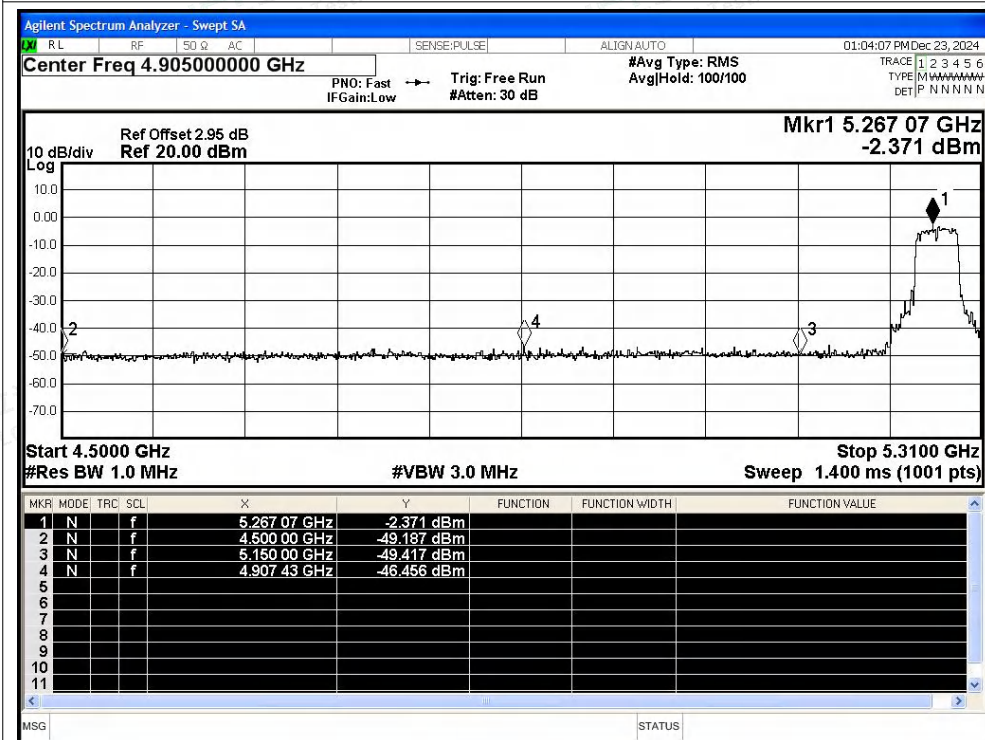

Restrict Band NVNT n40 5270MHz Ant1 Average

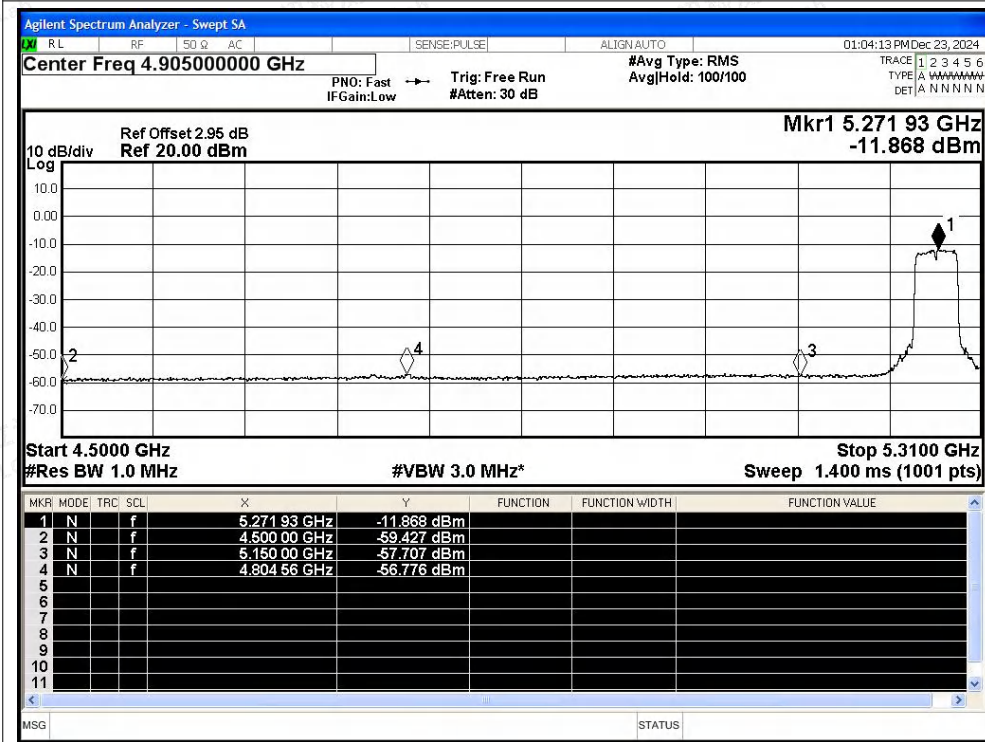

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant1 Peak

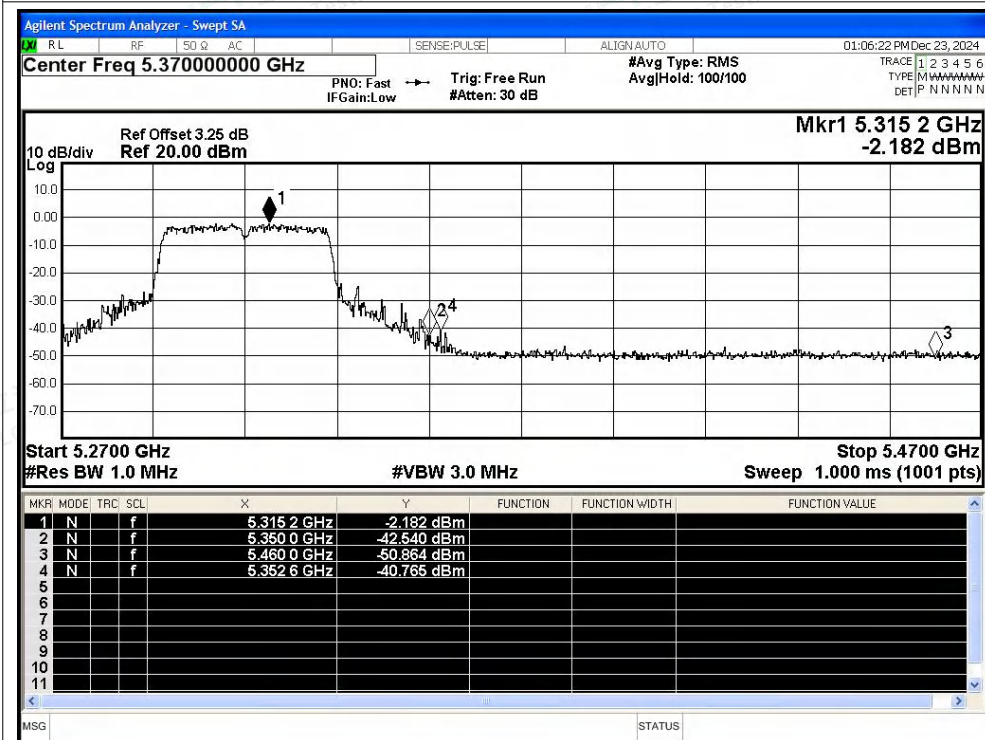

Restrict Band NVNT n40 5310MHz Ant1 Average

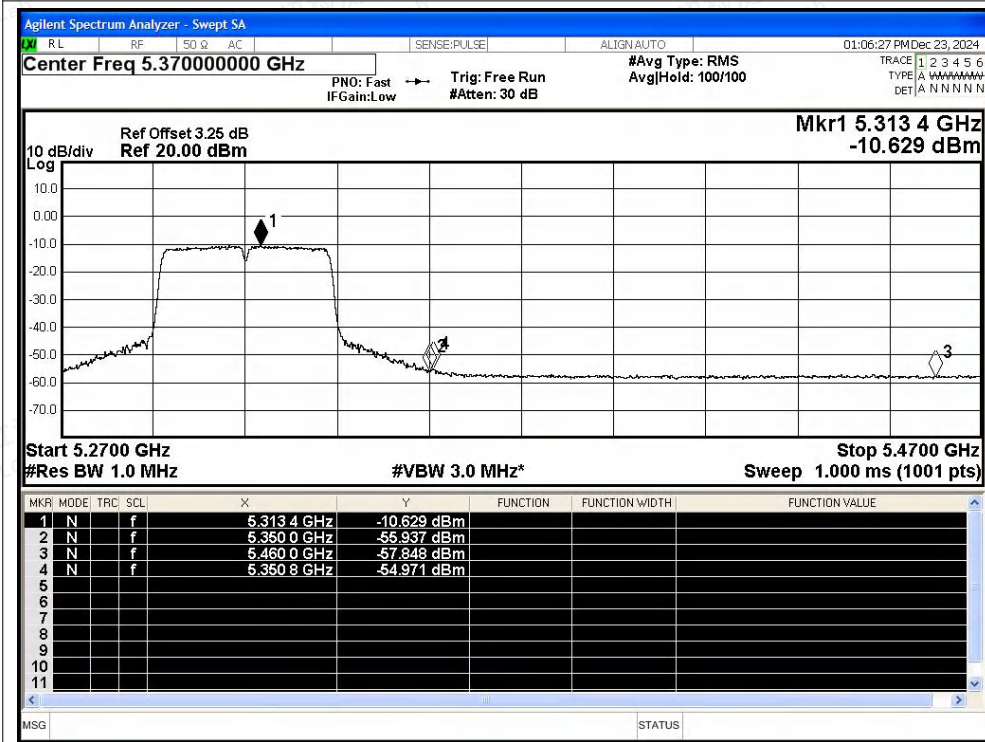

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant1 Peak

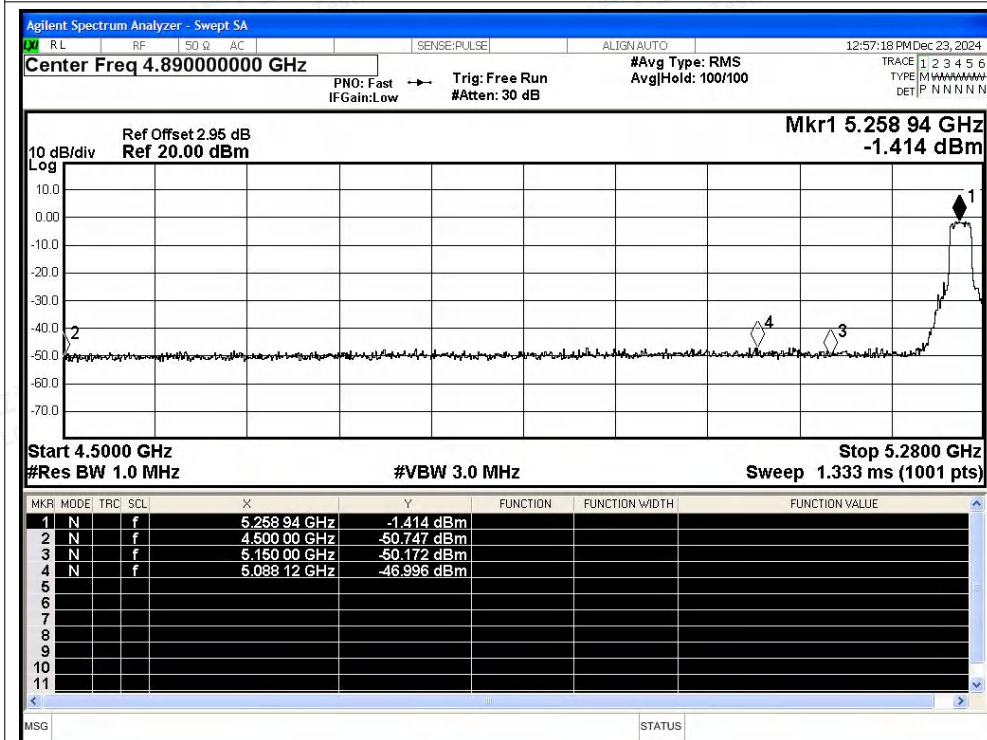


Restrict Band NVNT ac20 5260MHz Ant1 Average

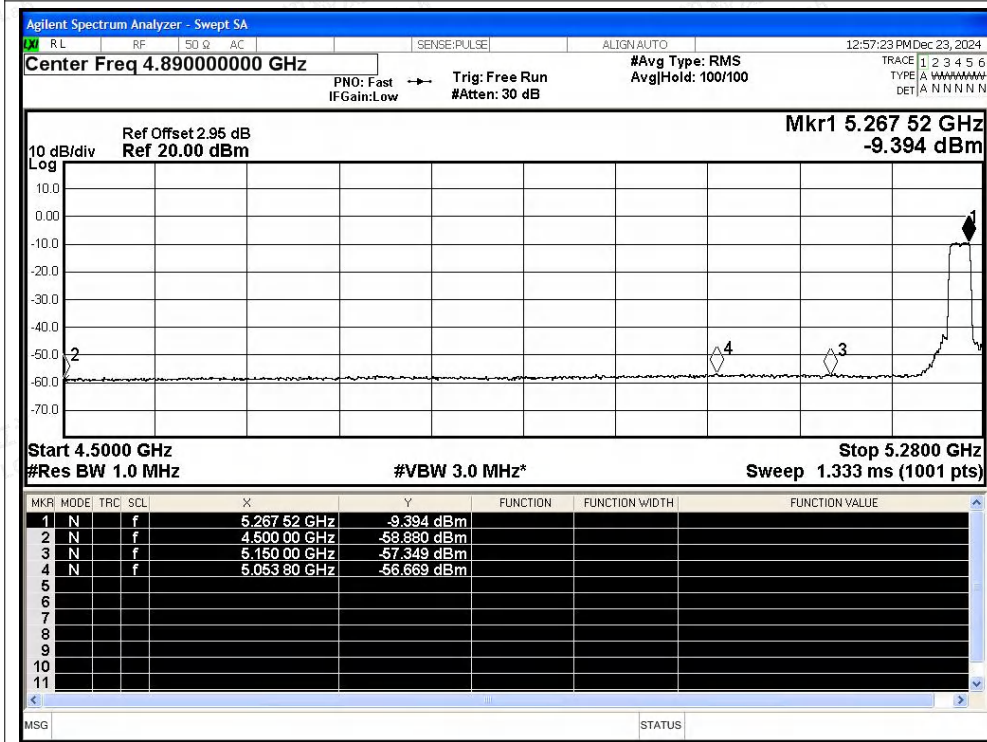




Restrict Band NVNT ac20 5320MHz Ant1 Peak

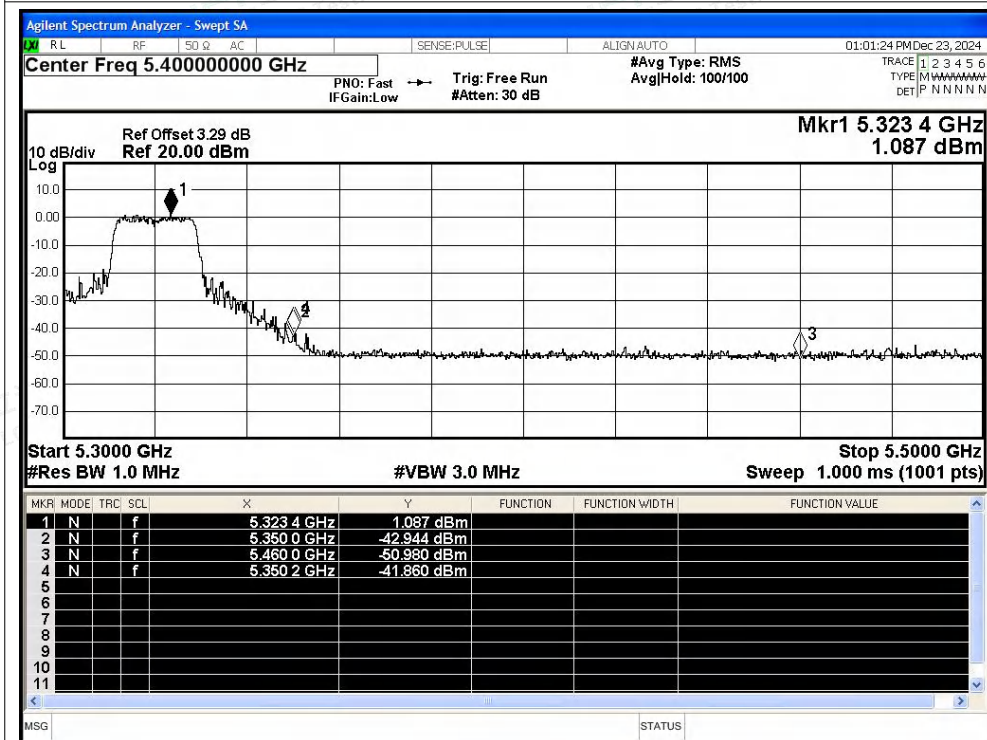

Restrict Band NVNT ac20 5320MHz Ant1 Average

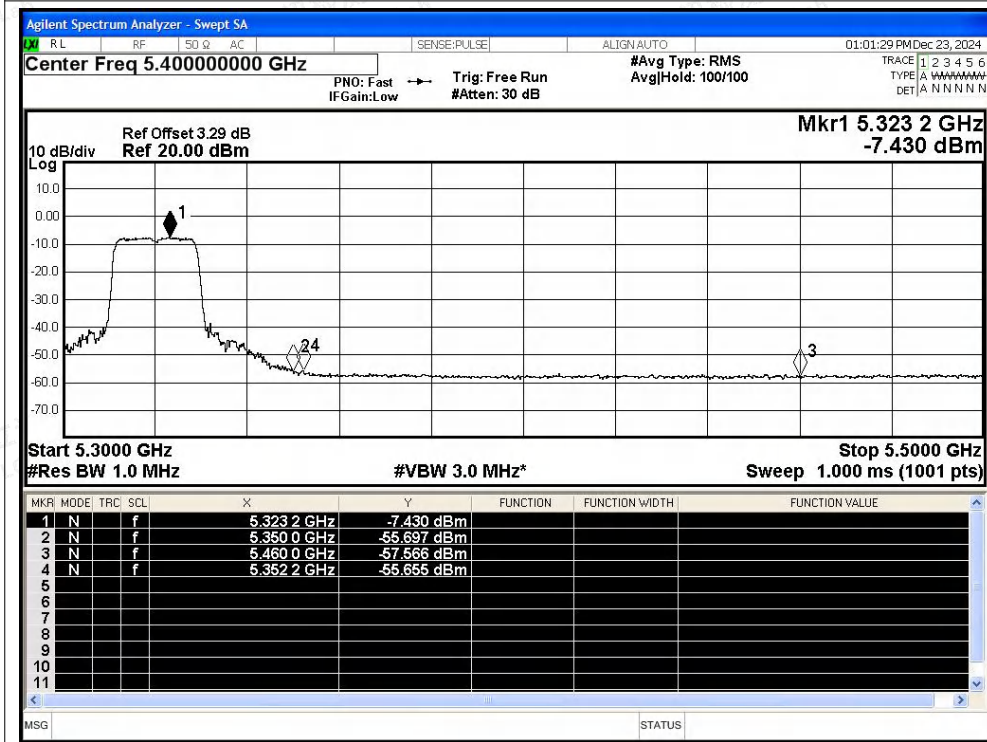

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant1 Peak

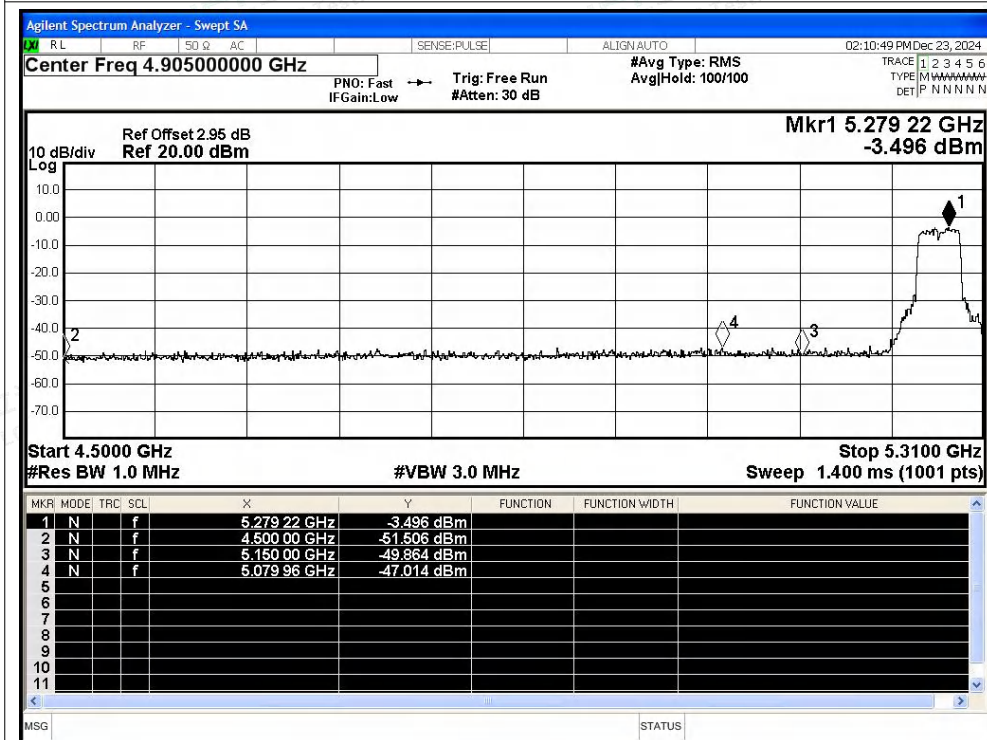

Restrict Band NVNT ac40 5270MHz Ant1 Average

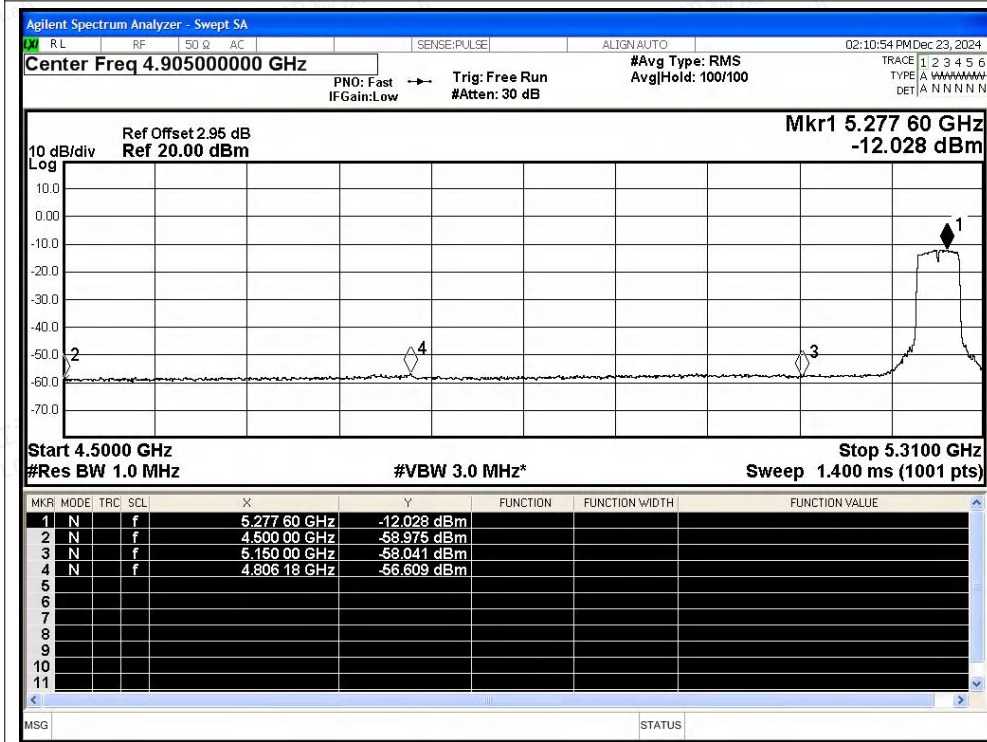

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant1 Peak

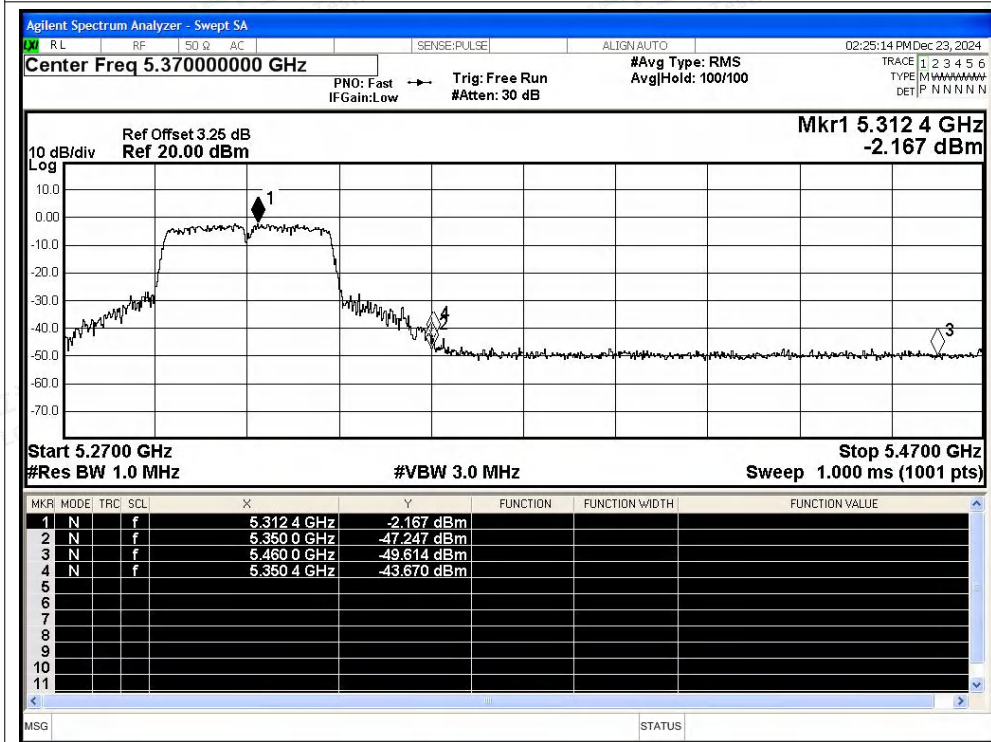


Restrict Band NVNT ac40 5310MHz Ant1 Average

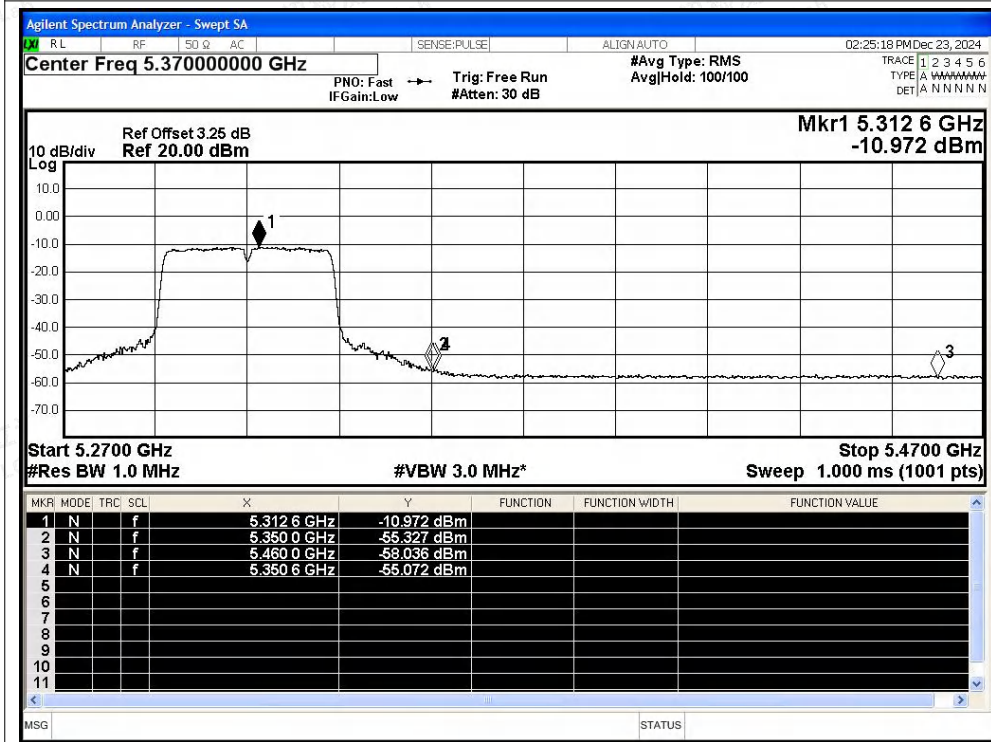




Restrict Band NVNT ac80 5290MHz Ant1 Peak

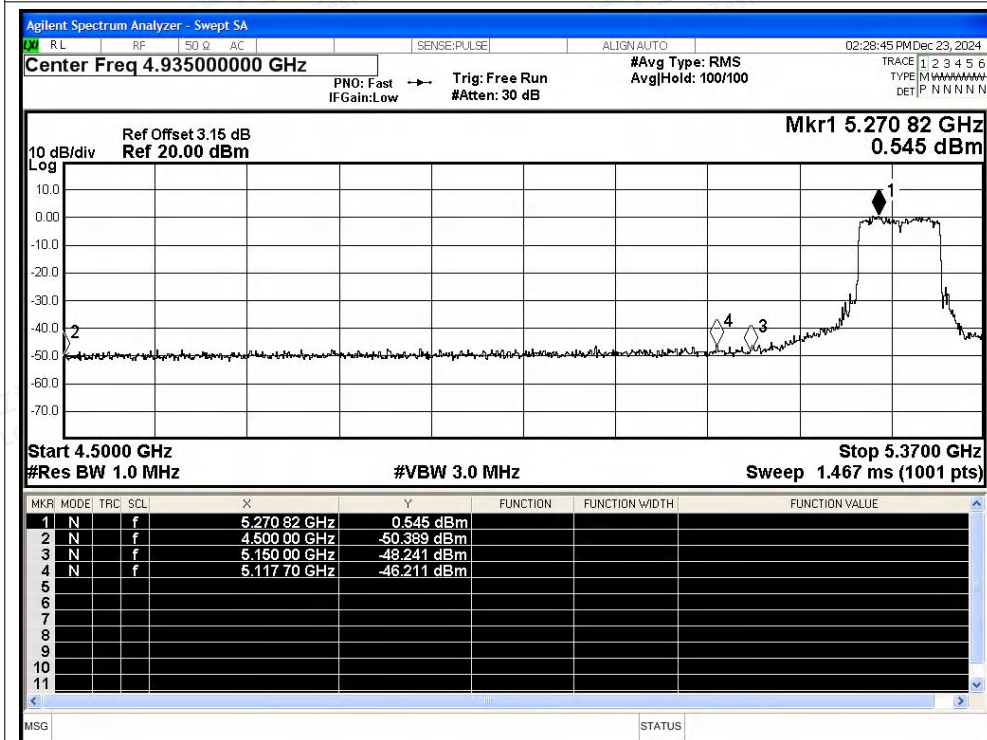

Restrict Band NVNT ac80 5290MHz Ant1 Average

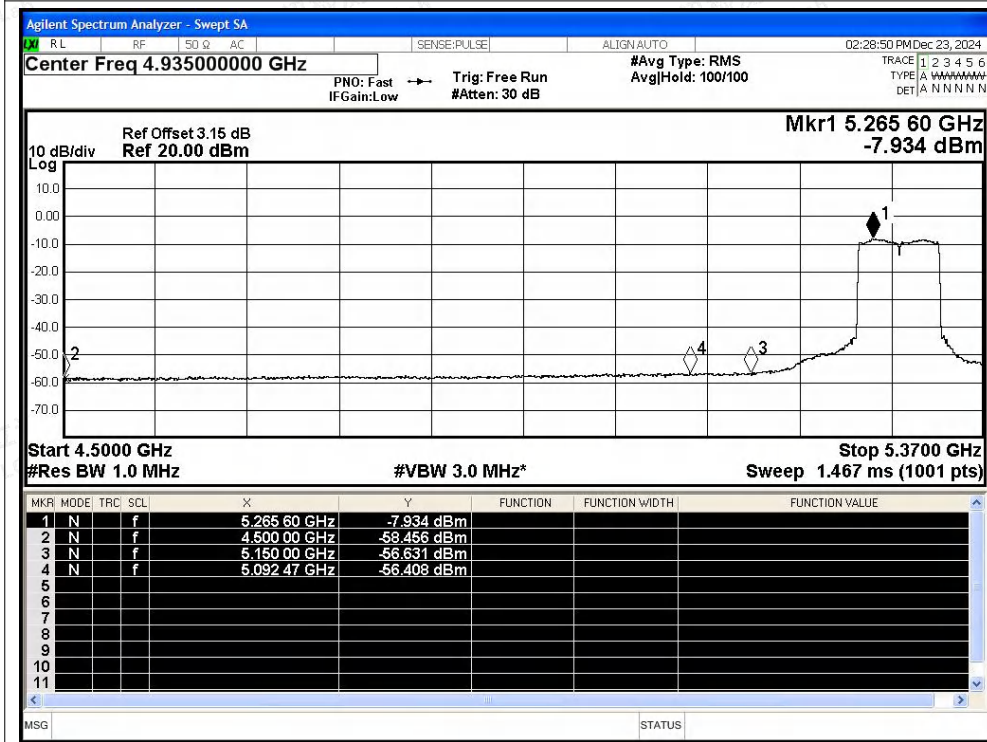

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant1 Peak

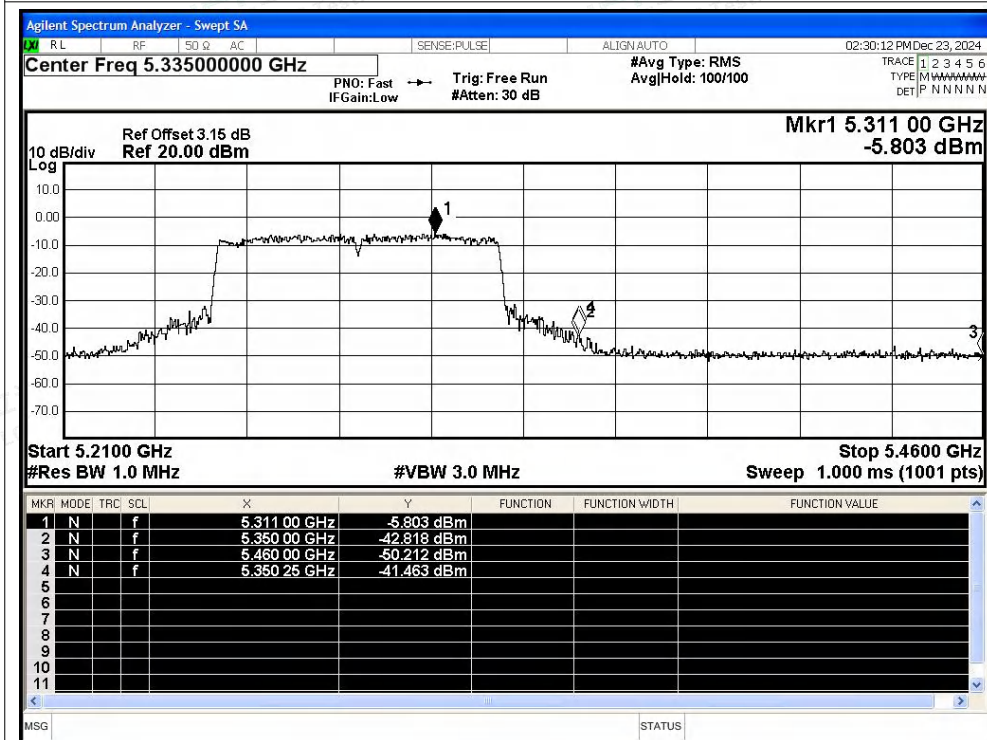

Restrict Band NVNT ac80 5290MHz Ant1 Average

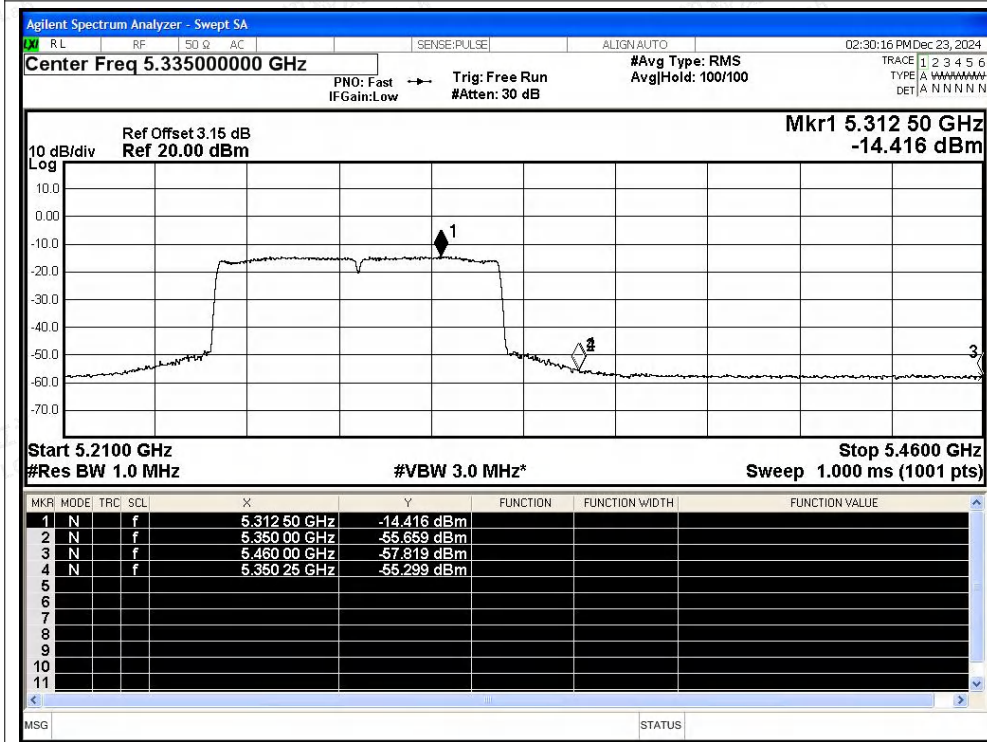

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant2	4500	-50.51	3.62	-	48.34	Peak	68.2	Pass
NVNT	a	5260	Ant2	4500	-59.15	3.62	0.24	39.94	Average	54	Pass
NVNT	a	5260	Ant2	5053.8	-46.27	3.62	-	52.58	Peak	68.2	Pass
NVNT	a	5260	Ant2	5115.42	-56.82	3.62	0.24	42.27	Average	54	Pass
NVNT	a	5260	Ant2	5150	-49.85	3.62	-	49.00	Peak	68.2	Pass
NVNT	a	5260	Ant2	5150	-57.43	3.62	0.24	41.66	Average	54	Pass
NVNT	a	5320	Ant2	5350	-46.22	3.62	-	52.63	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-56.54	3.62	0.24	42.55	Average	54	Pass
NVNT	a	5320	Ant2	5350	-46.22	3.62	-	52.63	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350.6	-56.31	3.62	0.24	42.78	Average	54	Pass
NVNT	a	5320	Ant2	5460	-48.81	3.62	-	50.04	Peak	68.2	Pass
NVNT	a	5320	Ant2	5460	-57.86	3.62	0.24	41.23	Average	54	Pass
NVNT	n20	5260	Ant2	4500	-50.18	3.62	-	48.67	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4500	-58.98	3.62	0.12	39.99	Average	54	Pass
NVNT	n20	5260	Ant2	4922.76	-46.66	3.62	-	52.19	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5076.42	-56.85	3.62	0.12	42.12	Average	54	Pass
NVNT	n20	5260	Ant2	5150	-49.21	3.62	-	49.64	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5150	-57.29	3.62	0.12	41.68	Average	54	Pass
NVNT	n20	5320	Ant2	5350	-45.21	3.62	-	53.64	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-55.58	3.62	0.12	43.39	Average	54	Pass
NVNT	n20	5320	Ant2	5351.4	-42.65	3.62	-	56.20	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-55.58	3.62	0.12	43.39	Average	54	Pass
NVNT	n20	5320	Ant2	5460	-50.38	3.62	-	48.47	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5460	-57.45	3.62	0.12	41.52	Average	54	Pass
NVNT	n40	5270	Ant2	4500	-50.01	3.62	-	48.84	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4500	-59.08	3.62	0.23	40.00	Average	54	Pass
NVNT	n40	5270	Ant2	5096.16	-46.87	3.62	-	51.98	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5069.43	-56.76	3.62	0.23	42.32	Average	54	Pass
NVNT	n40	5270	Ant2	5150	-48.36	3.62	-	50.49	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5150	-57.86	3.62	0.23	41.22	Average	54	Pass
NVNT	n40	5310	Ant2	5350	-43.1	3.62	-	55.75	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-56.24	3.62	0.24	42.85	Average	54	Pass
NVNT	n40	5310	Ant2	5350	-43.1	3.62	-	55.75	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5351	-55.63	3.62	0.24	43.46	Average	54	Pass
NVNT	n40	5310	Ant2	5460	-49.76	3.62	-	49.09	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5460	-57.79	3.62	0.24	41.30	Average	54	Pass
NVNT	ac20	5260	Ant2	4500	-50.33	3.62	-	48.52	Peak	68.2	Pass





NVNT	ac20	5260	Ant2	4500	-59.05	3.62	0.12	39.92	Average	54	Pass
NVNT	ac20	5260	Ant2	5093.58	-46.49	3.62	-	52.36	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5063.94	-56.52	3.62	0.12	42.45	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-49.35	3.62	-	49.50	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5150	-57.77	3.62	0.12	41.20	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-45.34	3.62	-	53.51	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-55.31	3.62	0.12	43.66	Average	54	Pass
NVNT	ac20	5320	Ant2	5351.8	-38.33	3.62	-	60.52	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-55.31	3.62	0.12	43.66	Average	54	Pass
NVNT	ac20	5320	Ant2	5460	-49.33	3.62	-	49.52	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5460	-57.9	3.62	0.12	41.07	Average	54	Pass
NVNT	ac40	5270	Ant2	4500	-51.05	3.62	-	47.80	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4500	-58.97	3.62	0.24	40.12	Average	54	Pass
NVNT	ac40	5270	Ant2	4772.97	-45.3	3.62	-	53.55	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4806.99	-53.7	3.62	0.24	45.39	Average	54	Pass
NVNT	ac40	5270	Ant2	5150	-47.68	3.62	-	51.17	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5150	-57.07	3.62	0.24	42.02	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-42.6	3.62	-	56.25	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-54.26	3.62	0.23	44.82	Average	54	Pass
NVNT	ac40	5310	Ant2	5353.8	-41.86	3.62	-	56.99	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-54.26	3.62	0.23	44.82	Average	54	Pass
NVNT	ac40	5310	Ant2	5460	-50.45	3.62	-	48.40	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5460	-57.57	3.62	0.23	41.51	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-50.58	3.62	-	48.27	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4500	-59.06	3.62	0.25	40.04	Average	54	Pass
NVNT	ac80	5290	Ant2	5084.64	-46.2	3.62	-	52.65	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5089.86	-56.46	3.62	0.25	42.64	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-49.2	3.62	-	49.65	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5150	-57.03	3.62	0.25	42.07	Average	54	Pass
NVNT	ac80	5290	Ant2	5350	-44.74	3.62	-	54.11	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350	-53.68	3.62	0.25	45.42	Average	54	Pass
NVNT	ac80	5290	Ant2	5353.25	-40.13	3.62	-	58.72	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350.5	-53.08	3.62	0.25	46.02	Average	54	Pass
NVNT	ac80	5290	Ant2	5460	-49.52	3.62	-	49.33	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5460	-57.45	3.62	0.25	41.65	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant2 Peak

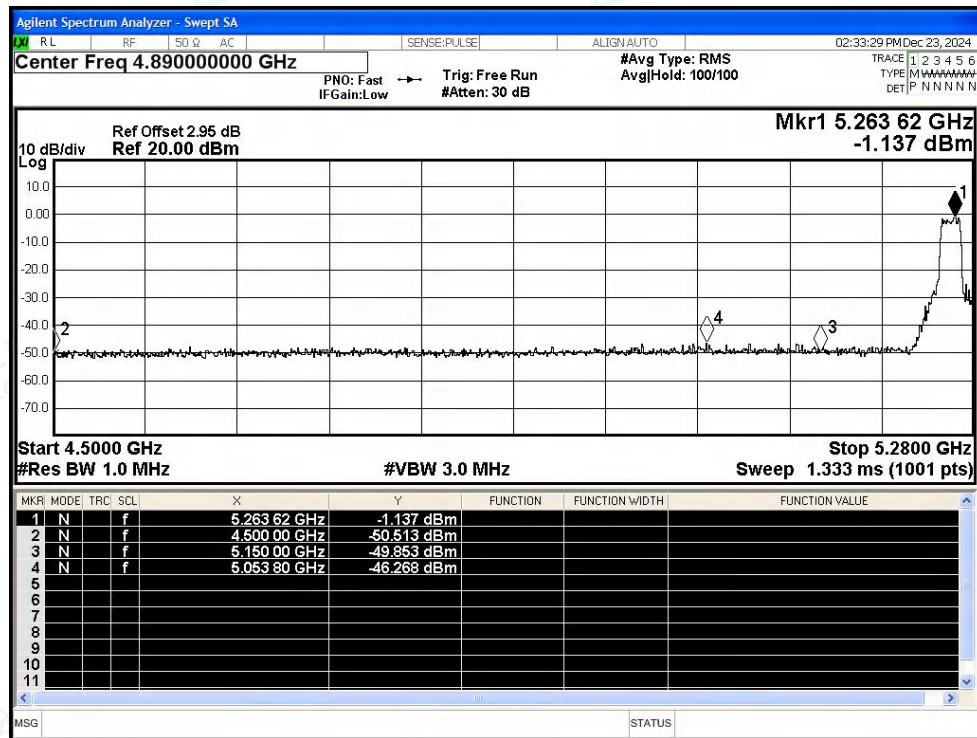

Restrict Band NVNT a 5260MHz Ant2 Average

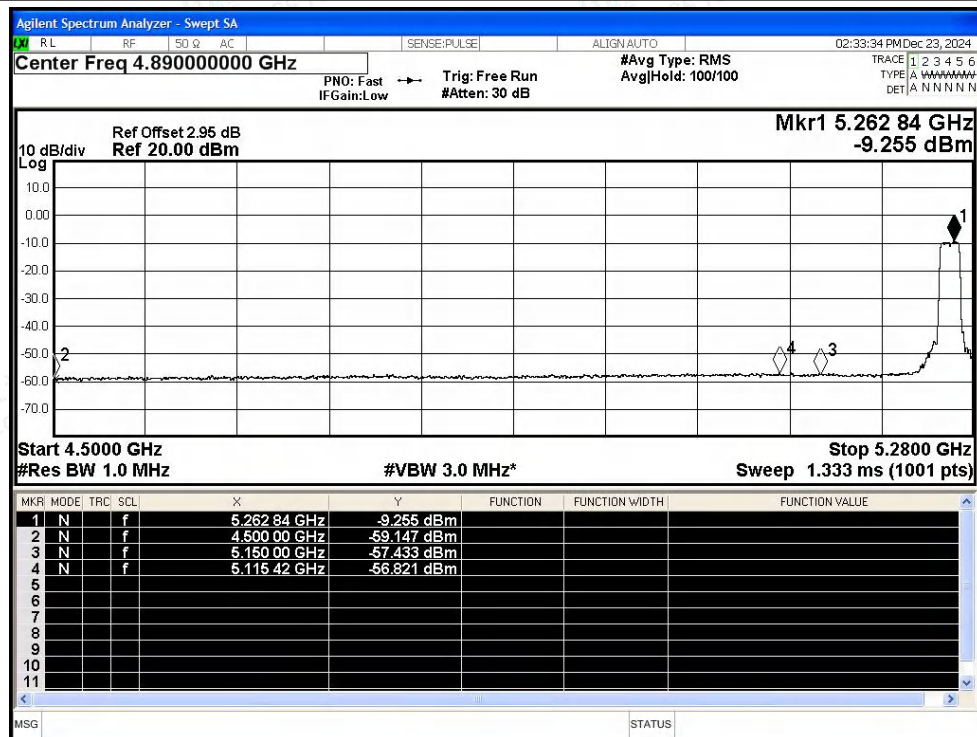

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant2 Peak

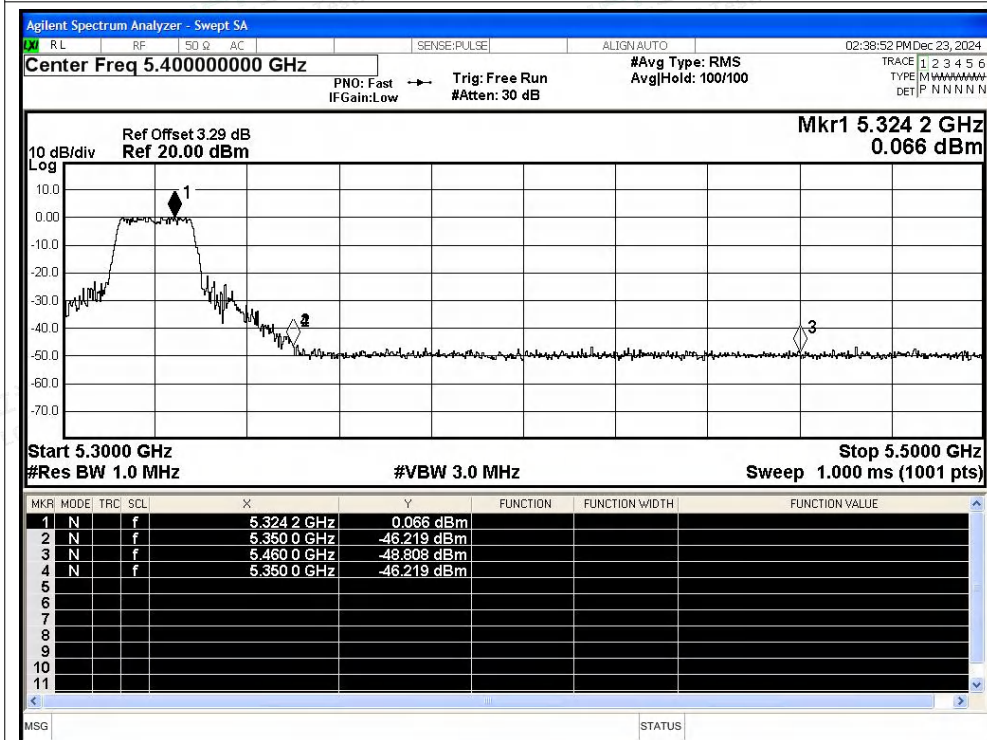

Restrict Band NVNT a 5320MHz Ant2 Average

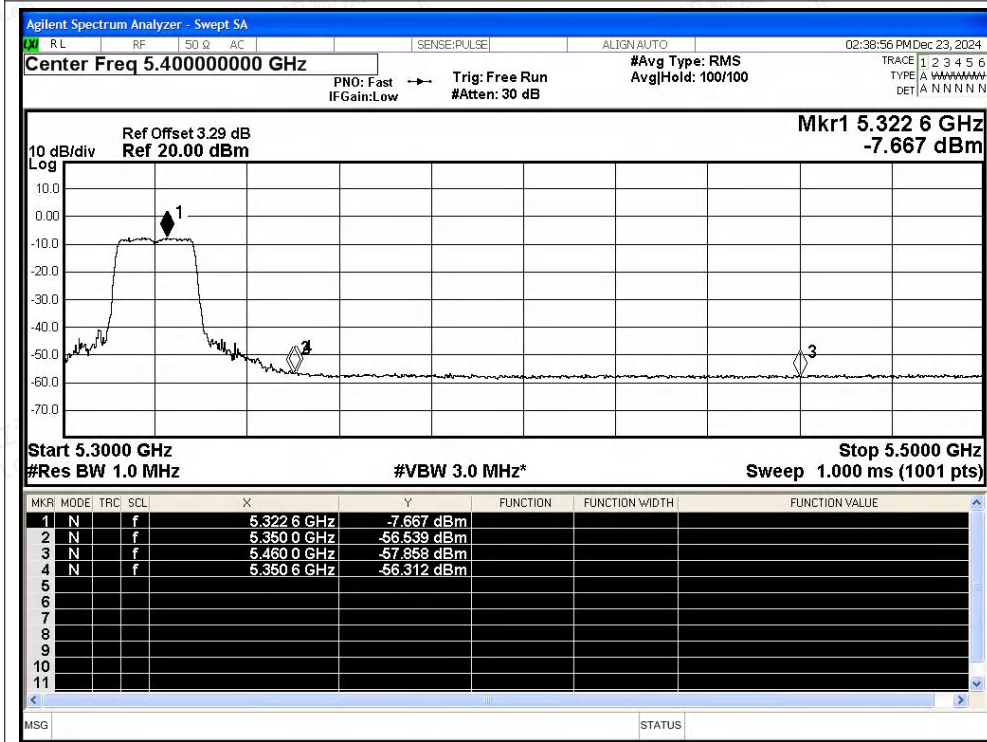

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant2 Peak

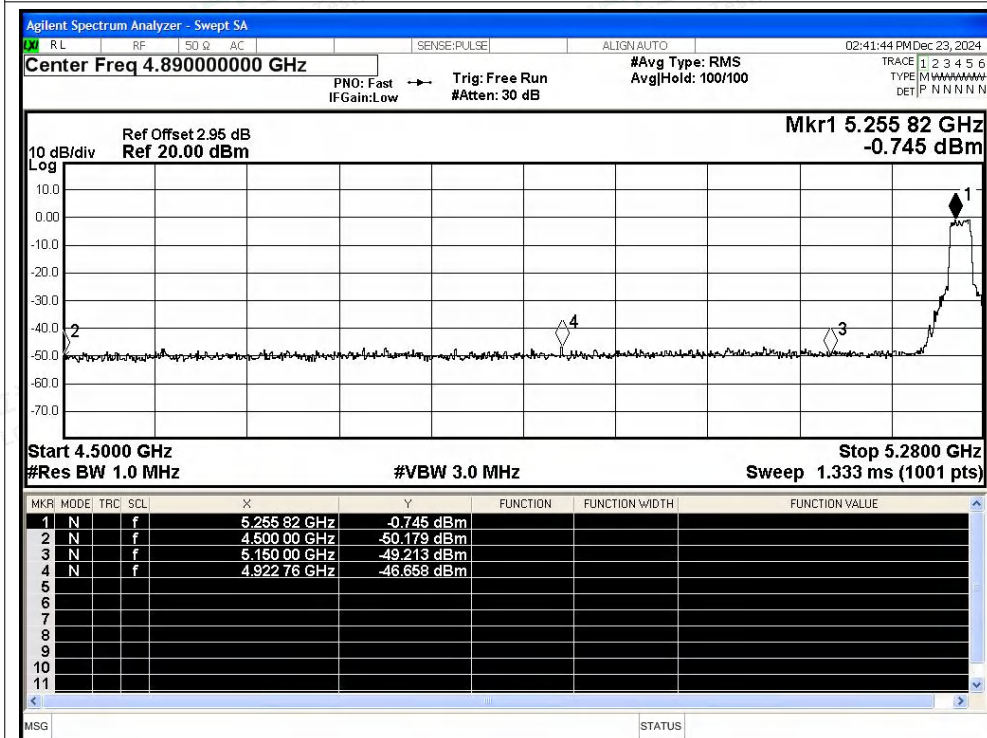

Restrict Band NVNT n20 5260MHz Ant2 Average

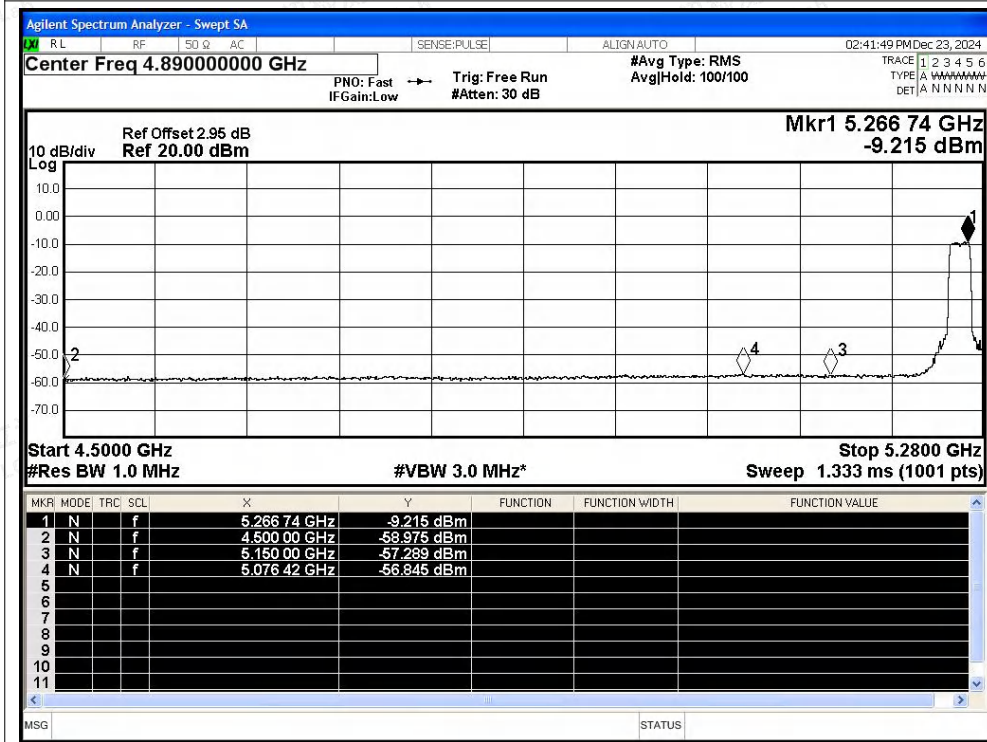

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant2 Peak

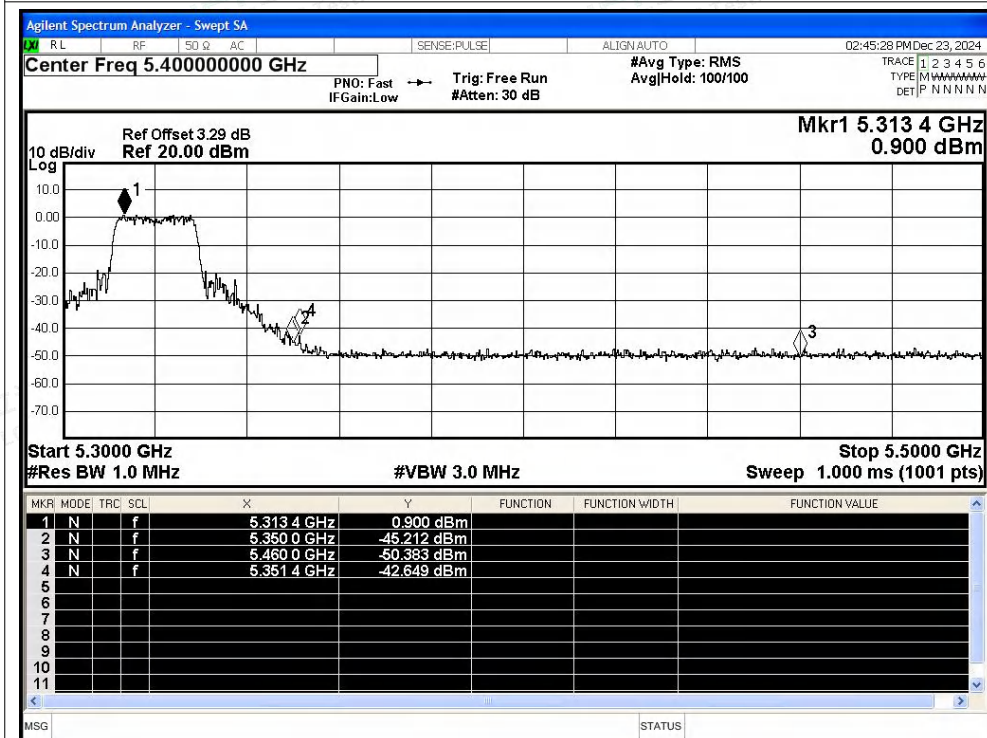

Restrict Band NVNT n20 5320MHz Ant2 Average

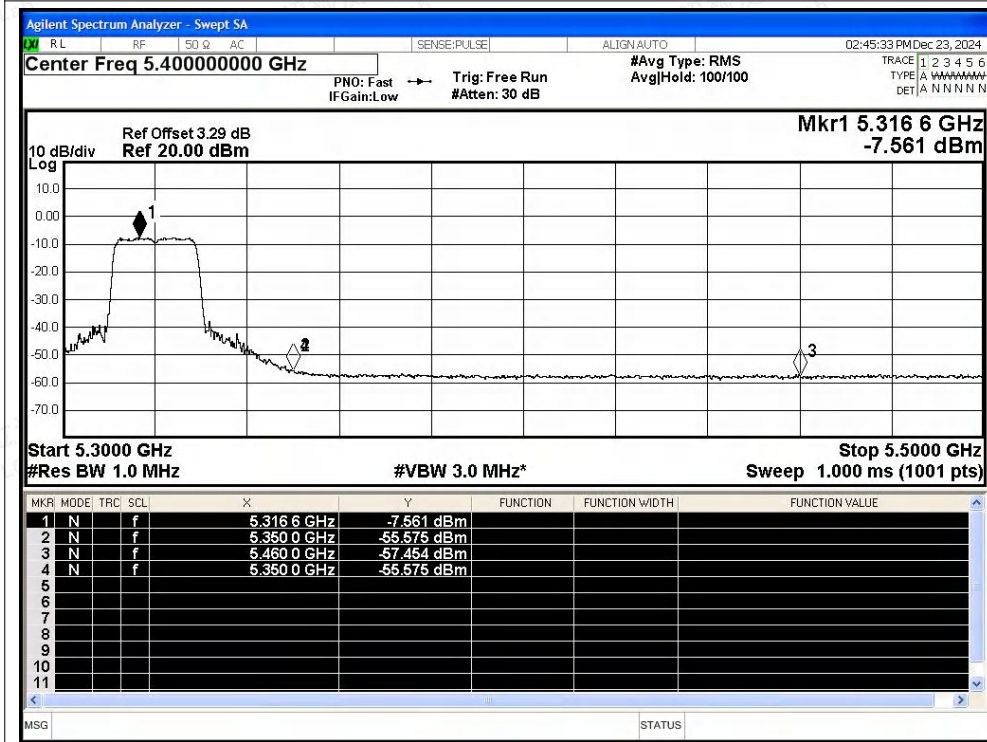

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant2 Peak

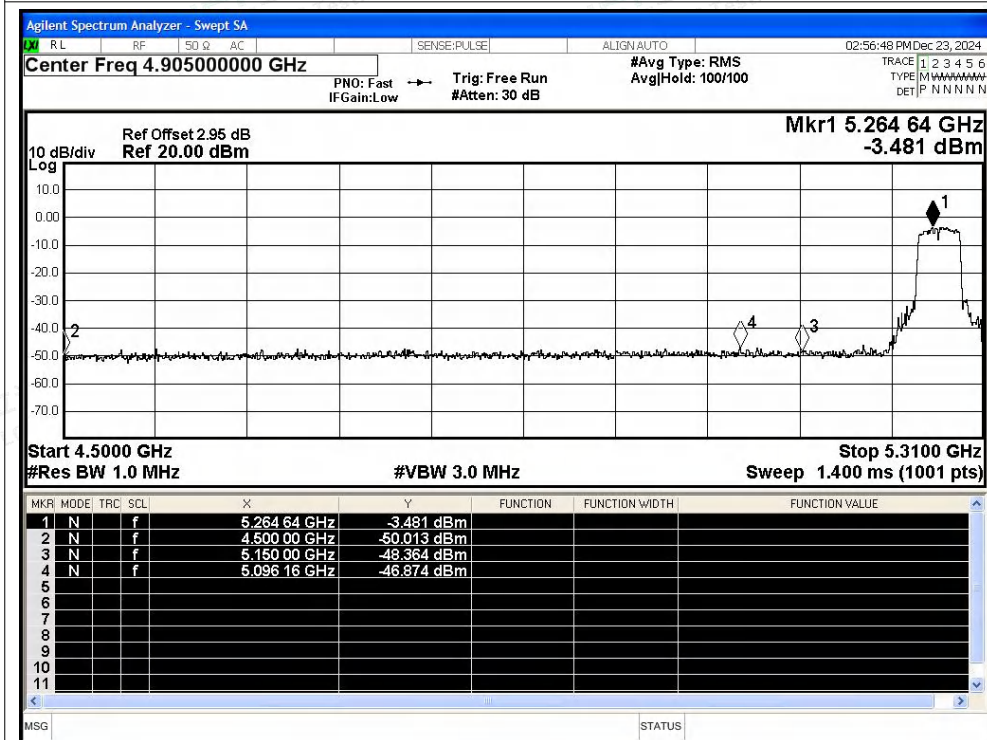

Restrict Band NVNT n40 5270MHz Ant2 Average

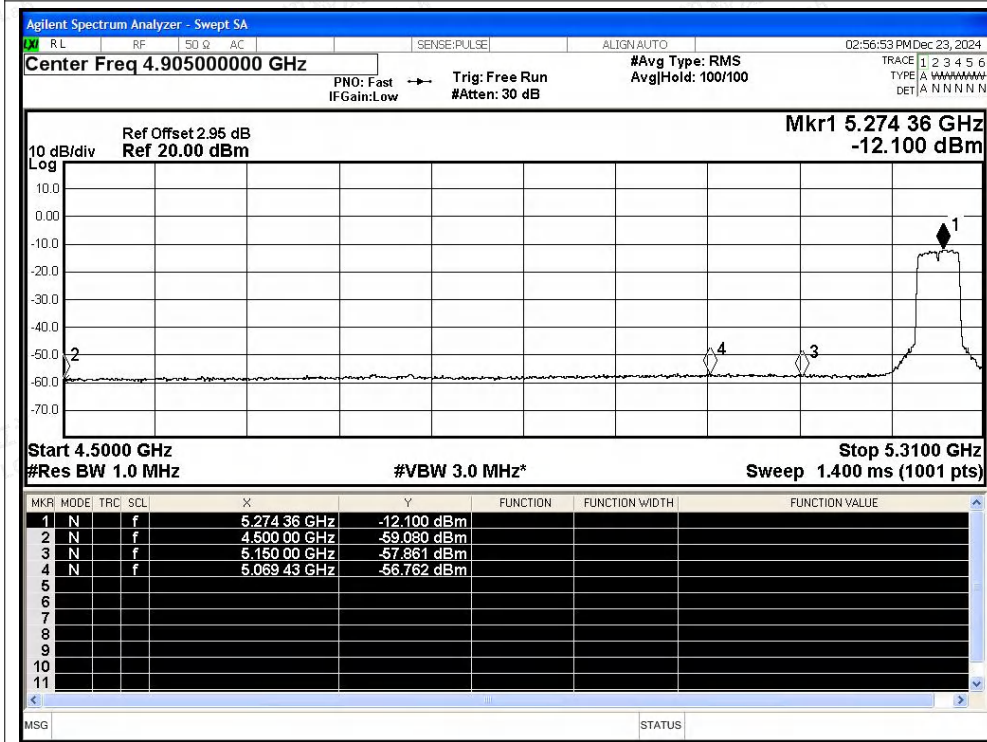

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant2 Peak

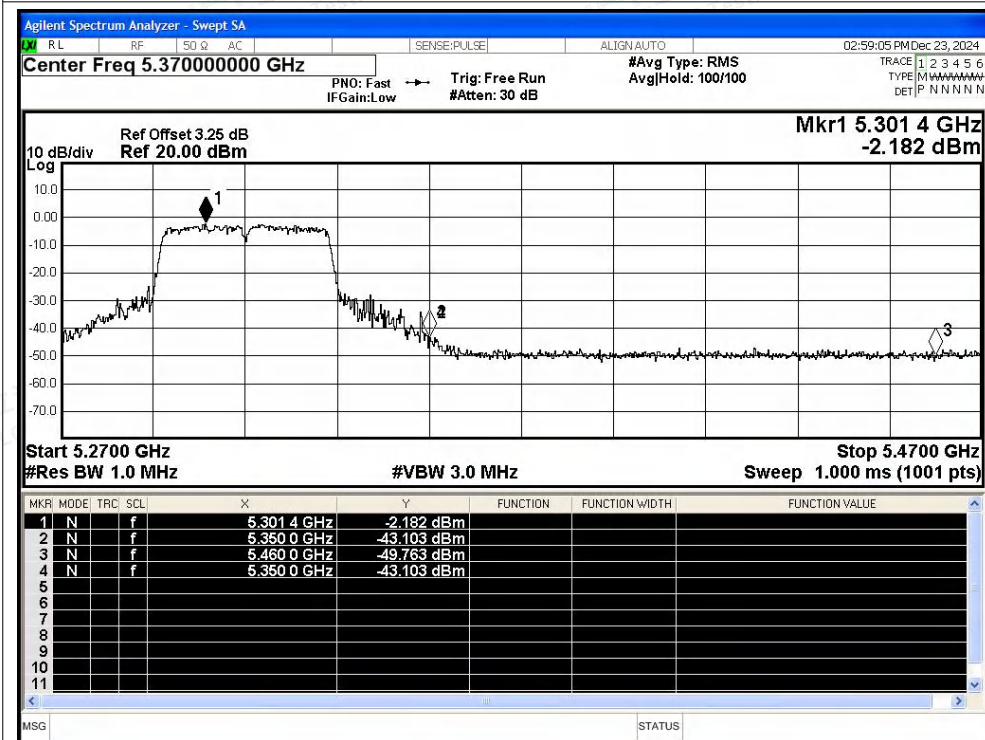


Restrict Band NVNT n40 5310MHz Ant2 Average

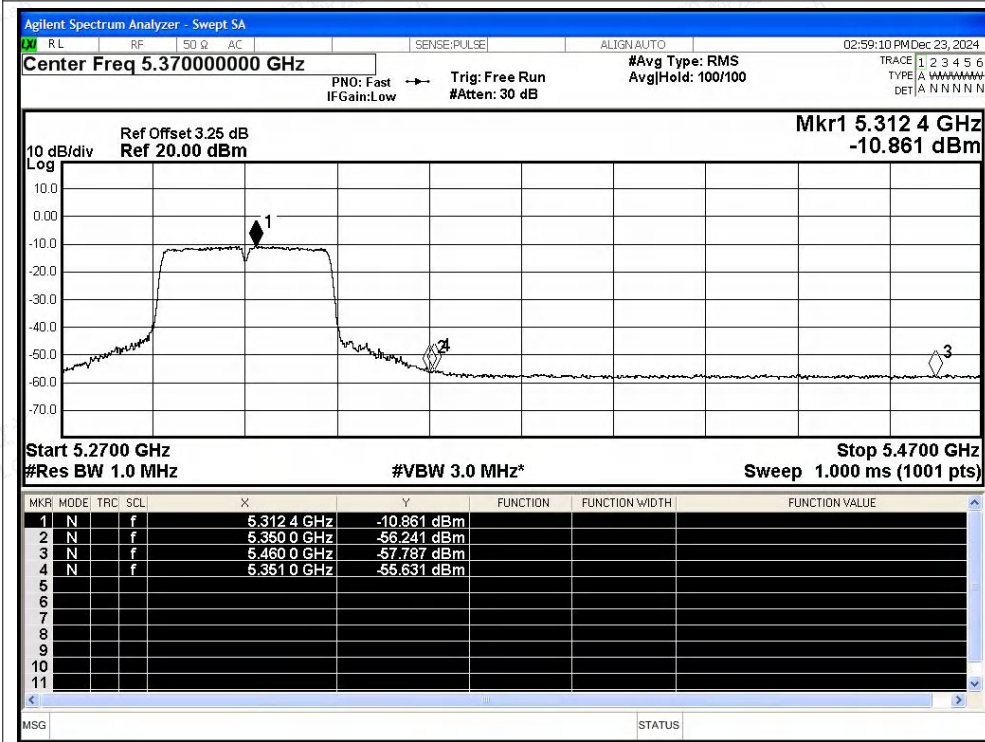




Restrict Band NVNT ac20 5260MHz Ant2 Peak

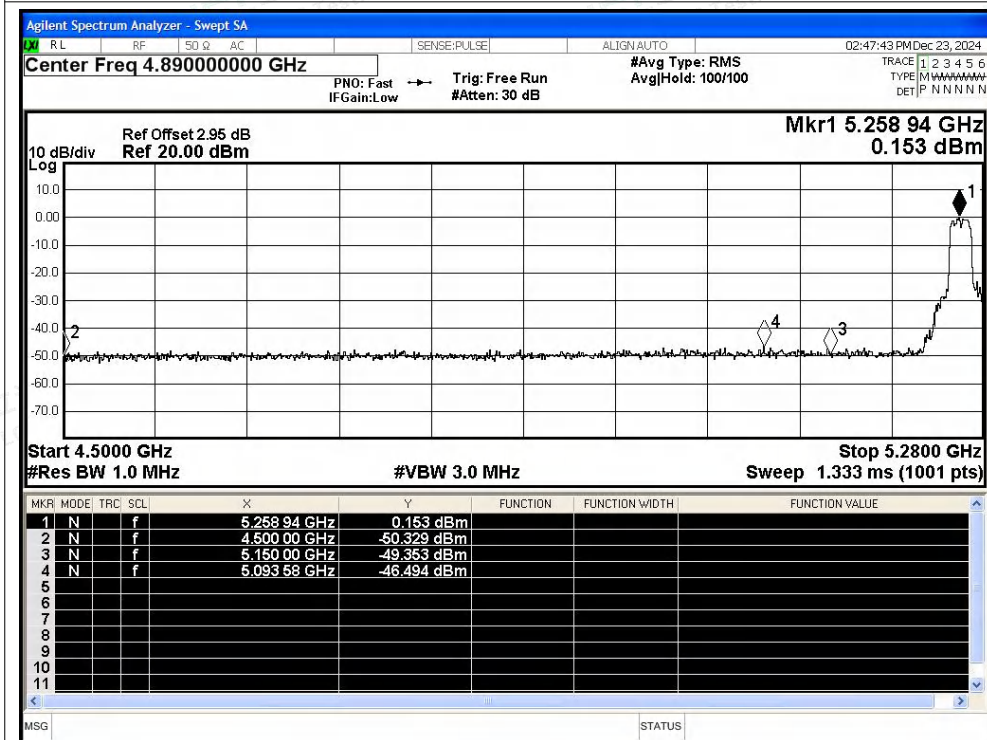

Restrict Band NVNT ac20 5260MHz Ant2 Average

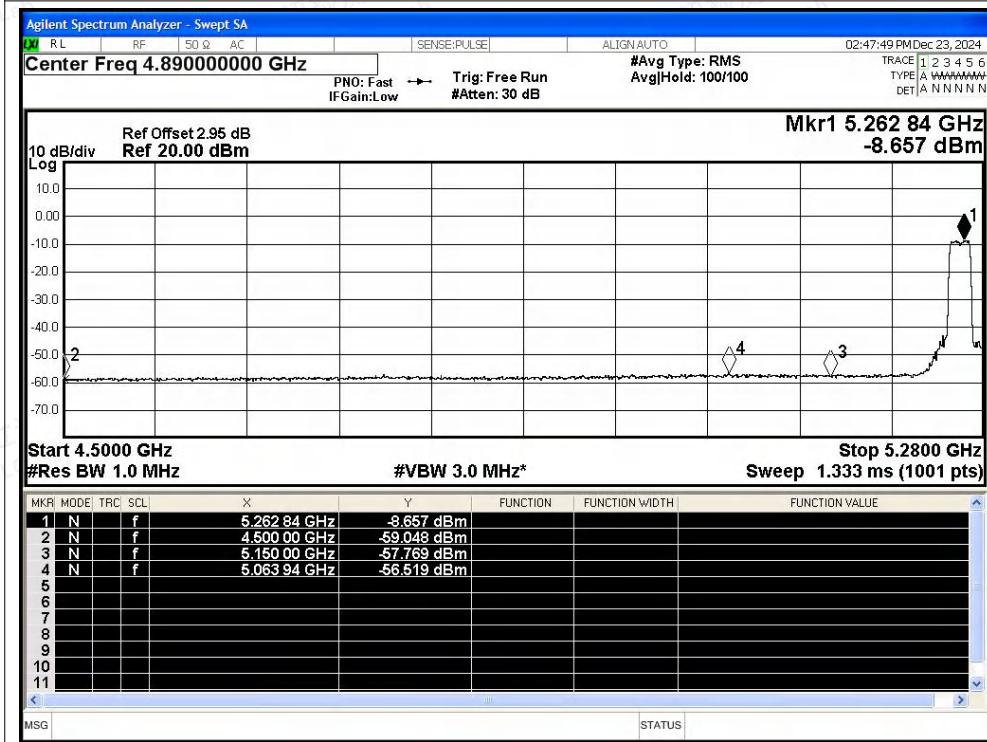

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant2 Peak

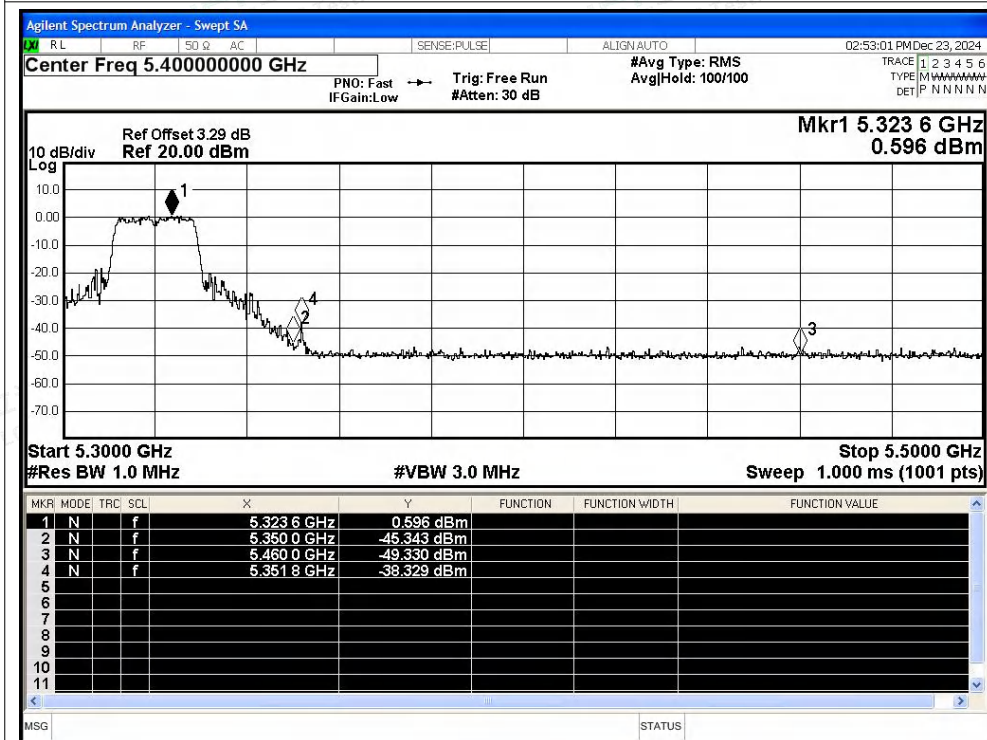

Restrict Band NVNT ac20 5320MHz Ant2 Average

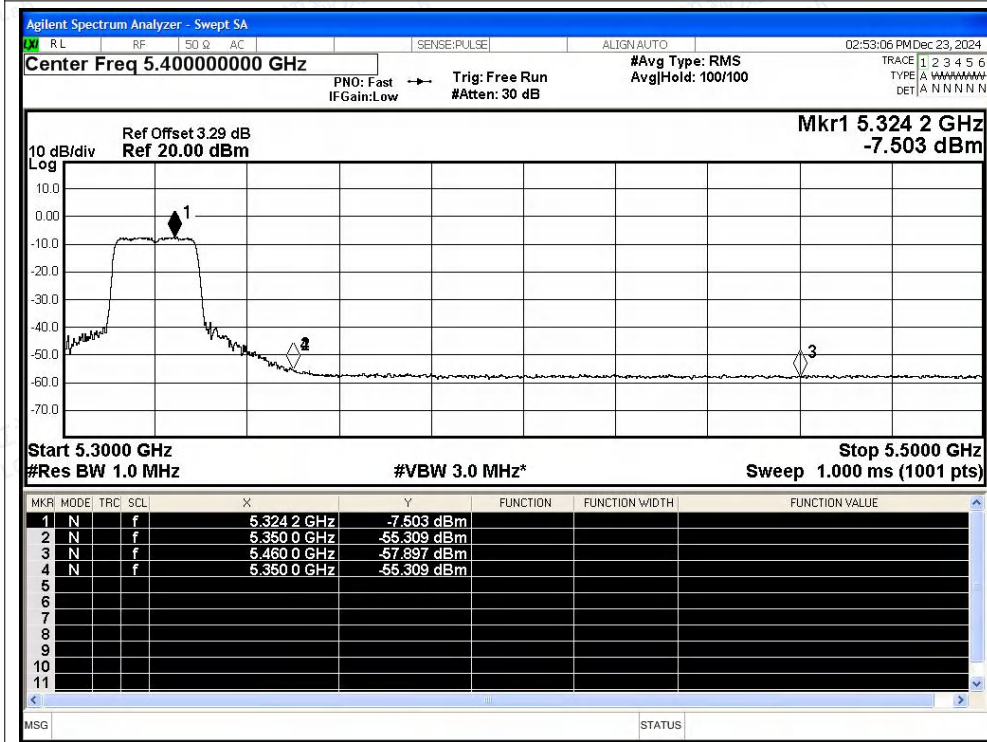

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant2 Peak

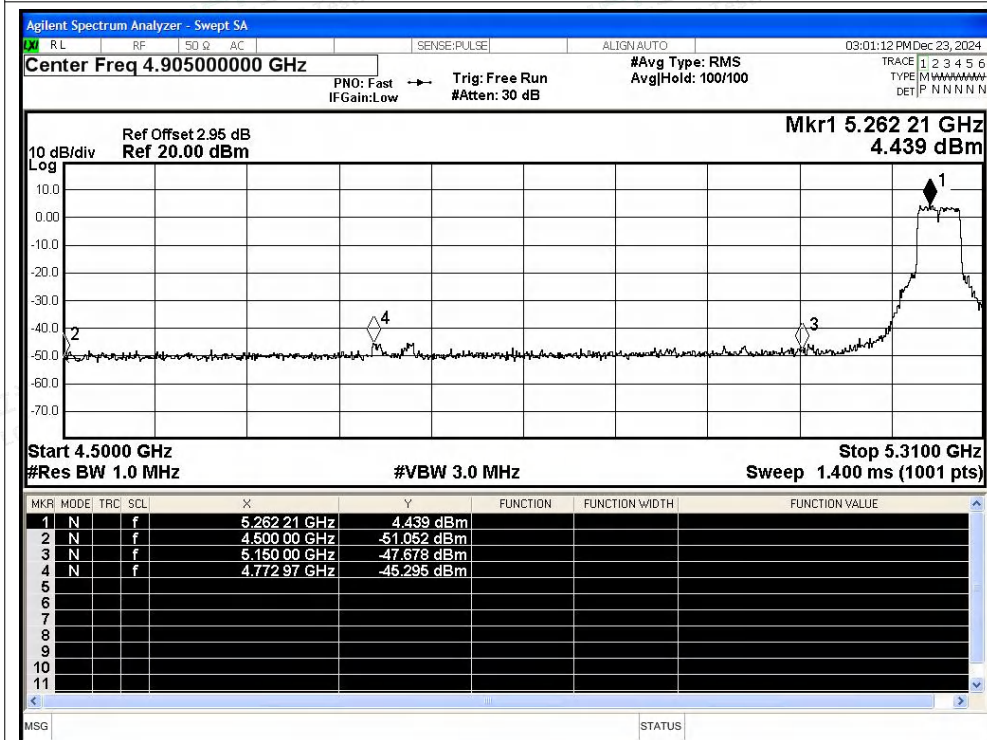

Restrict Band NVNT ac40 5270MHz Ant2 Average

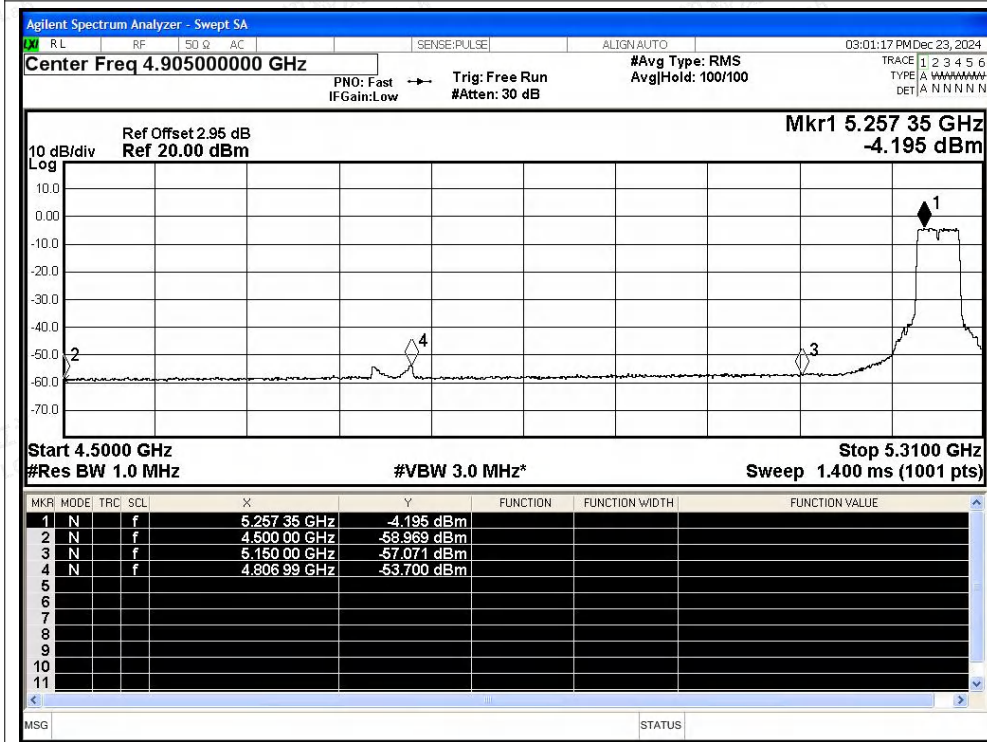

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant2 Peak

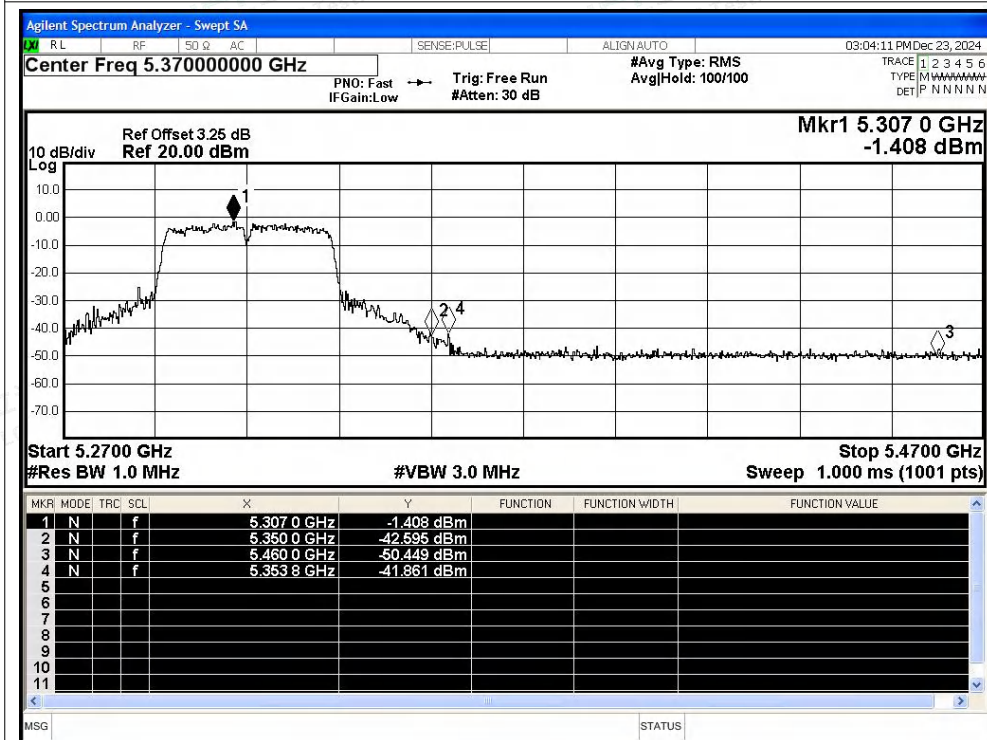

Restrict Band NVNT ac40 5310MHz Ant2 Average

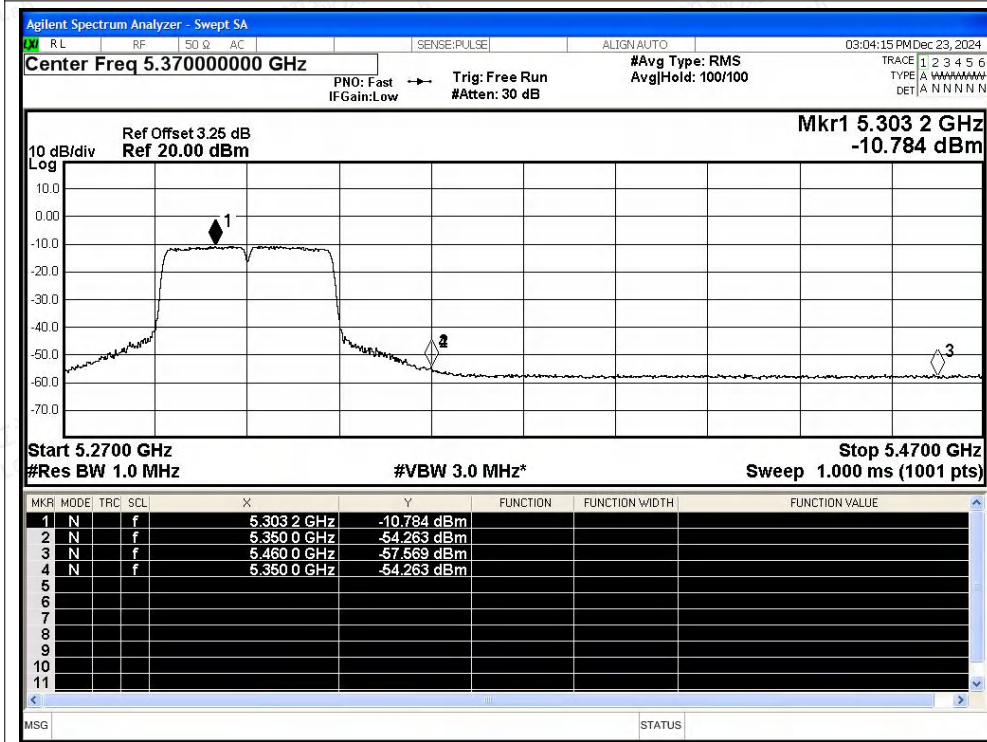

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

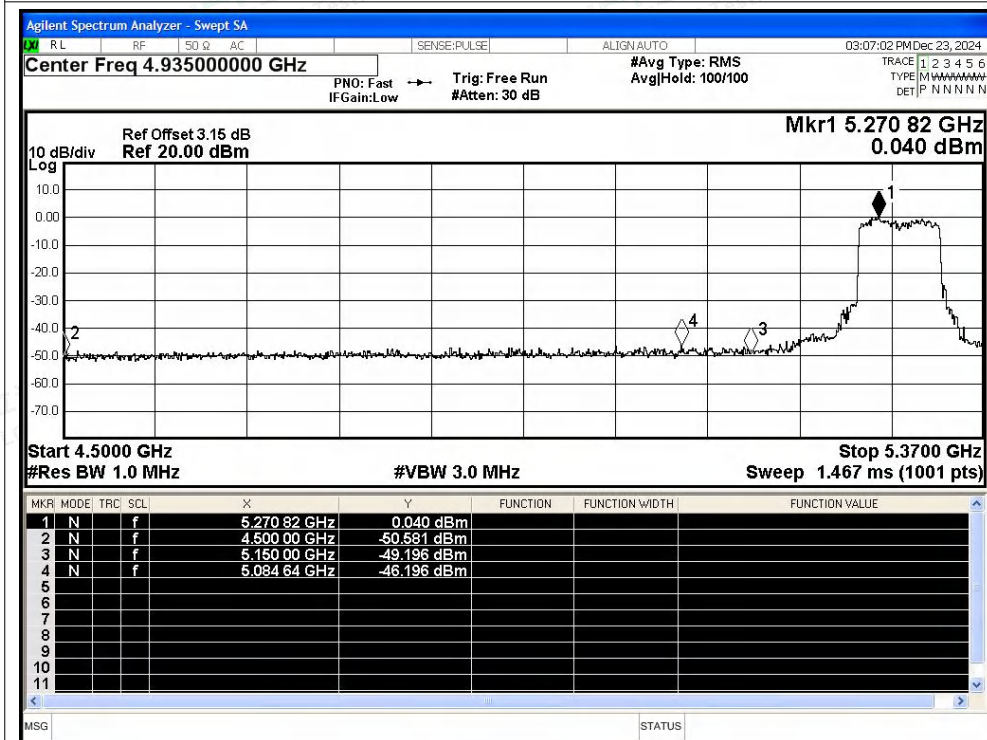

Restrict Band NVNT ac80 5290MHz Ant2 Average

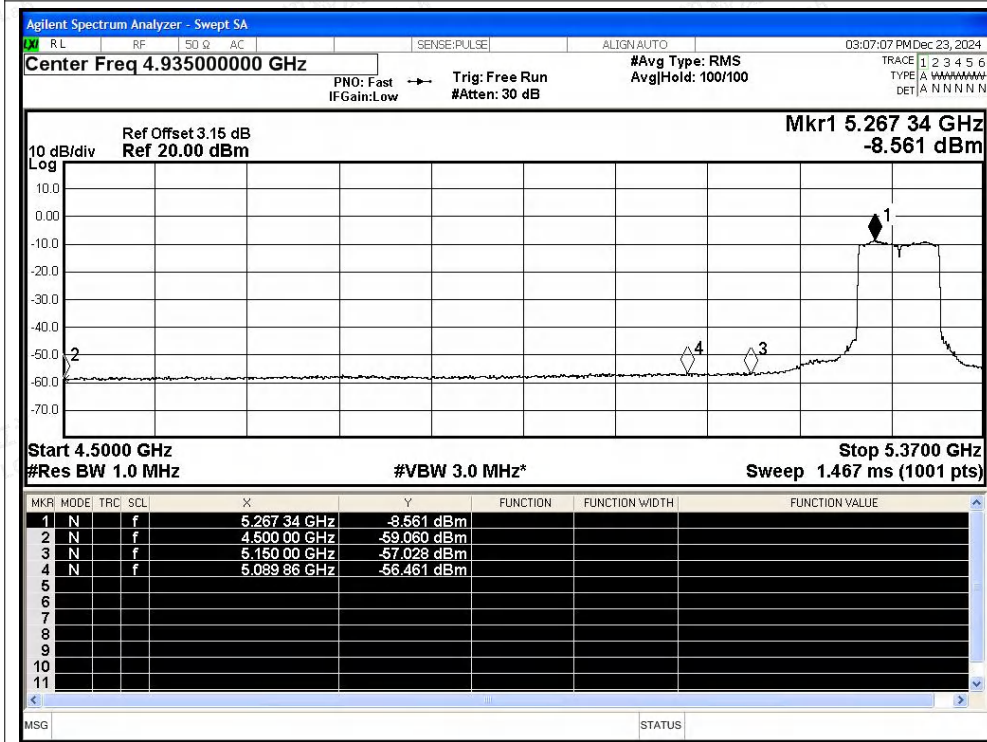

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

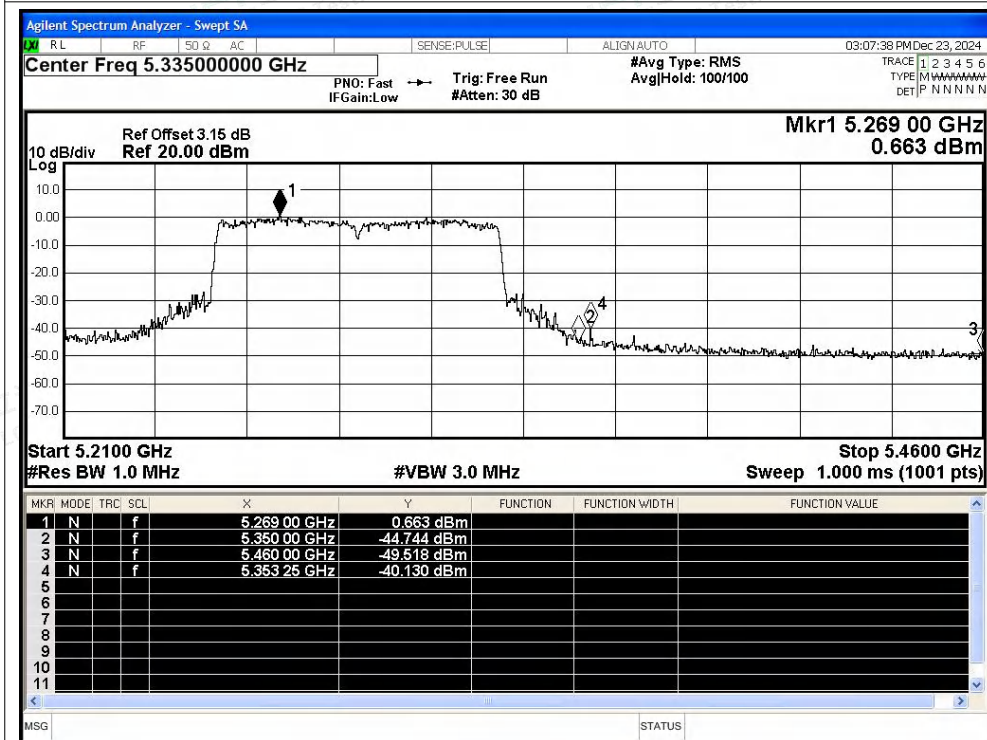

Restrict Band NVNT ac80 5290MHz Ant2 Average

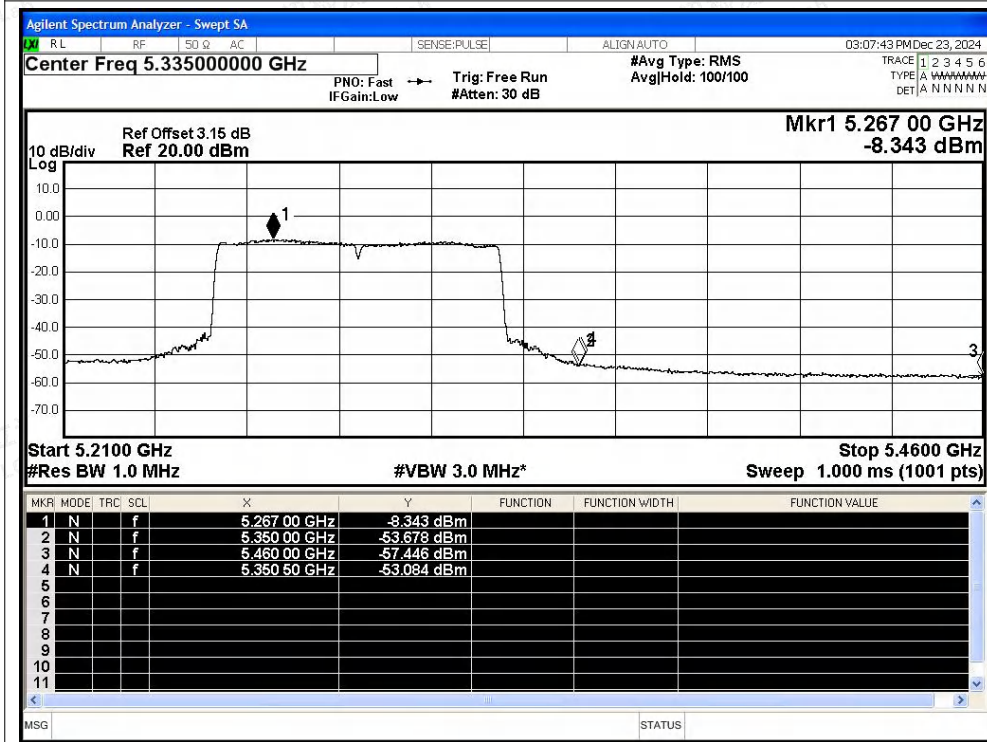

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	SUM	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5260	-49.06	-50.18	-46.57	6.79	55.44	Peak	68.2	Pass
NVNT	n20	5260	-59.19	-58.98	-56.07	6.79	45.94	Average	54	Pass
NVNT	n20	5260	-46.39	-46.66	-43.51	6.79	58.50	Peak	68.2	Pass
NVNT	n20	5260	-56.81	-56.85	-53.82	6.79	48.20	Average	54	Pass
NVNT	n20	5260	-50.2	-49.21	-46.67	6.79	55.35	Peak	68.2	Pass
NVNT	n20	5260	-57.3	-57.29	-54.28	6.79	47.73	Average	54	Pass
NVNT	n20	5320	-44.07	-45.21	-41.59	6.79	60.43	Peak	68.2	Pass
NVNT	n20	5320	-55.55	-55.58	-52.55	6.79	49.46	Average	54	Pass
NVNT	n20	5320	-40.8	-42.65	-38.62	6.79	63.40	Peak	68.2	Pass
NVNT	n20	5320	-55.28	-55.58	-52.42	6.79	49.60	Average	54	Pass
NVNT	n20	5320	-49.96	-50.38	-47.15	6.79	54.86	Peak	68.2	Pass
NVNT	n20	5320	-57.49	-57.45	-54.46	6.79	47.56	Average	54	Pass
NVNT	n40	5270	-49.19	-50.01	-46.57	6.79	55.45	Peak	68.2	Pass
NVNT	n40	5270	-59.43	-59.08	-56.24	6.79	45.78	Average	54	Pass
NVNT	n40	5270	-46.46	-46.87	-43.65	6.79	58.37	Peak	68.2	Pass
NVNT	n40	5270	-56.78	-56.76	-53.76	6.79	48.26	Average	54	Pass
NVNT	n40	5270	-49.42	-48.36	-45.85	6.79	56.17	Peak	68.2	Pass
NVNT	n40	5270	-57.71	-57.86	-54.77	6.79	47.24	Average	54	Pass
NVNT	n40	5310	-42.54	-43.1	-39.80	6.79	62.22	Peak	68.2	Pass
NVNT	n40	5310	-55.94	-56.24	-53.08	6.79	48.94	Average	54	Pass
NVNT	n40	5310	-40.77	-43.1	-38.77	6.79	63.25	Peak	68.2	Pass
NVNT	n40	5310	-54.97	-55.63	-52.28	6.79	49.74	Average	54	Pass
NVNT	n40	5310	-50.86	-49.76	-47.26	6.79	54.75	Peak	68.2	Pass
NVNT	n40	5310	-57.85	-57.79	-54.81	6.79	47.21	Average	54	Pass
NVNT	ac20	5260	-50.75	-50.33	-47.52	6.79	54.49	Peak	68.2	Pass
NVNT	ac20	5260	-58.88	-59.05	-55.95	6.79	46.06	Average	54	Pass
NVNT	ac20	5260	-47	-46.49	-43.73	6.79	58.29	Peak	68.2	Pass
NVNT	ac20	5260	-56.67	-56.52	-53.58	6.79	48.43	Average	54	Pass
NVNT	ac20	5260	-50.17	-49.35	-46.73	6.79	55.29	Peak	68.2	Pass
NVNT	ac20	5260	-57.35	-57.77	-54.54	6.79	47.47	Average	54	Pass
NVNT	ac20	5320	-42.94	-45.34	-40.97	6.79	61.05	Peak	68.2	Pass
NVNT	ac20	5320	-55.7	-55.31	-52.49	6.79	49.53	Average	54	Pass
NVNT	ac20	5320	-41.86	-38.33	-36.74	6.79	65.28	Peak	68.2	Pass
NVNT	ac20	5320	-55.66	-55.31	-52.47	6.79	49.55	Average	54	Pass
NVNT	ac20	5320	-50.98	-49.33	-47.07	6.79	54.95	Peak	68.2	Pass
NVNT	ac20	5320	-57.57	-57.9	-54.72	6.79	47.30	Average	54	Pass
NVNT	ac40	5270	-51.51	-51.05	-48.26	6.79	53.75	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5270	-58.98	-58.97	-55.96	6.79	46.05	Average	54	Pass
NVNT	ac40	5270	-47.01	-45.3	-43.06	6.79	58.96	Peak	68.2	Pass
NVNT	ac40	5270	-56.61	-53.7	-51.91	6.79	50.11	Average	54	Pass
NVNT	ac40	5270	-49.86	-47.68	-45.62	6.79	56.39	Peak	68.2	Pass
NVNT	ac40	5270	-58.04	-57.07	-54.52	6.79	47.50	Average	54	Pass
NVNT	ac40	5310	-47.25	-42.6	-41.32	6.79	60.70	Peak	68.2	Pass
NVNT	ac40	5310	-55.33	-54.26	-51.75	6.79	50.27	Average	54	Pass
NVNT	ac40	5310	-43.67	-41.86	-39.66	6.79	62.36	Peak	68.2	Pass
NVNT	ac40	5310	-55.07	-54.26	-51.64	6.79	50.38	Average	54	Pass
NVNT	ac40	5310	-49.61	-50.45	-47.00	6.79	55.02	Peak	68.2	Pass
NVNT	ac40	5310	-58.04	-57.57	-54.79	6.79	47.23	Average	54	Pass
NVNT	ac80	5290	-50.39	-50.58	-47.47	6.79	54.54	Peak	68.2	Pass
NVNT	ac80	5290	-58.46	-59.06	-55.74	6.79	46.28	Average	54	Pass
NVNT	ac80	5290	-46.21	-46.2	-43.19	6.79	58.82	Peak	68.2	Pass
NVNT	ac80	5290	-56.41	-56.46	-53.42	6.79	48.59	Average	54	Pass
NVNT	ac80	5290	-48.24	-49.2	-45.68	6.79	56.33	Peak	68.2	Pass
NVNT	ac80	5290	-56.63	-57.03	-53.82	6.79	48.20	Average	54	Pass
NVNT	ac80	5290	-42.82	-44.74	-40.66	6.79	61.35	Peak	68.2	Pass
NVNT	ac80	5290	-55.66	-53.68	-51.55	6.79	50.47	Average	54	Pass
NVNT	ac80	5290	-41.46	-40.13	-37.73	6.79	64.28	Peak	68.2	Pass
NVNT	ac80	5290	-55.3	-53.08	-51.04	6.79	50.98	Average	54	Pass
NVNT	ac80	5290	-50.21	-49.52	-46.84	6.79	55.18	Peak	68.2	Pass
NVNT	ac80	5290	-57.82	-57.45	-54.62	6.79	47.40	Average	54	Pass





D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	a	5300	Ant1	5299.98	-20000	-3.77	25	Pass
NVNT	a	5320	Ant1	5320	0	0	25	Pass
NVNT	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	n20	5300	Ant1	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant1	5270	0	0	25	Pass
NVNT	n40	5310	Ant1	5310	0	0	25	Pass
NVNT	ac20	5260	Ant1	5260	0	0	25	Pass
NVNT	ac20	5300	Ant1	5300	0	0	25	Pass
NVNT	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
NVNT	ac40	5310	Ant1	5310	0	0	25	Pass
NVNT	ac80	5290	Ant1	5290	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant1

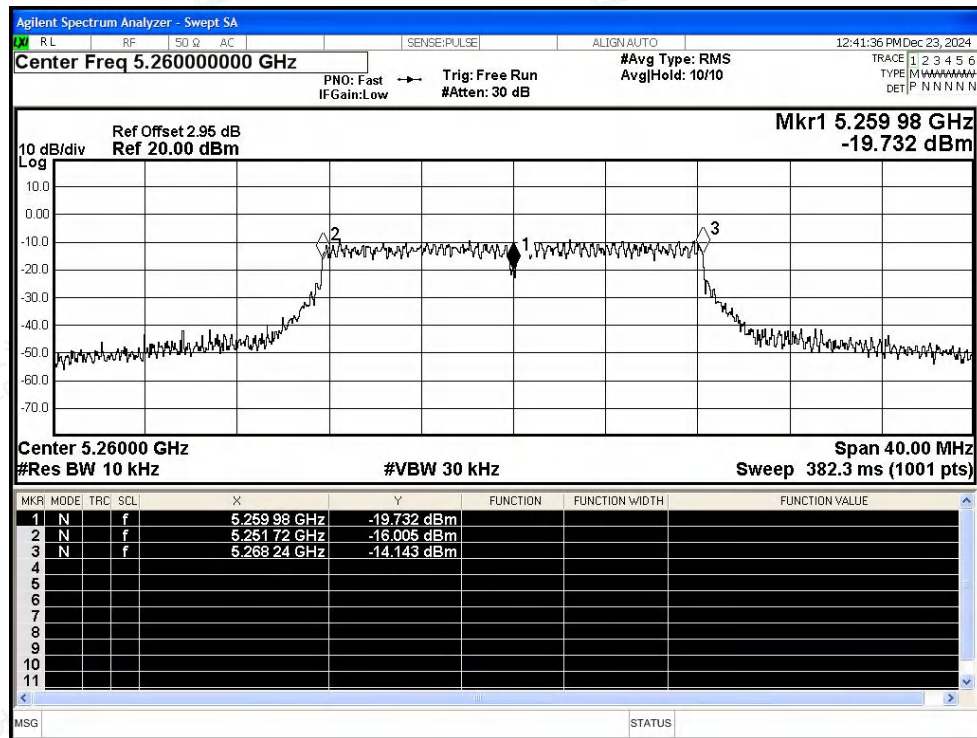

Freq. Stability NVNT a 5300MHz Ant1

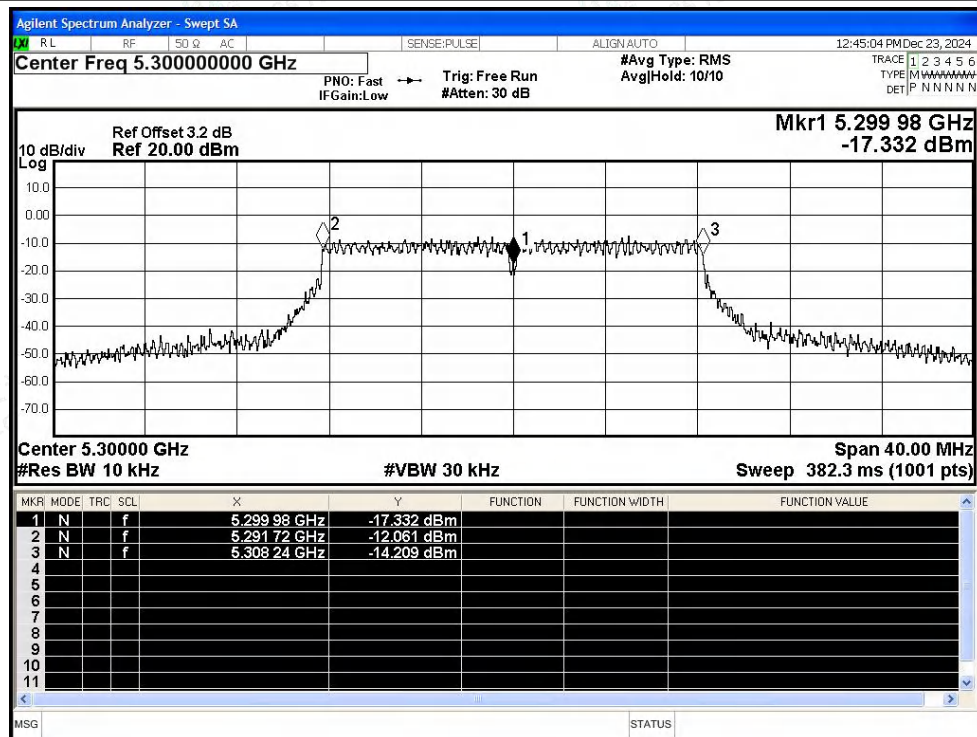

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant1

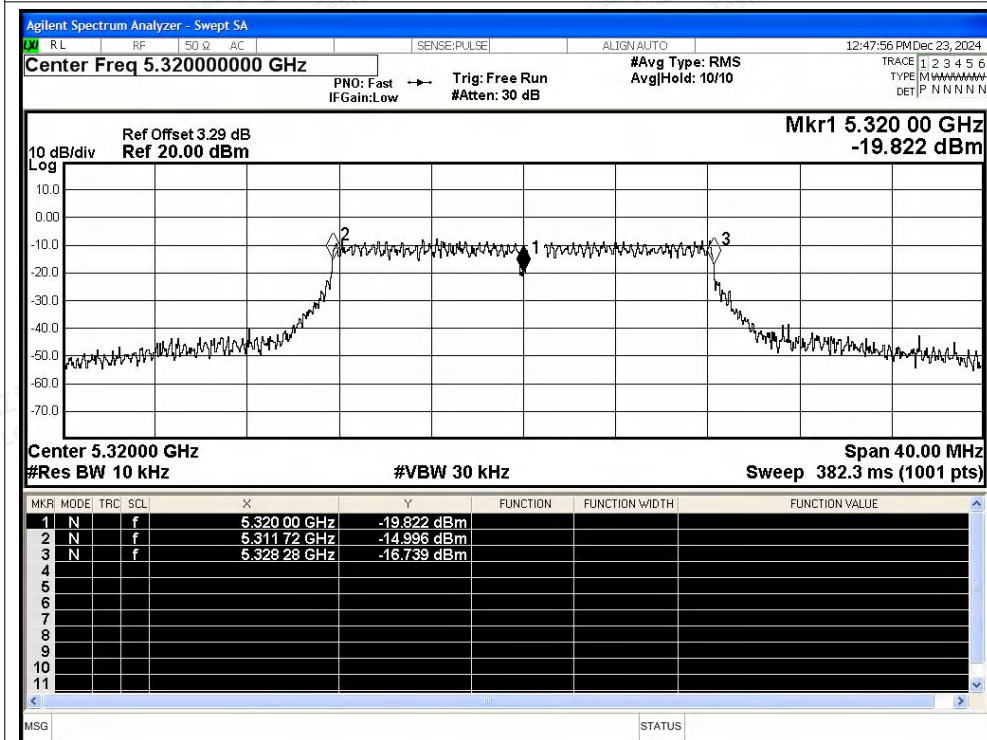


Freq. Stability NVNT n20 5260MHz Ant1

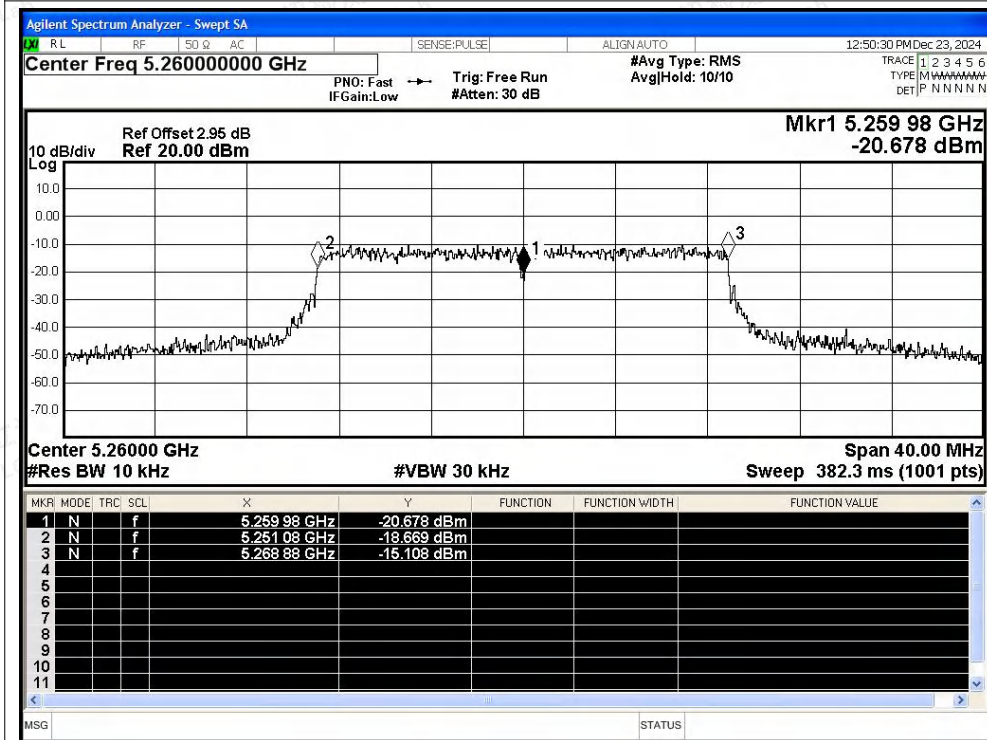




Freq. Stability NVNT n20 5300MHz Ant1

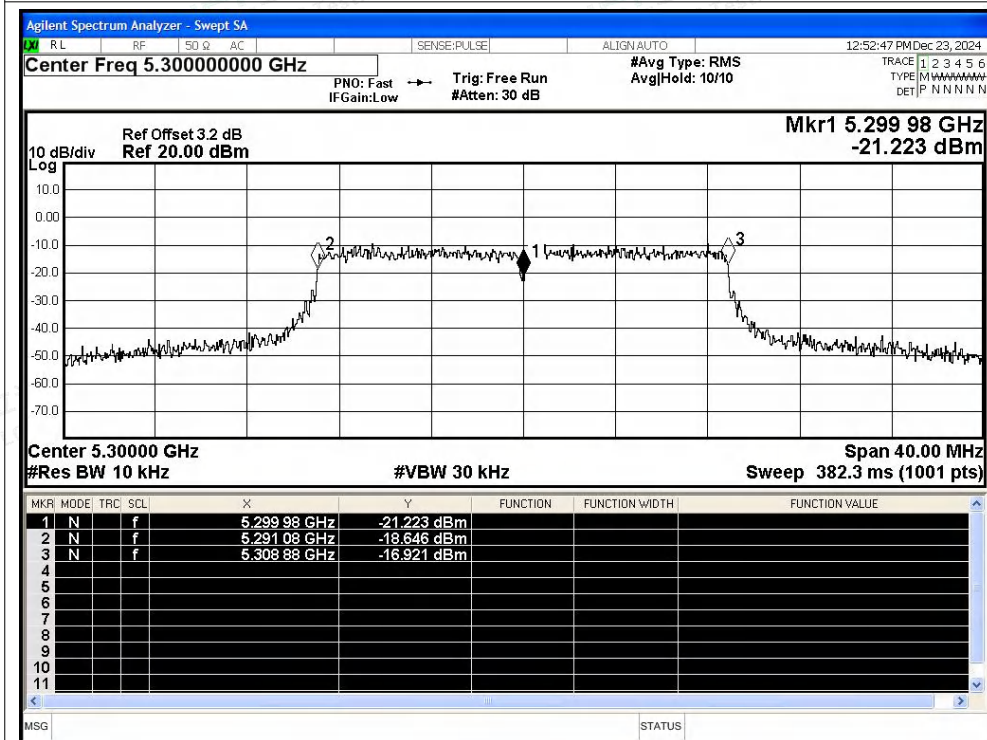

Freq. Stability NVNT n20 5320MHz Ant1

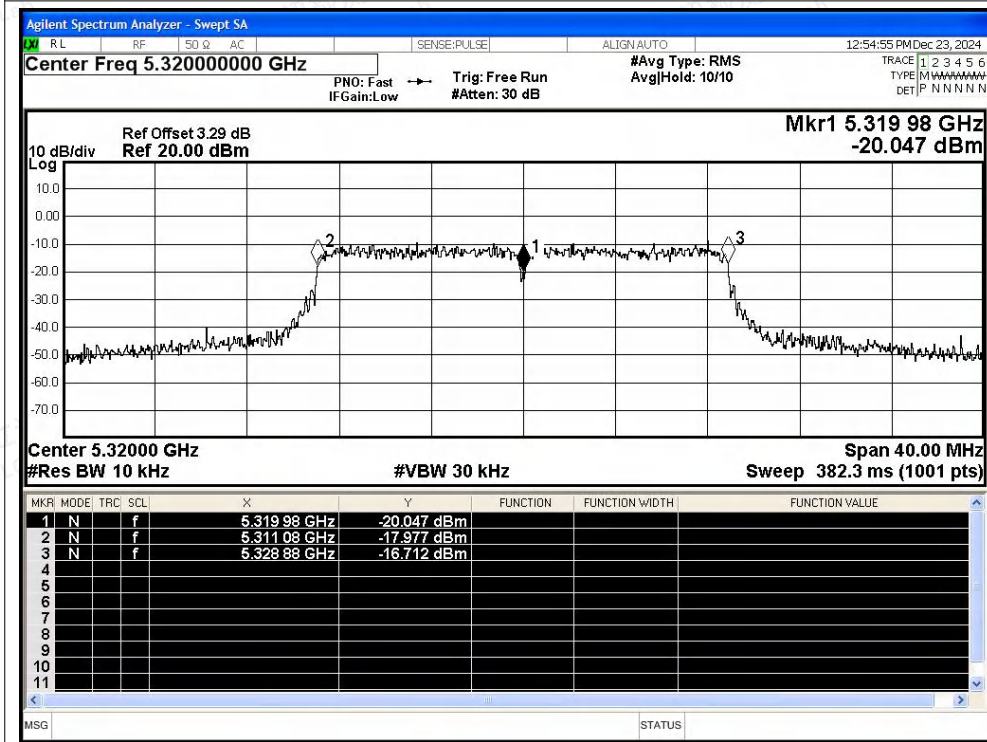

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant1

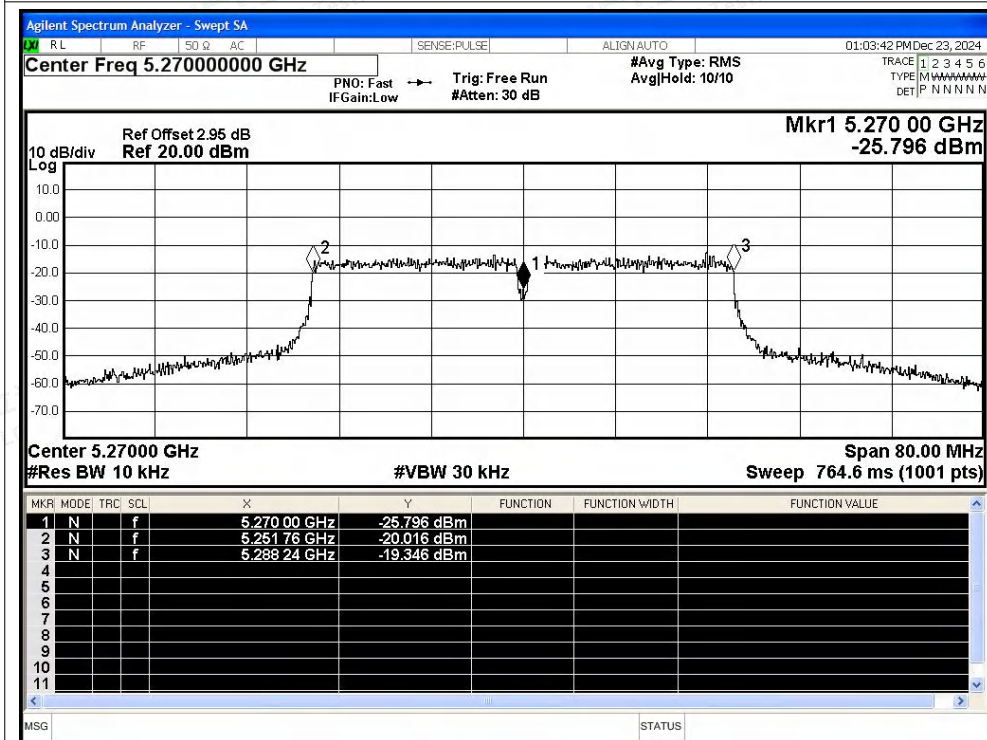

Freq. Stability NVNT n40 5310MHz Ant1

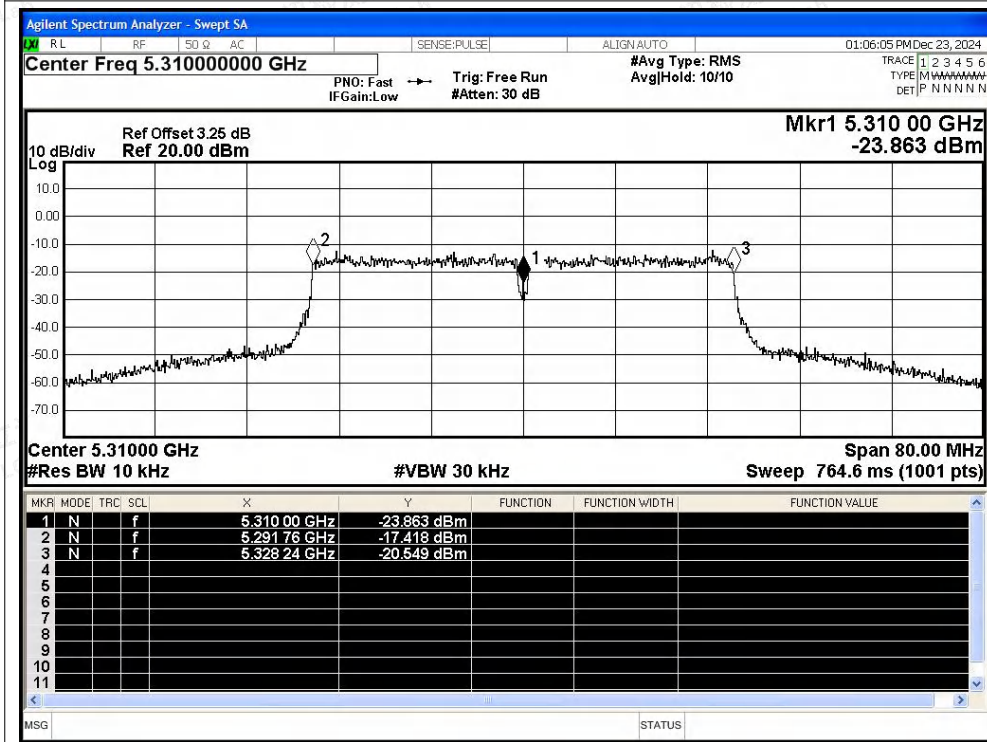

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant1

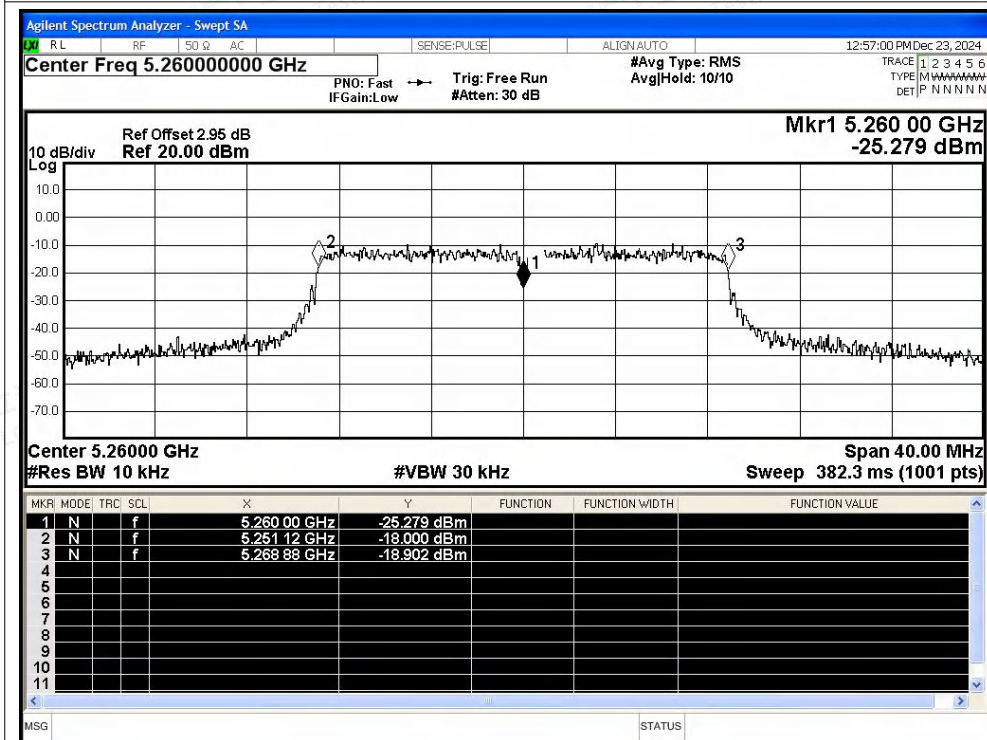

Freq. Stability NVNT ac20 5300MHz Ant1

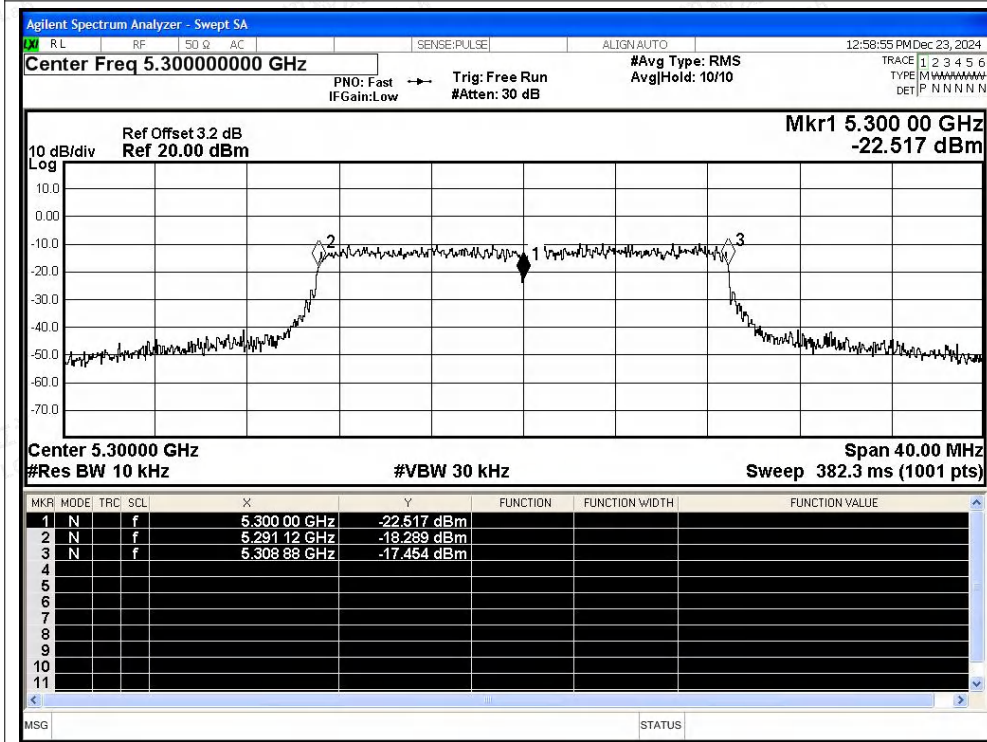

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant1

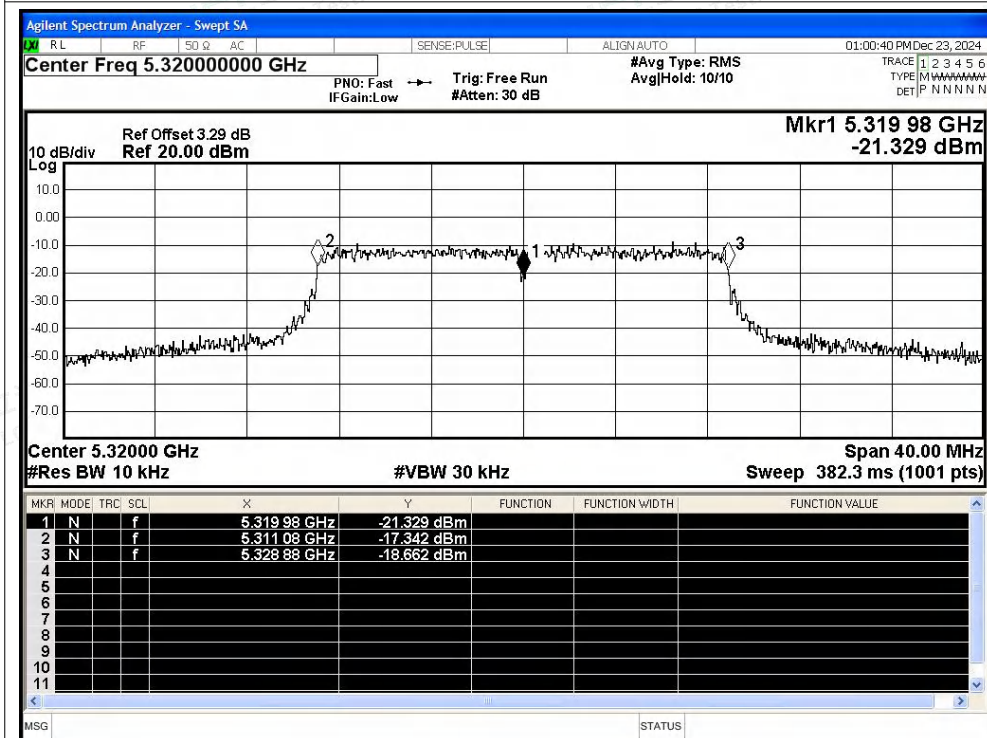

Freq. Stability NVNT ac40 5270MHz Ant1

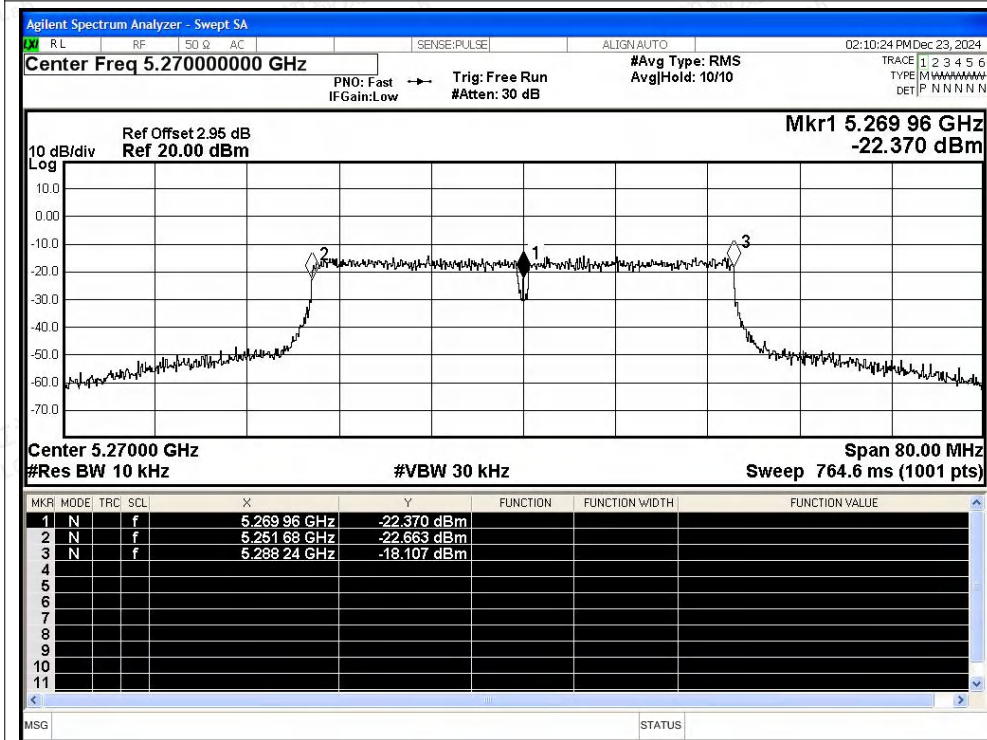

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant1

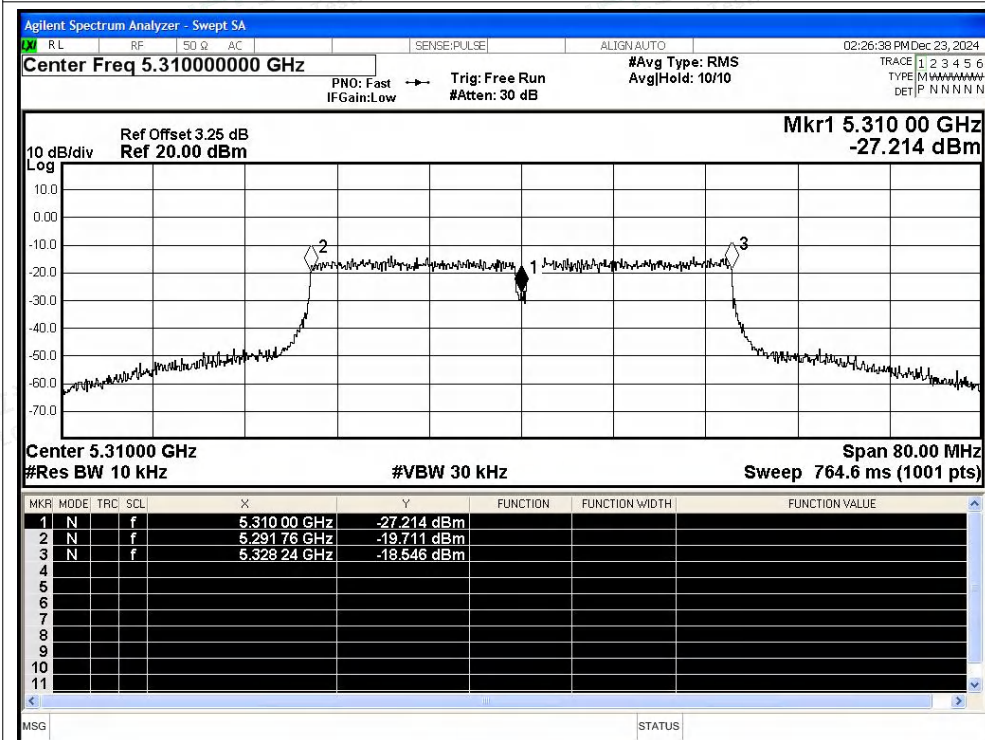

Freq. Stability NVNT ac80 5290MHz Ant1

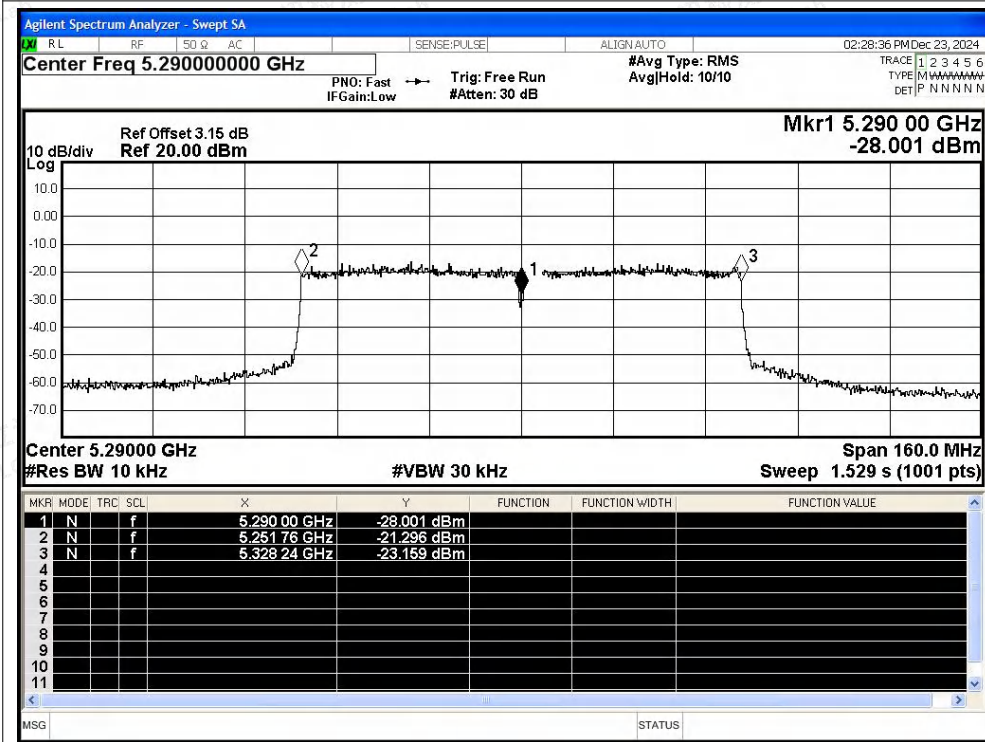

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	a	5300	Ant2	5300	0	0	25	Pass
NVNT	a	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant2	5260	0	0	25	Pass
NVNT	n20	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant2	5270	0	0	25	Pass
NVNT	n40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	ac20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant2	5270	0	0	25	Pass
NVNT	ac40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
NVNT	ac80	5290	Ant2	5290	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant2

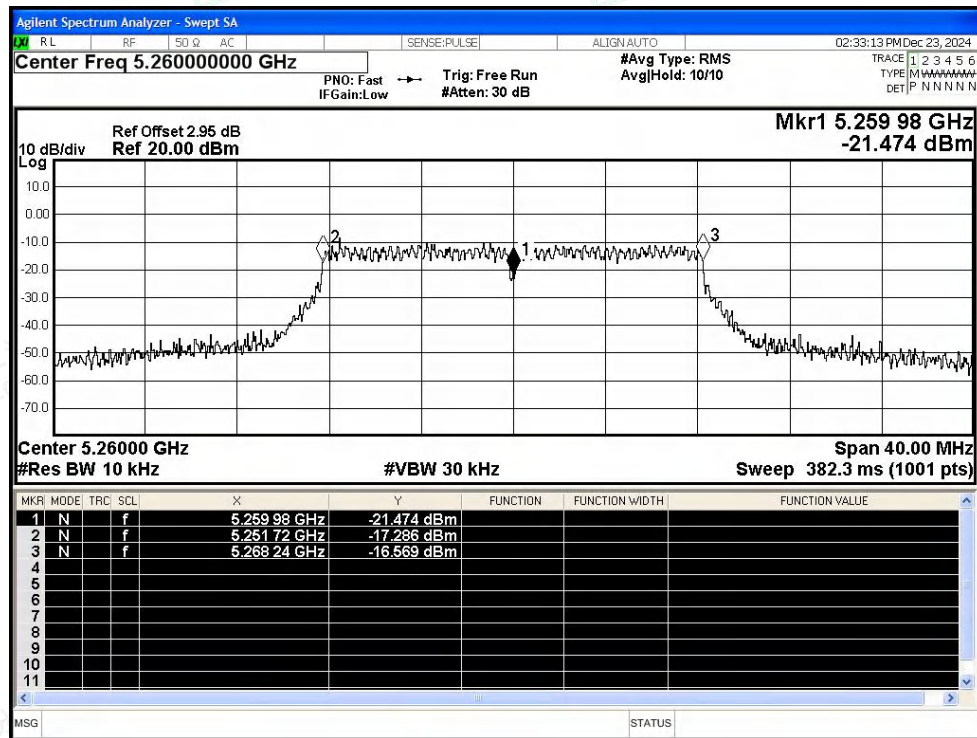

Freq. Stability NVNT a 5300MHz Ant2

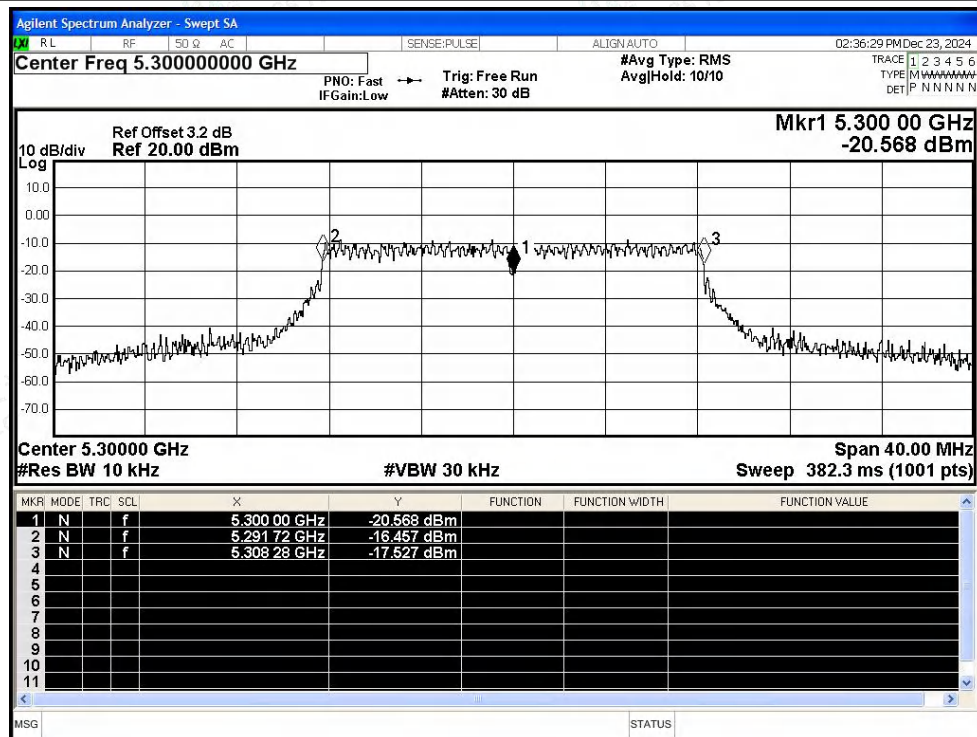

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity