



Band42c 20MHz 16QAM LCH 3560MHz RB 1 0 NTNV

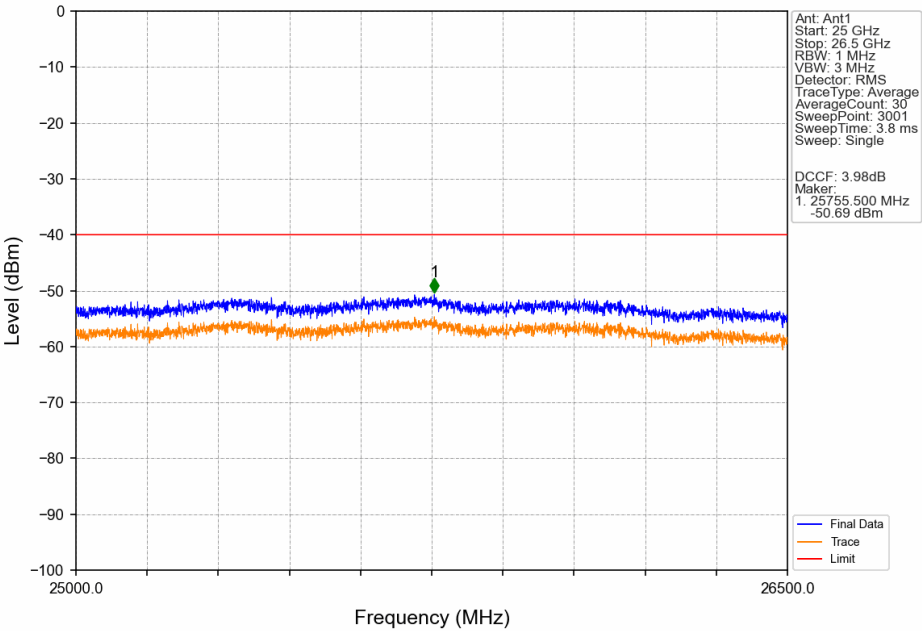


Band42c 20MHz 16QAM LCH 3560MHz RB 100 0 NTNV

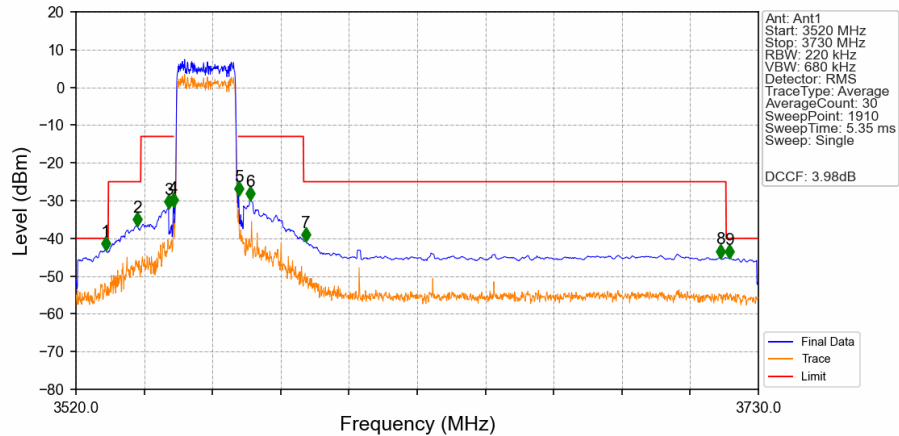


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
3520	3530	1	CHP	1	3529.130	-42.95	-40	Pass
3530	3540	1	CHP	2	3538.811	-36.55	-25	Pass
3540	3550	1	CHP	3	3548.491	-31.85	-13	Pass
3550	3550	0.22	/	4	3549.921	-31.33	-13	Pass
3550	3570	0.22	/	/	/	/	/	/
3570	3571	0.22	/	5	3570.052	-28.37	-13	Pass
3571	3590	1	CHP	6	3573.683	-29.68	-13	Pass
3590	3530	1	CHP	7	3590.733	-40.55	-25	Pass
3530	3720	1	CHP	8	3718.229	-45.00	-25	Pass
3720	3730	1	CHP	9	3721.090	-45.11	-40	Pass


Band42c 20MHz 16QAM MCH 3575MHz RB 1 0 NTNV

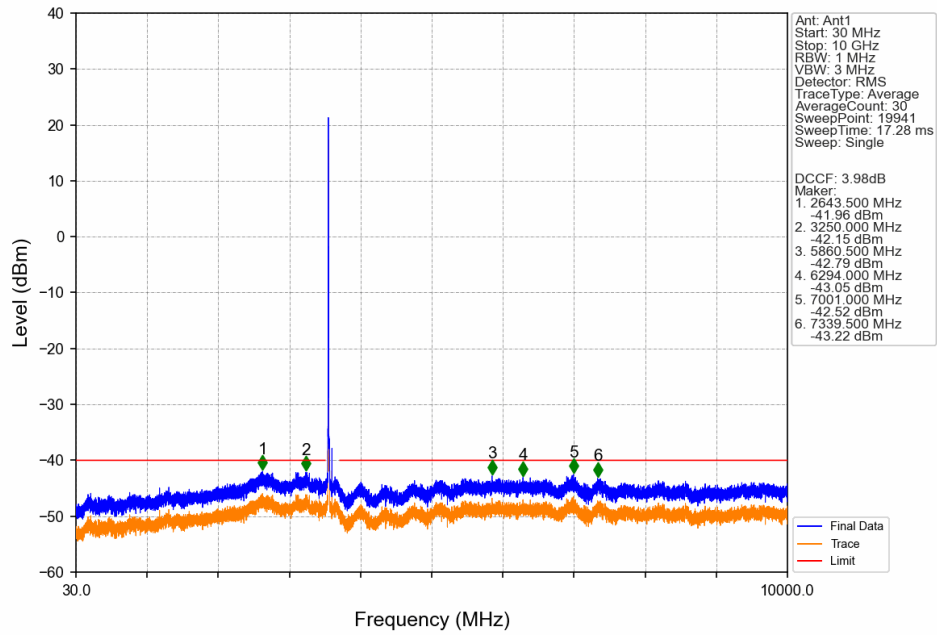


Band42c 20MHz 16QAM MCH 3575MHz RB 1 0 NTNV

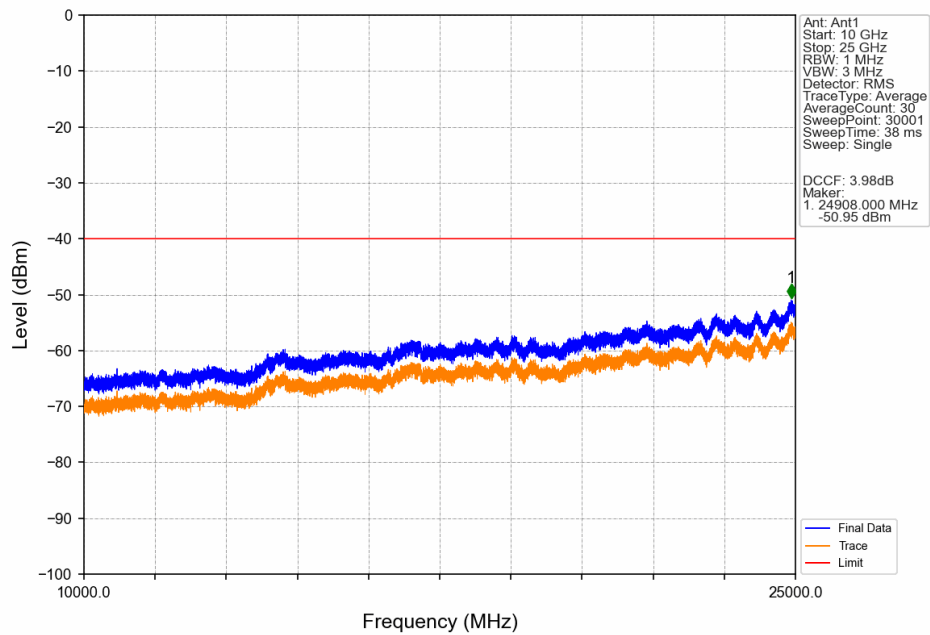


Band42c 20MHz 16QAM MCH 3575MHz RB 1 0 NTNV

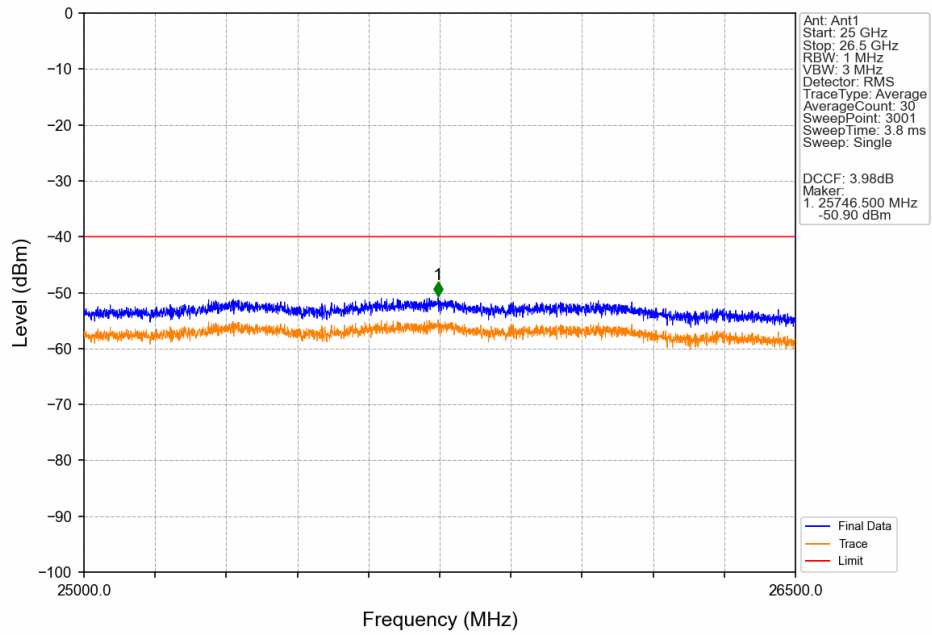


Band42c 20MHz 16QAM HCH 3590MHz RB 1 0 NTNV

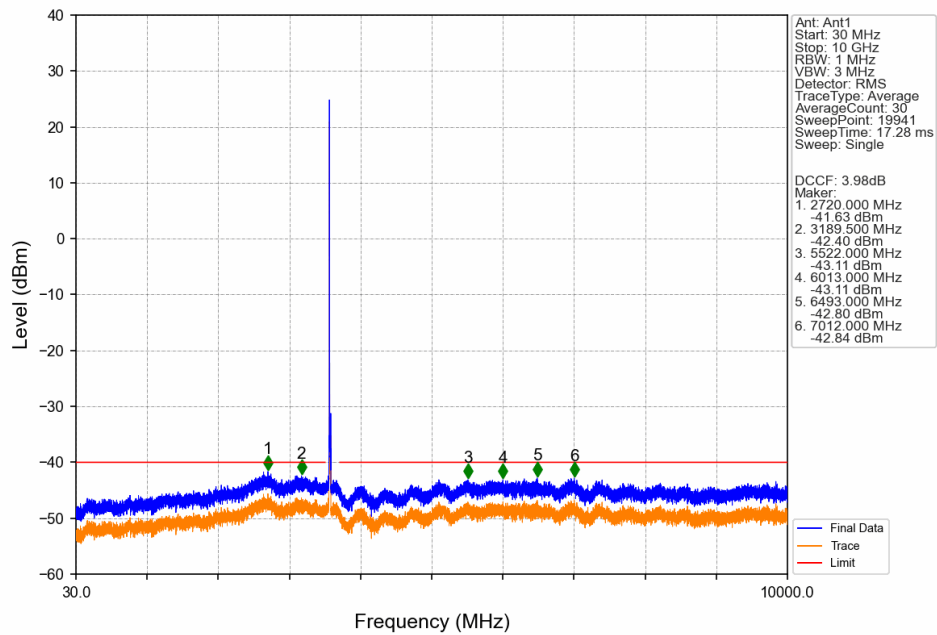


Band42c 20MHz 16QAM HCH 3590MHz RB 1 0 NTNV

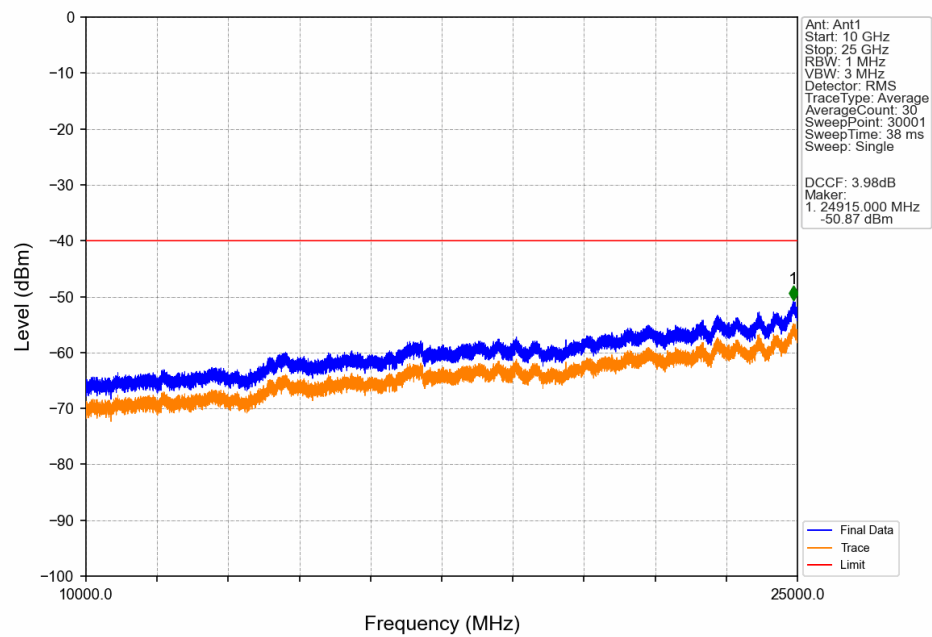

Band42c 20MHz 16QAM HCH 3590MHz RB 1 0 NTNV

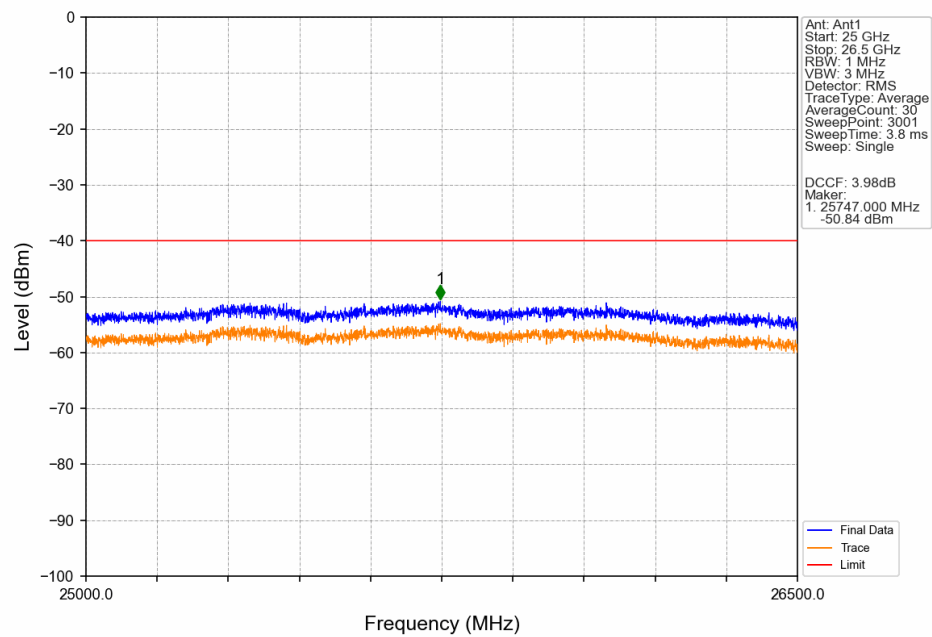


Band42c 20MHz 16QAM HCH 3590MHz RB 1 99 NTNV

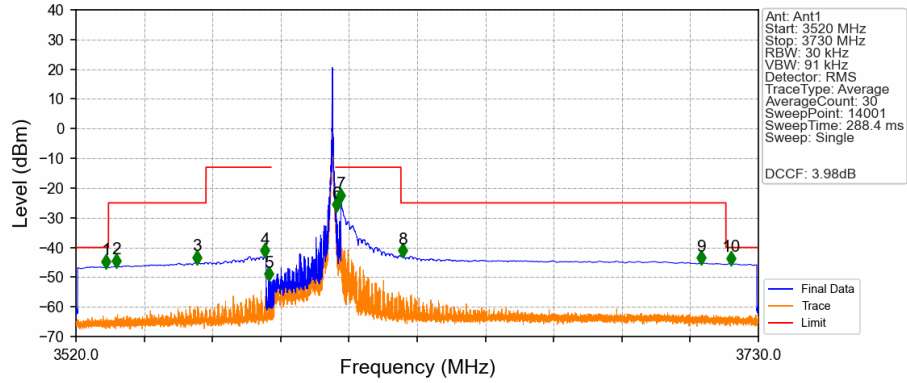

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
3520	3530	1	CHP	1	3529.270	-46.53	-40	Pass
3530	3540	1	CHP	2	3532.435	-46.13	-25	Pass
3540	3560	1	CHP	3	3557.335	-45.08	-25	Pass
3560	3580	1	CHP	4	3578.200	-42.78	-13	Pass
3580	3580	0.03	/	5	3579.310	-50.64	-13	Pass
3580	3600	0.03	/	/	/	/	/	/
3600	3601	0.03	/	6	3600.085	-27.27	-13	Pass
3601	3620	1	CHP	7	3601.510	-24.19	-13	Pass
3620	3720	1	CHP	8	3620.440	-42.77	-25	Pass
3720	3720	1	CHP	9	3712.405	-45.20	-25	Pass
3720	3730	1	CHP	10	3721.630	-45.40	-40	Pass

Band42c 20MHz 16QAM HCH 3590MHz RB 100 0 NTNV

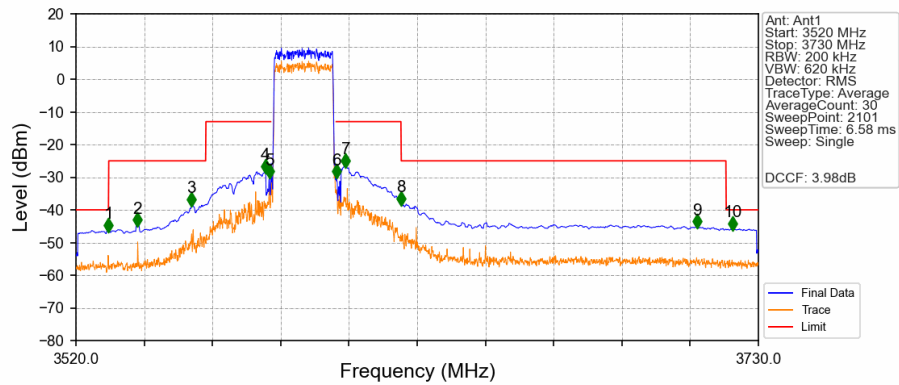

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
3520	3530	1	CHP	1	3530.000	-46.30	-40	Pass
3530	3540	1	CHP	2	3538.900	-44.65	-25	Pass
3540	3560	1	CHP	3	3555.600	-38.33	-25	Pass
3560	3580	1	CHP	4	3578.300	-28.15	-13	Pass
3580	3580	0.2	/	5	3579.500	-29.85	-13	Pass
3580	3600	0.2	/	/	/	/	/	/
3600	3601	0.2	/	6	3600.200	-29.79	-13	Pass
3601	3620	1	CHP	7	3603.000	-26.51	-13	Pass
3620	3720	1	CHP	8	3620.100	-38.03	-25	Pass
3720	3720	1	CHP	9	3711.200	-45.16	-25	Pass
3720	3730	1	CHP	10	3722.100	-45.82	-40	Pass