





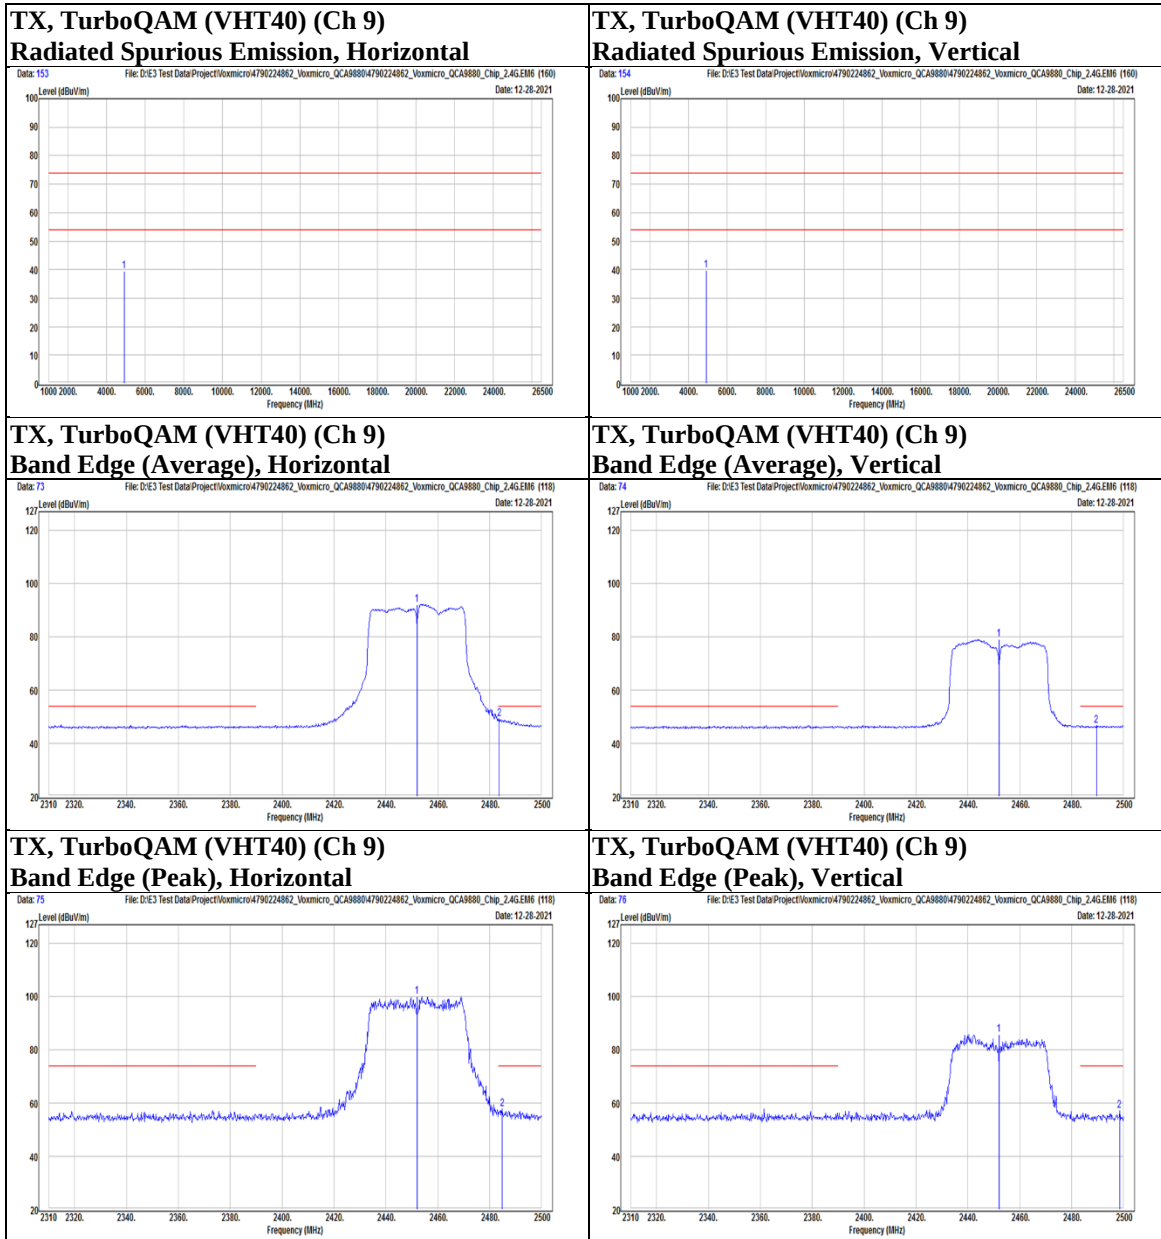

Below 1 GHz

Mode	802.11g	Channel	6
------	---------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		99.84	55.74	-16.45	39.29	43.5	-4.21	PK
		213.33	53.68	-13.44	40.24	43.5	-3.26	PK
		299.66	51.48	-9.94	41.54	46	-4.46	PK
		361.74	51.14	-8.15	42.99	46	-3.01	PK
		373.38	50.73	-7.78	42.95	46	-3.05	PK
		498.51	47.03	-4.79	42.24	46	-3.76	PK
Vertical		99.84	55.08	-16.45	38.63	43.5	-4.87	PK
		155.13	39.58	-11.21	28.37	43.5	-15.13	PK
		198.78	44.85	-13.9	30.95	43.5	-12.55	PK
		323.91	47.27	-9.18	38.09	46	-7.91	PK
		373.38	43.38	-7.78	35.6	46	-10.4	PK
		497.54	45.47	-4.79	40.68	46	-5.32	PK

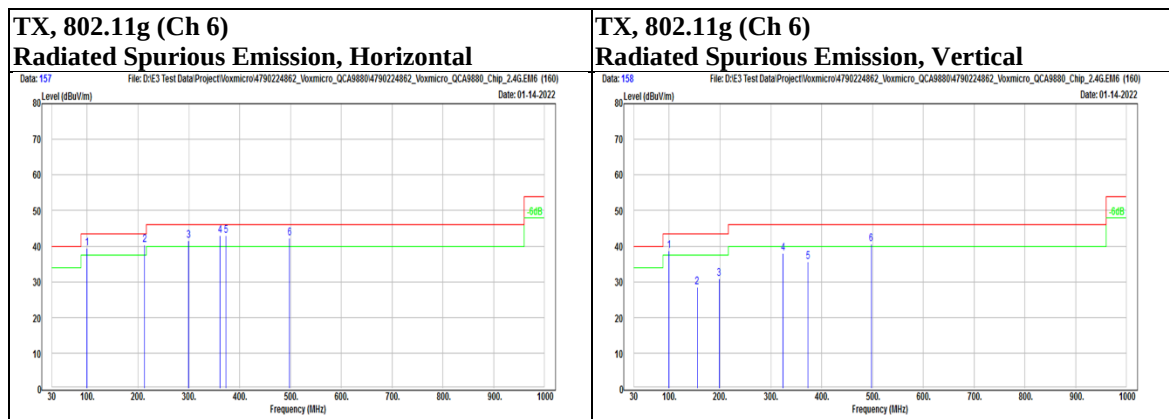

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



FPC Antenna

Above 1 GHz

Mode	802.11b	Channel	1
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2380.11	41.87	16.08	57.95	74	-16.05	PK
		2389.99	30.85	16.1	46.95	54	-7.05	AVG
	@	2412	95.94	16.13	112.07	N/A	N/A	PK
	@	2412	93.33	16.13	109.46	N/A	N/A	AVG
	*	4824	39.35	2.55	41.9	74	-32.1	PK
Vertical		2333.75	30.6	16.1	46.7	54	-7.3	AVG
		2378.4	41.12	16.08	57.2	74	-16.8	PK
	@	2412	87.35	16.13	103.48	N/A	N/A	PK
	@	2412	85.16	16.13	101.29	N/A	N/A	AVG
	*	4824	38.1	2.55	40.65	74	-33.35	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

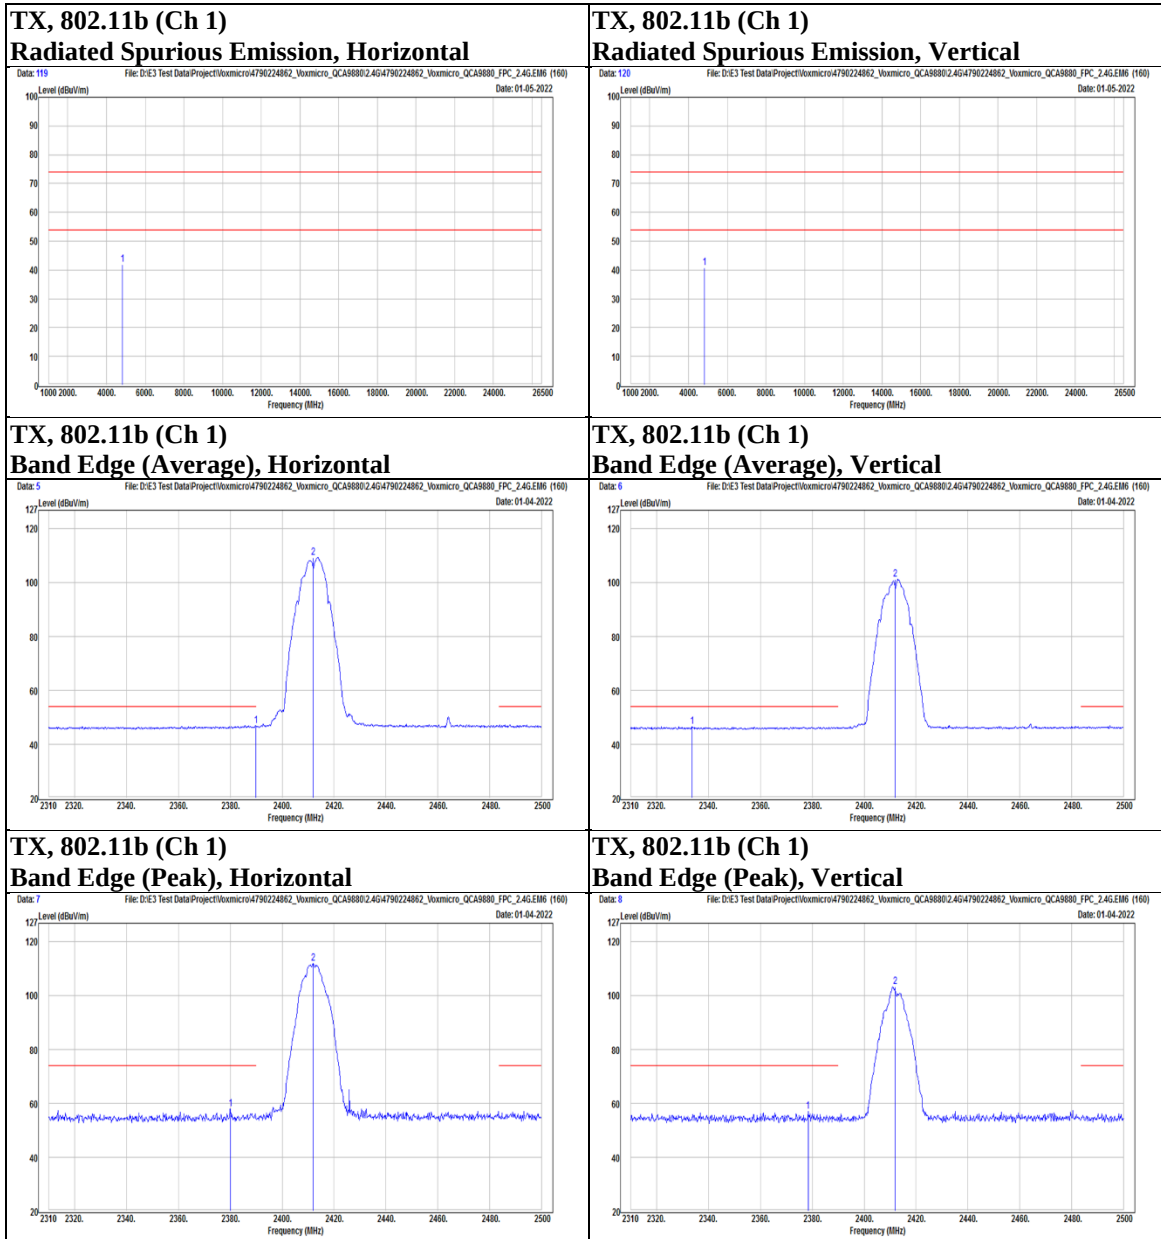



Test report No. : 4790224862-US-R0-V0
Page : 141 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11b	Channel	6
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2327.48	41.32	16.12	57.44	74	-16.56	PK
		2384.29	30.67	16.09	46.76	54	-7.24	AVG
	@	2437	96.31	16.12	112.43	N/A	N/A	PK
	@	2437	93.47	16.12	109.59	N/A	N/A	AVG
		2493.92	31.08	16.1	47.18	54	-6.82	AVG
		2496.58	41.19	16.1	57.29	74	-16.71	PK
	*	4874	40.02	2.66	42.68	74	-31.32	PK
Vertical		2367.95	30.53	16.07	46.6	54	-7.4	AVG
		2389.23	40.71	16.1	56.81	74	-17.19	PK
	@	2437	84.97	16.12	101.09	N/A	N/A	PK
	@	2437	81.8	16.12	97.92	N/A	N/A	AVG
		2485.37	40.73	16.1	56.83	74	-17.17	PK
		2496.58	30.36	16.1	46.46	54	-7.54	AVG
	*	4874	39.59	2.66	42.25	74	-31.75	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

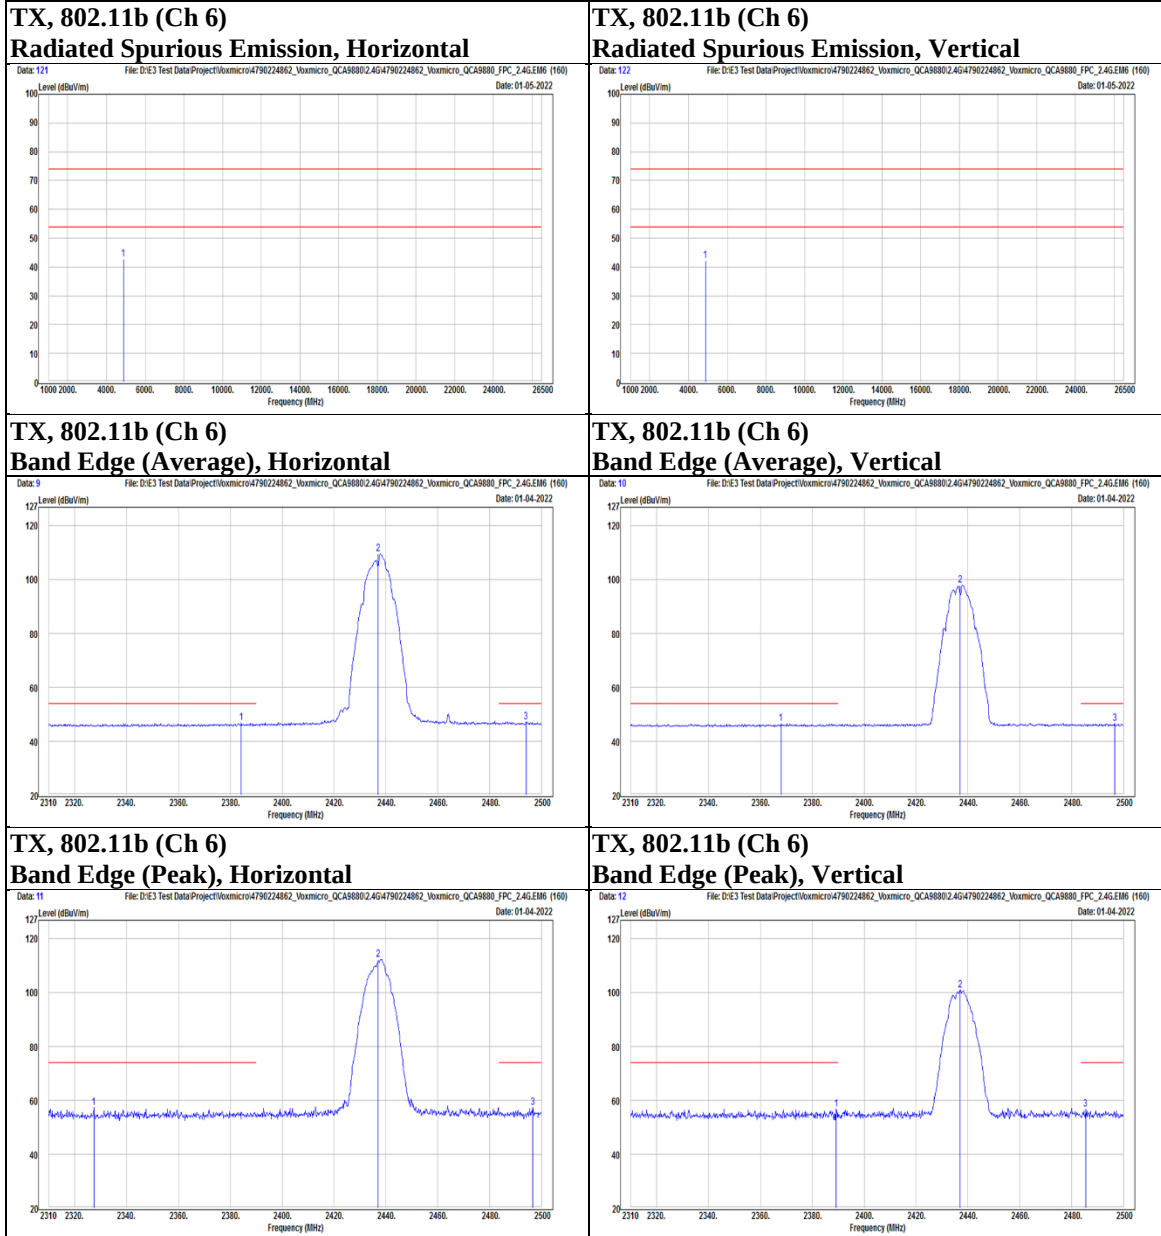

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790224862-US-R0-V0
Page : 143 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11b	Channel	11
------	---------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2462	95.21	16.12	111.33	N/A	N/A	PK
	@	2462	91.95	16.12	108.07	N/A	N/A	AVG
		2485.18	41.49	16.1	57.59	74	-16.41	PK
		2485.75	31.46	16.1	47.56	54	-6.44	AVG
	*	4924	40.14	2.61	42.75	74	-31.25	PK
Vertical	@	2462	85.22	16.12	101.34	N/A	N/A	PK
	@	2462	82.21	16.12	98.33	N/A	N/A	AVG
		2483.85	30.62	16.1	46.72	54	-7.28	AVG
		2485.18	40.71	16.1	56.81	74	-17.19	PK
	*	4924	40.13	2.61	42.74	74	-31.26	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

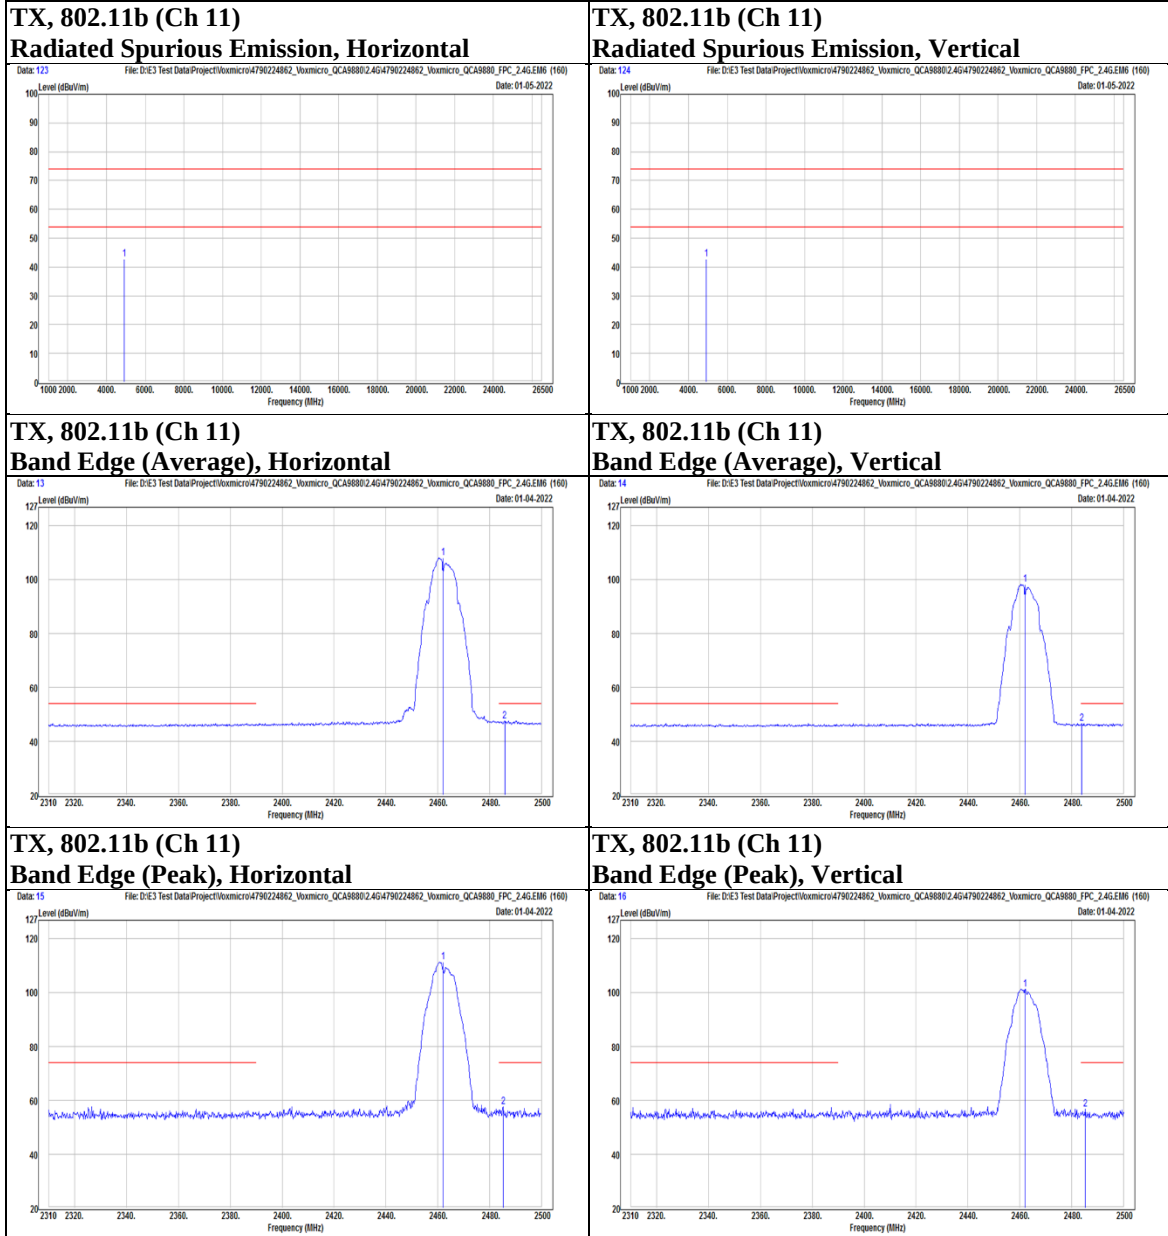



Test report No. : 4790224862-US-R0-V0
Page : 145 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11g	Channel	1
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2389.8	36.77	16.1	52.87	54	-1.13	AVG
		2389.99	50.03	16.1	66.13	74	-7.87	PK
	@	2412	97.19	16.13	113.32	N/A	N/A	PK
	@	2412	89.47	16.13	105.6	N/A	N/A	AVG
	*	4824	37.91	2.55	40.46	74	-33.54	PK
Vertical		2320.45	41.09	16.16	57.25	74	-16.75	PK
		2389.99	31.17	16.1	47.27	54	-6.73	AVG
	@	2412	87.89	16.13	104.02	N/A	N/A	PK
	@	2412	81.59	16.13	97.72	N/A	N/A	AVG
	*	4824	37.45	2.55	40	74	-34	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

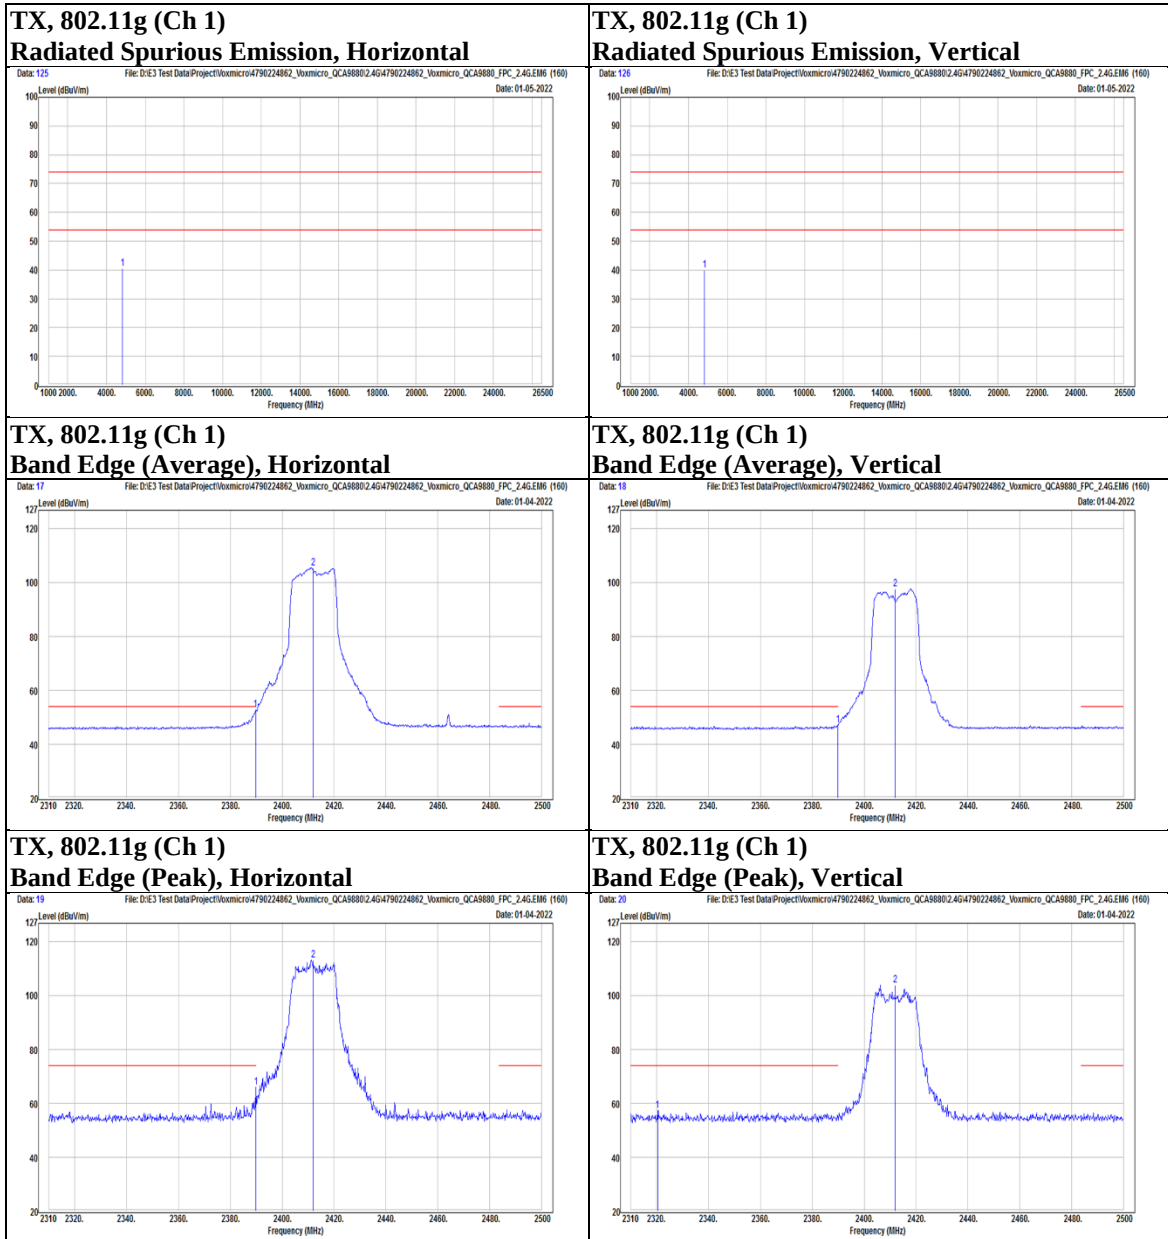



Test report No. : 4790224862-US-R0-V0
Page : 147 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11g	Channel	2
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2389.42	48.46	16.1	64.56	74	-9.44	PK
		2389.99	37.2	16.1	53.3	54	-0.7	AVG
	@	2417	101.13	16.13	117.26	N/A	N/A	PK
	@	2417	92.46	16.13	108.59	N/A	N/A	AVG
	*	4834	38.47	2.61	41.08	74	-32.92	PK
Vertical		2360.73	41.27	16.05	57.32	74	-16.68	PK
		2389.99	31.53	16.1	47.63	54	-6.37	AVG
	@	2417	90.39	16.13	106.52	N/A	N/A	PK
	@	2417	82.95	16.13	99.08	N/A	N/A	AVG
	*	4834	38.39	2.61	41	74	-33	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

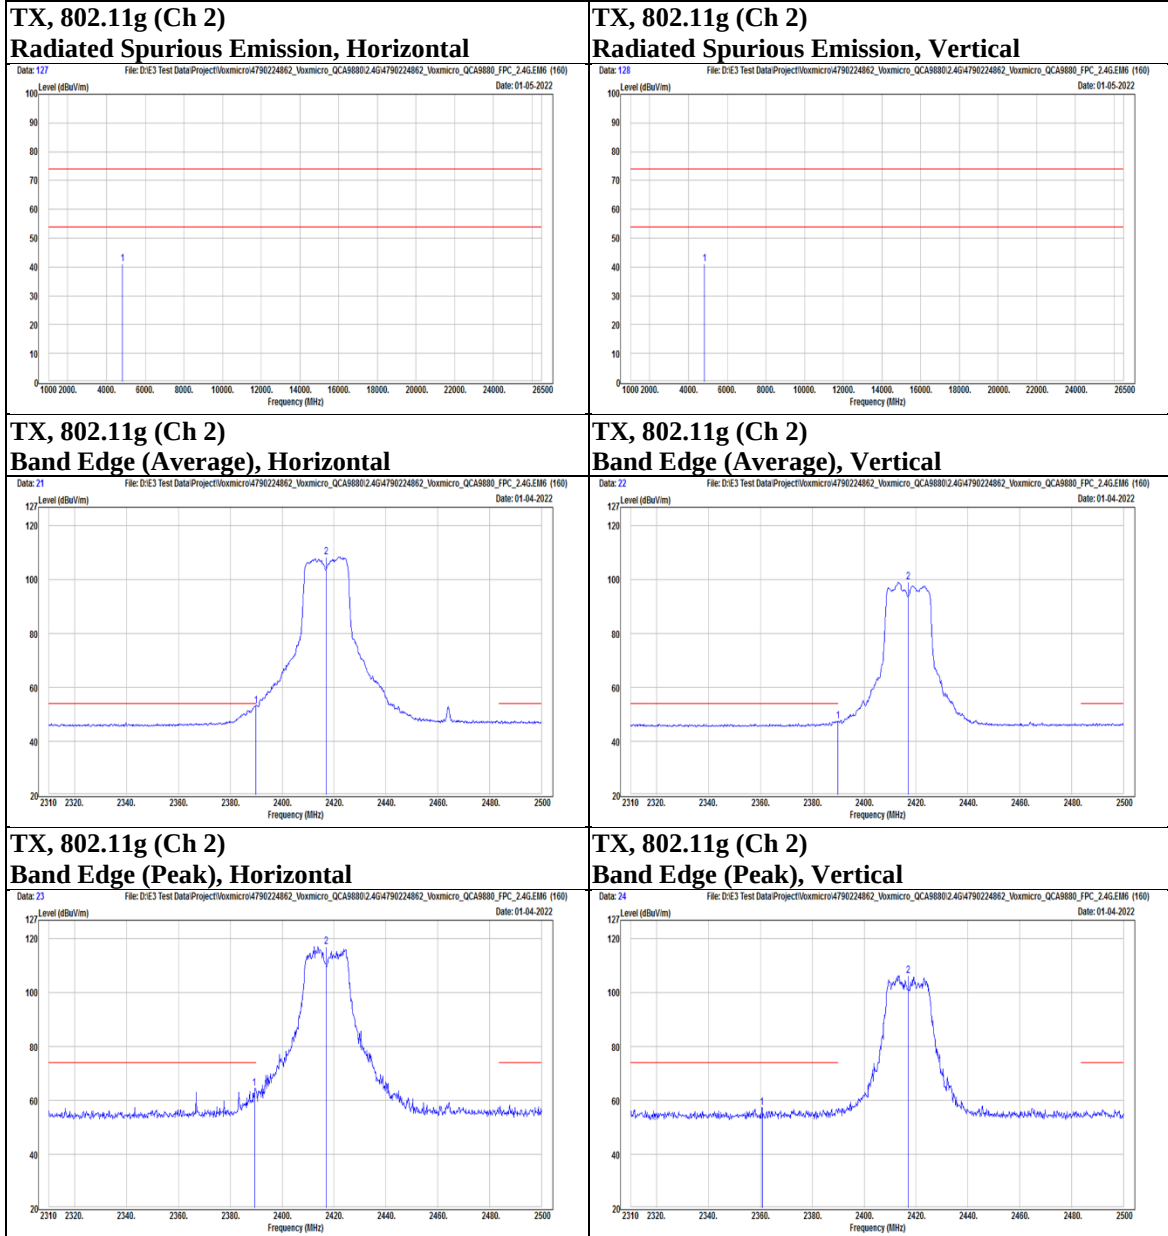



Mode	802.11g	Channel	6
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2388.28	50.56	16.1	66.66	74	-7.34	PK
		2388.85	36.94	16.1	53.04	54	-0.96	AVG
	@	2437	104.12	16.12	120.24	N/A	N/A	PK
	@	2437	96.22	16.12	112.34	N/A	N/A	AVG
		2483.66	36.78	16.1	52.88	54	-1.12	AVG
		2484.42	46.96	16.1	63.06	74	-10.94	PK
	*	4874	42.27	2.66	44.93	74	-29.07	PK
		7311	45.72	10.62	56.34	74	-17.66	PK
		7311	39.73	10.62	50.35	54	-3.65	AVG
Vertical		2388.66	31.74	16.1	47.84	54	-6.16	AVG
		2389.42	45.27	16.1	61.37	74	-12.63	PK
	@	2437	93.75	16.12	109.87	N/A	N/A	PK
	@	2437	86.57	16.12	102.69	N/A	N/A	AVG
		2483.66	42.27	16.1	58.37	74	-15.63	PK
		2485.56	31.42	16.1	47.52	54	-6.48	AVG
	*	4874	42.3	2.66	44.96	74	-29.04	PK
		7311	44.82	10.62	55.44	74	-18.56	PK
		7311	36.62	10.62	47.24	54	-6.76	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

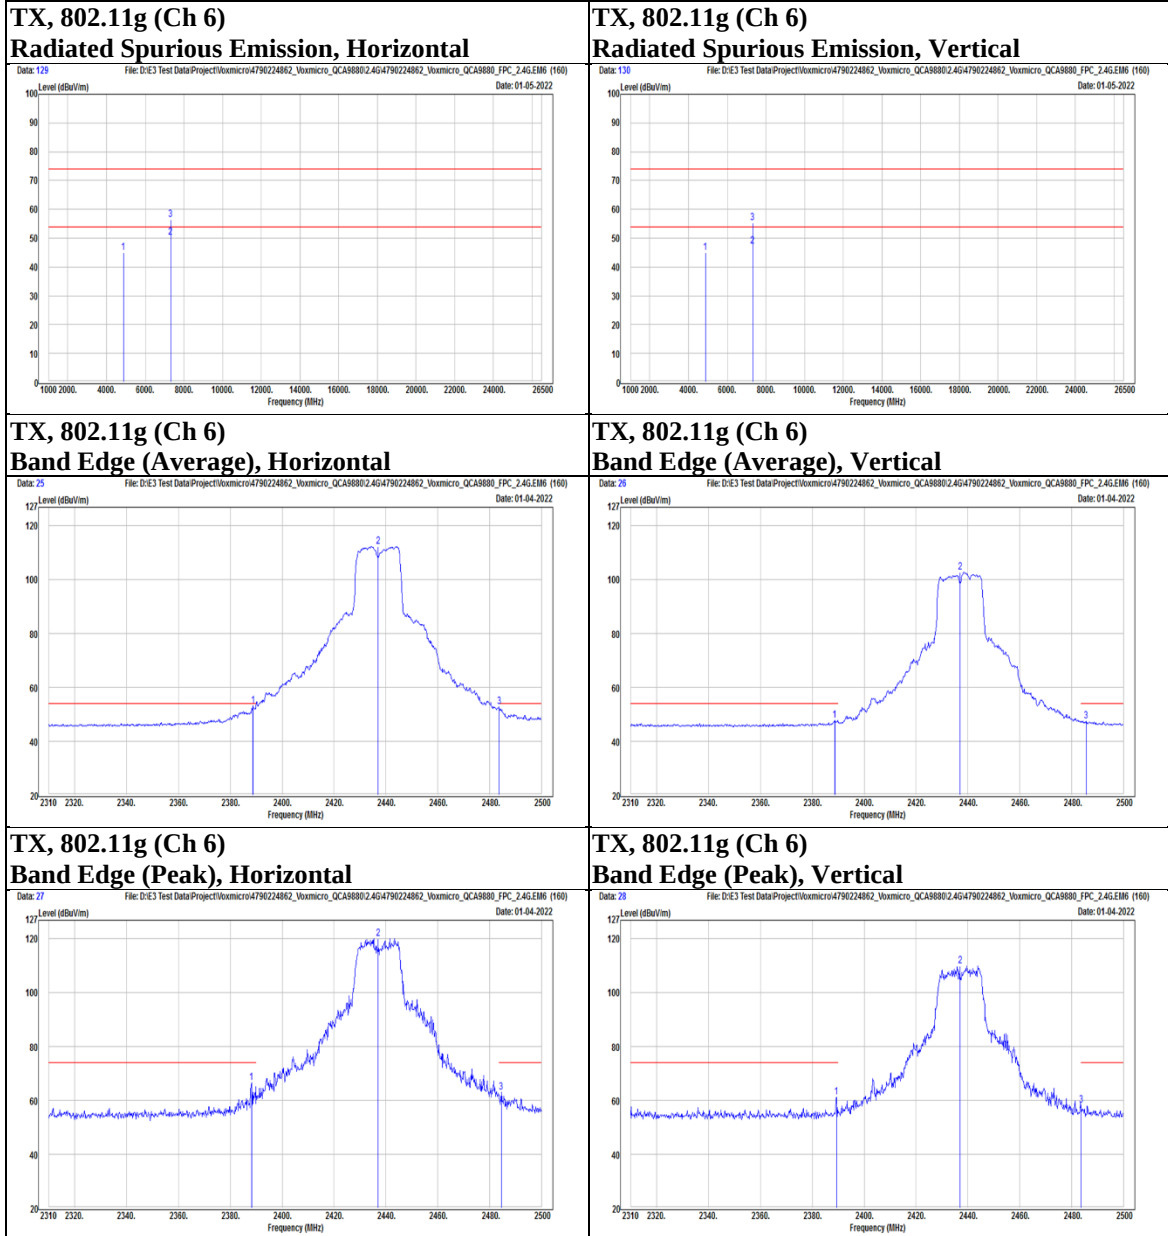



Test report No. : 4790224862-US-R0-V0
Page : 151 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11g	Channel	10
------	---------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2457	100.58	16.12	116.7	N/A	N/A	PK
	@	2457	92.37	16.12	108.49	N/A	N/A	AVG
		2484.04	47.5	16.1	63.6	74	-10.4	PK
		2484.23	33.13	16.1	49.23	54	-4.77	AVG
	*	4914	39.74	2.63	42.37	74	-31.63	PK
Vertical	@	2457	89.94	16.12	106.06	N/A	N/A	PK
	@	2457	81.75	16.12	97.87	N/A	N/A	AVG
		2489.17	40.6	16.1	56.7	74	-17.3	PK
		2491.45	30.48	16.1	46.58	54	-7.42	AVG
	*	4914	39.84	2.63	42.47	74	-31.53	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

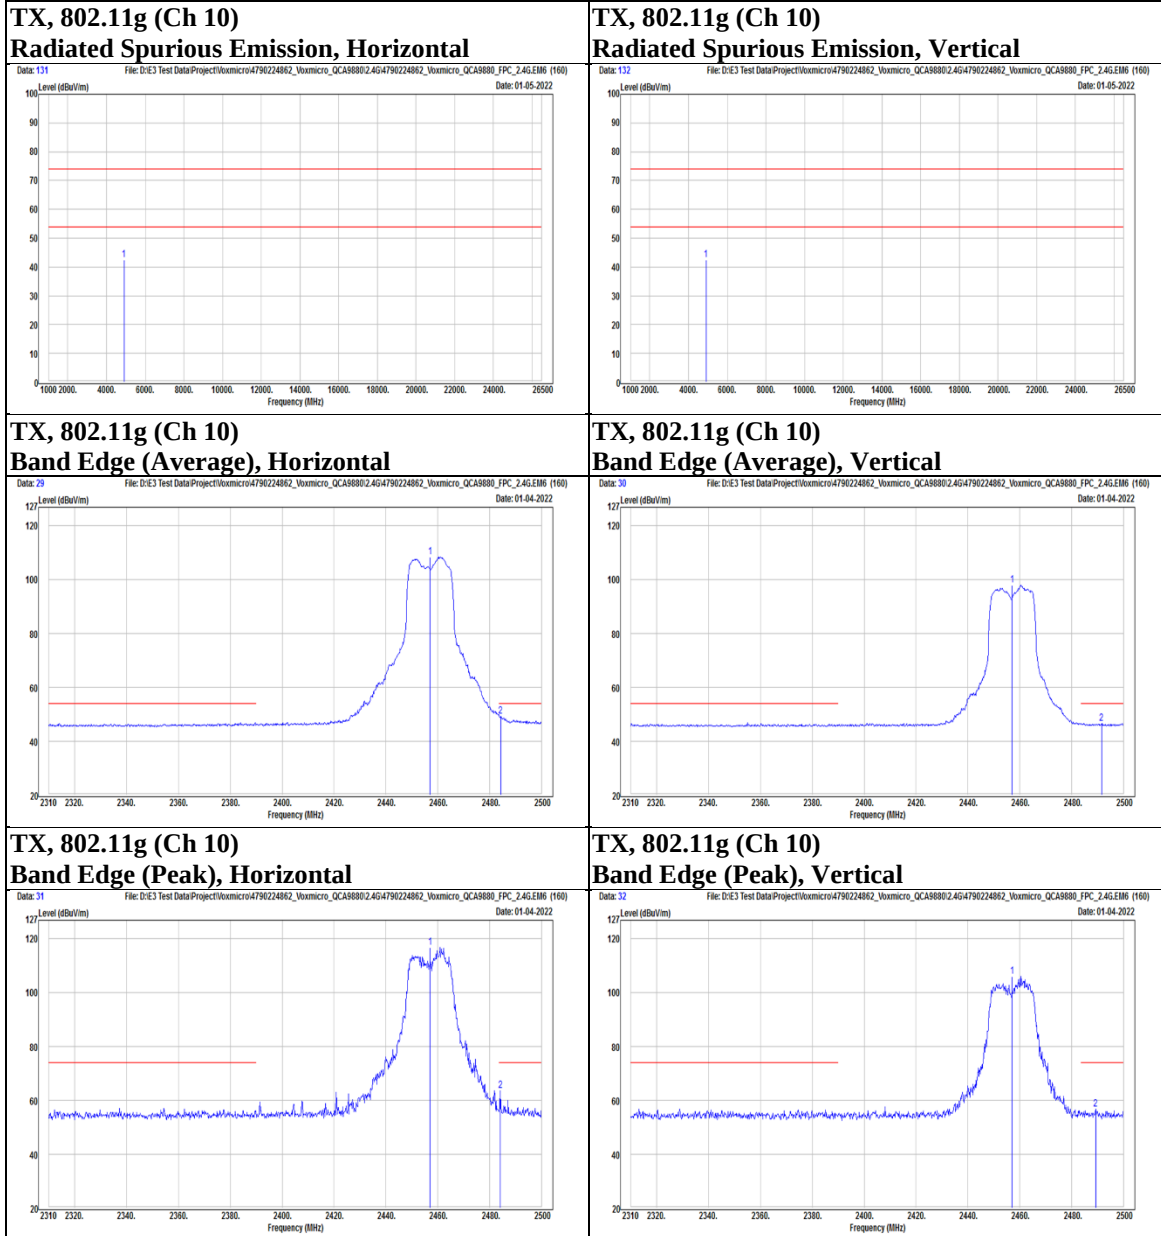



Test report No. : 4790224862-US-R0-V0
Page : 153 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11g	Channel	11
------	---------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2462	97.12	16.12	113.24	N/A	N/A	PK
	@	2462	88.83	16.12	104.95	N/A	N/A	AVG
		2483.85	34.54	16.1	50.64	54	-3.36	AVG
		2484.61	43.04	16.1	59.14	74	-14.86	PK
	*	4924	37.95	2.61	40.56	74	-33.44	PK
Vertical	@	2462	86.33	16.12	102.45	N/A	N/A	PK
	@	2462	78.17	16.12	94.29	N/A	N/A	AVG
		2484.61	30.75	16.1	46.85	54	-7.15	AVG
		2499.05	40.51	16.1	56.61	74	-17.39	PK
	*	4924	36.97	2.61	39.58	74	-34.42	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

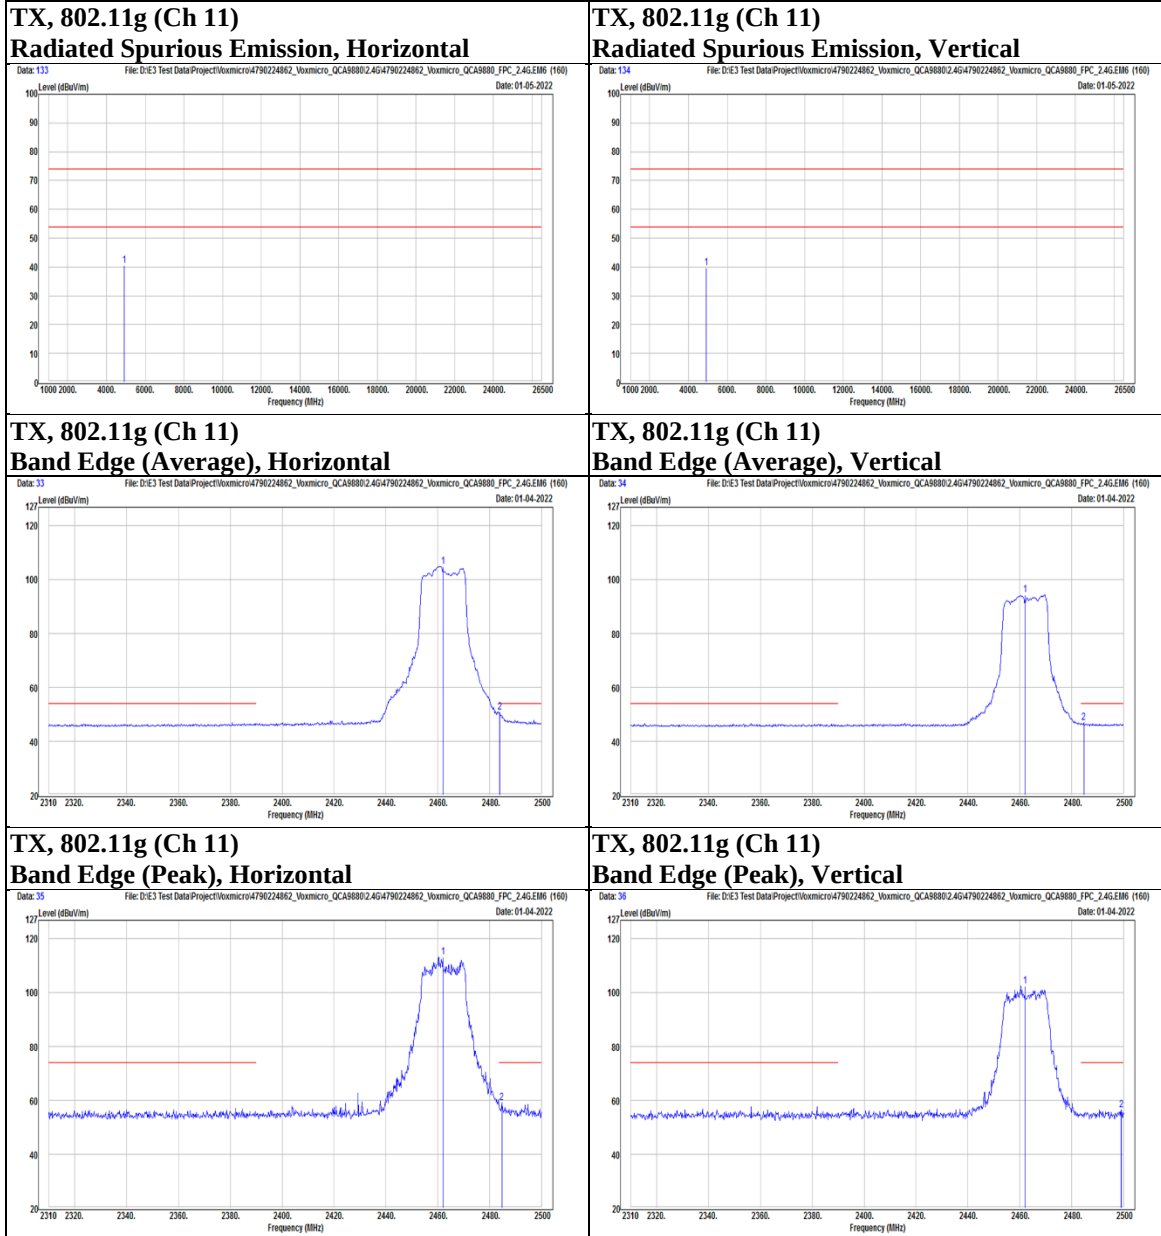

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790224862-US-R0-V0
Page : 155 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT20)	Channel	1
------	------------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2389.8	47.77	16.1	63.87	74	-10.13	PK
		2389.99	37.21	16.1	53.31	54	-0.69	AVG
	@	2412	96.57	16.13	112.7	N/A	N/A	PK
	@	2412	88.68	16.13	104.81	N/A	N/A	AVG
	*	4824	36.26	2.55	38.81	74	-35.19	PK
Vertical		2318.17	40.74	16.16	56.9	74	-17.1	PK
		2389.99	31.55	16.1	47.65	54	-6.35	AVG
	@	2412	85.13	16.13	101.26	N/A	N/A	PK
	@	2412	77.71	16.13	93.84	N/A	N/A	AVG
	*	4824	37.33	2.55	39.88	74	-34.12	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

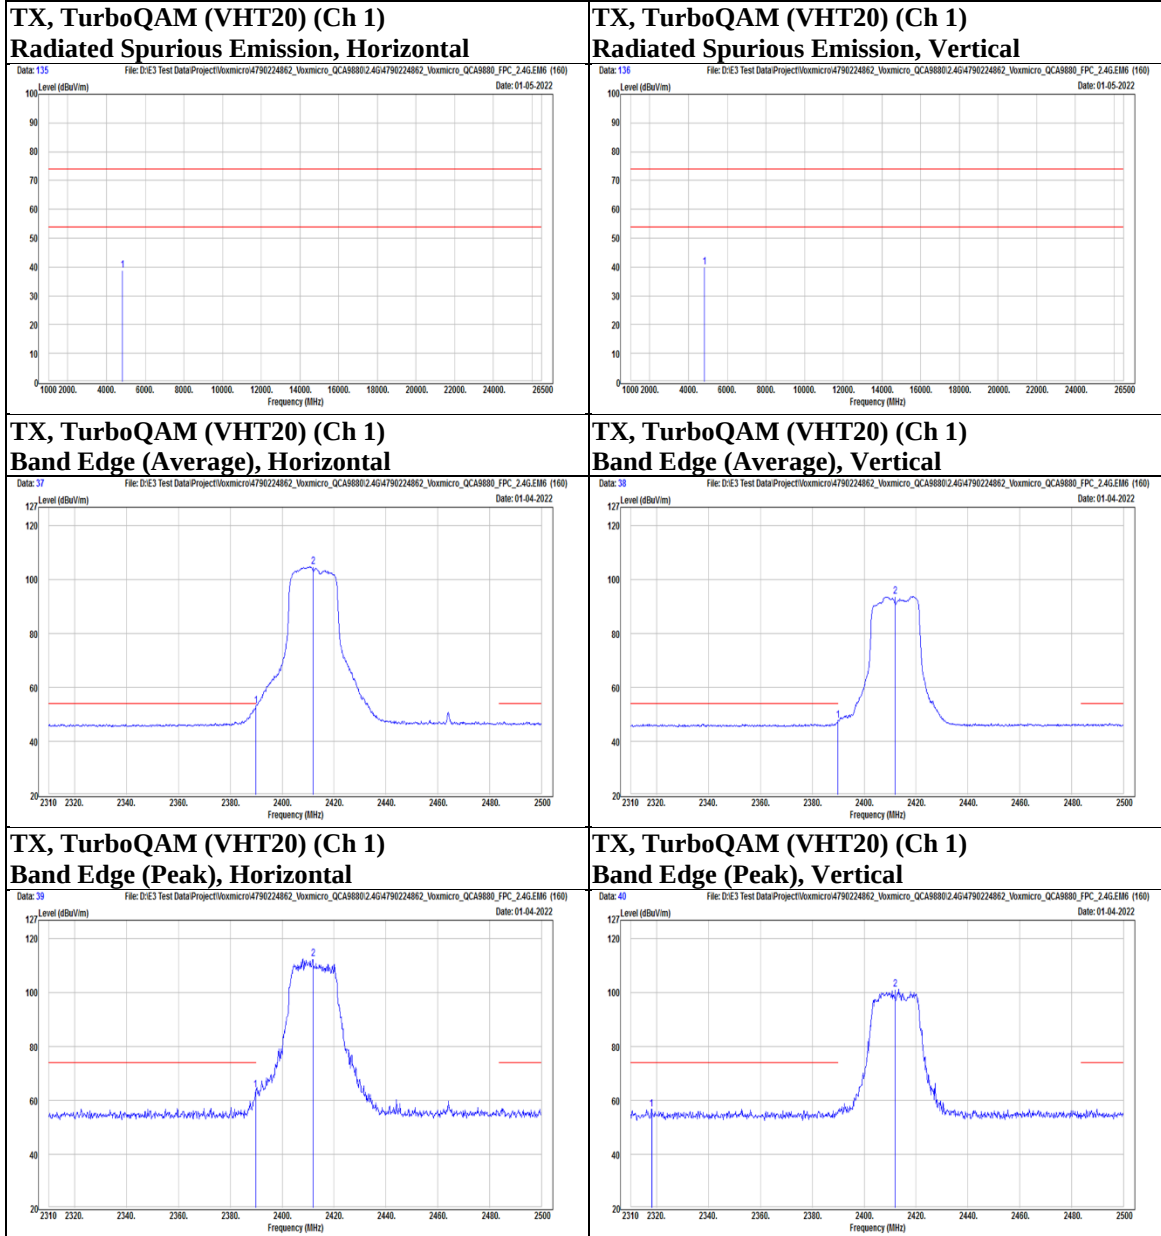



Test report No. : 4790224862-US-R0-V0
Page : 157 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT20)	Channel	2
------	------------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2388.66	52.08	16.1	68.18	74	-5.82	PK
		2389.61	37.38	16.1	53.48	54	-0.52	AVG
	@	2417	100.8	16.13	116.93	N/A	N/A	PK
	@	2417	92.28	16.13	108.41	N/A	N/A	AVG
	*	4834	38.2	2.61	40.81	74	-33.19	PK
Vertical		2344.96	41.41	16.05	57.46	74	-16.54	PK
		2387.33	31.73	16.1	47.83	54	-6.17	AVG
	@	2417	89.67	16.13	105.8	N/A	N/A	PK
	@	2417	81.58	16.13	97.71	N/A	N/A	AVG
	*	4834	38.01	2.61	40.62	74	-33.38	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

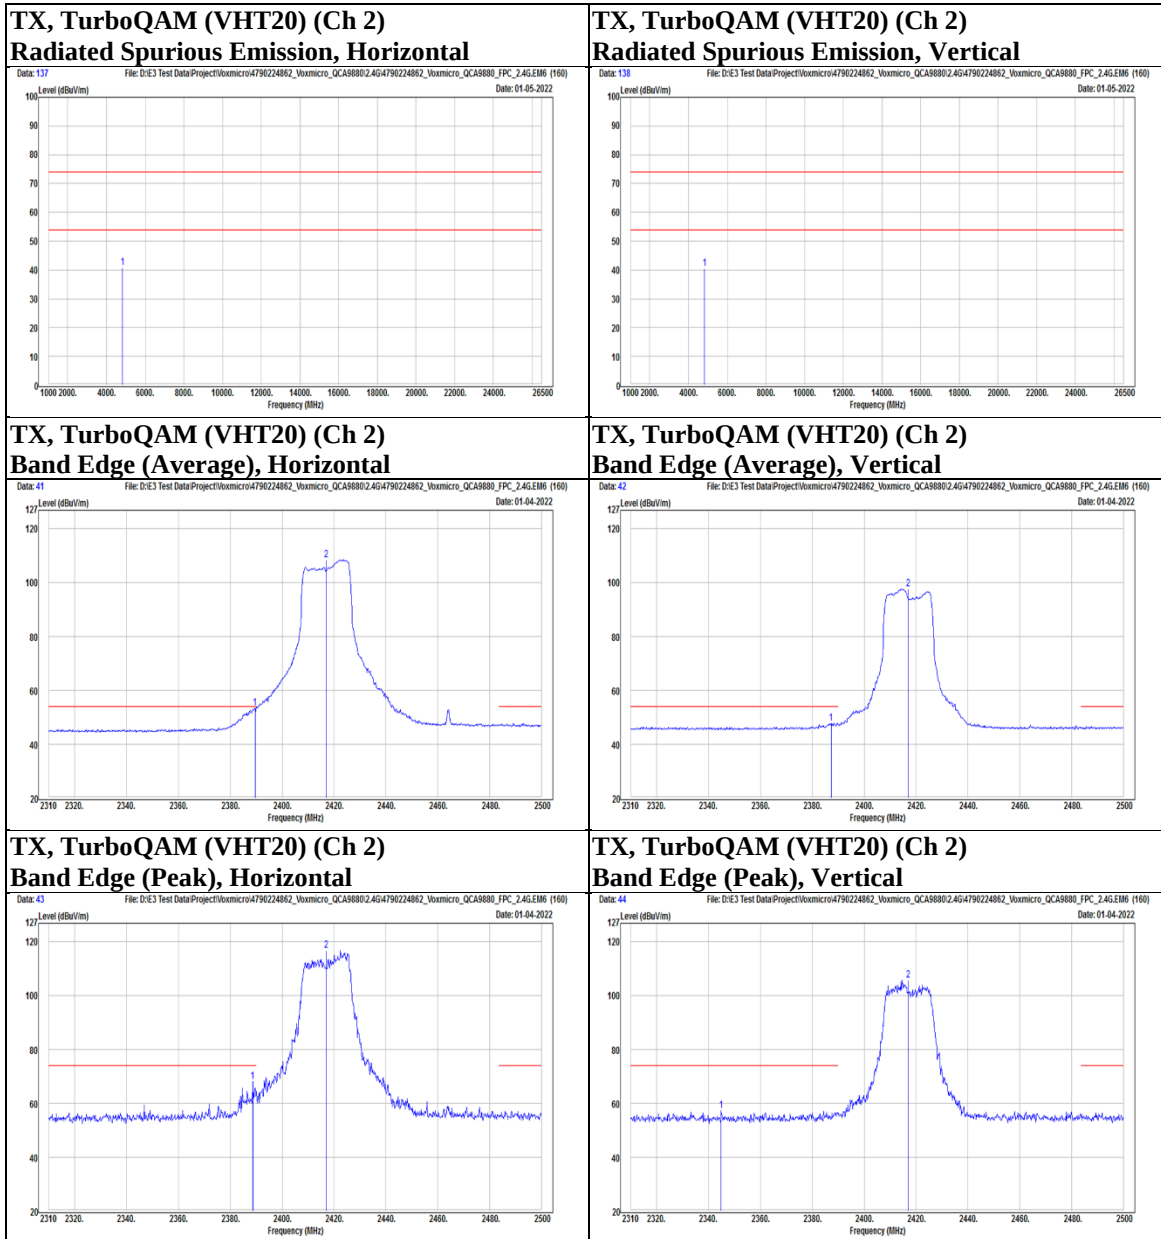

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Mode	TurboQAM (VHT20)	Channel	6
------	------------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2383.91	48.49	16.09	64.58	74	-9.42	PK
		2389.99	36.2	16.1	52.3	54	-1.7	AVG
	@	2437	103.88	16.12	120	N/A	N/A	PK
	@	2437	96.83	16.12	112.95	N/A	N/A	AVG
		2483.66	36.47	16.1	52.57	54	-1.43	AVG
		2485.94	49.19	16.1	65.29	74	-8.71	PK
	*	4874	42.87	2.66	45.53	74	-28.47	PK
		7311	47.65	10.62	58.27	74	-15.73	PK
		7311	39.26	10.62	49.88	54	-4.12	AVG
Vertical		2311.52	40.94	16.19	57.13	74	-16.87	PK
		2389.04	31.27	16.1	47.37	54	-6.63	AVG
	@	2437	94.23	16.12	110.35	N/A	N/A	PK
	@	2437	85.98	16.12	102.1	N/A	N/A	AVG
		2483.85	31.54	16.1	47.64	54	-6.36	AVG
		2487.27	42.21	16.11	58.32	74	-15.68	PK
	*	4874	43.56	2.66	46.22	74	-27.78	PK
		7311	42.83	10.62	53.45	74	-20.55	PK
		7311	36.74	10.62	47.36	54	-6.64	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

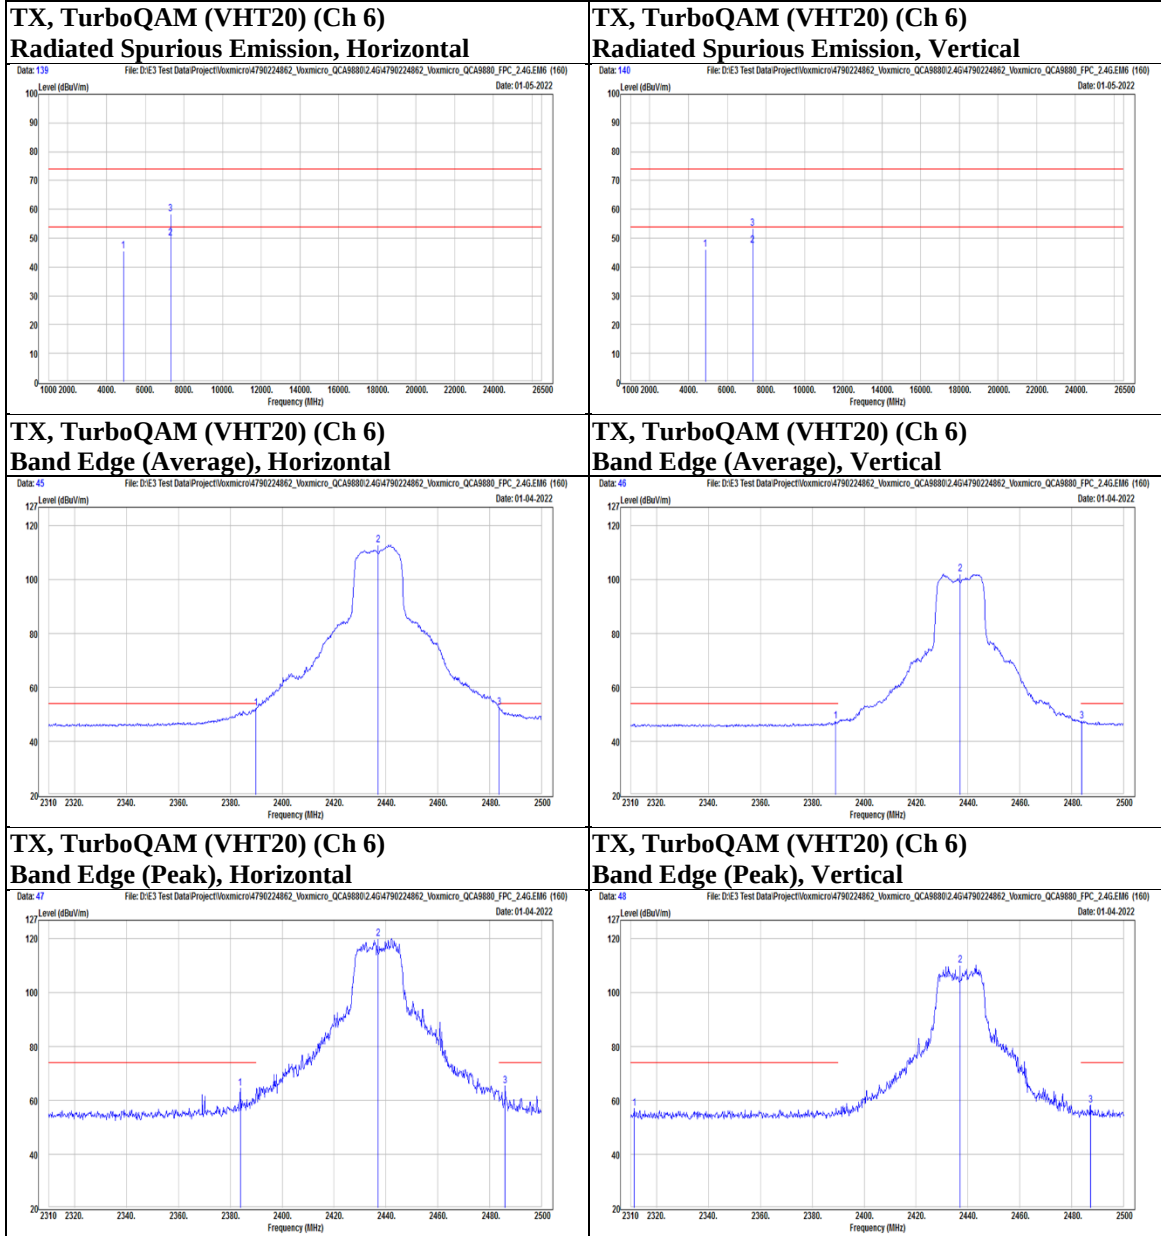

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790224862-US-R0-V0
Page : 161 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT20)	Channel	10
------	------------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2457	99.44	16.12	115.56	N/A	N/A	PK
	@	2457	91.5	16.12	107.62	N/A	N/A	AVG
		2484.42	33.62	16.1	49.72	54	-4.28	AVG
		2486.13	44	16.1	60.1	74	-13.9	PK
	*	4914	40.15	2.63	42.78	74	-31.22	PK
Vertical	@	2457	89.81	16.12	105.93	N/A	N/A	PK
	@	2457	81.09	16.12	97.21	N/A	N/A	AVG
		2486.13	30.43	16.1	46.53	54	-7.47	AVG
		2497.91	40.45	16.1	56.55	74	-17.45	PK
	*	4914	38.52	2.63	41.15	74	-32.85	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

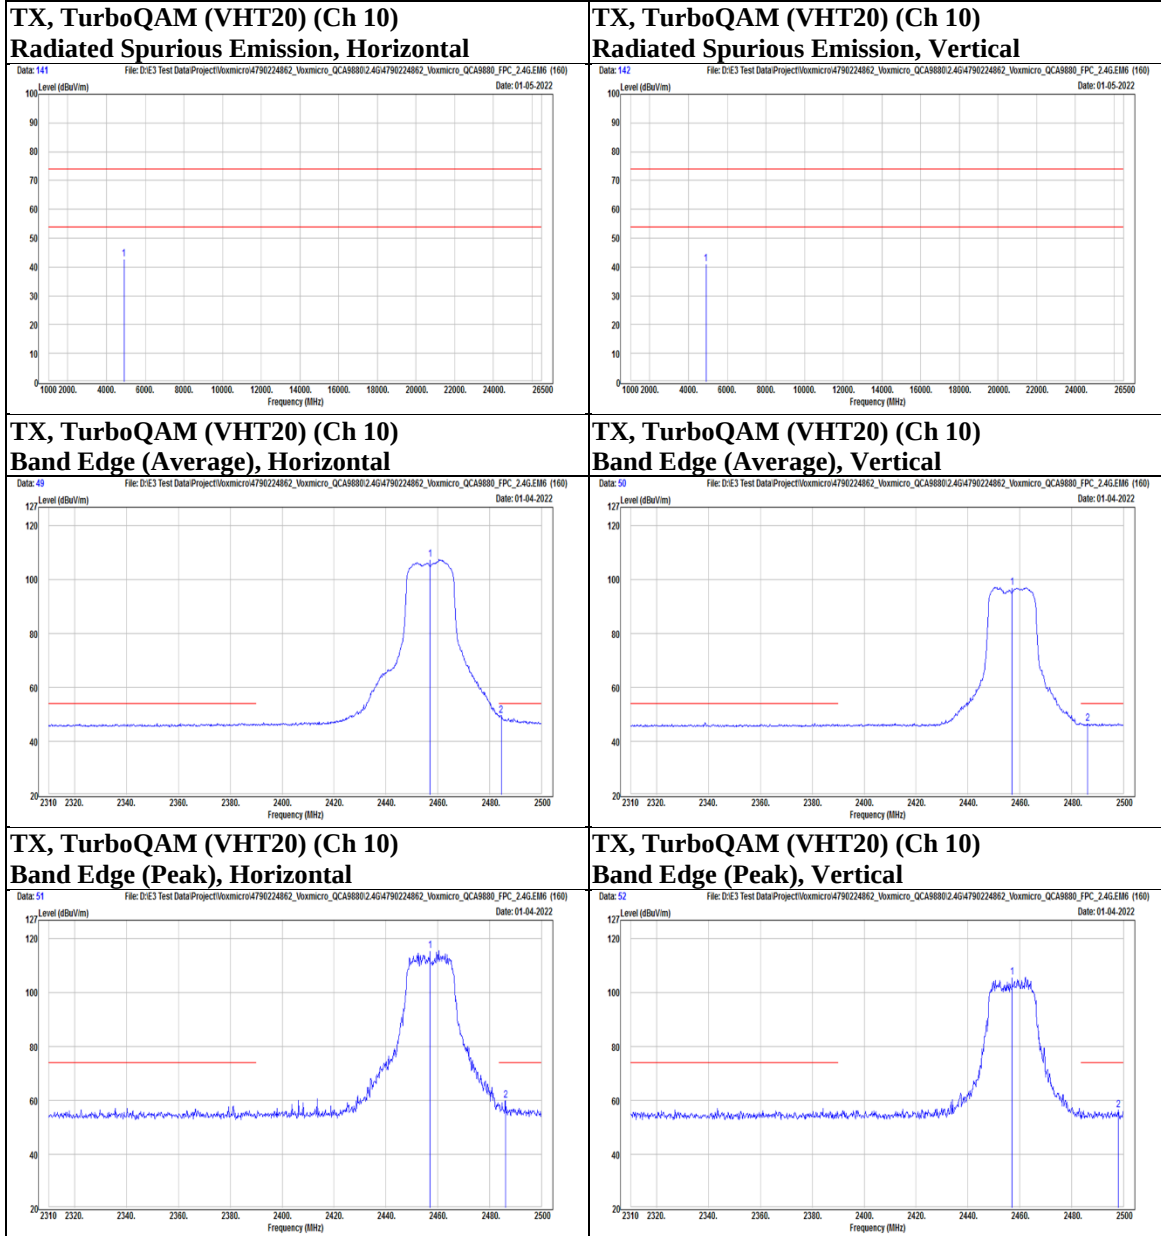



Test report No. : 4790224862-US-R0-V0
Page : 163 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT20)	Channel	11
------	------------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2462	95.31	16.12	111.43	N/A	N/A	PK
	@	2462	88.21	16.12	104.33	N/A	N/A	AVG
		2483.66	32.96	16.1	49.06	54	-4.94	AVG
		2484.23	42.28	16.1	58.38	74	-15.62	PK
	*	4924	36.74	2.61	39.35	74	-34.65	PK
		7386	42.69	10.56	53.25	74	-20.75	PK
		7386	34.86	10.56	45.42	54	-8.58	AVG
Vertical	@	2462	85.44	16.12	101.56	N/A	N/A	PK
	@	2462	77.66	16.12	93.78	N/A	N/A	AVG
		2483.85	30.61	16.1	46.71	54	-7.29	AVG
		2485.75	40.55	16.1	56.65	74	-17.35	PK
	*	4924	37.21	2.61	39.82	74	-34.18	PK
		7386	37.85	10.56	48.41	74	-25.59	PK
		7386	28.58	10.56	39.14	54	-14.86	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

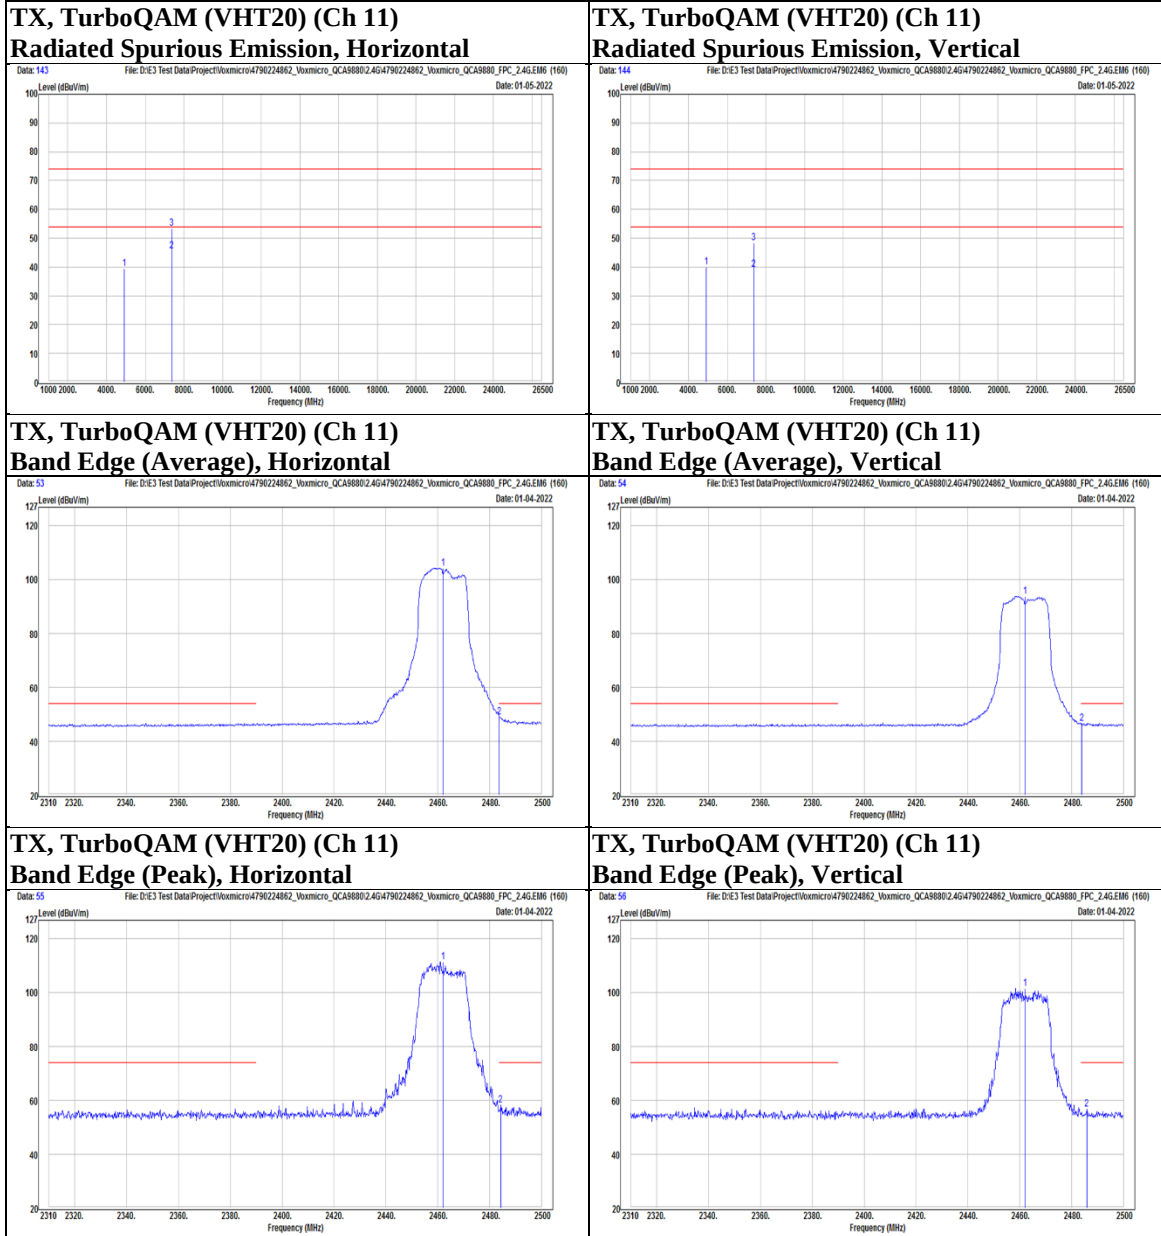



Test report No. : 4790224862-US-R0-V0
Page : 165 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT40)	Channel	3
------	------------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2389.04	46.28	16.1	62.38	74	-11.62	PK
		2389.99	37.38	16.1	53.48	54	-0.52	AVG
	@	2422	90.97	16.13	107.1	N/A	N/A	PK
	@	2422	82.53	16.13	98.66	N/A	N/A	AVG
	*	4844	37.09	2.66	39.75	74	-34.25	PK
Vertical		2373.65	40.57	16.08	56.65	74	-17.35	PK
		2387.71	31.04	16.1	47.14	54	-6.86	AVG
	@	2422	80.78	16.13	96.91	N/A	N/A	PK
	@	2422	72.63	16.13	88.76	N/A	N/A	AVG
	*	4844	35.95	2.66	38.61	74	-35.39	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

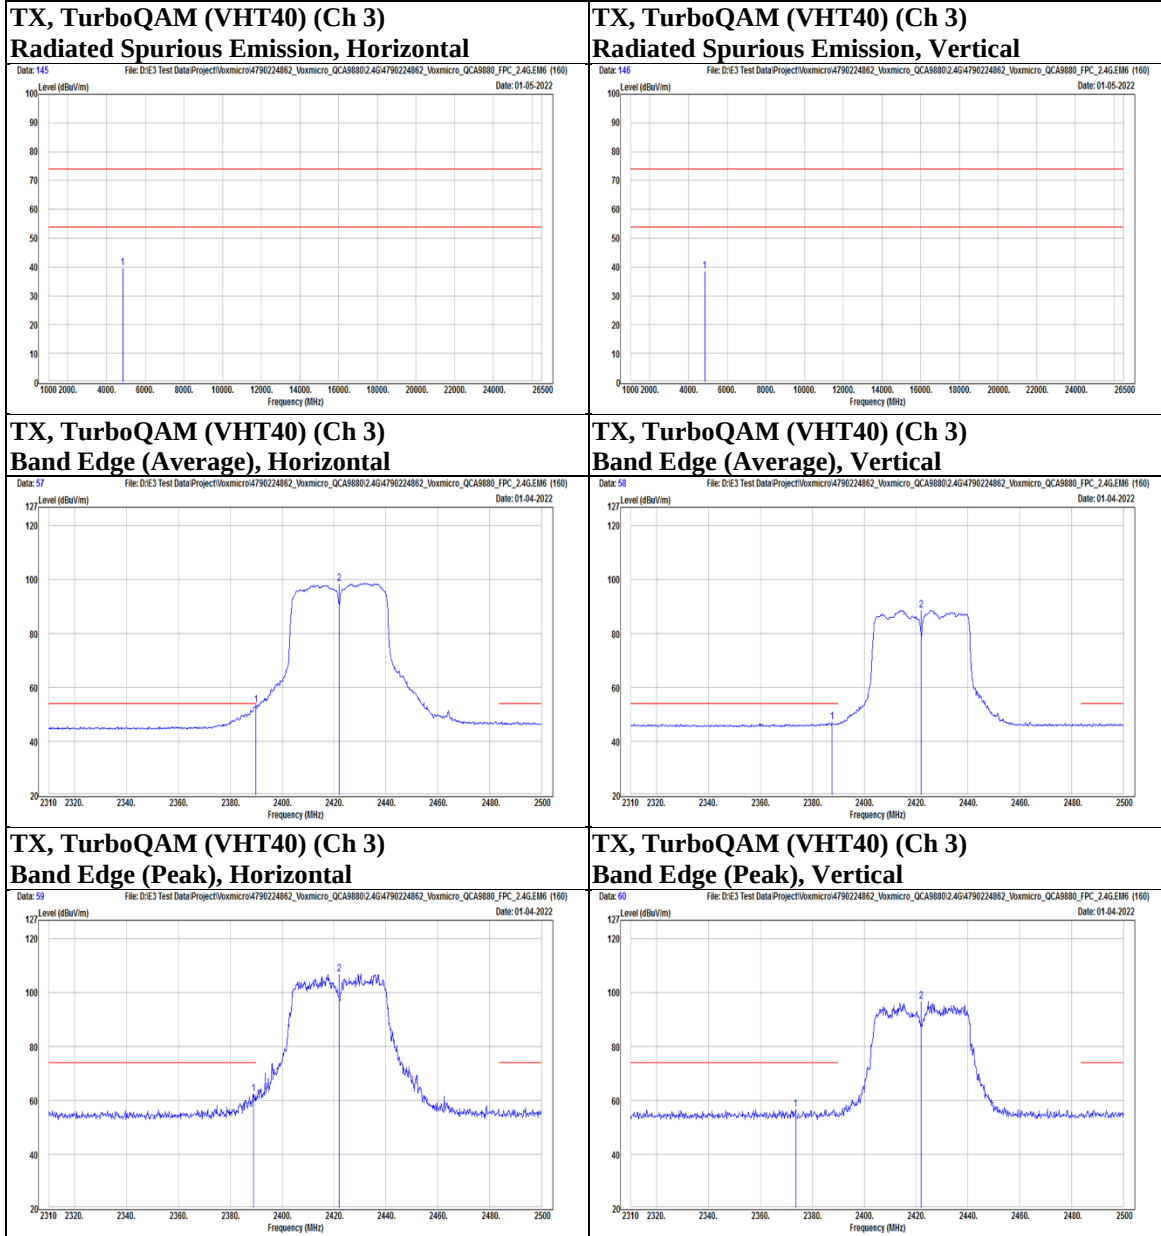



Test report No. : 4790224862-US-R0-V0
Page : 167 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT40)	Channel	4
------	------------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2388.09	47.07	16.1	63.17	74	-10.83	PK
		2389.42	35.82	16.1	51.92	54	-2.08	AVG
	@	2427	91.97	16.12	108.09	N/A	N/A	PK
	@	2427	83.7	16.12	99.82	N/A	N/A	AVG
	*	4854	36.01	2.68	38.69	74	-35.31	PK
Vertical		2344.96	41.29	16.05	57.34	74	-16.66	PK
		2388.85	30.85	16.1	46.95	54	-7.05	AVG
	@	2427	80.62	16.12	96.74	N/A	N/A	PK
	@	2427	73.78	16.12	89.9	N/A	N/A	AVG
	*	4854	36.01	2.68	38.69	74	-35.31	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

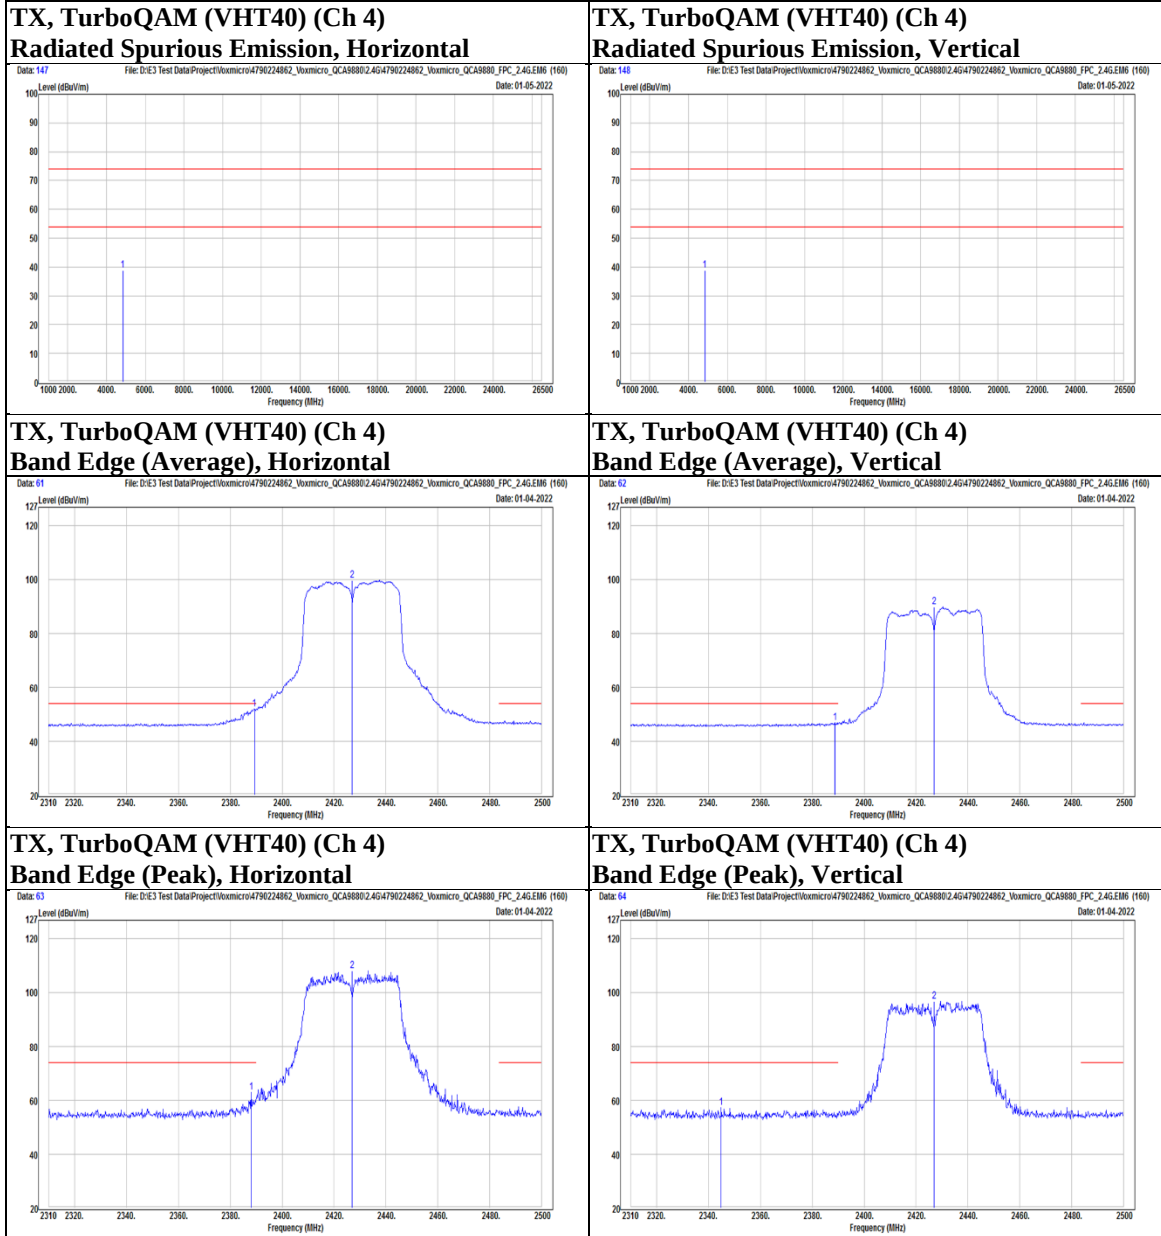



Test report No. : 4790224862-US-R0-V0
Page : 169 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT40)	Channel	6
------	------------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2389.04	48.8	16.1	64.9	74	-9.1	PK
		2389.99	37.28	16.1	53.38	54	-0.62	AVG
	@	2437	95.42	16.12	111.54	N/A	N/A	PK
	@	2437	86.79	16.12	102.91	N/A	N/A	AVG
		2483.66	43.85	16.1	59.95	74	-14.05	PK
		2484.04	35.27	16.1	51.37	54	-2.63	AVG
	*	4874	35.96	2.66	38.62	74	-35.38	PK
		7311	42.94	10.62	53.56	74	-20.44	PK
		7311	37.67	10.62	48.29	54	-5.71	AVG
Vertical		2330.14	41.48	16.11	57.59	74	-16.41	PK
		2389.99	30.77	16.1	46.87	54	-7.13	AVG
	@	2437	84.8	16.12	100.92	N/A	N/A	PK
	@	2437	77.78	16.12	93.9	N/A	N/A	AVG
		2483.66	30.76	16.1	46.86	54	-7.14	AVG
		2486.32	40.7	16.1	56.8	74	-17.2	PK
	*	4874	36.74	2.66	39.4	74	-34.6	PK
	*	7311	36.5	10.62	47.12	74	-26.88	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

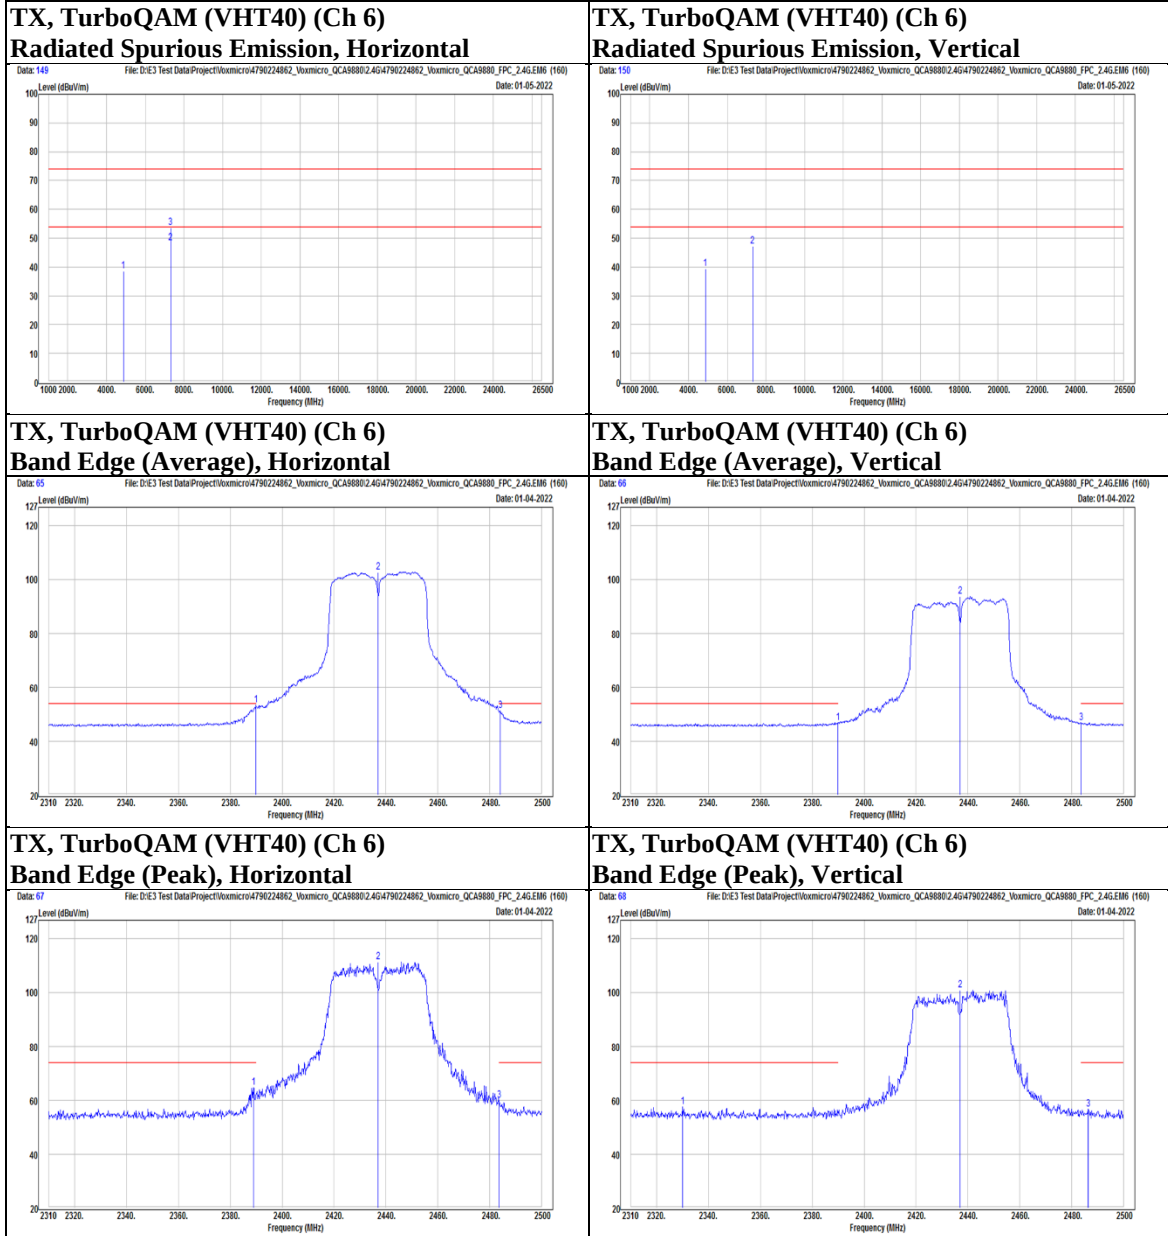



Test report No. : 4790224862-US-R0-V0
Page : 171 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT40)	Channel	8
------	------------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2447	91.85	16.12	107.97	N/A	N/A	PK
	@	2447	83.71	16.12	99.83	N/A	N/A	AVG
		2484.99	34.58	16.1	50.68	54	-3.32	AVG
		2487.27	45.33	16.11	61.44	74	-12.56	PK
	*	4894	37.06	2.64	39.7	74	-34.3	PK
		7341	41.77	10.48	52.25	74	-21.75	PK
		7341	34.14	10.48	44.62	54	-9.38	AVG
Vertical	@	2447	82.4	16.12	98.52	N/A	N/A	PK
	@	2447	74.23	16.12	90.35	N/A	N/A	AVG
		2484.42	31.09	16.1	47.19	54	-6.81	AVG
		2490.12	40.67	16.1	56.77	74	-17.23	PK
	*	4894	37.22	2.64	39.86	74	-34.14	PK
	*	7341	36.67	10.48	47.15	74	-26.85	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0