



B5 , Normal


10MHz_Low_QPSK_1@0

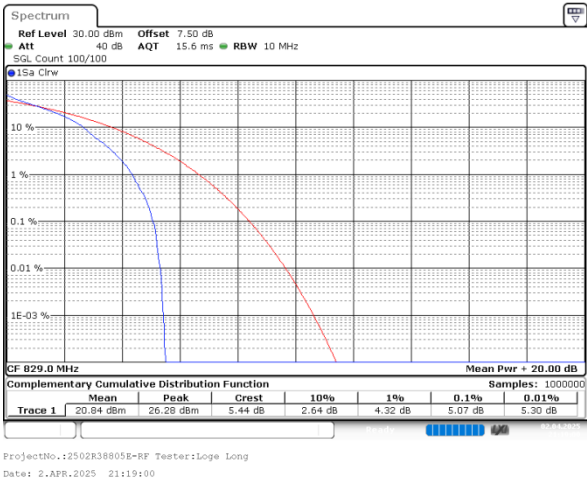


10MHz_Low_QPSK_50@0

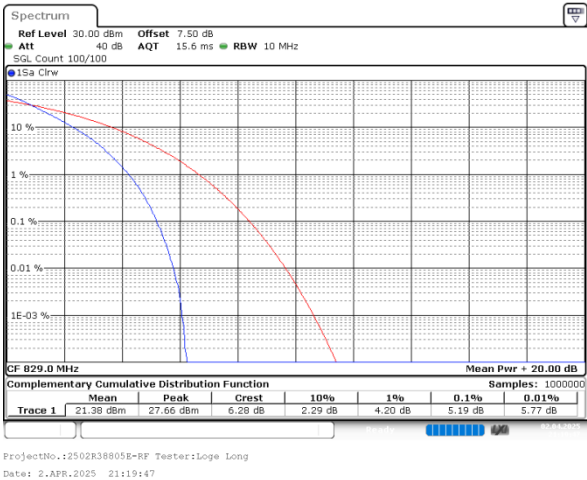


10MHz_Low_16QAM_1@0

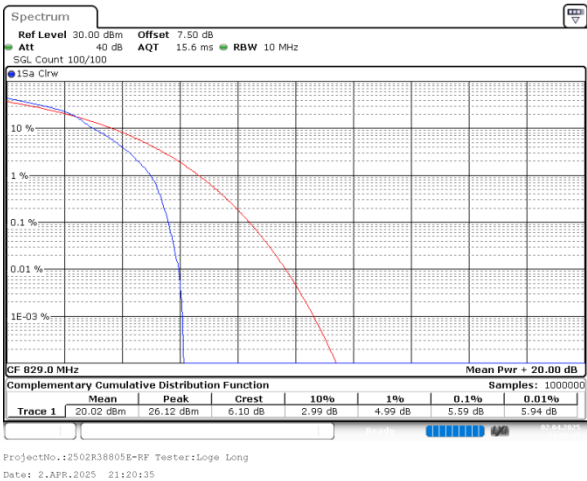


10MHz_Low_16QAM_50@0

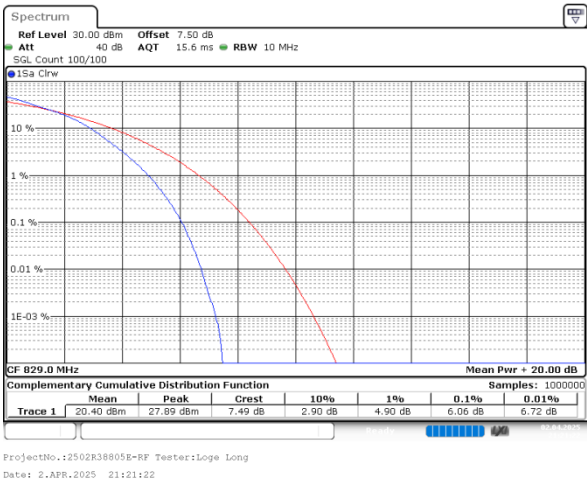


10MHz_Middle_QPSK_1@0

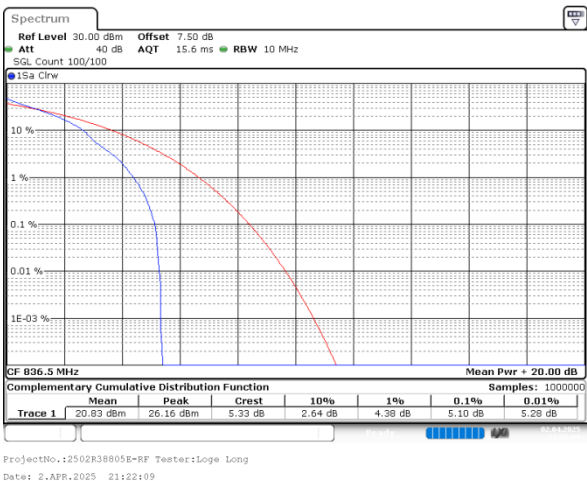

10MHz_Middle_QPSK_50@0

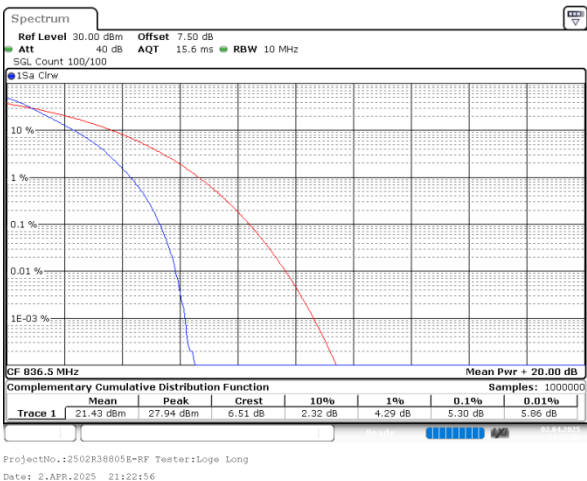


10MHz_Middle_16QAM_1@0

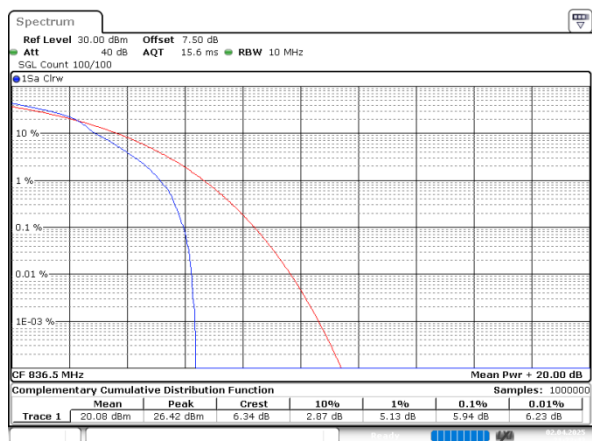


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:23:43

10MHz_Middle_16QAM_50@0

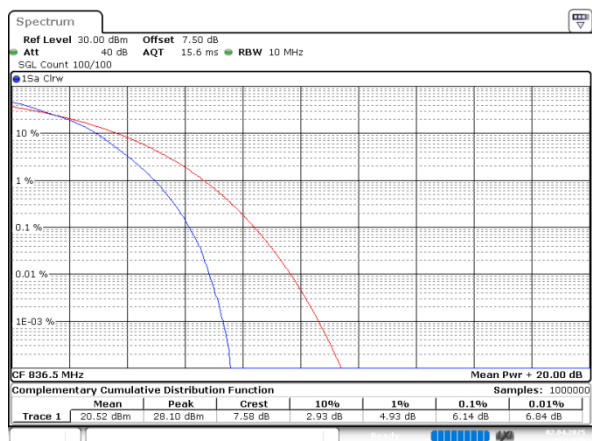


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:24:29

10MHz_High_QPSK_1@0

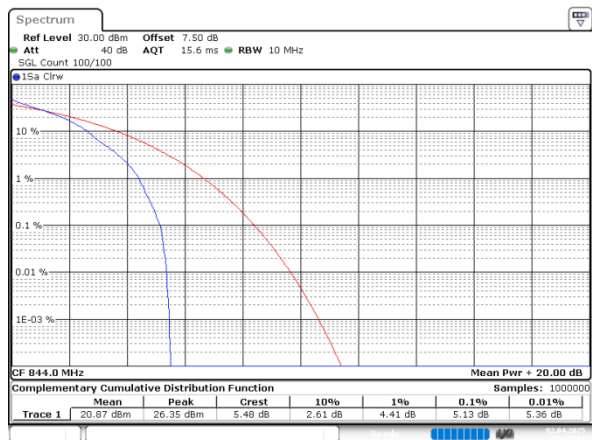


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:25:16

10MHz_High_QPSK_50@0

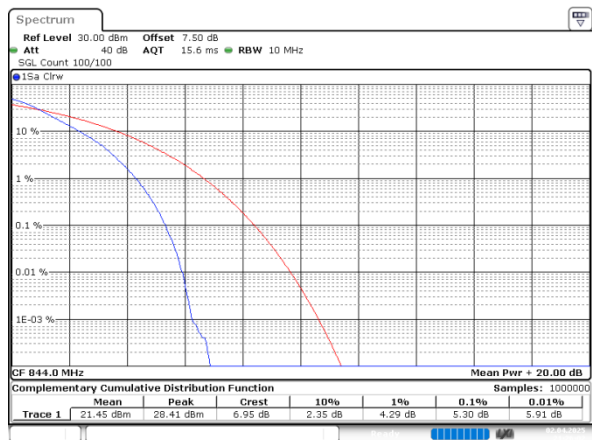


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:26:02

10MHz_High_16QAM_1@0

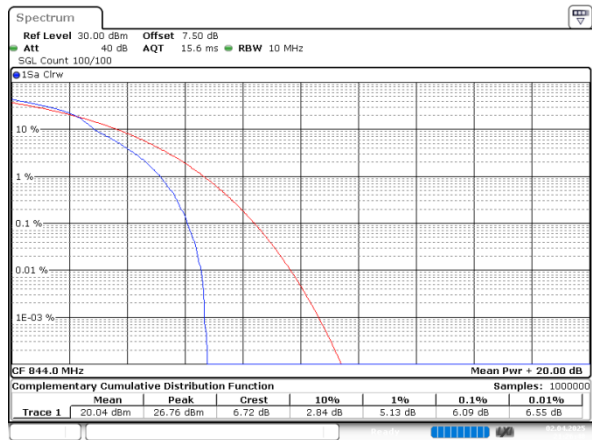

ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:26:48

10MHz_High_16QAM_50@0

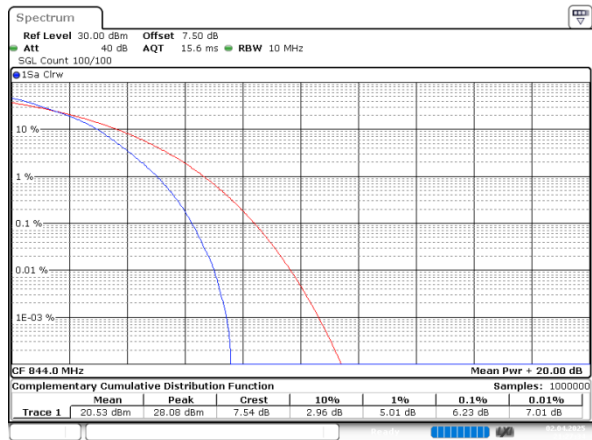

ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:27:34


FCC Part 24E**B2 , Normal**

Mode	Result (dB)	Limit (dB)
20MHz_Low_QPSK_1@0	5.07	13
20MHz_Low_QPSK_100@0	5.25	13
20MHz_Low_16QAM_1@0	5.97	13
20MHz_Low_16QAM_100@0	6.09	13
20MHz_Middle_QPSK_1@0	5.39	13
20MHz_Middle_QPSK_100@0	5.16	13
20MHz_Middle_16QAM_1@0	6.20	13
20MHz_Middle_16QAM_100@0	6.09	13
20MHz_High_QPSK_1@0	4.93	13
20MHz_High_QPSK_100@0	5.16	13
20MHz_High_16QAM_1@0	6	13
20MHz_High_16QAM_100@0	6.06	13


Note:worst case.

B2 , Normal


20MHz_Low_QPSK_1@0

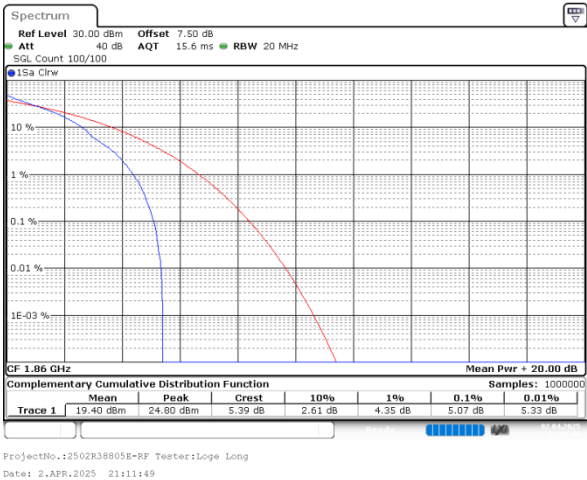


20MHz_Low_QPSK_100@0

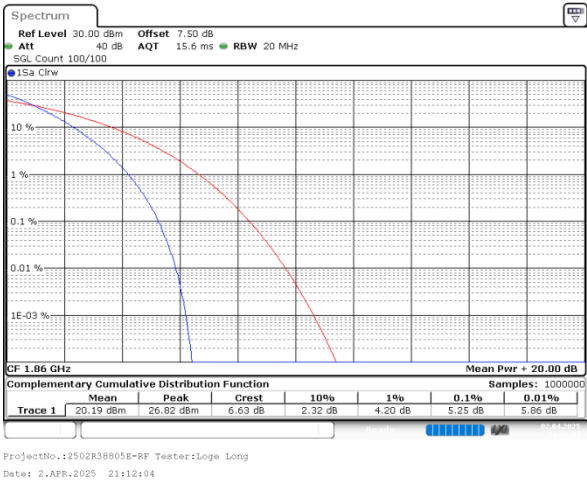


20MHz_Low_16QAM_1@0

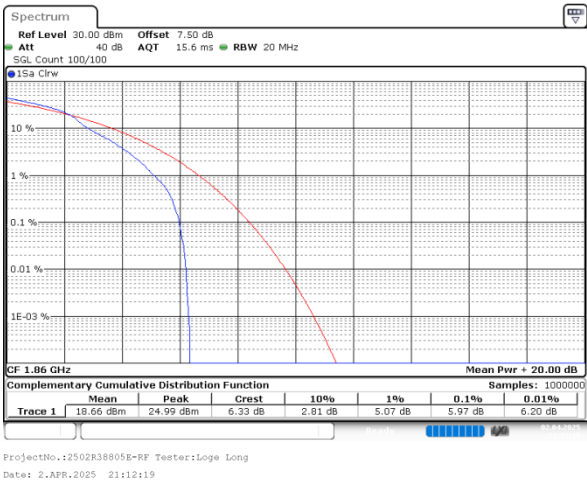


20MHz_Low_16QAM_100@0

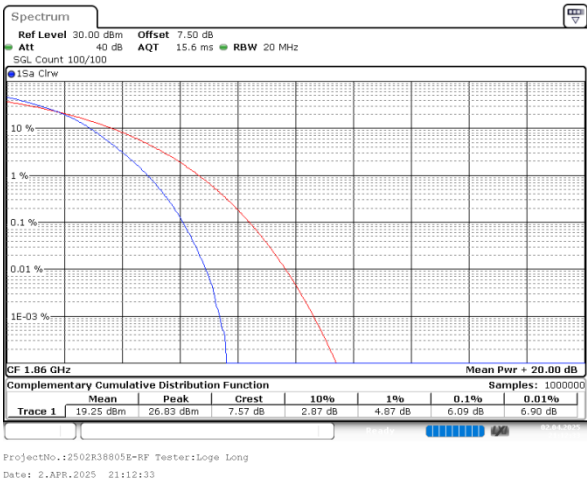


20MHz_Middle_QPSK_1@0

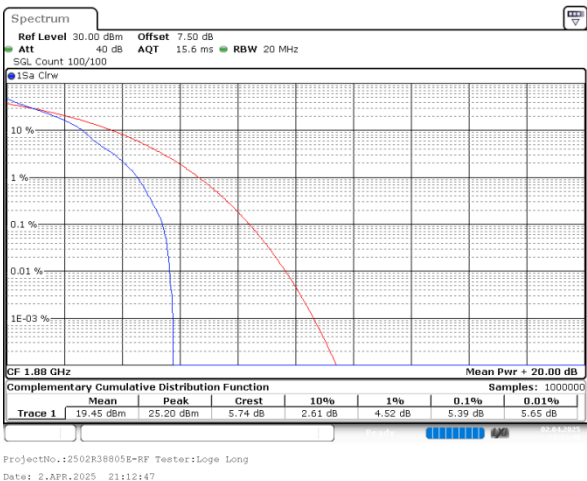

20MHz_Middle_QPSK_100@0

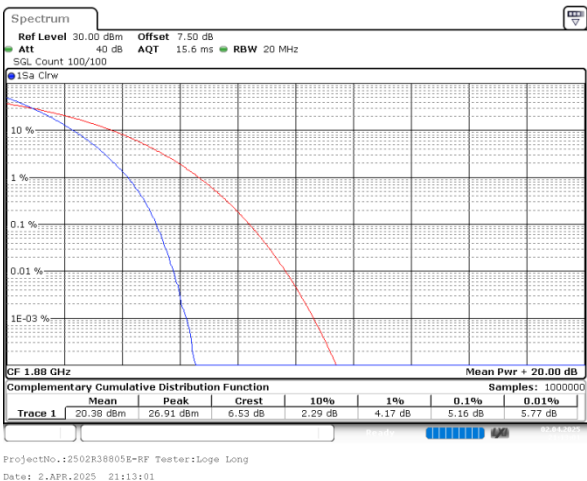


20MHz_Middle_16QAM_1@0

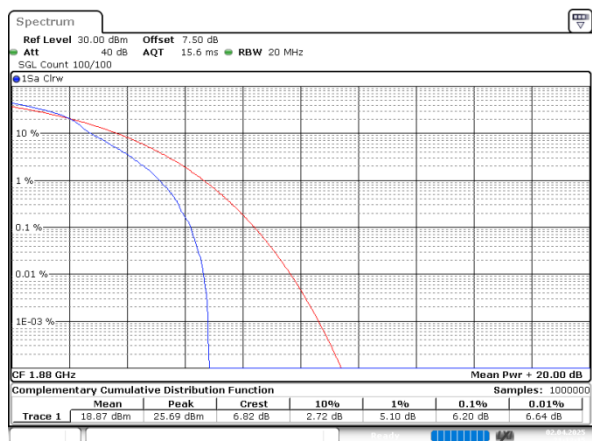


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:13:15

20MHz_Middle_16QAM_100@0

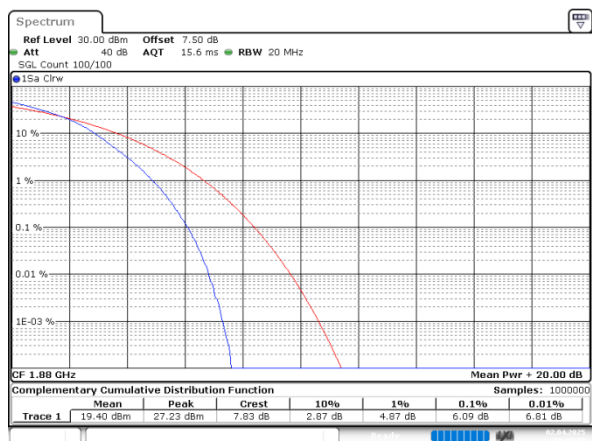


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:13:28

20MHz_High_QPSK_1@0

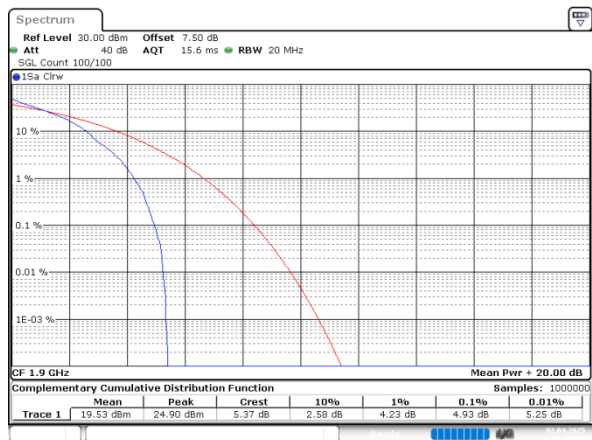


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:13:43

20MHz_High_QPSK_100@0

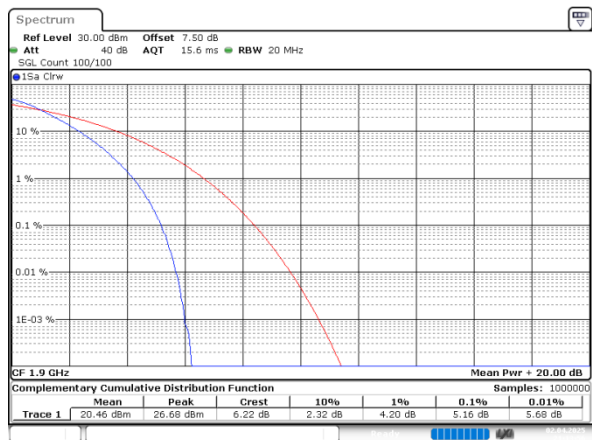


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:13:56

20MHz_High_16QAM_1@0

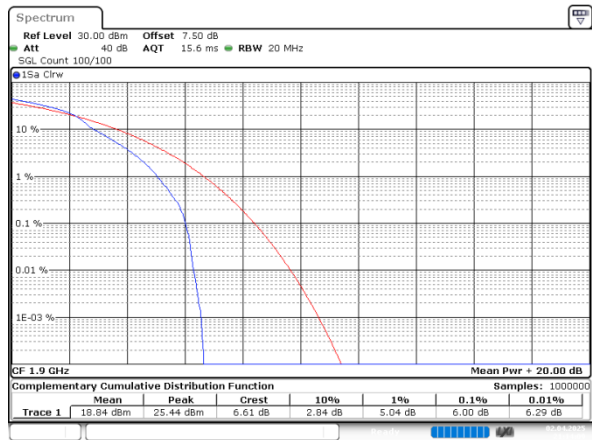

ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:14:09

20MHz_High_16QAM_100@0

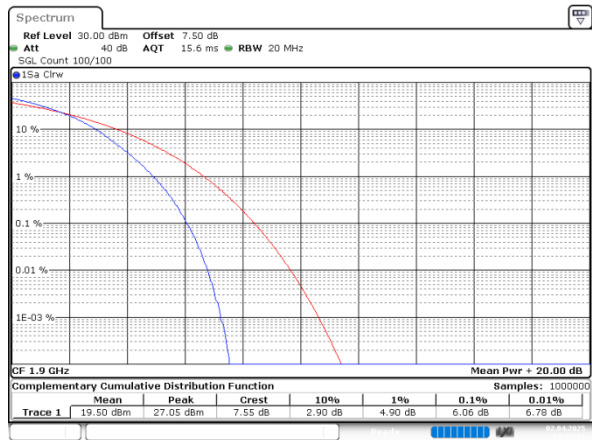

ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:14:23

FCC Part 27

B4 , Normal

Mode	Result (dB)	Limit (dB)
20MHz_Low_QPSK_1@0	4.46	13
20MHz_Low_QPSK_100@0	4.93	13
20MHz_Low_16QAM_1@0	5.28	13
20MHz_Low_16QAM_100@0	5.86	13
20MHz_Middle_QPSK_1@0	4.35	13
20MHz_Middle_QPSK_100@0	5.01	13
20MHz_Middle_16QAM_1@0	5.10	13
20MHz_Middle_16QAM_100@0	5.91	13
20MHz_High_QPSK_1@0	4.55	13
20MHz_High_QPSK_100@0	5.13	13
20MHz_High_16QAM_1@0	5.57	13
20MHz_High_16QAM_100@0	6.03	13


B7 , Normal

Mode	Result (dB)	Limit (dB)
20MHz_Low_QPSK_1@0	4.87	13
20MHz_Low_QPSK_100@0	5.42	13
20MHz_Low_16QAM_1@0	5.65	13
20MHz_Low_16QAM_100@0	6.35	13
20MHz_Middle_QPSK_1@0	5.42	13
20MHz_Middle_QPSK_100@0	5.39	13
20MHz_Middle_16QAM_1@0	6.32	13
20MHz_Middle_16QAM_100@0	6.38	13
20MHz_High_QPSK_1@0	5.16	13
20MHz_High_QPSK_100@0	5.39	13
20MHz_High_16QAM_1@0	6.43	13
20MHz_High_16QAM_100@0	6.32	13


Note:worst case.

B4 , Normal


20MHz_Low_QPSK_1@0

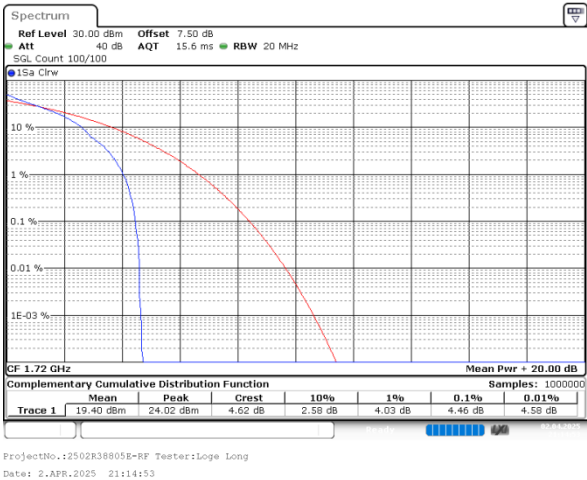


20MHz_Low_QPSK_100@0

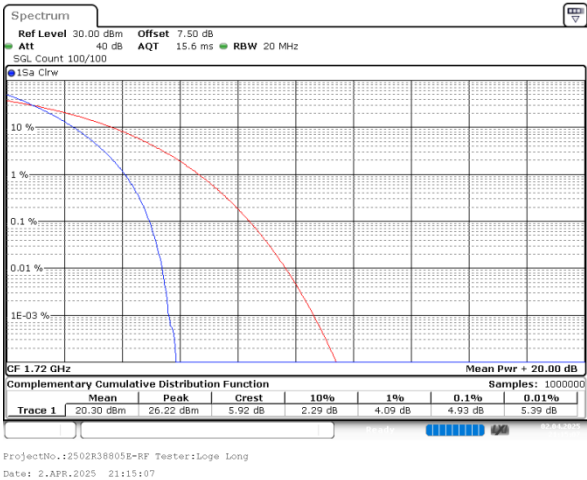


20MHz_Low_16QAM_1@0

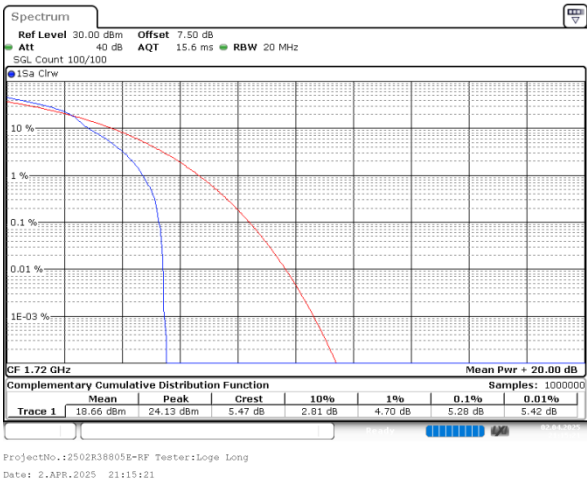


20MHz_Low_16QAM_100@0

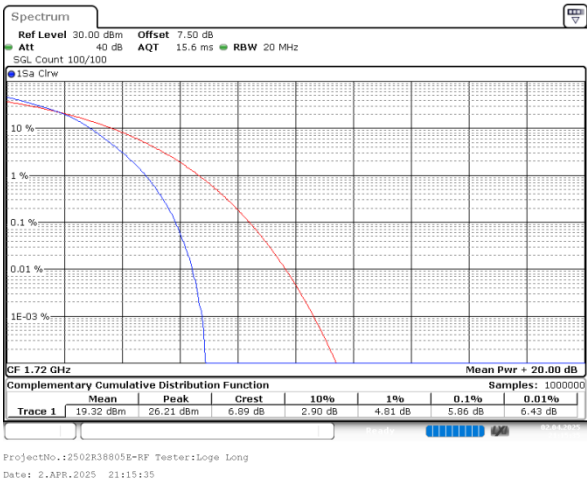


20MHz_Middle_QPSK_1@0

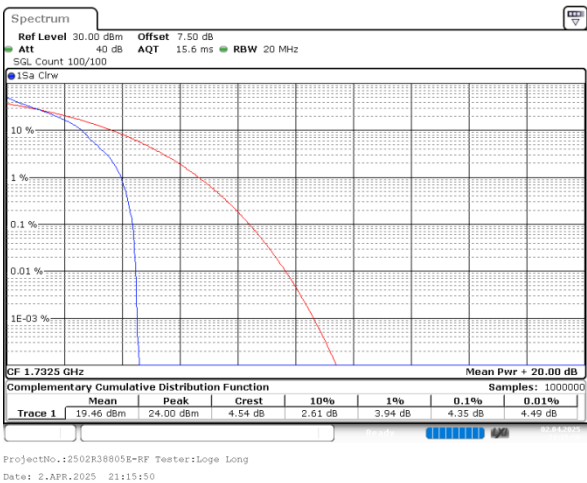

20MHz_Middle_QPSK_100@0

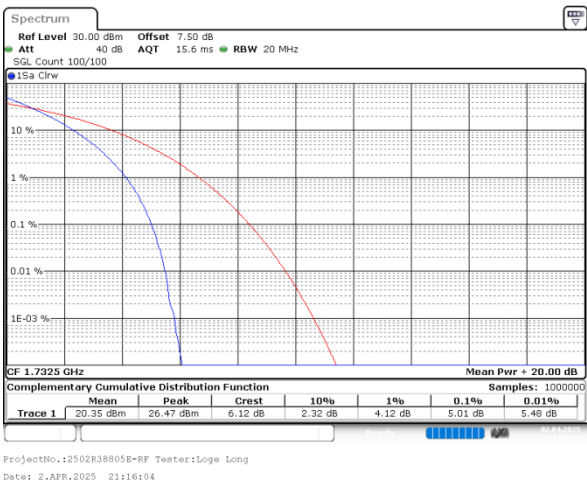


20MHz_Middle_16QAM_1@0

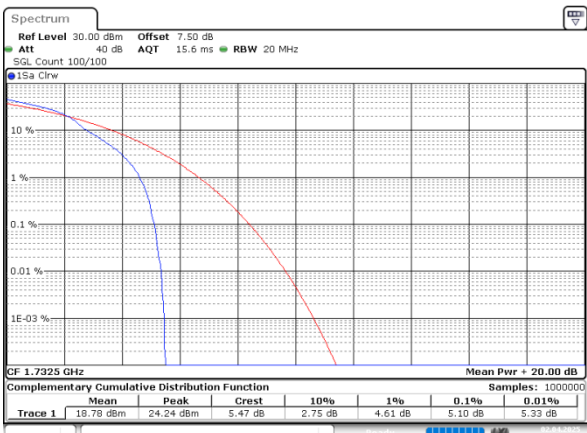


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:16:19

20MHz_Middle_16QAM_100@0

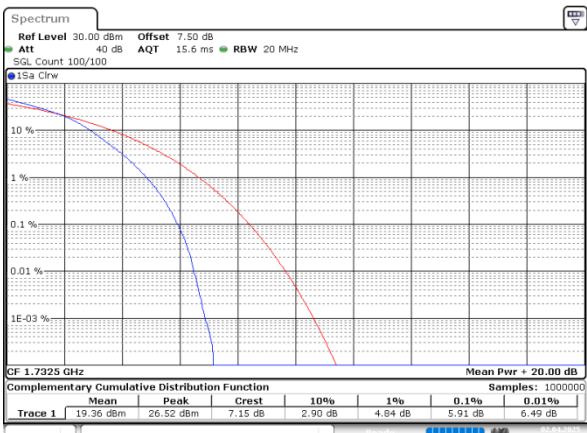


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:16:33

20MHz_High_QPSK_1@0

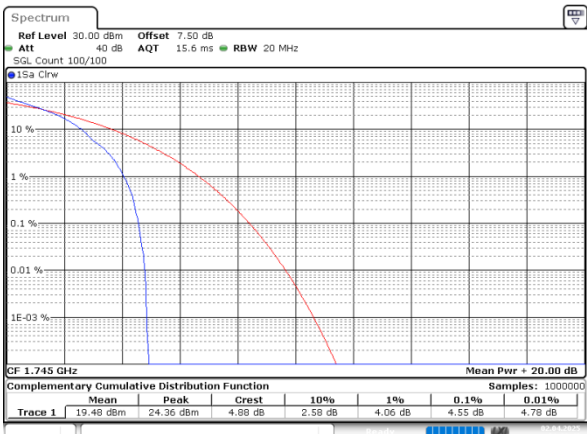


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:16:48

20MHz_High_QPSK_100@0

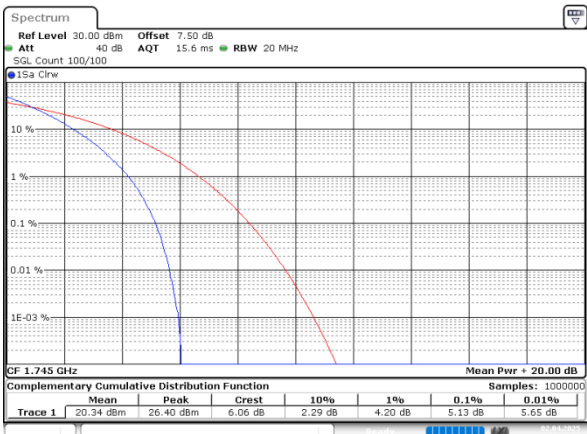


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:17:02

20MHz_High_16QAM_1@0

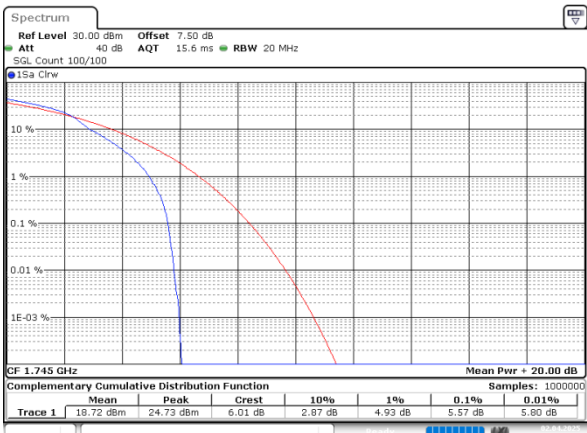

ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:17:18


20MHz_High_16QAM_100@0

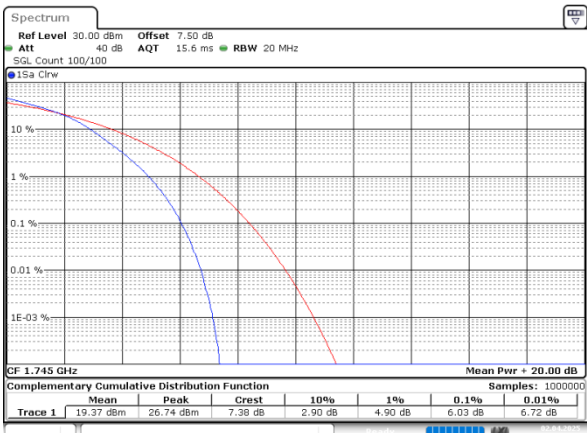


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:17:33

B7 , Normal


20MHz_Low_QPSK_1@0

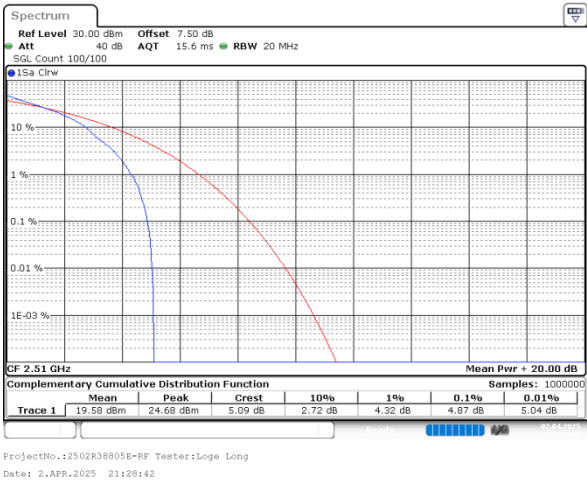


20MHz_Low_QPSK_100@0

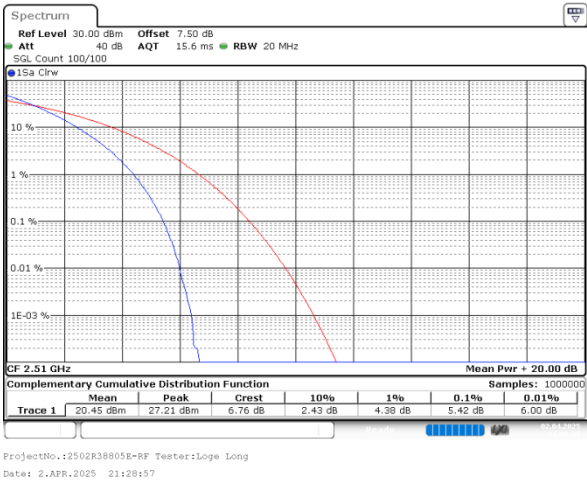


20MHz_Low_16QAM_1@0

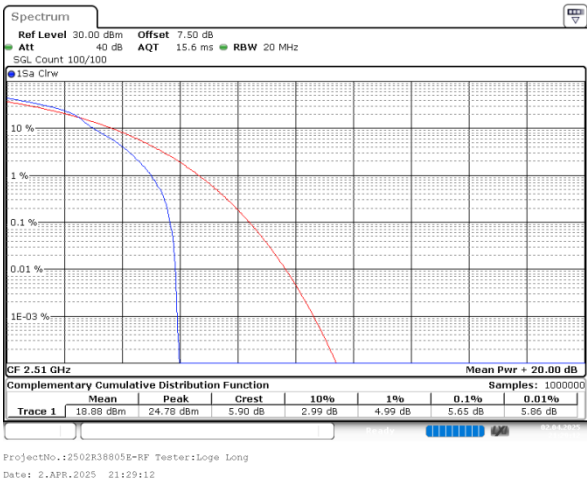


20MHz_Low_16QAM_100@0

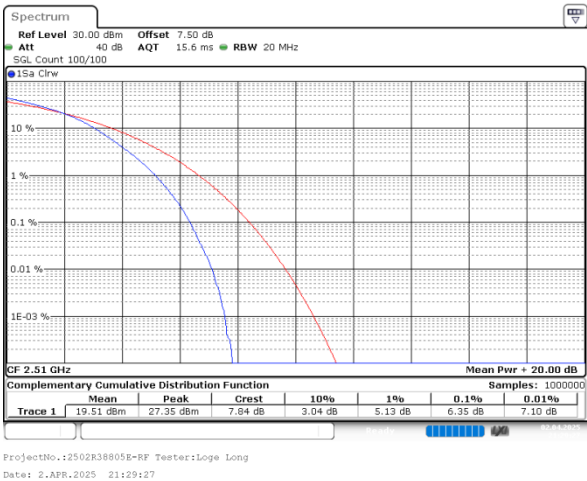


20MHz_Middle_QPSK_1@0

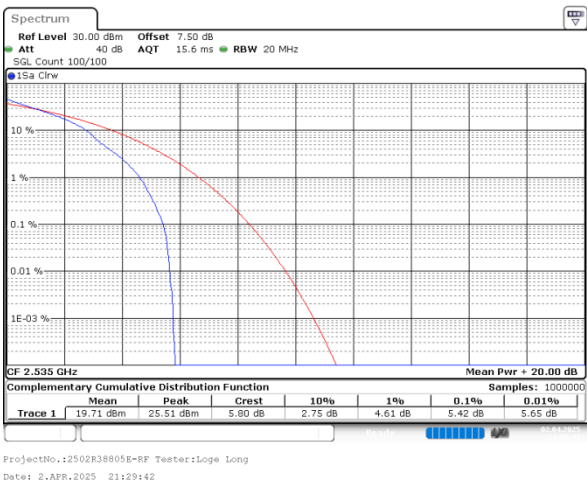

20MHz_Middle_QPSK_100@0

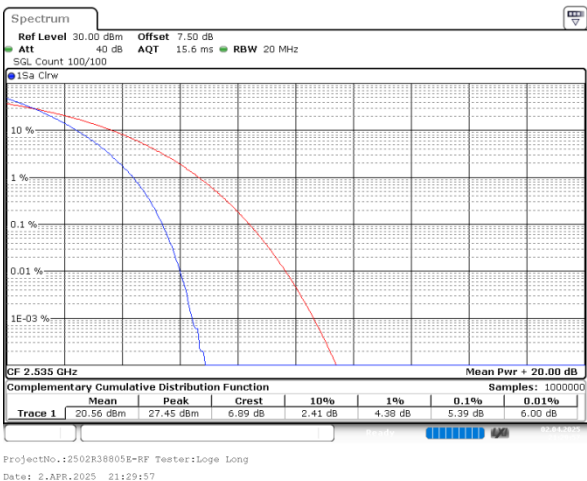


20MHz_Middle_16QAM_1@0

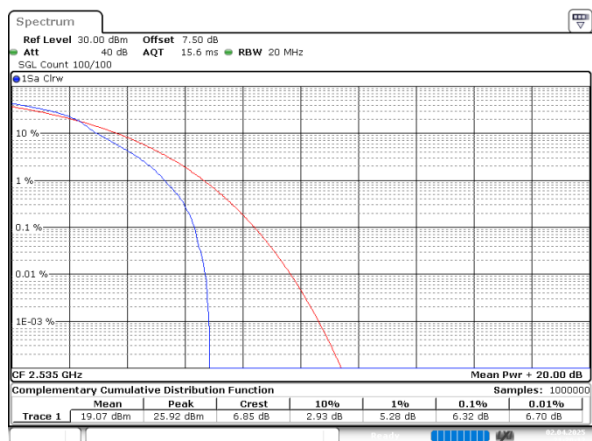


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:30:12

20MHz_Middle_16QAM_100@0

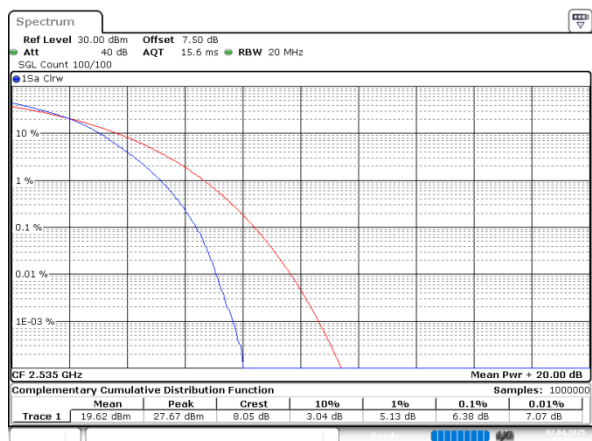


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:30:27

20MHz_High_QPSK_1@0

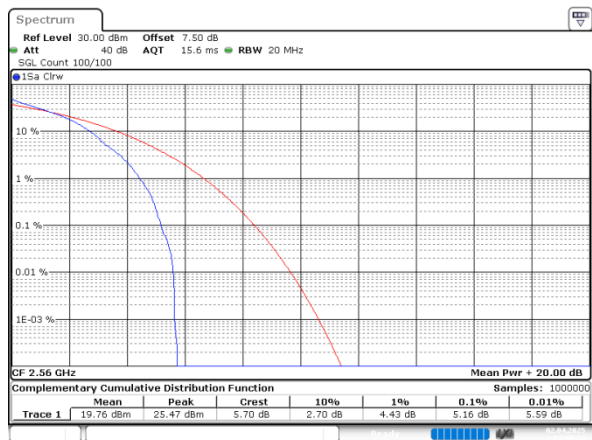


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:30:42

20MHz_High_QPSK_100@0

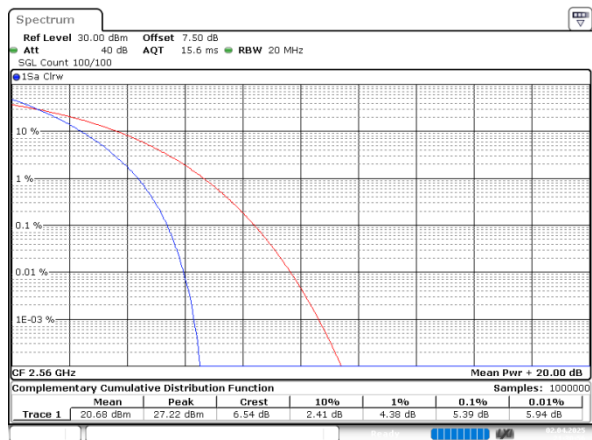


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:30:56

20MHz_High_16QAM_1@0

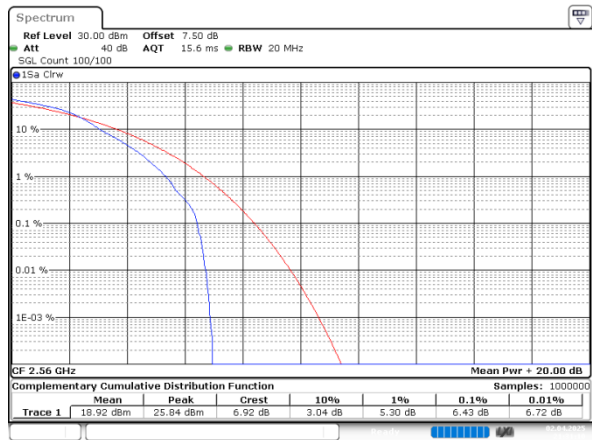

ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:31:10

20MHz_High_16QAM_100@0

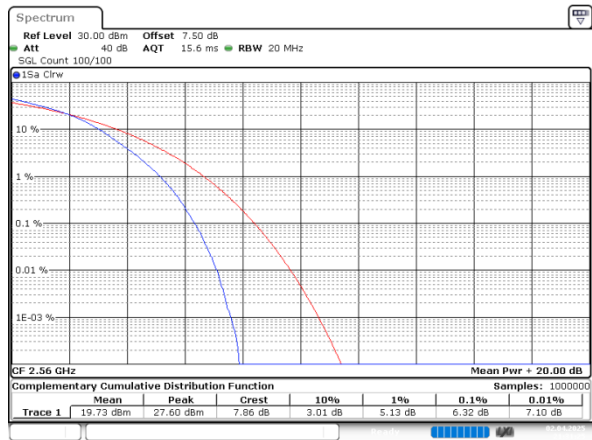


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 21:31:24

Out of band emission,Band Edge

FCC Part 22H


B5 , Normal

1.4MHz_Low_QPSK_1@0

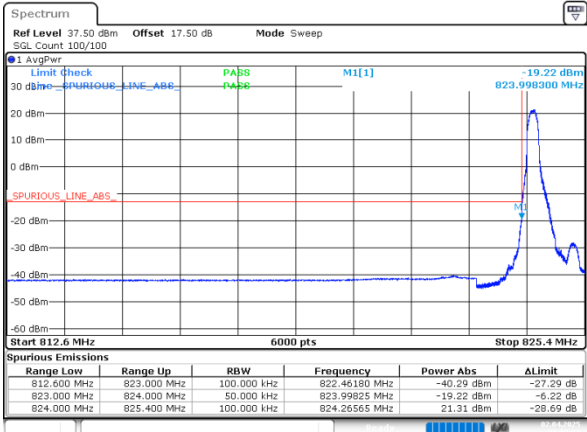


ProjectNo.:2502R38805E-RF Teeter:Loge Long
Date: 2.APR.2025 23:00:11

1.4MHz_Low_QPSK_6@0

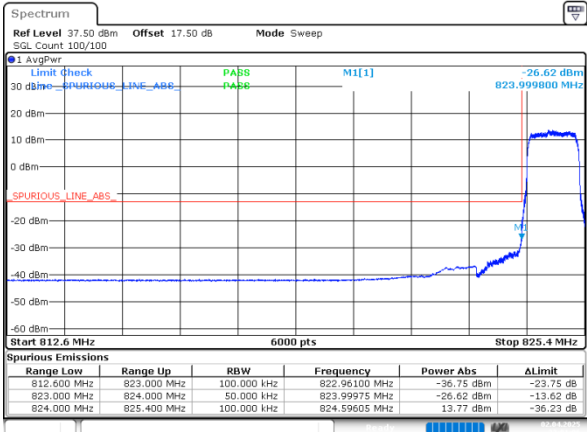


ProjectNo.:2502R38805E-RF Teeter:Loge Long
Date: 2.APR.2025 23:01:06

1.4MHz_Low_16QAM_1@0

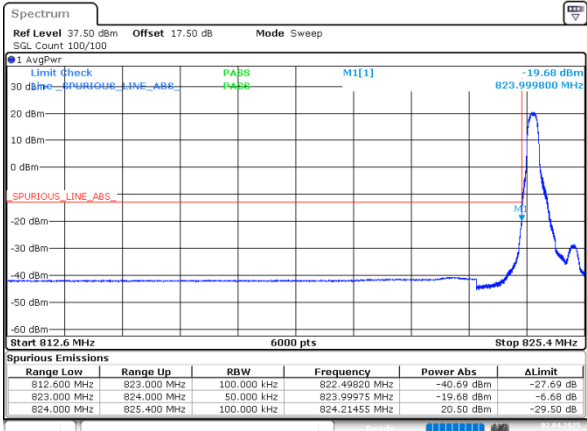


ProjectNo.:2502R38805E-RF Teeter:Loge Long
Date: 2.APR.2025 23:02:01

1.4MHz_Low_16QAM_6@0

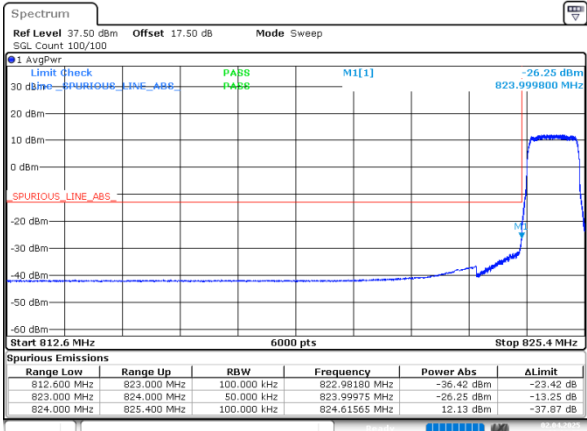


ProjectNo.:2502R38805E-RF Teeter:Loge Long
Date: 2.APR.2025 23:02:57

1.4MHz_High_QPSK_1@5

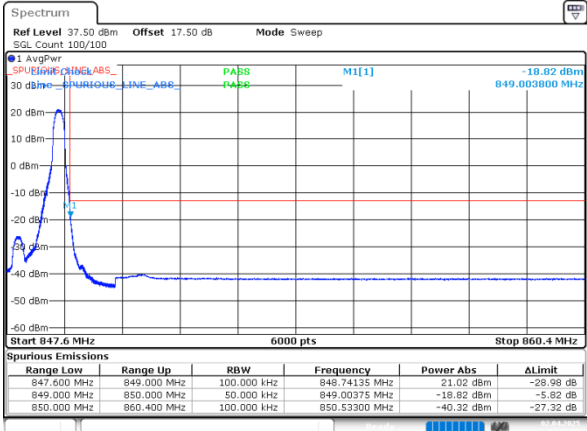


ProjectNo.:2502R38805E-RF Teeter:Loge Long
Date: 2.APR.2025 23:03:56

1.4MHz_High_QPSK_6@0

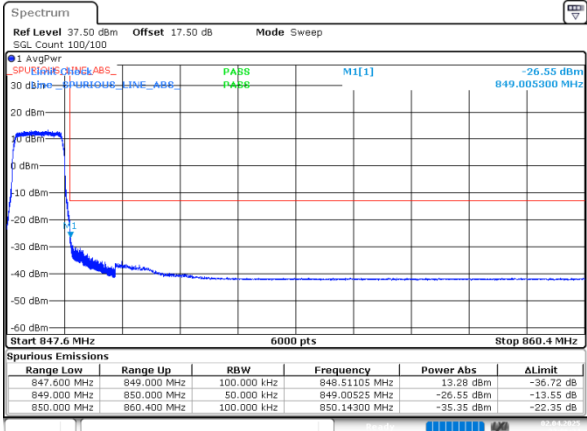


ProjectNo.:2502R38805E-RF Teeter:Loge Long
Date: 2.APR.2025 23:06:34

1.4MHz_High_16QAM_1@5

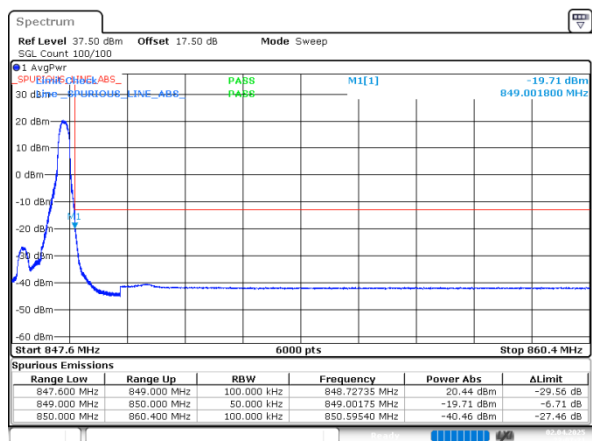


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:07:31

1.4MHz_High_16QAM_6@0

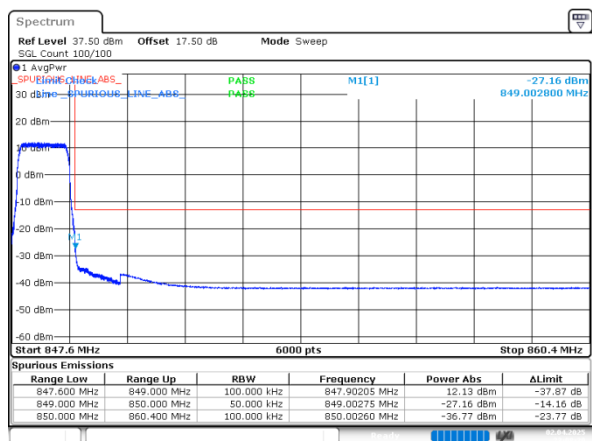


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:08:29

3MHz_Low_QPSK_1@0

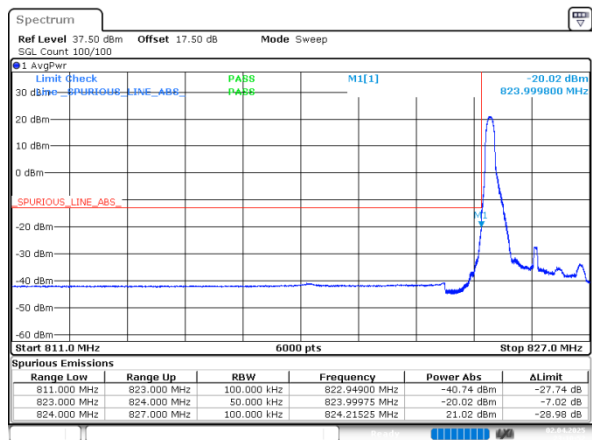


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:10:52

3MHz_Low_QPSK_15@0

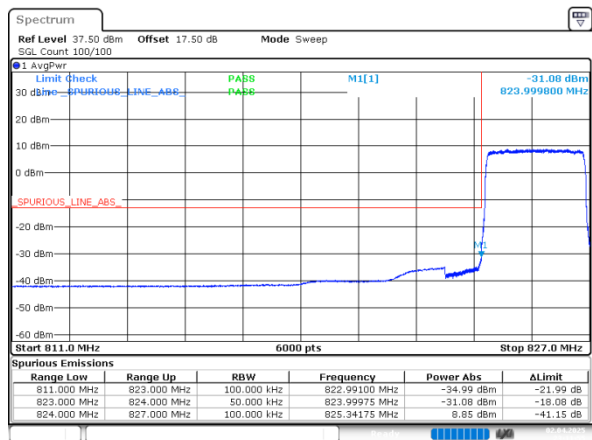


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:11:55

3MHz_Low_16QAM_1@0

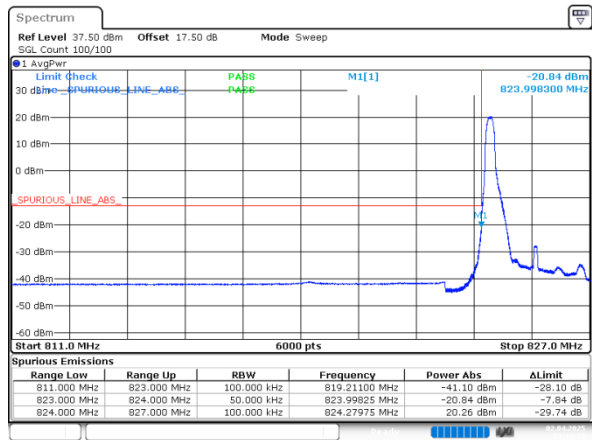


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:12:59

3MHz_Low_16QAM_15@0

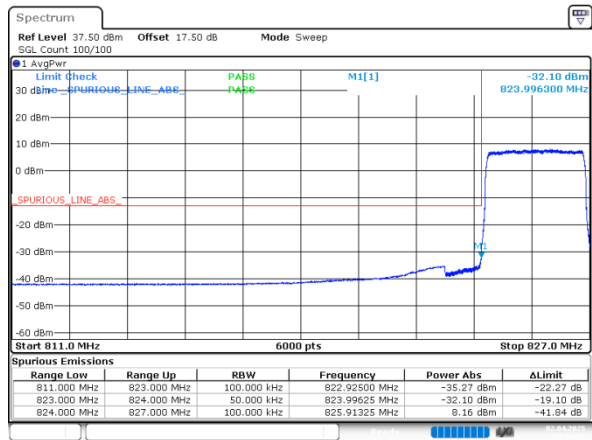


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:14:02

3MHz_High_QPSK_1@14

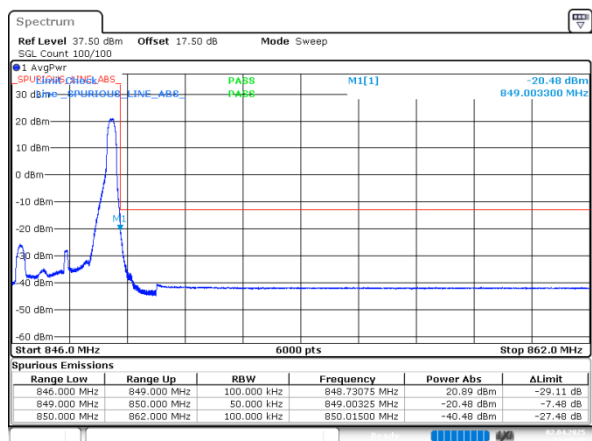


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:15:05

3MHz_High_QPSK_15@0

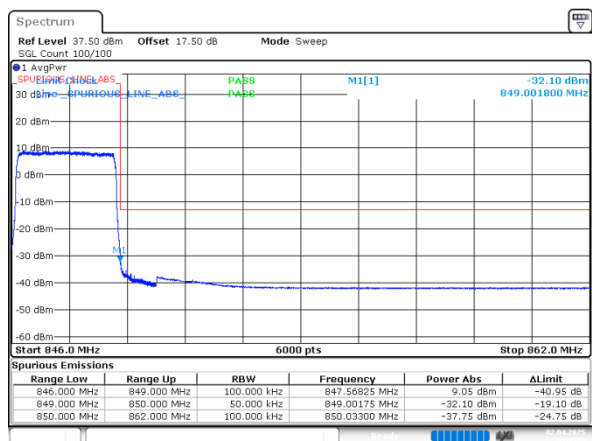


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:16:09

3MHz_High_16QAM_1@14

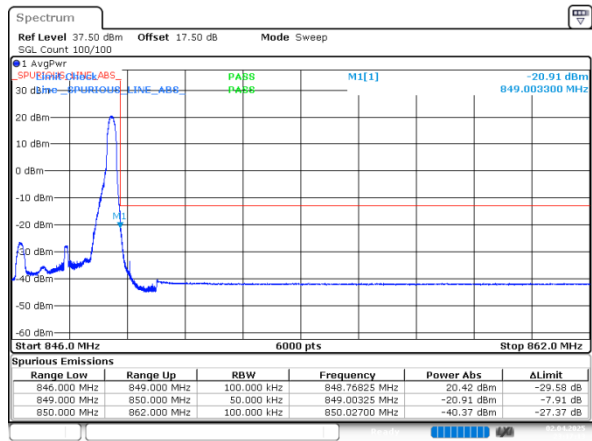


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:17:13

3MHz_High_16QAM_15@0

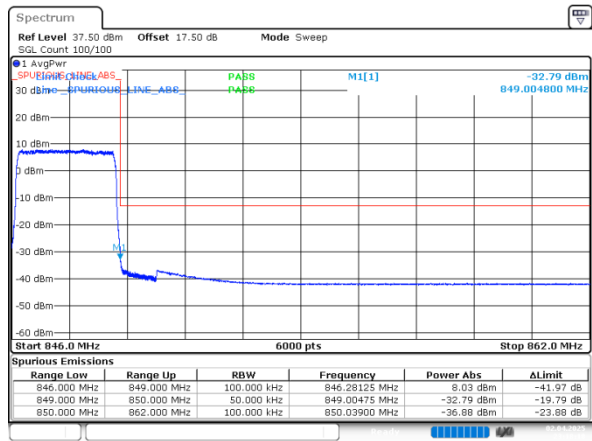


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:18:18

5MHz_Low_QPSK_1@0

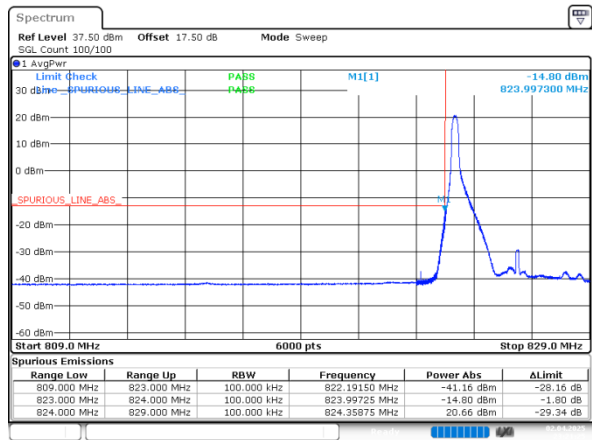


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:21:25

5MHz_Low_QPSK_25@0

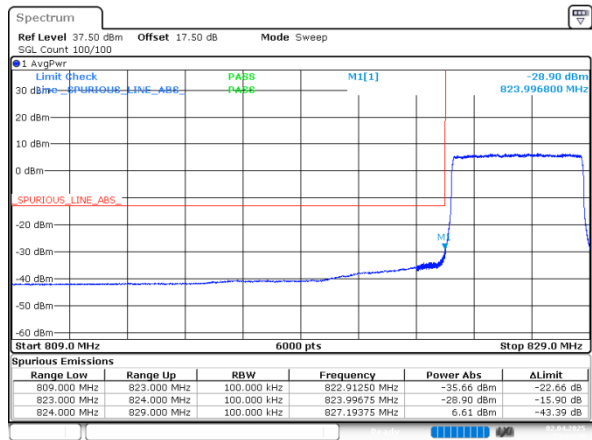


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:22:30

5MHz_Low_16QAM_1@0

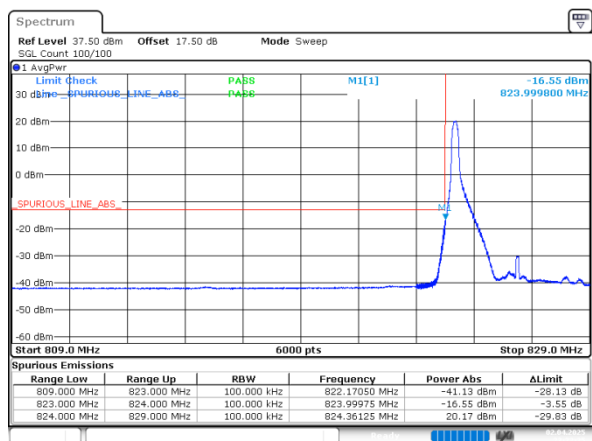


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:23:35

5MHz_Low_16QAM_25@0

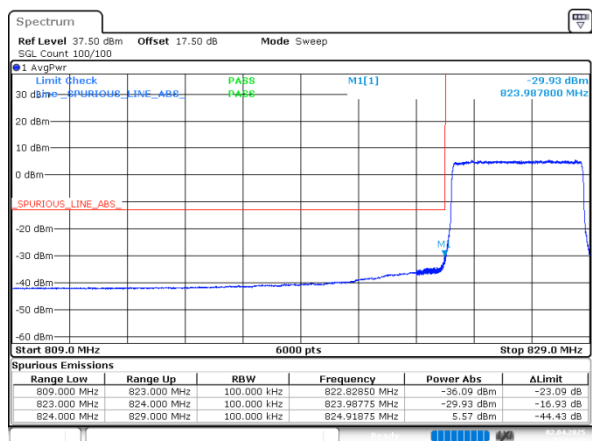


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:24:42

5MHz_High_QPSK_1@24

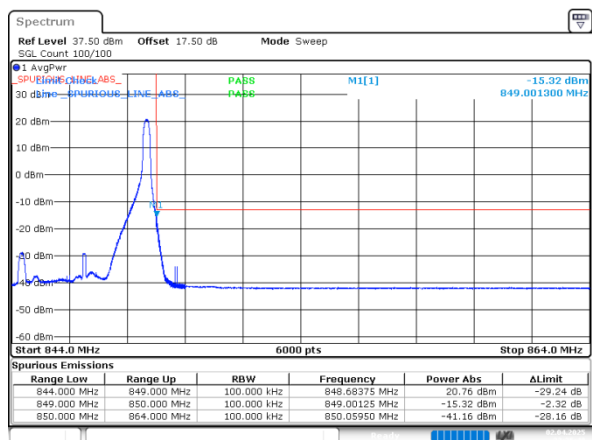


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:25:48

5MHz_High_QPSK_25@0

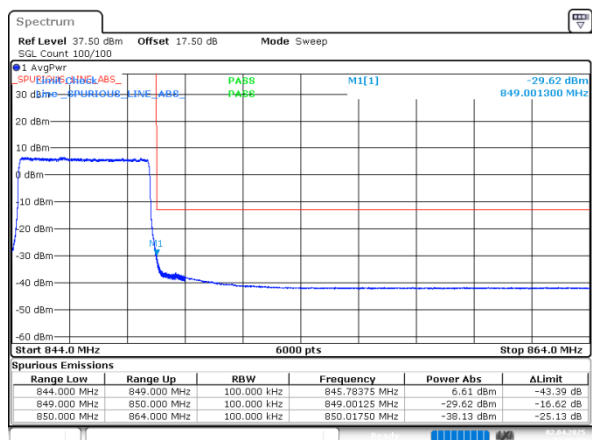


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:26:54

5MHz_High_16QAM_1@24

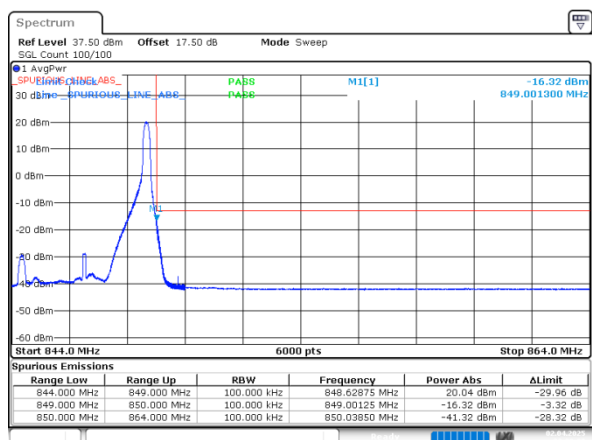


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:28:00

5MHz_High_16QAM_25@0

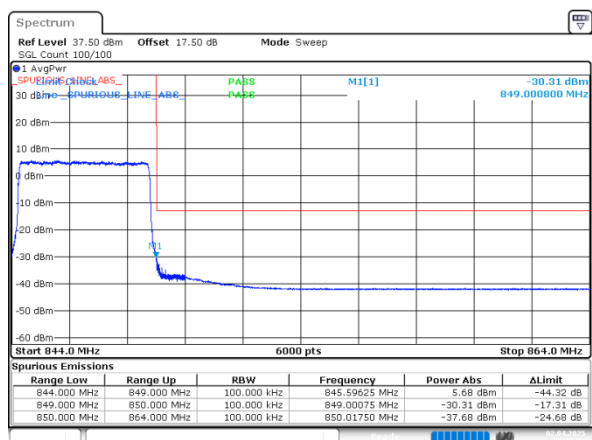


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:29:04

10MHz_Low_QPSK_1@0

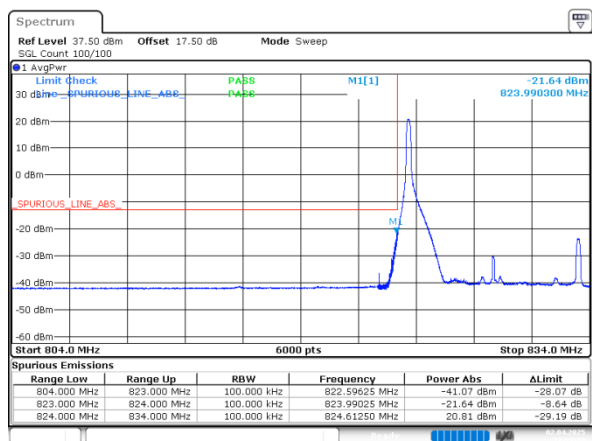


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:31:59

10MHz_Low_QPSK_50@0

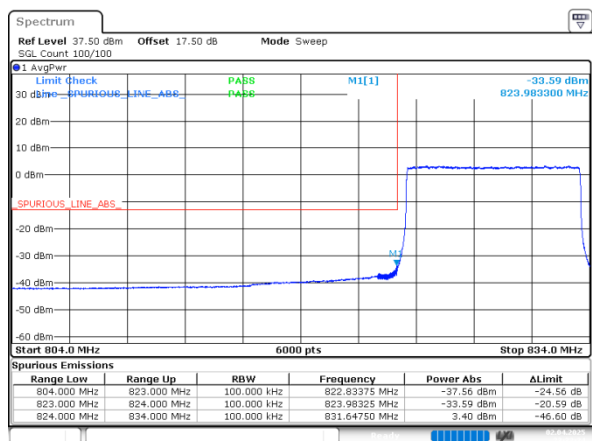


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:33:25

10MHz_Low_16QAM_1@0

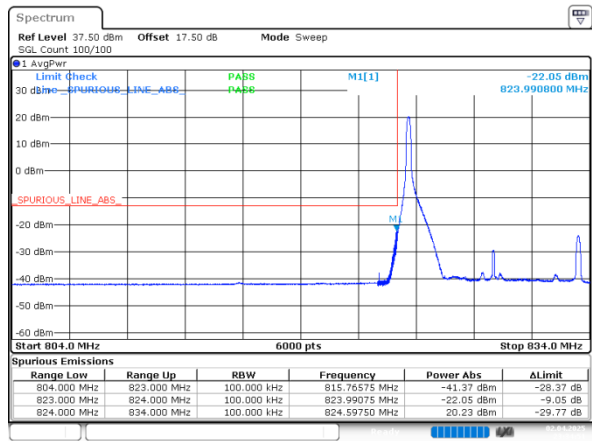


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:34:51

10MHz_Low_16QAM_50@0

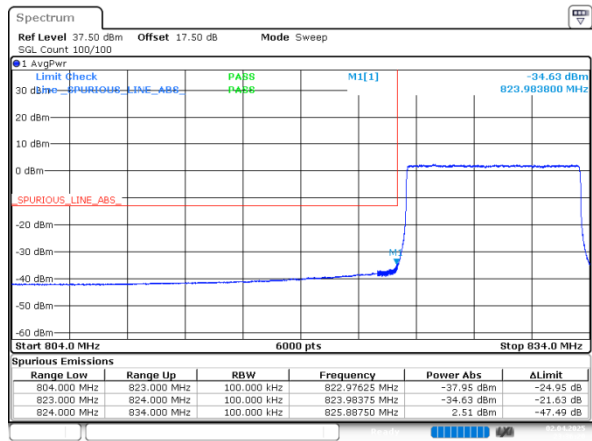


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:36:20

10MHz_High_QPSK_1@49

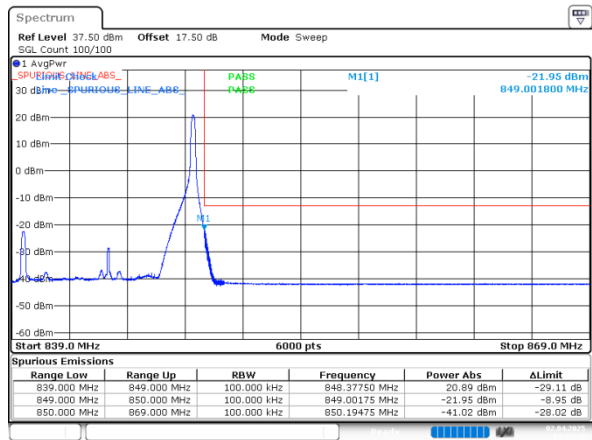


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:37:48

10MHz_High_QPSK_50@0

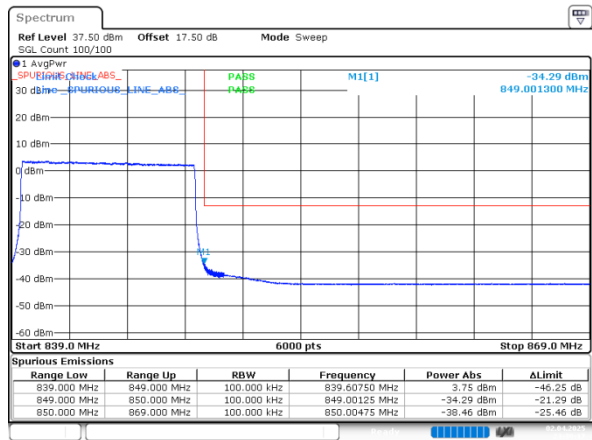


ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:39:18

10MHz_High_16QAM_1@49

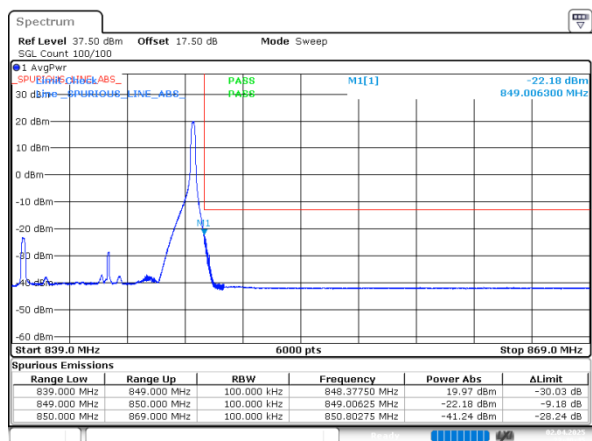

ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:40:46

10MHz_High_16QAM_50@0

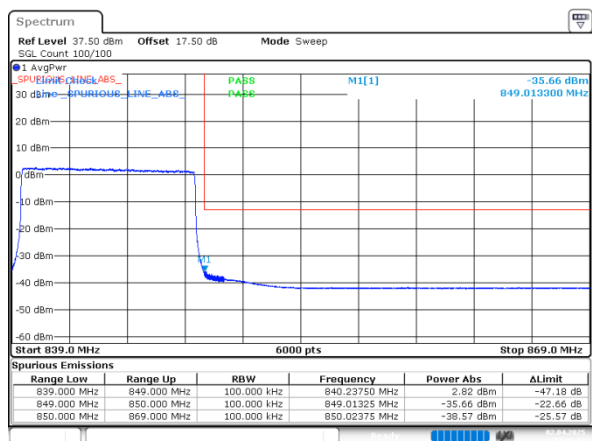

ProjectNo.:2502R38805E-RF Tester:Loge Long
Date: 2.APR.2025 23:42:12