





Band2-3MHz-QPSK-18615-1RB#14

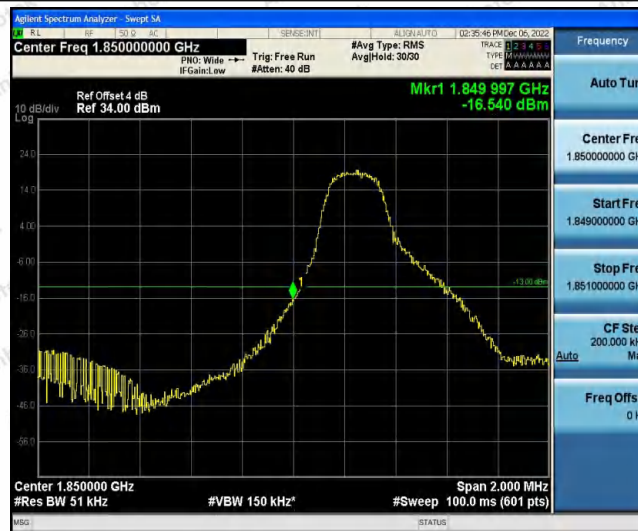

Band2-3MHz-QPSK-18615-15RB#0

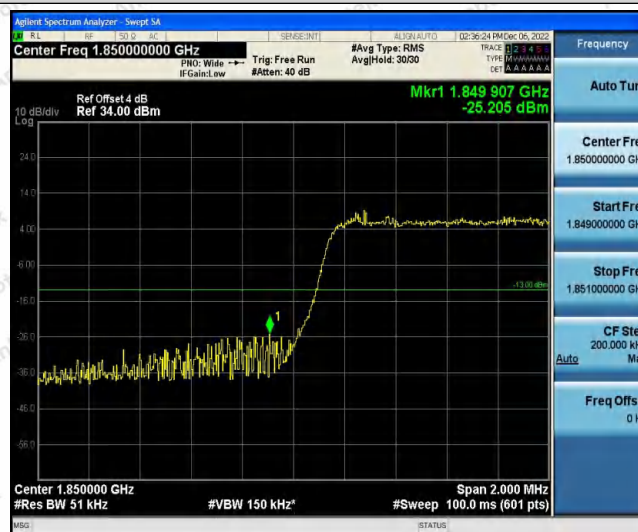

Band2-3MHz-QPSK-19185-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band2-3MHz-QPSK-19185-1RB#14

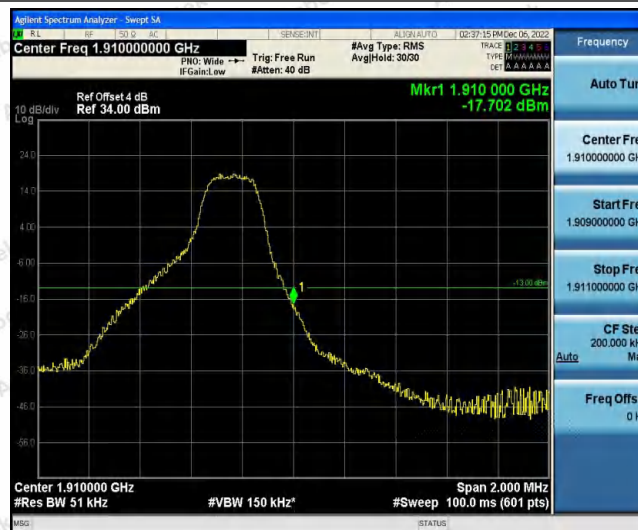

Band2-3MHz-QPSK-19185-15RB#0



Band2-3MHz-16QAM-18615-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-3MHz-16QAM-18615-1RB#14



Band2-3MHz-16QAM-18615-15RB#0



Band2-3MHz-16QAM-19185-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band2-3MHz-16QAM-19185-1RB#14

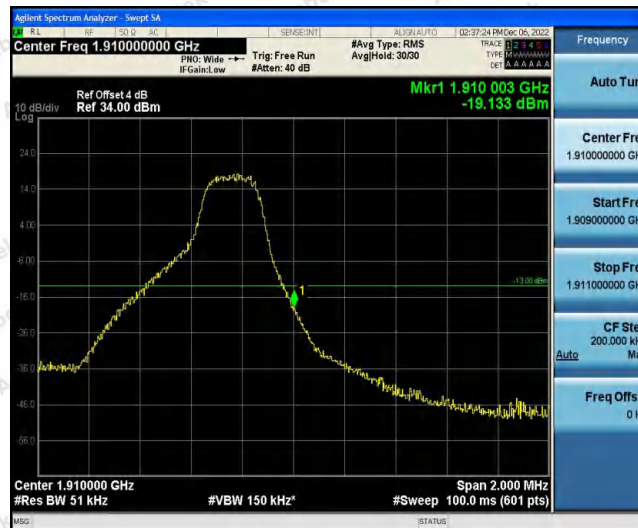

Band2-3MHz-16QAM-19185-15RB#0



Band2-5MHz-QPSK-18625-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-5MHz-QPSK-18625-1RB#24



Band2-5MHz-QPSK-18625-25RB#0



Band2-5MHz-QPSK-19175-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-5MHz-QPSK-19175-1RB#24



Band2-5MHz-QPSK-19175-25RB#0



Band2-5MHz-16QAM-18625-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




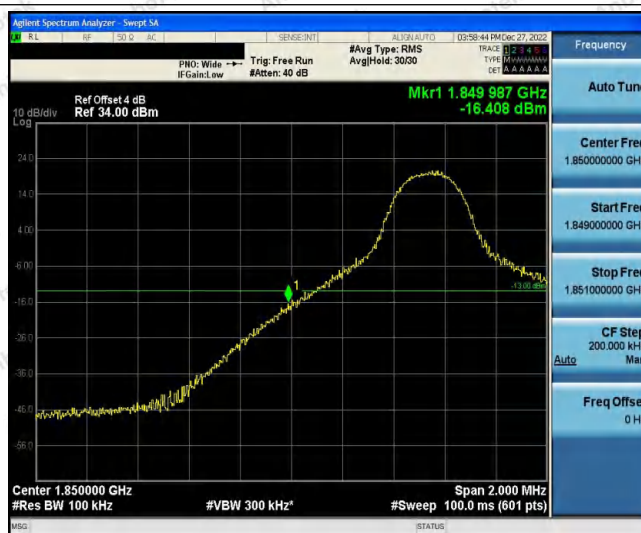

Band2-5MHz-16QAM-18625-1RB#24



Band2-5MHz-16QAM-18625-25RB#0

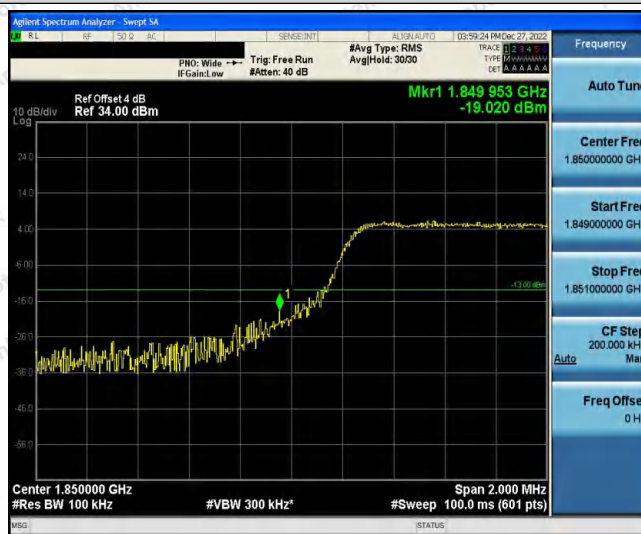

Band2-5MHz-16QAM-19175-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




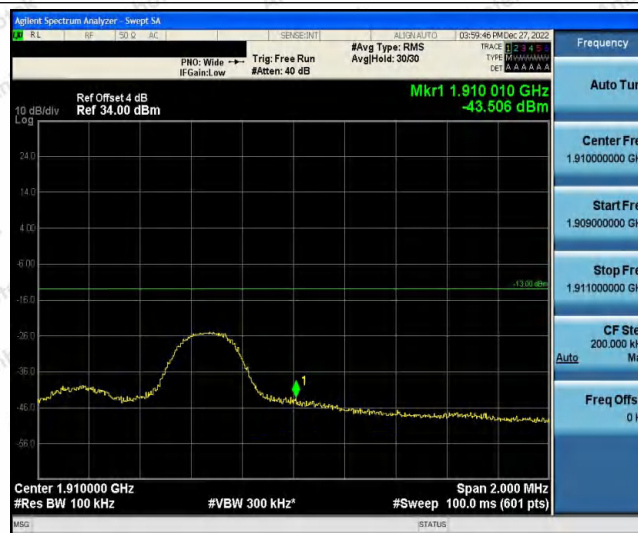

Band2-5MHz-16QAM-19175-1RB#24

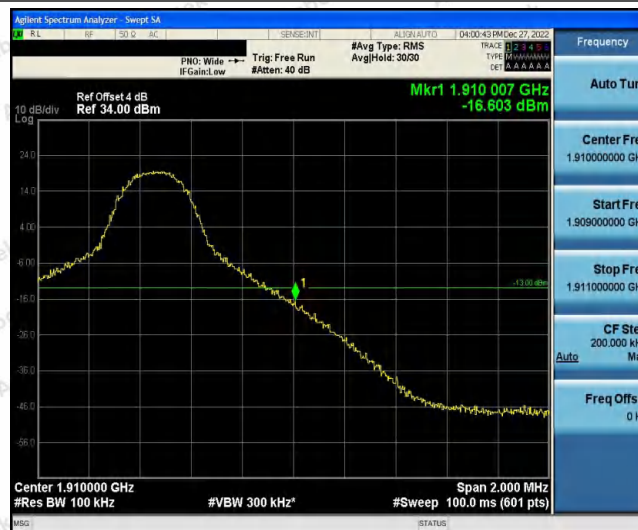

Band2-5MHz-16QAM-19175-25RB#0

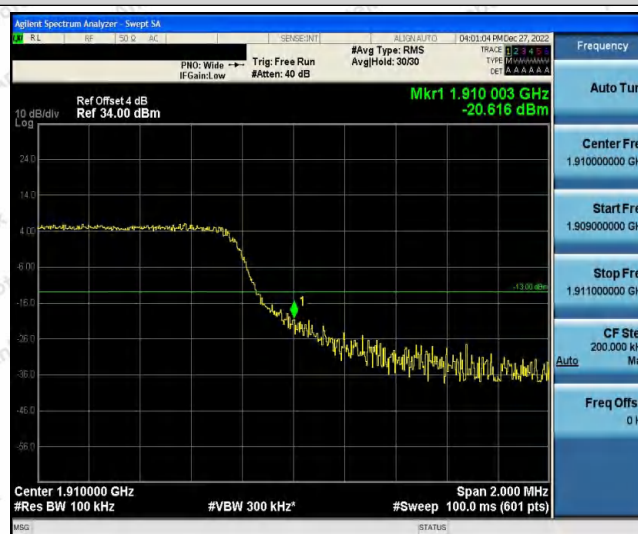

Band2-10MHz-QPSK-18650-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



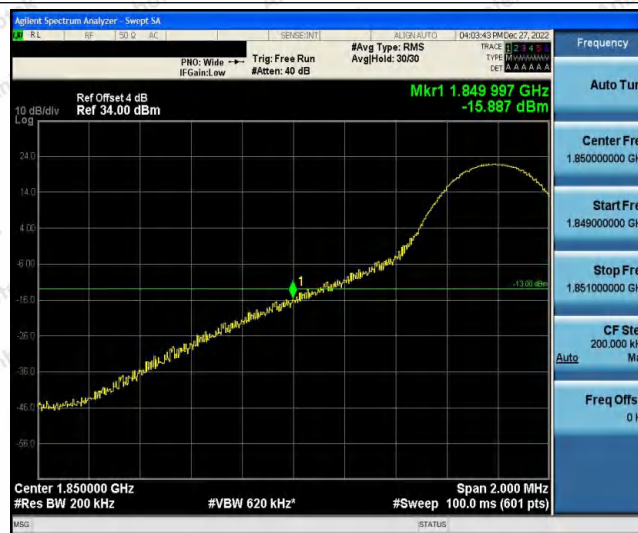

Band2-10MHz-QPSK-18650-1RB#49

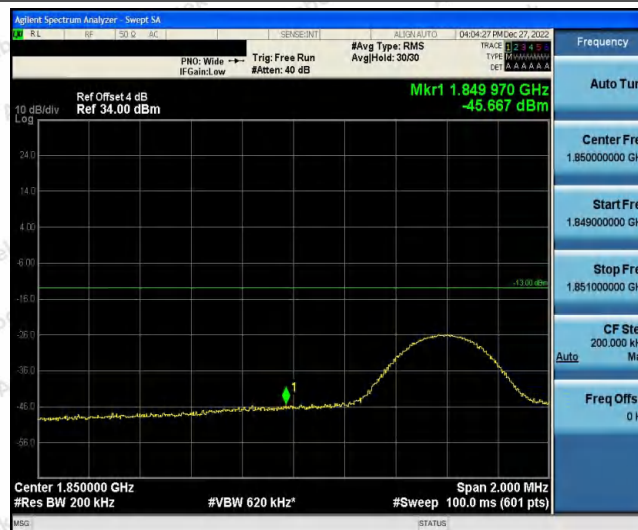

Band2-10MHz-QPSK-18650-50RB#0



Band2-10MHz-QPSK-19150-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn






Band2-10MHz-QPSK-19150-1RB#49



Band2-10MHz-QPSK-19150-50RB#0

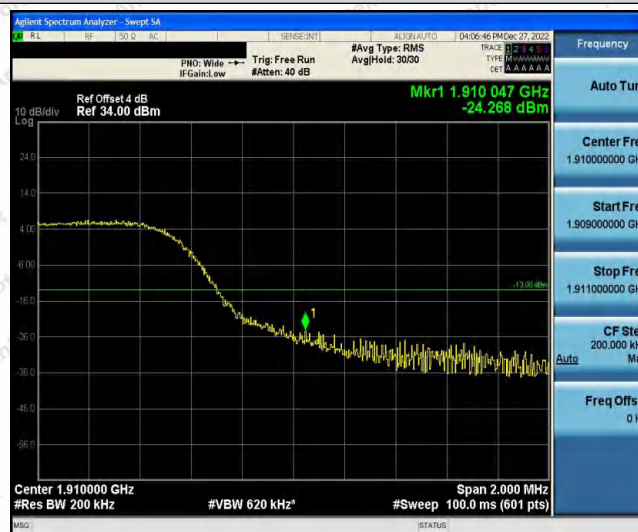

Band2-10MHz-16QAM-18650-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



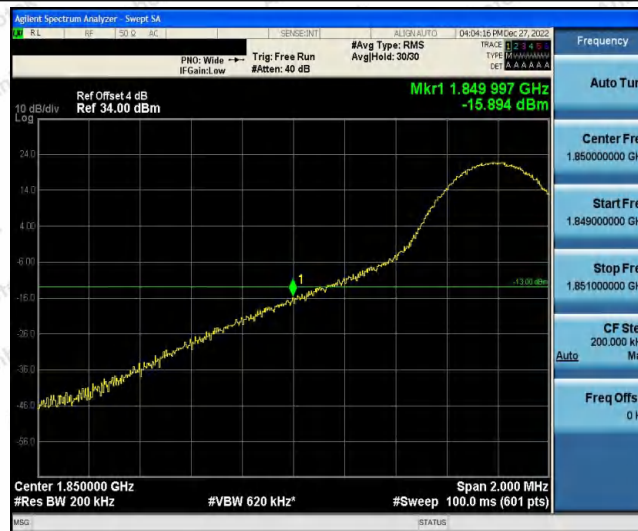

Band2-10MHz-16QAM-18650-1RB#49



Band2-10MHz-16QAM-18650-50RB#0



Band2-10MHz-16QAM-19150-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



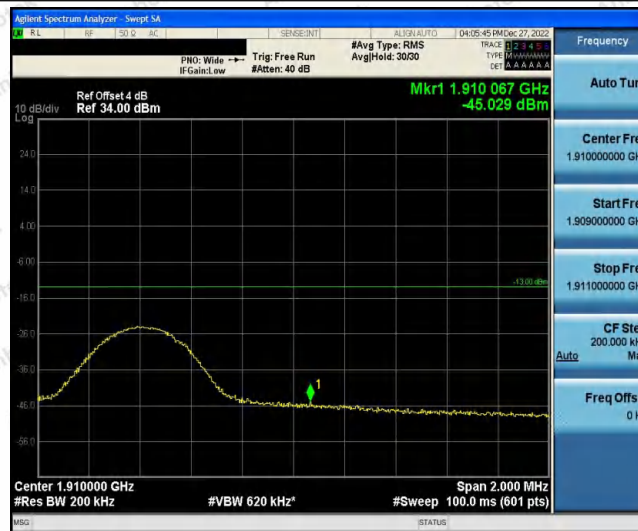

Band2-10MHz-16QAM-19150-1RB#49



Band2-10MHz-16QAM-19150-50RB#0



Band2-15MHz-QPSK-18675-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-15MHz-QPSK-18675-1RB#74



Band2-15MHz-QPSK-18675-75RB#0



Band2-15MHz-QPSK-19125-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-15MHz-QPSK-19125-1RB#74



Band2-15MHz-QPSK-19125-75RB#0



Band2-15MHz-16QAM-18675-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band2-15MHz-16QAM-18675-1RB#74

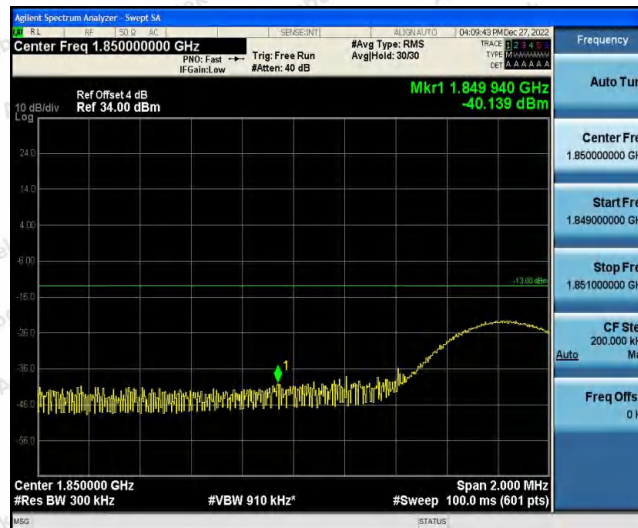

Band2-15MHz-16QAM-18675-75RB#0



Band2-15MHz-16QAM-19125-1RB#0





Band2-15MHz-16QAM-19125-1RB#74



Band2-15MHz-16QAM-19125-75RB#0



Band2-20MHz-QPSK-18700-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-20MHz-QPSK-18700-1RB#99



Band2-20MHz-QPSK-18700-100RB#0



Band2-20MHz-QPSK-19100-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-20MHz-QPSK-19100-1RB#99



Band2-20MHz-QPSK-19100-100RB#0



Band2-20MHz-16QAM-18700-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-20MHz-16QAM-18700-1RB#99



Band2-20MHz-16QAM-18700-100RB#0



Band2-20MHz-16QAM-19100-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn






Band2-20MHz-16QAM-19100-1RB#99



Band2-20MHz-16QAM-19100-100RB#0

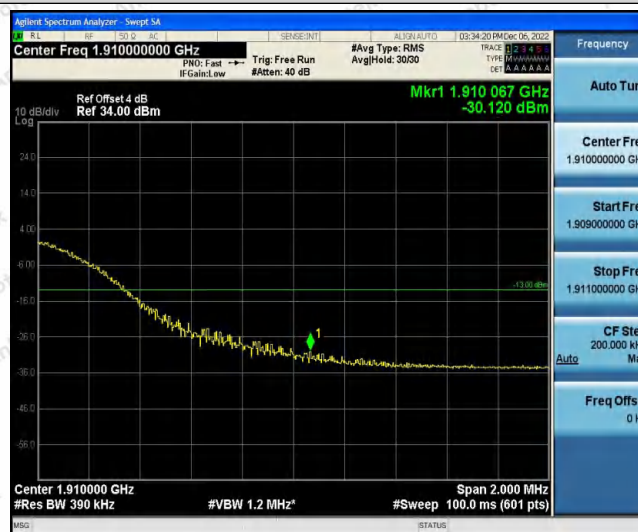

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	Range1:30~1000MHz	-56.96	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	Range2:1000~20000MHz	-33.61	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-57.14	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.07	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	Range1:30~1000MHz	-55.89	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	Range2:1000~20000MHz	-33.12	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	Range1:30~1000MHz	-57.39	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	Range2:1000~20000MHz	-32.74	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-56.88	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.77	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	Range1:30~1000MHz	-56.24	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	Range2:1000~20000MHz	-33.63	PASS
Band2	3MHz	QPSK	18615	1RB#0	Range1:30~1000MHz	-57.26	PASS
Band2	3MHz	QPSK	18615	1RB#0	Range2:1000~20000MHz	-32.93	PASS
Band2	3MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-56.89	PASS
Band2	3MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.34	PASS
Band2	3MHz	QPSK	19185	1RB#0	Range1:30~1000MHz	-56.42	PASS
Band2	3MHz	QPSK	19185	1RB#0	Range2:1000~20000MHz	-33.77	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band2	3MHz	16QAM	18615	1RB#0	Range1:30~1000MHz	-57.02	PASS
Band2	3MHz	16QAM	18615	1RB#0	Range2:1000~20000MHz	-33.99	PASS
Band2	3MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-57.54	PASS
Band2	3MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.46	PASS
Band2	3MHz	16QAM	19185	1RB#0	Range1:30~1000MHz	-57.62	PASS
Band2	3MHz	16QAM	19185	1RB#0	Range2:1000~20000MHz	-32.37	PASS
Band2	5MHz	QPSK	18625	1RB#0	Range1:30~1000MHz	-56.6	PASS
Band2	5MHz	QPSK	18625	1RB#0	Range2:1000~20000MHz	-32.56	PASS
Band2	5MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-56.67	PASS
Band2	5MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.1	PASS
Band2	5MHz	QPSK	19175	1RB#0	Range1:30~1000MHz	-57.65	PASS
Band2	5MHz	QPSK	19175	1RB#0	Range2:1000~20000MHz	-33.08	PASS
Band2	5MHz	16QAM	18625	1RB#0	Range1:30~1000MHz	-56.78	PASS
Band2	5MHz	16QAM	18625	1RB#0	Range2:1000~20000MHz	-33.02	PASS
Band2	5MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-56.36	PASS
Band2	5MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-32.71	PASS
Band2	5MHz	16QAM	19175	1RB#0	Range1:30~1000MHz	-56.64	PASS
Band2	5MHz	16QAM	19175	1RB#0	Range2:1000~20000MHz	-32.78	PASS
Band2	10MHz	QPSK	18650	1RB#0	Range1:30~1000MHz	-56.89	PASS
Band2	10MHz	QPSK	18650	1RB#0	Range2:1000~20000MHz	-33.82	PASS
Band2	10MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-57.12	PASS
Band2	10MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.43	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	10MHz	QPSK	19150	1RB#0	Range1:30~1000MHz	-57.01	PASS
Band2	10MHz	QPSK	19150	1RB#0	Range2:1000~20000MHz	-33.78	PASS
Band2	10MHz	16QAM	18650	1RB#0	Range1:30~1000MHz	-56.49	PASS
Band2	10MHz	16QAM	18650	1RB#0	Range2:1000~20000MHz	-33.81	PASS
Band2	10MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-56.76	PASS
Band2	10MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.3	PASS
Band2	10MHz	16QAM	19150	1RB#0	Range1:30~1000MHz	-57.18	PASS
Band2	10MHz	16QAM	19150	1RB#0	Range2:1000~20000MHz	-33.58	PASS
Band2	15MHz	QPSK	18675	1RB#0	Range1:30~1000MHz	-56.98	PASS
Band2	15MHz	QPSK	18675	1RB#0	Range2:1000~20000MHz	-33.48	PASS
Band2	15MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-57.02	PASS
Band2	15MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.03	PASS
Band2	15MHz	QPSK	19125	1RB#0	Range1:30~1000MHz	-57.28	PASS
Band2	15MHz	QPSK	19125	1RB#0	Range2:1000~20000MHz	-32.14	PASS
Band2	15MHz	16QAM	18675	1RB#0	Range1:30~1000MHz	-56.99	PASS
Band2	15MHz	16QAM	18675	1RB#0	Range2:1000~20000MHz	-33.48	PASS
Band2	15MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-56.61	PASS
Band2	15MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-32.28	PASS
Band2	15MHz	16QAM	19125	1RB#0	Range1:30~1000MHz	-57.6	PASS
Band2	15MHz	16QAM	19125	1RB#0	Range2:1000~20000MHz	-32.98	PASS
Band2	20MHz	QPSK	18700	1RB#0	Range1:30~1000MHz	-57.13	PASS
Band2	20MHz	QPSK	18700	1RB#0	Range2:1000~20000MHz	-32.62	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	20MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-57.79	PASS
Band2	20MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.38	PASS
Band2	20MHz	QPSK	19100	1RB#0	Range1:30~1000MHz	-57.49	PASS
Band2	20MHz	QPSK	19100	1RB#0	Range2:1000~20000MHz	-33.55	PASS
Band2	20MHz	16QAM	18700	1RB#0	Range1:30~1000MHz	-56.96	PASS
Band2	20MHz	16QAM	18700	1RB#0	Range2:1000~20000MHz	-33.34	PASS
Band2	20MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-57.55	PASS
Band2	20MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.11	PASS
Band2	20MHz	16QAM	19100	1RB#0	Range1:30~1000MHz	-57.31	PASS
Band2	20MHz	16QAM	19100	1RB#0	Range2:1000~20000MHz	-33.34	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
 www.anbotek.com.cn




Test Graphs


Band2-1.4MHz-QPSK-18607-1RB#0-Range1:30~1000MHz

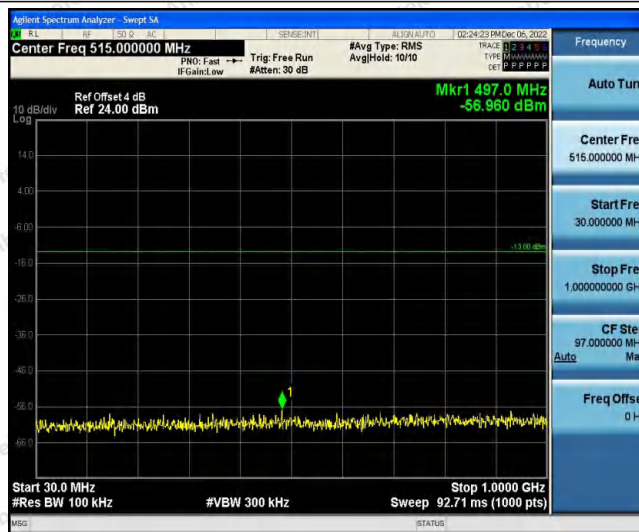

Band2-1.4MHz-QPSK-18607-1RB#0-Range2:1000~20000MHz

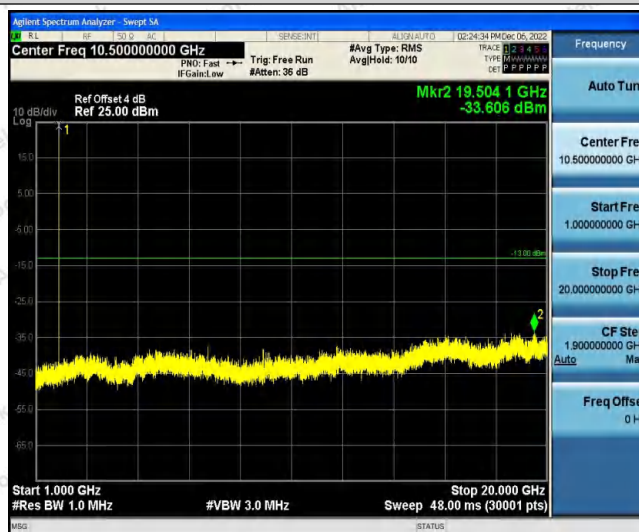

Band2-1.4MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

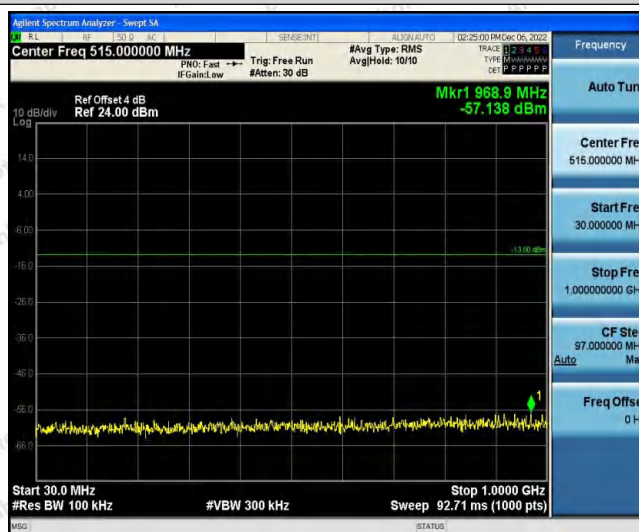

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




Band2-1.4MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz



Band2-1.4MHz-QPSK-19193-1RB#0-Range1:30~1000MHz

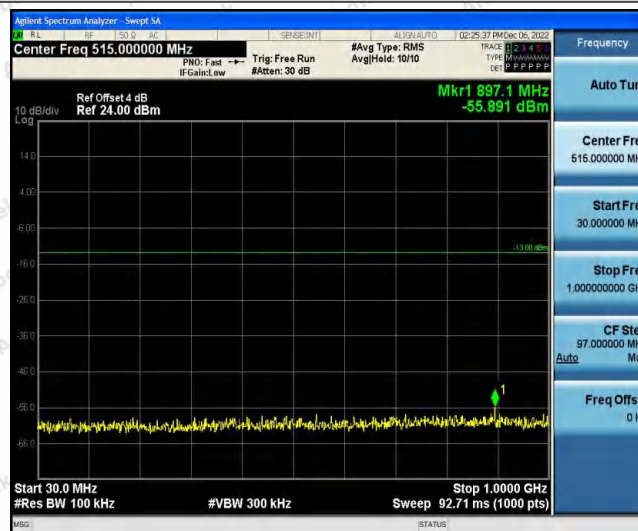

Band2-1.4MHz-QPSK-19193-1RB#0-Range2:1000~20000MHz

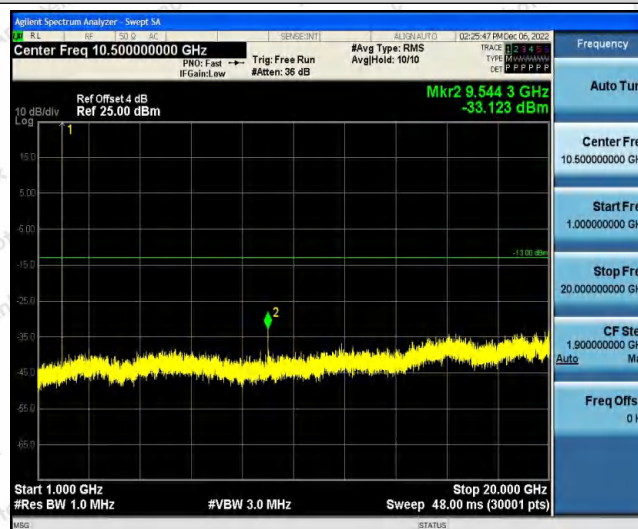

Band2-1.4MHz-16QAM-18607-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




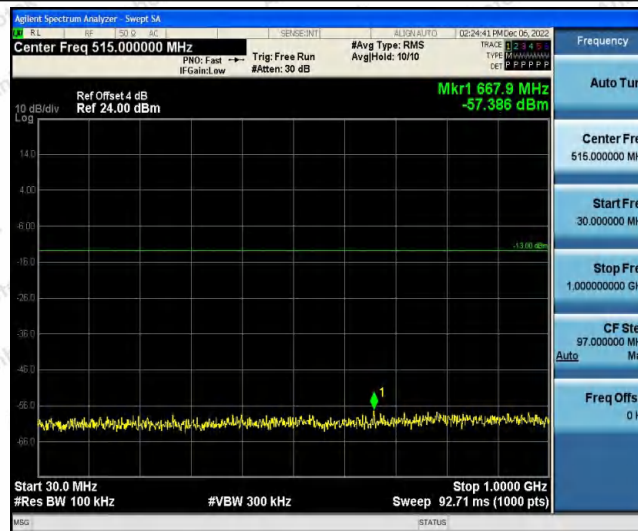

Band2-1.4MHz-16QAM-18607-1RB#0-Range2:1000~20000MHz

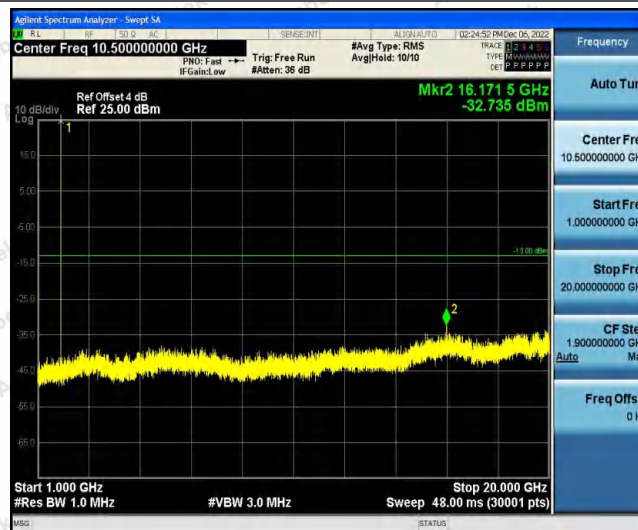

Band2-1.4MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

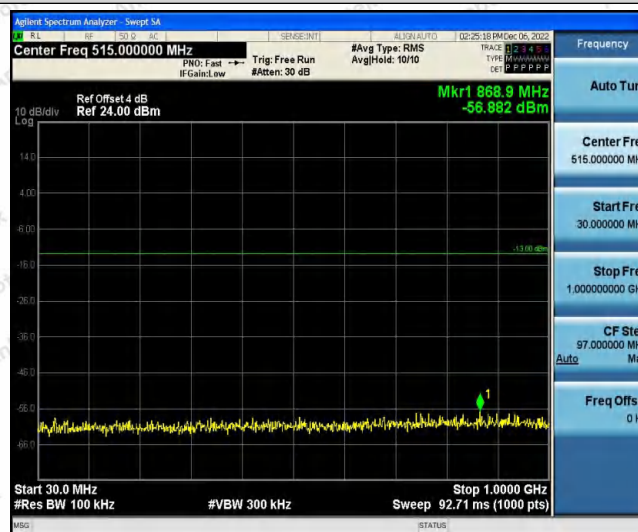

Band2-1.4MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




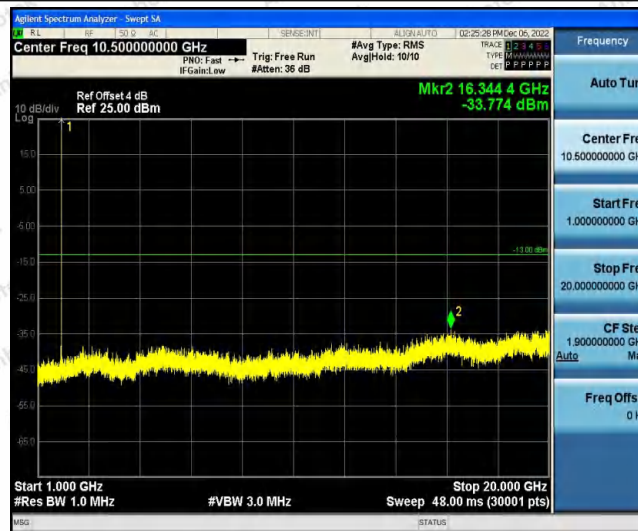

Band2-1.4MHz-16QAM-19193-1RB#0-Range1:30~1000MHz

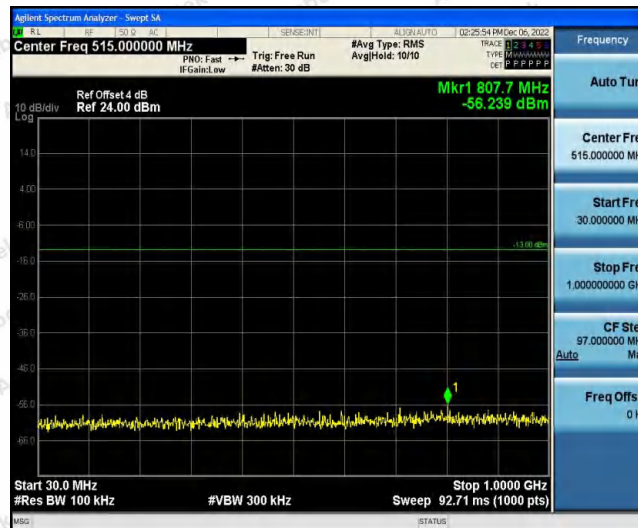

Band2-1.4MHz-16QAM-19193-1RB#0-Range2:1000~20000MHz

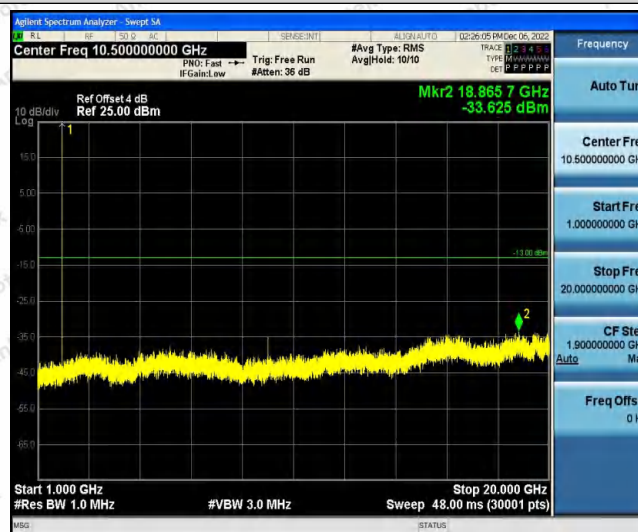

Band2-3MHz-QPSK-18615-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




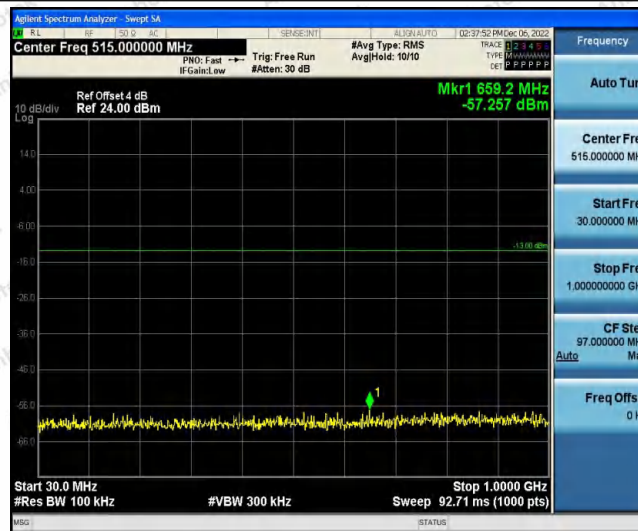

Band2-3MHz-QPSK-18615-1RB#0-Range2:1000~20000MHz

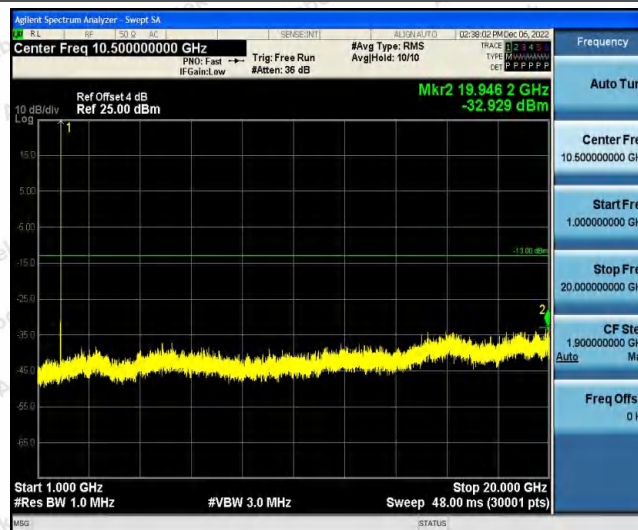

Band2-3MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

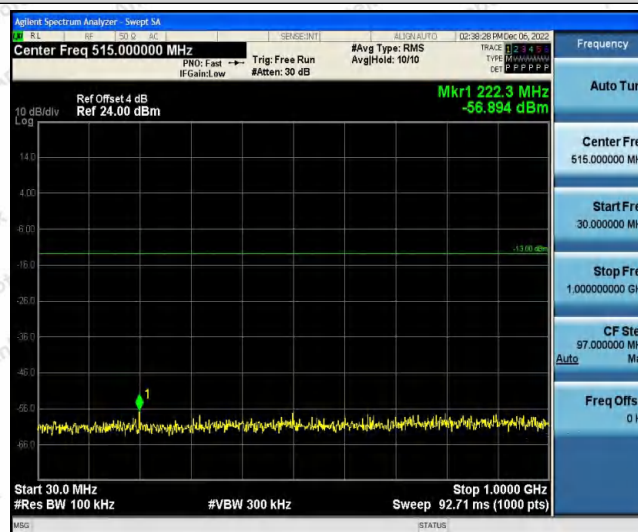

Band2-3MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band2-3MHz-QPSK-19185-1RB#0-Range1:30~1000MHz

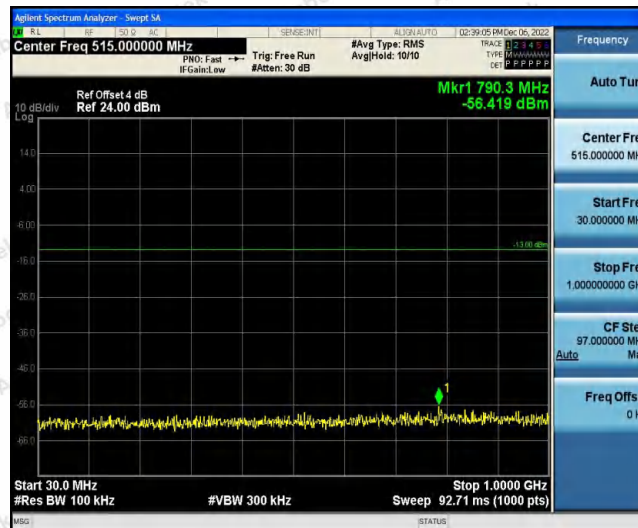

Band2-3MHz-QPSK-19185-1RB#0-Range2:1000~20000MHz

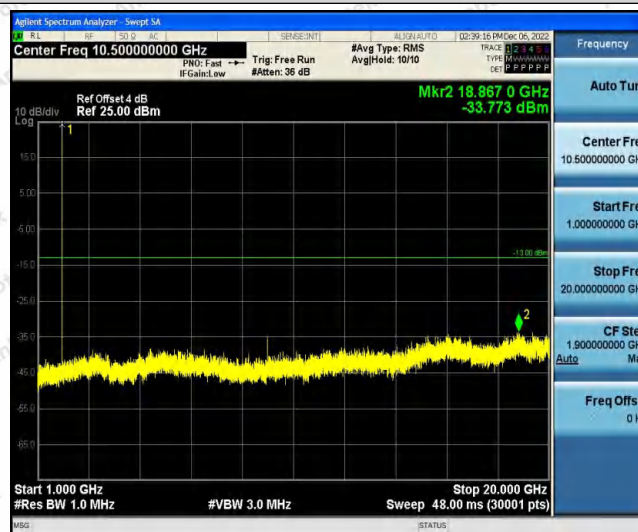

Band2-3MHz-16QAM-18615-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




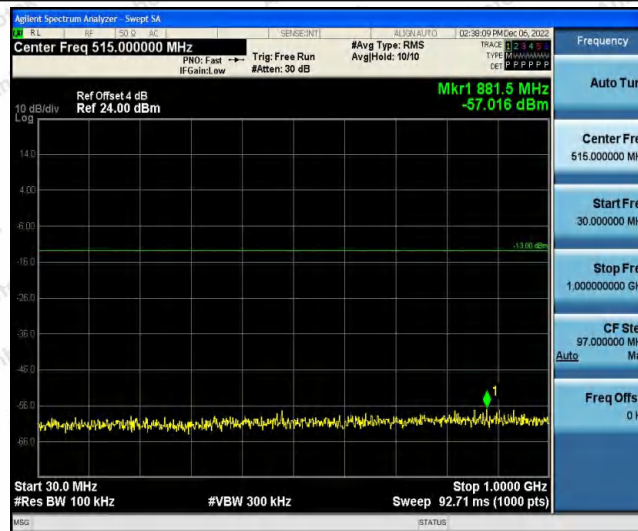

Band2-3MHz-16QAM-18615-1RB#0-Range2:1000~20000MHz



Band2-3MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

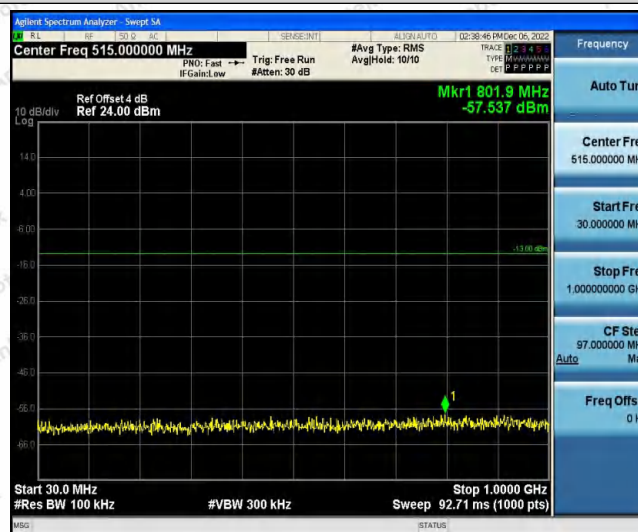

Band2-3MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




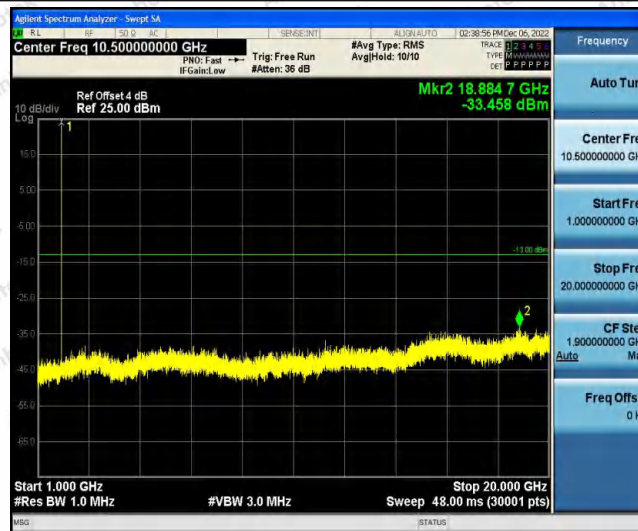

Band2-3MHz-16QAM-19185-1RB#0-Range1:30~1000MHz

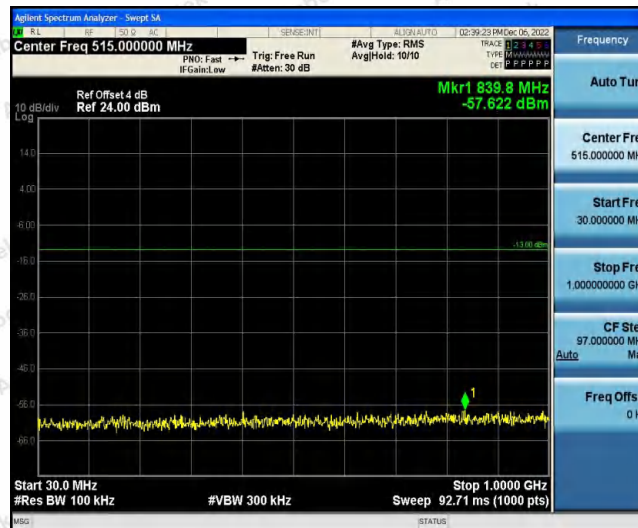

Band2-3MHz-16QAM-19185-1RB#0-Range2:1000~20000MHz

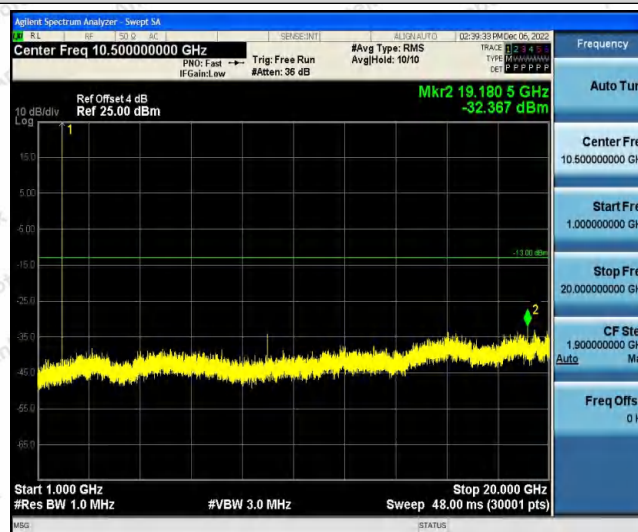

Band2-5MHz-QPSK-18625-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




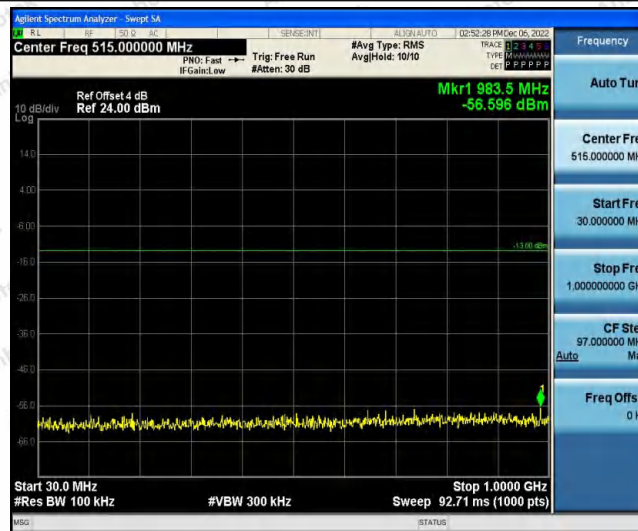

Band2-5MHz-QPSK-18625-1RB#0-Range2:1000~20000MHz

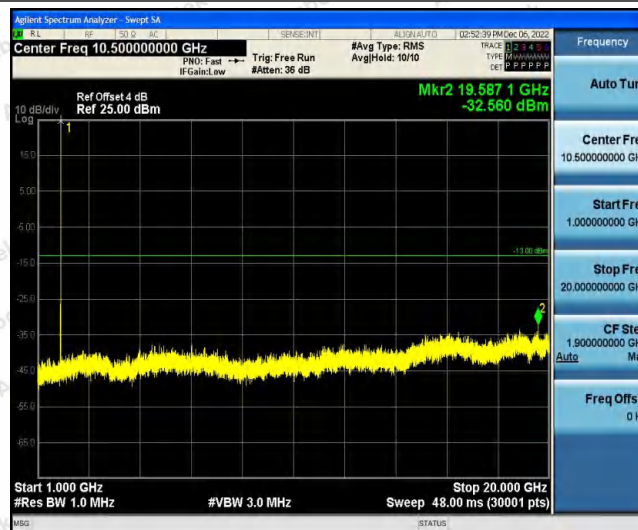

Band2-5MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

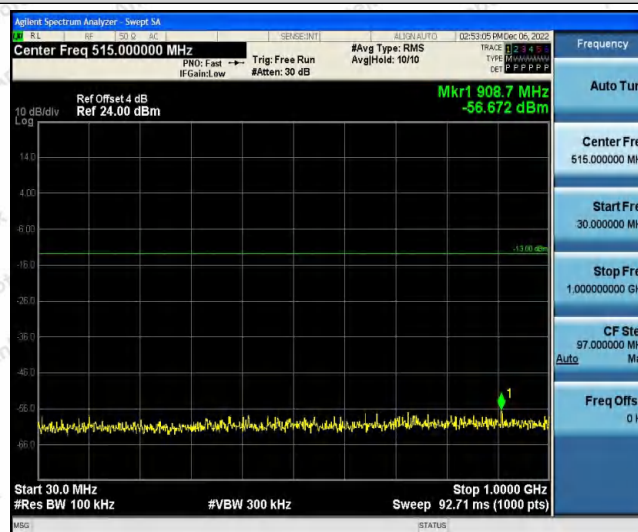

Band2-5MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




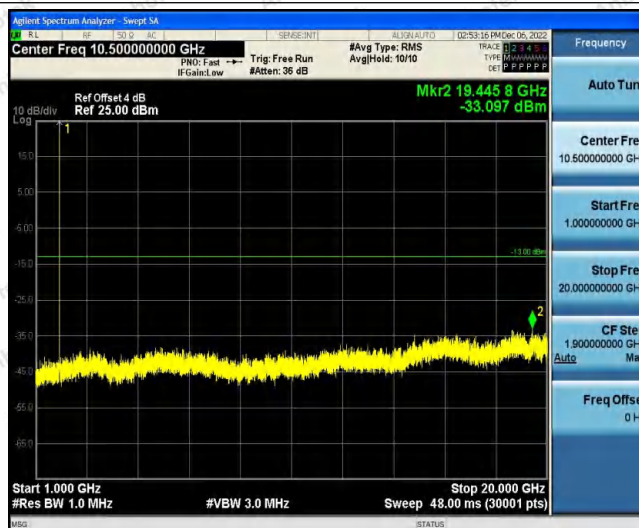

Band2-5MHz-QPSK-19175-1RB#0-Range1:30~1000MHz

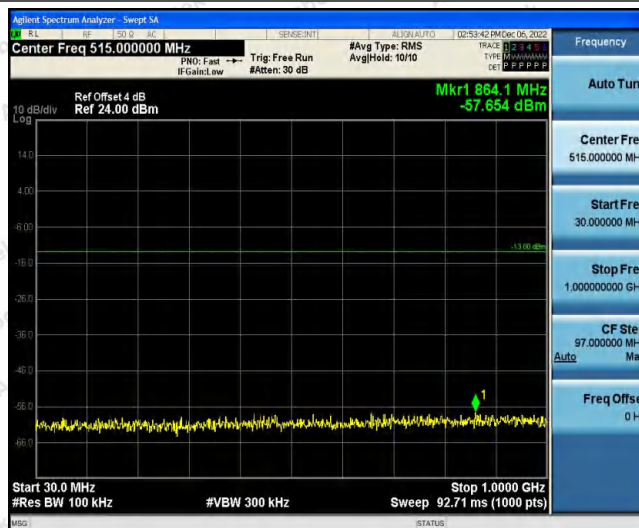

Band2-5MHz-QPSK-19175-1RB#0-Range2:1000~20000MHz

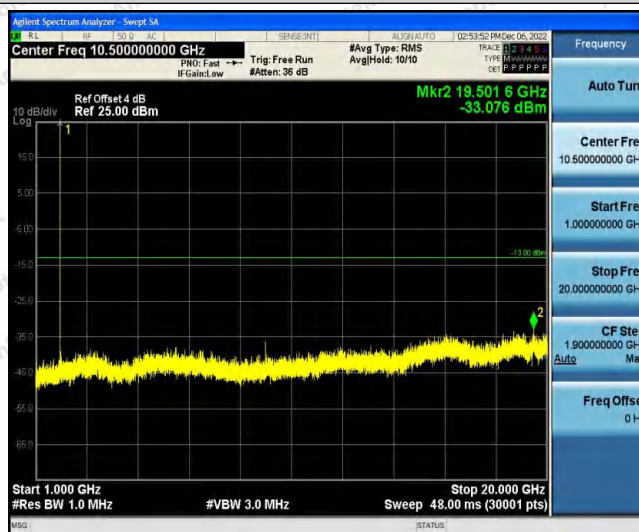

Band2-5MHz-16QAM-18625-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
anbotek.com.cn




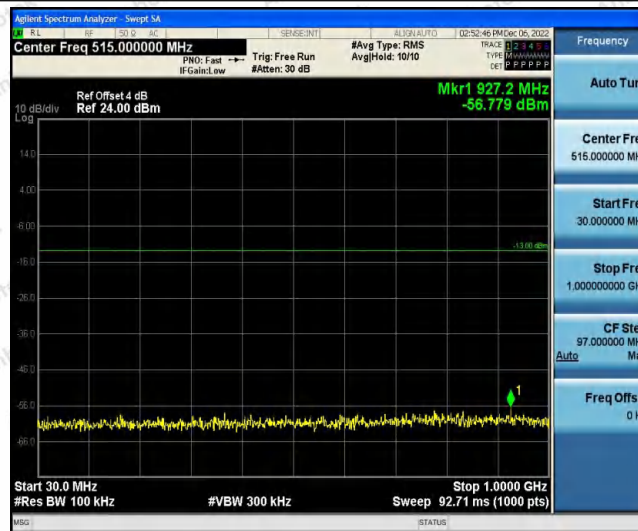

Band2-5MHz-16QAM-18625-1RB#0-Range2:1000~20000MHz

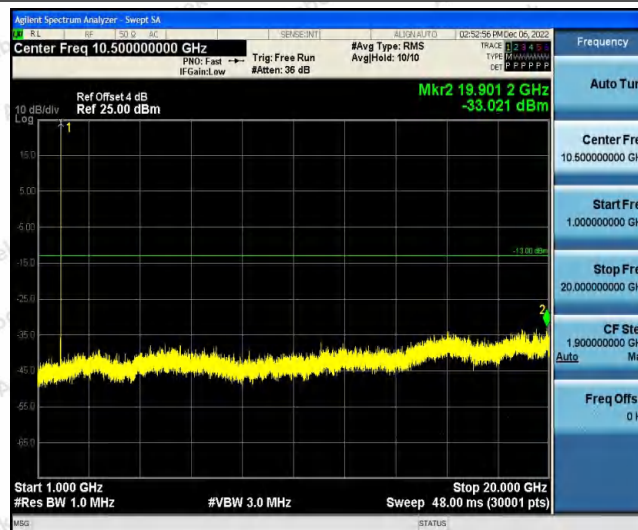

Band2-5MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

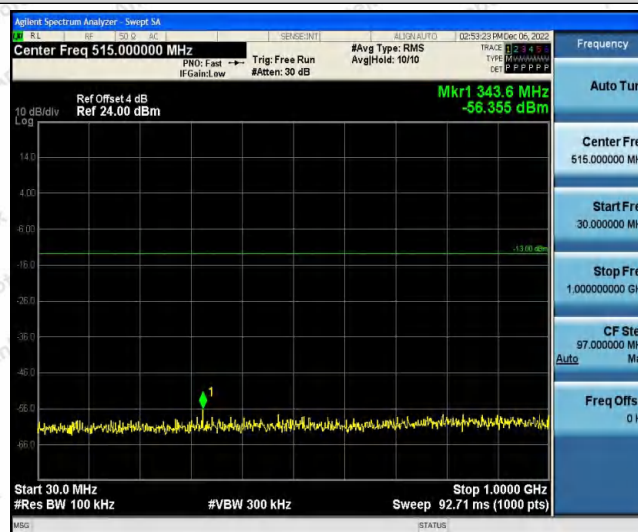

Band2-5MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




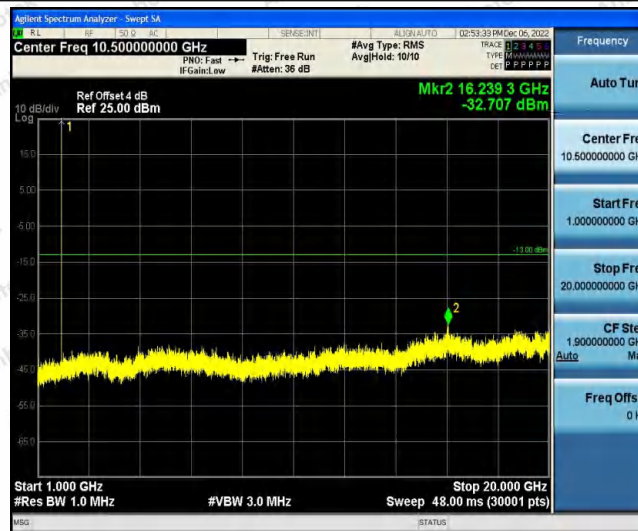

Band2-5MHz-16QAM-19175-1RB#0-Range1:30~1000MHz

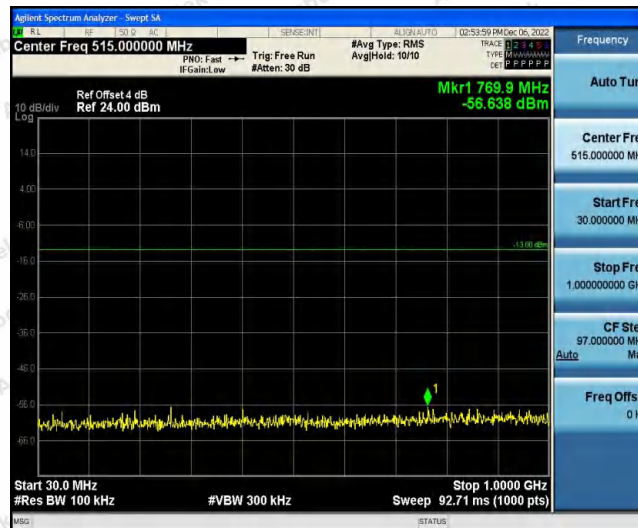

Band2-5MHz-16QAM-19175-1RB#0-Range2:1000~20000MHz

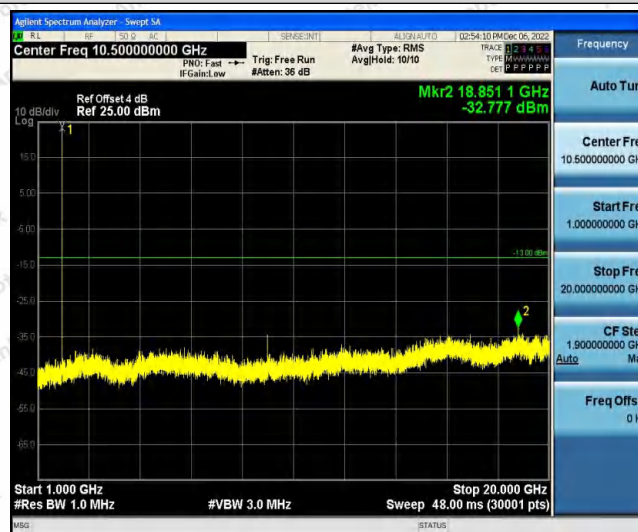

Band2-10MHz-QPSK-18650-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




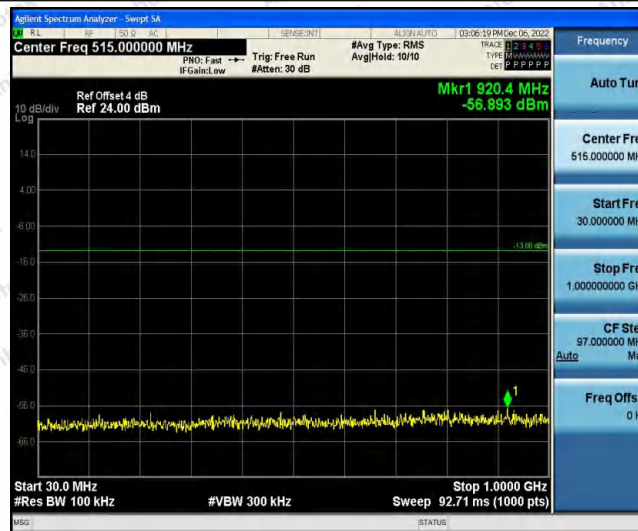

Band2-10MHz-QPSK-18650-1RB#0-Range2:1000~20000MHz

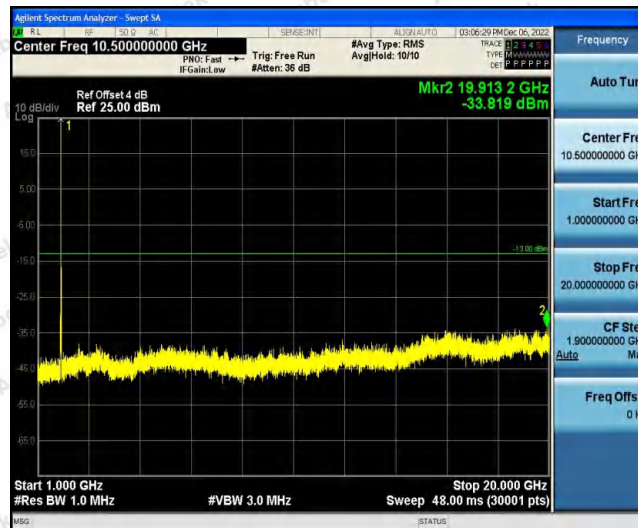

Band2-10MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

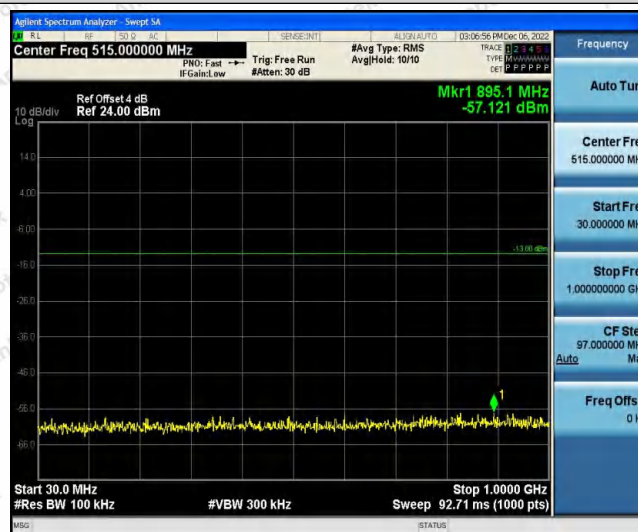

Band2-10MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band2-10MHz-QPSK-19150-1RB#0-Range1:30~1000MHz

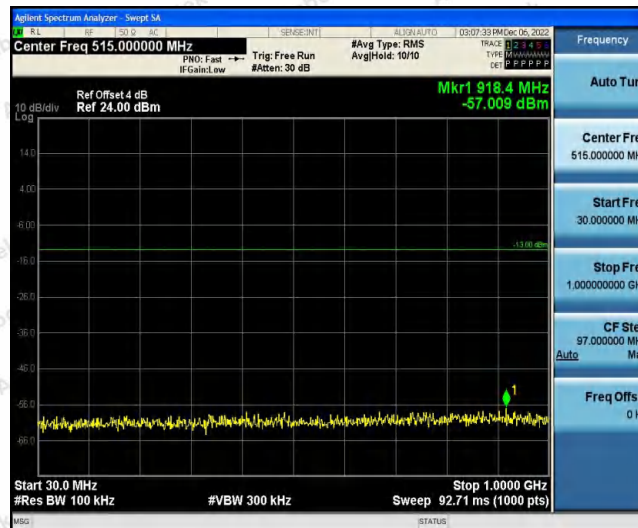

Band2-10MHz-QPSK-19150-1RB#0-Range2:1000~20000MHz

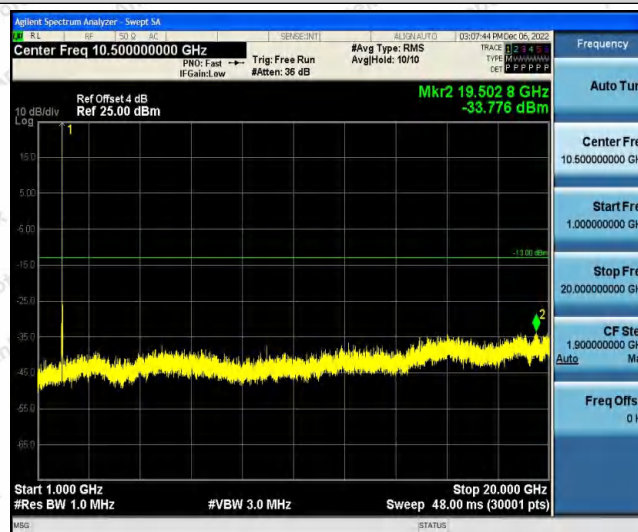

Band2-10MHz-16QAM-18650-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




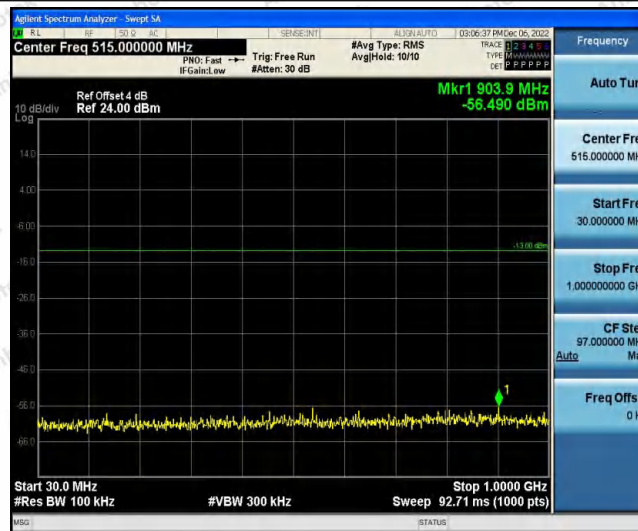

Band2-10MHz-16QAM-18650-1RB#0-Range2:1000~20000MHz

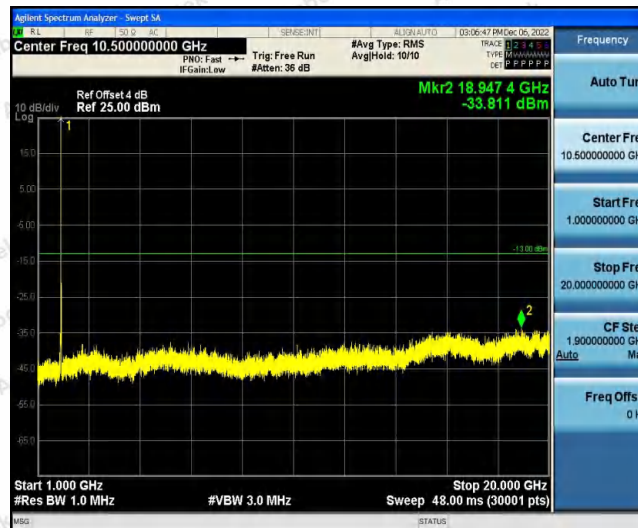

Band2-10MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

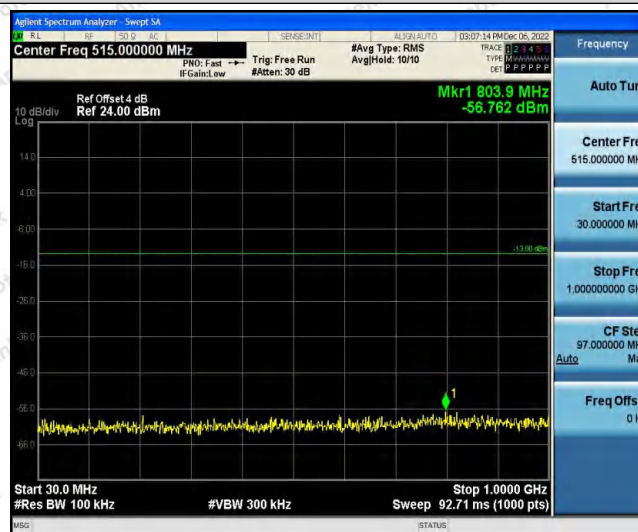

Band2-10MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




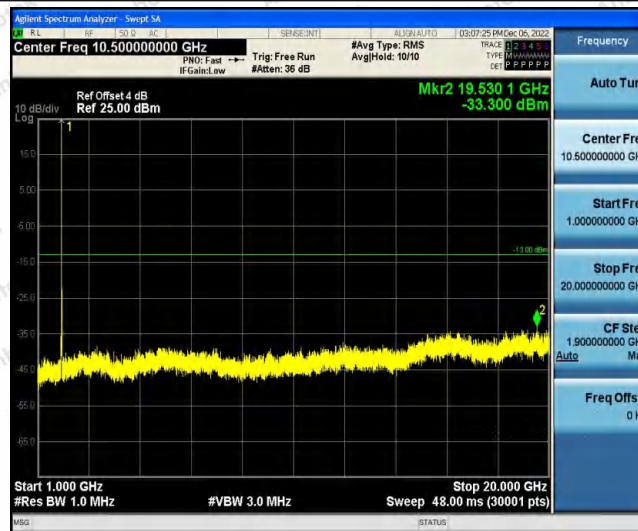

Band2-10MHz-16QAM-19150-1RB#0-Range1:30~1000MHz

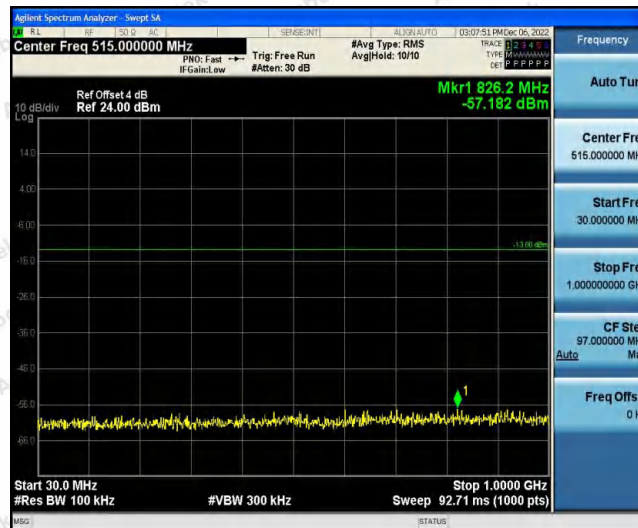

Band2-10MHz-16QAM-19150-1RB#0-Range2:1000~20000MHz

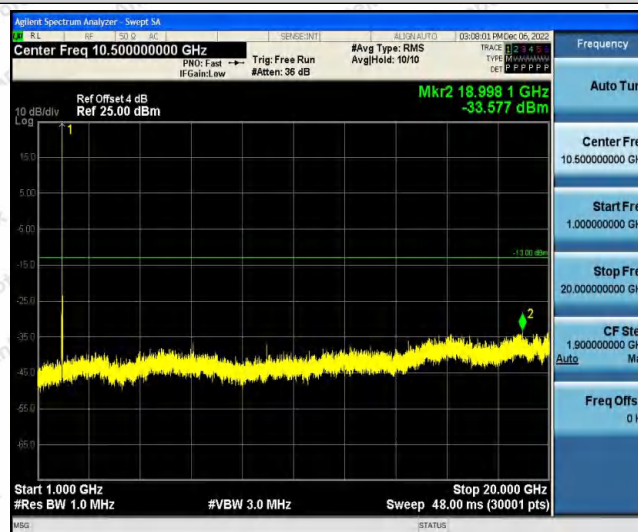

Band2-15MHz-QPSK-18675-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




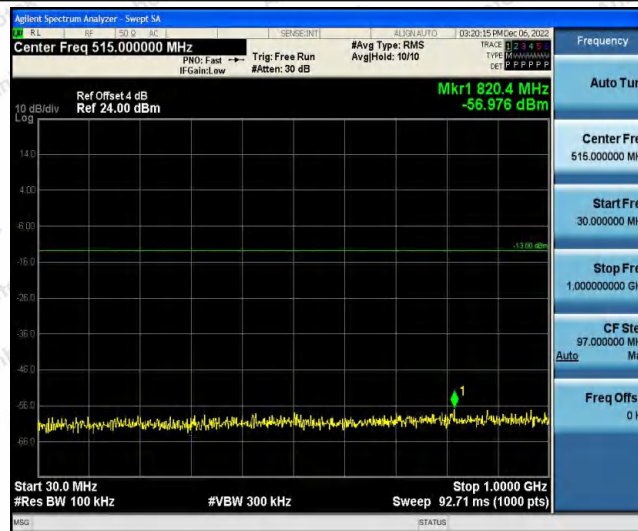

Band2-15MHz-QPSK-18675-1RB#0-Range2:1000~20000MHz



Band2-15MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

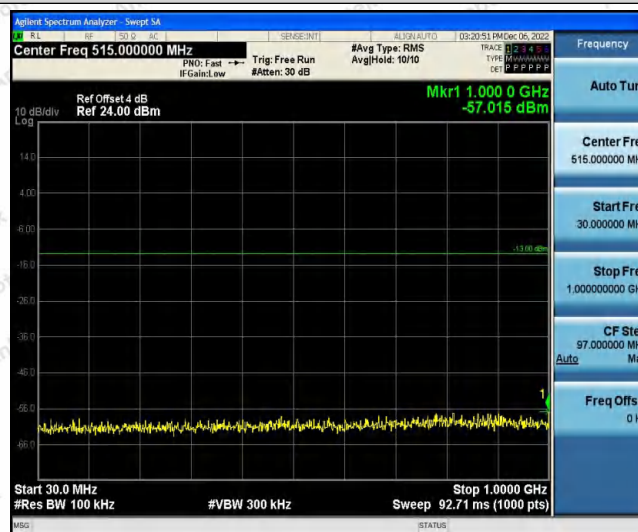

Band2-15MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




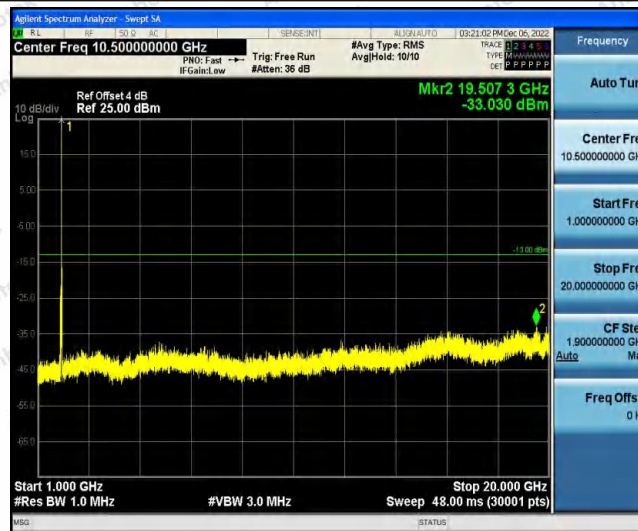

Band2-15MHz-QPSK-19125-1RB#0-Range1:30~1000MHz

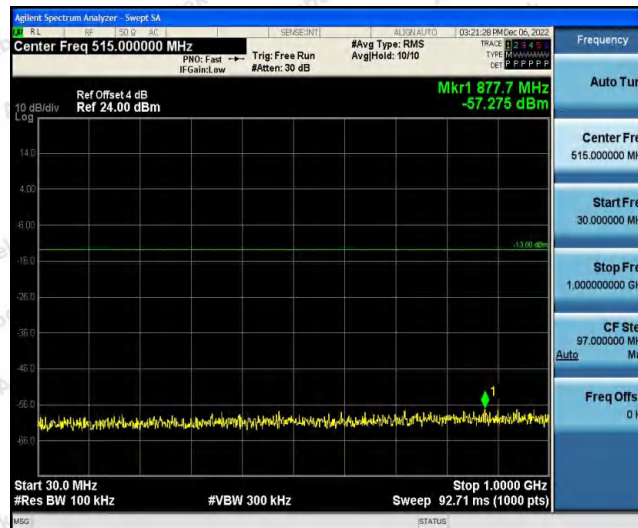

Band2-15MHz-QPSK-19125-1RB#0-Range2:1000~20000MHz

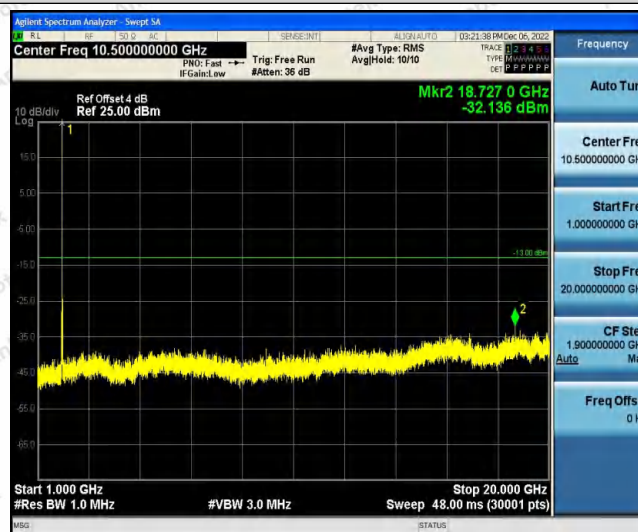

Band2-15MHz-16QAM-18675-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




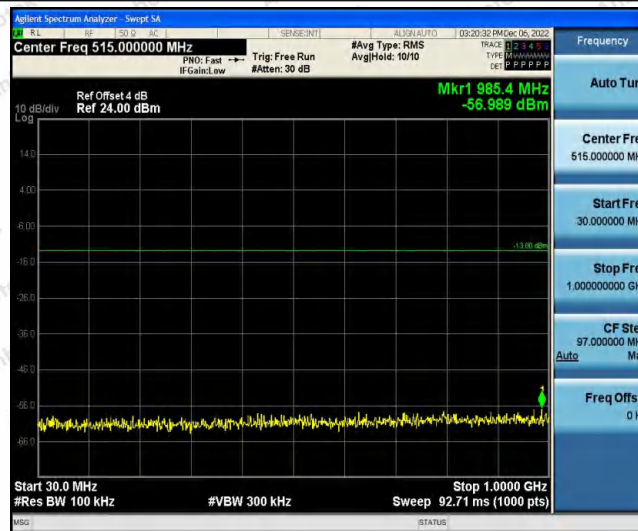

Band2-15MHz-16QAM-18675-1RB#0-Range2:1000~20000MHz

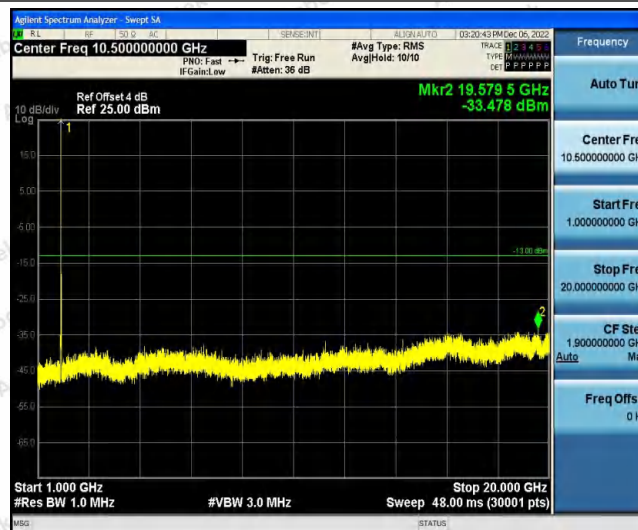

Band2-15MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

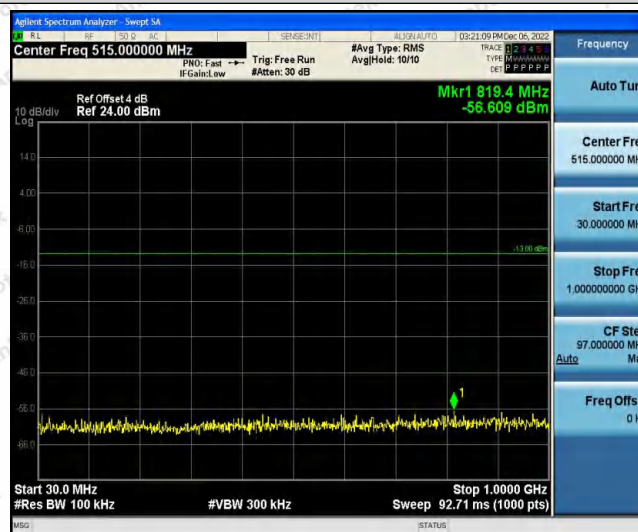

Band2-15MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band2-15MHz-16QAM-19125-1RB#0-Range1:30~1000MHz

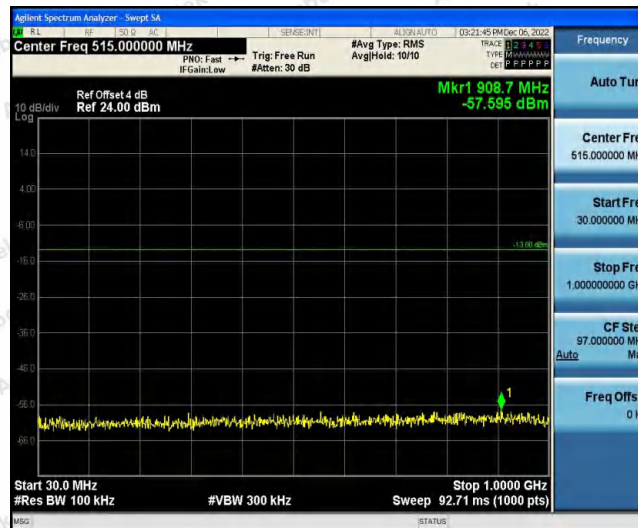

Band2-15MHz-16QAM-19125-1RB#0-Range2:1000~20000MHz

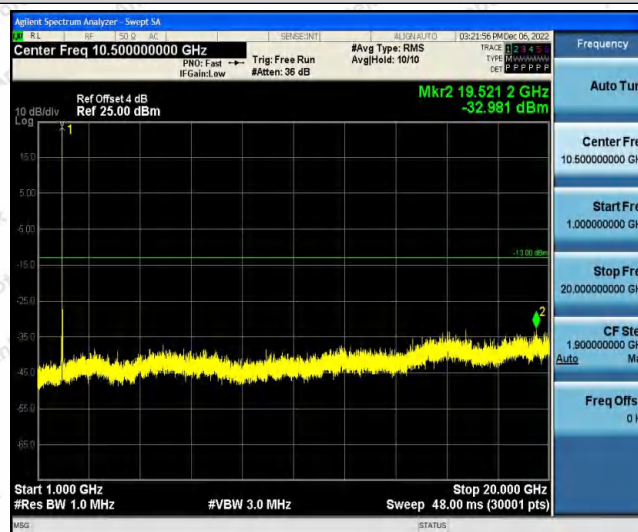

Band2-20MHz-QPSK-18700-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




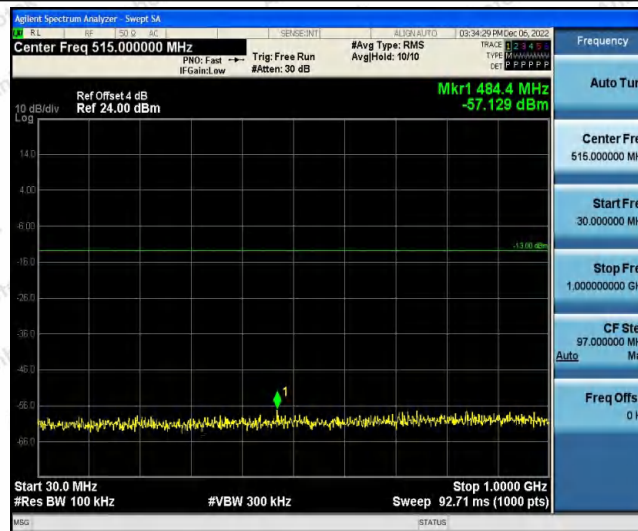

Band2-20MHz-QPSK-18700-1RB#0-Range2:1000~20000MHz



Band2-20MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

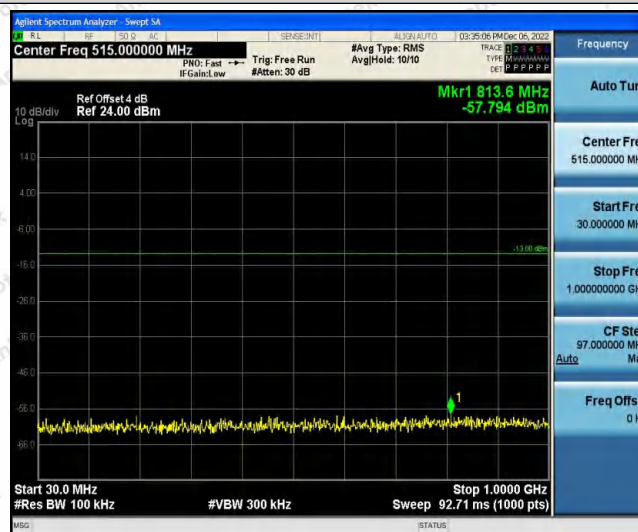

Band2-20MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




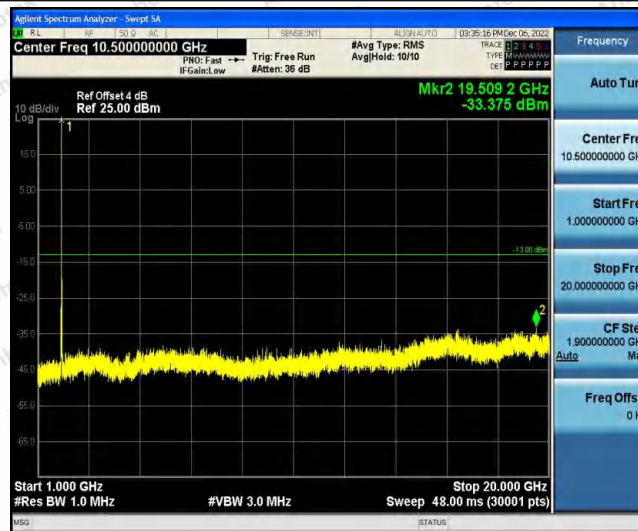

Band2-20MHz-QPSK-19100-1RB#0-Range1:30~1000MHz

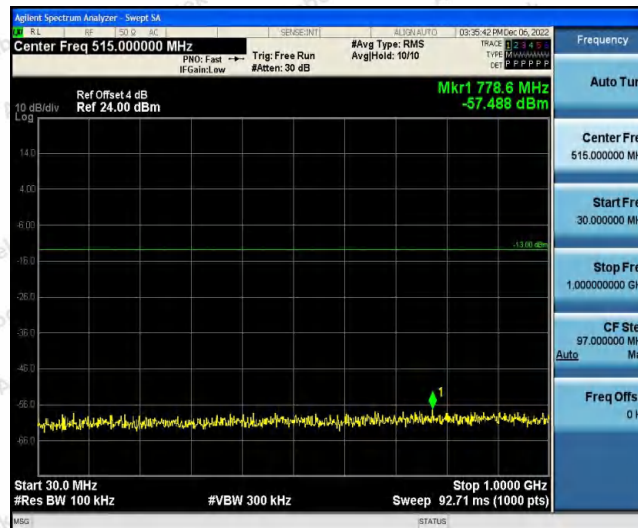

Band2-20MHz-QPSK-19100-1RB#0-Range2:1000~20000MHz

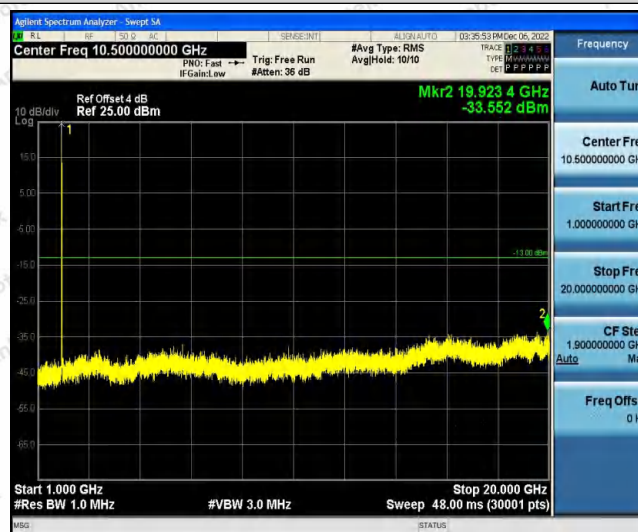

Band2-20MHz-16QAM-18700-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




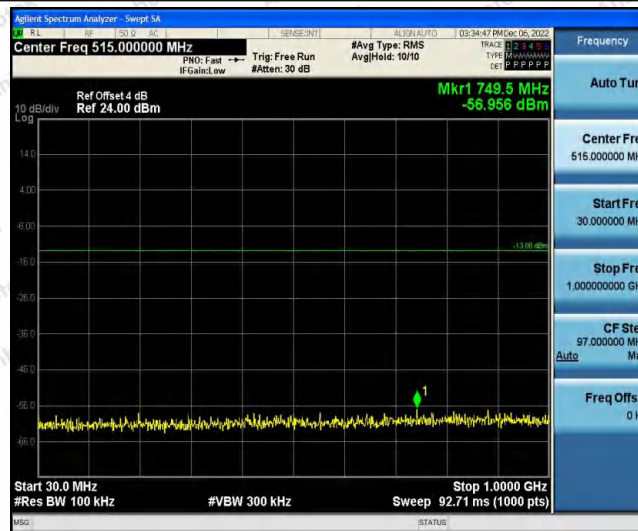

Band2-20MHz-16QAM-18700-1RB#0-Range2:1000~20000MHz

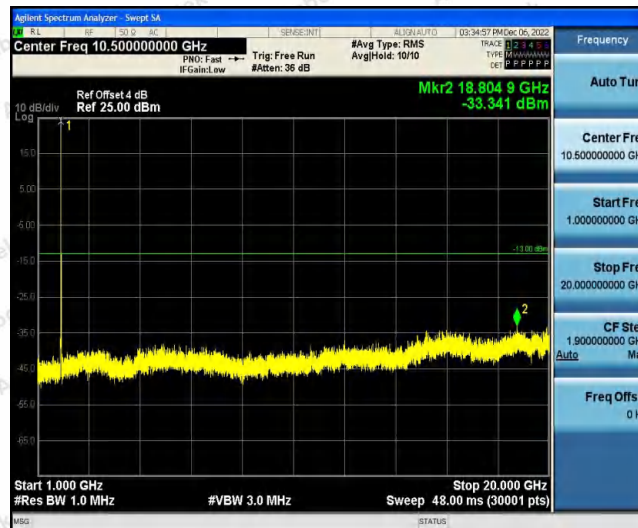

Band2-20MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

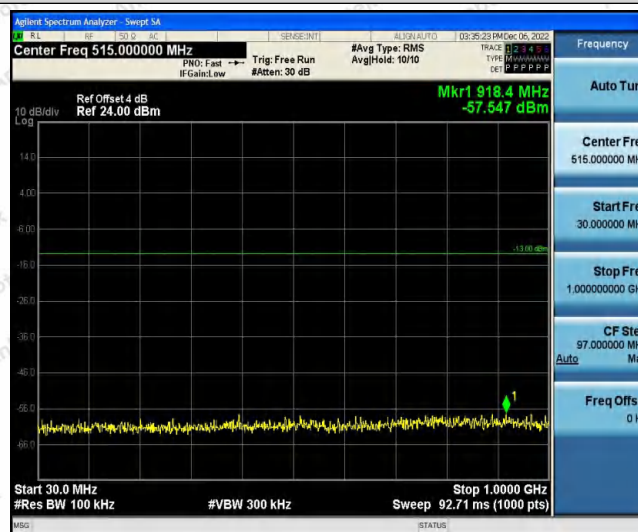

Band2-20MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




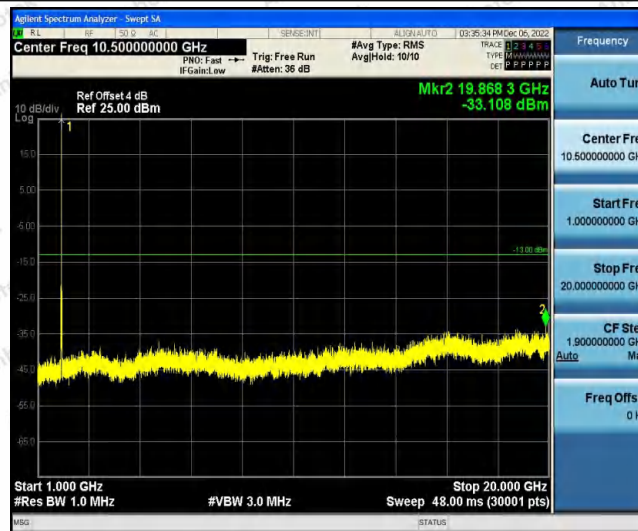

Band2-20MHz-16QAM-19100-1RB#0-Range1:30~1000MHz

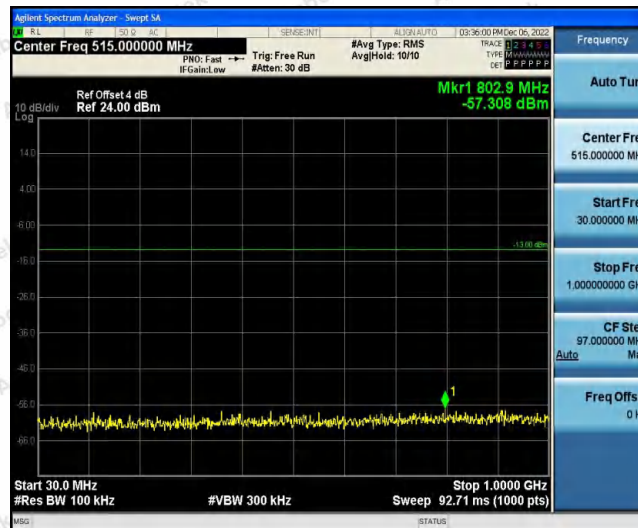

Band2-20MHz-16QAM-19100-1RB#0-Range2:1000~20000MHz

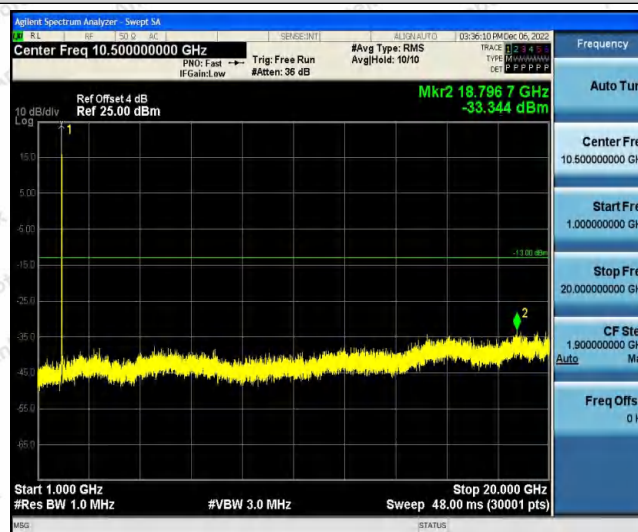

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-8.55	-0.004620	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-10.51	-0.005679	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-3.10	-0.001675	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-10.89	-0.005793	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-16.18	-0.008606	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-16.35	-0.008697	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-13.03	-0.006824	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-4.53	-0.002373	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-2.79	-0.001461	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-11.10	-0.005998	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-11.77	-0.006360	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-13.29	-0.007181	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-15.18	-0.008074	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-7.98	-0.004245	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-11.86	-0.006309	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	3.05	0.001597	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	-8.47	-0.004436	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	3.65	0.001912	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-9.80	-0.005293	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-14.61	-0.007891	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-17.45	-0.009425	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-19.27	-0.010250	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	-14.63	-0.007782	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-2.98	-0.001585	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	-14.42	-0.007556	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	-13.89	-0.007278	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	-15.85	-0.008305	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	-6.77	-0.003656	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-6.12	-0.003305	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-15.42	-0.008328	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-14.31	-0.007612	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-12.45	-0.006622	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	-13.36	-0.007106	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	-5.85	-0.003065	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band2	3MHz	16QAM	19185	15RB#0	VN	NT	-14.41	-0.007550	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	-13.60	-0.007126	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-13.06	-0.007050	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-9.88	-0.005333	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-5.09	-0.002748	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-13.23	-0.007037	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-7.15	-0.003803	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-10.59	-0.005633	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	-11.22	-0.005882	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	-7.91	-0.004147	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	-9.48	-0.004970	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-13.83	-0.007466	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-10.49	-0.005663	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-13.03	-0.007034	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-7.05	-0.003750	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-6.95	-0.003697	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-14.20	-0.007553	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	-11.47	-0.006013	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	-11.10	-0.005819	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-16.49	-0.008645	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-8.84	-0.004765	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-11.07	-0.005968	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-7.45	-0.004016	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-14.23	-0.007569	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	-17.70	-0.009415	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-8.63	-0.004590	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	-9.33	-0.004898	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	-8.27	-0.004341	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	-10.23	-0.005370	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	-6.55	-0.003531	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	-6.68	-0.003601	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	-5.21	-0.002809	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	-8.38	-0.004457	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	-8.63	-0.004590	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	-10.51	-0.005590	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	-14.03	-0.007365	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	-10.54	-0.005533	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	-9.66	-0.005071	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-13.98	-0.007526	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-9.71	-0.005227	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-8.03	-0.004323	±2.5	PASS



Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-14.78	-0.007862	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-7.21	-0.003835	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-9.18	-0.004883	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-11.99	-0.006302	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-6.24	-0.003280	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-8.01	-0.004210	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	-5.99	-0.003225	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	-11.63	-0.006261	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	-4.86	-0.002616	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	-9.68	-0.005149	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	-6.81	-0.003622	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	-10.30	-0.005479	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	-8.93	-0.004694	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	-14.76	-0.007758	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	-12.97	-0.006817	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	-8.91	-0.004790	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	-7.58	-0.004075	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	-6.32	-0.003398	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-10.73	-0.005707	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	-8.75	-0.004654	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-3.66	-0.001947	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-9.38	-0.004937	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-7.67	-0.004037	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-12.12	-0.006379	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	-5.19	-0.002790	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	-4.48	-0.002409	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	-8.45	-0.004543	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	-9.78	-0.005202	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	-7.00	-0.003723	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	-9.23	-0.004910	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	-8.40	-0.004421	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	-7.64	-0.004021	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	-6.37	-0.003353	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	-5.51	-0.002977	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	-11.47	-0.006198	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-9.14	-0.004939	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	-8.83	-0.004771	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	-12.12	-0.006549	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-8.97	-0.004771	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	-9.51	-0.005059	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-11.30	-0.006011	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-11.07	-0.005888	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-9.71	-0.005165	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	-8.55	-0.004478	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	-8.77	-0.004593	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	-12.03	-0.006301	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	-4.29	-0.002247	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	-11.70	-0.006128	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-10.60	-0.005728	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	-12.67	-0.006846	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-15.31	-0.008273	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	-11.40	-0.006160	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-13.66	-0.007381	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	-14.48	-0.007702	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-10.53	-0.005601	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-10.90	-0.005798	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-17.27	-0.009186	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-7.41	-0.003941	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	-6.29	-0.003294	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	-11.56	-0.006055	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	-10.46	-0.005478	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	-3.09	-0.001618	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	-9.24	-0.004839	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	-14.10	-0.007615	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	-9.81	-0.005298	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	-16.24	-0.008771	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-13.18	-0.007119	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	-13.46	-0.007270	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band2	3MHz	QPSK	18900	15RB#0	NV	-30	-8.15	-0.004335	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	5.48	0.002915	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-3.82	-0.002032	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	-12.43	-0.006612	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	-4.43	-0.002356	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	-15.59	-0.008169	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	-15.09	-0.007907	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	-13.52	-0.007084	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	-13.63	-0.007142	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	-14.83	-0.007771	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	-6.82	-0.003683	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-16.45	-0.008885	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	-12.56	-0.006784	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	-7.01	-0.003786	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	-12.10	-0.006535	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	-14.79	-0.007867	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	-7.50	-0.003989	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	-4.88	-0.002596	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	-10.40	-0.005532	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	-13.52	-0.007191	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	-13.15	-0.006890	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	-8.93	-0.004679	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	-11.29	-0.005916	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	-2.62	-0.001373	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	-6.79	-0.003558	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	-9.48	-0.005117	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	-12.17	-0.006570	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	-12.52	-0.006758	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	-7.82	-0.004221	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	-12.85	-0.006937	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-12.06	-0.006415	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	-8.51	-0.004527	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-8.87	-0.004718	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-8.01	-0.004261	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-9.61	-0.005112	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	-9.16	-0.004802	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	-11.67	-0.006118	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	-8.53	-0.004472	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	-13.76	-0.007214	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	-12.62	-0.006616	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	-11.96	-0.006456	±2.5	PASS



Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-8.61	-0.004648	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	-13.15	-0.007099	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	5.88	0.003174	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	-11.92	-0.006435	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	-10.36	-0.005511	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	-8.81	-0.004686	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	-8.45	-0.004495	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	-10.19	-0.005420	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	5.76	0.003064	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	-9.14	-0.004792	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	-13.98	-0.007329	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	-9.26	-0.004855	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	-7.74	-0.004058	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	-15.71	-0.008236	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-7.62	-0.004108	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-7.31	-0.003941	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	-3.93	-0.002119	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-6.22	-0.003353	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	4.31	0.002323	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-11.46	-0.006096	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-8.01	-0.004261	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-6.15	-0.003271	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-15.16	-0.008064	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	-5.19	-0.002761	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	-7.78	-0.004084	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	-10.39	-0.005454	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	-8.96	-0.004703	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	-8.65	-0.004541	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	-8.25	-0.004331	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	5.32	0.002868	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	-11.83	-0.006377	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	4.35	0.002345	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	-7.72	-0.004162	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	-7.27	-0.003919	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	-12.59	-0.006697	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	-8.48	-0.004511	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	-13.18	-0.007011	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	-13.28	-0.007064	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	-13.32	-0.007085	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	-8.33	-0.004373	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	-7.81	-0.004100	±2.5	PASS



Band2	10MHz	16QAM	19150	50RB#0	NV	0	-5.74	-0.003013	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	-7.35	-0.003858	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	-12.75	-0.006693	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	-9.88	-0.005319	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-10.27	-0.005529	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-11.72	-0.006310	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-13.09	-0.007047	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-9.68	-0.005211	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-7.44	-0.003957	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-8.13	-0.004324	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	-9.48	-0.005043	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-9.86	-0.005245	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-6.77	-0.003601	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-11.46	-0.006024	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-10.26	-0.005393	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-8.65	-0.004547	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-9.48	-0.004983	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-10.11	-0.005314	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	-3.98	-0.002143	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	-5.35	-0.002880	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	-4.99	-0.002686	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	-10.03	-0.005400	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	-12.19	-0.006563	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	-11.13	-0.005920	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	-11.99	-0.006378	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	-9.01	-0.004793	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	-12.99	-0.006910	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	-3.99	-0.002122	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	-9.26	-0.004867	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	-13.16	-0.006917	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	-9.77	-0.005135	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	-13.49	-0.007091	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	-15.68	-0.008242	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	-6.09	-0.003274	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	-9.40	-0.005054	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	-9.68	-0.005204	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	-5.94	-0.003194	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	-8.78	-0.004720	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	-6.77	-0.003601	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-6.67	-0.003548	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	-5.68	-0.003021	±2.5	PASS



Band2	20MHz	QPSK	18900	100RB#0	NV	10	-3.36	-0.001787	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	-3.45	-0.001835	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-8.78	-0.004621	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-8.93	-0.004700	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-13.99	-0.007363	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	-8.04	-0.004232	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-12.76	-0.006716	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	-5.84	-0.003140	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	-6.81	-0.003661	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	-9.86	-0.005301	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	6.75	0.003629	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	-9.98	-0.005366	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	-7.11	-0.003782	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	-11.09	-0.005899	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	-8.90	-0.004734	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	-12.97	-0.006899	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	-7.75	-0.004122	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	-11.43	-0.006016	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	-9.27	-0.004879	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	-12.13	-0.006384	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	-13.09	-0.006889	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	-9.66	-0.005084	±2.5	PASS

---End---

