


Band66-3MHz-QPSK-132657-15RB#0



Band66-3MHz-16QAM-131987-15RB#0

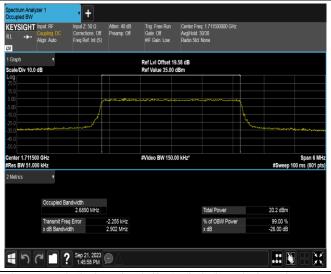


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.









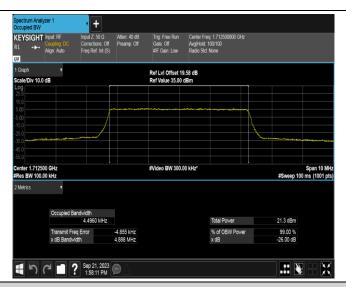

Band66-5MHz-QPSK-132322-25RB#0

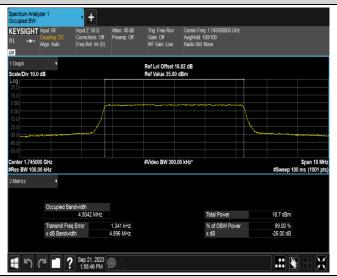


Band66-5MHz-QPSK-132647-25RB#0

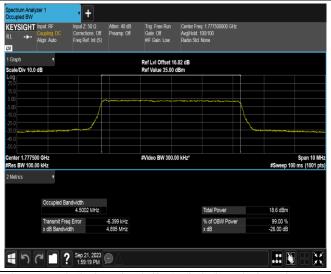

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.




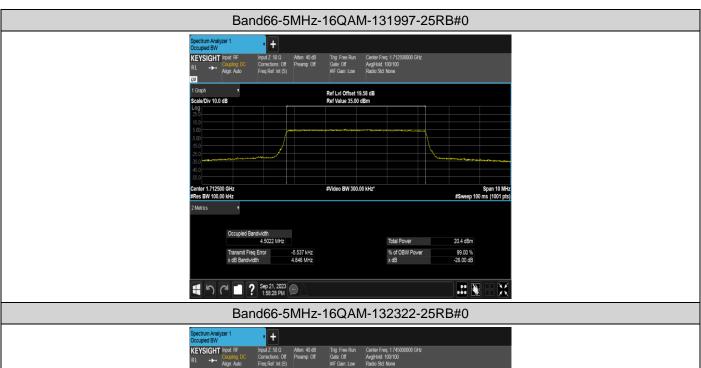



Band66-5MHz-16QAM-132647-25RB#0




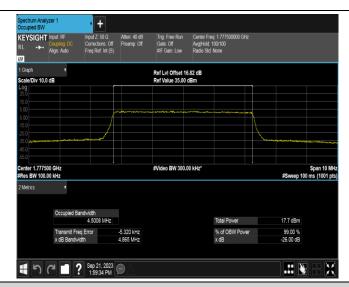

Band66-10MHz-QPSK-132022-50RB#0



Band66-10MHz-QPSK-132322-50RB#0

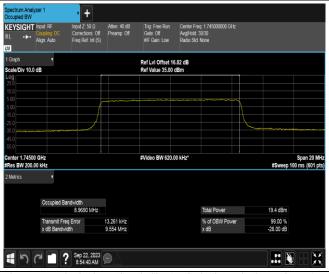


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.








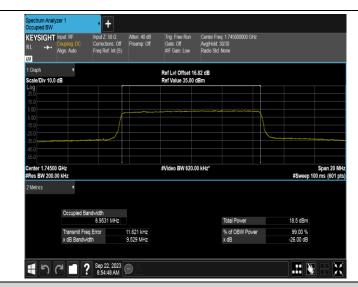

Band66-10MHz-16QAM-132622-50RB#0



Band66-15MHz-QPSK-132047-75RB#0

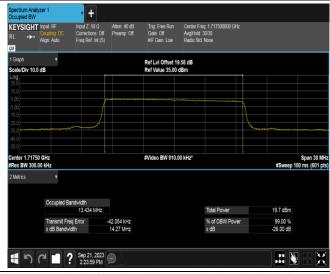


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.








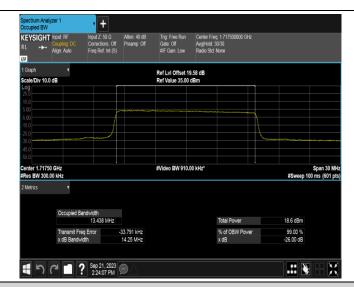

Band66-15MHz-16QAM-132322-75RB#0




Band66-15MHz-16QAM-132597-75RB#0

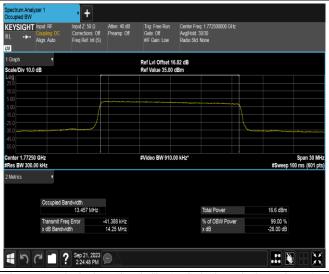

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.




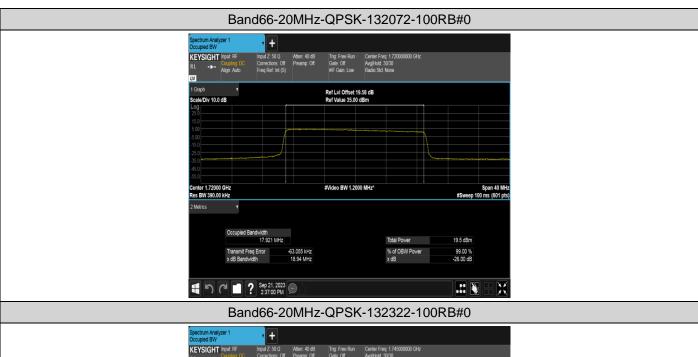



Band66-20MHz-QPSK-132572-100RB#0




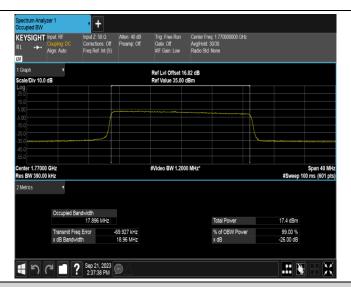

Band66-20MHz-16QAM-132072-100RB#0




Band66-20MHz-16QAM-132322-100RB#0

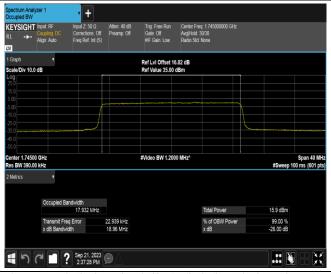

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



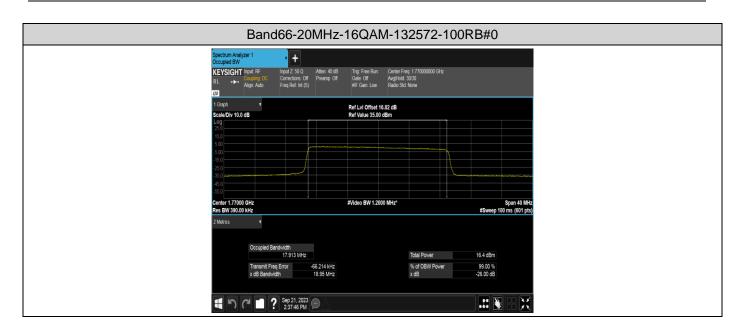



Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	-19.34	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	-29.14	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	-24.39	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	-33.83	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	-20.52	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	-26.68	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	-18.54	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	-29.00	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	-25.68	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	-34.95	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	-22.71	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	-29.17	PASS
Band66	3MHz	QPSK	131987	1RB#0	-15.78	PASS
Band66	3MHz	QPSK	131987	1RB#14	-37.97	PASS
Band66	3MHz	QPSK	131987	15RB#0	-24.71	PASS
Band66	3MHz	QPSK	132657	1RB#0	-41.93	PASS
Band66	3MHz	QPSK	132657	1RB#14	-16.31	PASS
Band66	3MHz	QPSK	132657	15RB#0	-27.27	PASS
Band66	3MHz	16QAM	131987	1RB#0	-14.38	PASS
Band66	3MHz	16QAM	131987	1RB#14	-38.73	PASS
Band66	3MHz	16QAM	131987	15RB#0	-23.91	PASS
Band66	3MHz	16QAM	132657	1RB#0	-42.23	PASS
Band66	3MHz	16QAM	132657	1RB#14	-17.47	PASS
Band66	3MHz	16QAM	132657	15RB#0	-28.50	PASS
Band66	5MHz	QPSK	131997	1RB#0	-15.01	PASS
Band66	5MHz	QPSK	131997	1RB#24	-38.22	PASS
Band66	5MHz	QPSK	131997	25RB#0	-24.69	PASS
Band66	5MHz	QPSK	132647	1RB#0	-41.08	PASS
Band66	5MHz	QPSK	132647	1RB#24	-17.98	PASS
Band66	5MHz	QPSK	132647	25RB#0	-28.53	PASS
Band66	5MHz	16QAM	131997	1RB#0	-17.32	PASS
Band66	5MHz	16QAM	131997	1RB#24	-38.34	PASS
Band66	5MHz	16QAM	131997	25RB#0	-25.05	PASS
Band66	5MHz	16QAM	132647	1RB#0	-40.85	PASS



Band66	5MHz	16QAM	132647	1RB#24	-18.43	PASS
Band66	5MHz	16QAM	132647	25RB#0	-27.41	PASS
Band66	10MHz	QPSK	132022	1RB#0	-19.90	PASS
Band66	10MHz	QPSK	132022	1RB#49	-36.54	PASS
Band66	10MHz	QPSK	132022	50RB#0	-24.98	PASS
Band66	10MHz	QPSK	132622	1RB#0	-39.11	PASS
Band66	10MHz	QPSK	132622	1RB#49	-22.78	PASS
Band66	10MHz	QPSK	132622	50RB#0	-25.08	PASS
Band66	10MHz	16QAM	132022	1RB#0	-21.06	PASS
Band66	10MHz	16QAM	132022	1RB#49	-36.74	PASS
Band66	10MHz	16QAM	132022	50RB#0	-25.81	PASS
Band66	10MHz	16QAM	132622	1RB#0	-39.10	PASS
Band66	10MHz	16QAM	132622	1RB#49	-22.03	PASS
Band66	10MHz	16QAM	132622	50RB#0	-26.06	PASS
Band66	15MHz	QPSK	132047	1RB#0	-22.92	PASS
Band66	15MHz	QPSK	132047	1RB#74	-35.20	PASS
Band66	15MHz	QPSK	132047	75RB#0	-28.41	PASS
Band66	15MHz	QPSK	132597	1RB#0	-38.04	PASS
Band66	15MHz	QPSK	132597	1RB#74	-24.84	PASS
Band66	15MHz	QPSK	132597	75RB#0	-32.87	PASS
Band66	15MHz	16QAM	132047	1RB#0	-22.15	PASS
Band66	15MHz	16QAM	132047	1RB#74	-35.24	PASS
Band66	15MHz	16QAM	132047	75RB#0	-29.24	PASS
Band66	15MHz	16QAM	132597	1RB#0	-37.63	PASS
Band66	15MHz	16QAM	132597	1RB#74	-24.11	PASS
Band66	15MHz	16QAM	132597	75RB#0	-33.94	PASS
Band66	20MHz	QPSK	132072	1RB#0	-23.90	PASS
Band66	20MHz	QPSK	132072	1RB#99	-34.47	PASS
Band66	20MHz	QPSK	132072	100RB#0	-28.00	PASS
Band66	20MHz	QPSK	132572	1RB#0	-36.84	PASS
Band66	20MHz	QPSK	132572	1RB#99	-26.98	PASS
Band66	20MHz	QPSK	132572	100RB#0	-33.52	PASS
Band66	20MHz	16QAM	132072	1RB#0	-24.40	PASS
Band66	20MHz	16QAM	132072	1RB#99	-34.30	PASS
Band66	20MHz	16QAM	132072	100RB#0	-28.17	PASS
Band66	20MHz	16QAM	132572	1RB#0	-36.79	PASS
Band66	20MHz	16QAM	132572	1RB#99	-26.20	PASS
Band66	20MHz	16QAM	132572	100RB#0	-33.45	PASS



Test Graphs







Band66-1.4MHz-QPSK-132665-1RB#0




Band66-1.4MHz-QPSK-132665-1RB#5



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Web: http://www.agccert.com/



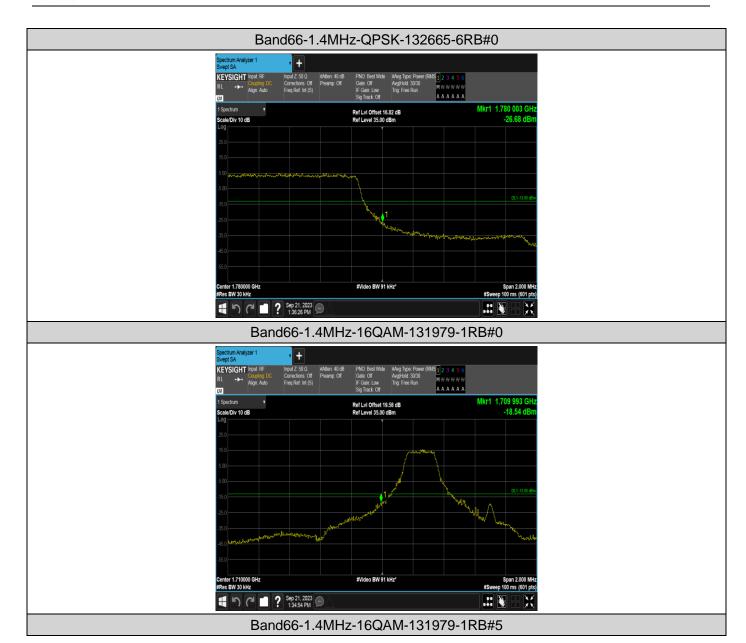





Band66-1.4MHz-16QAM-131979-6RB#0




Band66-1.4MHz-16QAM-132665-1RB#0










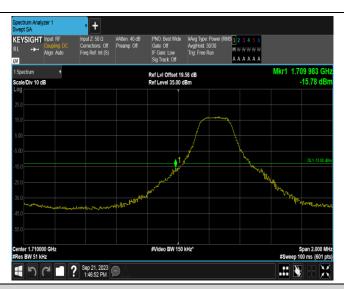

Band66-3MHz-QPSK-131987-1RB#14

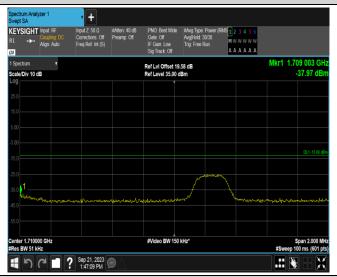


Band66-3MHz-QPSK-131987-15RB#0



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.




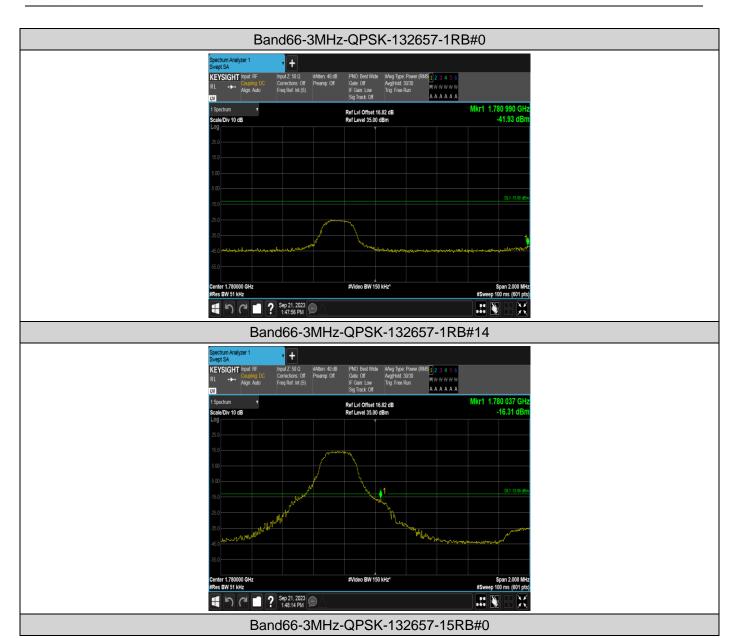






Band66-3MHz-16QAM-131987-1RB#0

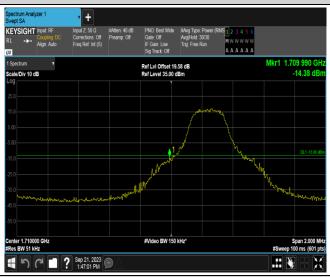

Band66-3MHz-16QAM-131987-1RB#14

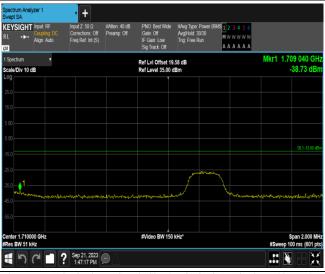


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.








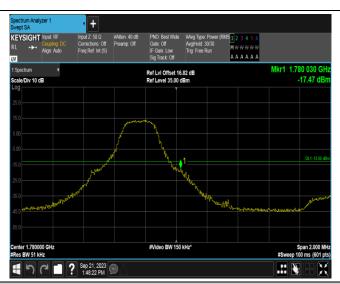

Band66-3MHz-16QAM-132657-15RB#0




Band66-5MHz-QPSK-131997-1RB#0

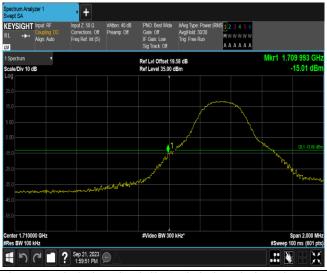

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



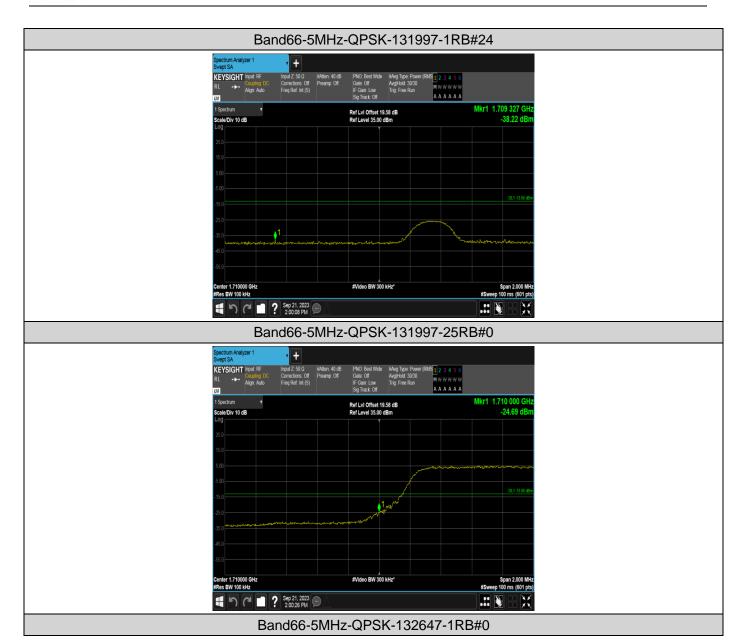





Band66-5MHz-QPSK-132647-1RB#24




Band66-5MHz-QPSK-132647-25RB#0



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



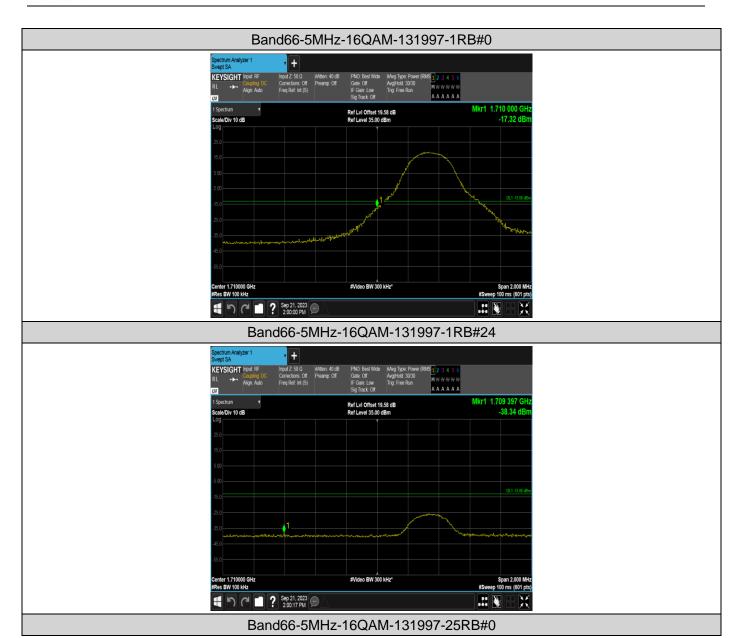






Band66-5MHz-16QAM-132647-1RB#0




Band66-5MHz-16QAM-132647-1RB#24

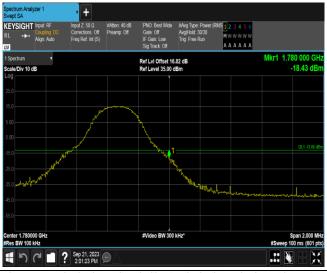

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



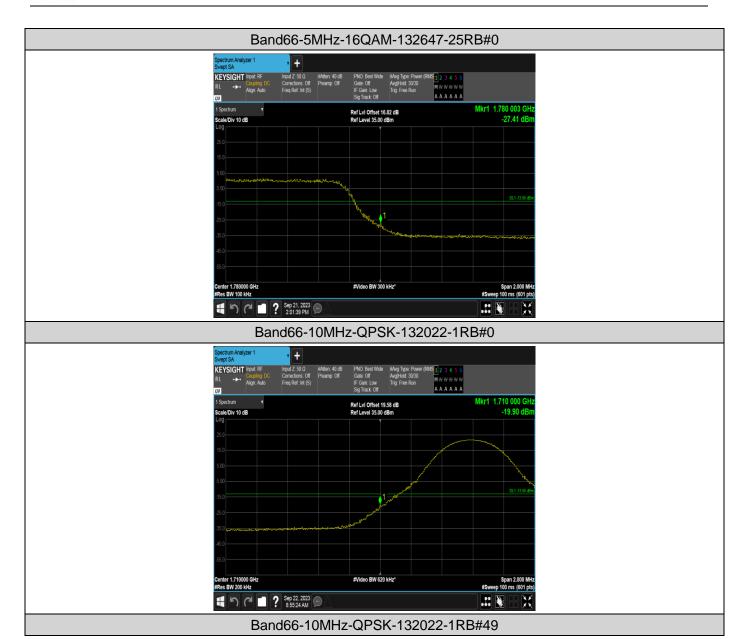





Band66-10MHz-QPSK-132022-50RB#0




Band66-10MHz-QPSK-132622-1RB#0



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



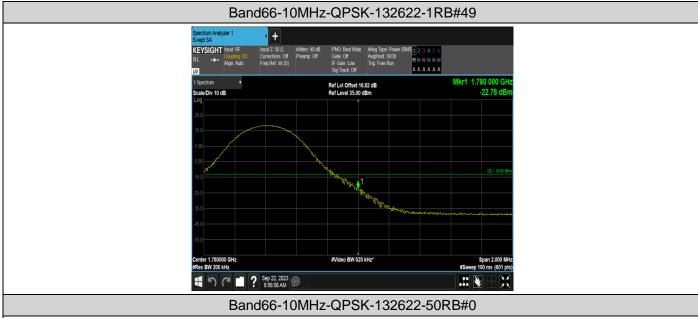





Band66-10MHz-16QAM-132022-1RB#0





Band66-10MHz-16QAM-132022-1RB#49




Band66-10MHz-16QAM-132022-50RB#0



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



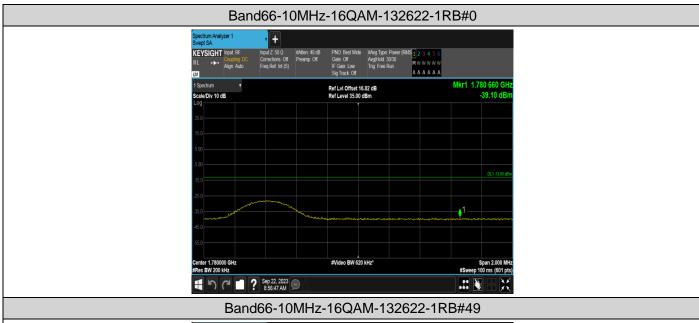



Band66-10MHz-16QAM-132622-50RB#0





Band66-15MHz-QPSK-132047-1RB#0




Band66-15MHz-QPSK-132047-1RB#74



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



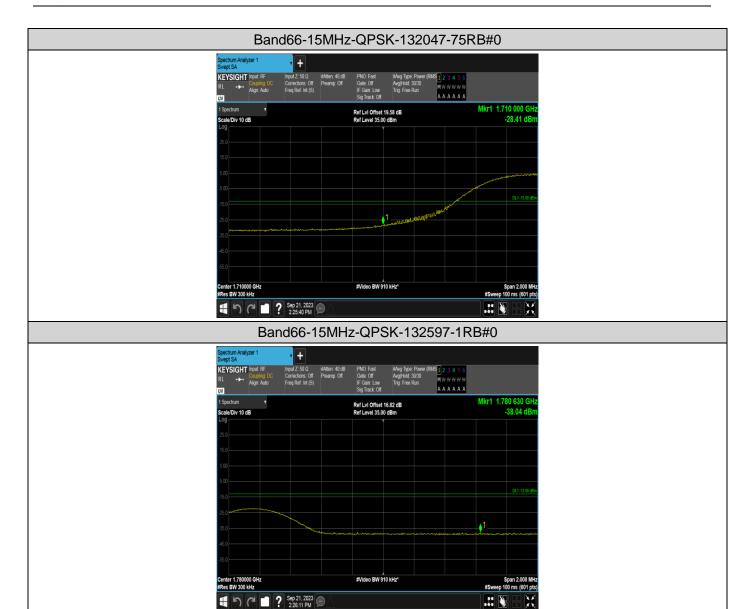

Band66-15MHz-QPSK-132597-1RB#74





Band66-15MHz-QPSK-132597-75RB#0



Band66-15MHz-16QAM-132047-1RB#0



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.