





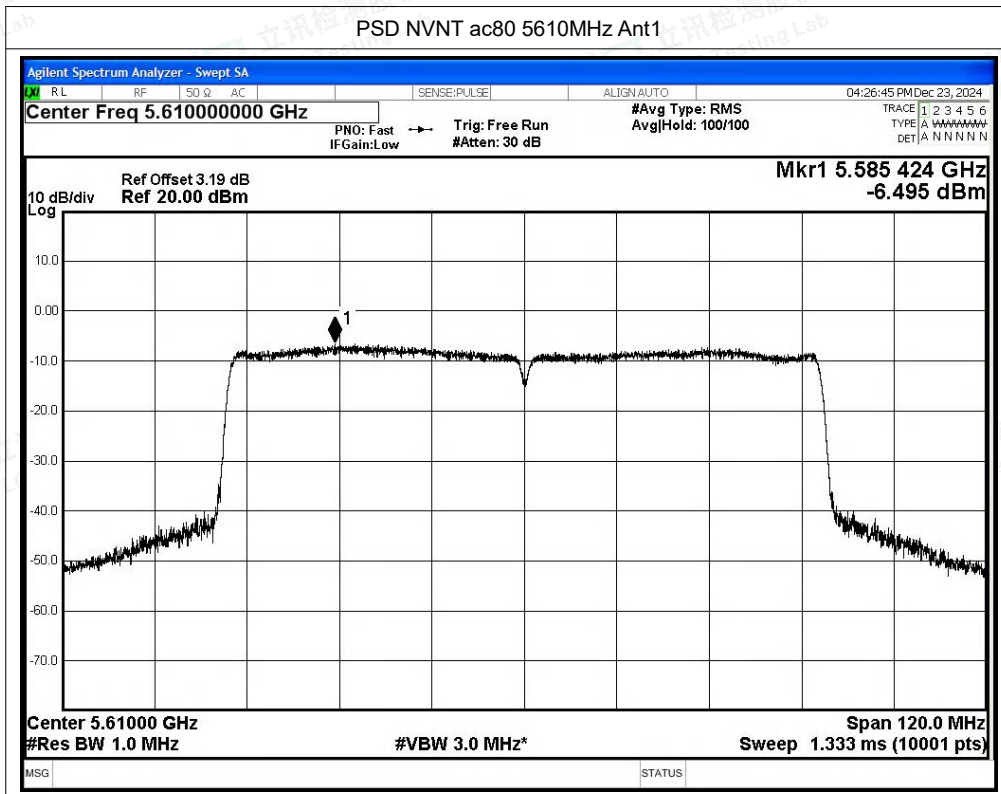


Test Graphs

PSD NVNT a 5500MHz Ant2

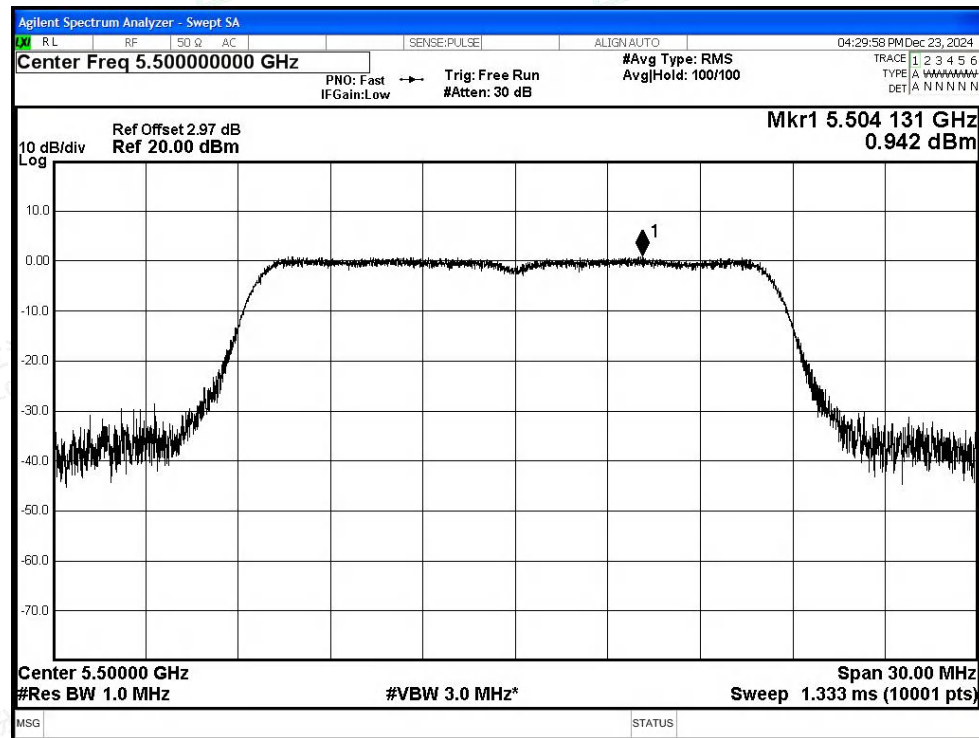


PSD NVNT a 5580MHz Ant2

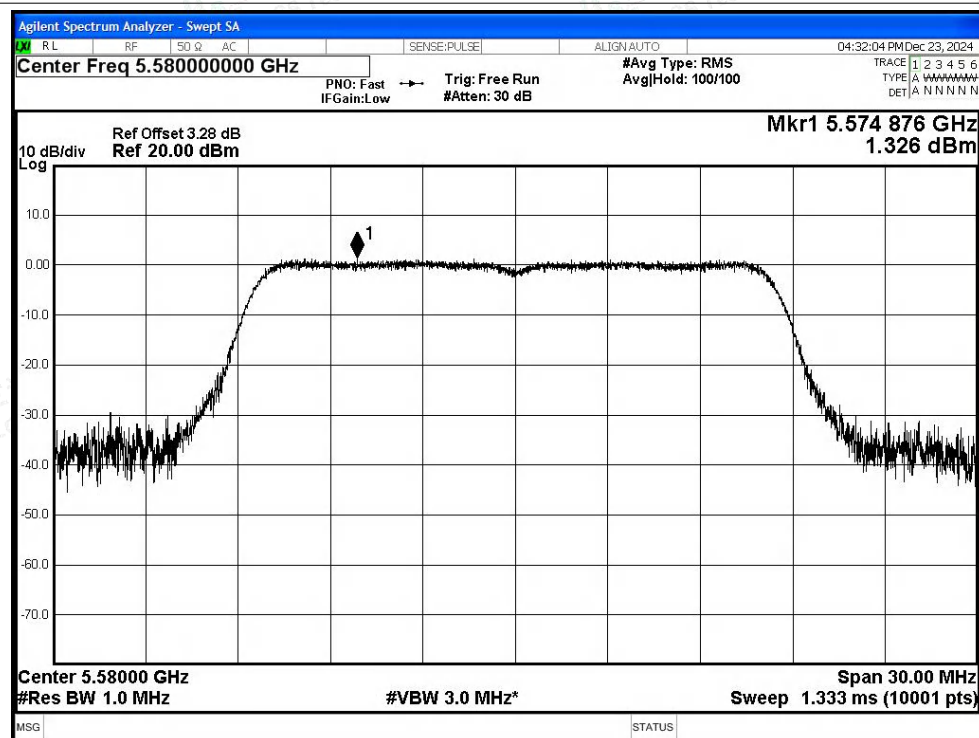








PSD NVNT a 5700MHz Ant2

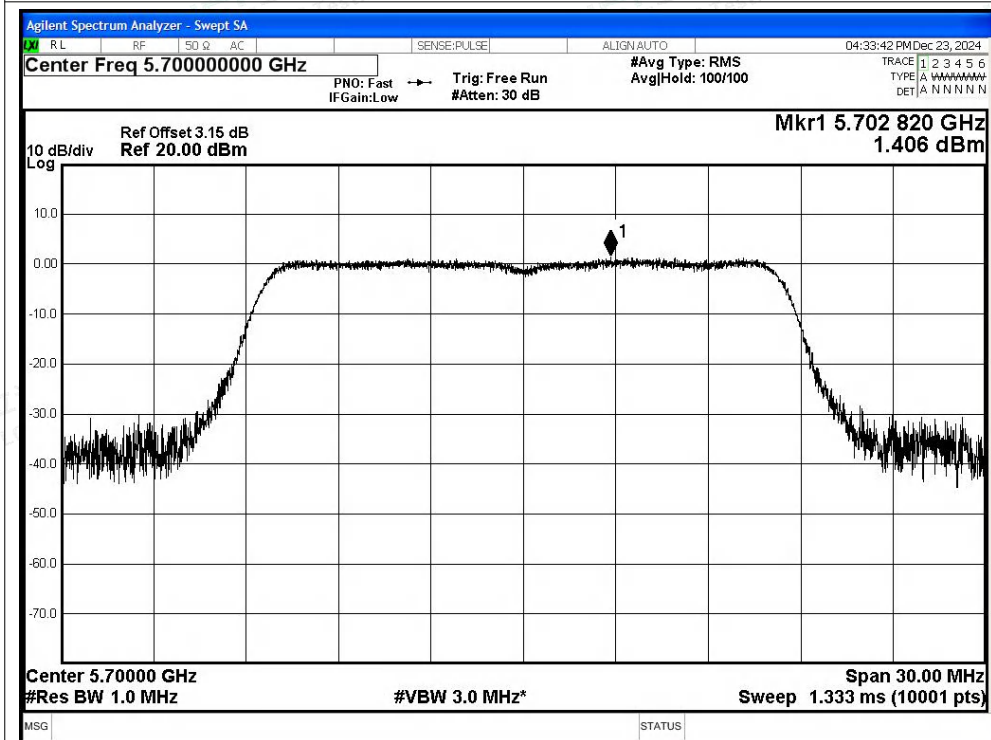

PSD NVNT n20 5500MHz Ant2

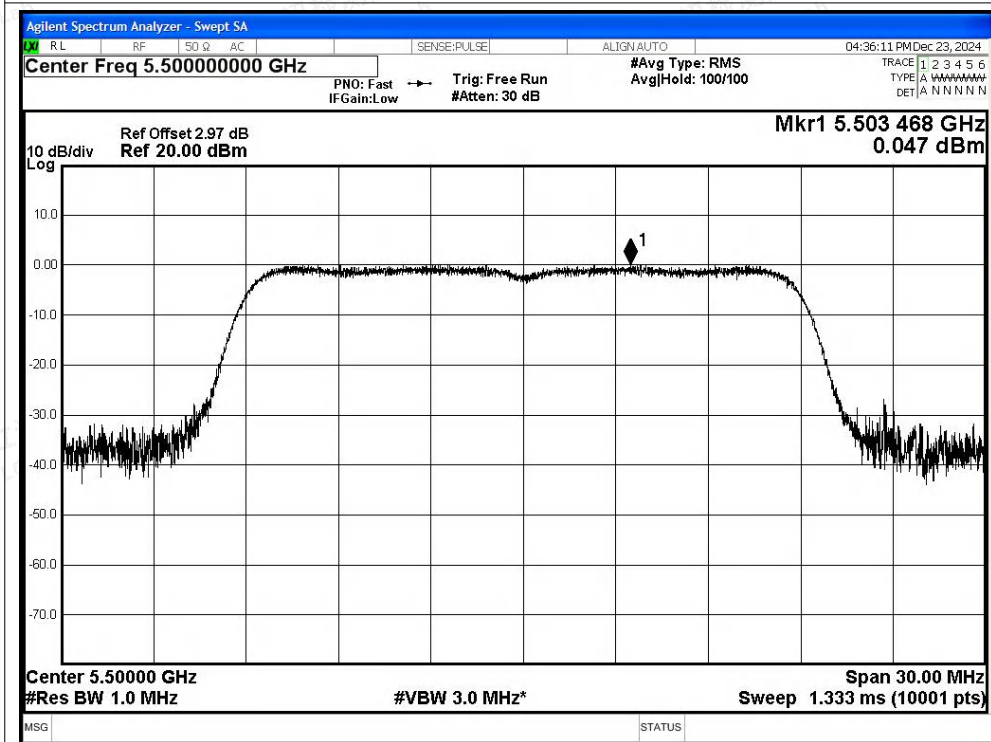

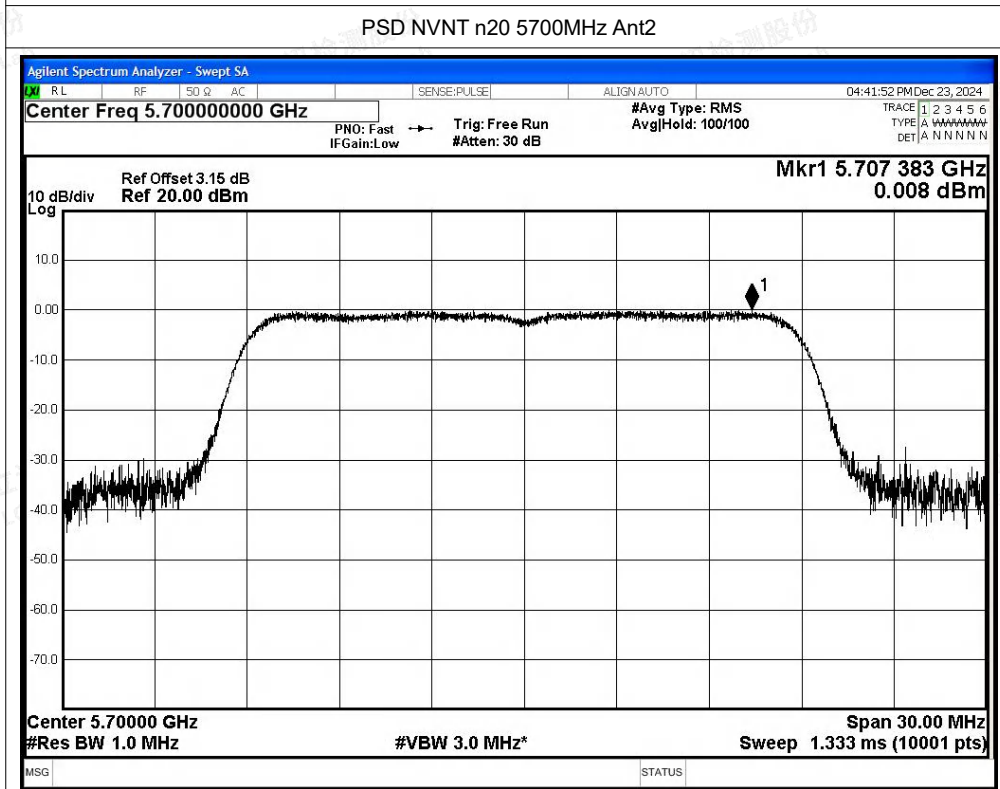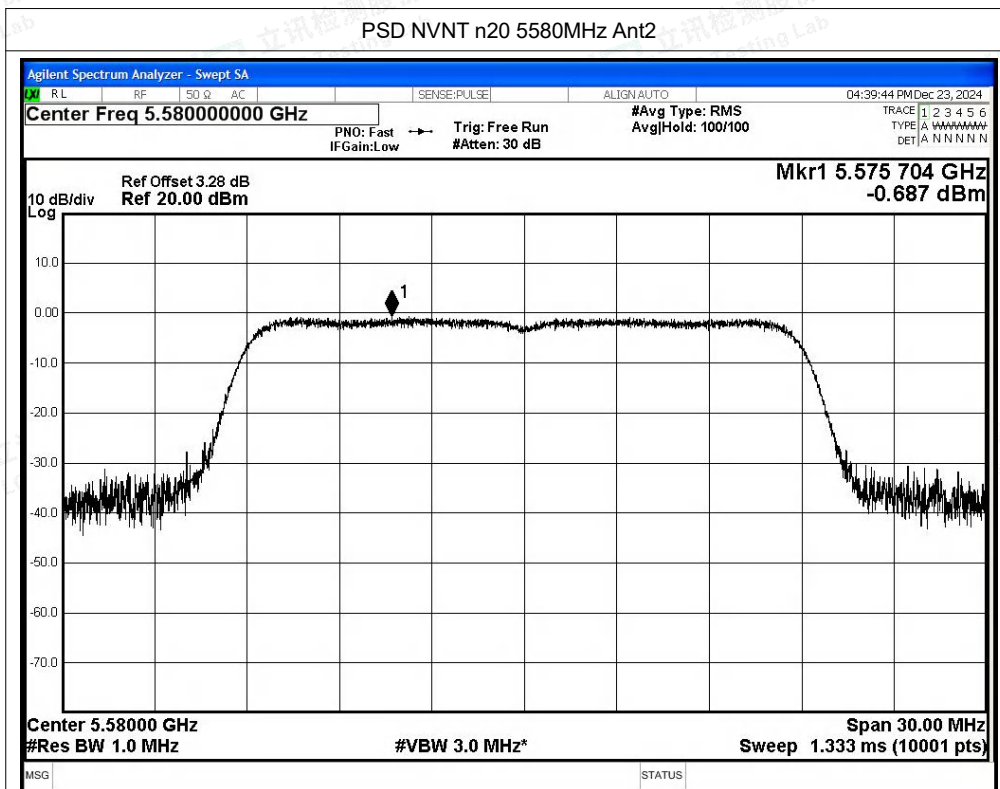

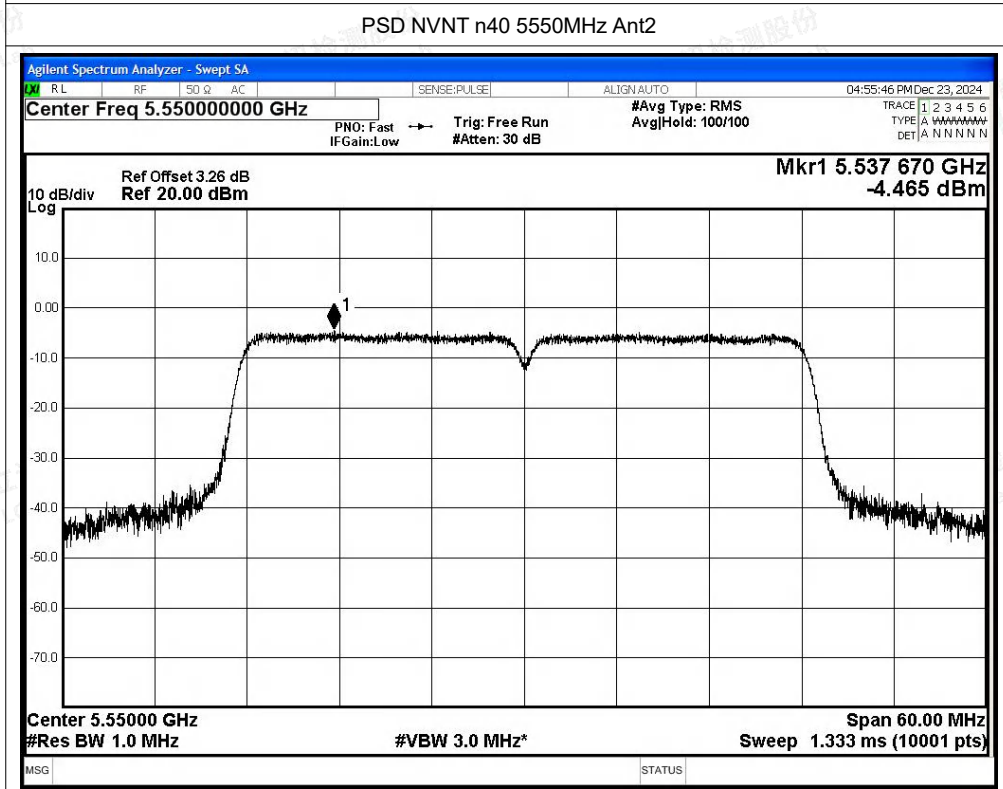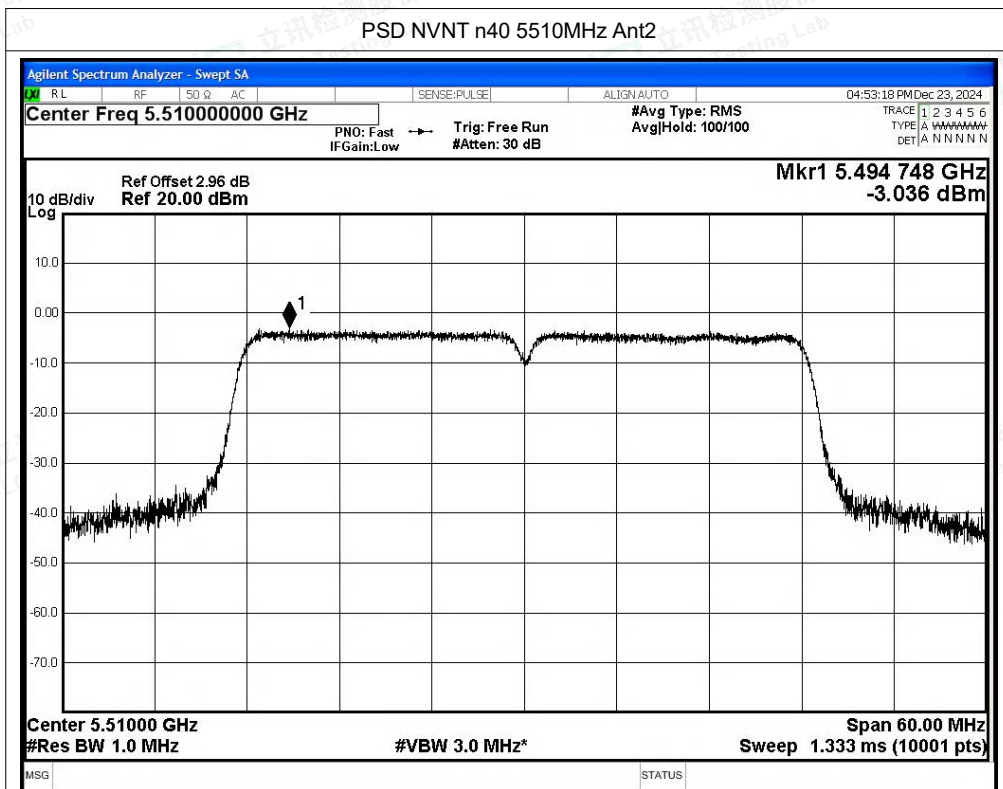

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT n40 5670MHz Ant2

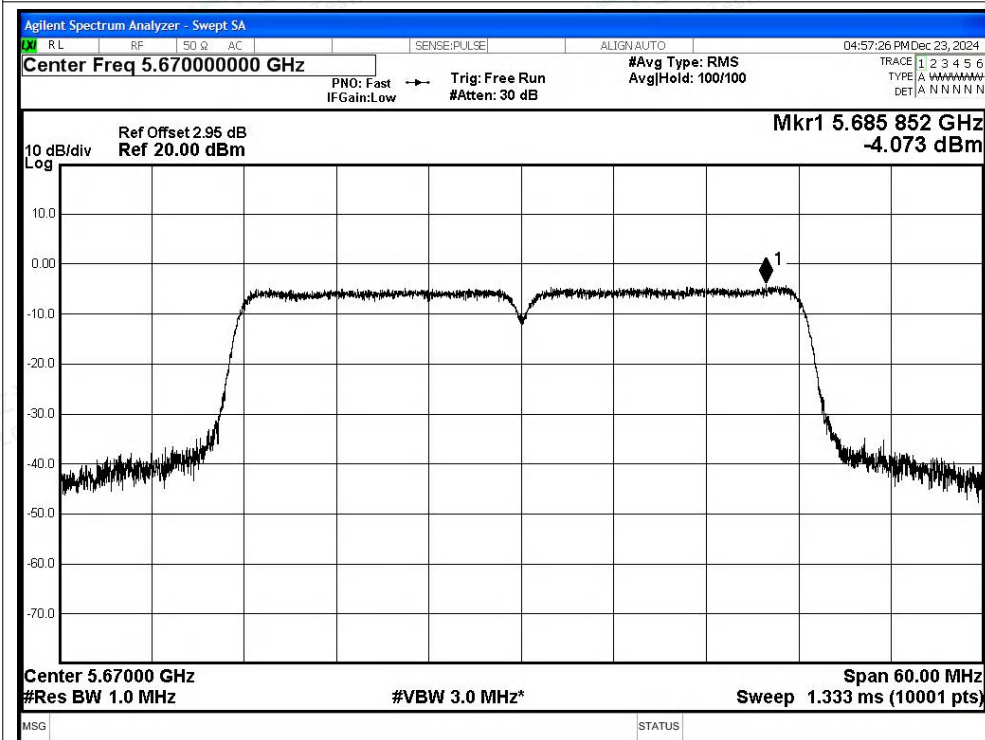

PSD NVNT ac20 5500MHz Ant2

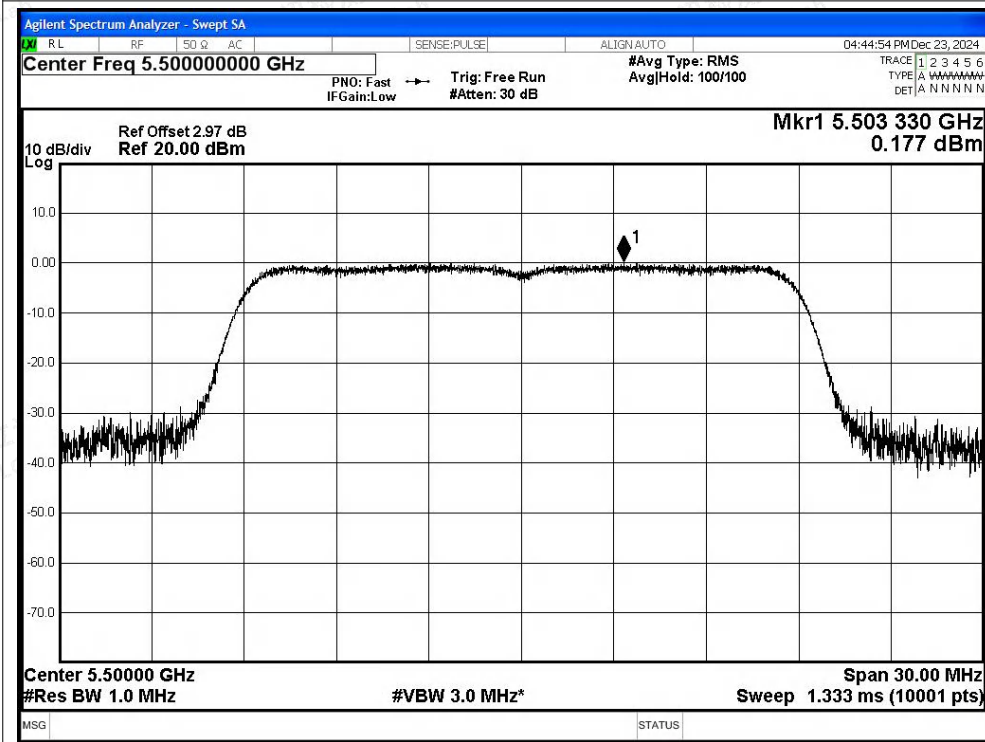

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity





PSD NVNT ac20 5580MHz Ant2

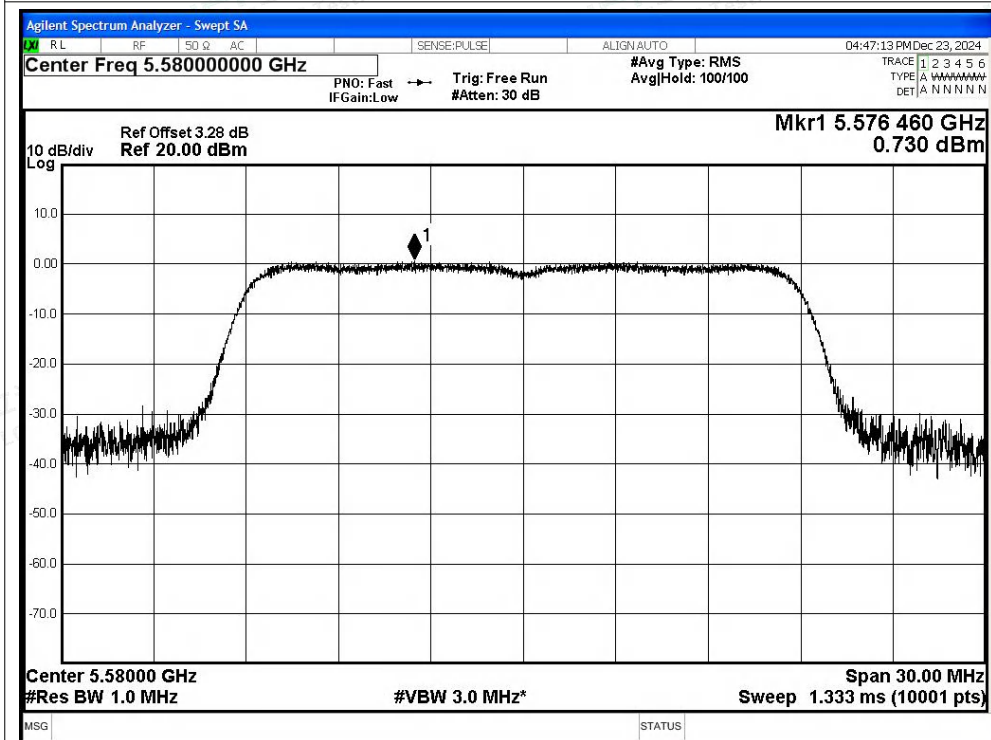


PSD NVNT ac20 5700MHz Ant2

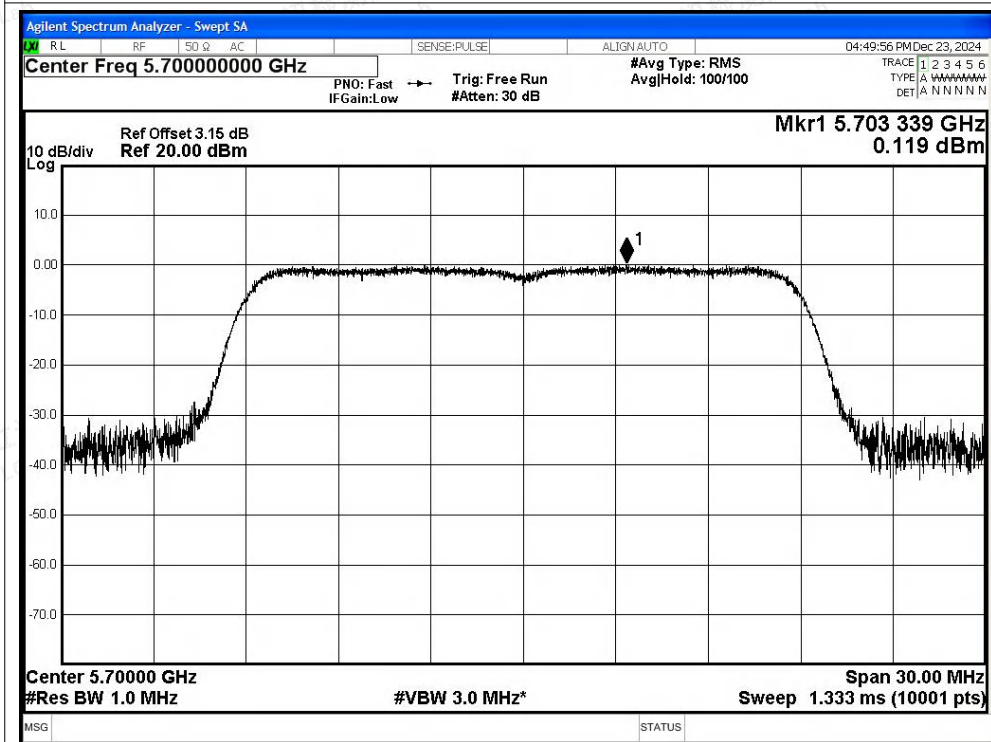

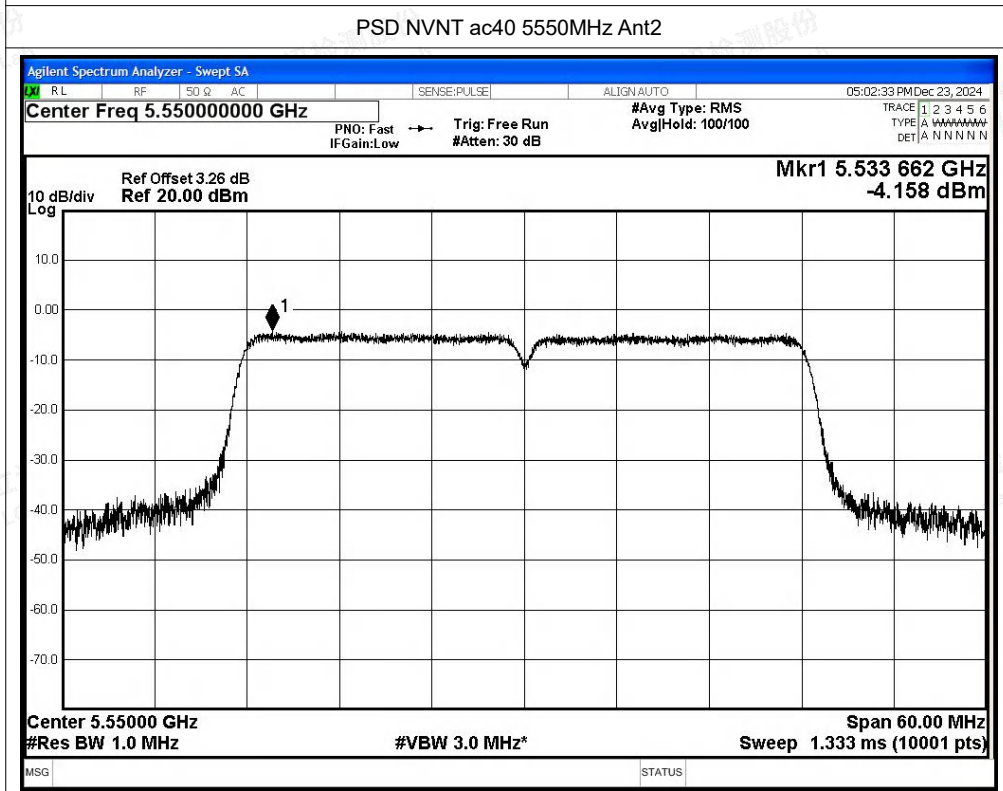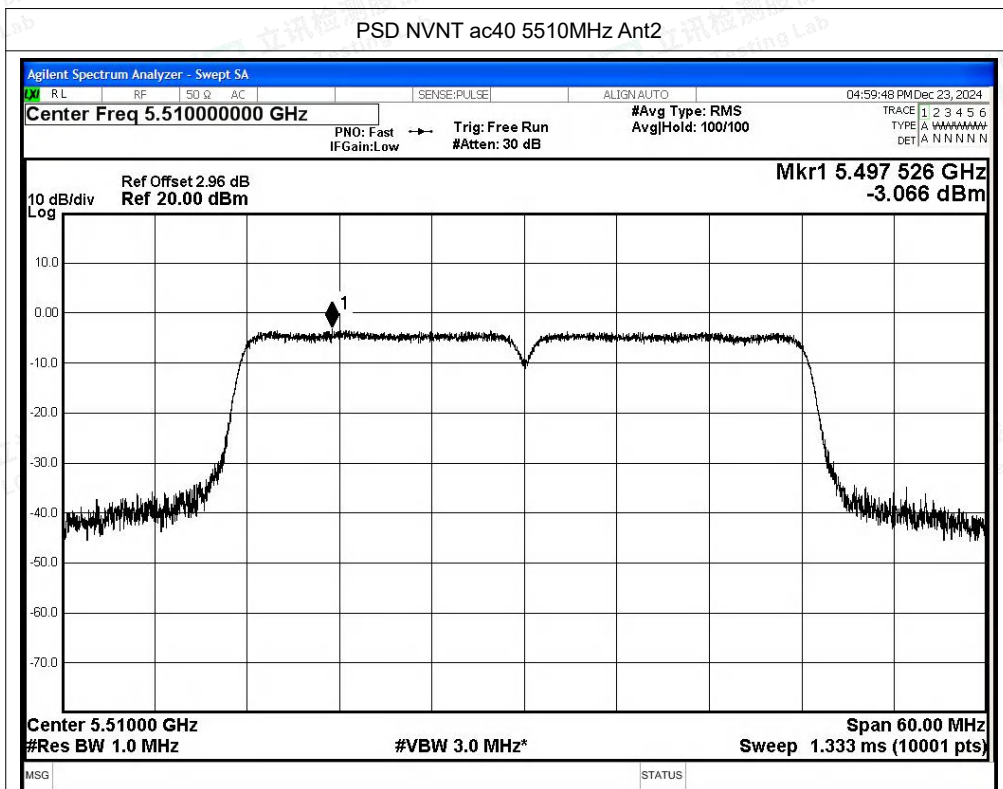





PSD NVNT ac40 5670MHz Ant2

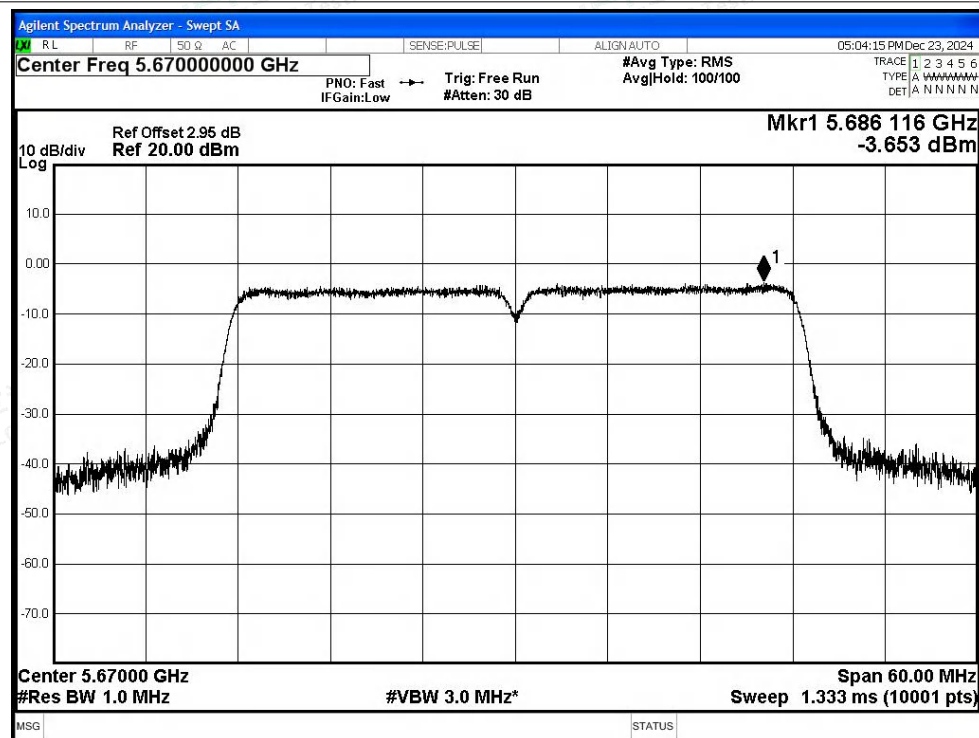

PSD NVNT ac80 5530MHz Ant2

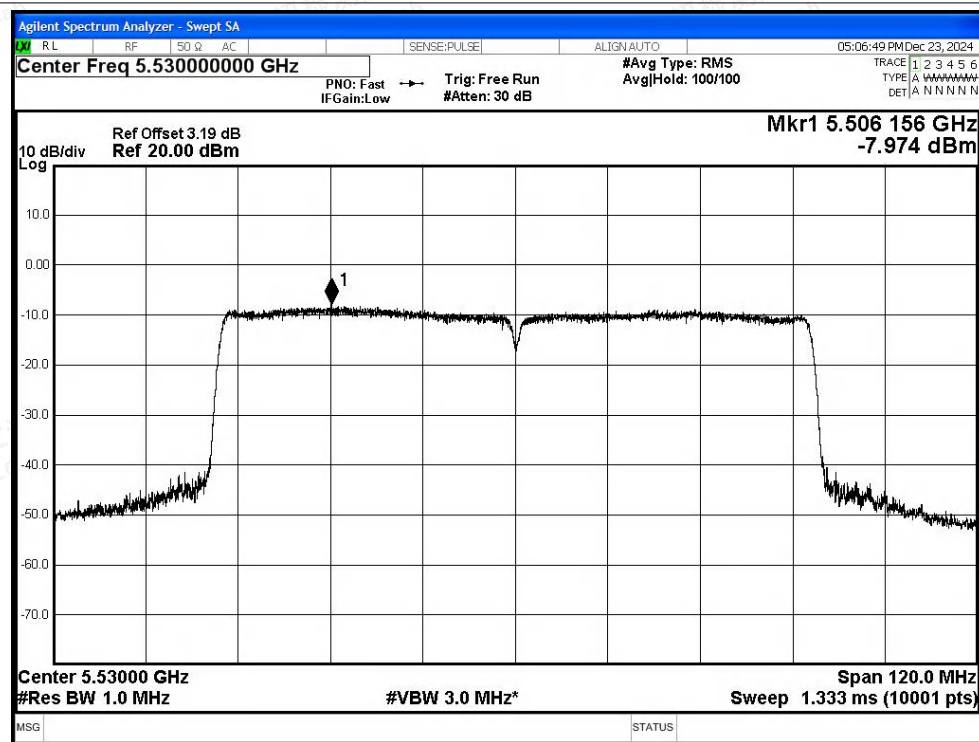

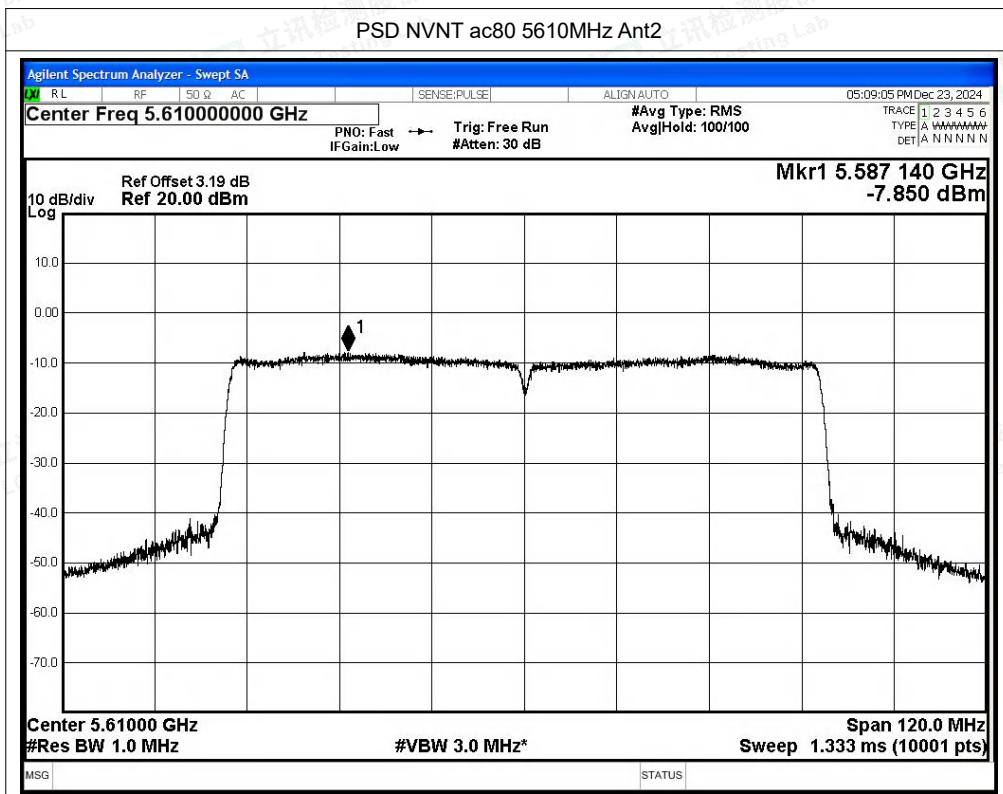

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant1	5460	-49.16	3.94	-	50.01	Peak	68.2	Pass
NVNT	a	5500	Ant1	5460	-57.69	3.94	0.24	41.72	Average	54	Pass
NVNT	a	5500	Ant1	5467.8	-44.63	3.94	-	54.54	Peak	68.2	Pass
NVNT	a	5500	Ant1	5467	-57.05	3.94	0.24	42.36	Average	54	Pass
NVNT	a	5500	Ant1	5470	-50.61	3.94	-	48.56	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-57.18	3.94	0.24	42.23	Average	54	Pass
NVNT	a	5700	Ant1	5725	-42.86	3.94	-	56.31	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-55.62	3.94	0.24	43.79	Average	54	Pass
NVNT	a	5700	Ant1	5727	-38.64	3.94	-	60.53	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725.2	-54.94	3.94	0.24	44.47	Average	54	Pass
NVNT	a	5700	Ant1	5735	-49.32	3.94	-	49.85	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-57.57	3.94	0.24	41.84	Average	54	Pass
NVNT	n20	5500	Ant1	5460	-49.53	3.94	-	49.64	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5460	-57.69	3.94	0.12	41.60	Average	54	Pass
NVNT	n20	5500	Ant1	5469.6	-43.77	3.94	-	55.40	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5469.6	-55.9	3.94	0.12	43.39	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-46.43	3.94	-	52.74	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-56.81	3.94	0.12	42.48	Average	54	Pass
NVNT	n20	5700	Ant1	5725	-41.9	3.94	-	57.27	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-53.94	3.94	0.12	45.35	Average	54	Pass
NVNT	n20	5700	Ant1	5725.4	-40.71	3.94	-	58.46	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-53.94	3.94	0.12	45.35	Average	54	Pass
NVNT	n20	5700	Ant1	5735	-49.87	3.94	-	49.30	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5735	-57.24	3.94	0.12	42.05	Average	54	Pass
NVNT	n40	5510	Ant1	5460	-47.91	3.94	-	51.26	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5460	-57.85	3.94	0.24	41.56	Average	54	Pass
NVNT	n40	5510	Ant1	5469.6	-40.76	3.94	-	58.41	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5468.8	-55.53	3.94	0.24	43.88	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-45.87	3.94	-	53.30	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-55.83	3.94	0.24	43.58	Average	54	Pass
NVNT	n40	5670	Ant1	5725	-46.98	3.94	-	52.19	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-55.37	3.94	0.23	44.03	Average	54	Pass
NVNT	n40	5670	Ant1	5730.2	-46.44	3.94	-	52.73	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-55.37	3.94	0.23	44.03	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-48.23	3.94	-	50.94	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5670	Ant1	5735	-56.42	3.94	0.23	42.98	Average	54	Pass
NVNT	ac20	5500	Ant1	5460	-49.64	3.94	-	49.53	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5460	-57.96	3.94	0.12	41.33	Average	54	Pass
NVNT	ac20	5500	Ant1	5464.2	-42.97	3.94	-	56.20	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5468.4	-56.2	3.94	0.12	43.09	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-45.4	3.94	-	53.77	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-56.94	3.94	0.12	42.35	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-40.22	3.94	-	58.95	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-53.94	3.94	0.12	45.35	Average	54	Pass
NVNT	ac20	5700	Ant1	5728.4	-39.52	3.94	-	59.65	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5726.6	-53.65	3.94	0.12	45.64	Average	54	Pass
NVNT	ac20	5700	Ant1	5735	-49.94	3.94	-	49.23	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-57.15	3.94	0.12	42.14	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-49.44	3.94	-	49.73	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-57.1	3.94	0.24	42.31	Average	54	Pass
NVNT	ac40	5510	Ant1	5468.2	-39.09	3.94	-	60.08	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-55.35	3.94	0.24	44.06	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-45.3	3.94	-	53.87	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-55.35	3.94	0.24	44.06	Average	54	Pass
NVNT	ac40	5670	Ant1	5725	-50.3	3.94	-	48.87	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-58.41	3.94	0.24	41.00	Average	54	Pass
NVNT	ac40	5670	Ant1	5726.6	-48.15	3.94	-	51.02	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5733.6	-57.3	3.94	0.24	42.11	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-50.56	3.94	-	48.61	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-58.26	3.94	0.24	41.15	Average	54	Pass
NVNT	ac80	5530	Ant1	5460	-47.39	3.94	-	51.78	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5460	-56.56	3.94	0.25	42.86	Average	54	Pass
NVNT	ac80	5530	Ant1	5469.6	-44.34	3.94	-	54.83	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5468.8	-54.9	3.94	0.25	44.52	Average	54	Pass
NVNT	ac80	5530	Ant1	5470	-46.73	3.94	-	52.44	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-55.66	3.94	0.25	43.76	Average	54	Pass
NVNT	ac80	5610	Ant1	5725	-49.78	3.94	-	49.39	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-57.7	3.94	0.25	41.72	Average	54	Pass
NVNT	ac80	5610	Ant1	5725.775	-48.05	3.94	-	51.12	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5729.26	-57.2	3.94	0.25	42.22	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-50.69	3.94	-	48.48	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5735	-58.46	3.94	0.25	40.96	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz Ant1 Peak

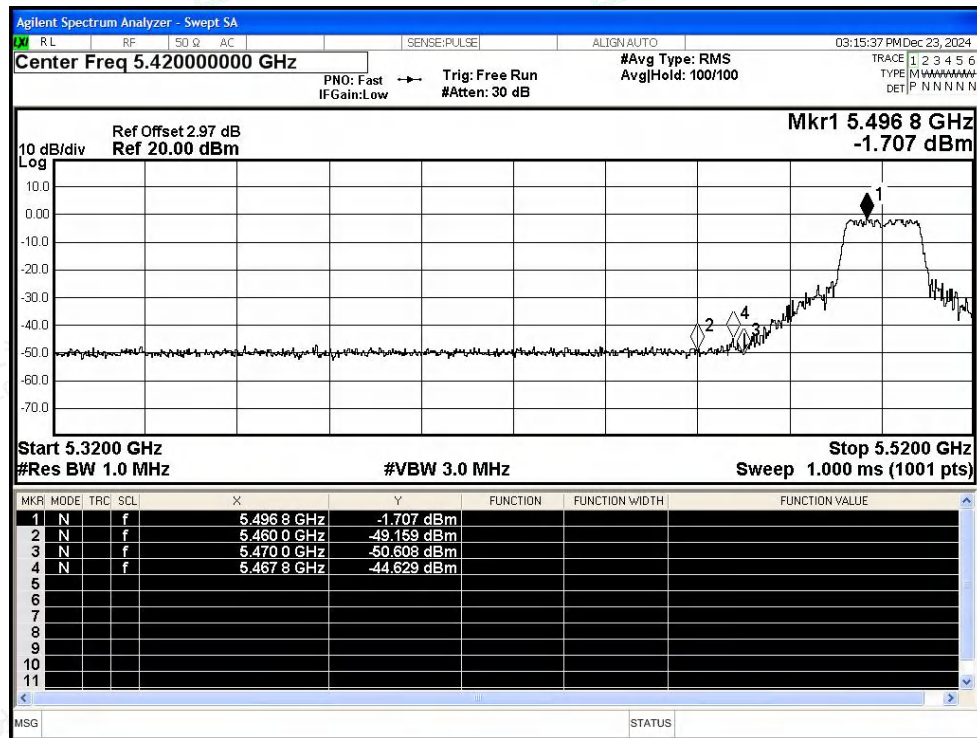

Restrict Band NVNT a 5500MHz Ant1 Average

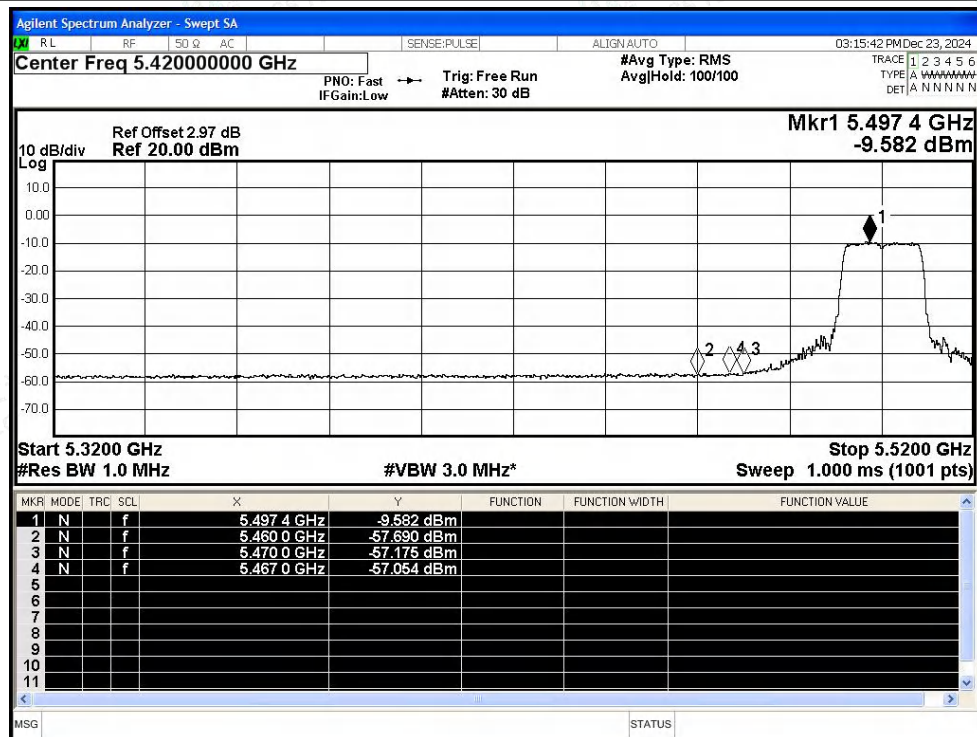

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant1 Peak

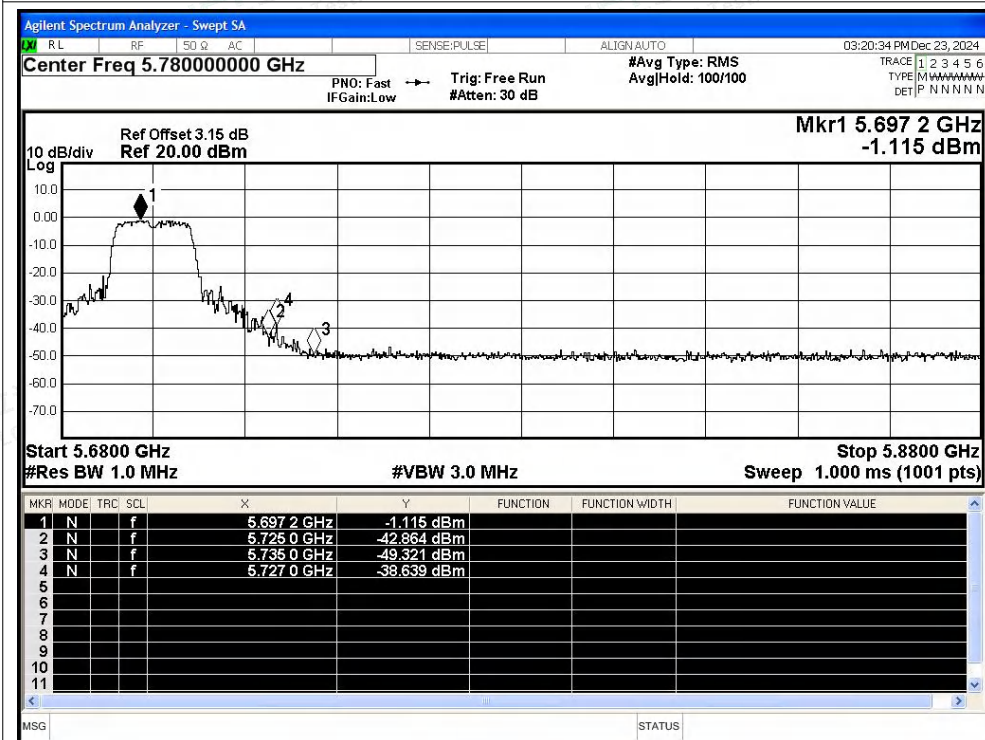

Restrict Band NVNT a 5700MHz Ant1 Average

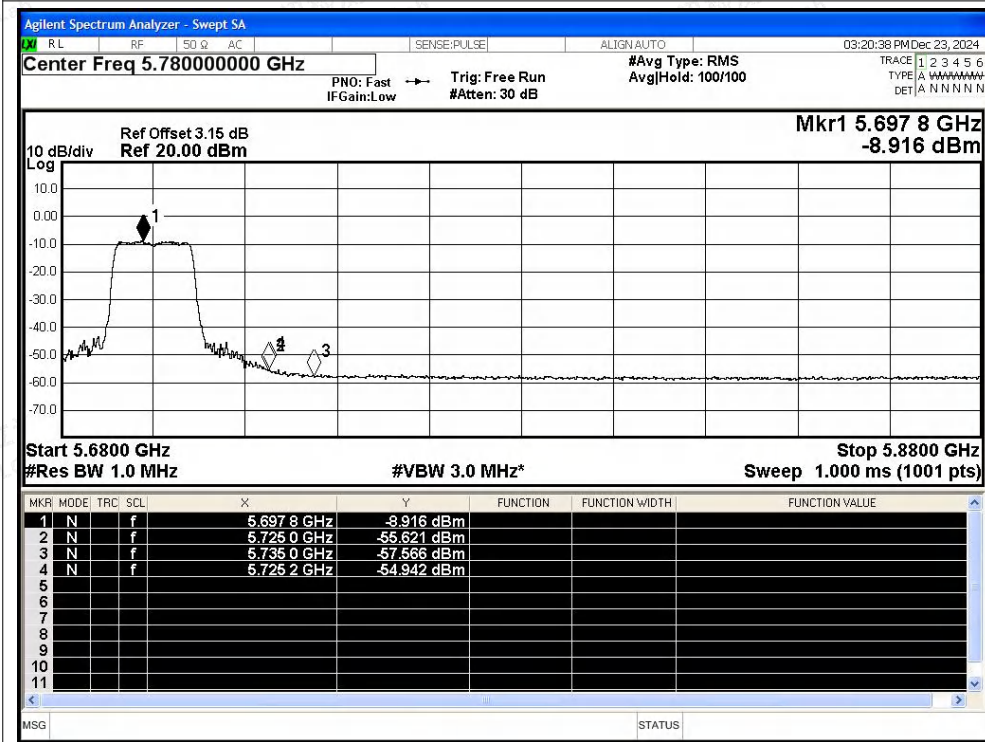

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant1 Peak

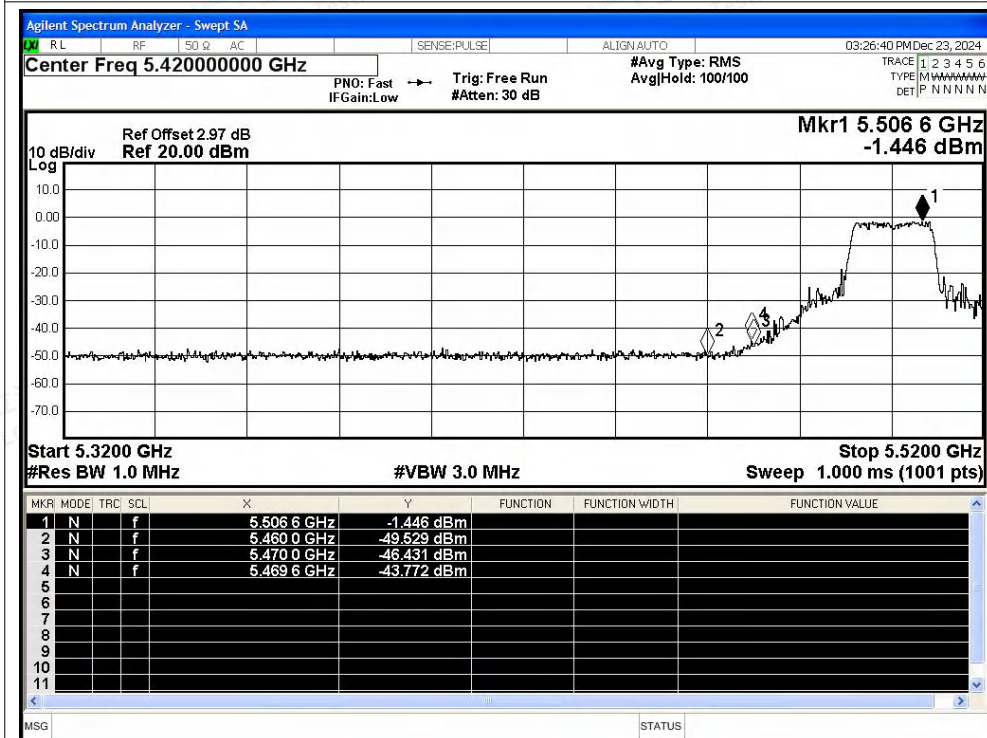

Restrict Band NVNT n20 5500MHz Ant1 Average

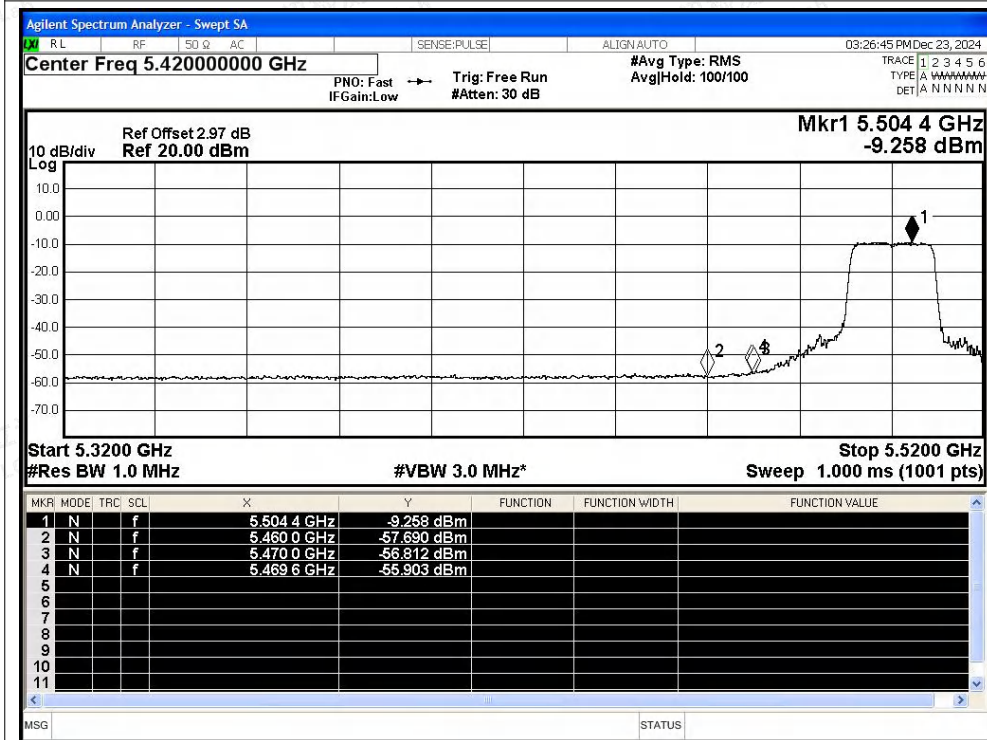

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant1 Peak

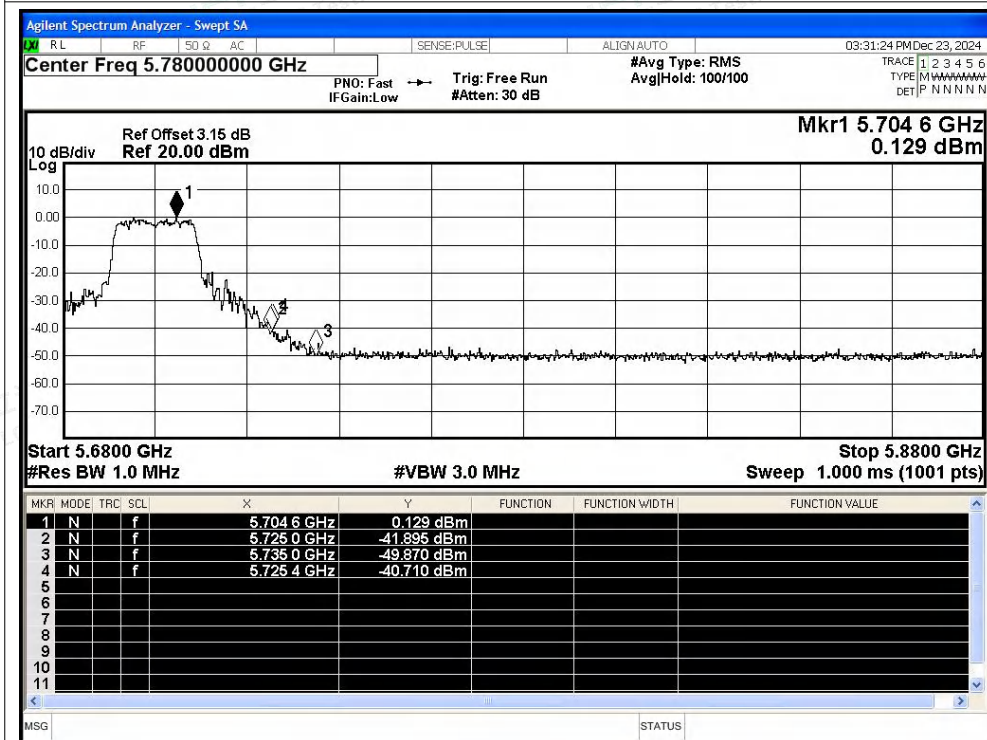

Restrict Band NVNT n20 5700MHz Ant1 Average

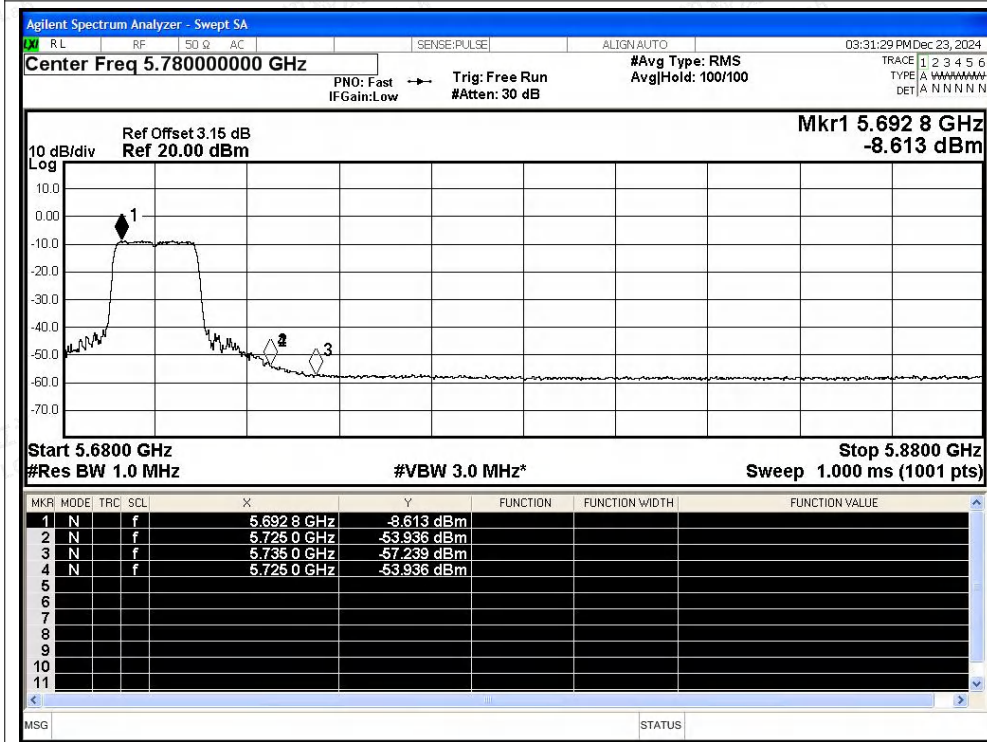

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant1 Peak

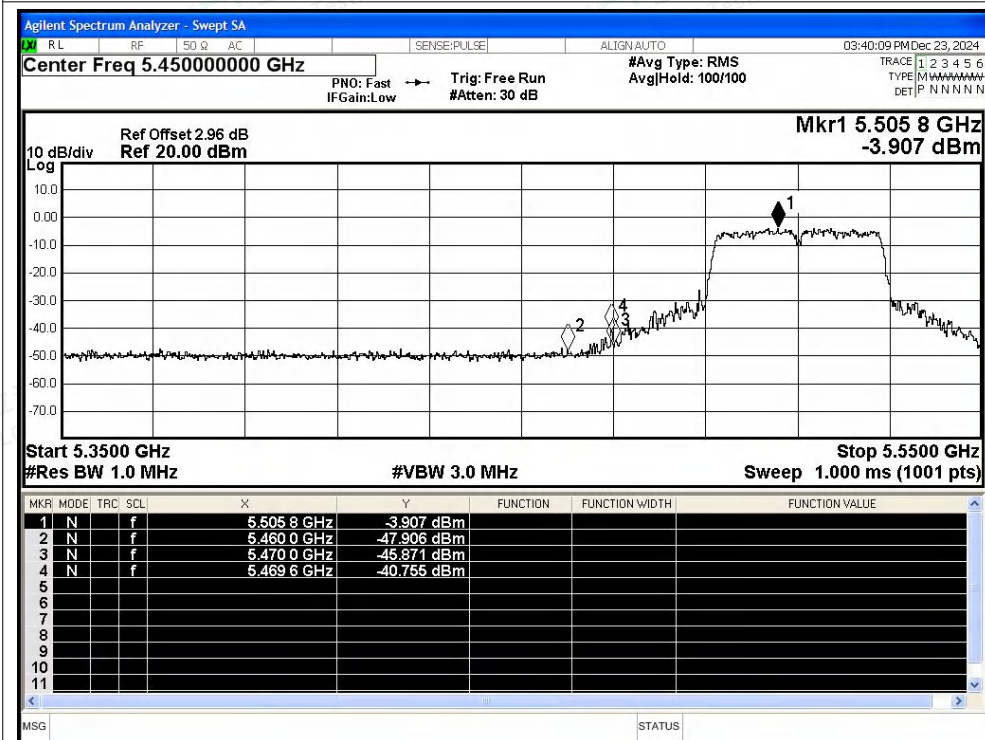

Restrict Band NVNT n40 5510MHz Ant1 Average

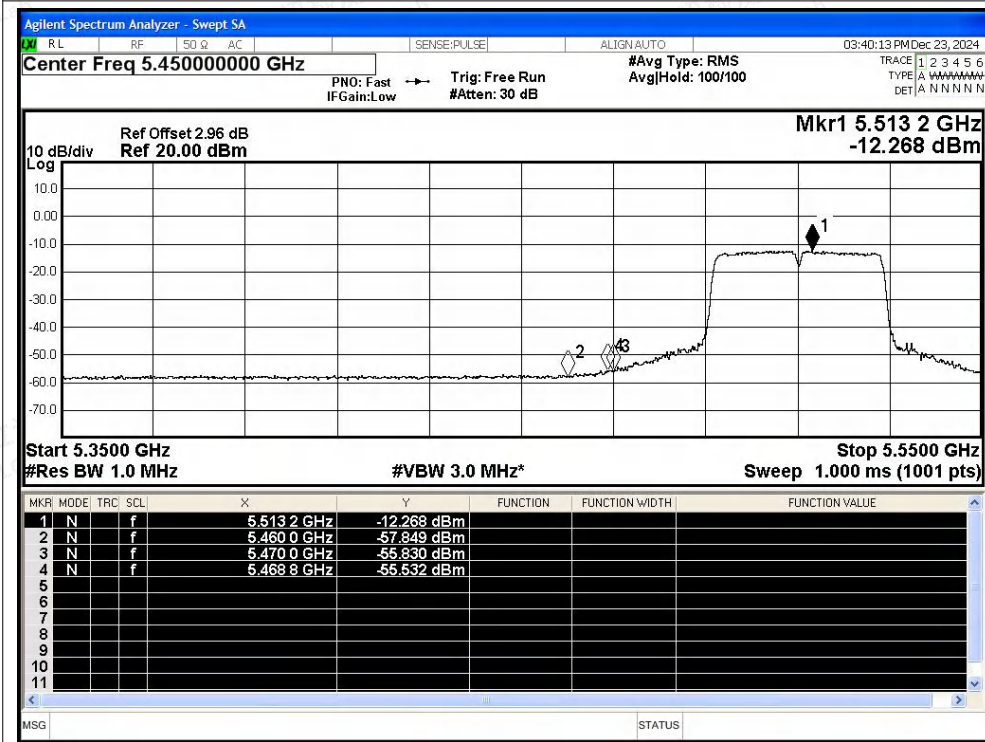

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant1 Peak

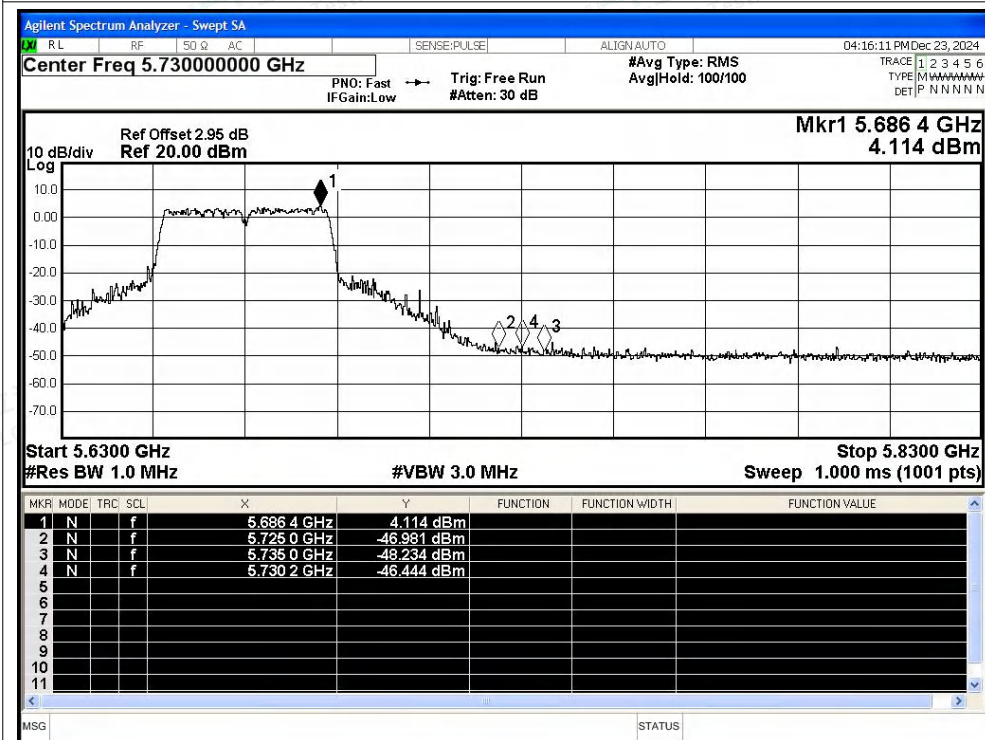

Restrict Band NVNT n40 5670MHz Ant1 Average

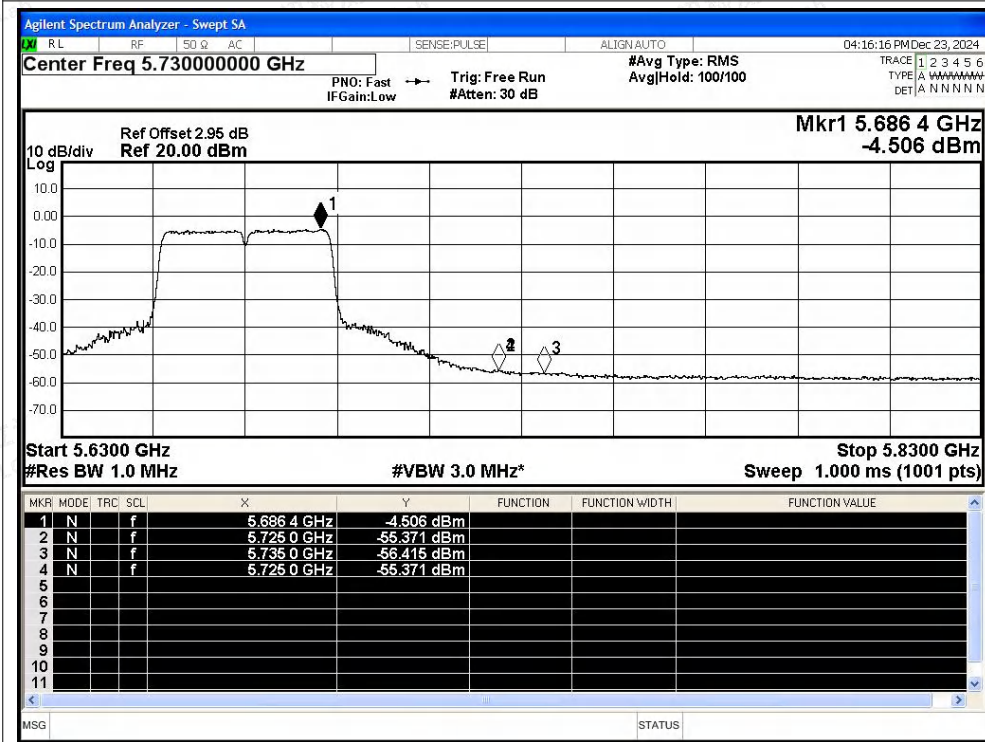

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant1 Peak

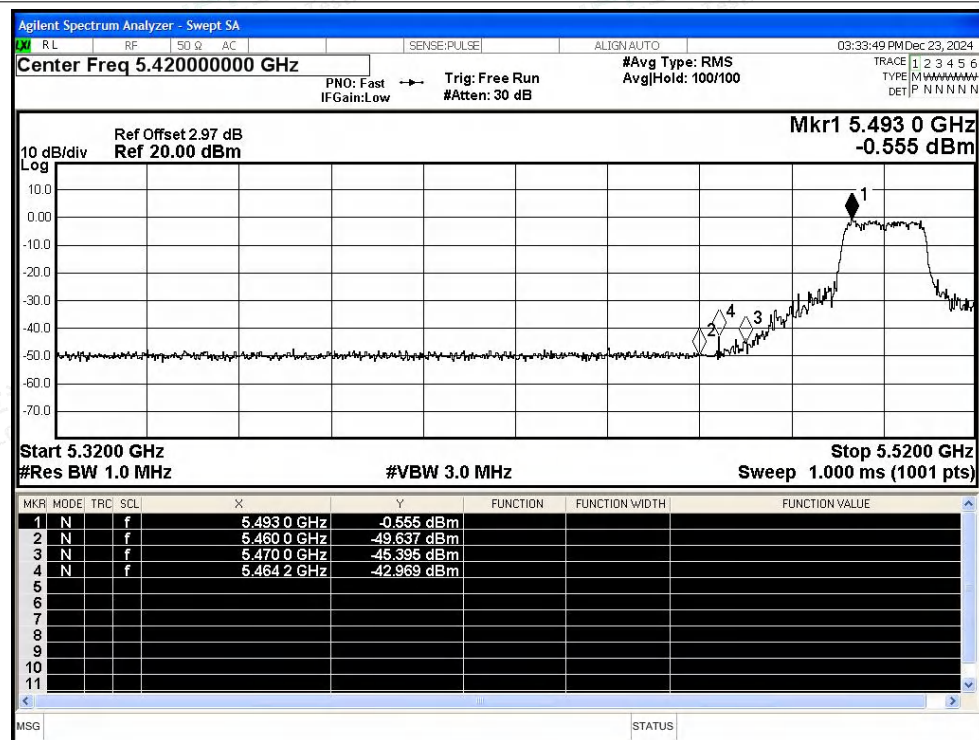

Restrict Band NVNT ac20 5500MHz Ant1 Average

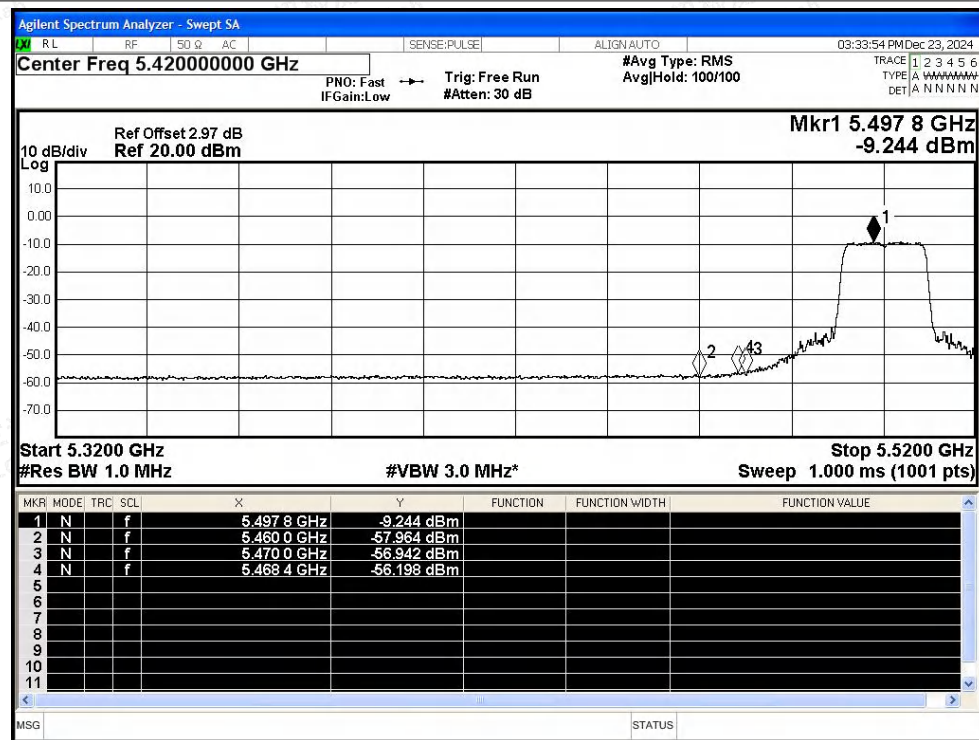

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant1 Peak

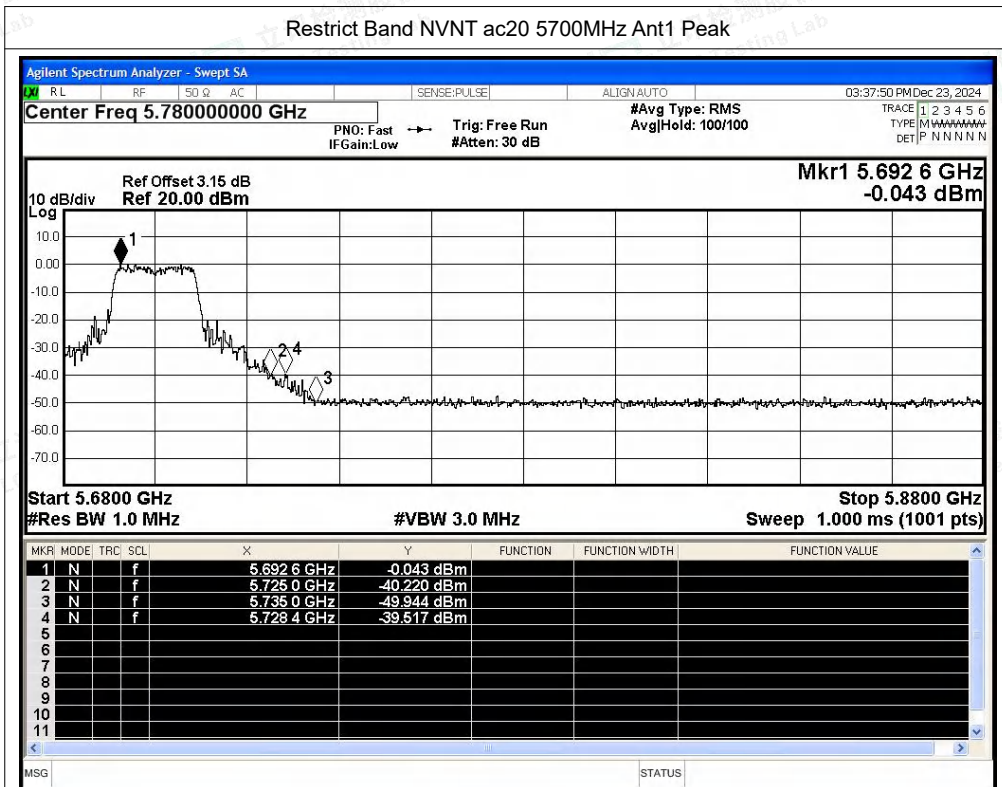

Restrict Band NVNT ac20 5700MHz Ant1 Average

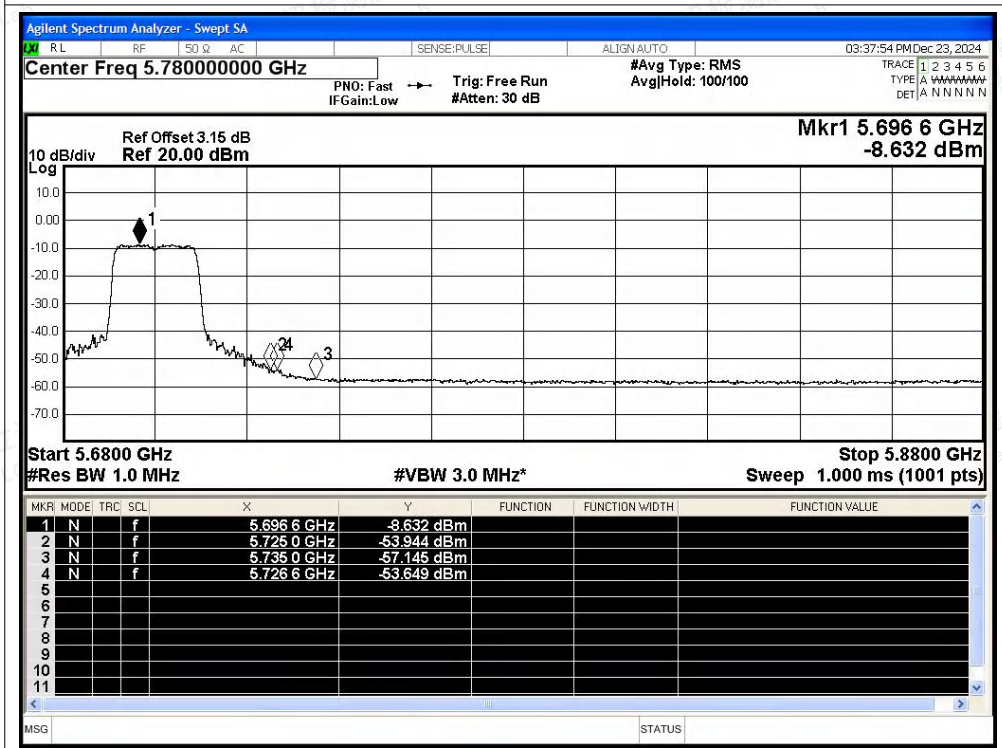

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant1 Peak

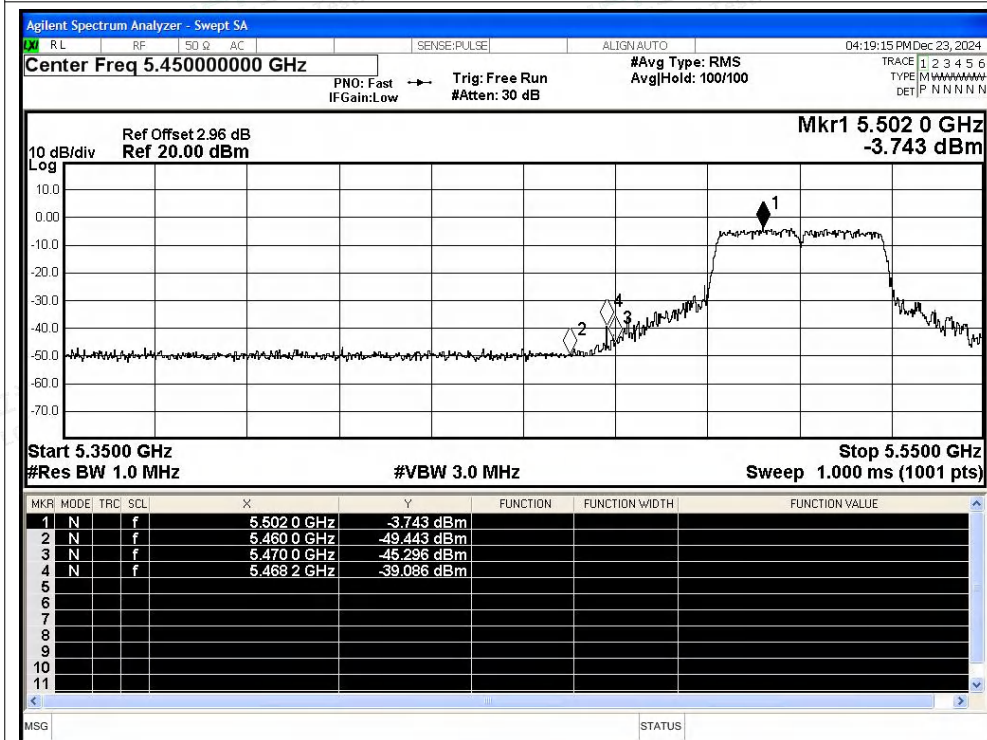

Restrict Band NVNT ac40 5510MHz Ant1 Average

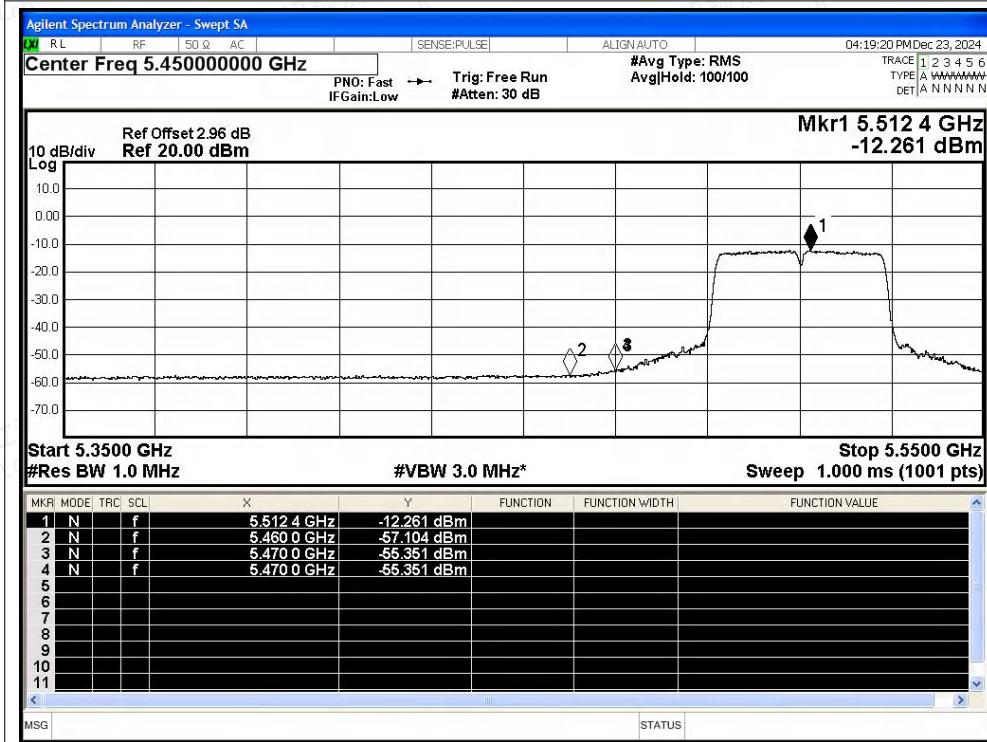

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant1 Peak

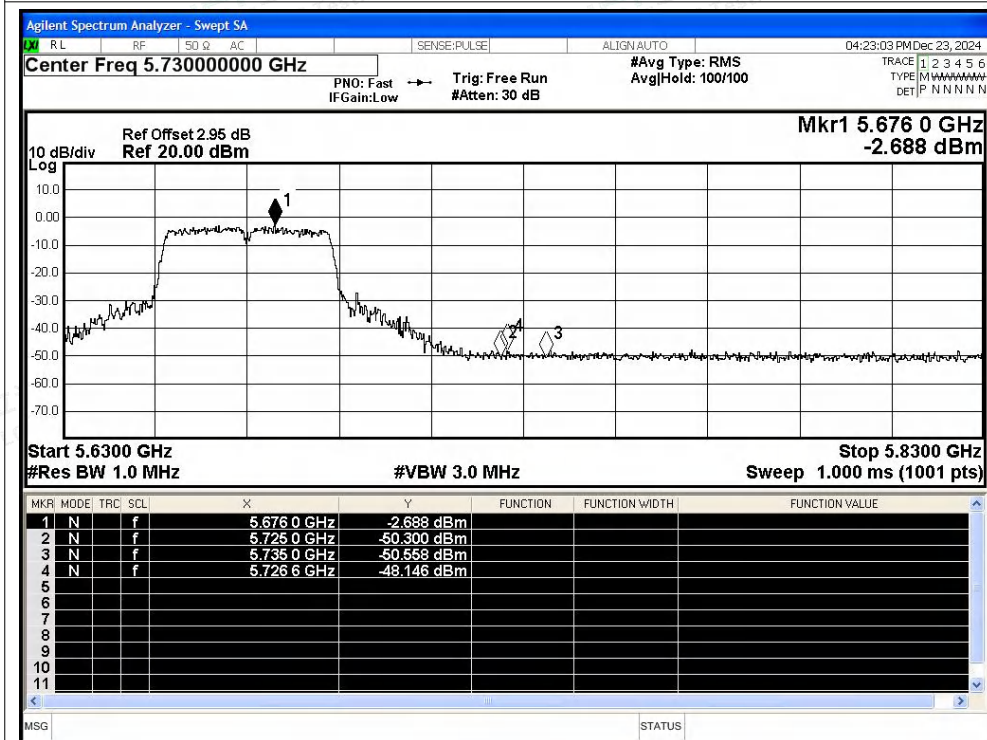

Restrict Band NVNT ac40 5670MHz Ant1 Average

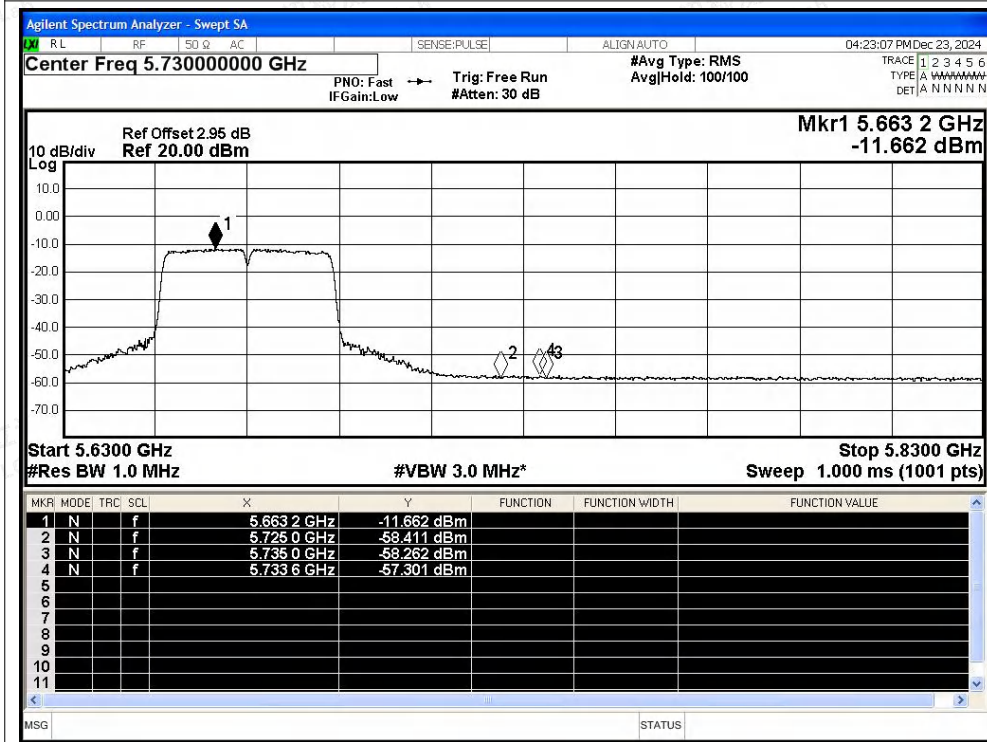

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz Ant1 Peak

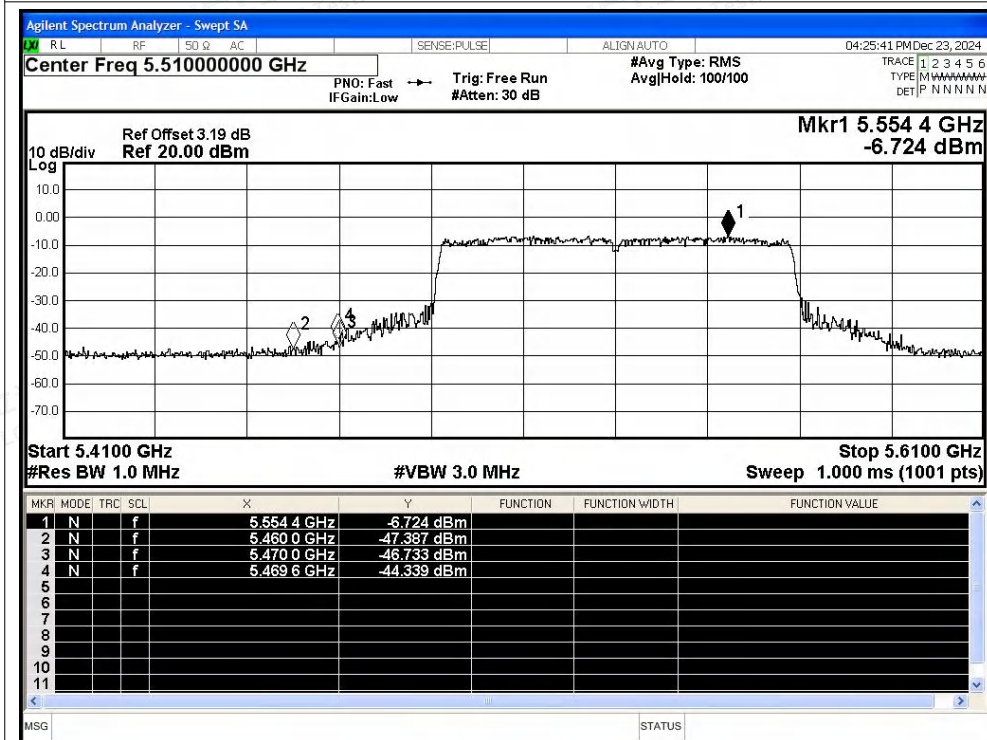

Restrict Band NVNT ac80 5530MHz Ant1 Average

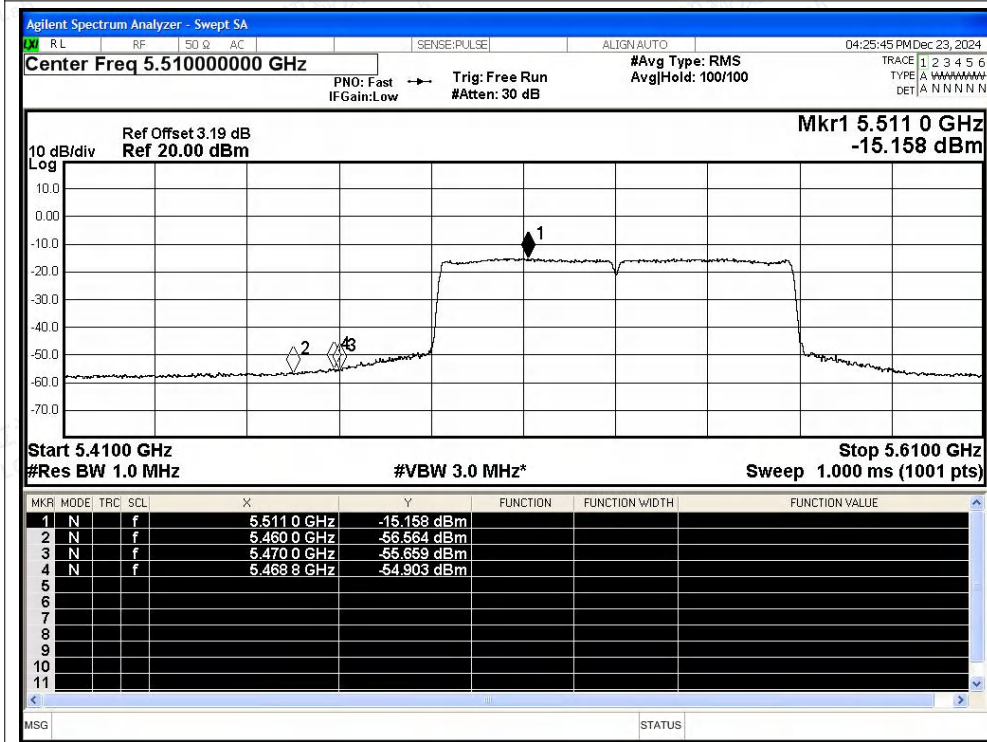

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant1 Peak

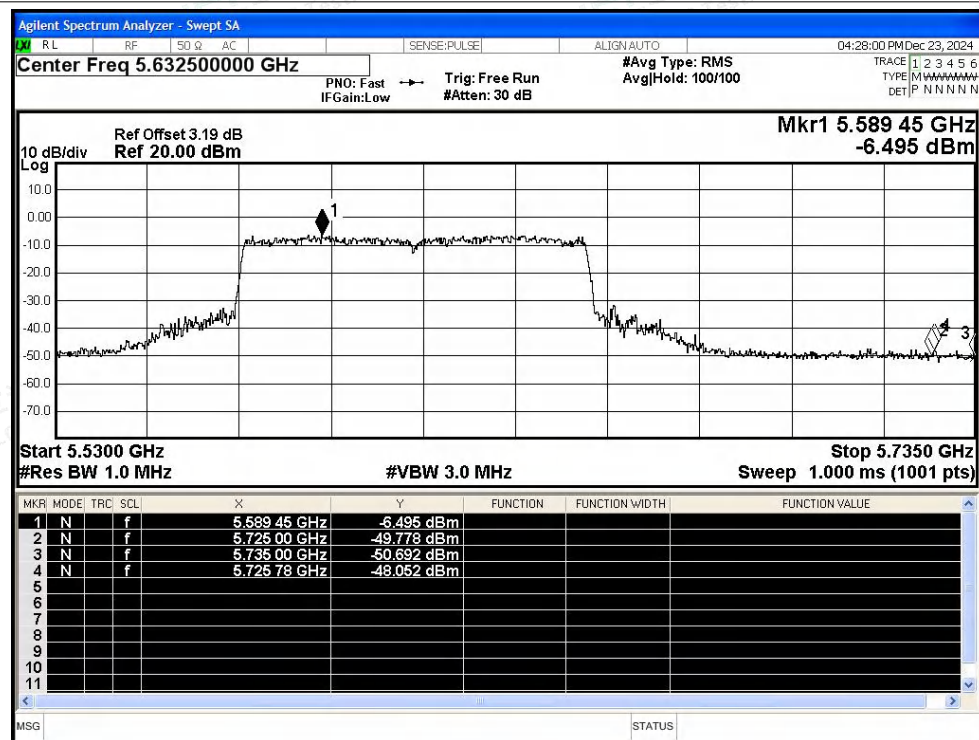

Restrict Band NVNT ac80 5610MHz Ant1 Average

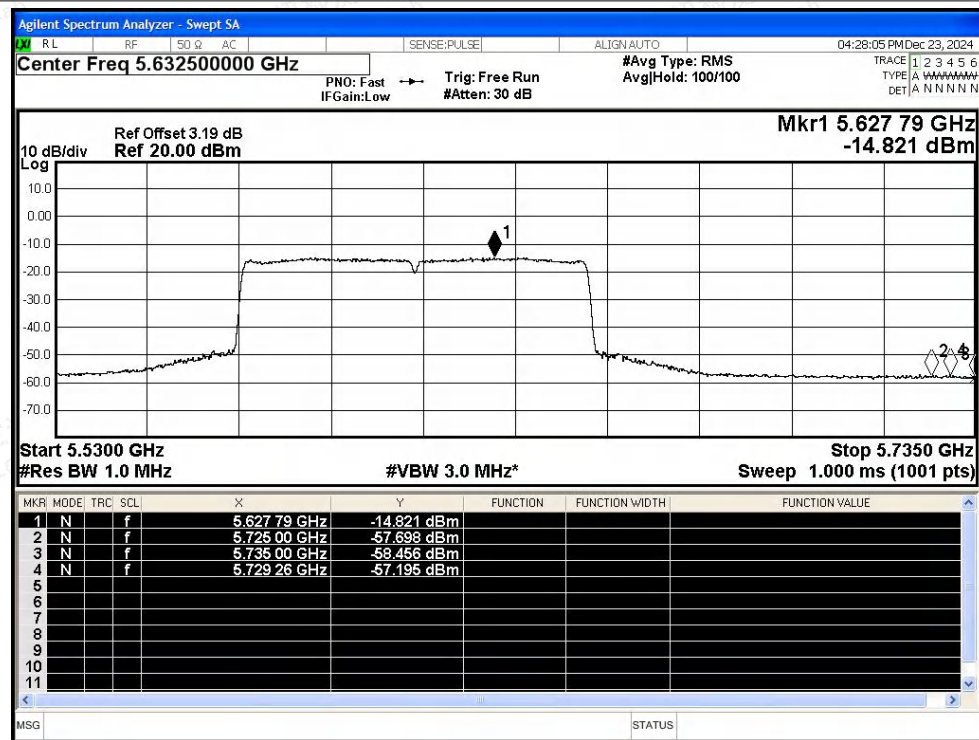

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant2	5460	-51.24	3.62	-	47.61	Peak	68.2	Pass
NVNT	a	5500	Ant2	5460	-57.78	3.62	0.24	41.31	Average	54	Pass
NVNT	a	5500	Ant2	5468.6	-43.84	3.62	-	55.01	Peak	68.2	Pass
NVNT	a	5500	Ant2	5469.8	-56.31	3.62	0.24	42.78	Average	54	Pass
NVNT	a	5500	Ant2	5470	-47.19	3.62	-	51.66	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-57.14	3.62	0.24	41.95	Average	54	Pass
NVNT	a	5700	Ant2	5725	-39.96	3.62	-	58.89	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-54.75	3.62	0.24	44.34	Average	54	Pass
NVNT	a	5700	Ant2	5726.4	-39.34	3.62	-	59.51	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-54.75	3.62	0.24	44.34	Average	54	Pass
NVNT	a	5700	Ant2	5735	-50.1	3.62	-	48.75	Peak	68.2	Pass
NVNT	a	5700	Ant2	5735	-58.18	3.62	0.24	40.91	Average	54	Pass
NVNT	n20	5500	Ant2	5460	-49.1	3.62	-	49.75	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5460	-57.64	3.62	0.12	41.33	Average	54	Pass
NVNT	n20	5500	Ant2	5468.4	-44.17	3.62	-	54.68	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5467.2	-56.15	3.62	0.12	42.82	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-44.45	3.62	-	54.40	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5470	-56.41	3.62	0.12	42.56	Average	54	Pass
NVNT	n20	5700	Ant2	5725	-40.33	3.62	-	58.52	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-54.63	3.62	0.12	44.34	Average	54	Pass
NVNT	n20	5700	Ant2	5726.8	-39.71	3.62	-	59.14	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5726	-53.32	3.62	0.12	45.65	Average	54	Pass
NVNT	n20	5700	Ant2	5735	-50.83	3.62	-	48.02	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5735	-57.36	3.62	0.12	41.61	Average	54	Pass
NVNT	n40	5510	Ant2	5460	-50.54	3.62	-	48.31	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5460	-57.65	3.62	0.24	41.44	Average	54	Pass
NVNT	n40	5510	Ant2	5464.8	-42.73	3.62	-	56.12	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5468.8	-55.35	3.62	0.24	43.74	Average	54	Pass
NVNT	n40	5510	Ant2	5470	-45.55	3.62	-	53.30	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-55.64	3.62	0.24	43.45	Average	54	Pass
NVNT	n40	5670	Ant2	5725	-50.03	3.62	-	48.82	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-57.73	3.62	0.24	41.36	Average	54	Pass
NVNT	n40	5670	Ant2	5729.8	-47.77	3.62	-	51.08	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5731.4	-57.66	3.62	0.24	41.43	Average	54	Pass
NVNT	n40	5670	Ant2	5735	-50.73	3.62	-	48.12	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5735	-58.34	3.62	0.24	40.75	Average	54	Pass
NVNT	ac20	5500	Ant2	5460	-50.82	3.62	-	48.03	Peak	68.2	Pass





NVNT	ac20	5500	Ant2	5460	-58.32	3.62	0.12	40.65	Average	54	Pass
NVNT	ac20	5500	Ant2	5469.2	-45.32	3.62	-	53.53	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5467.4	-56.11	3.62	0.12	42.86	Average	54	Pass
NVNT	ac20	5500	Ant2	5470	-45.79	3.62	-	53.06	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-56.41	3.62	0.12	42.56	Average	54	Pass
NVNT	ac20	5700	Ant2	5725	-40.7	3.62	-	58.15	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-53.57	3.62	0.12	45.40	Average	54	Pass
NVNT	ac20	5700	Ant2	5726	-40.46	3.62	-	58.39	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-53.57	3.62	0.12	45.40	Average	54	Pass
NVNT	ac20	5700	Ant2	5735	-48.97	3.62	-	49.88	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5735	-57.19	3.62	0.12	41.78	Average	54	Pass
NVNT	ac40	5510	Ant2	5460	-49.88	3.62	-	48.97	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5460	-57.76	3.62	0.24	41.33	Average	54	Pass
NVNT	ac40	5510	Ant2	5465.2	-42.79	3.62	-	56.06	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5468.8	-55.05	3.62	0.24	44.04	Average	54	Pass
NVNT	ac40	5510	Ant2	5470	-45.61	3.62	-	53.24	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-56.35	3.62	0.24	42.74	Average	54	Pass
NVNT	ac40	5670	Ant2	5725	-49.31	3.62	-	49.54	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725	-57.78	3.62	0.24	41.31	Average	54	Pass
NVNT	ac40	5670	Ant2	5732.4	-47.9	3.62	-	50.95	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5733.6	-57.28	3.62	0.24	41.81	Average	54	Pass
NVNT	ac40	5670	Ant2	5735	-51.07	3.62	-	47.78	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5735	-58.65	3.62	0.24	40.44	Average	54	Pass
NVNT	ac80	5530	Ant2	5460	-48.79	3.62	-	50.06	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5460	-56.4	3.62	0.25	42.70	Average	54	Pass
NVNT	ac80	5530	Ant2	5469.6	-44.15	3.62	-	54.70	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5467.8	-55.05	3.62	0.25	44.05	Average	54	Pass
NVNT	ac80	5530	Ant2	5470	-46.05	3.62	-	52.80	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-55.12	3.62	0.25	43.98	Average	54	Pass
NVNT	ac80	5610	Ant2	5725	-47.98	3.62	-	50.87	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725	-58.06	3.62	0.25	41.04	Average	54	Pass
NVNT	ac80	5610	Ant2	5727.825	-47.46	3.62	-	51.39	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5726.185	-57.5	3.62	0.25	41.60	Average	54	Pass
NVNT	ac80	5610	Ant2	5735	-50.01	3.62	-	48.84	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5735	-57.93	3.62	0.25	41.17	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz Ant2 Peak

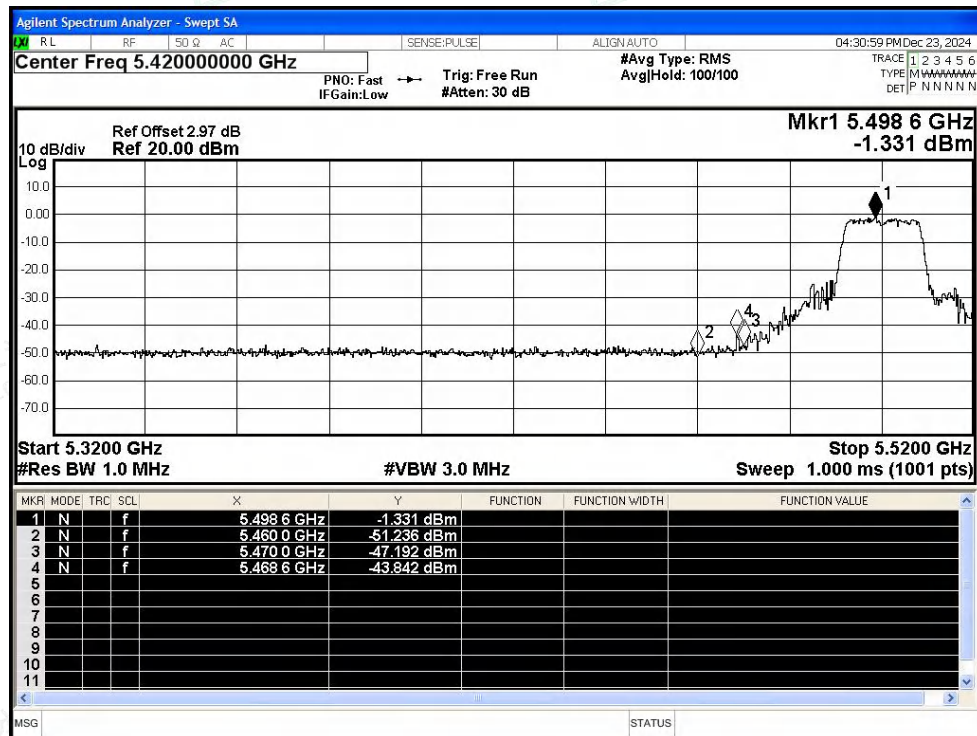

Restrict Band NVNT a 5500MHz Ant2 Average

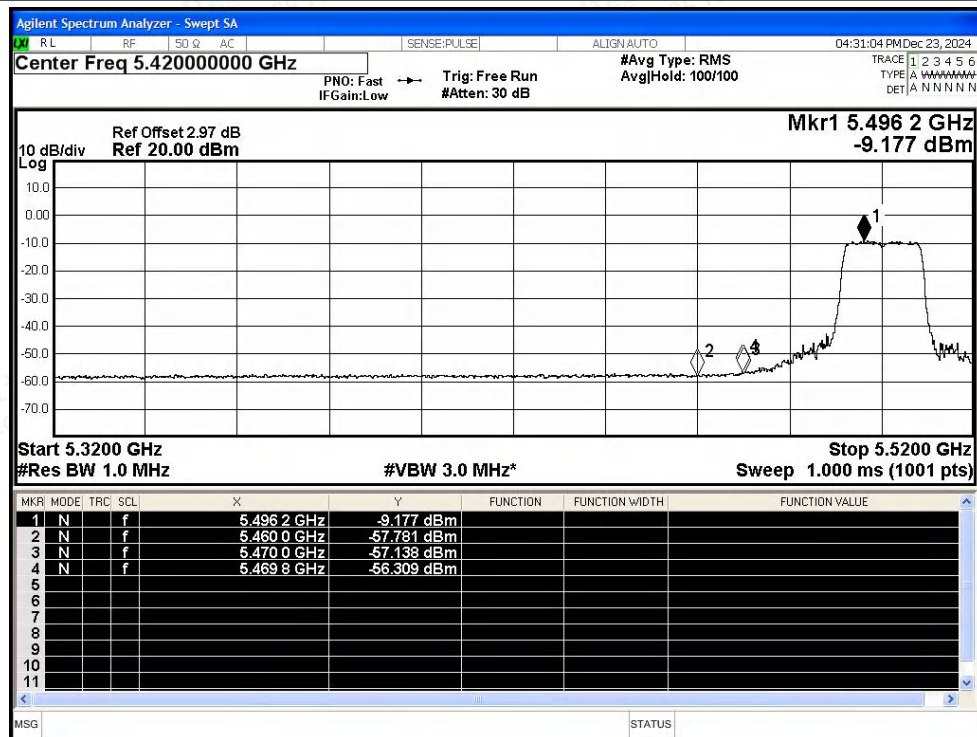

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant2 Peak

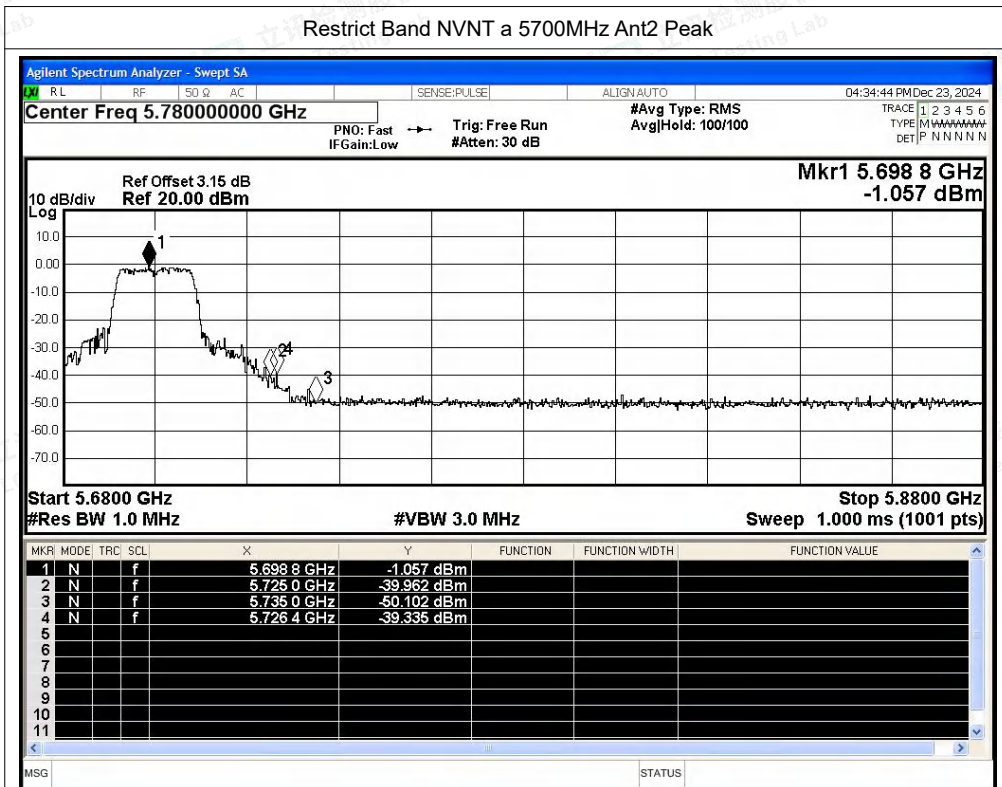

Restrict Band NVNT a 5700MHz Ant2 Average

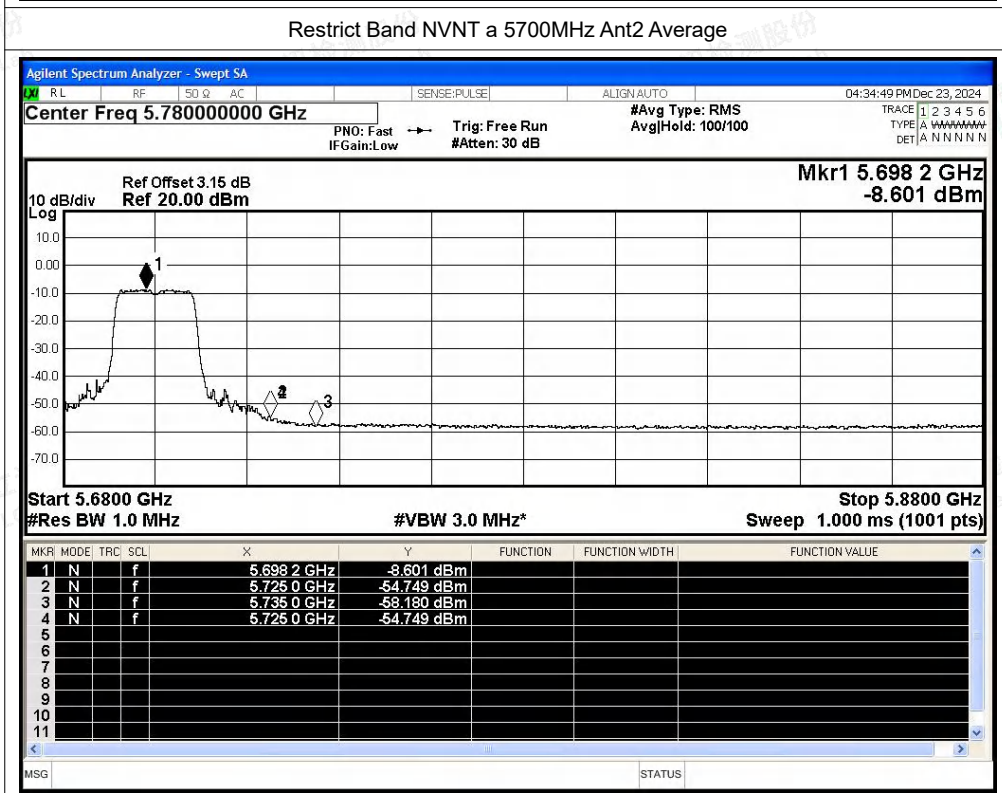

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant2 Peak

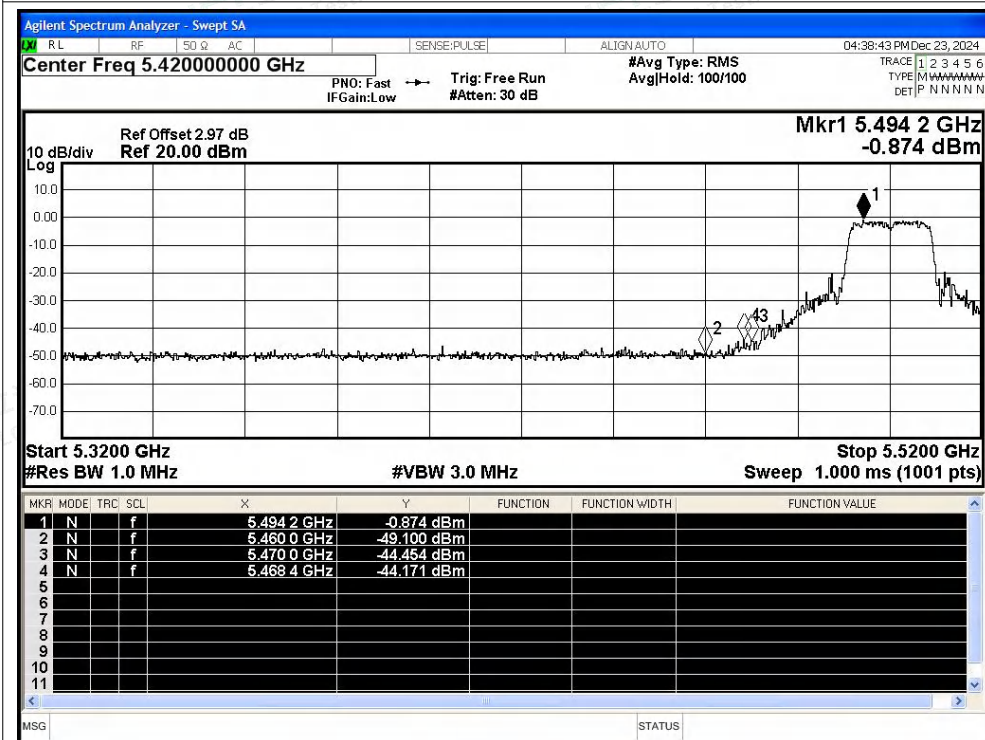

Restrict Band NVNT n20 5500MHz Ant2 Average

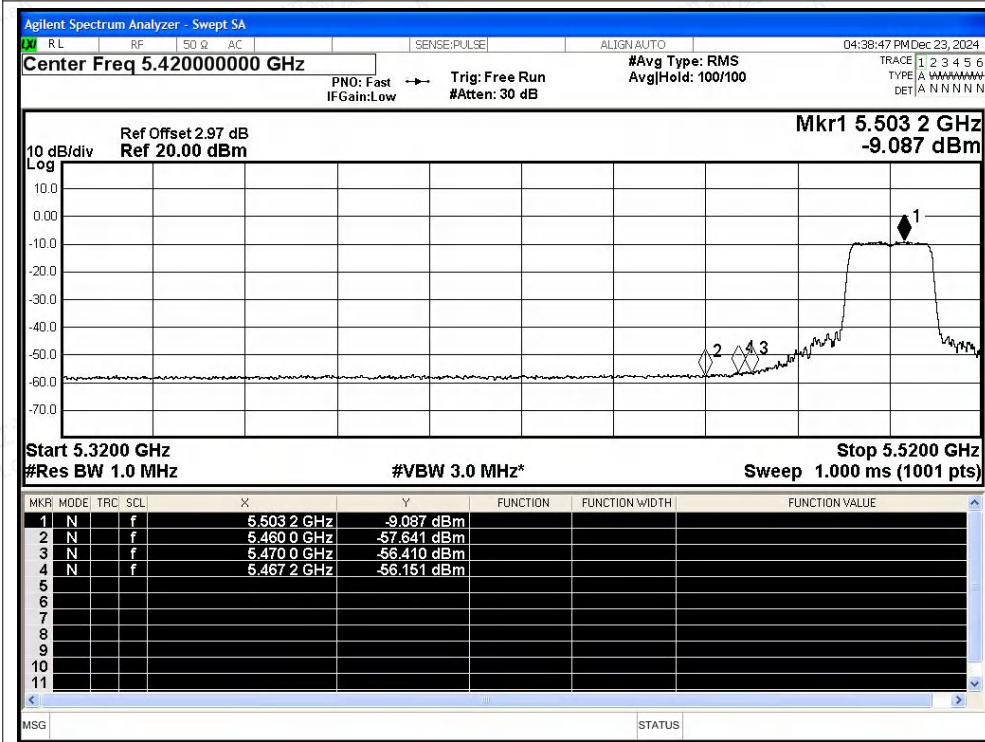

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant2 Peak

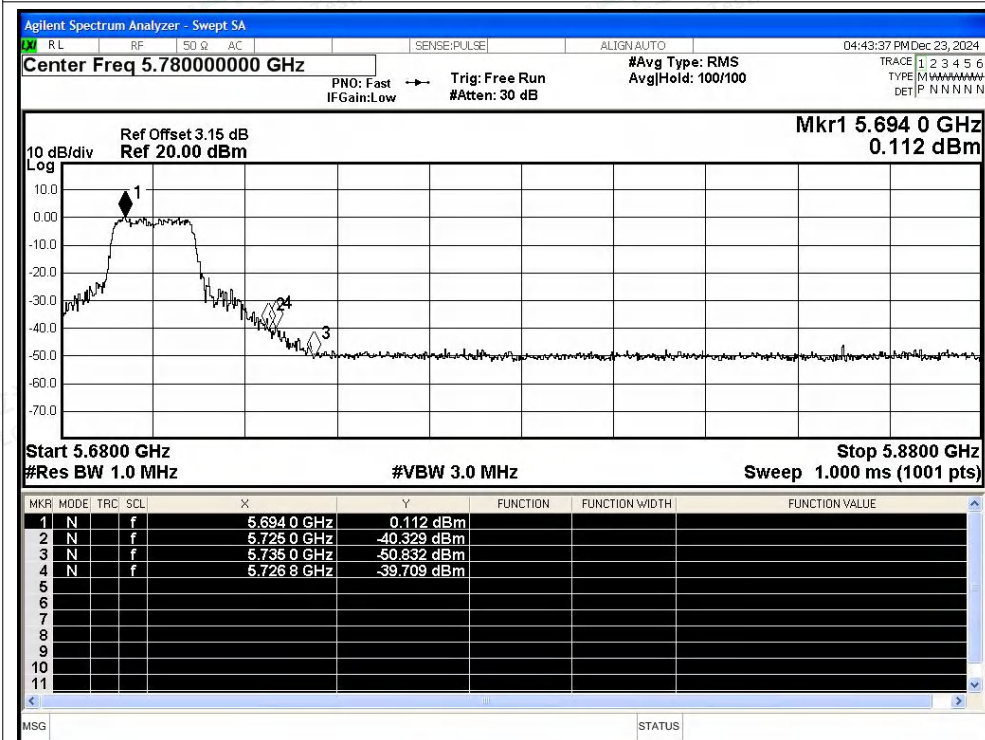

Restrict Band NVNT n20 5700MHz Ant2 Average

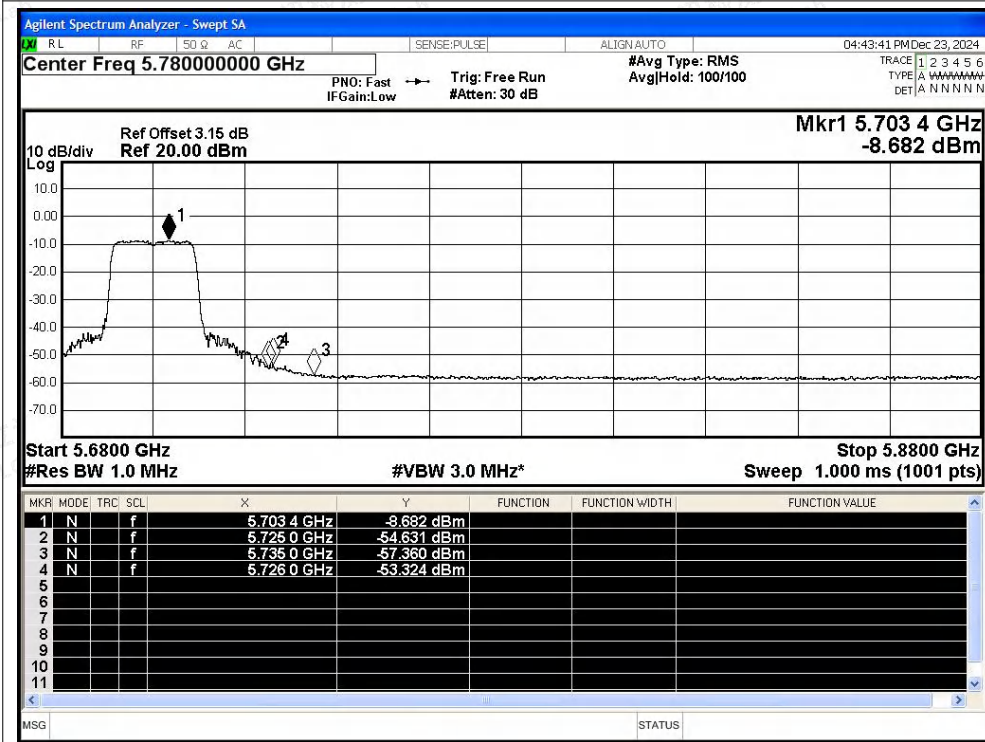

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity