

**FCC Part 27****Spurious emissions at antenna terminals****n41 , Normal**

| Mode                                                            | Value (dBm) | Limit (dBm) | Result |
|-----------------------------------------------------------------|-------------|-------------|--------|
| n41_10MHz_30kHz_2501.01MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz  | -32.65      | -25         | Pass   |
| n41_10MHz_30kHz_2501.01MHz_DFT-s-OFDM QPSK_RB1@23 30MHz_26.9GHz | -32.57      | -25         | Pass   |
| n41_10MHz_30kHz_2501.01MHz_DFT-s-OFDM QPSK_RB24@0 30MHz_26.9GHz | -31.47      | -25         | Pass   |
| n41_10MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz  | -32.04      | -25         | Pass   |
| n41_10MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@23 30MHz_26.9GHz | -32.18      | -25         | Pass   |
| n41_10MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB24@0 30MHz_26.9GHz | -32.2       | -25         | Pass   |
| n41_10MHz_30kHz_2685MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz     | -32.6       | -25         | Pass   |
| n41_10MHz_30kHz_2685MHz_DFT-s-OFDM QPSK_RB1@23 30MHz_26.9GHz    | -32.26      | -25         | Pass   |
| n41_10MHz_30kHz_2685MHz_DFT-s-OFDM QPSK_RB24@0 30MHz_26.9GHz    | -32.25      | -25         | Pass   |
| n41_15MHz_30kHz_2503.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz   | -32.71      | -25         | Pass   |
| n41_15MHz_30kHz_2503.5MHz_DFT-s-OFDM QPSK_RB1@37 30MHz_26.9GHz  | -32.15      | -25         | Pass   |
| n41_15MHz_30kHz_2503.5MHz_DFT-s-OFDM QPSK_RB36@0 30MHz_26.9GHz  | -32.44      | -25         | Pass   |
| n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz  | -32.54      | -25         | Pass   |
| n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB1@37 30MHz_26.9GHz | -32.1       | -25         | Pass   |
| n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM QPSK_RB36@0 30MHz_26.9GHz | -32.32      | -25         | Pass   |
| n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz  | -32.1       | -25         | Pass   |
| n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM QPSK_RB1@37 30MHz_26.9GHz | -32.03      | -25         | Pass   |
| n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM QPSK_RB36@0 30MHz_26.9GHz | -32.48      | -25         | Pass   |
| n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz  | -32.04      | -25         | Pass   |

| Mode                                                                | Value (dBm) | Limit (dBm) | Result |
|---------------------------------------------------------------------|-------------|-------------|--------|
| n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM<br>QPSK_RB1@50 30MHz_26.9GHz  | -32.66      | -25         | Pass   |
| n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM<br>QPSK_RB50@0 30MHz_26.9GHz  | -32.02      | -25         | Pass   |
| n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.1       | -25         | Pass   |
| n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@50 30MHz_26.9GHz  | -32.44      | -25         | Pass   |
| n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB50@0 30MHz_26.9GHz  | -32.52      | -25         | Pass   |
| n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.27      | -25         | Pass   |
| n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM<br>QPSK_RB1@50 30MHz_26.9GHz  | -32.27      | -25         | Pass   |
| n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM<br>QPSK_RB50@0 30MHz_26.9GHz  | -32.51      | -25         | Pass   |
| n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.17      | -25         | Pass   |
| n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM<br>QPSK_RB1@105 30MHz_26.9GHz | -32.38      | -25         | Pass   |
| n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM<br>QPSK_RB100@0 30MHz_26.9GHz | -32.49      | -25         | Pass   |
| n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.11      | -25         | Pass   |
| n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@105 30MHz_26.9GHz | -32.6       | -25         | Pass   |
| n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB100@0 30MHz_26.9GHz | -31.8       | -25         | Pass   |
| n41_40MHz_30kHz_2670MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz         | -32.54      | -25         | Pass   |
| n41_40MHz_30kHz_2670MHz_DFT-s-OFDM<br>QPSK_RB1@105 30MHz_26.9GHz    | -32.31      | -25         | Pass   |
| n41_40MHz_30kHz_2670MHz_DFT-s-OFDM<br>QPSK_RB100@0 30MHz_26.9GHz    | -32.59      | -25         | Pass   |
| n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.37      | -25         | Pass   |
| n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM<br>QPSK_RB1@132 30MHz_26.9GHz | -31.79      | -25         | Pass   |
| n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM<br>QPSK_RB128@0 30MHz_26.9GHz | -32.37      | -25         | Pass   |
| n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.5       | -25         | Pass   |

| Mode                                                                | Value (dBm) | Limit (dBm) | Result |
|---------------------------------------------------------------------|-------------|-------------|--------|
| n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@132 30MHz_26.9GHz | -32.69      | -25         | Pass   |
| n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB128@0 30MHz_26.9GHz | -32.65      | -25         | Pass   |
| n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.38      | -25         | Pass   |
| n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM<br>QPSK_RB1@132 30MHz_26.9GHz | -32.45      | -25         | Pass   |
| n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM<br>QPSK_RB128@0 30MHz_26.9GHz | -32.41      | -25         | Pass   |
| n41_60MHz_30kHz_2526MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz         | -31.93      | -25         | Pass   |
| n41_60MHz_30kHz_2526MHz_DFT-s-OFDM<br>QPSK_RB1@161 30MHz_26.9GHz    | -32.51      | -25         | Pass   |
| n41_60MHz_30kHz_2526MHz_DFT-s-OFDM<br>QPSK_RB162@0 30MHz_26.9GHz    | -32.17      | -25         | Pass   |
| n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.37      | -25         | Pass   |
| n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@161 30MHz_26.9GHz | -32.59      | -25         | Pass   |
| n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB162@0 30MHz_26.9GHz | -32.44      | -25         | Pass   |
| n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.41      | -25         | Pass   |
| n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM<br>QPSK_RB1@161 30MHz_26.9GHz | -32.37      | -25         | Pass   |
| n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM<br>QPSK_RB162@0 30MHz_26.9GHz | -32.43      | -25         | Pass   |
| n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.22      | -25         | Pass   |
| n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM<br>QPSK_RB1@216 30MHz_26.9GHz | -31.85      | -25         | Pass   |
| n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM<br>QPSK_RB216@0 30MHz_26.9GHz | -31.91      | -25         | Pass   |
| n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32         | -25         | Pass   |
| n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@216 30MHz_26.9GHz | -32.45      | -25         | Pass   |
| n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB216@0 30MHz_26.9GHz | -32.24      | -25         | Pass   |
| n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.16      | -25         | Pass   |

| Mode                                                                 | Value (dBm) | Limit (dBm) | Result |
|----------------------------------------------------------------------|-------------|-------------|--------|
| n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM<br>QPSK_RB1@216 30MHz_26.9GHz  | -32.17      | -25         | Pass   |
| n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM<br>QPSK_RB216@0 30MHz_26.9GHz  | -32.2       | -25         | Pass   |
| n41_90MHz_30kHz_2541MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_26.9GHz          | -32.09      | -25         | Pass   |
| n41_90MHz_30kHz_2541MHz_DFT-s-OFDM<br>QPSK_RB1@244 30MHz_26.9GHz     | -32.27      | -25         | Pass   |
| n41_90MHz_30kHz_2541MHz_DFT-s-OFDM<br>QPSK_RB243@0 30MHz_26.9GHz     | -32.51      | -25         | Pass   |
| n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz    | -32.52      | -25         | Pass   |
| n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@244 30MHz_26.9GHz  | -32.6       | -25         | Pass   |
| n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB243@0 30MHz_26.9GHz  | -32.11      | -25         | Pass   |
| n41_90MHz_30kHz_2644.98MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz    | -32.35      | -25         | Pass   |
| n41_90MHz_30kHz_2644.98MHz_DFT-s-OFDM<br>QPSK_RB1@244 30MHz_26.9GHz  | -32.32      | -25         | Pass   |
| n41_90MHz_30kHz_2644.98MHz_DFT-s-OFDM<br>QPSK_RB243@0 30MHz_26.9GHz  | -32.44      | -25         | Pass   |
| n41_100MHz_30kHz_2546.01MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.5       | -25         | Pass   |
| n41_100MHz_30kHz_2546.01MHz_DFT-s-OFDM<br>QPSK_RB1@272 30MHz_26.9GHz | -32.42      | -25         | Pass   |
| n41_100MHz_30kHz_2546.01MHz_DFT-s-OFDM<br>QPSK_RB270@0 30MHz_26.9GHz | -32.62      | -25         | Pass   |
| n41_100MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz   | -32.54      | -25         | Pass   |
| n41_100MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB1@272 30MHz_26.9GHz | -32.48      | -25         | Pass   |
| n41_100MHz_30kHz_2592.99MHz_DFT-s-OFDM<br>QPSK_RB270@0 30MHz_26.9GHz | -31.95      | -25         | Pass   |
| n41_100MHz_30kHz_2640MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_26.9GHz      | -32         | -25         | Pass   |
| n41_100MHz_30kHz_2640MHz_DFT-s-OFDM<br>QPSK_RB1@272 30MHz_26.9GHz    | -32.29      | -25         | Pass   |
| n41_100MHz_30kHz_2640MHz_DFT-s-OFDM<br>QPSK_RB270@0 30MHz_26.9GHz    | -32.46      | -25         | Pass   |

**n66 , Normal**

| Mode                                                              | Value (dBm) | Limit (dBm) | Result |
|-------------------------------------------------------------------|-------------|-------------|--------|
| n66_5MHz_15kHz_1712.5MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_17.8GHz   | -24.01      | -13         | Pass   |
| n66_5MHz_15kHz_1712.5MHz_DFT-s-OFDM<br>QPSK_RB1@24 30MHz_17.8GHz  | -23.7       | -13         | Pass   |
| n66_5MHz_15kHz_1712.5MHz_DFT-s-OFDM<br>QPSK_RB25@0 30MHz_17.8GHz  | -23.91      | -13         | Pass   |
| n66_5MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_17.8GHz       | -22.94      | -13         | Pass   |
| n66_5MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_17.8GHz       | -23.97      | -13         | Pass   |
| n66_5MHz_15kHz_1777.5MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_17.8GHz   | -23.36      | -13         | Pass   |
| n66_5MHz_15kHz_1777.5MHz_DFT-s-OFDM<br>QPSK_RB1@24 30MHz_17.8GHz  | -24.42      | -13         | Pass   |
| n66_5MHz_15kHz_1777.5MHz_DFT-s-OFDM<br>QPSK_RB25@0 30MHz_17.8GHz  | -24.15      | -13         | Pass   |
| n66_10MHz_15kHz_1715MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz       | -24.28      | -13         | Pass   |
| n66_10MHz_15kHz_1715MHz_DFT-s-OFDM<br>QPSK_RB1@51 30MHz_17.8GHz   | -23.81      | -13         | Pass   |
| n66_10MHz_15kHz_1715MHz_DFT-s-OFDM<br>QPSK_RB50@0 30MHz_17.8GHz   | -23.88      | -13         | Pass   |
| n66_10MHz_15kHz_1745MHz_DFT-s-OFDM<br>QPSK_RB1@51 30MHz_17.8GHz   | -23.07      | -13         | Pass   |
| n66_10MHz_15kHz_1745MHz_DFT-s-OFDM<br>QPSK_RB50@0 30MHz_17.8GHz   | -23.75      | -13         | Pass   |
| n66_10MHz_15kHz_1775MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz       | -24.24      | -13         | Pass   |
| n66_10MHz_15kHz_1775MHz_DFT-s-OFDM<br>QPSK_RB1@51 30MHz_17.8GHz   | -23.08      | -13         | Pass   |
| n66_10MHz_15kHz_1775MHz_DFT-s-OFDM<br>QPSK_RB50@0 30MHz_17.8GHz   | -23.63      | -13         | Pass   |
| n66_15MHz_15kHz_1717.5MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_17.8GHz  | -23.36      | -13         | Pass   |
| n66_15MHz_15kHz_1717.5MHz_DFT-s-OFDM<br>QPSK_RB1@78 30MHz_17.8GHz | -24.13      | -13         | Pass   |
| n66_15MHz_15kHz_1717.5MHz_DFT-s-OFDM<br>QPSK_RB75@0 30MHz_17.8GHz | -24.04      | -13         | Pass   |

| Mode                                                            | Value (dBm) | Limit (dBm) | Result |
|-----------------------------------------------------------------|-------------|-------------|--------|
| n66_15MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz     | -23.22      | -13         | Pass   |
| n66_15MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_17.8GHz    | -22.52      | -13         | Pass   |
| n66_15MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_17.8GHz    | -23.84      | -13         | Pass   |
| n66_15MHz_15kHz_1772.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_17.8GHz  | -23.38      | -13         | Pass   |
| n66_15MHz_15kHz_1772.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_17.8GHz  | -23.85      | -13         | Pass   |
| n66_20MHz_15kHz_1720MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz     | -23.55      | -13         | Pass   |
| n66_20MHz_15kHz_1720MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_17.8GHz   | -23.89      | -13         | Pass   |
| n66_20MHz_15kHz_1720MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_17.8GHz   | -23.81      | -13         | Pass   |
| n66_20MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_17.8GHz   | -23.61      | -13         | Pass   |
| n66_20MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_17.8GHz   | -24.13      | -13         | Pass   |
| n66_20MHz_15kHz_1770MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_17.8GHz   | -23.33      | -13         | Pass   |
| n66_25MHz_15kHz_1722.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz   | -23.62      | -13         | Pass   |
| n66_25MHz_15kHz_1722.5MHz_DFT-s-OFDM QPSK_RB1@132 30MHz_17.8GHz | -24.33      | -13         | Pass   |
| n66_25MHz_15kHz_1722.5MHz_DFT-s-OFDM QPSK_RB128@0 30MHz_17.8GHz | -23.3       | -13         | Pass   |
| n66_25MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz     | -23.07      | -13         | Pass   |
| n66_25MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@132 30MHz_17.8GHz   | -23.93      | -13         | Pass   |
| n66_25MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB128@0 30MHz_17.8GHz   | -24.19      | -13         | Pass   |
| n66_30MHz_15kHz_1725MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz     | -23.86      | -13         | Pass   |
| n66_30MHz_15kHz_1725MHz_DFT-s-OFDM QPSK_RB1@159 30MHz_17.8GHz   | -23.62      | -13         | Pass   |
| n66_30MHz_15kHz_1725MHz_DFT-s-OFDM QPSK_RB160@0 30MHz_17.8GHz   | -23.39      | -13         | Pass   |
| n66_30MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz     | -24.09      | -13         | Pass   |

| Mode                                                             | Value (dBm) | Limit (dBm) | Result |
|------------------------------------------------------------------|-------------|-------------|--------|
| n66_30MHz_15kHz_1745MHz_DFT-s-OFDM<br>QPSK_RB1@159 30MHz_17.8GHz | -23.41      | -13         | Pass   |
| n66_30MHz_15kHz_1745MHz_DFT-s-OFDM<br>QPSK_RB160@0 30MHz_17.8GHz | -22.63      | -13         | Pass   |
| n66_30MHz_15kHz_1765MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz      | -23.93      | -13         | Pass   |
| n66_30MHz_15kHz_1765MHz_DFT-s-OFDM<br>QPSK_RB1@159 30MHz_17.8GHz | -23.84      | -13         | Pass   |
| n66_30MHz_15kHz_1765MHz_DFT-s-OFDM<br>QPSK_RB160@0 30MHz_17.8GHz | -23.47      | -13         | Pass   |
| n66_40MHz_15kHz_1730MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz      | -23.33      | -13         | Pass   |
| n66_40MHz_15kHz_1730MHz_DFT-s-OFDM<br>QPSK_RB1@215 30MHz_17.8GHz | -23.76      | -13         | Pass   |
| n66_40MHz_15kHz_1730MHz_DFT-s-OFDM<br>QPSK_RB216@0 30MHz_17.8GHz | -22.85      | -13         | Pass   |
| n66_40MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz      | -24.02      | -13         | Pass   |
| n66_40MHz_15kHz_1745MHz_DFT-s-OFDM<br>QPSK_RB1@215 30MHz_17.8GHz | -23.94      | -13         | Pass   |
| n66_40MHz_15kHz_1745MHz_DFT-s-OFDM<br>QPSK_RB216@0 30MHz_17.8GHz | -24.03      | -13         | Pass   |
| n66_40MHz_15kHz_1760MHz_DFT-s-OFDM<br>QPSK_RB216@0 30MHz_17.8GHz | -24.12      | -13         | Pass   |
| n66_5MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz       | -23.29      | -13         | Pass   |
| n66_10MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz      | -24.17      | -13         | Pass   |
| n66_15MHz_15kHz_1772.5MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_17.8GHz | -23.26      | -13         | Pass   |
| n66_20MHz_15kHz_1745MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz      | -23.76      | -13         | Pass   |
| n66_20MHz_15kHz_1770MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz      | -23.91      | -13         | Pass   |
| n66_20MHz_15kHz_1770MHz_DFT-s-OFDM<br>QPSK_RB1@105 30MHz_17.8GHz | -23.74      | -13         | Pass   |
| n66_40MHz_15kHz_1760MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_17.8GHz      | -23.91      | -13         | Pass   |
| n66_40MHz_15kHz_1760MHz_DFT-s-OFDM<br>QPSK_RB1@215 30MHz_17.8GHz | -24.17      | -13         | Pass   |
| n66_25MHz_15kHz_1767.5MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_17.8GHz | -23.63      | -13         | Pass   |

| Mode                                                               | Value (dBm) | Limit (dBm) | Result |
|--------------------------------------------------------------------|-------------|-------------|--------|
| n66_25MHz_15kHz_1767.5MHz_DFT-s-OFDM<br>QPSK_RB128@0 30MHz_17.8GHz | -23.56      | -13         | Pass   |
| n66_25MHz_15kHz_1767.5MHz_DFT-s-OFDM<br>QPSK_RB1@132 30MHz_17.8GHz | -23.41      | -13         | Pass   |


**n71 , Normal**

| Mode                                                             | Value (dBm) | Limit (dBm) | Result |
|------------------------------------------------------------------|-------------|-------------|--------|
| n71_5MHz_15kHz_665.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz      | -25.23      | -13         | Pass   |
| n71_5MHz_15kHz_665.5MHz_DFT-s-OFDM<br>QPSK_RB1@24 30MHz_6.98GHz  | -24.94      | -13         | Pass   |
| n71_5MHz_15kHz_665.5MHz_DFT-s-OFDM<br>QPSK_RB25@0 30MHz_6.98GHz  | -24.93      | -13         | Pass   |
| n71_5MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz      | -25.06      | -13         | Pass   |
| n71_5MHz_15kHz_680.5MHz_DFT-s-OFDM<br>QPSK_RB1@24 30MHz_6.98GHz  | -24         | -13         | Pass   |
| n71_5MHz_15kHz_680.5MHz_DFT-s-OFDM<br>QPSK_RB25@0 30MHz_6.98GHz  | -24.54      | -13         | Pass   |
| n71_5MHz_15kHz_695.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz      | -24.06      | -13         | Pass   |
| n71_5MHz_15kHz_695.5MHz_DFT-s-OFDM<br>QPSK_RB1@24 30MHz_6.98GHz  | -20.98      | -13         | Pass   |
| n71_5MHz_15kHz_695.5MHz_DFT-s-OFDM<br>QPSK_RB25@0 30MHz_6.98GHz  | -24.96      | -13         | Pass   |
| n71_10MHz_15kHz_668MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz       | -24.11      | -13         | Pass   |
| n71_10MHz_15kHz_668MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_6.98GHz      | -24.56      | -13         | Pass   |
| n71_10MHz_15kHz_668MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_6.98GHz      | -24.31      | -13         | Pass   |
| n71_10MHz_15kHz_680.5MHz_DFT-s-OFDM<br>QPSK_RB1@0 30MHz_6.98GHz  | -25.18      | -13         | Pass   |
| n71_10MHz_15kHz_680.5MHz_DFT-s-OFDM<br>QPSK_RB1@51 30MHz_6.98GHz | -25.22      | -13         | Pass   |
| n71_10MHz_15kHz_680.5MHz_DFT-s-OFDM<br>QPSK_RB50@0 30MHz_6.98GHz | -25.03      | -13         | Pass   |
| n71_10MHz_15kHz_693MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz       | -24.56      | -13         | Pass   |
| n71_10MHz_15kHz_693MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_6.98GHz      | -24.38      | -13         | Pass   |


| Mode                                                           | Value (dBm) | Limit (dBm) | Result |
|----------------------------------------------------------------|-------------|-------------|--------|
| n71_10MHz_15kHz_693MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_6.98GHz    | -24.86      | -13         | Pass   |
| n71_15MHz_15kHz_670.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz   | -23.99      | -13         | Pass   |
| n71_15MHz_15kHz_670.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_6.98GHz  | -24.66      | -13         | Pass   |
| n71_15MHz_15kHz_670.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_6.98GHz  | -24.97      | -13         | Pass   |
| n71_15MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz   | -24.62      | -13         | Pass   |
| n71_15MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_6.98GHz  | -24.67      | -13         | Pass   |
| n71_15MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_6.98GHz  | -24.54      | -13         | Pass   |
| n71_15MHz_15kHz_690.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz   | -25.1       | -13         | Pass   |
| n71_15MHz_15kHz_690.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_6.98GHz  | -25.1       | -13         | Pass   |
| n71_15MHz_15kHz_690.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_6.98GHz  | -24.66      | -13         | Pass   |
| n71_20MHz_15kHz_673MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz     | -24.75      | -13         | Pass   |
| n71_20MHz_15kHz_673MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_6.98GHz   | -23.99      | -13         | Pass   |
| n71_20MHz_15kHz_673MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_6.98GHz   | -24.67      | -13         | Pass   |
| n71_20MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz   | -22.86      | -13         | Pass   |
| n71_20MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_6.98GHz | -24.12      | -13         | Pass   |
| n71_20MHz_15kHz_680.5MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_6.98GHz | -23.95      | -13         | Pass   |
| n71_20MHz_15kHz_688MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_6.98GHz     | -24.77      | -13         | Pass   |
| n71_20MHz_15kHz_688MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_6.98GHz   | -24.57      | -13         | Pass   |
| n71_20MHz_15kHz_688MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_6.98GHz   | -25.13      | -13         | Pass   |

n41 , Normal


n41\_10MHz 30kHz 2501.01MHz DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_26.9GHz

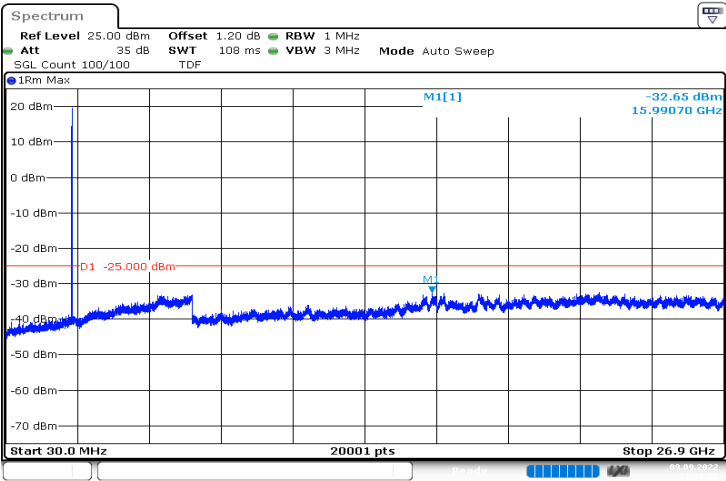


n41\_10MHz 30kHz 2501.01MHz DFT-s-OFDM  
QPSK\_RB1@23|30MHz\_26.9GHz

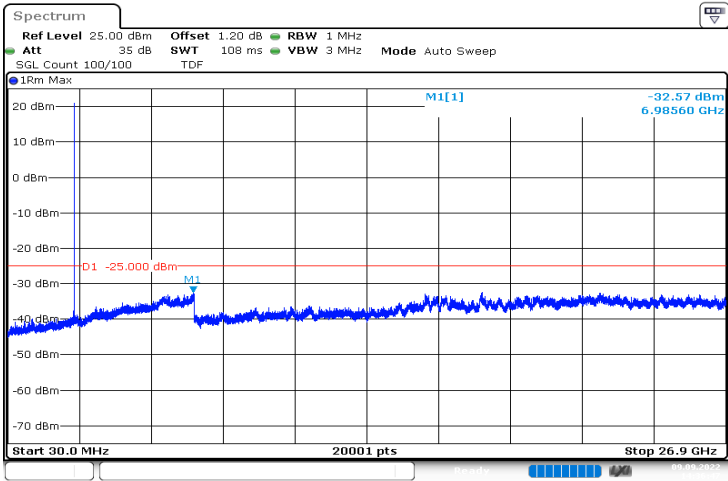


n41\_10MHz 30kHz 2501.01MHz DFT-s-OFDM  
QPSK\_RB24@0|30MHz\_26.9GHz

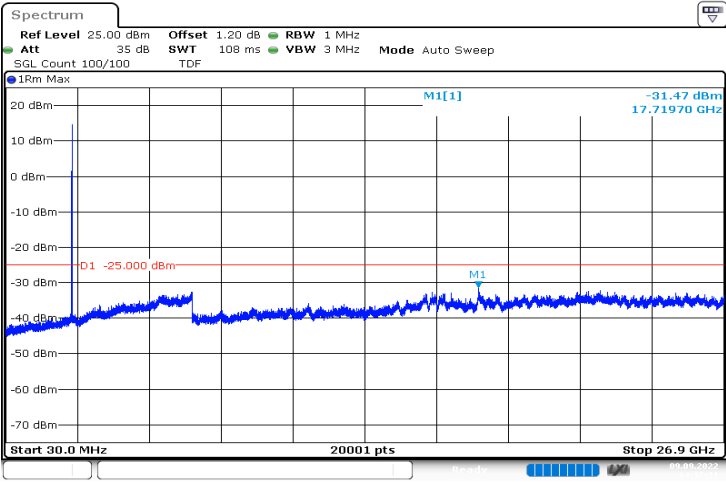


n41\_10MHz 30kHz 2592.99MHz DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_26.9GHz

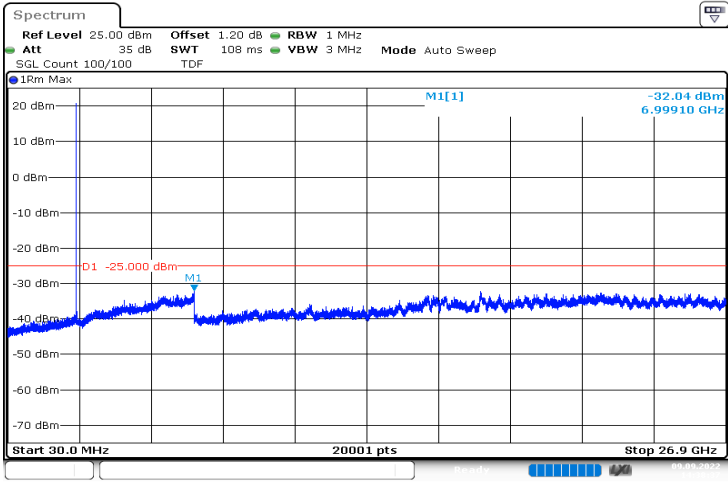


n41\_10MHz 30kHz 2592.99MHz DFT-s-OFDM  
QPSK\_RB1@23|30MHz\_26.9GHz

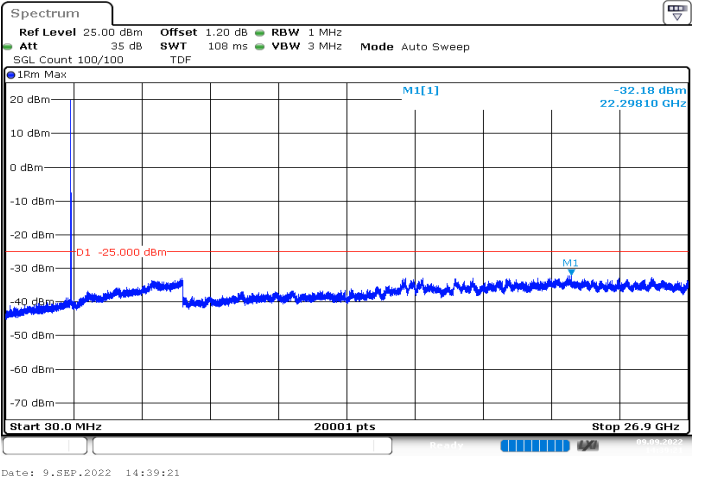

n41\_10MHz 30kHz 2592.99MHz DFT-s-OFDM  
QPSK\_RB24@0|30MHz\_26.9GHz

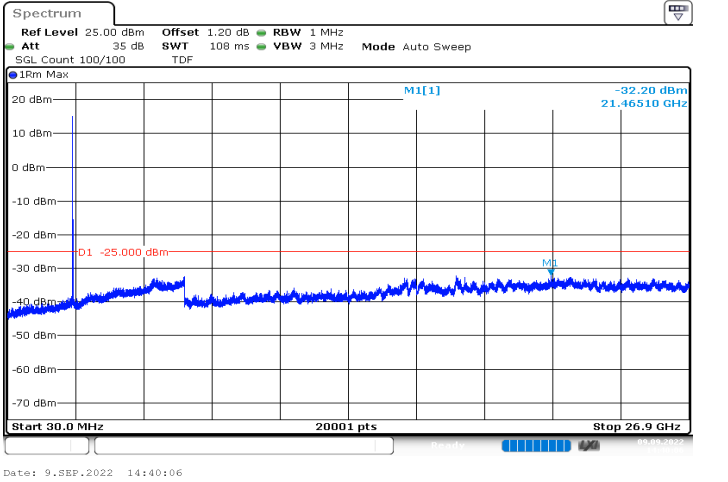


n41\_10MHz\_30kHz\_2685MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_26.9GHz

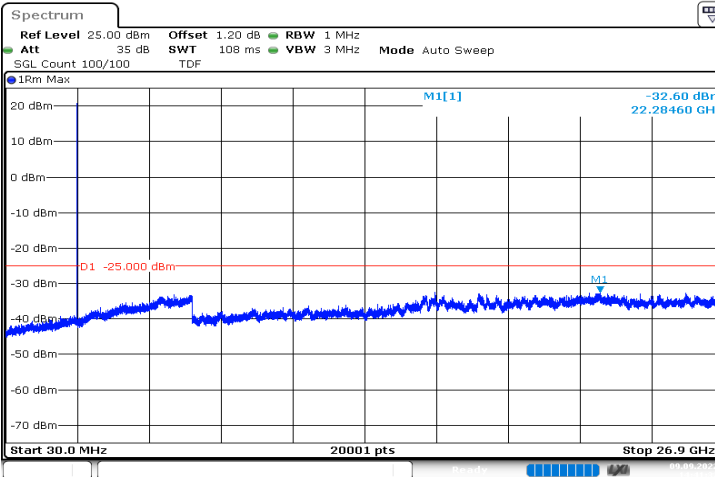


Date: 9.SEP.2022 14:41:32

n41\_10MHz\_30kHz\_2685MHz\_DFT-s-OFDM  
QPSK\_RB1@23|30MHz\_26.9GHz

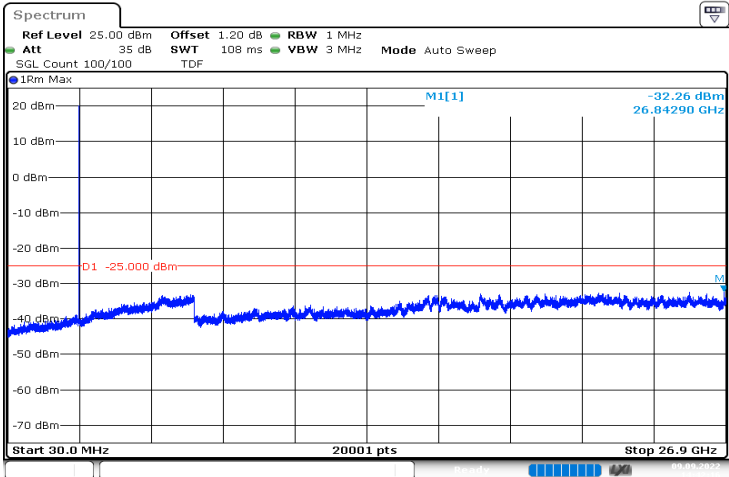


Date: 9.SEP.2022 14:42:16

n41\_10MHz\_30kHz\_2685MHz\_DFT-s-OFDM  
QPSK\_RB24@0|30MHz\_26.9GHz

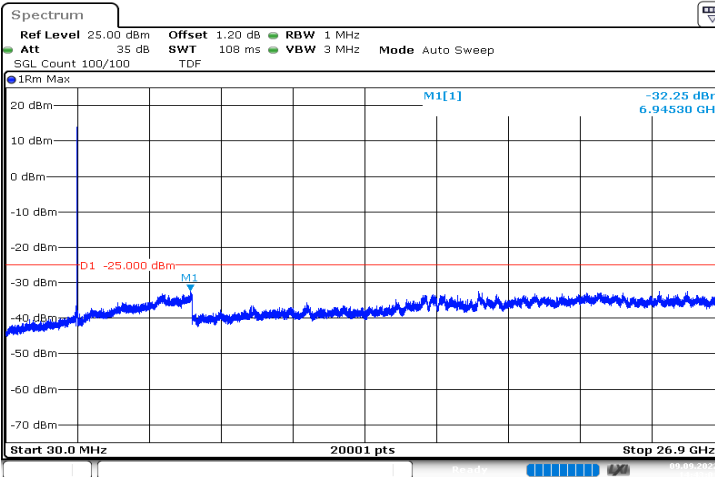


Date: 9.SEP.2022 14:43:01

n41\_15MHz\_30kHz\_2503.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_26.9GHz

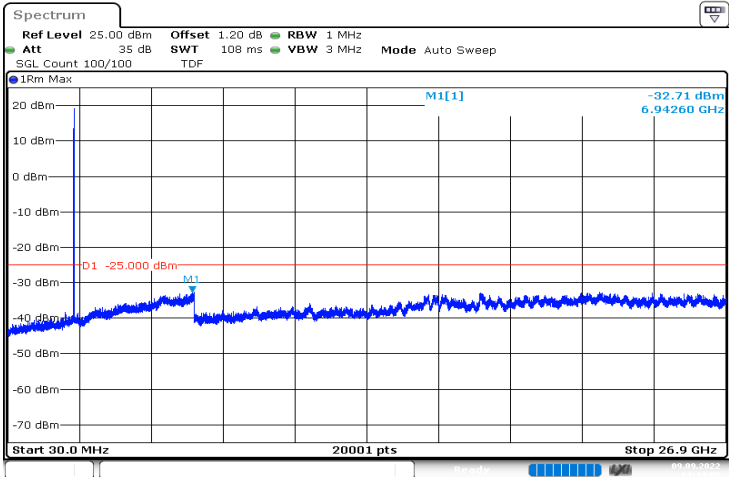


Date: 9.SEP.2022 14:44:08

n41\_15MHz\_30kHz\_2503.5MHz\_DFT-s-OFDM  
QPSK\_RB1@37|30MHz\_26.9GHz






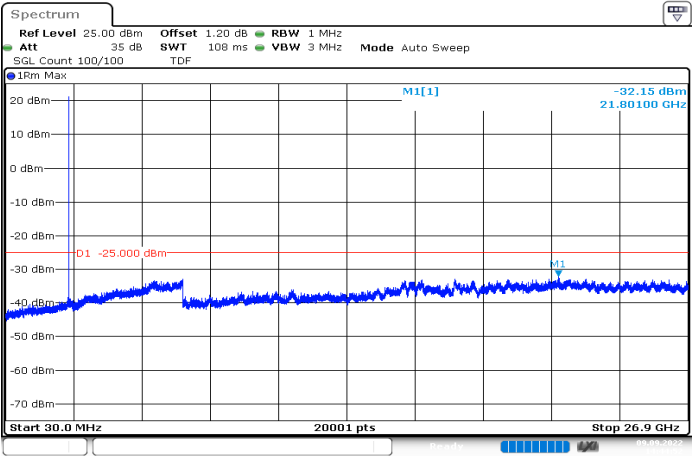








Date: 9.SEP.2022 14:44:52

n41\_15MHz\_30kHz\_2503.5MHz\_DFT-s-OFDM  
QPSK\_RB36@0|30MHz\_26.9GHz

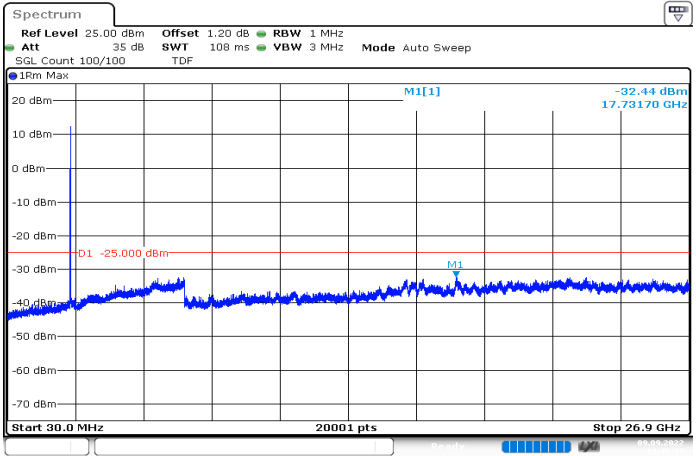


Date: 9.SEP.2022 14:45:38

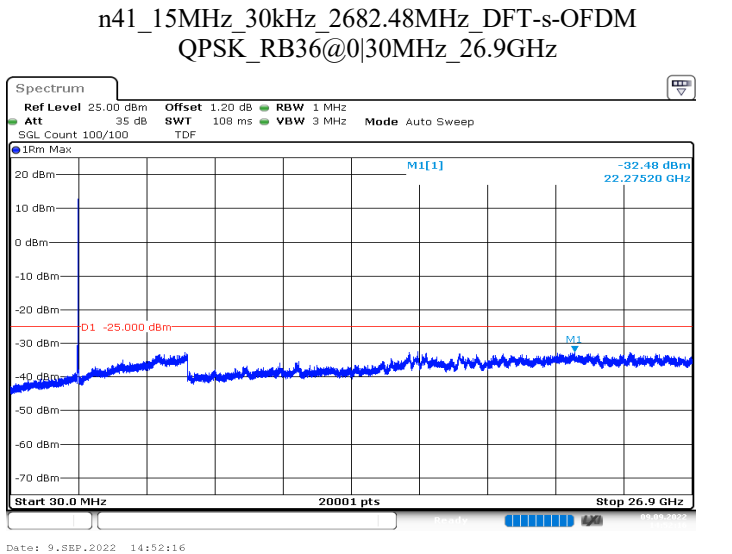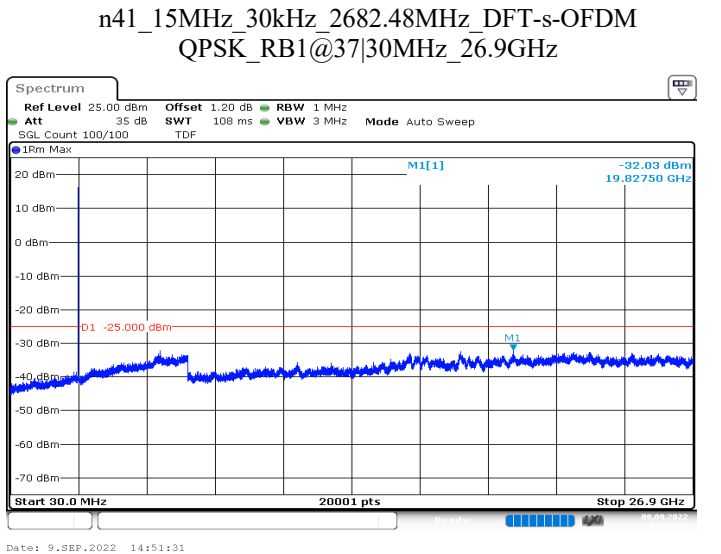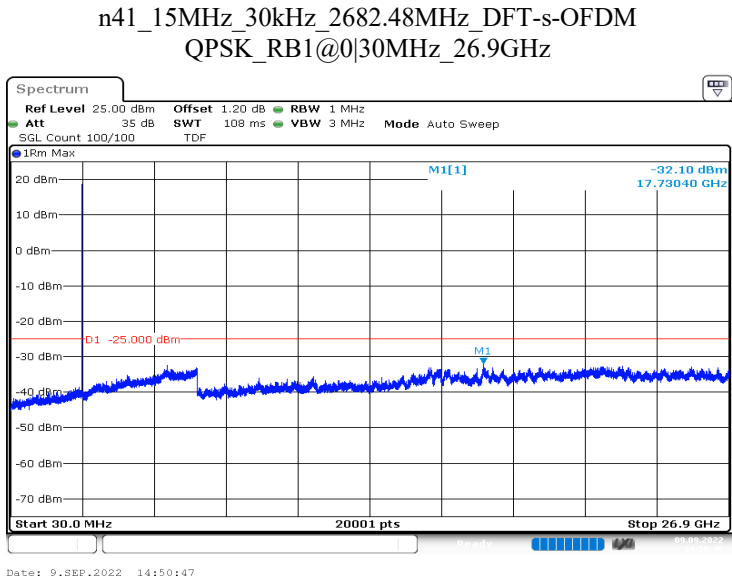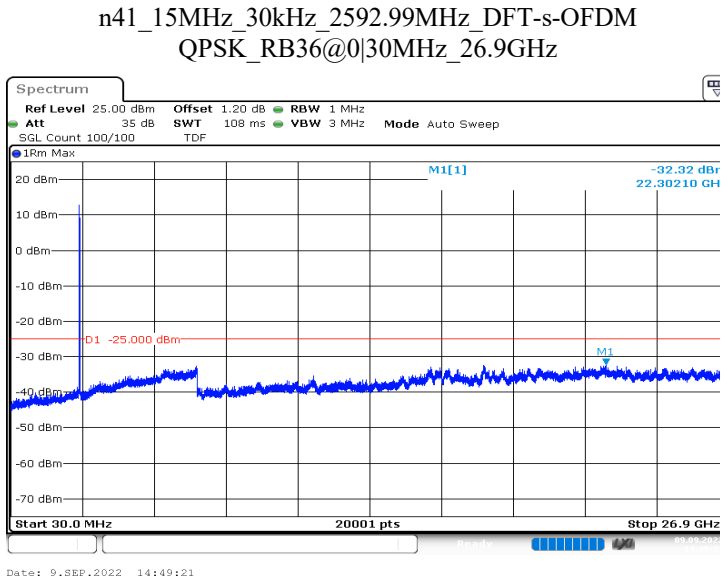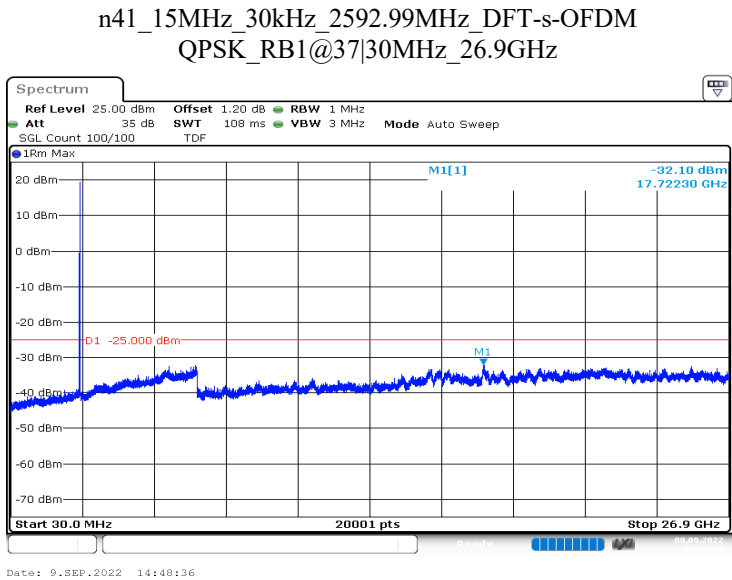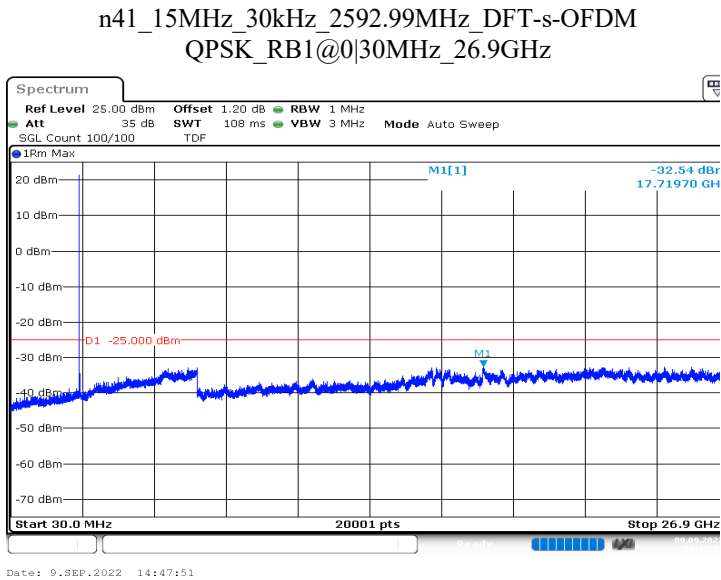

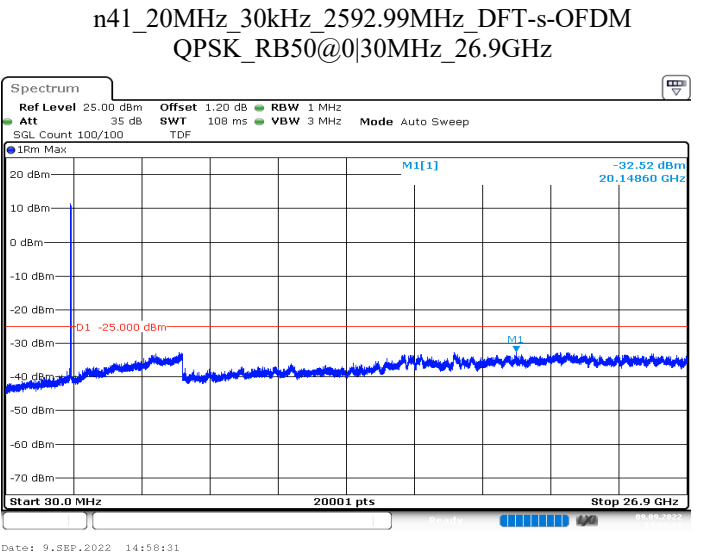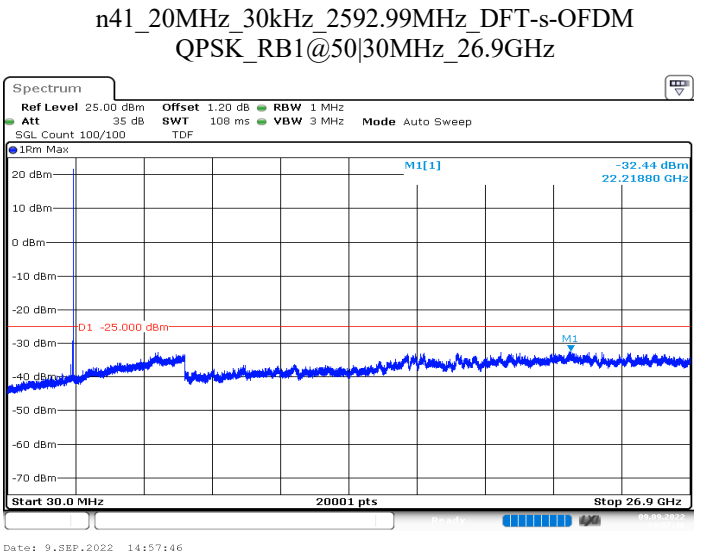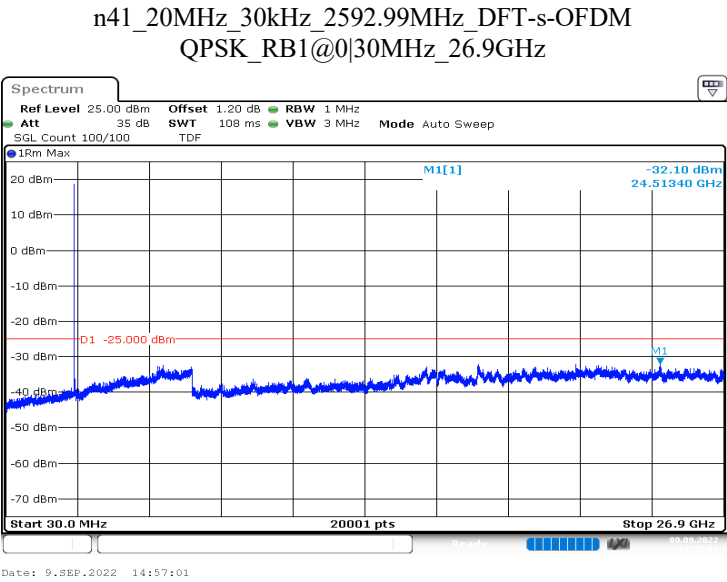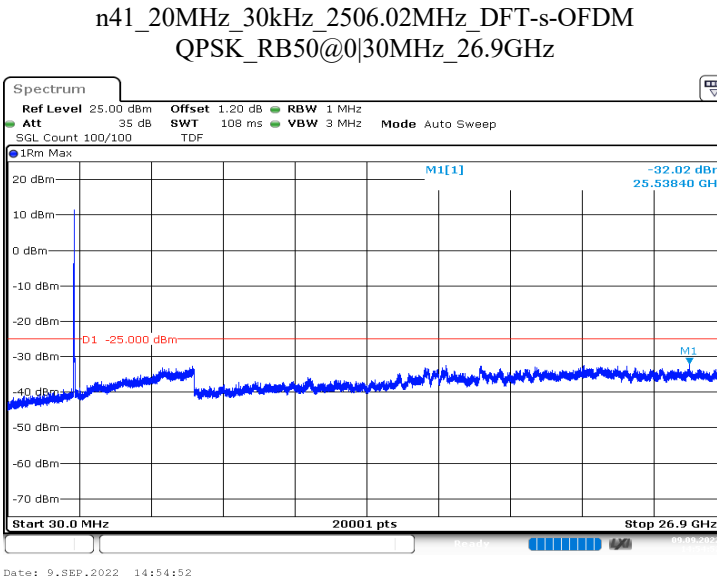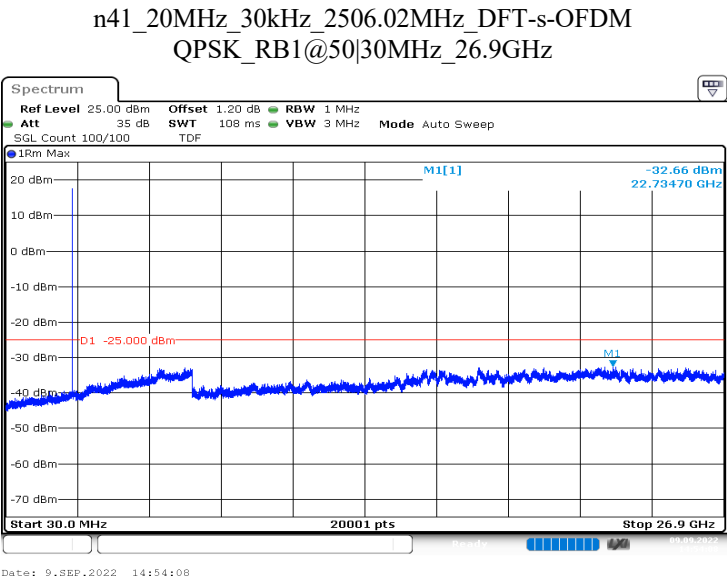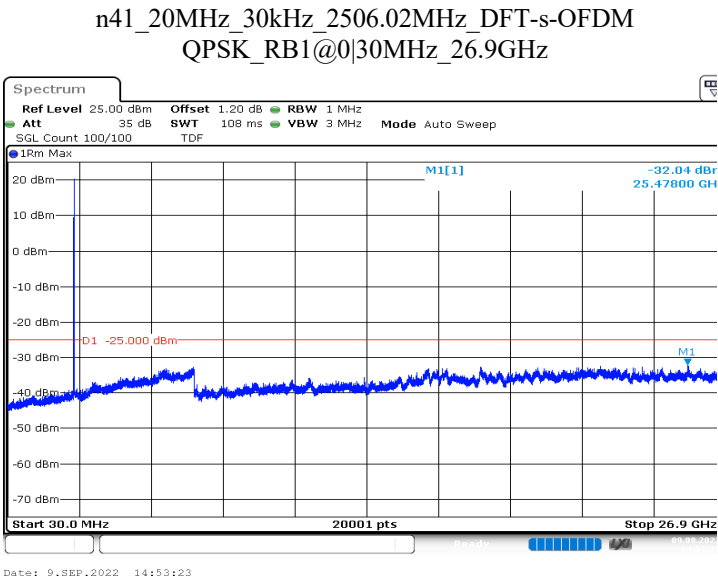


n41\_20MHz\_30kHz\_2679.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_26.9GHz

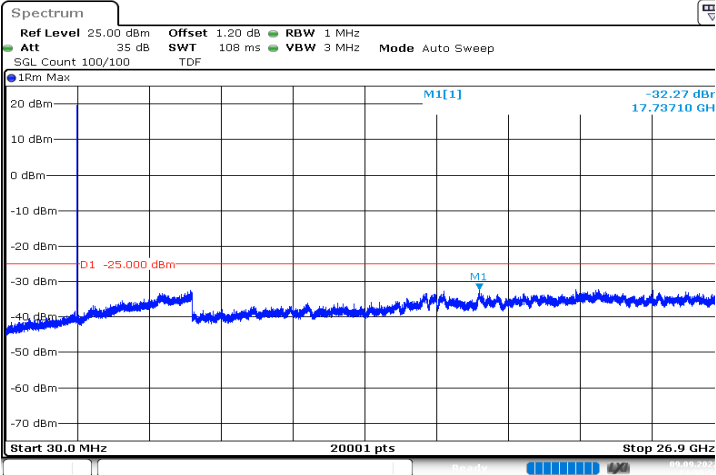


Date: 9.SEP.2022 14:59:56

n41\_20MHz\_30kHz\_2679.99MHz\_DFT-s-OFDM  
QPSK\_RB1@50|30MHz\_26.9GHz

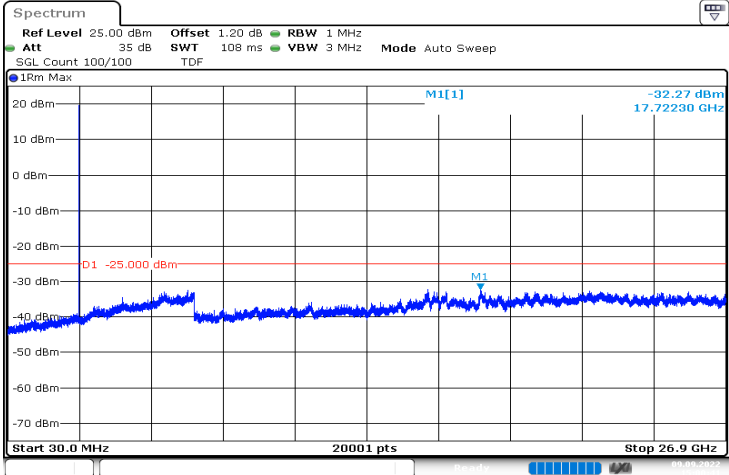


Date: 9.SEP.2022 15:00:41

n41\_20MHz\_30kHz\_2679.99MHz\_DFT-s-OFDM  
QPSK\_RB50@0|30MHz\_26.9GHz

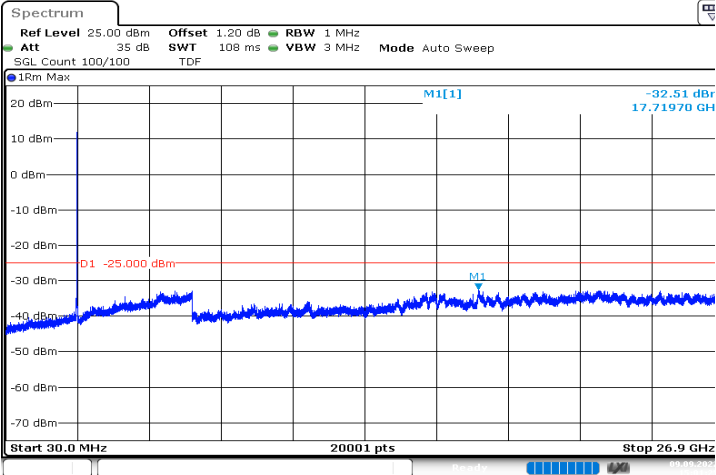


Date: 9.SEP.2022 15:01:25

n41\_40MHz\_30kHz\_2516.01MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_26.9GHz

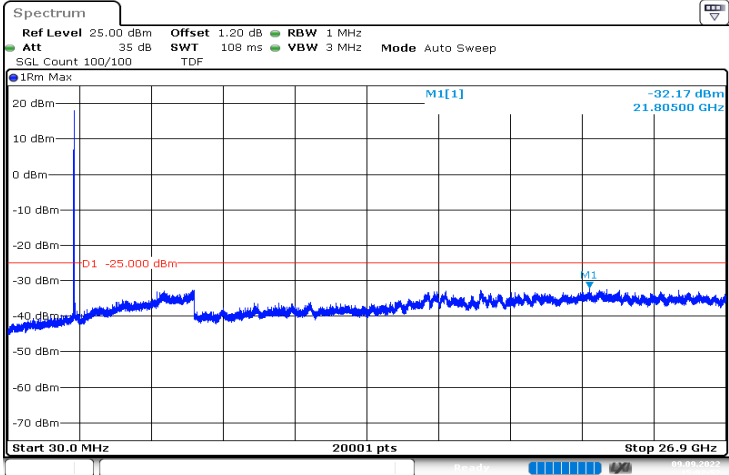


Date: 9.SEP.2022 15:02:52

n41\_40MHz\_30kHz\_2516.01MHz\_DFT-s-OFDM  
QPSK\_RB1@105|30MHz\_26.9GHz






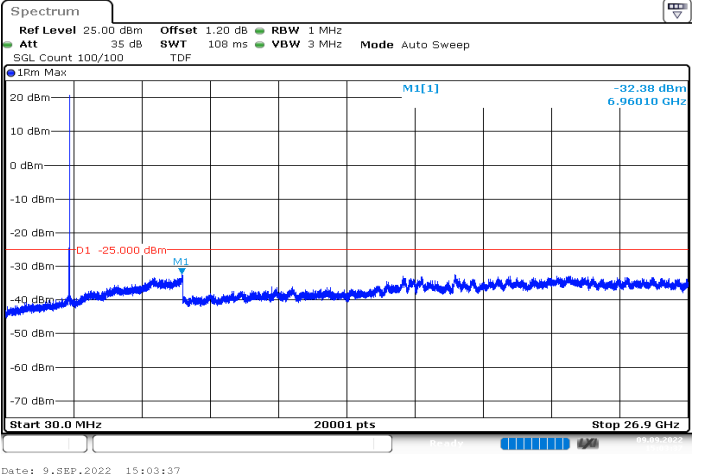








Date: 9.SEP.2022 15:03:37







n41\_40MHz\_30kHz\_2516.01MHz\_DFT-s-OFDM  
QPSK\_RB100@0|30MHz\_26.9GHz






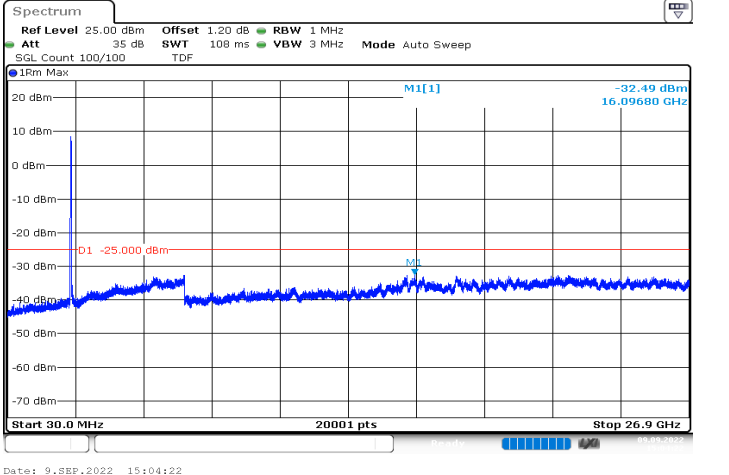


Date: 9.SEP.2022 15:04:22

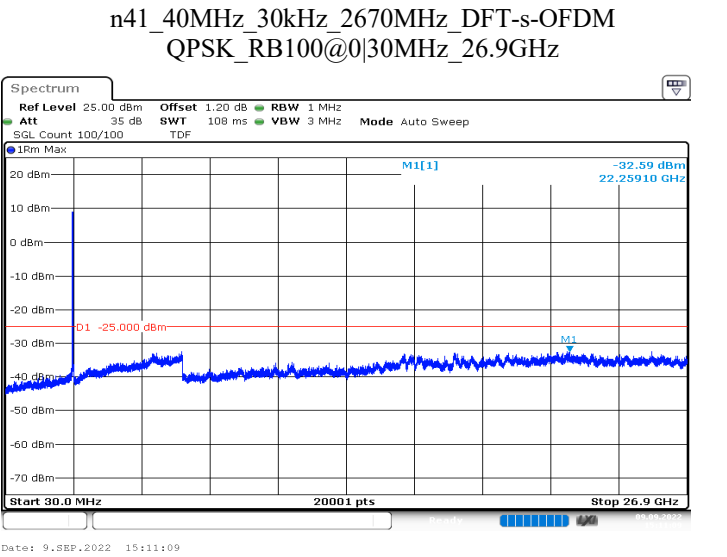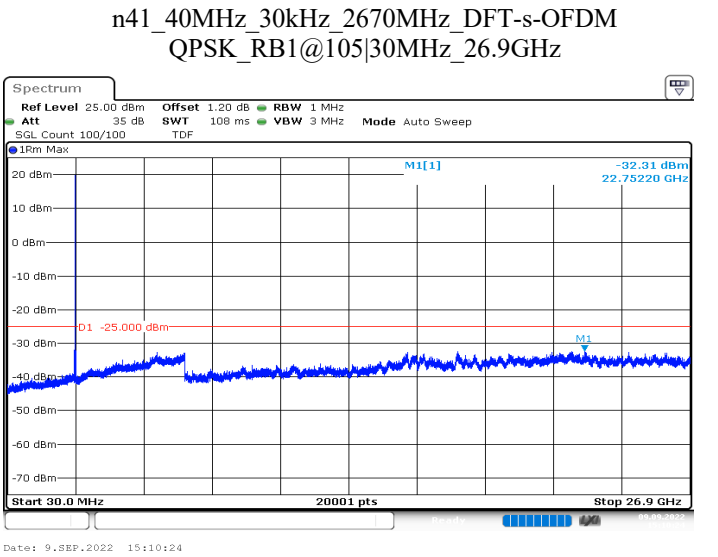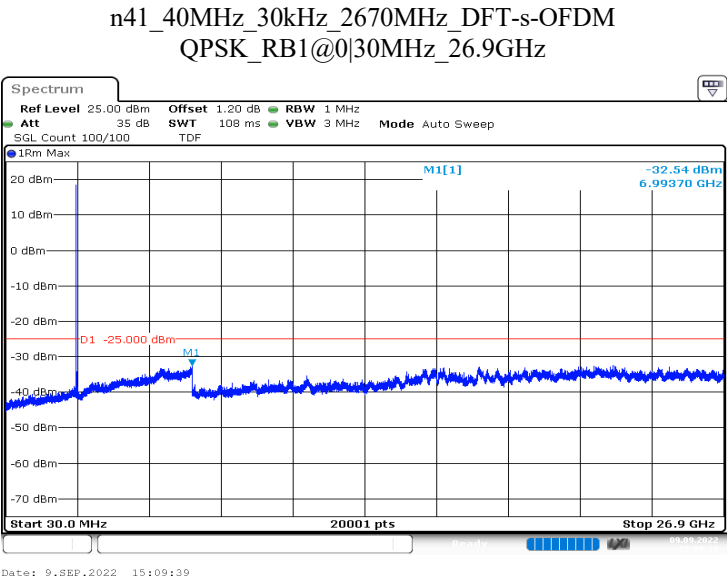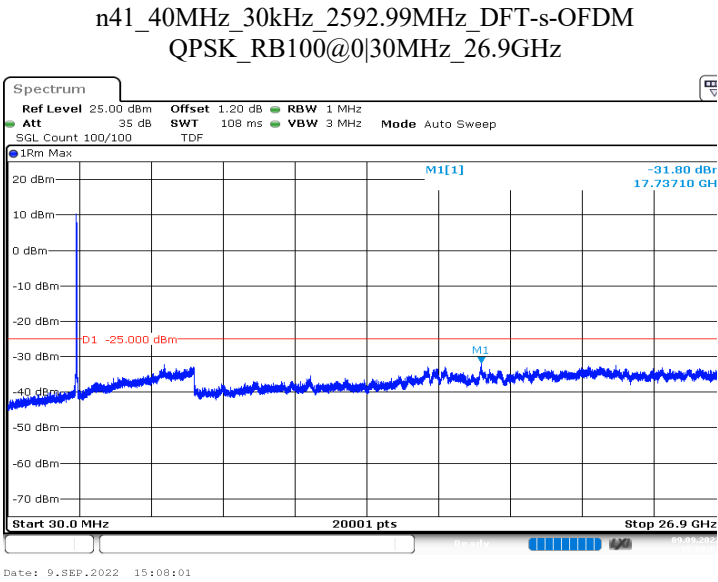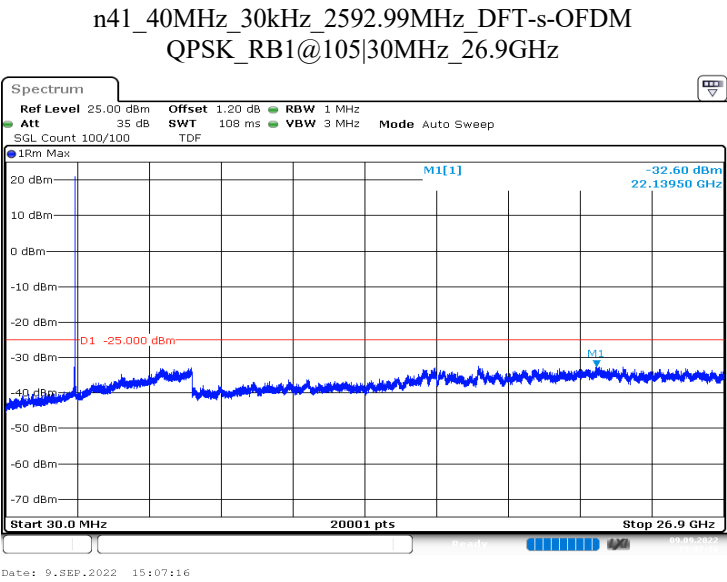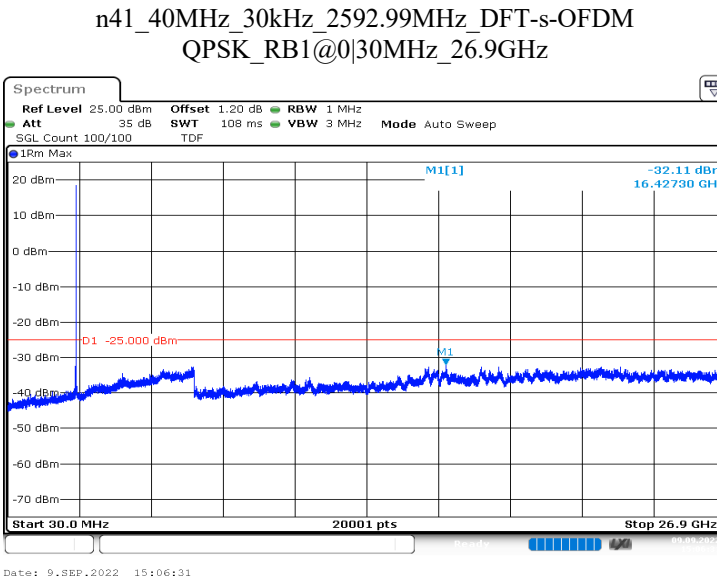


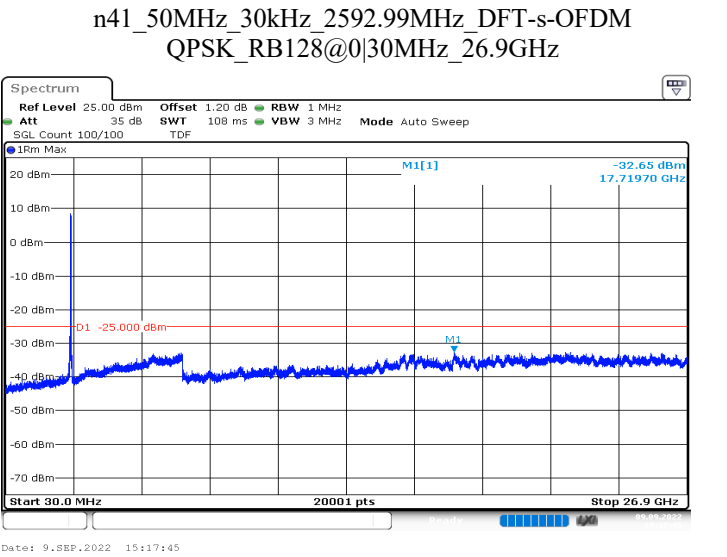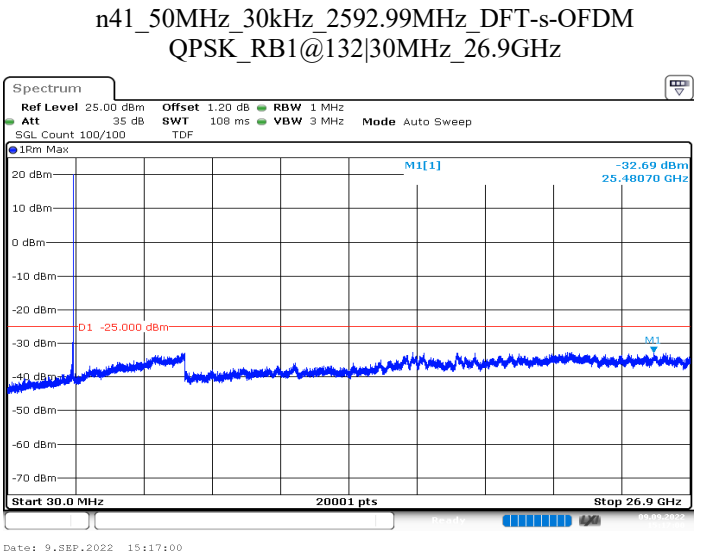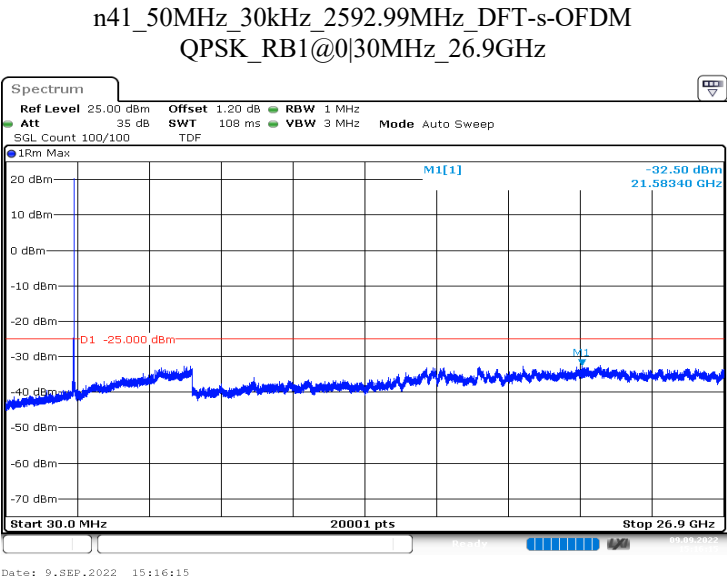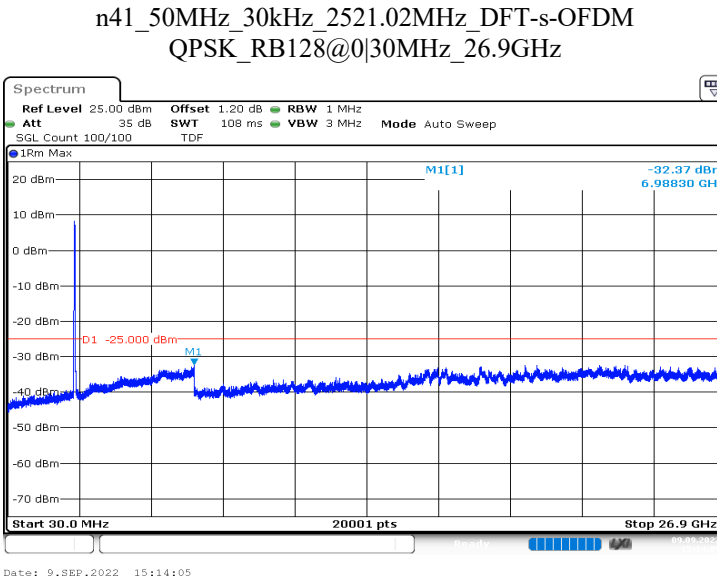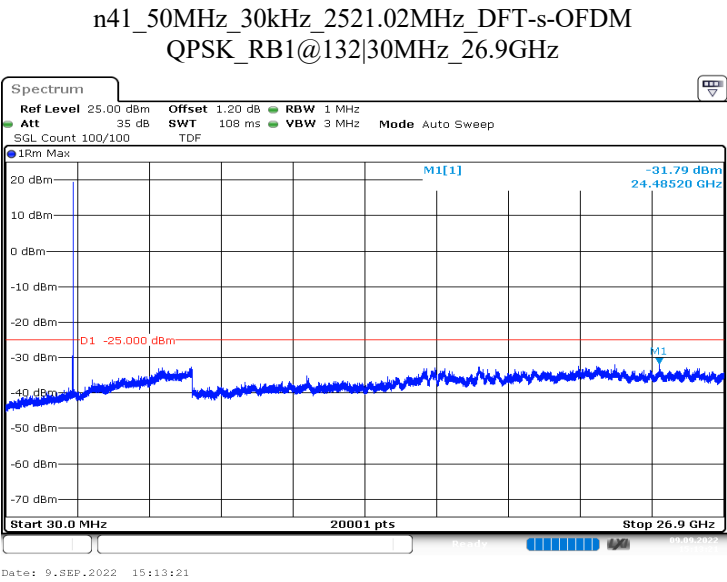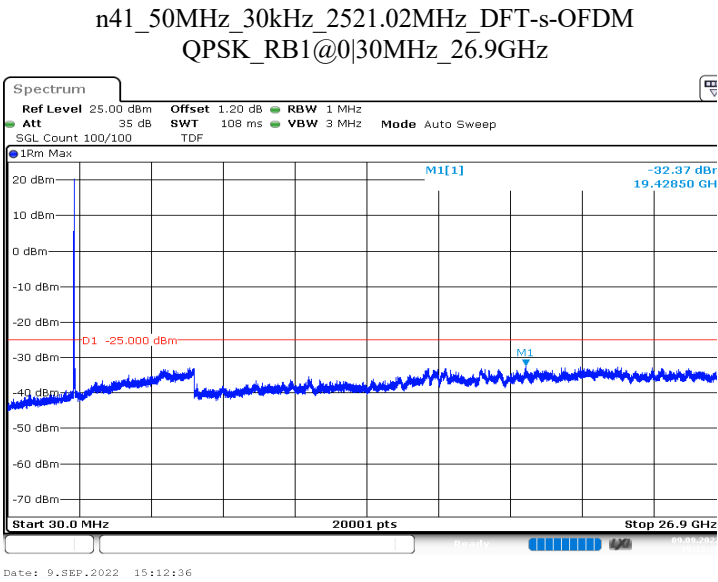

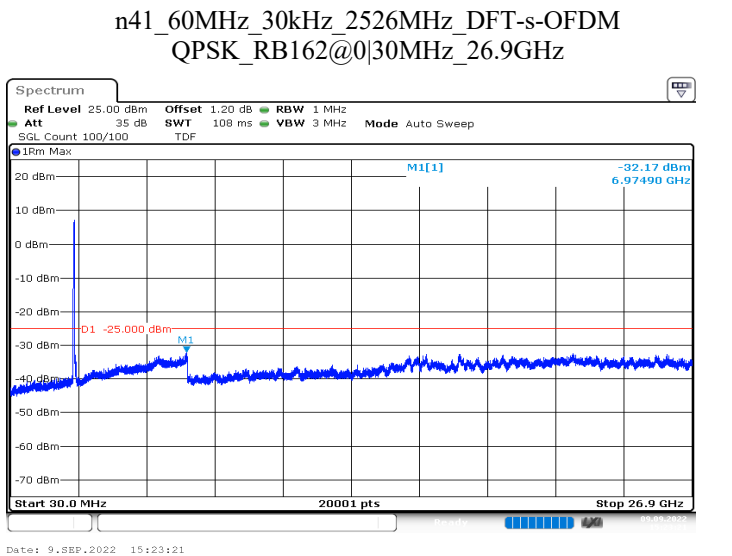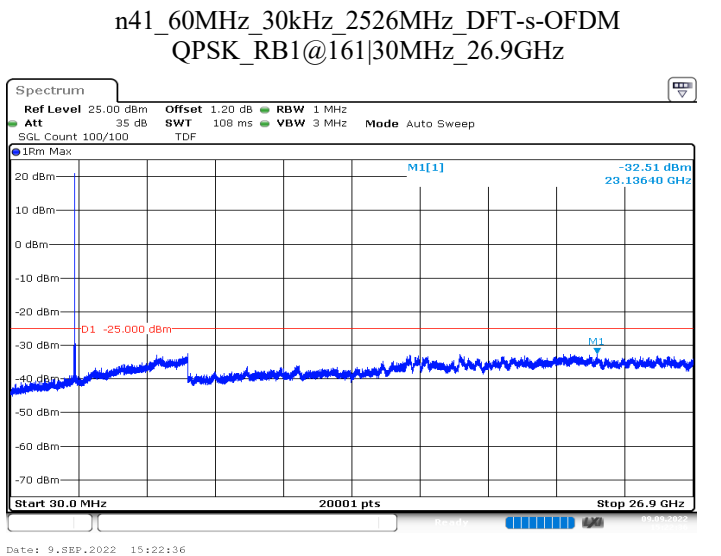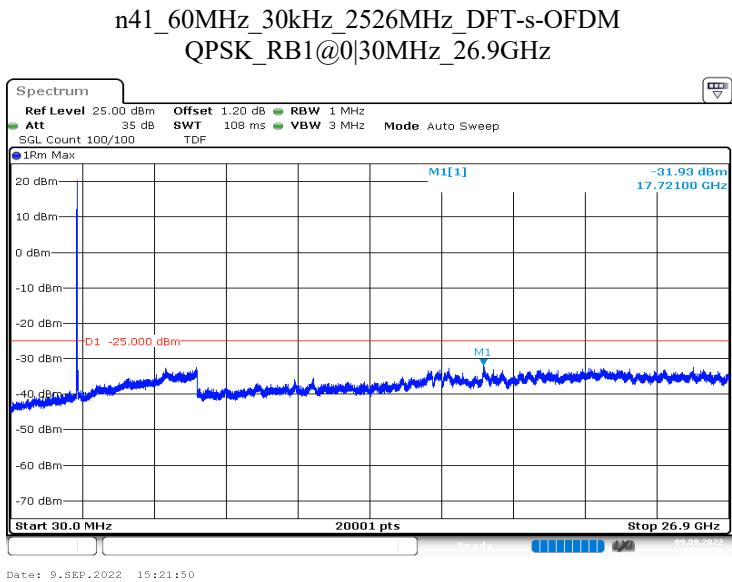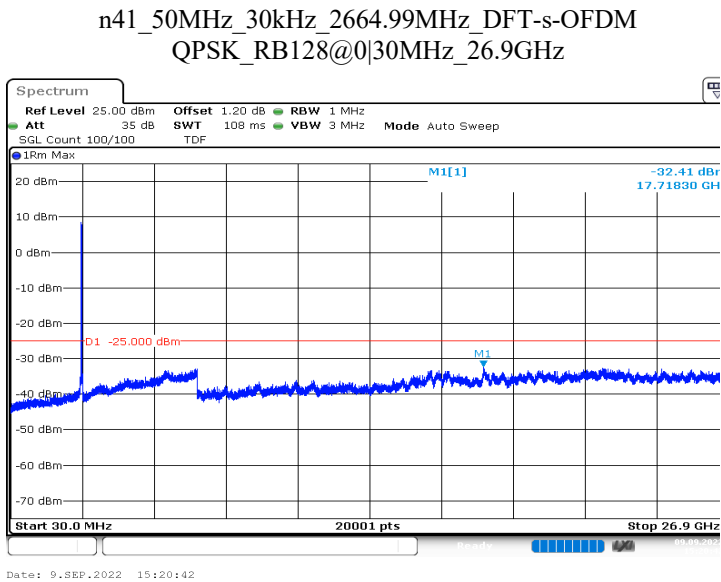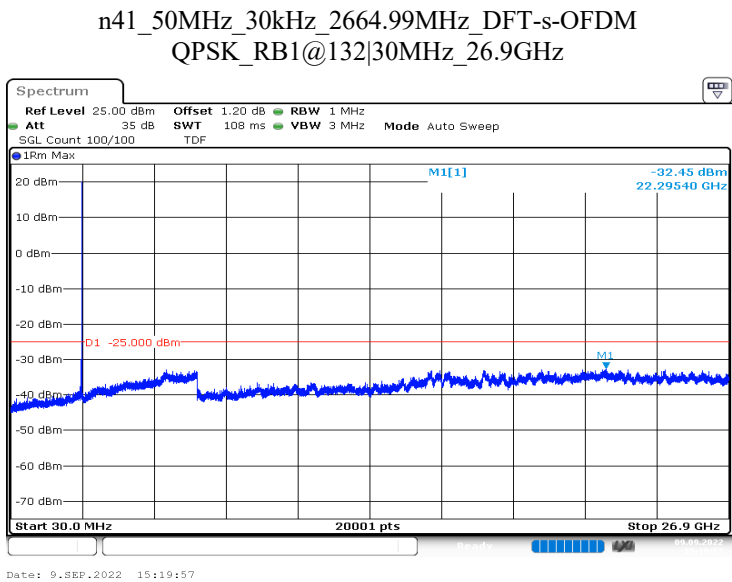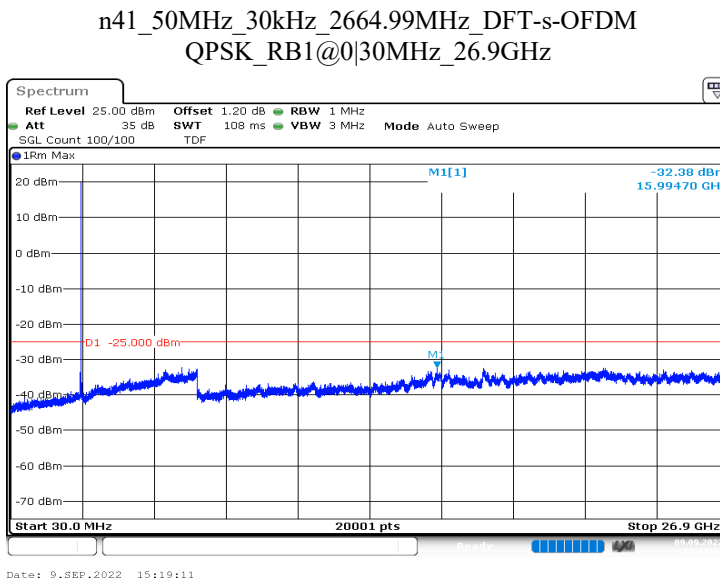

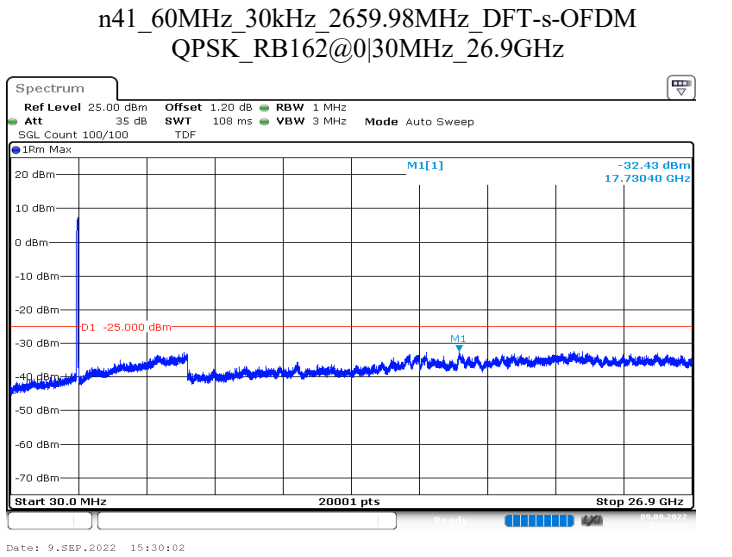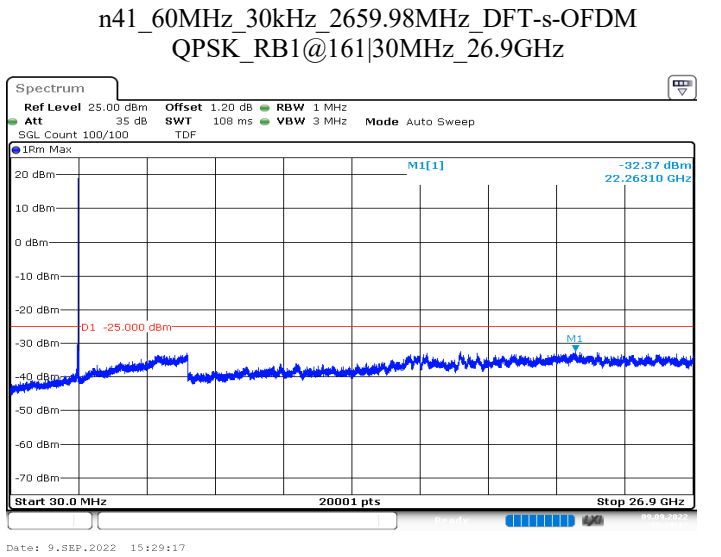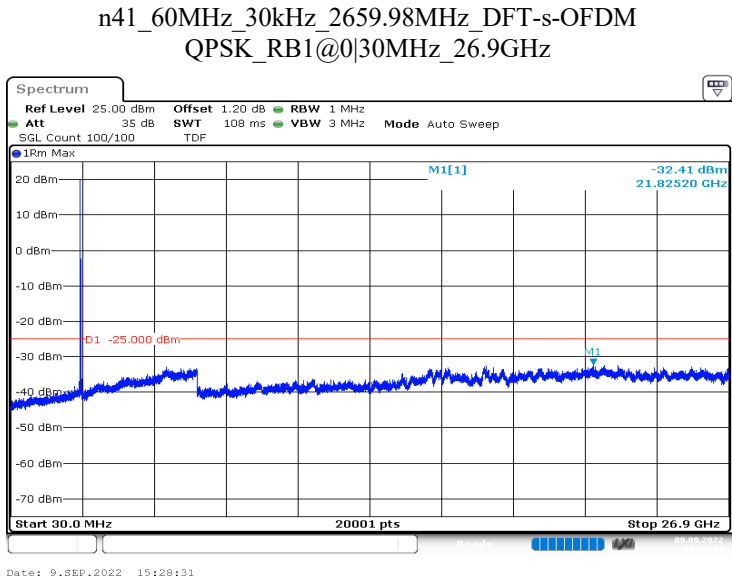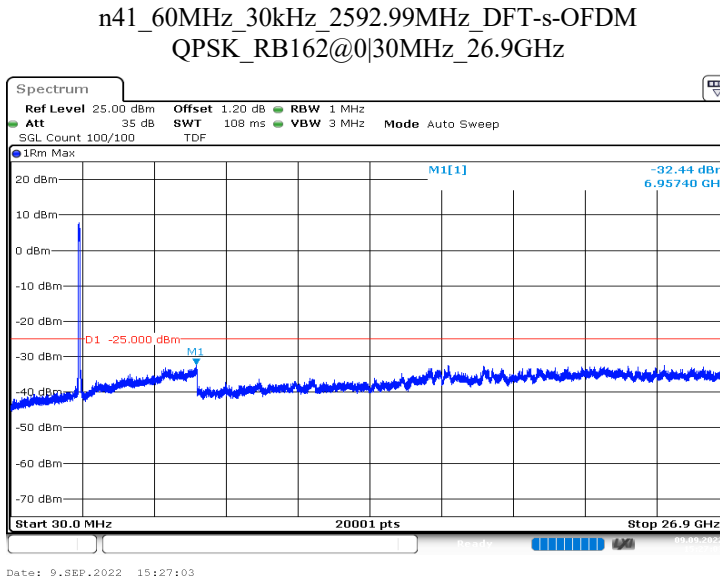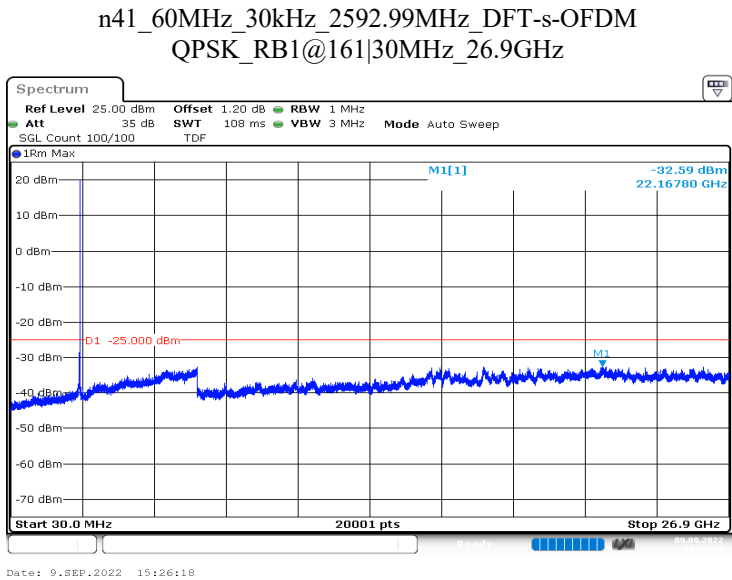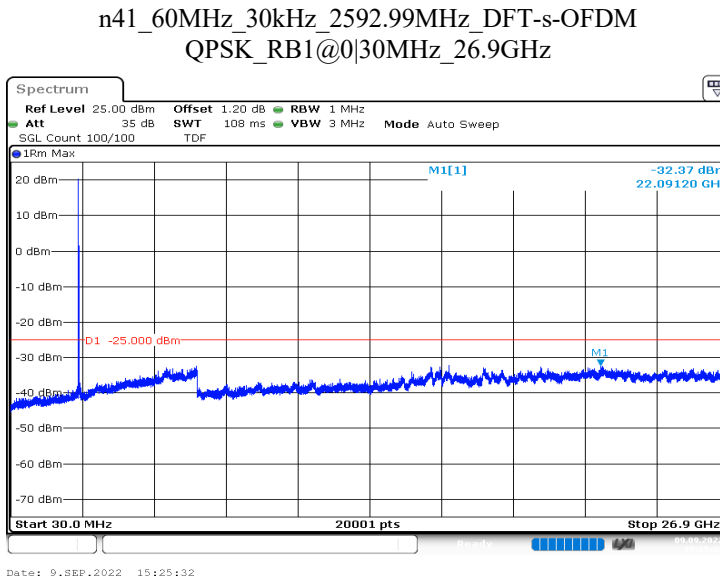


n41\_80MHz\_30kHz\_2536.02MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_26.9GHz

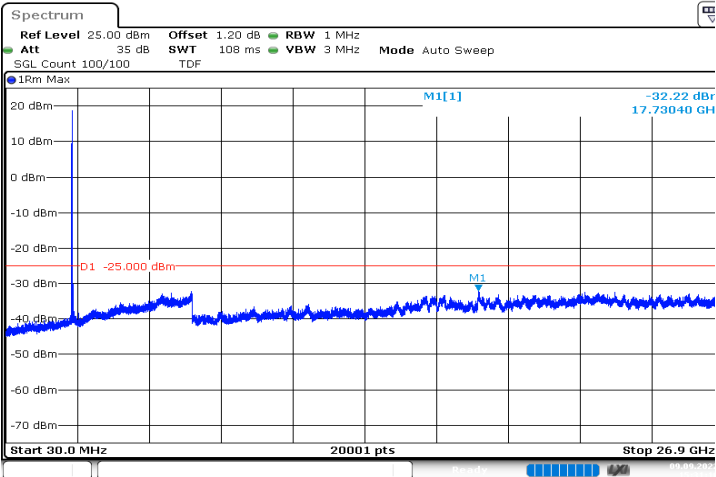


Date: 9.SEP.2022 15:31:10

n41\_80MHz\_30kHz\_2536.02MHz\_DFT-s-OFDM  
QPSK\_RB1@216|30MHz\_26.9GHz

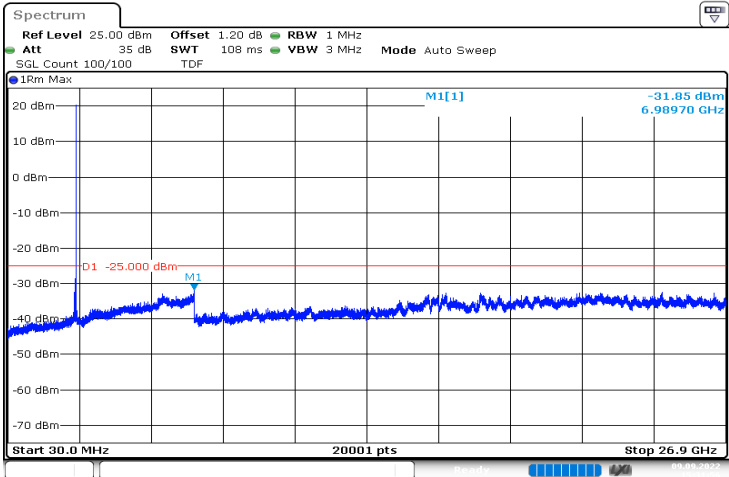


Date: 9.SEP.2022 15:31:56

n41\_80MHz\_30kHz\_2536.02MHz\_DFT-s-OFDM  
QPSK\_RB216@0|30MHz\_26.9GHz

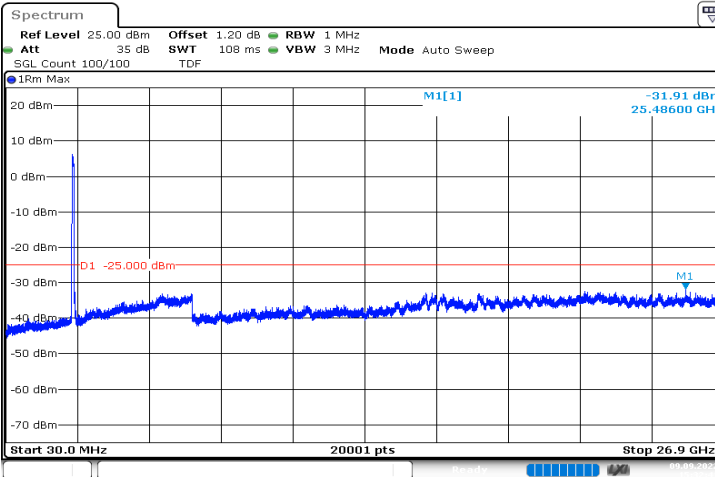


Date: 9.SEP.2022 15:32:41

n41\_80MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_26.9GHz

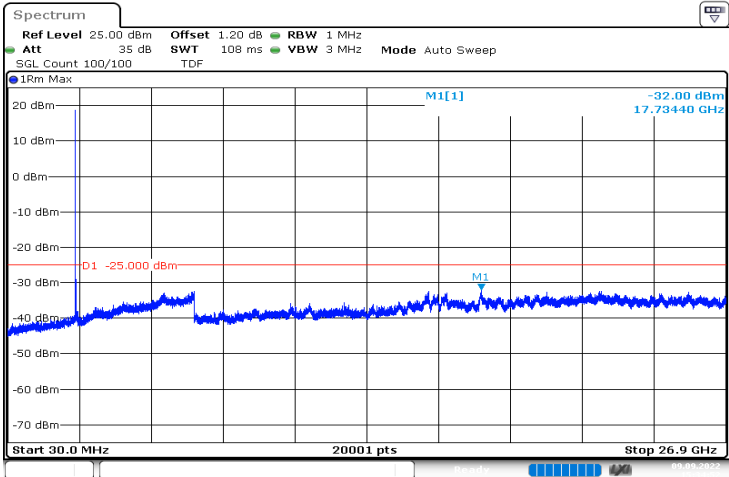


Date: 9.SEP.2022 15:34:52

n41\_80MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB1@216|30MHz\_26.9GHz






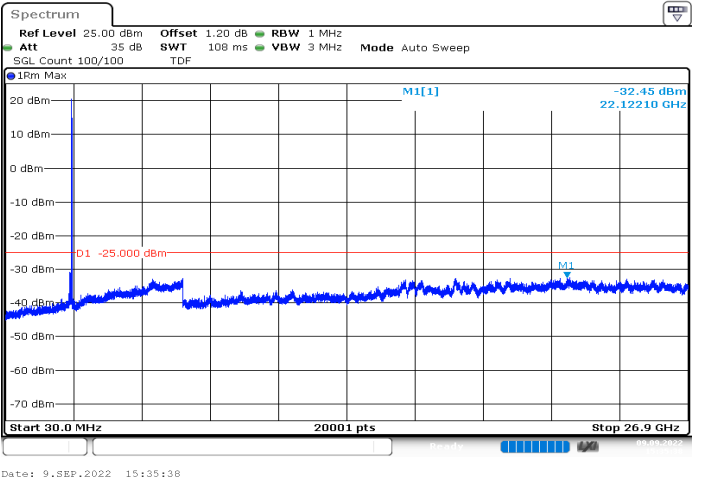








Date: 9.SEP.2022 15:35:38

n41\_80MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM  
QPSK\_RB216@0|30MHz\_26.9GHz

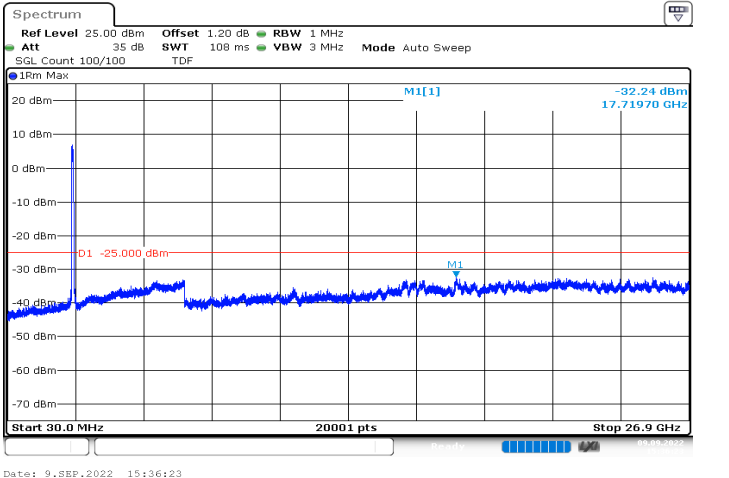


Date: 9.SEP.2022 15:36:23

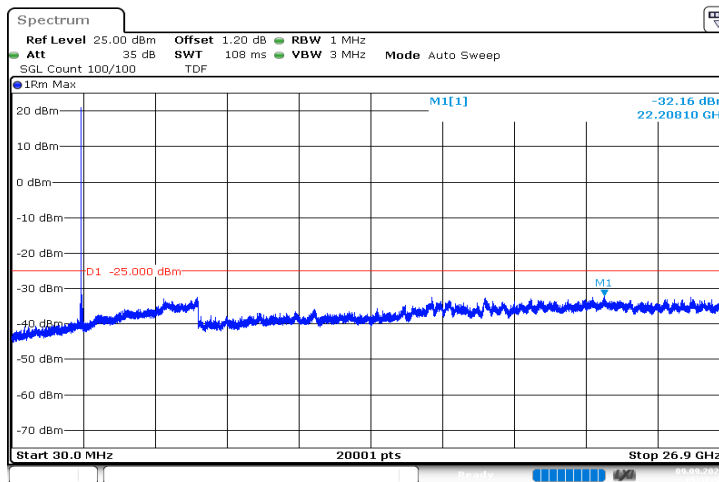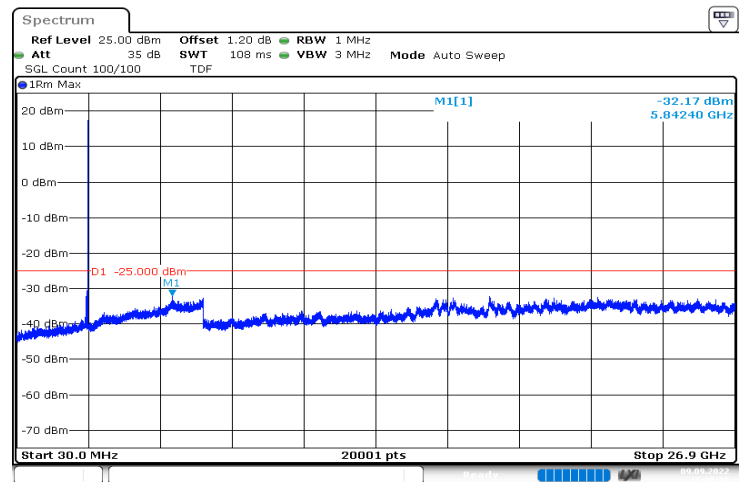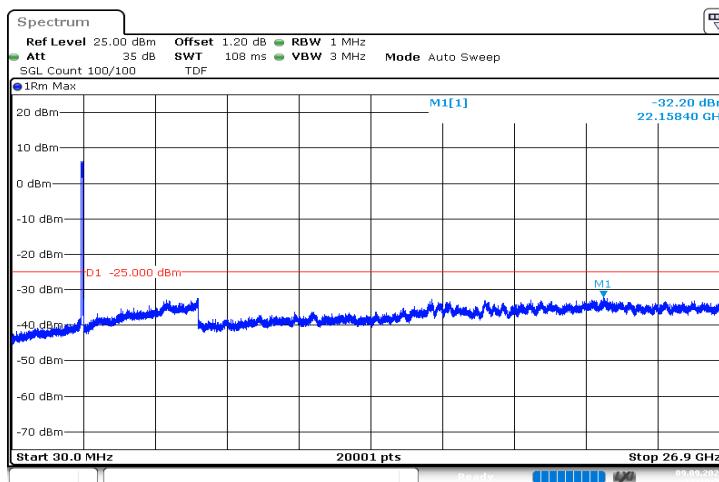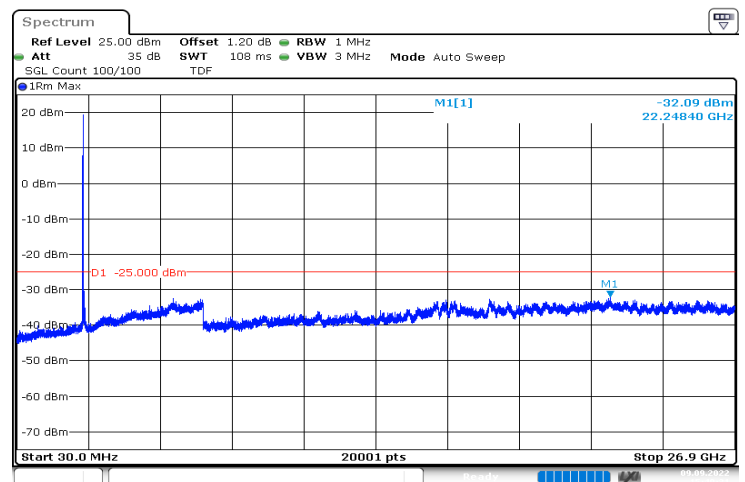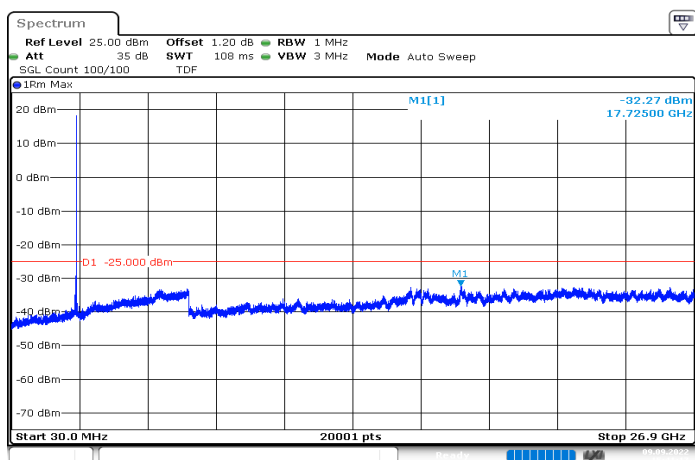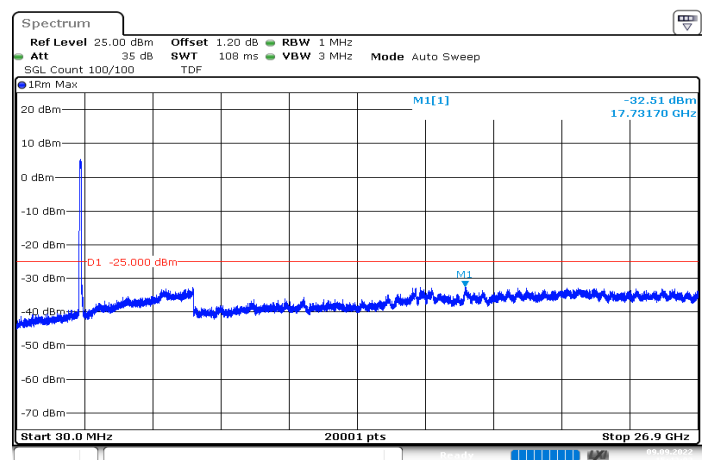n41\_80MHz\_30kHz\_2649.99MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_26.9GHzn41\_80MHz\_30kHz\_2649.99MHz\_DFT-s-OFDM  
QPSK\_RB1@216|30MHz\_26.9GHzn41\_80MHz\_30kHz\_2649.99MHz\_DFT-s-OFDM  
QPSK\_RB216@0|30MHz\_26.9GHzn41\_90MHz\_30kHz\_2541MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_26.9GHzn41\_90MHz\_30kHz\_2541MHz\_DFT-s-OFDM  
QPSK\_RB1@244|30MHz\_26.9GHzn41\_90MHz\_30kHz\_2541MHz\_DFT-s-OFDM  
QPSK\_RB243@0|30MHz\_26.9GHz

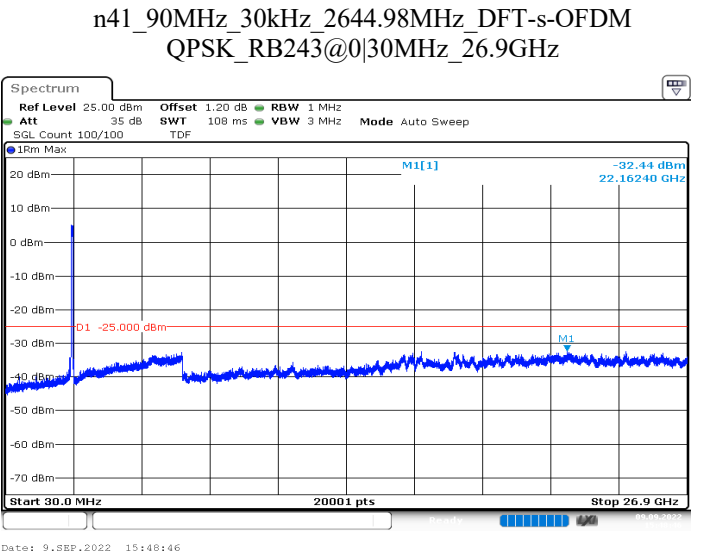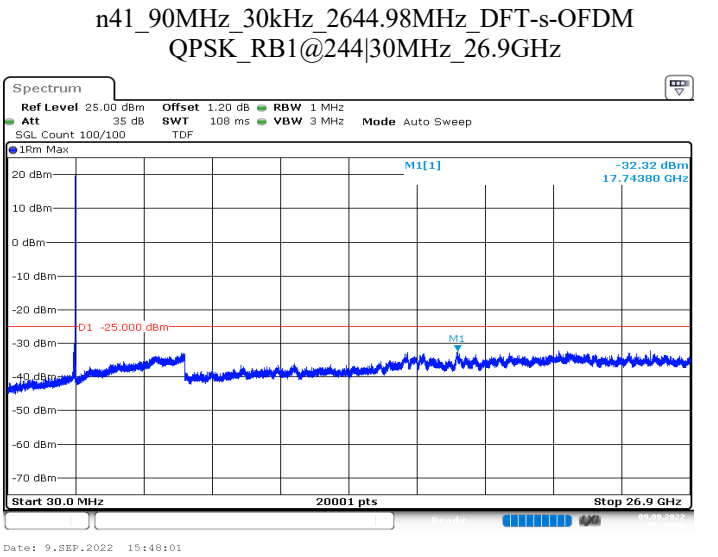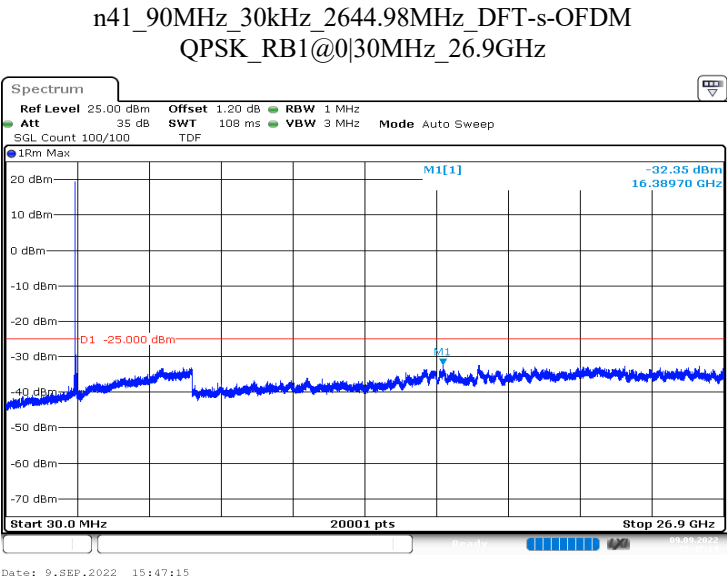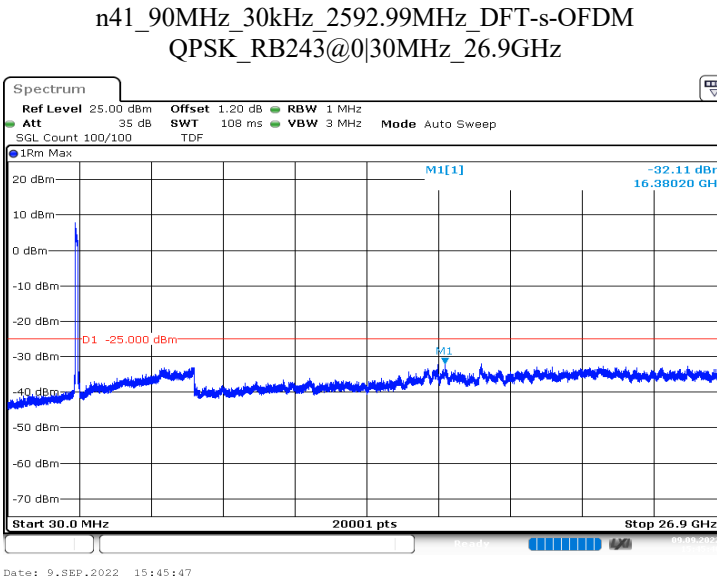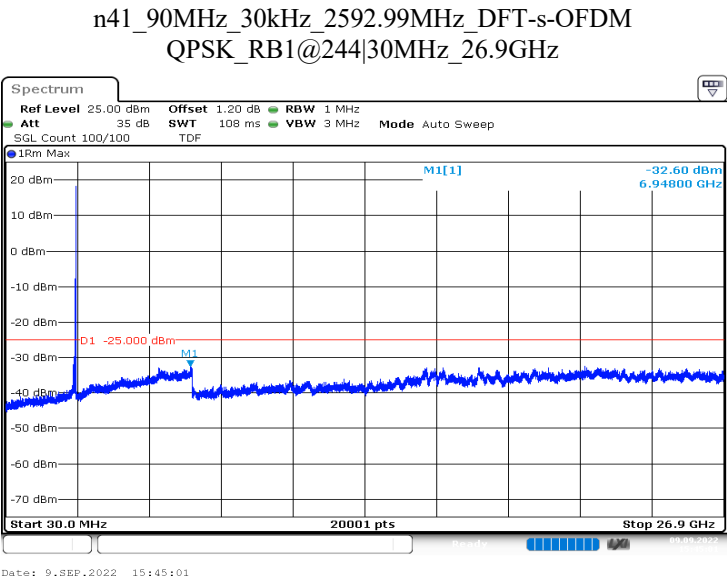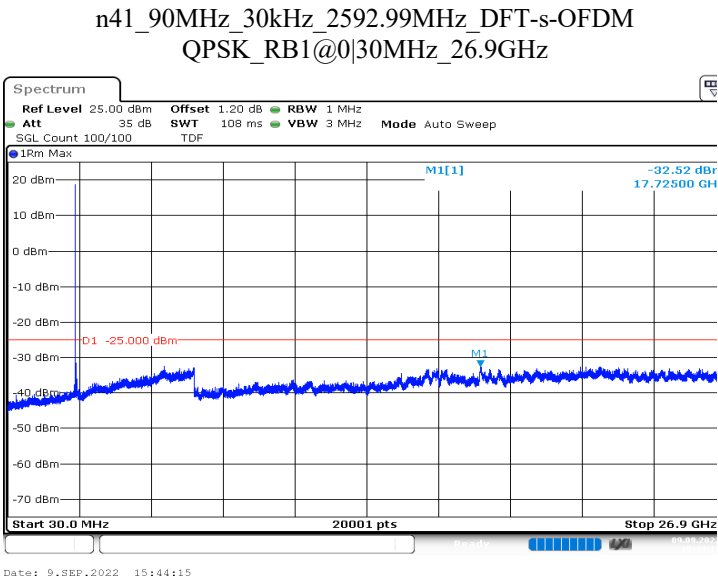


n41\_100MHz\_30kHz\_2546.01MHz\_DFT-s-OFDM\_QPSK\_RB1@0|30MHz\_26.9GHz

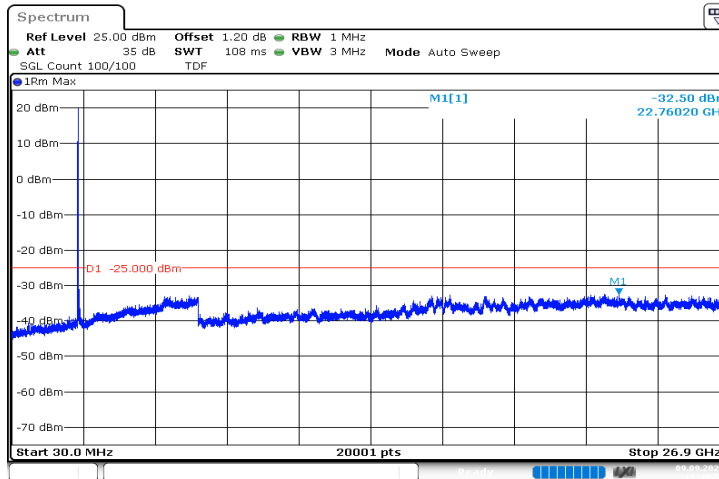


Date: 9.SEP.2022 15:49:56

n41\_100MHz\_30kHz\_2546.01MHz\_DFT-s-OFDM\_QPSK\_RB1@272|30MHz\_26.9GHz

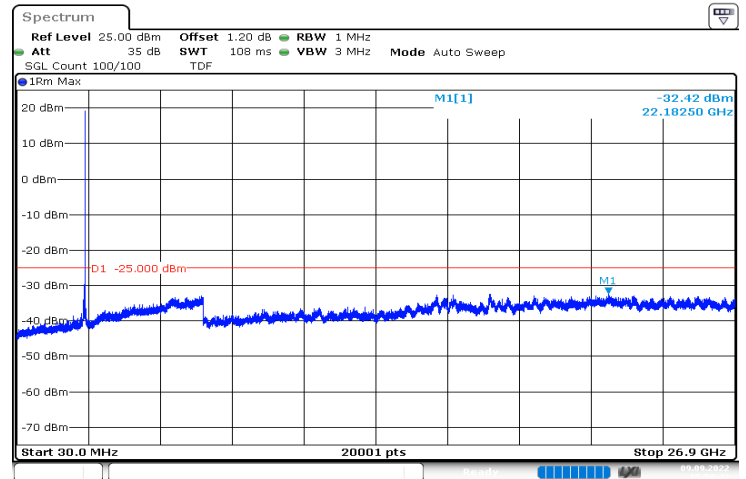


Date: 9.SEP.2022 15:50:42

n41\_100MHz\_30kHz\_2546.01MHz\_DFT-s-OFDM\_QPSK\_RB270@0|30MHz\_26.9GHz

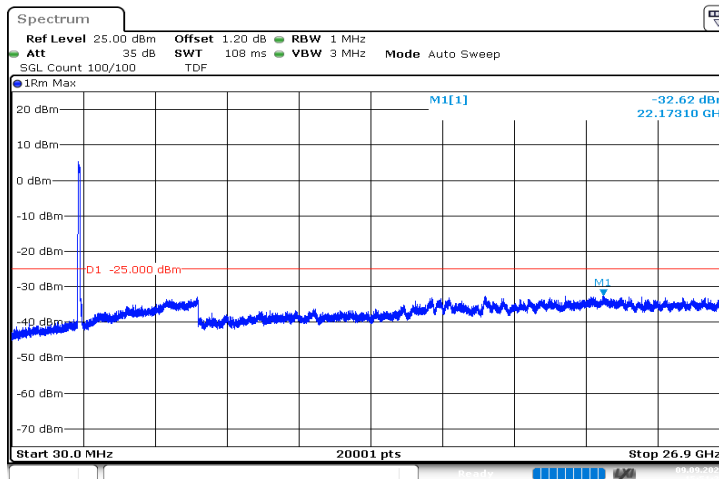


Date: 9.SEP.2022 15:51:28

n41\_100MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM\_QPSK\_RB1@0|30MHz\_26.9GHz

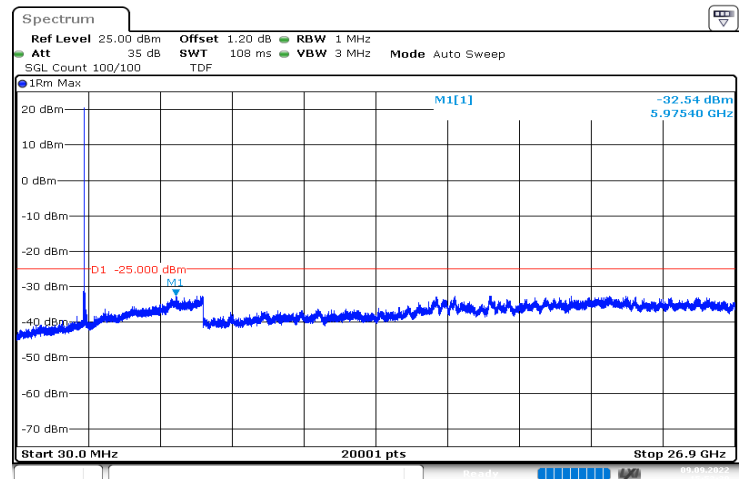


Date: 9.SEP.2022 15:53:40

n41\_100MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM\_QPSK\_RB1@272|30MHz\_26.9GHz



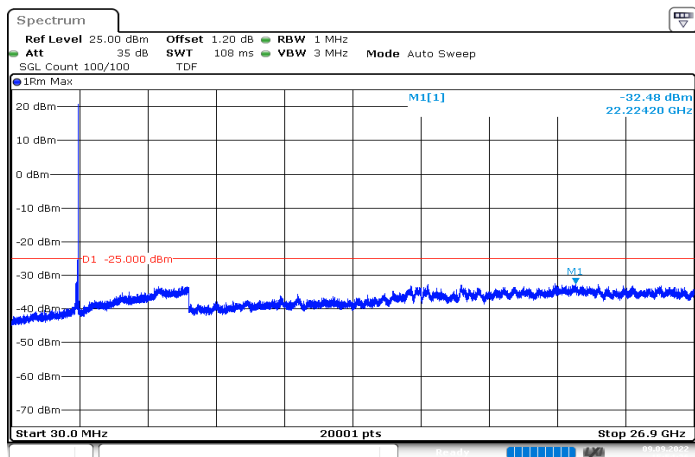


Date: 9.SEP.2022 15:54:26

n41\_100MHz\_30kHz\_2592.99MHz\_DFT-s-OFDM\_QPSK\_RB270@0|30MHz\_26.9GHz

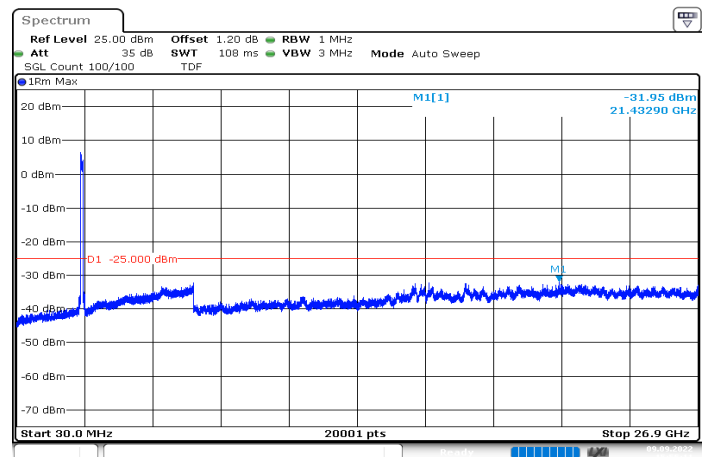


Date: 9.SEP.2022 15:55:12

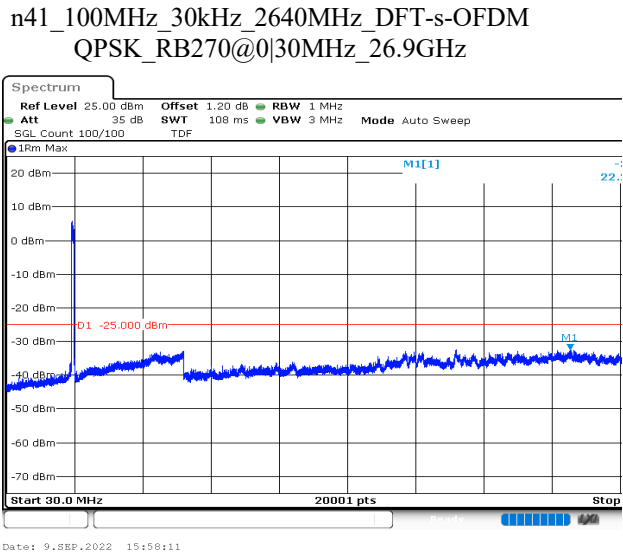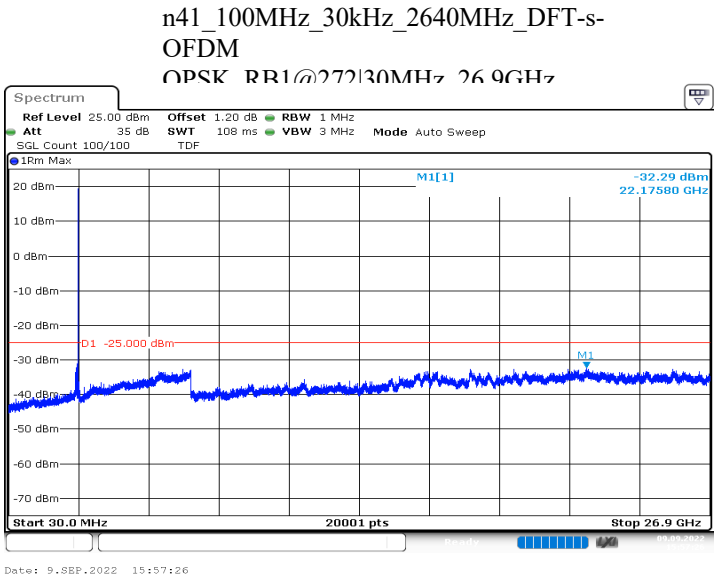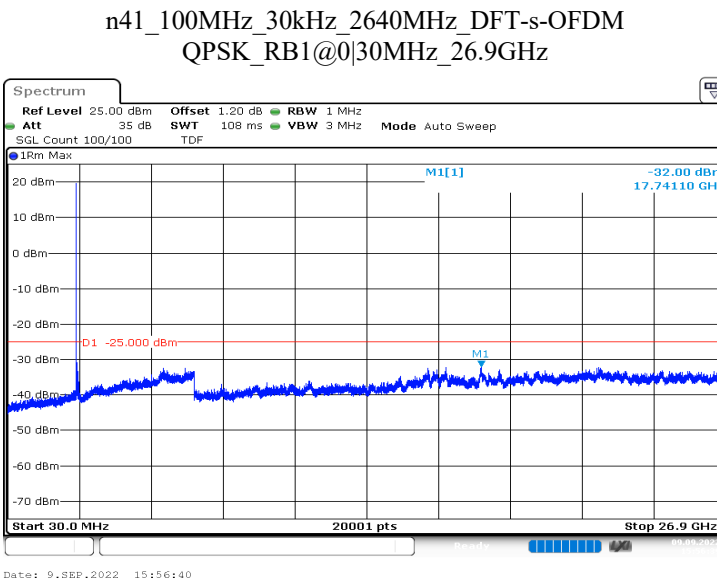


n66 , Normal

n66\_5MHz\_15kHz\_1712.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_17.8GHz

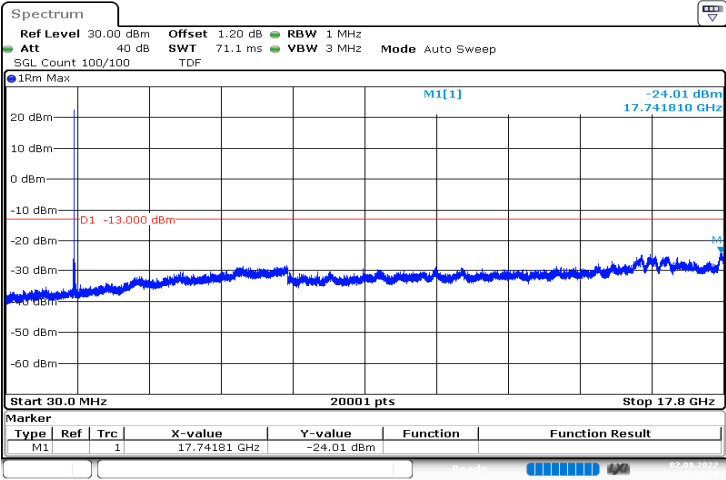


Date: 2.AUG.2022 15:32:39

n66\_5MHz\_15kHz\_1712.5MHz\_DFT-s-OFDM  
QPSK\_RB1@24|30MHz\_17.8GHz

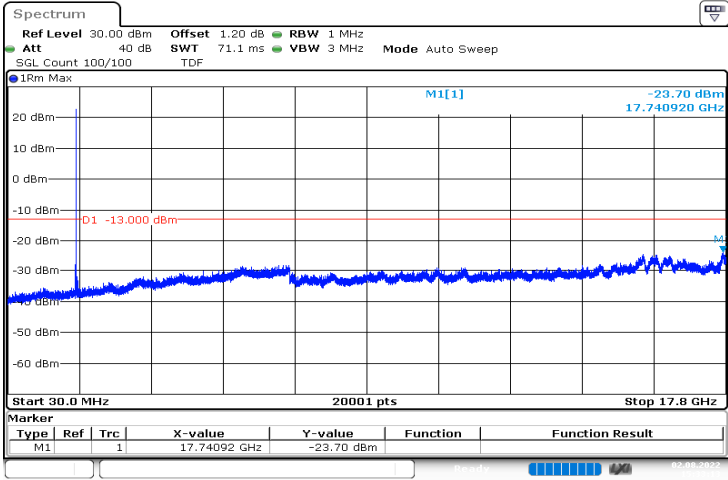


Date: 2.AUG.2022 15:33:13

n66\_5MHz\_15kHz\_1712.5MHz\_DFT-s-OFDM  
QPSK\_RB25@0|30MHz\_17.8GHz

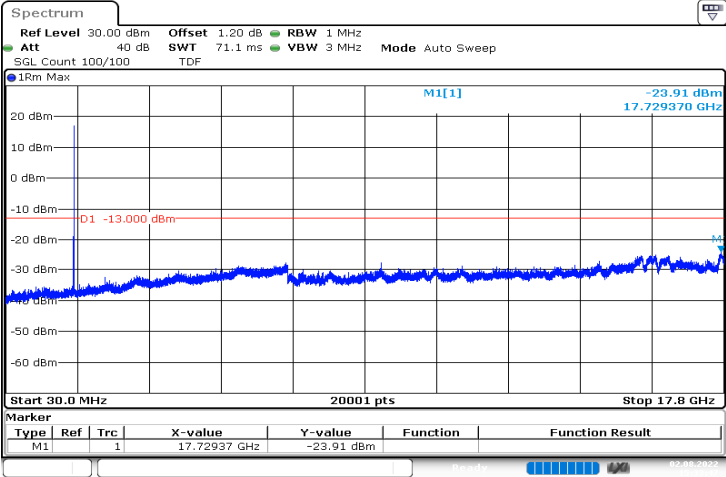


Date: 2.AUG.2022 15:33:47

n66\_5MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@24|30MHz\_17.8GHz

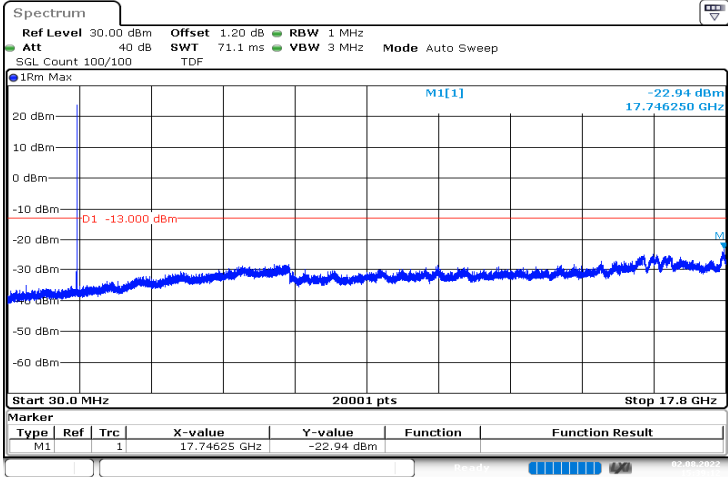


Date: 2.AUG.2022 15:39:13

n66\_5MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB25@0|30MHz\_17.8GHz






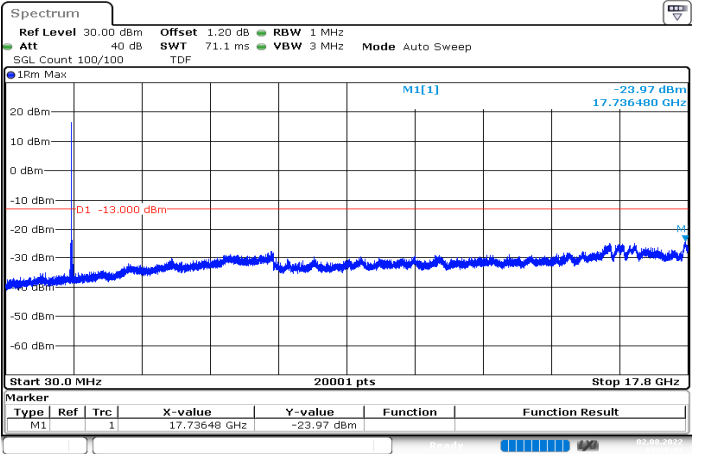



Date: 2.AUG.2022 15:39:48

n66\_5MHz\_15kHz\_1777.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_17.8GHz

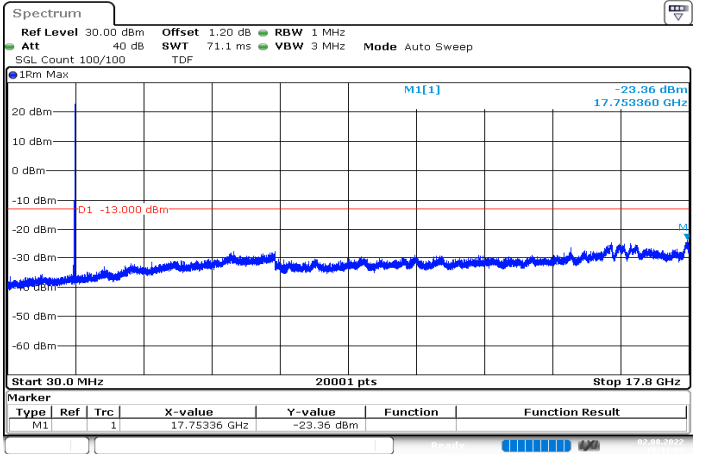


Date: 2.AUG.2022 15:41:04

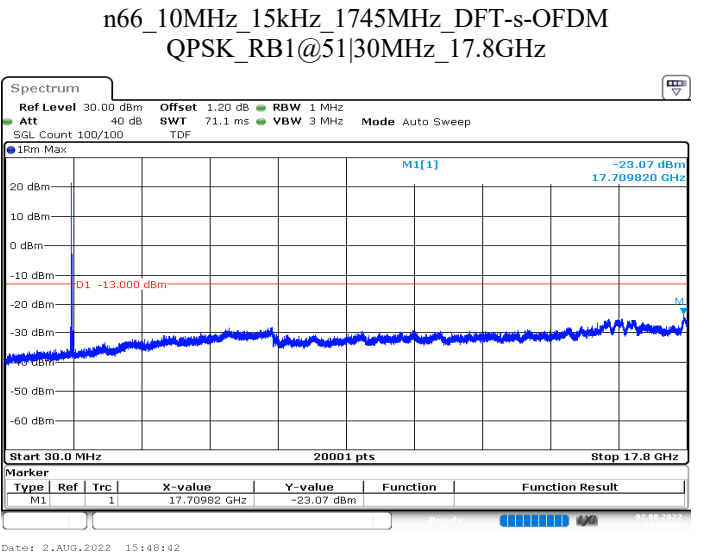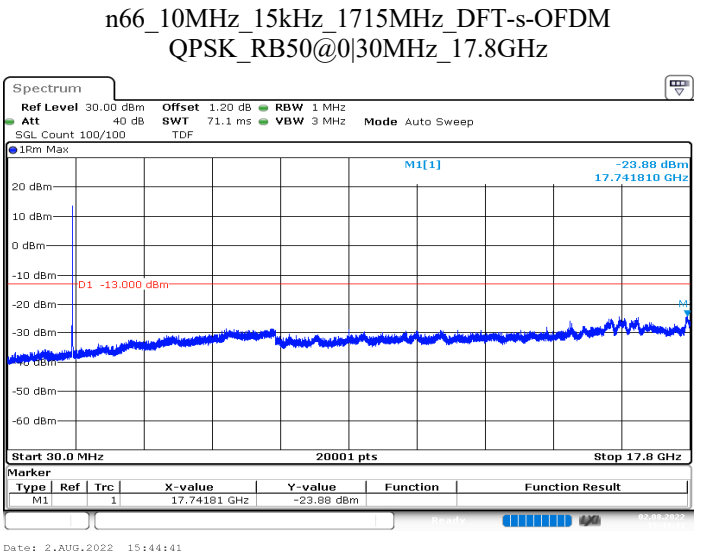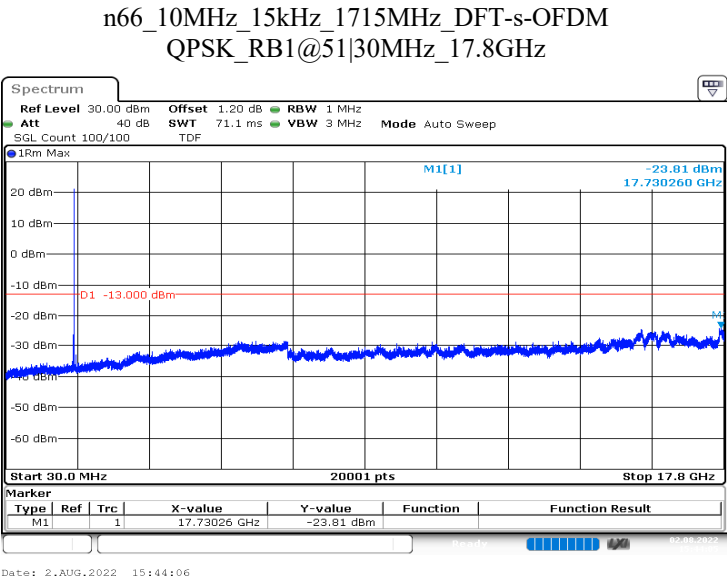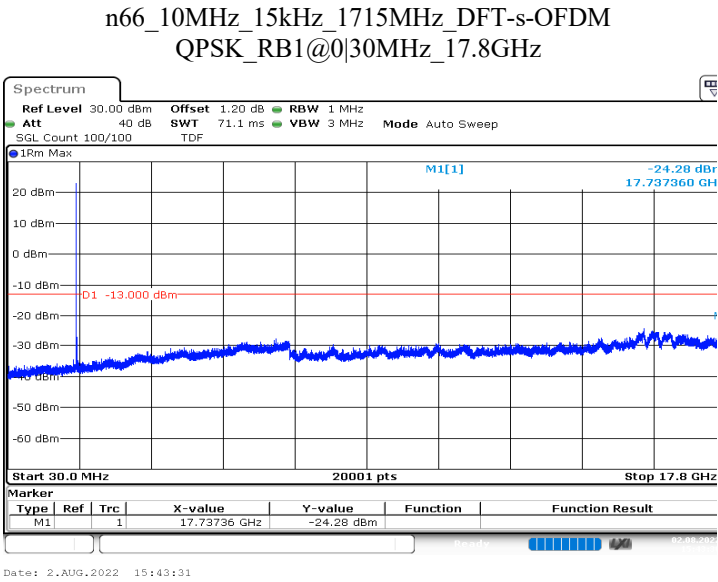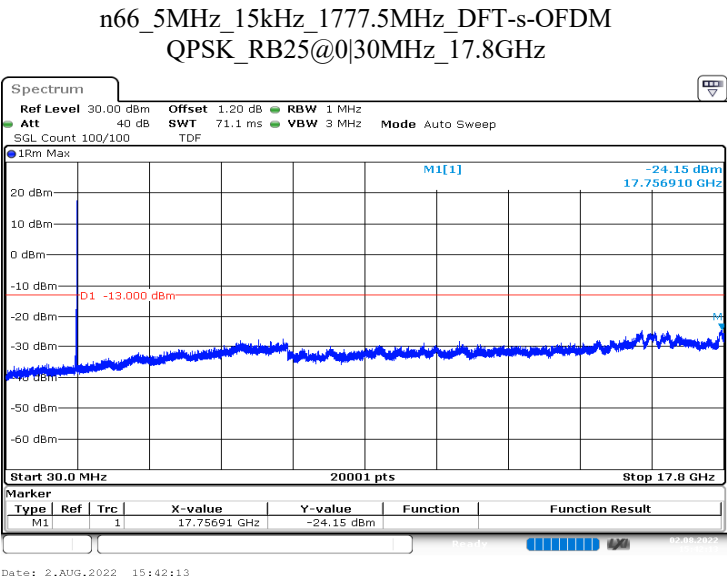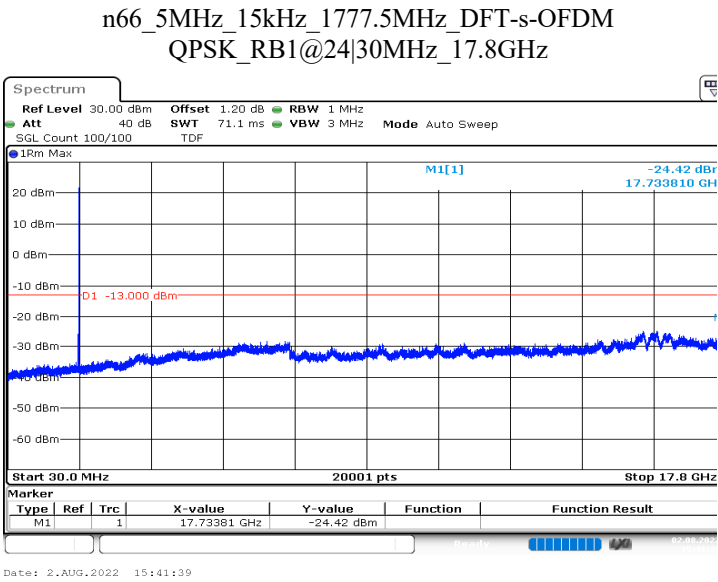


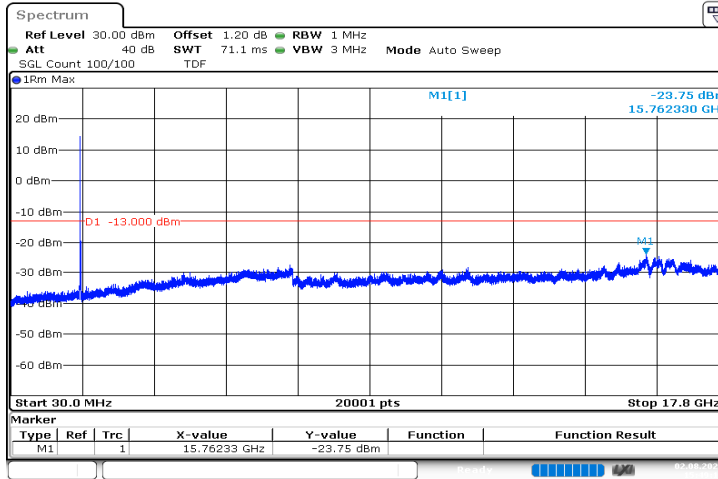n66\_10MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB50@0|30MHz\_17.8GHz


Date: 2.AUG.2022 15:49:17

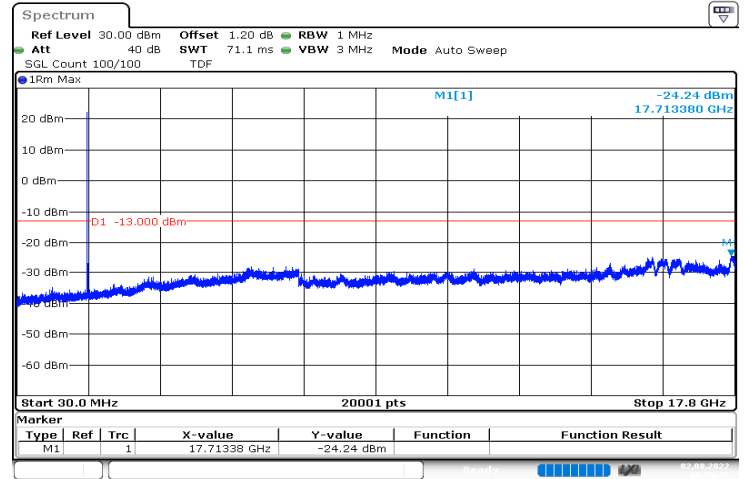n66\_10MHz\_15kHz\_1775MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_17.8GHz


Date: 2.AUG.2022 15:50:33

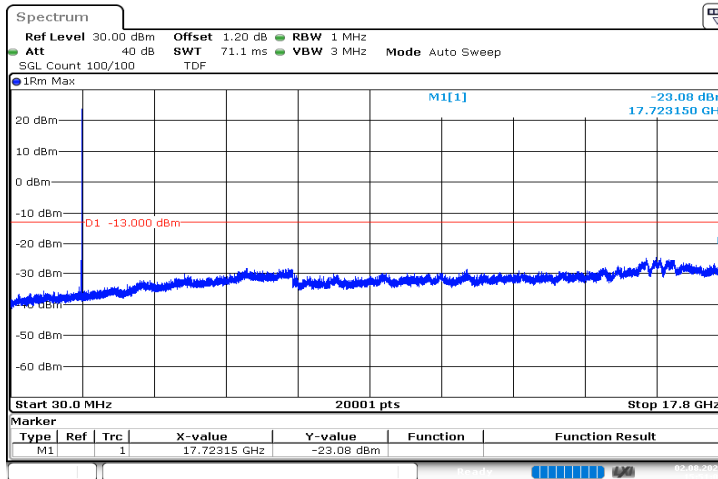n66\_10MHz\_15kHz\_1775MHz\_DFT-s-OFDM  
QPSK\_RB1@51|30MHz\_17.8GHz


Date: 2.AUG.2022 15:51:08

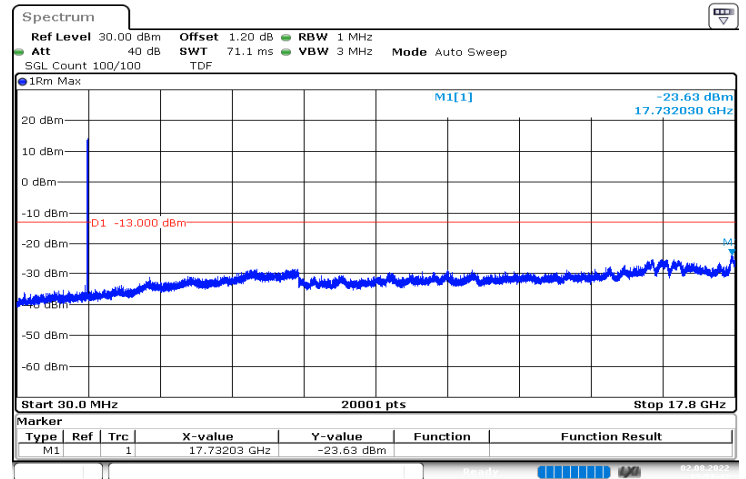n66\_10MHz\_15kHz\_1775MHz\_DFT-s-OFDM  
QPSK\_RB50@0|30MHz\_17.8GHz







Date: 2.AUG.2022 15:51:43






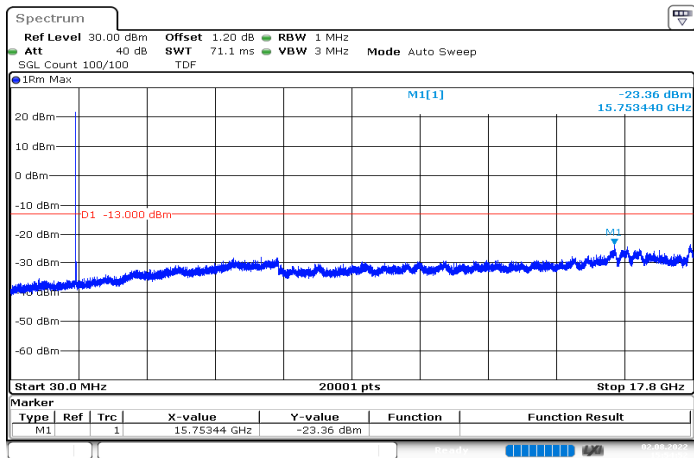
n66\_15MHz\_15kHz\_1717.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_17.8GHz







Date: 2.AUG.2022 15:54:52






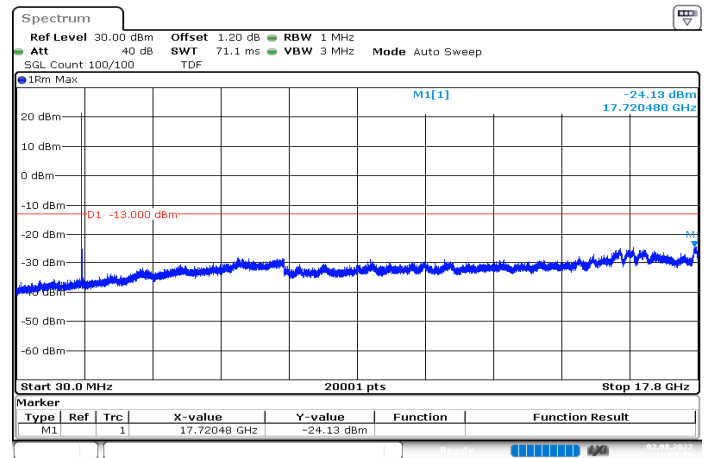
n66\_15MHz\_15kHz\_1717.5MHz\_DFT-s-OFDM  
QPSK\_RB1@78|30MHz\_17.8GHz







Date: 2.AUG.2022 15:55:27

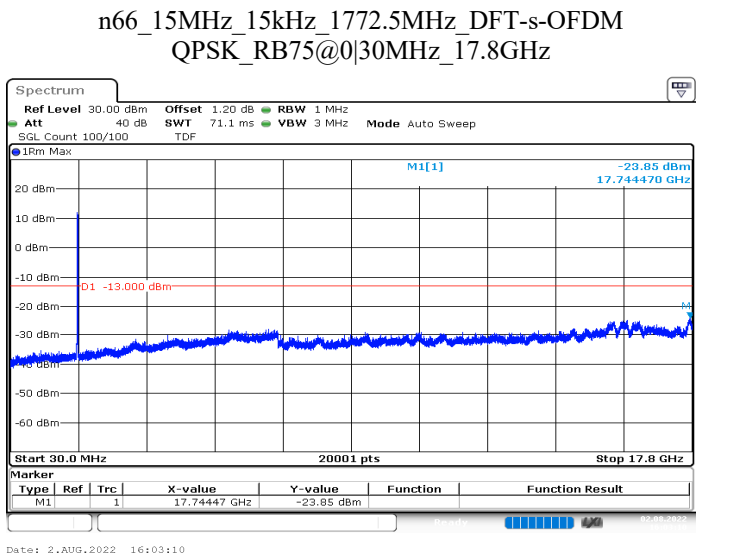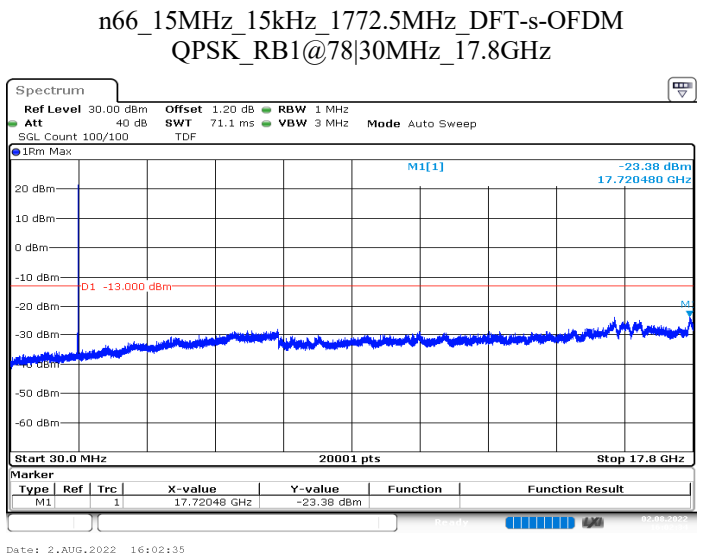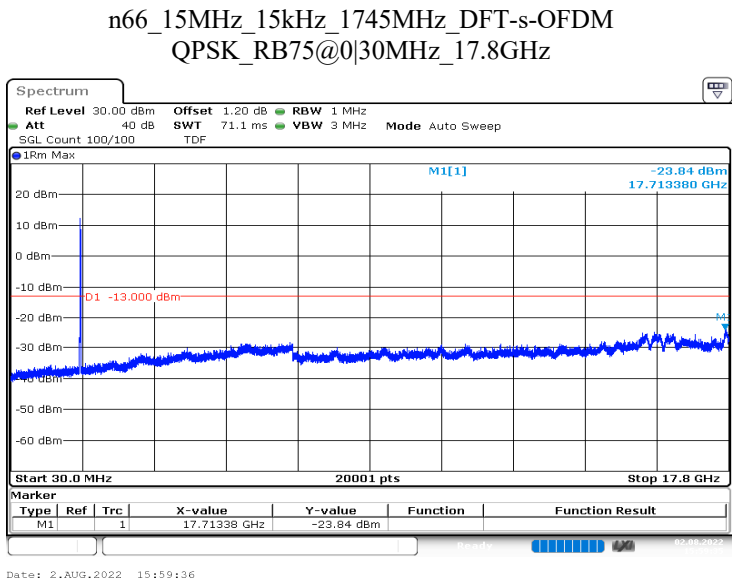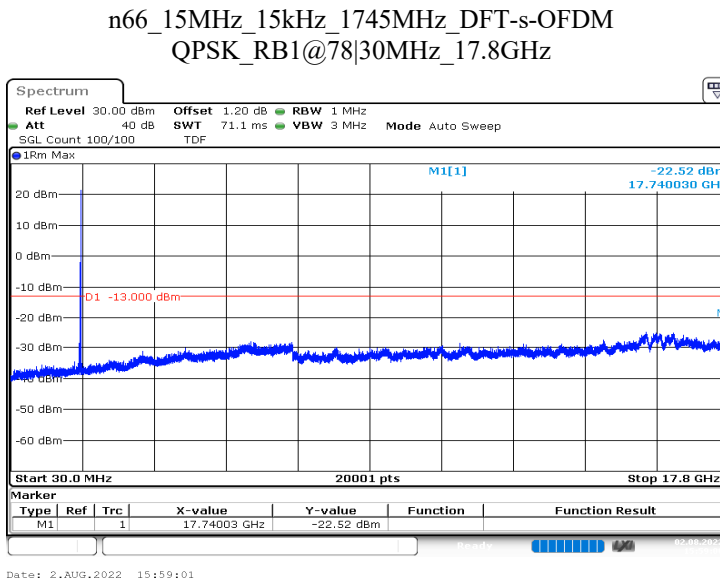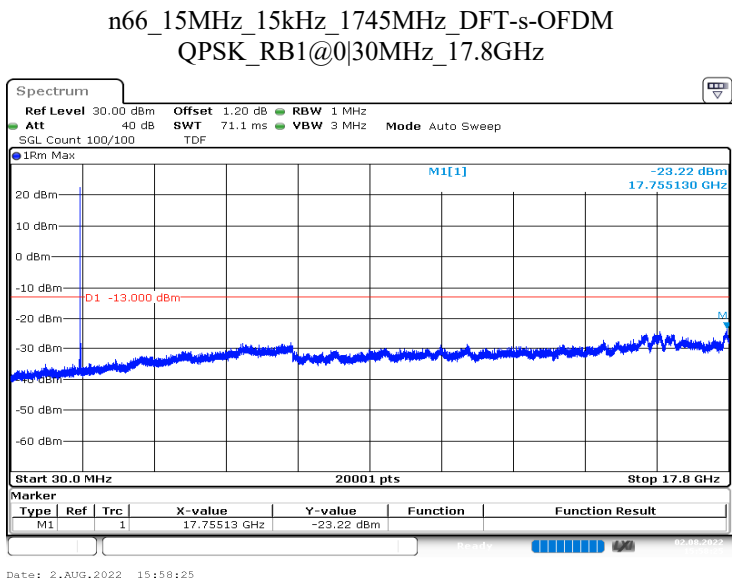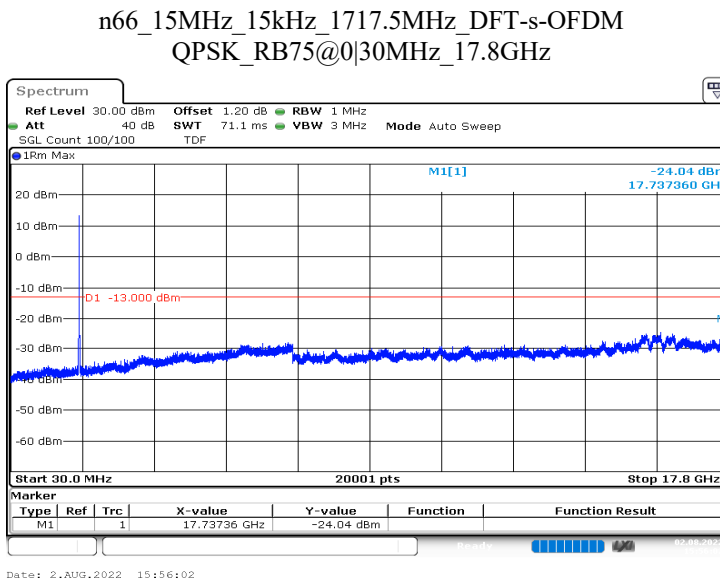


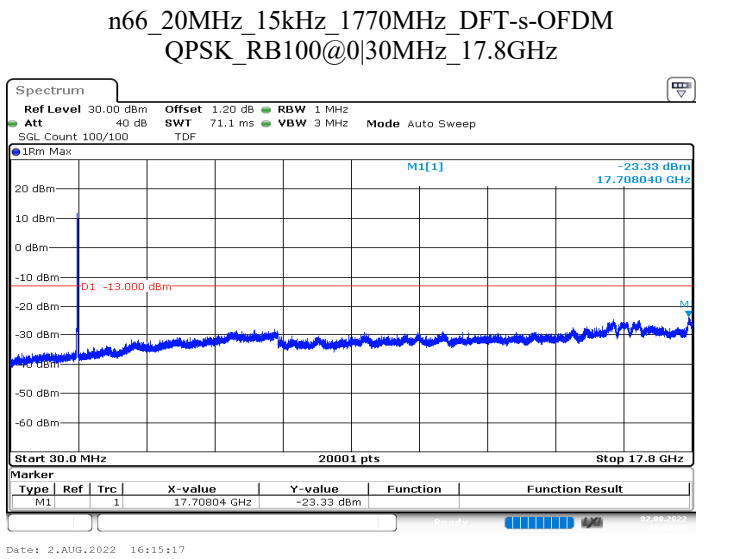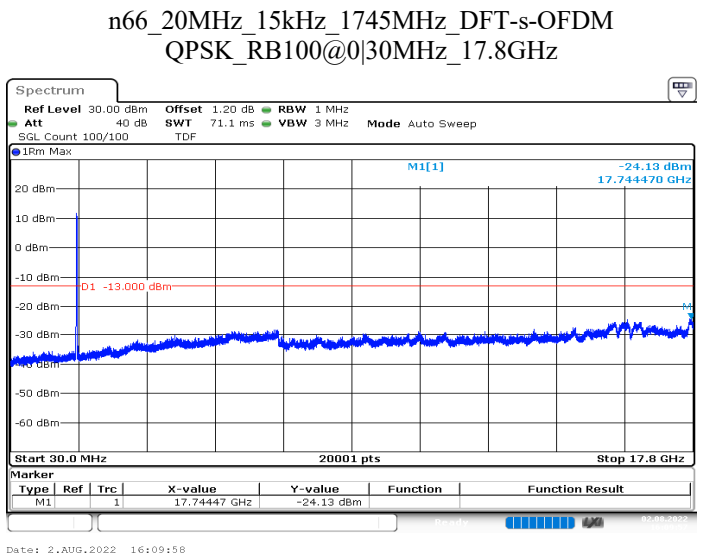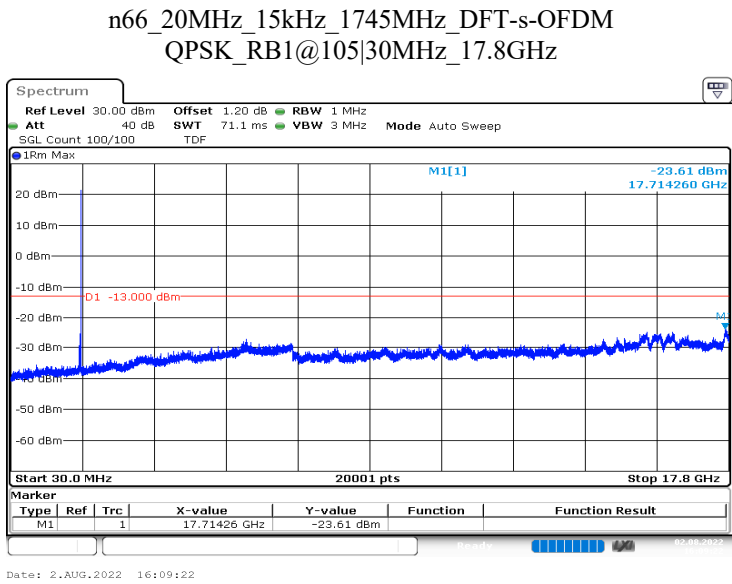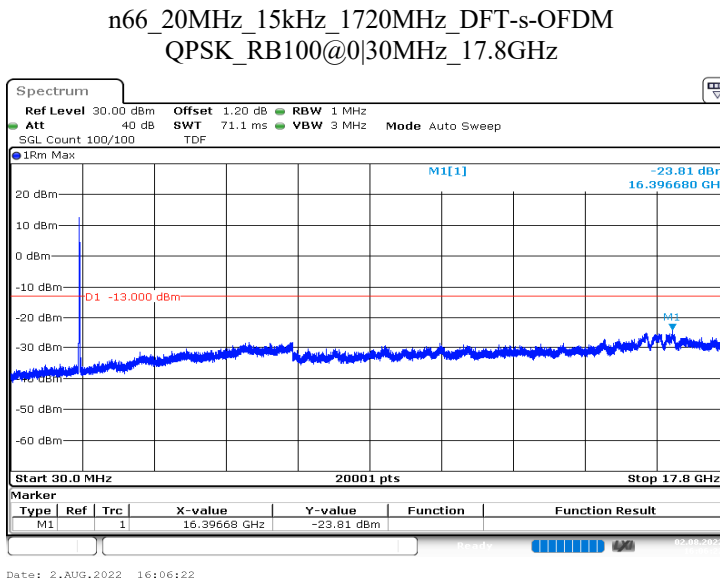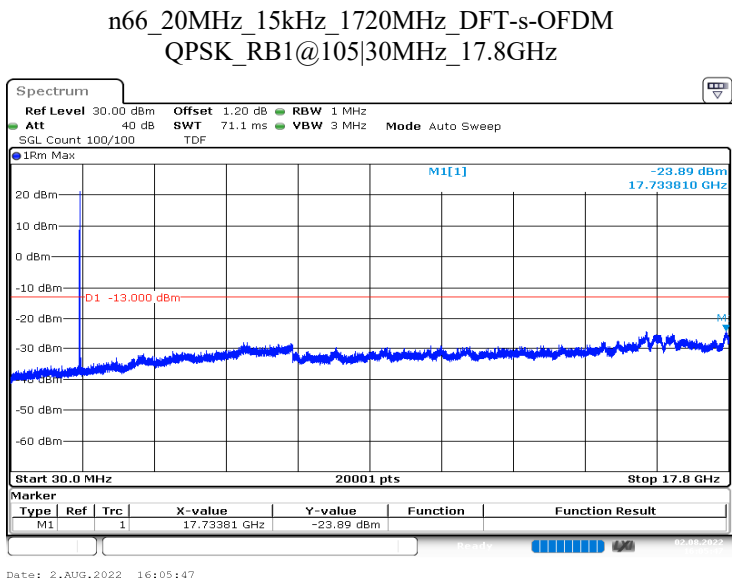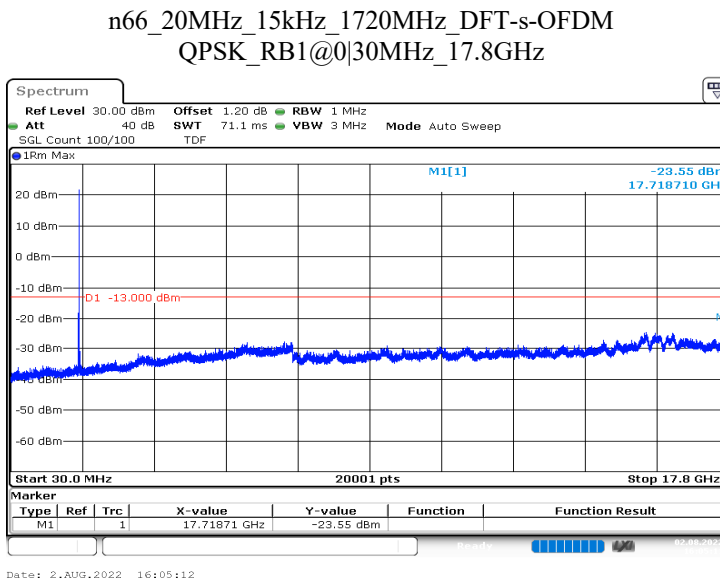

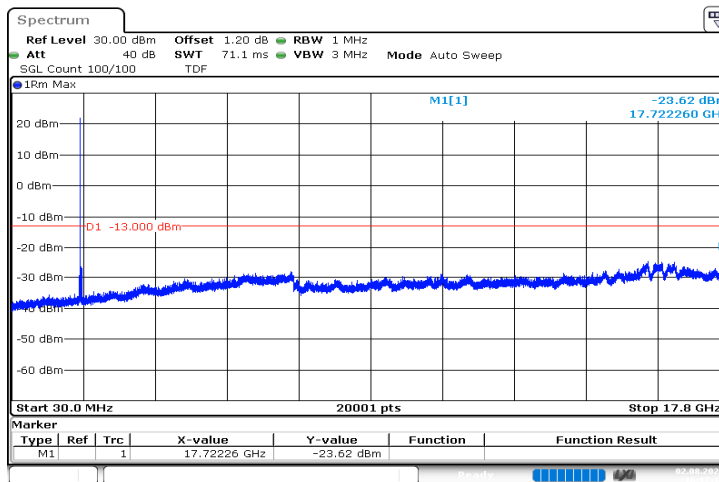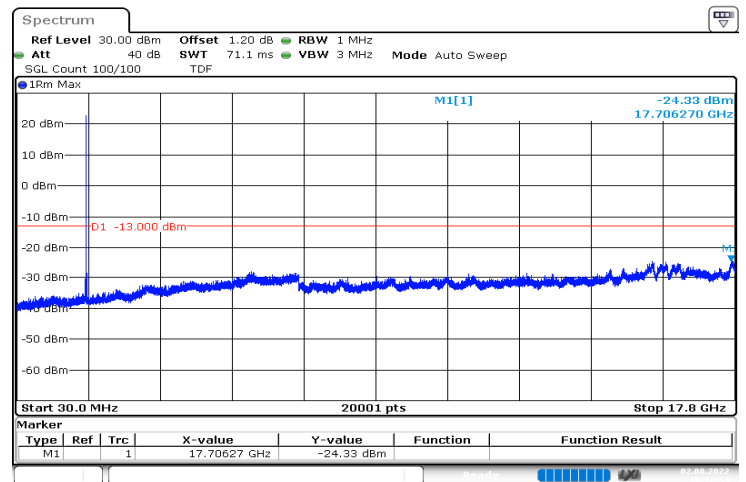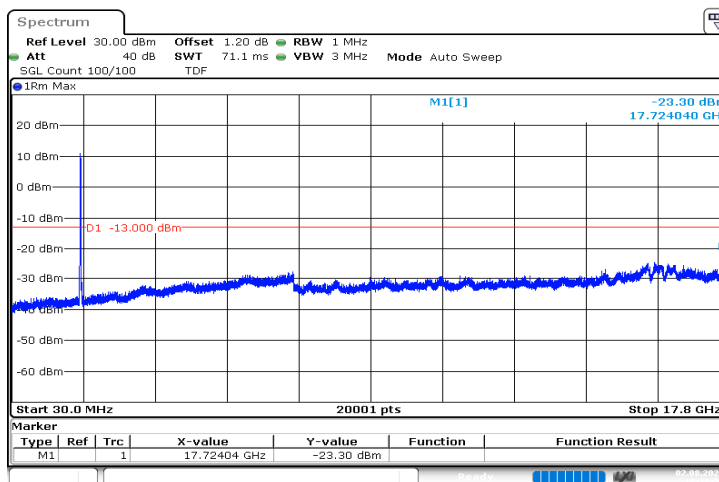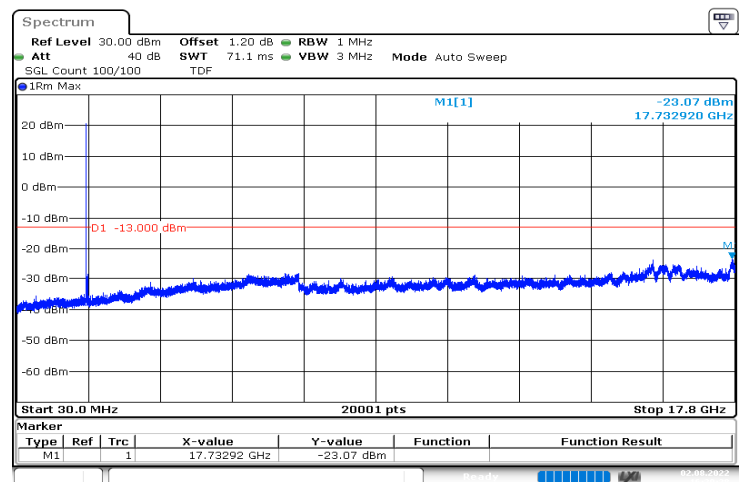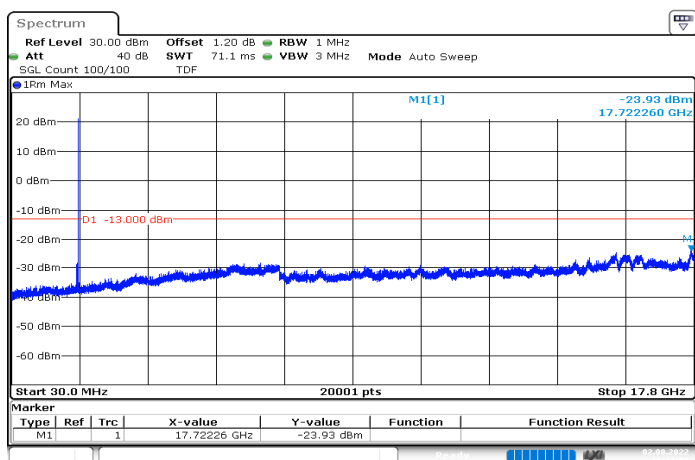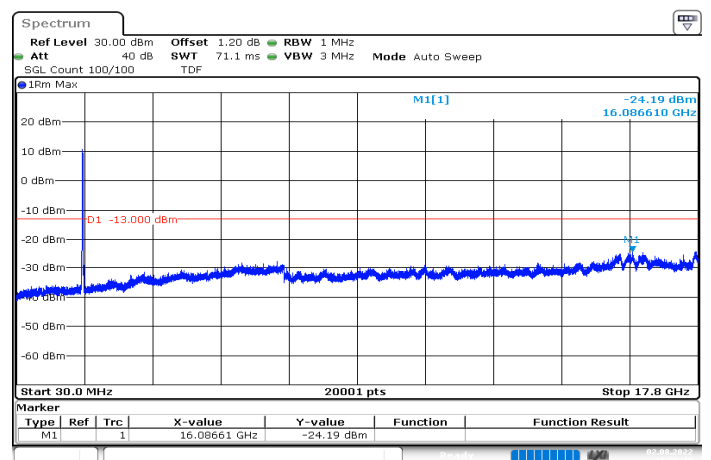
n66\_25MHz\_15kHz\_1722.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_17.8GHzn66\_25MHz\_15kHz\_1722.5MHz\_DFT-s-OFDM  
QPSK\_RB1@132|30MHz\_17.8GHzn66\_25MHz\_15kHz\_1722.5MHz\_DFT-s-OFDM  
QPSK\_RB128@0|30MHz\_17.8GHzn66\_25MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_17.8GHzn66\_25MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@132|30MHz\_17.8GHzn66\_25MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB128@0|30MHz\_17.8GHz

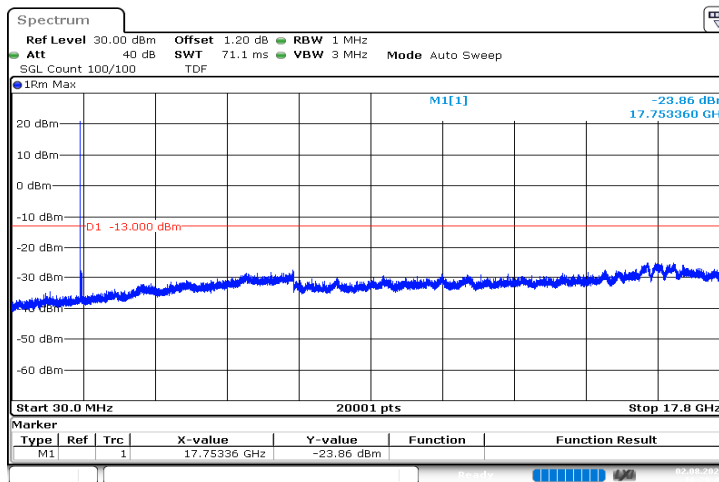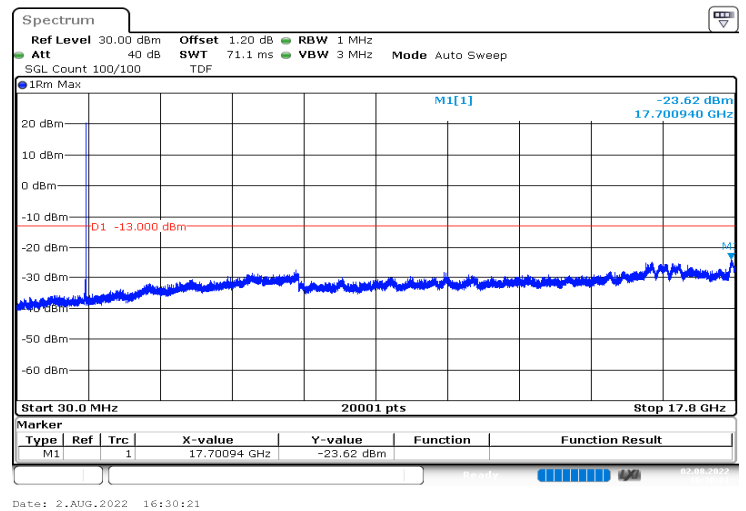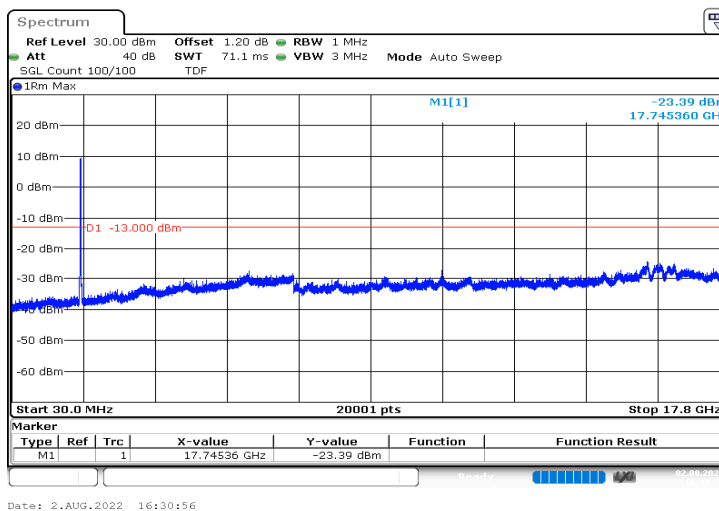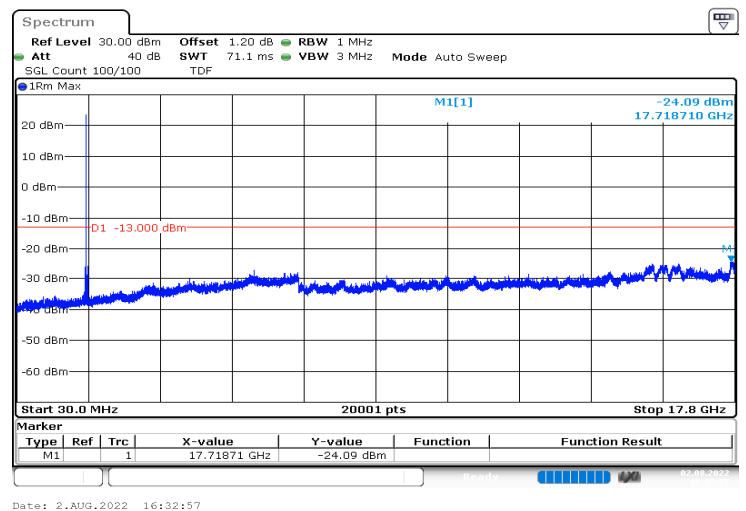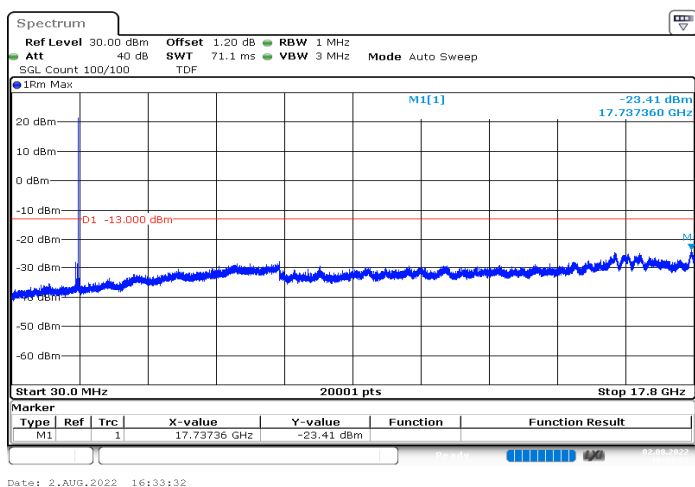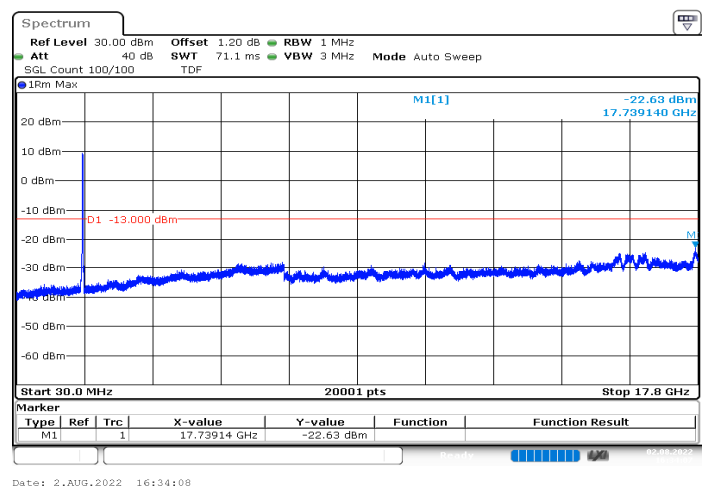n66\_30MHz\_15kHz\_1725MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_17.8GHzn66\_30MHz\_15kHz\_1725MHz\_DFT-s-OFDM  
QPSK\_RB1@159|30MHz\_17.8GHzn66\_30MHz\_15kHz\_1725MHz\_DFT-s-OFDM  
QPSK\_RB160@0|30MHz\_17.8GHzn66\_30MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_17.8GHzn66\_30MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@159|30MHz\_17.8GHzn66\_30MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB160@0|30MHz\_17.8GHz

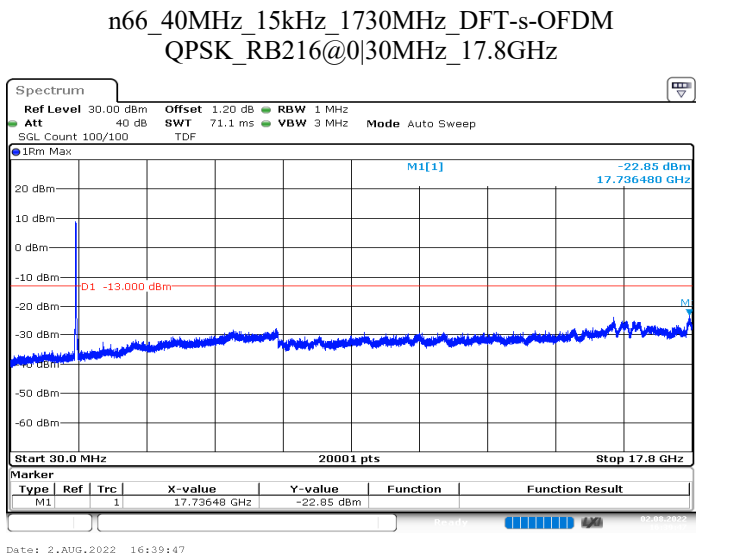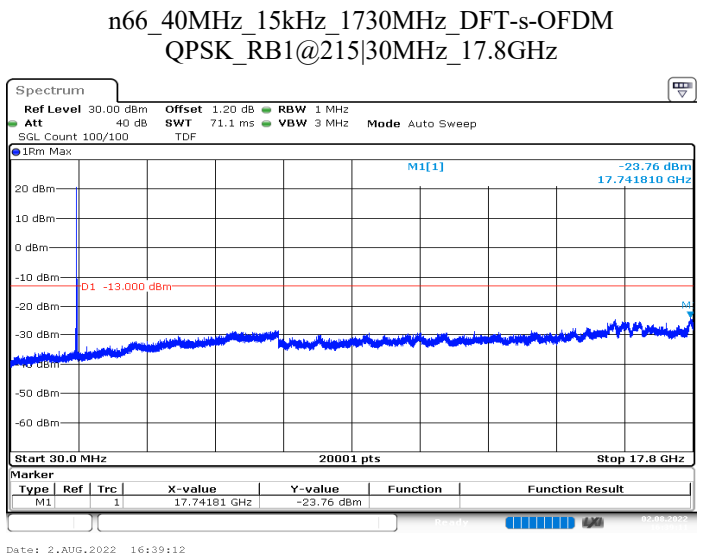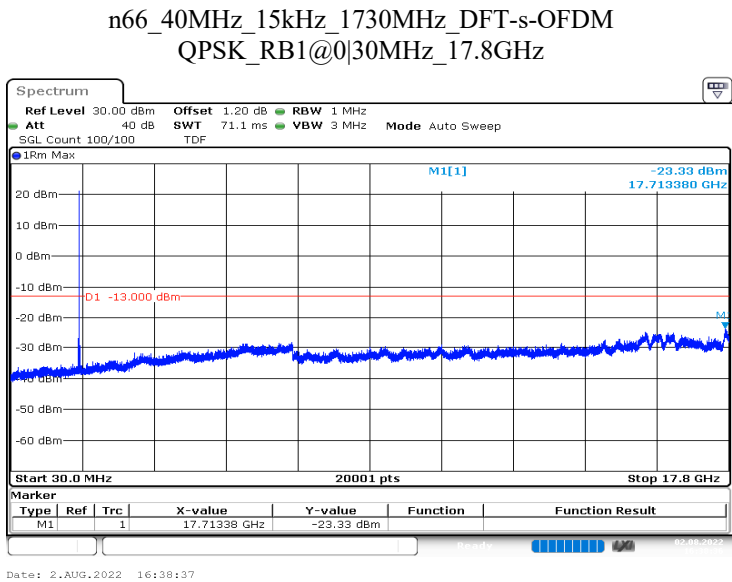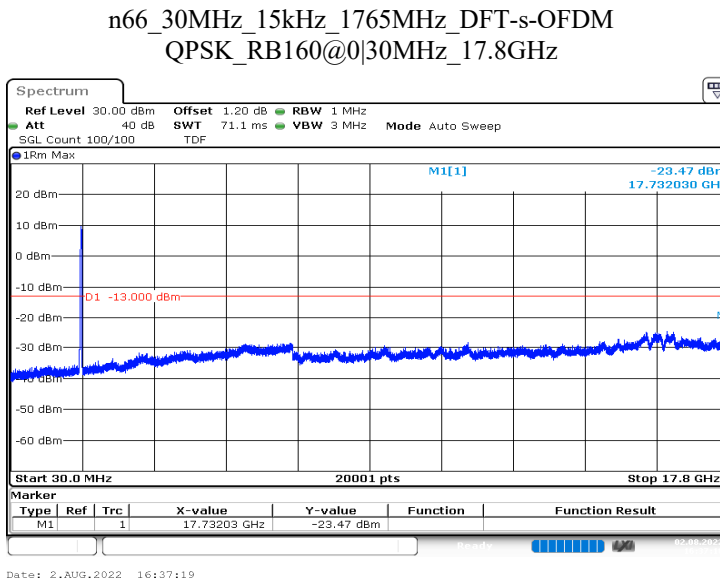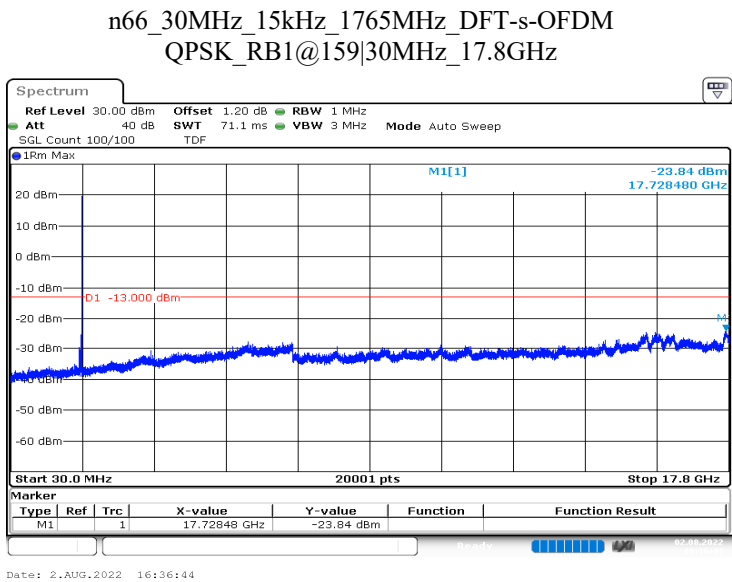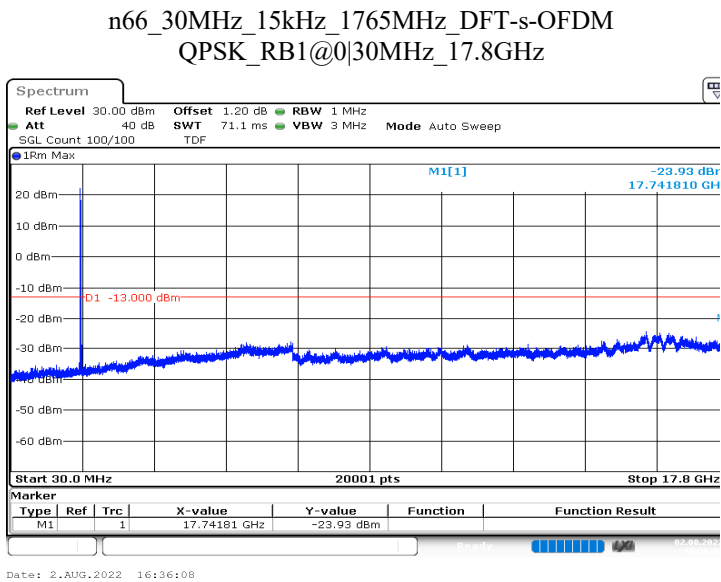


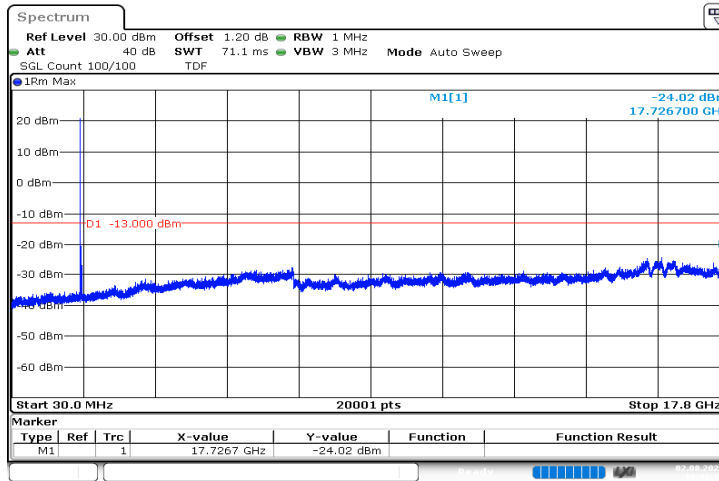n66\_40MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_17.8GHz


Date: 2.AUG.2022 16:41:49

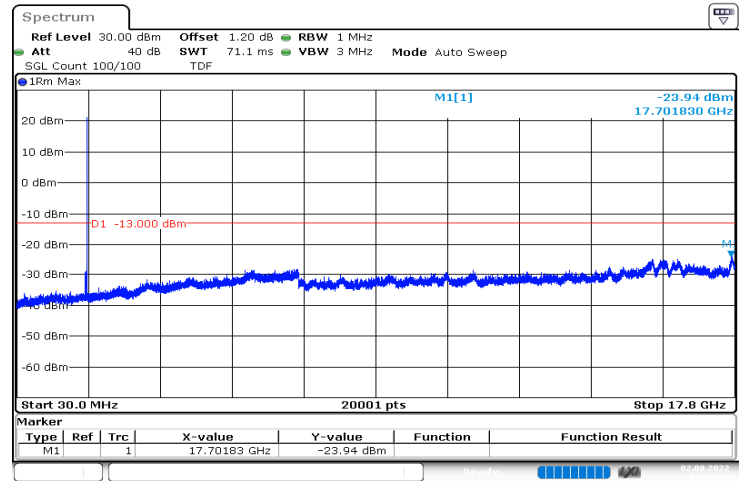n66\_40MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@215|30MHz\_17.8GHz


Date: 2.AUG.2022 16:42:24

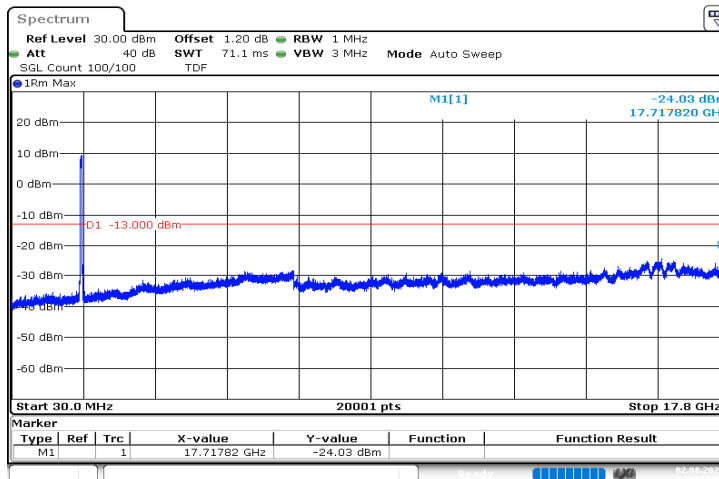n66\_40MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB216@0|30MHz\_17.8GHz


Date: 2.AUG.2022 16:42:59

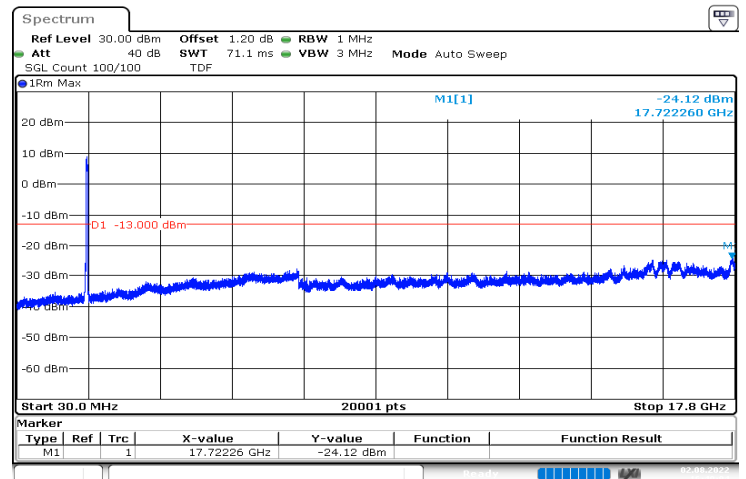n66\_40MHz\_15kHz\_1760MHz\_DFT-s-OFDM  
QPSK\_RB216@0|30MHz\_17.8GHz







Date: 2.AUG.2022 16:49:04

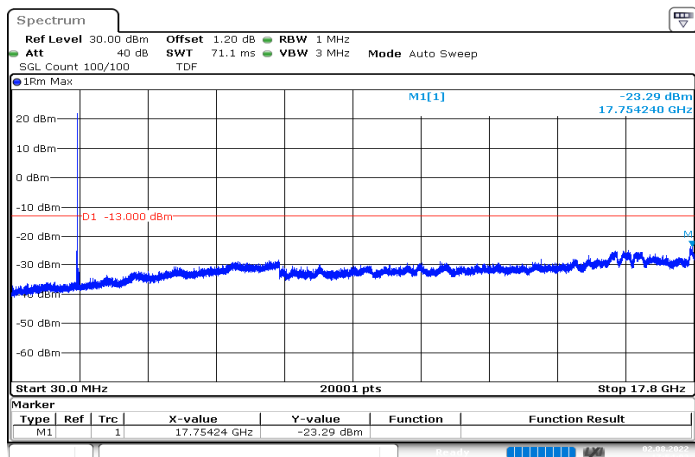n66\_5MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_17.8GHz


Date: 2.AUG.2022 17:54:03

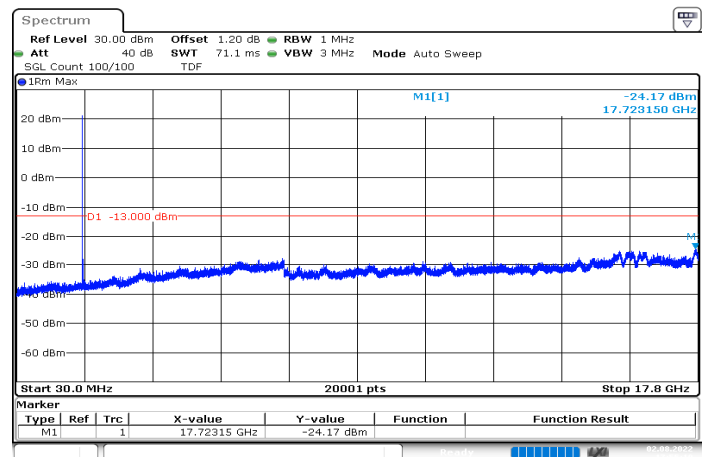n66\_10MHz\_15kHz\_1745MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_17.8GHz


Date: 2.AUG.2022 17:55:20

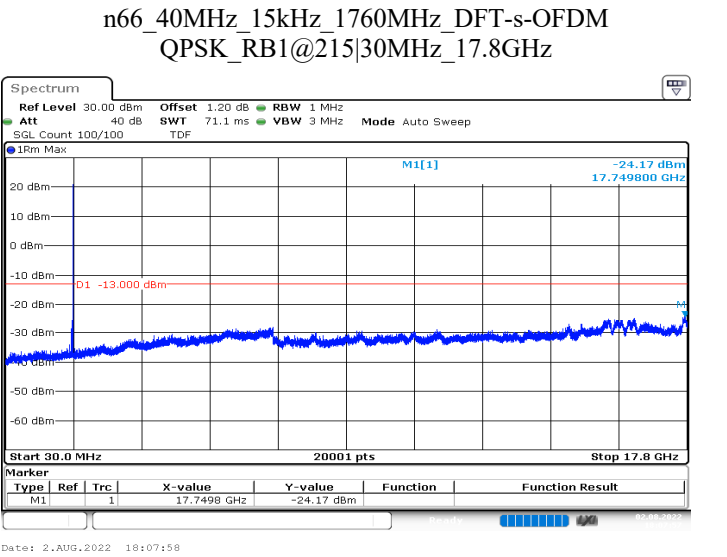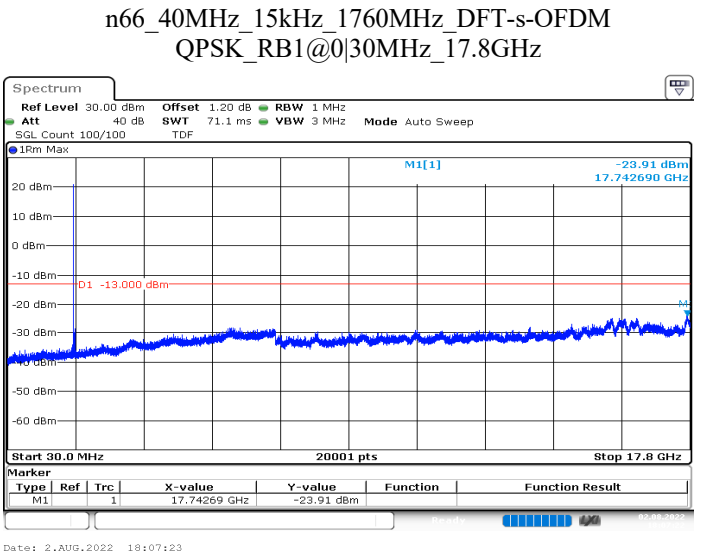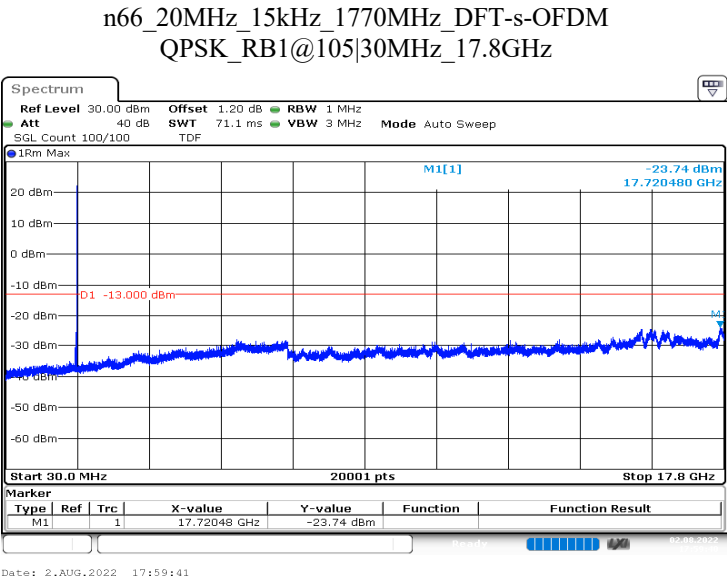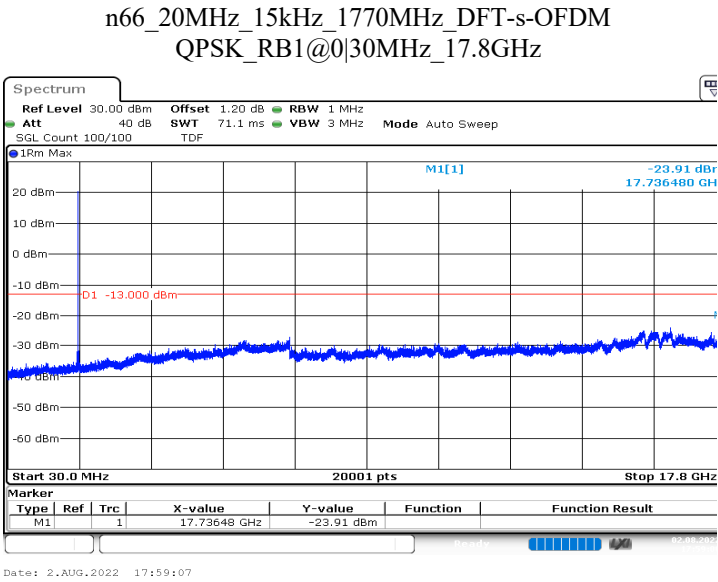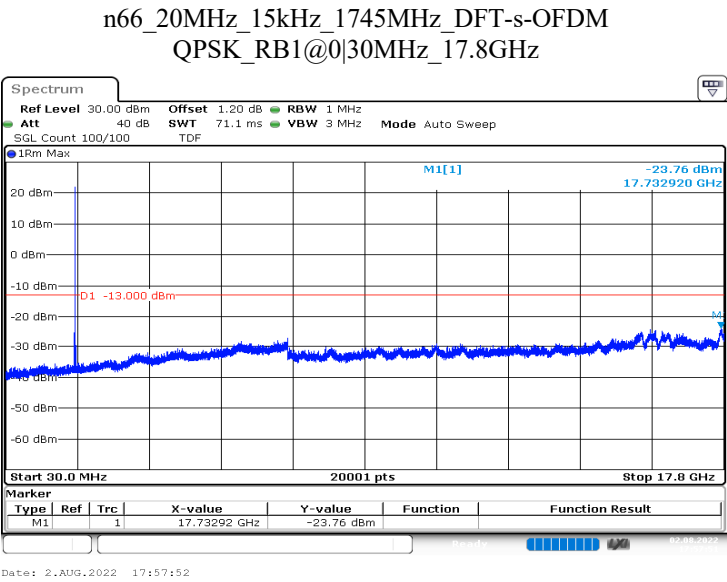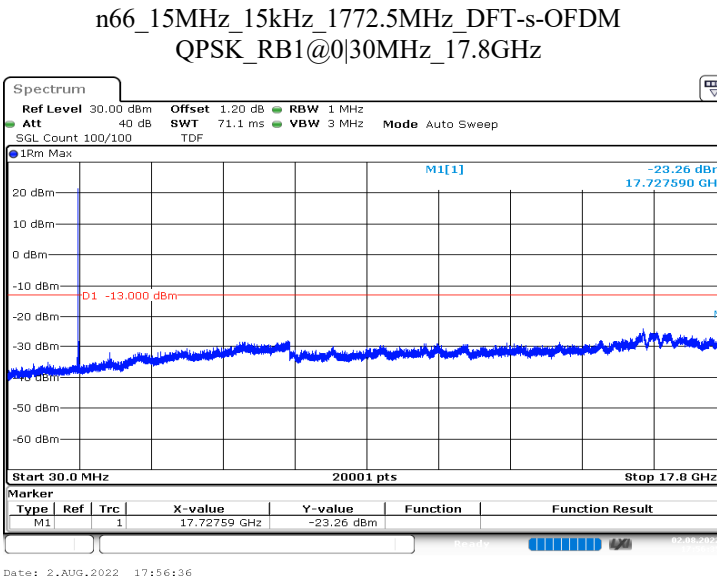


n66\_25MHz\_15kHz\_1767.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_17.8GHz

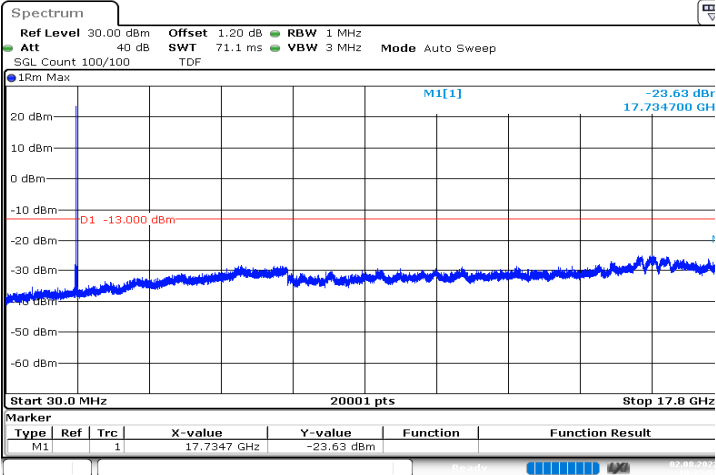

n66\_25MHz\_15kHz\_1767.5MHz\_DFT-s-OFDM  
QPSK\_RB128@0|30MHz\_17.8GHz

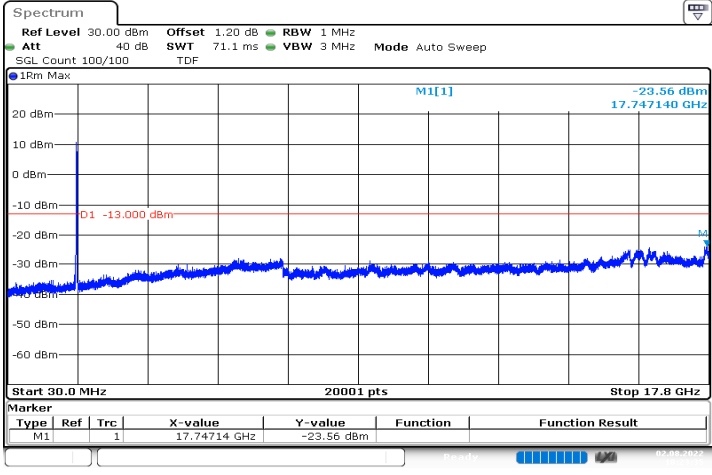


n66\_25MHz\_15kHz\_1767.5MHz\_DFT-s-OFDM  
QPSK\_RB1@132|30MHz\_17.8GHz

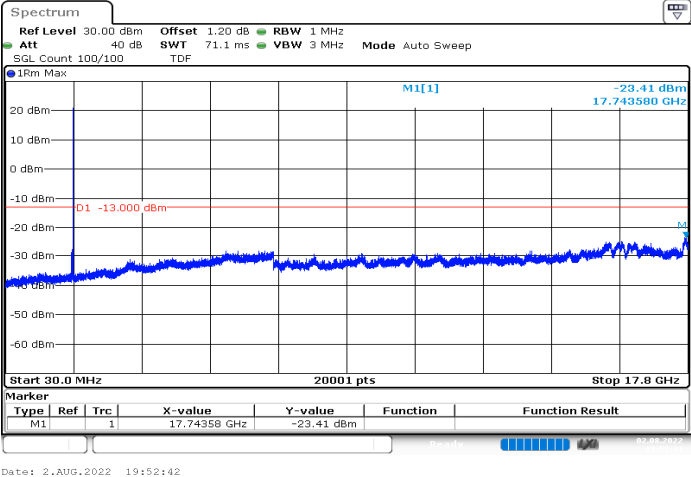




n71\_5MHz\_15kHz\_695.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_6.98GHz

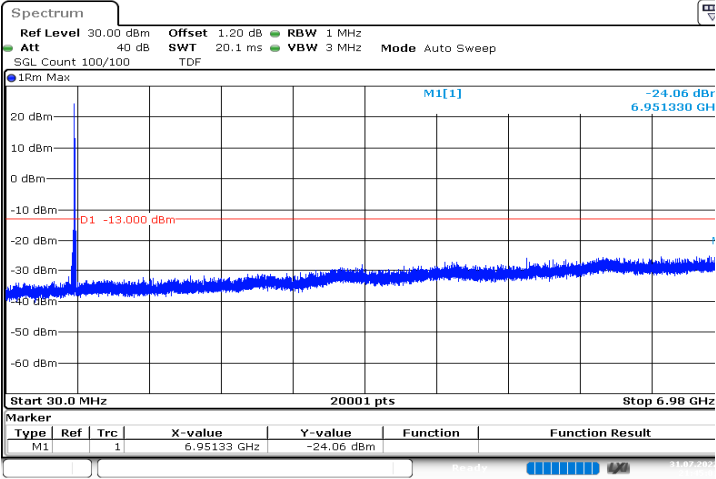


Date: 31.JUL.2022 21:45:02

n71\_5MHz\_15kHz\_695.5MHz\_DFT-s-OFDM  
QPSK\_RB1@24|30MHz\_6.98GHz

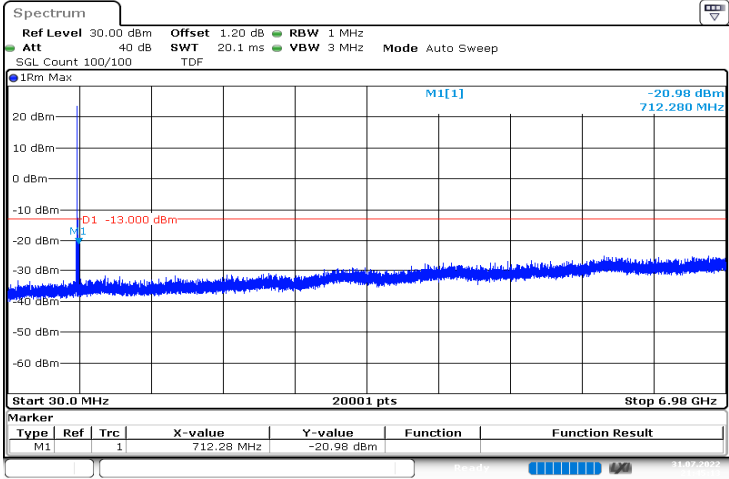


Date: 31.JUL.2022 21:45:13

n71\_5MHz\_15kHz\_695.5MHz\_DFT-s-OFDM  
QPSK\_RB25@0|30MHz\_6.98GHz

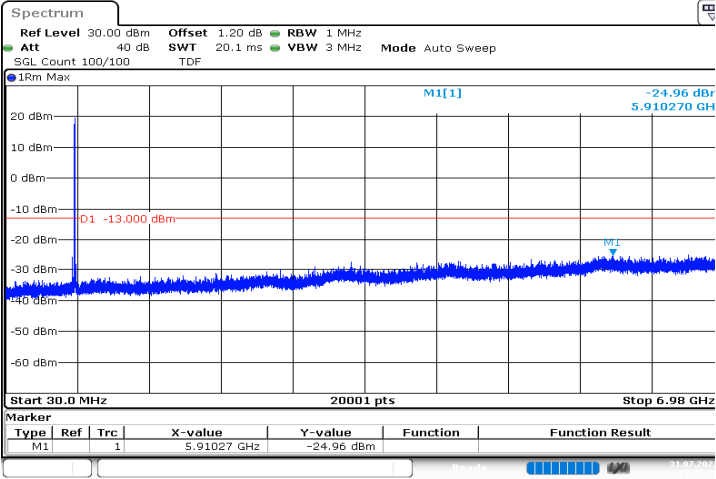


Date: 31.JUL.2022 21:45:25

n71\_10MHz\_15kHz\_668MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_6.98GHz

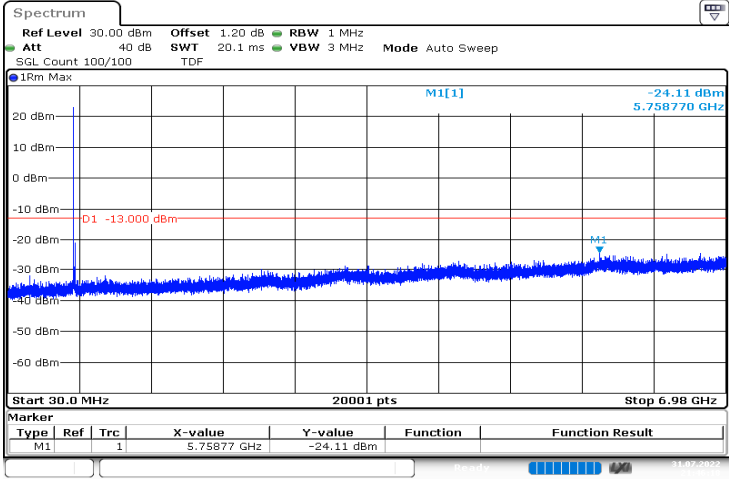


Date: 31.JUL.2022 21:46:19

n71\_10MHz\_15kHz\_668MHz\_DFT-s-OFDM  
QPSK\_RB1@51|30MHz\_6.98GHz






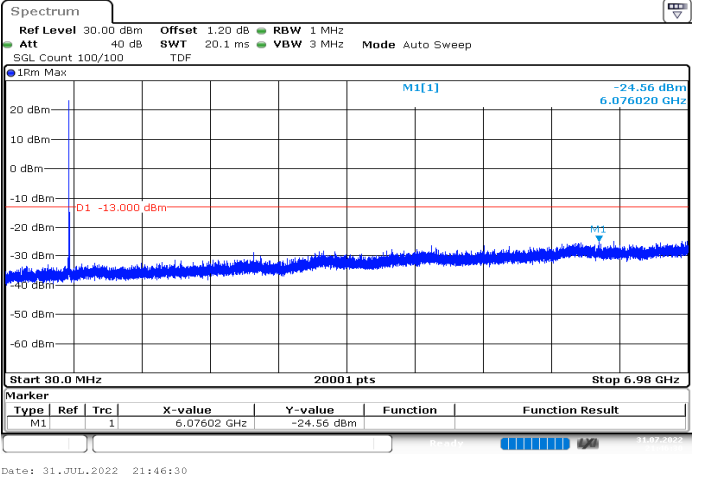


Date: 31.JUL.2022 21:46:30


n71\_10MHz\_15kHz\_668MHz\_DFT-s-OFDM  
QPSK\_RB50@0|30MHz\_6.98GHz

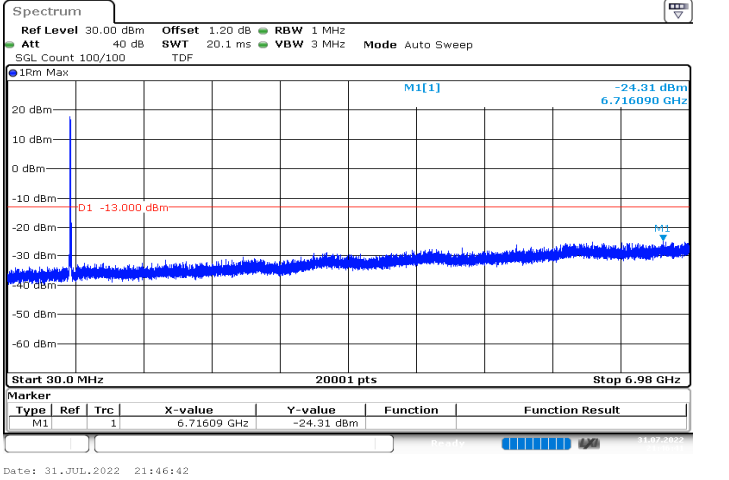

Date: 31.JUL.2022 21:46:42

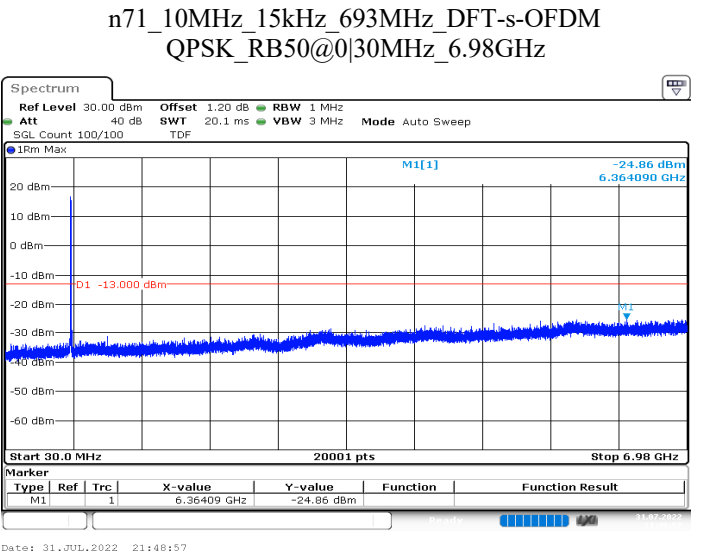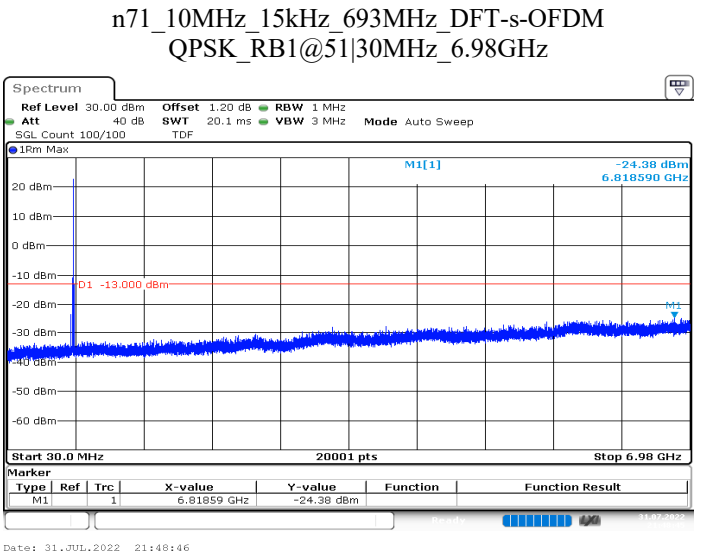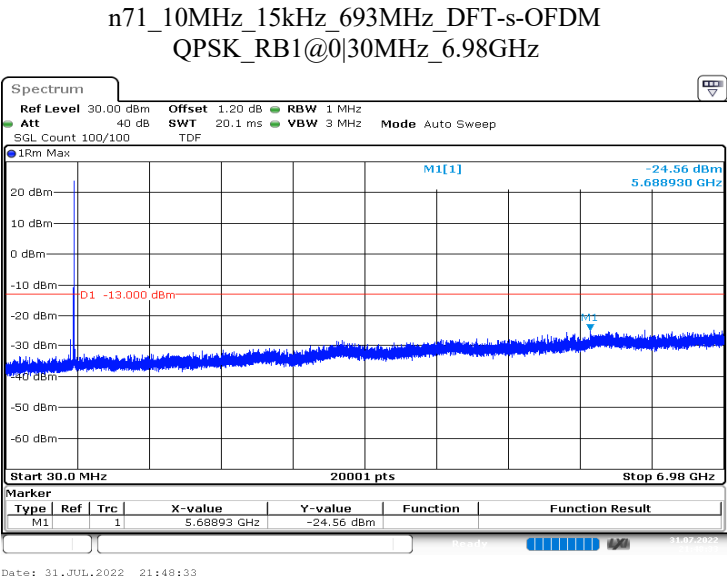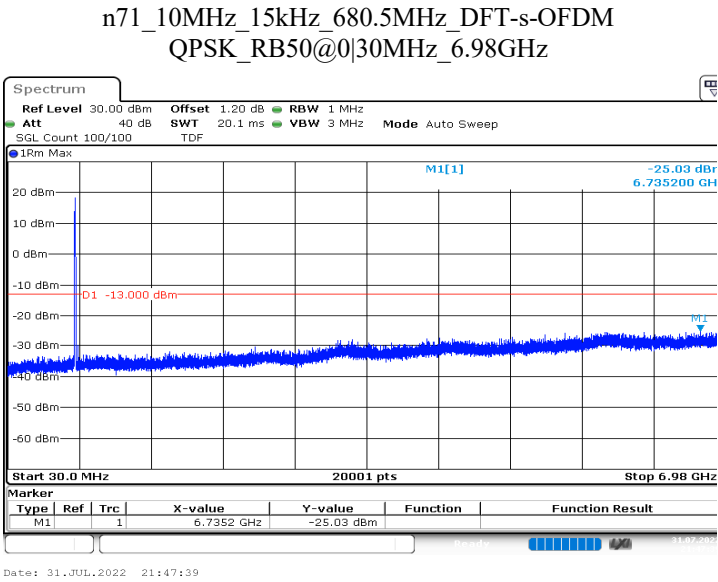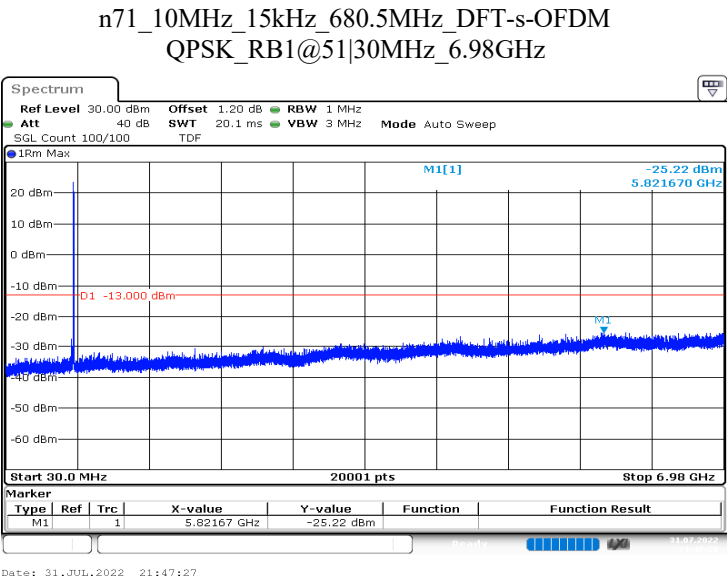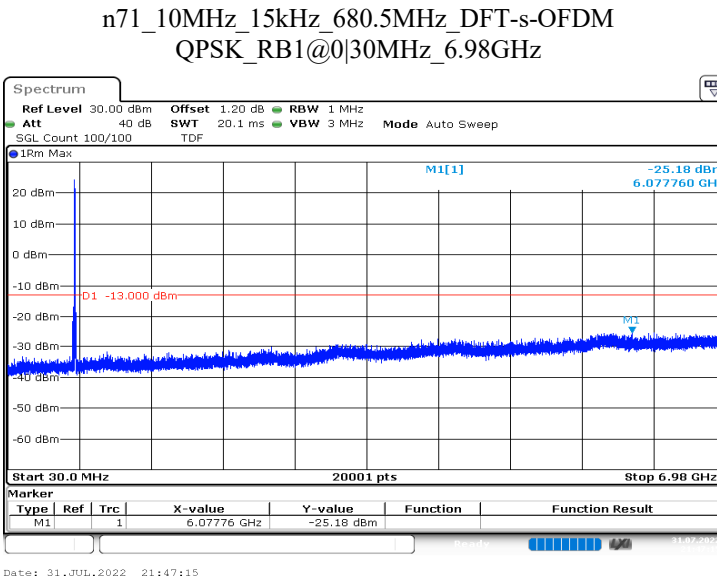


n71\_15MHz\_15kHz\_670.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_6.98GHz

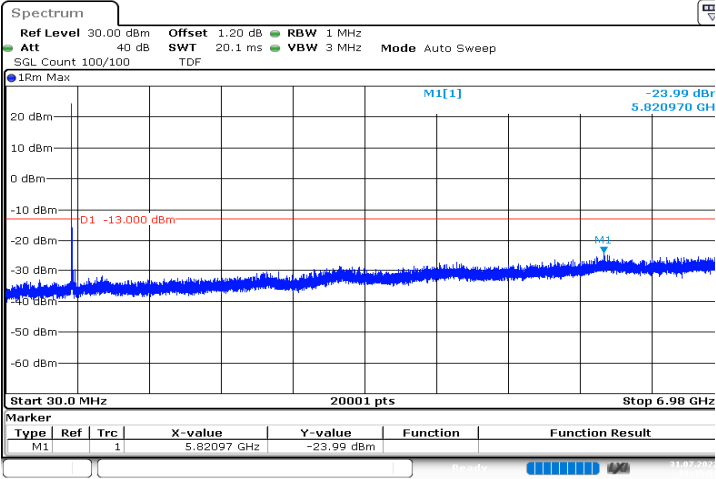


Date: 31.JUL.2022 21:49:51

n71\_15MHz\_15kHz\_670.5MHz\_DFT-s-OFDM  
QPSK\_RB1@78|30MHz\_6.98GHz

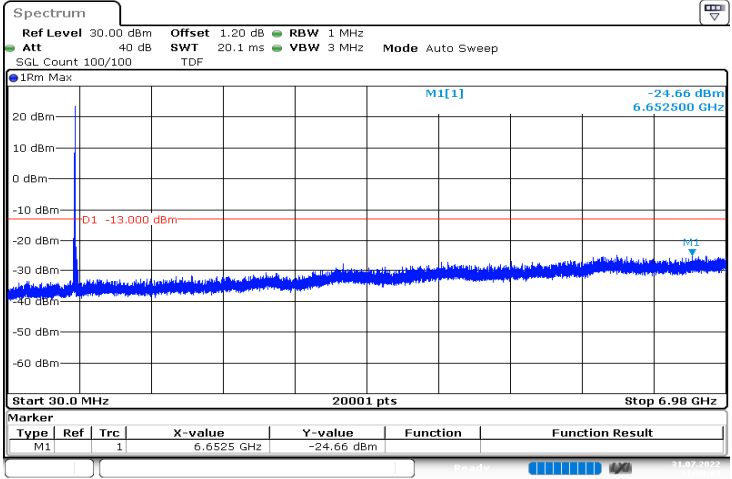


Date: 31.JUL.2022 21:50:03

n71\_15MHz\_15kHz\_670.5MHz\_DFT-s-OFDM  
QPSK\_RB75@0|30MHz\_6.98GHz

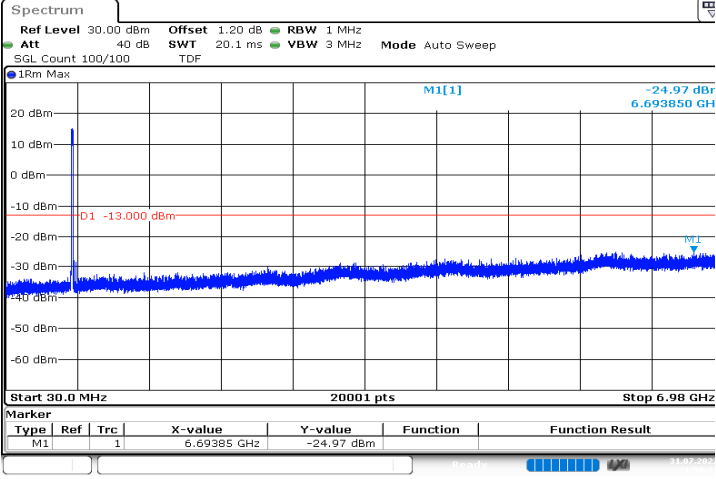


Date: 31.JUL.2022 21:50:15

n71\_15MHz\_15kHz\_680.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_6.98GHz

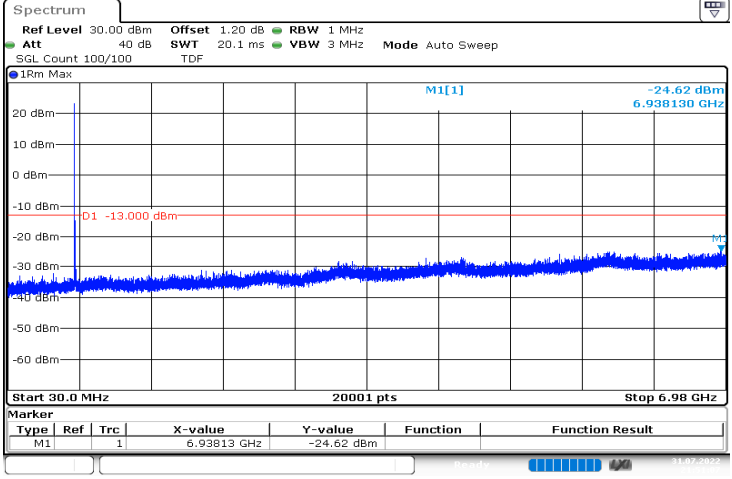


Date: 31.JUL.2022 21:51:08

n71\_15MHz\_15kHz\_680.5MHz\_DFT-s-OFDM  
QPSK\_RB1@78|30MHz\_6.98GHz






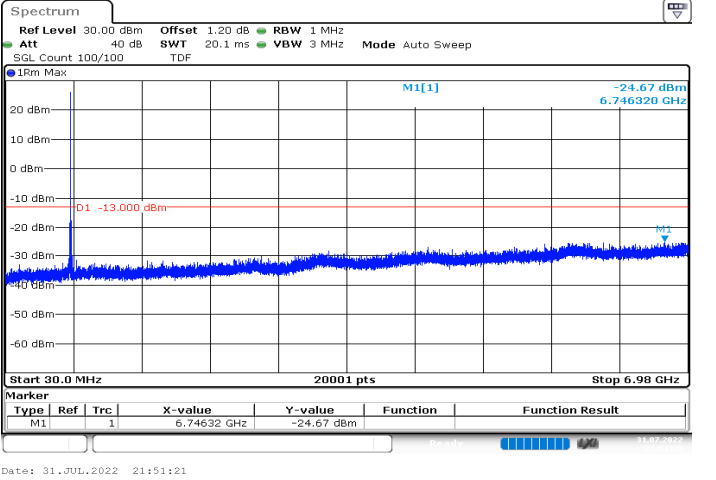


Date: 31.JUL.2022 21:51:21


n71\_15MHz\_15kHz\_680.5MHz\_DFT-s-OFDM  
QPSK\_RB75@0|30MHz\_6.98GHz

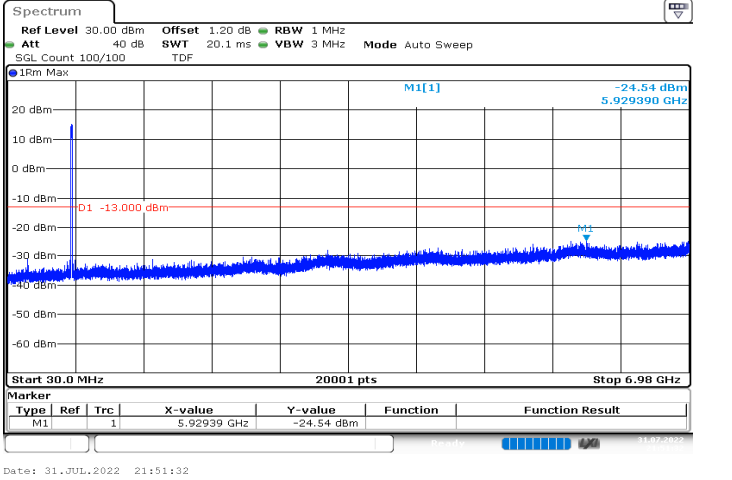

Date: 31.JUL.2022 21:51:32

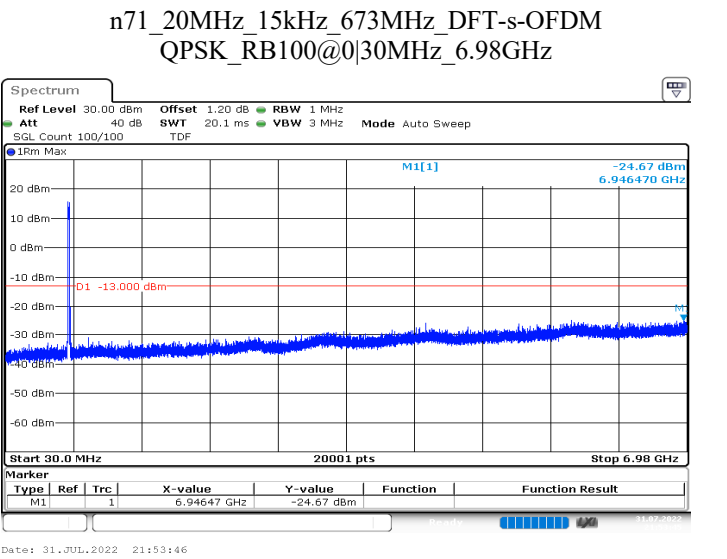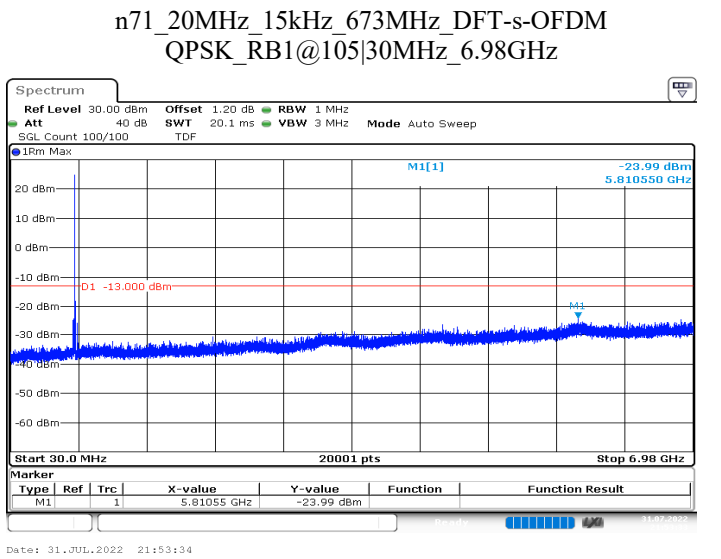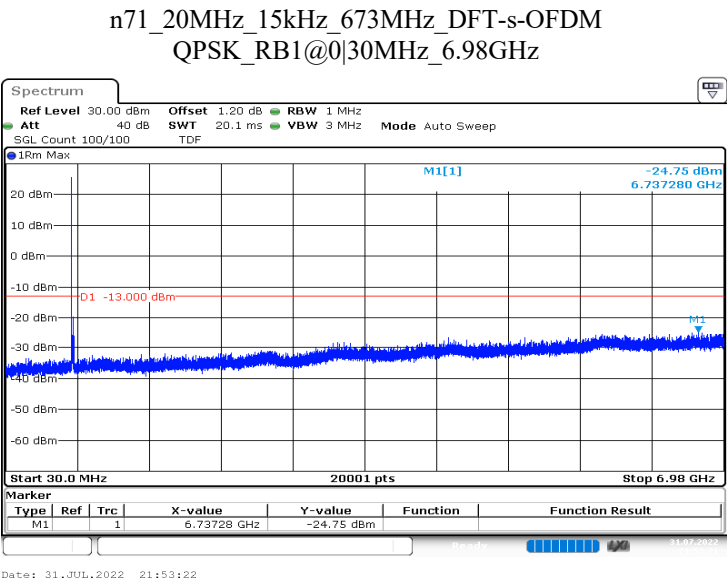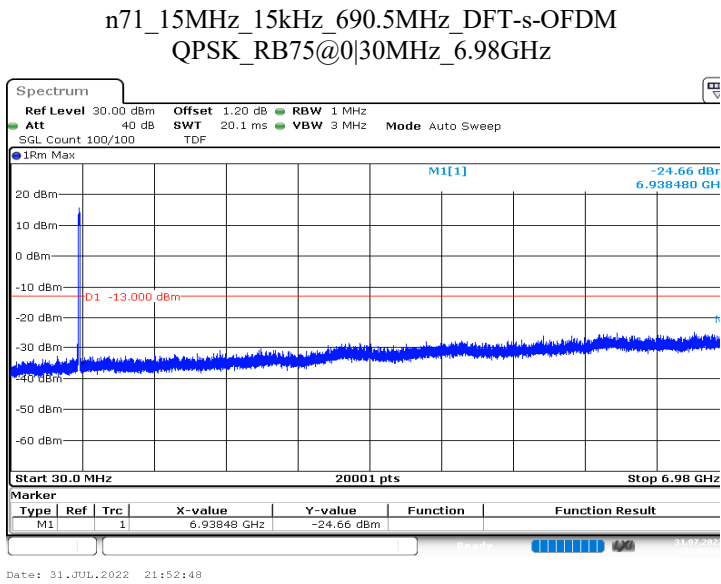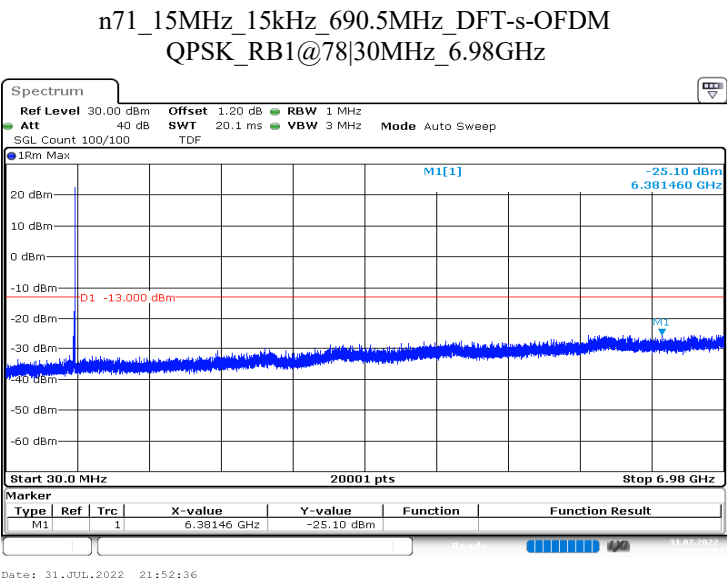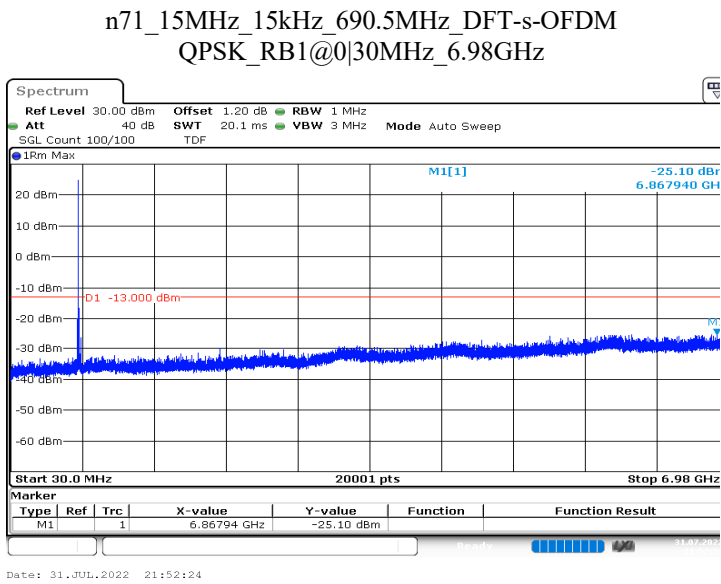


n71\_20MHz\_15kHz\_680.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_6.98GHz

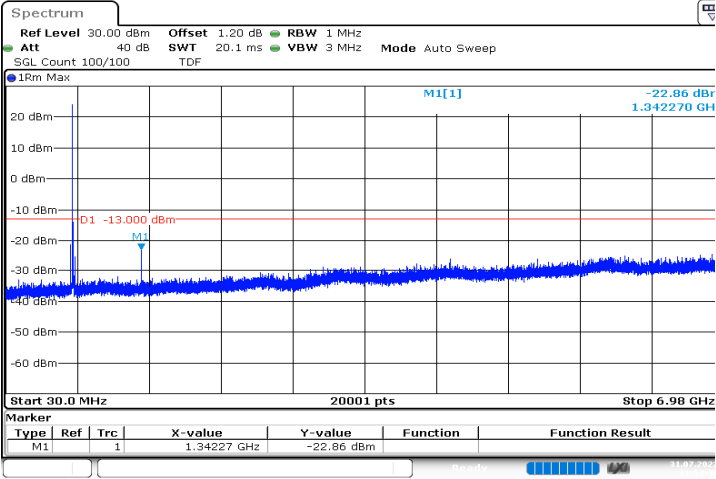


Date: 31.JUL.2022 21:54:38

n71\_20MHz\_15kHz\_680.5MHz\_DFT-s-OFDM  
QPSK\_RB1@105|30MHz\_6.98GHz

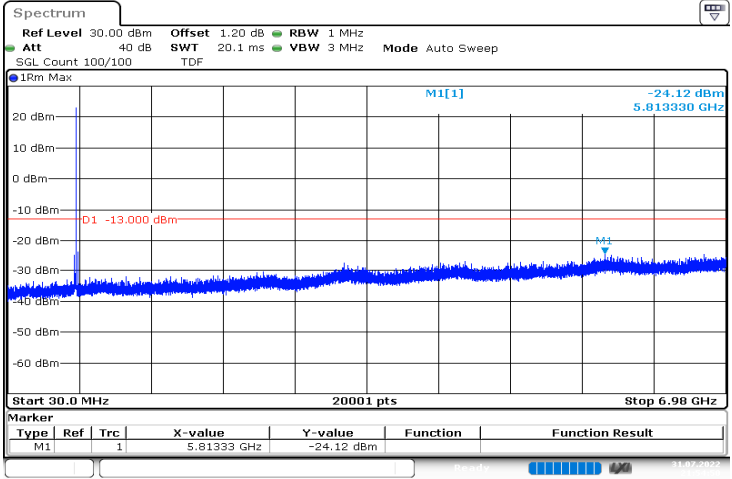


Date: 31.JUL.2022 21:54:50

n71\_20MHz\_15kHz\_680.5MHz\_DFT-s-OFDM  
QPSK\_RB100@0|30MHz\_6.98GHz

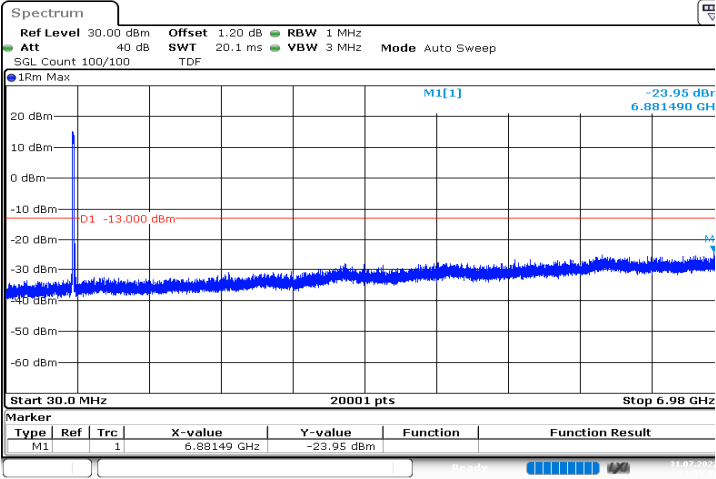


Date: 31.JUL.2022 21:55:02

n71\_20MHz\_15kHz\_688MHz\_DFT-s-OFDM  
QPSK\_RB1@0|30MHz\_6.98GHz

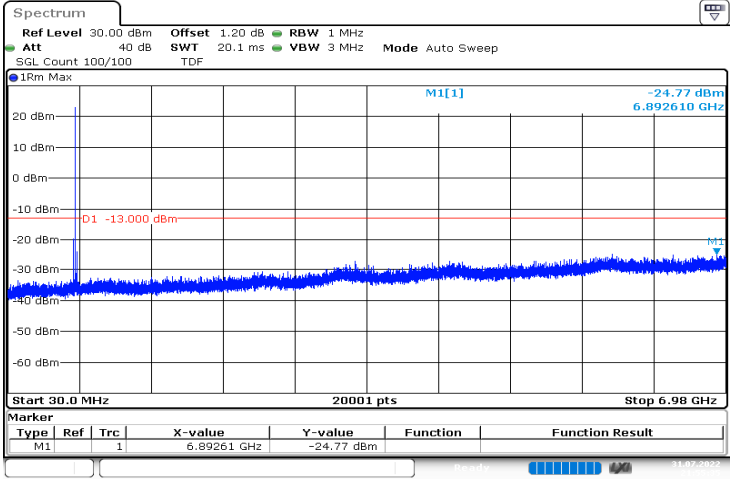


Date: 31.JUL.2022 21:55:35

n71\_20MHz\_15kHz\_688MHz\_DFT-s-OFDM  
QPSK\_RB1@105|30MHz\_6.98GHz

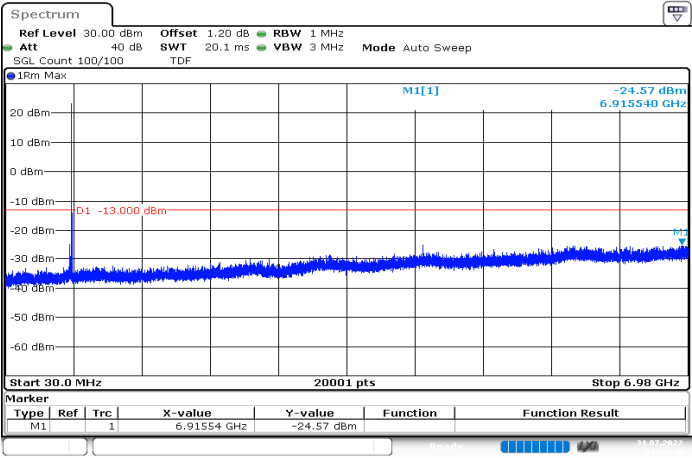

Date: 31.JUL.2022 21:55:48

n71\_20MHz\_15kHz\_688MHz\_DFT-s-OFDM  
QPSK\_RB100@0|30MHz\_6.98GHz

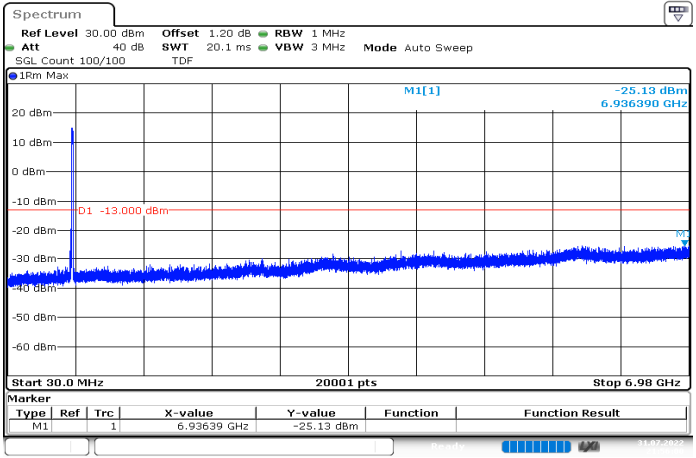

Date: 31.JUL.2022 21:56:00