


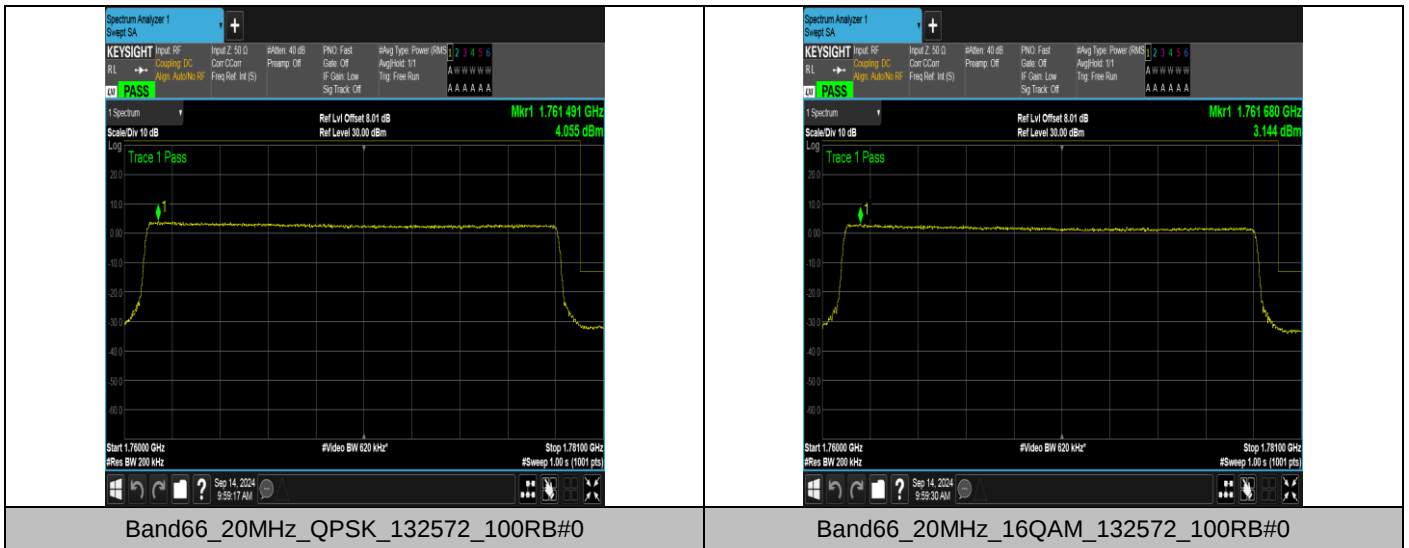

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	0.009~0.15	-55.72	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	0.15~30	-49.59	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	30~1000	-62.28	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	1000~3000	-43.60	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	3000~20000	-39.86	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	0.009~0.15	-54.96	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	0.15~30	-49.92	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	30~1000	-62.41	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	1000~3000	-42.74	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	3000~20000	-39.68	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	0.009~0.15	-57.68	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	0.15~30	-48.36	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	30~1000	-62.64	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	1000~3000	-43.92	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	3000~20000	-39.46	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	0.009~0.15	-55.26	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	0.15~30	-48.88	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	30~1000	-62.33	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	1000~3000	-42.74	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	3000~20000	-39.91	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	0.009~0.15	-56.82	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	0.15~30	-49.71	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	30~1000	-62.42	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	1000~3000	-35.15	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	3000~20000	-39.74	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	0.009~0.15	-57.19	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	0.15~30	-47.73	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	30~1000	-62.62	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	1000~3000	-36.41	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	3000~20000	-39.26	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	0.009~0.15	-55.77	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	0.15~30	-51.24	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	30~1000	-62.40	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	1000~3000	-42.82	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band66	1.4MHz	QPSK	132322	1RB#0	3000~20000	-40.08	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	0.009~0.15	-58.19	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	0.15~30	-56.20	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	30~1000	-62.51	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	1000~3000	-44.25	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	3000~20000	-39.88	PASS
Band66	1.4MHz	QPSK	132322	1RB#5	0.009~0.15	-55.80	PASS
Band66	1.4MHz	QPSK	132322	1RB#5	0.15~30	-50.73	PASS
Band66	1.4MHz	QPSK	132322	1RB#5	30~1000	-62.41	PASS
Band66	1.4MHz	QPSK	132322	1RB#5	1000~3000	-44.32	PASS
Band66	1.4MHz	QPSK	132322	1RB#5	3000~20000	-40.06	PASS
Band66	1.4MHz	16QAM	132322	1RB#5	0.009~0.15	-56.00	PASS
Band66	1.4MHz	16QAM	132322	1RB#5	0.15~30	-49.59	PASS
Band66	1.4MHz	16QAM	132322	1RB#5	30~1000	-62.54	PASS
Band66	1.4MHz	16QAM	132322	1RB#5	1000~3000	-43.33	PASS
Band66	1.4MHz	16QAM	132322	1RB#5	3000~20000	-39.83	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	0.009~0.15	-55.47	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	0.15~30	-52.20	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	30~1000	-62.56	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	1000~3000	-39.81	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	3000~20000	-40.12	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	0.009~0.15	-55.59	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	0.15~30	-50.39	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	30~1000	-62.54	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	1000~3000	-42.28	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	3000~20000	-39.79	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	0.009~0.15	-54.04	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	0.15~30	-51.05	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	30~1000	-62.65	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	1000~3000	-44.53	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	3000~20000	-39.76	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	0.009~0.15	-56.84	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	0.15~30	-51.51	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	30~1000	-62.49	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	1000~3000	-43.27	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	3000~20000	-40.12	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	0.009~0.15	-55.64	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	0.15~30	-49.97	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	30~1000	-62.58	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band66	1.4MHz	QPSK	132665	1RB#5	1000~3000	-42.52	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	3000~20000	-40.00	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	0.009~0.15	-57.04	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	0.15~30	-49.86	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	30~1000	-62.69	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	1000~3000	-43.57	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	3000~20000	-39.63	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	0.009~0.15	-55.15	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	0.15~30	-51.19	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	30~1000	-62.55	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	1000~3000	-38.85	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	3000~20000	-39.66	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	0.009~0.15	-54.16	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	0.15~30	-50.29	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	30~1000	-61.84	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	1000~3000	-37.68	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	3000~20000	-39.87	PASS
Band66	3MHz	QPSK	131987	1RB#0	0.009~0.15	-56.65	PASS
Band66	3MHz	QPSK	131987	1RB#0	0.15~30	-51.22	PASS
Band66	3MHz	QPSK	131987	1RB#0	30~1000	-62.55	PASS
Band66	3MHz	QPSK	131987	1RB#0	1000~3000	-45.53	PASS
Band66	3MHz	QPSK	131987	1RB#0	3000~20000	-39.73	PASS
Band66	3MHz	16QAM	131987	1RB#0	0.009~0.15	-55.13	PASS
Band66	3MHz	16QAM	131987	1RB#0	0.15~30	-50.09	PASS
Band66	3MHz	16QAM	131987	1RB#0	30~1000	-62.32	PASS
Band66	3MHz	16QAM	131987	1RB#0	1000~3000	-47.05	PASS
Band66	3MHz	16QAM	131987	1RB#0	3000~20000	-39.17	PASS
Band66	3MHz	QPSK	131987	1RB#14	0.009~0.15	-53.57	PASS
Band66	3MHz	QPSK	131987	1RB#14	0.15~30	-57.26	PASS
Band66	3MHz	QPSK	131987	1RB#14	30~1000	-62.63	PASS
Band66	3MHz	QPSK	131987	1RB#14	1000~3000	-45.56	PASS
Band66	3MHz	QPSK	131987	1RB#14	3000~20000	-39.60	PASS
Band66	3MHz	16QAM	131987	1RB#14	0.009~0.15	-57.66	PASS
Band66	3MHz	16QAM	131987	1RB#14	0.15~30	-59.10	PASS
Band66	3MHz	16QAM	131987	1RB#14	30~1000	-62.60	PASS
Band66	3MHz	16QAM	131987	1RB#14	1000~3000	-47.37	PASS
Band66	3MHz	16QAM	131987	1RB#14	3000~20000	-39.72	PASS
Band66	3MHz	QPSK	131987	15RB#0	0.009~0.15	-57.23	PASS
Band66	3MHz	QPSK	131987	15RB#0	0.15~30	-49.26	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band66	3MHz	QPSK	131987	15RB#0	30~1000	-62.70	PASS
Band66	3MHz	QPSK	131987	15RB#0	1000~3000	-38.18	PASS
Band66	3MHz	QPSK	131987	15RB#0	3000~20000	-39.83	PASS
Band66	3MHz	16QAM	131987	15RB#0	0.009~0.15	-56.63	PASS
Band66	3MHz	16QAM	131987	15RB#0	0.15~30	-52.49	PASS
Band66	3MHz	16QAM	131987	15RB#0	30~1000	-62.38	PASS
Band66	3MHz	16QAM	131987	15RB#0	1000~3000	-38.40	PASS
Band66	3MHz	16QAM	131987	15RB#0	3000~20000	-39.75	PASS
Band66	3MHz	QPSK	132322	1RB#0	0.009~0.15	-54.99	PASS
Band66	3MHz	QPSK	132322	1RB#0	0.15~30	-51.30	PASS
Band66	3MHz	QPSK	132322	1RB#0	30~1000	-62.74	PASS
Band66	3MHz	QPSK	132322	1RB#0	1000~3000	-45.50	PASS
Band66	3MHz	QPSK	132322	1RB#0	3000~20000	-39.65	PASS
Band66	3MHz	16QAM	132322	1RB#0	0.009~0.15	-54.83	PASS
Band66	3MHz	16QAM	132322	1RB#0	0.15~30	-51.02	PASS
Band66	3MHz	16QAM	132322	1RB#0	30~1000	-62.35	PASS
Band66	3MHz	16QAM	132322	1RB#0	1000~3000	-47.21	PASS
Band66	3MHz	16QAM	132322	1RB#0	3000~20000	-39.72	PASS
Band66	3MHz	QPSK	132322	1RB#14	0.009~0.15	-58.54	PASS
Band66	3MHz	QPSK	132322	1RB#14	0.15~30	-51.28	PASS
Band66	3MHz	QPSK	132322	1RB#14	30~1000	-62.67	PASS
Band66	3MHz	QPSK	132322	1RB#14	1000~3000	-46.09	PASS
Band66	3MHz	QPSK	132322	1RB#14	3000~20000	-39.64	PASS
Band66	3MHz	16QAM	132322	1RB#14	0.009~0.15	-56.10	PASS
Band66	3MHz	16QAM	132322	1RB#14	0.15~30	-49.01	PASS
Band66	3MHz	16QAM	132322	1RB#14	30~1000	-62.47	PASS
Band66	3MHz	16QAM	132322	1RB#14	1000~3000	-47.26	PASS
Band66	3MHz	16QAM	132322	1RB#14	3000~20000	-39.97	PASS
Band66	3MHz	QPSK	132322	15RB#0	0.009~0.15	-56.68	PASS
Band66	3MHz	QPSK	132322	15RB#0	0.15~30	-51.58	PASS
Band66	3MHz	QPSK	132322	15RB#0	30~1000	-62.75	PASS
Band66	3MHz	QPSK	132322	15RB#0	1000~3000	-44.07	PASS
Band66	3MHz	QPSK	132322	15RB#0	3000~20000	-39.78	PASS
Band66	3MHz	16QAM	132322	15RB#0	0.009~0.15	-56.77	PASS
Band66	3MHz	16QAM	132322	15RB#0	0.15~30	-52.18	PASS
Band66	3MHz	16QAM	132322	15RB#0	30~1000	-62.69	PASS
Band66	3MHz	16QAM	132322	15RB#0	1000~3000	-43.84	PASS
Band66	3MHz	16QAM	132322	15RB#0	3000~20000	-39.72	PASS
Band66	3MHz	QPSK	132657	1RB#0	0.009~0.15	-54.08	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band66	3MHz	QPSK	132657	1RB#0	0.15~30	-51.08	PASS
Band66	3MHz	QPSK	132657	1RB#0	30~1000	-62.66	PASS
Band66	3MHz	QPSK	132657	1RB#0	1000~3000	-40.99	PASS
Band66	3MHz	QPSK	132657	1RB#0	3000~20000	-39.69	PASS
Band66	3MHz	16QAM	132657	1RB#0	0.009~0.15	-55.80	PASS
Band66	3MHz	16QAM	132657	1RB#0	0.15~30	-51.41	PASS
Band66	3MHz	16QAM	132657	1RB#0	30~1000	-62.83	PASS
Band66	3MHz	16QAM	132657	1RB#0	1000~3000	-42.65	PASS
Band66	3MHz	16QAM	132657	1RB#0	3000~20000	-39.66	PASS
Band66	3MHz	QPSK	132657	1RB#14	0.009~0.15	-56.54	PASS
Band66	3MHz	QPSK	132657	1RB#14	0.15~30	-52.76	PASS
Band66	3MHz	QPSK	132657	1RB#14	30~1000	-62.42	PASS
Band66	3MHz	QPSK	132657	1RB#14	1000~3000	-45.58	PASS
Band66	3MHz	QPSK	132657	1RB#14	3000~20000	-39.61	PASS
Band66	3MHz	16QAM	132657	1RB#14	0.009~0.15	-55.62	PASS
Band66	3MHz	16QAM	132657	1RB#14	0.15~30	-51.47	PASS
Band66	3MHz	16QAM	132657	1RB#14	30~1000	-62.53	PASS
Band66	3MHz	16QAM	132657	1RB#14	1000~3000	-46.49	PASS
Band66	3MHz	16QAM	132657	1RB#14	3000~20000	-39.58	PASS
Band66	3MHz	QPSK	132657	15RB#0	0.009~0.15	-54.78	PASS
Band66	3MHz	QPSK	132657	15RB#0	0.15~30	-52.62	PASS
Band66	3MHz	QPSK	132657	15RB#0	30~1000	-62.25	PASS
Band66	3MHz	QPSK	132657	15RB#0	1000~3000	-40.02	PASS
Band66	3MHz	QPSK	132657	15RB#0	3000~20000	-39.67	PASS
Band66	3MHz	16QAM	132657	15RB#0	0.009~0.15	-56.36	PASS
Band66	3MHz	16QAM	132657	15RB#0	0.15~30	-51.93	PASS
Band66	3MHz	16QAM	132657	15RB#0	30~1000	-62.32	PASS
Band66	3MHz	16QAM	132657	15RB#0	1000~3000	-41.46	PASS
Band66	3MHz	16QAM	132657	15RB#0	3000~20000	-39.69	PASS
Band66	5MHz	QPSK	131997	1RB#0	0.009~0.15	-54.81	PASS
Band66	5MHz	QPSK	131997	1RB#0	0.15~30	-50.23	PASS
Band66	5MHz	QPSK	131997	1RB#0	30~1000	-62.50	PASS
Band66	5MHz	QPSK	131997	1RB#0	1000~3000	-47.51	PASS
Band66	5MHz	QPSK	131997	1RB#0	3000~20000	-39.76	PASS
Band66	5MHz	16QAM	131997	1RB#0	0.009~0.15	-55.15	PASS
Band66	5MHz	16QAM	131997	1RB#0	0.15~30	-50.88	PASS
Band66	5MHz	16QAM	131997	1RB#0	30~1000	-62.60	PASS
Band66	5MHz	16QAM	131997	1RB#0	1000~3000	-47.37	PASS
Band66	5MHz	16QAM	131997	1RB#0	3000~20000	-39.79	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band66	5MHz	QPSK	131997	1RB#24	0.009~0.15	-55.83	PASS
Band66	5MHz	QPSK	131997	1RB#24	0.15~30	-57.88	PASS
Band66	5MHz	QPSK	131997	1RB#24	30~1000	-62.44	PASS
Band66	5MHz	QPSK	131997	1RB#24	1000~3000	-47.82	PASS
Band66	5MHz	QPSK	131997	1RB#24	3000~20000	-38.95	PASS
Band66	5MHz	16QAM	131997	1RB#24	0.009~0.15	-56.27	PASS
Band66	5MHz	16QAM	131997	1RB#24	0.15~30	-58.27	PASS
Band66	5MHz	16QAM	131997	1RB#24	30~1000	-62.44	PASS
Band66	5MHz	16QAM	131997	1RB#24	1000~3000	-47.32	PASS
Band66	5MHz	16QAM	131997	1RB#24	3000~20000	-39.02	PASS
Band66	5MHz	QPSK	131997	25RB#0	0.009~0.15	-58.23	PASS
Band66	5MHz	QPSK	131997	25RB#0	0.15~30	-50.15	PASS
Band66	5MHz	QPSK	131997	25RB#0	30~1000	-62.07	PASS
Band66	5MHz	QPSK	131997	25RB#0	1000~3000	-38.75	PASS
Band66	5MHz	QPSK	131997	25RB#0	3000~20000	-39.69	PASS
Band66	5MHz	16QAM	131997	25RB#0	0.009~0.15	-56.95	PASS
Band66	5MHz	16QAM	131997	25RB#0	0.15~30	-50.01	PASS
Band66	5MHz	16QAM	131997	25RB#0	30~1000	-62.55	PASS
Band66	5MHz	16QAM	131997	25RB#0	1000~3000	-42.84	PASS
Band66	5MHz	16QAM	131997	25RB#0	3000~20000	-39.87	PASS
Band66	5MHz	QPSK	132322	1RB#0	0.009~0.15	-54.47	PASS
Band66	5MHz	QPSK	132322	1RB#0	0.15~30	-50.49	PASS
Band66	5MHz	QPSK	132322	1RB#0	30~1000	-62.45	PASS
Band66	5MHz	QPSK	132322	1RB#0	1000~3000	-47.47	PASS
Band66	5MHz	QPSK	132322	1RB#0	3000~20000	-39.93	PASS
Band66	5MHz	16QAM	132322	1RB#0	0.009~0.15	-56.69	PASS
Band66	5MHz	16QAM	132322	1RB#0	0.15~30	-50.69	PASS
Band66	5MHz	16QAM	132322	1RB#0	30~1000	-62.15	PASS
Band66	5MHz	16QAM	132322	1RB#0	1000~3000	-47.79	PASS
Band66	5MHz	16QAM	132322	1RB#0	3000~20000	-39.63	PASS
Band66	5MHz	QPSK	132322	1RB#24	0.009~0.15	-56.63	PASS
Band66	5MHz	QPSK	132322	1RB#24	0.15~30	-51.35	PASS
Band66	5MHz	QPSK	132322	1RB#24	30~1000	-62.00	PASS
Band66	5MHz	QPSK	132322	1RB#24	1000~3000	-47.30	PASS
Band66	5MHz	QPSK	132322	1RB#24	3000~20000	-39.11	PASS
Band66	5MHz	16QAM	132322	1RB#24	0.009~0.15	-55.78	PASS
Band66	5MHz	16QAM	132322	1RB#24	0.15~30	-50.64	PASS
Band66	5MHz	16QAM	132322	1RB#24	30~1000	-62.46	PASS
Band66	5MHz	16QAM	132322	1RB#24	1000~3000	-47.61	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band66	5MHz	16QAM	132322	1RB#24	3000~20000	-39.56	PASS
Band66	5MHz	QPSK	132322	25RB#0	0.009~0.15	-56.17	PASS
Band66	5MHz	QPSK	132322	25RB#0	0.15~30	-49.70	PASS
Band66	5MHz	QPSK	132322	25RB#0	30~1000	-62.47	PASS
Band66	5MHz	QPSK	132322	25RB#0	1000~3000	-46.62	PASS
Band66	5MHz	QPSK	132322	25RB#0	3000~20000	-39.47	PASS
Band66	5MHz	16QAM	132322	25RB#0	0.009~0.15	-56.43	PASS
Band66	5MHz	16QAM	132322	25RB#0	0.15~30	-51.62	PASS
Band66	5MHz	16QAM	132322	25RB#0	30~1000	-62.58	PASS
Band66	5MHz	16QAM	132322	25RB#0	1000~3000	-47.23	PASS
Band66	5MHz	16QAM	132322	25RB#0	3000~20000	-39.66	PASS
Band66	5MHz	QPSK	132647	1RB#0	0.009~0.15	-55.53	PASS
Band66	5MHz	QPSK	132647	1RB#0	0.15~30	-52.90	PASS
Band66	5MHz	QPSK	132647	1RB#0	30~1000	-62.65	PASS
Band66	5MHz	QPSK	132647	1RB#0	1000~3000	-47.10	PASS
Band66	5MHz	QPSK	132647	1RB#0	3000~20000	-39.99	PASS
Band66	5MHz	16QAM	132647	1RB#0	0.009~0.15	-54.80	PASS
Band66	5MHz	16QAM	132647	1RB#0	0.15~30	-51.13	PASS
Band66	5MHz	16QAM	132647	1RB#0	30~1000	-62.57	PASS
Band66	5MHz	16QAM	132647	1RB#0	1000~3000	-47.49	PASS
Band66	5MHz	16QAM	132647	1RB#0	3000~20000	-39.09	PASS
Band66	5MHz	QPSK	132647	1RB#24	0.009~0.15	-54.14	PASS
Band66	5MHz	QPSK	132647	1RB#24	0.15~30	-53.20	PASS
Band66	5MHz	QPSK	132647	1RB#24	30~1000	-62.24	PASS
Band66	5MHz	QPSK	132647	1RB#24	1000~3000	-47.56	PASS
Band66	5MHz	QPSK	132647	1RB#24	3000~20000	-39.85	PASS
Band66	5MHz	16QAM	132647	1RB#24	0.009~0.15	-56.43	PASS
Band66	5MHz	16QAM	132647	1RB#24	0.15~30	-51.27	PASS
Band66	5MHz	16QAM	132647	1RB#24	30~1000	-62.46	PASS
Band66	5MHz	16QAM	132647	1RB#24	1000~3000	-47.35	PASS
Band66	5MHz	16QAM	132647	1RB#24	3000~20000	-39.47	PASS
Band66	5MHz	QPSK	132647	25RB#0	0.009~0.15	-56.62	PASS
Band66	5MHz	QPSK	132647	25RB#0	0.15~30	-52.95	PASS
Band66	5MHz	QPSK	132647	25RB#0	30~1000	-62.62	PASS
Band66	5MHz	QPSK	132647	25RB#0	1000~3000	-38.19	PASS
Band66	5MHz	QPSK	132647	25RB#0	3000~20000	-39.59	PASS
Band66	5MHz	16QAM	132647	25RB#0	0.009~0.15	-55.43	PASS
Band66	5MHz	16QAM	132647	25RB#0	0.15~30	-49.63	PASS
Band66	5MHz	16QAM	132647	25RB#0	30~1000	-62.58	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band66	5MHz	16QAM	132647	25RB#0	1000~3000	-40.04	PASS
Band66	5MHz	16QAM	132647	25RB#0	3000~20000	-39.59	PASS
Band66	10MHz	QPSK	132022	1RB#0	0.009~0.15	-56.19	PASS
Band66	10MHz	QPSK	132022	1RB#0	0.15~30	-48.95	PASS
Band66	10MHz	QPSK	132022	1RB#0	30~1000	-62.33	PASS
Band66	10MHz	QPSK	132022	1RB#0	1000~3000	-47.83	PASS
Band66	10MHz	QPSK	132022	1RB#0	3000~20000	-39.57	PASS
Band66	10MHz	16QAM	132022	1RB#0	0.009~0.15	-55.44	PASS
Band66	10MHz	16QAM	132022	1RB#0	0.15~30	-49.74	PASS
Band66	10MHz	16QAM	132022	1RB#0	30~1000	-62.47	PASS
Band66	10MHz	16QAM	132022	1RB#0	1000~3000	-47.62	PASS
Band66	10MHz	16QAM	132022	1RB#0	3000~20000	-39.28	PASS
Band66	10MHz	QPSK	132022	1RB#49	0.009~0.15	-57.29	PASS
Band66	10MHz	QPSK	132022	1RB#49	0.15~30	-50.18	PASS
Band66	10MHz	QPSK	132022	1RB#49	30~1000	-62.78	PASS
Band66	10MHz	QPSK	132022	1RB#49	1000~3000	-47.64	PASS
Band66	10MHz	QPSK	132022	1RB#49	3000~20000	-38.30	PASS
Band66	10MHz	16QAM	132022	1RB#49	0.009~0.15	-55.44	PASS
Band66	10MHz	16QAM	132022	1RB#49	0.15~30	-60.64	PASS
Band66	10MHz	16QAM	132022	1RB#49	30~1000	-62.35	PASS
Band66	10MHz	16QAM	132022	1RB#49	1000~3000	-43.58	PASS
Band66	10MHz	16QAM	132022	1RB#49	3000~20000	-38.23	PASS
Band66	10MHz	QPSK	132022	50RB#0	0.009~0.15	-54.12	PASS
Band66	10MHz	QPSK	132022	50RB#0	0.15~30	-49.22	PASS
Band66	10MHz	QPSK	132022	50RB#0	30~1000	-62.32	PASS
Band66	10MHz	QPSK	132022	50RB#0	1000~3000	-43.61	PASS
Band66	10MHz	QPSK	132022	50RB#0	3000~20000	-39.66	PASS
Band66	10MHz	16QAM	132022	50RB#0	0.009~0.15	-54.80	PASS
Band66	10MHz	16QAM	132022	50RB#0	0.15~30	-49.90	PASS
Band66	10MHz	16QAM	132022	50RB#0	30~1000	-62.01	PASS
Band66	10MHz	16QAM	132022	50RB#0	1000~3000	-45.34	PASS
Band66	10MHz	16QAM	132022	50RB#0	3000~20000	-39.53	PASS
Band66	10MHz	QPSK	132322	1RB#0	0.009~0.15	-57.34	PASS
Band66	10MHz	QPSK	132322	1RB#0	0.15~30	-50.59	PASS
Band66	10MHz	QPSK	132322	1RB#0	30~1000	-62.44	PASS
Band66	10MHz	QPSK	132322	1RB#0	1000~3000	-46.69	PASS
Band66	10MHz	QPSK	132322	1RB#0	3000~20000	-39.66	PASS
Band66	10MHz	16QAM	132322	1RB#0	0.009~0.15	-54.94	PASS
Band66	10MHz	16QAM	132322	1RB#0	0.15~30	-51.96	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band66	10MHz	16QAM	132322	1RB#0	30~1000	-62.46	PASS
Band66	10MHz	16QAM	132322	1RB#0	1000~3000	-47.55	PASS
Band66	10MHz	16QAM	132322	1RB#0	3000~20000	-39.57	PASS
Band66	10MHz	QPSK	132322	1RB#49	0.009~0.15	-54.53	PASS
Band66	10MHz	QPSK	132322	1RB#49	0.15~30	-51.07	PASS
Band66	10MHz	QPSK	132322	1RB#49	30~1000	-62.54	PASS
Band66	10MHz	QPSK	132322	1RB#49	1000~3000	-47.55	PASS
Band66	10MHz	QPSK	132322	1RB#49	3000~20000	-39.78	PASS
Band66	10MHz	16QAM	132322	1RB#49	0.009~0.15	-55.08	PASS
Band66	10MHz	16QAM	132322	1RB#49	0.15~30	-48.00	PASS
Band66	10MHz	16QAM	132322	1RB#49	30~1000	-62.38	PASS
Band66	10MHz	16QAM	132322	1RB#49	1000~3000	-47.50	PASS
Band66	10MHz	16QAM	132322	1RB#49	3000~20000	-39.49	PASS
Band66	10MHz	QPSK	132322	50RB#0	0.009~0.15	-55.83	PASS
Band66	10MHz	QPSK	132322	50RB#0	0.15~30	-49.81	PASS
Band66	10MHz	QPSK	132322	50RB#0	30~1000	-62.23	PASS
Band66	10MHz	QPSK	132322	50RB#0	1000~3000	-46.82	PASS
Band66	10MHz	QPSK	132322	50RB#0	3000~20000	-39.61	PASS
Band66	10MHz	16QAM	132322	50RB#0	0.009~0.15	-53.65	PASS
Band66	10MHz	16QAM	132322	50RB#0	0.15~30	-51.05	PASS
Band66	10MHz	16QAM	132322	50RB#0	30~1000	-62.37	PASS
Band66	10MHz	16QAM	132322	50RB#0	1000~3000	-47.35	PASS
Band66	10MHz	16QAM	132322	50RB#0	3000~20000	-39.54	PASS
Band66	10MHz	QPSK	132622	1RB#0	0.009~0.15	-57.62	PASS
Band66	10MHz	QPSK	132622	1RB#0	0.15~30	-49.61	PASS
Band66	10MHz	QPSK	132622	1RB#0	30~1000	-62.62	PASS
Band66	10MHz	QPSK	132622	1RB#0	1000~3000	-46.85	PASS
Band66	10MHz	QPSK	132622	1RB#0	3000~20000	-39.44	PASS
Band66	10MHz	16QAM	132622	1RB#0	0.009~0.15	-54.17	PASS
Band66	10MHz	16QAM	132622	1RB#0	0.15~30	-50.51	PASS
Band66	10MHz	16QAM	132622	1RB#0	30~1000	-62.47	PASS
Band66	10MHz	16QAM	132622	1RB#0	1000~3000	-47.51	PASS
Band66	10MHz	16QAM	132622	1RB#0	3000~20000	-39.32	PASS
Band66	10MHz	QPSK	132622	1RB#49	0.009~0.15	-54.71	PASS
Band66	10MHz	QPSK	132622	1RB#49	0.15~30	-50.48	PASS
Band66	10MHz	QPSK	132622	1RB#49	30~1000	-62.56	PASS
Band66	10MHz	QPSK	132622	1RB#49	1000~3000	-47.42	PASS
Band66	10MHz	QPSK	132622	1RB#49	3000~20000	-39.42	PASS
Band66	10MHz	16QAM	132622	1RB#49	0.009~0.15	-56.30	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band66	10MHz	16QAM	132622	1RB#49	0.15~30	-50.45	PASS
Band66	10MHz	16QAM	132622	1RB#49	30~1000	-62.53	PASS
Band66	10MHz	16QAM	132622	1RB#49	1000~3000	-47.61	PASS
Band66	10MHz	16QAM	132622	1RB#49	3000~20000	-39.56	PASS
Band66	10MHz	QPSK	132622	50RB#0	0.009~0.15	-55.48	PASS
Band66	10MHz	QPSK	132622	50RB#0	0.15~30	-49.59	PASS
Band66	10MHz	QPSK	132622	50RB#0	30~1000	-62.45	PASS
Band66	10MHz	QPSK	132622	50RB#0	1000~3000	-38.20	PASS
Band66	10MHz	QPSK	132622	50RB#0	3000~20000	-39.82	PASS
Band66	10MHz	16QAM	132622	50RB#0	0.009~0.15	-54.61	PASS
Band66	10MHz	16QAM	132622	50RB#0	0.15~30	-51.83	PASS
Band66	10MHz	16QAM	132622	50RB#0	30~1000	-62.19	PASS
Band66	10MHz	16QAM	132622	50RB#0	1000~3000	-39.61	PASS
Band66	10MHz	16QAM	132622	50RB#0	3000~20000	-39.69	PASS
Band66	15MHz	QPSK	132047	1RB#0	0.009~0.15	-54.86	PASS
Band66	15MHz	QPSK	132047	1RB#0	0.15~30	-51.32	PASS
Band66	15MHz	QPSK	132047	1RB#0	30~1000	-62.55	PASS
Band66	15MHz	QPSK	132047	1RB#0	1000~3000	-47.72	PASS
Band66	15MHz	QPSK	132047	1RB#0	3000~20000	-39.59	PASS
Band66	15MHz	16QAM	132047	1RB#0	0.009~0.15	-55.29	PASS
Band66	15MHz	16QAM	132047	1RB#0	0.15~30	-50.64	PASS
Band66	15MHz	16QAM	132047	1RB#0	30~1000	-62.39	PASS
Band66	15MHz	16QAM	132047	1RB#0	1000~3000	-47.28	PASS
Band66	15MHz	16QAM	132047	1RB#0	3000~20000	-39.51	PASS
Band66	15MHz	QPSK	132047	1RB#74	0.009~0.15	-56.03	PASS
Band66	15MHz	QPSK	132047	1RB#74	0.15~30	-51.87	PASS
Band66	15MHz	QPSK	132047	1RB#74	30~1000	-62.68	PASS
Band66	15MHz	QPSK	132047	1RB#74	1000~3000	-47.40	PASS
Band66	15MHz	QPSK	132047	1RB#74	3000~20000	-38.38	PASS
Band66	15MHz	16QAM	132047	1RB#74	0.009~0.15	-57.12	PASS
Band66	15MHz	16QAM	132047	1RB#74	0.15~30	-52.27	PASS
Band66	15MHz	16QAM	132047	1RB#74	30~1000	-62.31	PASS
Band66	15MHz	16QAM	132047	1RB#74	1000~3000	-47.48	PASS
Band66	15MHz	16QAM	132047	1RB#74	3000~20000	-39.66	PASS
Band66	15MHz	QPSK	132047	75RB#0	0.009~0.15	-56.29	PASS
Band66	15MHz	QPSK	132047	75RB#0	0.15~30	-51.12	PASS
Band66	15MHz	QPSK	132047	75RB#0	30~1000	-62.50	PASS
Band66	15MHz	QPSK	132047	75RB#0	1000~3000	-45.42	PASS
Band66	15MHz	QPSK	132047	75RB#0	3000~20000	-39.64	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band66	15MHz	16QAM	132047	75RB#0	0.009~0.15	-56.46	PASS
Band66	15MHz	16QAM	132047	75RB#0	0.15~30	-51.69	PASS
Band66	15MHz	16QAM	132047	75RB#0	30~1000	-62.59	PASS
Band66	15MHz	16QAM	132047	75RB#0	1000~3000	-47.36	PASS
Band66	15MHz	16QAM	132047	75RB#0	3000~20000	-39.41	PASS
Band66	15MHz	QPSK	132322	1RB#0	0.009~0.15	-54.57	PASS
Band66	15MHz	QPSK	132322	1RB#0	0.15~30	-50.95	PASS
Band66	15MHz	QPSK	132322	1RB#0	30~1000	-62.22	PASS
Band66	15MHz	QPSK	132322	1RB#0	1000~3000	-47.73	PASS
Band66	15MHz	QPSK	132322	1RB#0	3000~20000	-39.70	PASS
Band66	15MHz	16QAM	132322	1RB#0	0.009~0.15	-55.54	PASS
Band66	15MHz	16QAM	132322	1RB#0	0.15~30	-51.75	PASS
Band66	15MHz	16QAM	132322	1RB#0	30~1000	-62.37	PASS
Band66	15MHz	16QAM	132322	1RB#0	1000~3000	-47.54	PASS
Band66	15MHz	16QAM	132322	1RB#0	3000~20000	-39.65	PASS
Band66	15MHz	QPSK	132322	1RB#74	0.009~0.15	-55.40	PASS
Band66	15MHz	QPSK	132322	1RB#74	0.15~30	-49.86	PASS
Band66	15MHz	QPSK	132322	1RB#74	30~1000	-62.32	PASS
Band66	15MHz	QPSK	132322	1RB#74	1000~3000	-47.36	PASS
Band66	15MHz	QPSK	132322	1RB#74	3000~20000	-39.08	PASS
Band66	15MHz	16QAM	132322	1RB#74	0.009~0.15	-55.14	PASS
Band66	15MHz	16QAM	132322	1RB#74	0.15~30	-53.04	PASS
Band66	15MHz	16QAM	132322	1RB#74	30~1000	-62.48	PASS
Band66	15MHz	16QAM	132322	1RB#74	1000~3000	-47.01	PASS
Band66	15MHz	16QAM	132322	1RB#74	3000~20000	-39.61	PASS
Band66	15MHz	QPSK	132322	75RB#0	0.009~0.15	-57.46	PASS
Band66	15MHz	QPSK	132322	75RB#0	0.15~30	-50.12	PASS
Band66	15MHz	QPSK	132322	75RB#0	30~1000	-62.40	PASS
Band66	15MHz	QPSK	132322	75RB#0	1000~3000	-46.62	PASS
Band66	15MHz	QPSK	132322	75RB#0	3000~20000	-39.53	PASS
Band66	15MHz	16QAM	132322	75RB#0	0.009~0.15	-57.03	PASS
Band66	15MHz	16QAM	132322	75RB#0	0.15~30	-52.42	PASS
Band66	15MHz	16QAM	132322	75RB#0	30~1000	-62.54	PASS
Band66	15MHz	16QAM	132322	75RB#0	1000~3000	-47.11	PASS
Band66	15MHz	16QAM	132322	75RB#0	3000~20000	-39.57	PASS
Band66	15MHz	QPSK	132597	1RB#0	0.009~0.15	-54.93	PASS
Band66	15MHz	QPSK	132597	1RB#0	0.15~30	-51.15	PASS
Band66	15MHz	QPSK	132597	1RB#0	30~1000	-62.32	PASS
Band66	15MHz	QPSK	132597	1RB#0	1000~3000	-47.49	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band66	15MHz	QPSK	132597	1RB#0	3000~20000	-39.77	PASS
Band66	15MHz	16QAM	132597	1RB#0	0.009~0.15	-54.64	PASS
Band66	15MHz	16QAM	132597	1RB#0	0.15~30	-50.47	PASS
Band66	15MHz	16QAM	132597	1RB#0	30~1000	-62.28	PASS
Band66	15MHz	16QAM	132597	1RB#0	1000~3000	-47.58	PASS
Band66	15MHz	16QAM	132597	1RB#0	3000~20000	-39.51	PASS
Band66	15MHz	QPSK	132597	1RB#74	0.009~0.15	-56.17	PASS
Band66	15MHz	QPSK	132597	1RB#74	0.15~30	-49.84	PASS
Band66	15MHz	QPSK	132597	1RB#74	30~1000	-62.54	PASS
Band66	15MHz	QPSK	132597	1RB#74	1000~3000	-43.69	PASS
Band66	15MHz	QPSK	132597	1RB#74	3000~20000	-39.75	PASS
Band66	15MHz	16QAM	132597	1RB#74	0.009~0.15	-55.49	PASS
Band66	15MHz	16QAM	132597	1RB#74	0.15~30	-50.80	PASS
Band66	15MHz	16QAM	132597	1RB#74	30~1000	-62.37	PASS
Band66	15MHz	16QAM	132597	1RB#74	1000~3000	-46.66	PASS
Band66	15MHz	16QAM	132597	1RB#74	3000~20000	-39.49	PASS
Band66	15MHz	QPSK	132597	75RB#0	0.009~0.15	-54.65	PASS
Band66	15MHz	QPSK	132597	75RB#0	0.15~30	-50.99	PASS
Band66	15MHz	QPSK	132597	75RB#0	30~1000	-62.48	PASS
Band66	15MHz	QPSK	132597	75RB#0	1000~3000	-36.95	PASS
Band66	15MHz	QPSK	132597	75RB#0	3000~20000	-39.42	PASS
Band66	15MHz	16QAM	132597	75RB#0	0.009~0.15	-57.93	PASS
Band66	15MHz	16QAM	132597	75RB#0	0.15~30	-48.54	PASS
Band66	15MHz	16QAM	132597	75RB#0	30~1000	-62.44	PASS
Band66	15MHz	16QAM	132597	75RB#0	1000~3000	-41.22	PASS
Band66	15MHz	16QAM	132597	75RB#0	3000~20000	-39.68	PASS
Band66	20MHz	QPSK	132072	1RB#0	0.009~0.15	-56.73	PASS
Band66	20MHz	QPSK	132072	1RB#0	0.15~30	-53.21	PASS
Band66	20MHz	QPSK	132072	1RB#0	30~1000	-62.48	PASS
Band66	20MHz	QPSK	132072	1RB#0	1000~3000	-43.74	PASS
Band66	20MHz	QPSK	132072	1RB#0	3000~20000	-38.95	PASS
Band66	20MHz	16QAM	132072	1RB#0	0.009~0.15	-55.68	PASS
Band66	20MHz	16QAM	132072	1RB#0	0.15~30	-51.91	PASS
Band66	20MHz	16QAM	132072	1RB#0	30~1000	-62.27	PASS
Band66	20MHz	16QAM	132072	1RB#0	1000~3000	-43.26	PASS
Band66	20MHz	16QAM	132072	1RB#0	3000~20000	-40.26	PASS
Band66	20MHz	QPSK	132072	1RB#99	0.009~0.15	-56.77	PASS
Band66	20MHz	QPSK	132072	1RB#99	0.15~30	-53.12	PASS
Band66	20MHz	QPSK	132072	1RB#99	30~1000	-62.54	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Band66	20MHz	QPSK	132072	1RB#99	1000~3000	-45.39	PASS
Band66	20MHz	QPSK	132072	1RB#99	3000~20000	-37.85	PASS
Band66	20MHz	16QAM	132072	1RB#99	0.009~0.15	-57.30	PASS
Band66	20MHz	16QAM	132072	1RB#99	0.15~30	-51.37	PASS
Band66	20MHz	16QAM	132072	1RB#99	30~1000	-62.64	PASS
Band66	20MHz	16QAM	132072	1RB#99	1000~3000	-47.29	PASS
Band66	20MHz	16QAM	132072	1RB#99	3000~20000	-39.59	PASS
Band66	20MHz	QPSK	132072	100RB#0	0.009~0.15	-56.13	PASS
Band66	20MHz	QPSK	132072	100RB#0	0.15~30	-51.61	PASS
Band66	20MHz	QPSK	132072	100RB#0	30~1000	-62.14	PASS
Band66	20MHz	QPSK	132072	100RB#0	1000~3000	-47.06	PASS
Band66	20MHz	QPSK	132072	100RB#0	3000~20000	-39.85	PASS
Band66	20MHz	16QAM	132072	100RB#0	0.009~0.15	-56.96	PASS
Band66	20MHz	16QAM	132072	100RB#0	0.15~30	-51.67	PASS
Band66	20MHz	16QAM	132072	100RB#0	30~1000	-62.32	PASS
Band66	20MHz	16QAM	132072	100RB#0	1000~3000	-47.56	PASS
Band66	20MHz	16QAM	132072	100RB#0	3000~20000	-40.00	PASS
Band66	20MHz	QPSK	132322	1RB#0	0.009~0.15	-55.82	PASS
Band66	20MHz	QPSK	132322	1RB#0	0.15~30	-51.61	PASS
Band66	20MHz	QPSK	132322	1RB#0	30~1000	-62.49	PASS
Band66	20MHz	QPSK	132322	1RB#0	1000~3000	-47.45	PASS
Band66	20MHz	QPSK	132322	1RB#0	3000~20000	-39.35	PASS
Band66	20MHz	16QAM	132322	1RB#0	0.009~0.15	-57.23	PASS
Band66	20MHz	16QAM	132322	1RB#0	0.15~30	-51.92	PASS
Band66	20MHz	16QAM	132322	1RB#0	30~1000	-62.39	PASS
Band66	20MHz	16QAM	132322	1RB#0	1000~3000	-47.37	PASS
Band66	20MHz	16QAM	132322	1RB#0	3000~20000	-39.93	PASS
Band66	20MHz	QPSK	132322	1RB#99	0.009~0.15	-57.48	PASS
Band66	20MHz	QPSK	132322	1RB#99	0.15~30	-49.93	PASS
Band66	20MHz	QPSK	132322	1RB#99	30~1000	-62.46	PASS
Band66	20MHz	QPSK	132322	1RB#99	1000~3000	-47.37	PASS
Band66	20MHz	QPSK	132322	1RB#99	3000~20000	-39.92	PASS
Band66	20MHz	16QAM	132322	1RB#99	0.009~0.15	-55.70	PASS
Band66	20MHz	16QAM	132322	1RB#99	0.15~30	-50.56	PASS
Band66	20MHz	16QAM	132322	1RB#99	30~1000	-62.48	PASS
Band66	20MHz	16QAM	132322	1RB#99	1000~3000	-47.45	PASS
Band66	20MHz	16QAM	132322	1RB#99	3000~20000	-39.96	PASS
Band66	20MHz	QPSK	132322	100RB#0	0.009~0.15	-56.57	PASS
Band66	20MHz	QPSK	132322	100RB#0	0.15~30	-53.17	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Band66	20MHz	QPSK	132322	100RB#0	30~1000	-62.46	PASS
Band66	20MHz	QPSK	132322	100RB#0	1000~3000	-46.91	PASS
Band66	20MHz	QPSK	132322	100RB#0	3000~20000	-40.24	PASS
Band66	20MHz	16QAM	132322	100RB#0	0.009~0.15	-57.89	PASS
Band66	20MHz	16QAM	132322	100RB#0	0.15~30	-51.92	PASS
Band66	20MHz	16QAM	132322	100RB#0	30~1000	-62.12	PASS
Band66	20MHz	16QAM	132322	100RB#0	1000~3000	-47.44	PASS
Band66	20MHz	16QAM	132322	100RB#0	3000~20000	-40.16	PASS
Band66	20MHz	QPSK	132572	1RB#0	0.009~0.15	-56.39	PASS
Band66	20MHz	QPSK	132572	1RB#0	0.15~30	-58.38	PASS
Band66	20MHz	QPSK	132572	1RB#0	30~1000	-61.79	PASS
Band66	20MHz	QPSK	132572	1RB#0	1000~3000	-45.44	PASS
Band66	20MHz	QPSK	132572	1RB#0	3000~20000	-39.84	PASS
Band66	20MHz	16QAM	132572	1RB#0	0.009~0.15	-55.49	PASS
Band66	20MHz	16QAM	132572	1RB#0	0.15~30	-59.32	PASS
Band66	20MHz	16QAM	132572	1RB#0	30~1000	-61.99	PASS
Band66	20MHz	16QAM	132572	1RB#0	1000~3000	-44.90	PASS
Band66	20MHz	16QAM	132572	1RB#0	3000~20000	-40.04	PASS
Band66	20MHz	QPSK	132572	1RB#99	0.009~0.15	-52.93	PASS
Band66	20MHz	QPSK	132572	1RB#99	0.15~30	-52.32	PASS
Band66	20MHz	QPSK	132572	1RB#99	30~1000	-62.09	PASS
Band66	20MHz	QPSK	132572	1RB#99	1000~3000	-36.49	PASS
Band66	20MHz	QPSK	132572	1RB#99	3000~20000	-40.04	PASS
Band66	20MHz	16QAM	132572	1RB#99	0.009~0.15	-55.74	PASS
Band66	20MHz	16QAM	132572	1RB#99	0.15~30	-50.93	PASS
Band66	20MHz	16QAM	132572	1RB#99	30~1000	-62.43	PASS
Band66	20MHz	16QAM	132572	1RB#99	1000~3000	-38.01	PASS
Band66	20MHz	16QAM	132572	1RB#99	3000~20000	-40.03	PASS
Band66	20MHz	QPSK	132572	100RB#0	0.009~0.15	-56.93	PASS
Band66	20MHz	QPSK	132572	100RB#0	0.15~30	-52.26	PASS
Band66	20MHz	QPSK	132572	100RB#0	30~1000	-62.73	PASS
Band66	20MHz	QPSK	132572	100RB#0	1000~3000	-39.26	PASS
Band66	20MHz	QPSK	132572	100RB#0	3000~20000	-39.62	PASS
Band66	20MHz	16QAM	132572	100RB#0	0.009~0.15	-56.32	PASS
Band66	20MHz	16QAM	132572	100RB#0	0.15~30	-50.81	PASS
Band66	20MHz	16QAM	132572	100RB#0	30~1000	-62.75	PASS
Band66	20MHz	16QAM	132572	100RB#0	1000~3000	-41.99	PASS
Band66	20MHz	16QAM	132572	100RB#0	3000~20000	-39.78	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Test Graphs

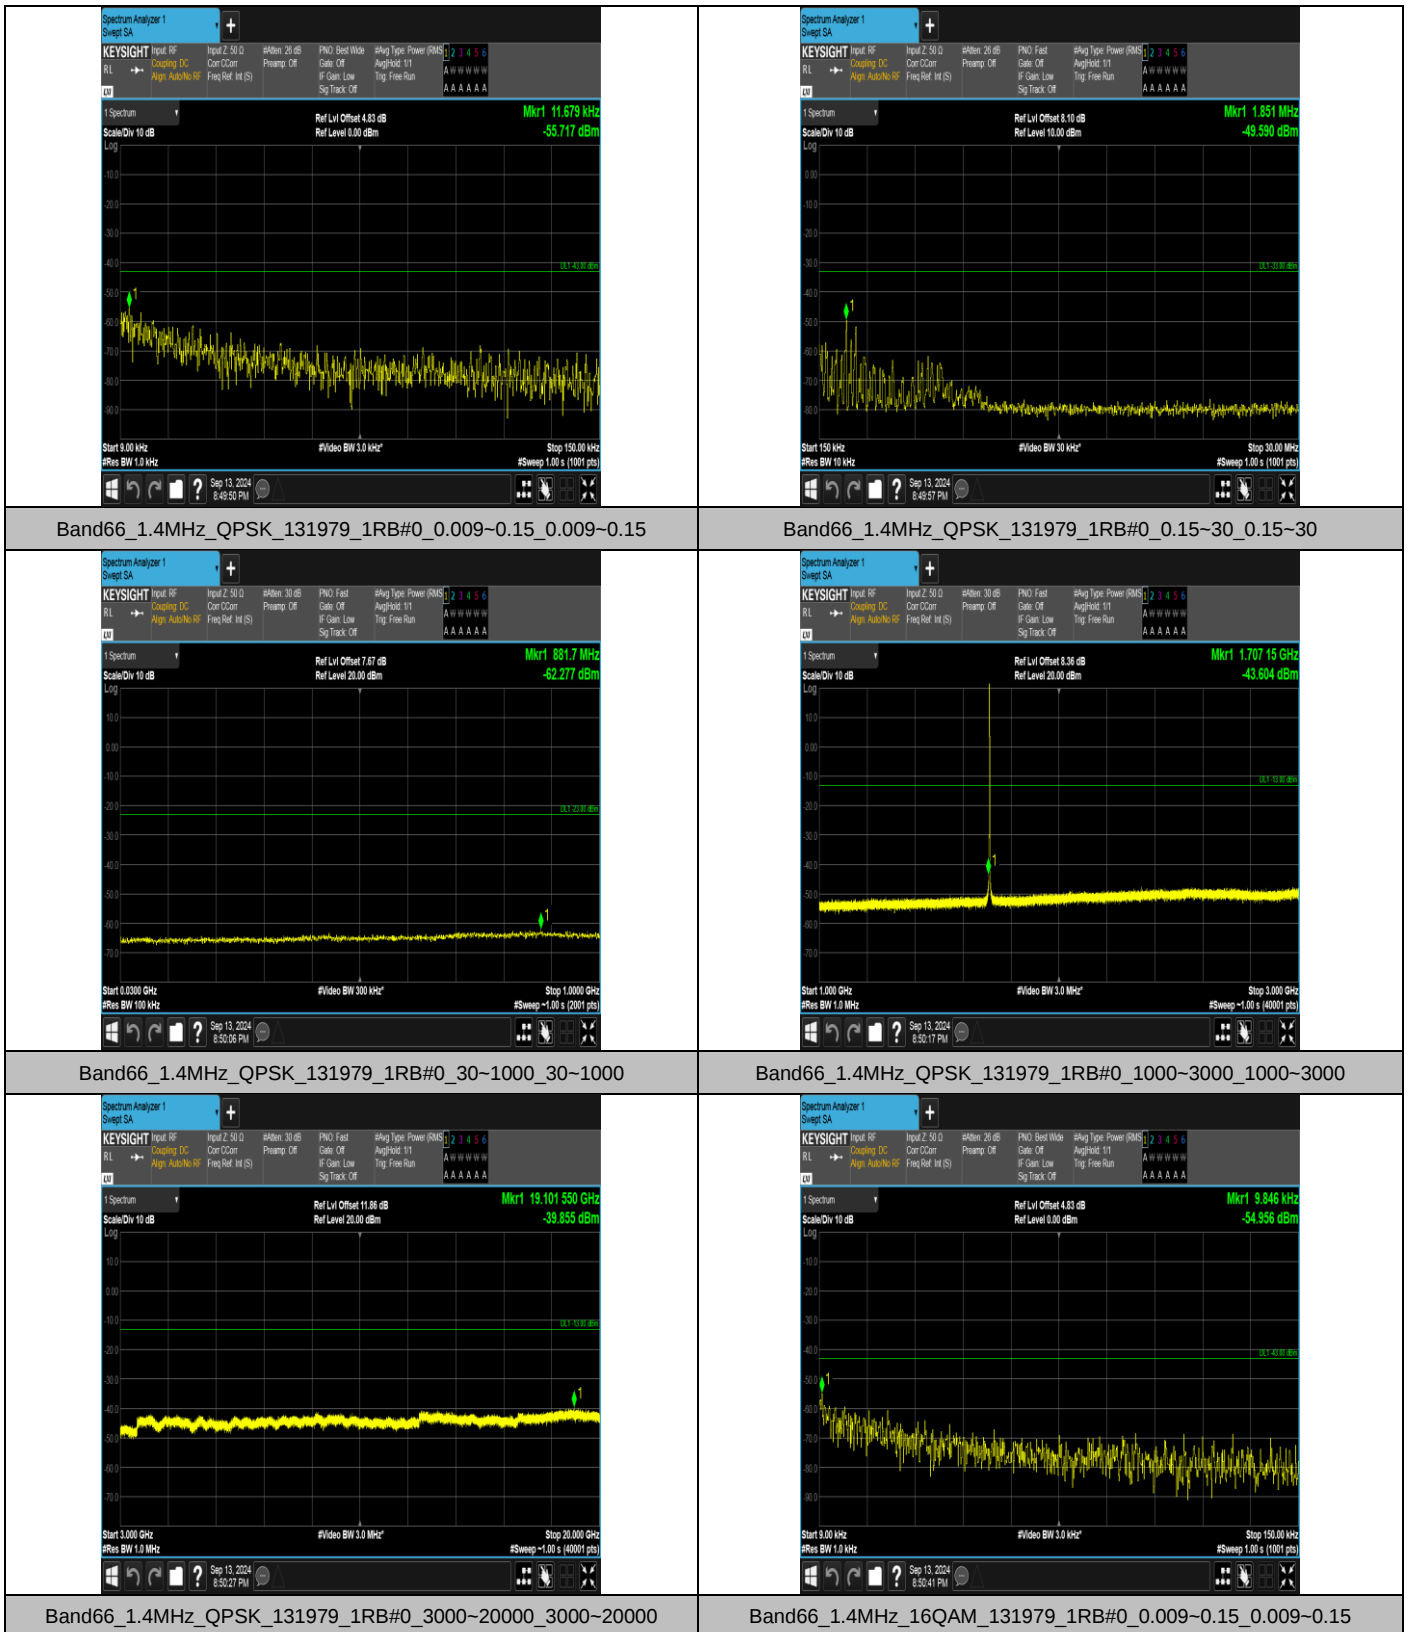


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

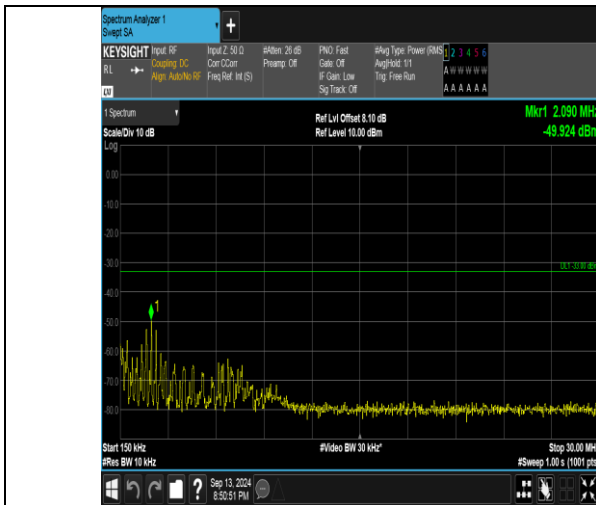


Band66_1.4MHz_16QAM_131979_1RB#0_0.15~30_0.15~30




Band66_1.4MHz_16QAM_131979_1RB#0_30~1000_30~1000

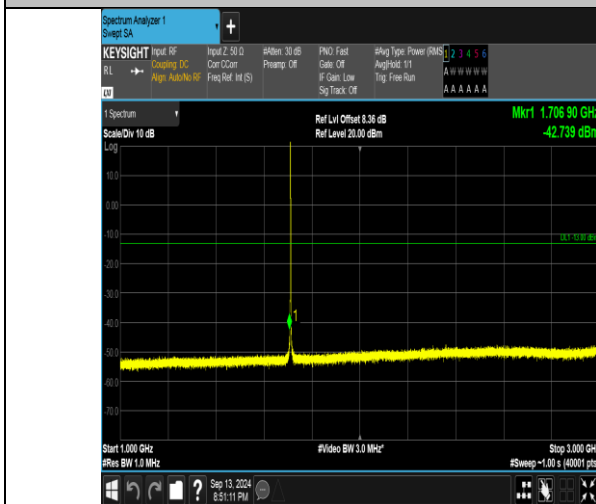


Band66_1.4MHz_16QAM_131979_1RB#0_1000~3000_1000~3000

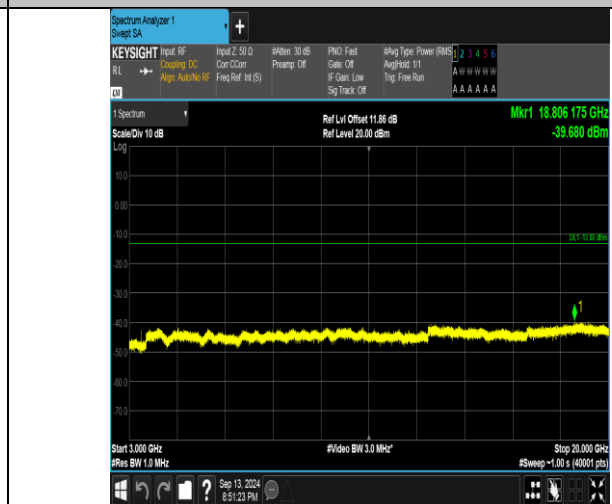

Band66_1.4MHz_16QAM_131979_1RB#0_3000~20000_3000~20000

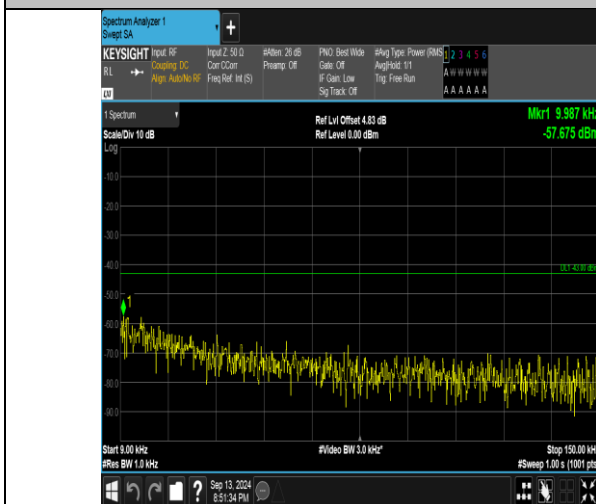


Band66_1.4MHz_QPSK_131979_1RB#5_0.009~0.15_0.009~0.15

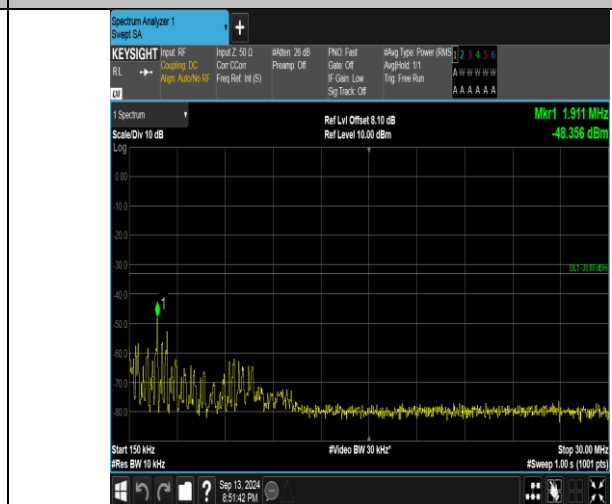

Band66_1.4MHz_QPSK_131979_1RB#5_0.15~30_0.15~30


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

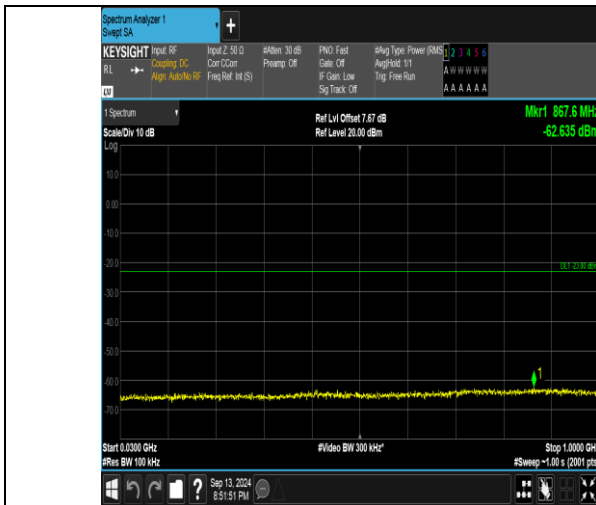


Band66_1.4MHz_QPSK_131979_1RB#5_30~1000_30~1000




Band66_1.4MHz_QPSK_131979_1RB#5_1000~3000_1000~3000

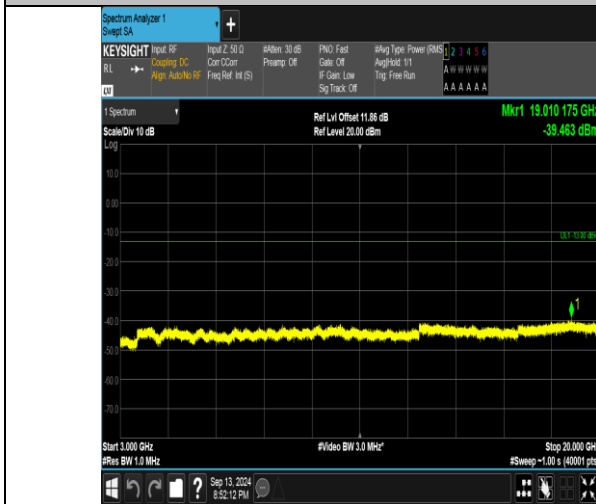


Band66_1.4MHz_QPSK_131979_1RB#5_3000~20000_3000~20000

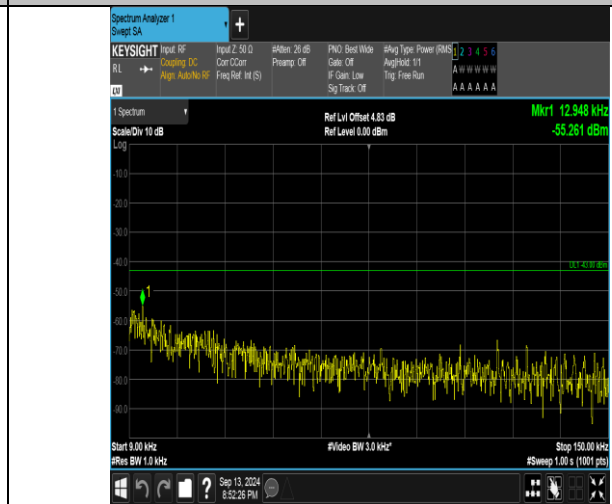

Band66_1.4MHz_16QAM_131979_1RB#5_0.009~0.15_0.009~0.15

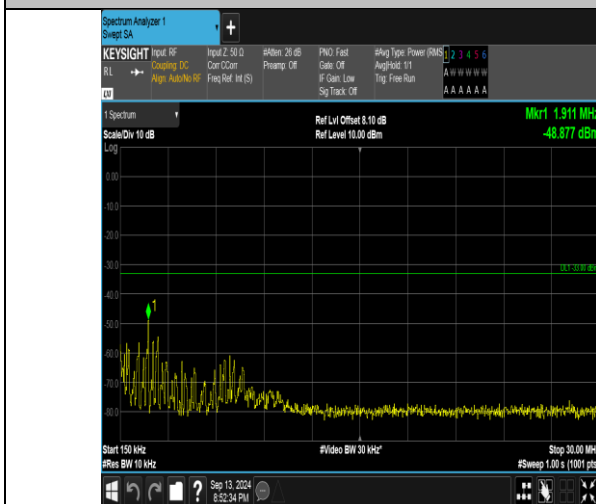

Band66_1.4MHz_16QAM_131979_1RB#5_0.15~30_0.15~30

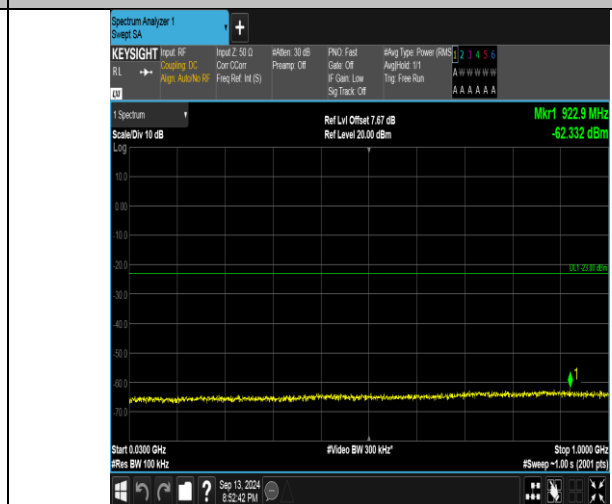


Band66_1.4MHz_16QAM_131979_1RB#5_30~1000_30~1000


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.




Band66_1.4MHz_16QAM_131979_1RB#5_1000~3000_1000~3000

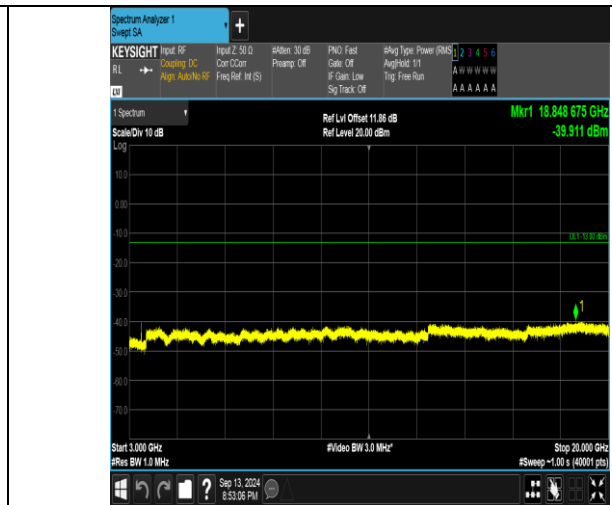


Band66_1.4MHz_16QAM_131979_1RB#5_3000~20000_3000~20000

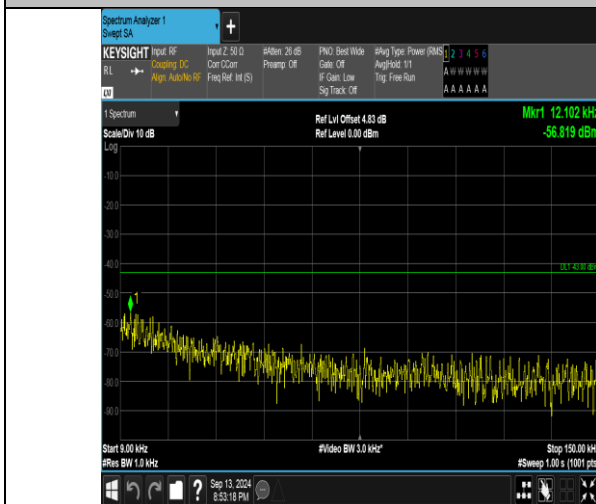

Band66_1.4MHz_QPSK_131979_6RB#0_0.009~0.15_0.009~0.15

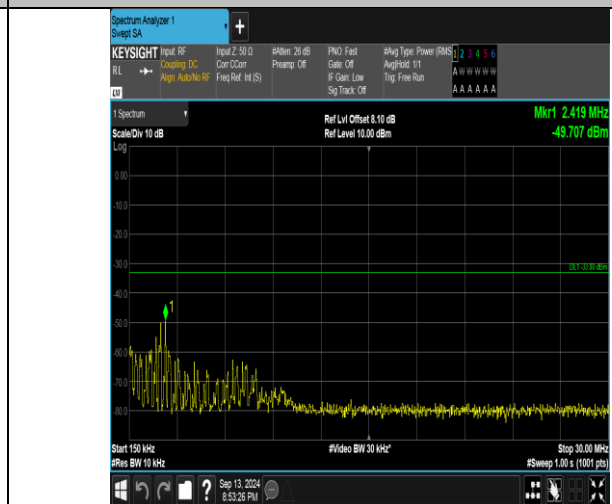

Band66_1.4MHz_QPSK_131979_6RB#0_0.15~30_0.15~30

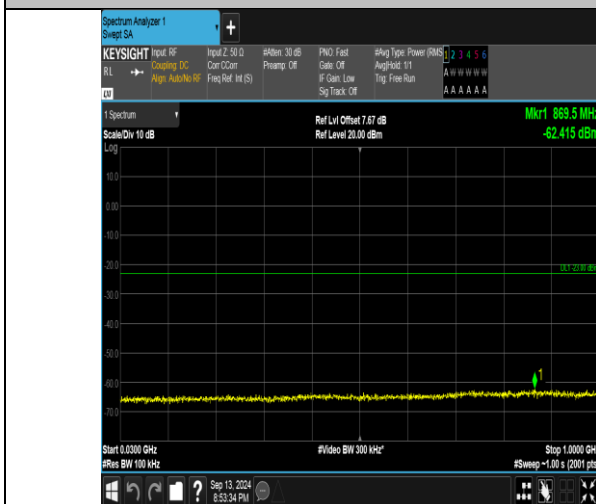


Band66_1.4MHz_QPSK_131979_6RB#0_30~1000_30~1000




Band66_1.4MHz_QPSK_131979_6RB#0_1000~3000_1000~3000


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

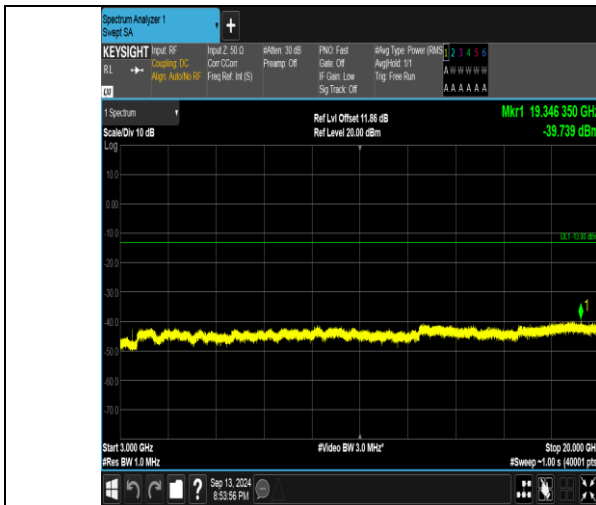

Band66_1.4MHz_QPSK_131979_6RB#0_3000~20000_3000~20000

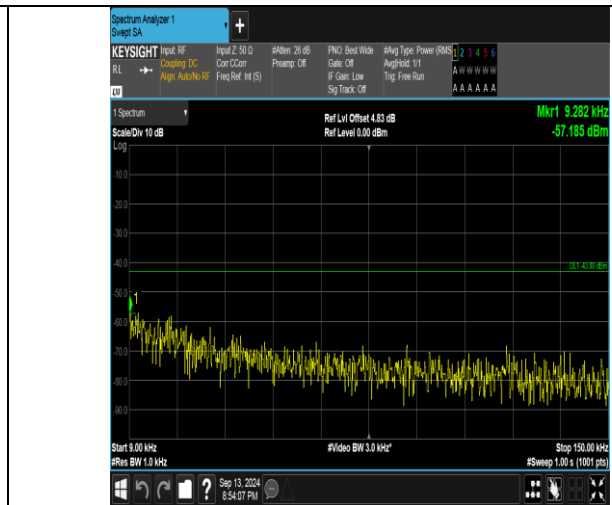

Band66_1.4MHz_16QAM_131979_6RB#0_0.009~0.15_0.009~0.15

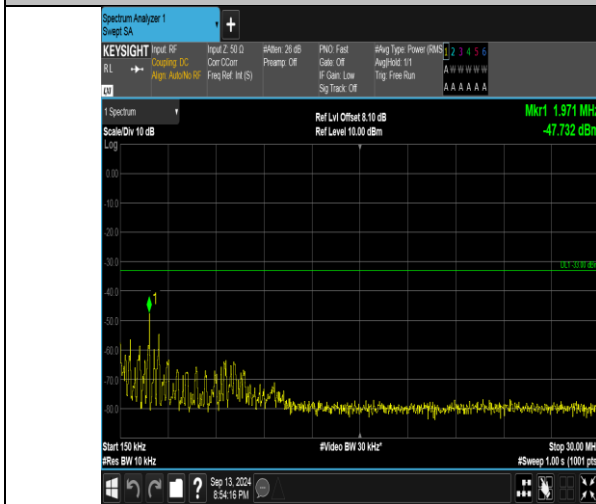


Band66_1.4MHz_16QAM_131979_6RB#0_0.15~30_0.15~30



Band66_1.4MHz_16QAM_131979_6RB#0_30~1000_30~1000




Band66_1.4MHz_16QAM_131979_6RB#0_1000~3000_1000~3000

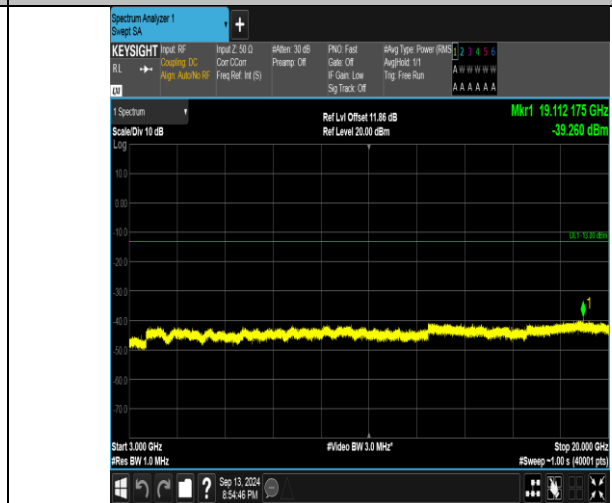


Band66_1.4MHz_16QAM_131979_6RB#0_3000~20000_3000~20000

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

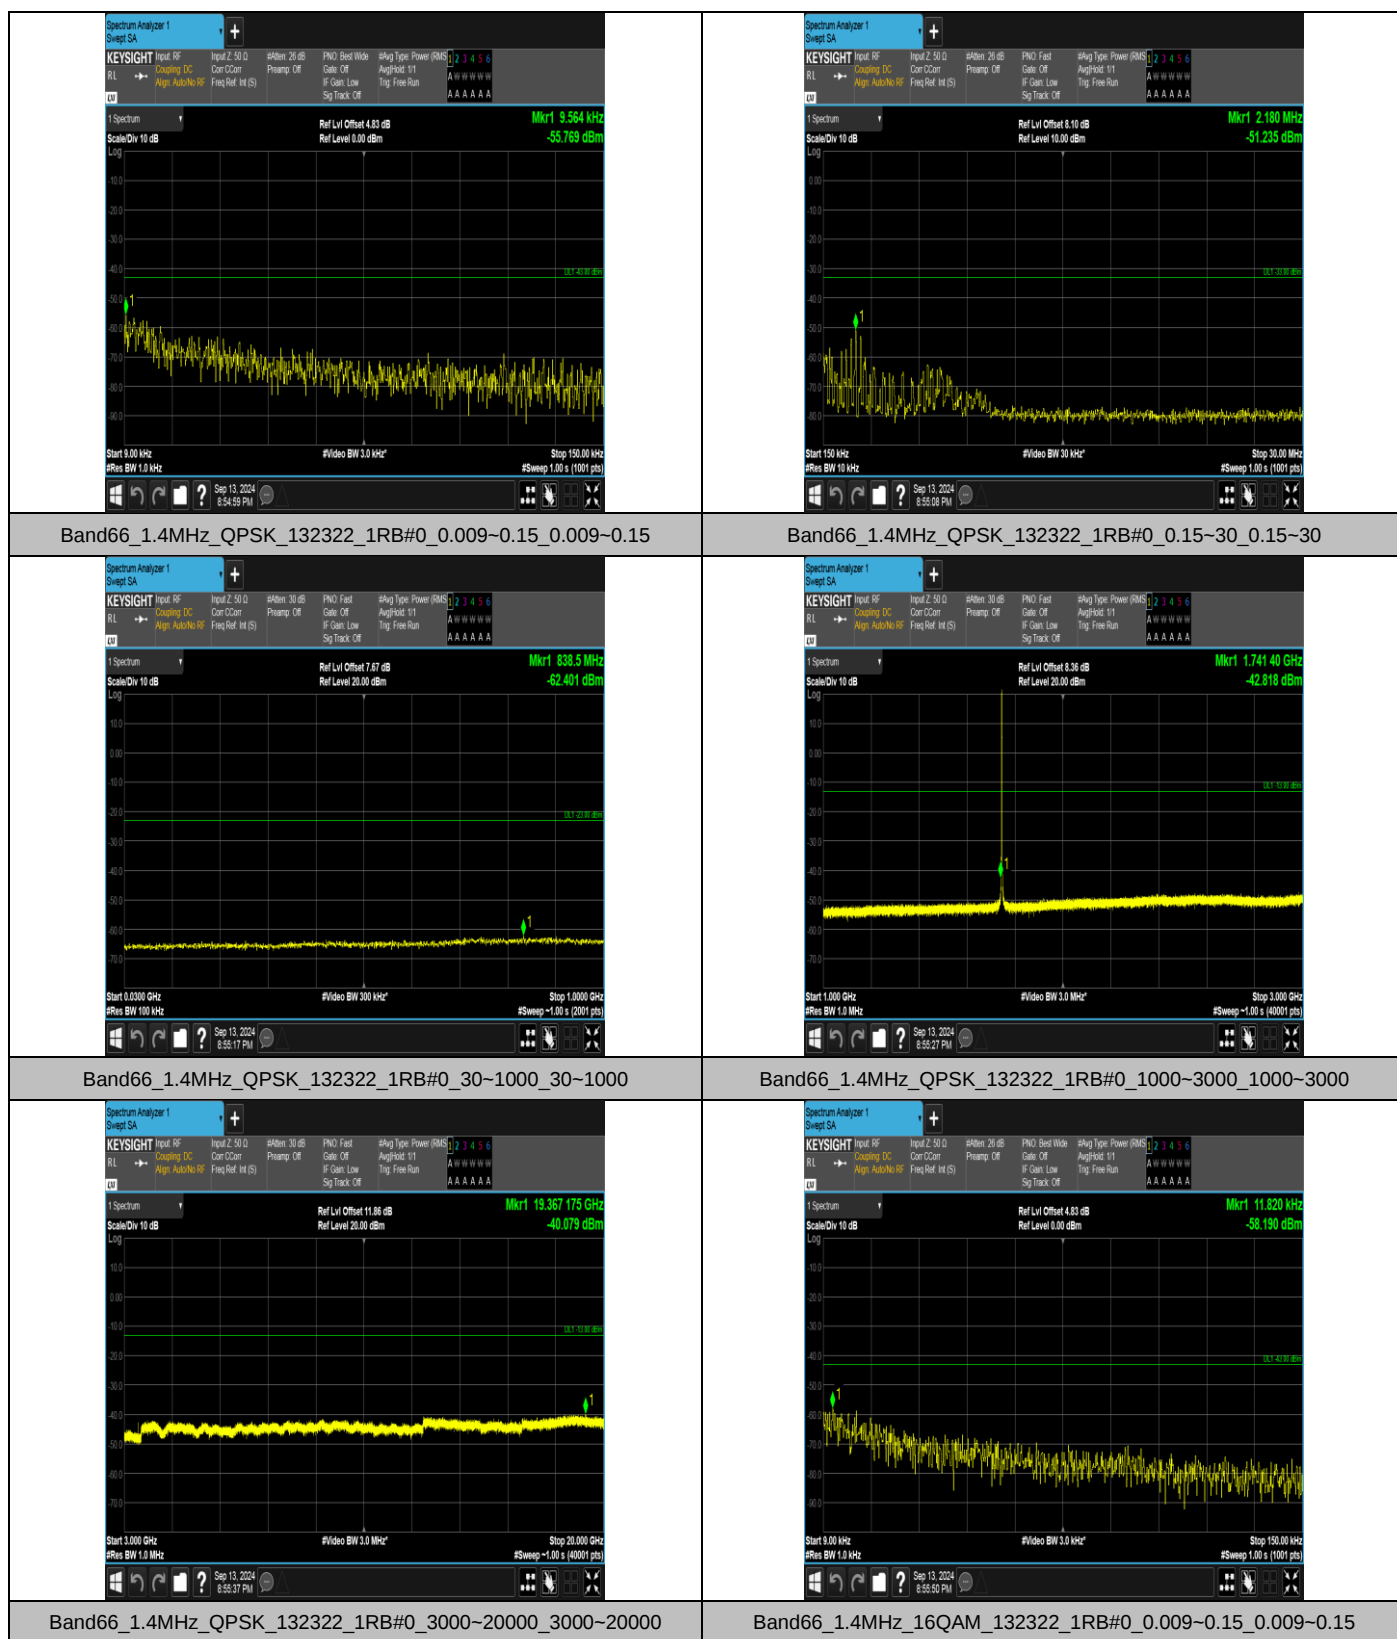


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

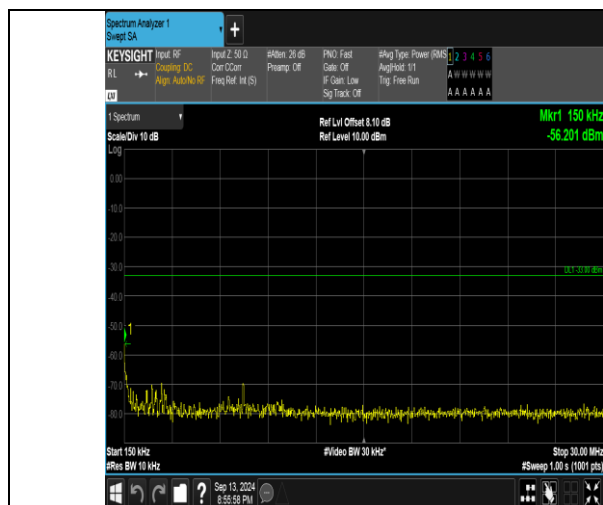


Band66_1.4MHz_16QAM_132322_1RB#0_0.15~30_0.15~30




Band66_1.4MHz_16QAM_132322_1RB#0_30~1000_30~1000

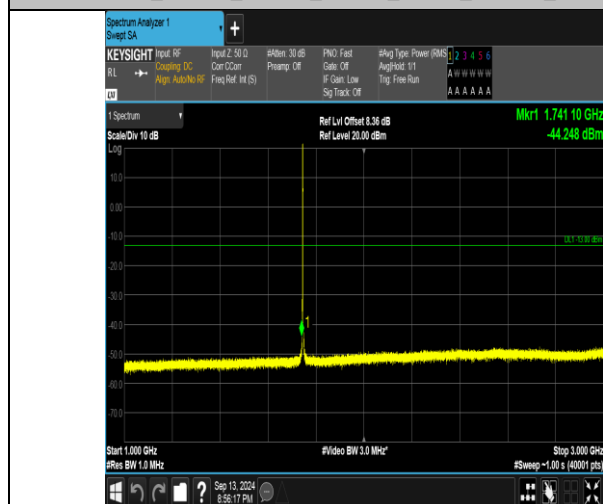


Band66_1.4MHz_16QAM_132322_1RB#0_1000~3000_1000~3000

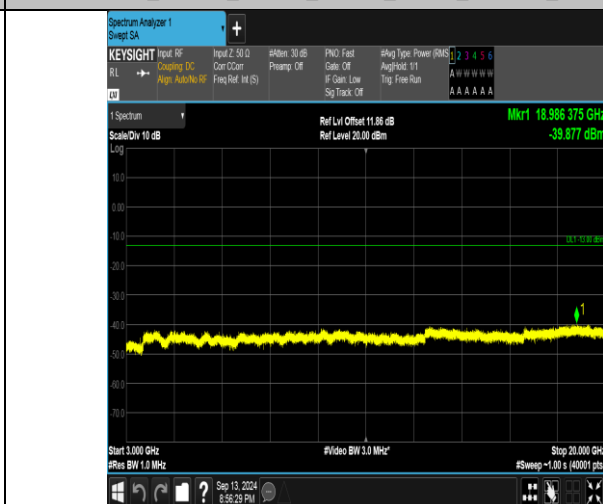

Band66_1.4MHz_16QAM_132322_1RB#0_3000~20000_3000~20000

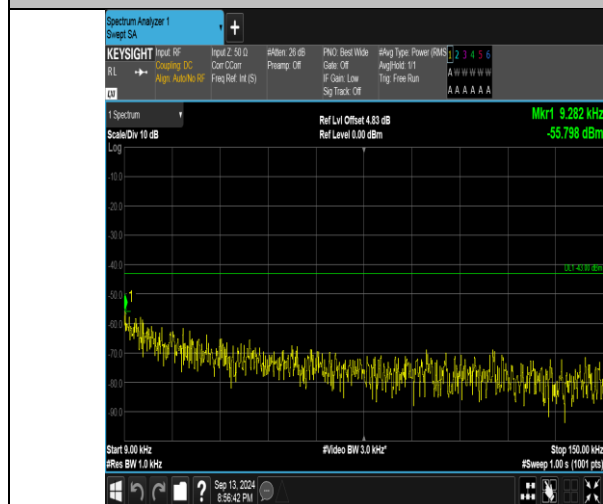


Band66_1.4MHz_QPSK_132322_1RB#5_0.009~0.15_0.009~0.15

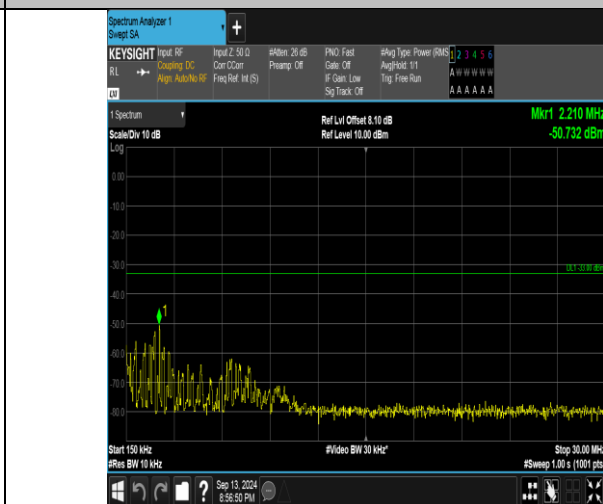


Band66_1.4MHz_QPSK_132322_1RB#5_0.15~30_0.15~30


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

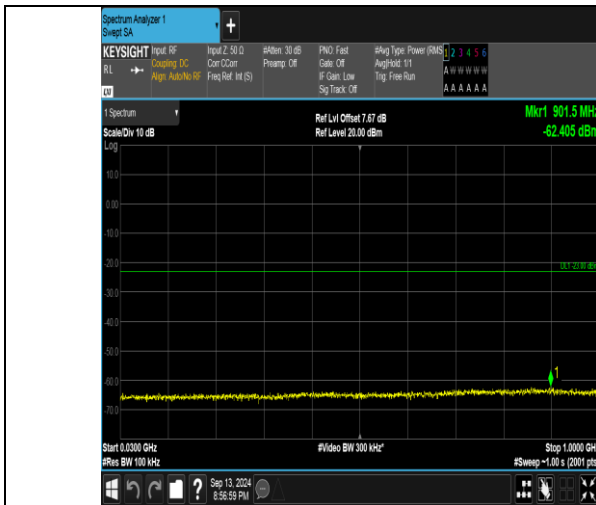


Band66_1.4MHz_QPSK_132322_1RB#5_30~1000_30~1000

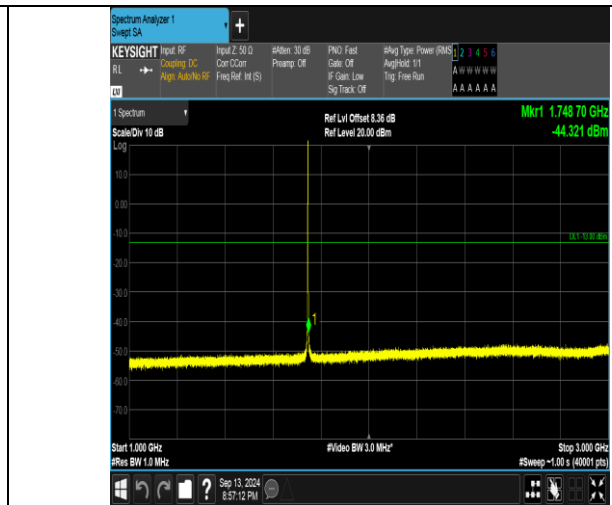


Band66_1.4MHz_QPSK_132322_1RB#5_1000~3000_1000~3000

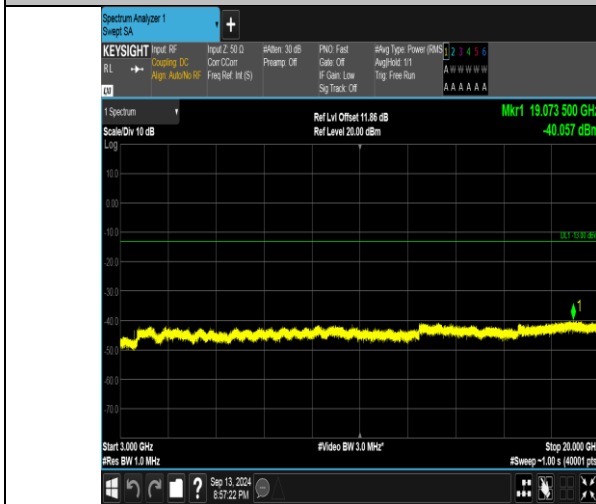


Band66_1.4MHz_QPSK_132322_1RB#5_3000~20000_3000~20000

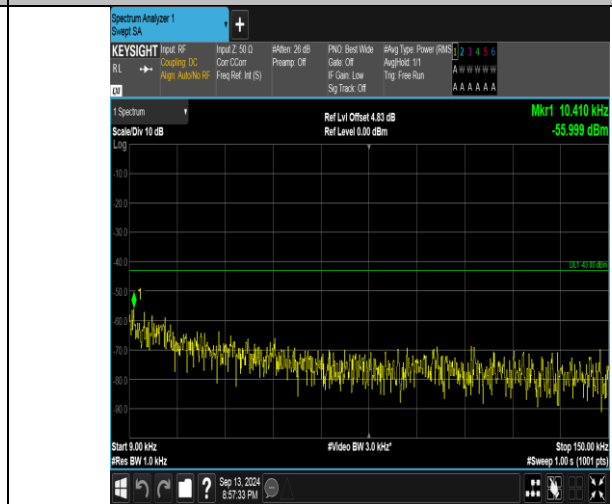

Band66_1.4MHz_16QAM_132322_1RB#5_0.009~0.15_0.009~0.15

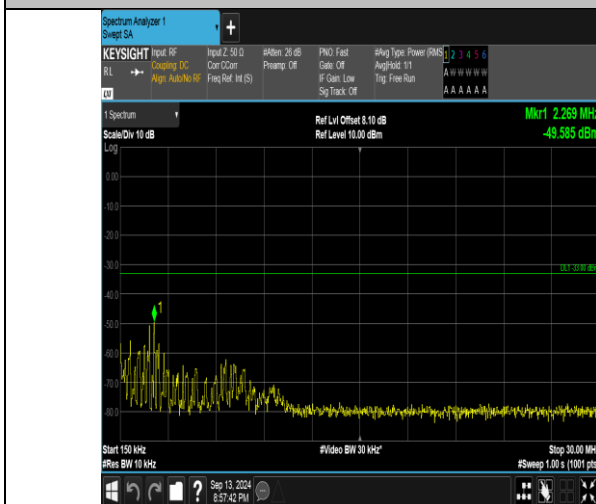

Band66_1.4MHz_16QAM_132322_1RB#5_0.15~30_0.15~30

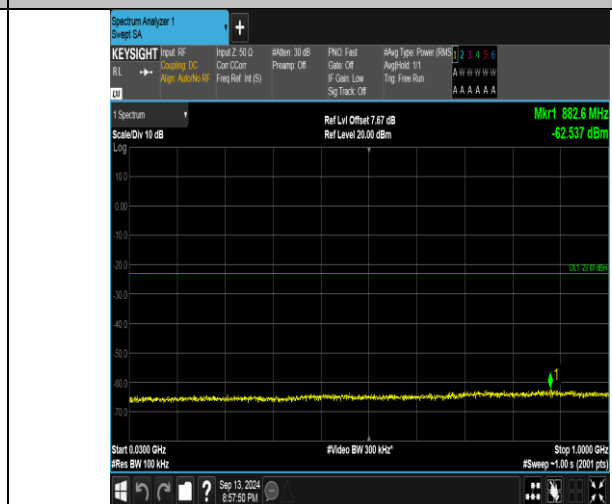


Band66_1.4MHz_16QAM_132322_1RB#5_30~1000_30~1000


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.




Band66_1.4MHz_16QAM_132322_1RB#5_1000~3000_1000~3000

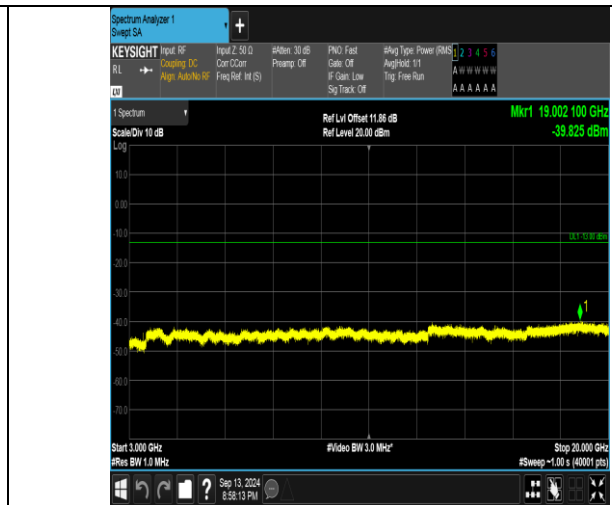


Band66_1.4MHz_16QAM_132322_1RB#5_3000~20000_3000~20000

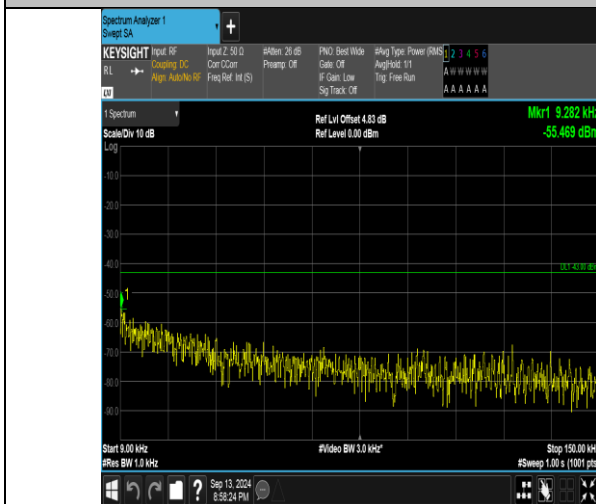


Band66_1.4MHz_QPSK_132322_6RB#0_0.009~0.15_0.009~0.15

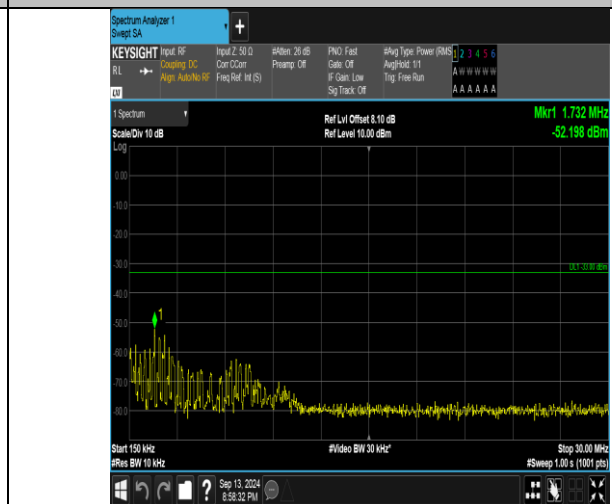

Band66_1.4MHz_QPSK_132322_6RB#0_0.15~30_0.15~30

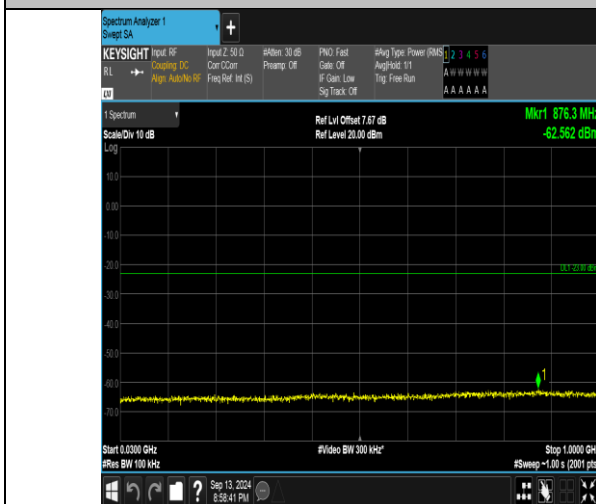


Band66_1.4MHz_QPSK_132322_6RB#0_30~1000_30~1000

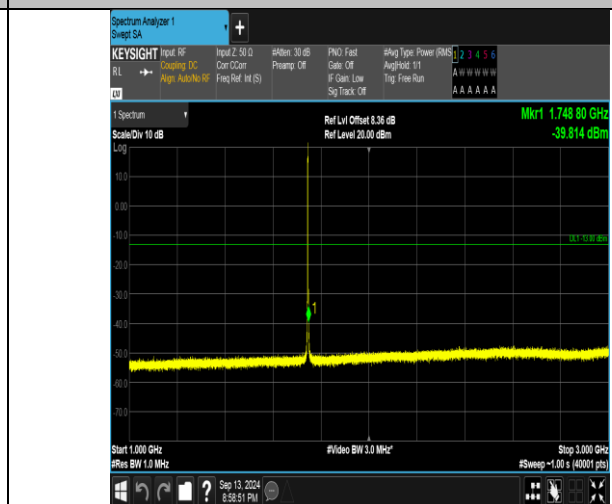

Band66_1.4MHz_QPSK_132322_6RB#0_1000~3000_1000~3000


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

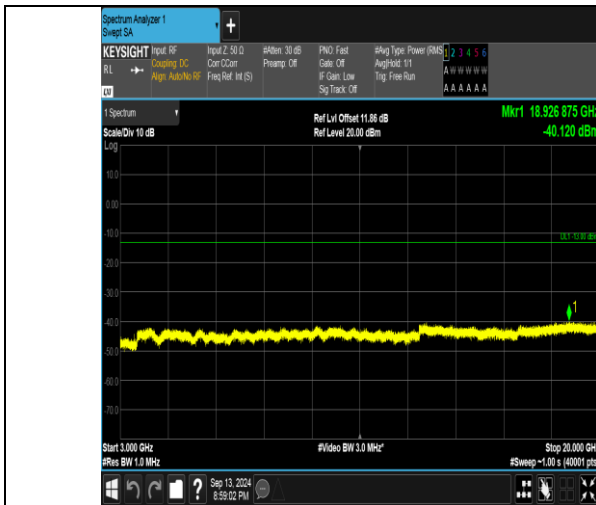


Band66_1.4MHz_QPSK_132322_6RB#0_3000~20000_3000~20000



Band66_1.4MHz_16QAM_132322_6RB#0_0.009~0.15_0.009~0.15

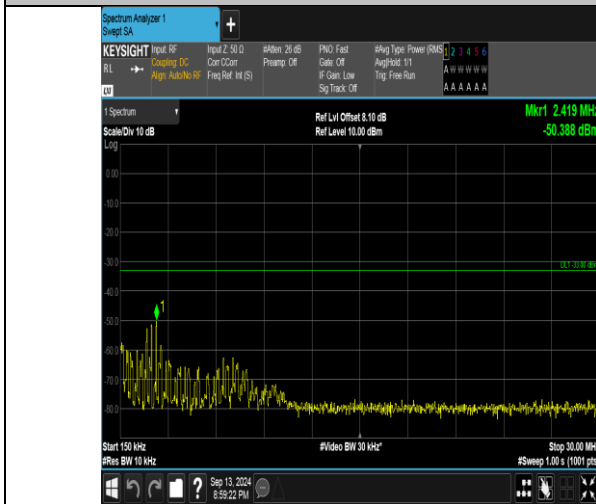


Band66_1.4MHz_16QAM_132322_6RB#0_0.15~30_0.15~30

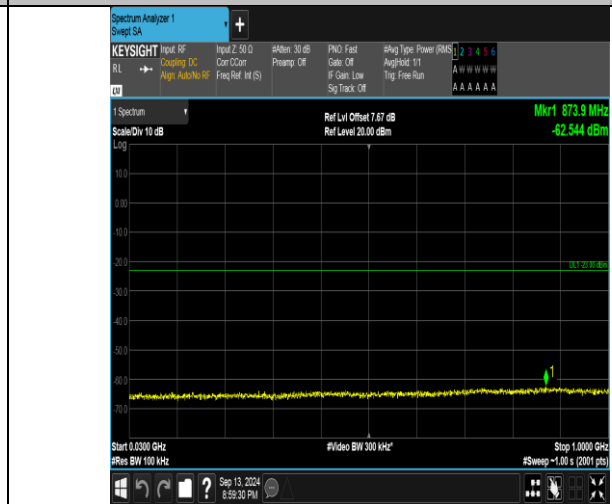

Band66_1.4MHz_16QAM_132322_6RB#0_30~1000_30~1000




Band66_1.4MHz_16QAM_132322_6RB#0_1000~3000_1000~3000

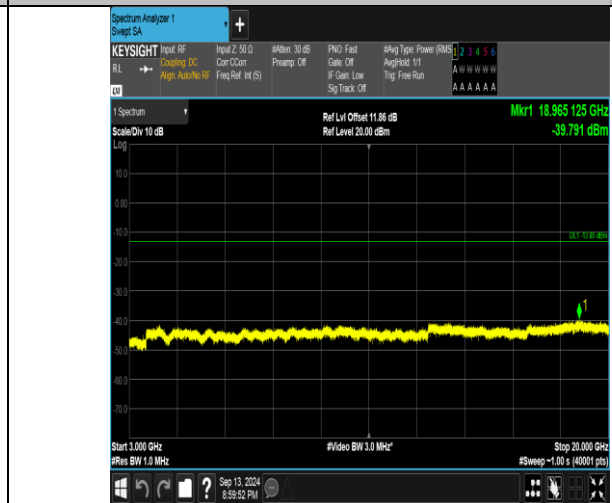


Band66_1.4MHz_16QAM_132322_6RB#0_3000~20000_3000~20000

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

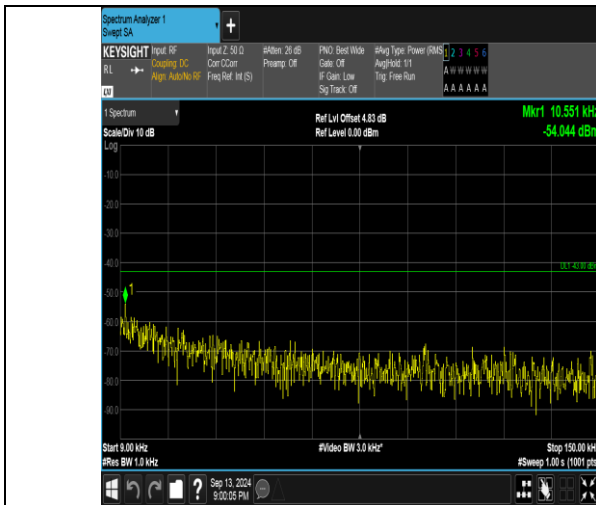

Band66_1.4MHz_QPSK_132665_1RB#0_0.009~0.15_0.009~0.15

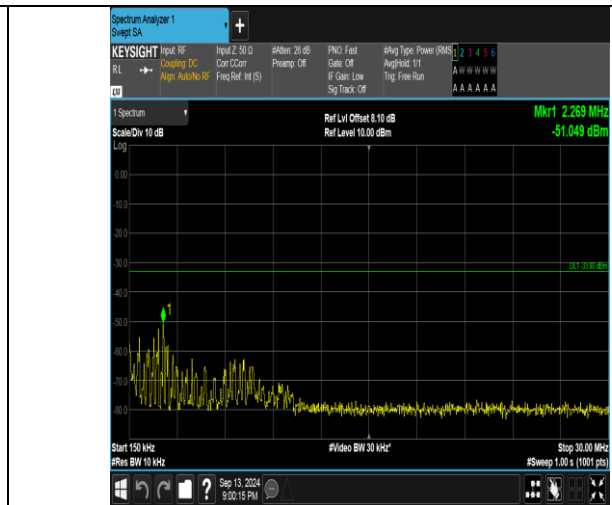


Band66_1.4MHz_QPSK_132665_1RB#0_0.15~30_0.15~30



Band66_1.4MHz_QPSK_132665_1RB#0_30~1000_30~1000



Band66_1.4MHz_QPSK_132665_1RB#0_1000~3000_1000~3000

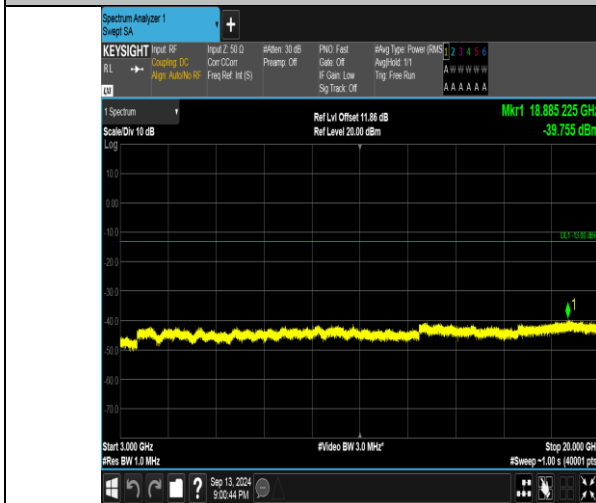


Band66_1.4MHz_QPSK_132665_1RB#0_3000~20000_3000~20000




Band66_1.4MHz_16QAM_132665_1RB#0_0.009~0.15_0.009~0.15

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

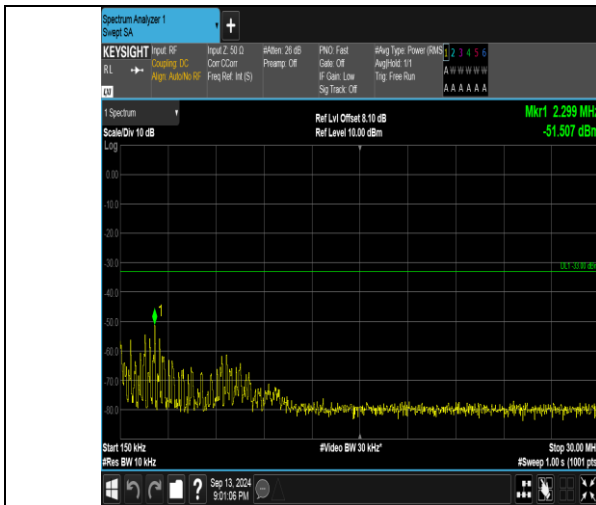


Band66_1.4MHz_16QAM_132665_1RB#0_0.15~30_0.15~30

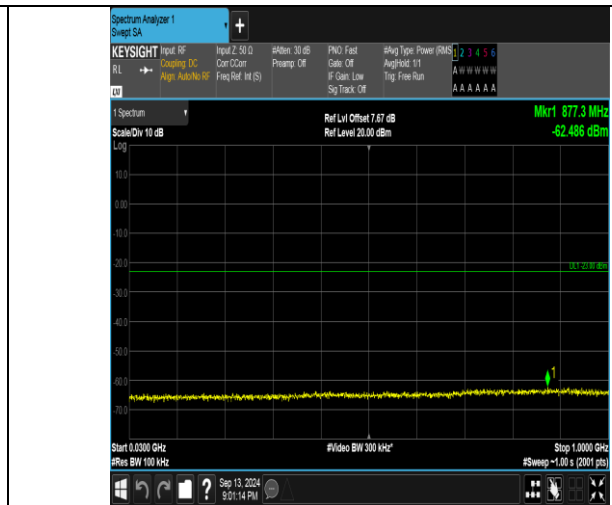


Band66_1.4MHz_16QAM_132665_1RB#0_30~1000_30~1000

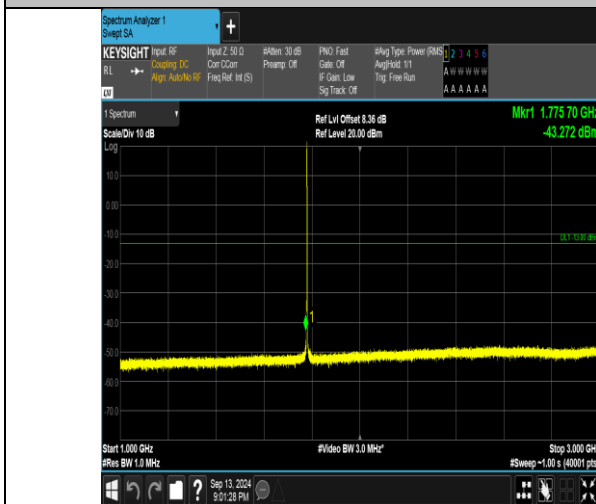


Band66_1.4MHz_16QAM_132665_1RB#0_1000~3000_1000~3000

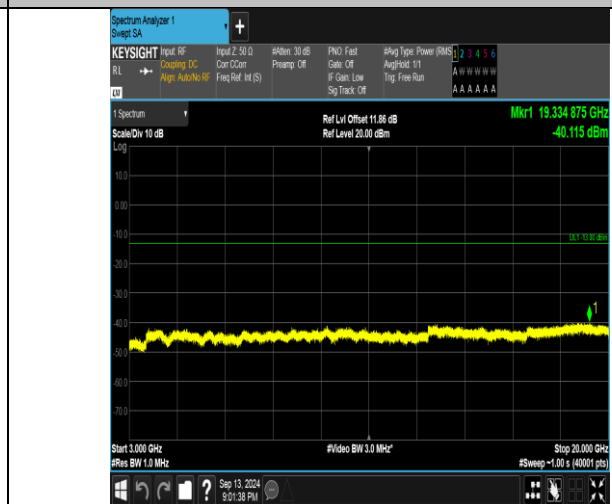

Band66_1.4MHz_16QAM_132665_1RB#0_3000~20000_3000~20000

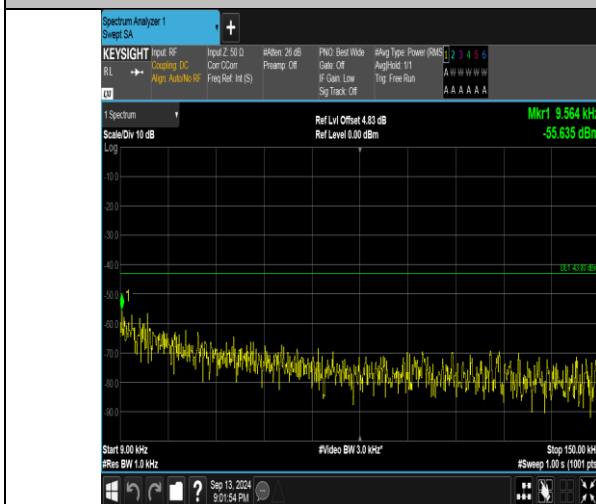


Band66_1.4MHz_QPSK_132665_1RB#5_0.009~0.15_0.009~0.15

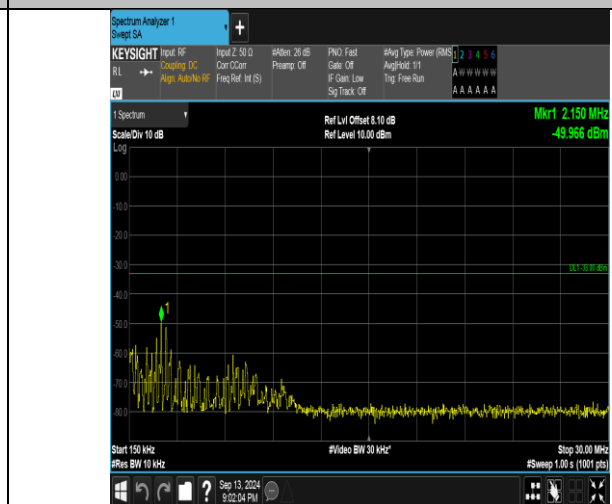

Band66_1.4MHz_QPSK_132665_1RB#5_0.15~30_0.15~30


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

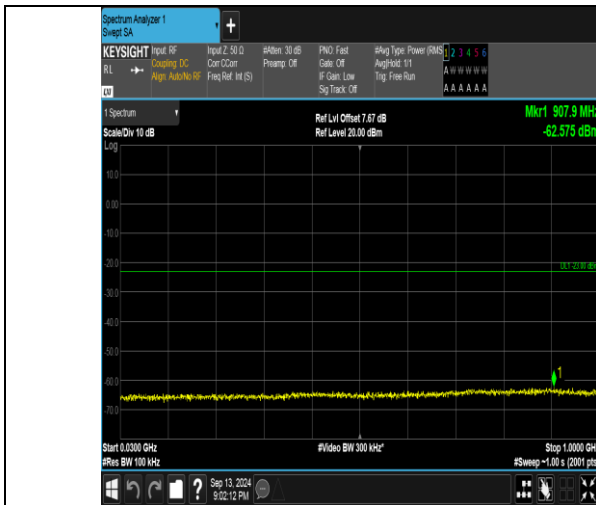

Band66_1.4MHz_QPSK_132665_1RB#5_30~1000_30~1000




Band66_1.4MHz_QPSK_132665_1RB#5_1000~3000_1000~3000

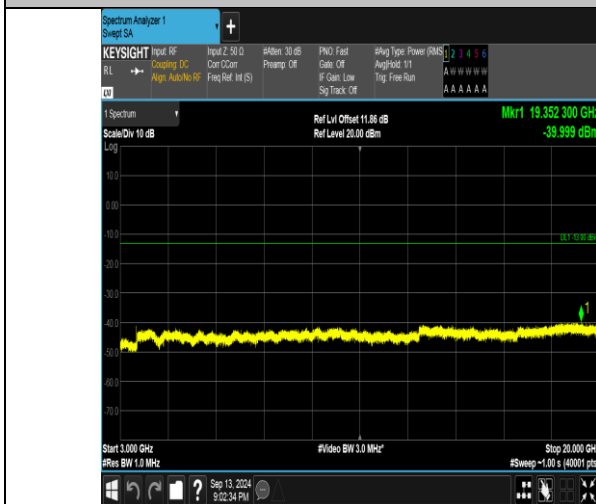


Band66_1.4MHz_QPSK_132665_1RB#5_3000~20000_3000~20000



Band66_1.4MHz_16QAM_132665_1RB#5_0.009~0.15_0.009~0.15

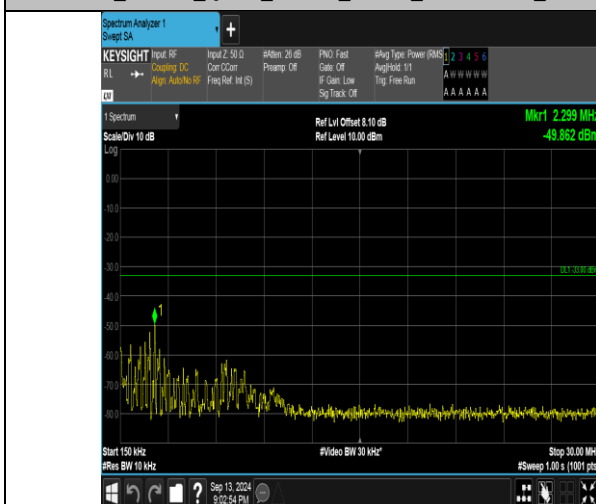

Band66_1.4MHz_16QAM_132665_1RB#5_0.15~30_0.15~30

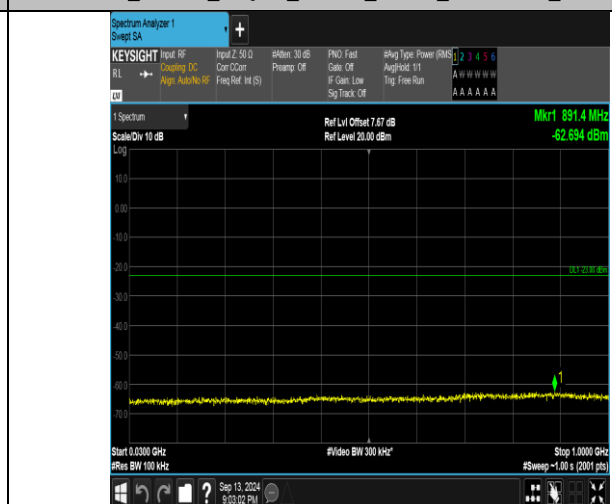


Band66_1.4MHz_16QAM_132665_1RB#5_30~1000_30~1000

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>




Band66_1.4MHz_16QAM_132665_1RB#5_1000~3000_1000~3000

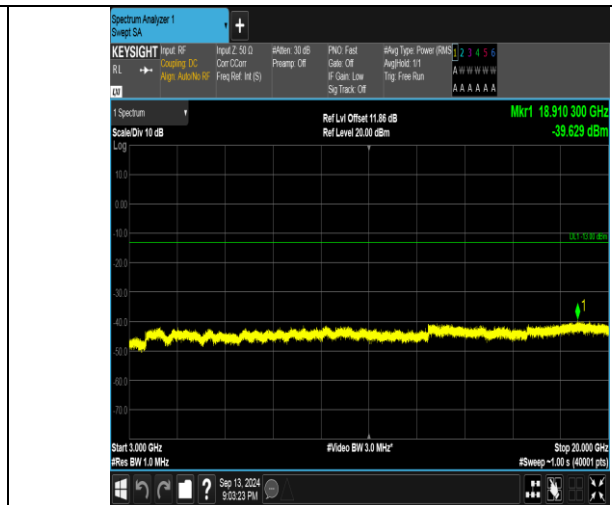


Band66_1.4MHz_16QAM_132665_1RB#5_3000~20000_3000~20000

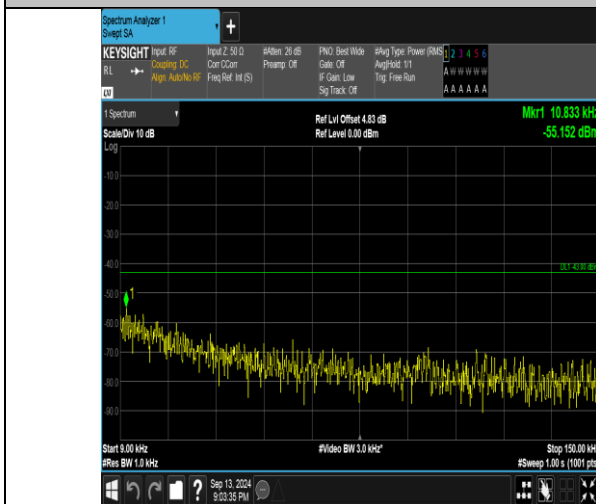


Band66_1.4MHz_QPSK_132665_6RB#0_0.009~0.15_0.009~0.15

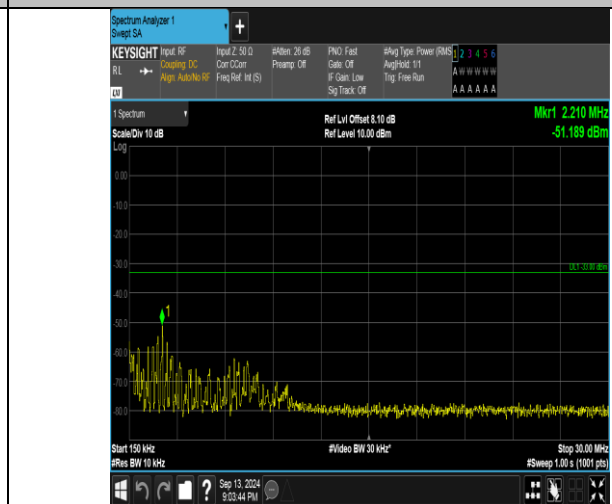

Band66_1.4MHz_QPSK_132665_6RB#0_0.15~30_0.15~30

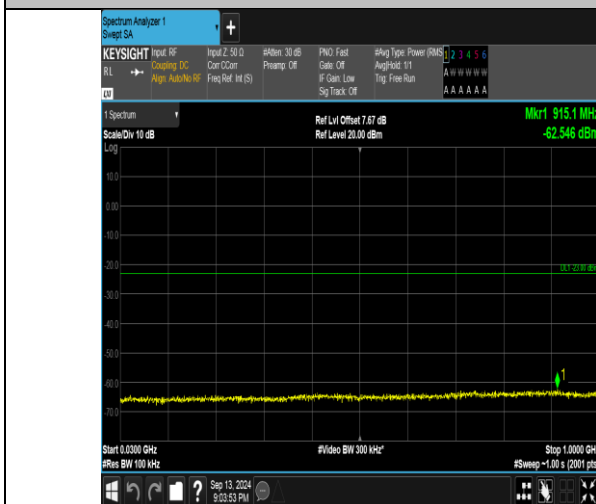

Band66_1.4MHz_QPSK_132665_6RB#0_30~1000_30~1000

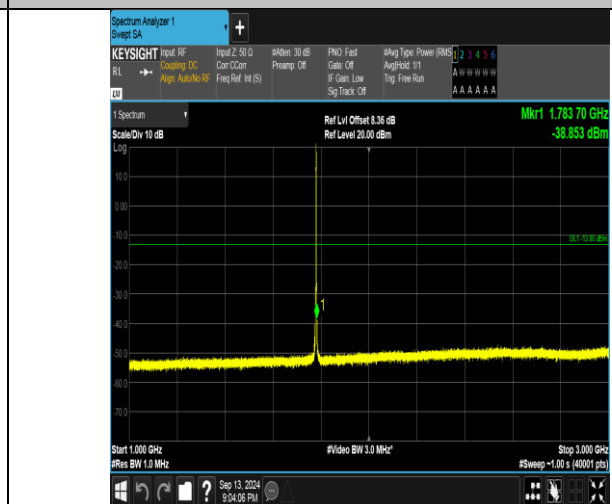

Band66_1.4MHz_QPSK_132665_6RB#0_1000~3000_1000~3000

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.