




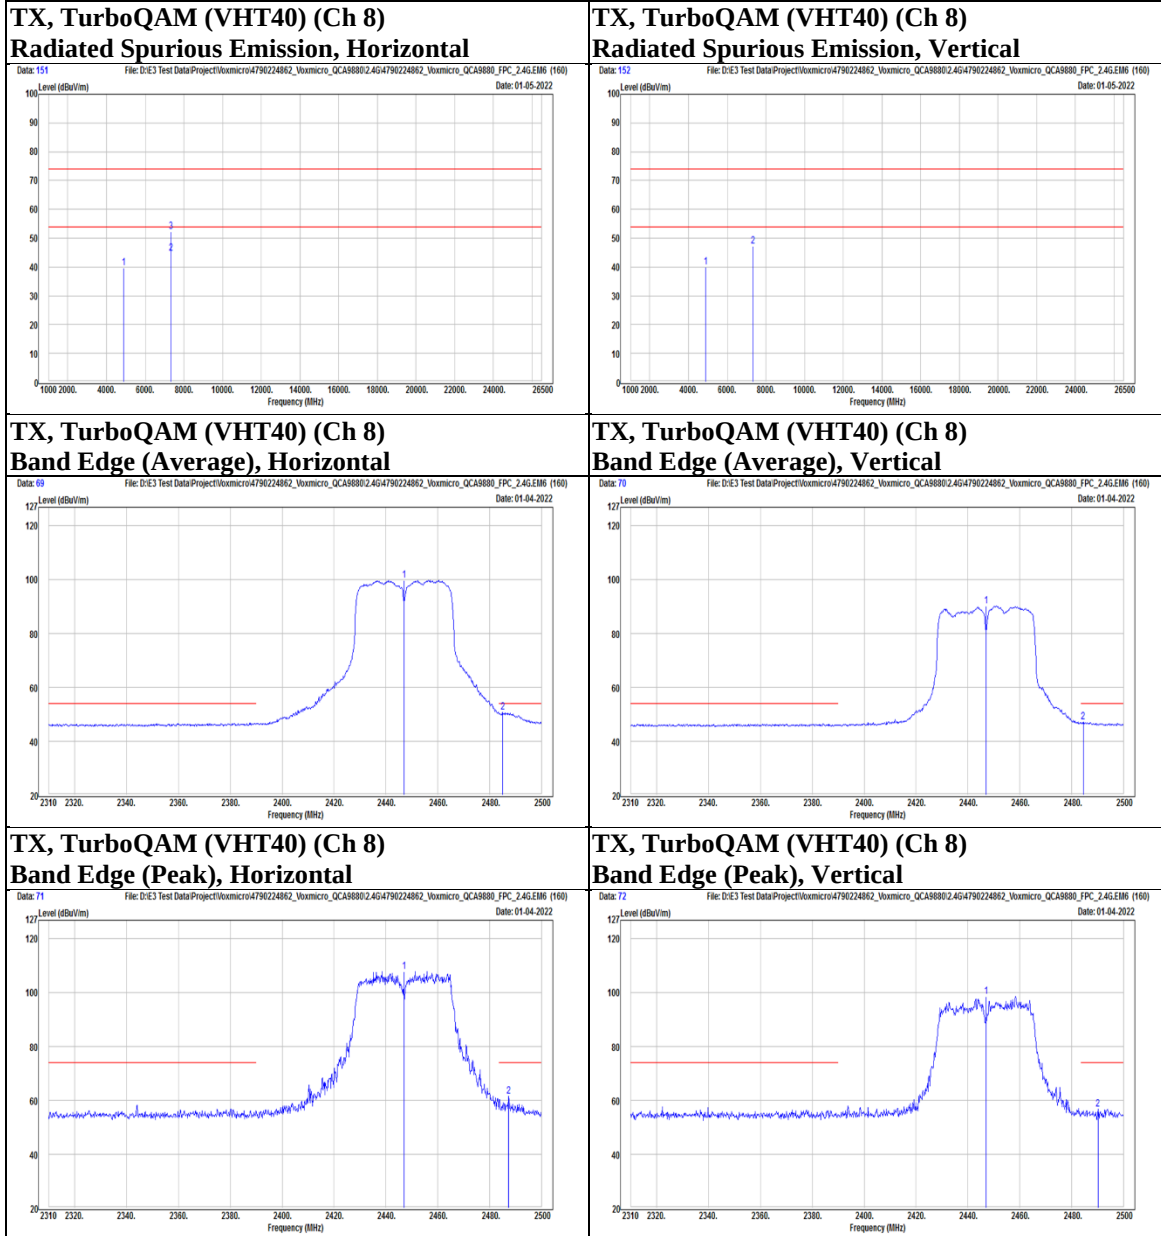

Test report No. : 4790224862-US-R0-V0
Page : 173 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT40)	Channel	9
------	------------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2452	88.21	16.12	104.33	N/A	N/A	PK
	@	2452	80.34	16.12	96.46	N/A	N/A	AVG
		2483.66	45.62	16.1	61.72	74	-12.28	PK
		2483.85	35.18	16.1	51.28	54	-2.72	AVG
	*	4904	36.59	2.63	39.22	74	-34.78	PK
Vertical	@	2452	78.41	16.12	94.53	N/A	N/A	PK
	@	2452	70.45	16.12	86.57	N/A	N/A	AVG
		2483.85	30.88	16.1	46.98	54	-7.02	AVG
		2498.67	40.99	16.1	57.09	74	-16.91	PK
	*	4904	36.92	2.63	39.55	74	-34.45	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

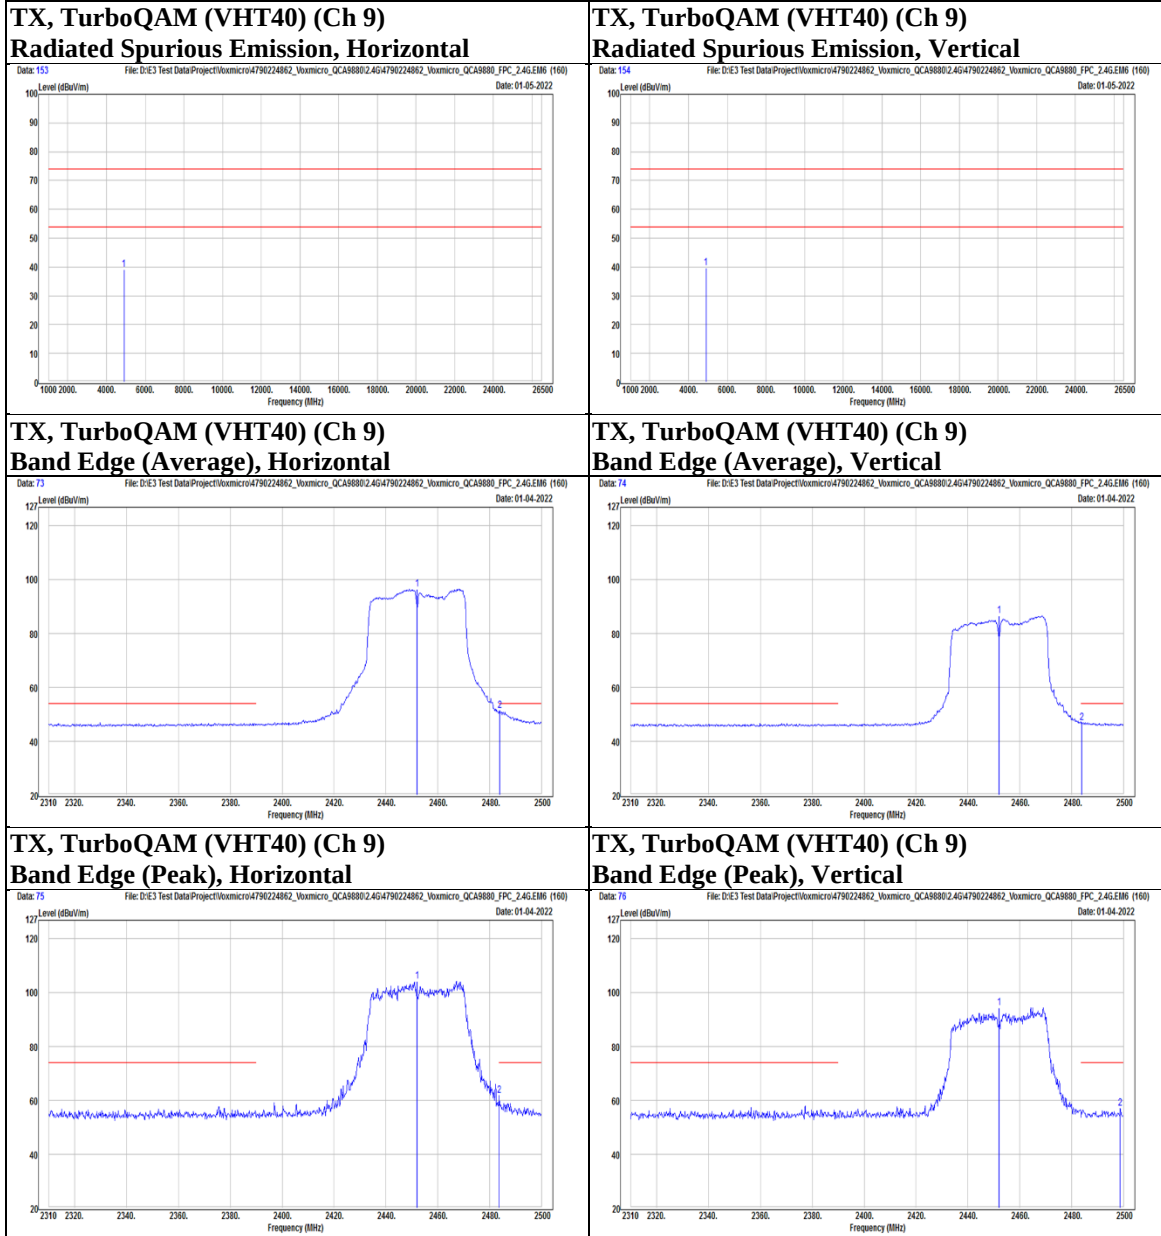




Below 1 GHz

Mode	802.11g	Channel	6
------	---------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		99.84	55.86	-16.45	39.41	43.5	-4.09	PK
		199.75	53.29	-13.91	39.38	43.5	-4.12	PK
		298.69	50.58	-9.99	40.59	46	-5.41	PK
		323.91	46.61	-9.18	37.43	46	-8.57	PK
		374.35	49.87	-7.75	42.12	46	-3.88	PK
		498.51	47.4	-4.79	42.61	46	-3.39	PK
Vertical		99.84	56.3	-16.45	39.85	43.5	-3.65	PK
		199.75	45.32	-13.91	31.41	43.5	-12.09	PK
		296.75	40.1	-10.08	30.02	46	-15.98	PK
		323.91	45	-9.18	35.82	46	-10.18	PK
		374.35	50.33	-7.75	42.58	46	-3.42	PK
		497.54	45.92	-4.79	41.13	46	-4.87	PK

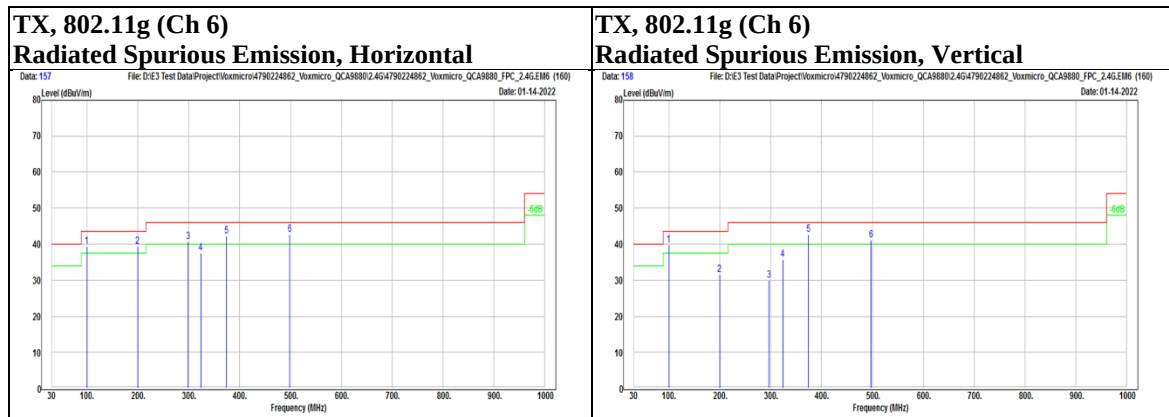

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Dipole Antenna

Above 1 GHz

Mode	802.11b	Channel	1
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2387.33	34.62	16.1	50.72	54	-3.28	AVG
		2388.28	41.73	16.1	57.83	74	-16.17	PK
	@	2412	95.59	16.13	111.72	N/A	N/A	PK
	@	2412	92.15	16.13	108.28	N/A	N/A	AVG
	*	4824	37.85	2.55	40.4	74	-33.6	PK
Vertical		2387.33	43.7	16.1	59.8	74	-14.2	PK
		2389.23	37.5	16.1	53.6	54	-0.4	AVG
	@	2412	100.94	16.13	117.07	N/A	N/A	PK
	@	2412	97.87	16.13	114	N/A	N/A	AVG
		4824	51.53	2.55	54.08	74	-19.92	PK
		4824	50.64	2.55	53.19	54	-0.81	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

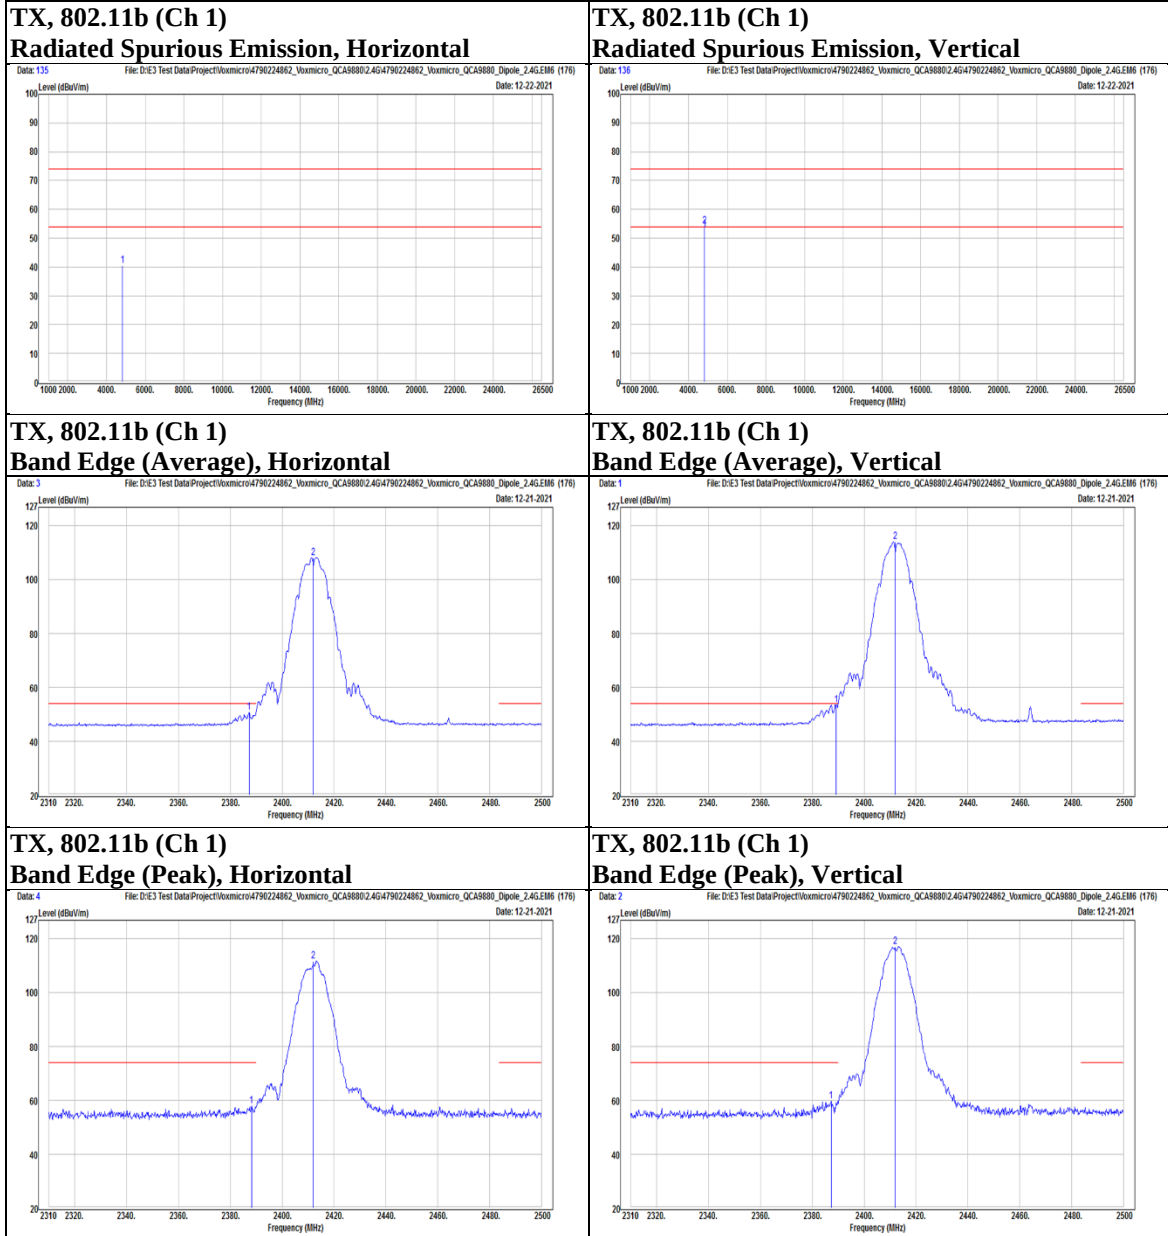

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Mode	802.11b	Channel	6
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2317.22	30.64	16.17	46.81	54	-7.19	AVG
		2373.08	41.12	16.08	57.2	74	-16.8	PK
	@	2437	96.05	16.12	112.17	N/A	N/A	PK
	@	2437	92.83	16.12	108.95	N/A	N/A	AVG
		2490.69	30.77	16.1	46.87	54	-7.13	AVG
		2493.35	41.83	16.1	57.93	74	-16.07	PK
	*	4874	38.97	2.66	41.63	74	-32.37	PK
Vertical		2326.91	41.83	16.12	57.95	74	-16.05	PK
		2366.62	30.95	16.06	47.01	54	-6.99	AVG
	@	2437	102.19	16.12	118.31	N/A	N/A	PK
	@	2437	99.12	16.12	115.24	N/A	N/A	AVG
		2492.97	31.83	16.1	47.93	54	-6.07	AVG
		2497.53	42.14	16.1	58.24	74	-15.76	PK
		4874	52.4	2.66	55.06	74	-18.94	PK
		4874	50.58	2.66	53.24	54	-0.76	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

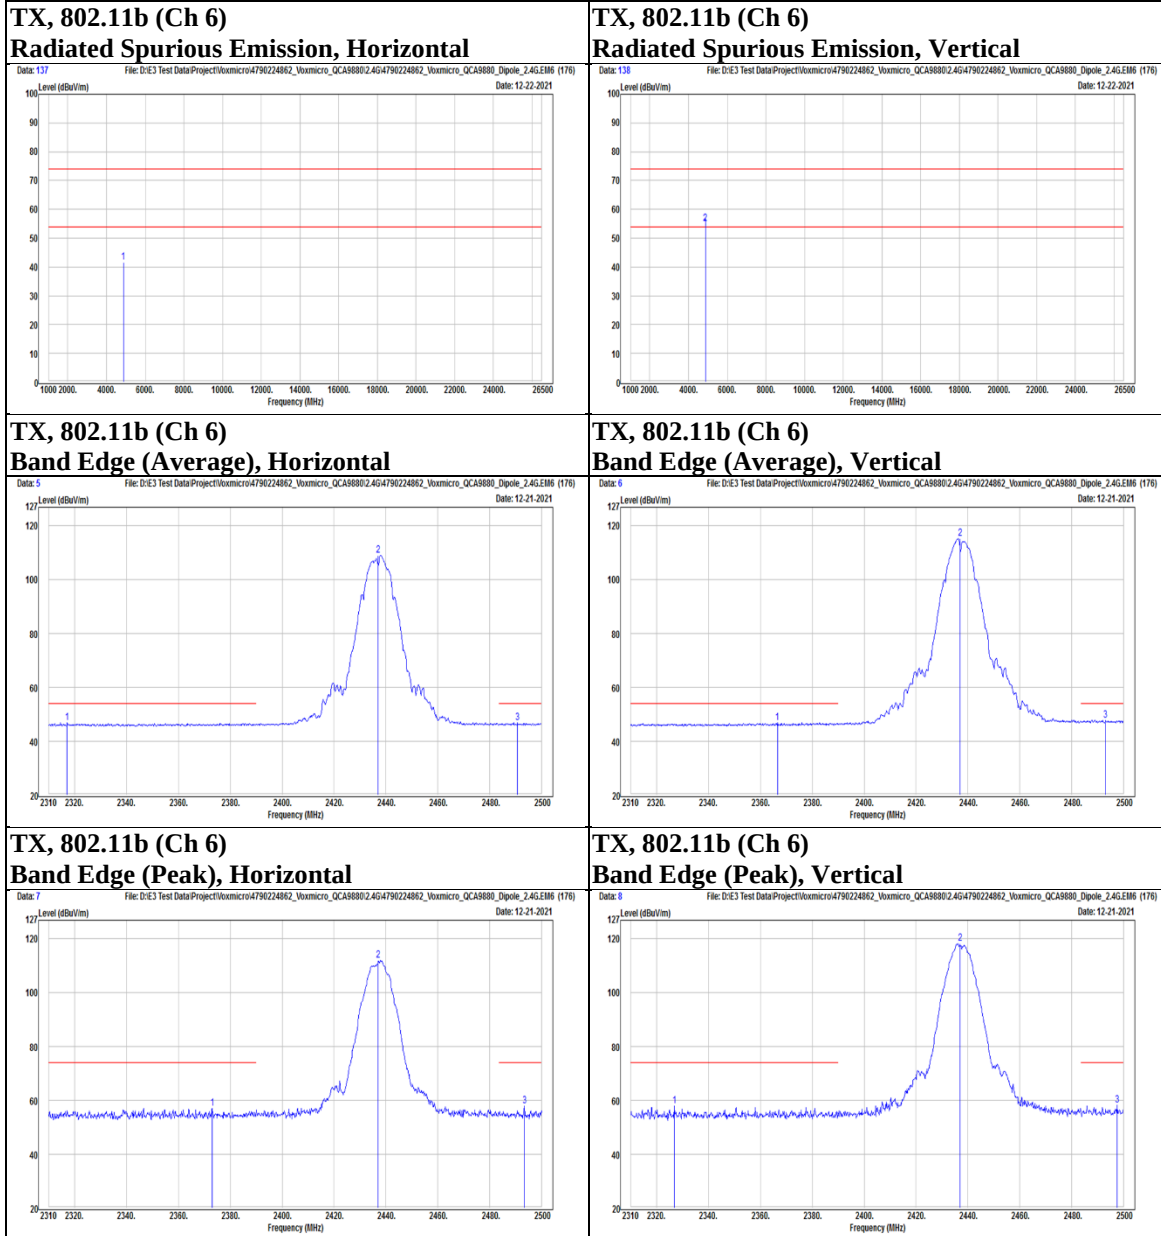



Test report No. : 4790224862-US-R0-V0
Page : 180 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11b	Channel	11
------	---------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2462	95.81	16.12	111.93	N/A	N/A	PK
	@	2462	92.49	16.12	108.61	N/A	N/A	AVG
		2483.66	32.67	16.1	48.77	54	-5.23	AVG
		2486.13	42.13	16.1	58.23	74	-15.77	PK
	*	4924	37.73	2.61	40.34	74	-33.66	PK
Vertical	@	2462	102.23	16.12	118.35	N/A	N/A	PK
	@	2462	98.44	16.12	114.56	N/A	N/A	AVG
		2483.66	35.9	16.1	52	54	-2	AVG
		2486.13	44.05	16.1	60.15	74	-13.85	PK
		4924	53.08	2.61	55.69	74	-18.31	PK
		4924	50.79	2.61	53.4	54	-0.6	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

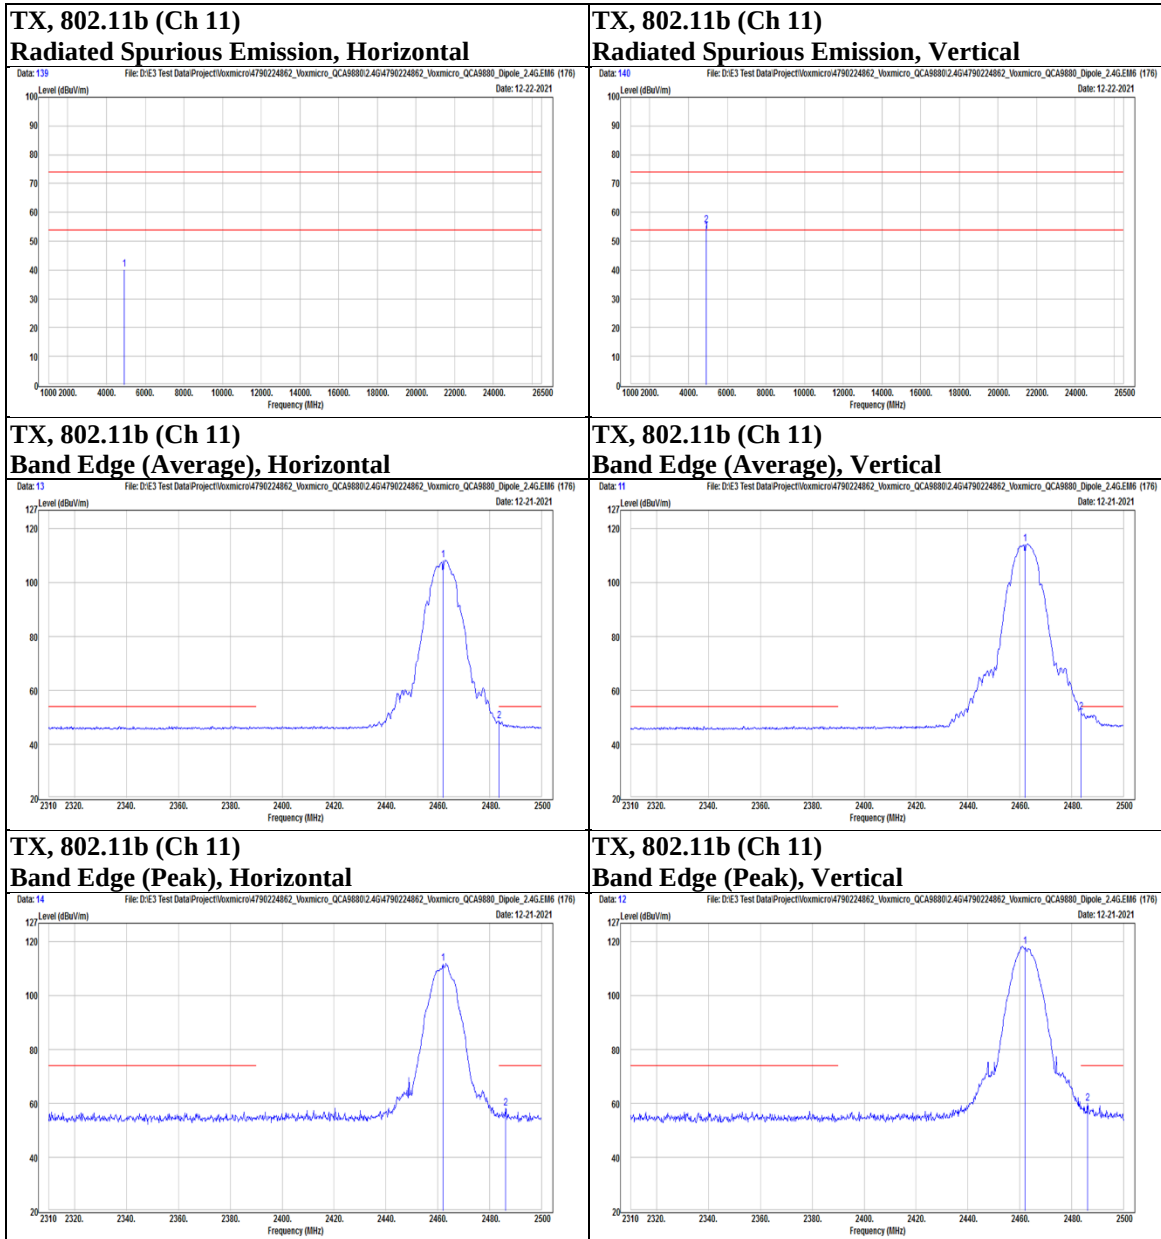

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790224862-US-R0-V0
Page : 182 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11g	Channel	1
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2389.61	44.04	16.1	60.14	74	-13.86	PK
		2389.8	34.48	16.1	50.58	54	-3.42	AVG
	@	2412	90.13	16.13	106.26	N/A	N/A	PK
	@	2412	82.12	16.13	98.25	N/A	N/A	AVG
	*	4824	38.03	2.55	40.58	74	-33.42	PK
Vertical		2384.67	48.82	16.09	64.91	74	-9.09	PK
		2389.23	37.42	16.1	53.52	54	-0.48	AVG
	@	2412	96.35	16.13	112.48	N/A	N/A	PK
	@	2412	88.31	16.13	104.44	N/A	N/A	AVG
		4824	49.6	2.55	52.15	74	-21.85	PK
		4824	42.32	2.55	44.87	54	-9.13	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

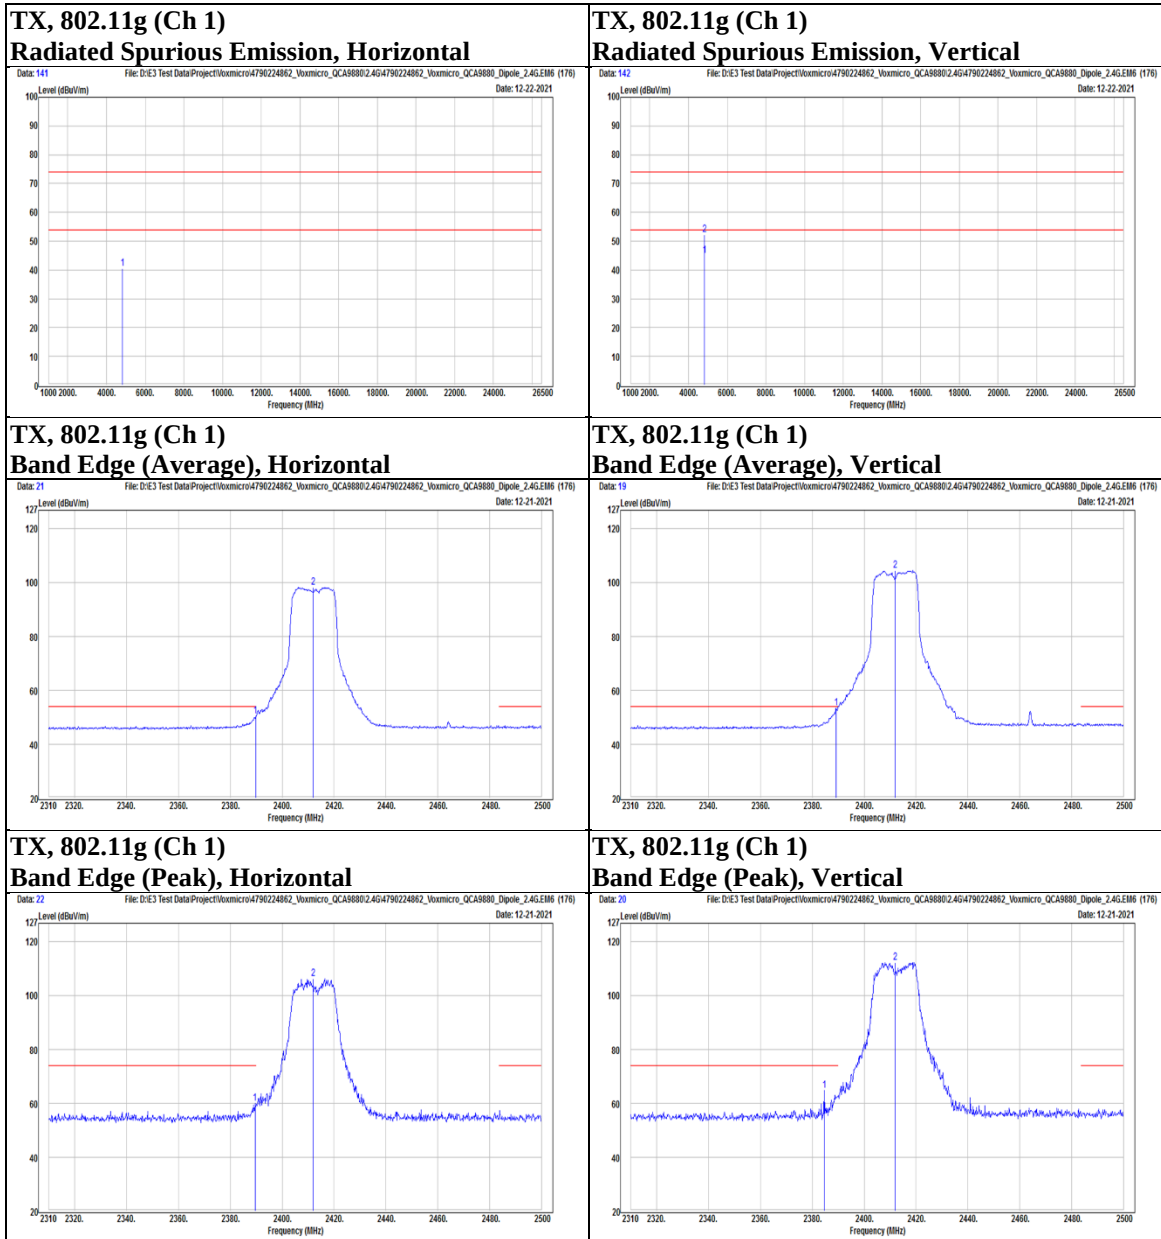



Test report No. : 4790224862-US-R0-V0
Page : 184 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11g	Channel	2
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2385.24	44.88	16.09	60.97	74	-13.03	PK
		2389.99	33.89	16.1	49.99	54	-4.01	AVG
	@	2417	92.91	16.13	109.04	N/A	N/A	PK
	@	2417	85.11	16.13	101.24	N/A	N/A	AVG
	*	4834	37.67	2.61	40.28	74	-33.72	PK
Vertical		2389.61	48.93	16.1	65.03	74	-8.97	PK
		2389.99	36.26	16.1	52.36	54	-1.64	AVG
	@	2417	97.66	16.13	113.79	N/A	N/A	PK
	@	2417	89.54	16.13	105.67	N/A	N/A	AVG
		4834	51.18	2.61	53.79	74	-20.21	PK
		4834	44.85	2.61	47.46	54	-6.54	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

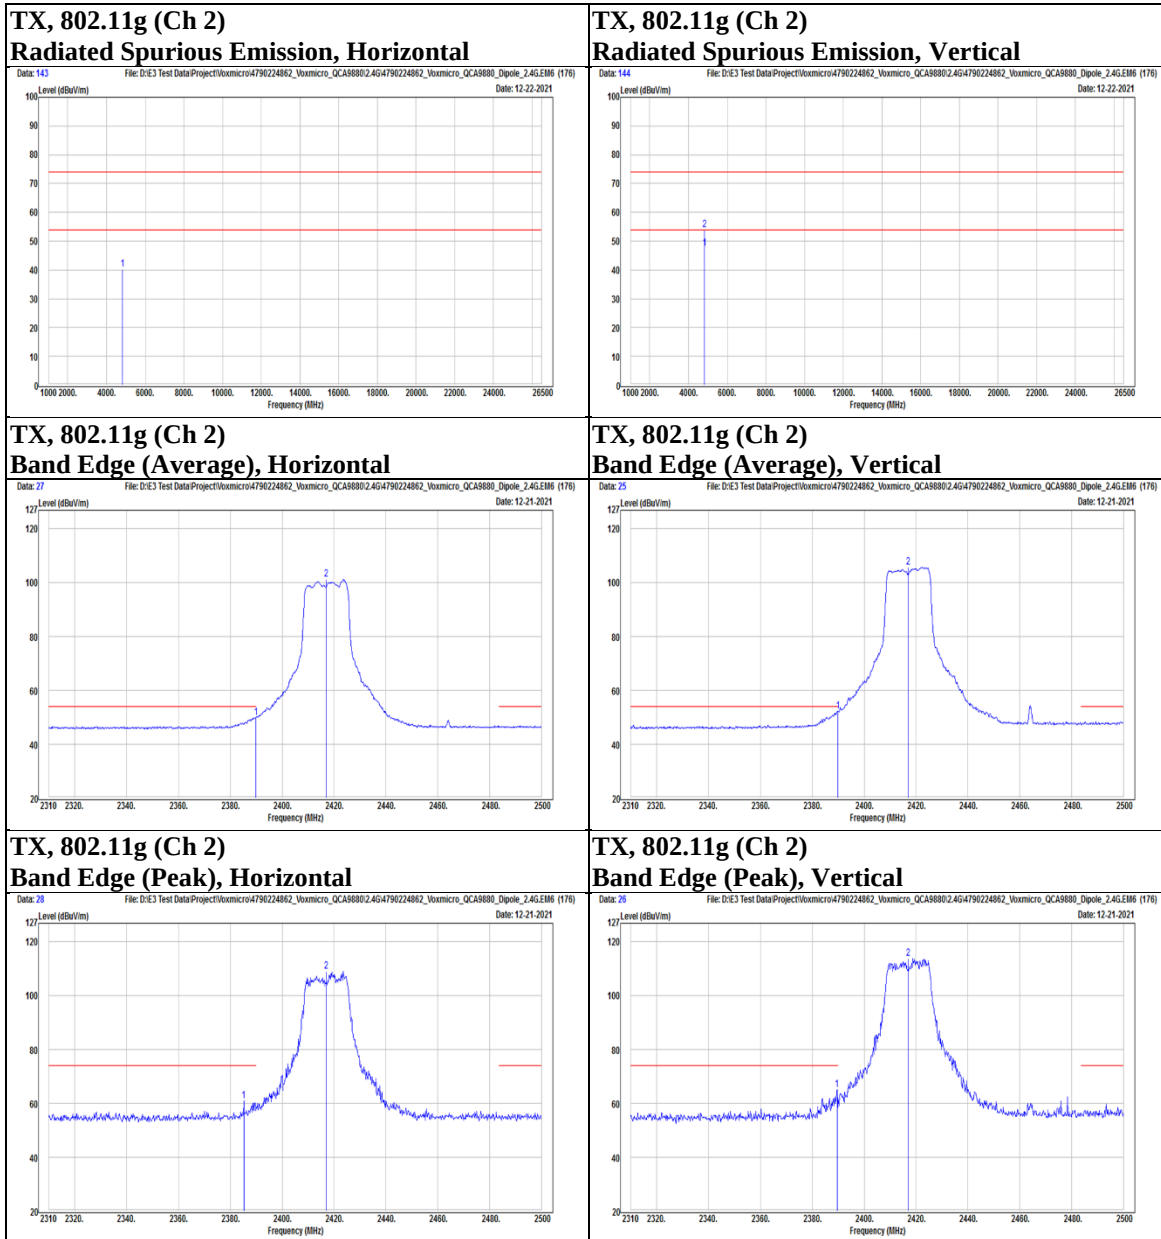

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Mode	802.11g	Channel	6
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2389.23	45.94	16.1	62.04	74	-11.96	PK
		2389.42	33.12	16.1	49.22	54	-4.78	AVG
	@	2437	97.62	16.12	113.74	N/A	N/A	PK
	@	2437	88.68	16.12	104.8	N/A	N/A	AVG
		2483.66	44.25	16.1	60.35	74	-13.65	PK
		2484.8	32.71	16.1	48.81	54	-5.19	AVG
	*	4874	41.44	2.66	44.1	74	-29.9	PK
		7311	44.22	10.62	54.84	74	-19.16	PK
		7311	38.66	10.62	49.28	54	-4.72	AVG
Vertical		2388.66	45.5	16.1	61.6	74	-12.4	PK
		2389.99	34.67	16.1	50.77	54	-3.23	AVG
	@	2437	101.63	16.12	117.75	N/A	N/A	PK
	@	2437	93.75	16.12	109.87	N/A	N/A	AVG
		2483.85	47.64	16.1	63.74	74	-10.26	PK
		2484.61	36.48	16.1	52.58	54	-1.42	AVG
		4874	57.96	2.66	60.62	74	-13.38	PK
		4874	49.99	2.66	52.65	54	-1.35	AVG
		7311	45.53	10.62	56.15	74	-17.85	PK
		7311	39.31	10.62	49.93	54	-4.07	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

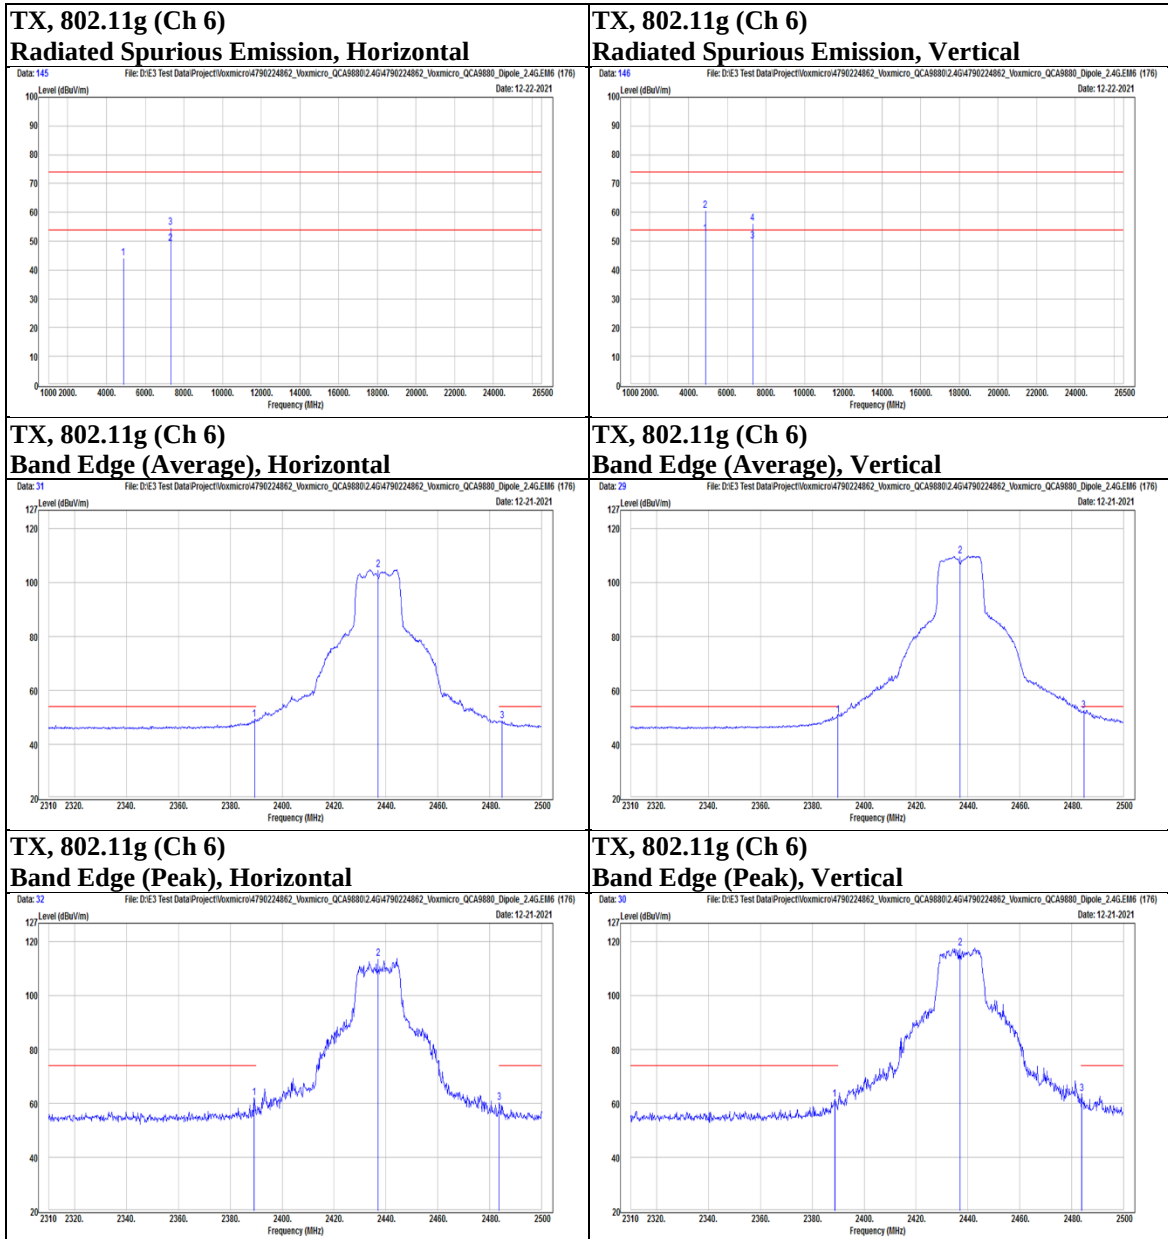

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790224862-US-R0-V0
Page : 188 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11g	Channel	10
------	---------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2457	92.77	16.12	108.89	N/A	N/A	PK
	@	2457	84.32	16.12	100.44	N/A	N/A	AVG
		2483.66	31.84	16.1	47.94	54	-6.06	AVG
		2485.94	41.21	16.1	57.31	74	-16.69	PK
	*	4914	37.95	2.63	40.58	74	-33.42	PK
Vertical	@	2457	98.2	16.12	114.32	N/A	N/A	PK
	@	2457	90	16.12	106.12	N/A	N/A	AVG
		2483.66	36.37	16.1	52.47	54	-1.53	AVG
		2483.85	47.56	16.1	63.66	74	-10.34	PK
		4914	52.55	2.63	55.18	74	-18.82	PK
		4914	44.74	2.63	47.37	54	-6.63	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

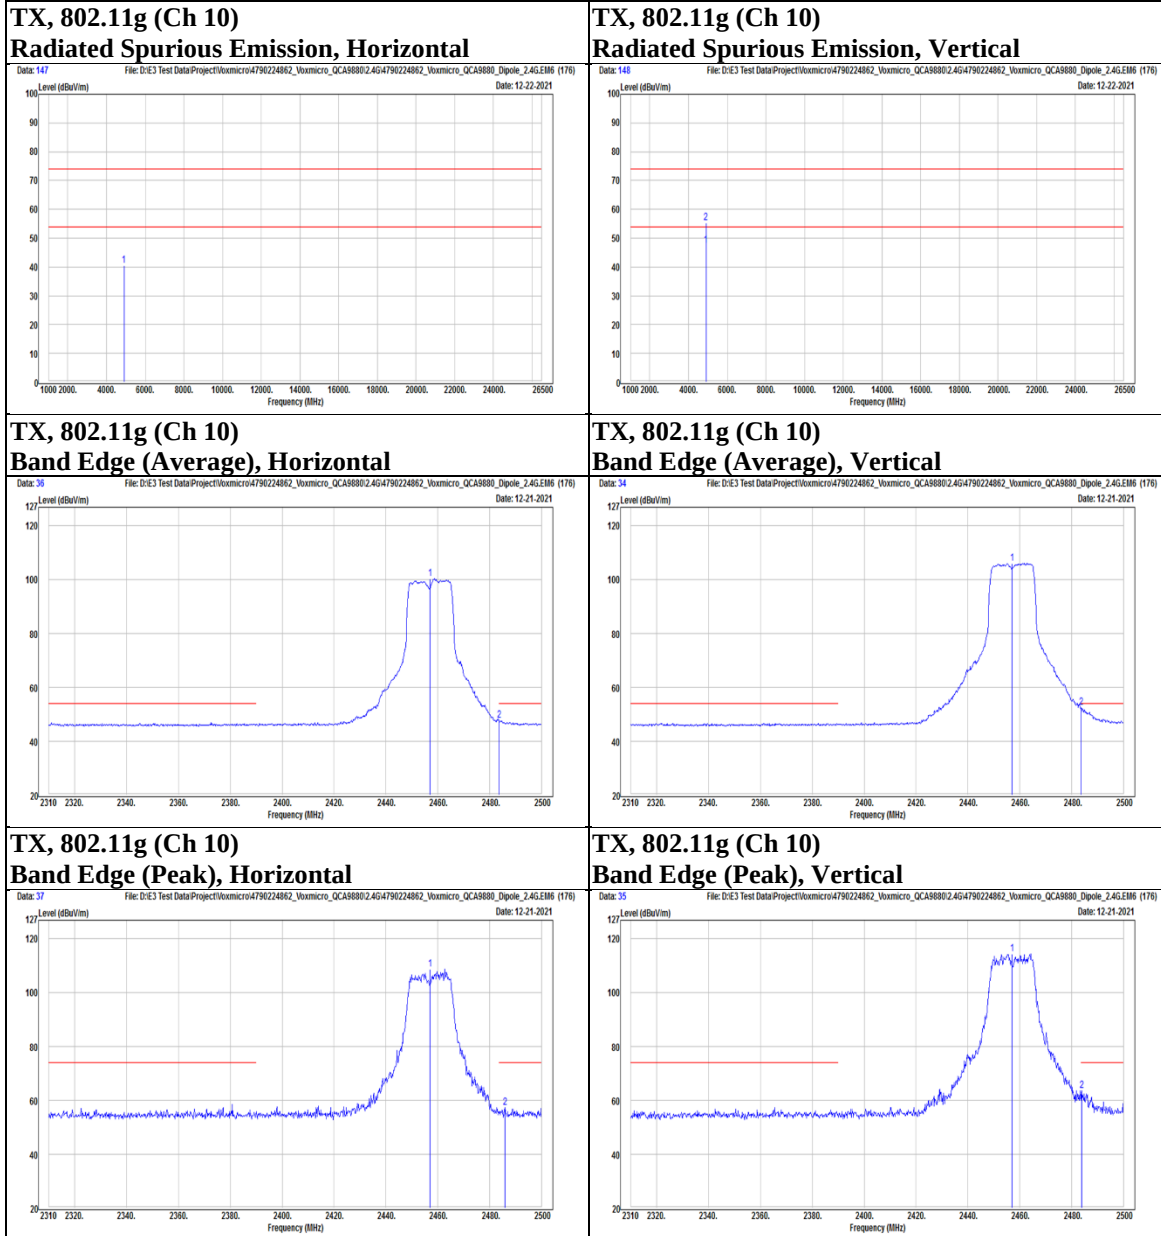

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790224862-US-R0-V0
Page : 190 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11g	Channel	11
------	---------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2462	89.46	16.12	105.58	N/A	N/A	PK
	@	2462	81.84	16.12	97.96	N/A	N/A	AVG
		2483.85	32.24	16.1	48.34	54	-5.66	AVG
		2490.69	41.73	16.1	57.83	74	-16.17	PK
	*	4924	39	2.61	41.61	74	-32.39	PK
Vertical	@	2462	97.58	16.12	113.7	N/A	N/A	PK
	@	2462	89.15	16.12	105.27	N/A	N/A	AVG
		2483.66	37.17	16.1	53.27	54	-0.73	AVG
		2488.6	47.11	16.1	63.21	74	-10.79	PK
		4924	51.53	2.61	54.14	74	-19.86	PK
		4924	41.32	2.61	43.93	54	-10.07	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

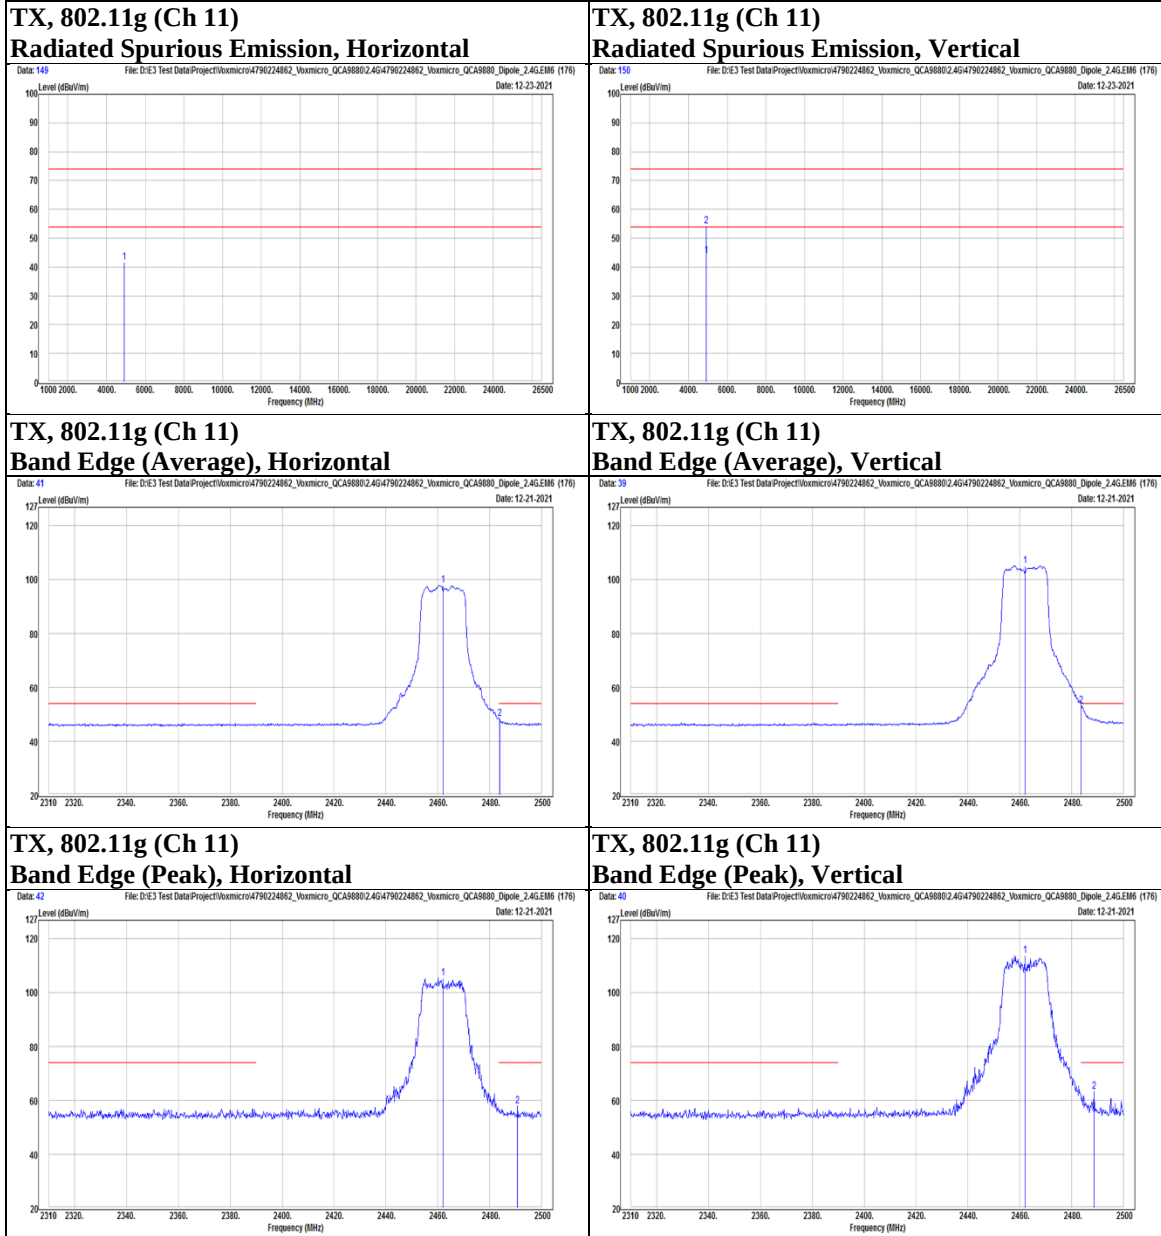

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790224862-US-R0-V0
Page : 192 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT20)	Channel	1
------	------------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2389.42	34.68	16.1	50.78	54	-3.22	AVG
		2389.8	44.62	16.1	60.72	74	-13.28	PK
	@	2412	90.13	16.13	106.26	N/A	N/A	PK
	@	2412	82.02	16.13	98.15	N/A	N/A	AVG
	*	4824	36.5	2.55	39.05	74	-34.95	PK
Vertical		2389.42	48.65	16.1	64.75	74	-9.25	PK
		2389.99	36.39	16.1	52.49	54	-1.51	AVG
	@	2412	95.44	16.13	111.57	N/A	N/A	PK
	@	2412	86.61	16.13	102.74	N/A	N/A	AVG
	*	4824	47.05	2.55	49.6	74	-24.4	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

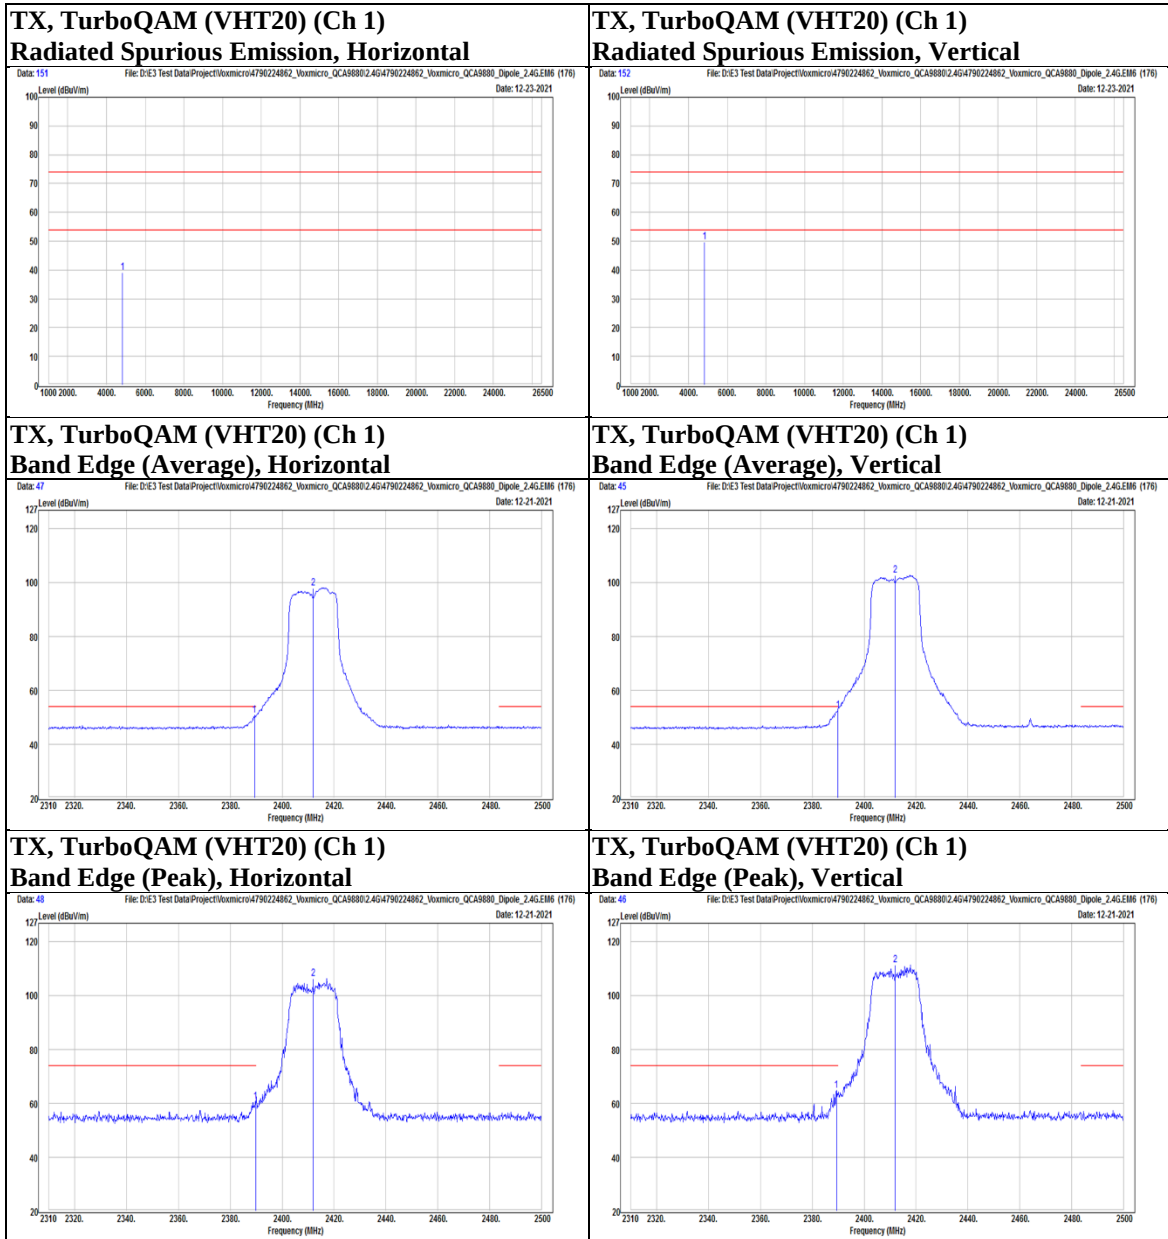

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790224862-US-R0-V0
Page : 194 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT20)	Channel	2
------	------------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2388.28	43.35	16.1	59.45	74	-14.55	PK
		2389.99	34.7	16.1	50.8	54	-3.2	AVG
	@	2417	92.41	16.13	108.54	N/A	N/A	PK
	@	2417	84.76	16.13	100.89	N/A	N/A	AVG
	*	4834	37.44	2.61	40.05	74	-33.95	PK
Vertical		2388.09	46.14	16.1	62.24	74	-11.76	PK
		2389.99	36.64	16.1	52.74	54	-1.26	AVG
	@	2417	97.22	16.13	113.35	N/A	N/A	PK
	@	2417	89.49	16.13	105.62	N/A	N/A	AVG
		4834	51.87	2.61	54.48	74	-19.52	PK
		4834	43.71	2.61	46.32	54	-7.68	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

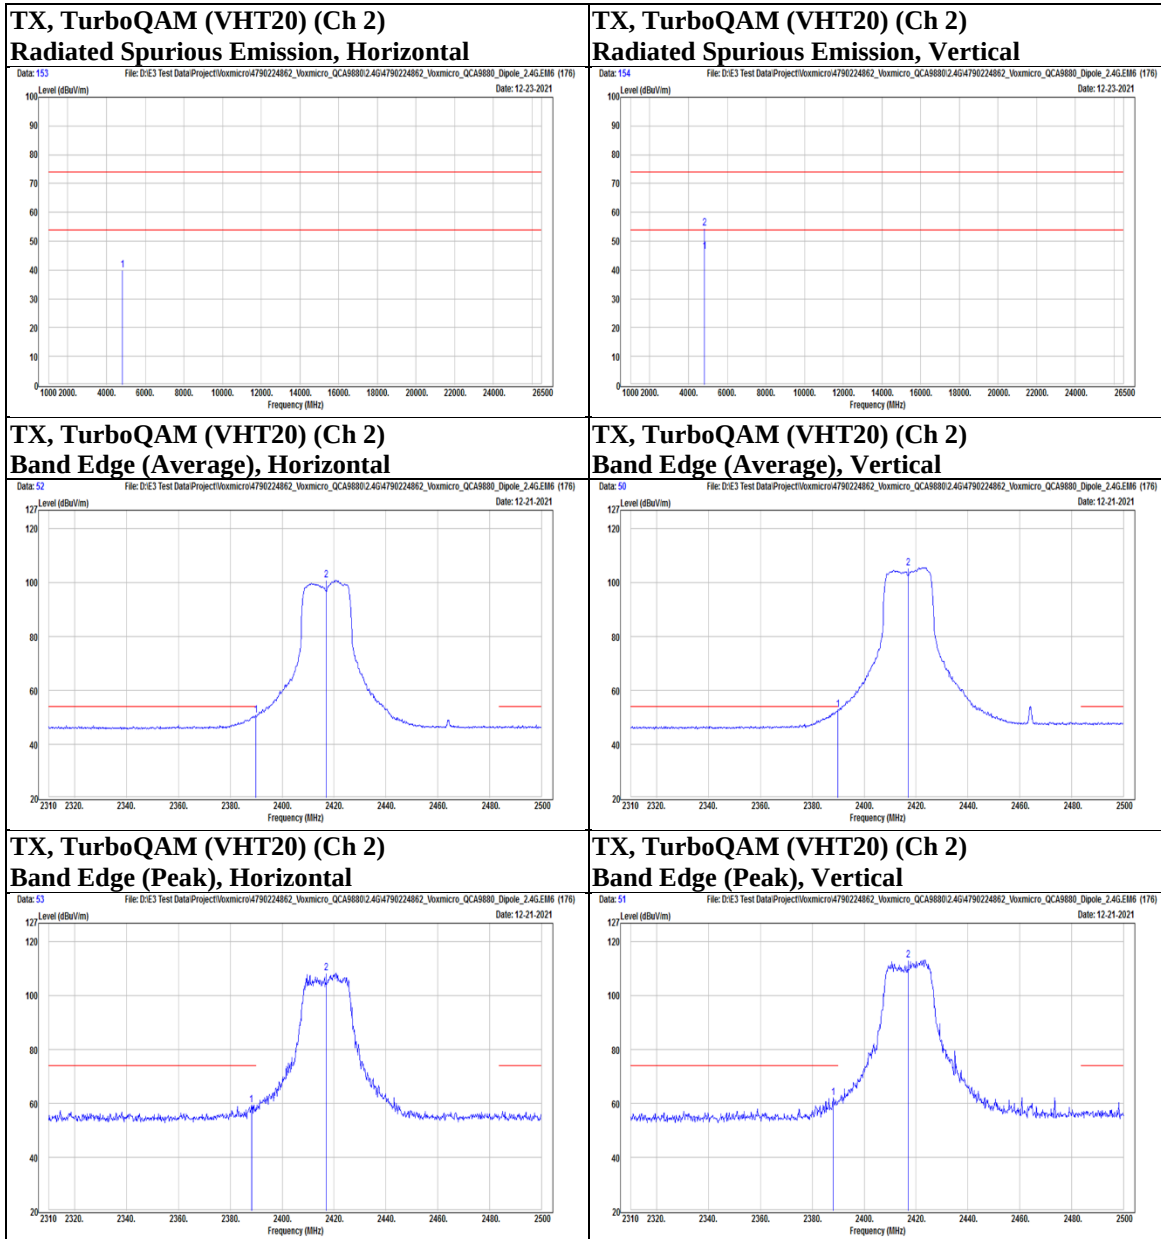



Mode	TurboQAM (VHT20)	Channel	6
------	------------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2389.04	44.07	16.1	60.17	74	-13.83	PK
		2389.8	33.78	16.1	49.88	54	-4.12	AVG
	@	2437	97.41	16.12	113.53	N/A	N/A	PK
	@	2437	88.93	16.12	105.05	N/A	N/A	AVG
		2484.04	32.36	16.1	48.46	54	-5.54	AVG
		2484.61	42.38	16.1	58.48	74	-15.52	PK
	*	4874	42.28	2.66	44.94	74	-29.06	PK
		7311	44.91	10.62	55.53	74	-18.47	PK
		7311	38.96	10.62	49.58	54	-4.42	AVG
Vertical		2388.66	45.36	16.1	61.46	74	-12.54	PK
		2389.99	34.85	16.1	50.95	54	-3.05	AVG
	@	2437	102.2	16.12	118.32	N/A	N/A	PK
	@	2437	93.97	16.12	110.09	N/A	N/A	AVG
		2484.23	36.74	16.1	52.84	54	-1.16	AVG
		2488.03	50.02	16.1	66.12	74	-7.88	PK
		4874	58.08	2.66	60.74	74	-13.26	PK
		4874	48.83	2.66	51.49	54	-2.51	AVG
		7311	45.93	10.62	56.55	74	-17.45	PK
		7311	38.56	10.62	49.18	54	-4.82	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

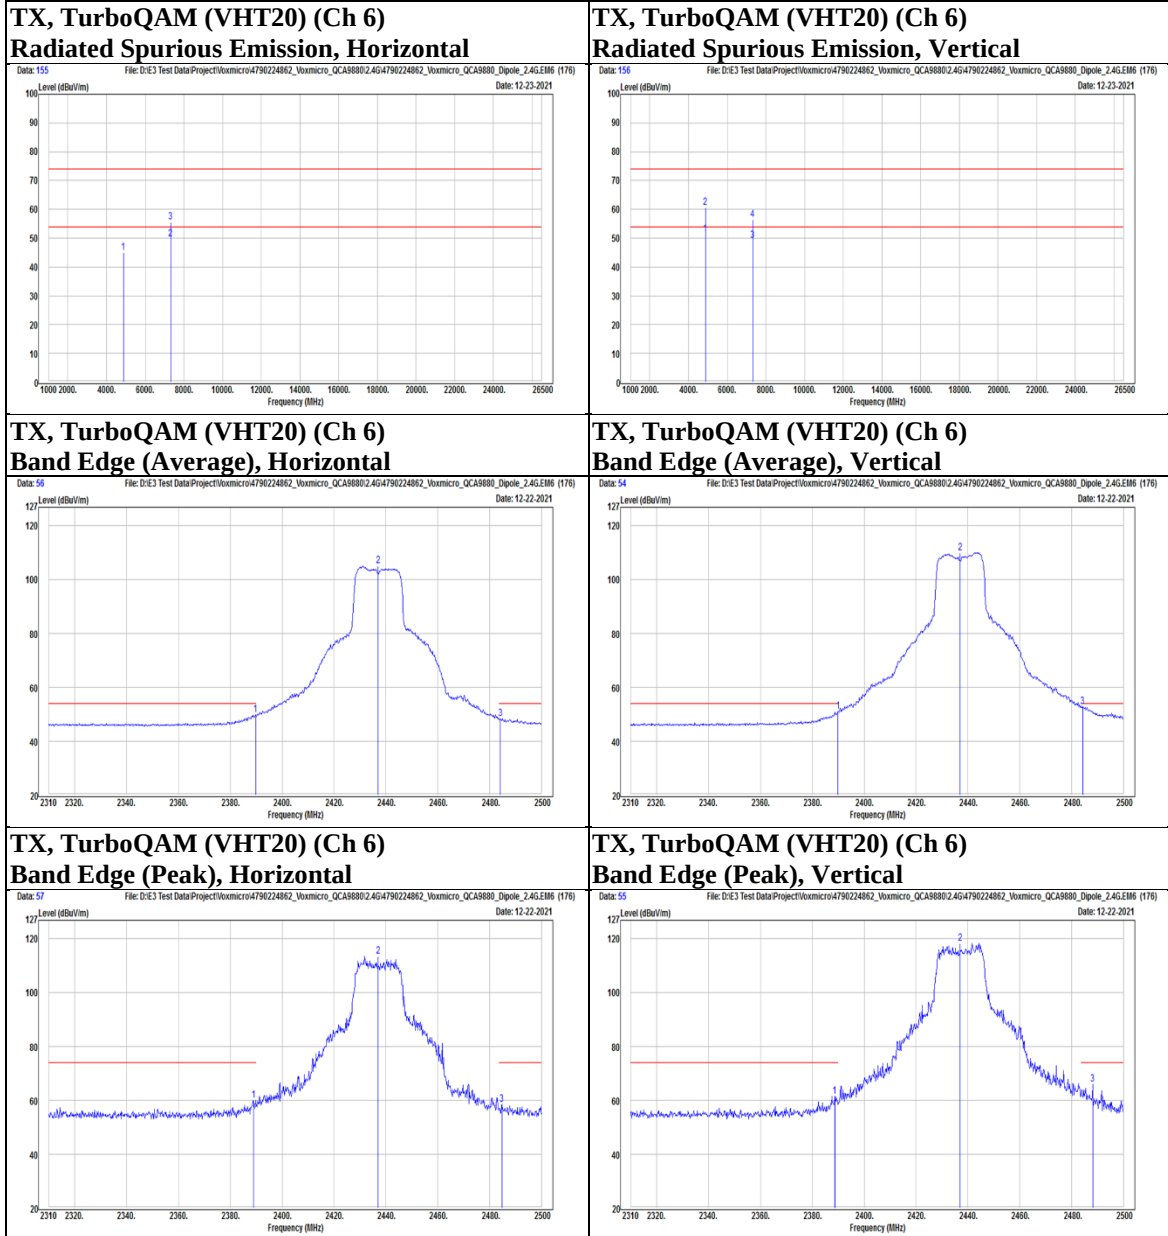



Test report No. : 4790224862-US-R0-V0
Page : 198 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT20)	Channel	10
------	------------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2457	92.86	16.12	108.98	N/A	N/A	PK
	@	2457	83.91	16.12	100.03	N/A	N/A	AVG
		2483.66	33.59	16.1	49.69	54	-4.31	AVG
		2487.84	41.96	16.1	58.06	74	-15.94	PK
	*	4914	38.5	2.63	41.13	74	-32.87	PK
Vertical	@	2457	99.52	16.12	115.64	N/A	N/A	PK
	@	2457	91.53	16.12	107.65	N/A	N/A	AVG
		2484.04	37.17	16.1	53.27	54	-0.73	AVG
		2484.42	46.98	16.1	63.08	74	-10.92	PK
		4914	51.63	2.63	54.26	74	-19.74	PK
		4914	44.55	2.63	47.18	54	-6.82	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

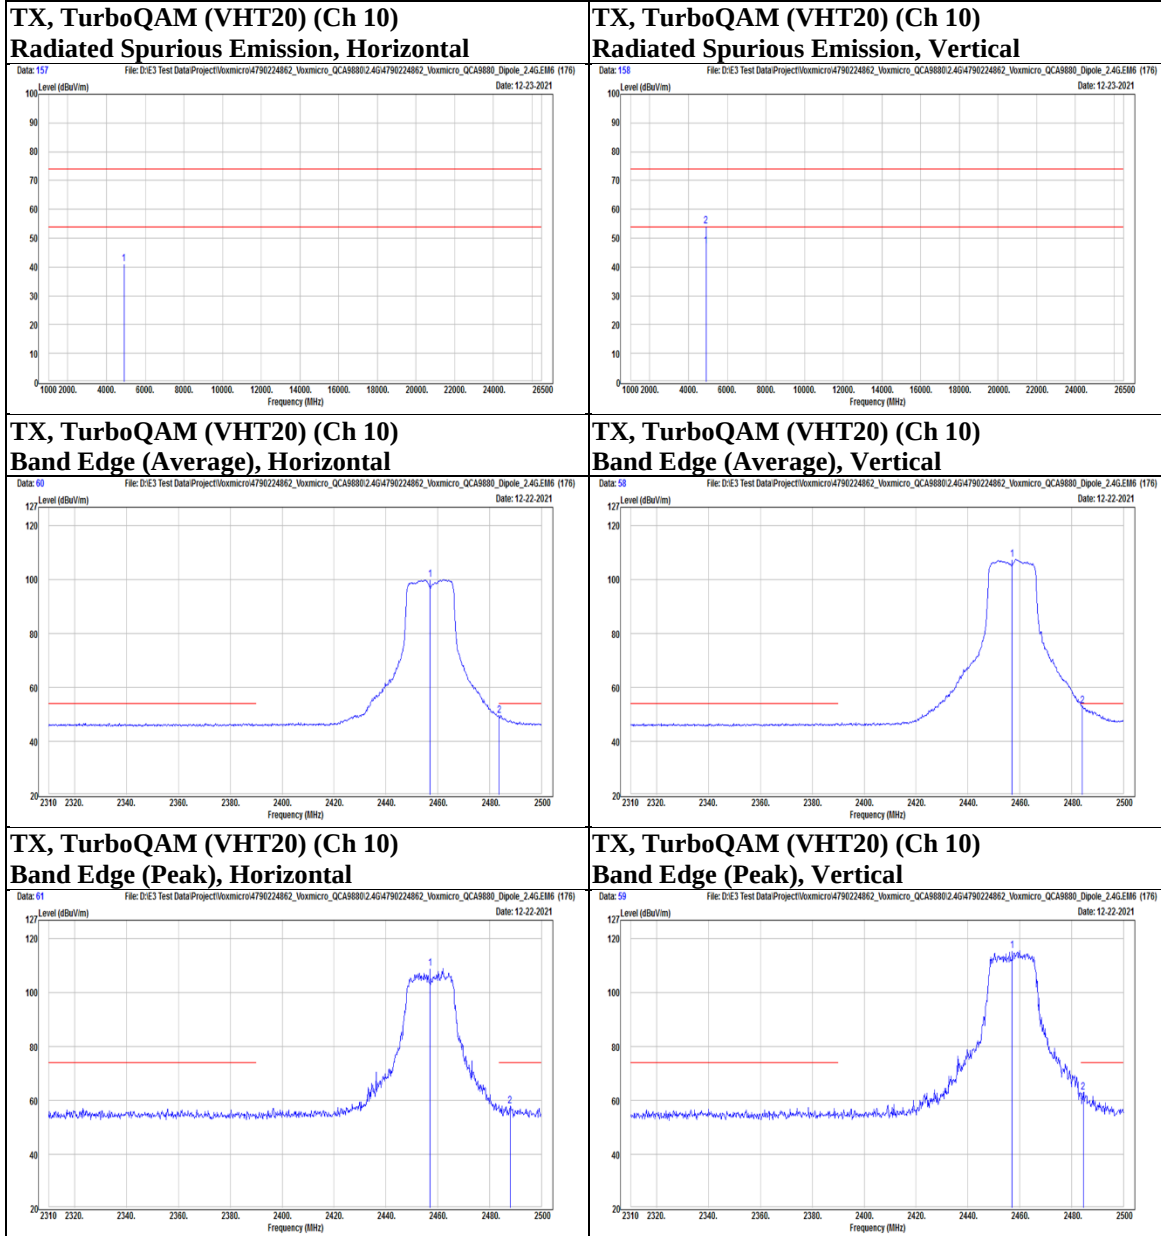

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790224862-US-R0-V0
Page : 200 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT20)	Channel	11
------	------------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2462	89.36	16.12	105.48	N/A	N/A	PK
	@	2462	80.95	16.12	97.07	N/A	N/A	AVG
		2483.66	32.42	16.1	48.52	54	-5.48	AVG
		2484.42	42.03	16.1	58.13	74	-15.87	PK
	*	4924	37.79	2.61	40.4	74	-33.6	PK
Vertical	@	2462	95.25	16.12	111.37	N/A	N/A	PK
	@	2462	87.29	16.12	103.41	N/A	N/A	AVG
		2483.85	36.24	16.1	52.34	54	-1.66	AVG
		2484.61	47.58	16.1	63.68	74	-10.32	PK
	*	4924	48.1	2.61	50.71	74	-23.29	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

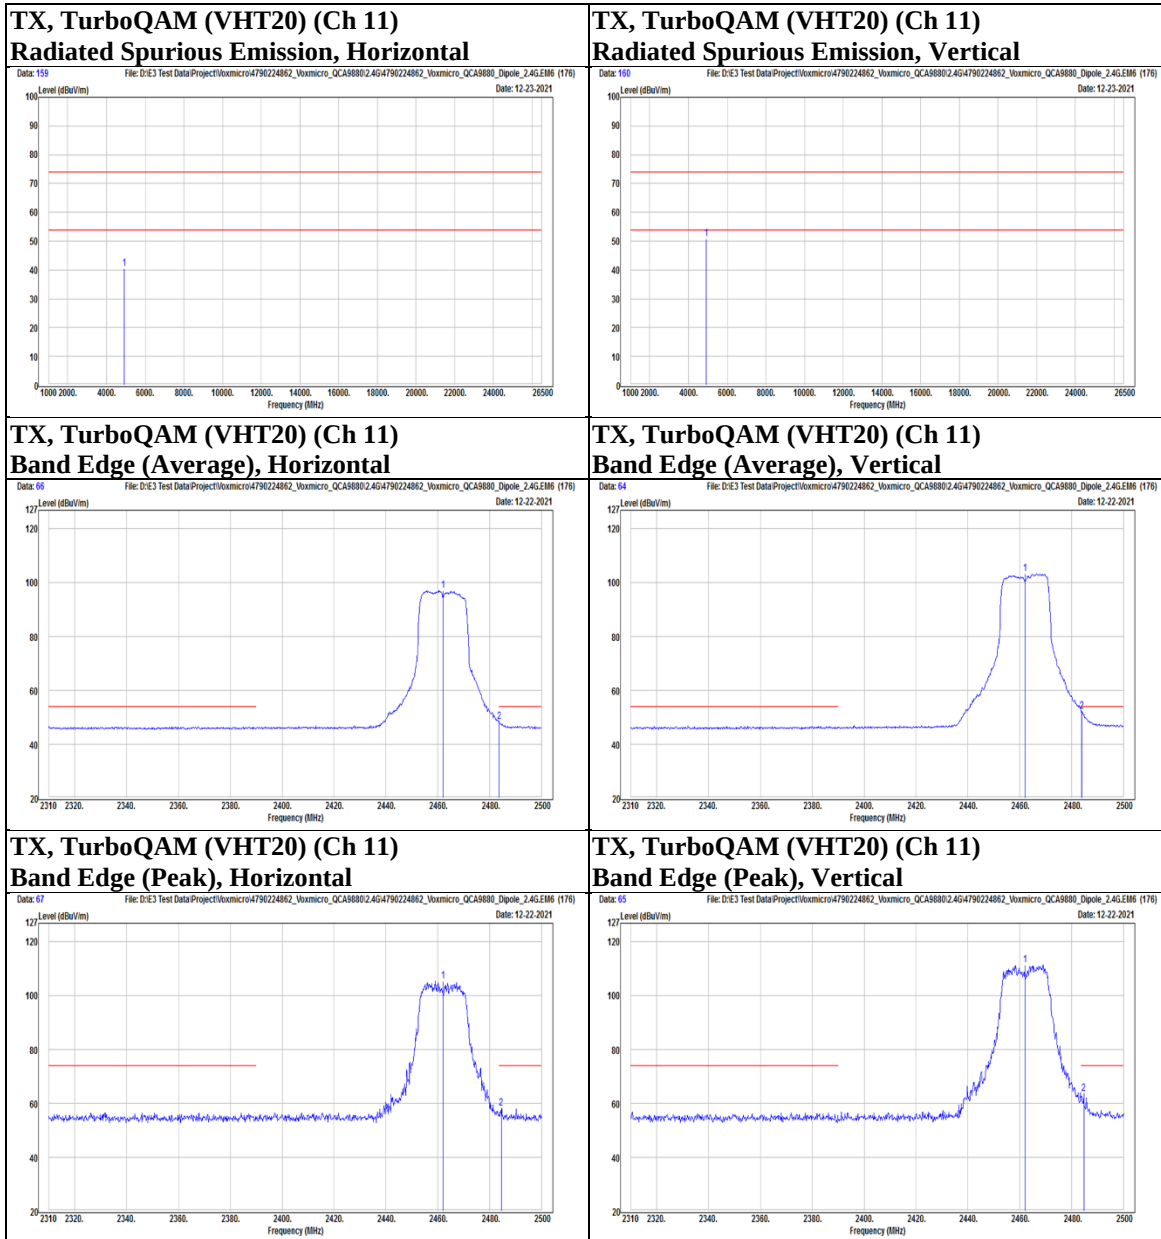

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790224862-US-R0-V0
Page : 202 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT40)	Channel	3
------	------------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2389.61	33.87	16.1	49.97	54	-4.03	AVG
		2389.99	44.32	16.1	60.42	74	-13.58	PK
	@	2422	84.51	16.13	100.64	N/A	N/A	PK
	@	2422	75.6	16.13	91.73	N/A	N/A	AVG
	*	4844	37.16	2.66	39.82	74	-34.18	PK
Vertical		2388.28	47.06	16.1	63.16	74	-10.84	PK
		2389.23	36.77	16.1	52.87	54	-1.13	AVG
	@	2422	90.1	16.13	106.23	N/A	N/A	PK
	@	2422	82.26	16.13	98.39	N/A	N/A	AVG
	*	4844	39.74	2.66	42.4	74	-31.6	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

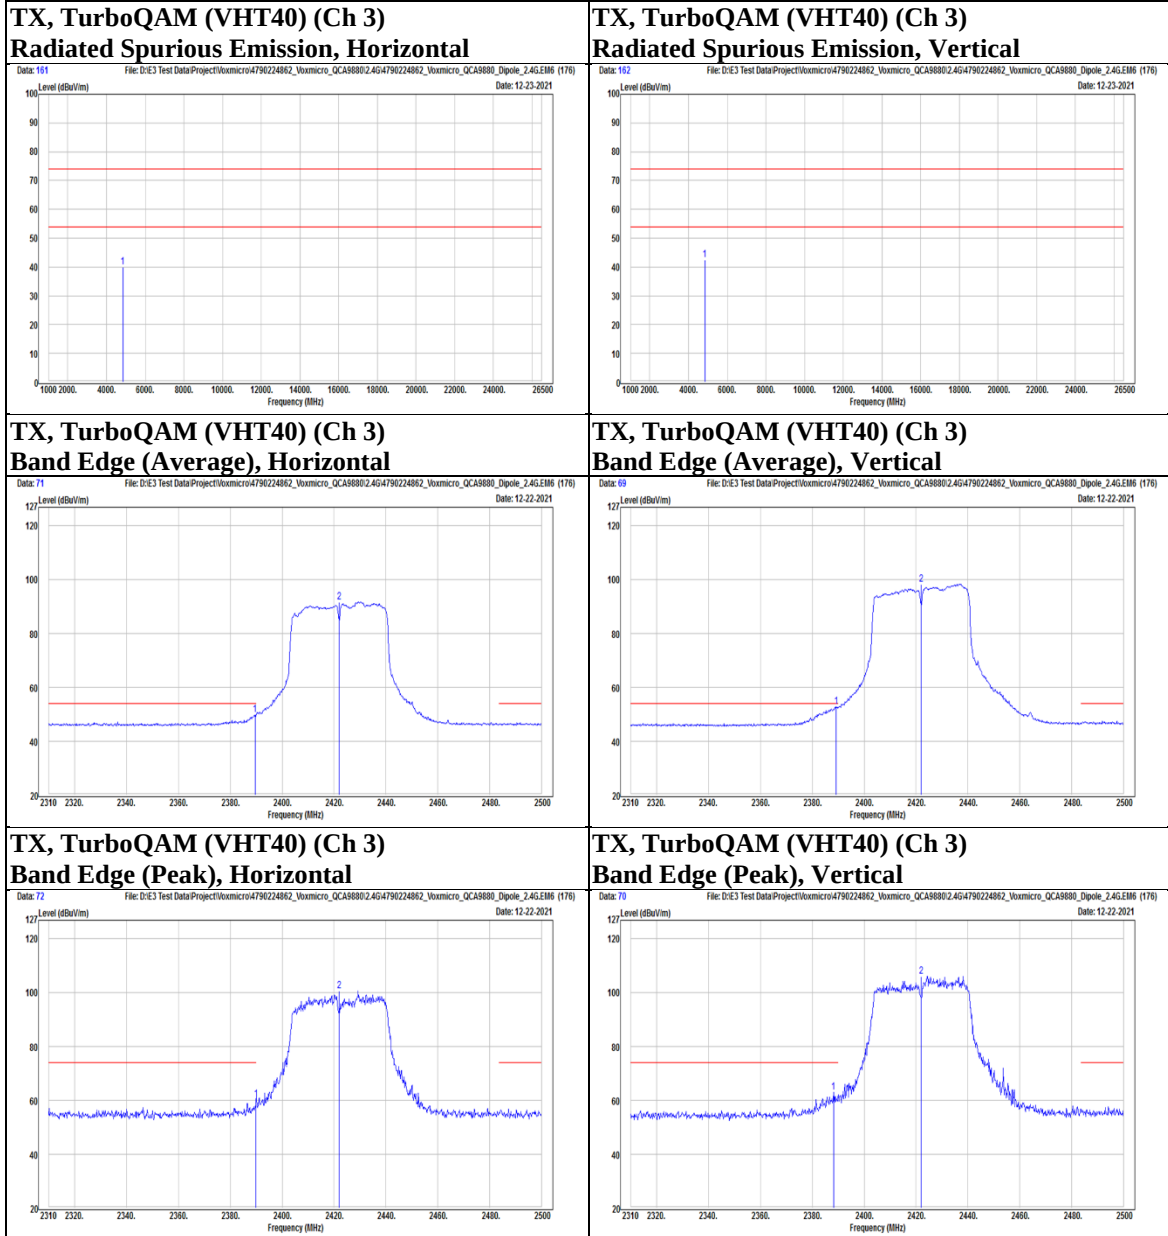

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790224862-US-R0-V0
Page : 204 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT40)	Channel	4
------	------------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2386.95	33.24	16.1	49.34	54	-4.66	AVG
		2389.99	42.11	16.1	58.21	74	-15.79	PK
	@	2427	84.44	16.12	100.56	N/A	N/A	PK
	@	2427	77.81	16.12	93.93	N/A	N/A	AVG
	*	4854	36.59	2.68	39.27	74	-34.73	PK
Vertical		2387.9	46.24	16.1	62.34	74	-11.66	PK
		2389.42	35.84	16.1	51.94	54	-2.06	AVG
	@	2427	90.87	16.12	106.99	N/A	N/A	PK
	@	2427	82.74	16.12	98.86	N/A	N/A	AVG
	*	4854	41.03	2.68	43.71	74	-30.29	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

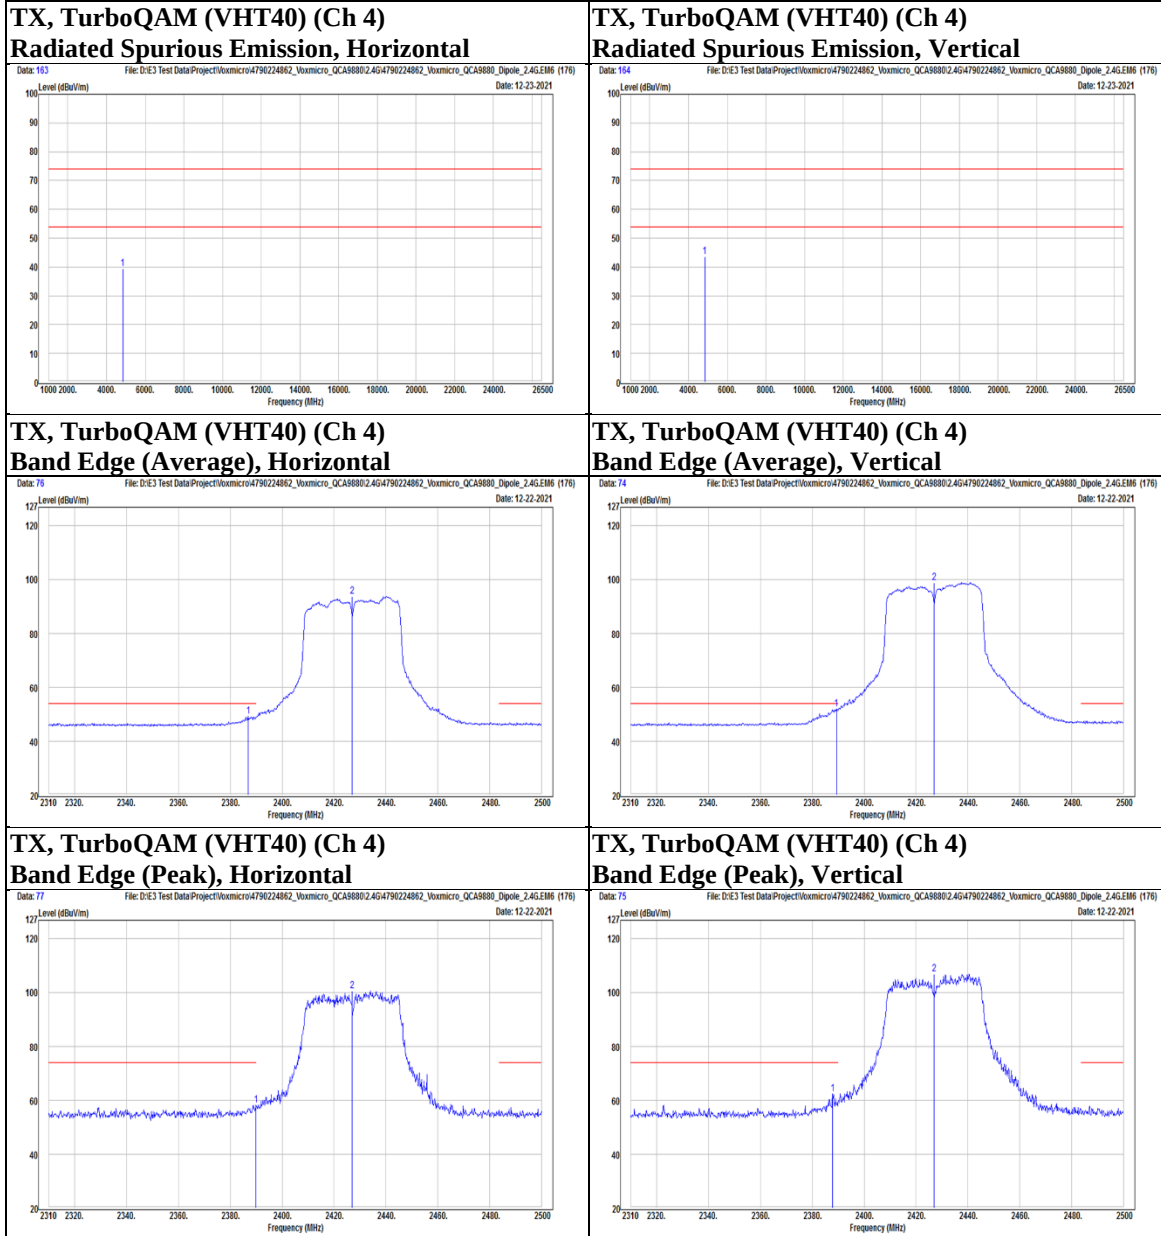



Test report No. : 4790224862-US-R0-V0
Page : 206 of 254
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	TurboQAM (VHT40)	Channel	6
------	------------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2361.3	41.63	16.05	57.68	74	-16.32	PK
		2389.42	33.18	16.1	49.28	54	-4.72	AVG
	@	2437	88.08	16.12	104.2	N/A	N/A	PK
	@	2437	80.84	16.12	96.96	N/A	N/A	AVG
		2483.66	41.35	16.1	57.45	74	-16.55	PK
		2483.66	32.4	16.1	48.5	54	-5.5	AVG
	*	4874	37.53	2.66	40.19	74	-33.81	PK
Vertical		2389.04	46.65	16.1	62.75	74	-11.25	PK
		2389.99	35.68	16.1	51.78	54	-2.22	AVG
	@	2437	94.24	16.12	110.36	N/A	N/A	PK
	@	2437	86.02	16.12	102.14	N/A	N/A	AVG
		2484.23	36.83	16.1	52.93	54	-1.07	AVG
		2485.37	46.03	16.1	62.13	74	-11.87	PK
	*	4874	48.65	2.66	51.31	74	-22.69	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0