



### 11A\_Ant1\_5180

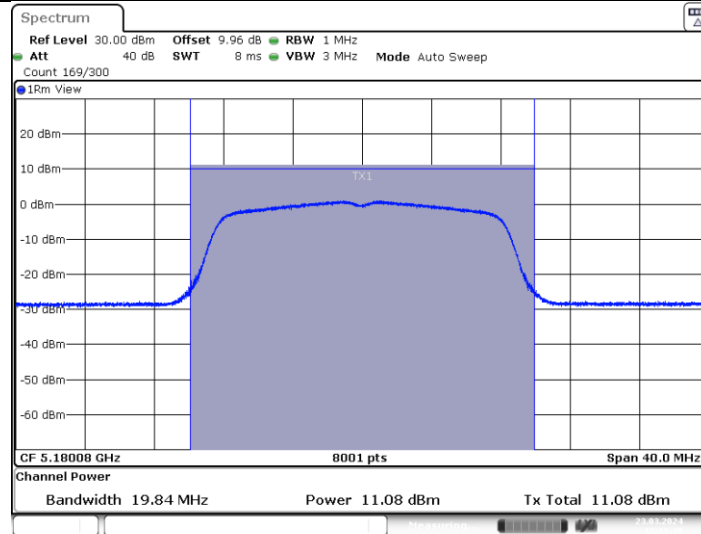


Date: 23.MAR.2024 12:13:30

### 11A\_Ant1\_5200

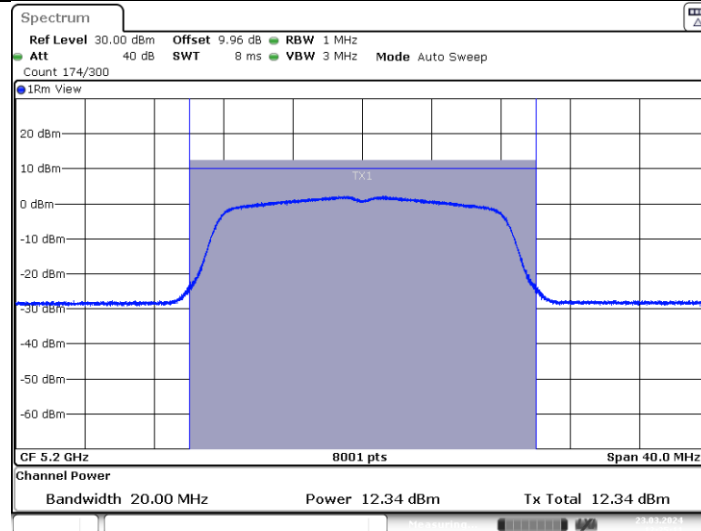


Date: 23.MAR.2024 12:25:11

### 11A\_Ant1\_5240

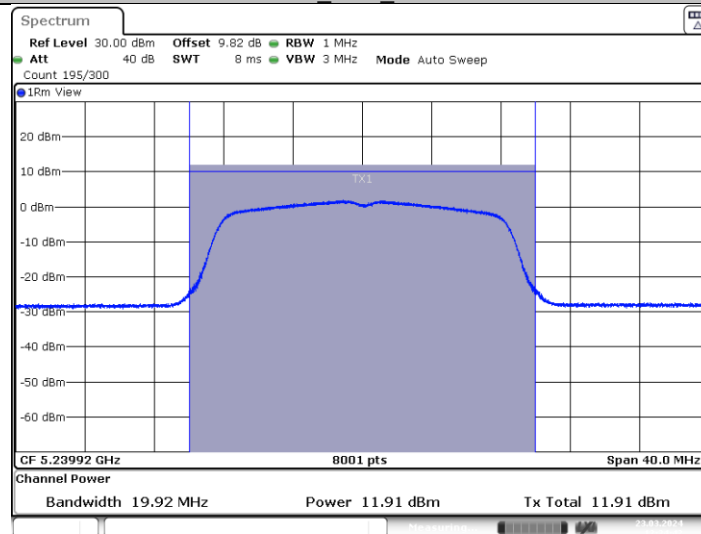


Date: 23.MAR.2024 12:34:42


### 11A\_Ant1\_5260

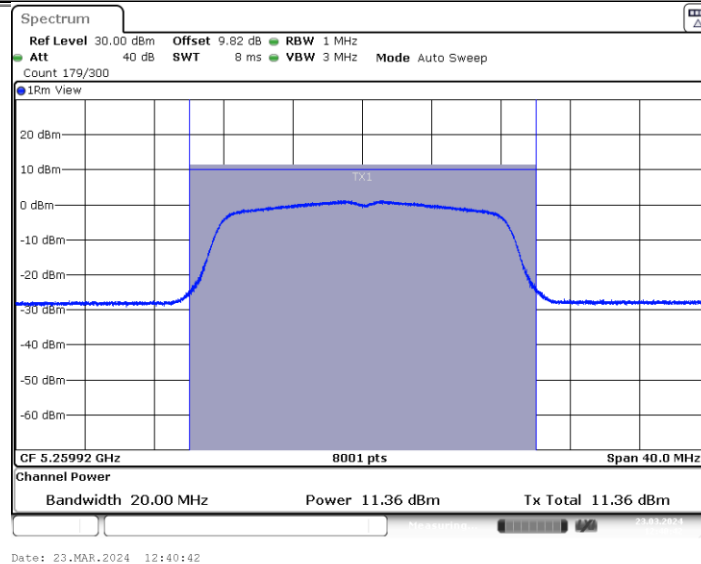


11A\_Ant1\_5280

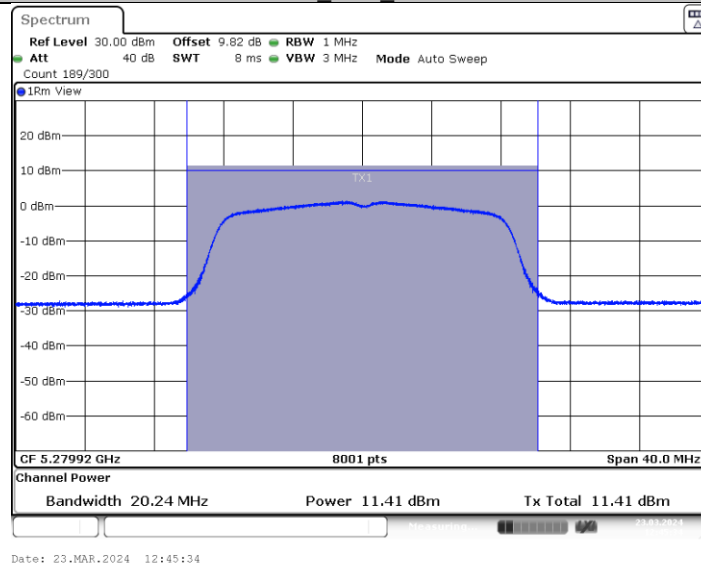


11A\_Ant1\_5320

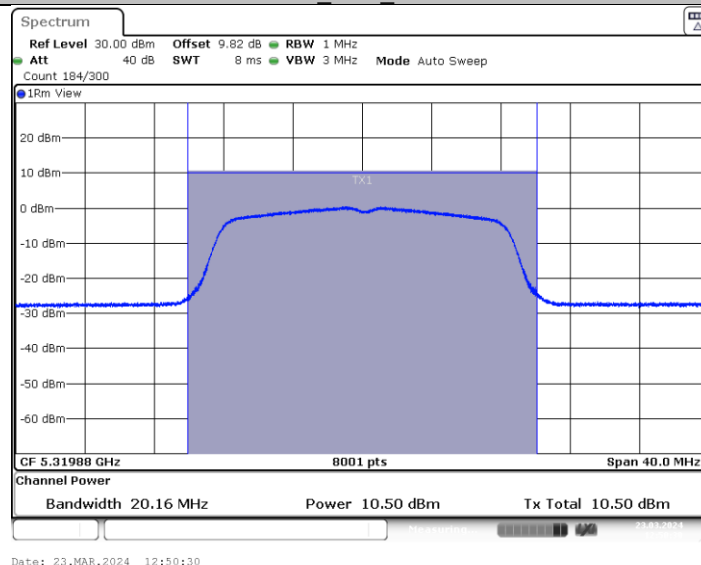


11A\_Ant1\_5500

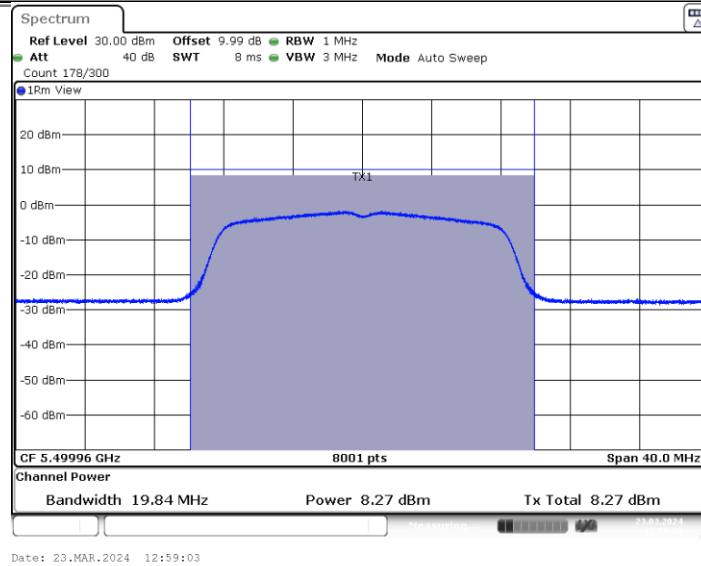


11A\_Ant1\_5580

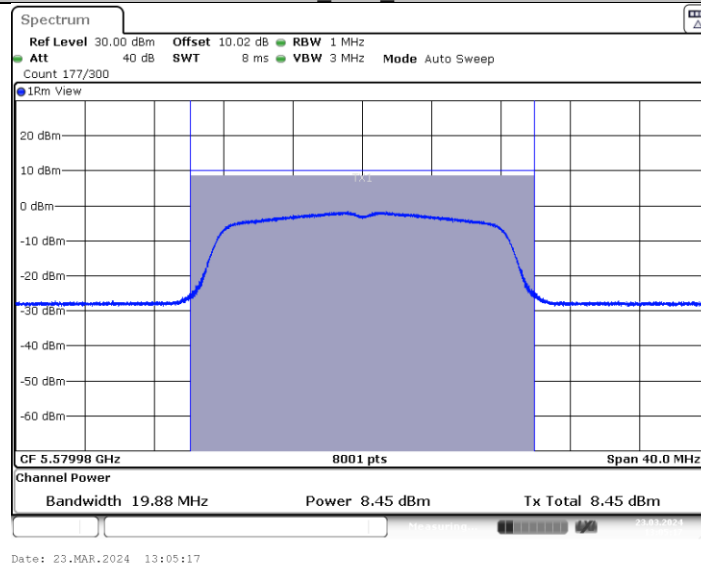


11A\_Ant1\_5700

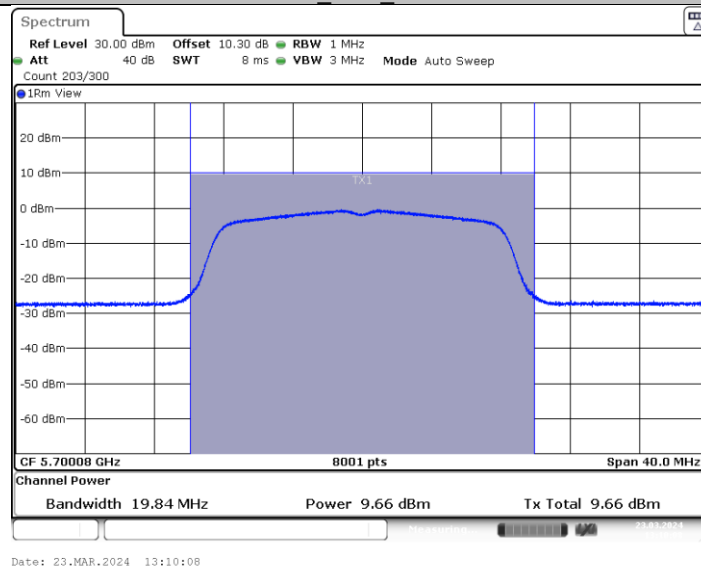


11A\_Ant1\_5745

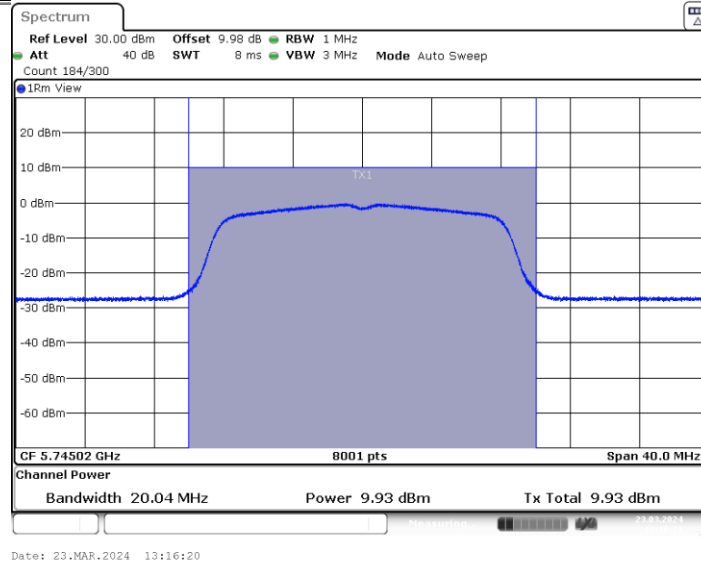


11A\_Ant1\_5785

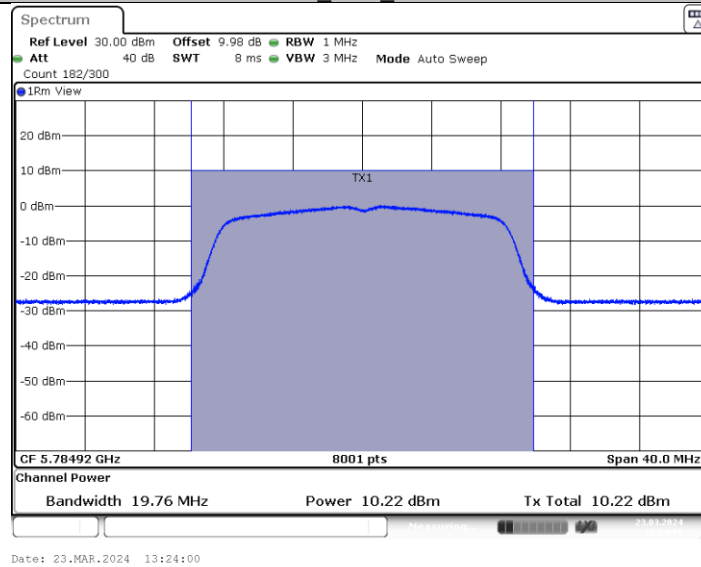


11A\_Ant1\_5825

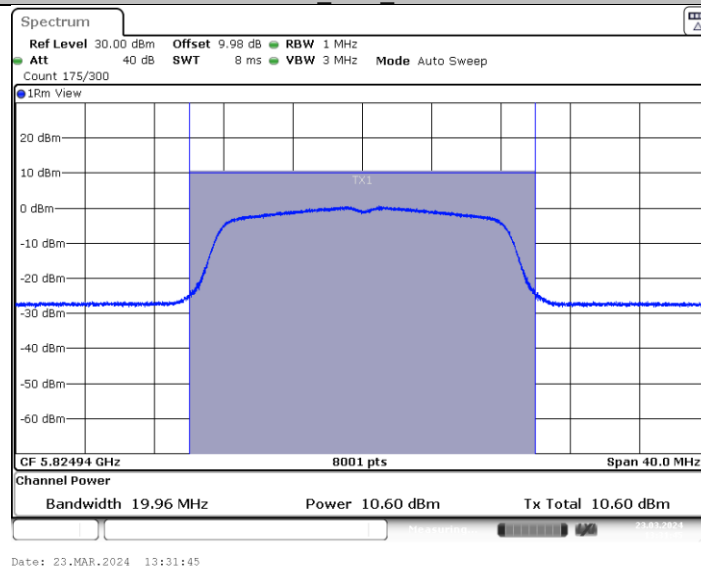


11N20SISO\_Ant1\_5180

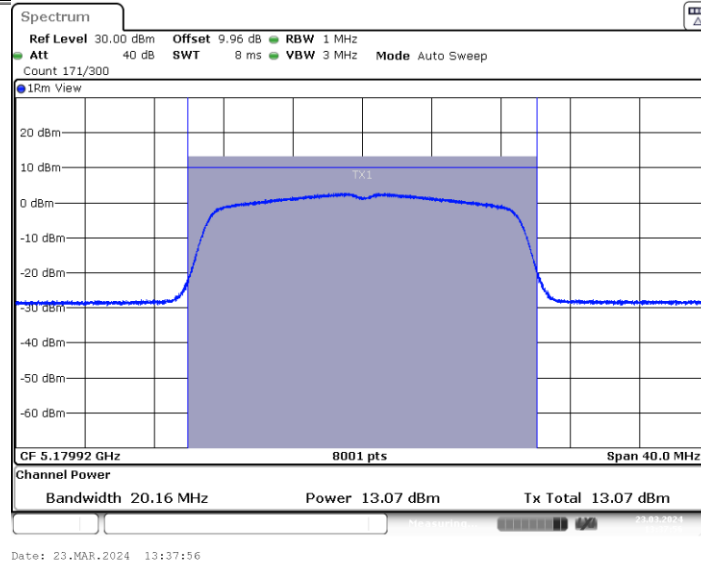


11N20SISO\_Ant1\_5200

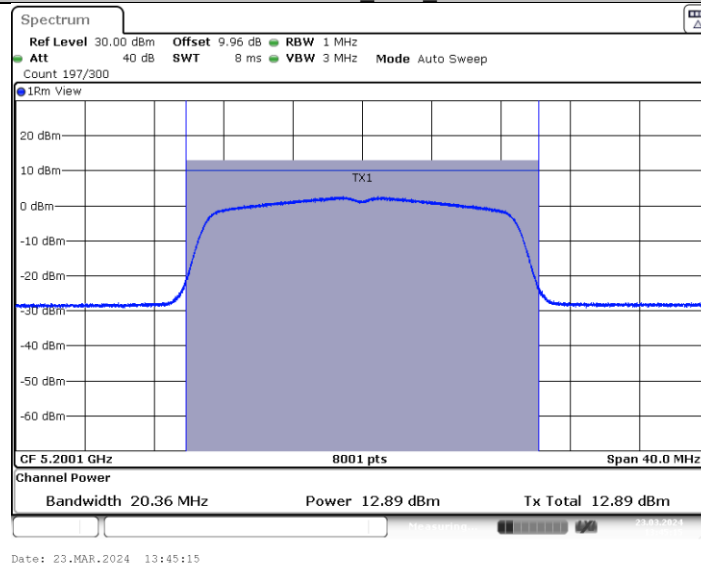


11N20SISO\_Ant1\_5240

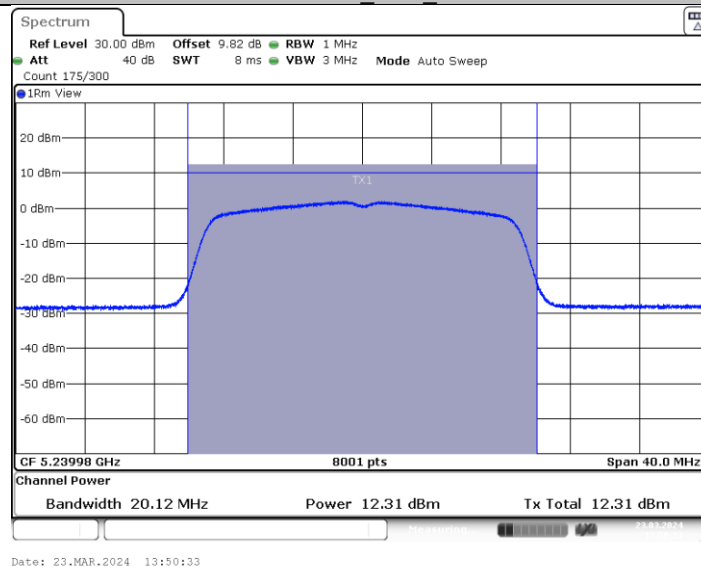


11N20SISO\_Ant1\_5260

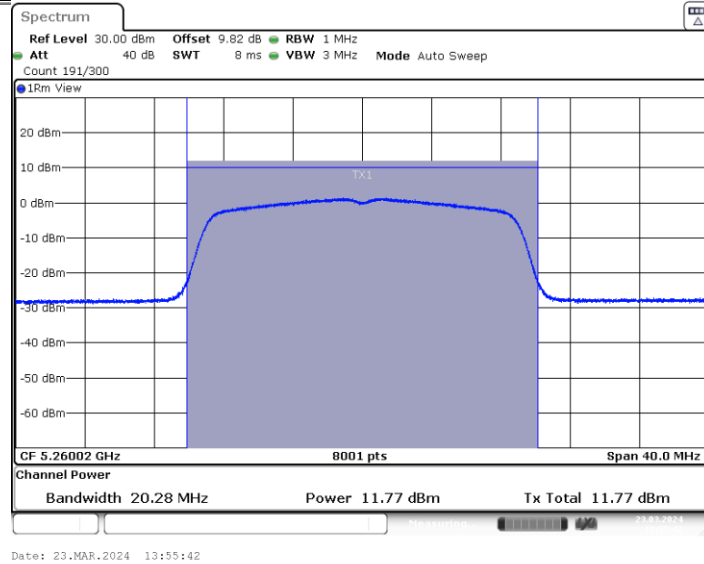


11N20SISO\_Ant1\_5280

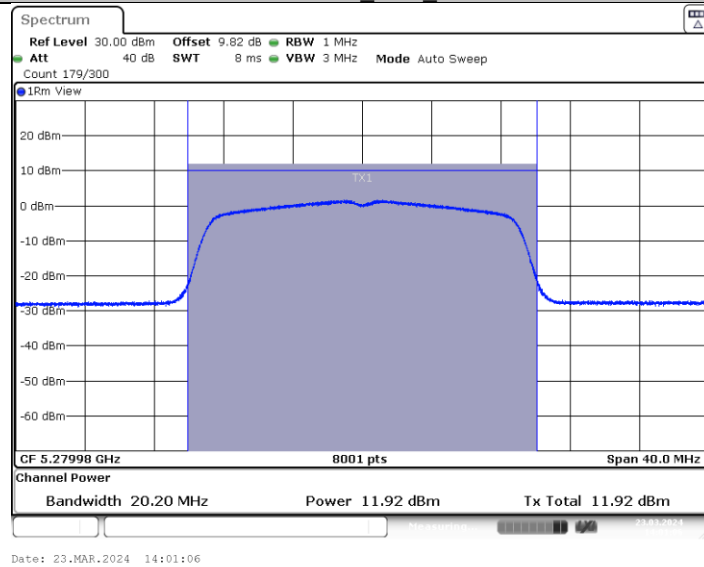


11N20SISO\_Ant1\_5320

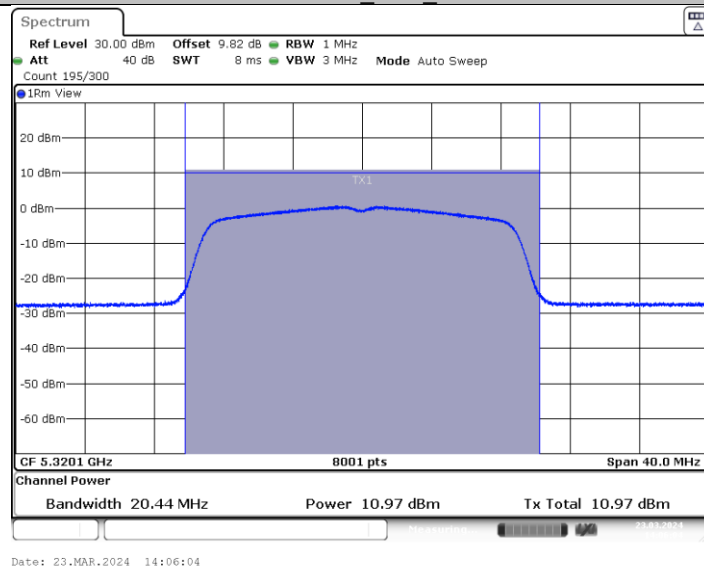


11N20SISO\_Ant1\_5500

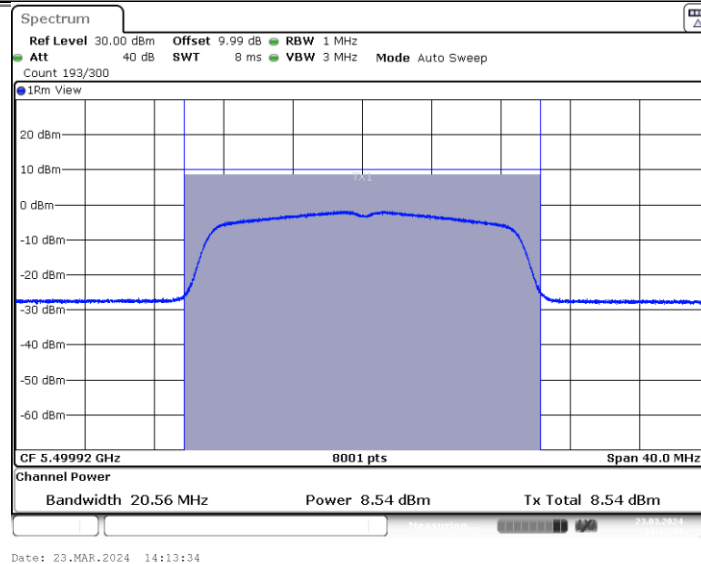


11N20SISO\_Ant1\_5580

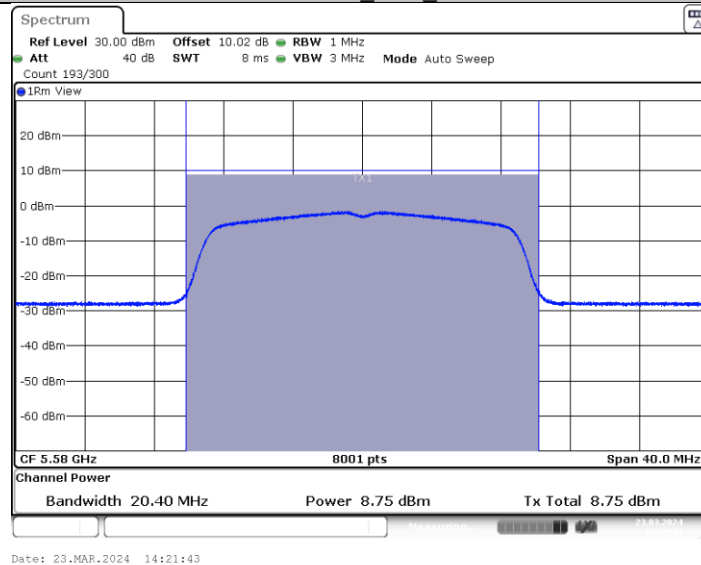


11N20SISO\_Ant1\_5700

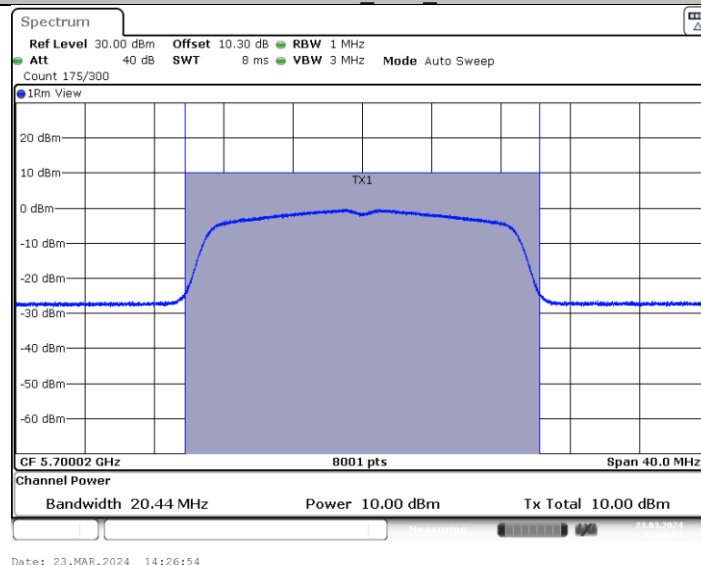


11N20SISO\_Ant1\_5745

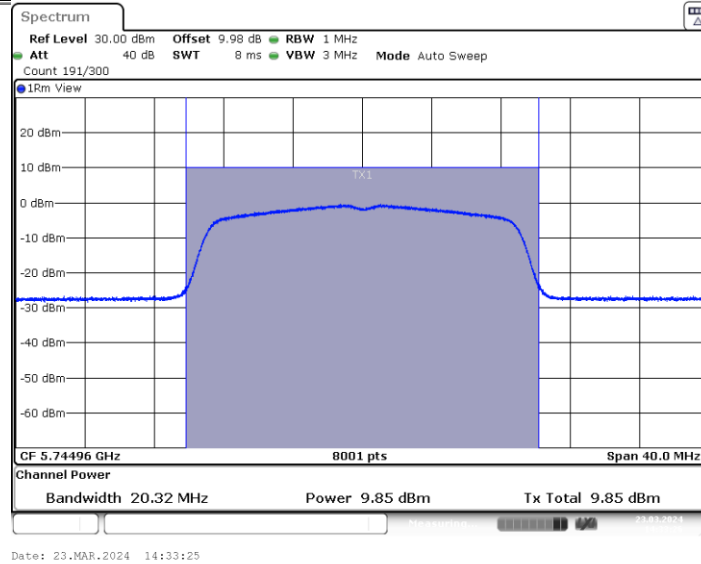


11N20SISO\_Ant1\_5785

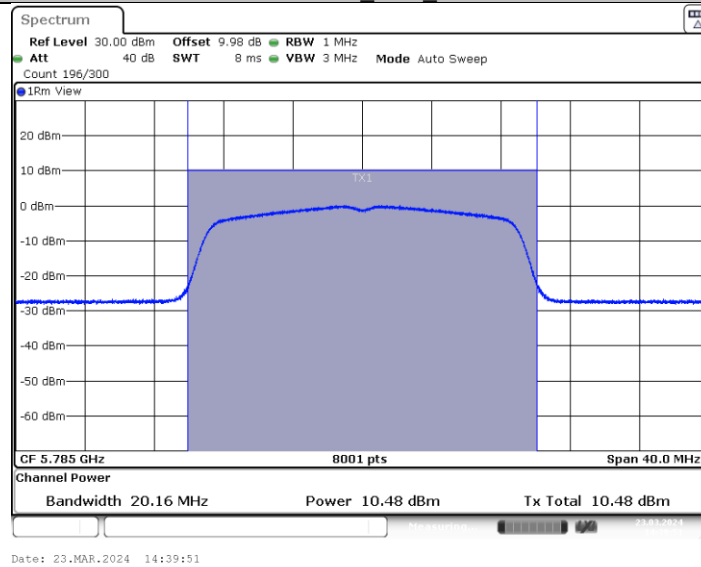


11N20SISO\_Ant1\_5825

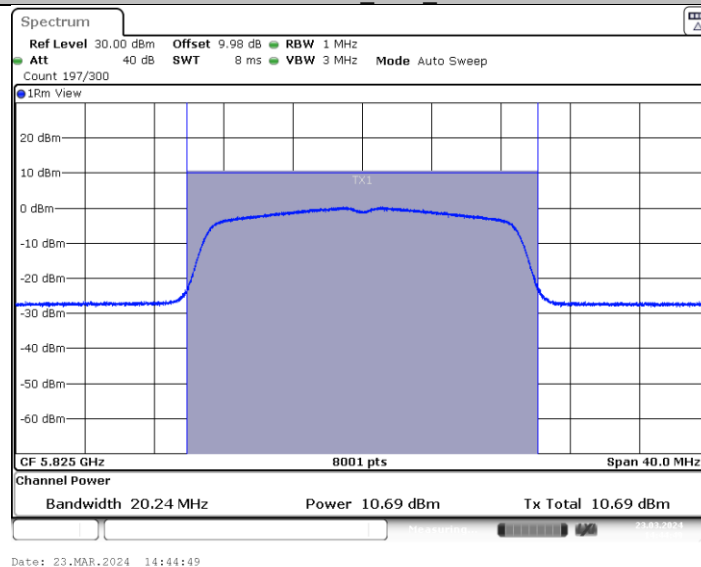


11N40SISO\_Ant1\_5190

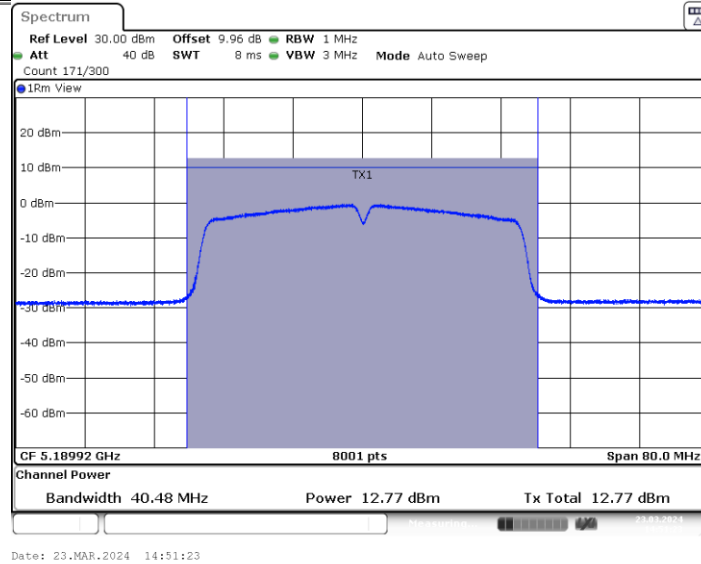


11N40SISO\_Ant1\_5230

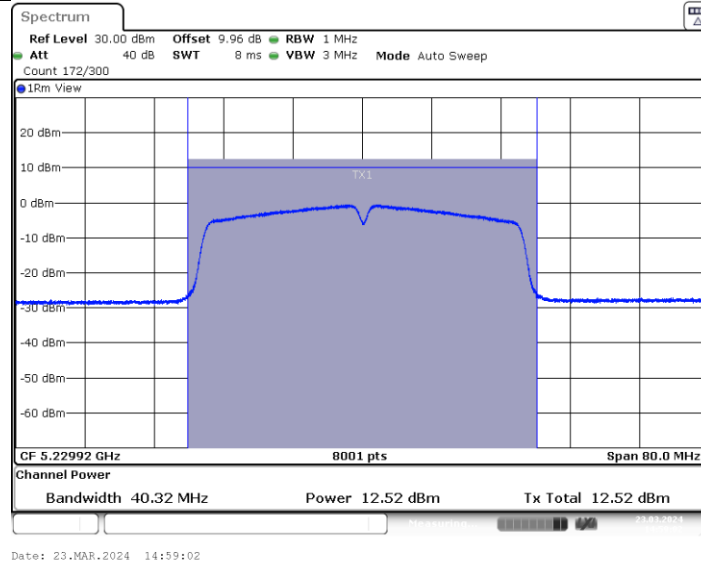


11N40SISO\_Ant1\_5270

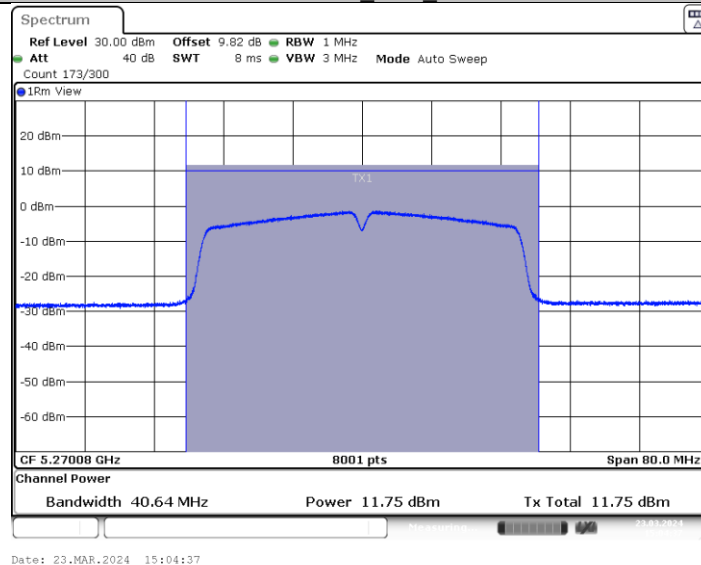


11N40SISO\_Ant1\_5310

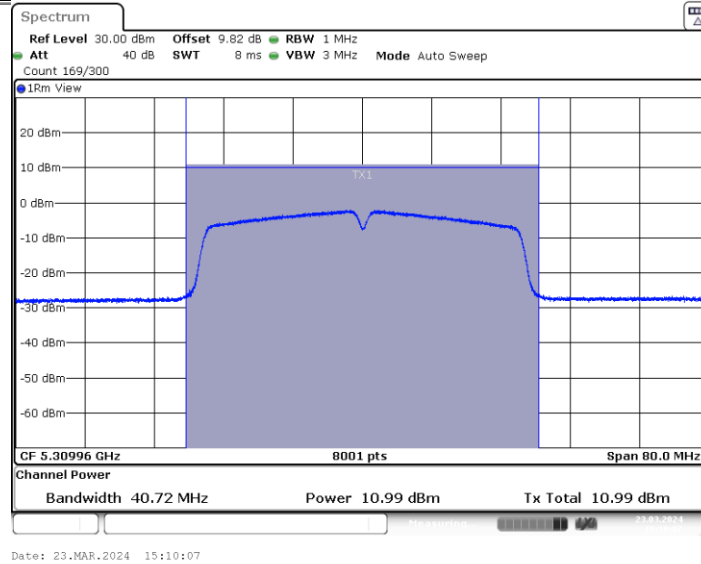


11N40SISO\_Ant1\_5510

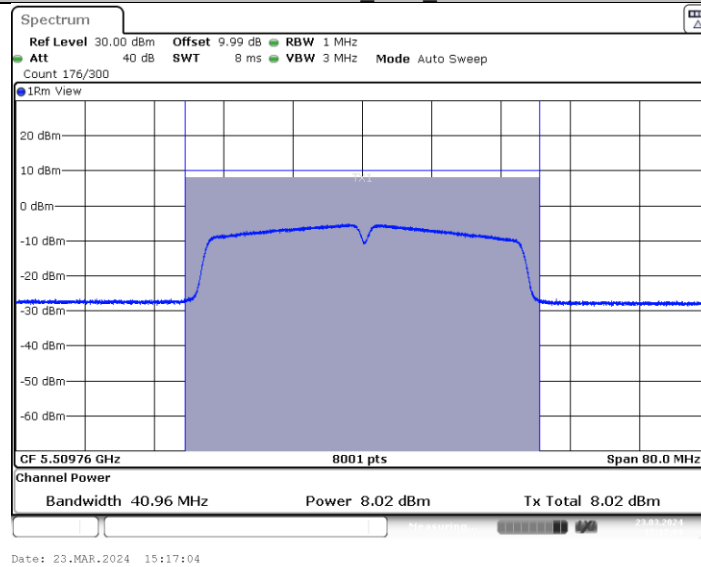


11N40SISO\_Ant1\_5550

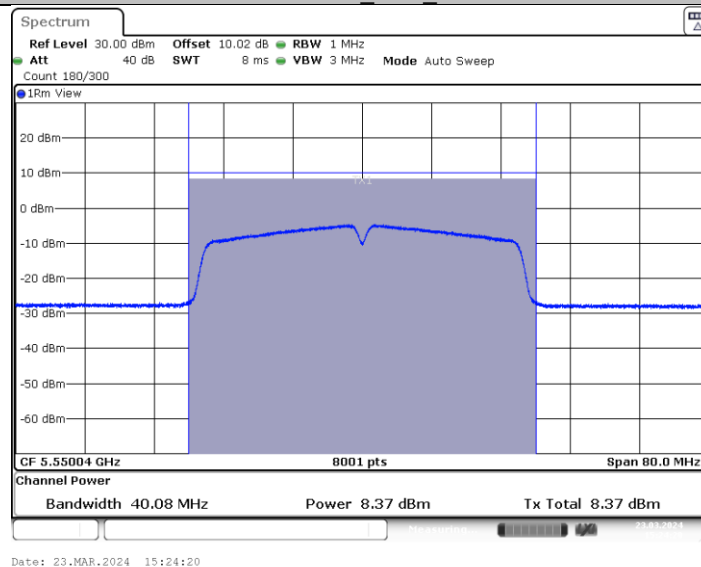


11N40SISO\_Ant1\_5670

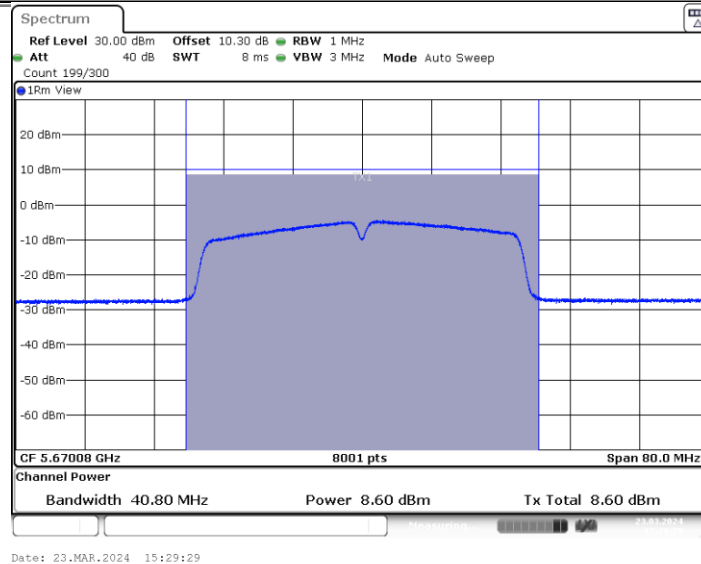


11N40SISO\_Ant1\_5755

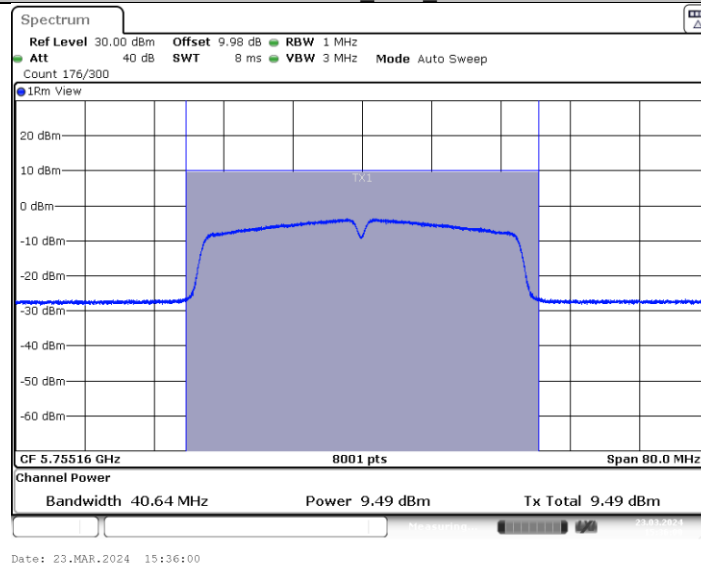


11N40SISO\_Ant1\_5795

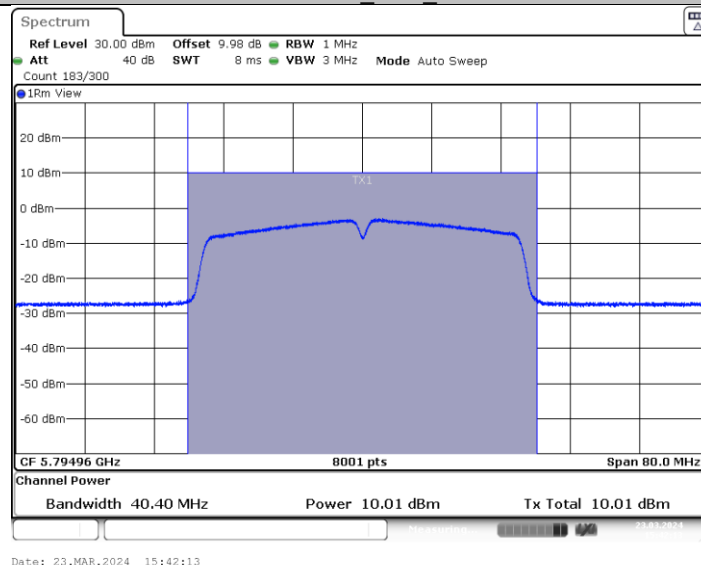


11AC20SISO\_Ant1\_5180

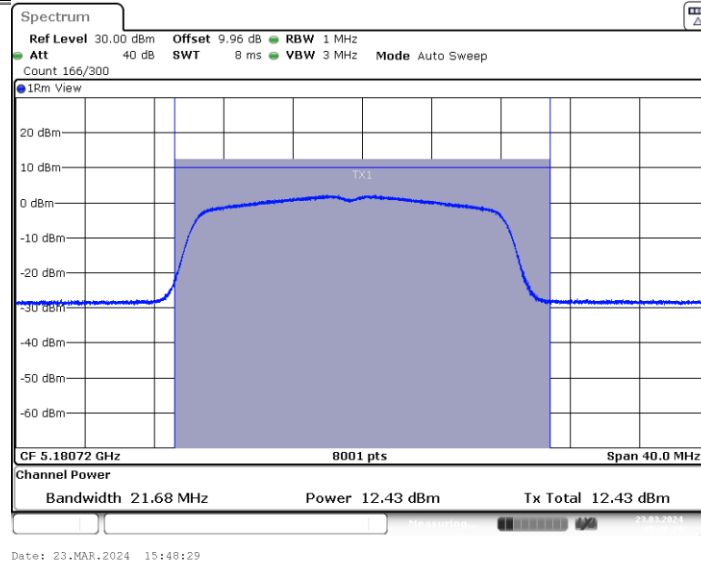


11AC20SISO\_Ant1\_5200

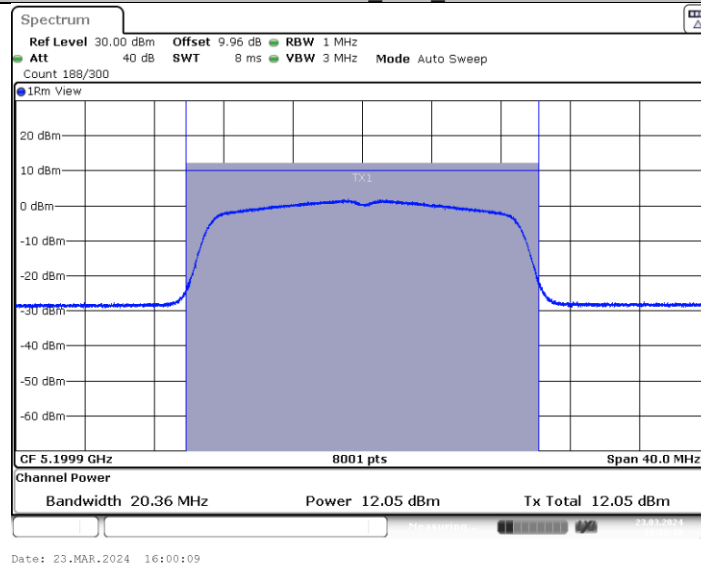


11AC20SISO\_Ant1\_5240

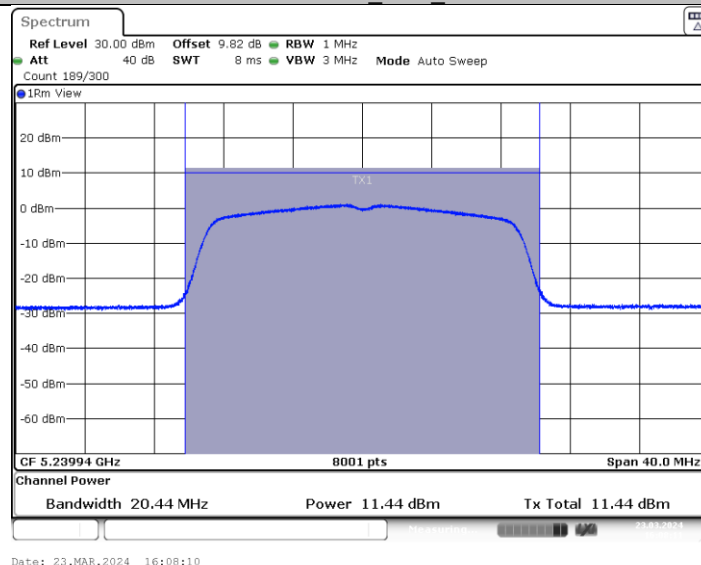


11AC20SISO\_Ant1\_5260

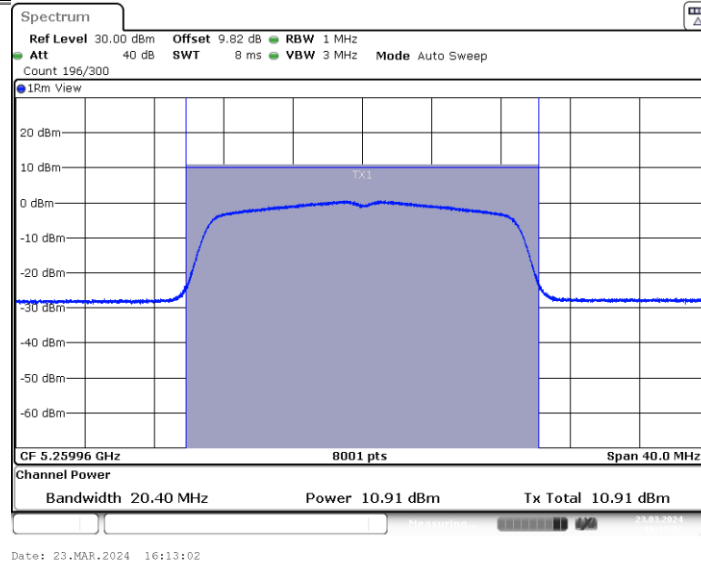


11AC20SISO\_Ant1\_5280

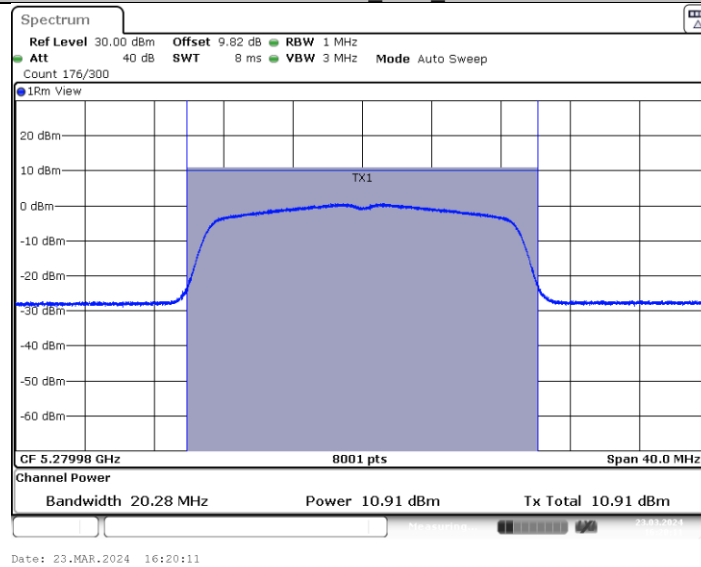


11AC20SISO\_Ant1\_5320

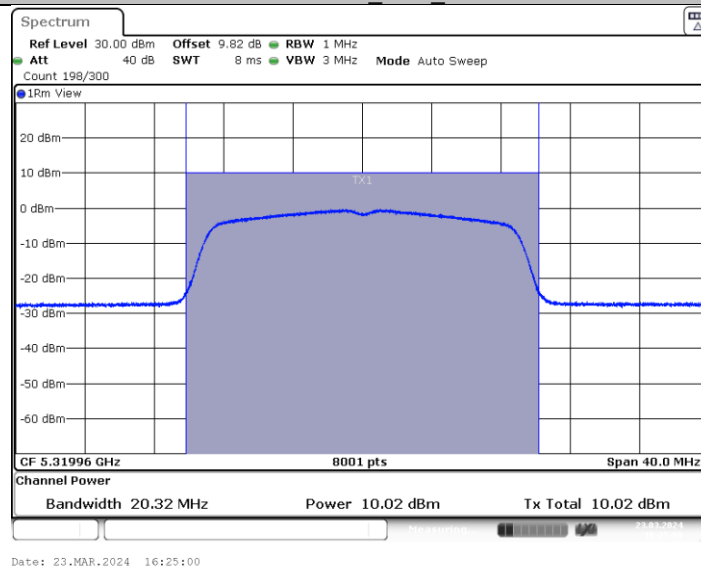


11AC20SISO\_Ant1\_5500

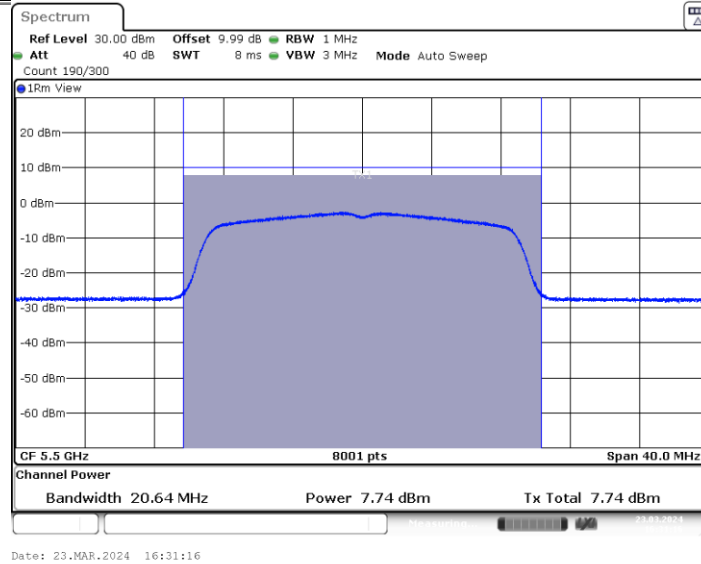


### 11AC20SISO\_Ant1\_5580

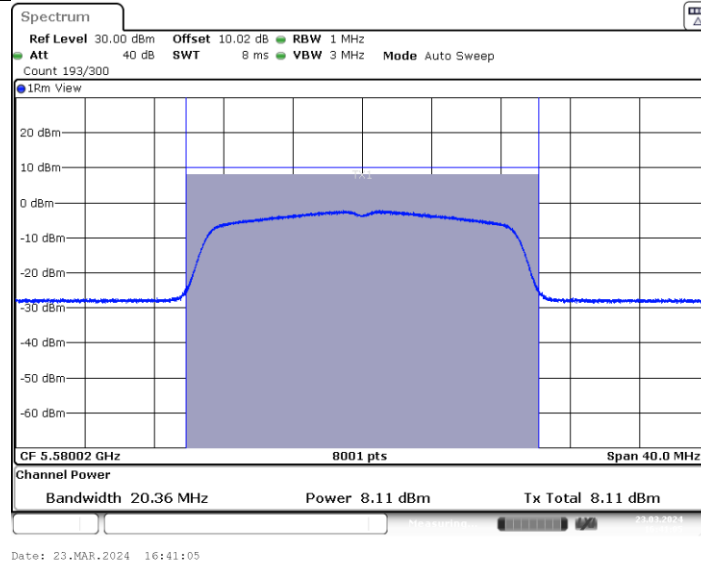


### 11AC20SISO\_Ant1\_5700

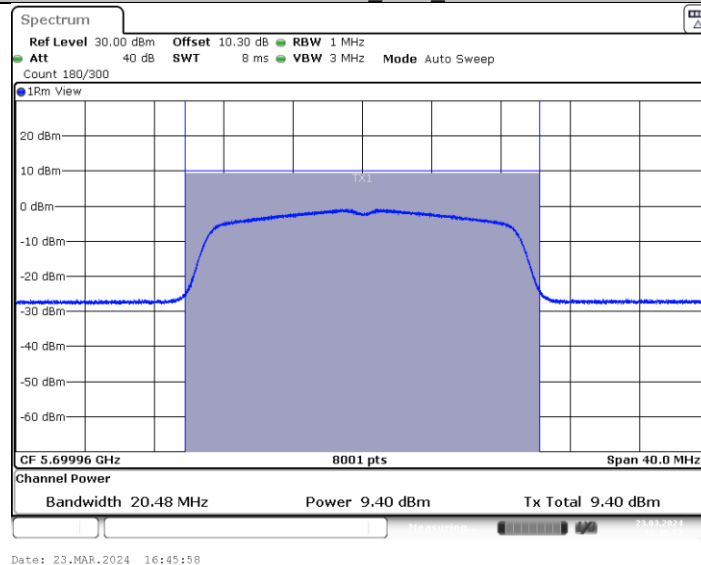


### 11AC20SISO\_Ant1\_5745

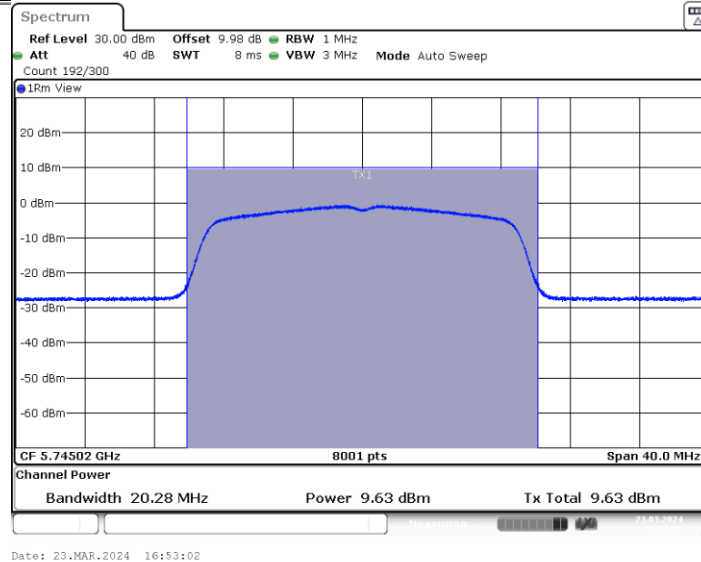


11AC20SISO\_Ant1\_5785

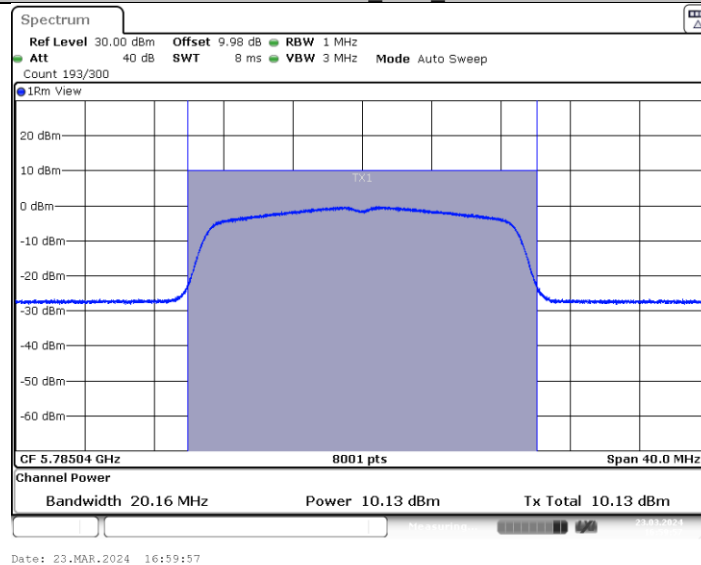


11AC20SISO\_Ant1\_5825

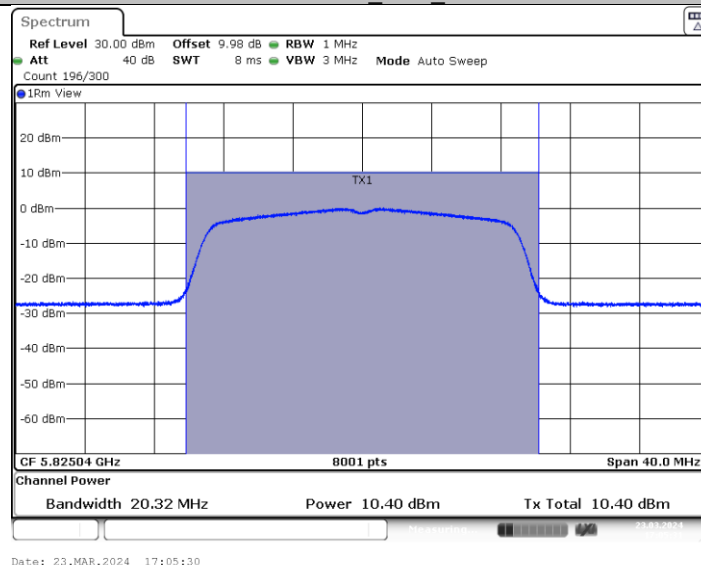


11AC40SISO\_Ant1\_5190

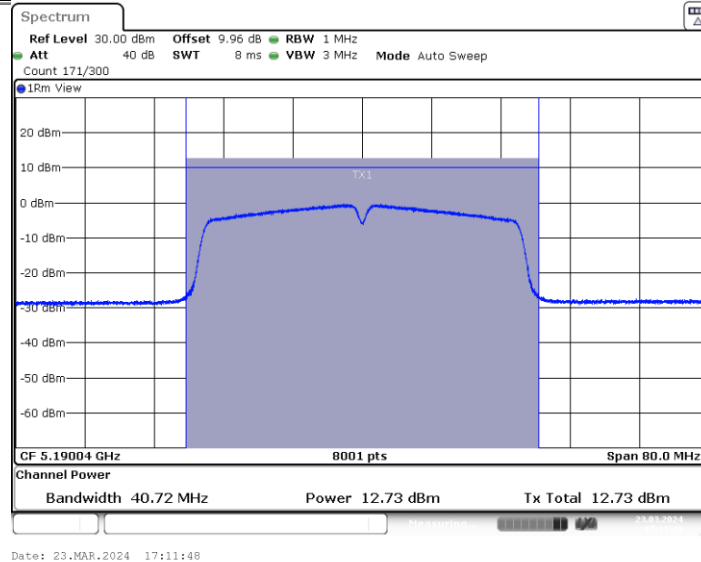


### 11AC40SISO\_Ant1\_5230

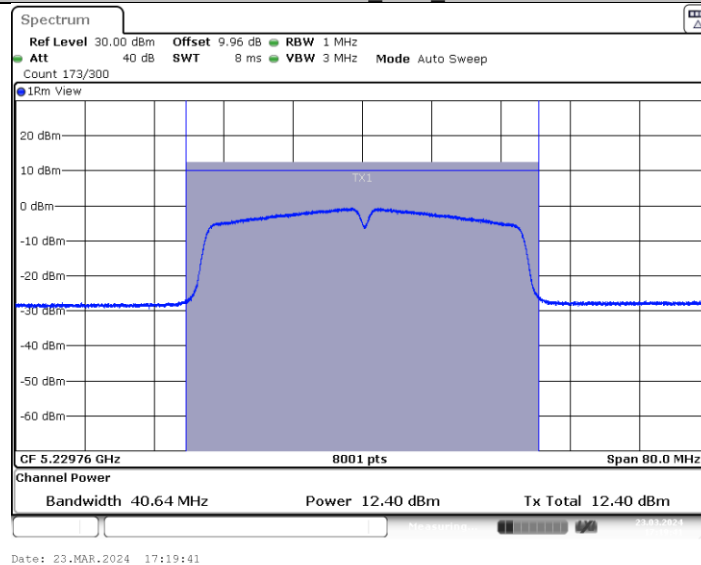


### 11AC40SISO\_Ant1\_5270

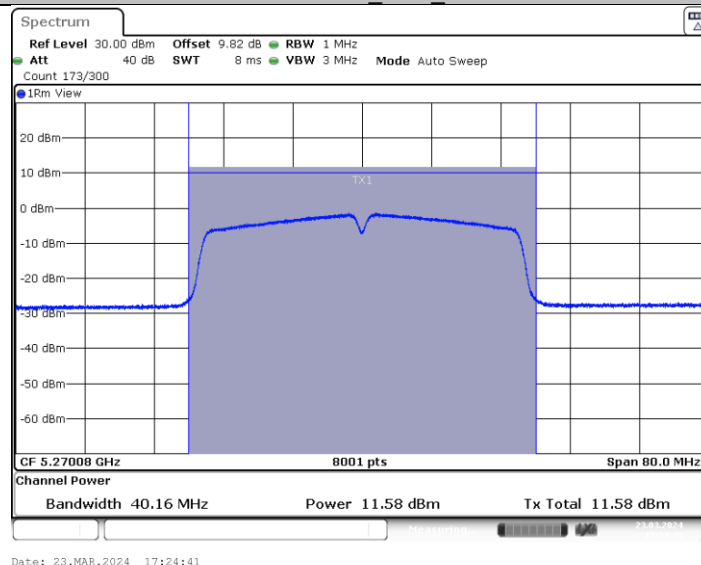


### 11AC40SISO\_Ant1\_5310

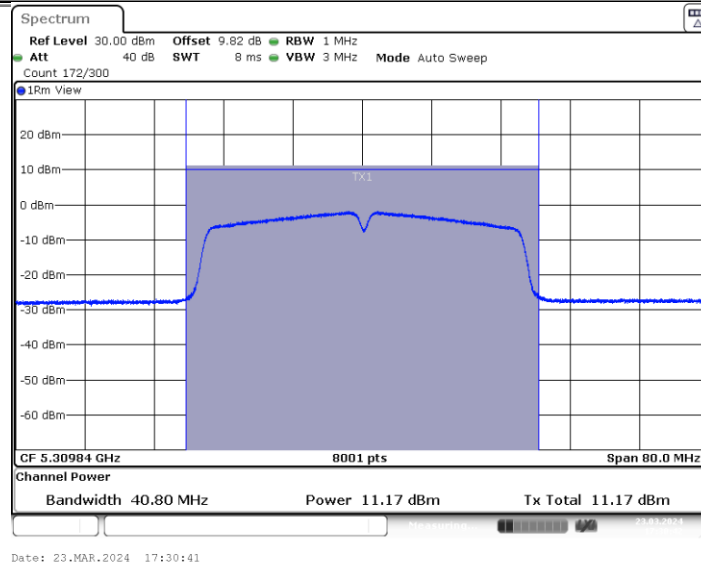


11AC40SISO\_Ant1\_5510

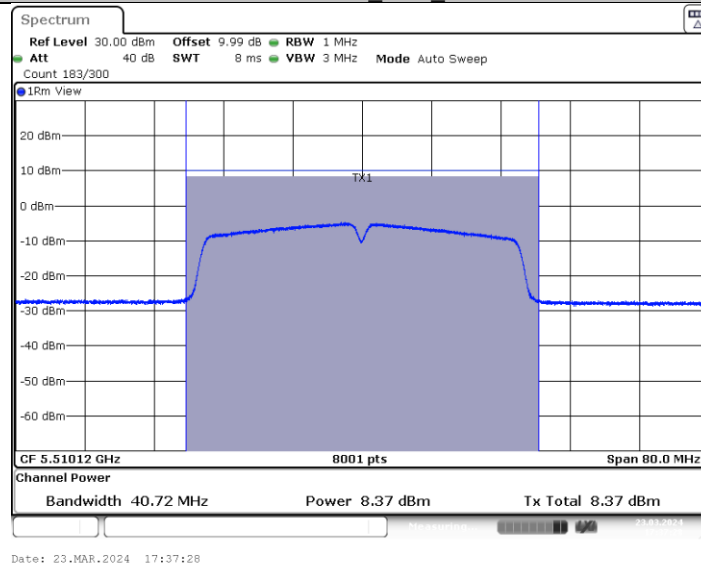


11AC40SISO\_Ant1\_5550

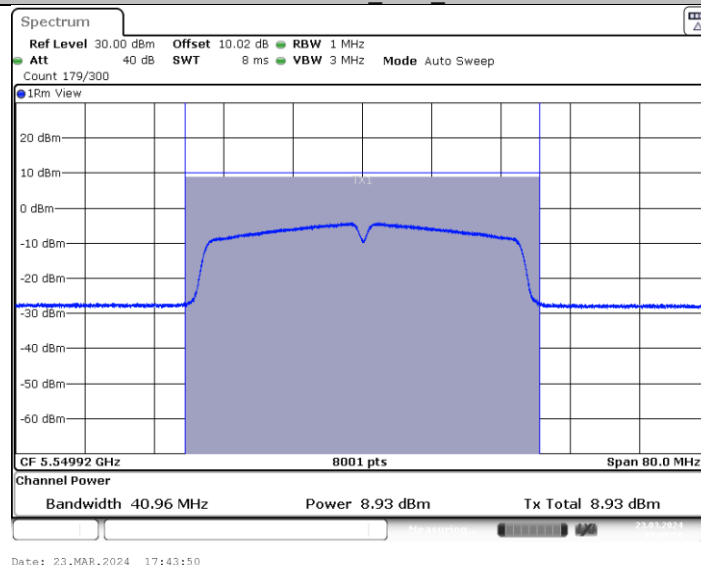


11AC40SISO\_Ant1\_5670

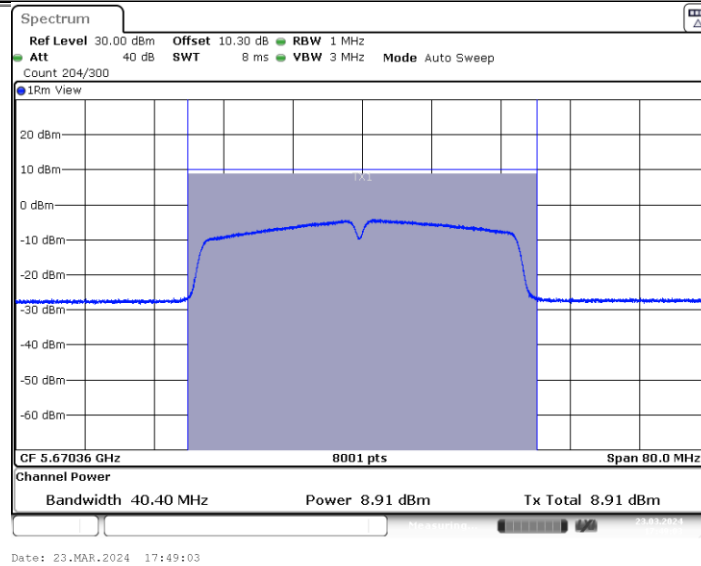


11AC40SISO\_Ant1\_5755

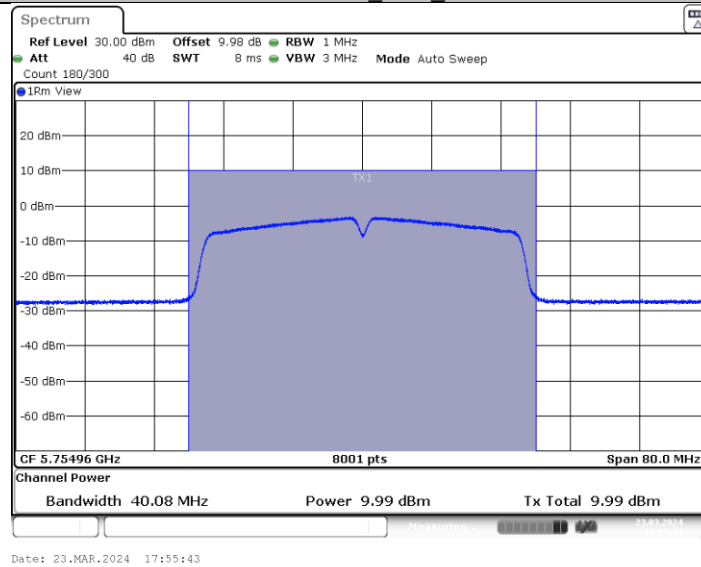


11AC40SISO\_Ant1\_5795

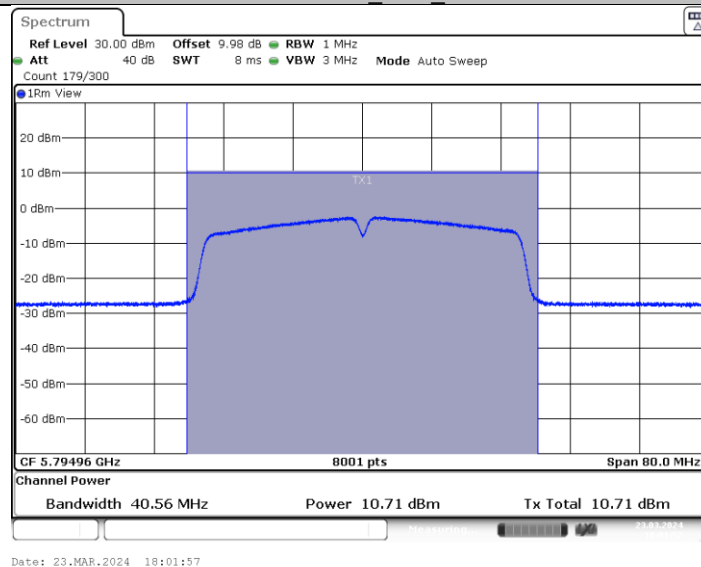


11AC80SISO\_Ant1\_5210

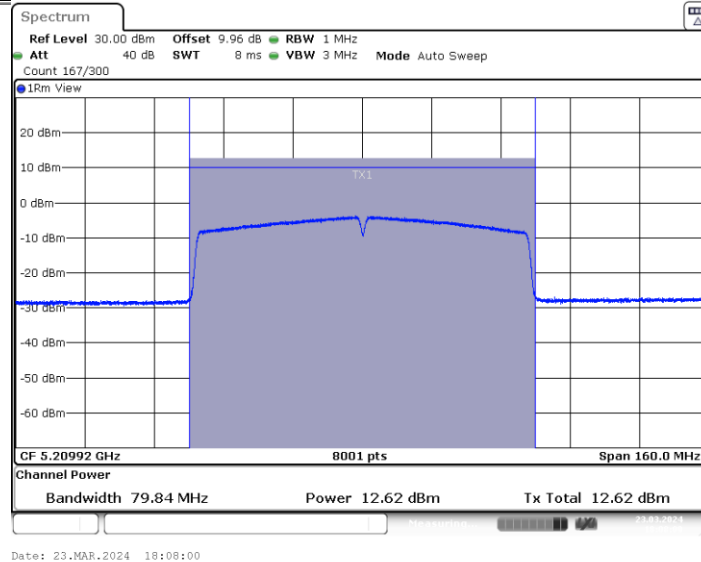


11AC80SISO\_Ant1\_5290

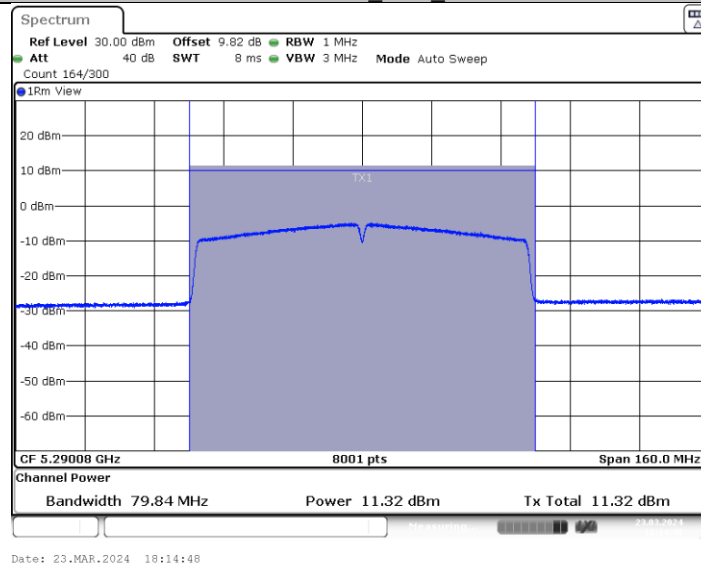


11AC80SISO\_Ant1\_5530

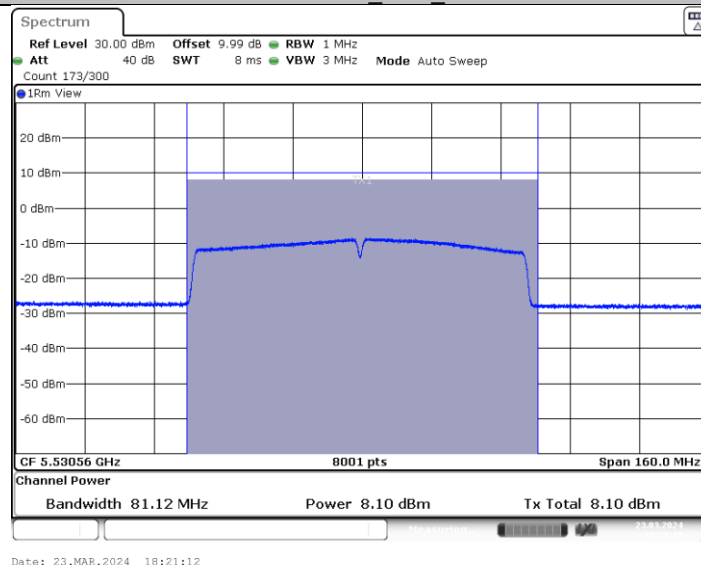

11AC80SISO\_Ant1\_5610

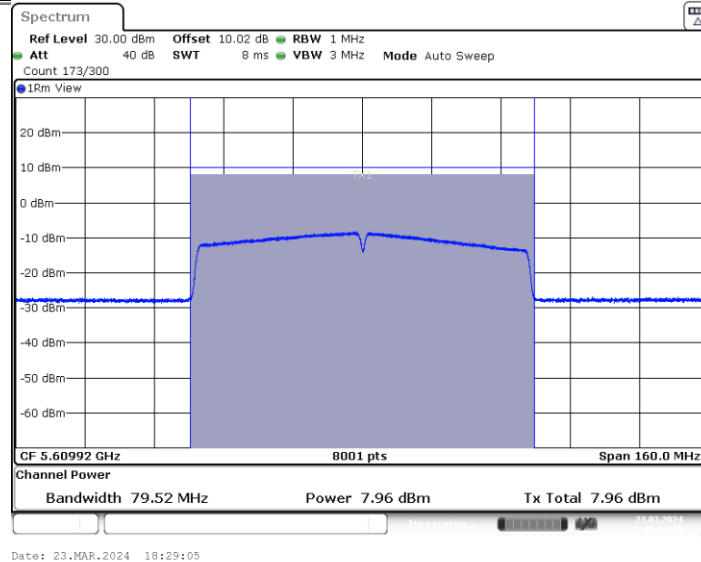

11AC80SISO\_Ant1\_5775

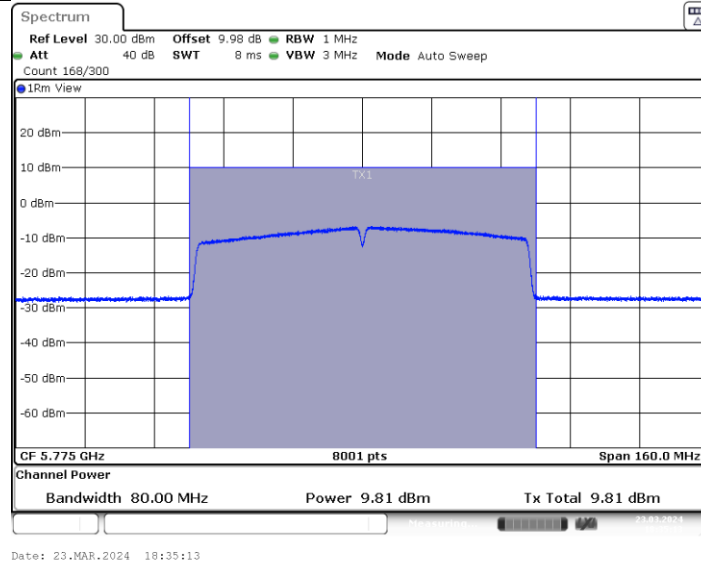


## APPENDIXG - POWER SPECTRAL DENSITY

| TestMode   | Antenna | Freq(MHz) | Result [dBm/MHz] | Limit[dBm/MHz] | Verdict |
|------------|---------|-----------|------------------|----------------|---------|
| 11A        | Ant1    | 5180      | 0.63             | ≤11.00         | PASS    |
|            |         | 5200      | 1.94             | ≤11.00         | PASS    |
|            |         | 5240      | 1.40             | ≤11.00         | PASS    |
|            |         | 5260      | 1.37             | ≤11.00         | PASS    |
|            |         | 5280      | 0.79             | ≤11.00         | PASS    |
|            |         | 5320      | 0.22             | ≤11.00         | PASS    |
|            |         | 5500      | -2.34            | ≤11.00         | PASS    |
|            |         | 5580      | -2.08            | ≤11.00         | PASS    |
|            |         | 5700      | -0.59            | ≤11.00         | PASS    |
|            |         | 5745      | -3.35            | ≤30.00         | PASS    |
|            |         | 5785      | -3.03            | ≤30.00         | PASS    |
|            |         | 5825      | -2.57            | ≤30.00         | PASS    |
| 11N20SISO  | Ant1    | 5180      | 2.35             | ≤11.00         | PASS    |
|            |         | 5200      | 2.14             | ≤11.00         | PASS    |
|            |         | 5240      | 1.96             | ≤11.00         | PASS    |
|            |         | 5260      | 1.00             | ≤11.00         | PASS    |
|            |         | 5280      | 1.48             | ≤11.00         | PASS    |
|            |         | 5320      | 0.26             | ≤11.00         | PASS    |
|            |         | 5500      | -1.95            | ≤11.00         | PASS    |
|            |         | 5580      | -2.15            | ≤11.00         | PASS    |
|            |         | 5700      | -0.19            | ≤11.00         | PASS    |
|            |         | 5745      | -3.44            | ≤30.00         | PASS    |
|            |         | 5785      | -3.11            | ≤30.00         | PASS    |
|            |         | 5825      | -2.53            | ≤30.00         | PASS    |
| 11N40SISO  | Ant1    | 5190      | -0.46            | ≤11.00         | PASS    |
|            |         | 5230      | -0.65            | ≤11.00         | PASS    |
|            |         | 5270      | -1.39            | ≤11.00         | PASS    |
|            |         | 5310      | -2.17            | ≤11.00         | PASS    |
|            |         | 5510      | -4.73            | ≤11.00         | PASS    |
|            |         | 5550      | -4.88            | ≤11.00         | PASS    |
|            |         | 5670      | -4.25            | ≤11.00         | PASS    |
|            |         | 5755      | -6.36            | ≤30.00         | PASS    |
|            |         | 5795      | -6.17            | ≤30.00         | PASS    |
| 11AC20SISO | Ant1    | 5180      | 2.08             | ≤11.00         | PASS    |
|            |         | 5200      | 1.52             | ≤11.00         | PASS    |
|            |         | 5240      | 0.68             | ≤11.00         | PASS    |
|            |         | 5260      | 0.40             | ≤11.00         | PASS    |
|            |         | 5280      | 0.71             | ≤11.00         | PASS    |
|            |         | 5320      | -0.69            | ≤11.00         | PASS    |
|            |         | 5500      | -2.95            | ≤11.00         | PASS    |
|            |         | 5580      | -2.36            | ≤11.00         | PASS    |
|            |         | 5700      | -1.34            | ≤11.00         | PASS    |
|            |         | 5745      | -3.49            | ≤30.00         | PASS    |
|            |         | 5785      | -3.17            | ≤30.00         | PASS    |
|            |         | 5825      | -3.19            | ≤30.00         | PASS    |
| 11AC40SISO | Ant1    | 5190      | -0.37            | ≤11.00         | PASS    |
|            |         | 5230      | -0.09            | ≤11.00         | PASS    |
|            |         | 5270      | -1.55            | ≤11.00         | PASS    |
|            |         | 5310      | -2.41            | ≤11.00         | PASS    |
|            |         | 5510      | -4.81            | ≤11.00         | PASS    |
|            |         | 5550      | -4.37            | ≤11.00         | PASS    |
|            |         | 5670      | -4.18            | ≤11.00         | PASS    |
|            |         | 5755      | -6.26            | ≤30.00         | PASS    |
|            |         | 5795      | -4.98            | ≤30.00         | PASS    |
| 11AC80SISO | Ant1    | 5210      | -3.73            | ≤11.00         | PASS    |
|            |         | 5290      | -4.46            | ≤11.00         | PASS    |
|            |         | 5530      | -7.96            | ≤11.00         | PASS    |
|            |         | 5610      | -7.99            | ≤11.00         | PASS    |
|            |         | 5775      | -9.37            | ≤30.00         | PASS    |

Note: 1.The Result and Limit Unit is dBm/500 kHz in the band 5.725–5.85 GHz.  
2.The Duty Cycle Factorand RBW Factoriscompensatedinthegraph.


# Test Graphs

11A\_Ant1\_5180

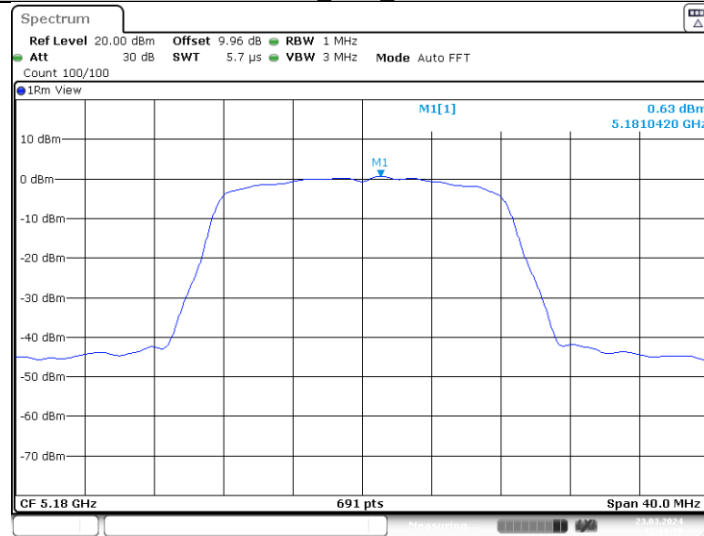


Date: 23.MAR.2024 12:13:39

11A\_Ant1\_5200

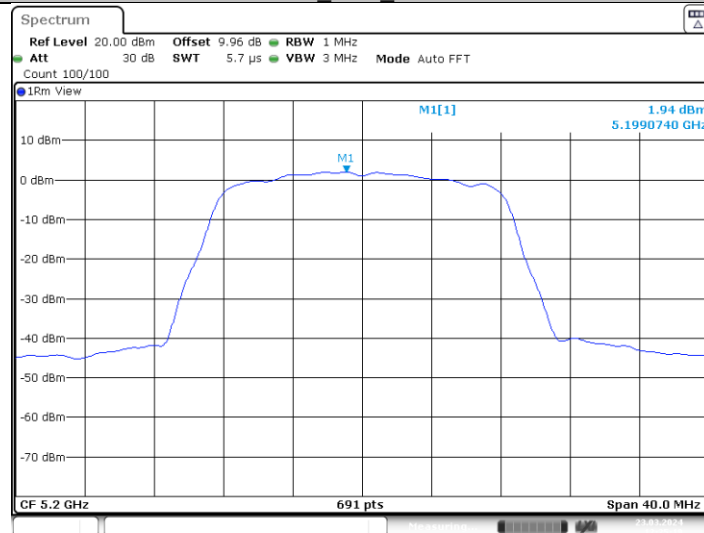


Date: 23.MAR.2024 12:25:20

11A\_Ant1\_5240

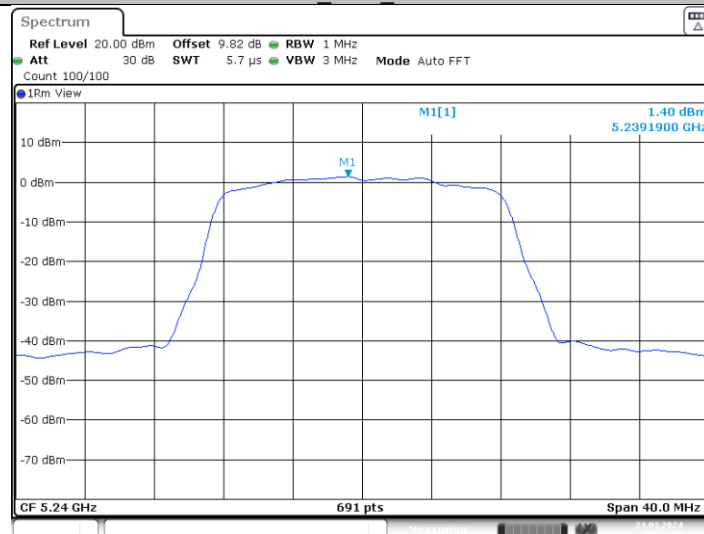


Date: 23.MAR.2024 12:34:51


11A\_Ant1\_5260

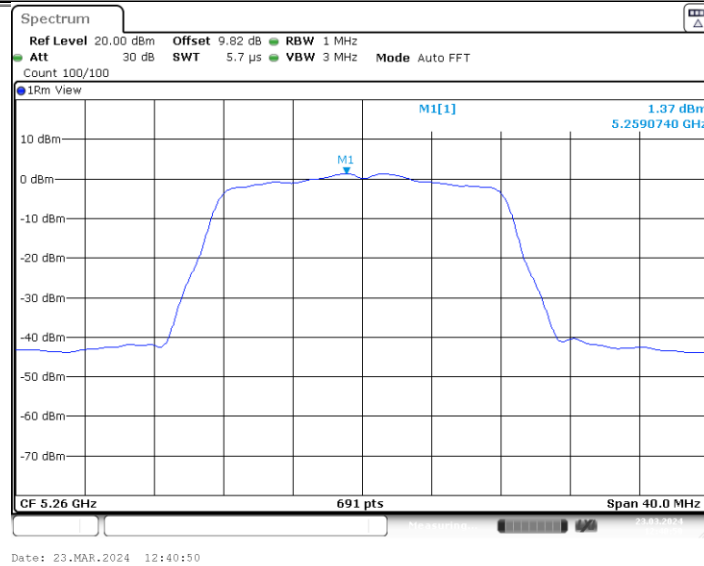


11A\_Ant1\_5280

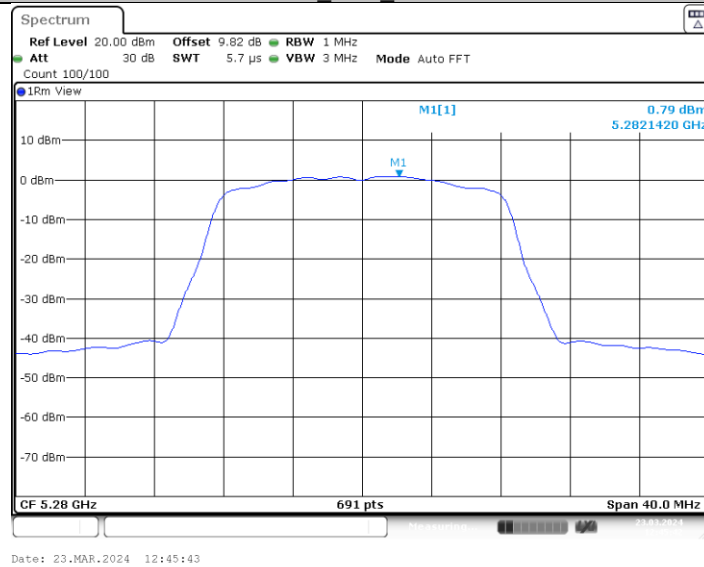

11A\_Ant1\_5320

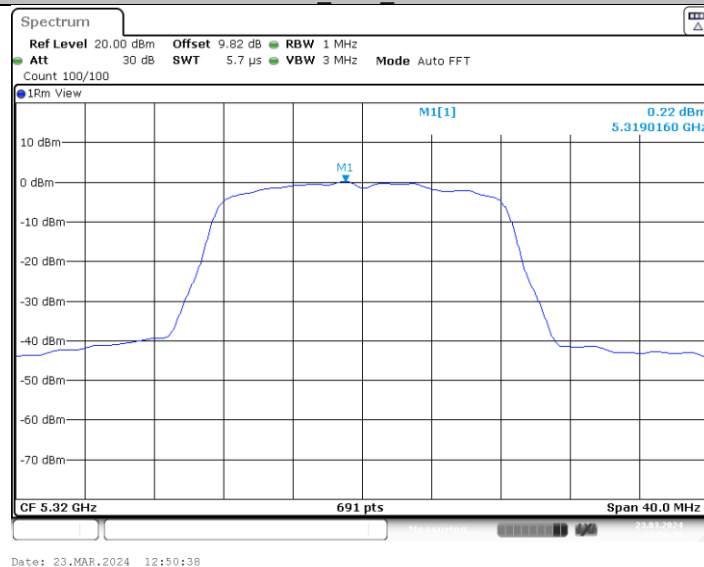


11A\_Ant1\_5500

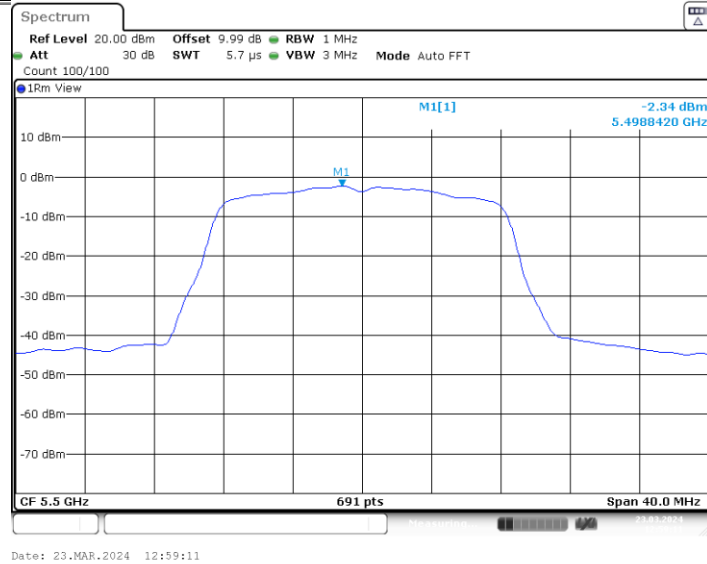


11A\_Ant1\_5580




11A\_Ant1\_5700

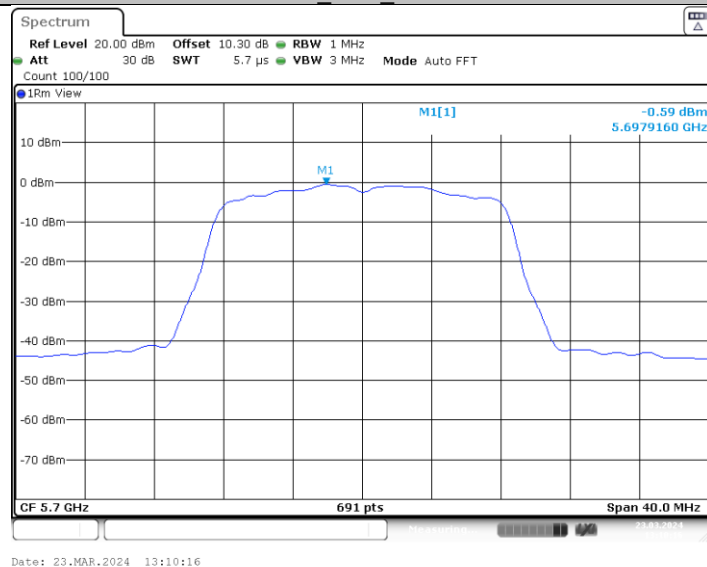

11A\_Ant1\_5745

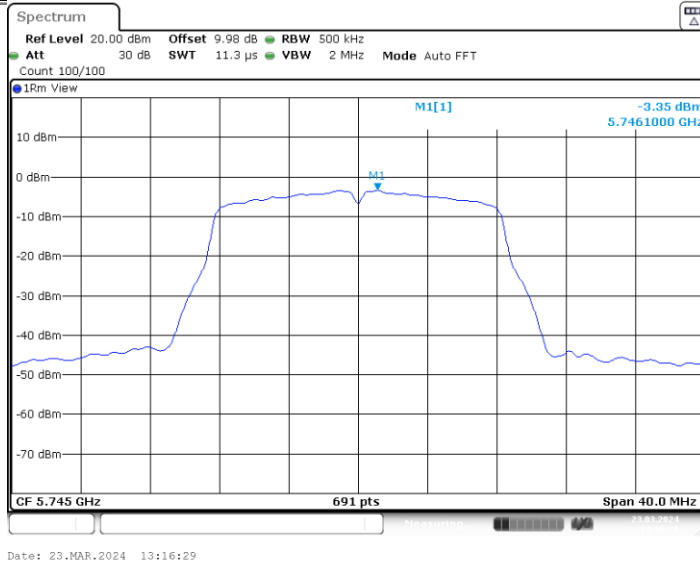


11A\_Ant1\_5785

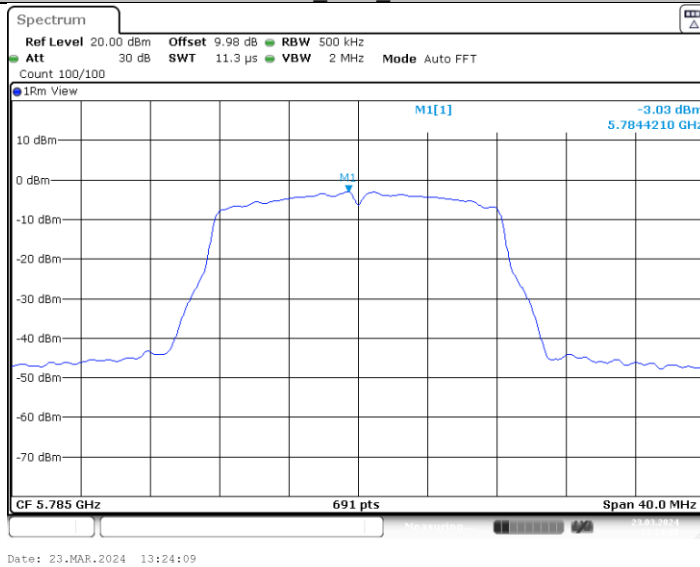


11A\_Ant1\_5825




11N20SISO\_Ant1\_5180

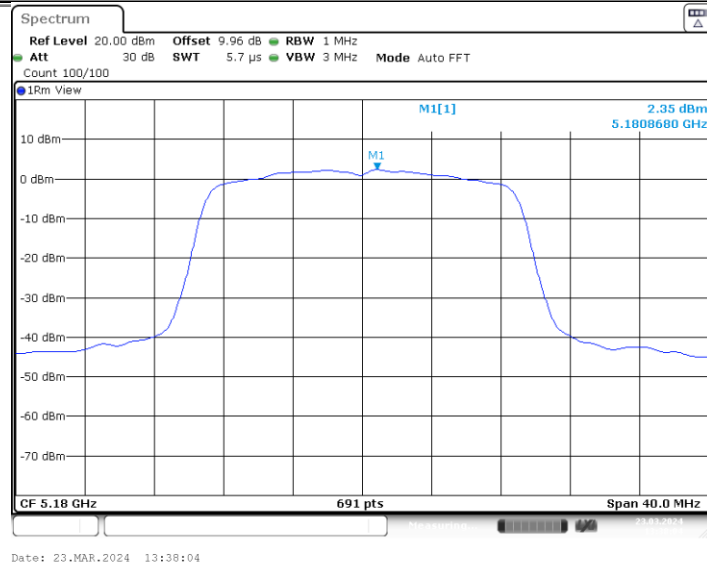


11N20SISO\_Ant1\_5200

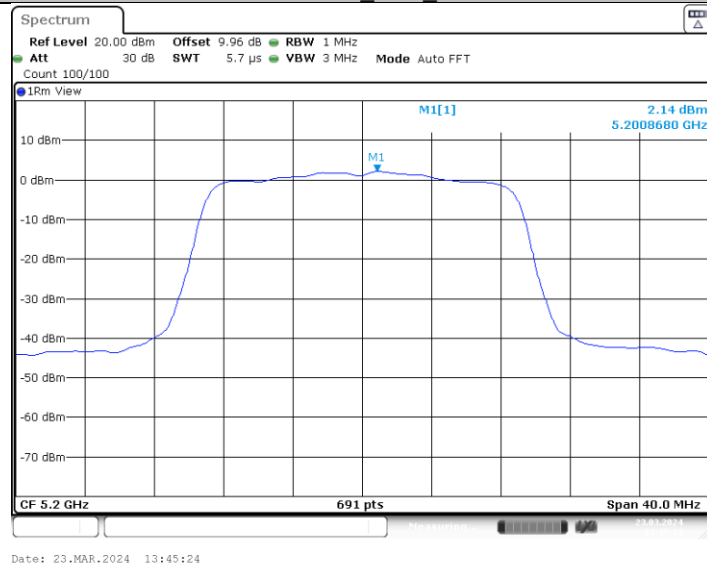


11N20SISO\_Ant1\_5240

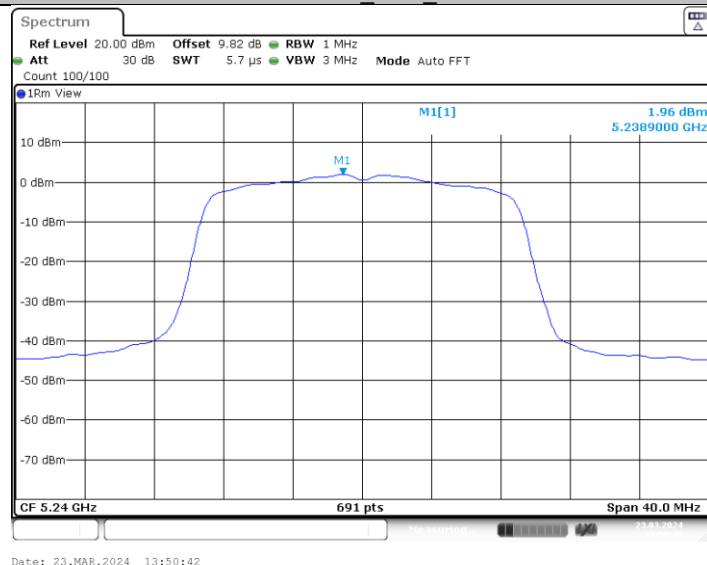


11N20SISO\_Ant1\_5260

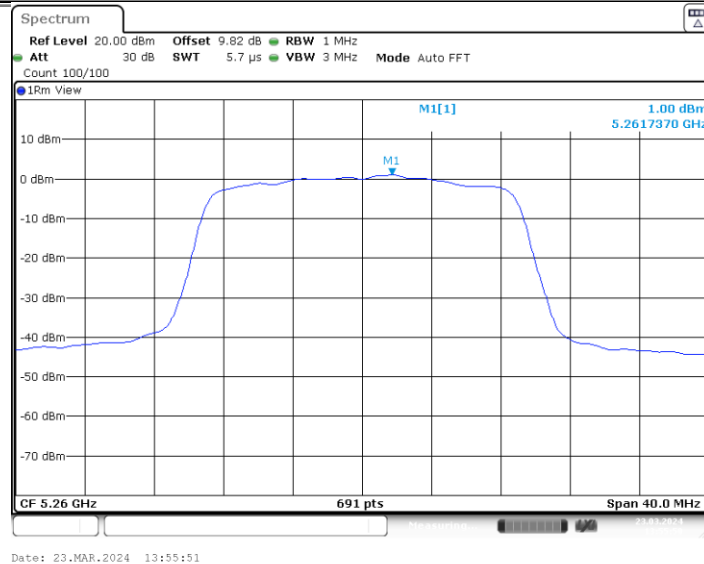


11N20SISO\_Ant1\_5280

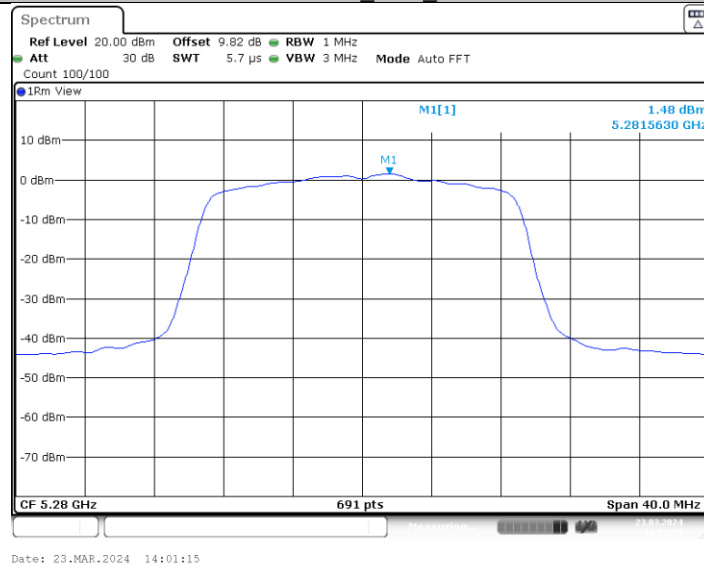


11N20SISO\_Ant1\_5320

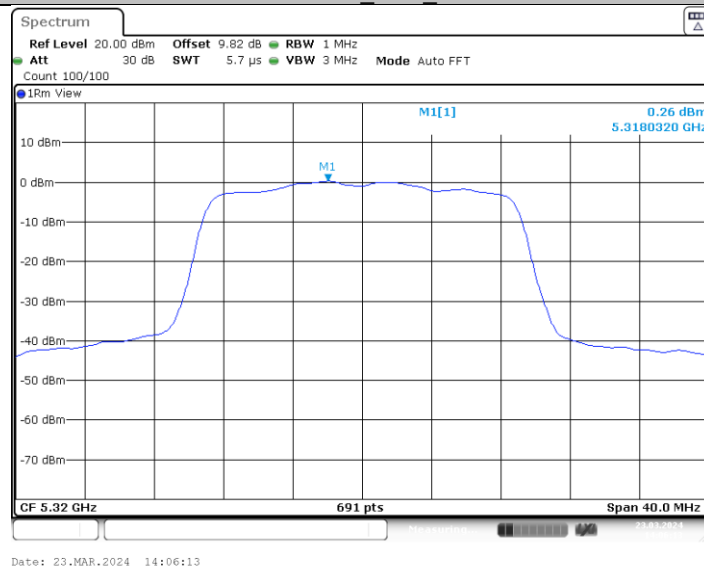


11N20SISO\_Ant1\_5500

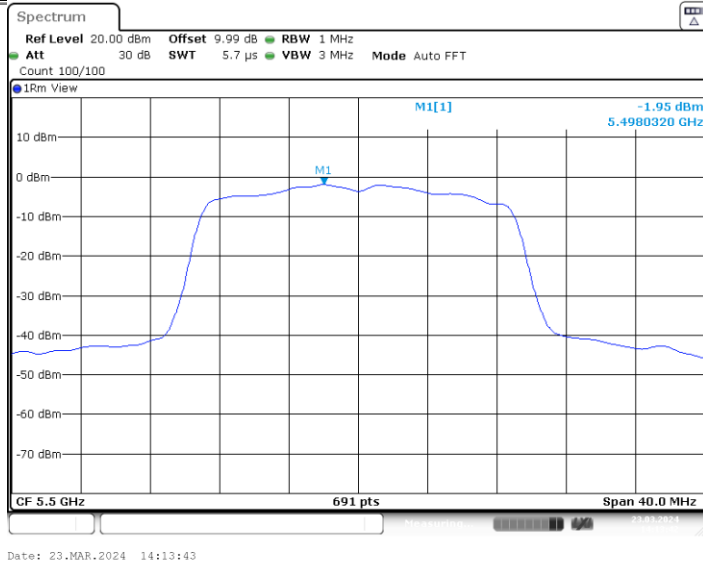


11N20SISO\_Ant1\_5580

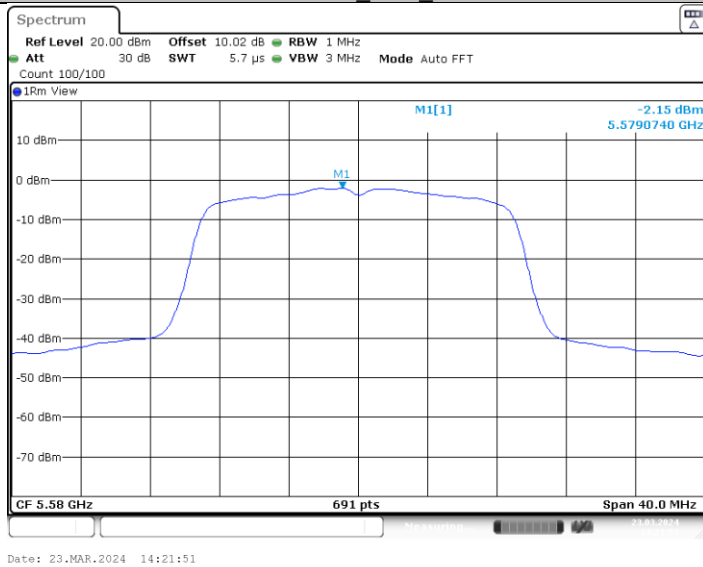

11N20SISO\_Ant1\_5700

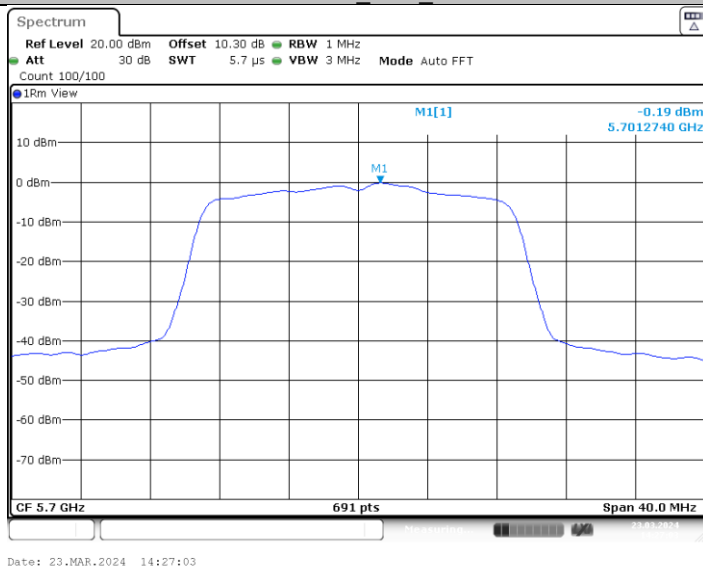


11N20SISO\_Ant1\_5745

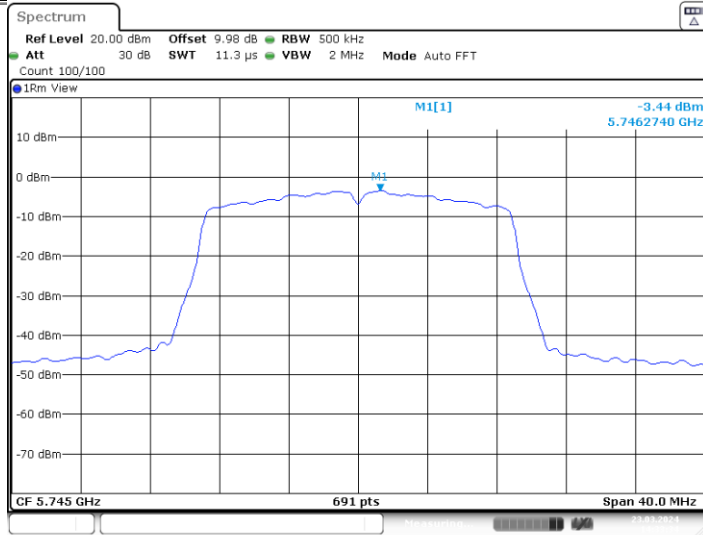


Date: 23.MAR.2024 14:33:34

### 11N20SISO\_Ant1\_5785

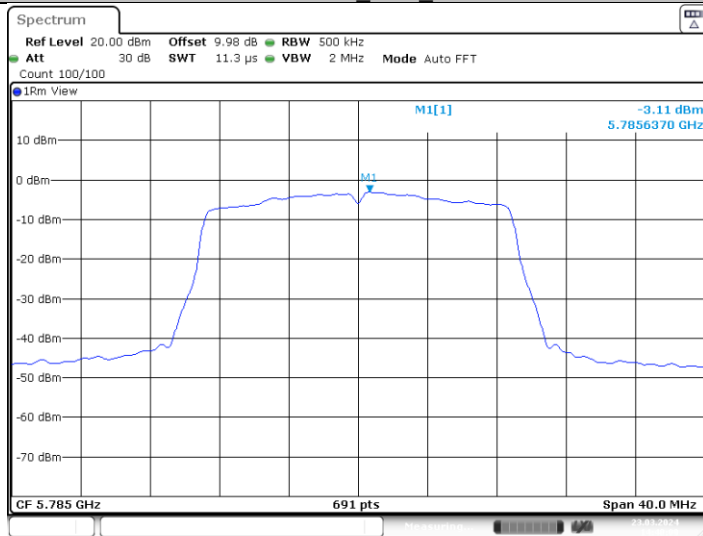


Date: 23.MAR.2024 14:40:00

### 11N20SISO\_Ant1\_5825

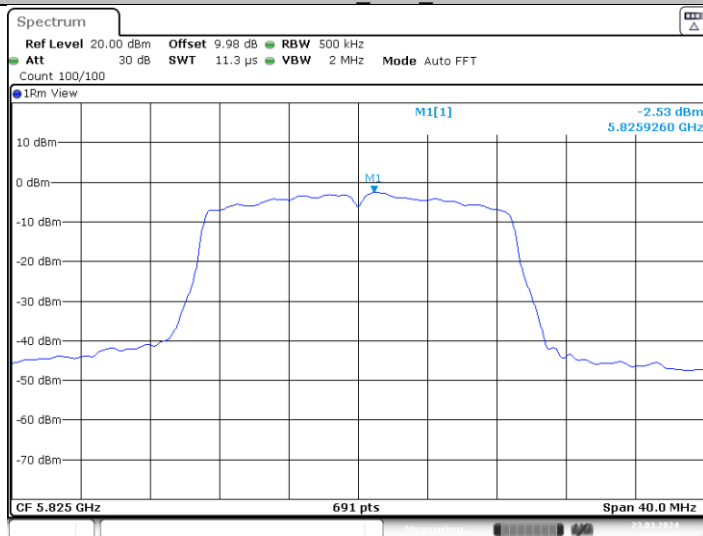


Date: 23.MAR.2024 14:44:58


### 11N40SISO\_Ant1\_5190

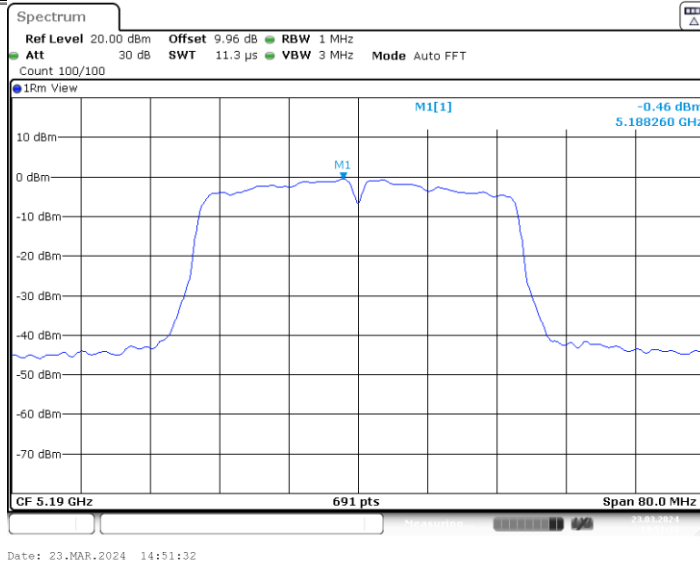


11N40SISO\_Ant1\_5230

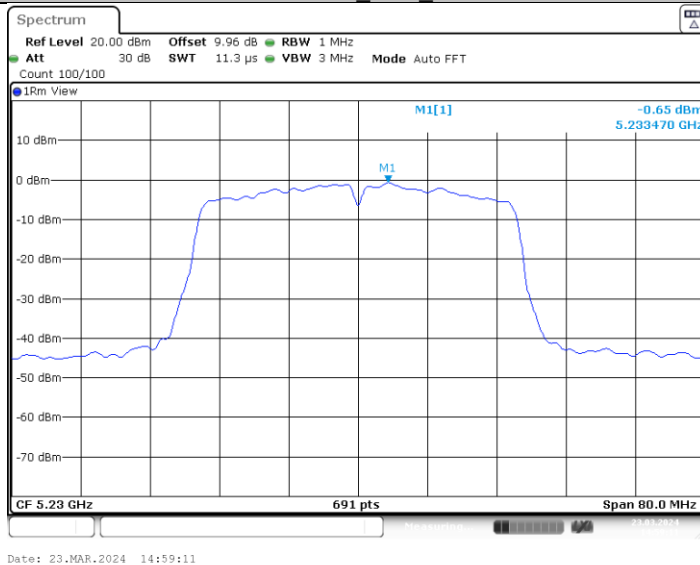


11N40SISO\_Ant1\_5270

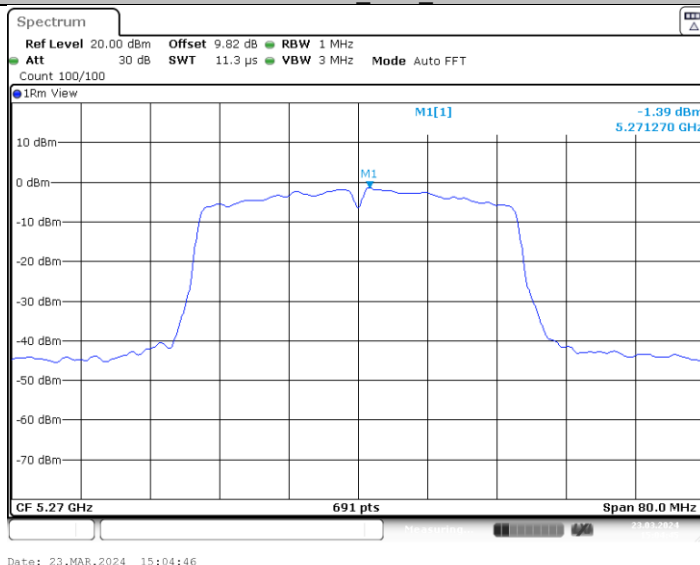


11N40SISO\_Ant1\_5310

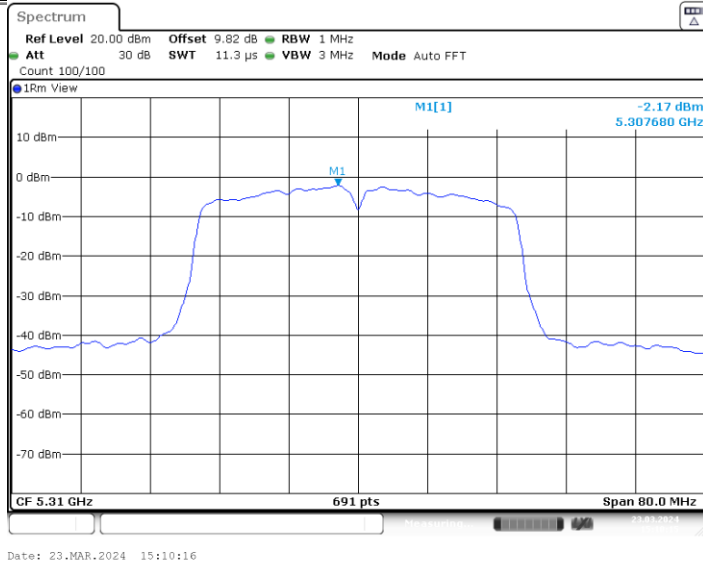


11N40SISO\_Ant1\_5510

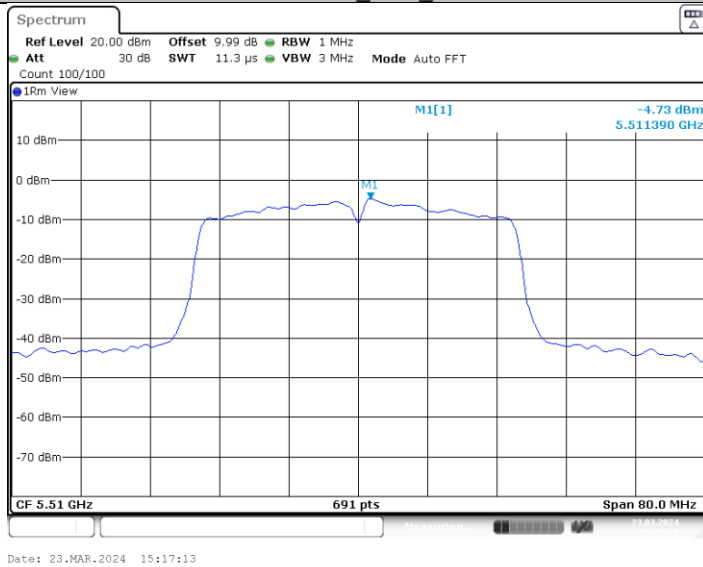


11N40SISO\_Ant1\_5550

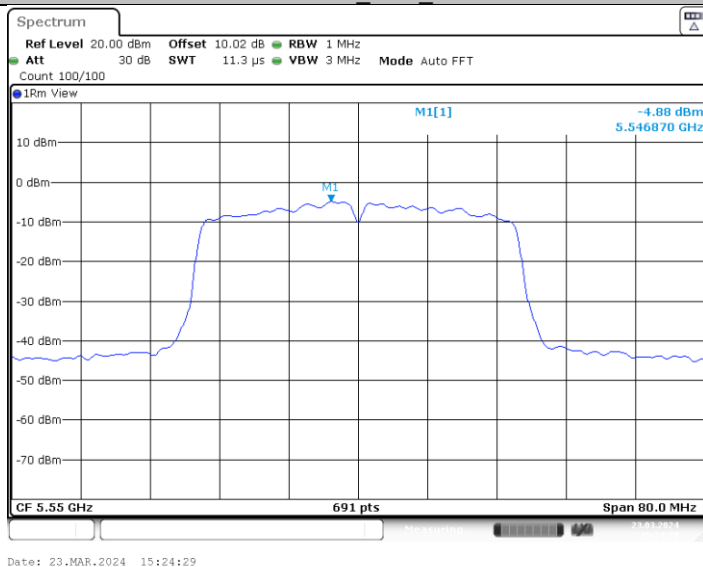


11N40SISO\_Ant1\_5670

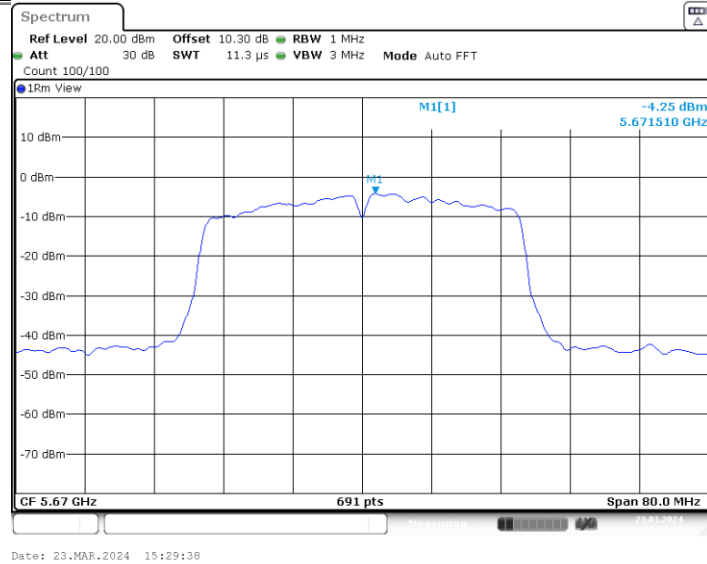


11N40SISO\_Ant1\_5755

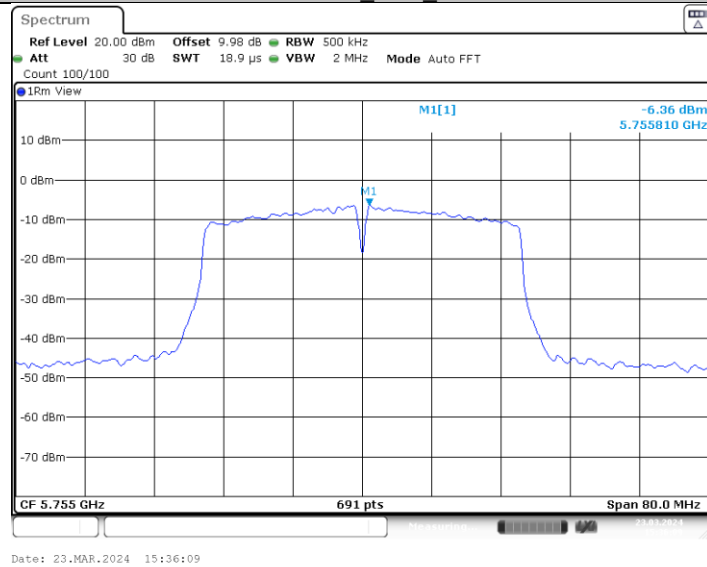


11N40SISO\_Ant1\_5795

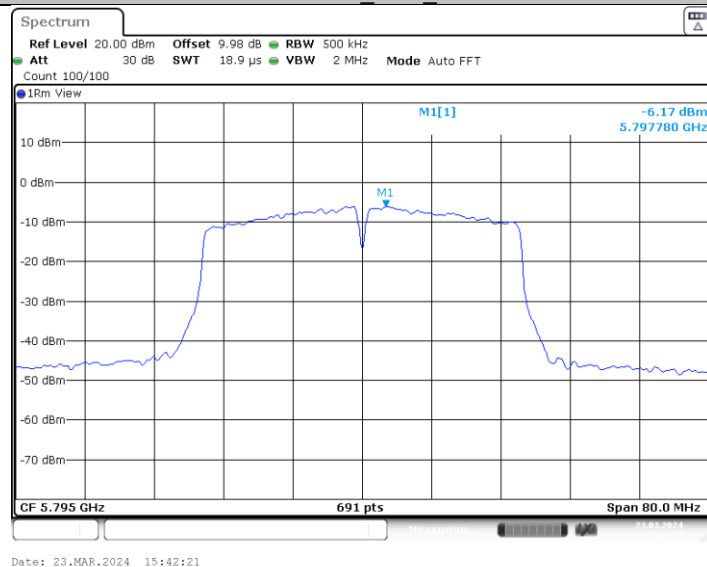


11AC20SISO\_Ant1\_5180

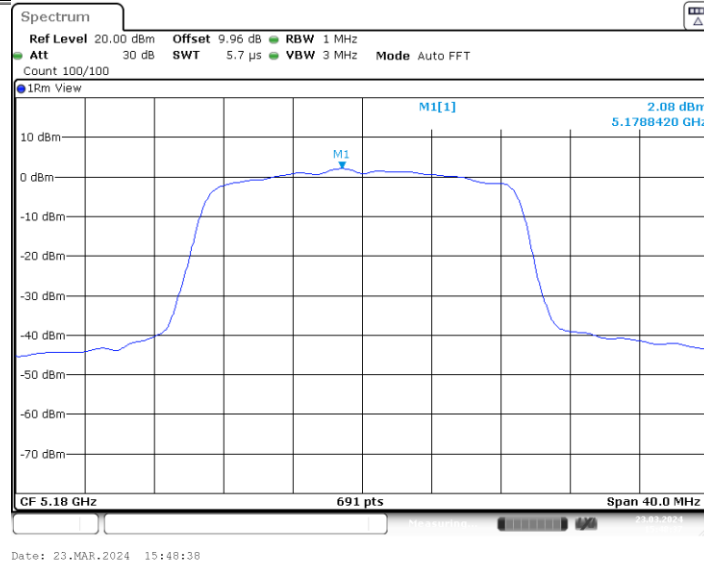


11AC20SISO\_Ant1\_5200

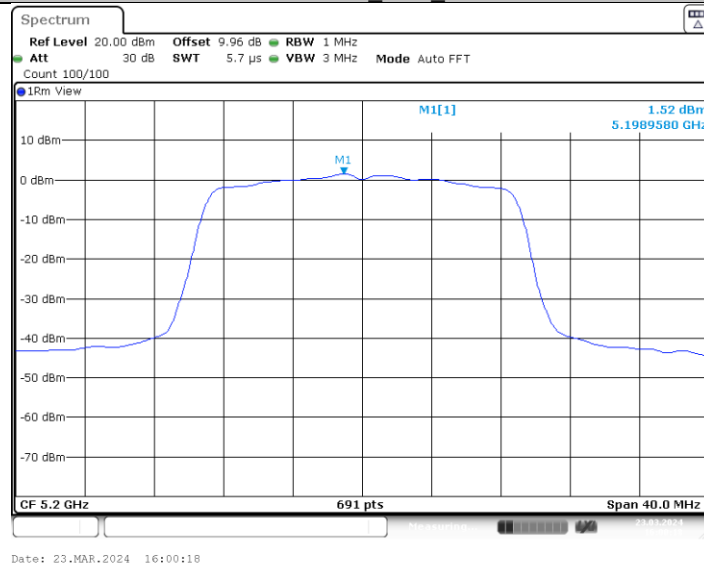


11AC20SISO\_Ant1\_5240

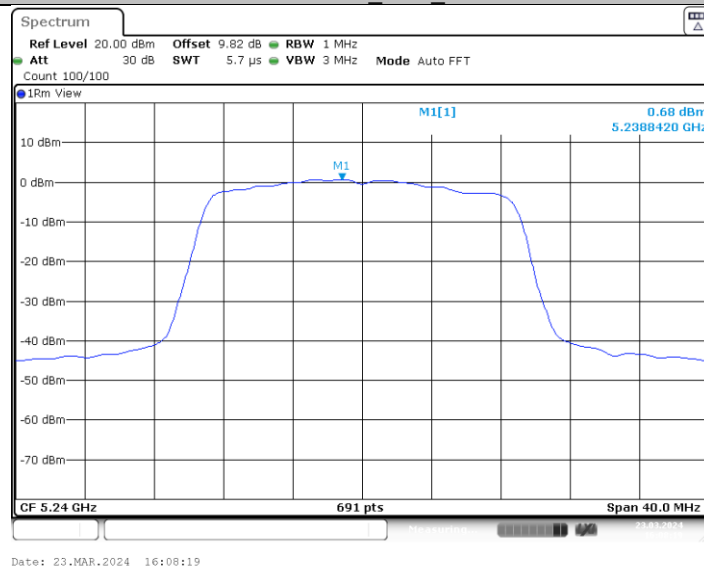


11AC20SISO\_Ant1\_5260

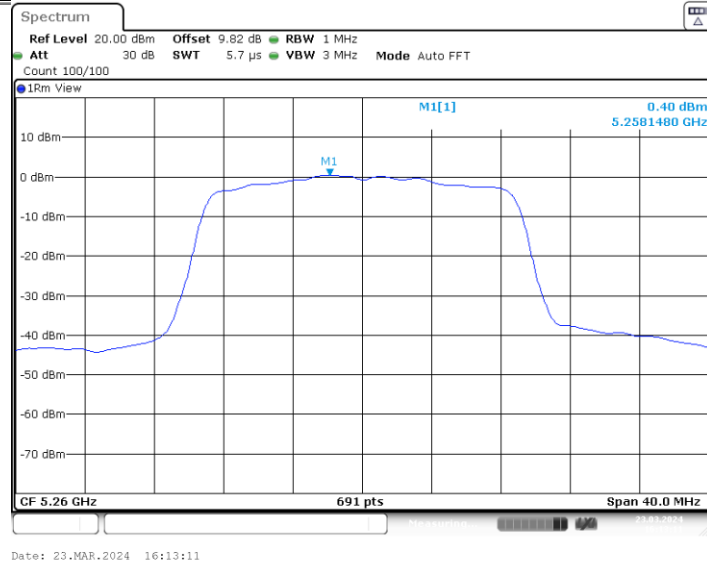


11AC20SISO\_Ant1\_5280

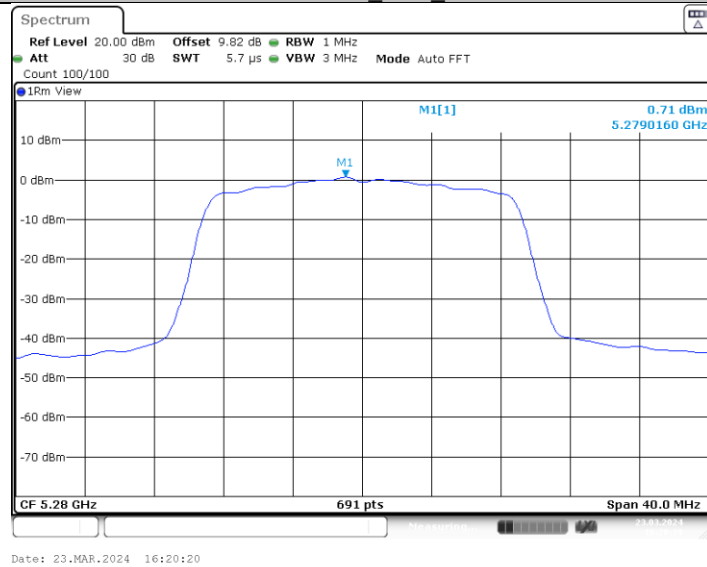

11AC20SISO\_Ant1\_5320

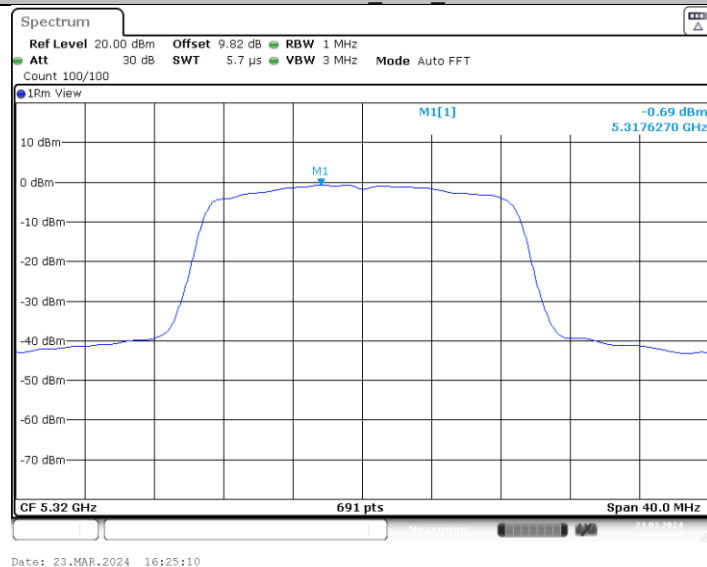


11AC20SISO\_Ant1\_5500

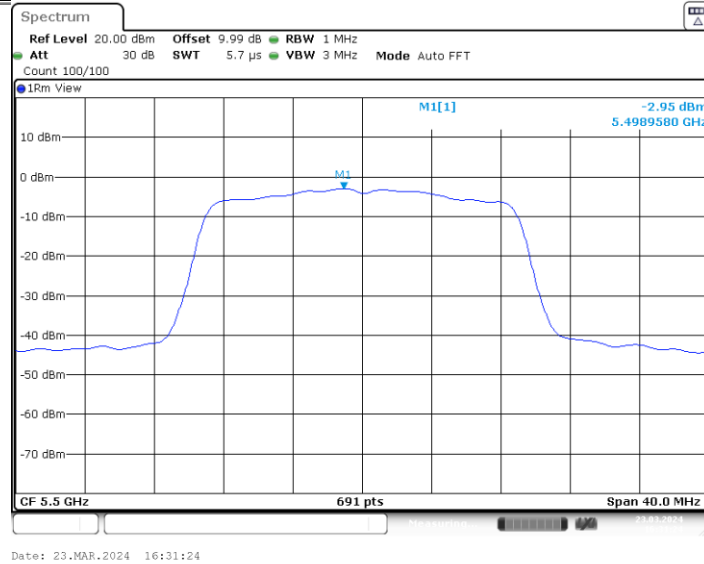


11AC20SISO\_Ant1\_5580



11AC20SISO\_Ant1\_5700

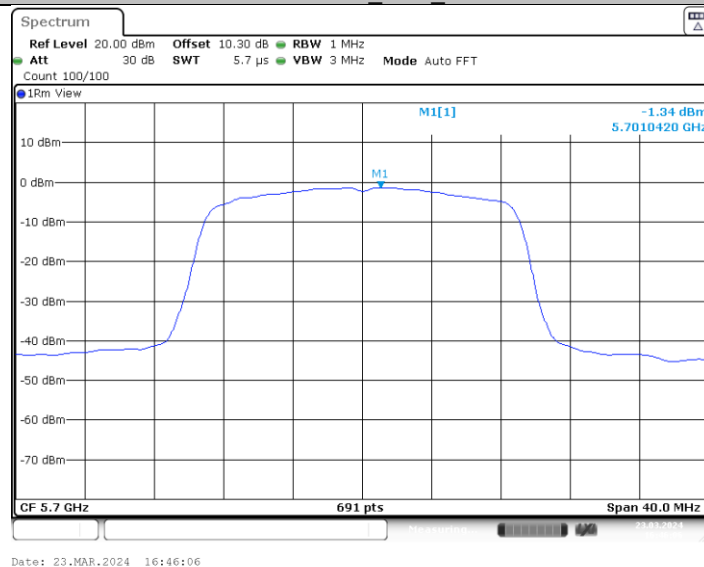


11AC20SISO\_Ant1\_5745

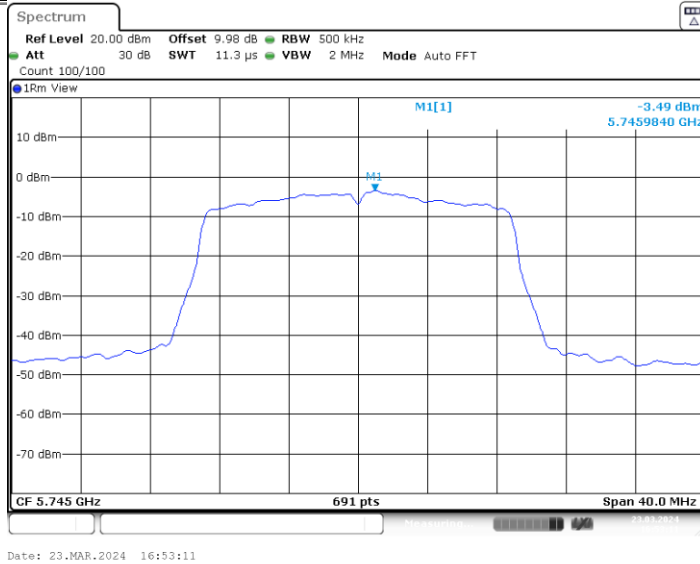


11AC20SISO\_Ant1\_5785



11AC20SISO\_Ant1\_5825

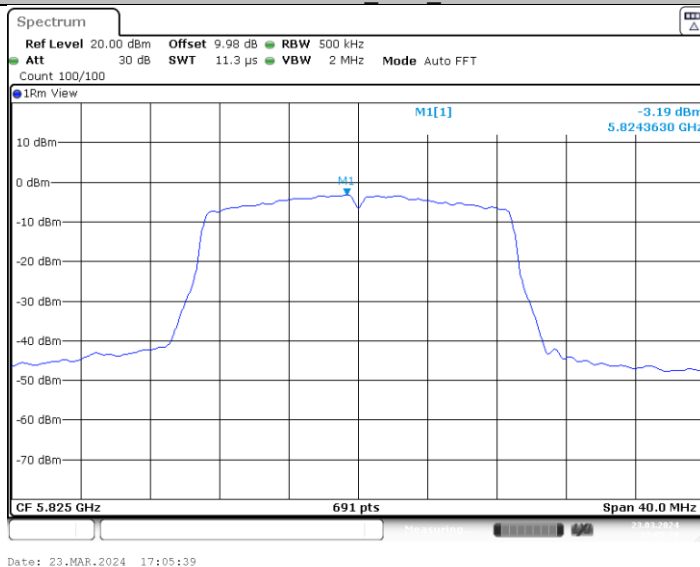


11AC40SISO\_Ant1\_5190

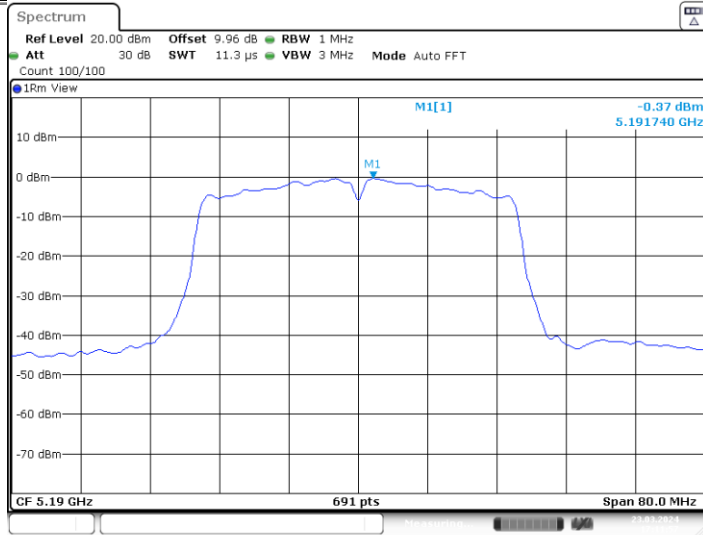


Date: 23.MAR.2024 17:11:57

### 11AC40SISO\_Ant1\_5230

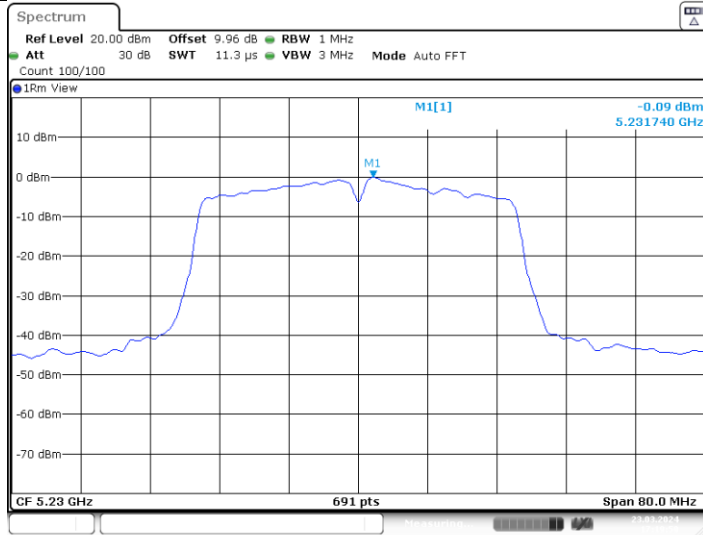


Date: 23.MAR.2024 17:19:50

### 11AC40SISO\_Ant1\_5270

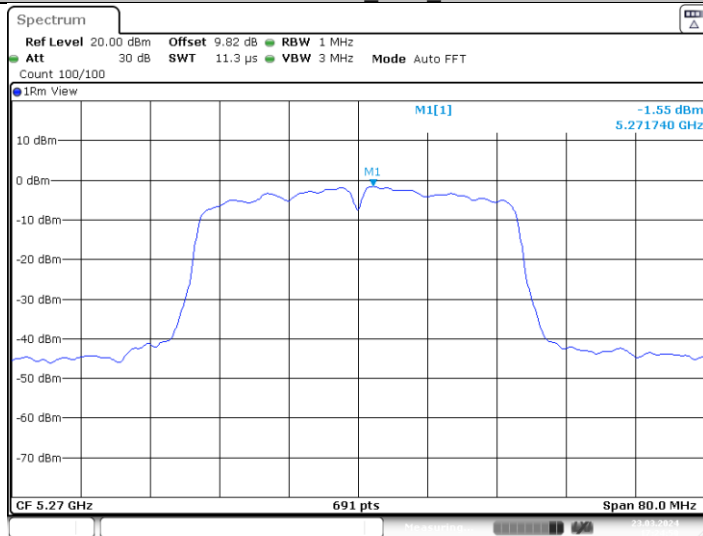


Date: 23.MAR.2024 17:24:50


### 11AC40SISO\_Ant1\_5310

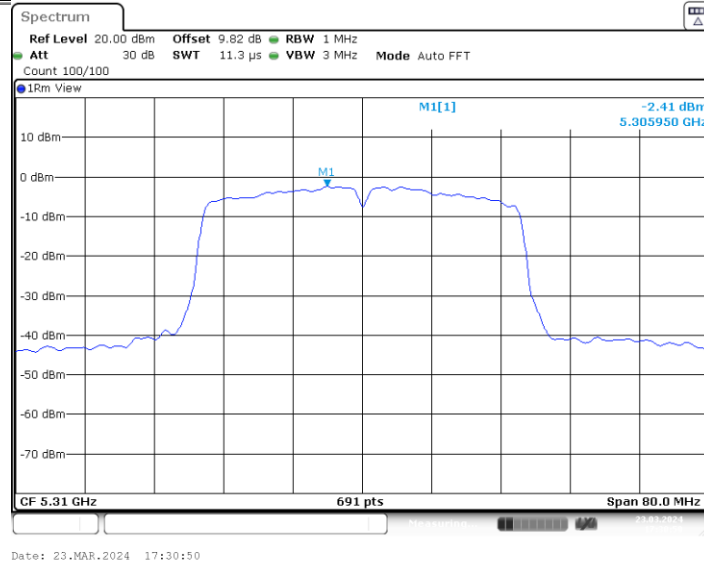


11AC40SISO\_Ant1\_5510

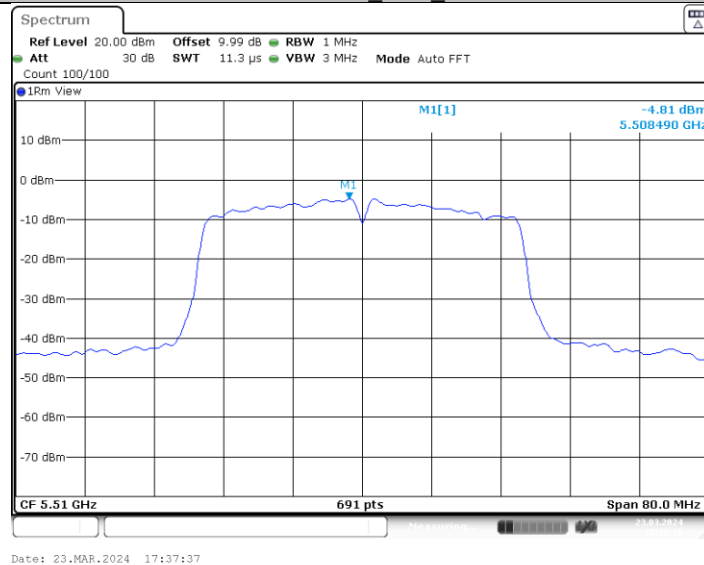


11AC40SISO\_Ant1\_5550

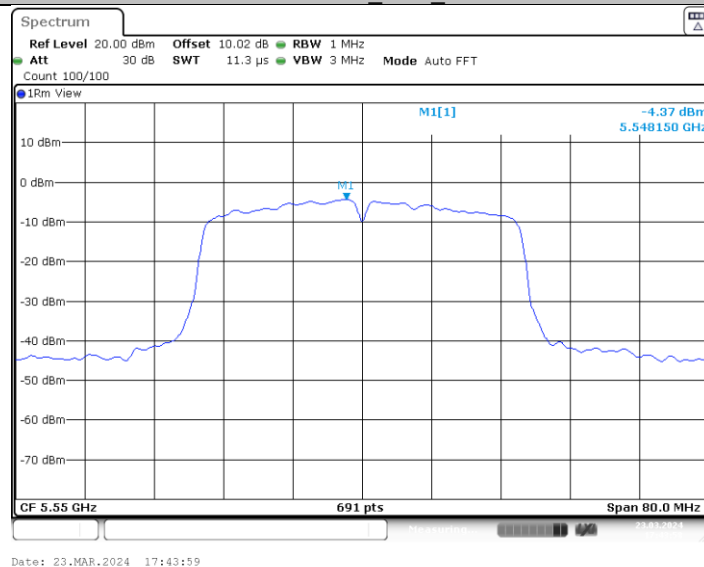


11AC40SISO\_Ant1\_5670

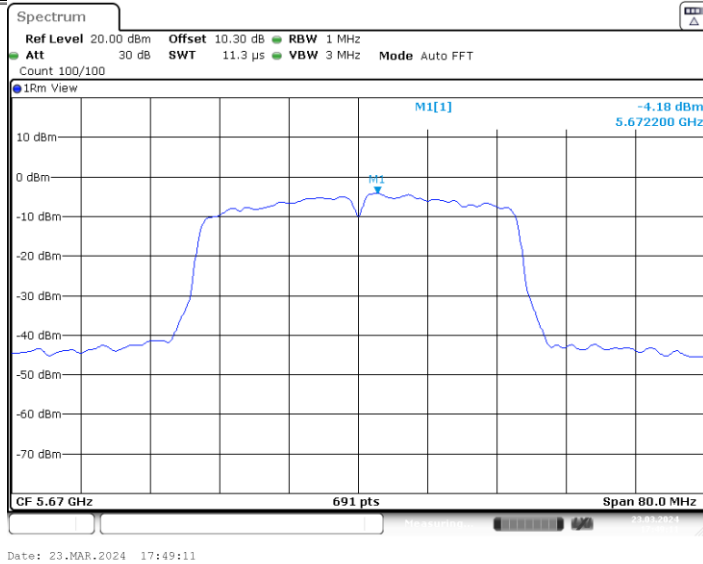


11AC40SISO\_Ant1\_5755

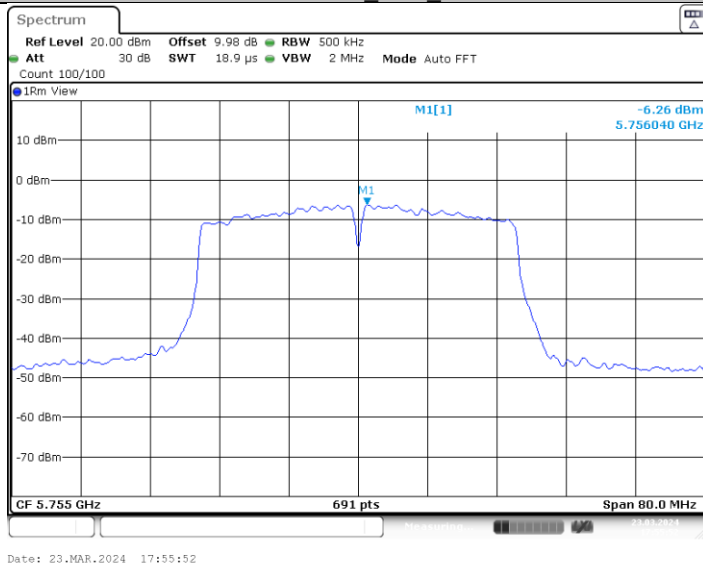


11AC40SISO\_Ant1\_5795

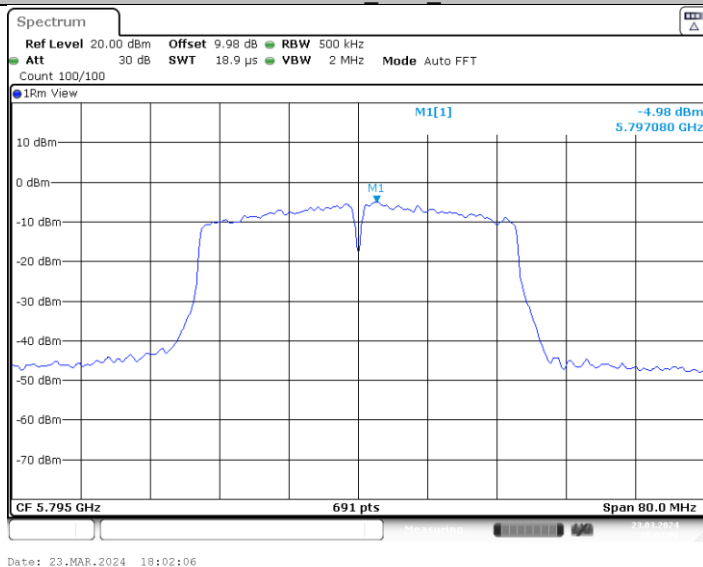


11AC80SISO\_Ant1\_5210

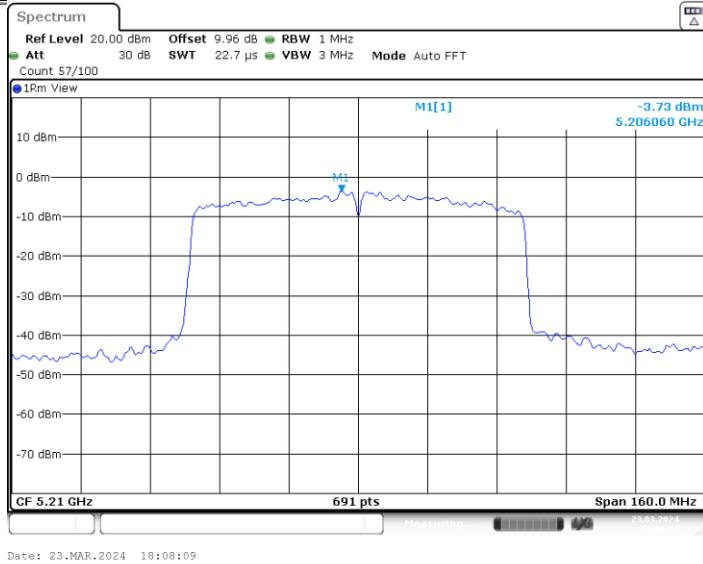


11AC80SISO\_Ant1\_5290

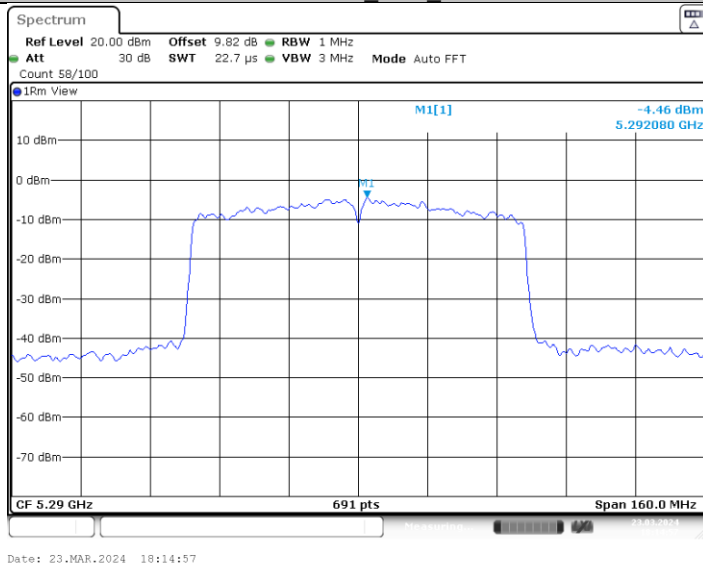

11AC80SISO\_Ant1\_5530

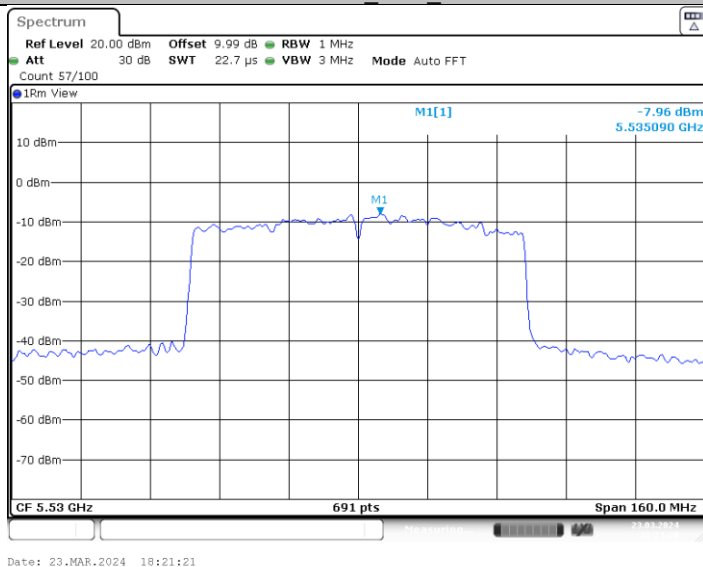


11AC80SISO\_Ant1\_5610

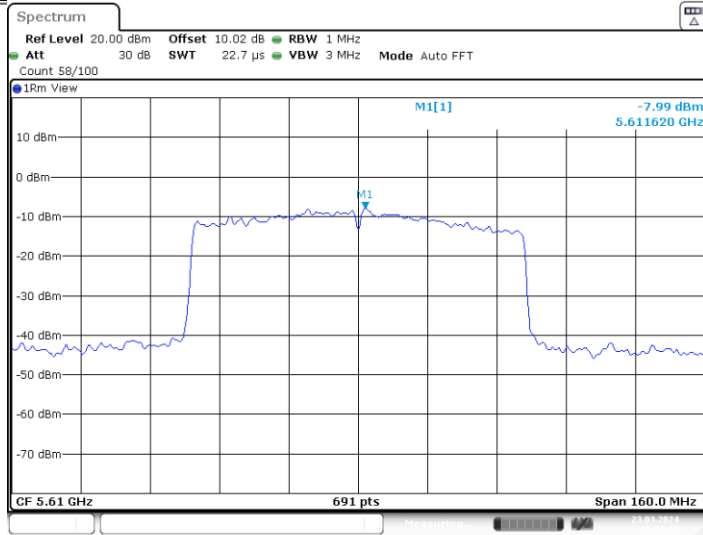

Date: 23.MAR.2024 18:29:14

### 11AC80SISO\_Ant1\_5775

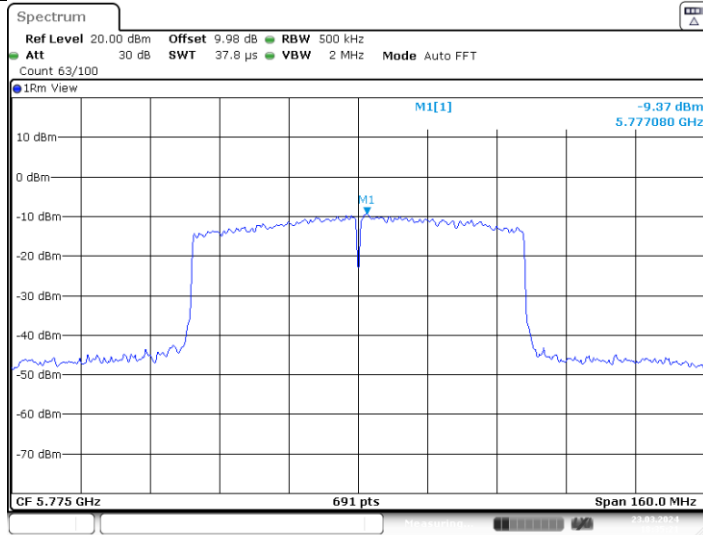

Date: 23.MAR.2024 18:35:22

## APPENDIX H - Frequency Stability

| Voltage   |         |           |               |                  |                |                 |             |         |
|-----------|---------|-----------|---------------|------------------|----------------|-----------------|-------------|---------|
| TestMode  | Antenna | Freq(MHz) | Voltage [Vdc] | Temperature (°C) | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
| 11A       | Ant1    | 5180      | NV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | LV            | NT               | -20000.00      | -3.861004       | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.861004       | 20          | PASS    |
|           |         | 5200      | NV            | NT               | -20000.00      | -3.846154       | 20          | PASS    |
|           |         |           | LV            | NT               | -20000.00      | -3.846154       | 20          | PASS    |
|           |         |           | HV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         | 5240      | NV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | LV            | NT               | -20000.00      | -3.816794       | 20          | PASS    |
|           |         |           | HV            | NT               | -40000.00      | -7.633588       | 20          | PASS    |
|           |         | 5260      | NV            | NT               | -20000.00      | -3.802281       | 20          | PASS    |
|           |         |           | LV            | NT               | -20000.00      | -3.802281       | 20          | PASS    |
|           |         |           | HV            | NT               | -40000.00      | -7.604563       | 20          | PASS    |
|           |         | 5280      | NV            | NT               | -40000.00      | -7.575758       | 20          | PASS    |
|           |         |           | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.787879       | 20          | PASS    |
|           |         | 5320      | NV            | NT               | -40000.00      | -7.518797       | 20          | PASS    |
|           |         |           | LV            | NT               | -20000.00      | -3.759398       | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.759398       | 20          | PASS    |
|           |         | 5500      | NV            | NT               | -20000.00      | -3.636364       | 20          | PASS    |
|           |         |           | LV            | NT               | -20000.00      | -3.636364       | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.636364       | 20          | PASS    |
|           |         | 5580      | NV            | NT               | -40000.00      | -7.168459       | 20          | PASS    |
|           |         |           | LV            | NT               | -20000.00      | -3.584229       | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.584229       | 20          | PASS    |
|           |         | 5700      | NV            | NT               | -20000.00      | -3.508772       | 20          | PASS    |
|           |         |           | LV            | NT               | -20000.00      | -3.508772       | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.508772       | 20          | PASS    |
|           |         | 5745      | NV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | LV            | NT               | -20000.00      | -3.481288       | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.481288       | 20          | PASS    |
|           |         | 5785      | NV            | NT               | -20000.00      | -3.457217       | 20          | PASS    |
|           |         |           | LV            | NT               | -20000.00      | -3.457217       | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.457217       | 20          | PASS    |
|           |         | 5825      | NV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.433476       | 20          | PASS    |
| 11N20SISO | Ant1    | 5180      | NV            | NT               | -40000.00      | -7.722008       | 20          | PASS    |
|           |         |           | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.861004       | 20          | PASS    |
|           |         | 5200      | NV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | HV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         | 5240      | NV            | NT               | -20000.00      | -3.816794       | 20          | PASS    |
|           |         |           | LV            | NT               | -20000.00      | -3.816794       | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.816794       | 20          | PASS    |
|           |         | 5260      | NV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | HV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         | 5280      | NV            | NT               | -20000.00      | -3.787879       | 20          | PASS    |
|           |         |           | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | HV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         | 5320      | NV            | NT               | -20000.00      | -3.759398       | 20          | PASS    |
|           |         |           | LV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.759398       | 20          | PASS    |
|           |         | 5500      | NV            | NT               | 0.00           | 0.000000        | 20          | PASS    |
|           |         |           | LV            | NT               | -20000.00      | -3.636364       | 20          | PASS    |
|           |         |           | HV            | NT               | -20000.00      | -3.636364       | 20          | PASS    |
|           |         | 5580      | NV            | NT               | 20000.00       | 3.584229        | 20          | PASS    |

|            |      |      |    |    |           |            |    |      |
|------------|------|------|----|----|-----------|------------|----|------|
|            |      | 5700 | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | NV | NT | -20000.00 | -3.508772  | 20 | PASS |
|            |      | 5745 | LV | NT | -20000.00 | -3.508772  | 20 | PASS |
|            |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      | 5785 | LV | NT | -40000.00 | -6.962576  | 20 | PASS |
|            |      |      | HV | NT | -20000.00 | -3.481288  | 20 | PASS |
|            |      |      | NV | NT | -20000.00 | -3.457217  | 20 | PASS |
|            |      | 5825 | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
| 11N40SISO  | Ant1 | 5190 | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | NV | NT | -40000.00 | -7.707129  | 20 | PASS |
|            |      | 5230 | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | HV | NT | -40000.00 | -7.648184  | 20 | PASS |
|            |      |      | NV | NT | -40000.00 | -7.590133  | 20 | PASS |
|            |      | 5270 | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | NV | NT | -40000.00 | -7.532957  | 20 | PASS |
|            |      | 5310 | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | HV | NT | -40000.00 | -7.532957  | 20 | PASS |
|            |      |      | NV | NT | -40000.00 | -7.259528  | 20 | PASS |
|            |      | 5510 | LV | NT | -80000.00 | -14.519056 | 20 | PASS |
|            |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      | 5550 | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | HV | NT | -40000.00 | -7.207207  | 20 | PASS |
|            |      |      | NV | NT | -40000.00 | -7.054674  | 20 | PASS |
|            |      | 5670 | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | NV | NT | -40000.00 | -6.950478  | 20 | PASS |
|            |      | 5755 | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | NV | NT | -40000.00 | -6.902502  | 20 | PASS |
|            |      | 5795 | LV | NT | -40000.00 | -6.902502  | 20 | PASS |
|            |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | NV | NT | -20000.00 | -3.861004  | 20 | PASS |
| 11AC20SISO | Ant1 | 5180 | LV | NT | -40000.00 | -7.722008  | 20 | PASS |
|            |      |      | HV | NT | -20000.00 | -3.861004  | 20 | PASS |
|            |      |      | NV | NT | -20000.00 | -3.846154  | 20 | PASS |
|            |      | 5200 | LV | NT | -20000.00 | -3.846154  | 20 | PASS |
|            |      |      | HV | NT | -20000.00 | -3.846154  | 20 | PASS |
|            |      |      | NV | NT | -40000.00 | -7.633588  | 20 | PASS |
|            |      | 5240 | LV | NT | -40000.00 | -7.633588  | 20 | PASS |
|            |      |      | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|            |      |      | NV | NT | -40000.00 | -7.604563  | 20 | PASS |
|            |      | 5260 | LV | NT | -40000.00 | -7.604563  | 20 | PASS |
|            |      |      | HV | NT | -40000.00 | -7.604563  | 20 | PASS |
|            |      |      | NV | NT | -20000.00 | -3.787879  | 20 | PASS |
|            |      | 5280 | LV | NT | -40000.00 | -7.575758  | 20 | PASS |
|            |      |      | HV | NT | -20000.00 | -3.787879  | 20 | PASS |
|            |      |      | NV | NT | -20000.00 | -3.759398  | 20 | PASS |
|            |      | 5320 | LV | NT | -40000.00 | -7.518797  | 20 | PASS |
|            |      |      | HV | NT | -40000.00 | -7.518797  | 20 | PASS |
|            |      |      | NV | NT | -20000.00 | -3.636364  | 20 | PASS |
|            |      | 5500 | LV | NT | -20000.00 | -3.636364  | 20 | PASS |
|            |      |      | HV | NT | -40000.00 | -7.272727  | 20 | PASS |
|            |      |      | NV | NT | -20000.00 | -3.584229  | 20 | PASS |
|            |      | 5580 | LV | NT | -20000.00 | -3.584229  | 20 | PASS |
|            |      |      | HV | NT | -40000.00 | -7.168459  | 20 | PASS |
|            |      |      | NV | NT | -60000.00 | -10.526316 | 20 | PASS |
|            |      | 5700 | LV | NT | -40000.00 | -7.017544  | 20 | PASS |

|                |      |      |    |    |           |            |    |      |
|----------------|------|------|----|----|-----------|------------|----|------|
|                |      | 5745 | HV | NT | -20000.00 | -3.508772  | 20 | PASS |
|                |      |      | NV | NT | -20000.00 | -3.481288  | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5785 | HV | NT | 20000.00  | 3.481288   | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 20000.00  | 3.457217   | 20 | PASS |
|                |      | 5825 | HV | NT | -20000.00 | -3.457217  | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | -20000.00 | -3.433476  | 20 | PASS |
|                |      |      | HV | NT | -20000.00 | -3.433476  | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
| 11AC40SIS<br>O | Ant1 | 5190 | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5230 | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5270 | HV | NT | -40000.00 | -7.590133  | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5310 | HV | NT | -40000.00 | -7.532957  | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5510 | HV | NT | -40000.00 | -7.259528  | 20 | PASS |
|                |      |      | NV | NT | -40000.00 | -7.259528  | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5550 | HV | NT | -40000.00 | -7.207207  | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5670 | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5755 | HV | NT | -80000.00 | -13.900956 | 20 | PASS |
|                |      |      | NV | NT | -40000.00 | -6.950478  | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5795 | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | NV | NT | -40000.00 | -6.902502  | 20 | PASS |
|                |      |      | LV | NT | -40000.00 | -6.902502  | 20 | PASS |
| 11AC80SIS<br>O | Ant1 | 5210 | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5290 | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5530 | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5610 | HV | NT | -80000.00 | -14.260250 | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      | 5775 | HV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | NV | NT | 0.00      | 0.000000   | 20 | PASS |
|                |      |      | LV | NT | 0.00      | 0.000000   | 20 | PASS |

| Temperature  |         |           |                  |                         |                   |                    |                |         |
|--------------|---------|-----------|------------------|-------------------------|-------------------|--------------------|----------------|---------|
| TestMod<br>e | Antenna | Freq(MHz) | Voltage<br>[Vdc] | Temperat<br>ure<br>(°C) | Deviation<br>(Hz) | Deviation<br>(ppm) | Limit<br>(ppm) | Verdict |
| 11A          | Ant1    | 5180      | NV               | -30                     | -40000.00         | -7.722008          | 20             | PASS    |
|              |         |           | NV               | -20                     | -20000.00         | -3.861004          | 20             | PASS    |
|              |         |           | NV               | -10                     | -20000.00         | -3.861004          | 20             | PASS    |
|              |         |           | NV               | 0                       | -20000.00         | -3.861004          | 20             | PASS    |
|              |         |           | NV               | 10                      | -20000.00         | -3.861004          | 20             | PASS    |
|              |         |           | NV               | 20                      | 0.00              | 0.000000           | 20             | PASS    |
|              |         |           | NV               | 30                      | -20000.00         | -3.861004          | 20             | PASS    |
|              |         |           | NV               | 40                      | 0.00              | 0.000000           | 20             | PASS    |
|              |         | 5200      | NV               | 50                      | -20000.00         | -3.861004          | 20             | PASS    |
|              |         |           | NV               | -30                     | -20000.00         | -3.846154          | 20             | PASS    |

|  |  |      |    |     |           |           |    |      |
|--|--|------|----|-----|-----------|-----------|----|------|
|  |  |      | NV | -20 | -20000.00 | -3.846154 | 20 | PASS |
|  |  |      | NV | -10 | -20000.00 | -3.846154 | 20 | PASS |
|  |  |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 10  | -20000.00 | -3.846154 | 20 | PASS |
|  |  |      | NV | 20  | 20000.00  | 3.846154  | 20 | PASS |
|  |  |      | NV | 30  | -40000.00 | -7.692308 | 20 | PASS |
|  |  |      | NV | 40  | -20000.00 | -3.846154 | 20 | PASS |
|  |  |      | NV | 50  | -20000.00 | -3.846154 | 20 | PASS |
|  |  | 5240 | NV | -30 | -20000.00 | -3.816794 | 20 | PASS |
|  |  |      | NV | -20 | -20000.00 | -3.816794 | 20 | PASS |
|  |  |      | NV | -10 | -20000.00 | -3.816794 | 20 | PASS |
|  |  |      | NV | 0   | -40000.00 | -7.633588 | 20 | PASS |
|  |  |      | NV | 10  | -20000.00 | -3.816794 | 20 | PASS |
|  |  |      | NV | 20  | -40000.00 | -7.633588 | 20 | PASS |
|  |  |      | NV | 30  | -20000.00 | -3.816794 | 20 | PASS |
|  |  |      | NV | 40  | -20000.00 | -3.816794 | 20 | PASS |
|  |  |      | NV | 50  | -20000.00 | -3.816794 | 20 | PASS |
|  |  |      | NV | -30 | -40000.00 | -7.604563 | 20 | PASS |
|  |  |      | NV | -20 | -20000.00 | -3.802281 | 20 | PASS |
|  |  |      | NV | -10 | -20000.00 | -3.802281 | 20 | PASS |
|  |  |      | NV | 0   | -20000.00 | -3.802281 | 20 | PASS |
|  |  |      | NV | 10  | -20000.00 | -3.802281 | 20 | PASS |
|  |  |      | NV | 20  | -40000.00 | -7.604563 | 20 | PASS |
|  |  |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 50  | -20000.00 | -3.802281 | 20 | PASS |
|  |  |      | NV | -30 | -20000.00 | -3.787879 | 20 | PASS |
|  |  |      | NV | -20 | -20000.00 | -3.787879 | 20 | PASS |
|  |  |      | NV | -10 | -20000.00 | -3.787879 | 20 | PASS |
|  |  |      | NV | 0   | -20000.00 | -3.787879 | 20 | PASS |
|  |  |      | NV | 10  | -20000.00 | -3.787879 | 20 | PASS |
|  |  |      | NV | 20  | -20000.00 | -3.787879 | 20 | PASS |
|  |  |      | NV | 30  | -20000.00 | -3.787879 | 20 | PASS |
|  |  |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 50  | -20000.00 | -3.787879 | 20 | PASS |
|  |  |      | NV | -30 | -20000.00 | -3.759398 | 20 | PASS |
|  |  |      | NV | -20 | -20000.00 | -3.759398 | 20 | PASS |
|  |  |      | NV | -10 | -20000.00 | -3.759398 | 20 | PASS |
|  |  |      | NV | 0   | -20000.00 | -3.759398 | 20 | PASS |
|  |  |      | NV | 10  | -20000.00 | -3.759398 | 20 | PASS |
|  |  |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 50  | -40000.00 | -7.518797 | 20 | PASS |
|  |  |      | NV | -30 | -20000.00 | -3.636364 | 20 | PASS |
|  |  |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | -10 | -20000.00 | -3.636364 | 20 | PASS |
|  |  |      | NV | 0   | -20000.00 | -3.636364 | 20 | PASS |
|  |  |      | NV | 10  | -20000.00 | -3.636364 | 20 | PASS |
|  |  |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 30  | -20000.00 | -3.636364 | 20 | PASS |
|  |  |      | NV | 40  | -20000.00 | -3.636364 | 20 | PASS |
|  |  |      | NV | 50  | -20000.00 | -3.636364 | 20 | PASS |
|  |  |      | NV | -30 | -20000.00 | -3.584229 | 20 | PASS |
|  |  |      | NV | -20 | -20000.00 | -3.584229 | 20 | PASS |
|  |  |      | NV | -10 | -20000.00 | -3.584229 | 20 | PASS |
|  |  |      | NV | 0   | -40000.00 | -7.168459 | 20 | PASS |
|  |  |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 20  | -20000.00 | -3.584229 | 20 | PASS |
|  |  |      | NV | 30  | -20000.00 | -3.584229 | 20 | PASS |
|  |  |      | NV | 40  | -20000.00 | -3.584229 | 20 | PASS |
|  |  |      | NV | 50  | -20000.00 | -3.584229 | 20 | PASS |
|  |  |      | NV | -30 | -40000.00 | -7.017544 | 20 | PASS |
|  |  |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | -10 | -20000.00 | -3.508772 | 20 | PASS |
|  |  |      | NV | 0   | -20000.00 | -3.508772 | 20 | PASS |
|  |  |      | NV | 10  | -20000.00 | -3.508772 | 20 | PASS |

|               |      |      |    |     |           |           |    |      |
|---------------|------|------|----|-----|-----------|-----------|----|------|
| 11N20SI<br>SO | Ant1 | 5745 | NV | 20  | -20000.00 | -3.508772 | 20 | PASS |
|               |      |      | NV | 30  | -20000.00 | -3.508772 | 20 | PASS |
|               |      |      | NV | 40  | -20000.00 | -3.508772 | 20 | PASS |
|               |      |      | NV | 50  | -20000.00 | -3.508772 | 20 | PASS |
|               |      | 5785 | NV | -30 | -20000.00 | -3.481288 | 20 | PASS |
|               |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | -10 | -20000.00 | -3.481288 | 20 | PASS |
|               |      |      | NV | 0   | -20000.00 | -3.481288 | 20 | PASS |
|               |      |      | NV | 10  | -20000.00 | -3.481288 | 20 | PASS |
|               |      |      | NV | 20  | -20000.00 | -3.481288 | 20 | PASS |
|               |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | 40  | -20000.00 | -3.481288 | 20 | PASS |
|               |      |      | NV | 50  | -20000.00 | -3.481288 | 20 | PASS |
|               |      |      | NV | -30 | -20000.00 | -3.457217 | 20 | PASS |
|               |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|               |      | 5825 | NV | -10 | 20000.00  | 3.457217  | 20 | PASS |
|               |      |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | 10  | -20000.00 | -3.457217 | 20 | PASS |
|               |      |      | NV | 20  | -20000.00 | -3.457217 | 20 | PASS |
|               |      |      | NV | 30  | -20000.00 | -3.457217 | 20 | PASS |
|               |      |      | NV | 40  | -20000.00 | -3.457217 | 20 | PASS |
|               |      |      | NV | 50  | -20000.00 | -3.457217 | 20 | PASS |
|               |      |      | NV | -30 | -20000.00 | -3.433476 | 20 | PASS |
|               |      |      | NV | -20 | -20000.00 | -3.433476 | 20 | PASS |
|               |      |      | NV | -10 | -20000.00 | -3.433476 | 20 | PASS |
|               |      |      | NV | 0   | -20000.00 | -3.433476 | 20 | PASS |
|               |      |      | NV | 10  | -20000.00 | -3.433476 | 20 | PASS |
|               |      |      | NV | 20  | -20000.00 | -3.433476 | 20 | PASS |
|               |      |      | NV | 30  | -20000.00 | -3.433476 | 20 | PASS |
|               |      |      | NV | 40  | -20000.00 | -3.433476 | 20 | PASS |
|               |      |      | NV | 50  | -20000.00 | -3.433476 | 20 | PASS |
|               |      | 5180 | NV | -30 | -20000.00 | -3.861004 | 20 | PASS |
|               |      |      | NV | -20 | -20000.00 | -3.861004 | 20 | PASS |
|               |      |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | 0   | -20000.00 | -3.861004 | 20 | PASS |
|               |      |      | NV | 10  | -20000.00 | -3.861004 | 20 | PASS |
|               |      |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | 30  | -40000.00 | -7.722008 | 20 | PASS |
|               |      |      | NV | 40  | -20000.00 | -3.861004 | 20 | PASS |
|               |      |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|               |      | 5200 | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | -20 | -40000.00 | -7.692308 | 20 | PASS |
|               |      |      | NV | -10 | -20000.00 | -3.846154 | 20 | PASS |
|               |      |      | NV | 0   | -20000.00 | -3.846154 | 20 | PASS |
|               |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | 20  | -20000.00 | -3.846154 | 20 | PASS |
|               |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | 40  | -20000.00 | -3.846154 | 20 | PASS |
|               |      |      | NV | 50  | -20000.00 | -3.846154 | 20 | PASS |
|               |      | 5240 | NV | -30 | -20000.00 | -3.816794 | 20 | PASS |
|               |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | -10 | -20000.00 | -3.816794 | 20 | PASS |
|               |      |      | NV | 0   | -40000.00 | -7.633588 | 20 | PASS |
|               |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | 30  | -20000.00 | -3.816794 | 20 | PASS |
|               |      |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|               |      | 5260 | NV | -30 | -20000.00 | -3.802281 | 20 | PASS |
|               |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | -10 | -20000.00 | -3.802281 | 20 | PASS |
|               |      |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | 20  | -20000.00 | -3.802281 | 20 | PASS |
|               |      |      | NV | 30  | -20000.00 | -3.802281 | 20 | PASS |
|               |      |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|               |      |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |

|  |  |      |    |     |           |           |    |      |
|--|--|------|----|-----|-----------|-----------|----|------|
|  |  | 5280 | NV | -30 | -20000.00 | -3.787879 | 20 | PASS |
|  |  |      | NV | -20 | -20000.00 | -3.787879 | 20 | PASS |
|  |  |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 10  | -40000.00 | -7.575758 | 20 | PASS |
|  |  |      | NV | 20  | -40000.00 | -7.575758 | 20 | PASS |
|  |  |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|  |  | 5320 | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | -30 | -20000.00 | -3.759398 | 20 | PASS |
|  |  |      | NV | -20 | -20000.00 | -3.759398 | 20 | PASS |
|  |  |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 0   | -20000.00 | -3.759398 | 20 | PASS |
|  |  |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 30  | -40000.00 | -7.518797 | 20 | PASS |
|  |  | 5500 | NV | 40  | -20000.00 | -3.759398 | 20 | PASS |
|  |  |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | -30 | -20000.00 | -3.636364 | 20 | PASS |
|  |  |      | NV | -20 | -40000.00 | -7.272727 | 20 | PASS |
|  |  |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 10  | -20000.00 | -3.636364 | 20 | PASS |
|  |  |      | NV | 20  | -20000.00 | -3.636364 | 20 | PASS |
|  |  | 5580 | NV | 30  | -20000.00 | -3.636364 | 20 | PASS |
|  |  |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 50  | -20000.00 | -3.636364 | 20 | PASS |
|  |  |      | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 0   | -20000.00 | -3.584229 | 20 | PASS |
|  |  |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|  |  | 5700 | NV | 20  | 20000.00  | 3.584229  | 20 | PASS |
|  |  |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 40  | -40000.00 | -7.168459 | 20 | PASS |
|  |  |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | -20 | -40000.00 | -7.017544 | 20 | PASS |
|  |  |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 0   | -40000.00 | -7.017544 | 20 | PASS |
|  |  | 5745 | NV | 10  | 20000.00  | 3.508772  | 20 | PASS |
|  |  |      | NV | 20  | -20000.00 | -3.508772 | 20 | PASS |
|  |  |      | NV | 30  | -40000.00 | -7.017544 | 20 | PASS |
|  |  |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 50  | -20000.00 | -3.508772 | 20 | PASS |
|  |  |      | NV | -30 | -40000.00 | -6.962576 | 20 | PASS |
|  |  |      | NV | -20 | 20000.00  | 3.481288  | 20 | PASS |
|  |  |      | NV | -10 | -40000.00 | -6.962576 | 20 | PASS |
|  |  | 5785 | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 10  | -20000.00 | -3.481288 | 20 | PASS |
|  |  |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 30  | -20000.00 | -3.481288 | 20 | PASS |
|  |  |      | NV | 40  | -20000.00 | -3.481288 | 20 | PASS |
|  |  |      | NV | 50  | -20000.00 | -3.481288 | 20 | PASS |
|  |  |      | NV | -30 | -40000.00 | -6.914434 | 20 | PASS |
|  |  |      | NV | -20 | -20000.00 | -3.457217 | 20 | PASS |
|  |  | 5825 | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 10  | -20000.00 | -3.457217 | 20 | PASS |
|  |  |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | 40  | -20000.00 | -3.457217 | 20 | PASS |
|  |  |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|  |  | 5825 | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|  |  |      | NV | -10 | -20000.00 | -3.433476 | 20 | PASS |
|  |  |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |

|               |      |      |    |     |           |            |    |      |
|---------------|------|------|----|-----|-----------|------------|----|------|
|               |      |      | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 20  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 30  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 40  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 50  | -20000.00 | -3.433476  | 20 | PASS |
| 11N40SI<br>SO | Ant1 | 5190 | NV | -30 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -20 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -10 | -40000.00 | -7.707129  | 20 | PASS |
|               |      |      | NV | 0   | -40000.00 | -7.707129  | 20 | PASS |
|               |      |      | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 20  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 30  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 40  | -40000.00 | -7.707129  | 20 | PASS |
|               |      |      | NV | 50  | 0.00      | 0.000000   | 20 | PASS |
|               |      | 5230 | NV | -30 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -20 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -10 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 0   | -40000.00 | -7.648184  | 20 | PASS |
|               |      |      | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 20  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 30  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 40  | -40000.00 | -7.648184  | 20 | PASS |
|               |      |      | NV | 50  | 0.00      | 0.000000   | 20 | PASS |
|               |      | 5270 | NV | -30 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -20 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -10 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 0   | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 20  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 30  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 40  | -40000.00 | -7.590133  | 20 | PASS |
|               |      |      | NV | 50  | 0.00      | 0.000000   | 20 | PASS |
|               |      | 5310 | NV | -30 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -20 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -10 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 0   | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 20  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 30  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 40  | -40000.00 | -7.532957  | 20 | PASS |
|               |      |      | NV | 50  | 0.00      | 0.000000   | 20 | PASS |
|               |      | 5510 | NV | -30 | -40000.00 | -7.259528  | 20 | PASS |
|               |      |      | NV | -20 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -10 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 0   | -40000.00 | -7.259528  | 20 | PASS |
|               |      |      | NV | 10  | -40000.00 | -7.259528  | 20 | PASS |
|               |      |      | NV | 20  | -80000.00 | -14.519056 | 20 | PASS |
|               |      |      | NV | 30  | -40000.00 | -7.259528  | 20 | PASS |
|               |      |      | NV | 40  | -80000.00 | -14.519056 | 20 | PASS |
|               |      |      | NV | 50  | 0.00      | 0.000000   | 20 | PASS |
|               |      | 5550 | NV | -30 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -20 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -10 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 0   | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 10  | -40000.00 | -7.207207  | 20 | PASS |
|               |      |      | NV | 20  | -40000.00 | -7.207207  | 20 | PASS |
|               |      |      | NV | 30  | -40000.00 | -7.207207  | 20 | PASS |
|               |      |      | NV | 40  | -40000.00 | -7.207207  | 20 | PASS |
|               |      |      | NV | 50  | 0.00      | 0.000000   | 20 | PASS |
|               |      | 5670 | NV | -30 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -20 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | -10 | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 0   | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 20  | 0.00      | 0.000000   | 20 | PASS |
|               |      |      | NV | 30  | 40000.00  | 7.054674   | 20 | PASS |
|               |      |      | NV | 40  | 0.00      | 0.000000   | 20 | PASS |

|                |      |           |           |            |           |           |      |      |
|----------------|------|-----------|-----------|------------|-----------|-----------|------|------|
|                |      |           | NV        | 50         | 40000.00  | 7.054674  | 20   | PASS |
|                |      | 5755      | NV        | -30        | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | -20        | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | -10        | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | 0          | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | 10         | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | 20         | -40000.00 | -6.950478 | 20   | PASS |
|                |      |           | NV        | 30         | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | 40         | 0.00      | 0.000000  | 20   | PASS |
|                |      | NV        | 50        | 0.00       | 0.000000  | 20        | PASS |      |
|                |      | 5795      | NV        | -30        | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | -20        | -40000.00 | -6.902502 | 20   | PASS |
|                |      |           | NV        | -10        | -40000.00 | -6.902502 | 20   | PASS |
|                |      |           | NV        | 0          | -40000.00 | -6.902502 | 20   | PASS |
|                |      |           | NV        | 10         | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | 20         | 0.00      | 0.000000  | 20   | PASS |
| NV             | 30   |           | 0.00      | 0.000000   | 20        | PASS      |      |      |
| NV             | 40   |           | 0.00      | 0.000000   | 20        | PASS      |      |      |
| NV             | 50   | 0.00      | 0.000000  | 20         | PASS      |           |      |      |
| 11AC20<br>SISO | Ant1 | 5180      | NV        | -30        | -40000.00 | -7.722008 | 20   | PASS |
|                |      |           | NV        | -20        | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | -10        | -20000.00 | -3.861004 | 20   | PASS |
|                |      |           | NV        | 0          | -20000.00 | -3.861004 | 20   | PASS |
|                |      |           | NV        | 10         | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | 20         | -20000.00 | -3.861004 | 20   | PASS |
|                |      |           | NV        | 30         | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | 40         | 0.00      | 0.000000  | 20   | PASS |
|                |      | NV        | 50        | -20000.00  | -3.861004 | 20        | PASS |      |
|                |      | 5200      | NV        | -30        | -20000.00 | -3.846154 | 20   | PASS |
|                |      |           | NV        | -20        | -20000.00 | -3.846154 | 20   | PASS |
|                |      |           | NV        | -10        | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | 0          | -20000.00 | -3.846154 | 20   | PASS |
|                |      |           | NV        | 10         | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | 20         | -20000.00 | -3.846154 | 20   | PASS |
|                |      |           | NV        | 30         | -20000.00 | -3.846154 | 20   | PASS |
|                |      |           | NV        | 40         | -20000.00 | -3.846154 | 20   | PASS |
|                |      | NV        | 50        | 0.00       | 0.000000  | 20        | PASS |      |
|                |      | 5240      | NV        | -30        | -20000.00 | -3.816794 | 20   | PASS |
|                |      |           | NV        | -20        | -40000.00 | -7.633588 | 20   | PASS |
|                |      |           | NV        | -10        | 0.00      | 0.000000  | 20   | PASS |
|                |      |           | NV        | 0          | -40000.00 | -7.633588 | 20   | PASS |
|                |      |           | NV        | 10         | -40000.00 | -7.633588 | 20   | PASS |
|                |      |           | NV        | 20         | -20000.00 | -3.816794 | 20   | PASS |
|                |      |           | NV        | 30         | -20000.00 | -3.816794 | 20   | PASS |
|                |      |           | NV        | 40         | -20000.00 | -3.816794 | 20   | PASS |
|                |      | NV        | 50        | -40000.00  | -7.633588 | 20        | PASS |      |
|                |      | 5260      | NV        | -30        | -20000.00 | -3.802281 | 20   | PASS |
|                |      |           | NV        | -20        | -20000.00 | -3.802281 | 20   | PASS |
|                |      |           | NV        | -10        | -40000.00 | -7.604563 | 20   | PASS |
|                |      |           | NV        | 0          | -20000.00 | -3.802281 | 20   | PASS |
|                |      |           | NV        | 10         | -20000.00 | -3.802281 | 20   | PASS |
| NV             | 20   |           | -20000.00 | -3.802281  | 20        | PASS      |      |      |
| NV             | 30   |           | 0.00      | 0.000000   | 20        | PASS      |      |      |
| NV             | 40   |           | -20000.00 | -3.802281  | 20        | PASS      |      |      |
| NV             | 50   | -20000.00 | -3.802281 | 20         | PASS      |           |      |      |
| 5280           | NV   | -30       | -20000.00 | -3.787879  | 20        | PASS      |      |      |
|                | NV   | -20       | -20000.00 | -3.787879  | 20        | PASS      |      |      |
|                | NV   | -10       | 0.00      | 0.000000   | 20        | PASS      |      |      |
|                | NV   | 0         | -20000.00 | -3.787879  | 20        | PASS      |      |      |
|                | NV   | 10        | -20000.00 | -3.787879  | 20        | PASS      |      |      |
|                | NV   | 20        | -20000.00 | -3.787879  | 20        | PASS      |      |      |
|                | NV   | 30        | -60000.00 | -11.363636 | 20        | PASS      |      |      |
|                | NV   | 40        | -20000.00 | -3.787879  | 20        | PASS      |      |      |
| NV             | 50   | -40000.00 | -7.575758 | 20         | PASS      |           |      |      |
| 5320           | NV   | -30       | -20000.00 | -3.759398  | 20        | PASS      |      |      |
|                | NV   | -20       | -40000.00 | -7.518797  | 20        | PASS      |      |      |
|                | NV   | -10       | -40000.00 | -7.518797  | 20        | PASS      |      |      |

|                |      |      |    |     |           |           |    |      |
|----------------|------|------|----|-----|-----------|-----------|----|------|
|                |      |      | NV | 0   | -20000.00 | -3.759398 | 20 | PASS |
|                |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 20  | -40000.00 | -7.518797 | 20 | PASS |
|                |      |      | NV | 30  | -40000.00 | -7.518797 | 20 | PASS |
|                |      |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 50  | -40000.00 | -7.518797 | 20 | PASS |
|                |      | 5500 | NV | -30 | -40000.00 | -7.272727 | 20 | PASS |
|                |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -10 | -40000.00 | -7.272727 | 20 | PASS |
|                |      |      | NV | 0   | -40000.00 | -7.272727 | 20 | PASS |
|                |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 20  | -20000.00 | -3.636364 | 20 | PASS |
|                |      |      | NV | 30  | -20000.00 | -3.636364 | 20 | PASS |
|                |      |      | NV | 40  | -20000.00 | -3.636364 | 20 | PASS |
|                |      |      | NV | 50  | -20000.00 | -3.636364 | 20 | PASS |
|                |      | 5580 | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -20 | -40000.00 | -7.168459 | 20 | PASS |
|                |      |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 0   | -20000.00 | -3.584229 | 20 | PASS |
|                |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 20  | -20000.00 | -3.584229 | 20 | PASS |
|                |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 50  | -40000.00 | -7.168459 | 20 | PASS |
|                |      | 5700 | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -20 | -20000.00 | -3.508772 | 20 | PASS |
|                |      |      | NV | -10 | -20000.00 | -3.508772 | 20 | PASS |
|                |      |      | NV | 0   | -20000.00 | -3.508772 | 20 | PASS |
|                |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 20  | -40000.00 | -7.017544 | 20 | PASS |
|                |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 40  | -20000.00 | -3.508772 | 20 | PASS |
|                |      |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|                |      | 5745 | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -10 | -20000.00 | -3.481288 | 20 | PASS |
|                |      |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 20  | -20000.00 | -3.481288 | 20 | PASS |
|                |      |      | NV | 30  | -40000.00 | -6.962576 | 20 | PASS |
|                |      |      | NV | 40  | -20000.00 | -3.481288 | 20 | PASS |
|                |      |      | NV | 50  | -40000.00 | -6.962576 | 20 | PASS |
|                |      | 5785 | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -10 | -40000.00 | -6.914434 | 20 | PASS |
|                |      |      | NV | 0   | -20000.00 | -3.457217 | 20 | PASS |
|                |      |      | NV | 10  | -20000.00 | -3.457217 | 20 | PASS |
|                |      |      | NV | 20  | -20000.00 | -3.457217 | 20 | PASS |
|                |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 40  | -20000.00 | -3.457217 | 20 | PASS |
|                |      |      | NV | 50  | -20000.00 | -3.457217 | 20 | PASS |
|                |      | 5825 | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -20 | -40000.00 | -6.866953 | 20 | PASS |
|                |      |      | NV | -10 | -20000.00 | -3.433476 | 20 | PASS |
|                |      |      | NV | 0   | -20000.00 | -3.433476 | 20 | PASS |
|                |      |      | NV | 10  | -20000.00 | -3.433476 | 20 | PASS |
|                |      |      | NV | 20  | 20000.00  | 3.433476  | 20 | PASS |
|                |      |      | NV | 30  | -20000.00 | -3.433476 | 20 | PASS |
|                |      |      | NV | 40  | -20000.00 | -3.433476 | 20 | PASS |
|                |      |      | NV | 50  | -20000.00 | -3.433476 | 20 | PASS |
| 11AC40<br>SISO | Ant1 | 5190 | NV | -30 | -40000.00 | -7.707129 | 20 | PASS |
|                |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 10  | -40000.00 | -7.707129 | 20 | PASS |
|                |      |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 30  | -40000.00 | -7.707129 | 20 | PASS |

|  |  |      |    |     |           |            |    |      |
|--|--|------|----|-----|-----------|------------|----|------|
|  |  |      | NV | 40  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 50  | -40000.00 | -7.707129  | 20 | PASS |
|  |  | 5230 | NV | -30 | -40000.00 | -7.648184  | 20 | PASS |
|  |  |      | NV | -20 | -40000.00 | -7.648184  | 20 | PASS |
|  |  |      | NV | -10 | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 0   | -40000.00 | -7.648184  | 20 | PASS |
|  |  |      | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 20  | -40000.00 | -7.648184  | 20 | PASS |
|  |  |      | NV | 30  | -80000.00 | -15.296367 | 20 | PASS |
|  |  |      | NV | 40  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 50  | -40000.00 | -7.648184  | 20 | PASS |
|  |  | 5270 | NV | -30 | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | -20 | -40000.00 | -7.590133  | 20 | PASS |
|  |  |      | NV | -10 | -40000.00 | -7.590133  | 20 | PASS |
|  |  |      | NV | 0   | -40000.00 | -7.590133  | 20 | PASS |
|  |  |      | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 20  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 30  | -40000.00 | -7.590133  | 20 | PASS |
|  |  |      | NV | 40  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 50  | 0.00      | 0.000000   | 20 | PASS |
|  |  | 5310 | NV | -30 | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | -20 | -40000.00 | -7.532957  | 20 | PASS |
|  |  |      | NV | -10 | -40000.00 | -7.532957  | 20 | PASS |
|  |  |      | NV | 0   | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 20  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 30  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 40  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 50  | 0.00      | 0.000000   | 20 | PASS |
|  |  | 5510 | NV | -30 | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | -20 | -40000.00 | -7.259528  | 20 | PASS |
|  |  |      | NV | -10 | -40000.00 | -7.259528  | 20 | PASS |
|  |  |      | NV | 0   | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 20  | -80000.00 | -14.519056 | 20 | PASS |
|  |  |      | NV | 30  | -40000.00 | -7.259528  | 20 | PASS |
|  |  |      | NV | 40  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 50  | -40000.00 | -7.259528  | 20 | PASS |
|  |  | 5550 | NV | -30 | -40000.00 | -7.207207  | 20 | PASS |
|  |  |      | NV | -20 | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | -10 | -40000.00 | -7.207207  | 20 | PASS |
|  |  |      | NV | 0   | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 10  | -40000.00 | -7.207207  | 20 | PASS |
|  |  |      | NV | 20  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 30  | 40000.00  | 7.207207   | 20 | PASS |
|  |  |      | NV | 40  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 50  | 0.00      | 0.000000   | 20 | PASS |
|  |  | 5670 | NV | -30 | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | -20 | 40000.00  | 7.054674   | 20 | PASS |
|  |  |      | NV | -10 | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 0   | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 20  | 40000.00  | 7.054674   | 20 | PASS |
|  |  |      | NV | 30  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 40  | 40000.00  | 7.054674   | 20 | PASS |
|  |  |      | NV | 50  | 0.00      | 0.000000   | 20 | PASS |
|  |  | 5755 | NV | -30 | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | -20 | -40000.00 | -6.950478  | 20 | PASS |
|  |  |      | NV | -10 | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 0   | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 10  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 20  | -40000.00 | -6.950478  | 20 | PASS |
|  |  |      | NV | 30  | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | 40  | -40000.00 | -6.950478  | 20 | PASS |
|  |  |      | NV | 50  | 0.00      | 0.000000   | 20 | PASS |
|  |  | 5795 | NV | -30 | 0.00      | 0.000000   | 20 | PASS |
|  |  |      | NV | -20 | 0.00      | 0.000000   | 20 | PASS |

|                |      |      |    |     |           |           |    |      |
|----------------|------|------|----|-----|-----------|-----------|----|------|
| 11AC80<br>SISO | Ant1 |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 50  | -40000.00 | -6.902502 | 20 | PASS |
|                |      | 5210 | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|                |      | 5290 | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|                |      | 5530 | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|                |      | 5610 | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |
|                |      | 5775 | NV | -30 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -20 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | -10 | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 0   | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 10  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 20  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 30  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 40  | 0.00      | 0.000000  | 20 | PASS |
|                |      |      | NV | 50  | 0.00      | 0.000000  | 20 | PASS |

End of Test Report