




Freq. Stability 20C 2.81V n20 5240MHz Ant1 0 Minutes

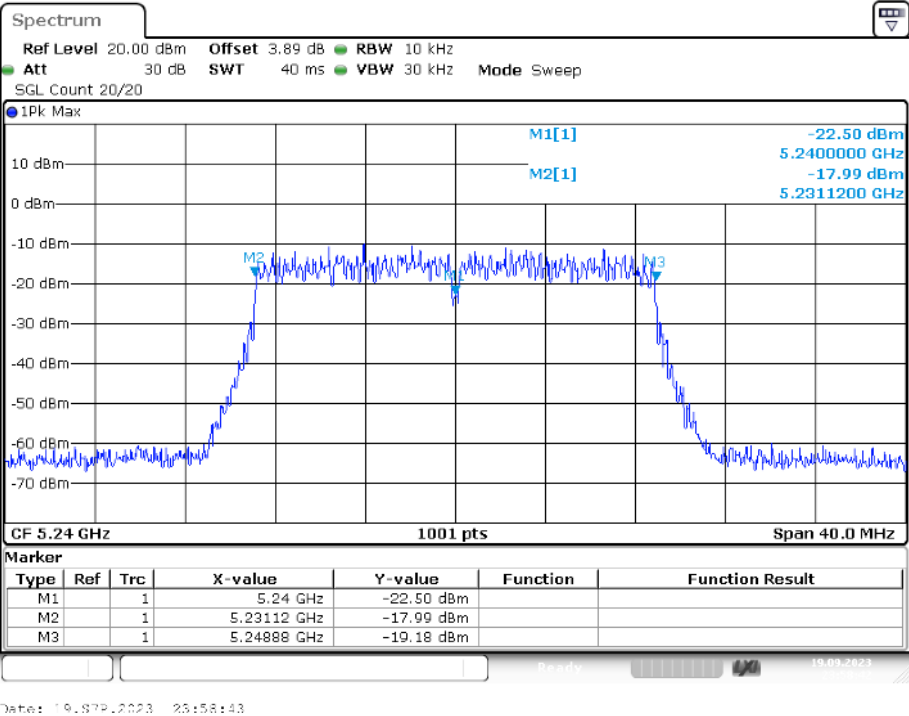


Freq. Stability 20C 3.3V n20 5240MHz Ant1 0 Minutes

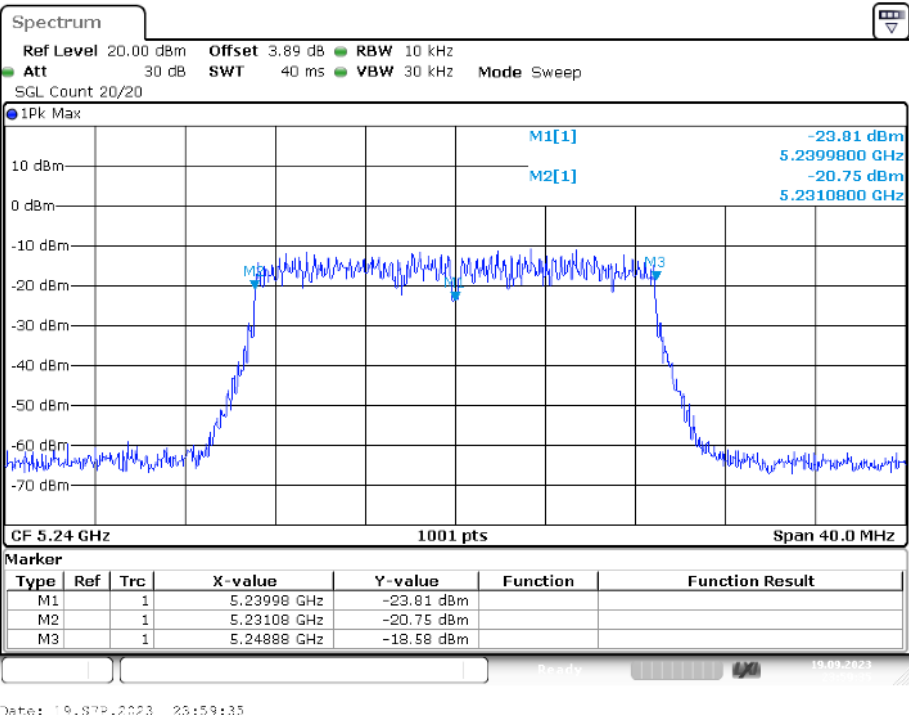


Freq. Stability 20C 3.80V n20 5240MHz Ant1 0 Minutes

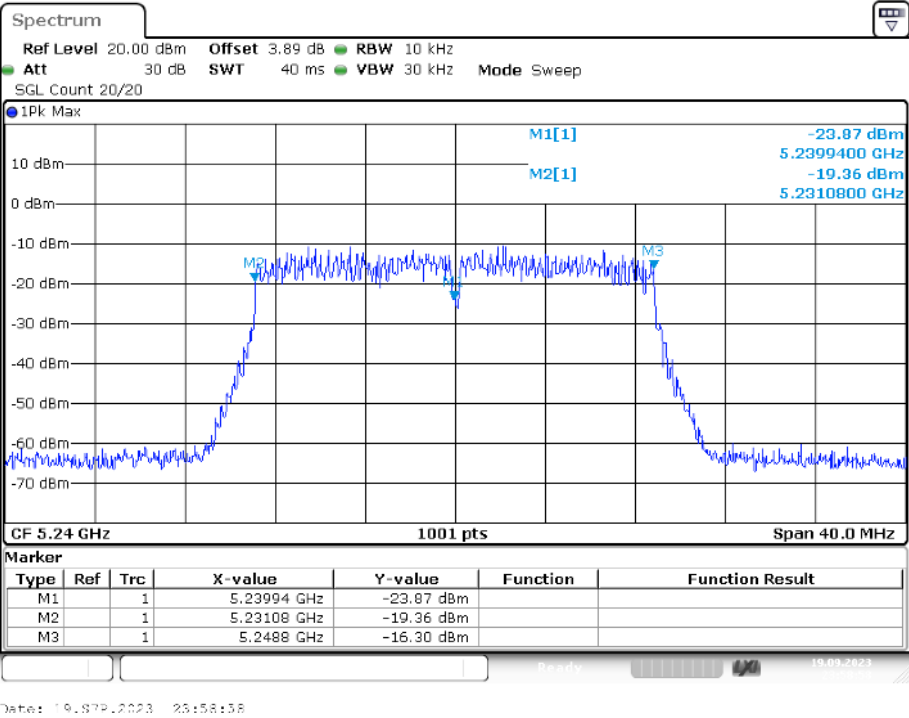

Freq. Stability -20C 3.3V n20 5240MHz Ant1 0 Minutes

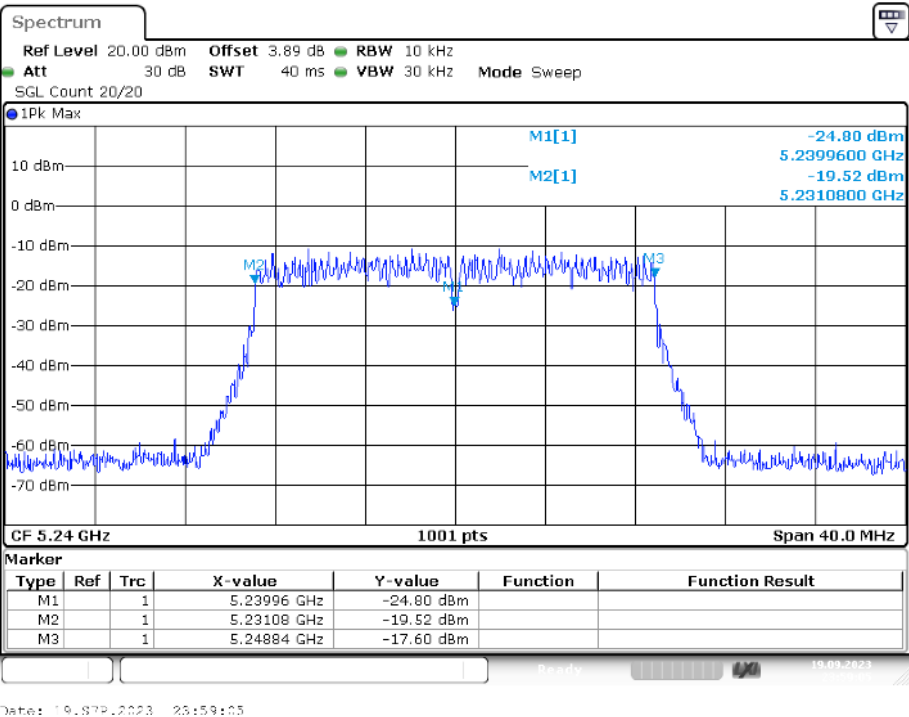


Freq. Stability -10C 3.3V n20 5240MHz Ant1 0 Minutes

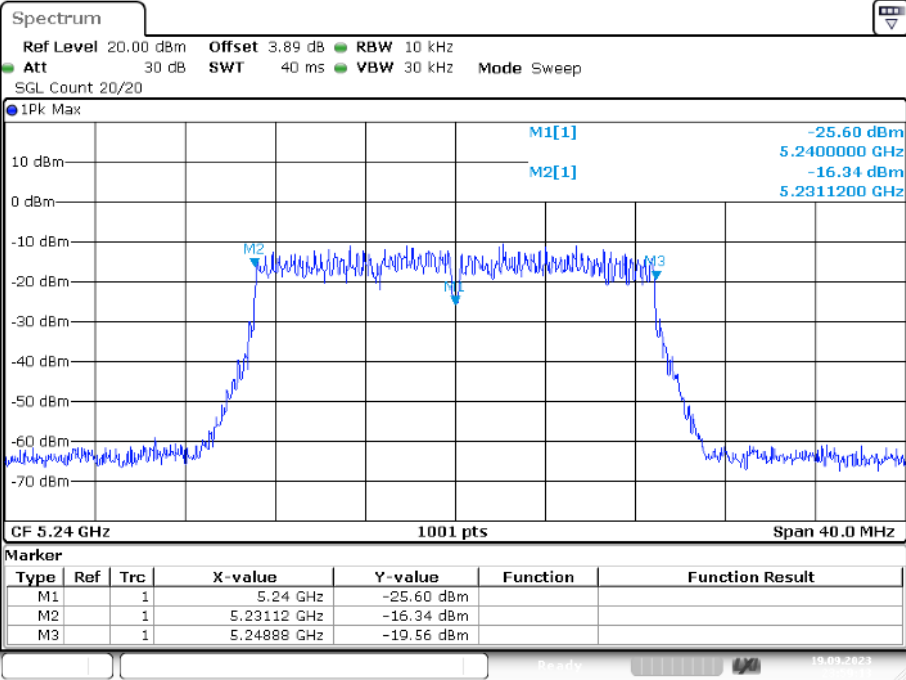


Date: 19.07.2023 23:59:13

Freq. Stability 0C 3.3V n20 5240MHz Ant1 0 Minutes

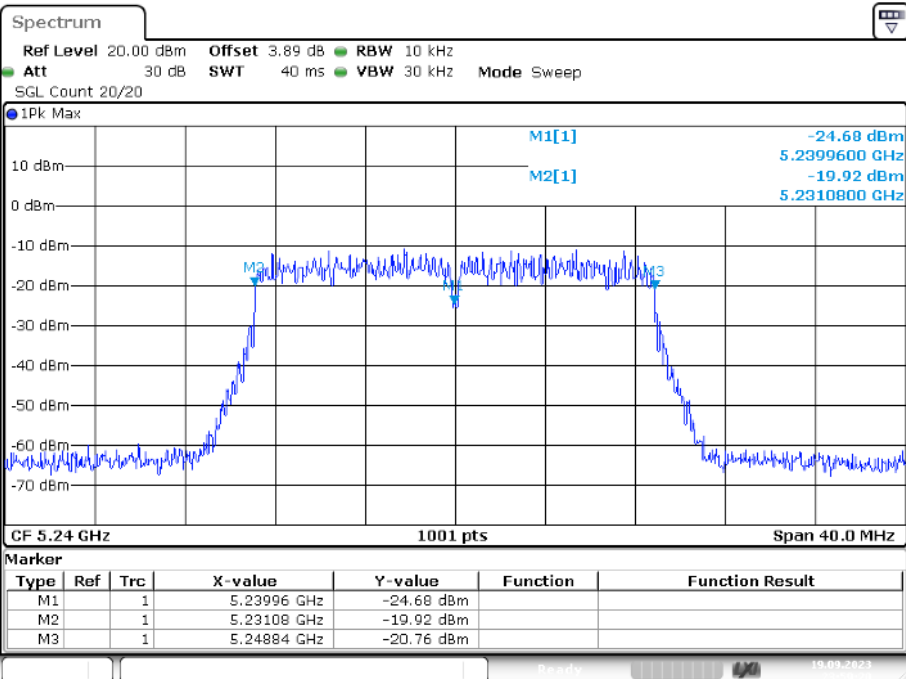


Date: 19.07.2023 23:59:20

Freq. Stability 10C 3.3V n20 5240MHz Ant1 0 Minutes

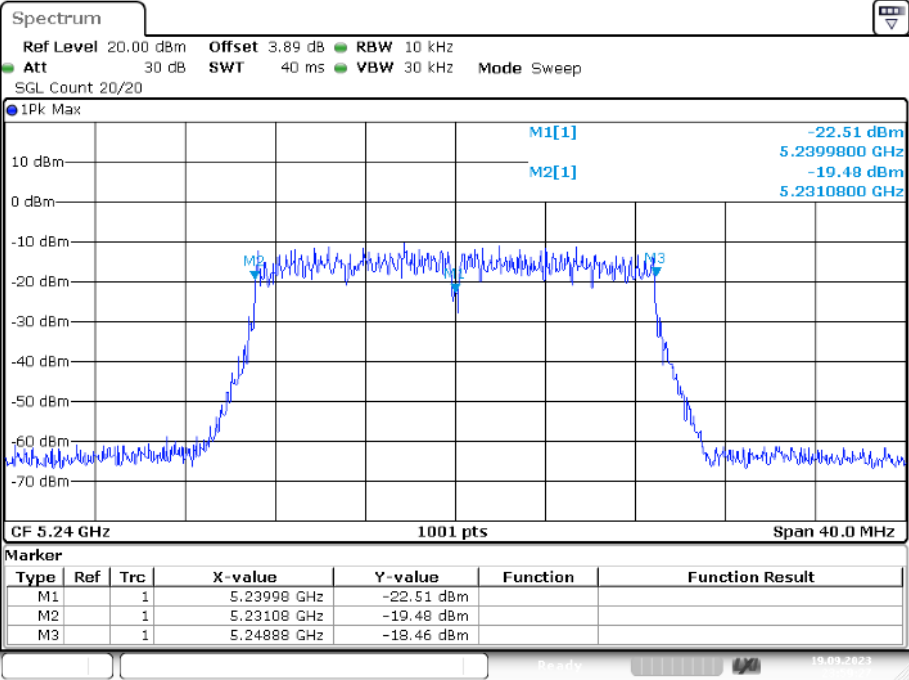


Date: 19.09.2023 23:59:27

Freq. Stability 30C 3.3V n20 5240MHz Ant1 0 Minutes

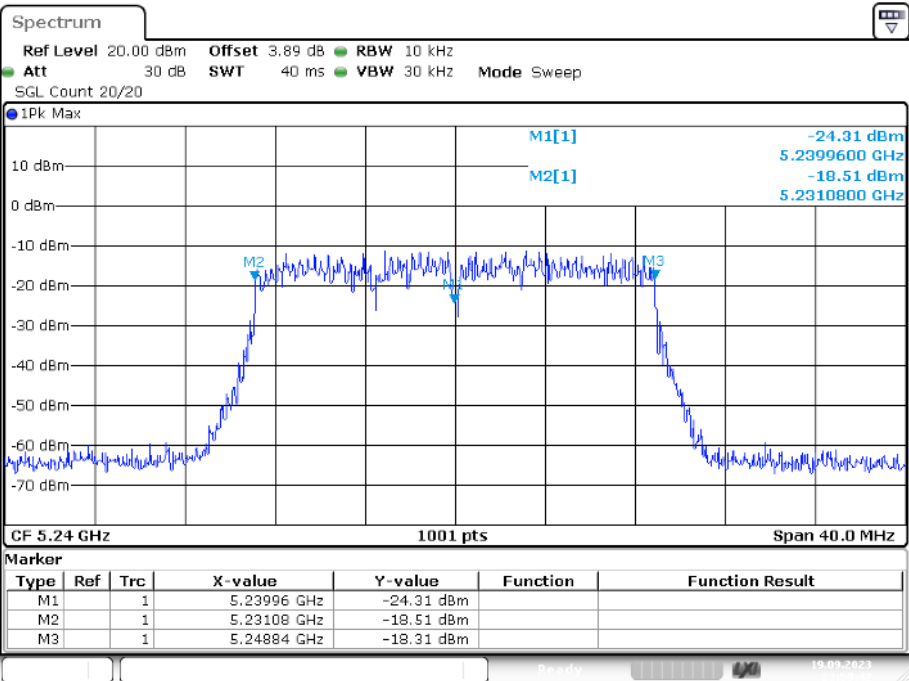


Date: 19.09.2023 23:59:42


Freq. Stability 40C 3.3V n20 5240MHz Ant1 0 Minutes

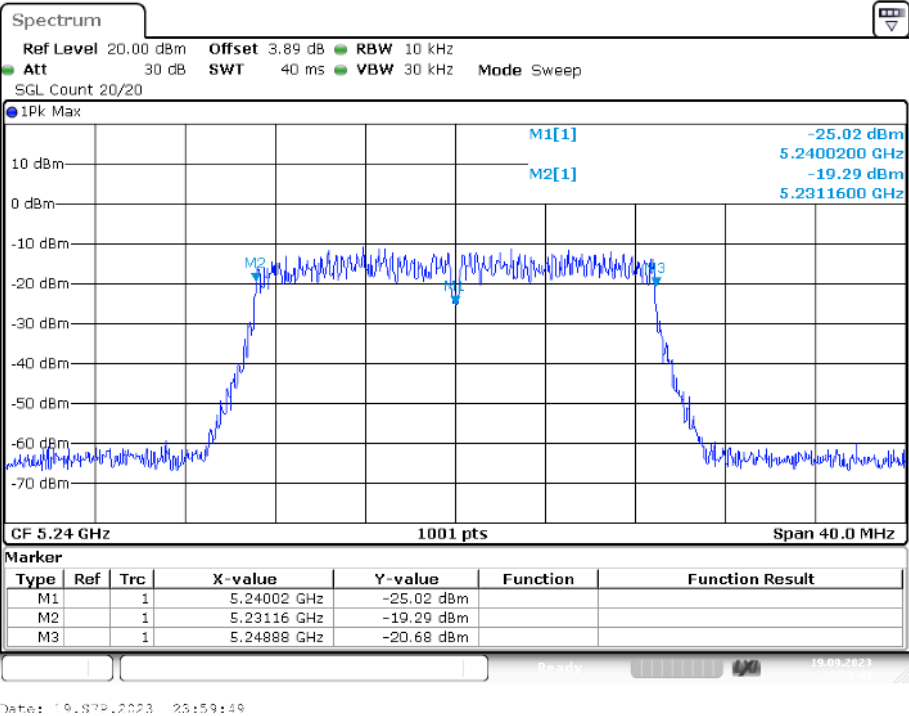

Freq. Stability 50C 3.3V n20 5240MHz Ant1 0 Minutes

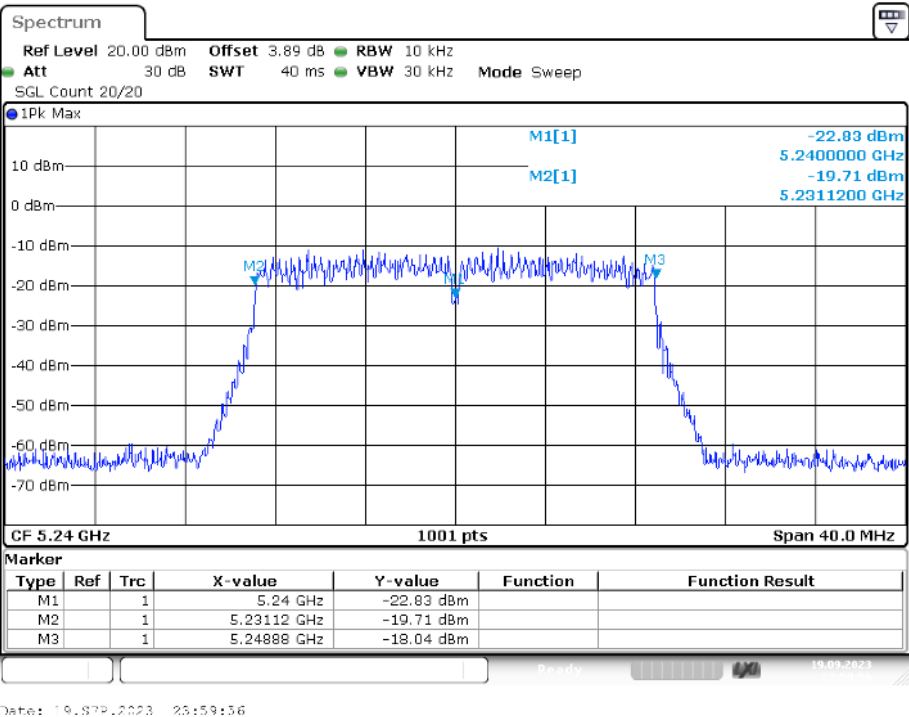


Freq. Stability 20C 2.81V n20 5260MHz Ant1 0 Minutes

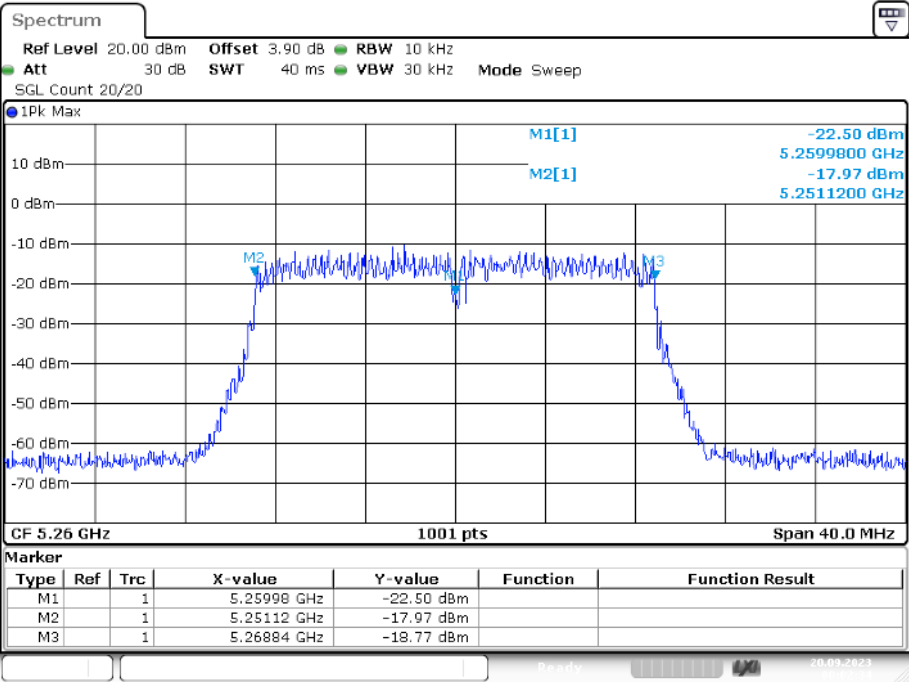


Date: 20.09.2023 00:02:34

Freq. Stability 20C 3.3V n20 5260MHz Ant1 0 Minutes

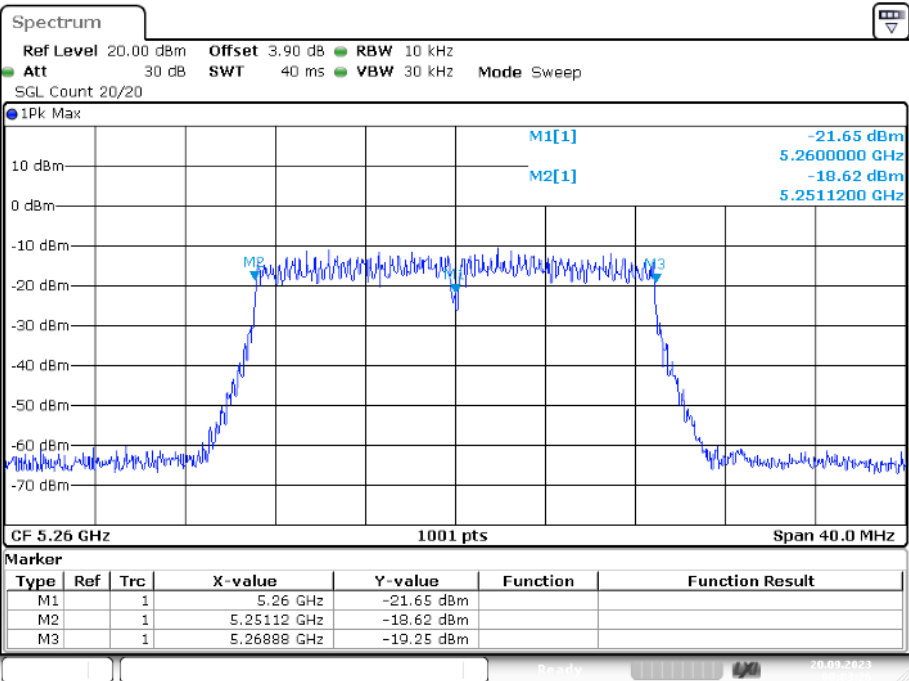


Date: 20.09.2023 00:03:25

Freq. Stability 20C 3.80V n20 5260MHz Ant1 0 Minutes

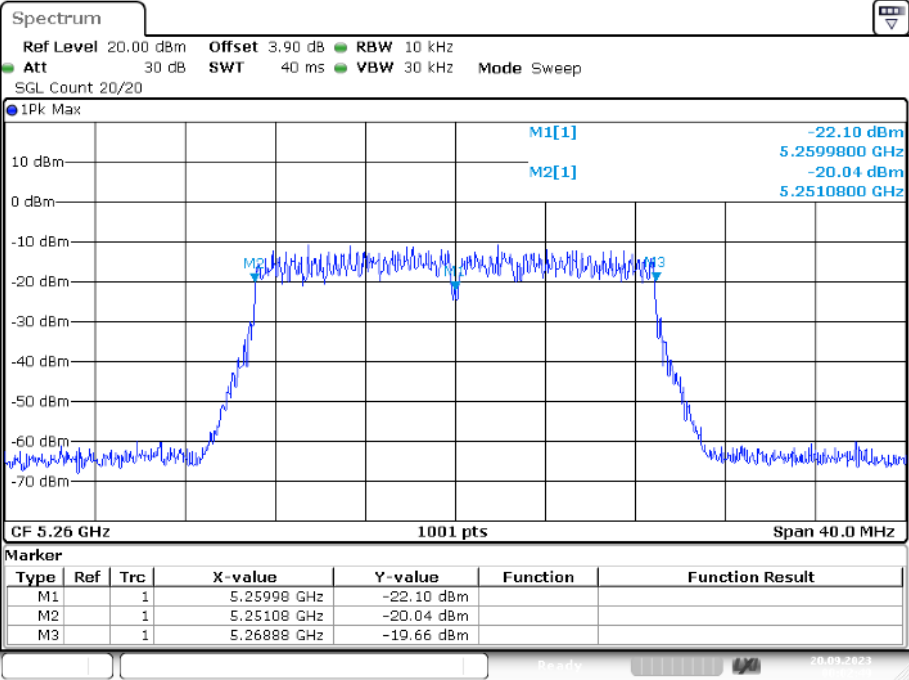


Date: 20.09.2023 00:02:49

Freq. Stability -20C 3.3V n20 5260MHz Ant1 0 Minutes

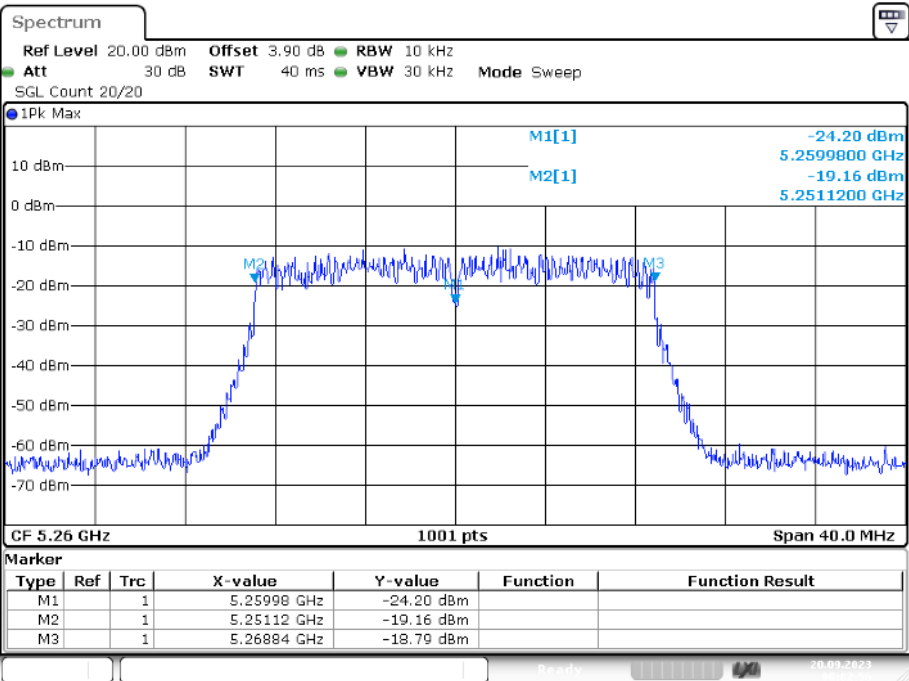


Date: 20.09.2023 00:02:56

Freq. Stability -10C 3.3V n20 5260MHz Ant1 0 Minutes

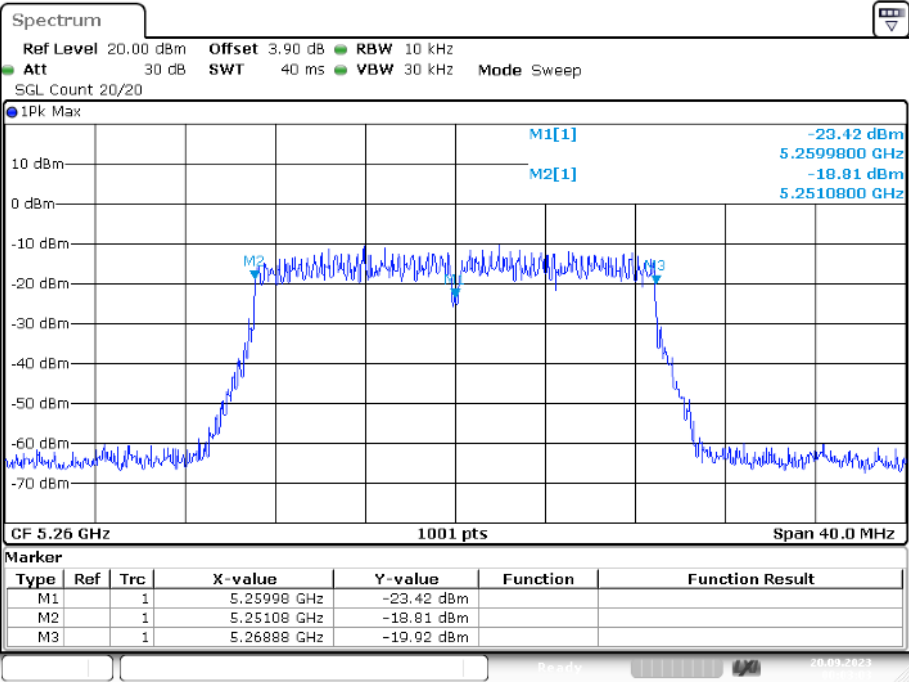


Date: 20.09.2023 00:03:03

Freq. Stability 0C 3.3V n20 5260MHz Ant1 0 Minutes

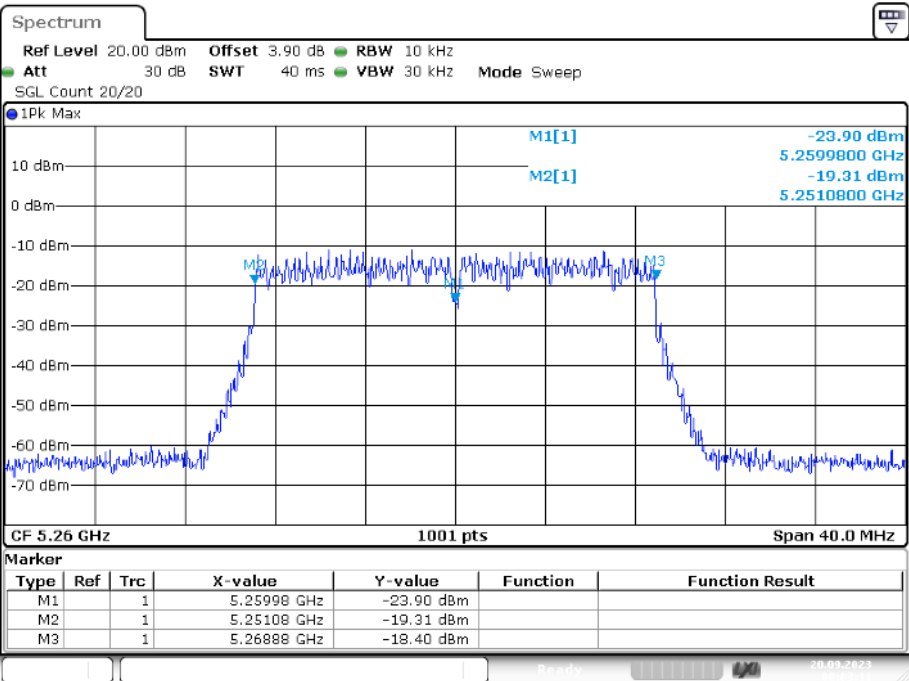


Date: 20.09.2023 00:03:11

Freq. Stability 10C 3.3V n20 5260MHz Ant1 0 Minutes

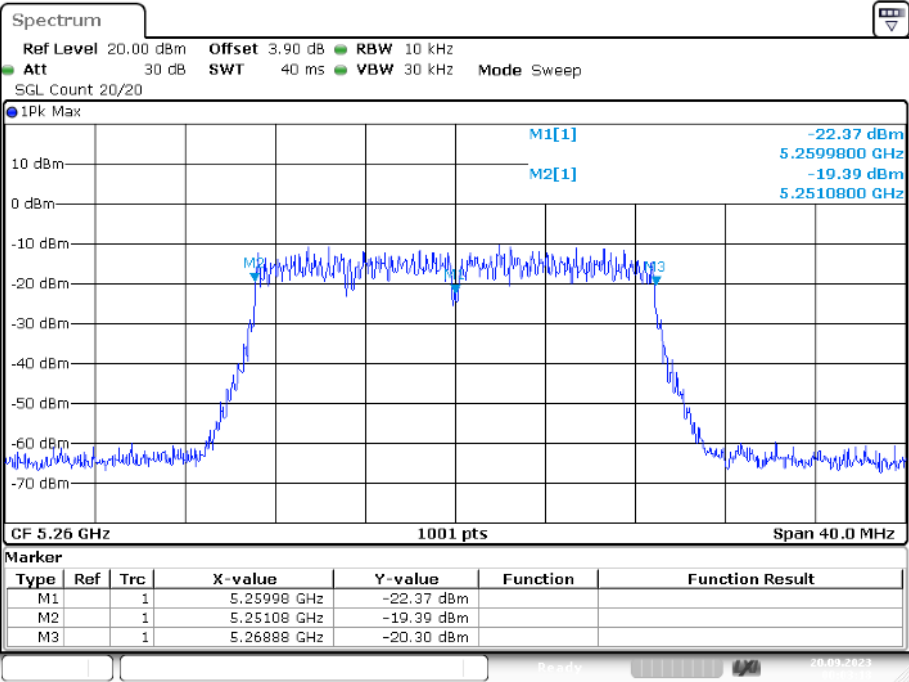


Date: 20.07.2023 00:03:18

Freq. Stability 30C 3.3V n20 5260MHz Ant1 0 Minutes

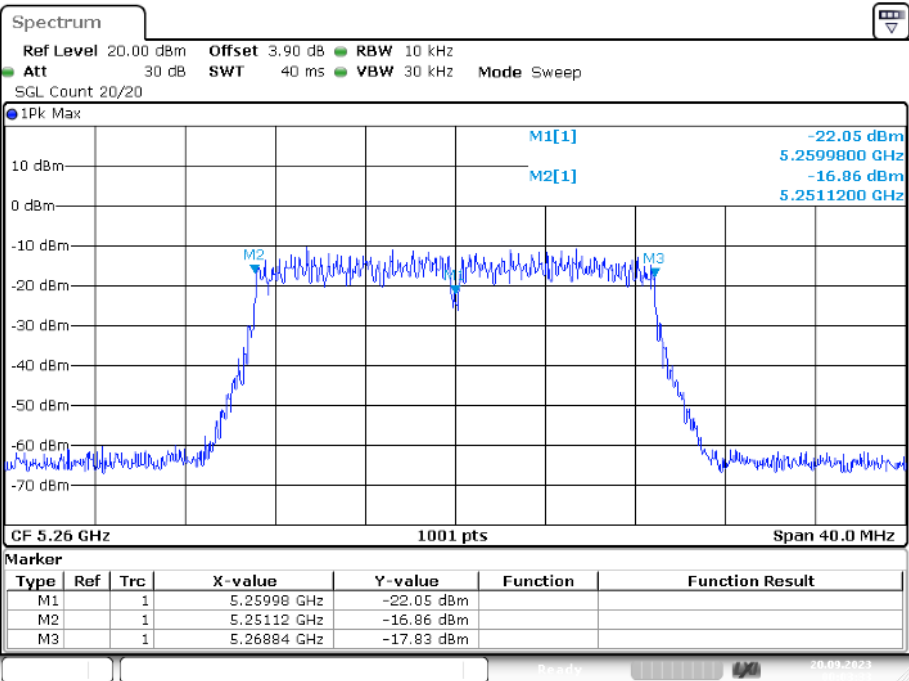


Date: 20.07.2023 00:03:33

Freq. Stability 40C 3.3V n20 5260MHz Ant1 0 Minutes

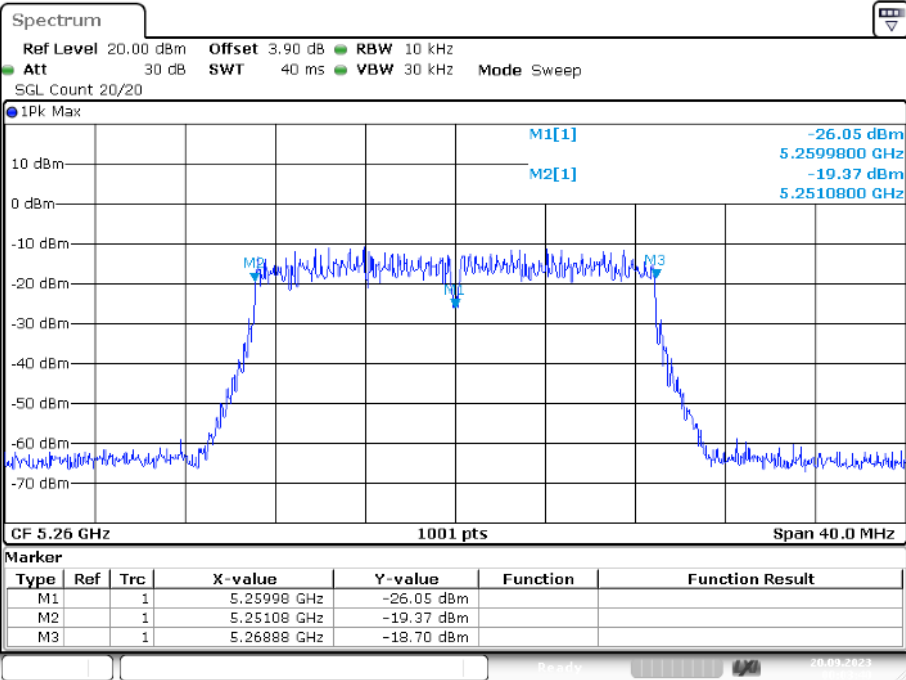


Date: 20.09.2023 00:03:40

Freq. Stability 50C 3.3V n20 5260MHz Ant1 0 Minutes

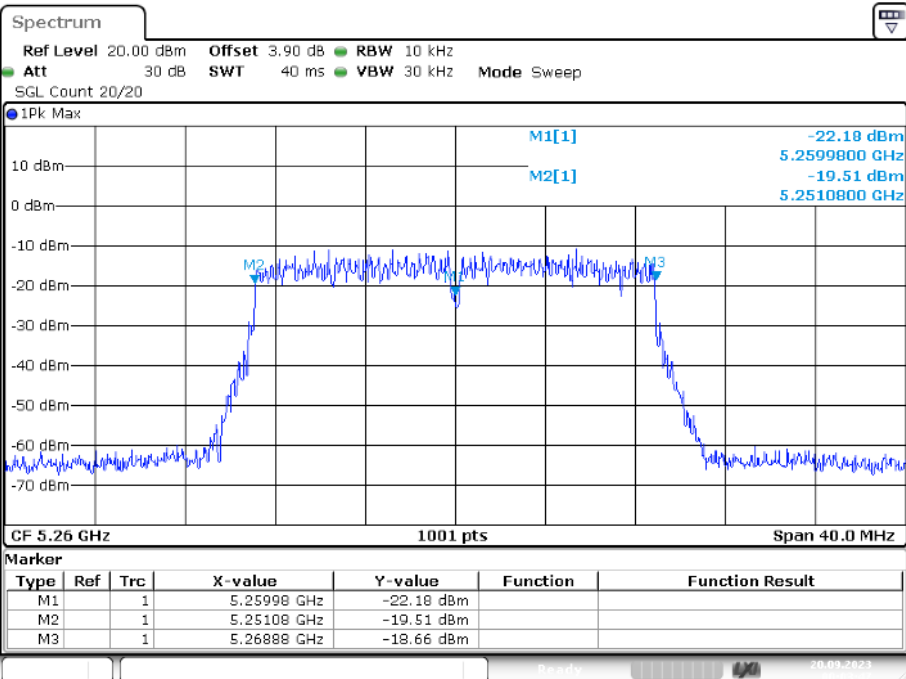


Date: 20.09.2023 00:03:47

Freq. Stability 20C 2.81V n20 5300MHz Ant1 0 Minutes

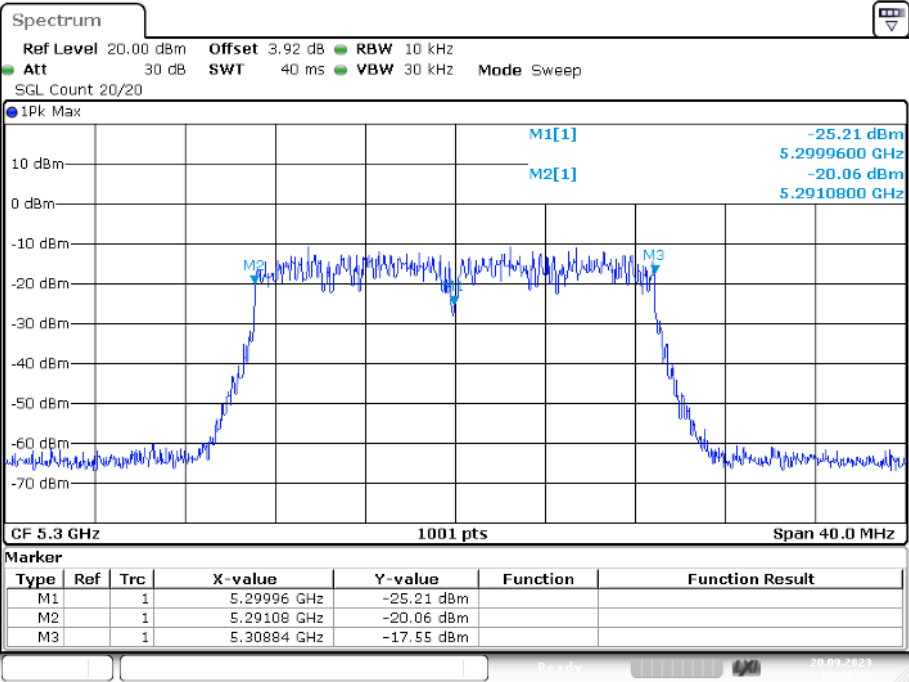


Date: 20.09.2023 00:06:21

Freq. Stability 20C 3.3V n20 5300MHz Ant1 0 Minutes

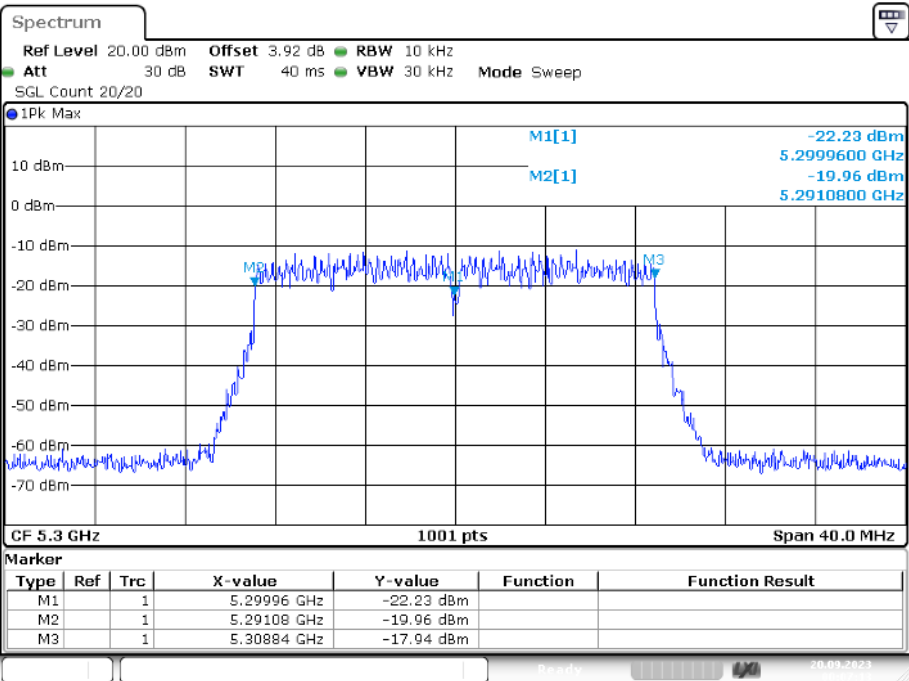


Date: 20.09.2023 00:07:13

Freq. Stability 20C 3.80V n20 5300MHz Ant1 0 Minutes

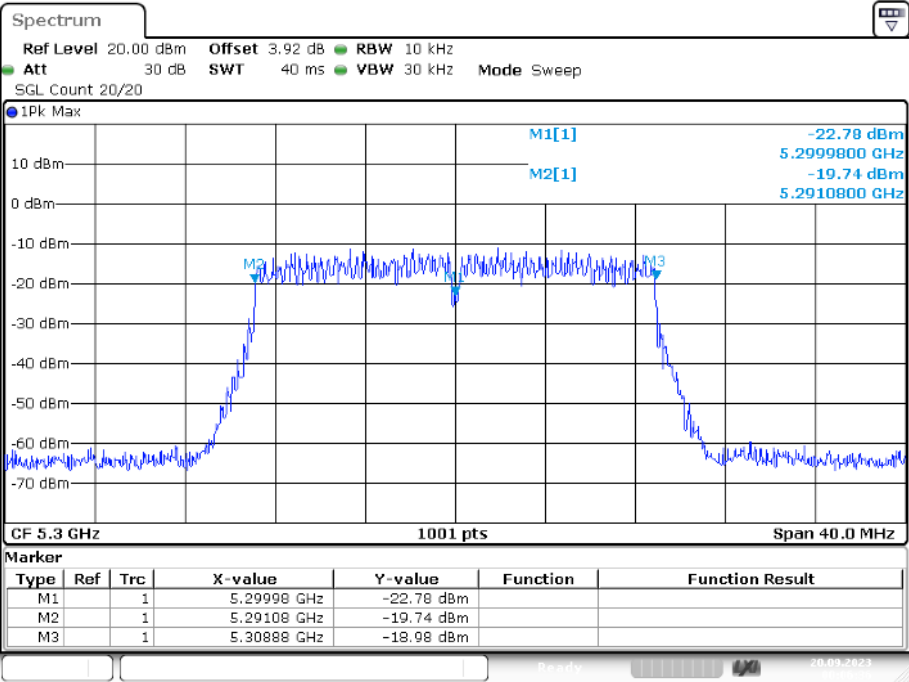


Date: 20.09.2023 00:06:36

Freq. Stability -20C 3.3V n20 5300MHz Ant1 0 Minutes

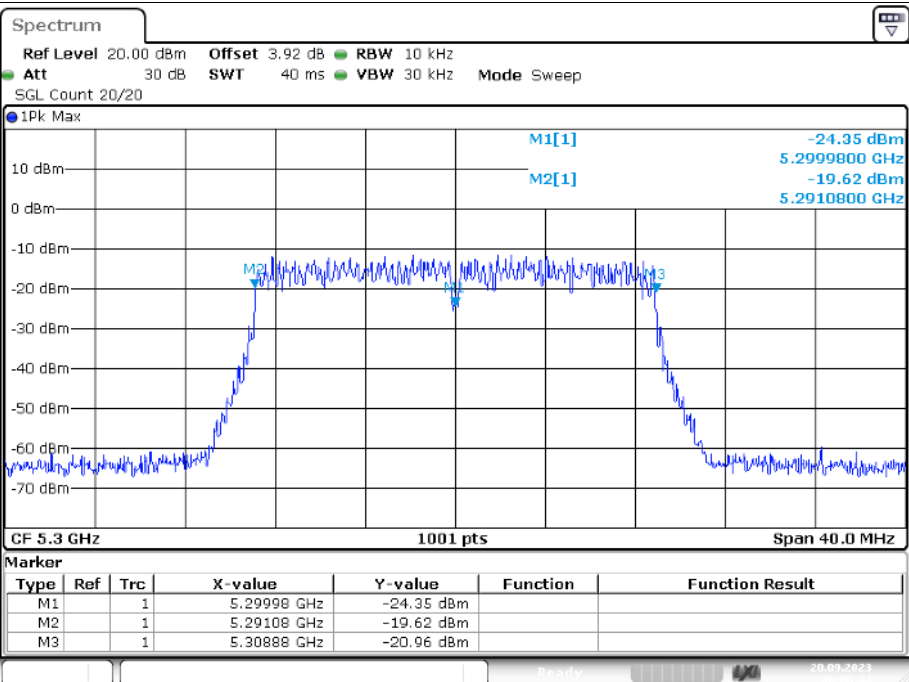


Date: 20.09.2023 00:06:43

Freq. Stability -10C 3.3V n20 5300MHz Ant1 0 Minutes

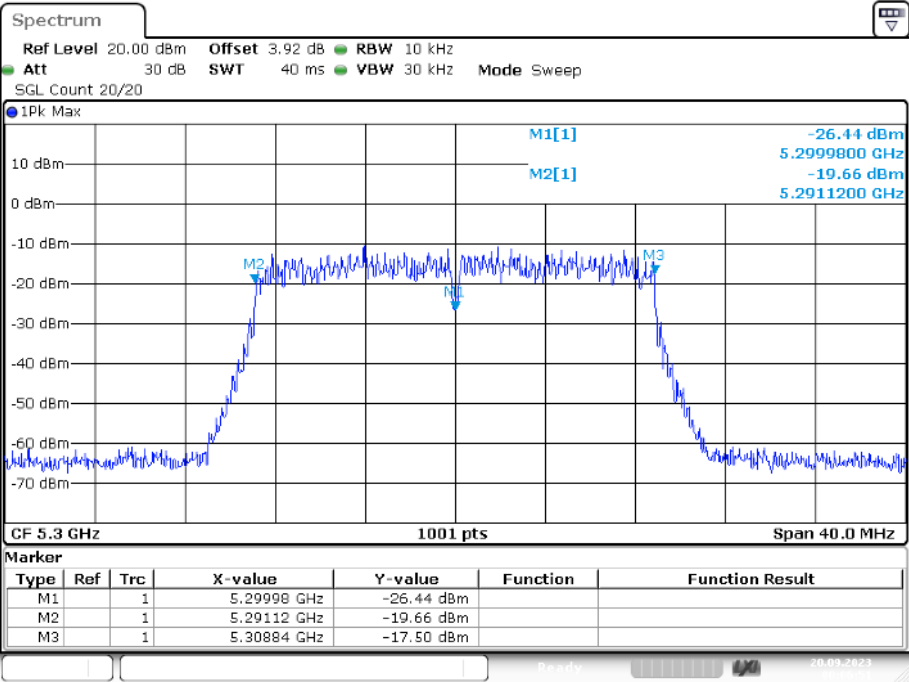


Date: 20.09.2023 00:06:51

Freq. Stability 0C 3.3V n20 5300MHz Ant1 0 Minutes

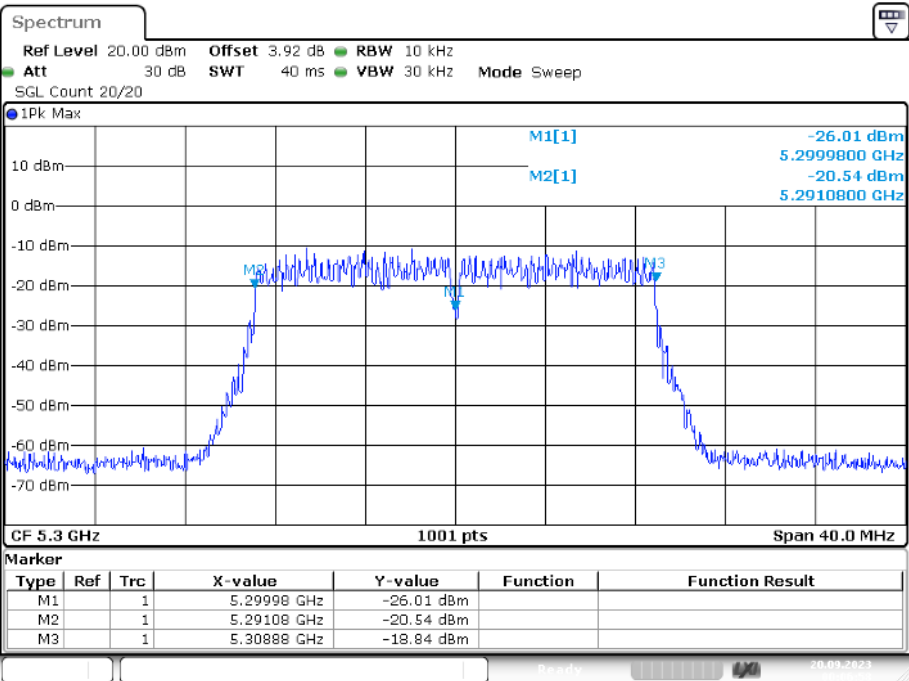


Date: 20.09.2023 00:06:58

Freq. Stability 10C 3.3V n20 5300MHz Ant1 0 Minutes

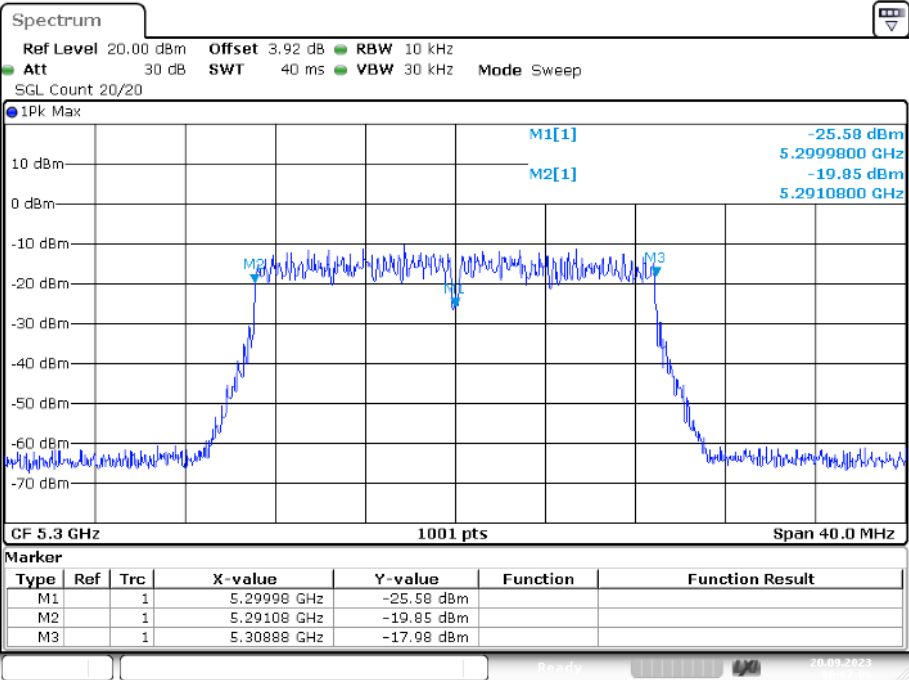


Date: 20.09.2023 00:07:05

Freq. Stability 30C 3.3V n20 5300MHz Ant1 0 Minutes

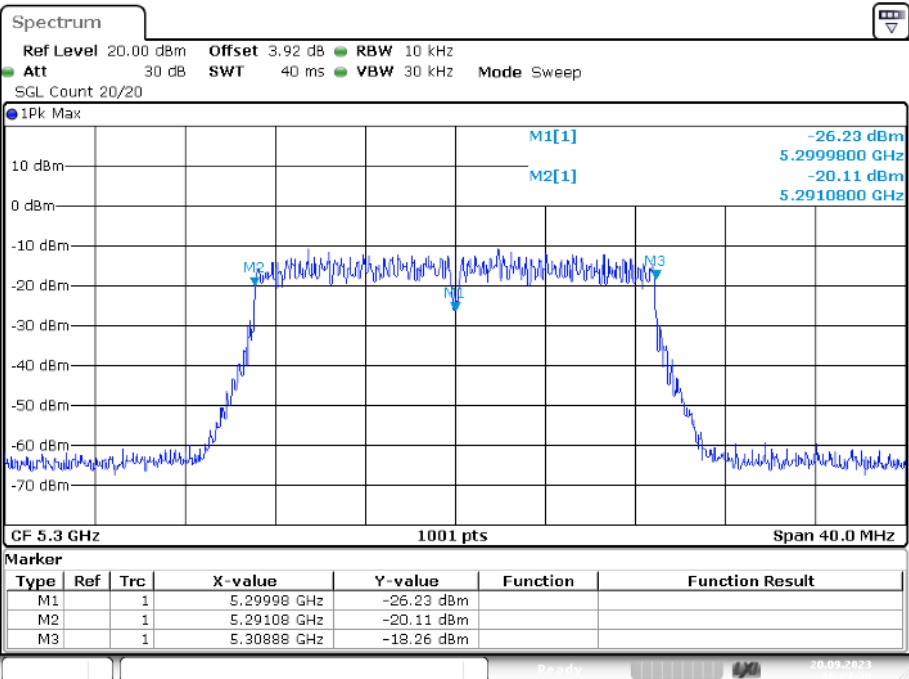


Date: 20.09.2023 00:07:20

Freq. Stability 40C 3.3V n20 5300MHz Ant1 0 Minutes

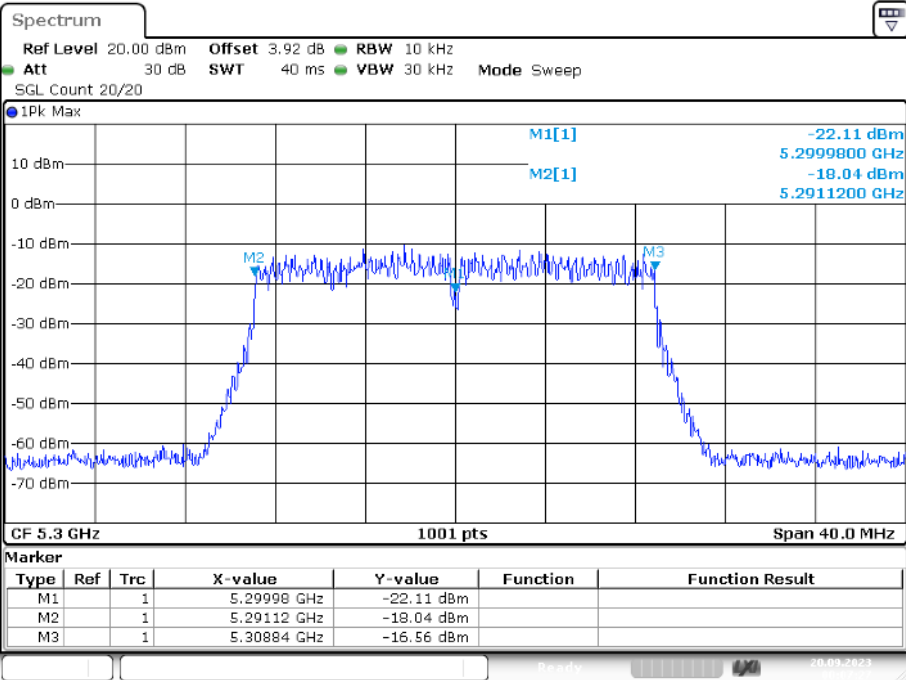


Date: 20.09.2023 00:07:27

Freq. Stability 50C 3.3V n20 5300MHz Ant1 0 Minutes

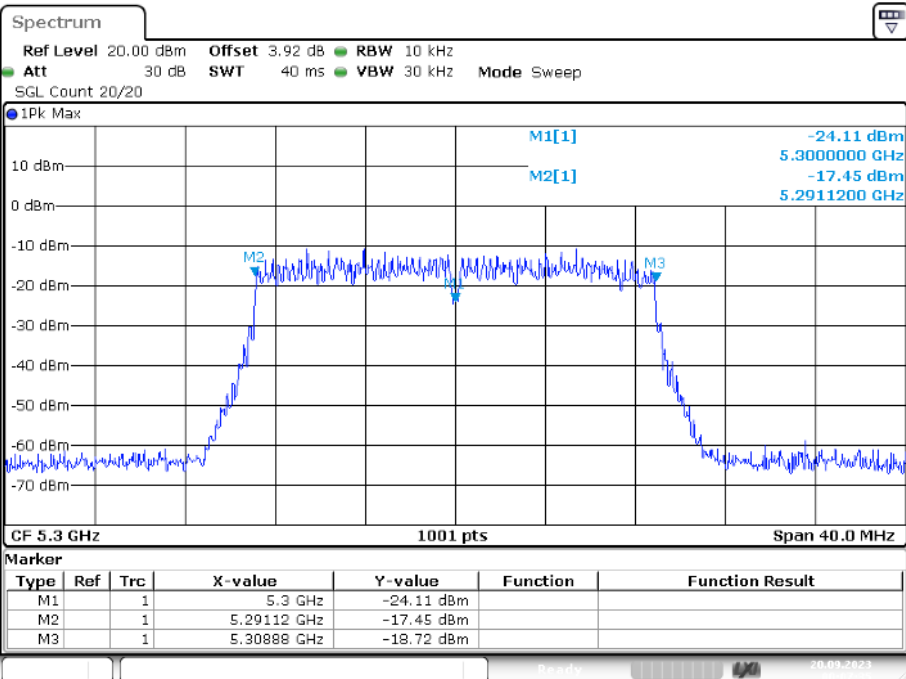


Date: 20.09.2023 00:07:35

Freq. Stability 20C 2.81V n20 5320MHz Ant1 0 Minutes

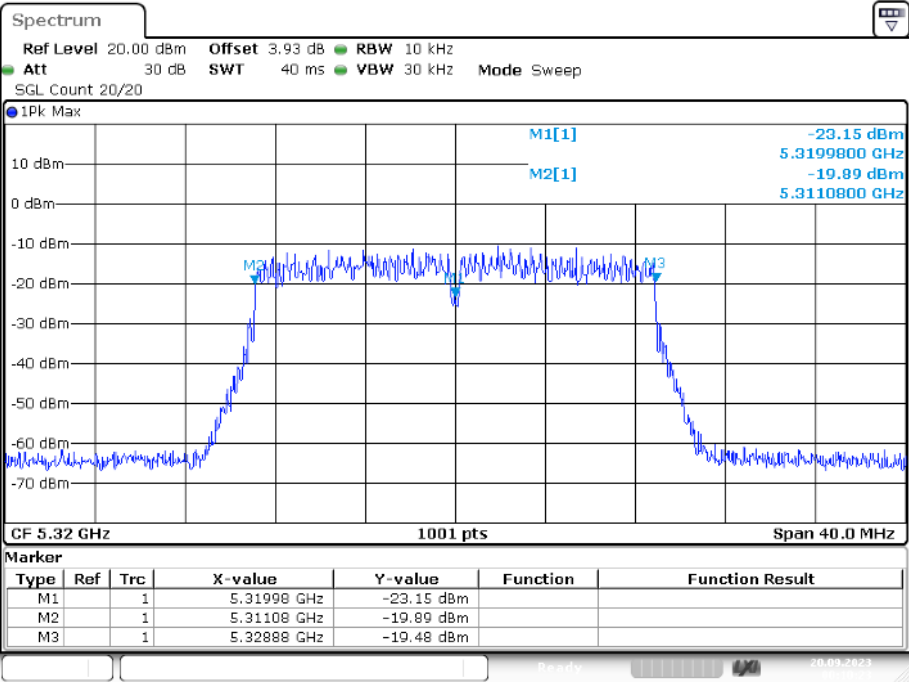


Date: 20.09.2023 00:10:24

Freq. Stability 20C 3.3V n20 5320MHz Ant1 0 Minutes

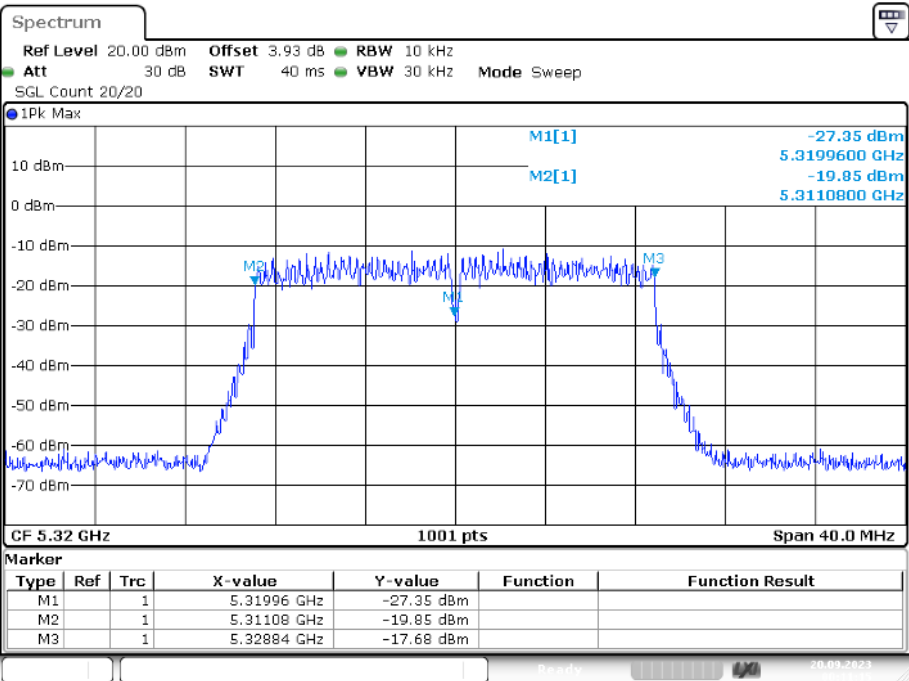


Date: 20.09.2023 00:11:15

Freq. Stability 20C 3.80V n20 5320MHz Ant1 0 Minutes

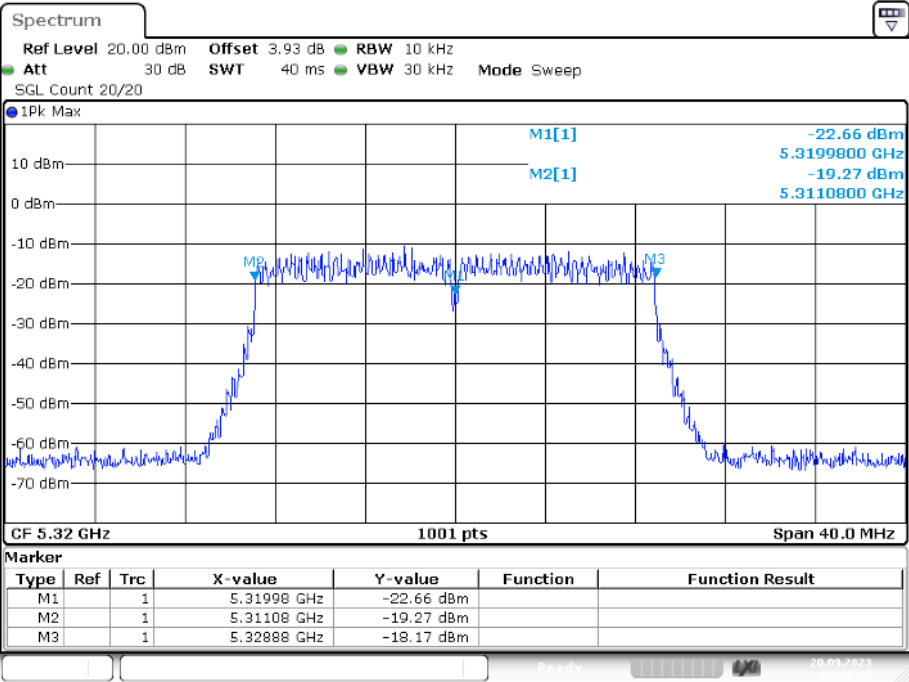


Date: 20.07.2023 00:10:38

Freq. Stability -20C 3.3V n20 5320MHz Ant1 0 Minutes

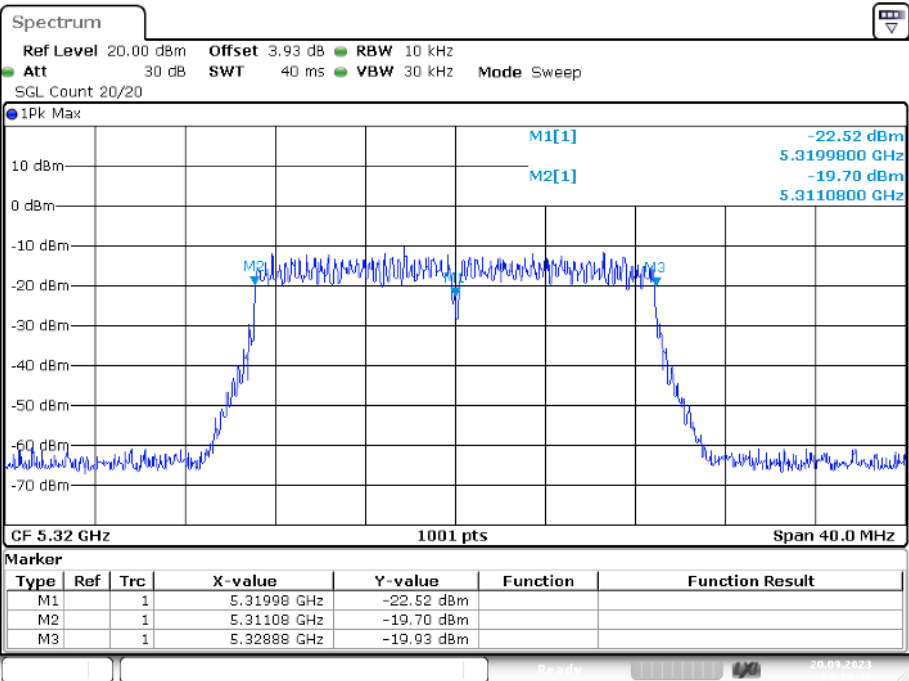


Date: 20.07.2023 00:10:46

Freq. Stability -10C 3.3V n20 5320MHz Ant1 0 Minutes

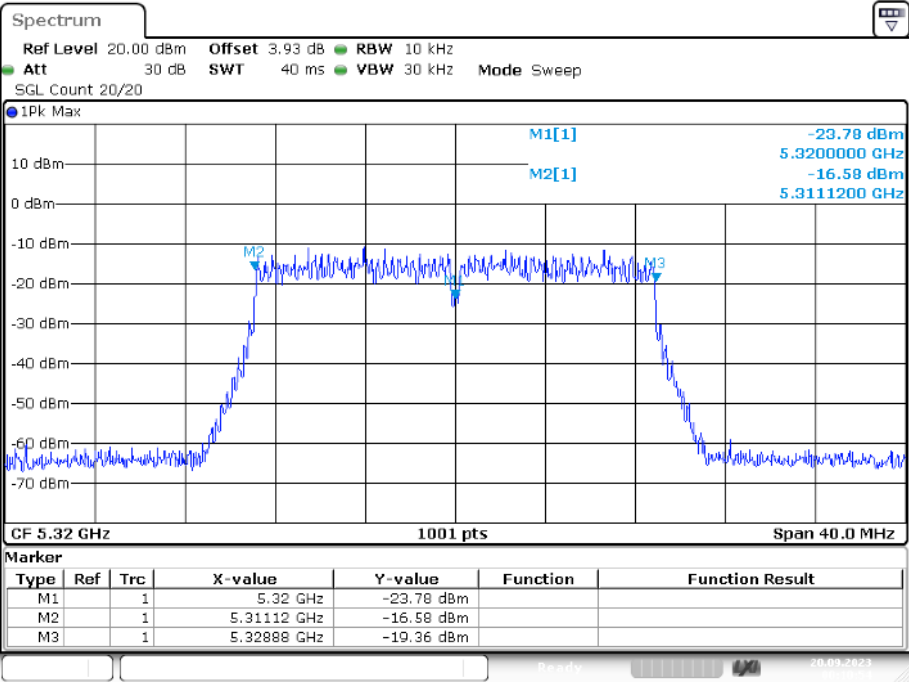


Date: 20.09.2023 00:10:53

Freq. Stability 0C 3.3V n20 5320MHz Ant1 0 Minutes

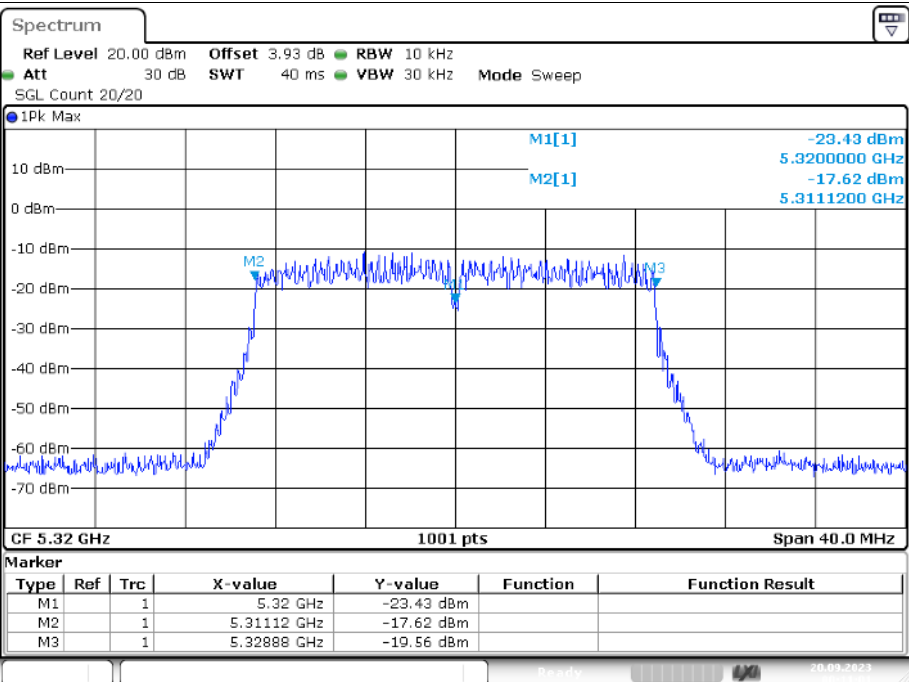


Date: 20.09.2023 00:11:01

Freq. Stability 10C 3.3V n20 5320MHz Ant1 0 Minutes

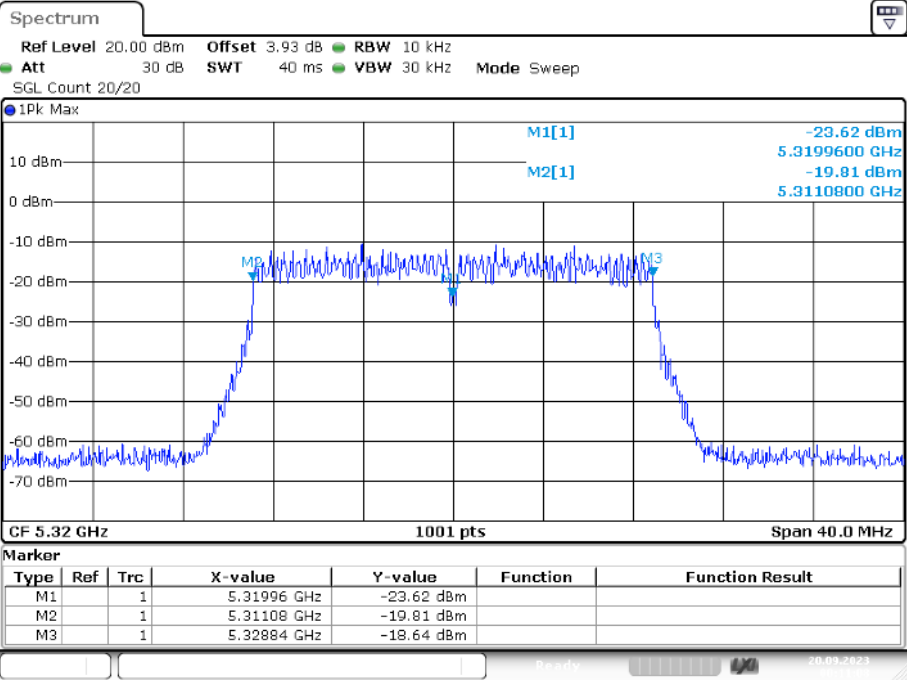


Date: 20.09.2023 00:11:08

Freq. Stability 30C 3.3V n20 5320MHz Ant1 0 Minutes

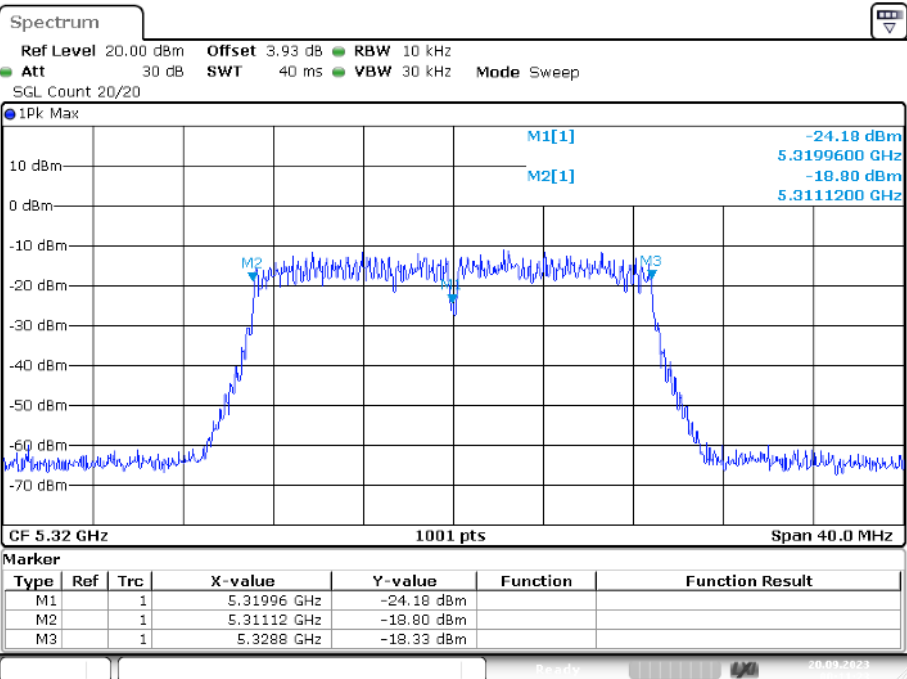


Date: 20.09.2023 00:11:23

Freq. Stability 40C 3.3V n20 5320MHz Ant1 0 Minutes

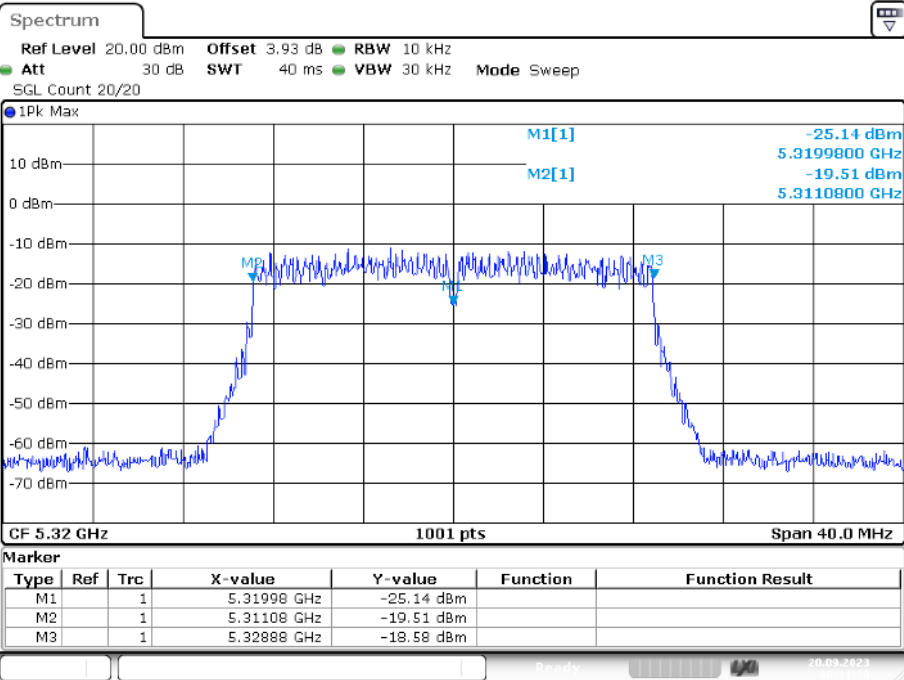


Date: 20.09.2023 00:11:30

Freq. Stability 50C 3.3V n20 5320MHz Ant1 0 Minutes

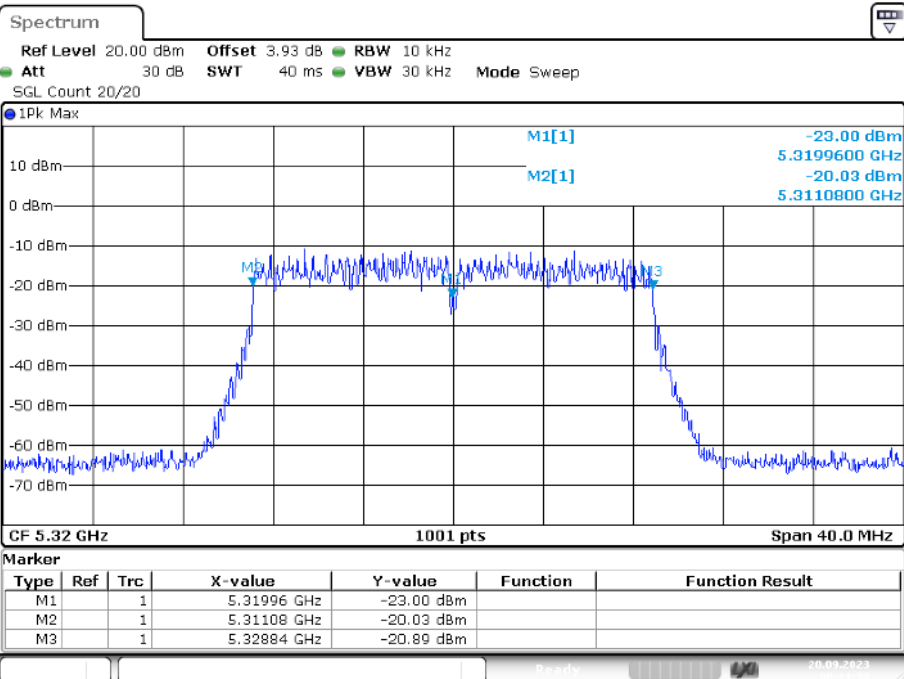


Date: 20.09.2023 00:11:37

Freq. Stability 20C 2.81V n20 5500MHz Ant1 0 Minutes

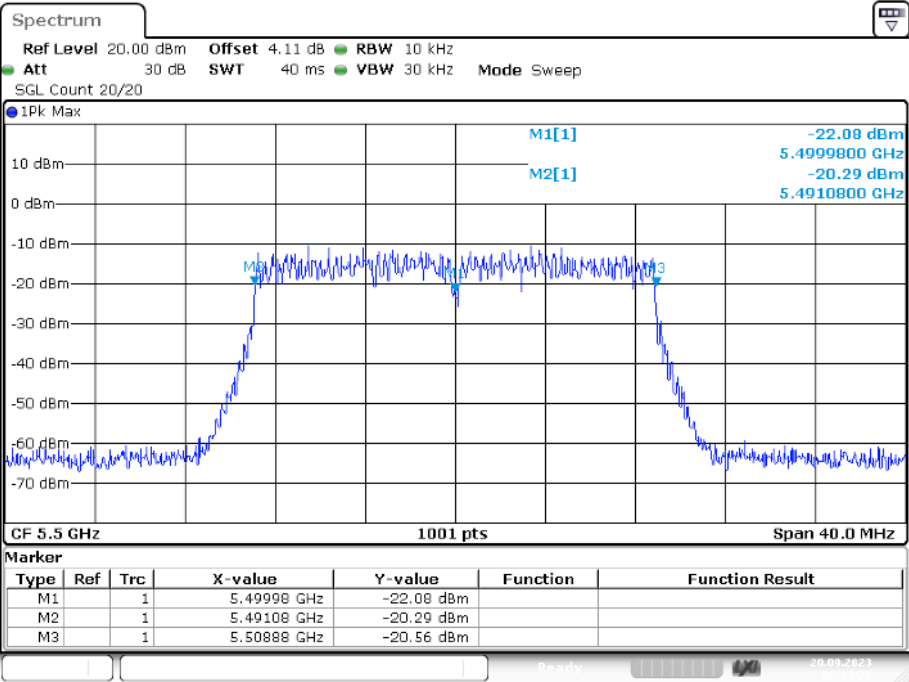


Date: 20.09.2023 00:14:27

Freq. Stability 20C 3.3V n20 5500MHz Ant1 0 Minutes

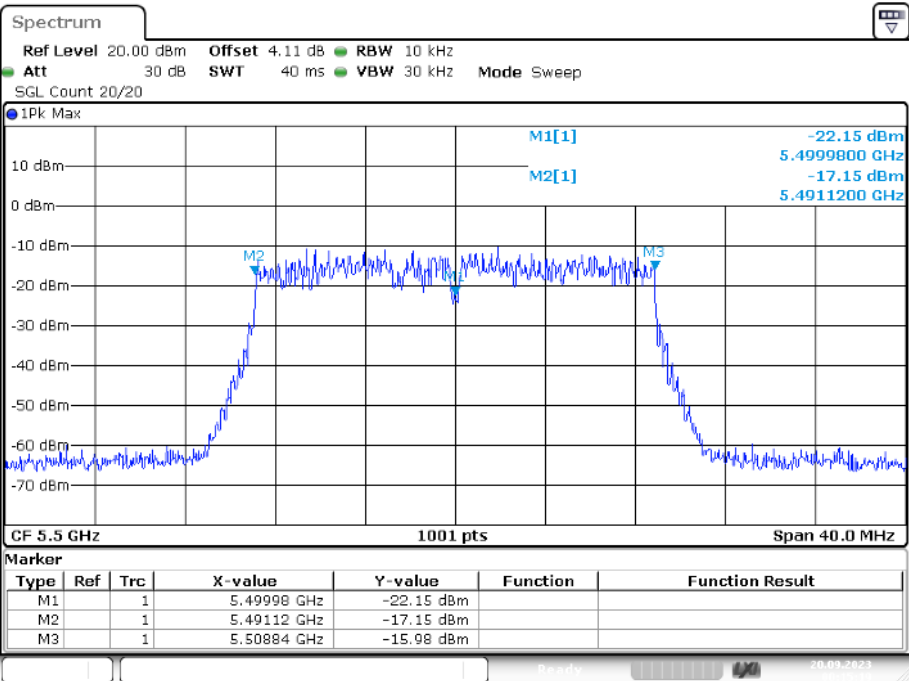


Date: 20.09.2023 00:15:19

Freq. Stability 20C 3.80V n20 5500MHz Ant1 0 Minutes

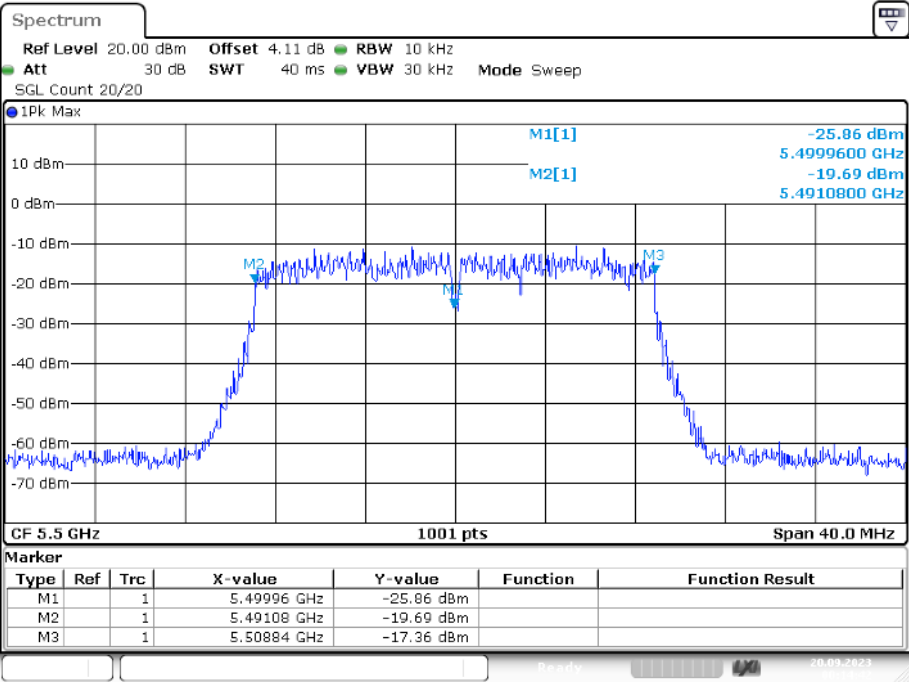


Date: 20.09.2023 00:14:42

Freq. Stability -20C 3.3V n20 5500MHz Ant1 0 Minutes

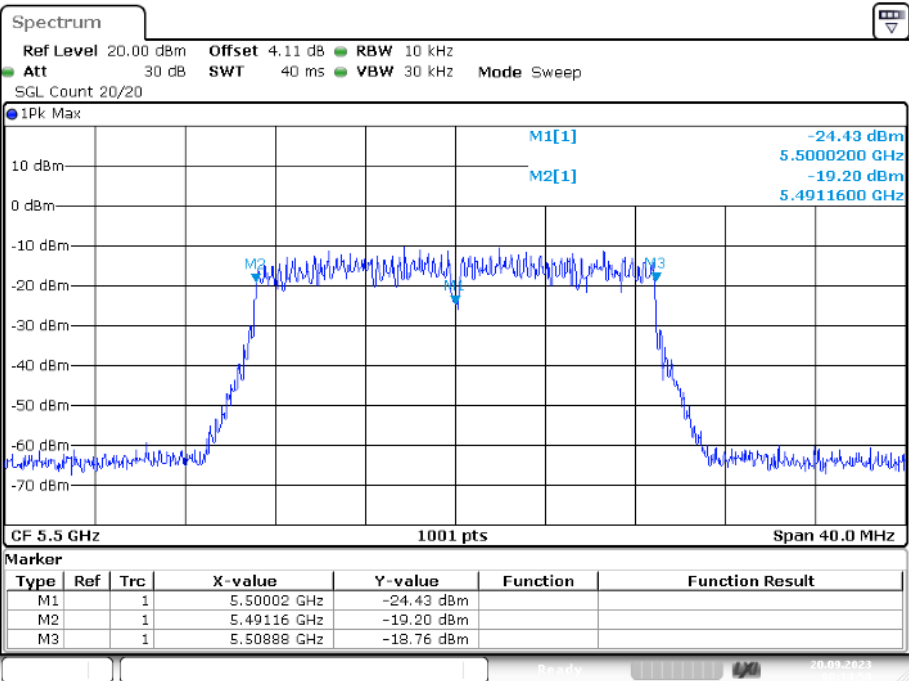


Date: 20.09.2023 00:14:49

Freq. Stability -10C 3.3V n20 5500MHz Ant1 0 Minutes

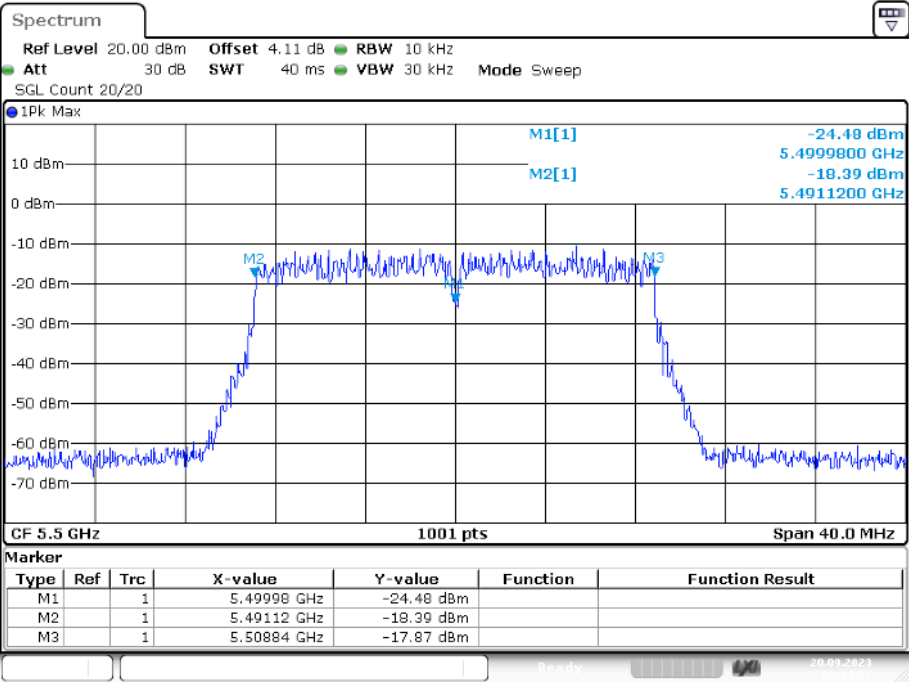


Date: 20.09.2023 00:14:37

Freq. Stability 0C 3.3V n20 5500MHz Ant1 0 Minutes

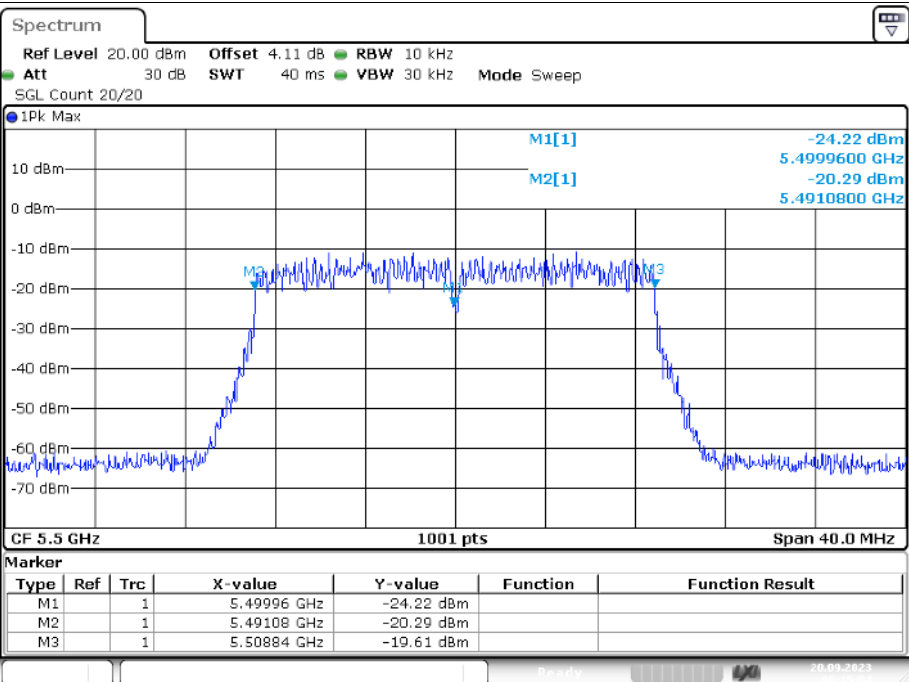


Date: 20.09.2023 00:15:04

Freq. Stability 10C 3.3V n20 5500MHz Ant1 0 Minutes

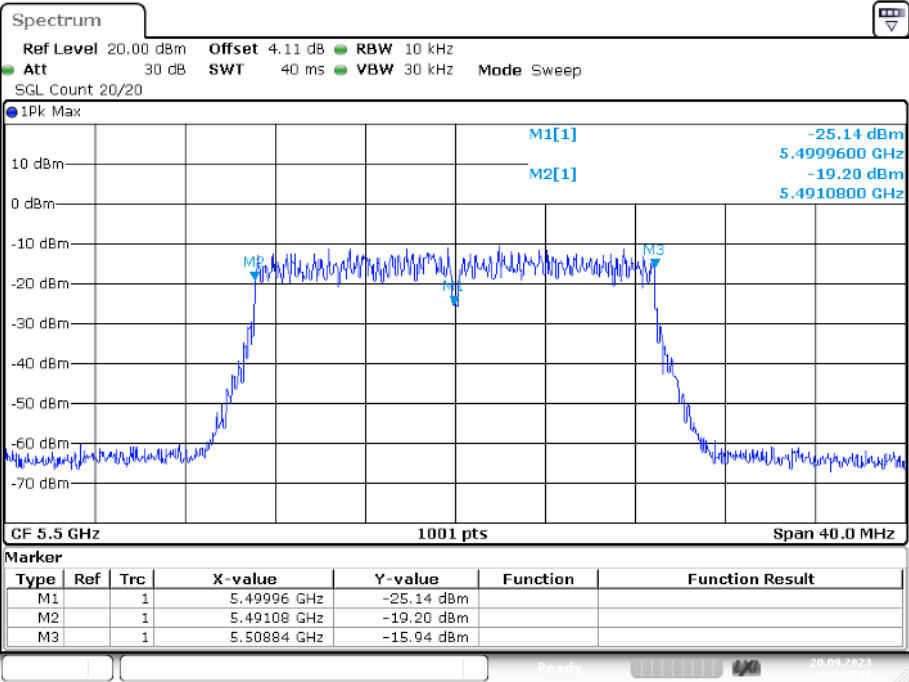


Date: 20.09.2023 00:15:11

Freq. Stability 30C 3.3V n20 5500MHz Ant1 0 Minutes

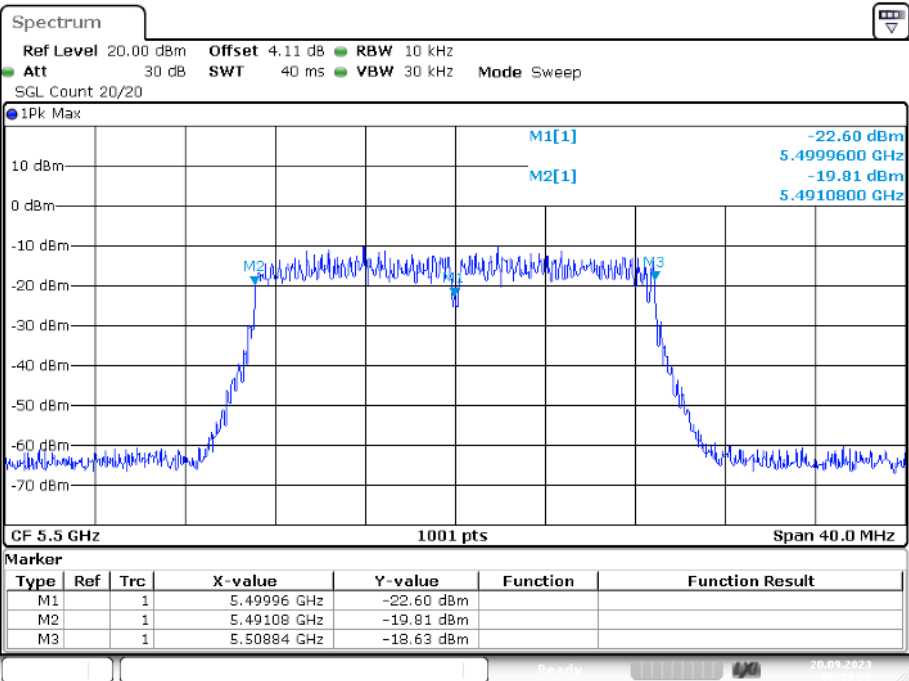


Date: 20.09.2023 00:15:26

Freq. Stability 40C 3.3V n20 5500MHz Ant1 0 Minutes

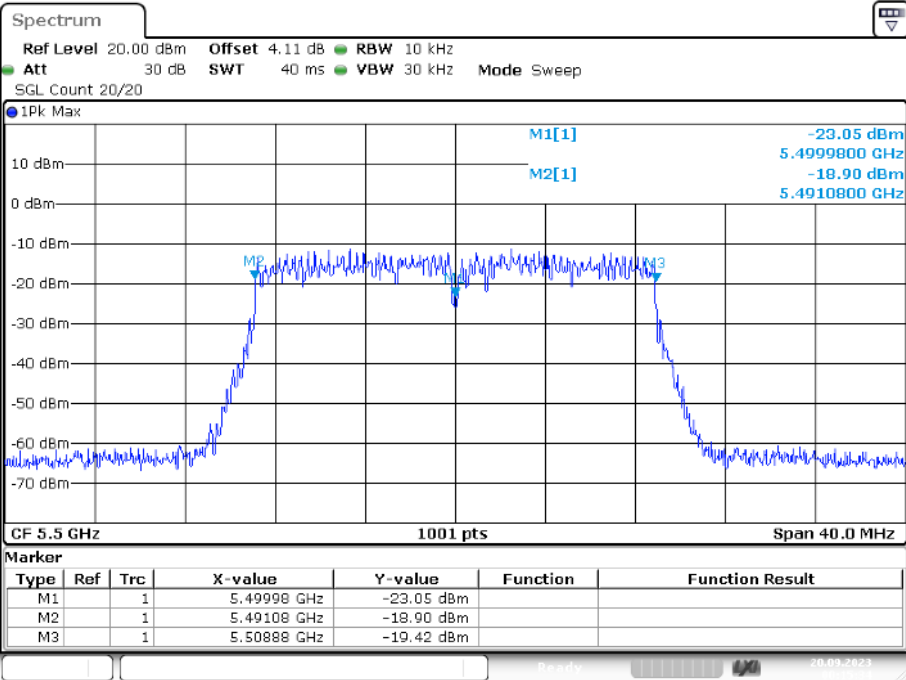


Date: 20.09.2023 00:15:33

Freq. Stability 50C 3.3V n20 5500MHz Ant1 0 Minutes

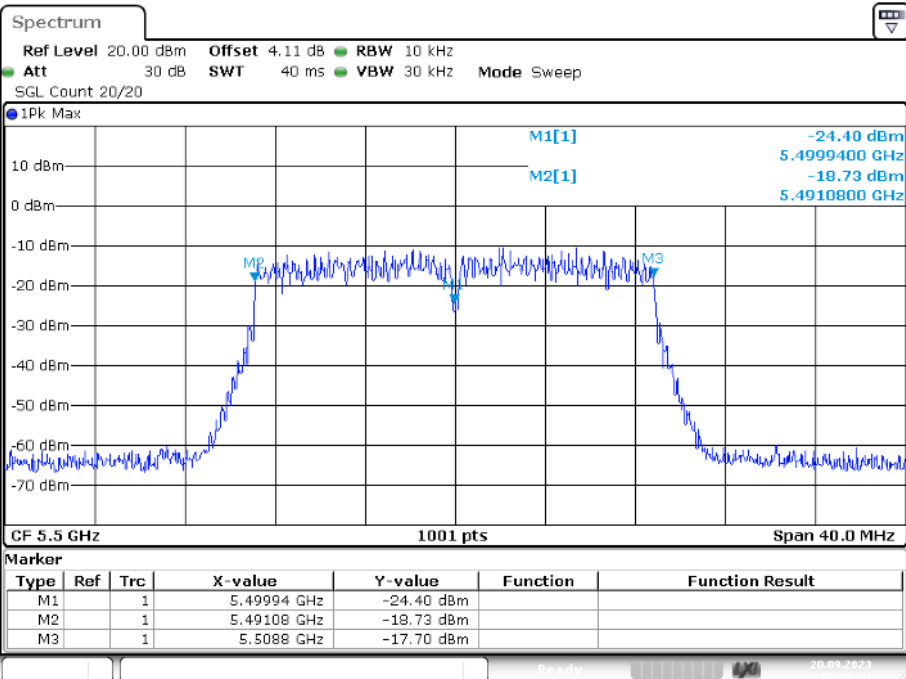


Date: 20.09.2023 00:15:41

Freq. Stability 20C 2.81V n20 5600MHz Ant1 0 Minutes

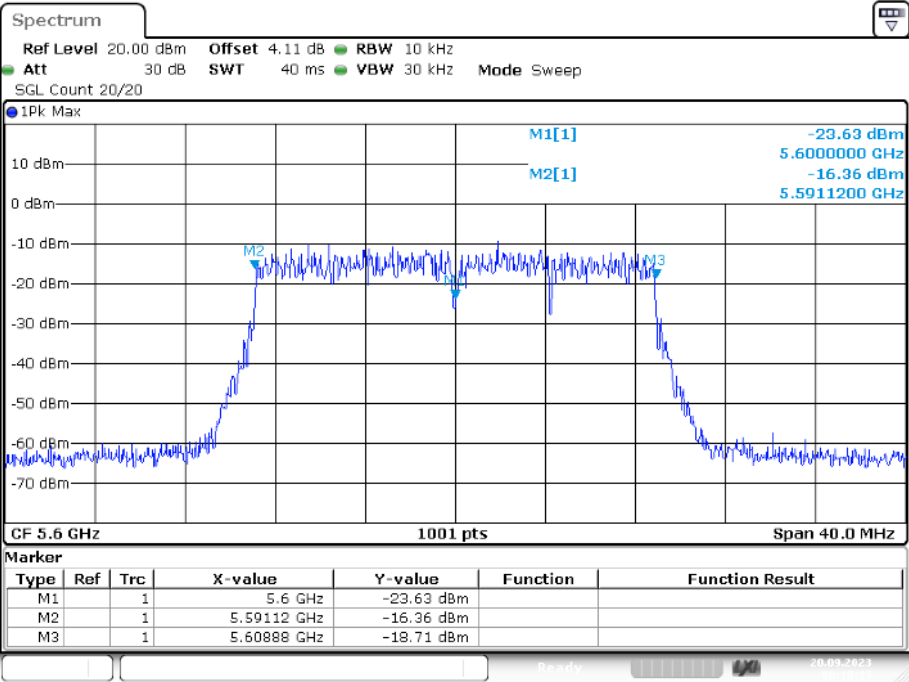


Date: 20.09.2023 00:18:15

Freq. Stability 20C 3.3V n20 5600MHz Ant1 0 Minutes

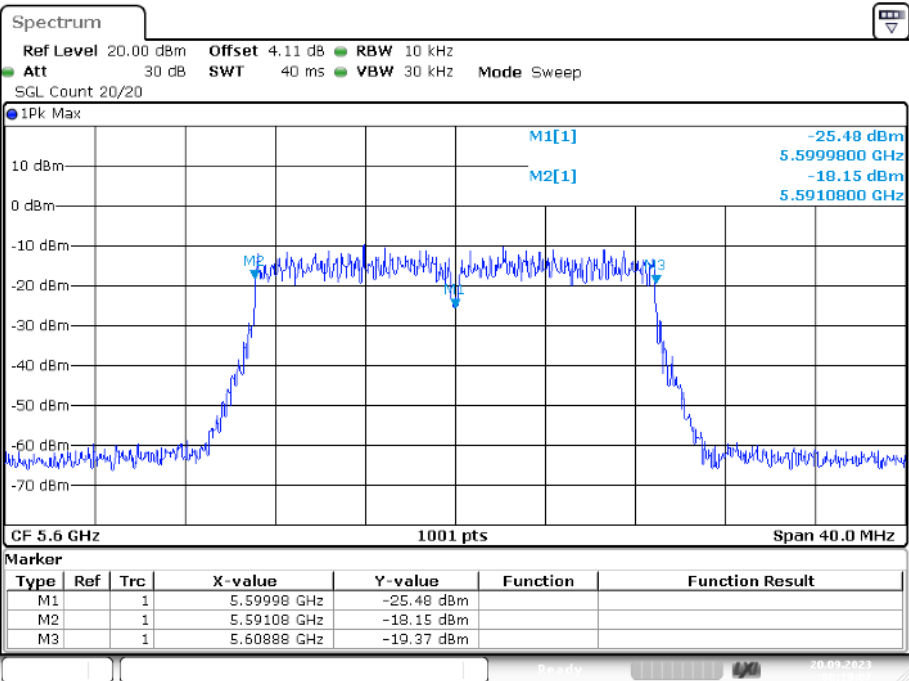


Date: 20.09.2023 00:19:07

Freq. Stability 20C 3.80V n20 5600MHz Ant1 0 Minutes

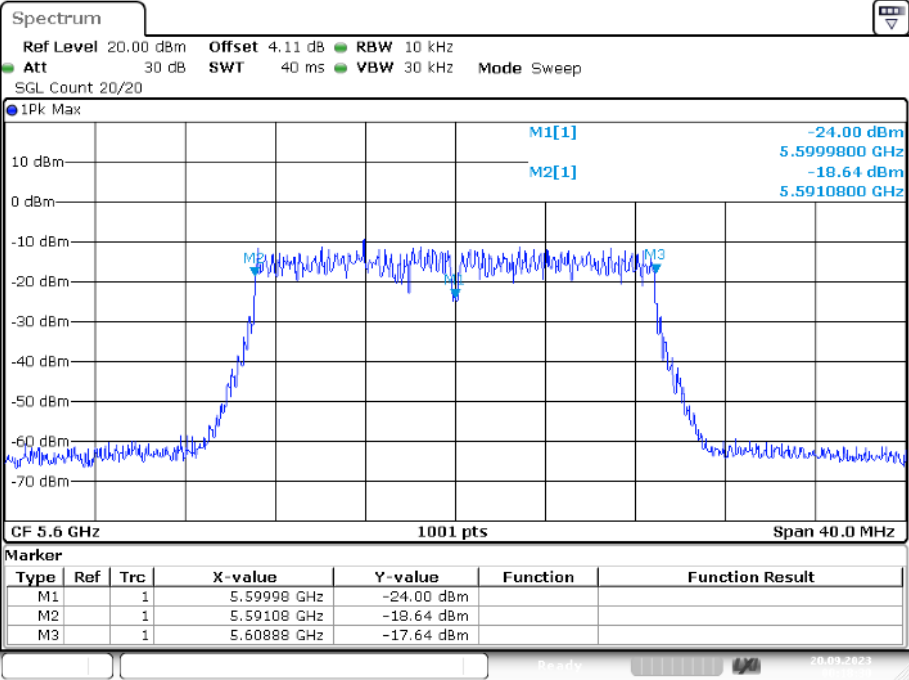


Date: 20.09.2023 00:18:30

Freq. Stability -20C 3.3V n20 5600MHz Ant1 0 Minutes

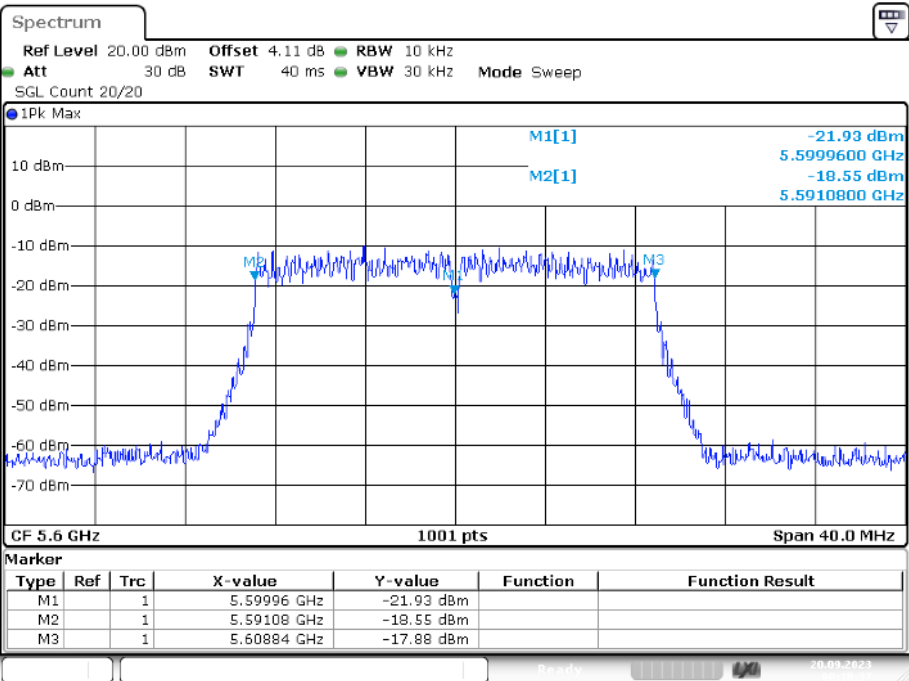


Date: 20.09.2023 00:18:37

Freq. Stability -10C 3.3V n20 5600MHz Ant1 0 Minutes

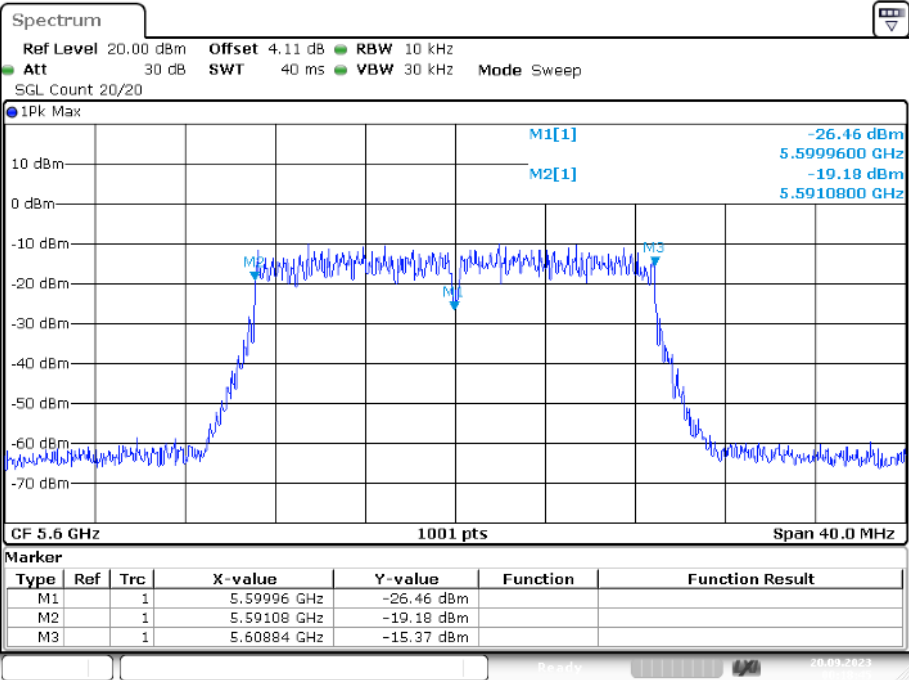


Date: 20.09.2023 00:18:45

Freq. Stability 0C 3.3V n20 5600MHz Ant1 0 Minutes

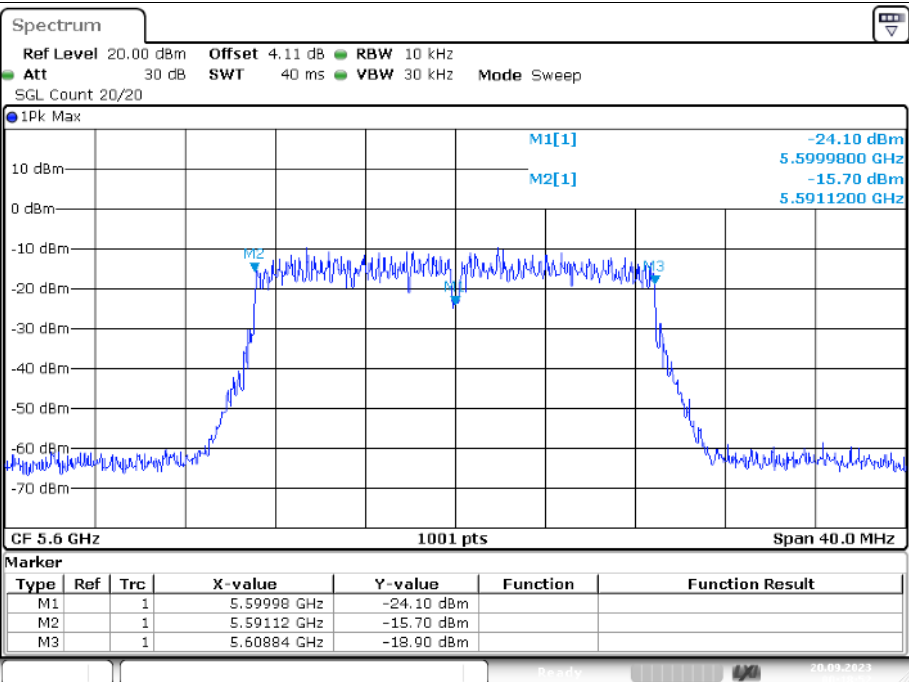


Date: 20.09.2023 00:18:52

Freq. Stability 10C 3.3V n20 5600MHz Ant1 0 Minutes

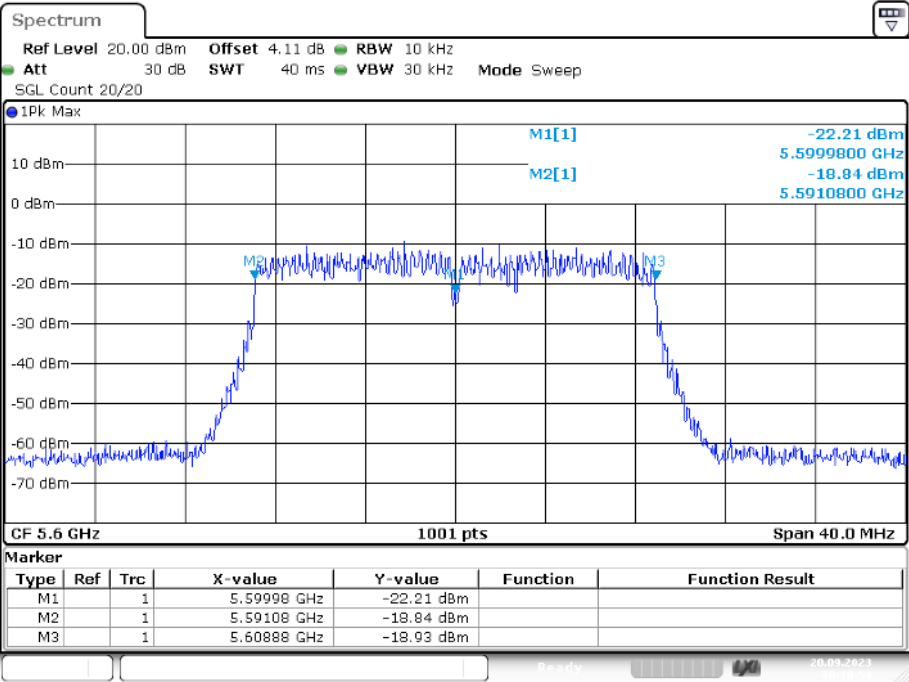


Date: 20.09.2023 00:18:39

Freq. Stability 30C 3.3V n20 5600MHz Ant1 0 Minutes

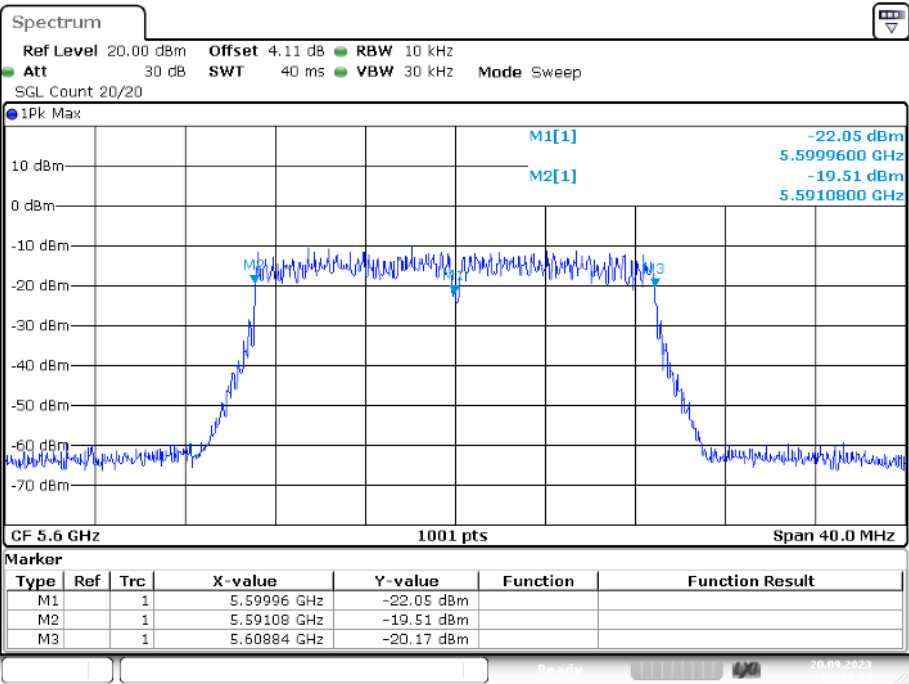


Date: 20.09.2023 00:19:14

Freq. Stability 40C 3.3V n20 5600MHz Ant1 0 Minutes

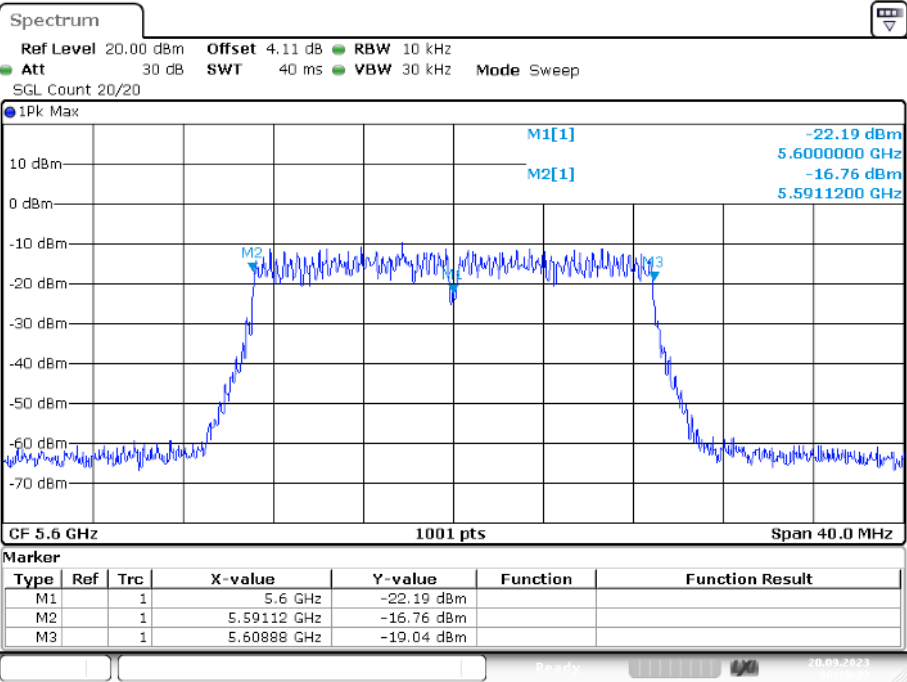


Date: 20.09.2023 00:19:21

Freq. Stability 50C 3.3V n20 5600MHz Ant1 0 Minutes

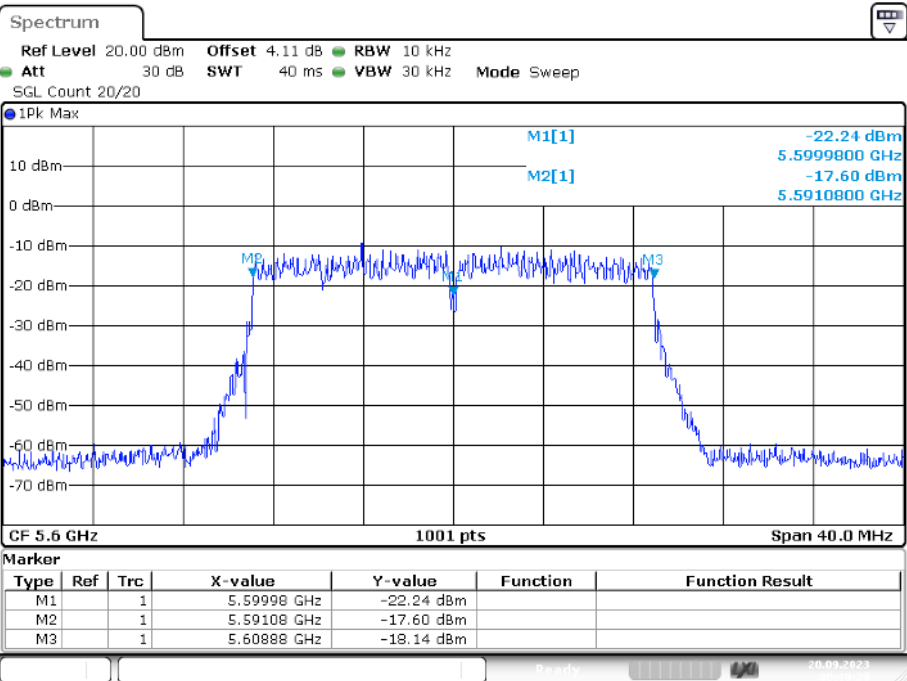


Date: 20.09.2023 00:19:29

Freq. Stability 20C 2.81V n20 5700MHz Ant1 0 Minutes

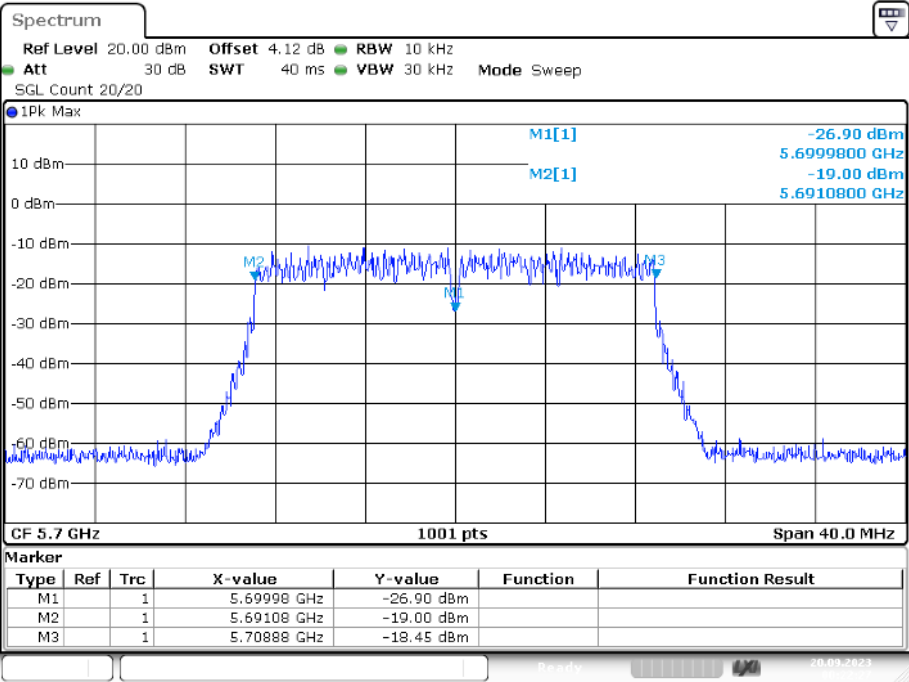


Date: 20.09.2023 00:22:26

Freq. Stability 20C 3.3V n20 5700MHz Ant1 0 Minutes

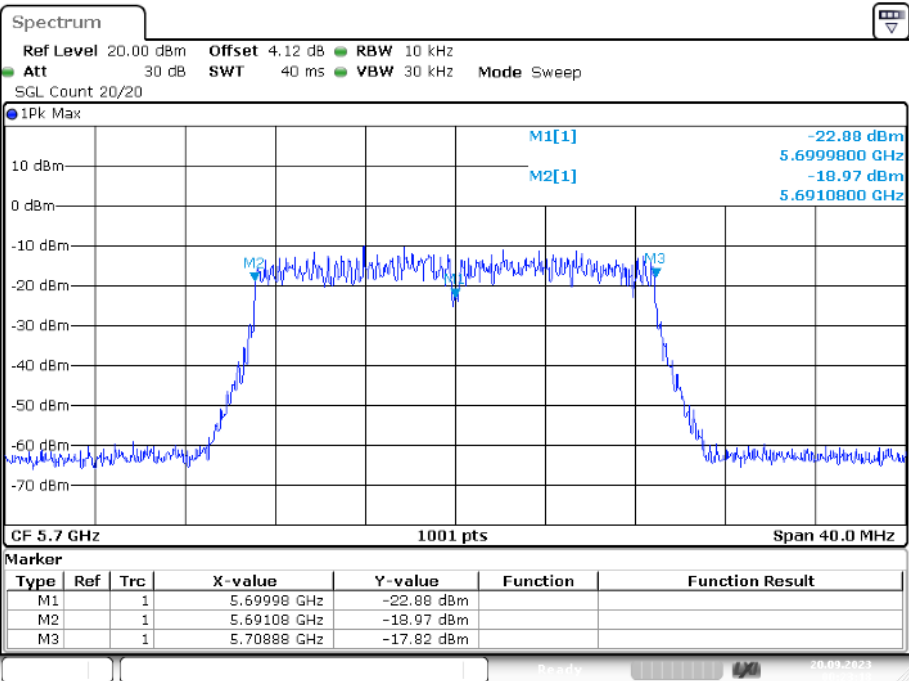


Date: 20.09.2023 00:23:18

Freq. Stability 20C 3.80V n20 5700MHz Ant1 0 Minutes

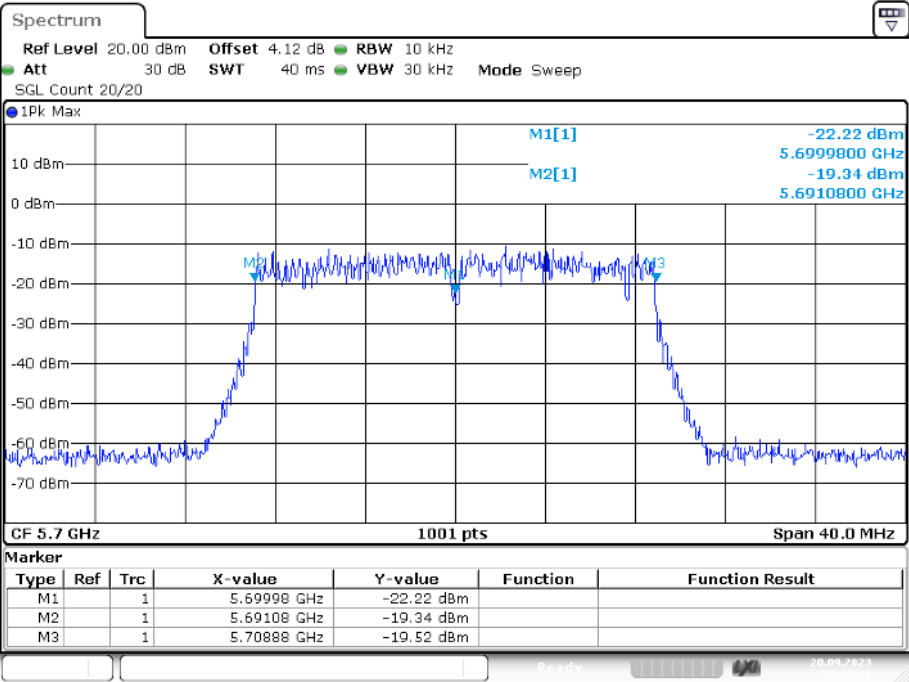


Date: 20.09.2023 00:22:41

Freq. Stability -20C 3.3V n20 5700MHz Ant1 0 Minutes

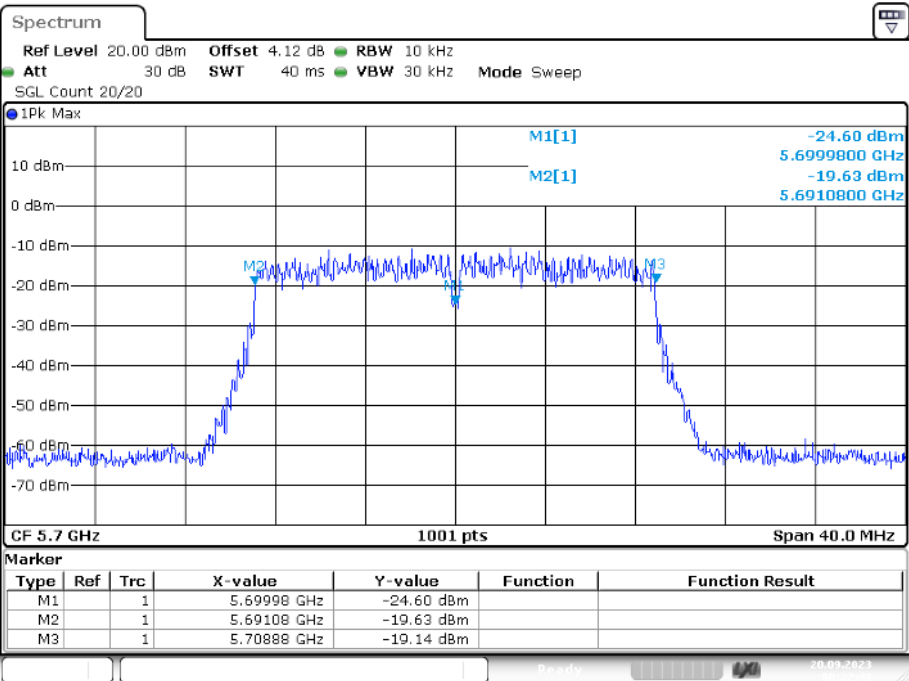


Date: 20.09.2023 00:22:48

Freq. Stability -10C 3.3V n20 5700MHz Ant1 0 Minutes

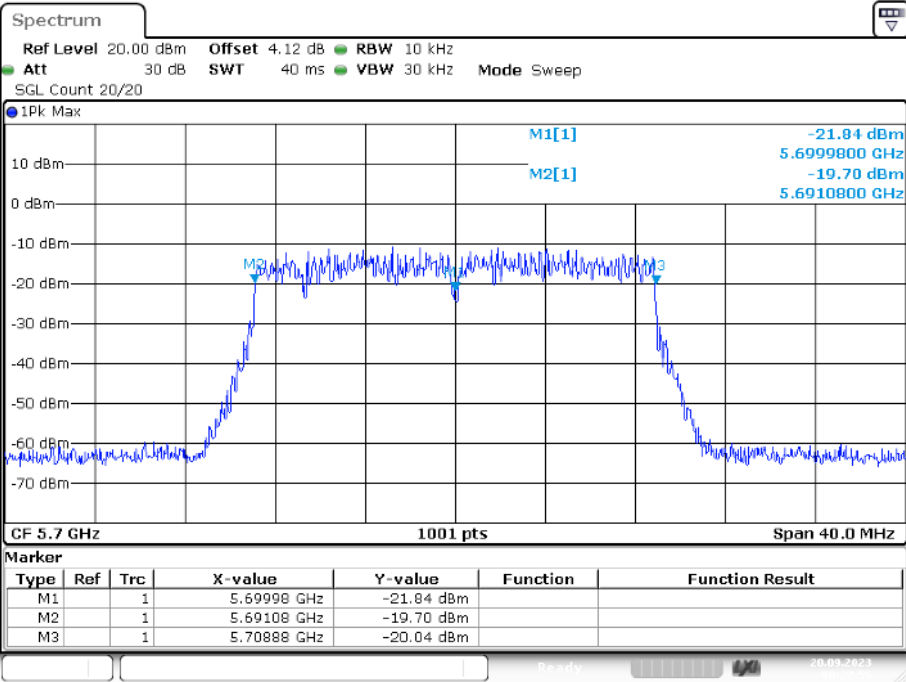


Date: 20.09.2023 00:22:36

Freq. Stability 0C 3.3V n20 5700MHz Ant1 0 Minutes

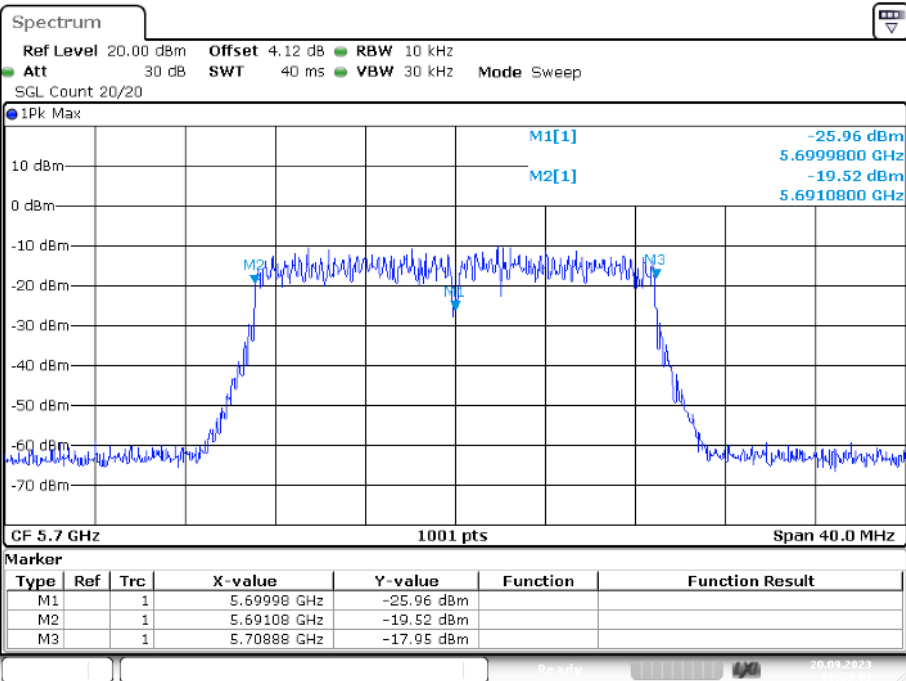


Date: 20.09.2023 00:23:03

Freq. Stability 10C 3.3V n20 5700MHz Ant1 0 Minutes

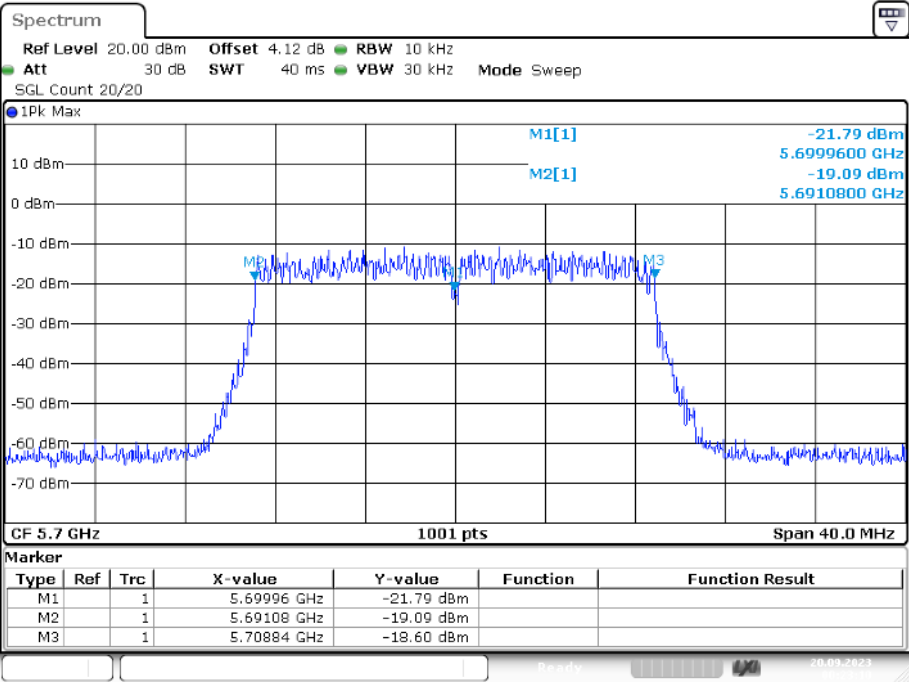


Date: 20.09.2023 00:23:10

Freq. Stability 30C 3.3V n20 5700MHz Ant1 0 Minutes

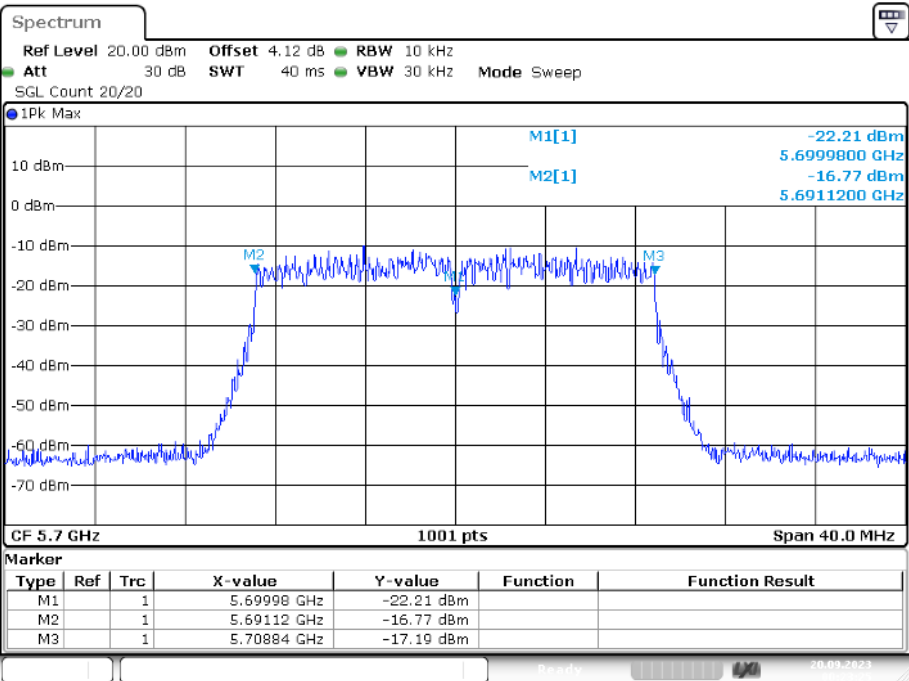


Date: 20.09.2023 00:23:25

Freq. Stability 40C 3.3V n20 5700MHz Ant1 0 Minutes

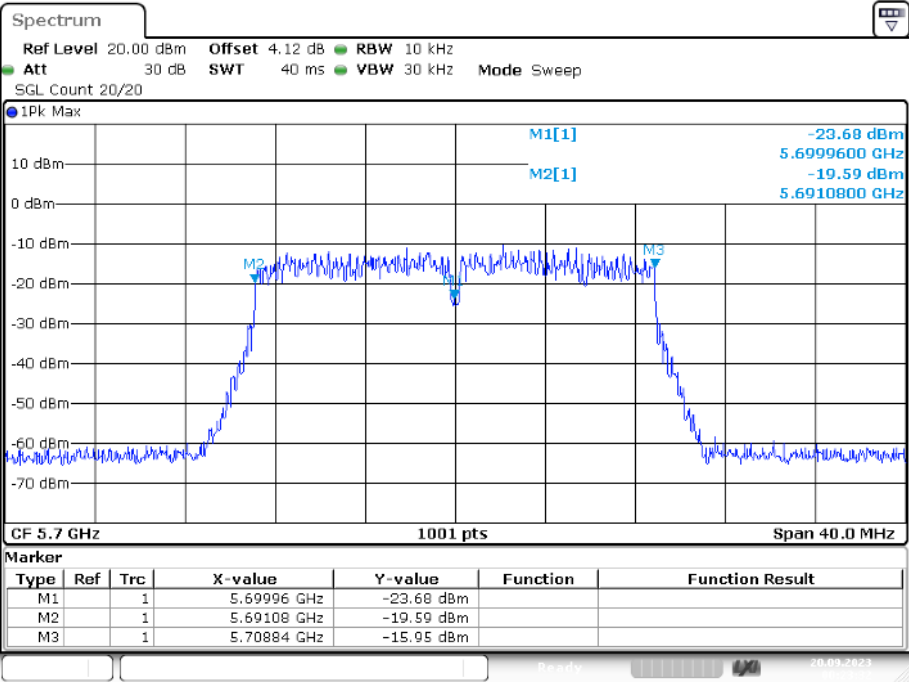


Date: 20.09.2023 00:23:32

Freq. Stability 50C 3.3V n20 5700MHz Ant1 0 Minutes

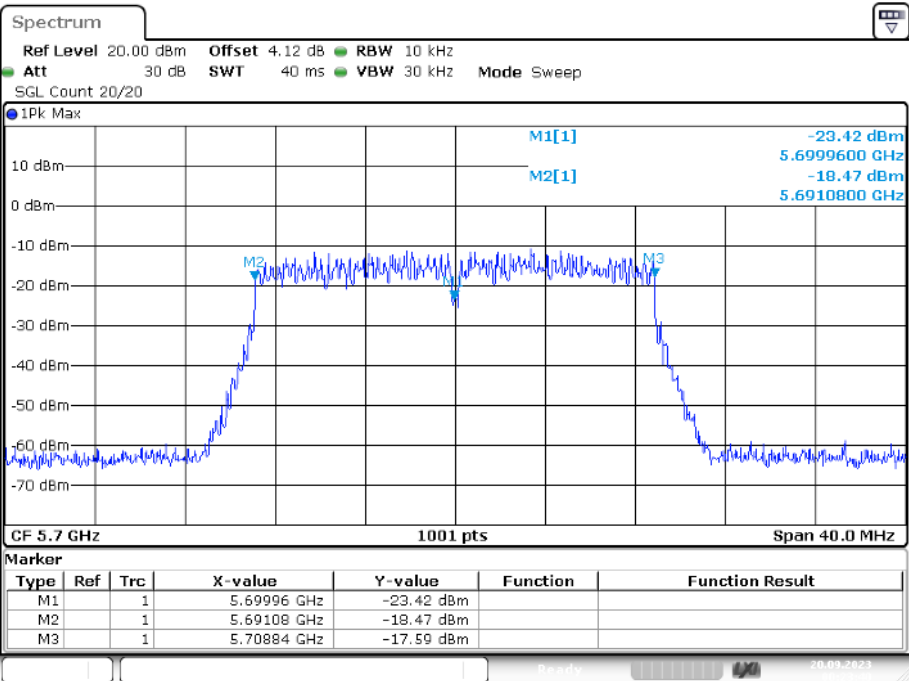


Date: 20.09.2023 00:23:39

Freq. Stability 20C 2.81V n20 5745MHz Ant1 0 Minutes

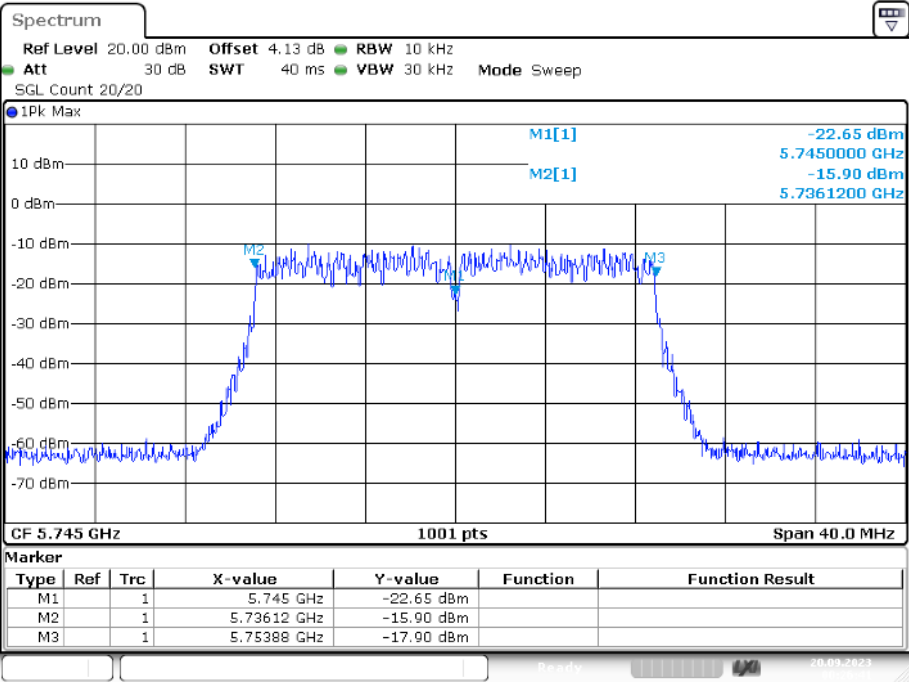


Date: 20.09.2023 00:26:40

Freq. Stability 20C 3.3V n20 5745MHz Ant1 0 Minutes

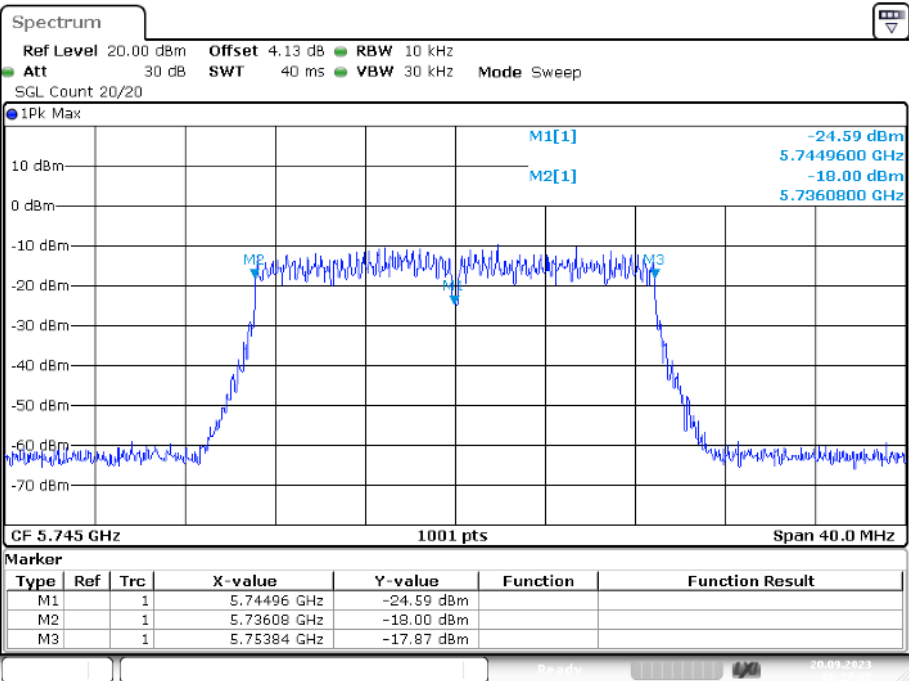


Date: 20.09.2023 00:27:32

Freq. Stability 20C 3.80V n20 5745MHz Ant1 0 Minutes

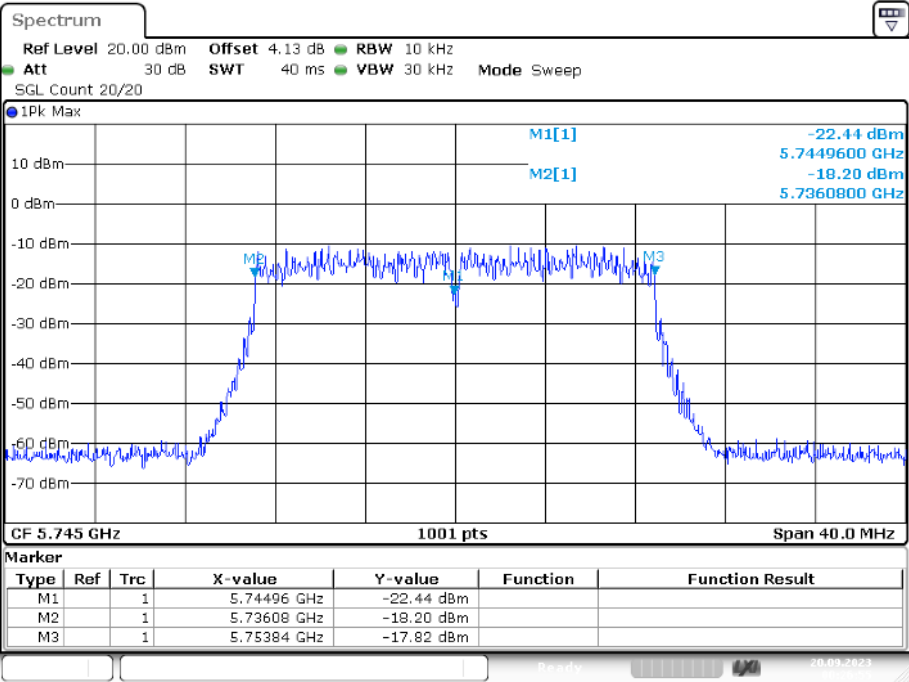


Date: 20.09.2023 00:26:55

Freq. Stability -20C 3.3V n20 5745MHz Ant1 0 Minutes

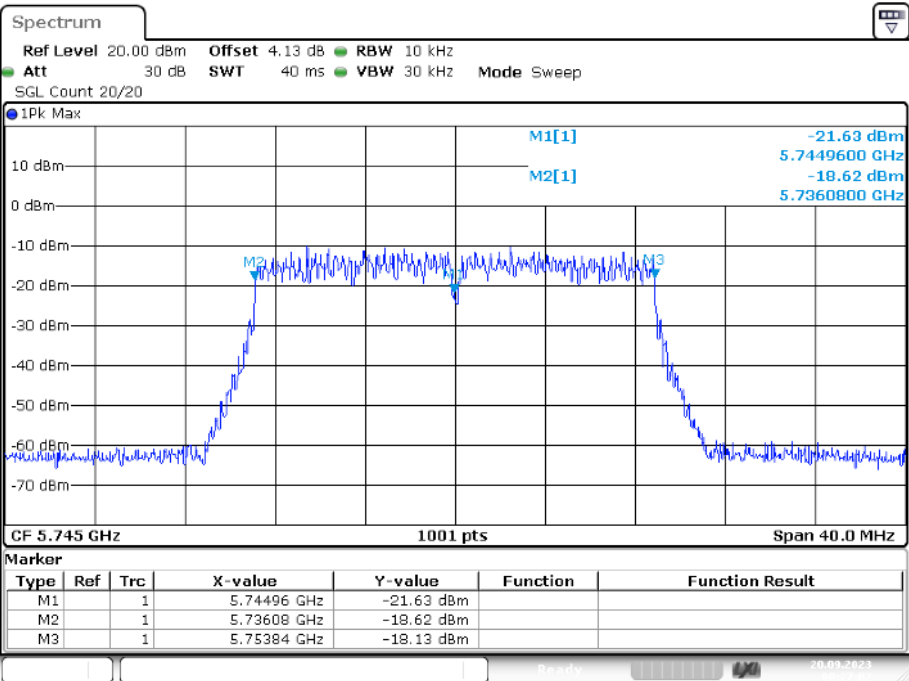


Date: 20.09.2023 00:27:02

Freq. Stability -10C 3.3V n20 5745MHz Ant1 0 Minutes

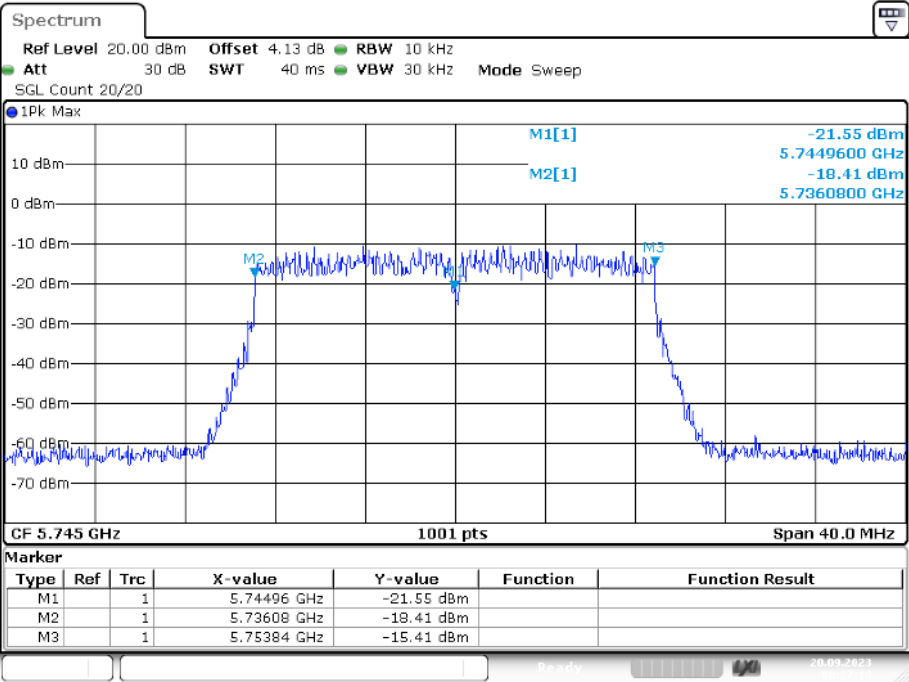


Date: 20.09.2023 00:27:10

Freq. Stability 0C 3.3V n20 5745MHz Ant1 0 Minutes

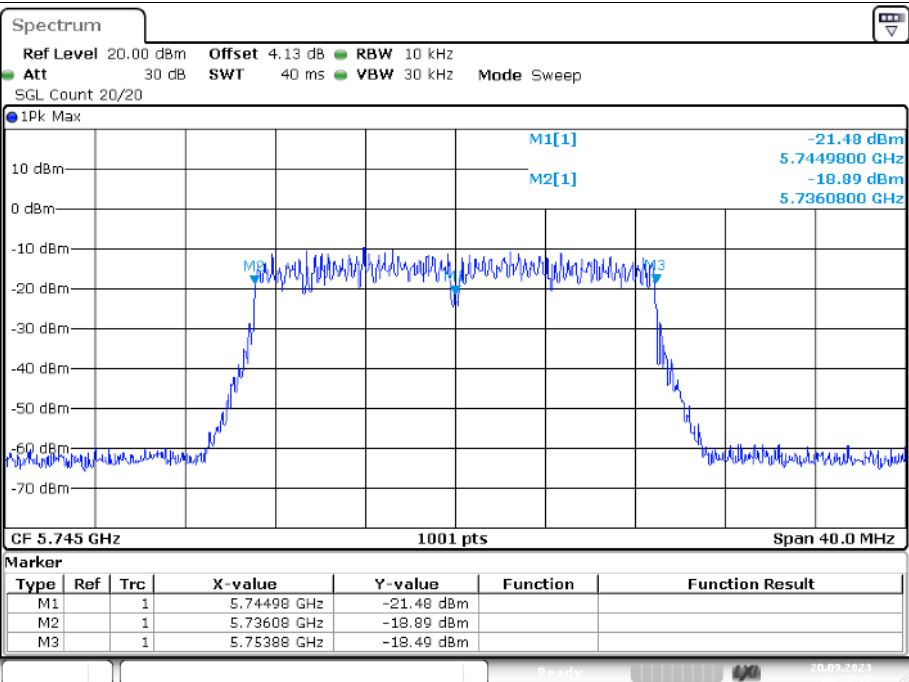


Date: 20.09.2023 00:27:17


Freq. Stability 10C 3.3V n20 5745MHz Ant1 0 Minutes

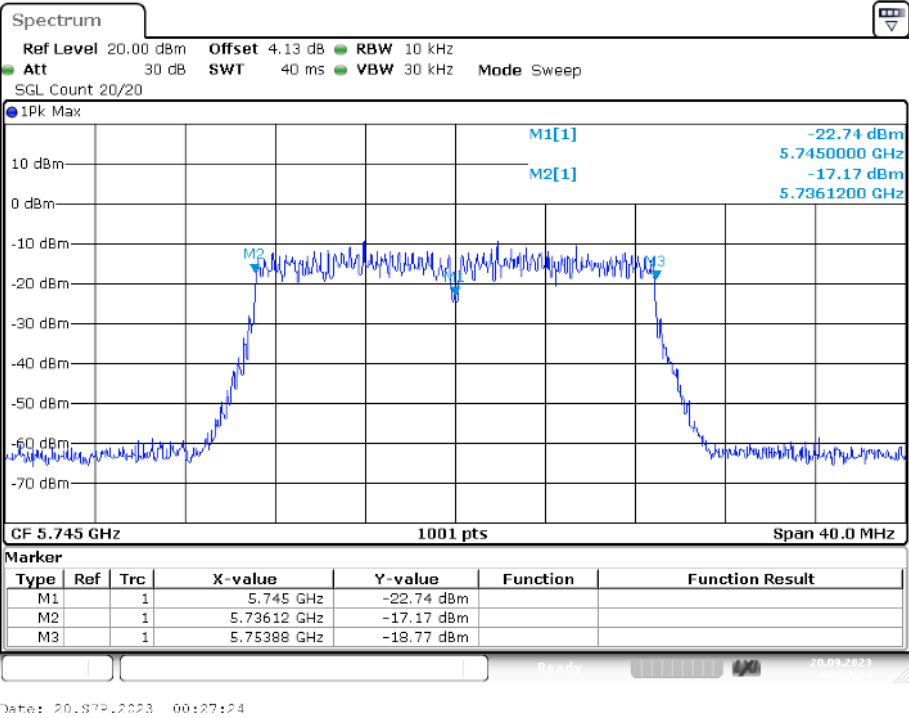

Freq. Stability 30C 3.3V n20 5745MHz Ant1 0 Minutes

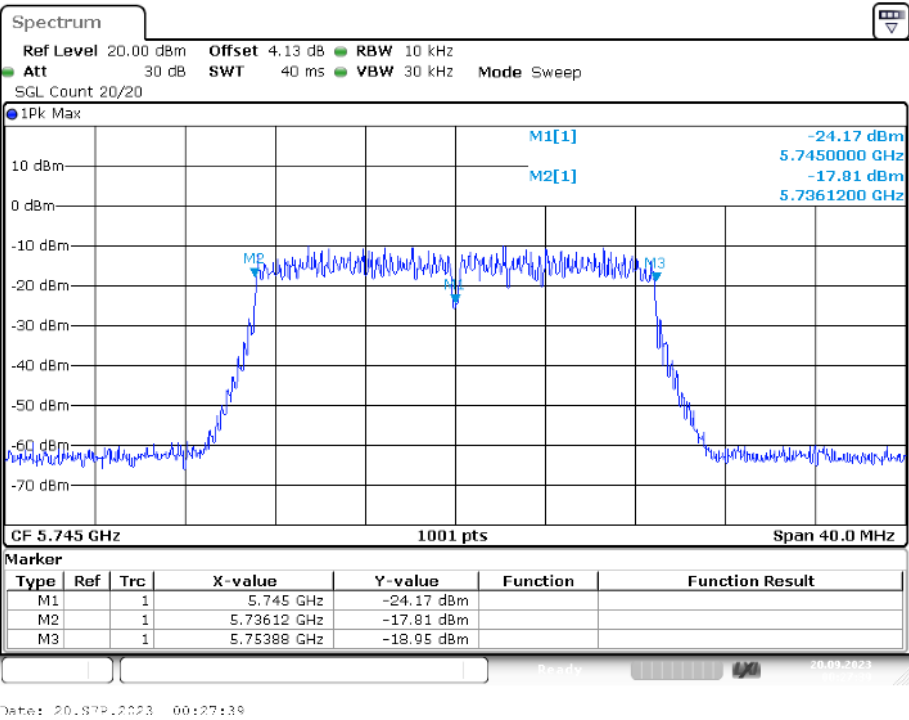


Freq. Stability 40C 3.3V n20 5745MHz Ant1 0 Minutes

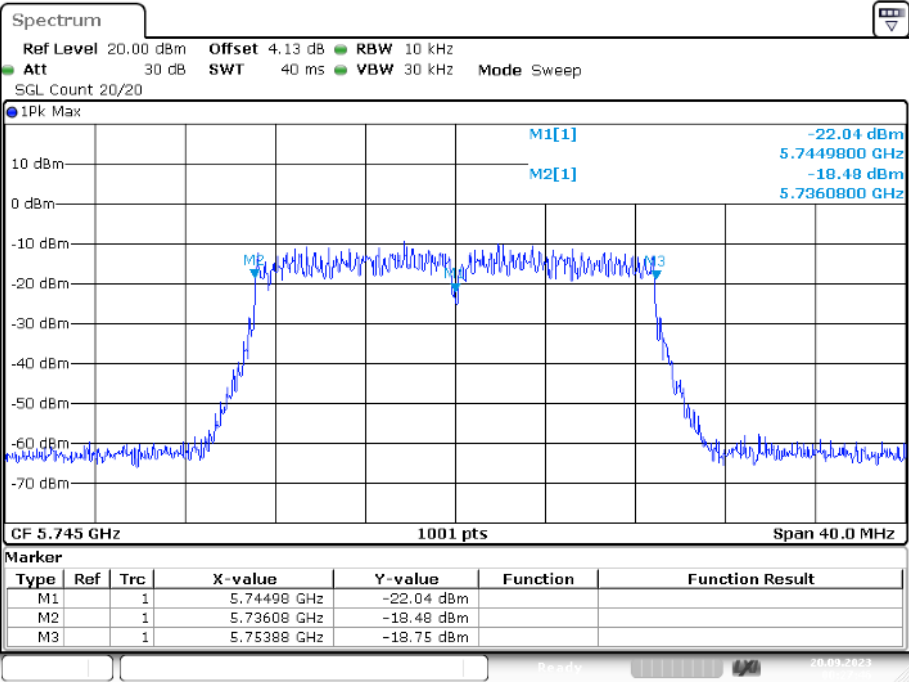


Date: 20.09.2023 00:27:46

Freq. Stability 50C 3.3V n20 5745MHz Ant1 0 Minutes

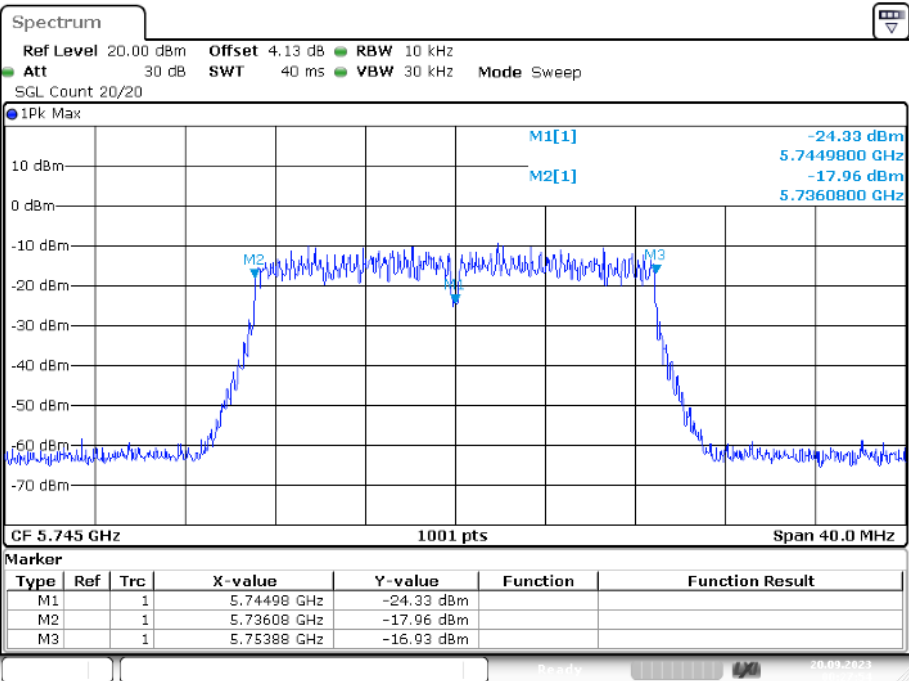


Date: 20.09.2023 00:27:54


Freq. Stability 20C 2.81V n20 5785MHz Ant1 0 Minutes

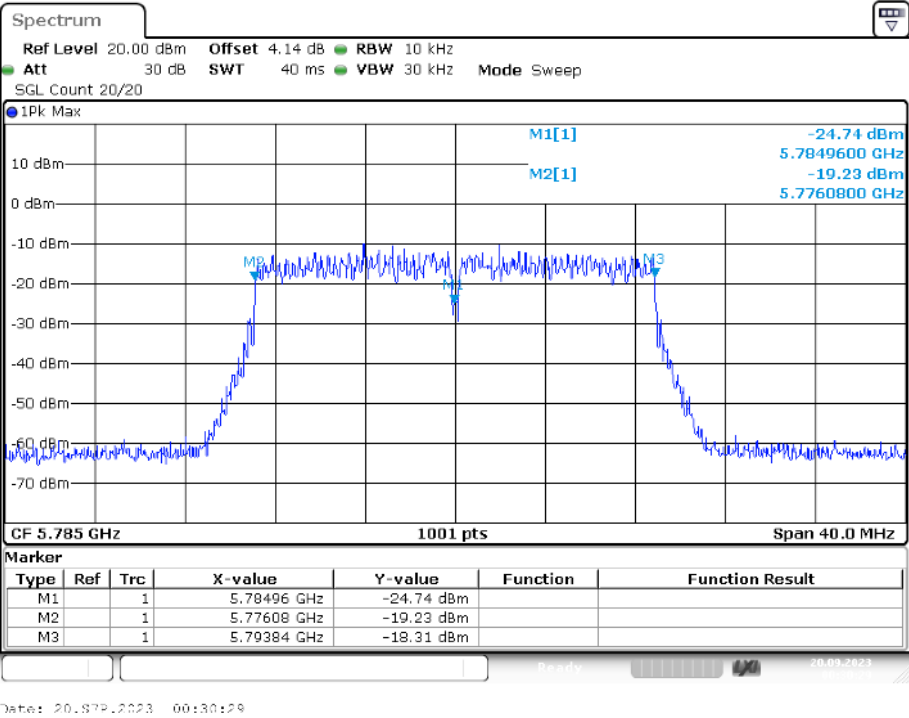


Freq. Stability 20C 3.3V n20 5785MHz Ant1 0 Minutes

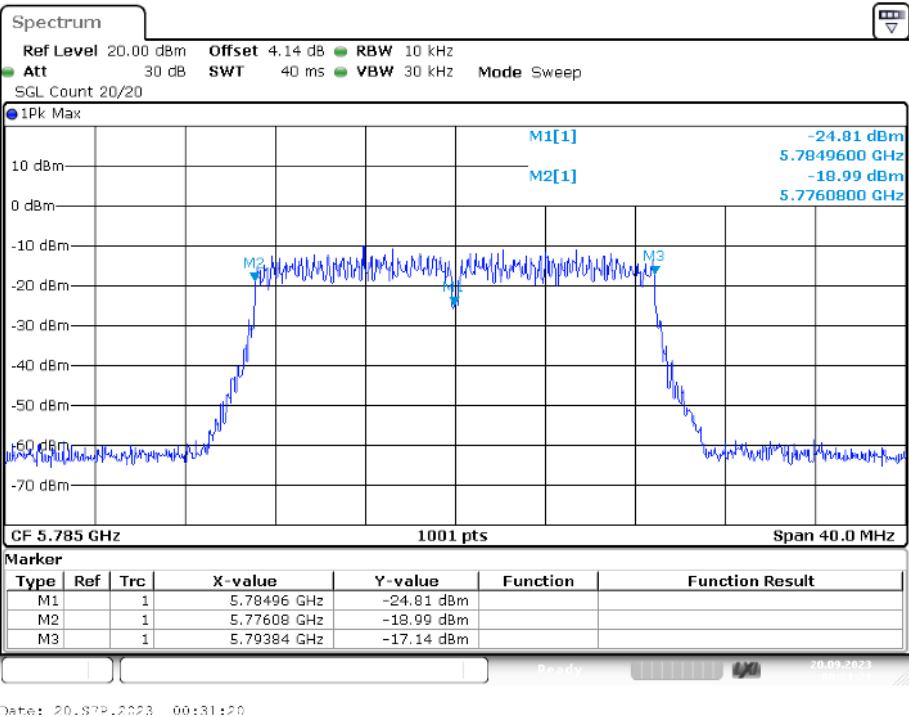


Freq. Stability 20C 3.80V n20 5785MHz Ant1 0 Minutes

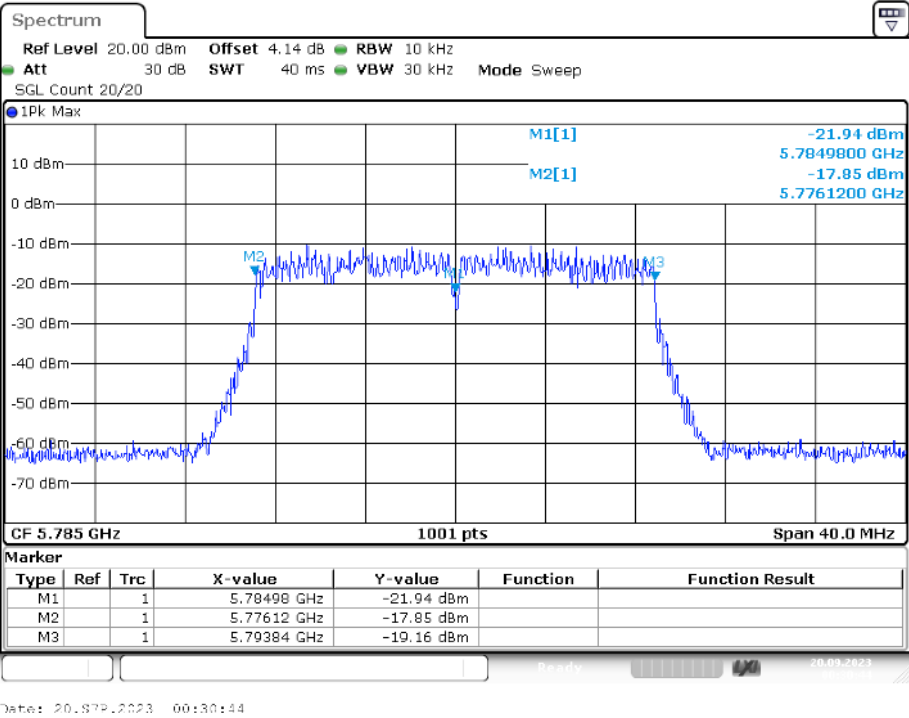

Freq. Stability -20C 3.3V n20 5785MHz Ant1 0 Minutes

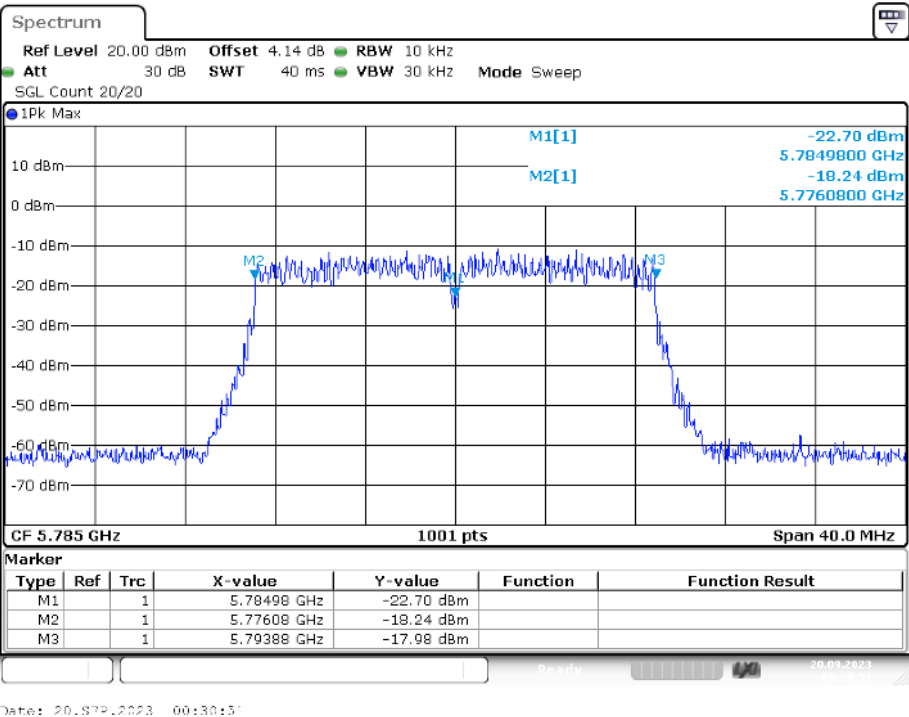


Freq. Stability -10C 3.3V n20 5785MHz Ant1 0 Minutes

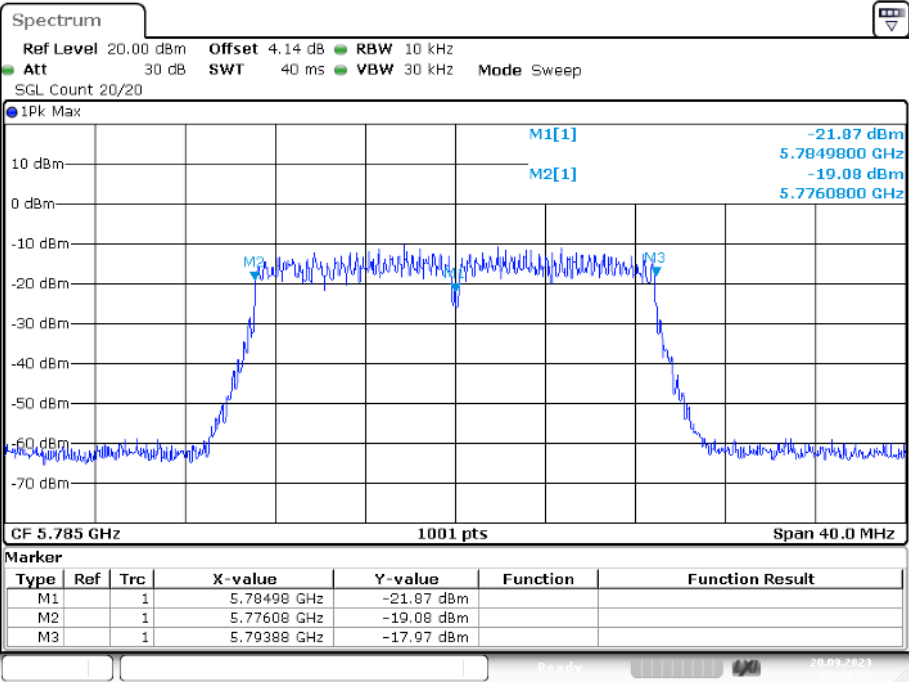


Date: 20.09.2023 00:30:38

Freq. Stability 0C 3.3V n20 5785MHz Ant1 0 Minutes

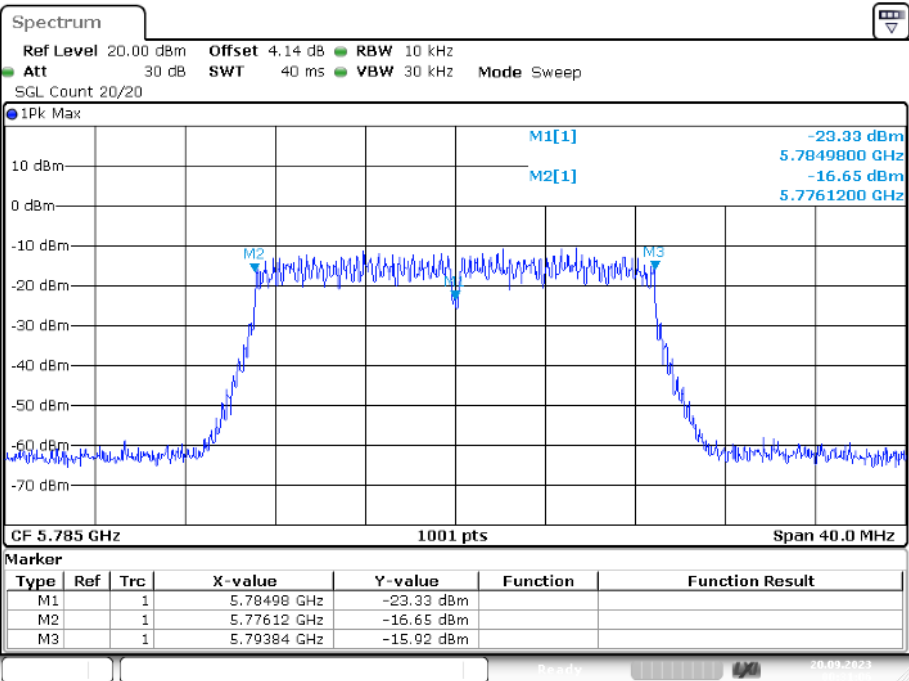


Date: 20.09.2023 00:31:06

Freq. Stability 10C 3.3V n20 5785MHz Ant1 0 Minutes

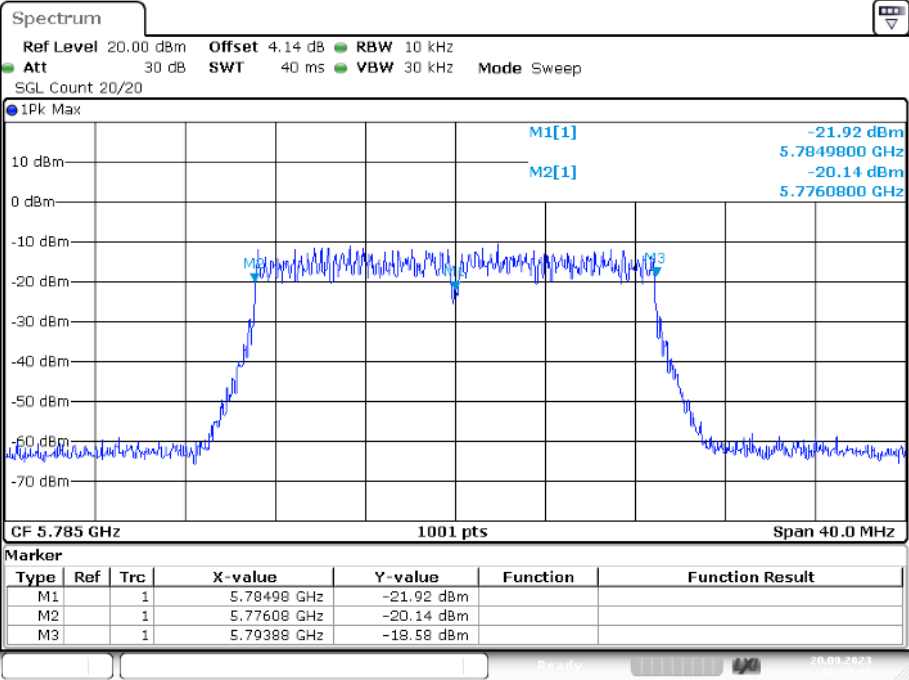


Date: 20.09.2023 00:31:13

Freq. Stability 30C 3.3V n20 5785MHz Ant1 0 Minutes

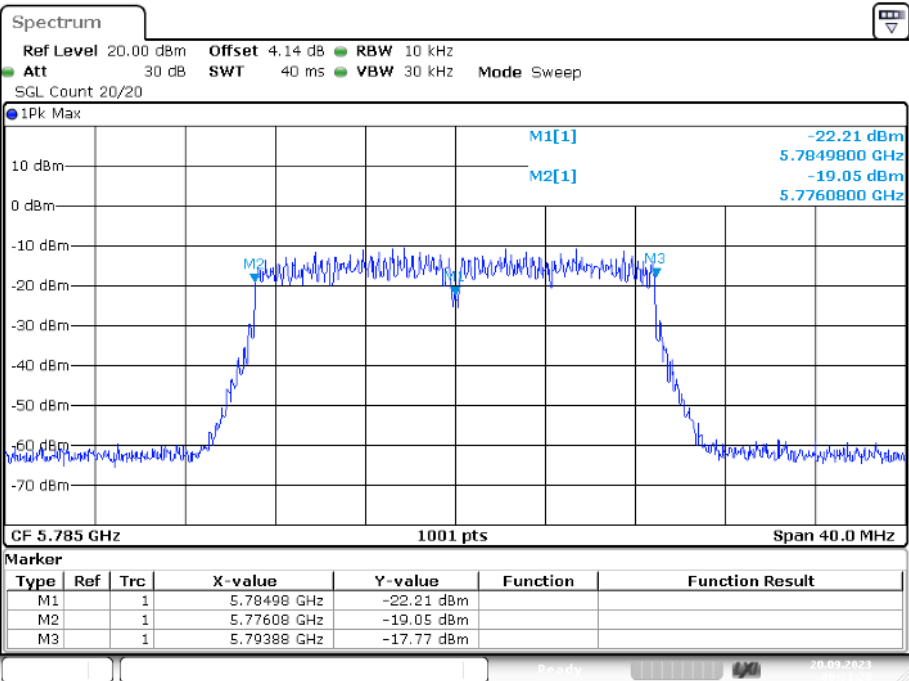


Date: 20.09.2023 00:31:28

Freq. Stability 40C 3.3V n20 5785MHz Ant1 0 Minutes

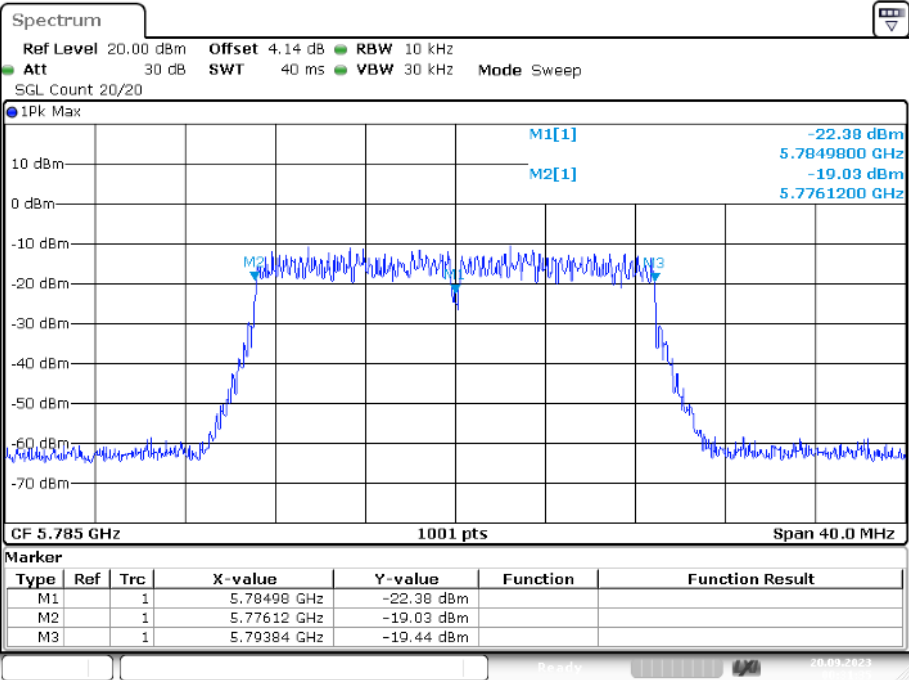


Date: 20.09.2023 00:31:35

Freq. Stability 50C 3.3V n20 5785MHz Ant1 0 Minutes

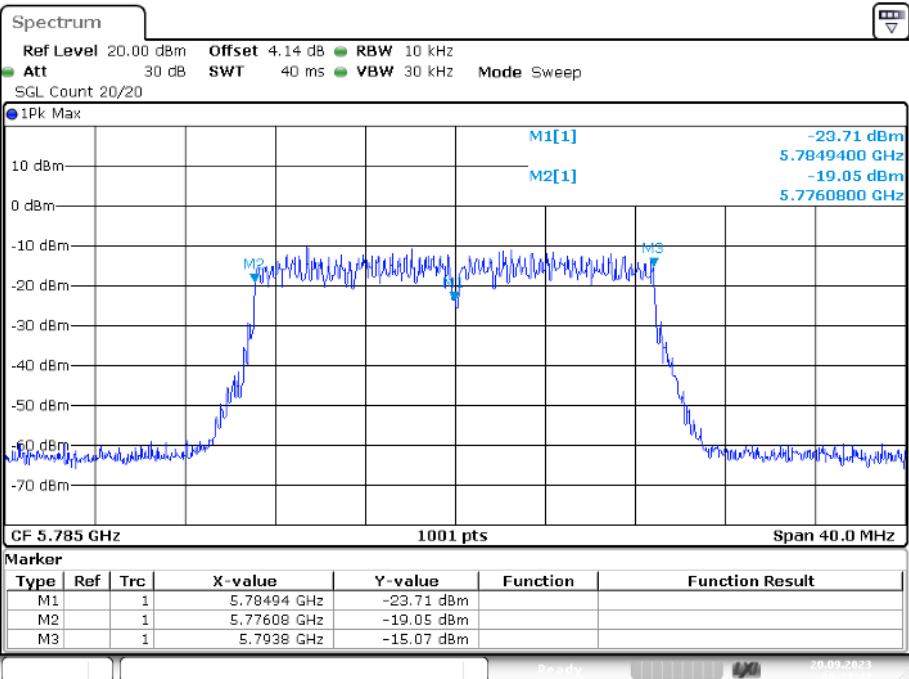


Date: 20.09.2023 00:31:42


Freq. Stability 20C 2.81V n20 5825MHz Ant1 0 Minutes

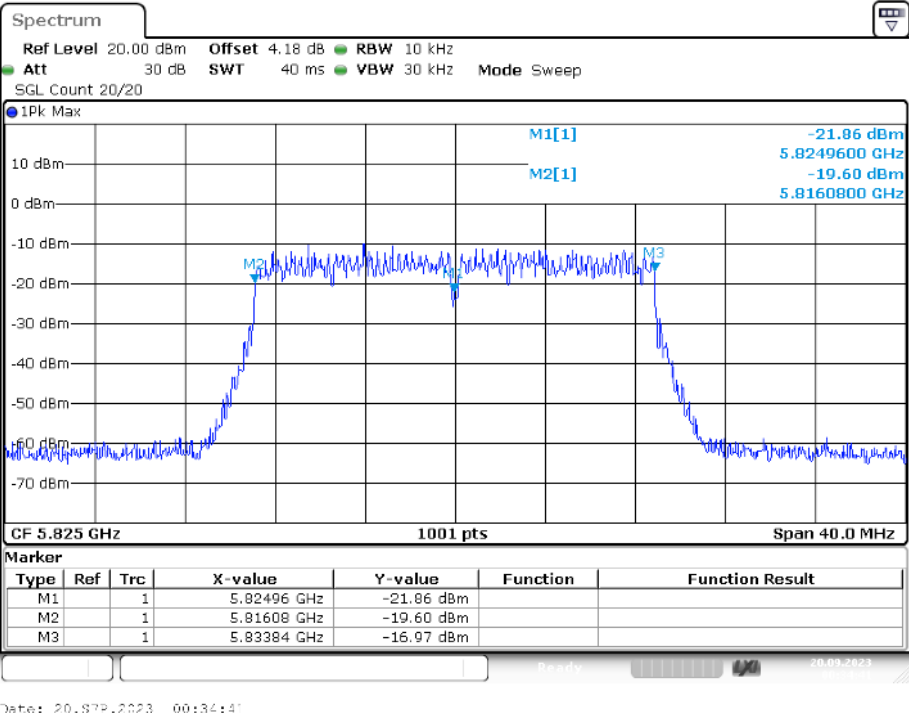


Freq. Stability 20C 3.3V n20 5825MHz Ant1 0 Minutes

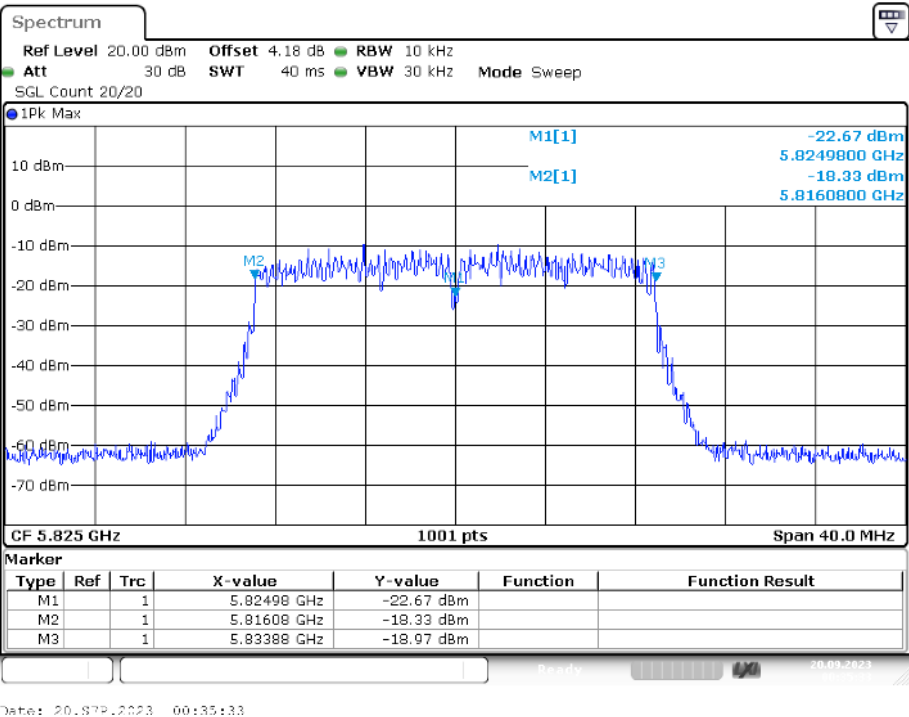


Freq. Stability 20C 3.80V n20 5825MHz Ant1 0 Minutes

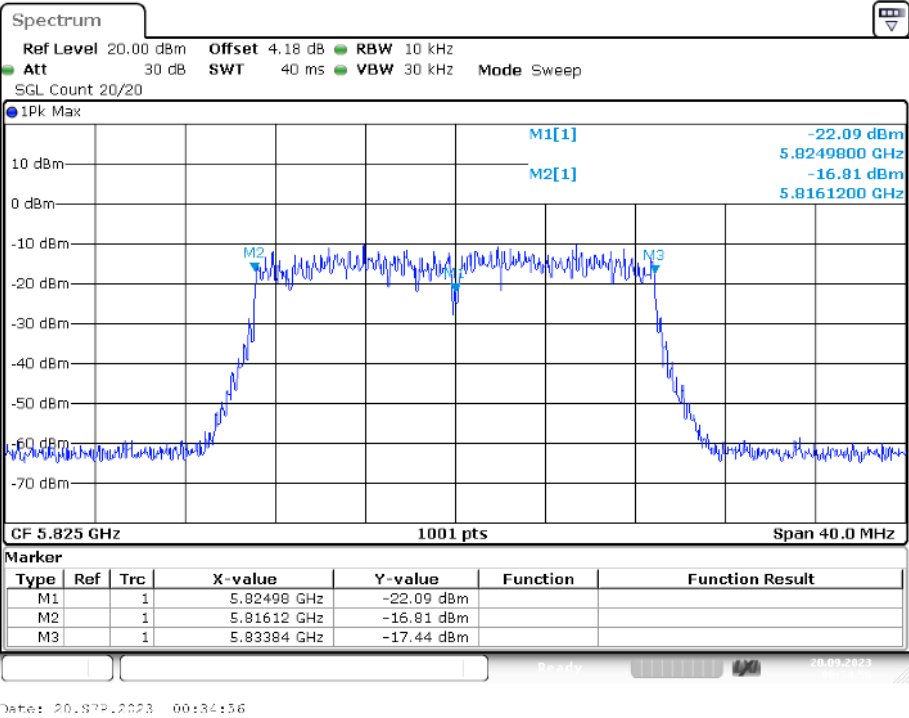


Freq. Stability -20C 3.3V n20 5825MHz Ant1 0 Minutes

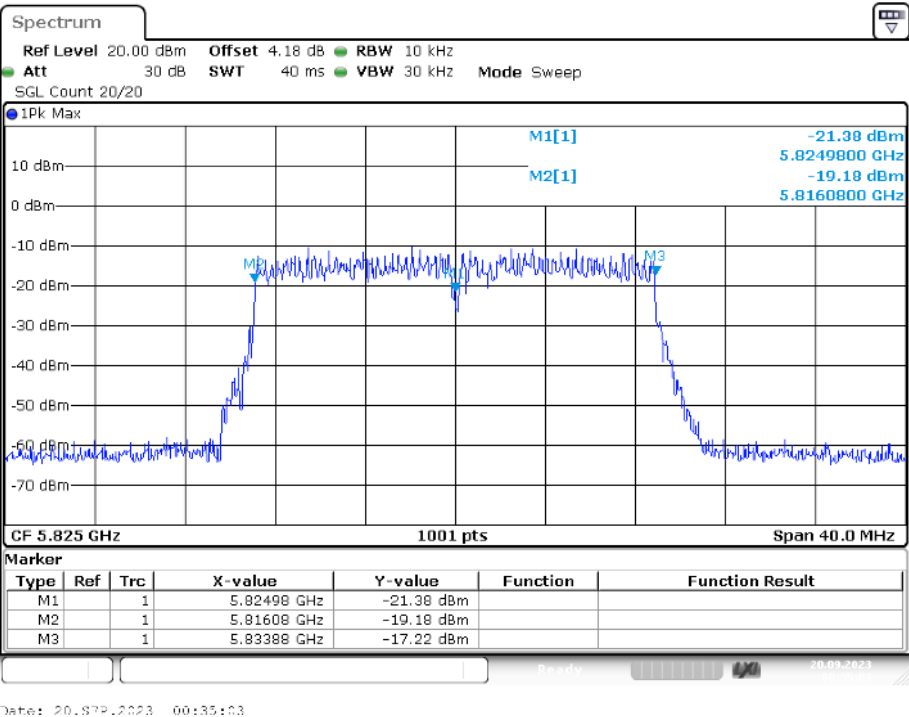


Freq. Stability -10C 3.3V n20 5825MHz Ant1 0 Minutes

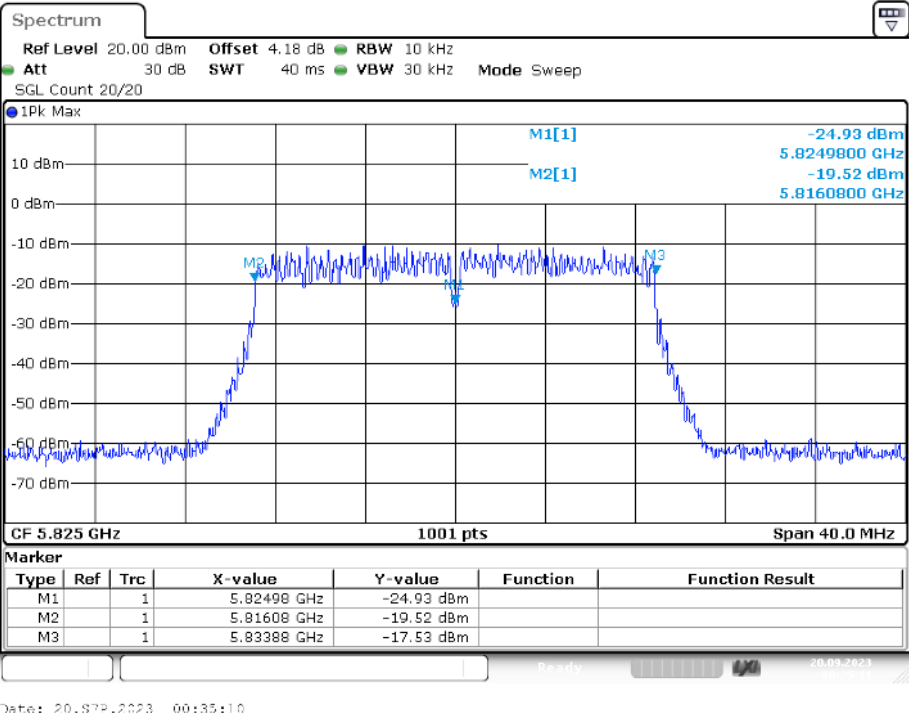

Freq. Stability 0C 3.3V n20 5825MHz Ant1 0 Minutes

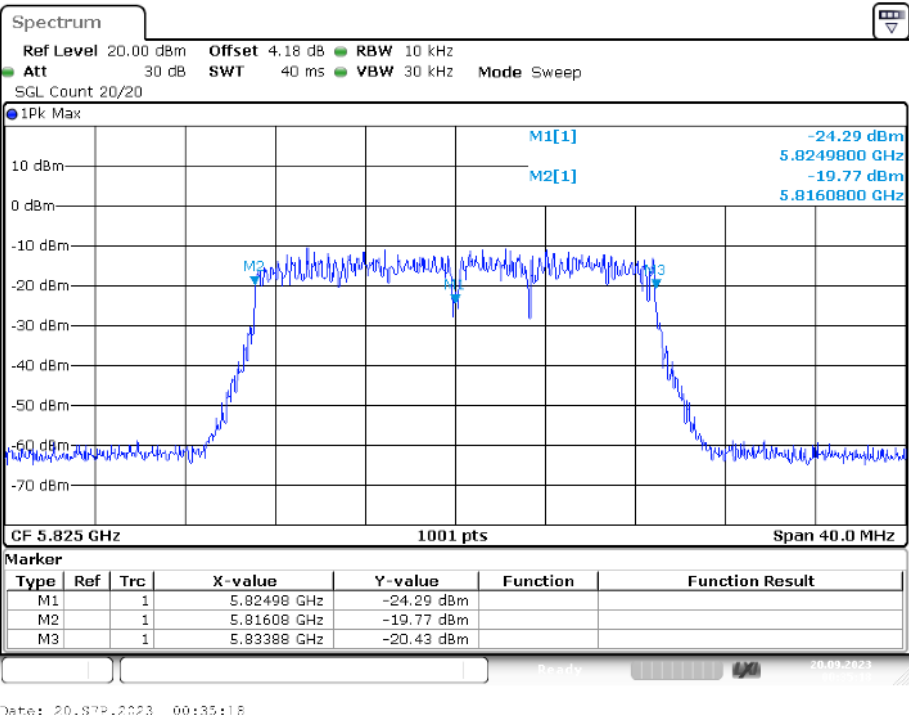


Freq. Stability 10C 3.3V n20 5825MHz Ant1 0 Minutes

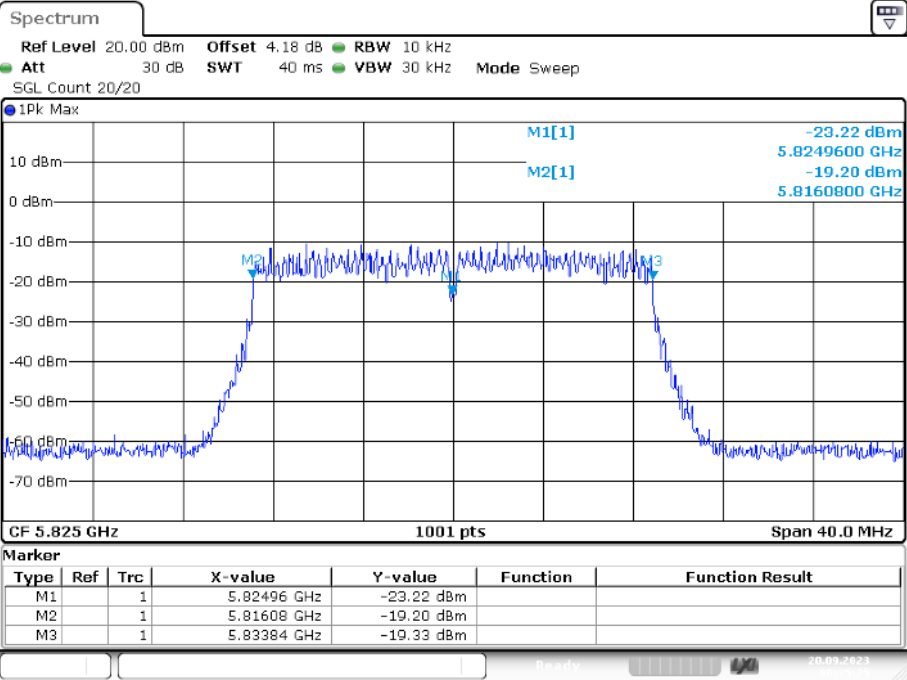


Date: 20.09.2023 00:35:25

Freq. Stability 30C 3.3V n20 5825MHz Ant1 0 Minutes

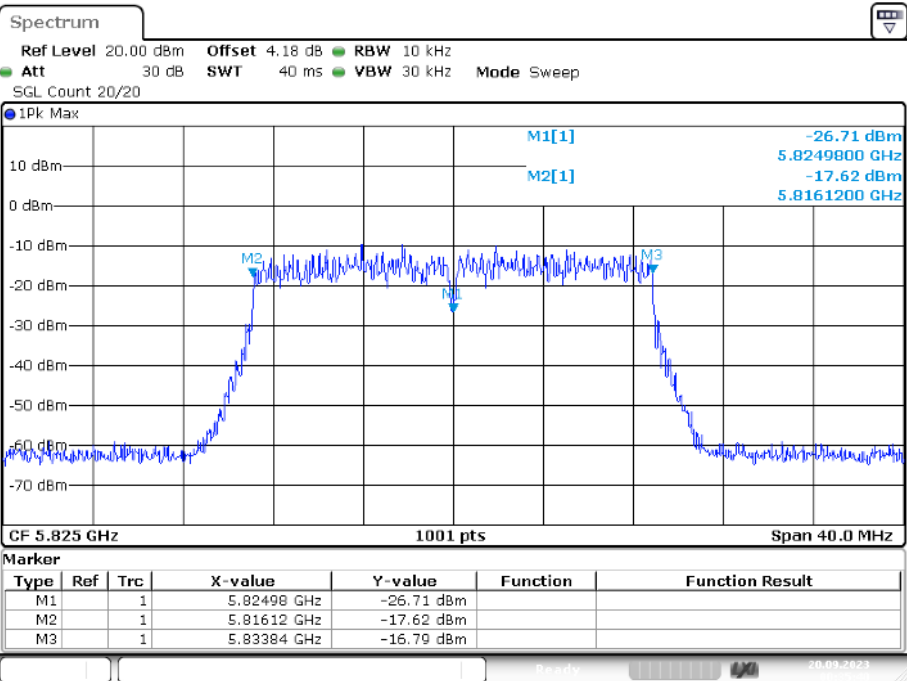


Date: 20.09.2023 00:35:40

Freq. Stability 40C 3.3V n20 5825MHz Ant1 0 Minutes

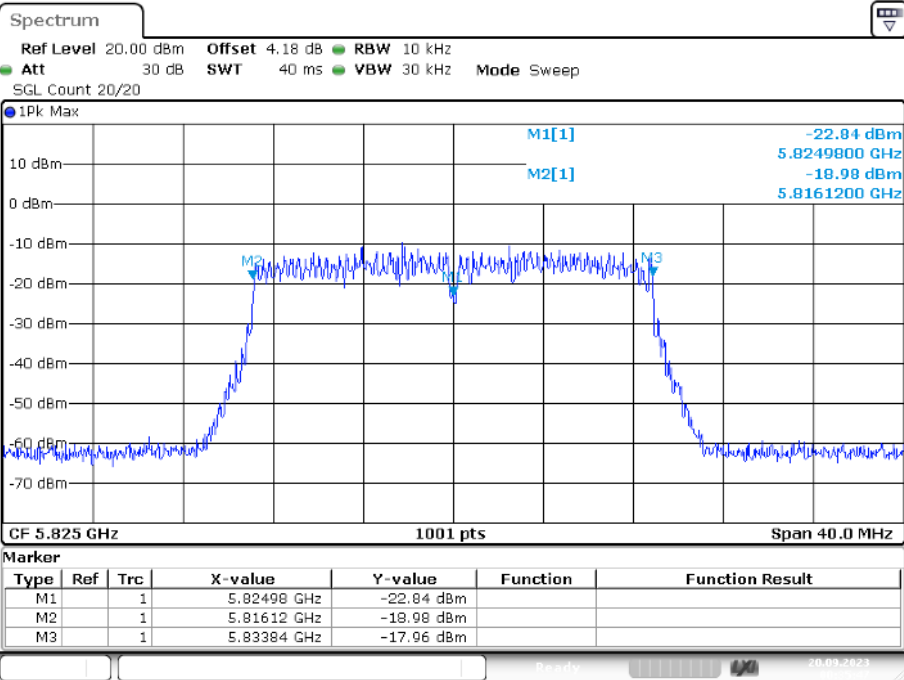


Date: 20.09.2023 00:35:47

Freq. Stability 50C 3.3V n20 5825MHz Ant1 0 Minutes

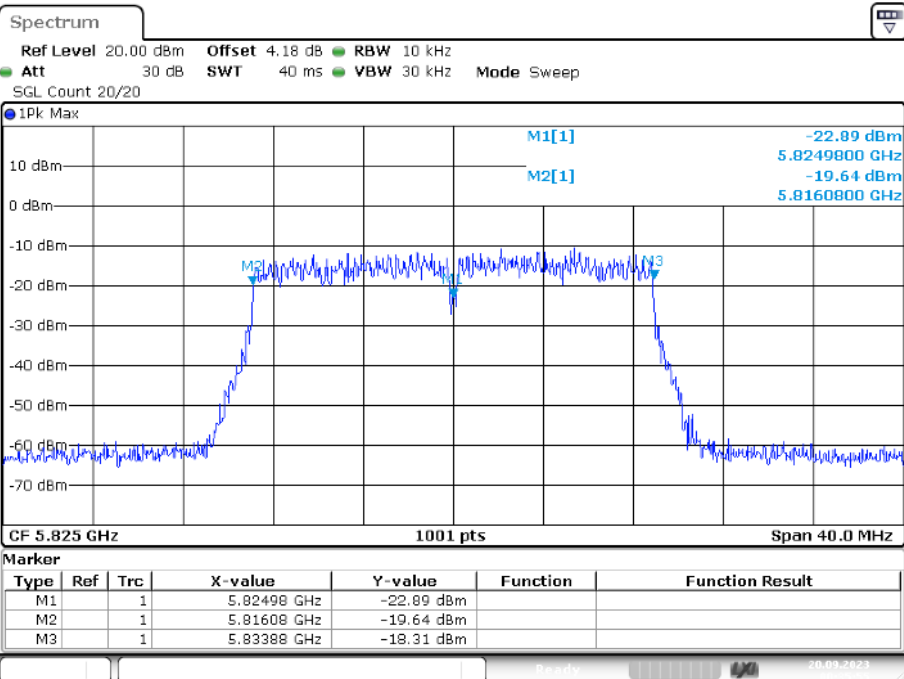


Date: 20.09.2023 00:35:54

Freq. Stability 20C 2.81V n20 5180MHz Ant2 0 Minutes

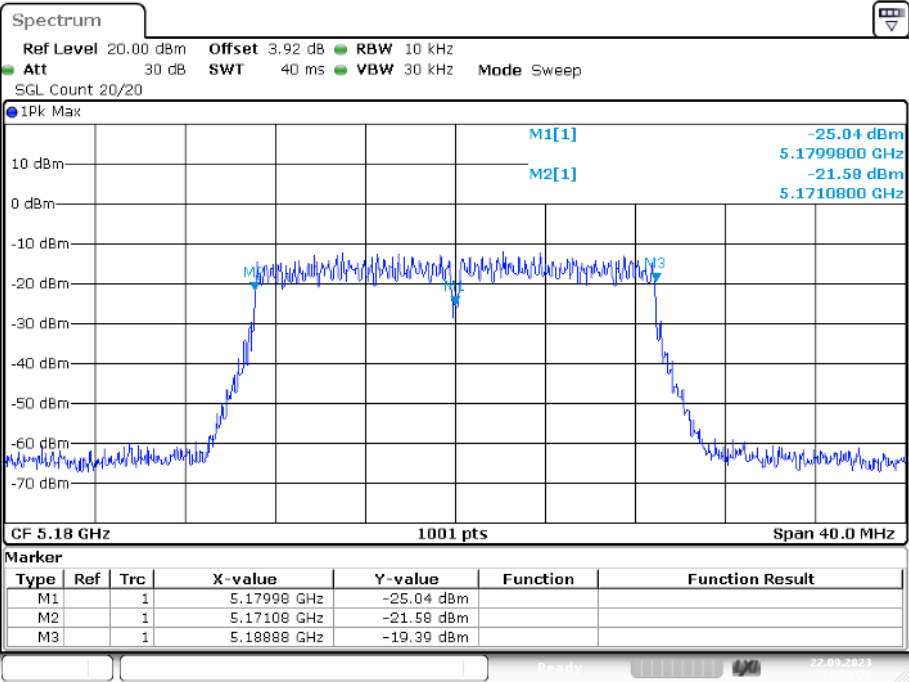


Date: 22.09.2023 19:59:22

Freq. Stability 20C 3.3V n20 5180MHz Ant2 0 Minutes

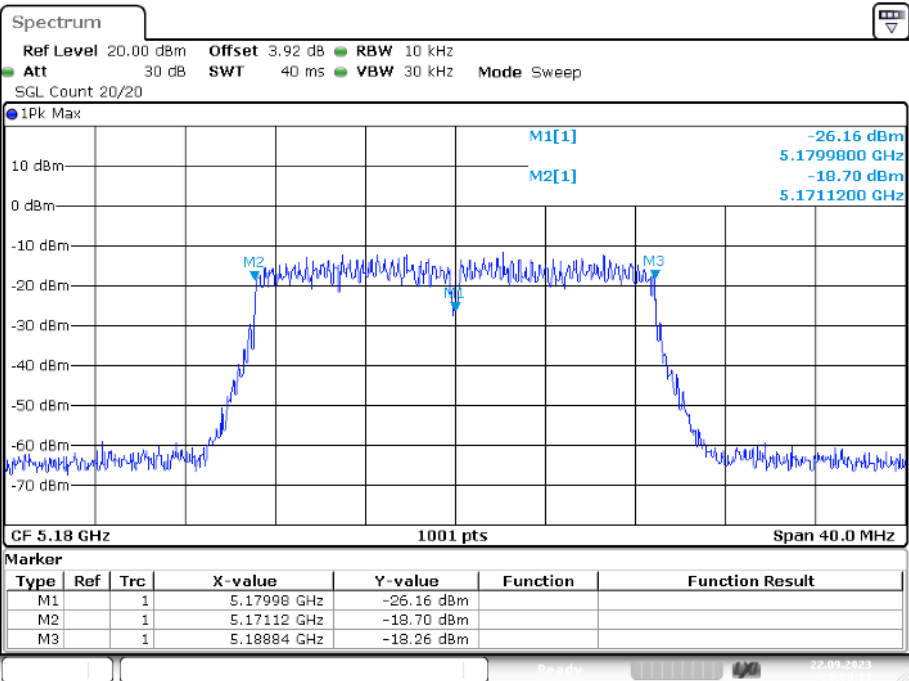


Date: 22.09.2023 20:00:13

Freq. Stability 20C 3.80V n20 5180MHz Ant2 0 Minutes

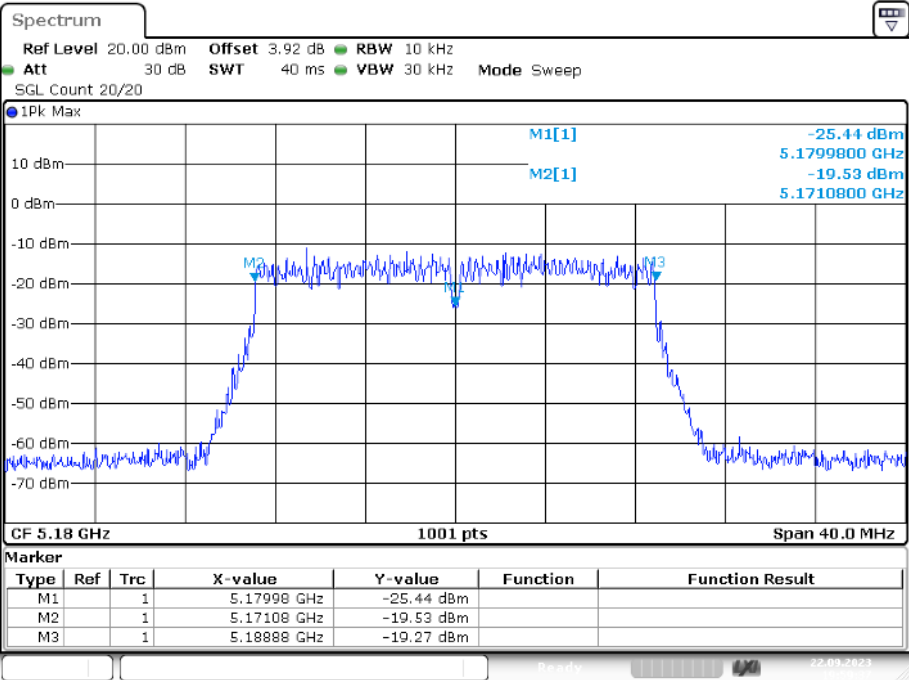


Date: 22.09.2023 19:59:37

Freq. Stability -20C 3.3V n20 5180MHz Ant2 0 Minutes

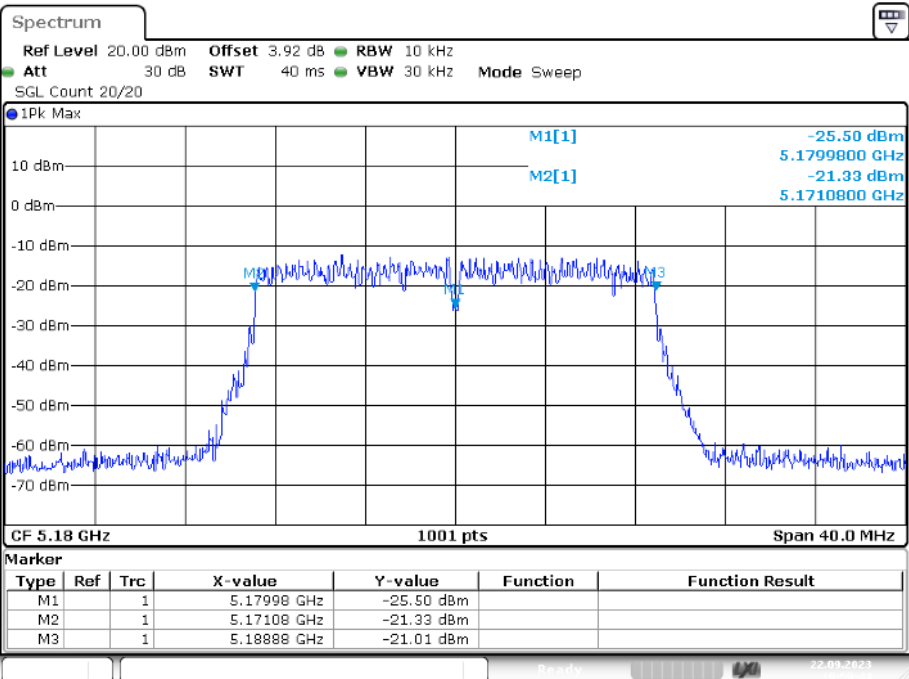


Date: 22.09.2023 19:59:44

Freq. Stability -10C 3.3V n20 5180MHz Ant2 0 Minutes

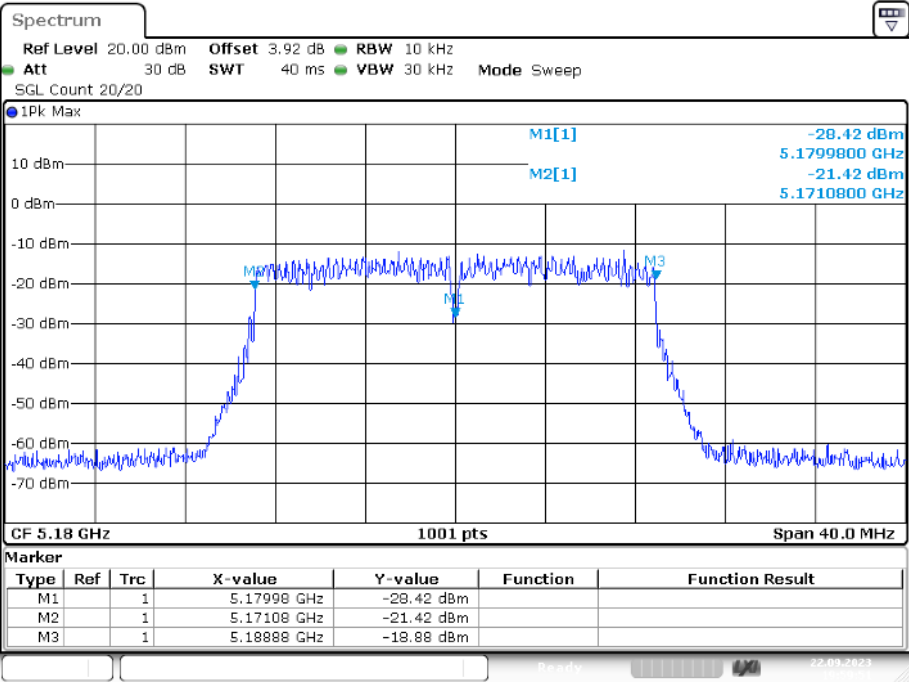


Date: 22.09.2023 19:59:31

Freq. Stability 0C 3.3V n20 5180MHz Ant2 0 Minutes

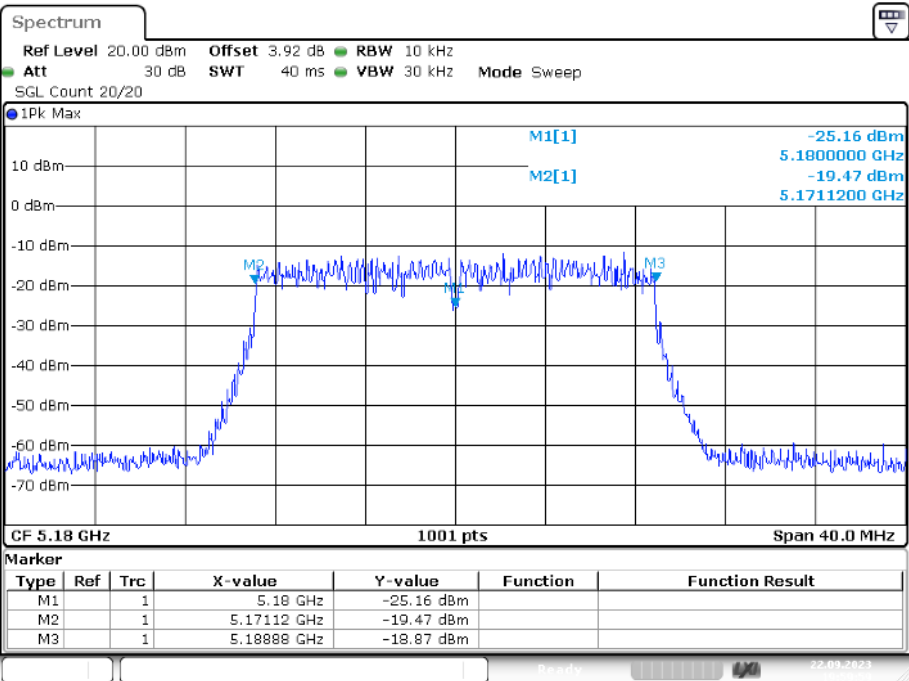


Date: 22.09.2023 19:59:39

Freq. Stability 10C 3.3V n20 5180MHz Ant2 0 Minutes

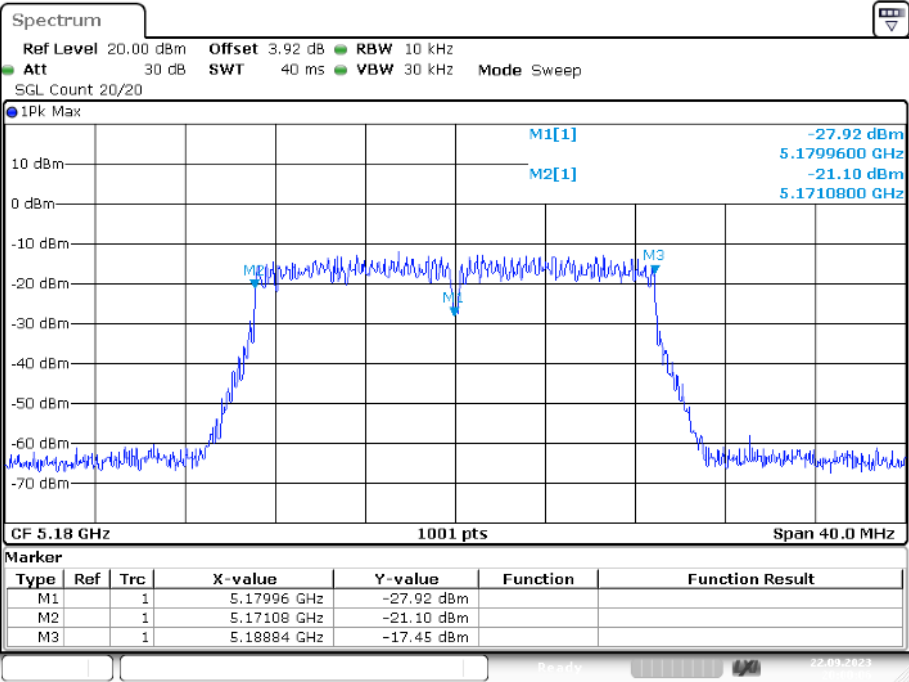


Date: 22.9.2023 20:00:06

Freq. Stability 30C 3.3V n20 5180MHz Ant2 0 Minutes

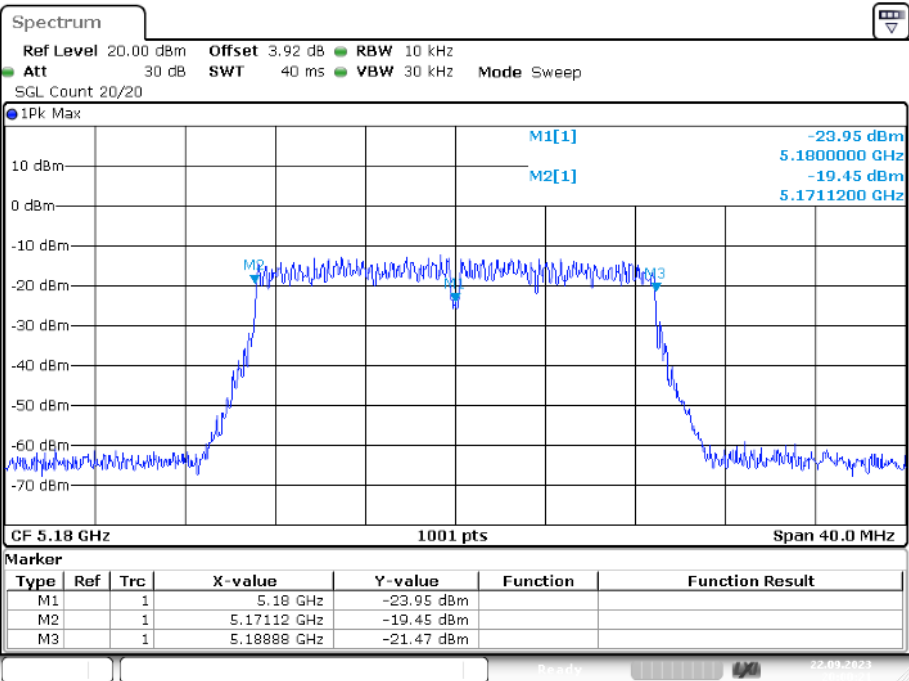


Date: 22.9.2023 20:00:21

Freq. Stability 40C 3.3V n20 5180MHz Ant2 0 Minutes

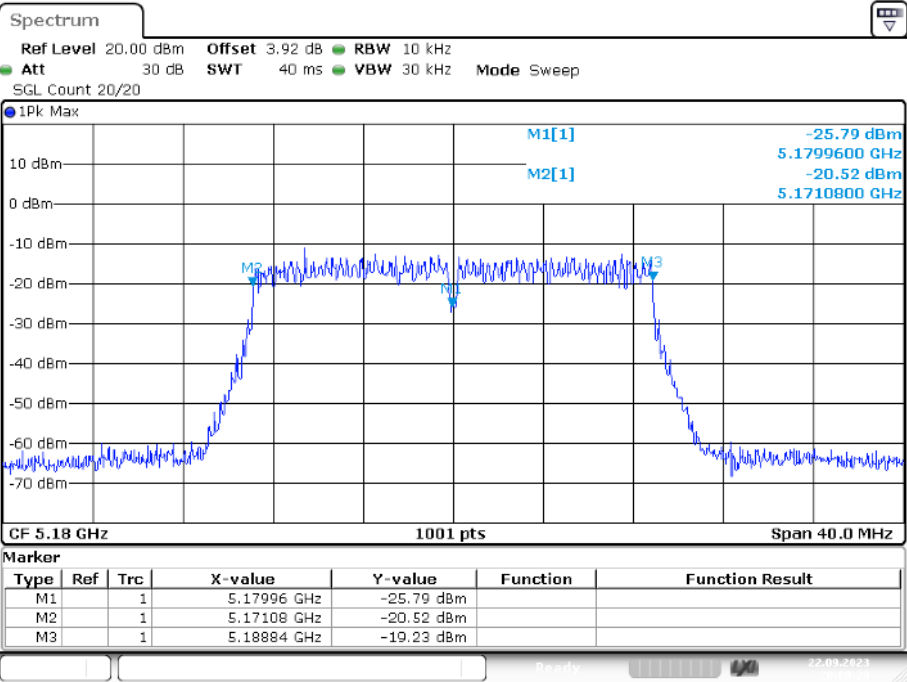


Date: 22.9.2023 20:00:28

Freq. Stability 50C 3.3V n20 5180MHz Ant2 0 Minutes

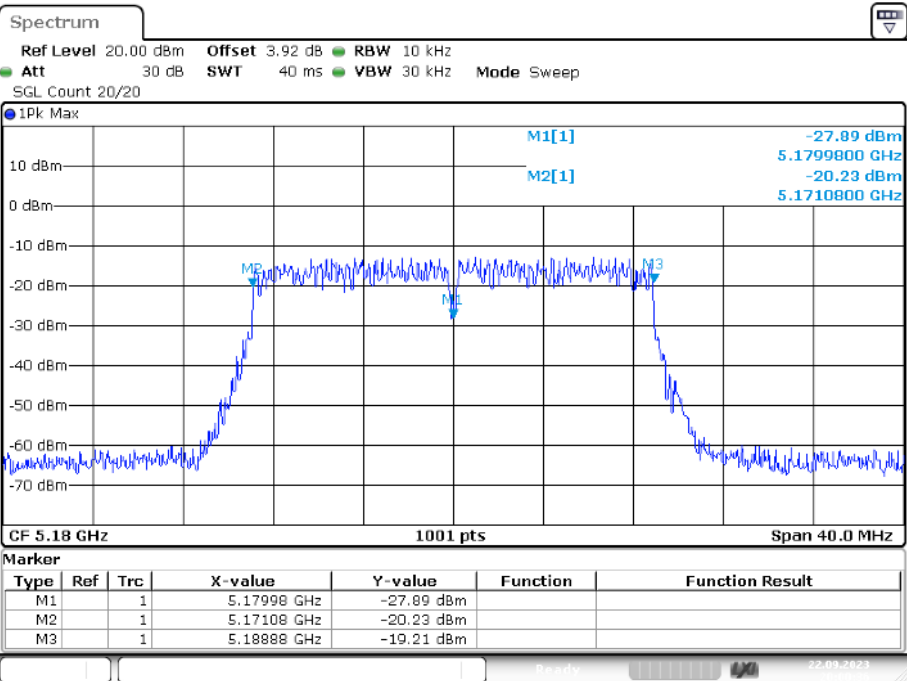


Date: 22.9.2023 20:00:35

Freq. Stability 20C 2.81V n20 5200MHz Ant2 0 Minutes

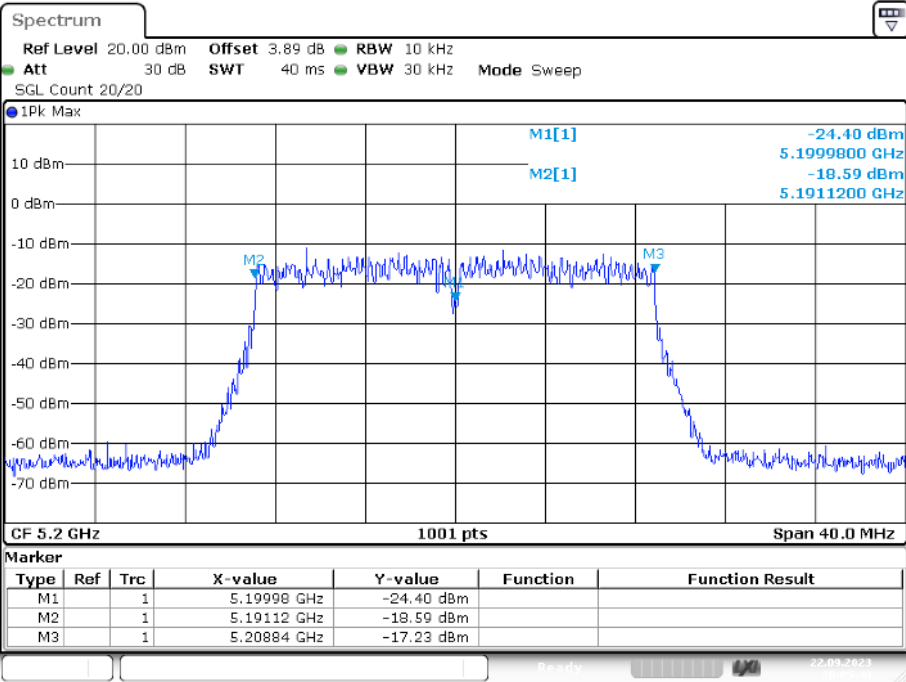


Date: 22.9.2023 20:05:40

Freq. Stability 20C 3.3V n20 5200MHz Ant2 0 Minutes

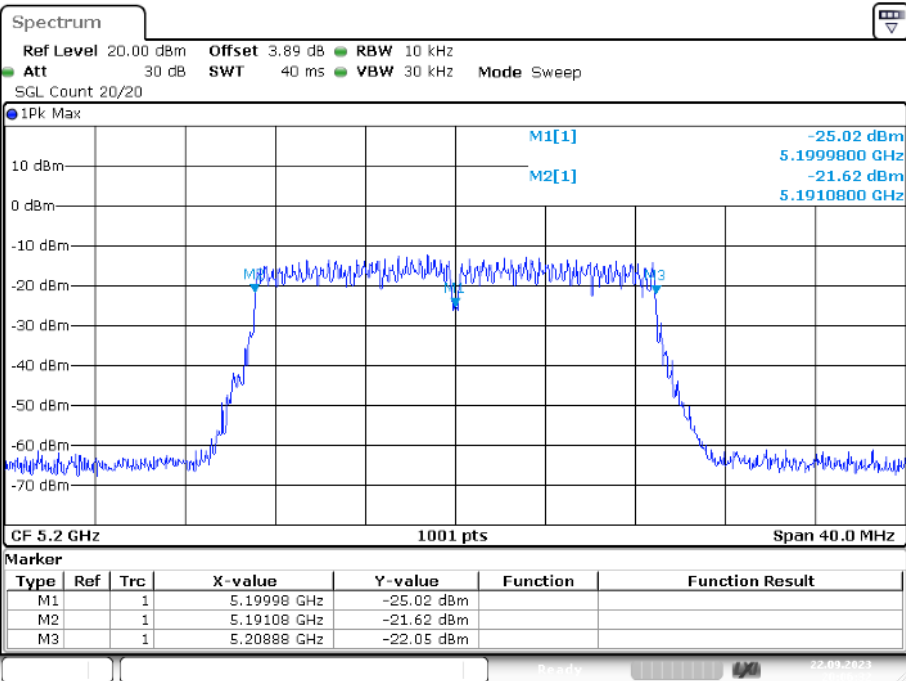


Date: 22.9.2023 20:06:32

Freq. Stability 20C 3.80V n20 5200MHz Ant2 0 Minutes

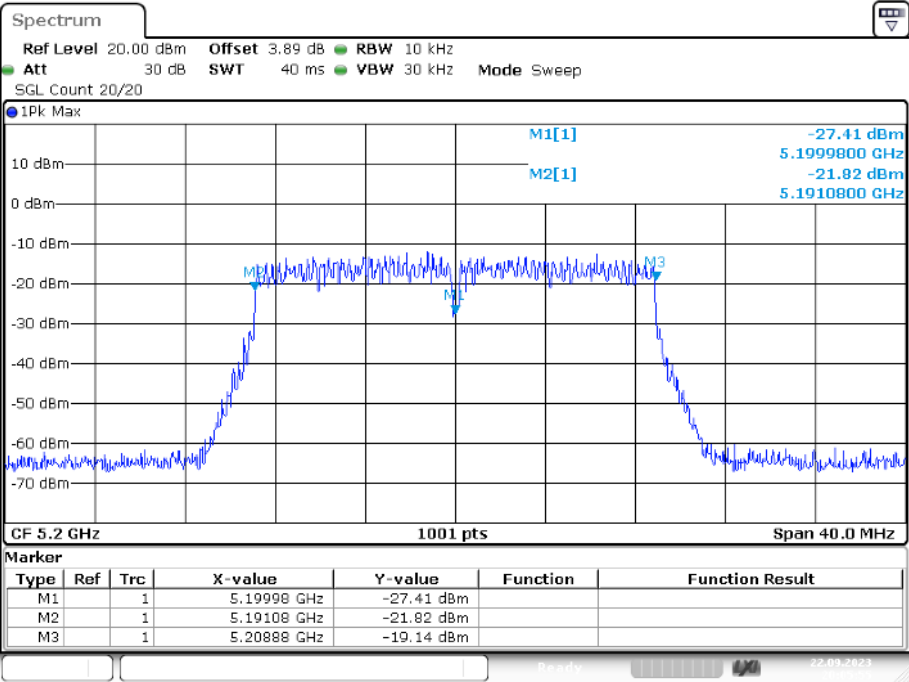


Date: 22.9.2023 20:05:35

Freq. Stability -20C 3.3V n20 5200MHz Ant2 0 Minutes

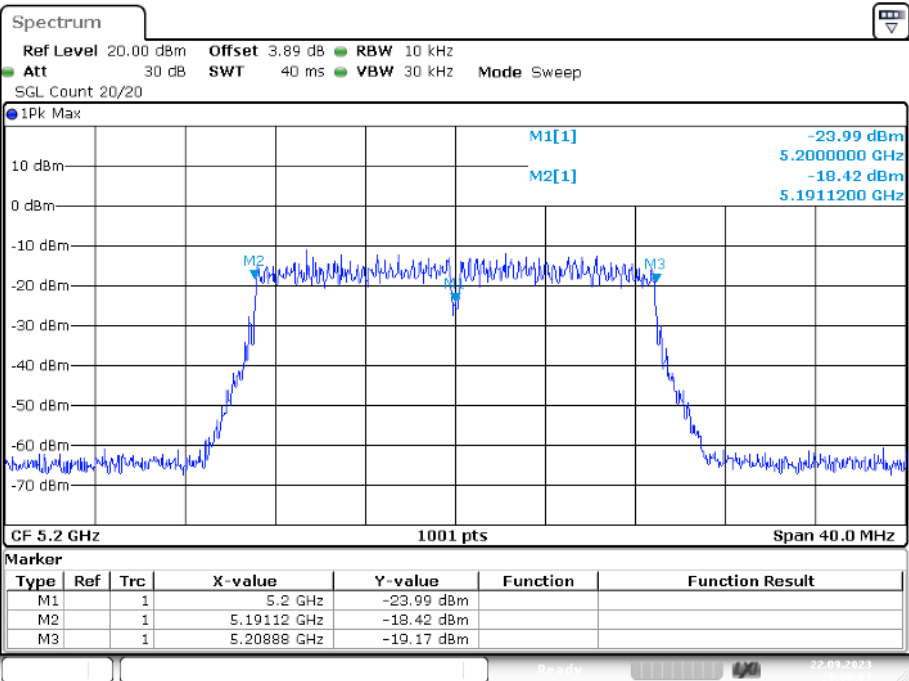


Date: 22.9.2023 20:06:02

Freq. Stability -10C 3.3V n20 5200MHz Ant2 0 Minutes

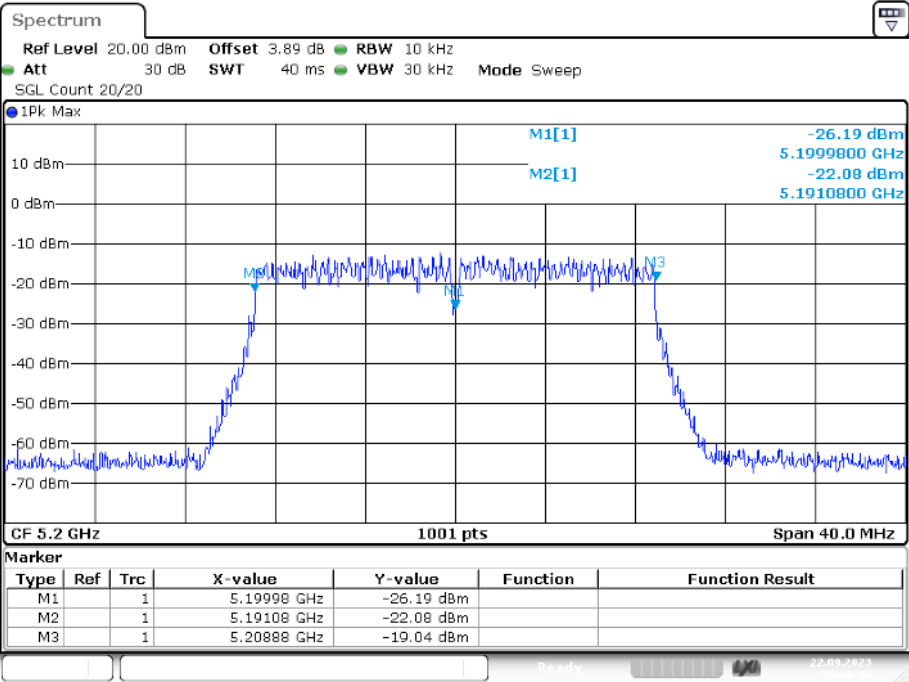


Date: 22.9.2023 20:06:10

Freq. Stability 0C 3.3V n20 5200MHz Ant2 0 Minutes

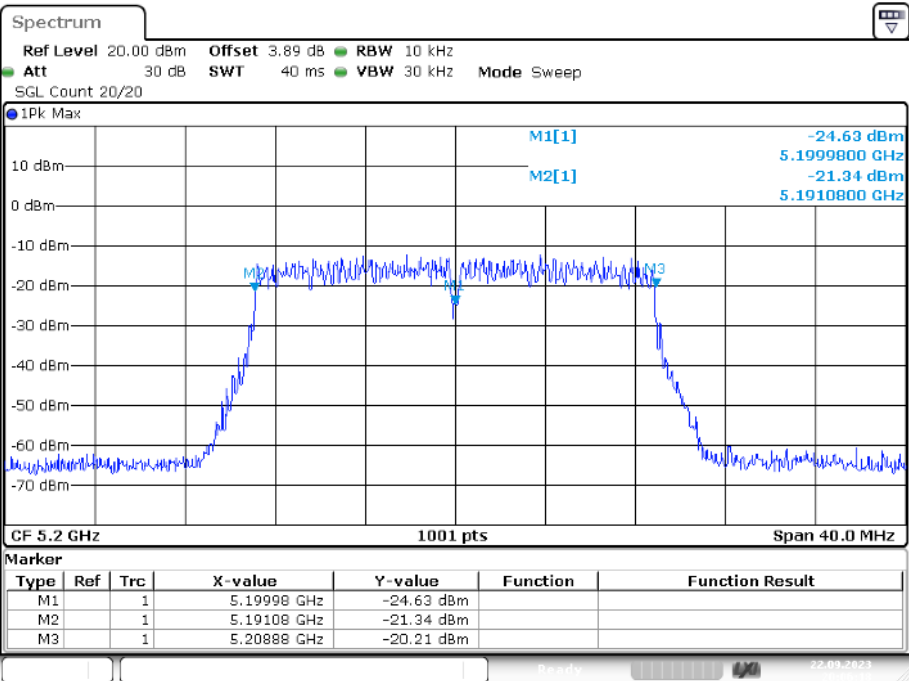


Date: 22.9.2023 20:06:17

Freq. Stability 10C 3.3V n20 5200MHz Ant2 0 Minutes

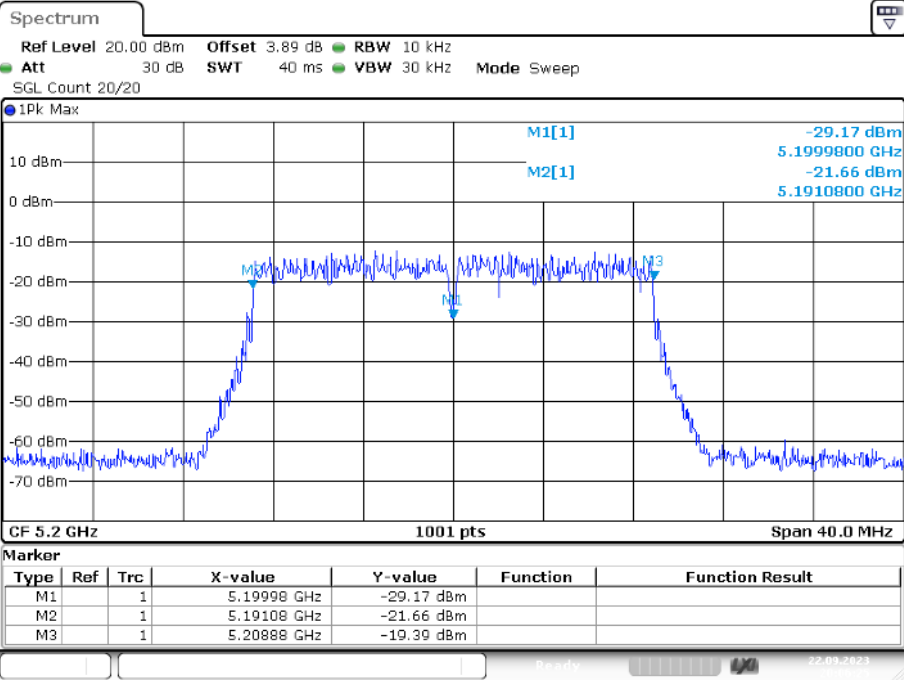


Date: 22.9.2023 20:06:25

Freq. Stability 30C 3.3V n20 5200MHz Ant2 0 Minutes

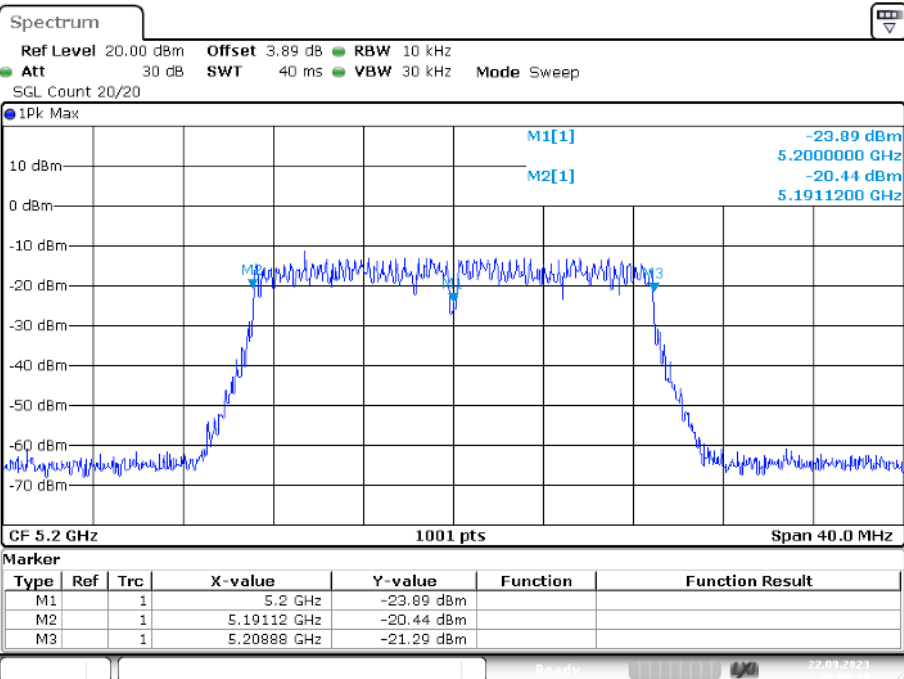


Date: 22.9.2023 20:06:39

Freq. Stability 40C 3.3V n20 5200MHz Ant2 0 Minutes

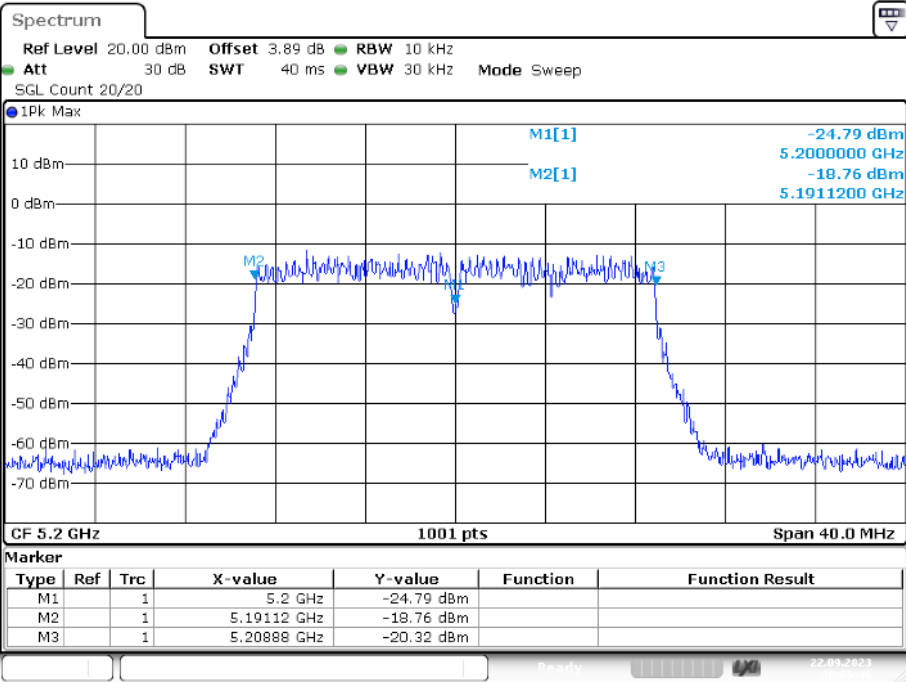

Date: 22.9.2023 20:06:46

Freq. Stability 50C 3.3V n20 5200MHz Ant2 0 Minutes

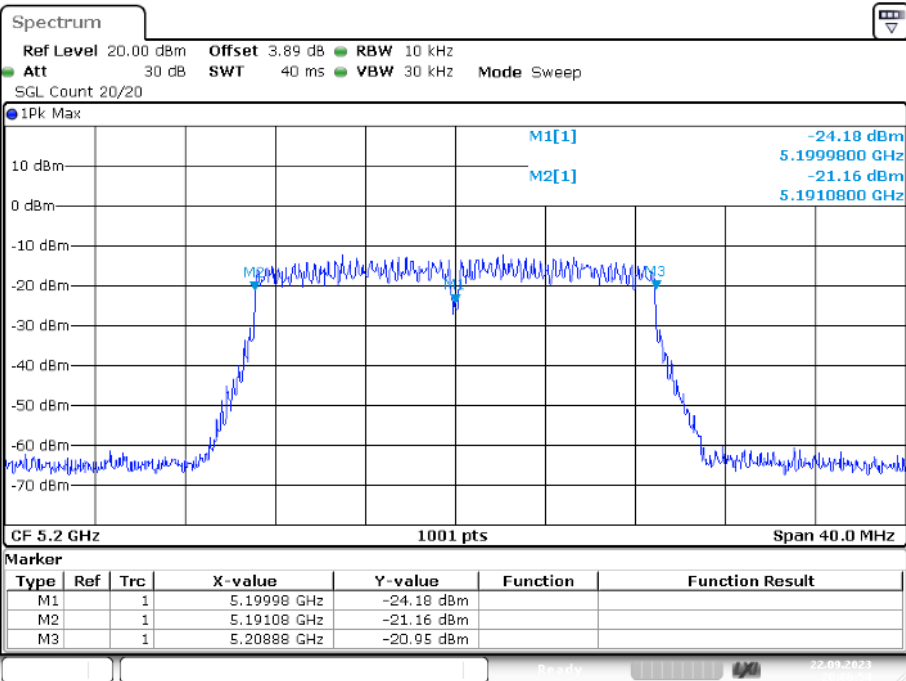

Date: 22.9.2023 20:06:54