




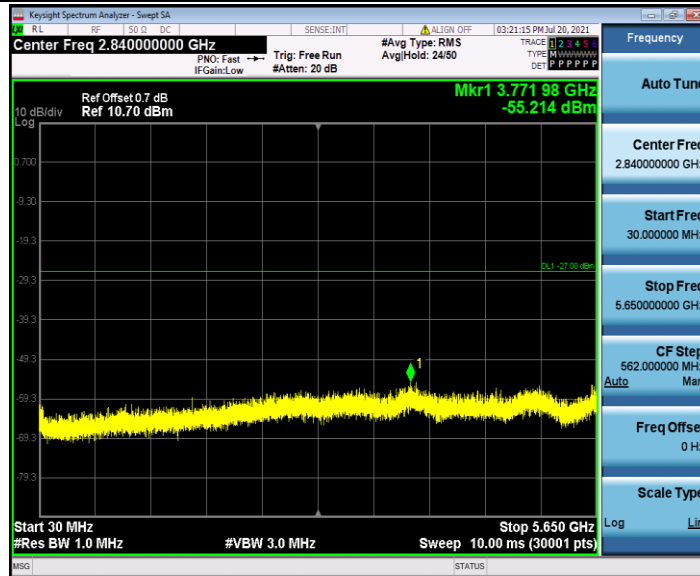

11AC80SISO_Ant1_5775_5925~40000

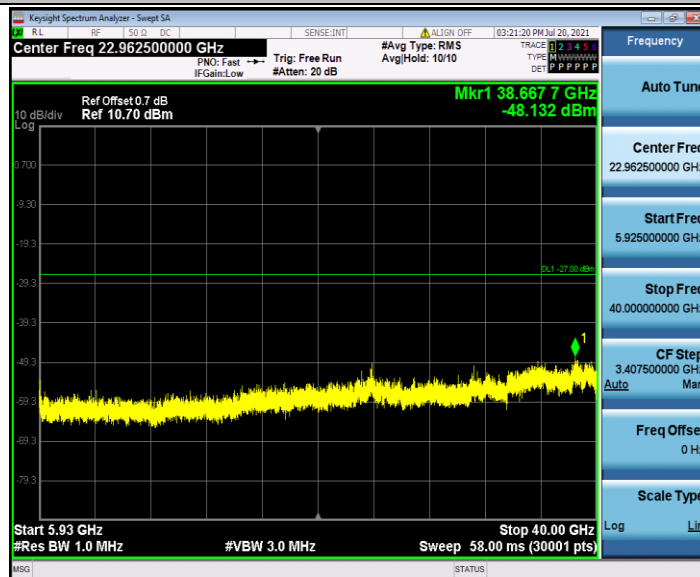

11AC80SISO_Ant2_5775_30~5650

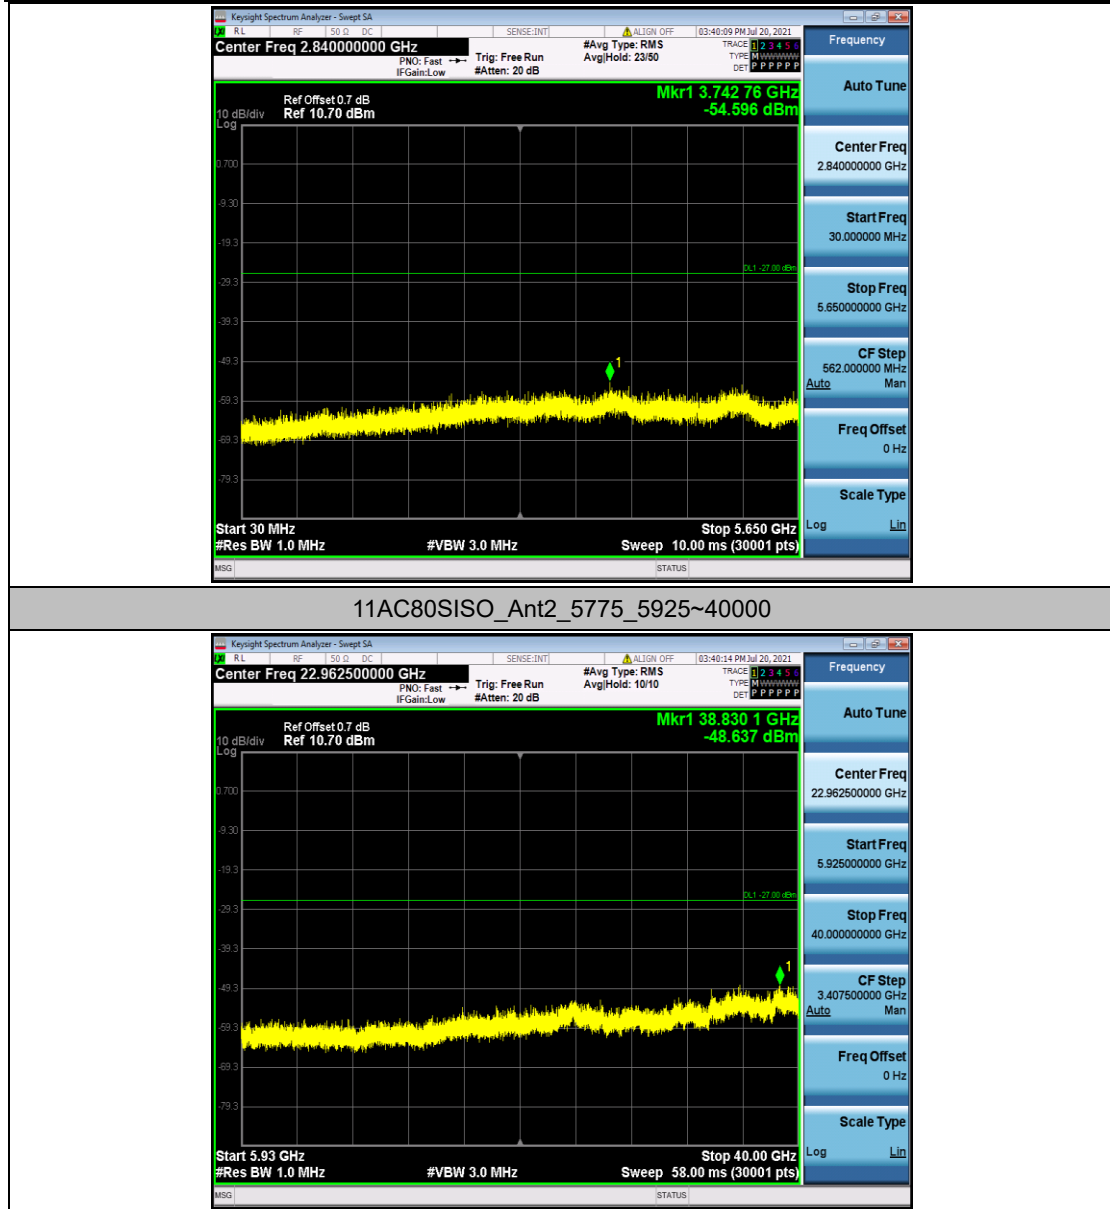

Appendix F: Duty Cycle

Test Result

TestMode	Antenna	Channel	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Duty Factor: $10\log[1/DC]$
11A	Ant1	5180	2.02	2.53	80.04	0.97
	Ant2	5180	2.02	2.53	80.04	0.97
	Ant1	5220	2.02	2.53	80.04	0.97
	Ant2	5220	2.02	2.53	80.00	0.97
	Ant1	5240	2.02	2.53	80.04	0.97
	Ant2	5240	2.02	2.53	80.04	0.97
	Ant1	5260	2.02	2.53	80.04	0.97
	Ant2	5260	2.02	2.53	80.04	0.97
	Ant1	5300	2.02	2.53	80.05	0.97
	Ant2	5300	2.02	2.53	80.04	0.97
	Ant1	5320	2.02	2.53	80.04	0.97
	Ant2	5320	2.02	2.53	80.04	0.97
	Ant1	5500	2.02	2.53	80.04	0.97
	Ant2	5500	2.02	2.53	80.04	0.97
	Ant1	5580	2.02	2.53	80.05	0.97
	Ant2	5580	2.02	2.53	80.00	0.97
	Ant1	5700	2.02	2.53	80.04	0.97
	Ant2	5700	2.02	2.53	80.00	0.97
	Ant1	5745	2.02	2.53	80.00	0.97
	Ant2	5745	2.02	2.53	80.05	0.97
	Ant1	5785	2.02	2.53	80.04	0.97
	Ant2	5785	2.02	2.53	80.00	0.97
	Ant1	5825	2.02	2.53	80.04	0.97
	Ant2	5825	2.02	2.53	80.05	0.97
11N20SISO	Ant1	5180	1.89	2.39	78.90	1.03
	Ant2	5180	1.89	2.39	78.91	1.03
	Ant1	5220	1.89	2.39	78.91	1.03
	Ant2	5220	1.89	2.39	78.91	1.03
	Ant1	5240	1.89	2.39	78.91	1.03
	Ant2	5240	1.89	2.39	78.90	1.03
	Ant1	5260	1.89	2.39	78.91	1.03

	Ant2	5260	1.89	2.39	78.91	1.03
	Ant1	5300	1.89	2.39	78.91	1.03
	Ant2	5300	1.89	2.39	78.91	1.03
	Ant1	5320	1.89	2.39	78.91	1.03
	Ant2	5320	1.89	2.39	78.91	1.03
	Ant1	5500	1.89	2.39	78.91	1.03
	Ant2	5500	1.89	2.39	78.91	1.03
	Ant1	5580	1.89	2.39	78.91	1.03
	Ant2	5580	1.89	2.39	78.91	1.03
	Ant1	5700	1.89	2.39	78.91	1.03
	Ant2	5700	1.89	2.39	78.91	1.03
	Ant1	5745	1.89	2.39	78.91	1.03
	Ant2	5745	1.89	2.39	78.91	1.03
	Ant1	5785	1.89	2.39	78.91	1.03
	Ant2	5785	1.89	2.39	78.91	1.03
	Ant1	5825	1.89	2.39	78.91	1.03
	Ant2	5825	1.89	2.39	78.91	1.03
11N40SISO	Ant1	5190	0.93	1.43	64.76	1.89
	Ant2	5190	0.93	1.43	64.75	1.89
	Ant1	5230	0.93	1.43	64.75	1.89
	Ant2	5230	0.93	1.43	64.79	1.88
	Ant1	5270	0.93	1.43	64.75	1.89
	Ant2	5270	0.93	1.43	64.75	1.89
	Ant1	5310	0.93	1.43	64.75	1.89
	Ant2	5310	0.93	1.43	64.75	1.89
	Ant1	5510	0.93	1.43	64.75	1.89
	Ant2	5510	0.93	1.43	64.75	1.89
	Ant1	5550	0.93	1.43	64.78	1.89
	Ant2	5550	0.93	1.43	64.78	1.89
	Ant1	5670	0.93	1.43	64.75	1.89
	Ant2	5670	0.93	1.43	64.75	1.89
	Ant1	5755	0.93	1.43	64.75	1.89
	Ant2	5755	0.93	1.43	64.75	1.89
	Ant1	5795	0.93	1.43	64.75	1.89
	Ant2	5795	0.93	1.44	64.87	1.88
11AC20SISO	Ant1	5180	1.89	2.39	78.94	1.03
	Ant2	5180	1.89	2.40	78.94	1.03
	Ant1	5220	1.89	2.39	78.94	1.03



SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch

Page: 436 of 496
Report No.: GZCR210502031703
FCC ID: 2AWD4-ECHTES101

	Ant2	5220	1.89	2.39	78.94	1.03
	Ant1	5240	1.89	2.39	78.94	1.03
	Ant2	5240	1.89	2.40	78.94	1.03
	Ant1	5260	1.89	2.39	78.94	1.03
	Ant2	5260	1.89	2.39	78.94	1.03
	Ant1	5300	1.89	2.40	78.90	1.03
	Ant2	5300	1.89	2.39	78.94	1.03
	Ant1	5320	1.89	2.39	78.94	1.03
	Ant2	5320	1.89	2.39	78.94	1.03
	Ant1	5500	1.89	2.39	78.94	1.03
	Ant2	5500	1.89	2.39	78.90	1.03
	Ant1	5580	1.89	2.39	78.94	1.03
	Ant2	5580	1.89	2.39	78.94	1.03
	Ant1	5700	1.89	2.39	78.94	1.03
	Ant2	5700	1.89	2.39	78.94	1.03
	Ant1	5745	1.89	2.40	78.94	1.03
	Ant2	5745	1.89	2.39	78.94	1.03
	Ant1	5785	1.89	2.40	78.95	1.03
	Ant2	5785	1.89	2.39	78.94	1.03
	Ant1	5825	1.89	2.39	78.94	1.03
	Ant2	5825	1.89	2.39	78.90	1.03
11AC40SISO	Ant1	5190	0.93	1.43	64.84	1.88
	Ant2	5190	0.93	1.43	64.84	1.88
	Ant1	5230	0.93	1.44	64.87	1.88
	Ant2	5230	0.93	1.43	64.84	1.88
	Ant1	5270	0.93	1.43	64.84	1.88
	Ant2	5270	0.93	1.43	64.84	1.88
	Ant1	5310	0.93	1.43	64.84	1.88
	Ant2	5310	0.93	1.43	64.84	1.88
	Ant1	5510	0.93	1.43	64.84	1.88
	Ant2	5510	0.93	1.43	64.84	1.88
	Ant1	5550	0.93	1.43	64.84	1.88
	Ant2	5550	0.93	1.43	64.84	1.88
	Ant1	5670	0.93	1.43	64.84	1.88
	Ant2	5670	0.93	1.44	64.78	1.89
	Ant1	5755	0.93	1.43	64.84	1.88
	Ant2	5755	0.93	1.44	64.78	1.89
	Ant1	5795	0.93	1.44	64.78	1.89




SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch


Page: 437 of 496
Report No.: GZCR210502031703
FCC ID: 2AWD4-ECHTES101

	Ant2	5795	0.93	1.44	64.87	1.88
11AC80SISO	Ant1	5210	0.45	0.96	47.21	3.26
	Ant2	5210	0.45	0.95	47.14	3.27
	Ant1	5290	0.45	0.95	47.14	3.27
	Ant2	5290	0.45	0.95	47.14	3.27
	Ant1	5530	0.45	0.95	47.14	3.27
	Ant2	5530	0.45	0.95	47.14	3.27
	Ant1	5610	0.45	0.95	47.14	3.27
	Ant2	5610	0.45	0.96	47.08	3.27
	Ant1	5775	0.45	0.96	47.08	3.27
	Ant2	5775	0.45	0.95	47.14	3.27


Test Graphs

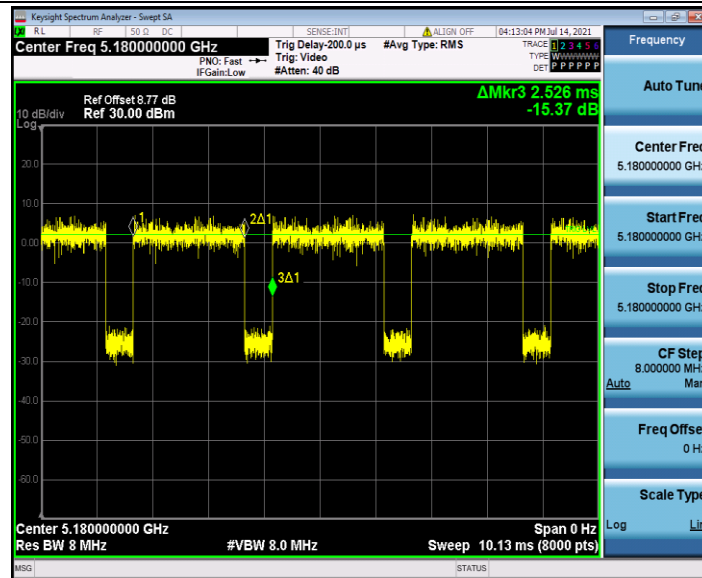


11A_Ant1_5180

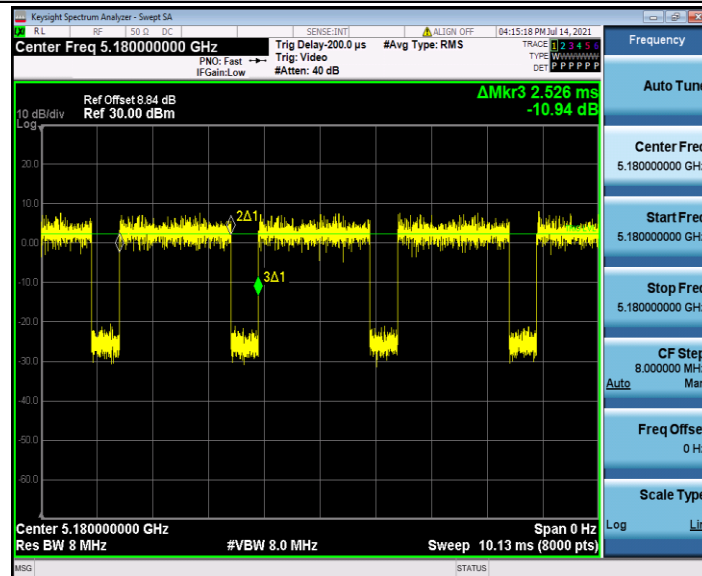


11A_Ant2_5180

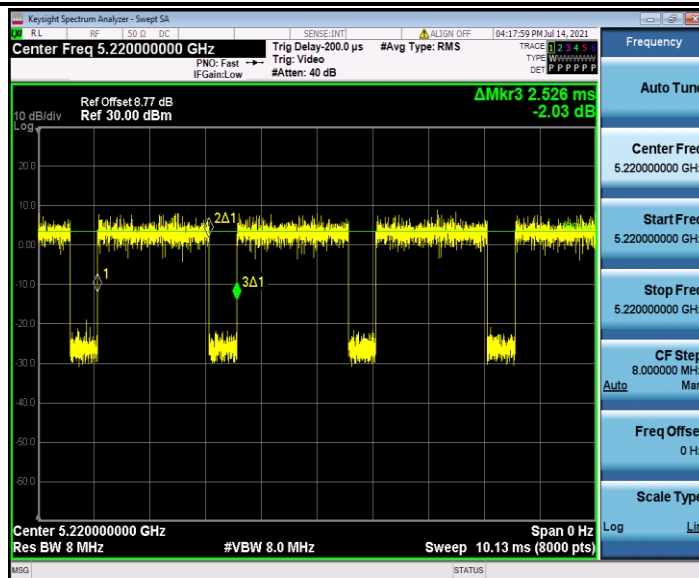


11A Ant1 5220

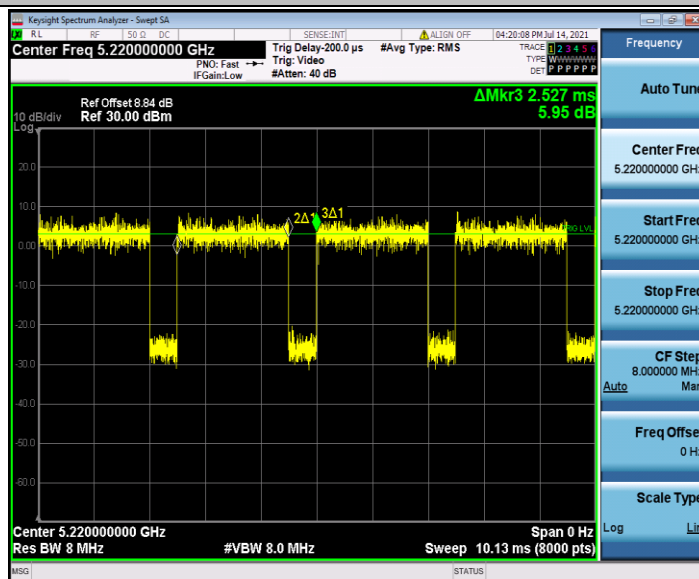


11A Ant2 5220

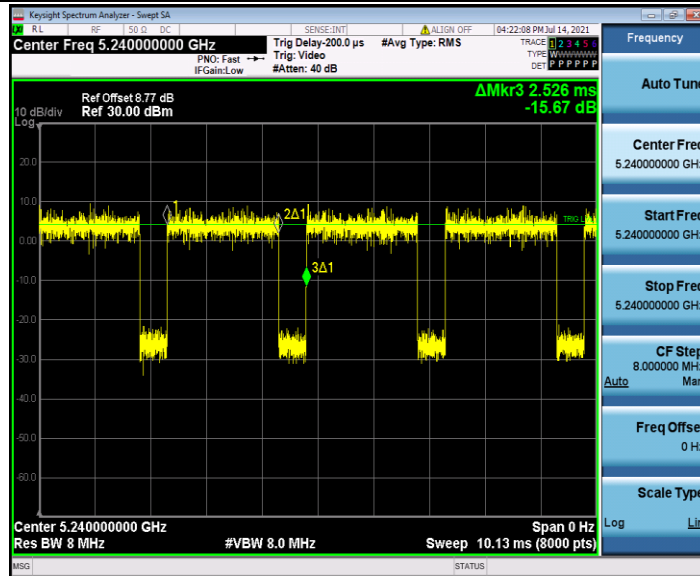


11A_Ant1_5240

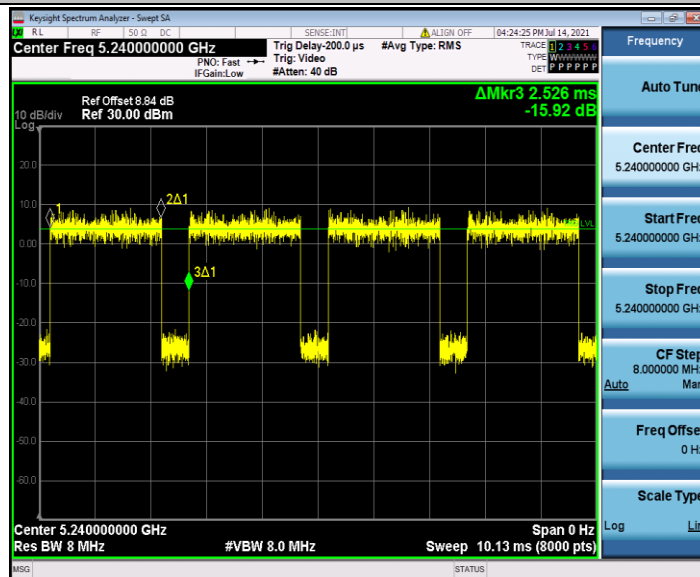


11A_Ant2_5240

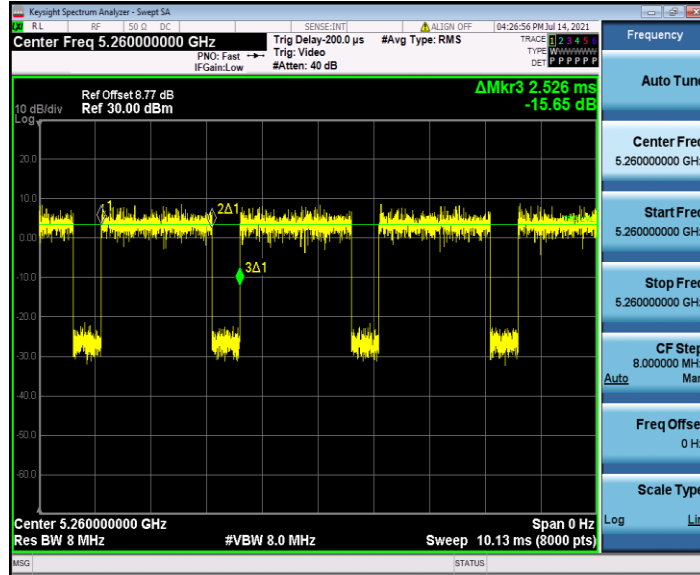


11A_Ant1_5260

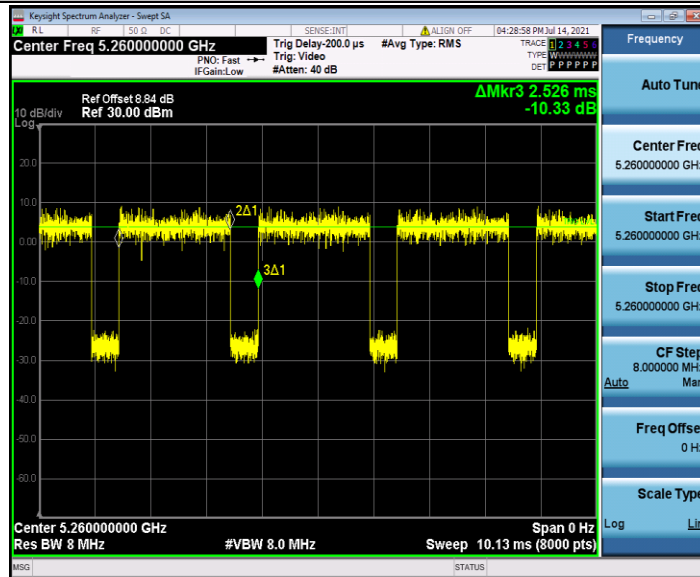


11A_Ant2_5260

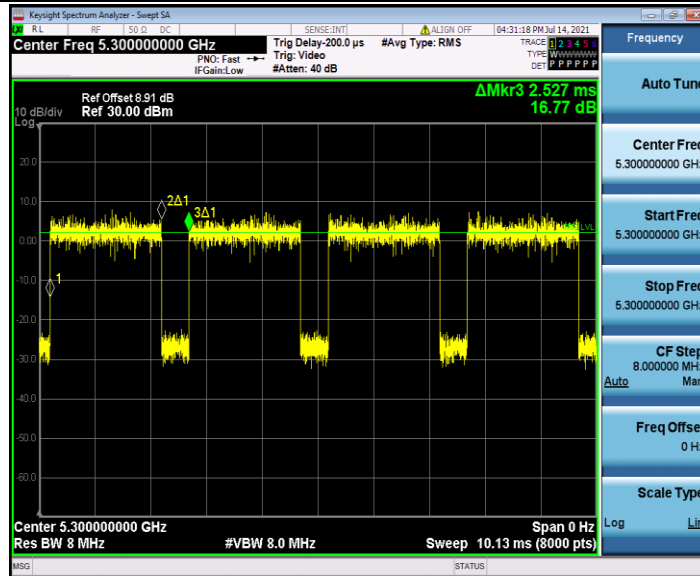


11A_Ant1_5300

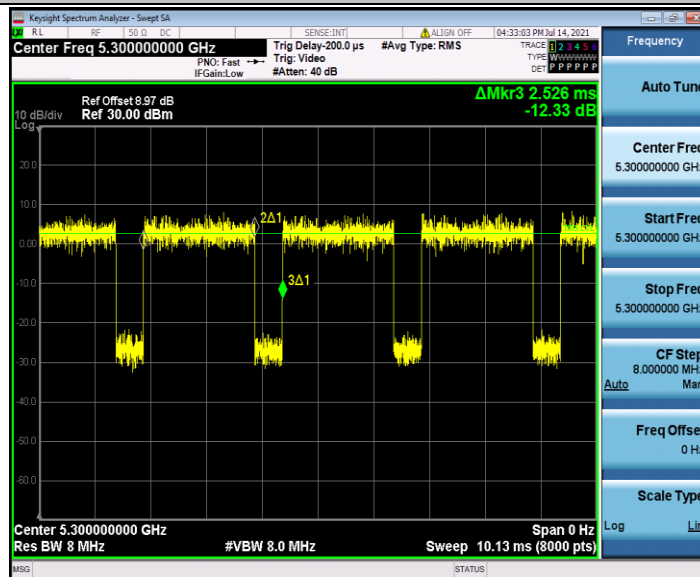


11A_Ant2_5300

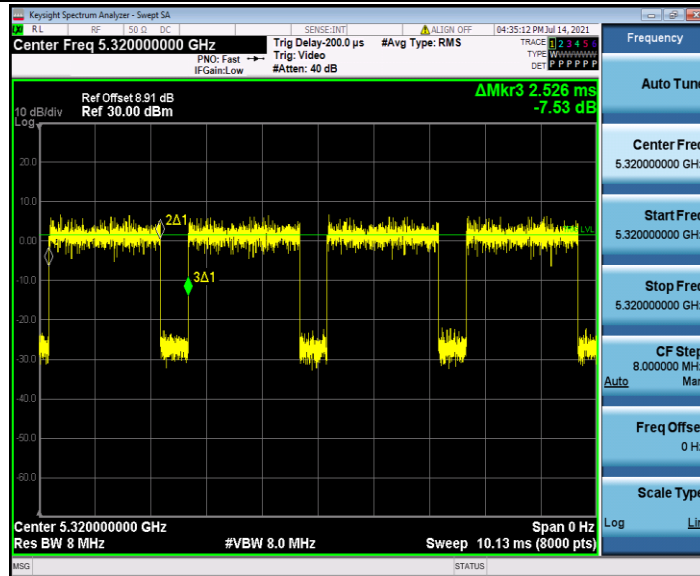


11A_Ant1_5320

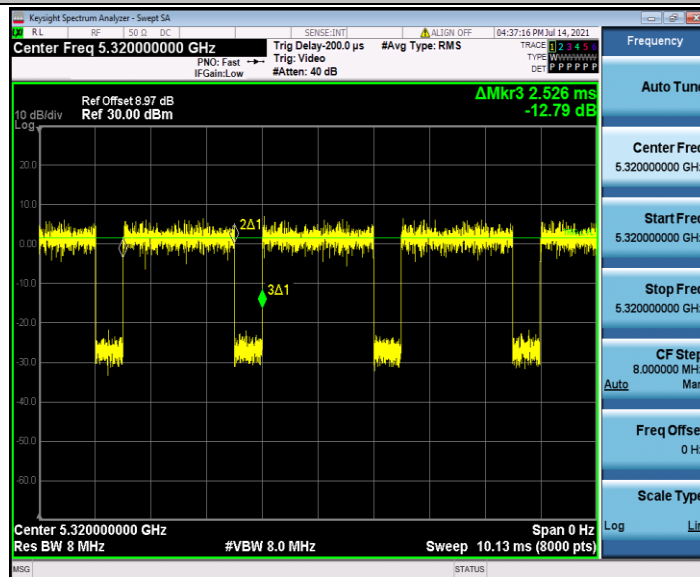


11A_Ant2_5320

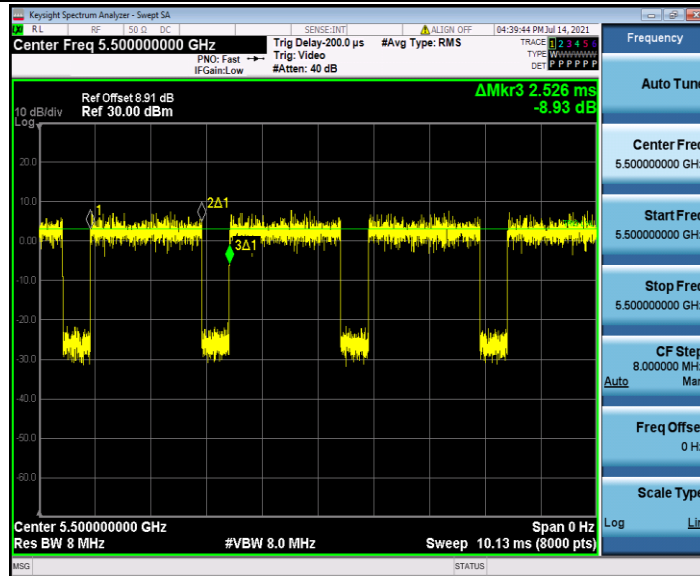


11A_Ant1_5500

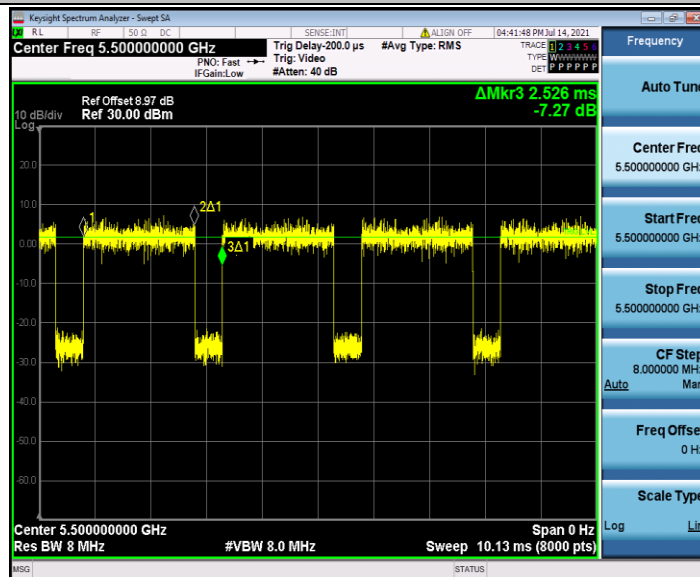


11A_Ant2_5500

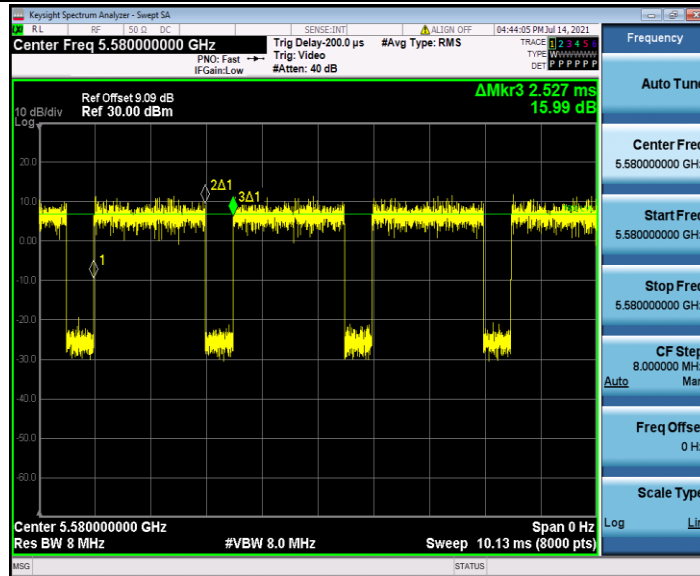


11A_Ant1_5580

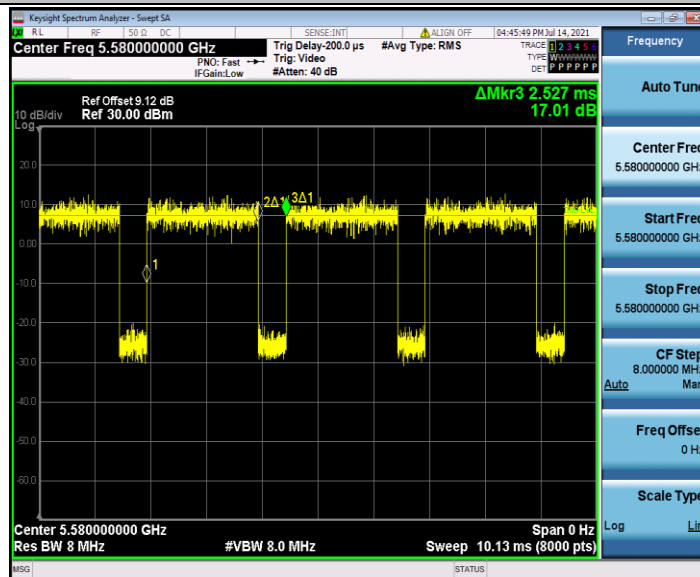


11A_Ant2_5580

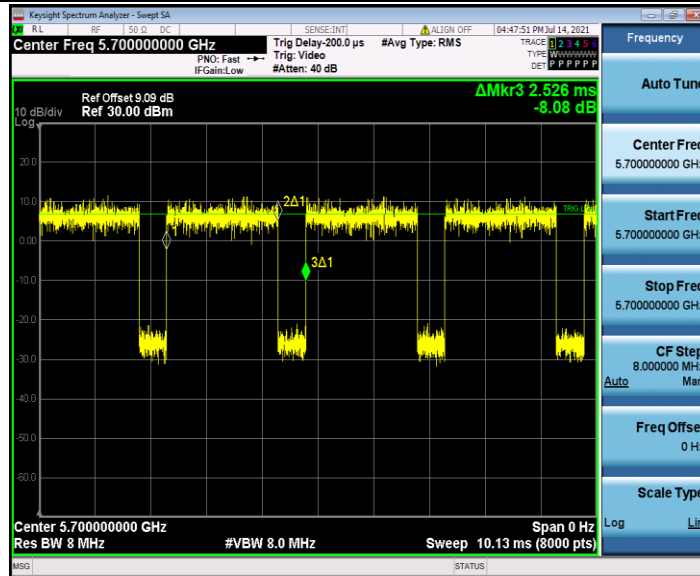


11A_Ant1_5700

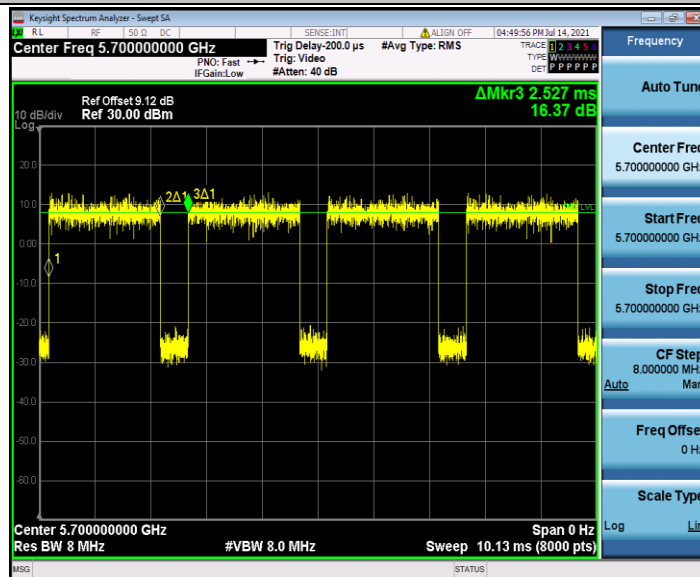


11A_Ant2_5700

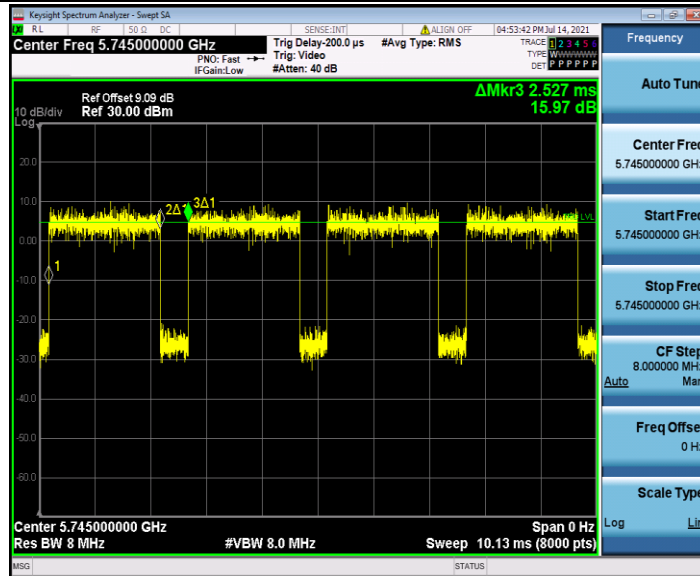


11A_Ant1_5745

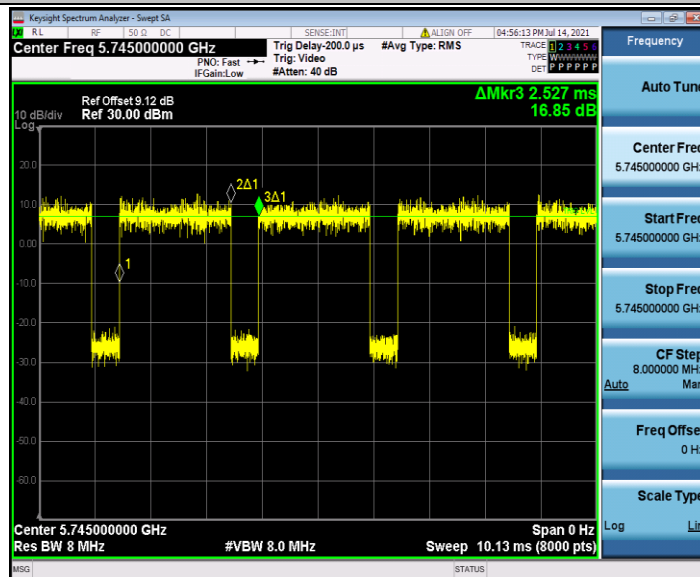


11A_Ant2_5745

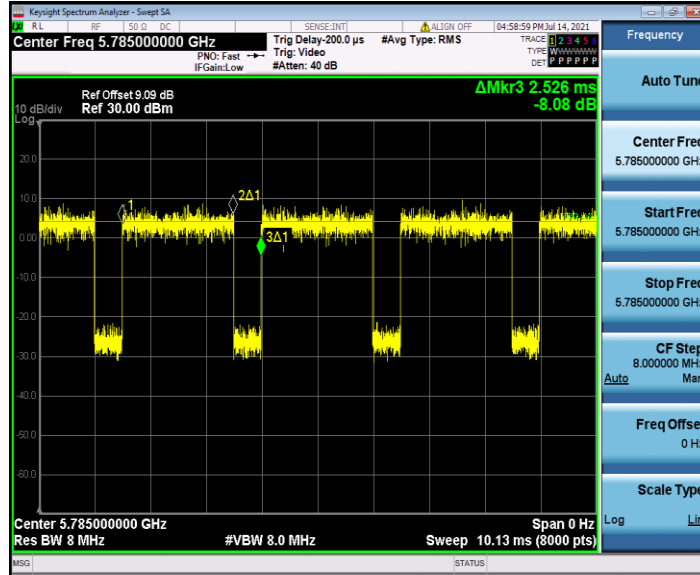


11A_Ant1_5785

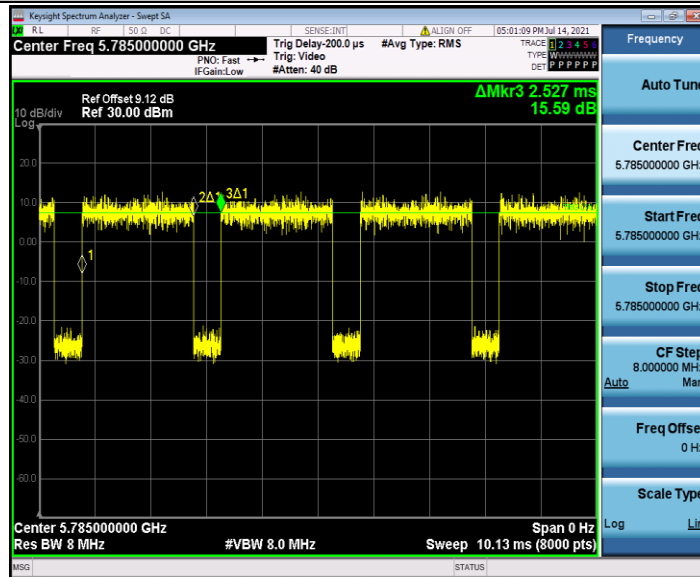

11A_Ant2_5785

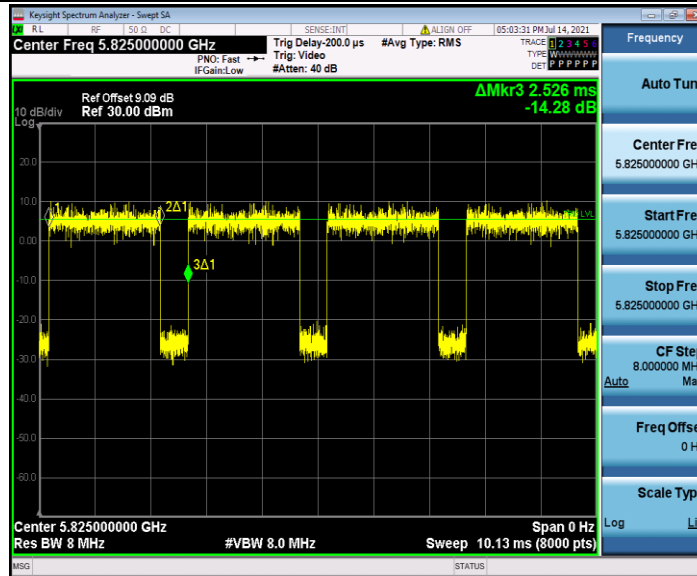


11A_Ant1_5825

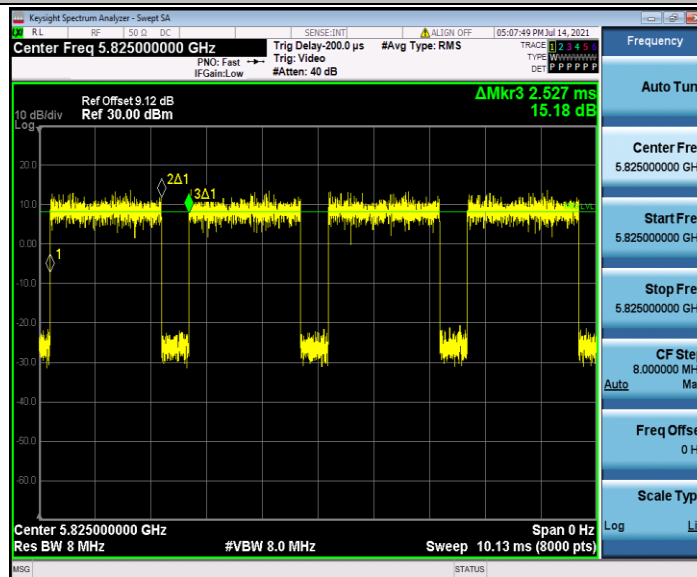


11A_Ant2_5825


11N20SISO_Ant1_5180

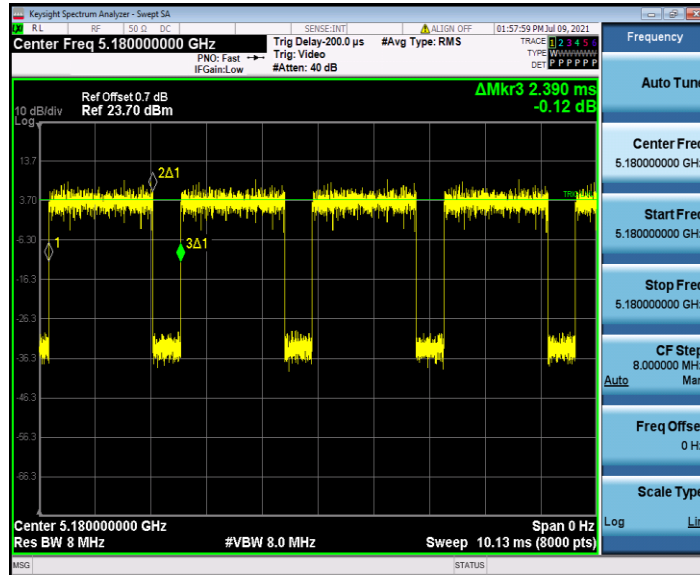


11N20SISO_Ant2_5180

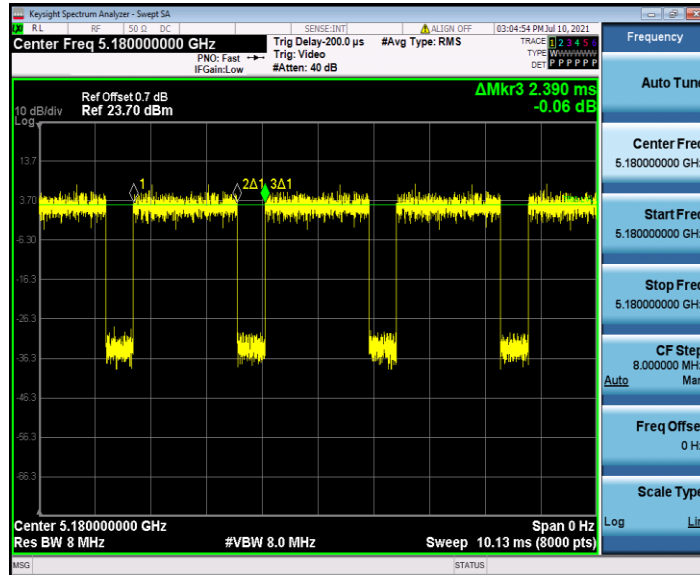


11N20SISO_Ant1_5220

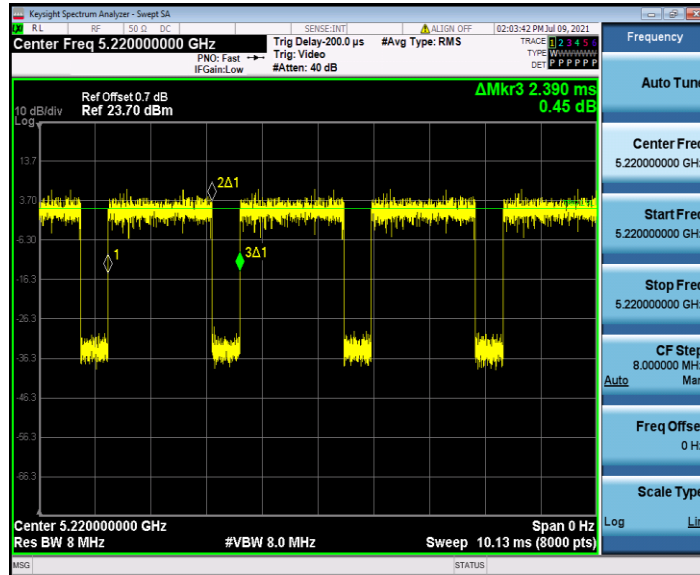


11N20SISO_Ant2_5220

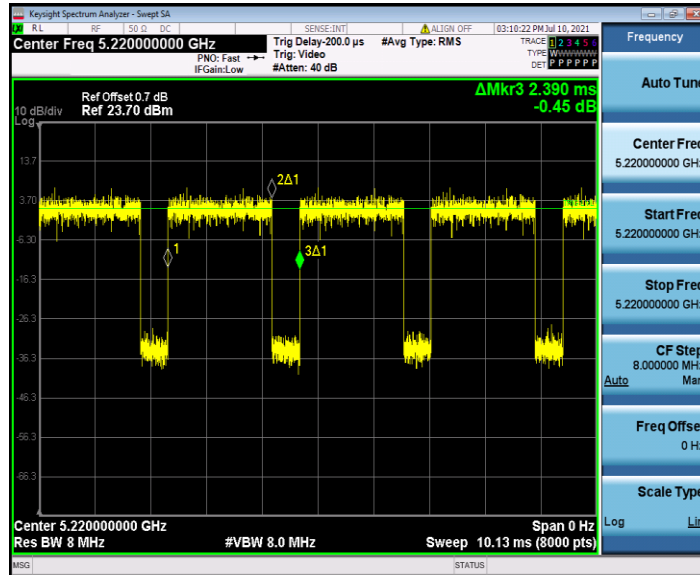


11N20SISO_Ant1_5240

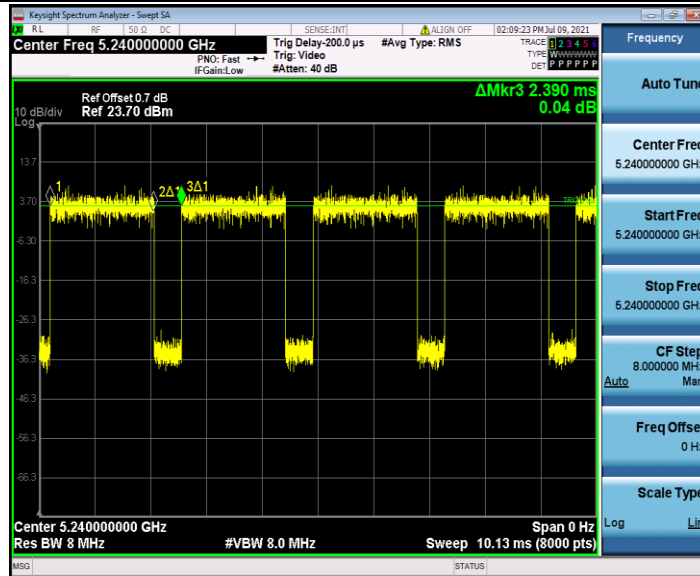


11N20SISO_Ant2_5240

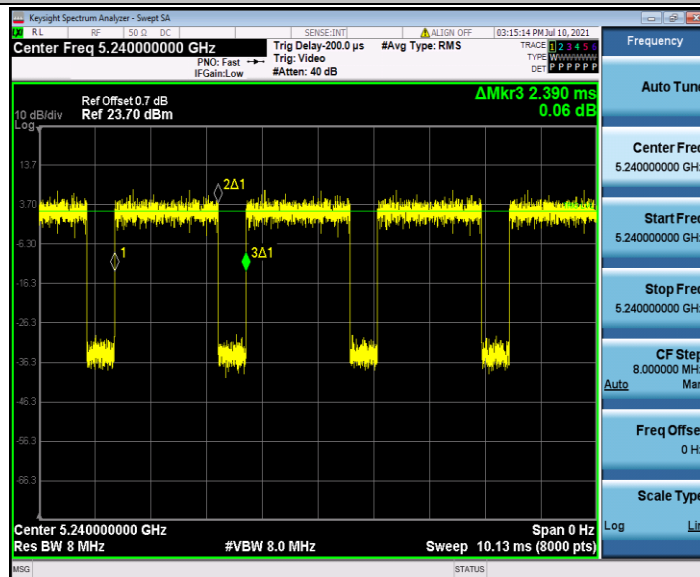


11N20SISO_Ant1_5260

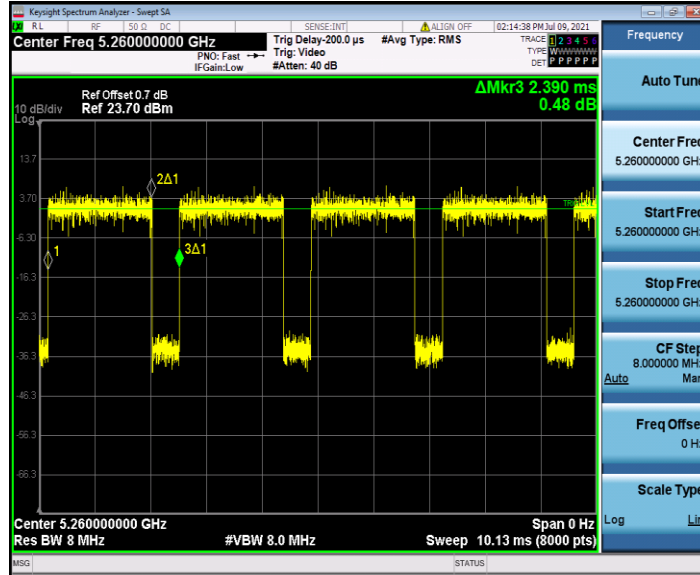


11N20SISO_Ant2_5260

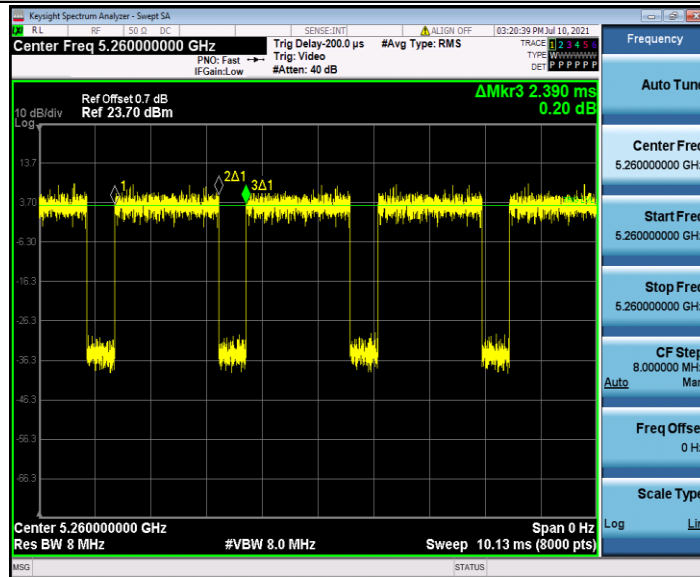


11N20SISO_Ant1_5300

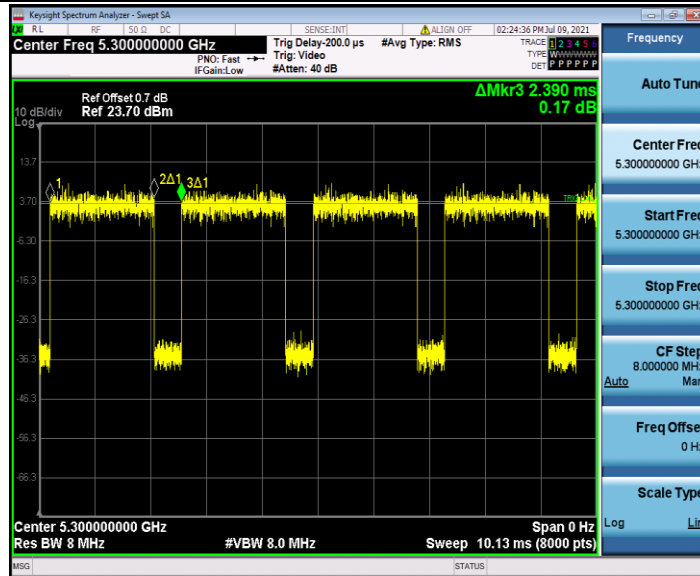


11N20SISO_Ant2_5300

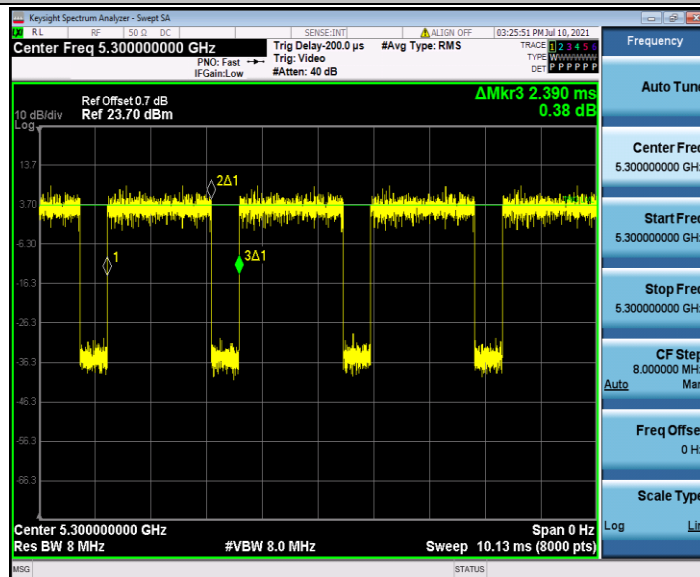


11N20SISO_Ant1_5320

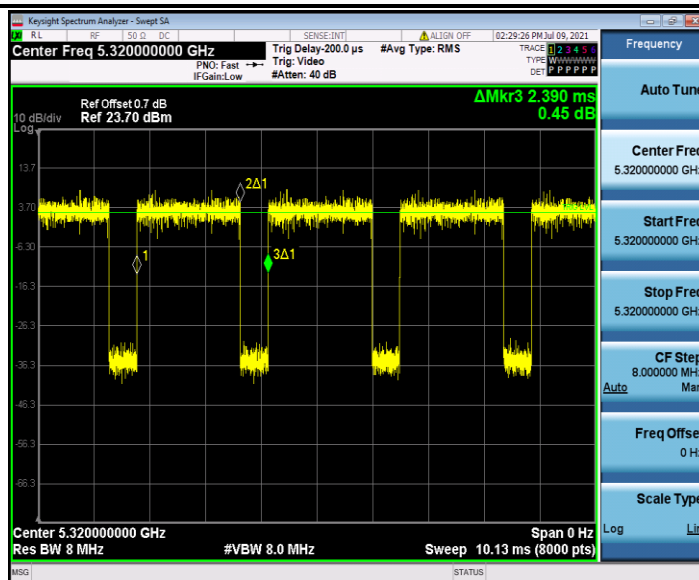


11N20SISO Ant2 5320

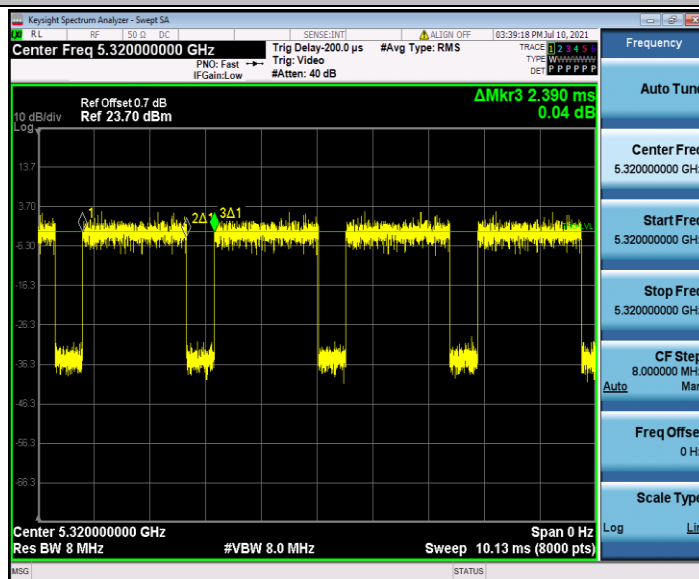


11N20SISO Ant1 5500

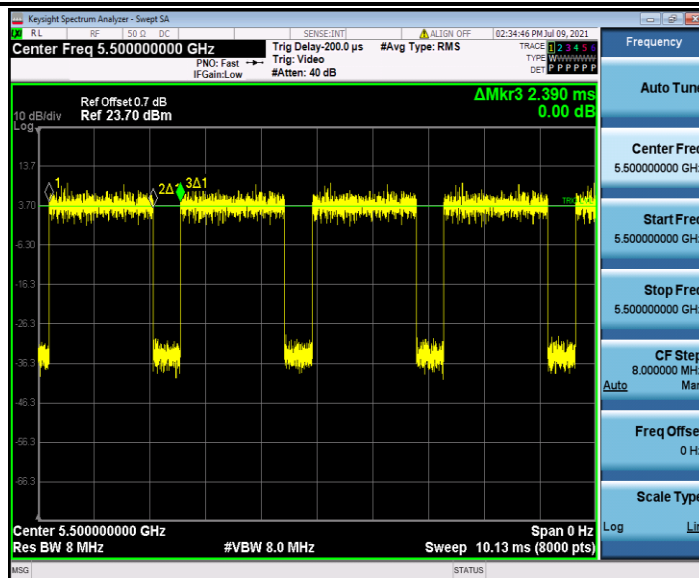


11N20SISO Ant2 5500

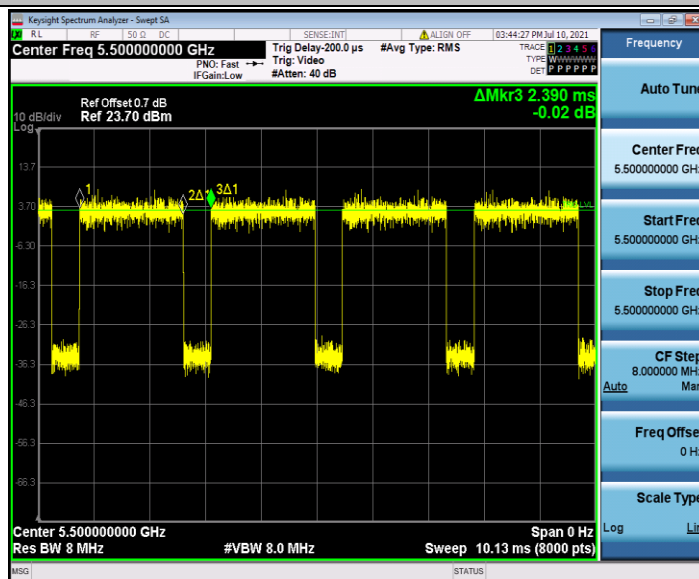


11N20SISO Ant1 5580

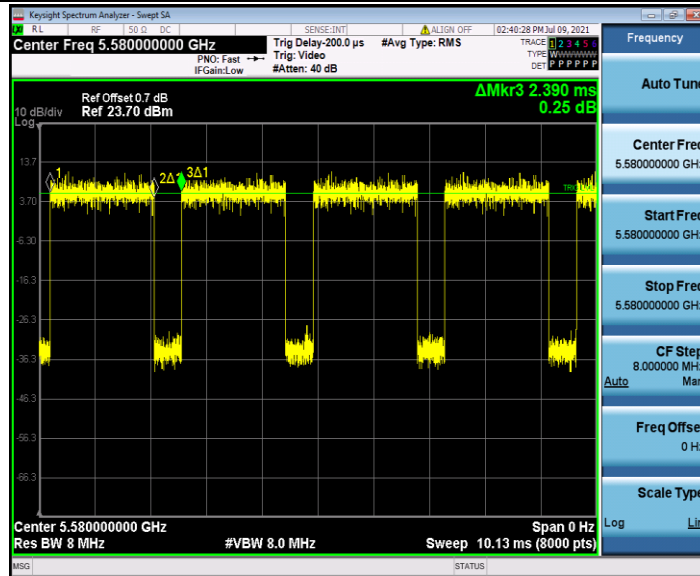


11N20SISO_Ant2_5580

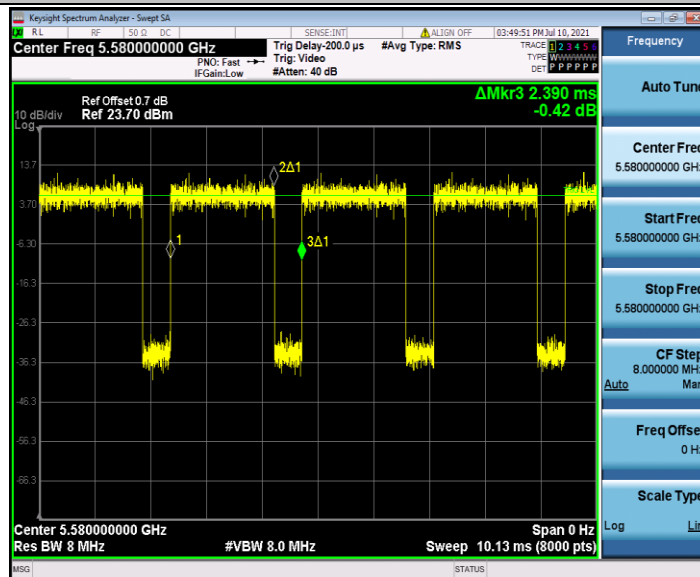

11N20SISO_Ant1_5700

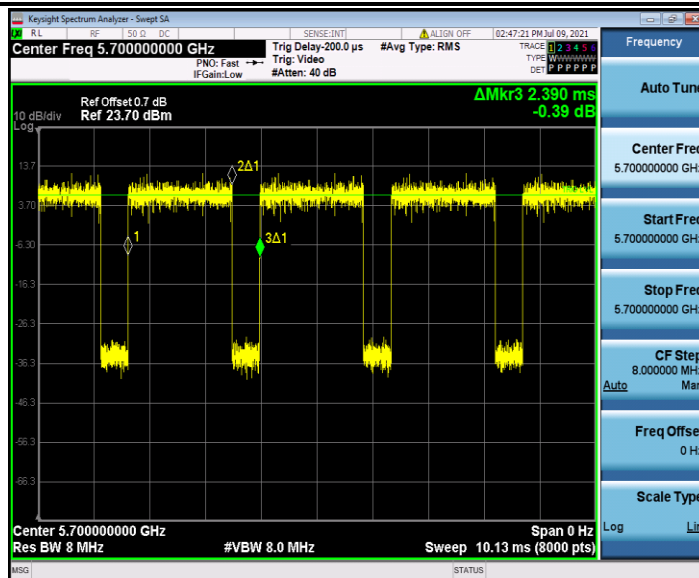

11N20SISO Ant2 5700

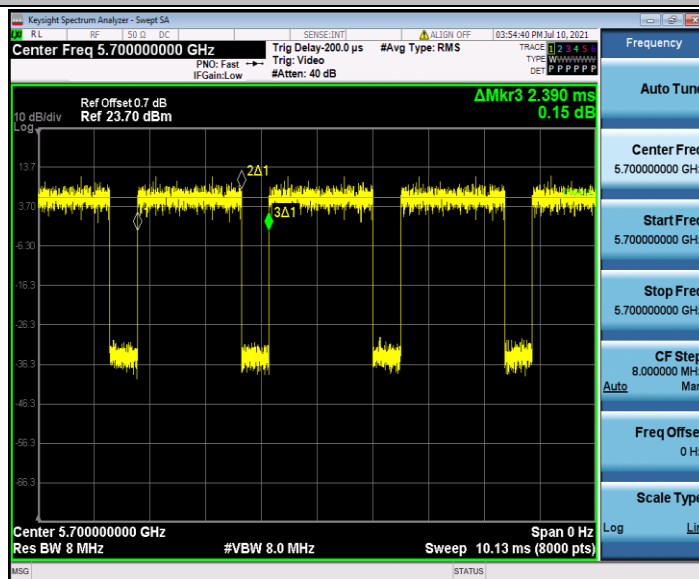

11N20SISO Ant1 5745