

FCC Part 24E**Spurious emissions at antenna terminals****n2 , Normal**

Mode	Value (dBm)	Limit (dBm)	Result
n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.92	-13	Pass
n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.1GHz	-31.76	-13	Pass
n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_18GHz	-24.06	-13	Pass
n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB1@24 18GHz_19.1GHz	-31.66	-13	Pass
n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_18GHz	-23.84	-13	Pass
n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB25@0 18GHz_19.1GHz	-31.54	-13	Pass
n2_5MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.9	-13	Pass
n2_5MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.1GHz	-31.4	-13	Pass
n2_5MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_18GHz	-23.68	-13	Pass
n2_5MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@24 18GHz_19.1GHz	-30.16	-13	Pass
n2_5MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_18GHz	-24.1	-13	Pass
n2_5MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB25@0 18GHz_19.1GHz	-31.55	-13	Pass
n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.91	-13	Pass
n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.1GHz	-31.94	-13	Pass
n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_18GHz	-23.95	-13	Pass
n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB1@24 18GHz_19.1GHz	-32.06	-13	Pass
n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_18GHz	-23.29	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB25@0 18GHz_19.1GHz	-31.58	-13	Pass
n2_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.53	-13	Pass
n2_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.1GHz	-31.7	-13	Pass
n2_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_18GHz	-23.97	-13	Pass
n2_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB1@51 18GHz_19.1GHz	-31.66	-13	Pass
n2_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_18GHz	-24.02	-13	Pass
n2_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB50@0 18GHz_19.1GHz	-31.28	-13	Pass
n2_10MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-24.22	-13	Pass
n2_10MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.1GHz	-31.78	-13	Pass
n2_10MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_18GHz	-23.45	-13	Pass
n2_10MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@51 18GHz_19.1GHz	-31.57	-13	Pass
n2_10MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_18GHz	-24.22	-13	Pass
n2_10MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-16.47	-13	Pass
n2_10MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.1GHz	-24.65	-13	Pass
n2_10MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_18GHz	-23.66	-13	Pass
n2_10MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB1@51 18GHz_19.1GHz	-31.8	-13	Pass
n2_10MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_18GHz	-24.03	-13	Pass
n2_10MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB50@0 18GHz_19.1GHz	-32.08	-13	Pass
n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.58	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.1GHz	-31.9	-13	Pass
n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_18GHz	-23.82	-13	Pass
n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB1@78 18GHz_19.1GHz	-31.64	-13	Pass
n2_10MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB50@0 18GHz_19.1GHz	-31.53	-13	Pass
n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_18GHz	-21.83	-13	Pass
n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB75@0 18GHz_19.1GHz	-31.33	-13	Pass
n2_15MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-24.05	-13	Pass
n2_15MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.1GHz	-31.3	-13	Pass
n2_15MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_18GHz	-23.72	-13	Pass
n2_15MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@78 18GHz_19.1GHz	-31.69	-13	Pass
n2_15MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_18GHz	-23.32	-13	Pass
n2_15MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB75@0 18GHz_19.1GHz	-31.76	-13	Pass
n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.03	-13	Pass
n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.1GHz	-31.61	-13	Pass
n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_18GHz	-23.82	-13	Pass
n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM QPSK_RB1@78 18GHz_19.1GHz	-31.44	-13	Pass
n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_18GHz	-23.67	-13	Pass
n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM QPSK_RB75@0 18GHz_19.1GHz	-31.4	-13	Pass
n2_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-24.12	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n2_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.1GHz	-31.46	-13	Pass
n2_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_18GHz	-24.23	-13	Pass
n2_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB1@105 18GHz_19.1GHz	-31.85	-13	Pass
n2_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_18GHz	-23.85	-13	Pass
n2_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB100@0 18GHz_19.1GHz	-31.67	-13	Pass
n2_20MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.84	-13	Pass
n2_20MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.1GHz	-30.62	-13	Pass
n2_20MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_18GHz	-24	-13	Pass
n2_20MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@105 18GHz_19.1GHz	-31.94	-13	Pass
n2_20MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_18GHz	-23.84	-13	Pass
n2_20MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB100@0 18GHz_19.1GHz	-30.55	-13	Pass
n2_20MHz_15kHz_1900MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.45	-13	Pass
n2_20MHz_15kHz_1900MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.1GHz	-31.78	-13	Pass
n2_20MHz_15kHz_1900MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_18GHz	-24.12	-13	Pass
n2_20MHz_15kHz_1900MHz_DFT-s-OFDM QPSK_RB1@105 18GHz_19.1GHz	-31.84	-13	Pass
n2_20MHz_15kHz_1900MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_18GHz	-24.31	-13	Pass
n2_20MHz_15kHz_1900MHz_DFT-s-OFDM QPSK_RB100@0 18GHz_19.1GHz	-31.84	-13	Pass

n25 , Normal

Mode	Value (dBm)	Limit (dBm)	Result
------	-------------	-------------	--------

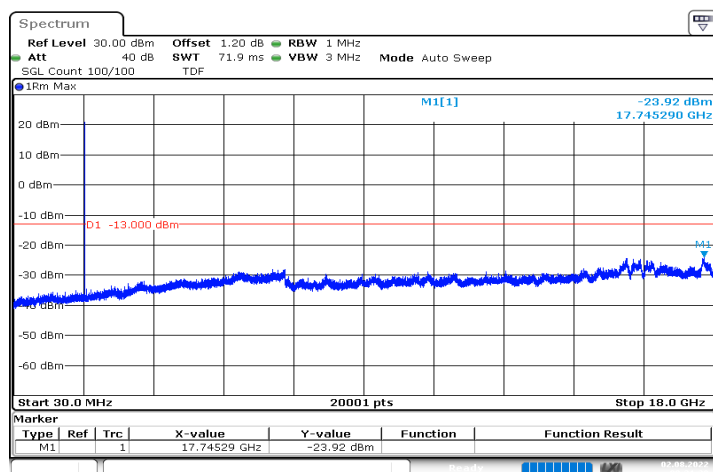
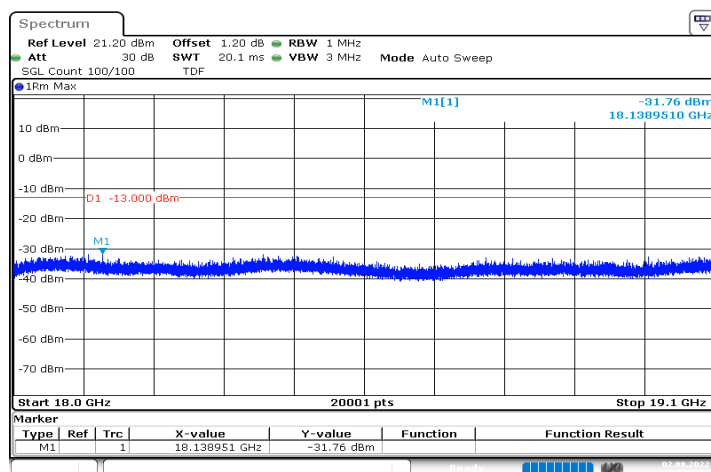
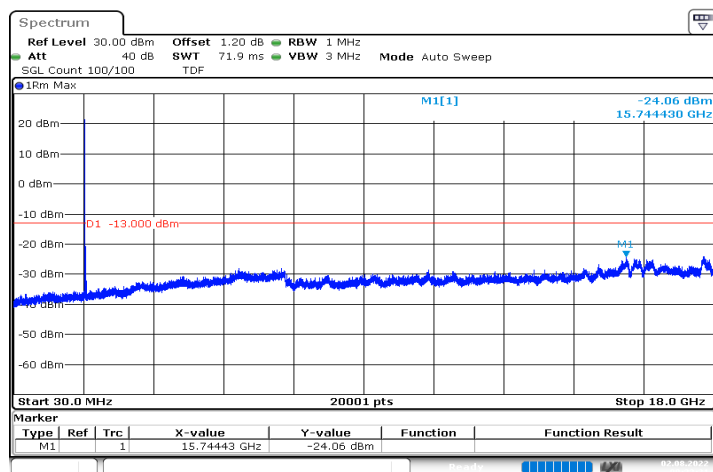
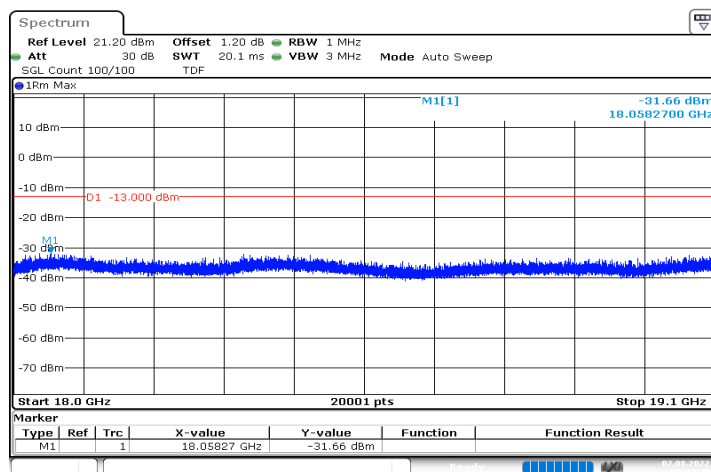
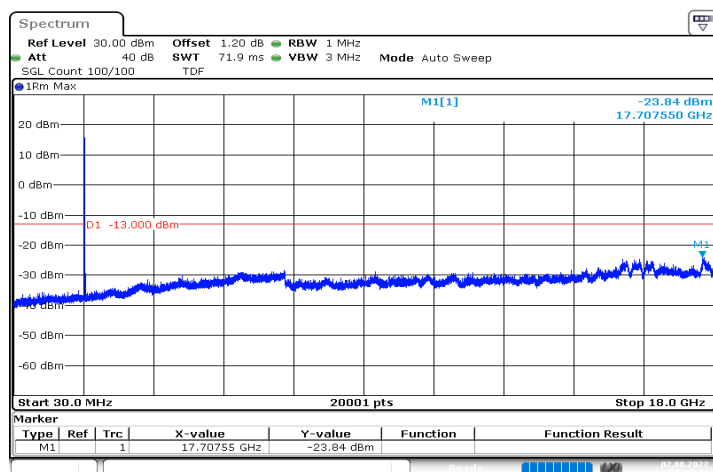
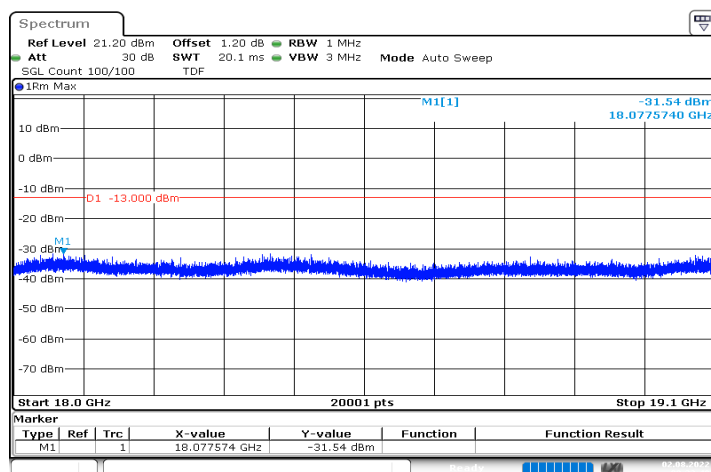
Mode	Value (dBm)	Limit (dBm)	Result
n25_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_18GHz	-23.6	-13	Pass
n25_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB1@24 18GHz_19.15GHz	-31.99	-13	Pass
n25_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_18GHz	-23.04	-13	Pass
n25_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB25@0 18GHz_19.15GHz	-31.52	-13	Pass
n25_5MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-24.26	-13	Pass
n25_5MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.15GHz	-31.65	-13	Pass
n25_5MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_18GHz	-23.02	-13	Pass
n25_5MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@24 18GHz_19.15GHz	-31.62	-13	Pass
n25_5MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_18GHz	-24	-13	Pass
n25_5MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB25@0 18GHz_19.15GHz	-31.39	-13	Pass
n25_5MHz_15kHz_1912.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_18GHz	-24.28	-13	Pass
n25_5MHz_15kHz_1912.5MHz_DFT-s-OFDM QPSK_RB1@24 18GHz_19.15GHz	-31.71	-13	Pass
n25_5MHz_15kHz_1912.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_18GHz	-23.95	-13	Pass
n25_5MHz_15kHz_1912.5MHz_DFT-s-OFDM QPSK_RB25@0 18GHz_19.15GHz	-31.4	-13	Pass
n25_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_18GHz	-23.47	-13	Pass
n25_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB50@0 18GHz_19.15GHz	-31.58	-13	Pass
n25_10MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.72	-13	Pass
n25_10MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.15GHz	-31.74	-13	Pass
n25_10MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_18GHz	-23.93	-13	Pass

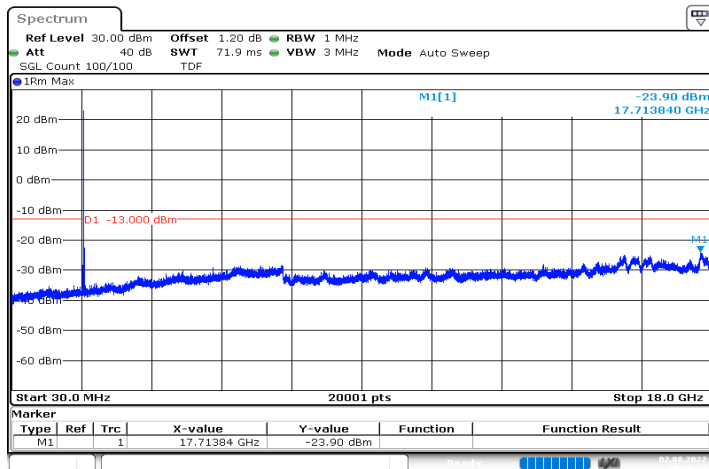
Mode	Value (dBm)	Limit (dBm)	Result
n25_10MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@51 18GHz_19.15GHz	-32.39	-13	Pass
n25_10MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_18GHz	-23.64	-13	Pass
n25_10MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB50@0 18GHz_19.15GHz	-31.19	-13	Pass
n25_10MHz_15kHz_1910MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_18GHz	-23.96	-13	Pass
n25_10MHz_15kHz_1910MHz_DFT-s-OFDM QPSK_RB1@51 18GHz_19.15GHz	-31.7	-13	Pass
n25_10MHz_15kHz_1910MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_18GHz	-24.17	-13	Pass
n25_10MHz_15kHz_1910MHz_DFT-s-OFDM QPSK_RB50@0 18GHz_19.15GHz	-31.72	-13	Pass
n25_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_18GHz	-23.59	-13	Pass
n25_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB1@78 18GHz_19.15GHz	-31.8	-13	Pass
n25_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_18GHz	-23.88	-13	Pass
n25_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB75@0 18GHz_19.15GHz	-31.46	-13	Pass
n25_15MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.69	-13	Pass
n25_15MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.15GHz	-31.09	-13	Pass
n25_15MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_18GHz	-24.27	-13	Pass
n25_15MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@78 18GHz_19.15GHz	-31.23	-13	Pass
n25_15MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_18GHz	-23.44	-13	Pass
n25_15MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB75@0 18GHz_19.15GHz	-32.03	-13	Pass
n25_15MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_18GHz	-23.15	-13	Pass
n25_15MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB1@78 18GHz_19.15GHz	-30.94	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n25_15MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_18GHz	-24.31	-13	Pass
n25_15MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB75@0 18GHz_19.15GHz	-31.48	-13	Pass
n25_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-22.97	-13	Pass
n25_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.15GHz	-31.78	-13	Pass
n25_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_18GHz	-24.21	-13	Pass
n25_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB1@105 18GHz_19.15GHz	-31.65	-13	Pass
n25_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_18GHz	-24.17	-13	Pass
n25_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB100@0 18GHz_19.15GHz	-31.26	-13	Pass
n25_20MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.21	-13	Pass
n25_20MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.15GHz	-32.09	-13	Pass
n25_20MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_18GHz	-23.16	-13	Pass
n25_20MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB1@105 18GHz_19.15GHz	-31.11	-13	Pass
n25_20MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_18GHz	-22.74	-13	Pass
n25_20MHz_15kHz_1882.5MHz_DFT-s-OFDM QPSK_RB100@0 18GHz_19.15GHz	-31.72	-13	Pass
n25_20MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_18GHz	-24.04	-13	Pass
n25_20MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB1@105 18GHz_19.15GHz	-32.06	-13	Pass
n25_20MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_18GHz	-23.4	-13	Pass
n25_20MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB100@0 18GHz_19.15GHz	-31.2	-13	Pass
n25_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-24.03	-13	Pass

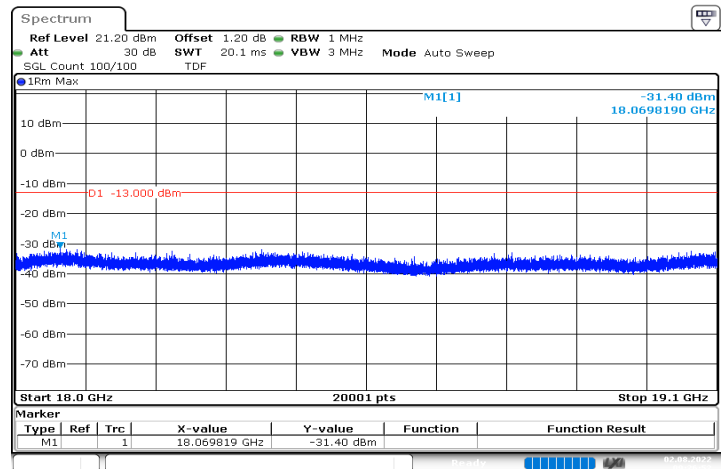
Mode	Value (dBm)	Limit (dBm)	Result
n25_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.15GHz	-31.59	-13	Pass
n25_5MHz_15kHz_1912.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.35	-13	Pass
n25_5MHz_15kHz_1912.5MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.15GHz	-31.59	-13	Pass
n25_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.61	-13	Pass
n25_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.15GHz	-32.11	-13	Pass
n25_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_18GHz	-23.16	-13	Pass
n25_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB1@51 18GHz_19.15GHz	-32.19	-13	Pass
n25_10MHz_15kHz_1910MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-24.01	-13	Pass
n25_10MHz_15kHz_1910MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.15GHz	-31.5	-13	Pass
n25_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.6	-13	Pass
n25_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.15GHz	-31.9	-13	Pass
n25_15MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.27	-13	Pass
n25_15MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.15GHz	-31.66	-13	Pass
n25_20MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_18GHz	-23.9	-13	Pass
n25_20MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB1@0 18GHz_19.15GHz	-30.45	-13	Pass

n2 , Normal

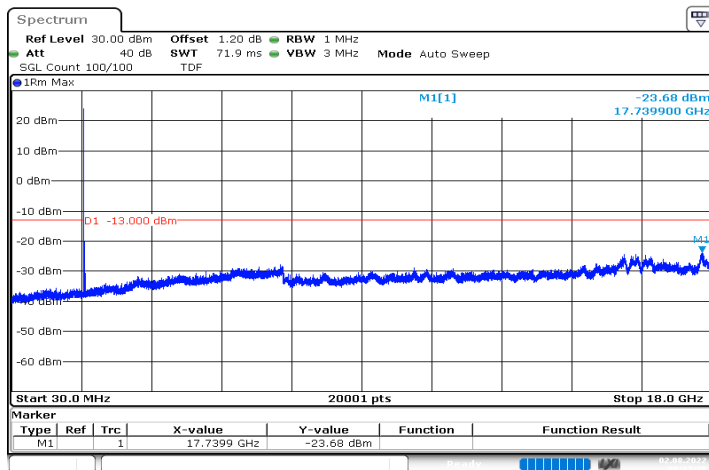
n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHzn2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.1GHzn2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_18GHzn2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB1@24|18GHz_19.1GHzn2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_18GHzn2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB25@0|18GHz_19.1GHz

n2_5MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

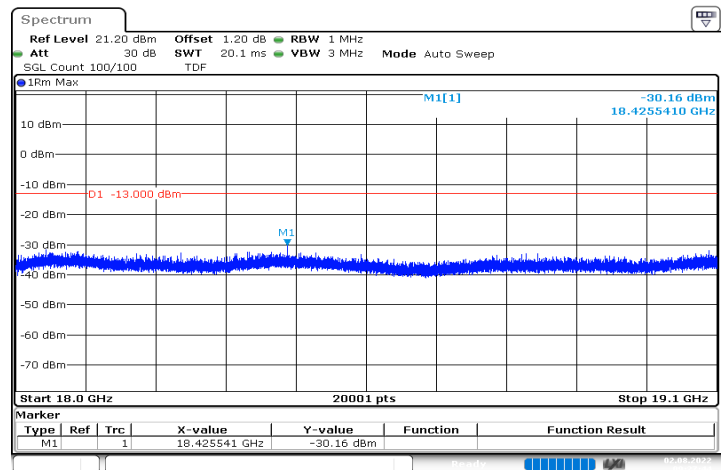
Date: 2.AUG.2022 09:26:37

n2_5MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.1GHz

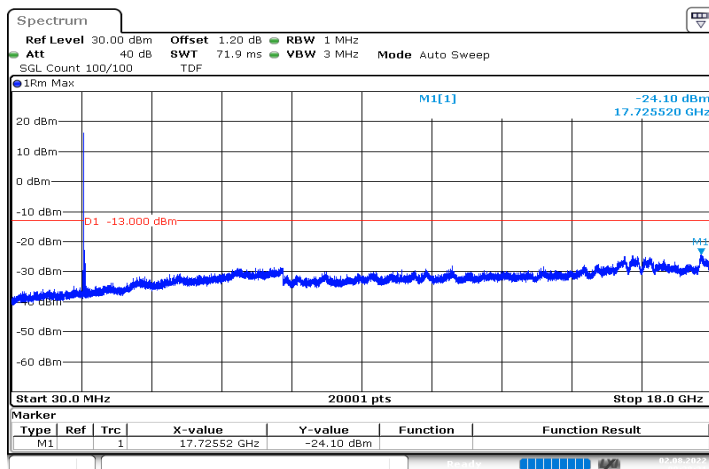
Date: 2.AUG.2022 09:26:52

n2_5MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_18GHz

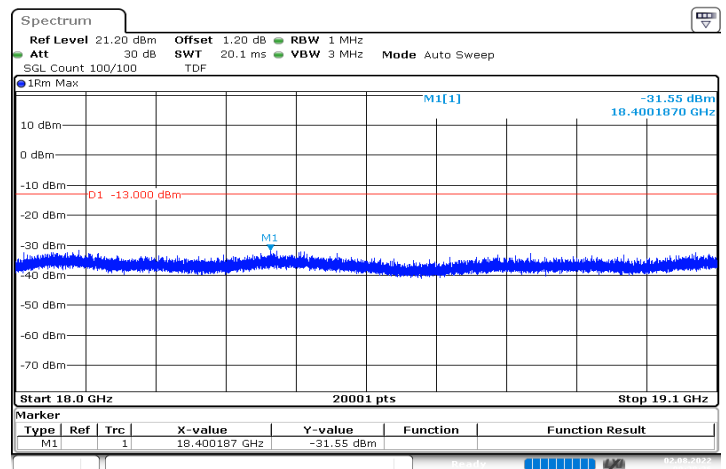
Date: 2.AUG.2022 09:27:29

n2_5MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@24|18GHz_19.1GHz

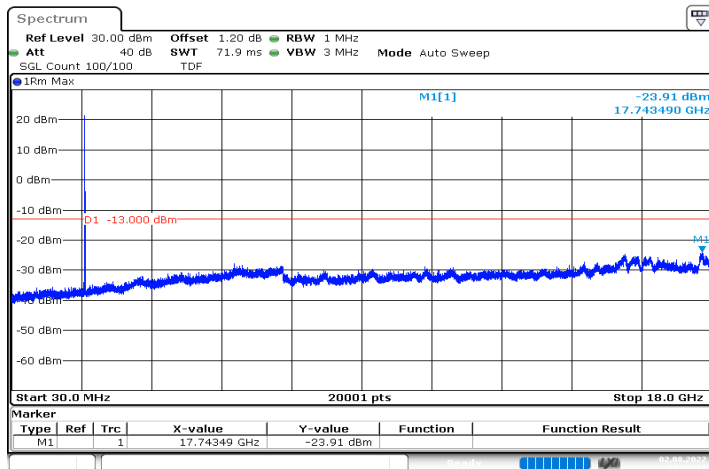
Date: 2.AUG.2022 09:27:44

n2_5MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_18GHz

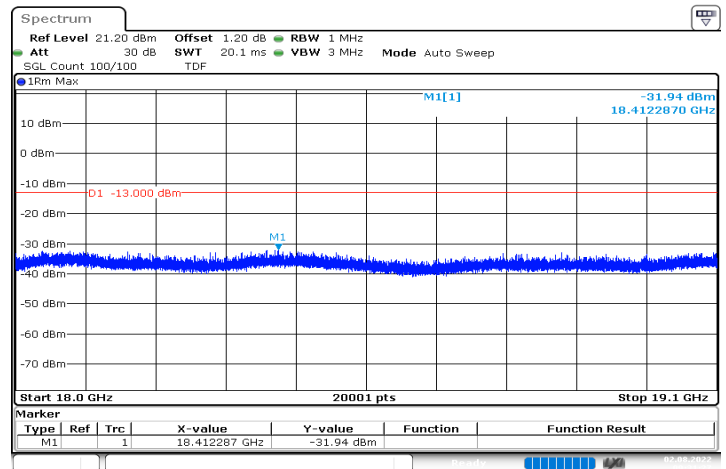
Date: 2.AUG.2022 09:28:21

n2_5MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB25@0|18GHz_19.1GHz

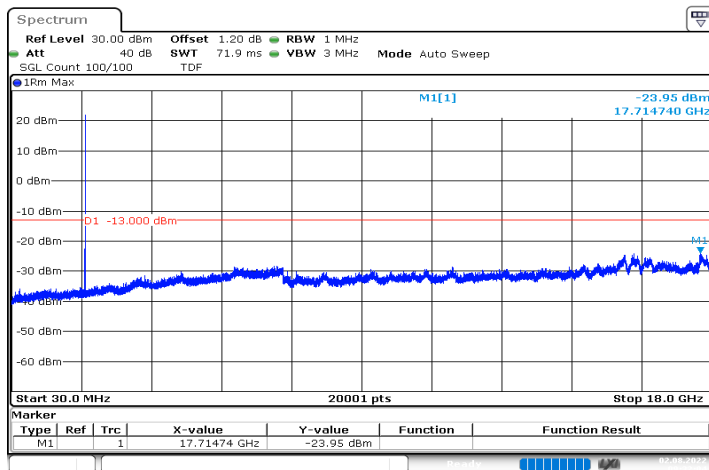
Date: 2.AUG.2022 09:28:36

n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

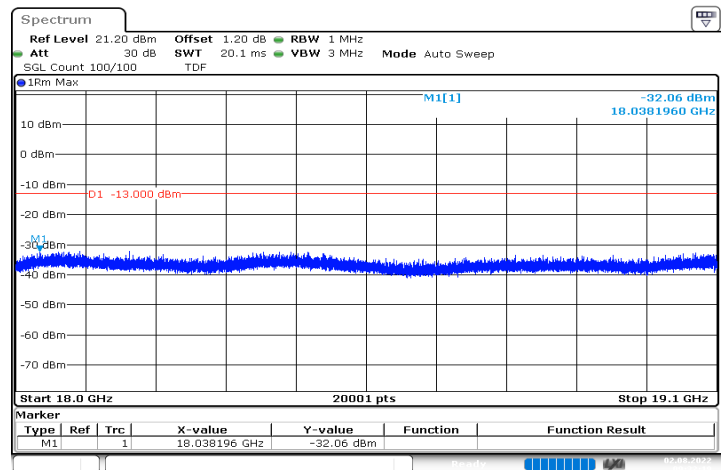
Date: 2.AUG.2022 09:31:12

n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.1GHz

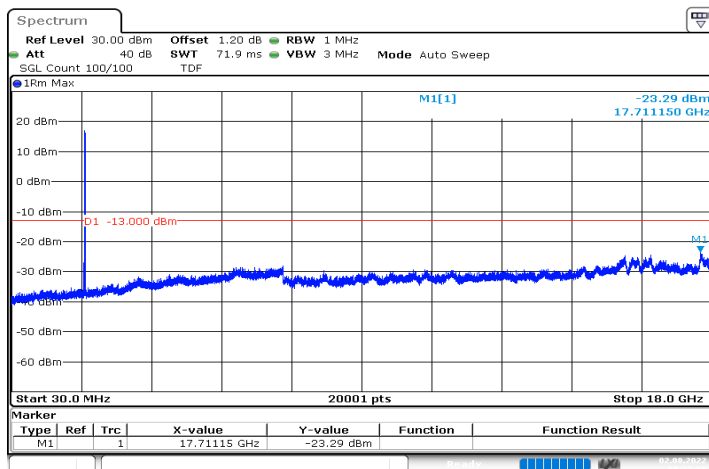
Date: 2.AUG.2022 09:31:27

n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_18GHz

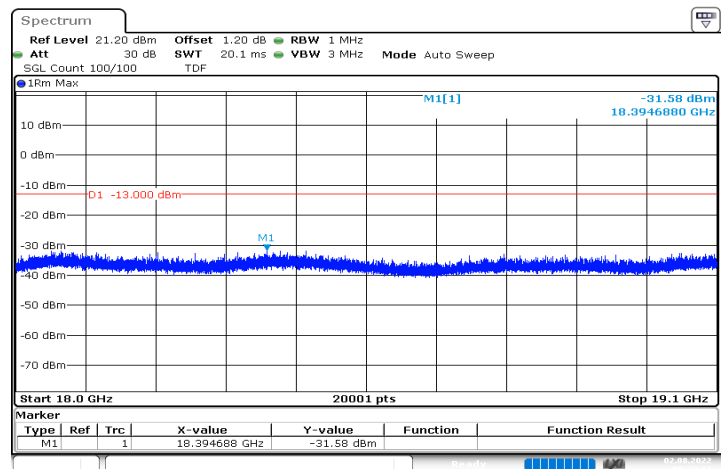
Date: 2.AUG.2022 09:32:04

n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB1@24|18GHz_19.1GHz

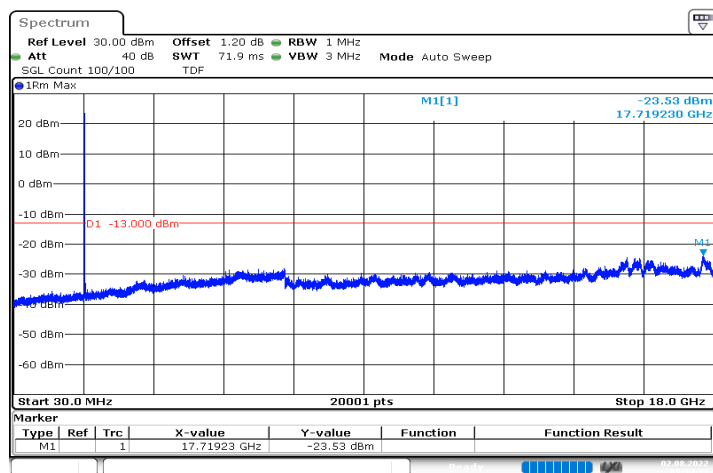
Date: 2.AUG.2022 09:32:19

n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_18GHz

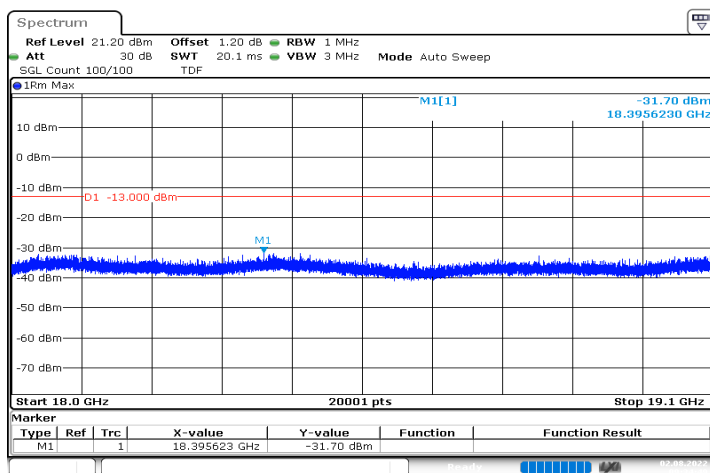
Date: 2.AUG.2022 09:32:56

n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB25@0|18GHz_19.1GHz

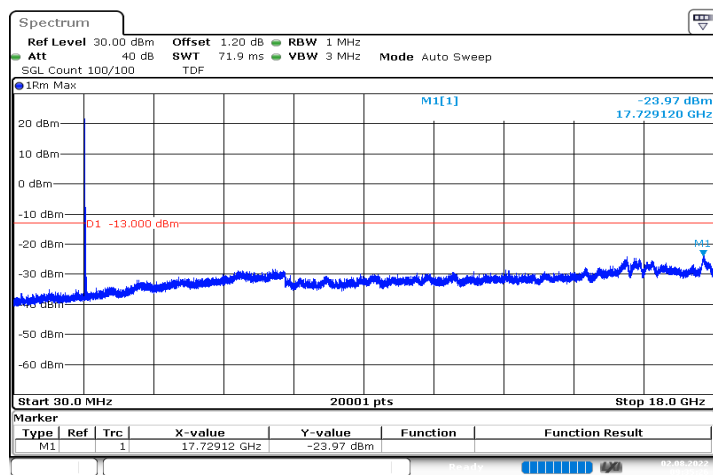
Date: 2.AUG.2022 09:33:11

n2_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

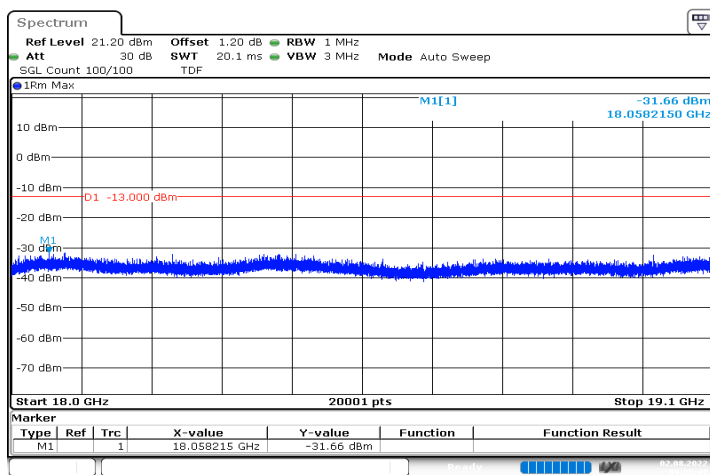
Date: 2.AUG.2022 09:34:33

n2_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.1GHz

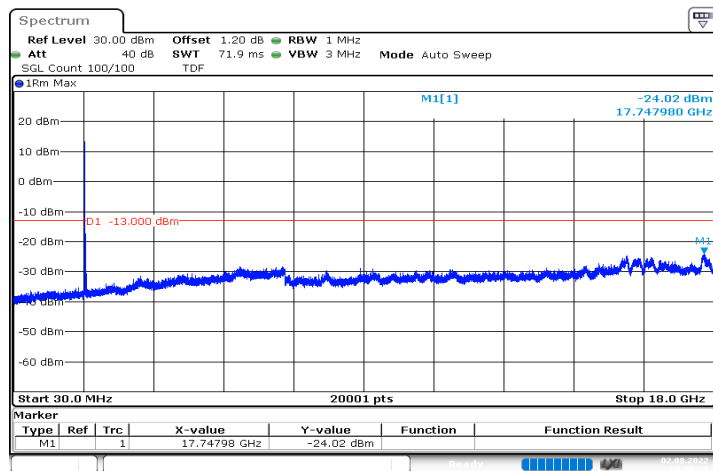
Date: 2.AUG.2022 09:34:49

n2_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_18GHz

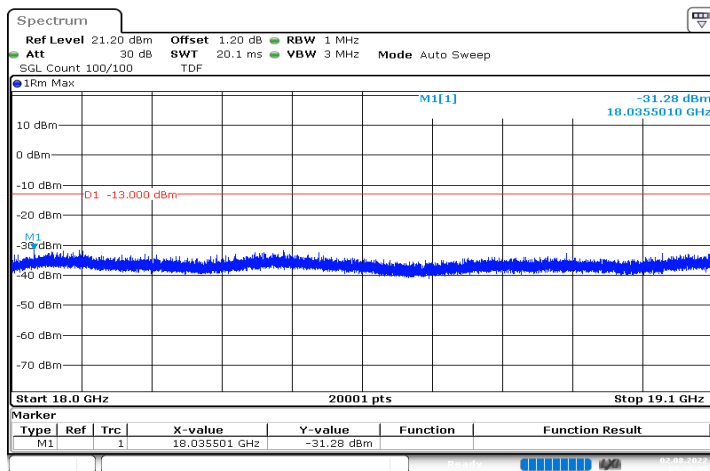
Date: 2.AUG.2022 09:35:26

n2_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB1@51|18GHz_19.1GHz

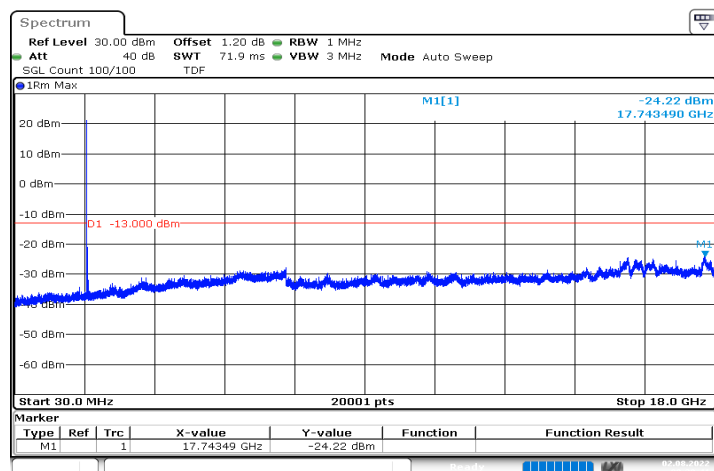
Date: 2.AUG.2022 09:35:41

n2_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_18GHz

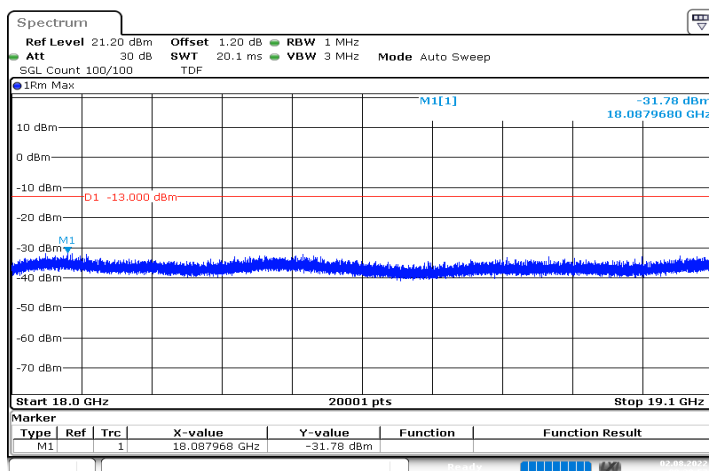
Date: 2.AUG.2022 09:36:19

n2_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB50@0|18GHz_19.1GHz

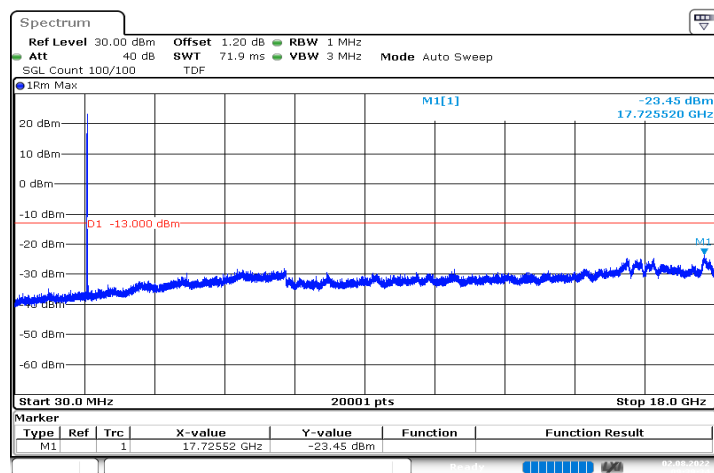
Date: 2.AUG.2022 09:36:35

n2_10MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

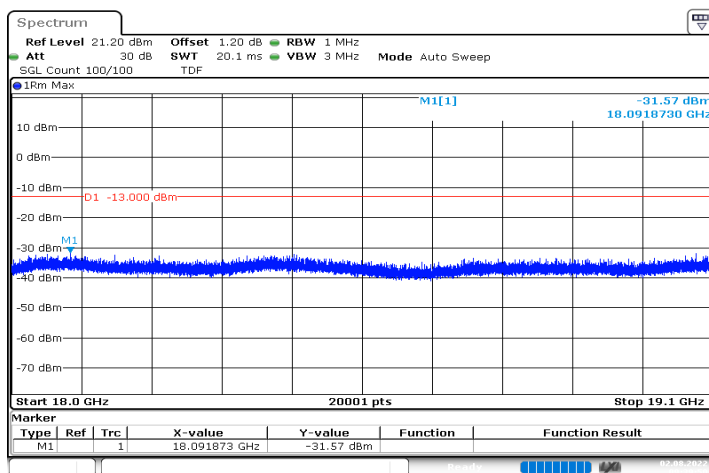
Date: 2.AUG.2022 09:38:41

n2_10MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.1GHz

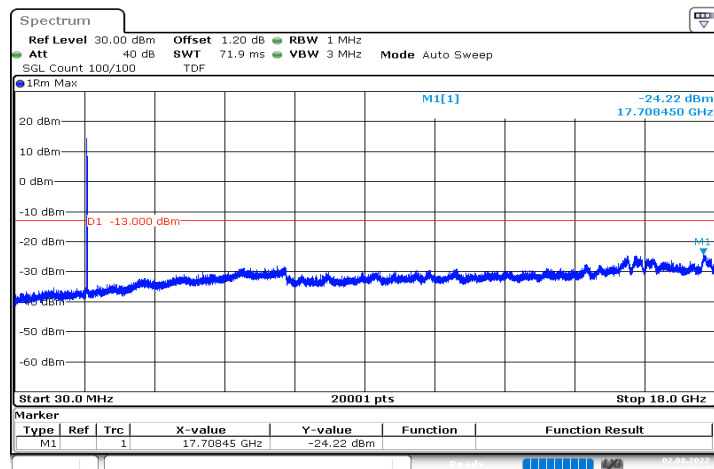
Date: 2.AUG.2022 09:38:57

n2_10MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_18GHz

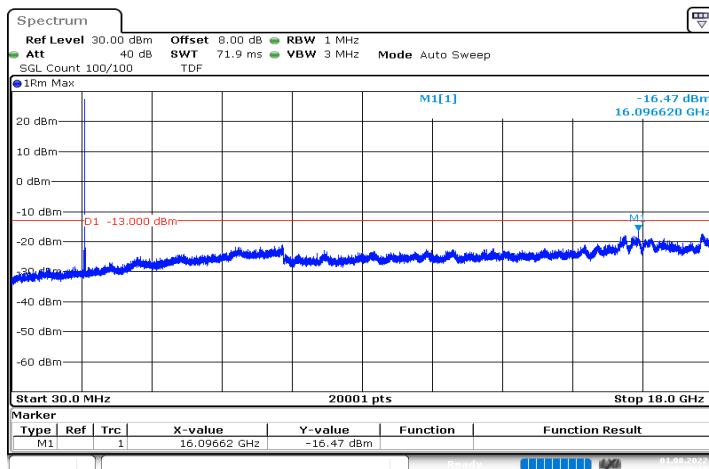
Date: 2.AUG.2022 09:39:34

n2_10MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@51|18GHz_19.1GHz

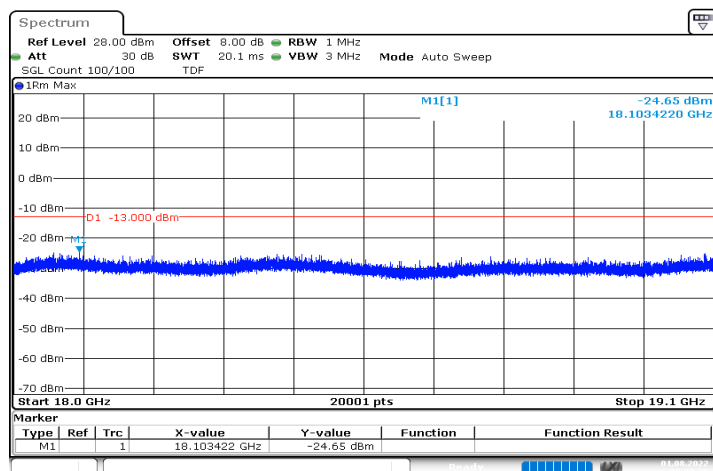
Date: 2.AUG.2022 09:39:50

n2_10MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_18GHz

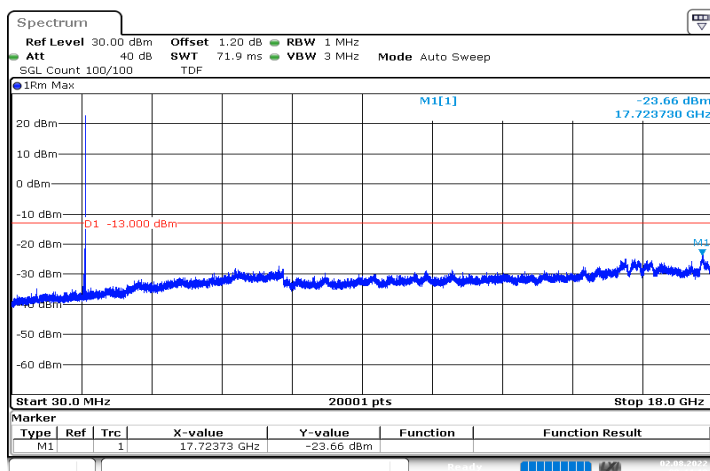
Date: 2.AUG.2022 09:40:27

n2_10MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

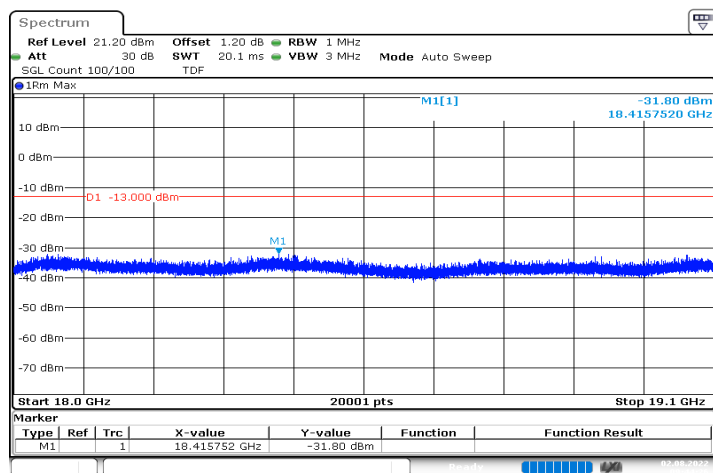
Date: 1.AUG.2022 20:29:10

n2_10MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.1GHz

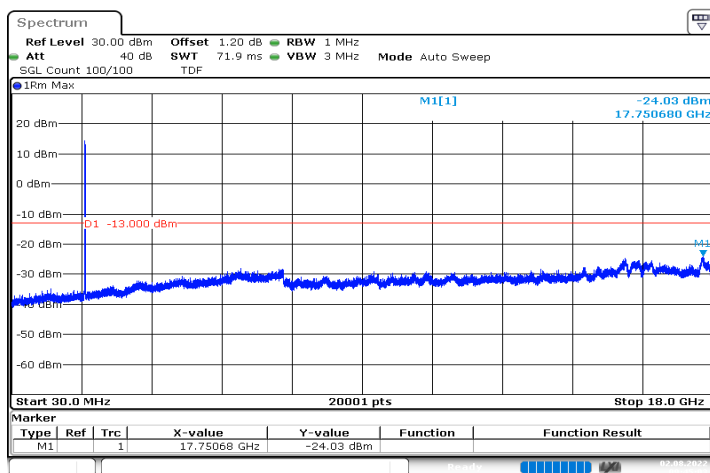
Date: 1.AUG.2022 20:29:26

n2_10MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_18GHz

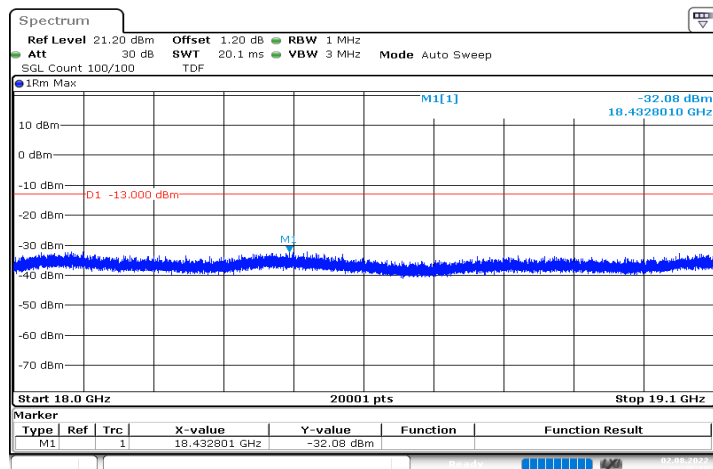
Date: 2.AUG.2022 09:44:10

n2_10MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB1@51|18GHz_19.1GHz

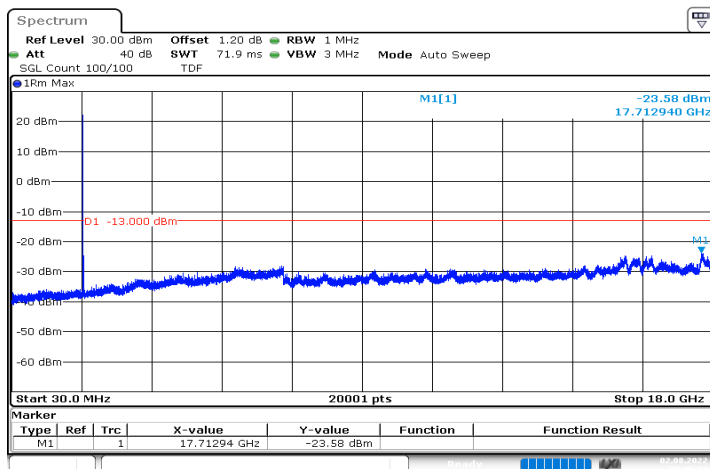
Date: 2.AUG.2022 09:44:26

n2_10MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_18GHz

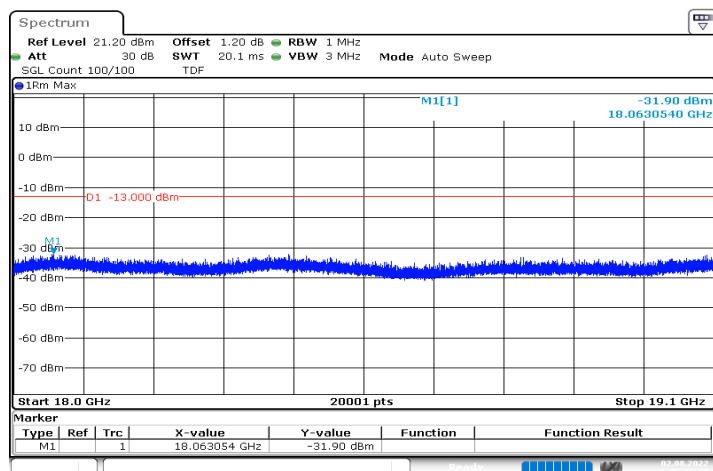
Date: 2.AUG.2022 09:45:03

n2_10MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB50@0|18GHz_19.1GHz

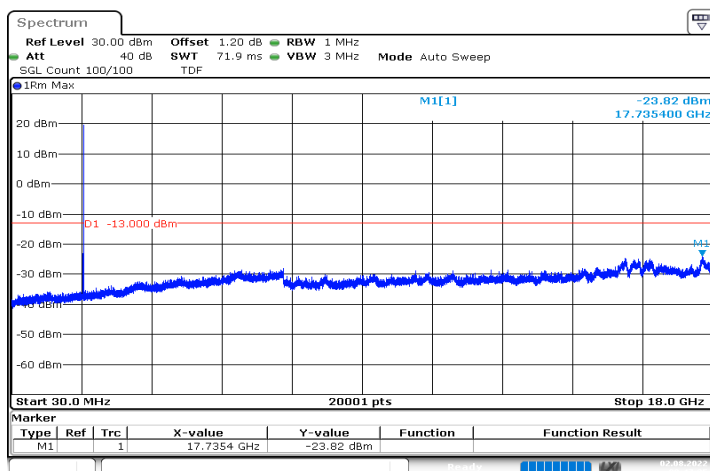
Date: 2.AUG.2022 09:45:19

n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

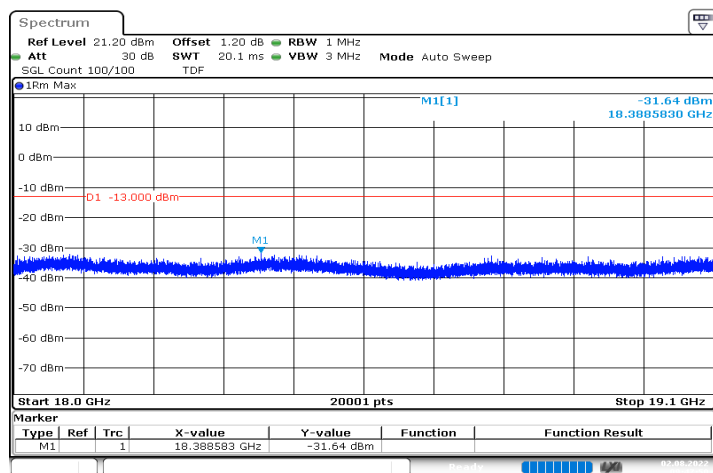
Date: 2.AUG.2022 09:46:42

n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.1GHz

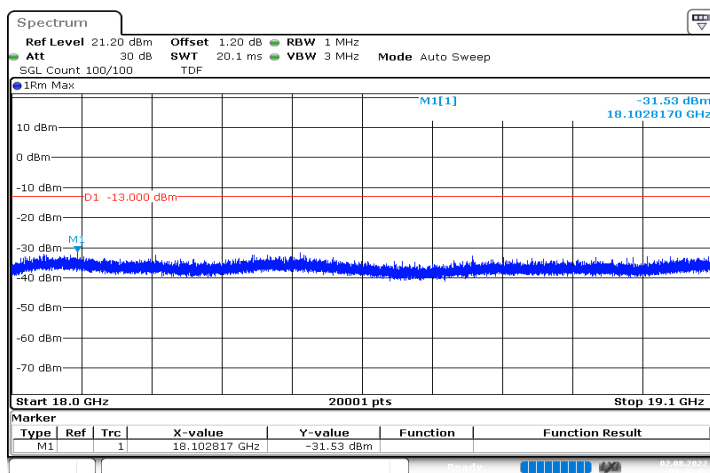
Date: 2.AUG.2022 09:46:57

n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_18GHz

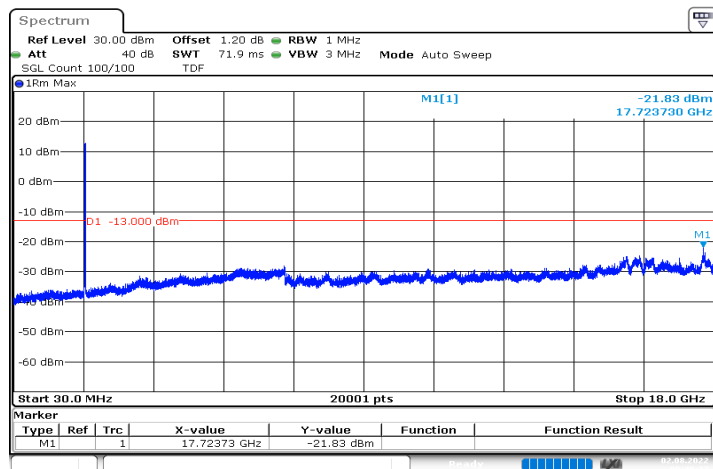
Date: 2.AUG.2022 09:47:35

n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB1@78|18GHz_19.1GHz

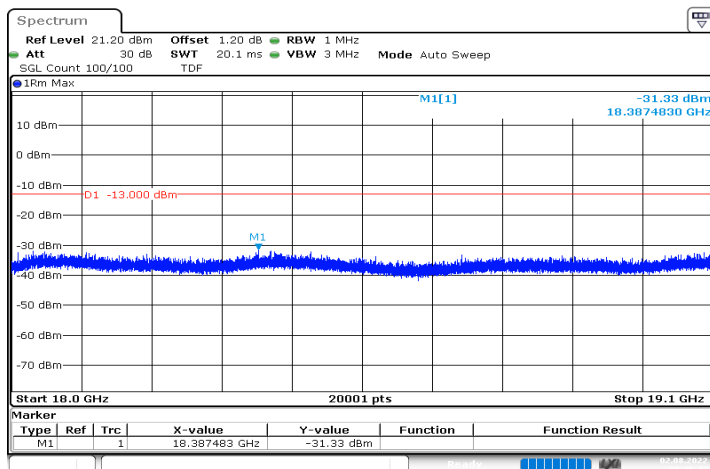
Date: 2.AUG.2022 09:47:50

n2_10MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB50@0|18GHz_19.1GHz

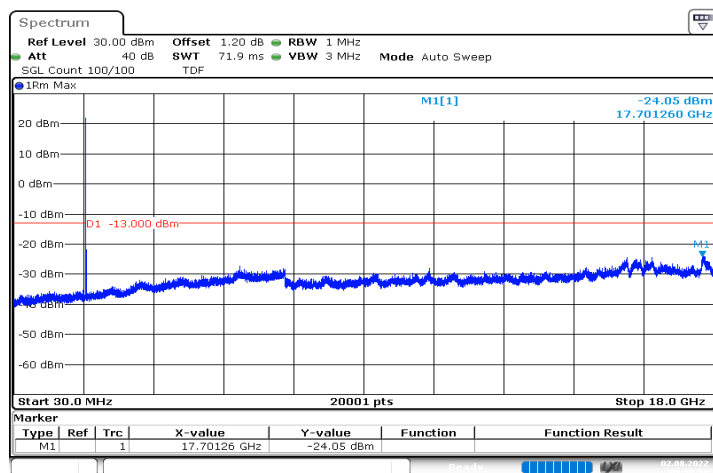
Date: 2.AUG.2022 09:40:43

n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_18GHz

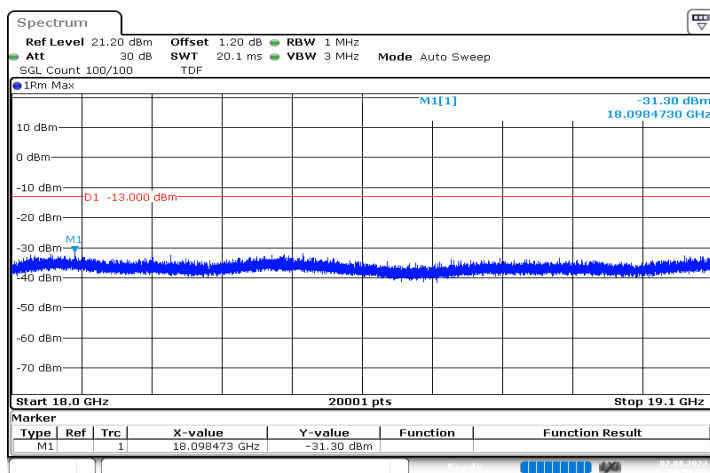
Date: 2.AUG.2022 09:48:27

n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB75@0|18GHz_19.1GHz

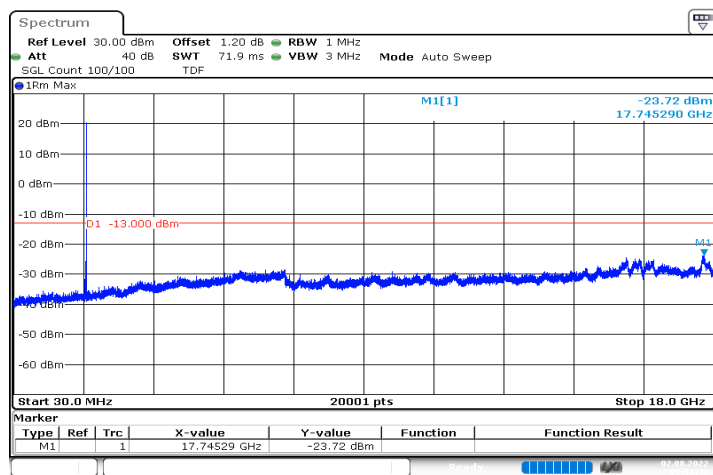
Date: 2.AUG.2022 09:48:42

n2_15MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

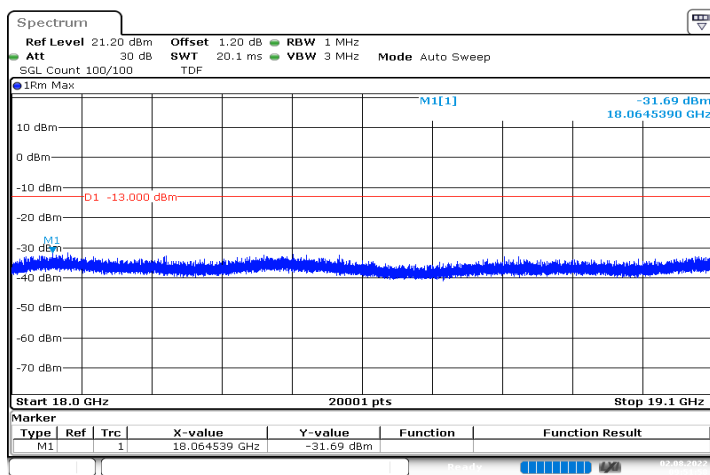
Date: 2.AUG.2022 09:50:50

n2_15MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.1GHz

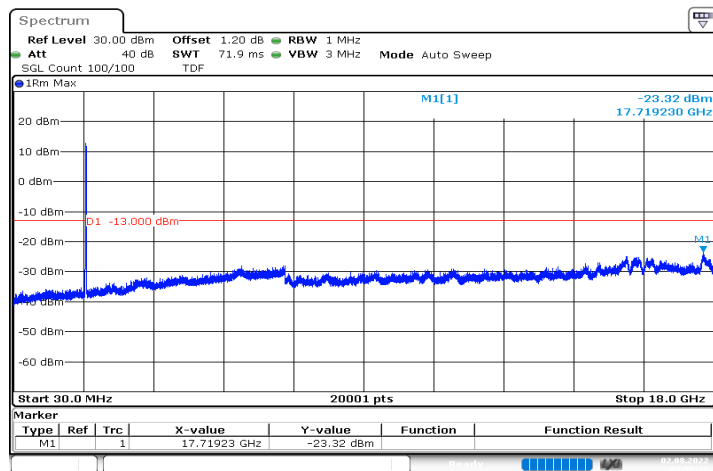
Date: 2.AUG.2022 09:51:06

n2_15MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_18GHz

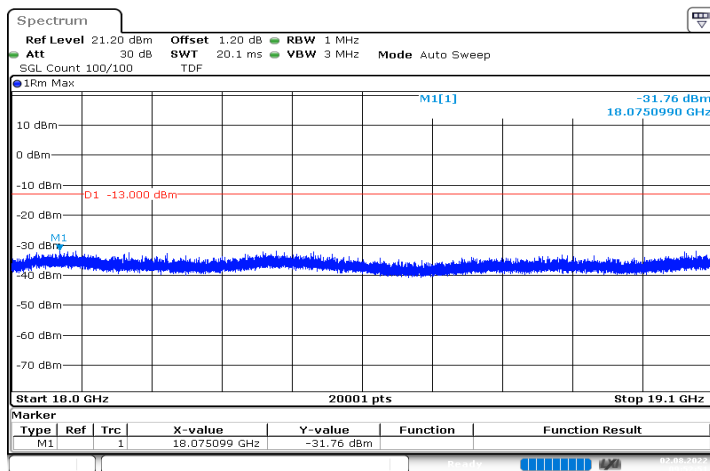
Date: 2.AUG.2022 09:51:42

n2_15MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@78|18GHz_19.1GHz

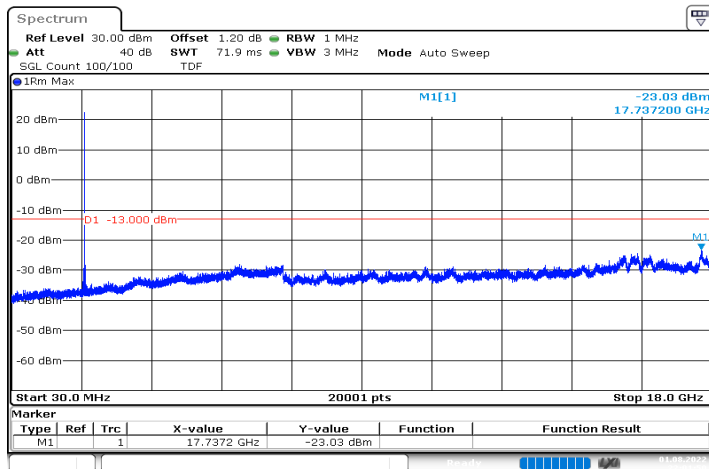
Date: 2.AUG.2022 09:51:58

n2_15MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_18GHz

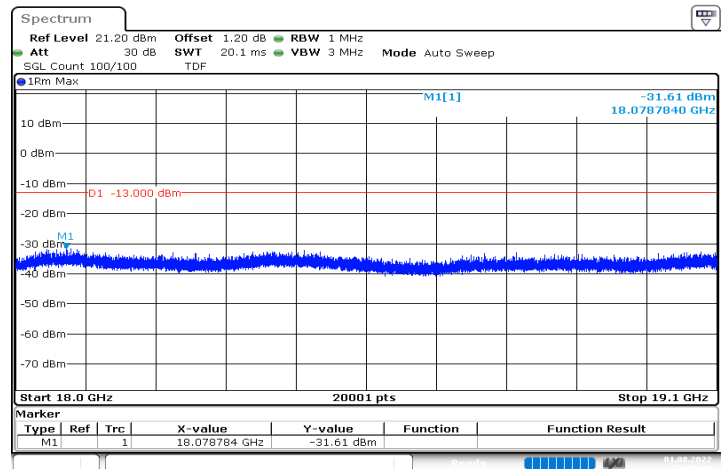
Date: 2.AUG.2022 09:52:35

n2_15MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB75@0|18GHz_19.1GHz

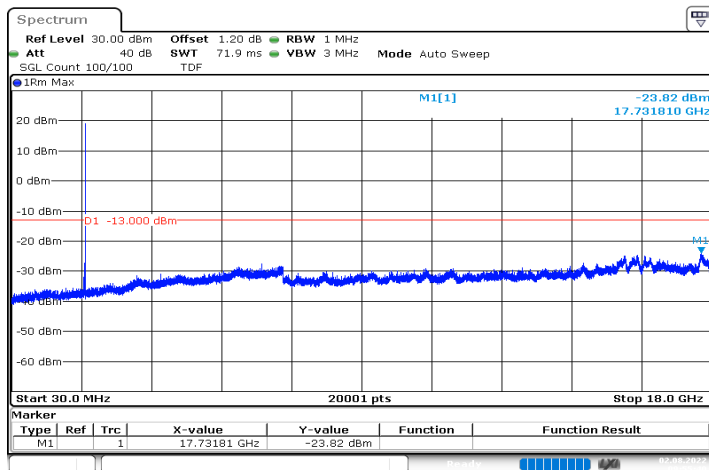
Date: 2.AUG.2022 09:52:51

n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

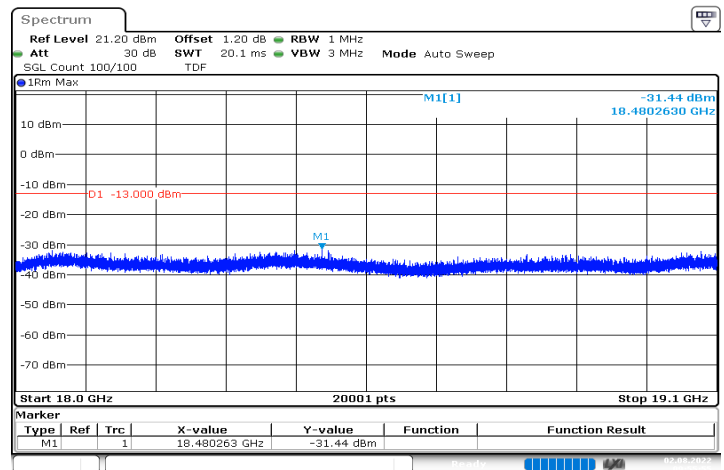
Date: 1.AUG.2022 22:01:50

n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.1GHz

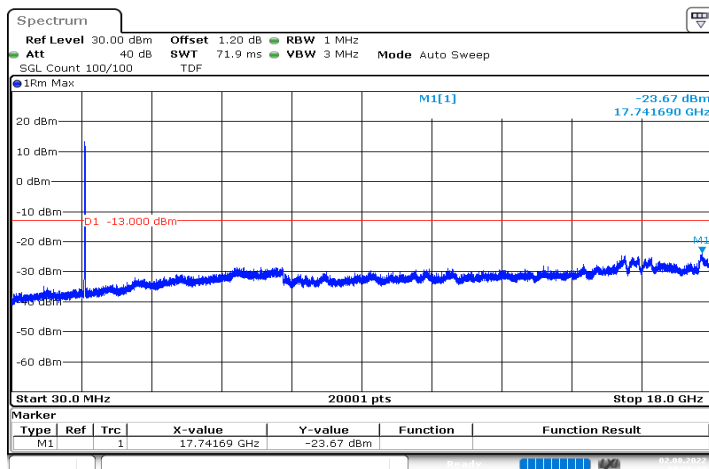
Date: 1.AUG.2022 22:02:03

n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_18GHz

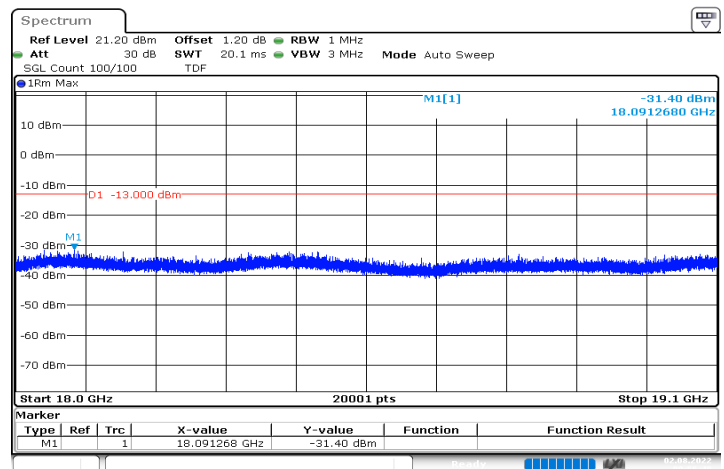
Date: 2.AUG.2022 09:55:40

n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM
QPSK_RB1@78|18GHz_19.1GHz

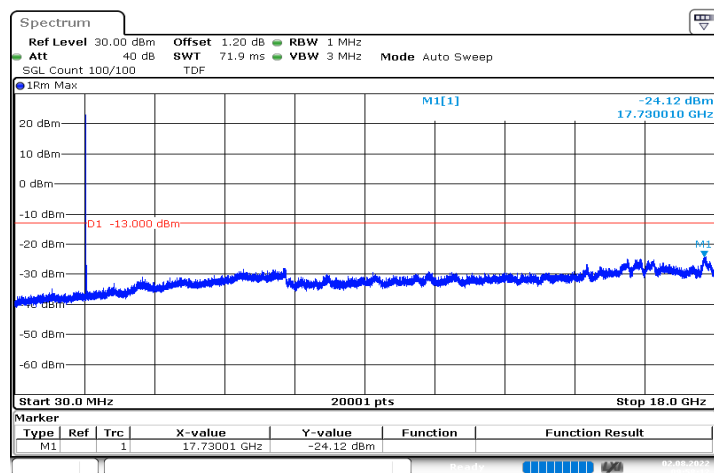
Date: 2.AUG.2022 09:55:55

n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_18GHz

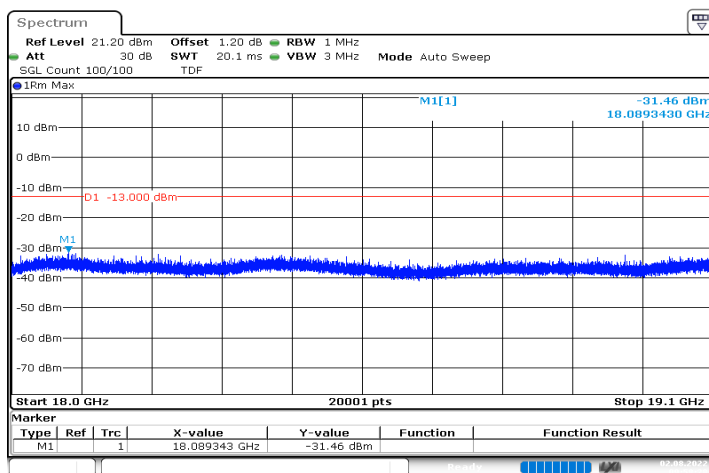
Date: 2.AUG.2022 09:56:33

n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM
QPSK_RB75@0|18GHz_19.1GHz

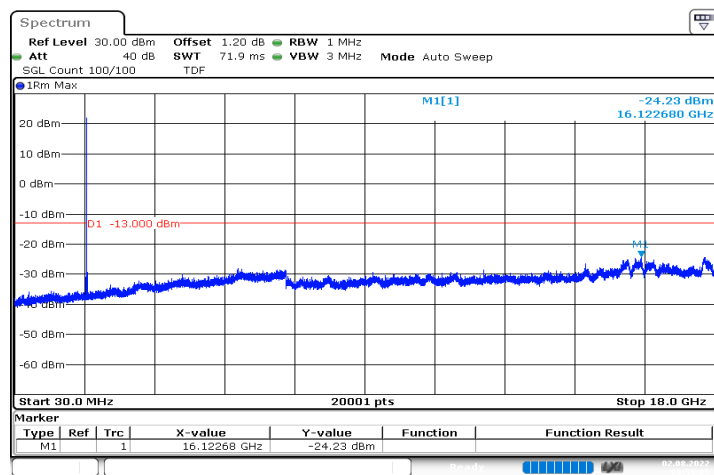
Date: 2.AUG.2022 09:56:48

n2_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

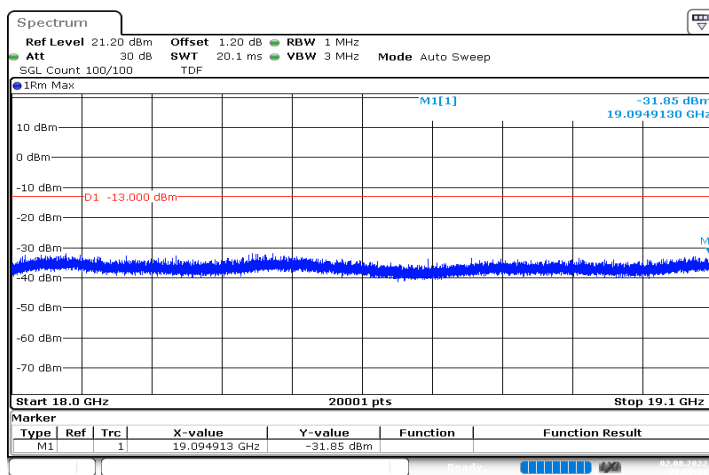
Date: 2.AUG.2022 09:58:12

n2_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.1GHz

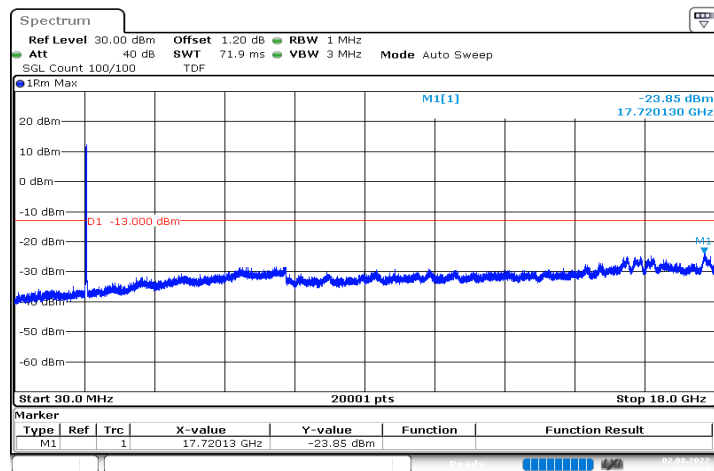
Date: 2.AUG.2022 09:58:28

n2_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_18GHz

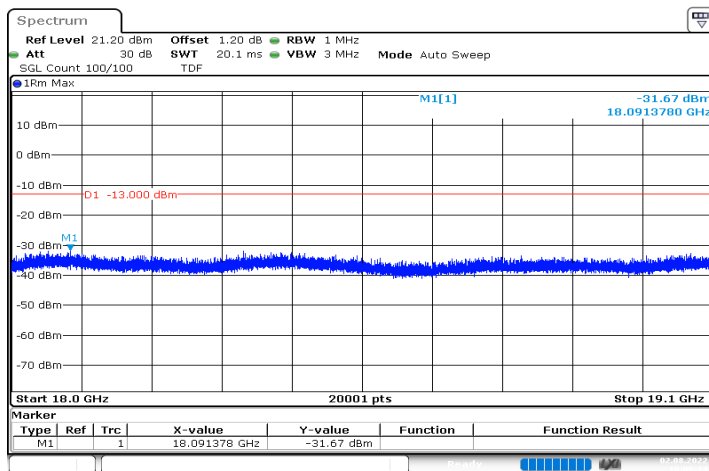
Date: 2.AUG.2022 09:59:05

n2_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB1@105|18GHz_19.1GHz

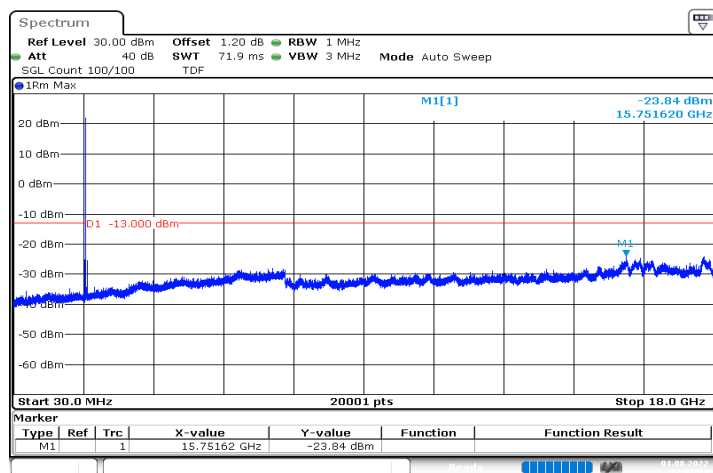
Date: 2.AUG.2022 09:59:21

n2_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_18GHz

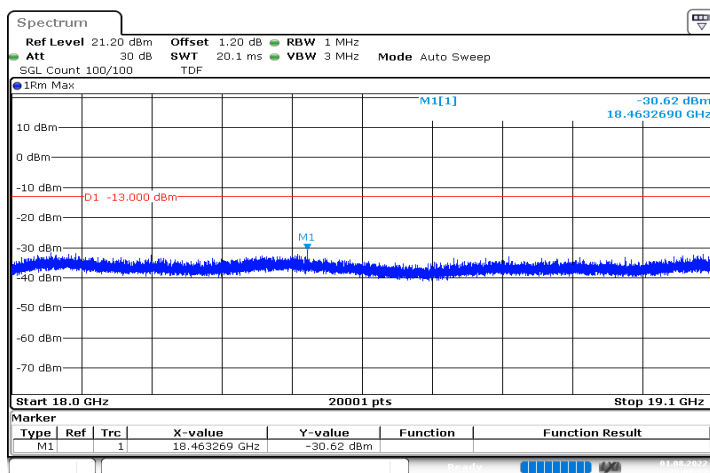
Date: 2.AUG.2022 09:59:58

n2_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB100@0|18GHz_19.1GHz

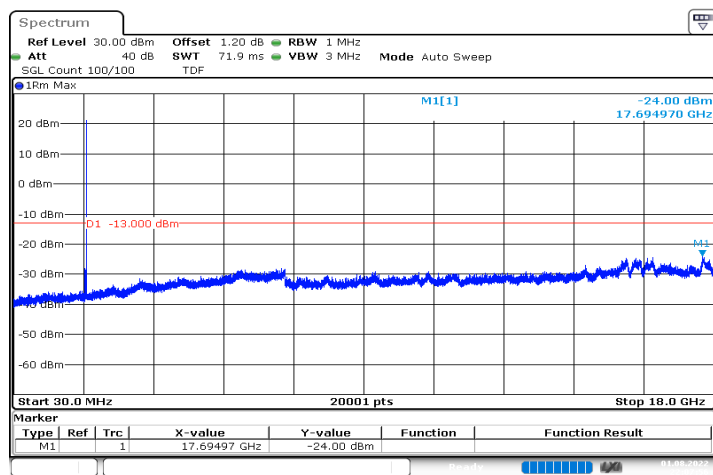
Date: 2.AUG.2022 10:00:14

n2_20MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

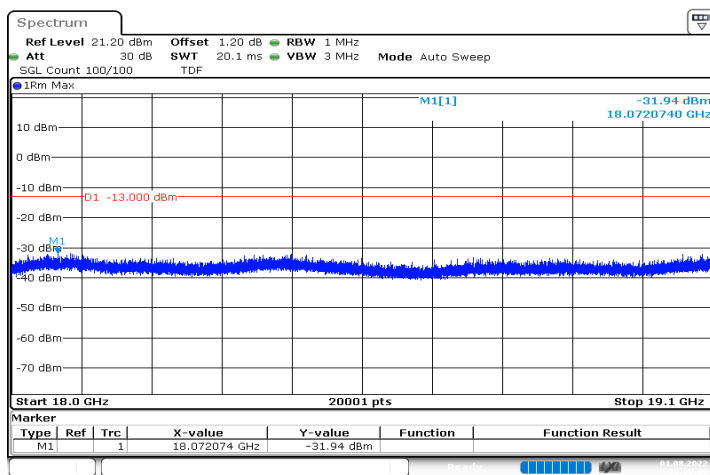
Date: 1.AUG.2022 22:07:09

n2_20MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.1GHz

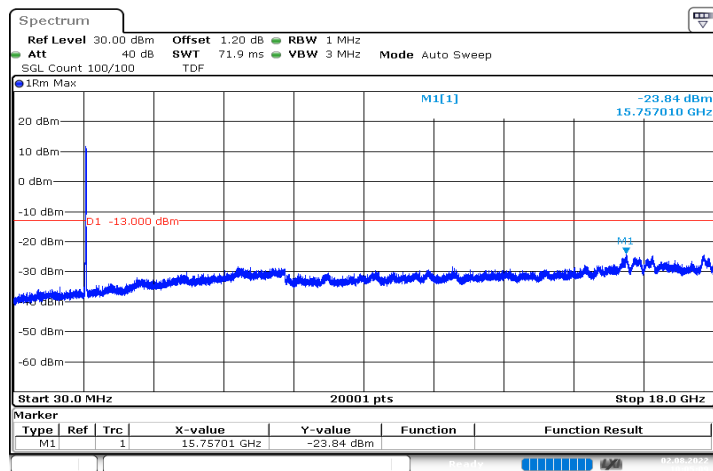
Date: 1.AUG.2022 22:07:22

n2_20MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_18GHz

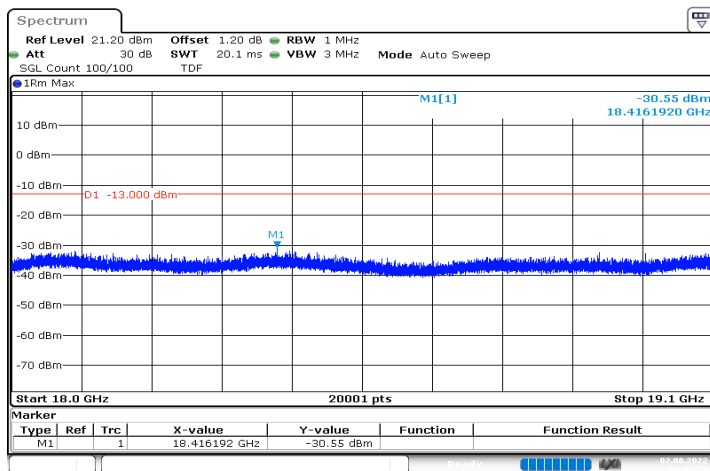
Date: 1.AUG.2022 22:07:56

n2_20MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@105|18GHz_19.1GHz

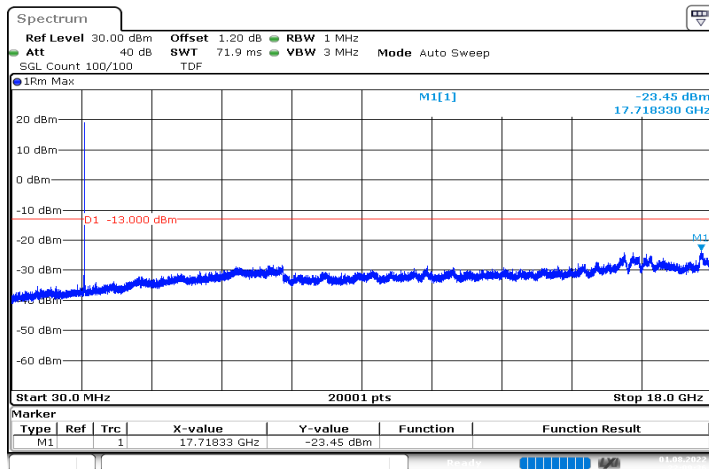
Date: 1.AUG.2022 22:08:09

n2_20MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_18GHz

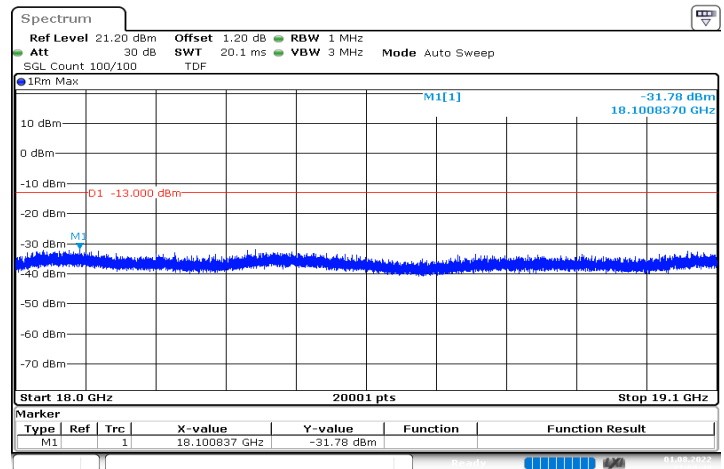
Date: 2.AUG.2022 10:05:09

n2_20MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB100@0|18GHz_19.1GHz

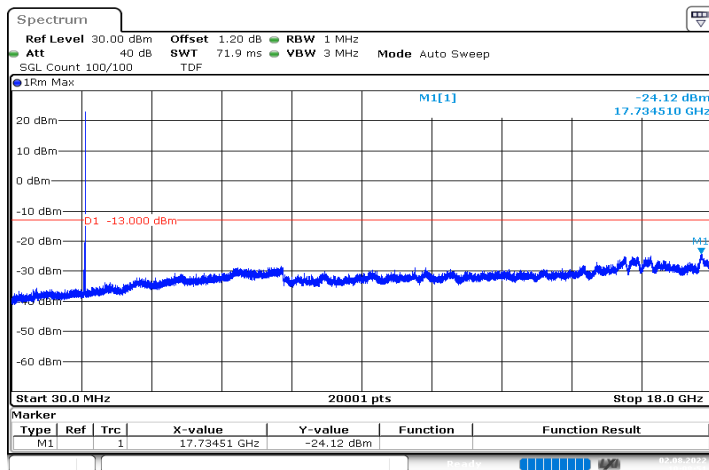
Date: 2.AUG.2022 10:05:25

n2_20MHz_15kHz_1900MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

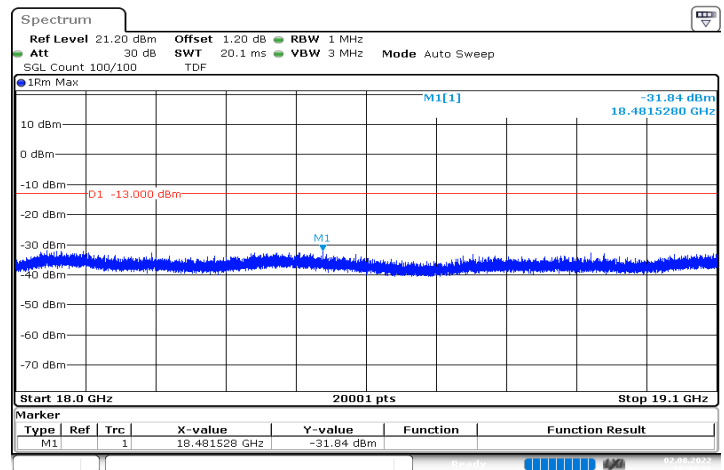
Date: 1.AUG.2022 22:09:36

n2_20MHz_15kHz_1900MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.1GHz

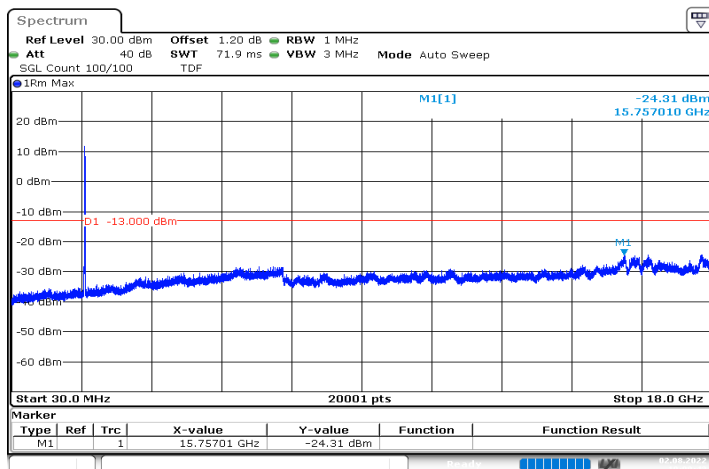
Date: 1.AUG.2022 22:09:49

n2_20MHz_15kHz_1900MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_18GHz

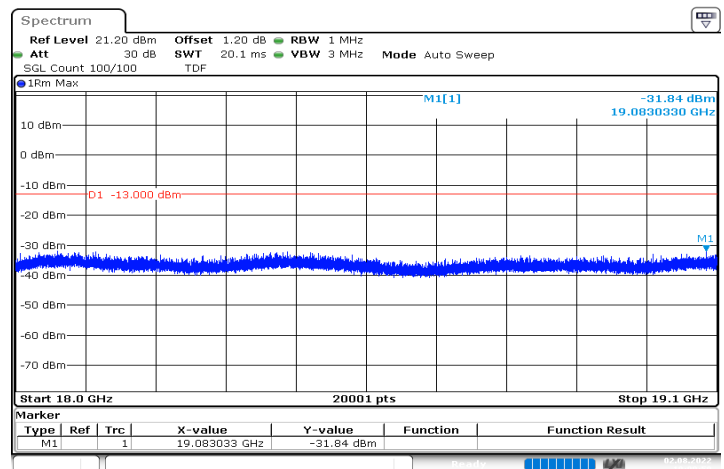
Date: 2.AUG.2022 10:08:51

n2_20MHz_15kHz_1900MHz_DFT-s-OFDM
QPSK_RB1@105|18GHz_19.1GHz

Date: 2.AUG.2022 10:09:06

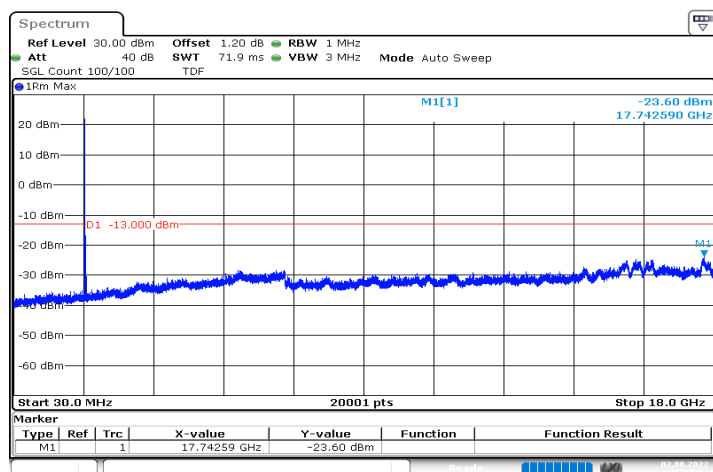
n2_20MHz_15kHz_1900MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_18GHz

Date: 2.AUG.2022 10:09:44

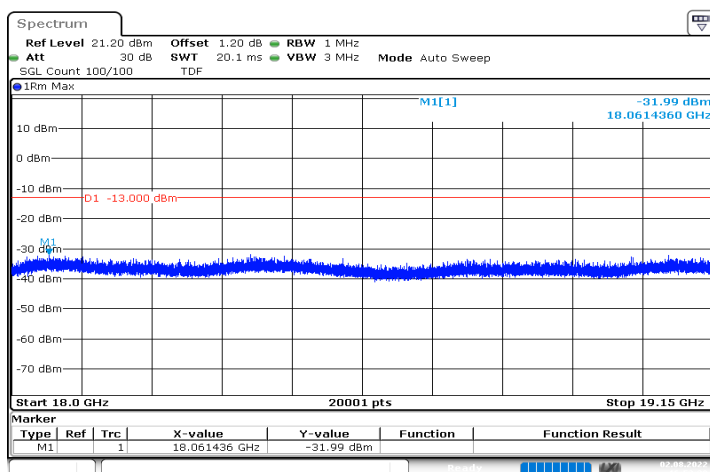
n2_20MHz_15kHz_1900MHz_DFT-s-OFDM
QPSK_RB100@0|18GHz_19.1GHz

Date: 2.AUG.2022 10:09:59

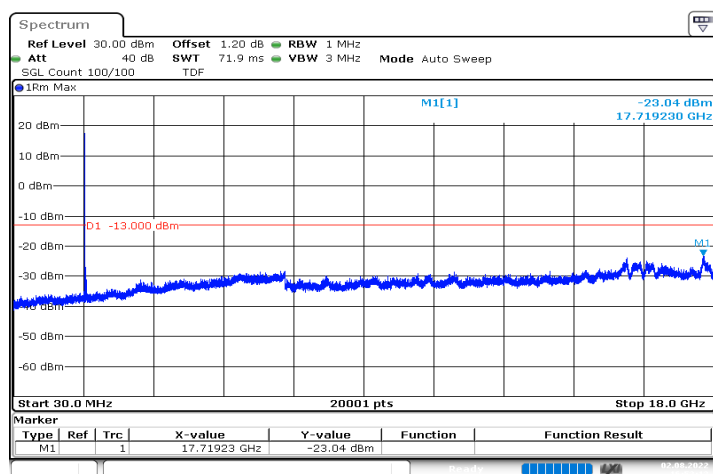
n25 , Normal

n25_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_18GHz

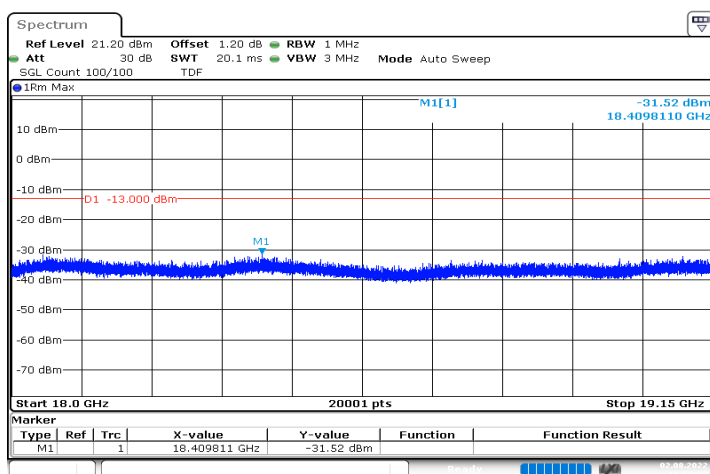
Date: 2.AUG.2022 16:52:24

n25_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB1@24|18GHz_19.15GHz

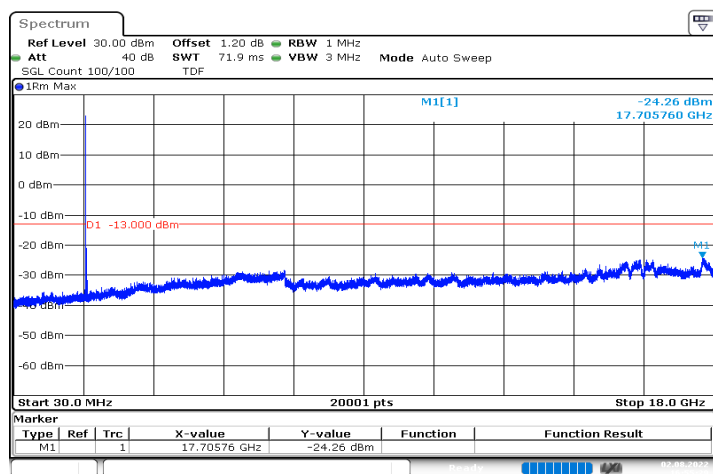
Date: 2.AUG.2022 16:52:39

n25_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_18GHz

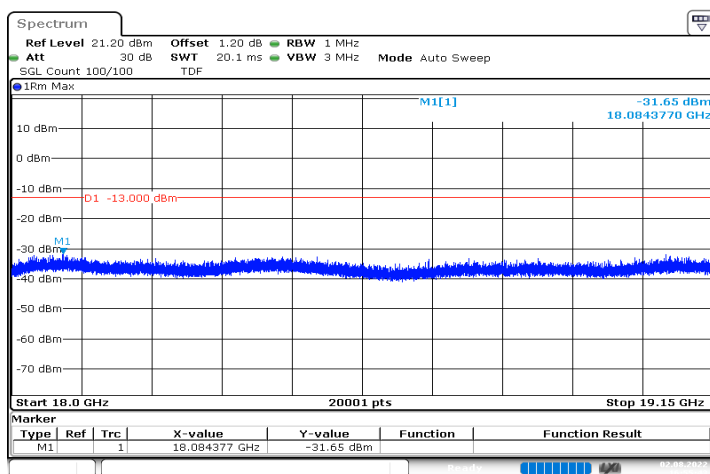
Date: 2.AUG.2022 16:53:14

n25_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB25@0|18GHz_19.15GHz

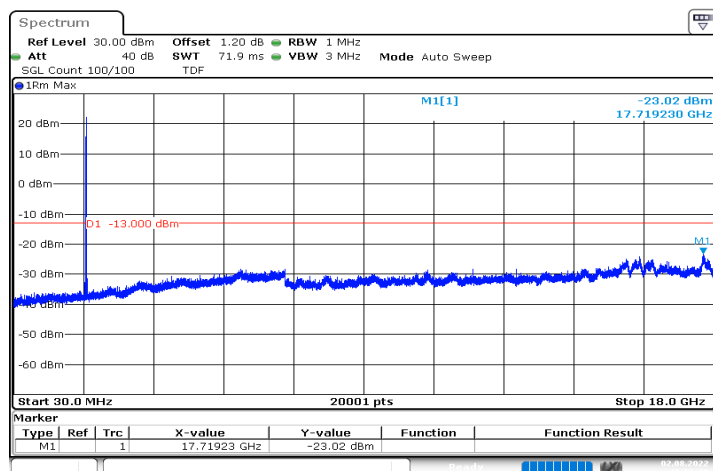
Date: 2.AUG.2022 16:53:28

n25_5MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

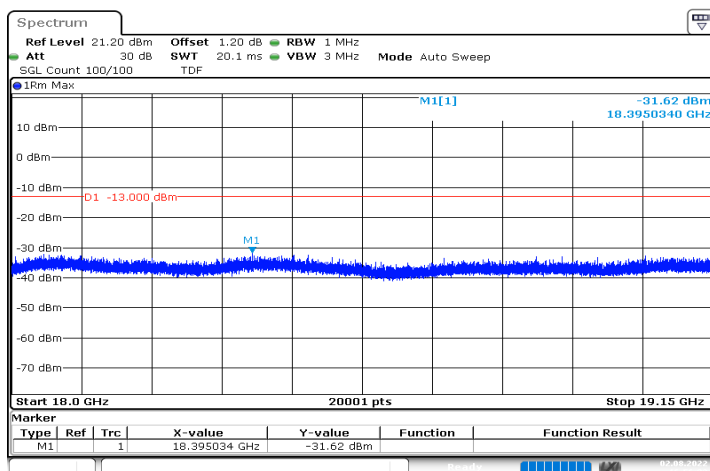
Date: 2.AUG.2022 16:55:29

n25_5MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.15GHz

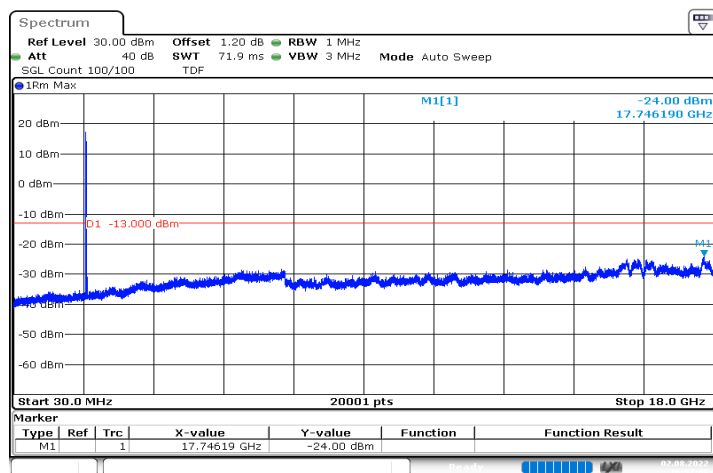
Date: 2.AUG.2022 16:55:43

n25_5MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_18GHz

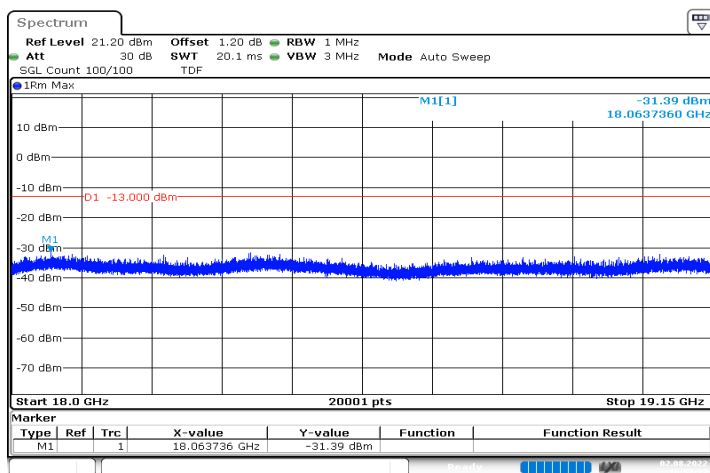
Date: 2.AUG.2022 16:56:19

n25_5MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@24|18GHz_19.15GHz

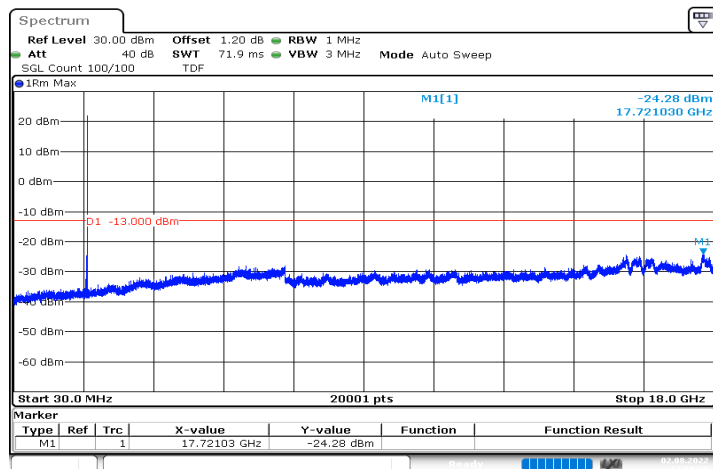
Date: 2.AUG.2022 16:56:33

n25_5MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_18GHz

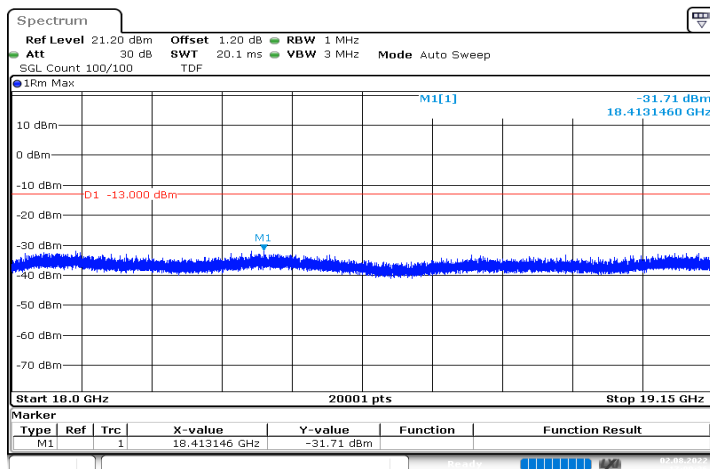
Date: 2.AUG.2022 16:57:09

n25_5MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB25@0|18GHz_19.15GHz

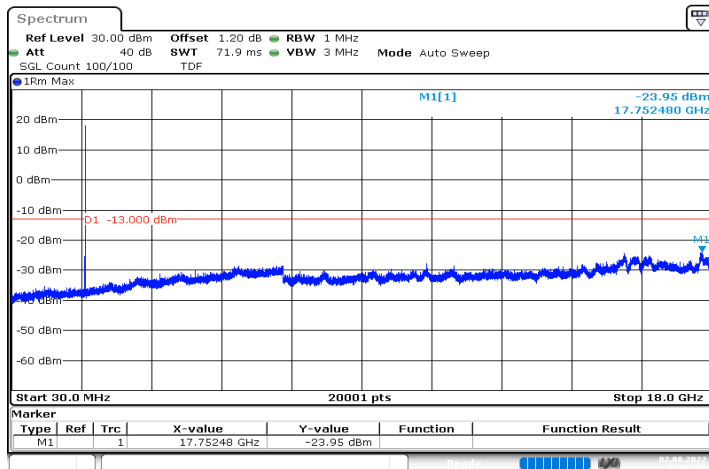
Date: 2.AUG.2022 16:57:23

n25_5MHz_15kHz_1912.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_18GHz

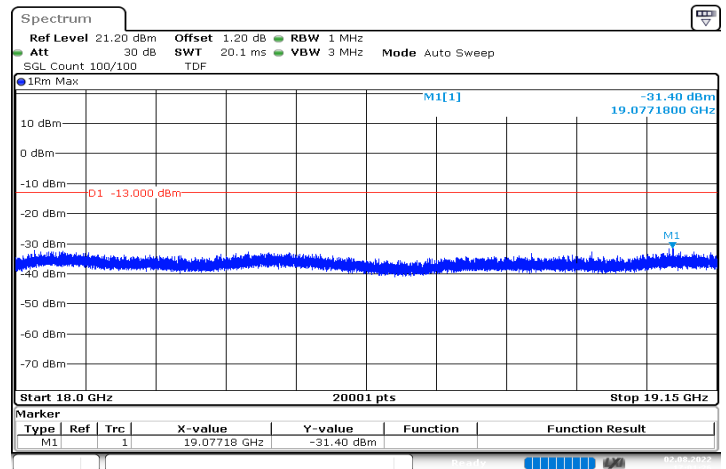
Date: 2.AUG.2022 17:00:22

n25_5MHz_15kHz_1912.5MHz_DFT-s-OFDM
QPSK_RB1@24|18GHz_19.15GHz

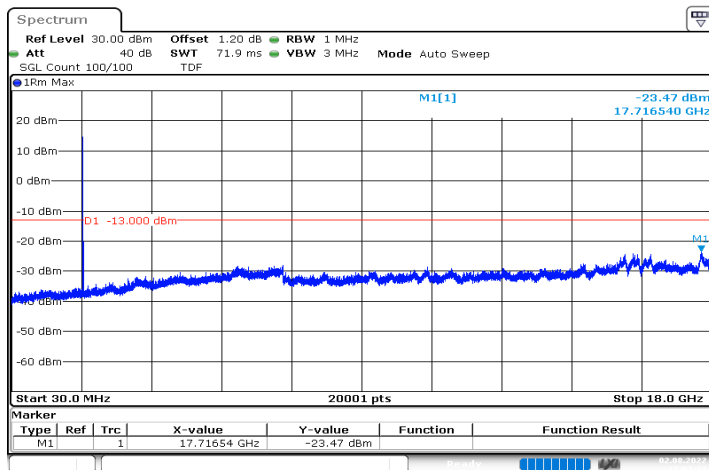
Date: 2.AUG.2022 17:00:37

n25_5MHz_15kHz_1912.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_18GHz

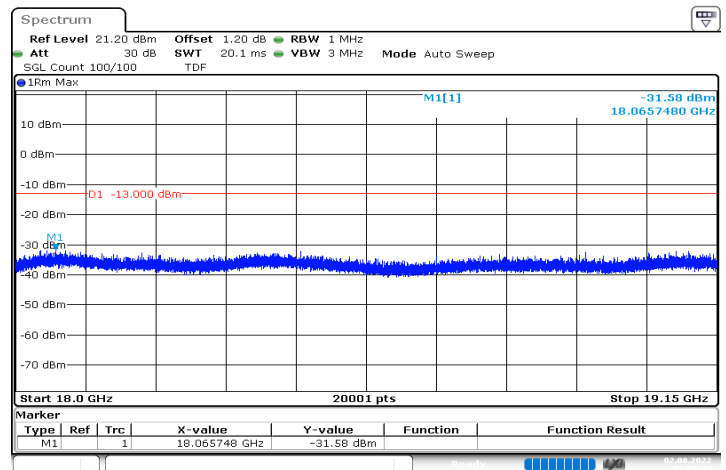
Date: 2.AUG.2022 17:01:12

n25_5MHz_15kHz_1912.5MHz_DFT-s-OFDM
QPSK_RB25@0|18GHz_19.15GHz

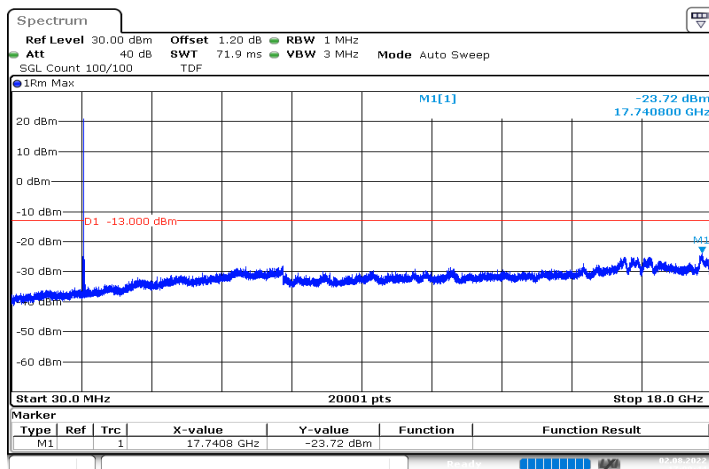
Date: 2.AUG.2022 17:01:26

n25_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_18GHz

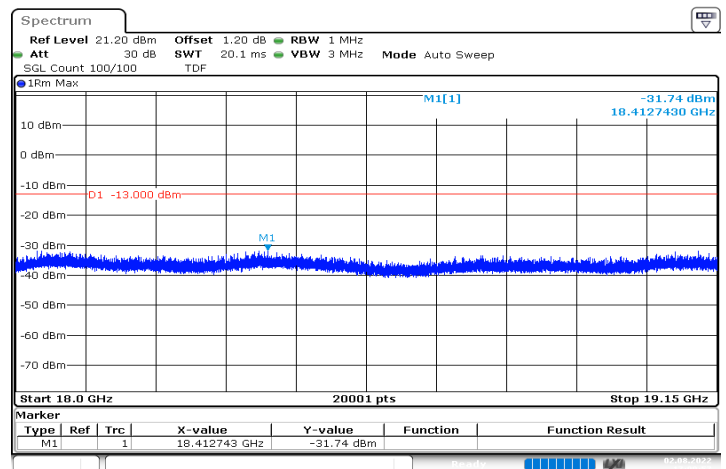
Date: 2.AUG.2022 17:07:31

n25_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB50@0|18GHz_19.15GHz

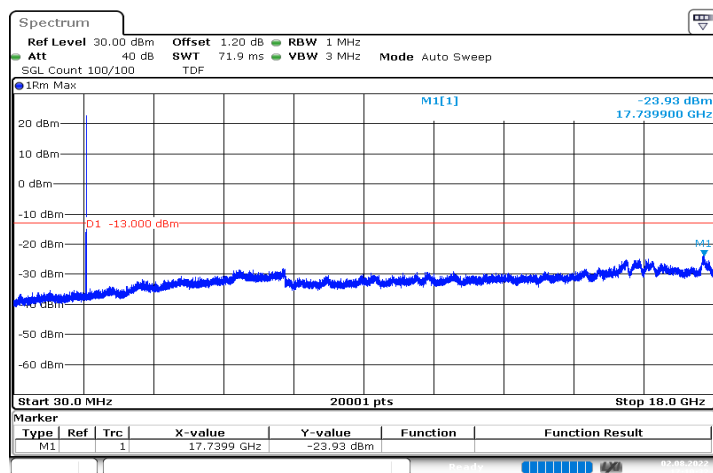
Date: 2.AUG.2022 17:07:45

n25_10MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

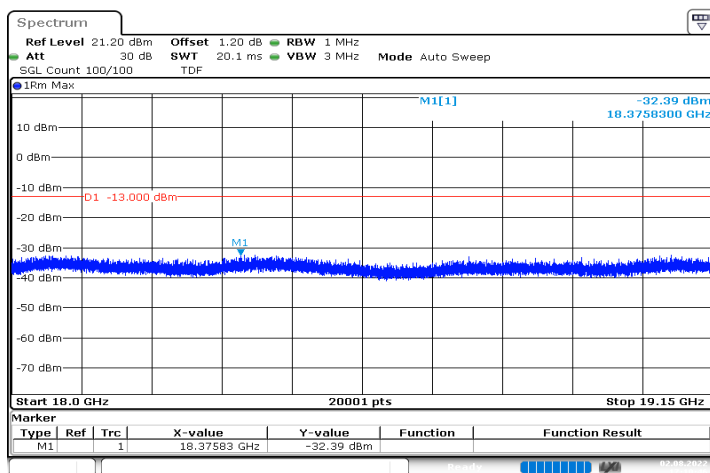
Date: 2.AUG.2022 17:09:44

n25_10MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.15GHz

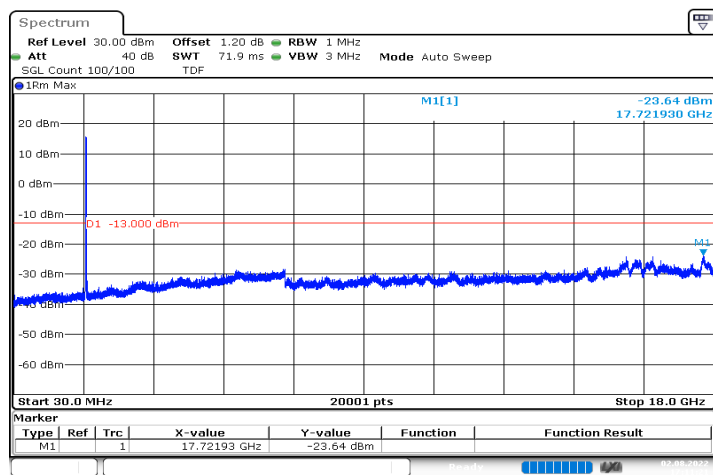
Date: 2.AUG.2022 17:09:58

n25_10MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_18GHz

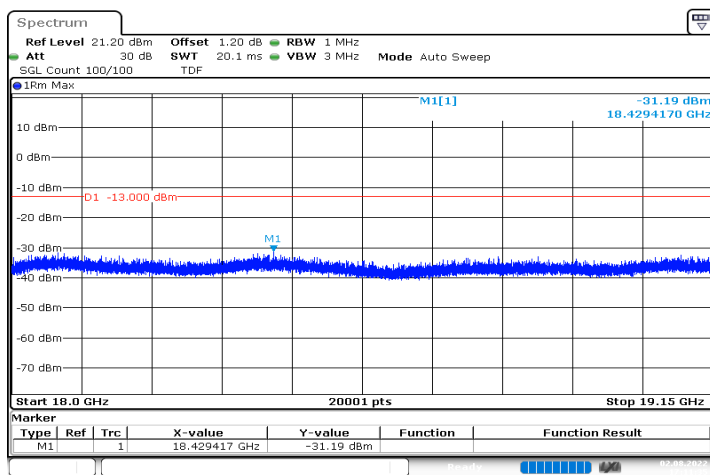
Date: 2.AUG.2022 17:10:33

n25_10MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@51|18GHz_19.15GHz

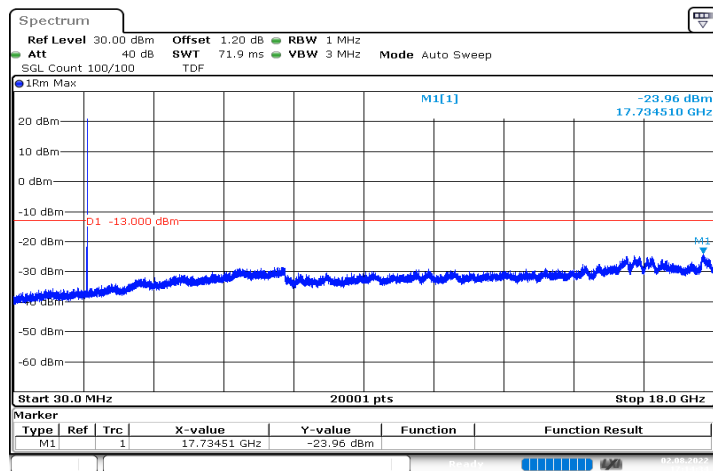
Date: 2.AUG.2022 17:10:47

n25_10MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_18GHz

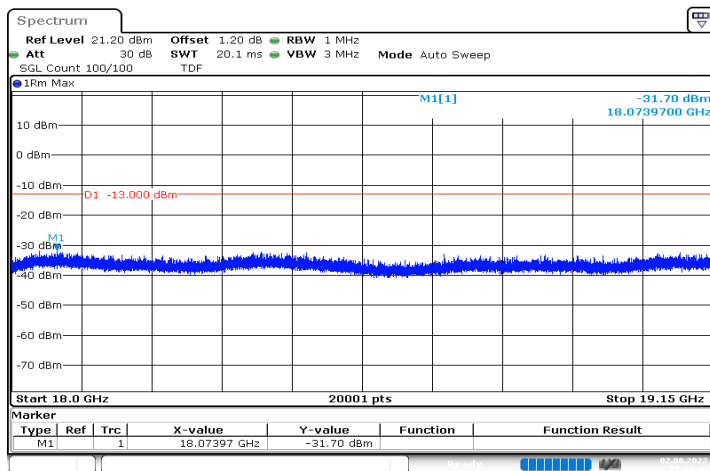
Date: 2.AUG.2022 17:11:21

n25_10MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB50@0|18GHz_19.15GHz

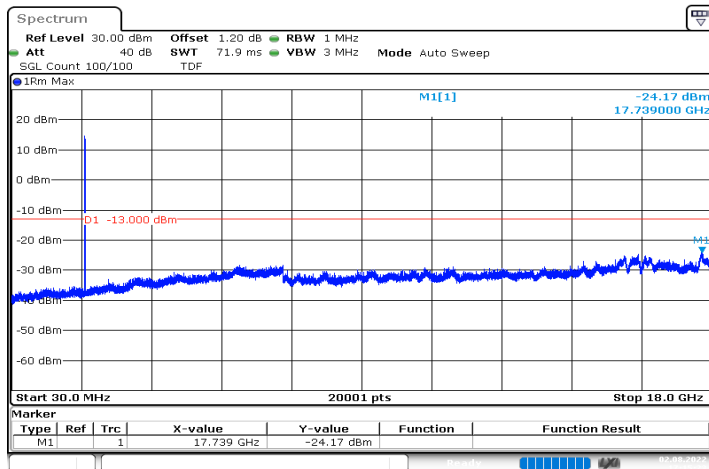
Date: 2.AUG.2022 17:11:35

n25_10MHz_15kHz_1910MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_18GHz

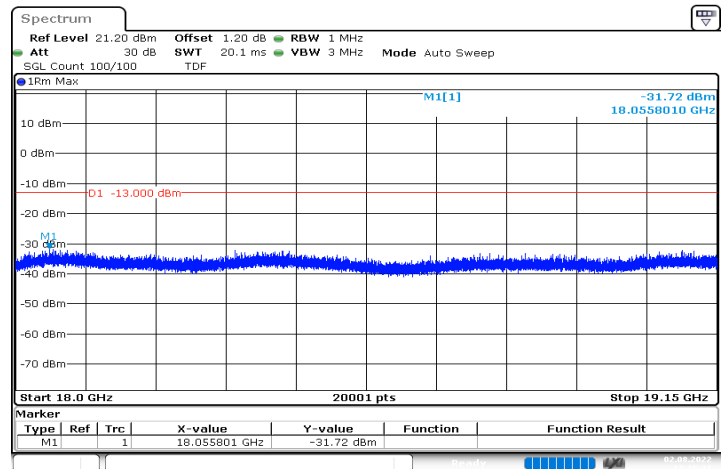
Date: 2.AUG.2022 17:14:34

n25_10MHz_15kHz_1910MHz_DFT-s-OFDM
QPSK_RB1@51|18GHz_19.15GHz

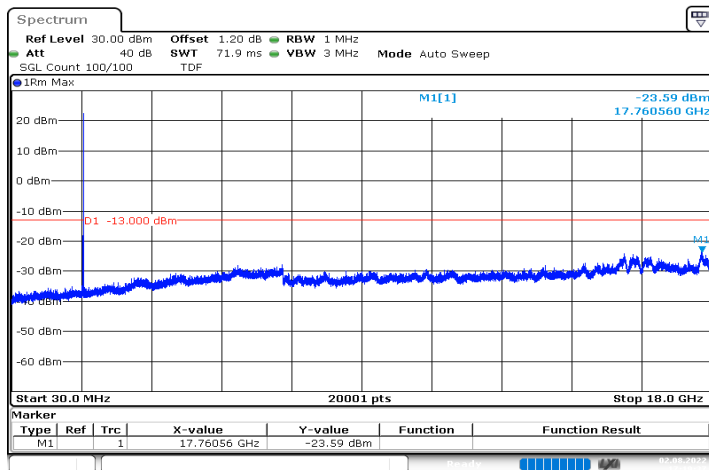
Date: 2.AUG.2022 17:14:48

n25_10MHz_15kHz_1910MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_18GHz

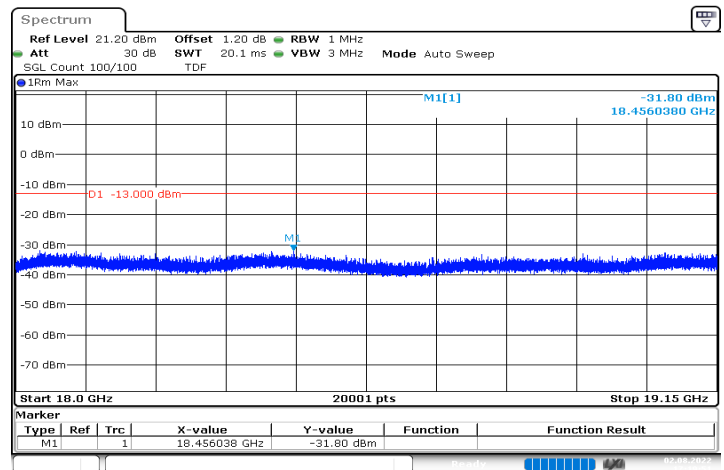
Date: 2.AUG.2022 17:15:23

n25_10MHz_15kHz_1910MHz_DFT-s-OFDM
QPSK_RB50@0|18GHz_19.15GHz

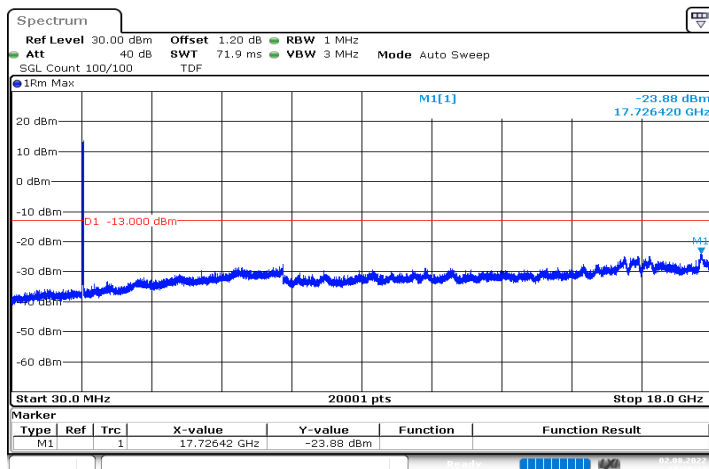
Date: 2.AUG.2022 17:15:37

n25_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_18GHz

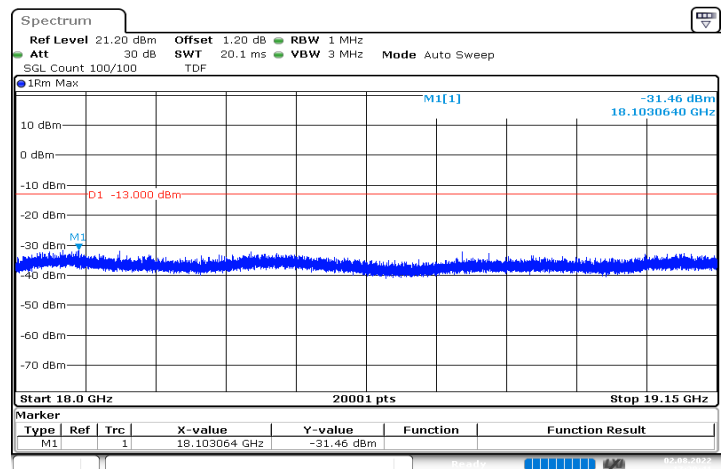
Date: 2.AUG.2022 17:19:38

n25_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB1@78|18GHz_19.15GHz

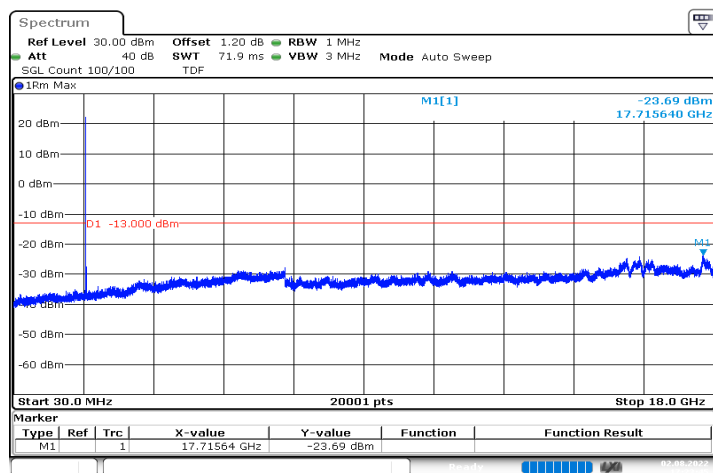
Date: 2.AUG.2022 17:19:52

n25_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_18GHz

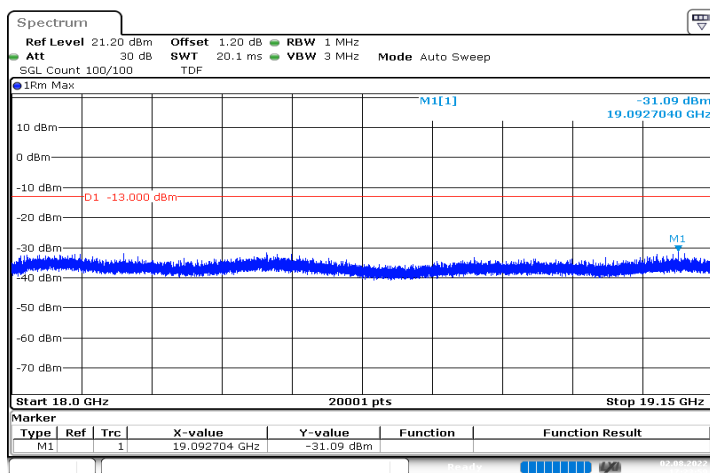
Date: 2.AUG.2022 17:20:28

n25_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB75@0|18GHz_19.15GHz

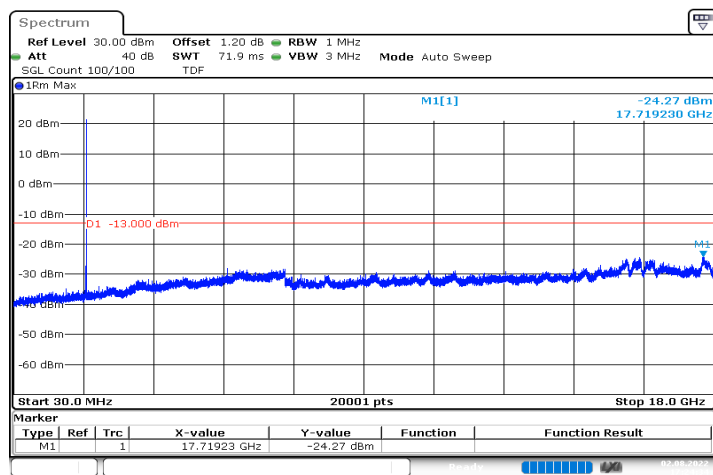
Date: 2.AUG.2022 17:20:42

n25_15MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

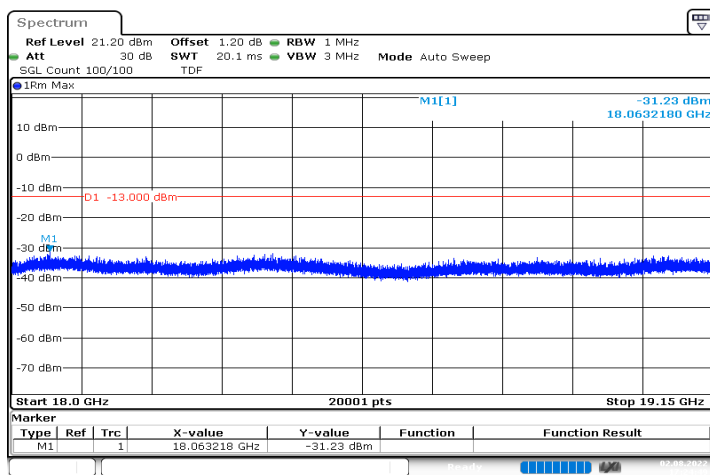
Date: 2.AUG.2022 17:23:46

n25_15MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.15GHz

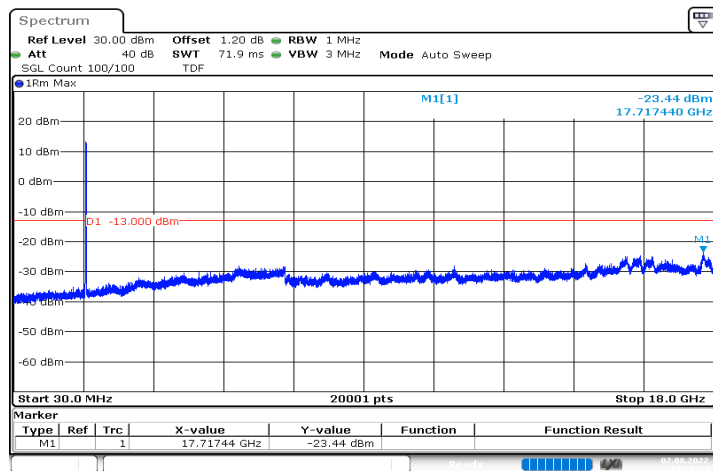
Date: 2.AUG.2022 17:24:00

n25_15MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_18GHz

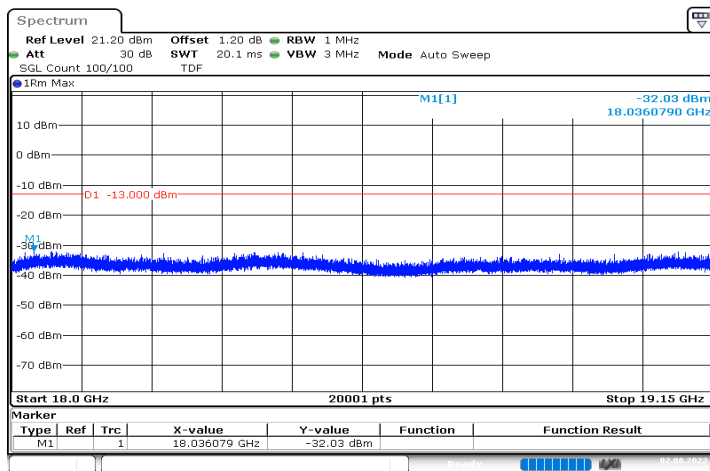
Date: 2.AUG.2022 17:24:35

n25_15MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@78|18GHz_19.15GHz

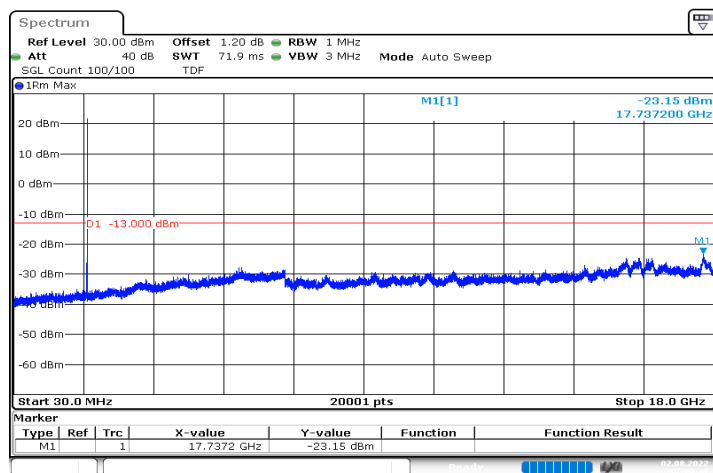
Date: 2.AUG.2022 17:24:49

n25_15MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_18GHz

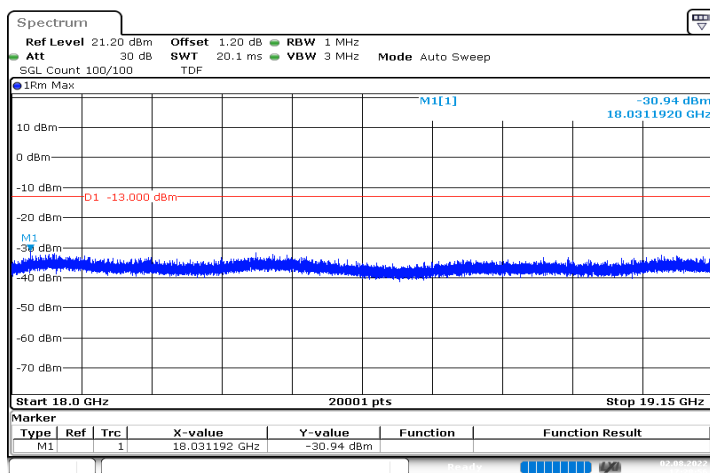
Date: 2.AUG.2022 17:25:25

n25_15MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB75@0|18GHz_19.15GHz

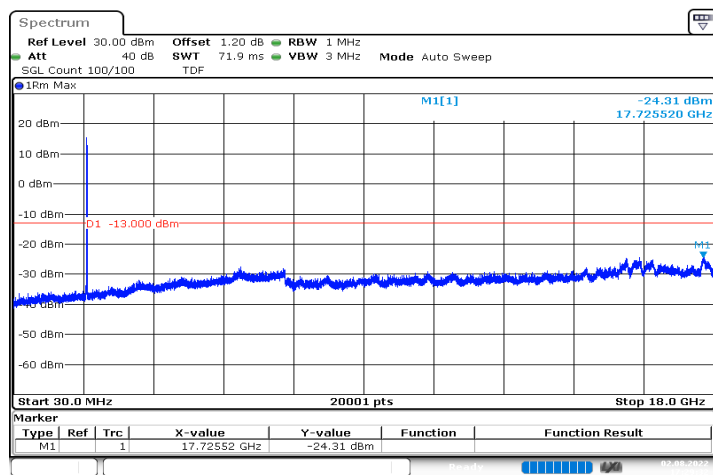
Date: 2.AUG.2022 17:25:39

n25_15MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_18GHz

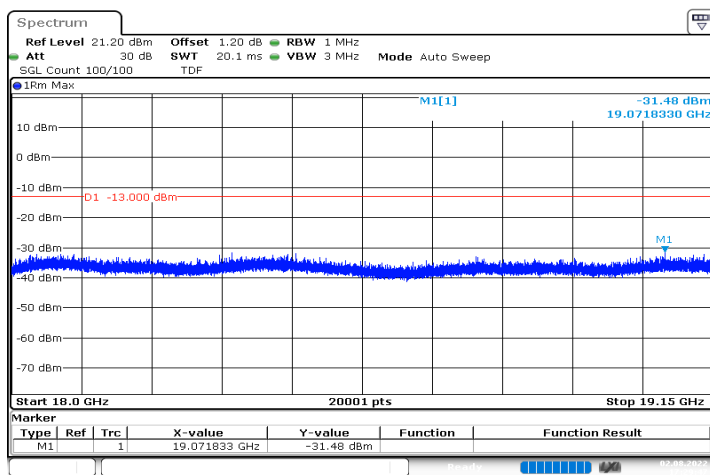
Date: 2.AUG.2022 17:28:42

n25_15MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB1@78|18GHz_19.15GHz

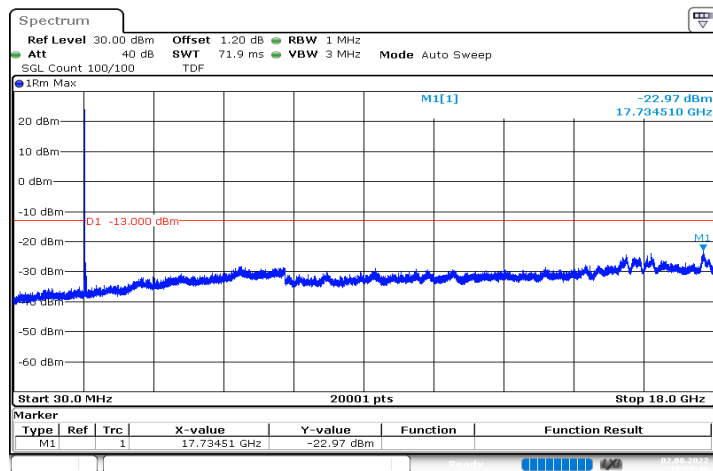
Date: 2.AUG.2022 17:28:57

n25_15MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_18GHz

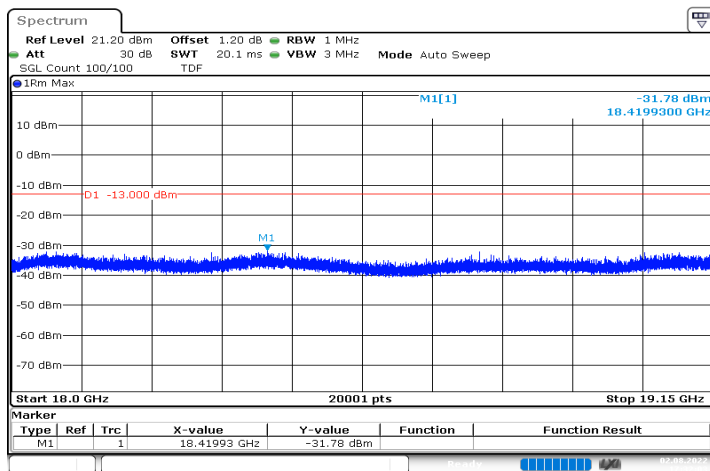
Date: 2.AUG.2022 17:29:33

n25_15MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB75@0|18GHz_19.15GHz

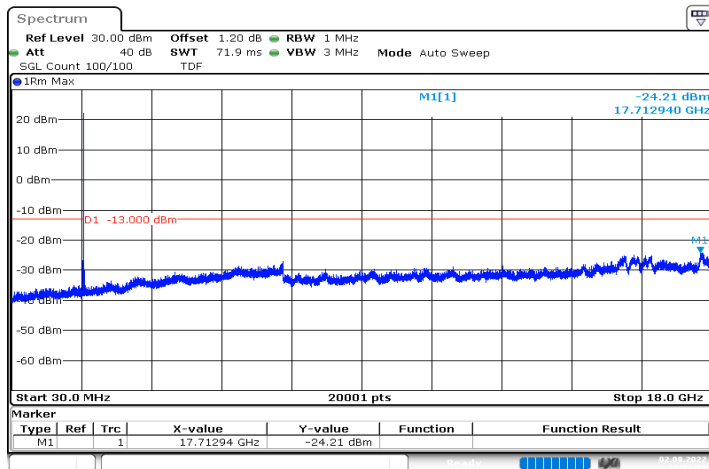
Date: 2.AUG.2022 17:29:47

n25_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

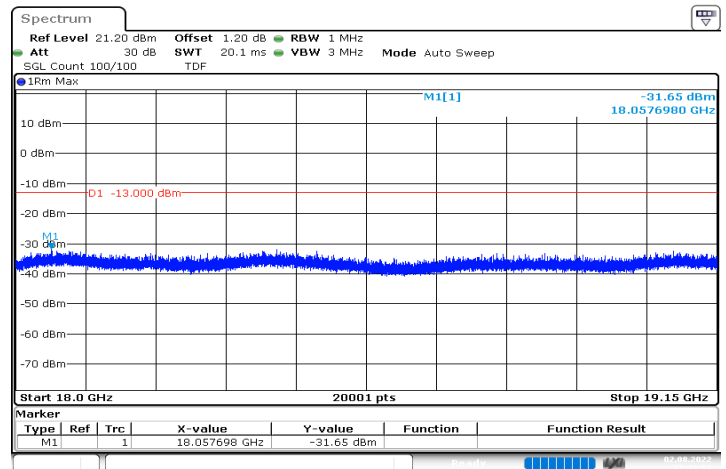
Date: 2.AUG.2022 17:31:50

n25_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.15GHz

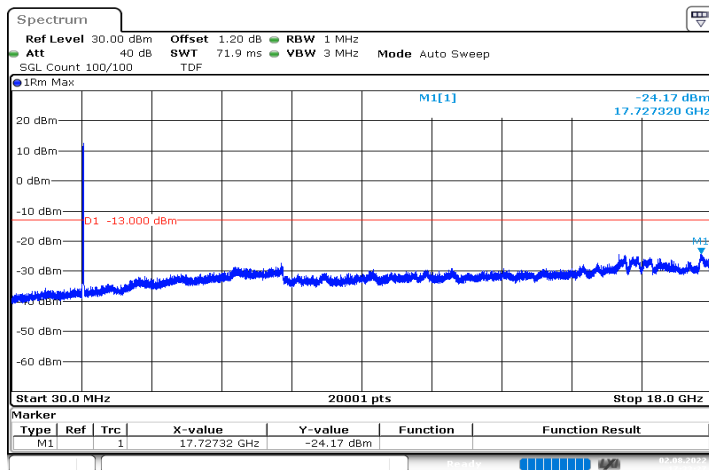
Date: 2.AUG.2022 17:32:03

n25_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_18GHz

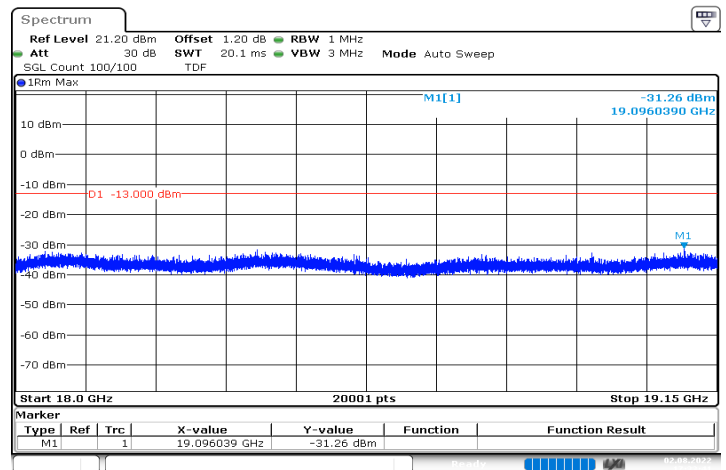
Date: 2.AUG.2022 17:32:39

n25_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB1@105|18GHz_19.15GHz

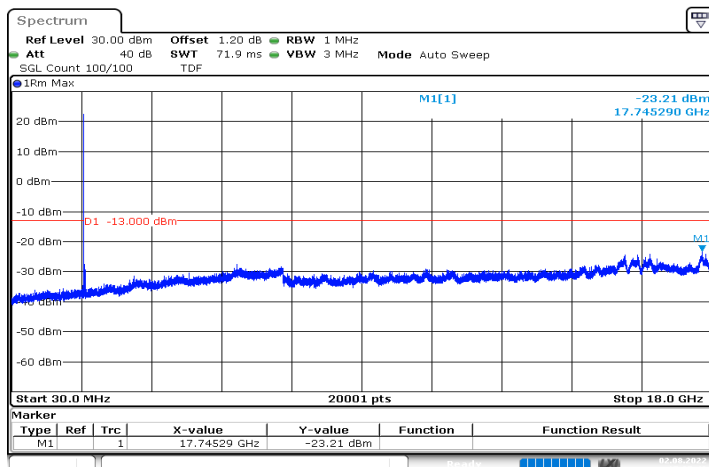
Date: 2.AUG.2022 17:32:53

n25_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_18GHz

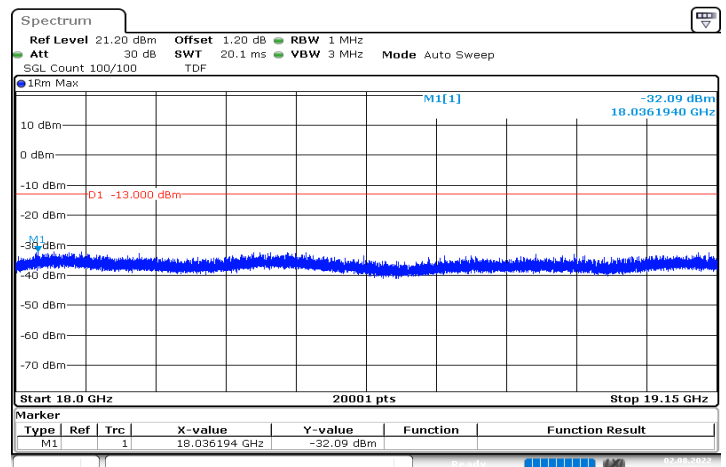
Date: 2.AUG.2022 17:33:28

n25_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB100@0|18GHz_19.15GHz

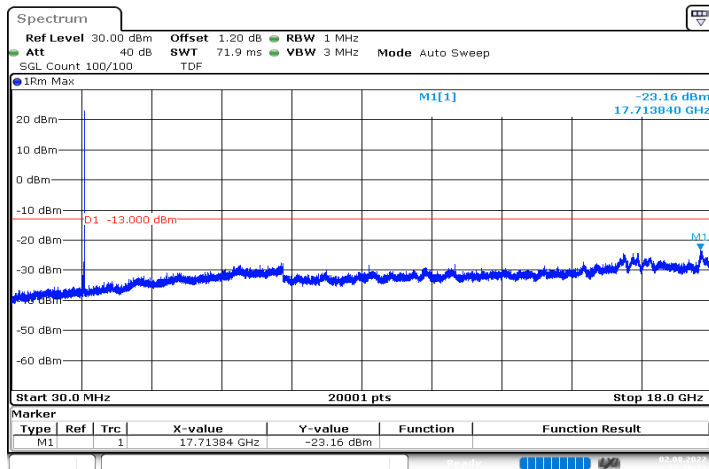
Date: 2.AUG.2022 17:33:42

n25_20MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

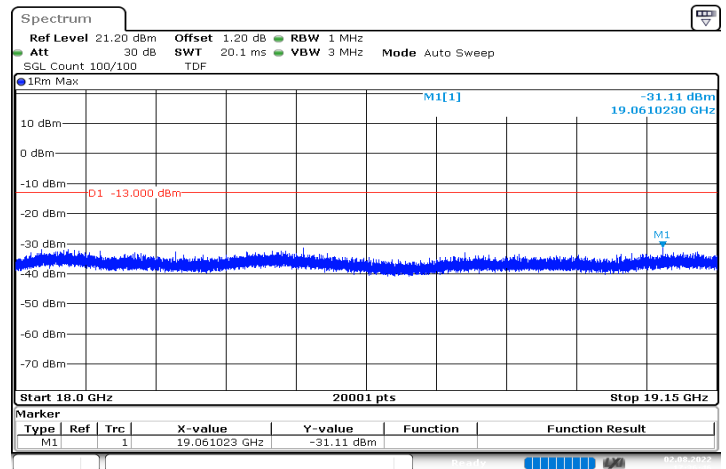
Date: 2.AUG.2022 17:35:43

n25_20MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.15GHz

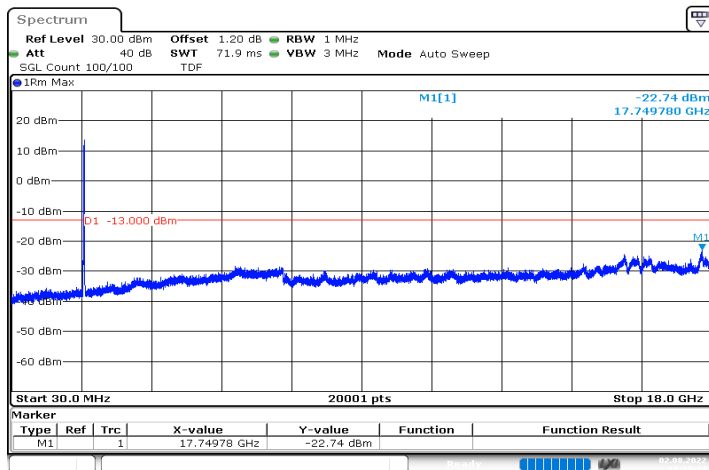
Date: 2.AUG.2022 17:35:57

n25_20MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_18GHz

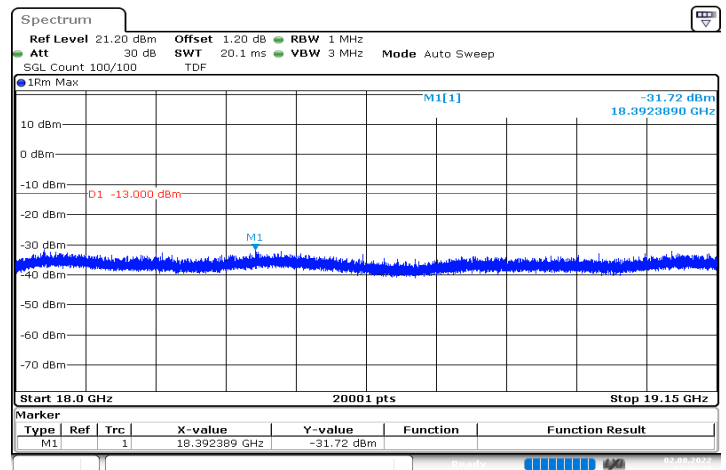
Date: 2.AUG.2022 17:36:32

n25_20MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB1@105|18GHz_19.15GHz

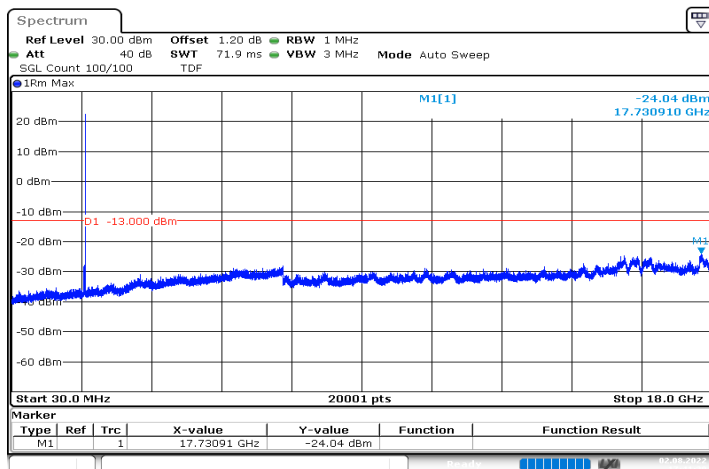
Date: 2.AUG.2022 17:36:46

n25_20MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_18GHz

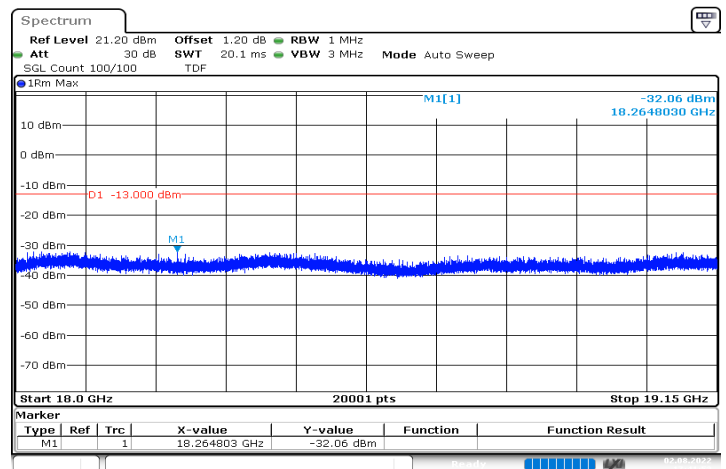
Date: 2.AUG.2022 17:37:22

n25_20MHz_15kHz_1882.5MHz_DFT-s-OFDM
QPSK_RB100@0|18GHz_19.15GHz

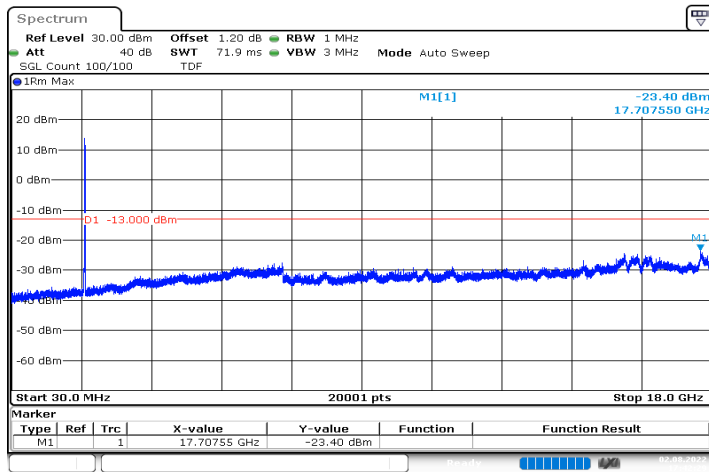
Date: 2.AUG.2022 17:37:36

n25_20MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_18GHz

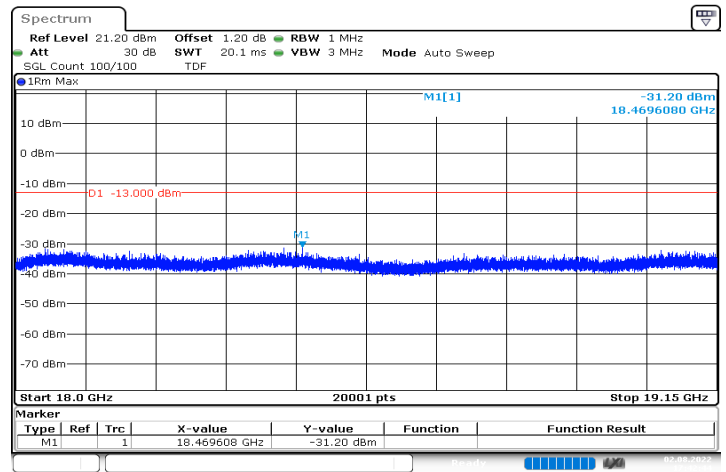
Date: 2.AUG.2022 17:41:40

n25_20MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB1@105|18GHz_19.15GHz

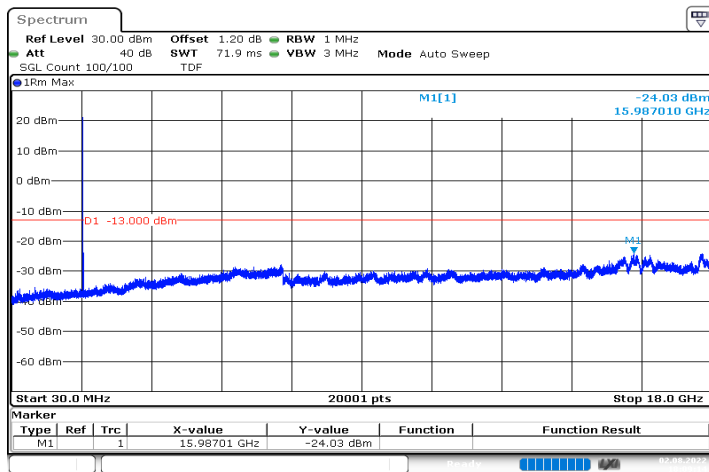
Date: 2.AUG.2022 17:41:54

n25_20MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_18GHz

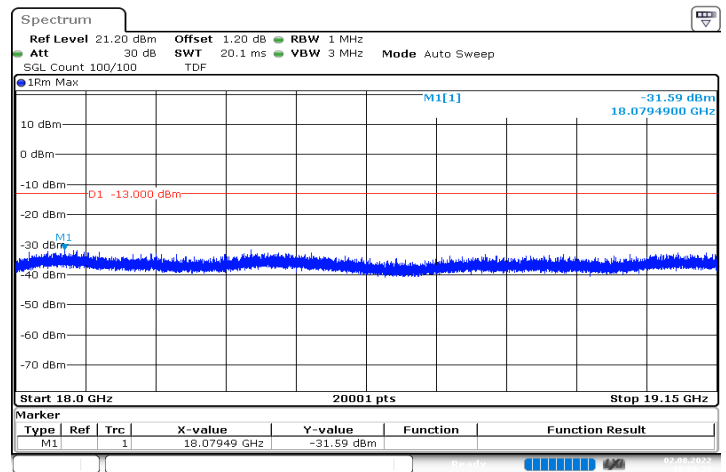
Date: 2.AUG.2022 17:42:30

n25_20MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB100@0|18GHz_19.15GHz

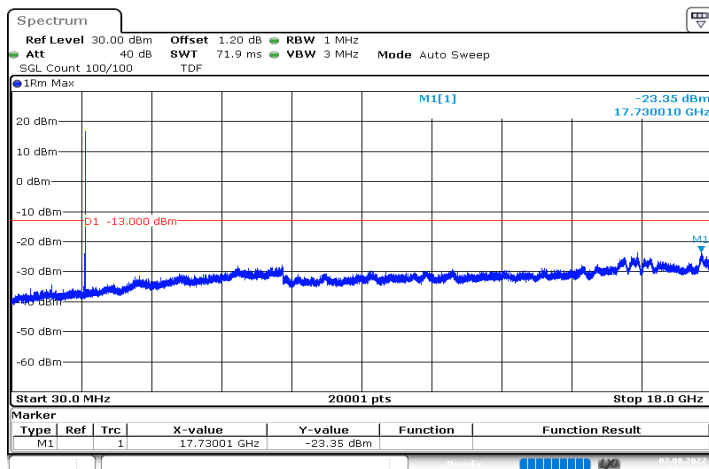
Date: 2.AUG.2022 17:42:44

n25_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

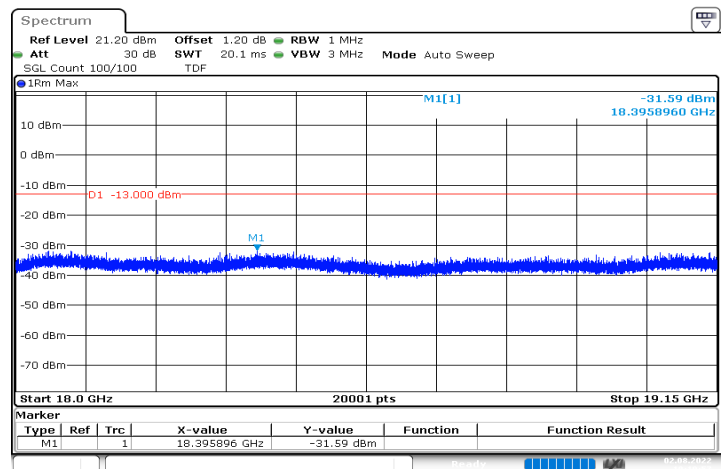
Date: 2.AUG.2022 18:09:15

n25_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.15GHz

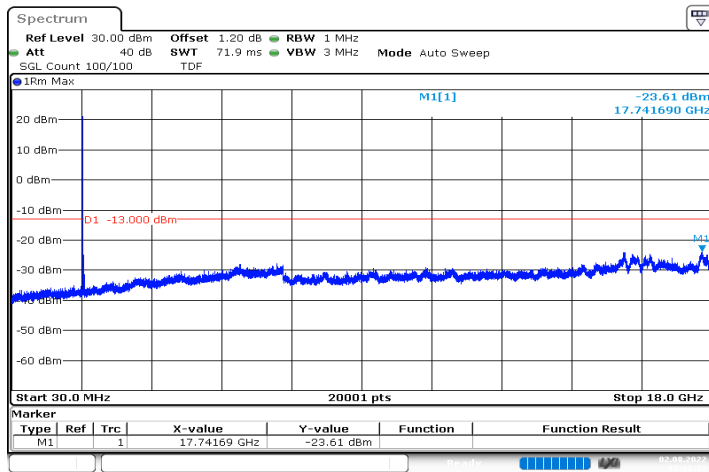
Date: 2.AUG.2022 18:09:28

n25_5MHz_15kHz_1912.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

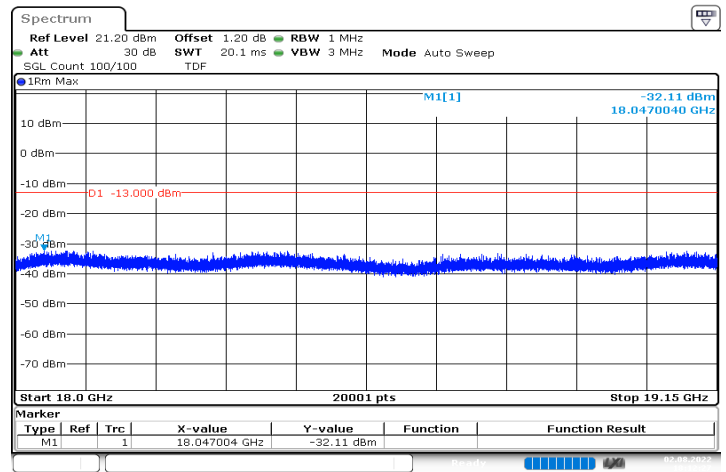
Date: 2.AUG.2022 18:10:43

n25_5MHz_15kHz_1912.5MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.15GHz

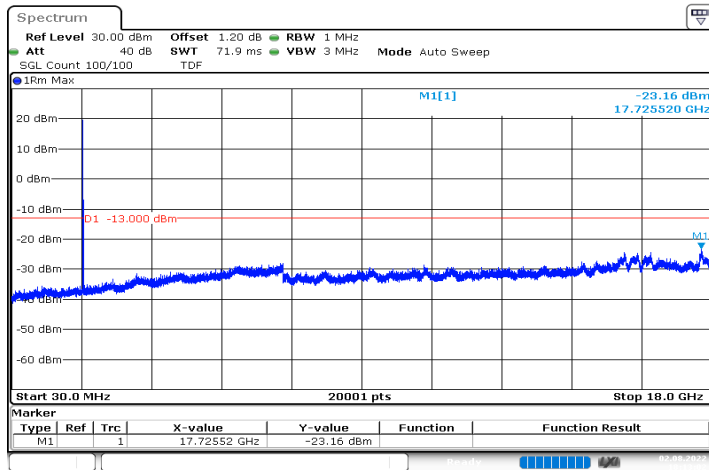
Date: 2.AUG.2022 18:10:57

n25_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

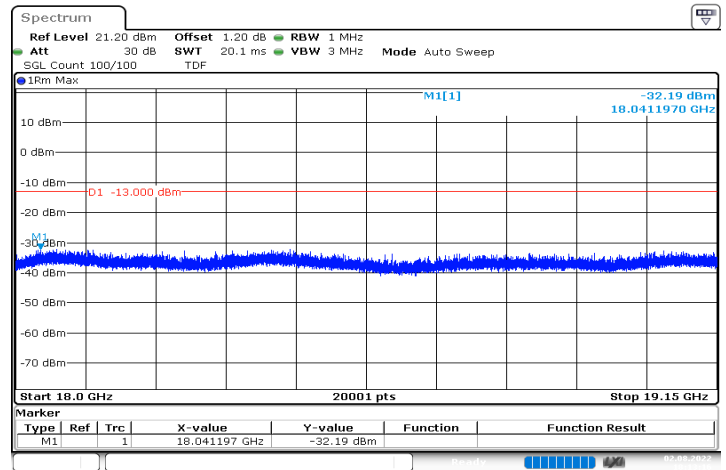
Date: 2.AUG.2022 18:12:14

n25_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.15GHz

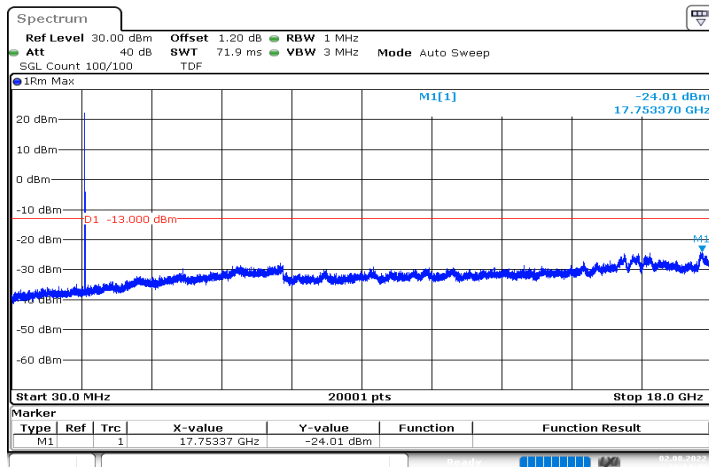
Date: 2.AUG.2022 18:12:28

n25_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_18GHz

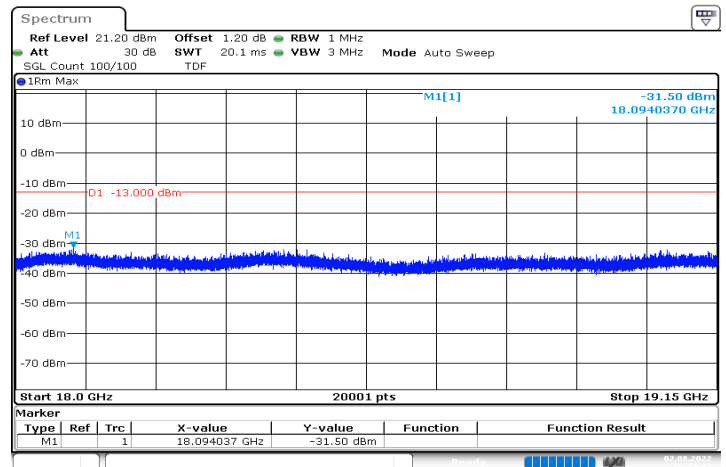
Date: 2.AUG.2022 18:13:03

n25_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB1@51|18GHz_19.15GHz

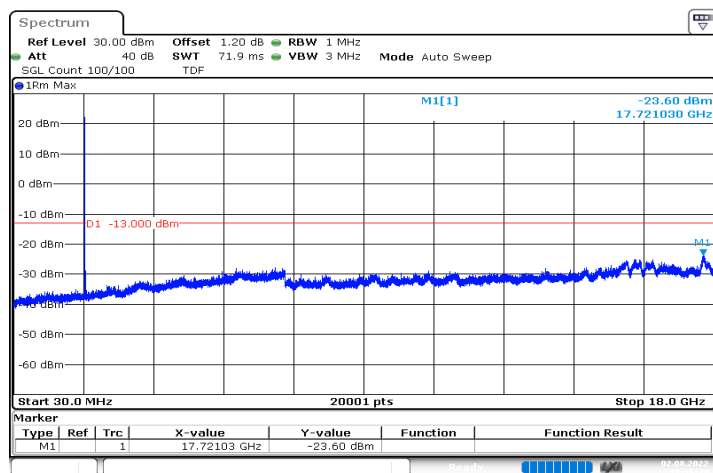
Date: 2.AUG.2022 18:13:16

n25_10MHz_15kHz_1910MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

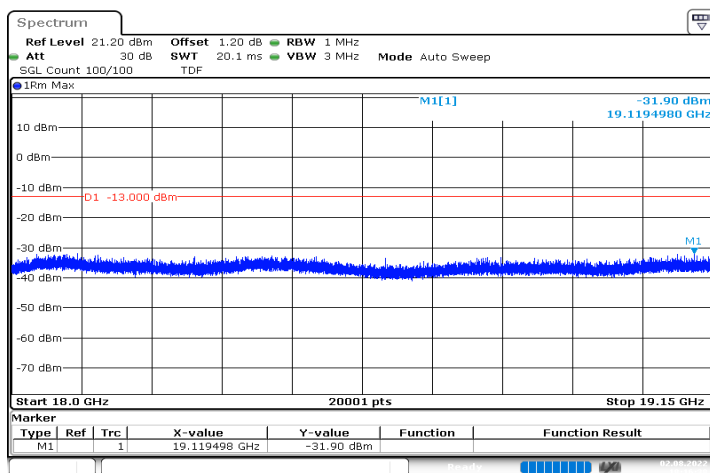
Date: 2.AUG.2022 18:14:41

n25_10MHz_15kHz_1910MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.15GHz

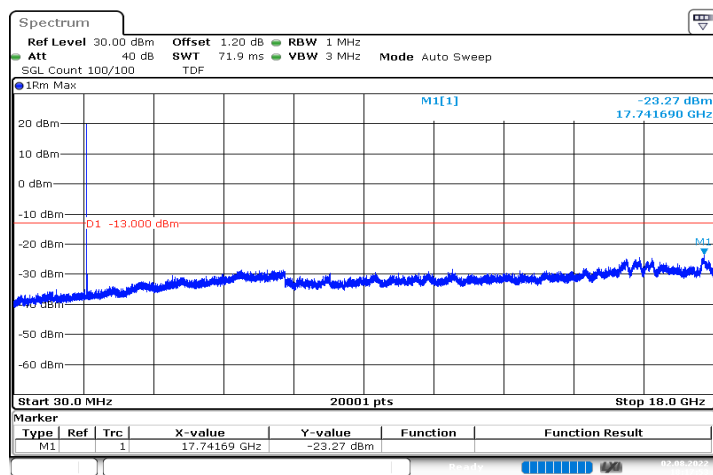
Date: 2.AUG.2022 18:14:54

n25_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

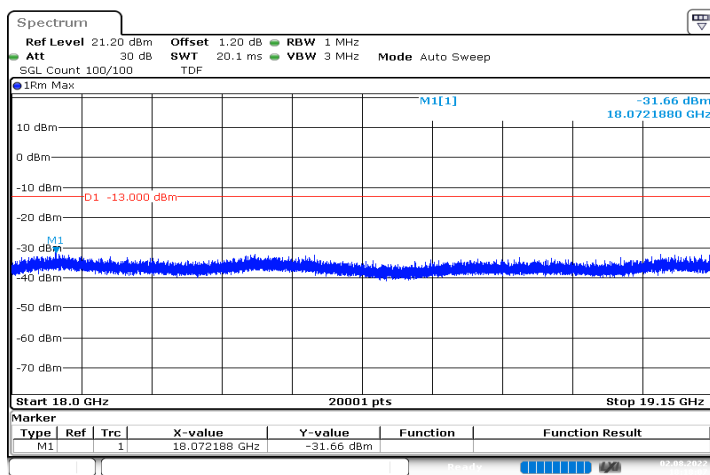
Date: 2.AUG.2022 18:16:25

n25_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.15GHz

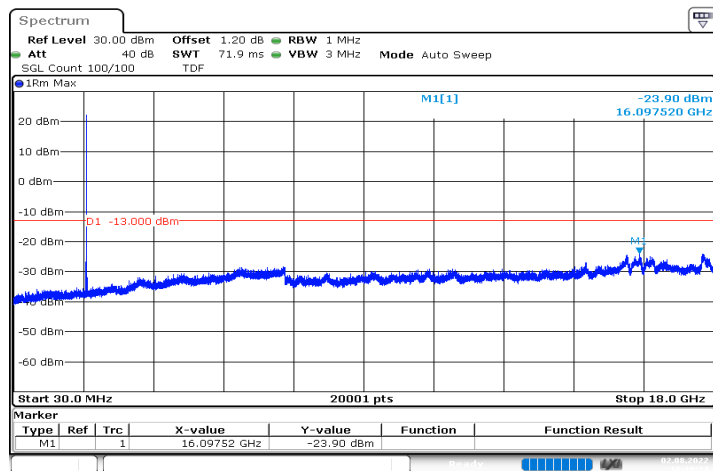
Date: 2.AUG.2022 18:16:38

n25_15MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

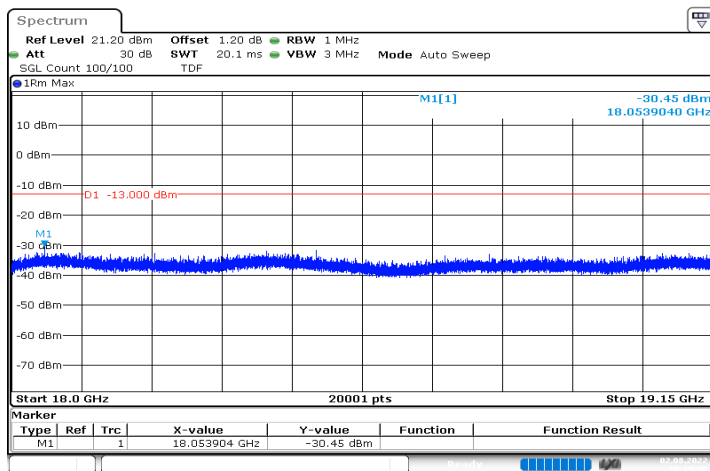
Date: 2.AUG.2022 18:17:54

n25_15MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.15GHz

Date: 2.AUG.2022 18:18:08

n25_20MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_18GHz

Date: 2.AUG.2022 18:19:25

n25_20MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB1@0|18GHz_19.15GHz

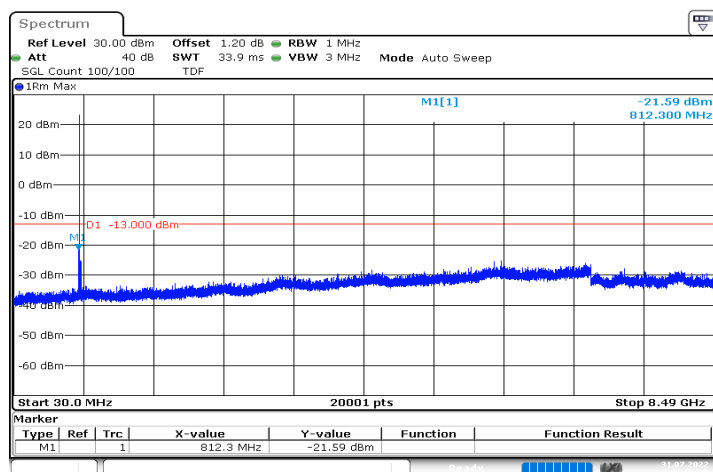
Date: 2.AUG.2022 18:19:39

FCC Part 22H**Spurious emissions at antenna terminals****n5 , Normal**

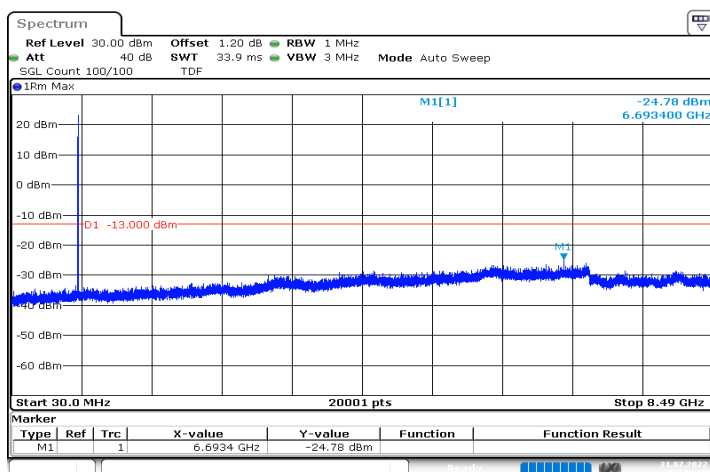
Mode	Value (dBm)	Limit (dBm)	Result
n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-21.59	-13	Pass
n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_8.49GHz	-24.78	-13	Pass
n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_8.49GHz	-25.8	-13	Pass
n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.91	-13	Pass
n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_8.49GHz	-25.49	-13	Pass
n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_8.49GHz	-26.6	-13	Pass
n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.53	-13	Pass
n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_8.49GHz	-26.21	-13	Pass
n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_8.49GHz	-26.28	-13	Pass
n5_10MHz_15kHz_829MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.73	-13	Pass
n5_10MHz_15kHz_829MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_8.49GHz	-26.02	-13	Pass
n5_10MHz_15kHz_829MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_8.49GHz	-26.06	-13	Pass
n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.5	-13	Pass
n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_8.49GHz	-26.23	-13	Pass
n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_8.49GHz	-25.87	-13	Pass
n5_10MHz_15kHz_844MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.94	-13	Pass
n5_10MHz_15kHz_844MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_8.49GHz	-25.71	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n5_10MHz_15kHz_844MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_8.49GHz	-25.9	-13	Pass
n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-26.63	-13	Pass
n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_8.49GHz	-26.46	-13	Pass
n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_8.49GHz	-26.04	-13	Pass
n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-26.27	-13	Pass
n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_8.49GHz	-26.16	-13	Pass
n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_8.49GHz	-24.74	-13	Pass
n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.93	-13	Pass
n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_8.49GHz	-25.58	-13	Pass
n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_8.49GHz	-26.36	-13	Pass
n5_20MHz_15kHz_834MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-26.47	-13	Pass
n5_20MHz_15kHz_834MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_8.49GHz	-25.82	-13	Pass
n5_20MHz_15kHz_834MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_8.49GHz	-25.3	-13	Pass
n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.73	-13	Pass
n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_8.49GHz	-25.86	-13	Pass
n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_8.49GHz	-26.5	-13	Pass
n5_20MHz_15kHz_839MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-26.54	-13	Pass
n5_20MHz_15kHz_839MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_8.49GHz	-25.97	-13	Pass
n5_20MHz_15kHz_839MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_8.49GHz	-25.21	-13	Pass

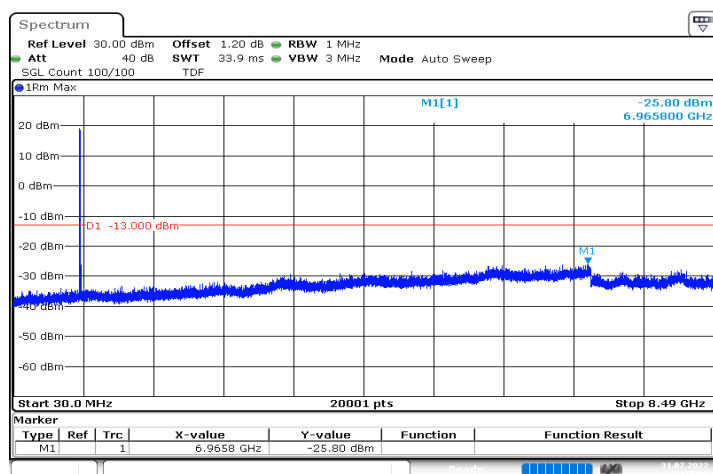
n5 , Normal

n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

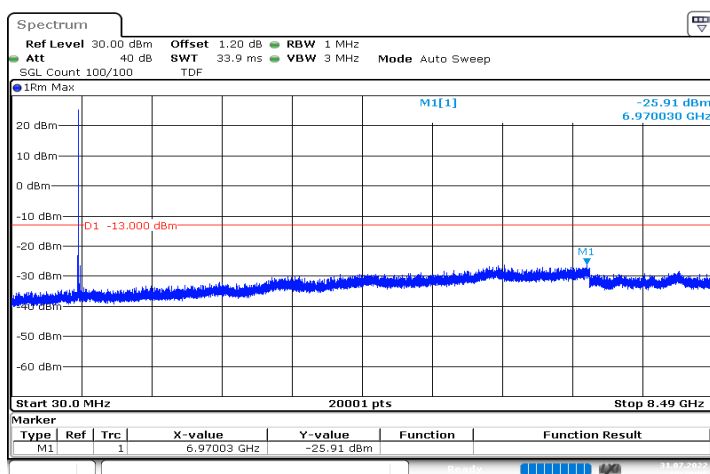
Date: 31.JUL.2022 18:28:25

n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_8.49GHz

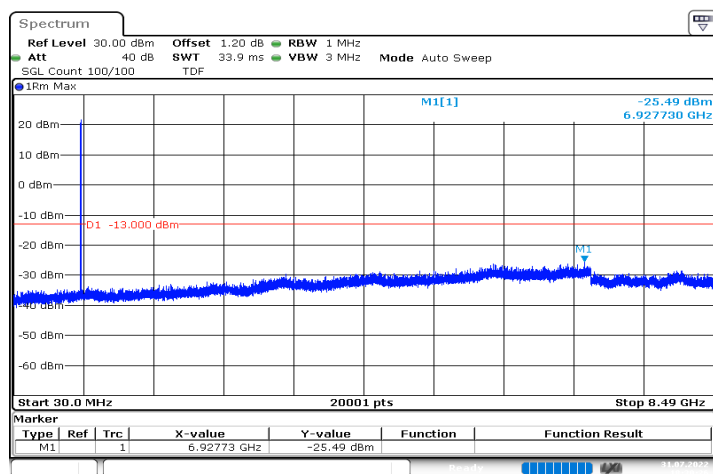
Date: 31.JUL.2022 18:28:45

n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_8.49GHz

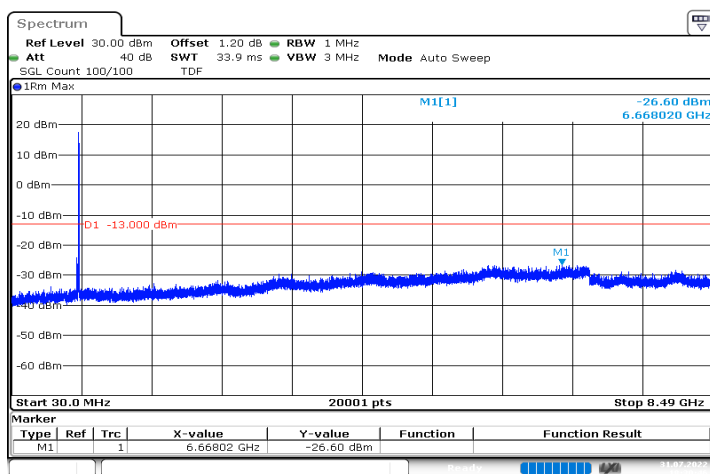
Date: 31.JUL.2022 18:29:05

n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

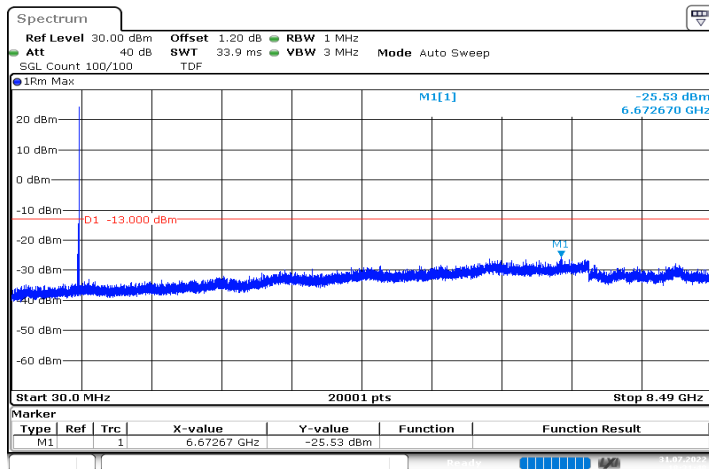
Date: 31.JUL.2022 18:30:06

n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_8.49GHz

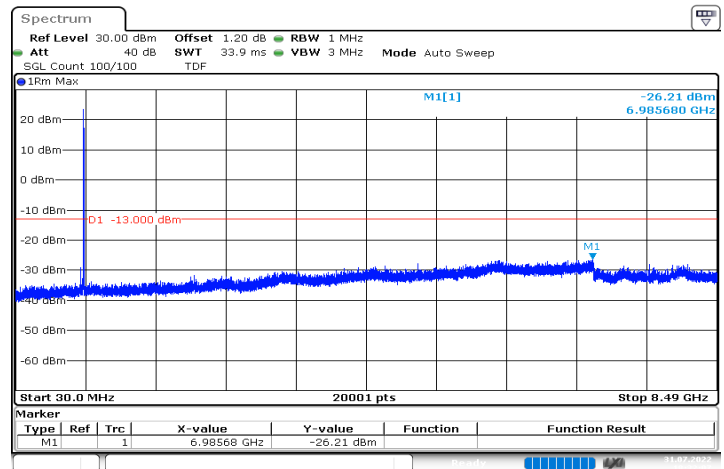
Date: 31.JUL.2022 18:30:26

n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_8.49GHz

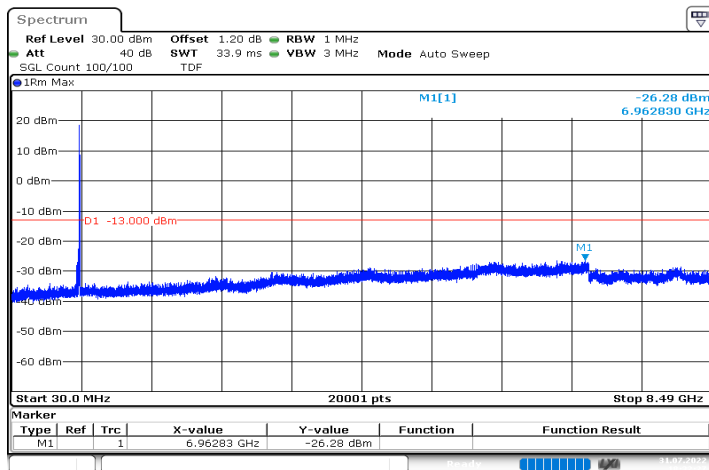
Date: 31.JUL.2022 18:30:46

n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

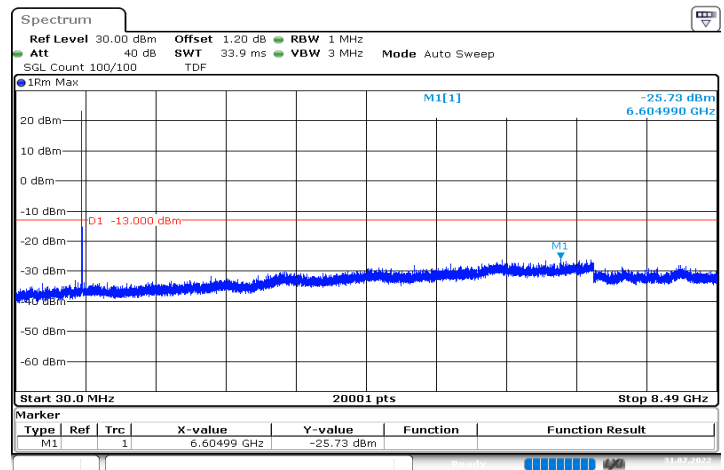
Date: 31.JUL.2022 18:31:48

n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_8.49GHz

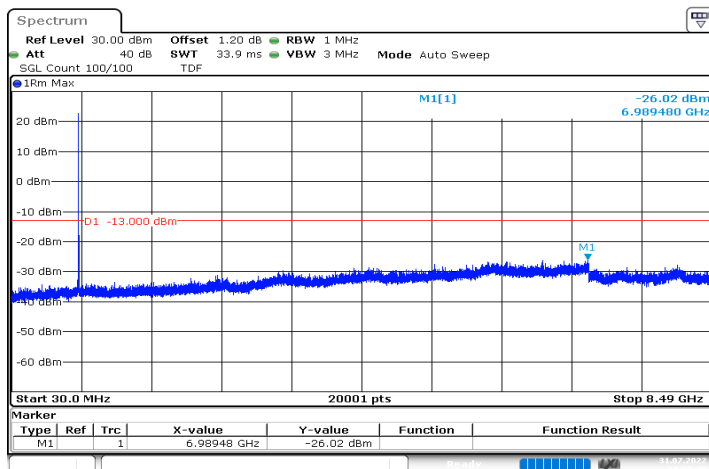
Date: 31.JUL.2022 18:32:07

n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_8.49GHz

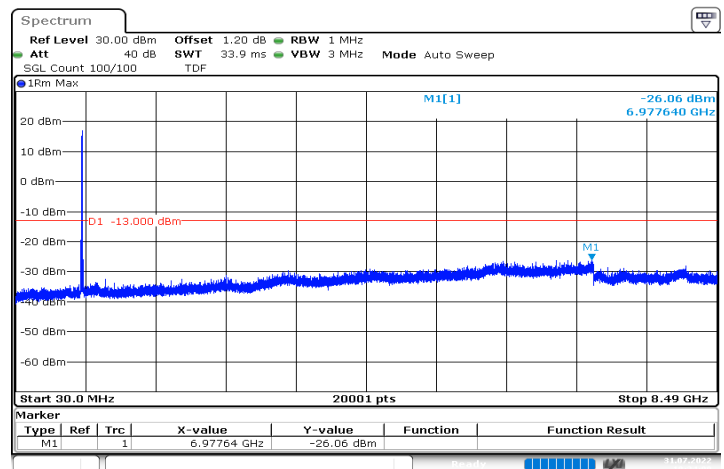
Date: 31.JUL.2022 18:32:27

n5_10MHz_15kHz_829MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

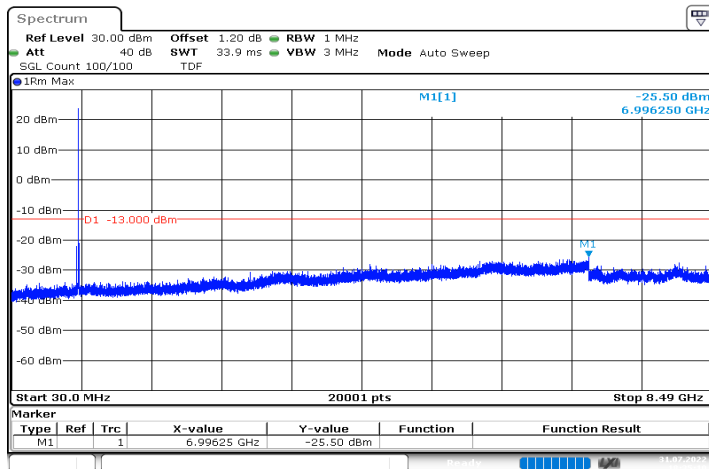
Date: 31.JUL.2022 18:33:30

n5_10MHz_15kHz_829MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_8.49GHz

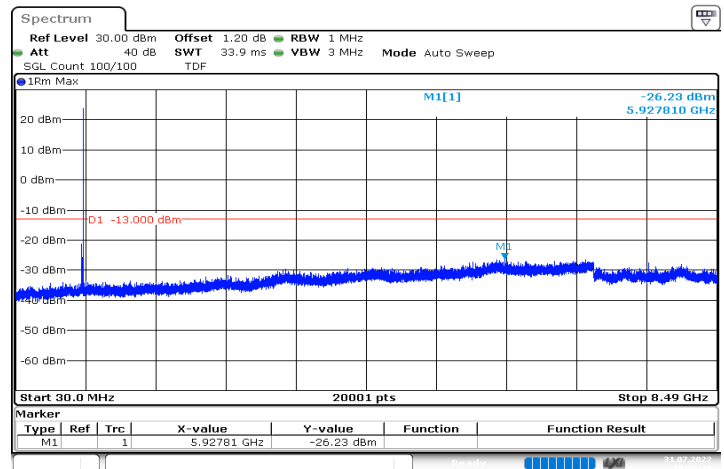
Date: 31.JUL.2022 18:33:50

n5_10MHz_15kHz_829MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_8.49GHz

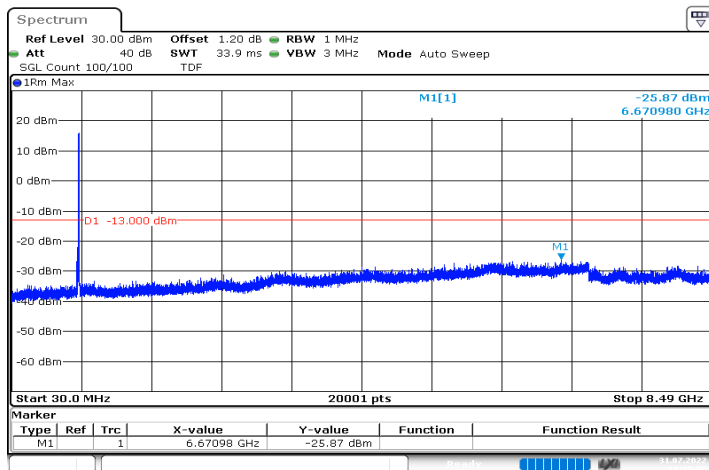
Date: 31.JUL.2022 18:34:09

n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

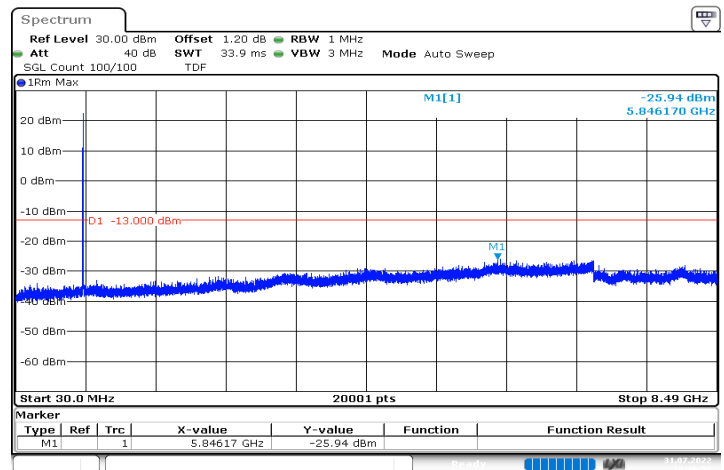
Date: 31.JUL.2022 18:35:11

n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_8.49GHz

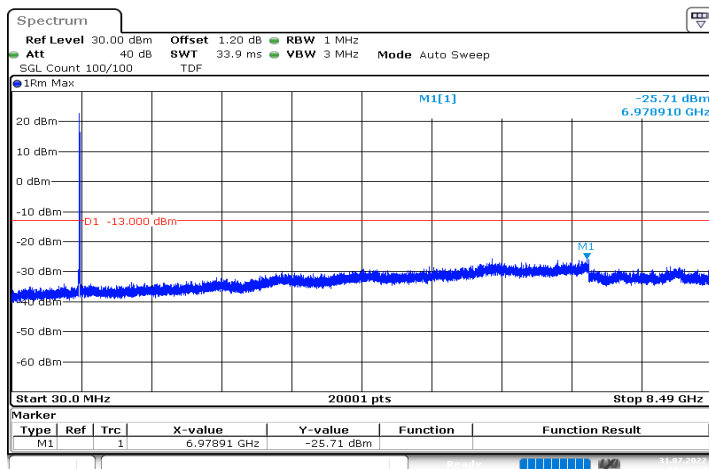
Date: 31.JUL.2022 18:35:31

n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_8.49GHz

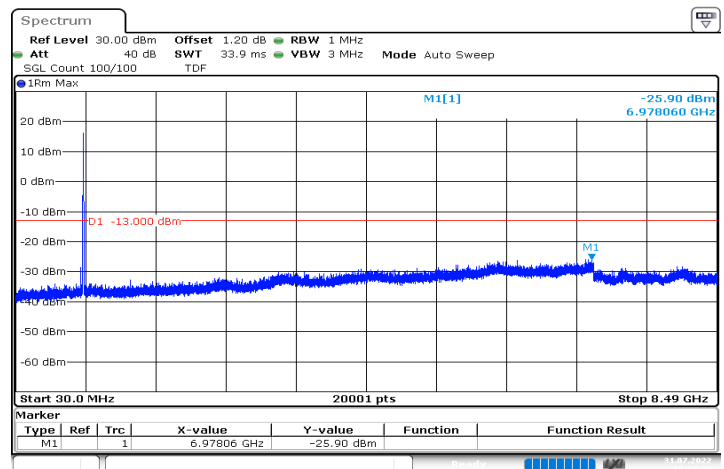
Date: 31.JUL.2022 18:35:51

n5_10MHz_15kHz_844MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

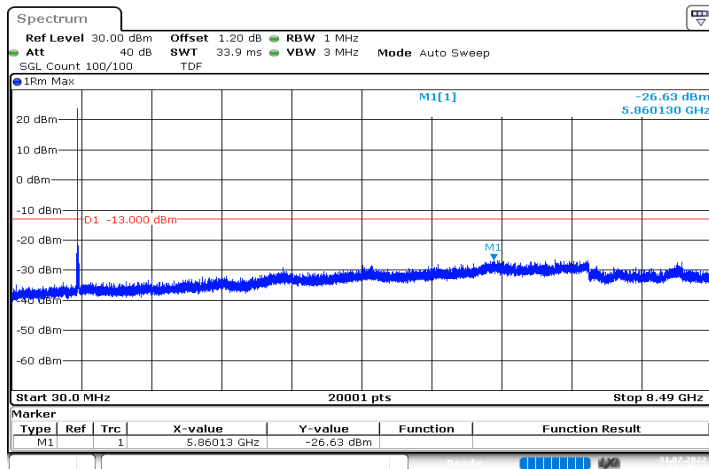
Date: 31.JUL.2022 18:36:52

n5_10MHz_15kHz_844MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_8.49GHz

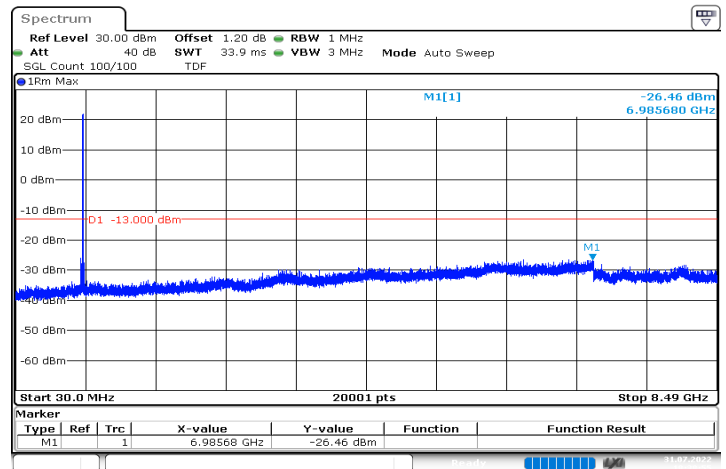
Date: 31.JUL.2022 18:37:12

n5_10MHz_15kHz_844MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_8.49GHz

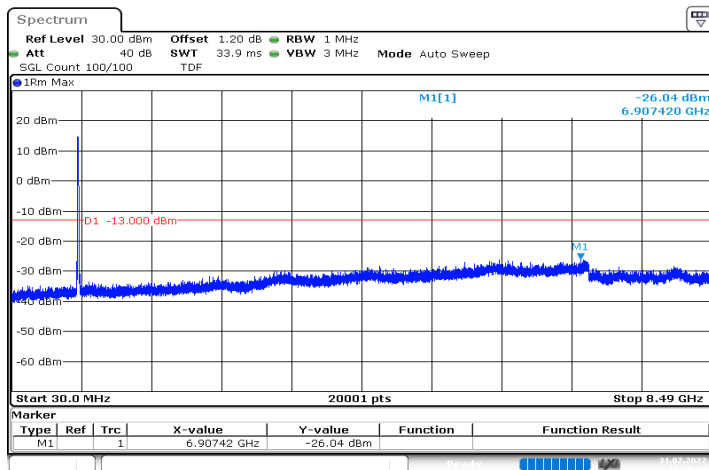
Date: 31.JUL.2022 18:37:32

n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

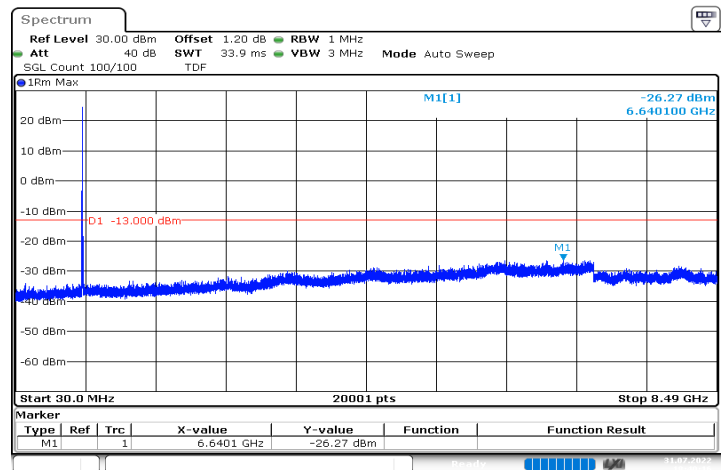
Date: 31.JUL.2022 18:38:34

n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_8.49GHz

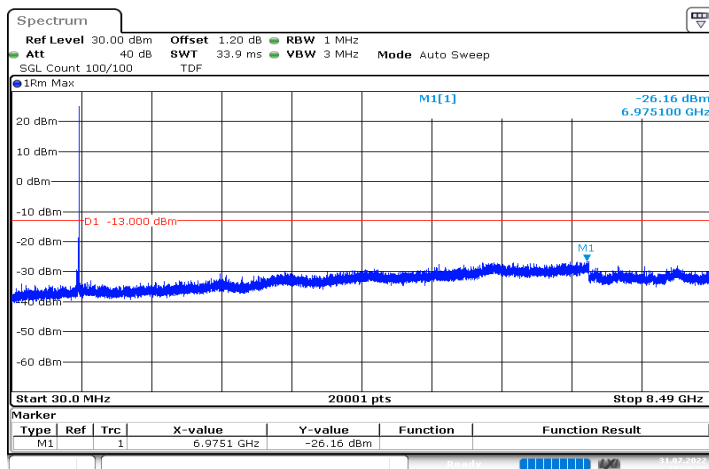
Date: 31.JUL.2022 18:38:55

n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_8.49GHz

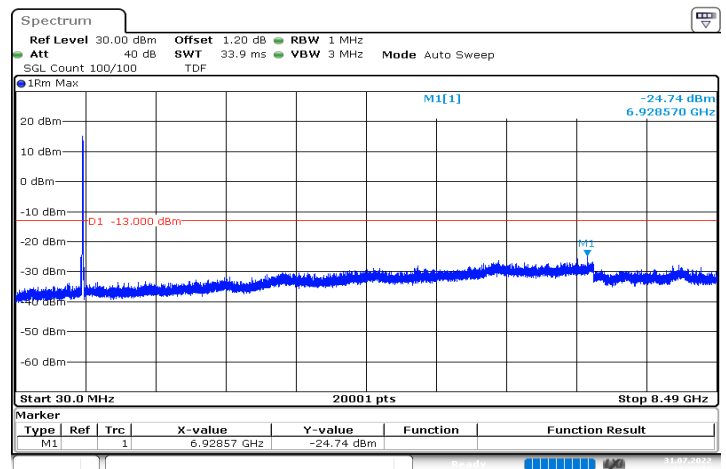
Date: 31.JUL.2022 18:39:15

n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

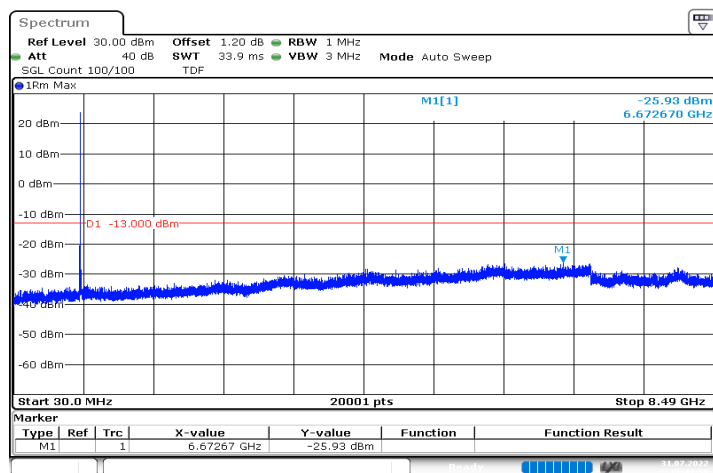
Date: 31.JUL.2022 18:40:17

n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_8.49GHz

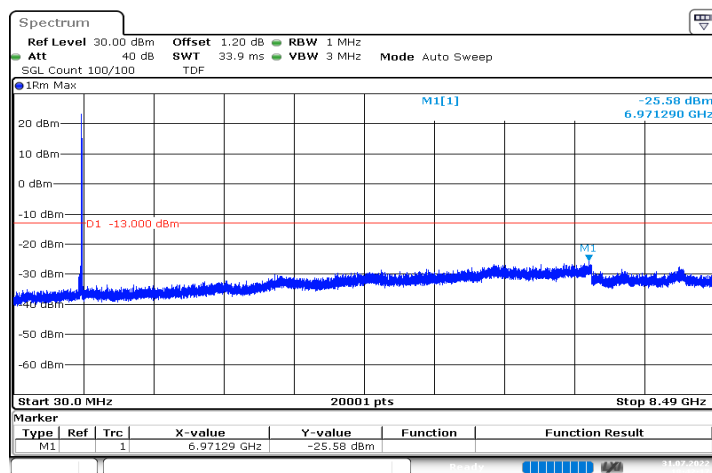
Date: 31.JUL.2022 18:40:37

n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_8.49GHz

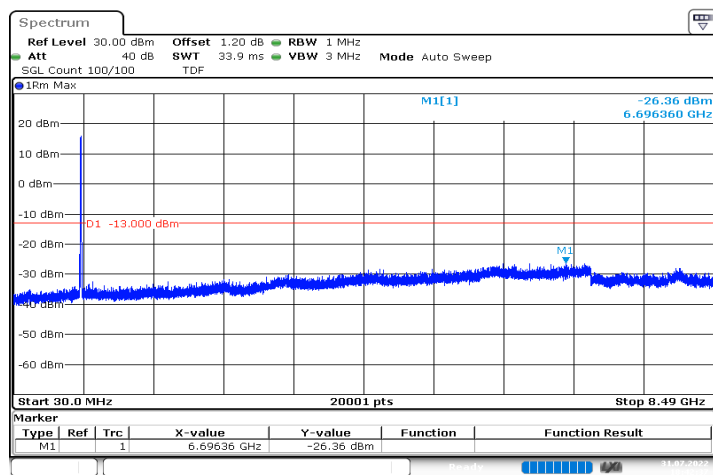
Date: 31.JUL.2022 18:40:56

n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

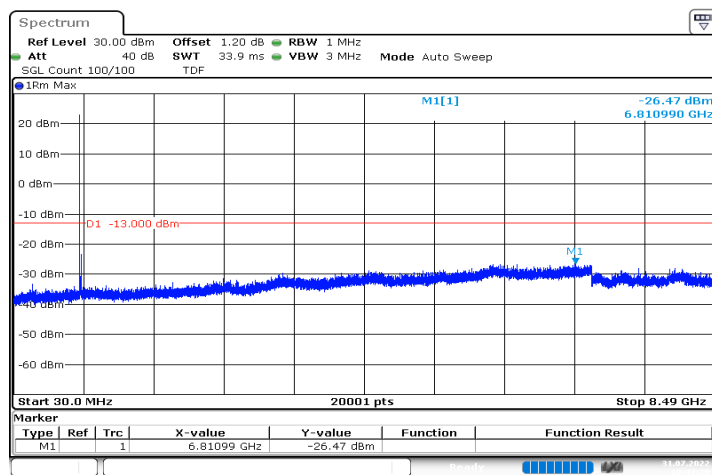
Date: 31.JUL.2022 18:41:58

n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_8.49GHz

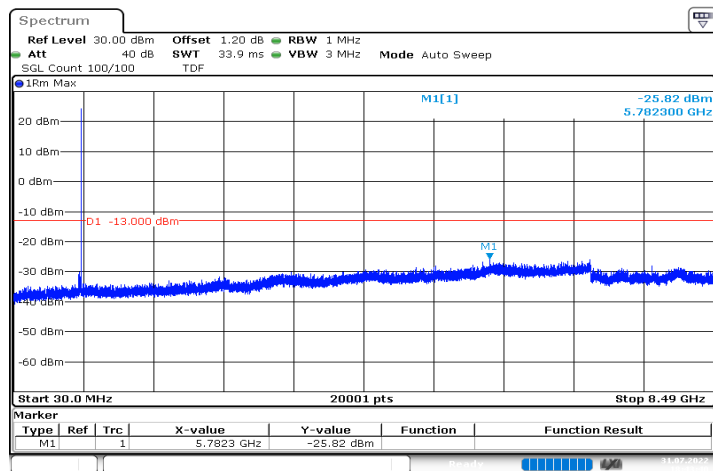
Date: 31.JUL.2022 18:42:18

n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_8.49GHz

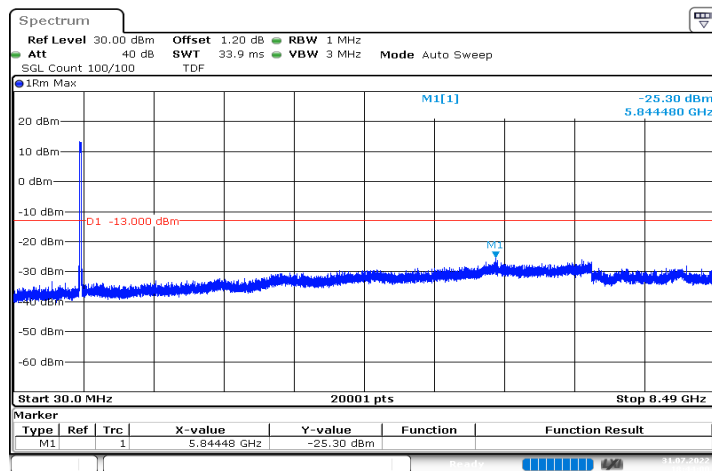
Date: 31.JUL.2022 18:42:38

n5_20MHz_15kHz_834MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

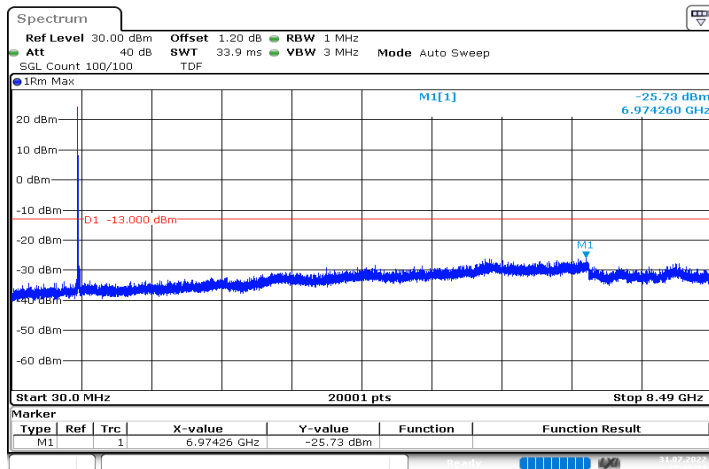
Date: 31.JUL.2022 18:43:20

n5_20MHz_15kHz_834MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_8.49GHz

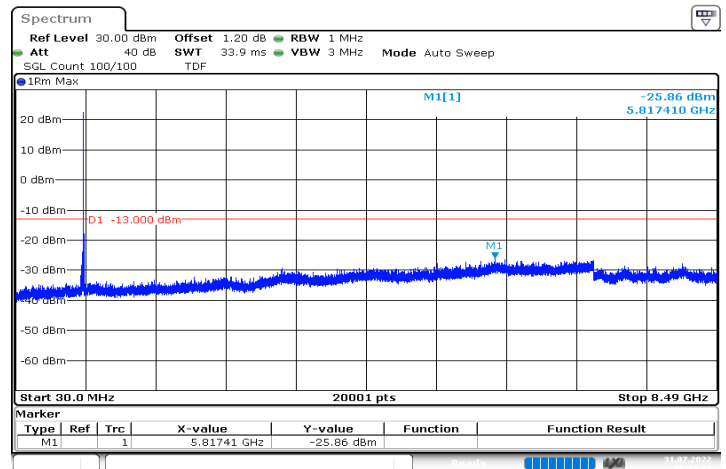
Date: 31.JUL.2022 18:43:40

n5_20MHz_15kHz_834MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_8.49GHz

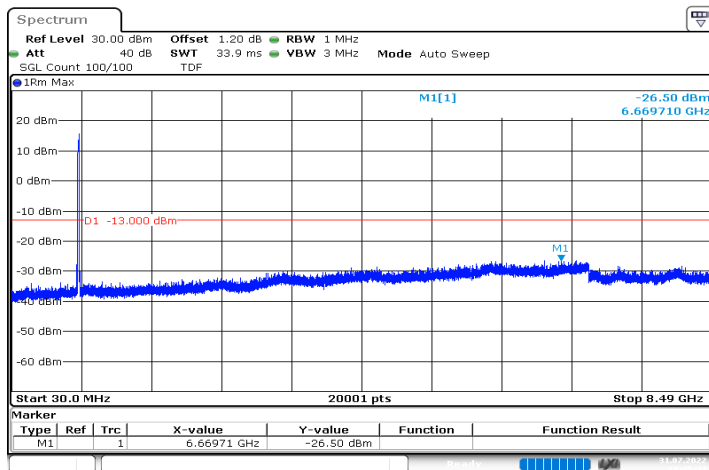
Date: 31.JUL.2022 18:44:00

n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

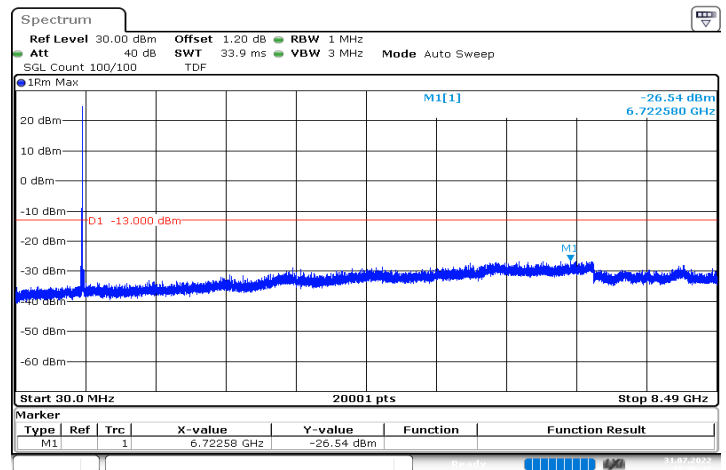
Date: 31.JUL.2022 18:45:01

n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_8.49GHz

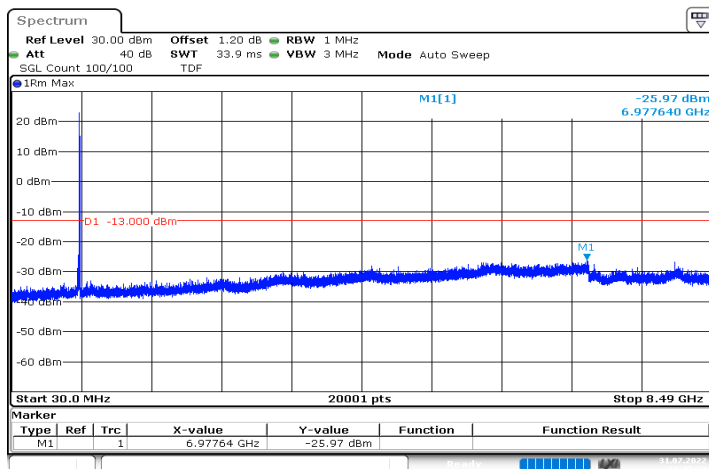
Date: 31.JUL.2022 18:45:21

n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_8.49GHz

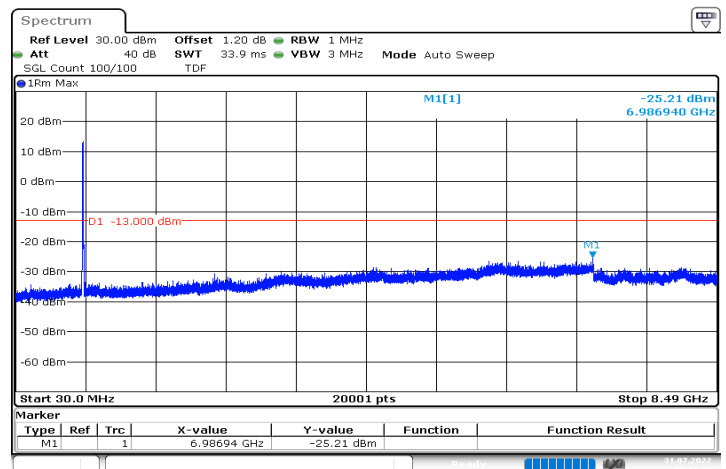
Date: 31.JUL.2022 18:45:41

n5_20MHz_15kHz_839MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

Date: 31.JUL.2022 18:46:42

n5_20MHz_15kHz_839MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_8.49GHz

Date: 31.JUL.2022 18:47:04

n5_20MHz_15kHz_839MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_8.49GHz

Date: 31.JUL.2022 18:47:24