LABORATORY TEST REPORT

RADIO PERFORMANCE MEASUREMENTS

for the

TMBHKB Mobile Transceiver

Tested in accordance with:

FCC 47 CFR Parts 22 and 90

RSS-119 Issue 12 RSS-Gen Issue 5

Report Revision:

1

Issue Date:

5 June 2018

PREPARED BY:

L. M. White

Test Technician

CHECKED & APPROVED BY:

M. C. James

Laboratory Technical Manager



FCC REGISTRATION:

838288

IC LISTING REGISTRATION:

SITE# 737A-1

All tests reported herein have been performed in accordance with the laboratory's scope of accreditation.

This document must not be reproduced except in full, without the written permission of the Compliance Laboratory Manager

TELTEST Laboratories (A Division of Tait Communications) PO Box 1645, 558 Wairakei Road, Christchurch, New Zealand.

FCC ID: CASTMBHKB

IC: 737A-TMBHKB

Page 1 of 96

Telephone: 64 3 358 3399 FAX: 64 3 359 4632 Report Revision: 1

Issue Date: 5 June 2018

TABLE OF CONTENTS

REVISION	3
INTRODUCTION	4
STATEMENT OF COMPLIANCE	5
MODULATION TYPES, NECESSARY BANDWIDTH & EMISSION DESIGNAT	ORS 6
TEST RESULTS	8
TRANSMITTER OUTPUT POWER (CONDUCTED)	8
TRANSMITTER AUDIO FREQUENCY RESPONSE - PRE-EMPHASIS	10
TRANSMITTER MODULATION LIMITING	
TRANSMITTER OCCUPIED BANDWIDTH AND SPECTRUM MASKS	18
TRANSMITTER SPURIOUS EMISSIONS (CONDUCTED)	55
TRANSMITTER SPURIOUS EMISSIONS (RADIATED)	71
TRANSIENT FREQUENCY BEHAVIOR	76
TRANSMITTER FREQUENCY STABILITY - TEMPERATURE	89
TRANSMITTER FREQUENCY STABILITY - VOLTAGE	
RECEIVER SPURIOUS EMISSIONS (CONDUCTED)	92
TEST EQUIPMENT LIST	94
ANNEX A – TEST SETUP DETAILS	96

REVISION

Date	Revision	Comments
5 June 2018	1	Initial test report

INTRODUCTION

Type approval testing of the TMBHKB, 40 Watt, Mobile transceiver in order to demonstrate compliance with FCC 47 Parts 22 & 90, and RSS-119 Issue 12 & RSS-Gen Issue 5. This radio supports analogue, digital FFSK, Digital Mobile Radio (DMR), APCO P25 phase-1 and APCO P25 phase-2 modulations.

REPORT PREPARED FOR

Tait Ltd 245 Wooldridge Road Harewood Christchurch 8051 New Zealand

DESCRIPTION OF SAMPLE

Manufacturer Tait Limited
Equipment: Mobile Transceiver

Type: TMBHKB

Product Code: T02-00012-RBAA

Serial Number(s): 20554861 Frequency range 378 → 470 MHz

Transmit Power 40 W

Modulation		Channel Spacing	Speech Channels	Symbol Rate (symbols/sec)	Data Rate (bps)
Analogue FM		12.5 kHz	1	-	-
FFSK	Fast Frequency Shift Keying	12.5 kHz	-	1200	1200
		12.5 kHz	-	2400	2400
Digital Mobile Radio (DMR)	4 Level FSK (2 slot TDMA) (ETSI TS102 361-1)	12.5 kHz	2	4800	9600
APCO P25 Phase 1	C4FM (TIA 102)	12.5 kHz	1	4800	9600
APCO P25 Phase 2	H-CPM (2 slot TDMA) (TIA 102)	12.5 kHz	2	6000	12000

HARDWARE & SOFTWARE Quantity: 1

	Analogue, FFSK and DMR tests	P25 tests	
Hardware ID	TMBB24-HK00_0002	TMBB24-HK00_0002	
Boot Code	QMB2B_S00_3.04.01.0003	QMB2B_S00_3.04.01.0003	
DSP	QMB2A_E00_2.18.02.0041	QMB2A_A02_2.12.07.0045	
Radio Application	QMB2F_E00_2.18.02.0041	QMB2F_A00_2.12.07.0045	
Firmware Package	QI93M_E00_2.18.02.0041	QI94M_A02_2.12.07.0045	
FPGA Image	QMB2G_S00_1.12.04.0001	QMB2G_S00_1.12.04.0001	

TEST CONDITIONS

All testing was performed between $8 \rightarrow 16$ May 2018, and under the following conditions:

Ambient temperature: $15^{\circ}\text{C} \rightarrow 30^{\circ}\text{C}$ Relative Humidity: $20\% \rightarrow 75\%$ Standard Test Voltage 13.8 V_{DC}

FCC ID: CASTMBHKB Page 4 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

STATEMENT OF COMPLIANCE

We, TELTEST LABORATORIES of 558 Wairakei Road, Christchurch, New Zealand, declare under our sole responsibility that the product:

Equipment:

Mobile Transceiver

Type:

TMBHKB

Product Code:

T02-00012-RBAA

Serial Number(s):

20554861

Quantity:

1

to which this declaration relates, is in conformity with the following standards:

FCC 47 CFR Parts 22 and 90

RSS-119 Issue 12 & RSS-Gen Issue 5

Signature:

M. C. James

Laboratory Technical Manager

Date:

5 July 2018

FCC ID: CASTMBHKB IC: 737A-TMBHKB

Page 5 of 96

Report Revision: 1 Issue Date: 5 June 2018

MODULATION TYPES, NECESSARY BANDWIDTH & EMISSION DESIGNATORS

MODULATION TYPES:

F3E Analogue Frequency Modulation (FM)

F2D FFSK 1200 bps and 2400 bps

FXW DMR Digital Voice 9600 bps FXD DMR Digital Data 9600 bps F1E, F7E P25 phase 1 Digital Voice 9600 bps F1D, F7D P25 phase 1 Digital Data 9600 bps F1W P25 phase 2 Digital Voice / Data 12000 bps

CHANNEL SPACING: 12.5 kHz

EMISSION DESIGNATORS:

	12.5 kHz
Analog FM	11K0F3E
FFSK Data 1200 bps	6K60F2D
FFSK Data 2400 bps	7K80F2D
Digital Voice DMR	7K60FXW
Digital Data DMR	7K60FXD
Digital Voice P25 phase 1	8K10F1E
Digital Data P25 phase 1	8K10F1D
Digital Voice P25 phase 2	8K10F1W
Digital Data P25 phase 2	8K10F1W

CALCULATIONS

Equation: Bn = 2M + 2Dk

(M is highest modulating frequency; D is peak allowable deviation; k is a constant of 1 for FM)

Analogue Voice 12.5 kHz Bandwidth

Necessary bandwidth Emission Designator

M = 3.0 kHz 11K0F3E

D = 2.5 kHz F3E represents an FM voice transmission

Bn = $(2x3.0) + (2x2.5) \times 1$ = 11.0 kHz

Fast Frequency Shift Keying (FFSK – 1200 bps) 12.5 kHz Bandwidth

Necessary bandwidth Emission Designator

M = 1.8 kHz **6K60F2D**

D = 1.5 kHz (60% of peak deviation) F2D represents a FM data transmission with

Bn = $(2 \times 1.8) + (2 \times 1.5) \times 1$ the use of a modulating sub carrier

= 6.6 kHz

Fast Frequency Shift Keying (FFSK – 2400 bps) 12.5 kHz Bandwidth

Necessary bandwidth Emission Designator

M = 2.4 kHz **7K80F2D**

D = 1.5 kHz (60% of peak deviation) F2D represents a FM data transmission with

 $Bn = (2 \times 2.4) + (2 \times 1.5) \times 1$ the use of a modulating sub carrier

= 7.8 kHz

FCC ID: CASTMBHKB Page 6 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Emission Designators - Continued

Digital Voice 12.5 kHz Bandwidth DMR

99% bandwidth Emission Designator

= 7.6 kHz **7K60FXW**

FXW represents a FM Time Division Multiple Access (TDMA) combination of data and telephony

Digital Data 12.5 kHz Bandwidth DMR

99% bandwidth Emission Designator

= 7.6 kHz **7K60FXD**

FXD represents FM Time Division Multiple Access (TDMA) data only

Digital Voice 12.5 kHz Bandwidth P25 phase 1

99% bandwidth Emission Designator

= 8.1 kHz **8K10F1E**

F1E represents a digital FM voice transmission

Digital Data 12.5 kHz Bandwidth P25 phase 1

99% bandwidth Emission Designator

= 8.1 kHz **8K10F1D**

F1D represents an digital FM data transmission

Digital Voice 12.5 kHz Bandwidth P25 phase 2

99% bandwidth Emission Designator

= 8.1 kHz **8K10F1W**

F1W represents a single FM telephony channel

Digital Data 12.5 kHz Bandwidth P25 phase 2

99% bandwidth Emission Designator

= 8.1 kHz **8K10F1W**

F1W represents digital FM data transmission

FCC ID: CASTMBHKB Page 7 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

TEST RESULTS

TRANSMITTER OUTPUT POWER (CONDUCTED)

SPECIFICATION: FCC 47 CFR 2.1046

RSS-119 5.4

GUIDE: TIA/EIA-603D 2.2.1

MEASUREMENT PROCEDURE:

1. Refer Annex A for Equipment set up.

2. The coaxial attenuator has an impedance of 50 Ohms.

3. The unmodulated output power was measured with an RF Power meter.

MEASUREMENT RESULTS:

Manufacturer's Rated Output Power:

Nominal 40 W	Measured	Variation (%)	Variation (dB)	
406.2 MHz	42.4	6.0	0.3	
418.05 MHz	42.6	6.4	0.3	
429.9 MHz	40.6	1.4	0.1	
450.1 MHz	39.6	-0.9	0.0	
459.9 MHz	43.0	7.5	0.3	
469.9 MHz	41.2	2.9	0.1	
Measurement Uncertainty		± 0.6 dB		

Switchable: 40 W and 10 W

FCC ID: CASTMBHKB Page 8 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Transmitter Output Power (Conducted) - continued

Nominal 10 W	Measured	Variation (%)	Variation (dB)	
406.2 MHz	11.0	9.9	0.4	
418.05 MHz	10.8	8.0	0.3	
429.9 MHz	10.4	4.4	0.2	
450.1 MHz	10.2	2.0	0.1	
459.9 MHz	10.5	4.8	0.2	
469.9 MHz	10.5	5.0	0.2	
Measurement Uncertainty		± 0.6 dB		

LIMIT CLAUSES:

FCC 47 CFR 90.205 (s)

The output power shall not exceed by more than 20%... the manufacturer's rated output power for the particular transmitter specifically listed on the authorization.

RSS-119 5.4

The output power shall be within ±1.0 dB of the manufacturer's rated power.

FCC ID: CASTMBHKB Page 9 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

TRANSMITTER AUDIO FREQUENCY RESPONSE - PRE-EMPHASIS

SPECIFICATION: FCC 47 CFR 2.1047 (a)

GUIDE: TIA/EIA-603D 2.2.6

MEASUREMENT PROCEDURE:

- 1. Refer Annex A for Equipment set up.
- 2. An audio input tone of 1000 Hz was applied with the level set to obtain 20% of maximum deviation. This was used as the 0 dB reference point.
- 3. The AF was varied while the audio level was held constant.
- 4. The response in dB relative to 1000 Hz was measured.

MEASUREMENT RESULTS:

See the plots on the following pages for 12.5 kHz channel spacing tested at 40 W transmit power.

LIMIT CLAUSE: TIA/EIA-603D 3.2.6


MEASUREMENT UNCERTAINTY: ± 1.5 %

FCC ID: CASTMBHKB Page 10 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Transmitter Audio Frequency Response – Pre-emphasis


SPECIFICATION: FCC CFR 2.1047 (a)

Tx FREQUENCY: 406.2 MHz 12.5 kHz Channel Spacing

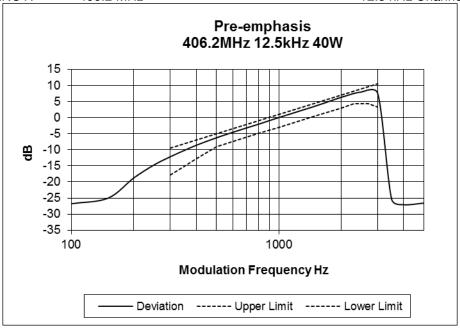

SPECIFICATION: FCC CFR 2.1047 (a)


Tx FREQUENCY: 418.05 MHz 12.5 kHz Channel Spacing

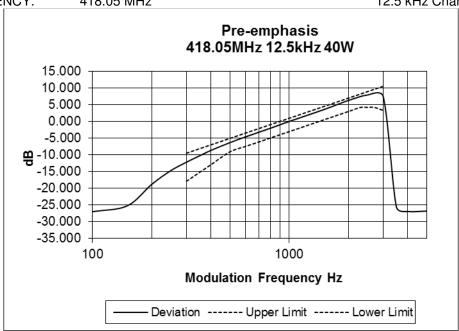

Transmitter Audio Frequency Response – Pre-emphasis


SPECIFICATION: FCC CFR 2.1047 (a)

Tx FREQUENCY: 429.9 MHz 12.5 kHz Channel Spacing

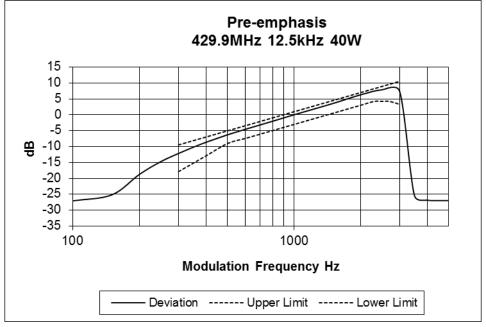

SPECIFICATION: FCC CFR 2.1047 (a)


Tx FREQUENCY: 450.1 MHz 12.5 kHz Channel Spacing

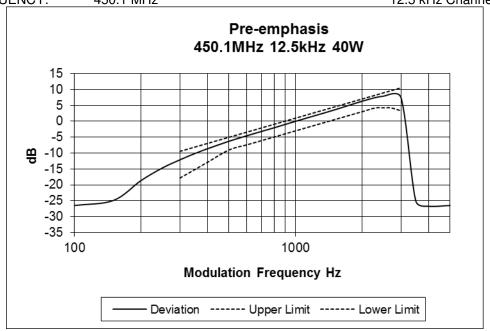

Transmitter Audio Frequency Response – Pre-emphasis


SPECIFICATION: FCC CFR 2.1047 (a)

Tx FREQUENCY: 459.9 MHz 12.5 kHz Channel Spacing

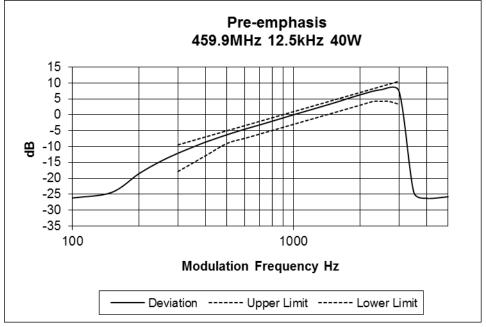

SPECIFICATION: FCC CFR 2.1047 (a)

Tx FREQUENCY: 469.9 MHz 12.5 kHz Channel Spacing

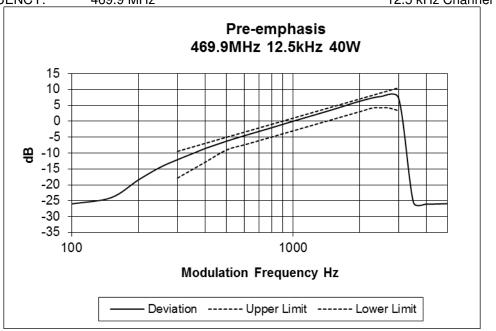

TRANSMITTER MODULATION LIMITING

SPECIFICATION: FCC 47 CFR 2.1047 (b)

GUIDE: TIA/EIA-603D 2.2.3

MEASUREMENT PROCEDURE:

1. Refer Annex A for Equipment set up.

- 2. The modulation response was measured at three audio frequencies while varying the input level.
- 3. Measurements were made for both Positive and Negative Deviation.

MEASUREMENT RESULTS:

See the plots on the following pages for 12.5 kHz channel spacing.

LIMIT CLAUSE: TIA/EIA-603D 1.3.4.4


MEASUREMENT UNCERTAINTY: ± 1.5 %

FCC ID: CASTMBHKB Page 14 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Transmitter Modulation Limiting


SPECIFICATION: FCC CFR 2.1047 (b)

Tx FREQUENCY: 406.2 MHz 12.5 kHz Channel Spacing

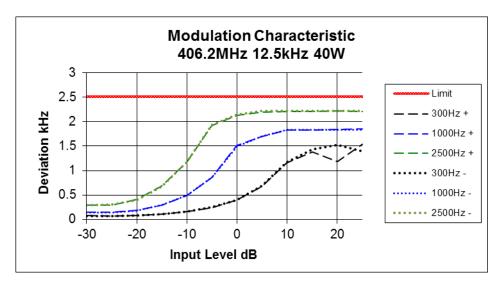

SPECIFICATION: FCC CFR 2.1047 (b)


Tx FREQUENCY: 418.05 MHz 12.5 kHz Channel Spacing

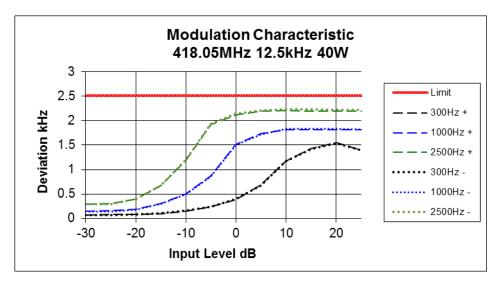

Transmitter Modulation Limiting


SPECIFICATION: FCC CFR 2.1047 (b)

Tx FREQUENCY: 429.9 MHz 12.5 kHz Channel Spacing

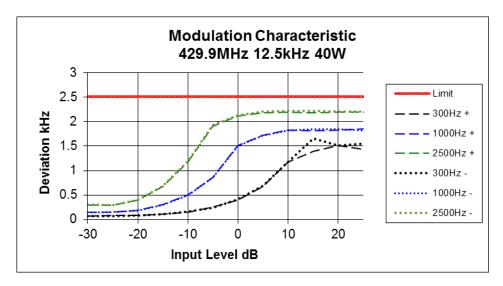

SPECIFICATION: FCC CFR 2.1047 (b)


Tx FREQUENCY: 450.1 MHz 12.5 kHz Channel Spacing

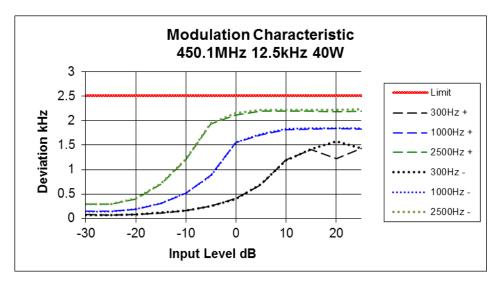

Transmitter Modulation Limiting


SPECIFICATION: FCC CFR 2.1047 (b)

Tx FREQUENCY: 459.9 MHz 12.5 kHz Channel Spacing

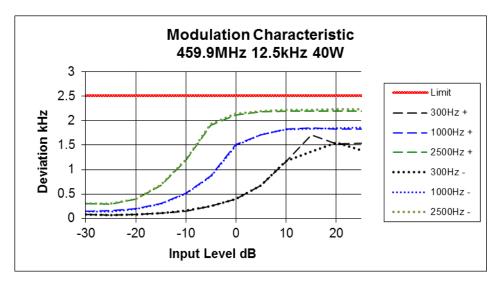

SPECIFICATION: FCC CFR 2.1047 (b)

Tx FREQUENCY: 469.9 MHz 12.5 kHz Channel Spacing

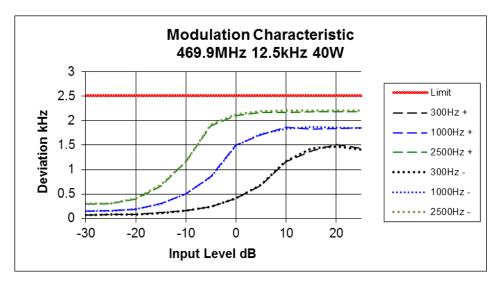

TRANSMITTER OCCUPIED BANDWIDTH AND SPECTRUM MASKS

SPECIFICATION: FCC 47 CFR 2.1049 (c) RSS-119 5.5

GUIDE: TIA/EIA-603D 2.2.11 (Analog)

TIA-102.CAAA-C 2.2.5 (Digital)

MEASUREMENT PROCEDURE:

1. Refer Annex A for Equipment Set up.

- 2. For analog measurements: The EUT was modulated by a 2500 Hz tone at an input level 16 dB above a level that produced 50% deviation. The input level was established at the frequency of maximum response of the audio modulating circuit.
 - For Data measurements: The EUT was modulated with an internally generated pseudo random bit sequence at the appropriate Baud rates.
- 3. The Occupied Bandwidth was measured on the Spectrum Analyser, with bandwidth settings as follows.

Emission Mask D – Resolution Bandwidth = 100 Hz, Video Bandwidth = 1 kHz

MEASUREMENT RESULTS:

See the plots on the following pages for 12.5 kHz channel spacing.

MEASUREMENT UNCERTAINTY 95% ±0.65dB

LIMIT CLAUSE: FCC 47 CFR 90.210 RSS-119 5.5

EMISSION MASKS

Emission Mask D 12.5 kHz Channel Spacing Analog, FFSK, Digital Voice/data

DATA SPEED


Digital Voice/Data 12.5 kHz Channel Spacing 9600 bps & 12000 bps FFSK 12.5 kHz Channel Spacing 1200 bps & 2400 bps

FCC ID: CASTMBHKB Page 18 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

ANALOG VOICE

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

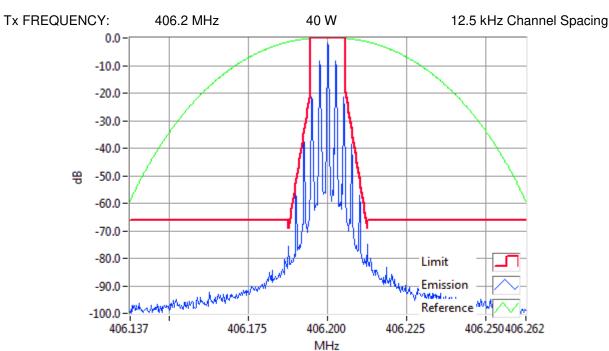

Analogue Modulation 406.2000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

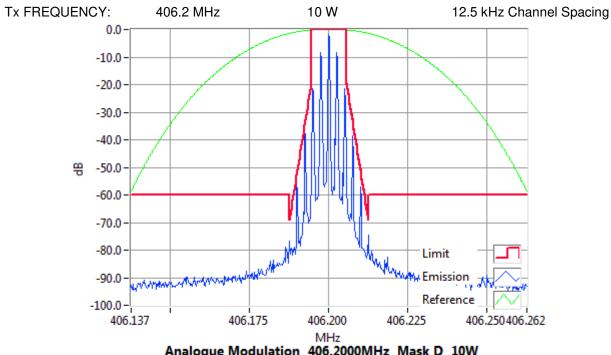


Analogue Modulation 406.2000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass


Occupied Bandwidth and Spectrum Masks

ANALOG VOICE

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

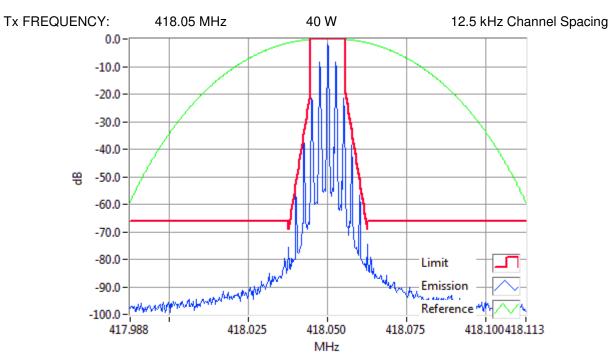

Analogue Modulation 418.0500MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

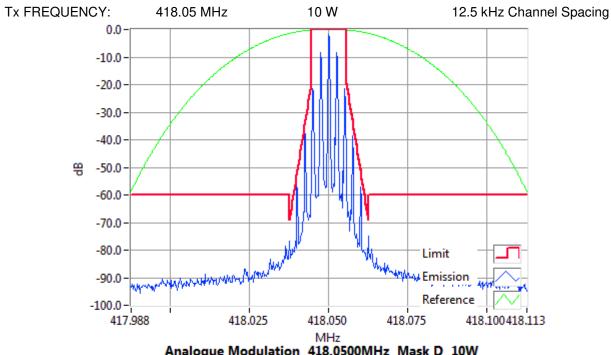


Analogue Modulation 418.0500MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 20 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

ANALOG VOICE

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

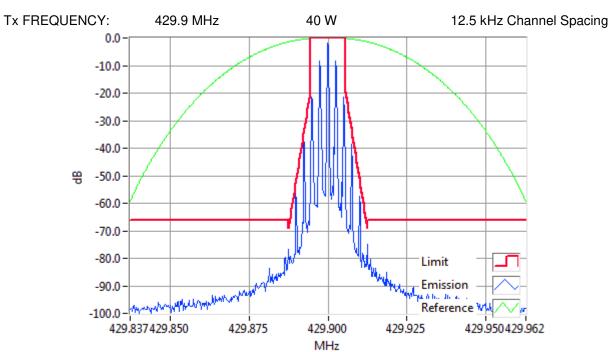

Analogue Modulation 429.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

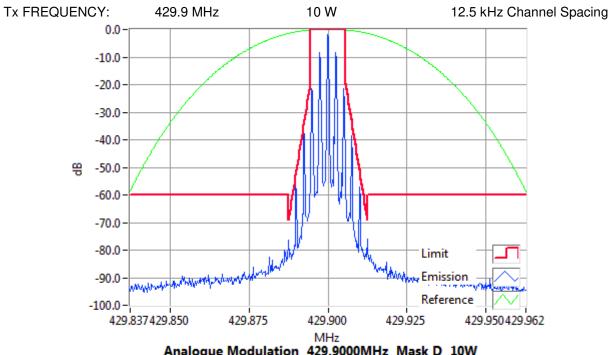


Analogue Modulation 429.9000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

Occupied Bandwidth and Spectrum Masks


ANALOG VOICE

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

Tx FREQUENCY: 450.1 MHz 40 W 12.5 kHz Channel S

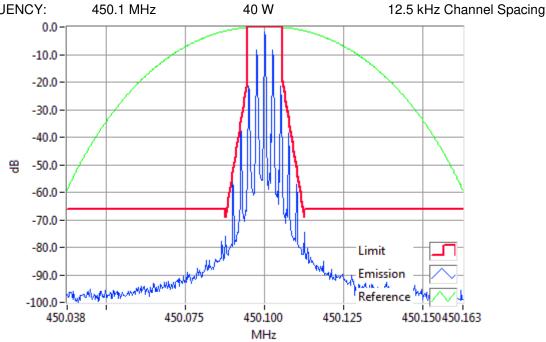

Analogue Modulation 450.1000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

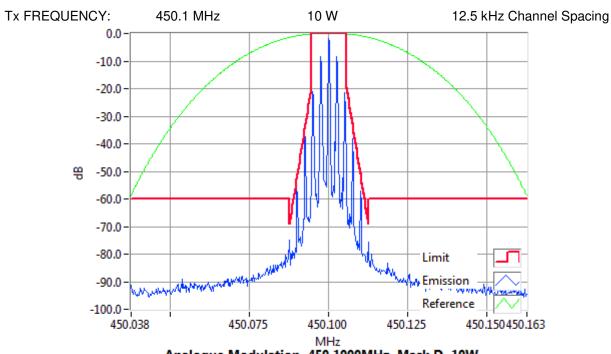


Analogue Modulation 450.1000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass


Occupied Bandwidth and Spectrum Masks

ANALOG VOICE

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

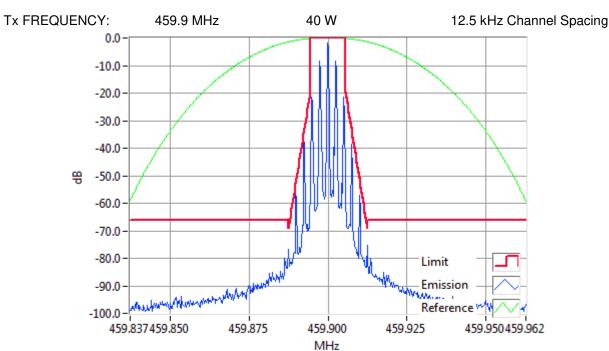

Analogue Modulation 459.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

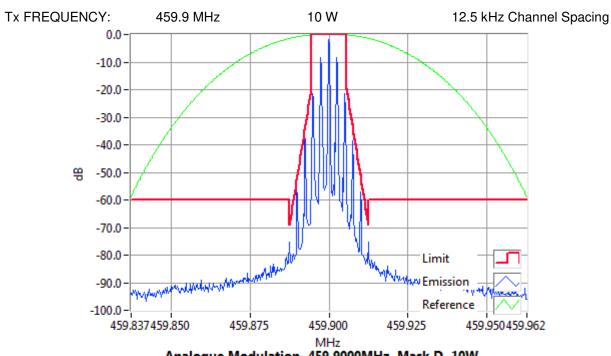


Analogue Modulation 459.9000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 23 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

ANALOG VOICE

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

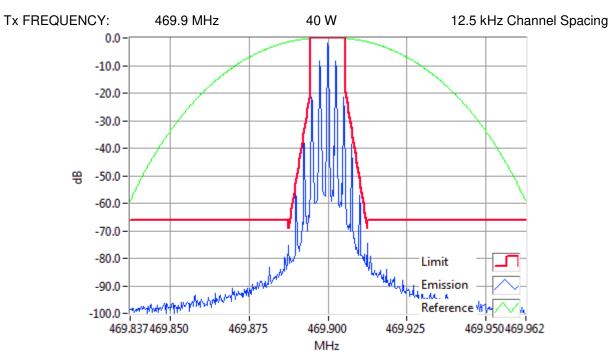

Analogue Modulation 469.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

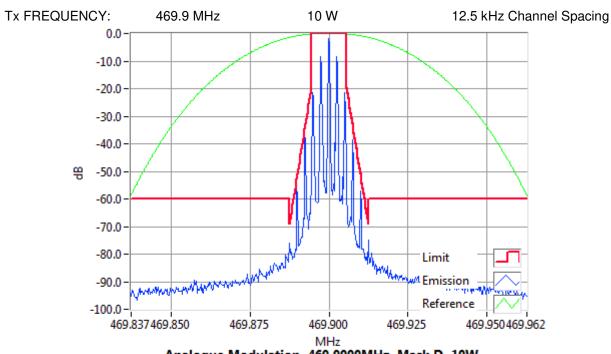


Analogue Modulation 469.9000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass


Occupied Bandwidth and Spectrum Masks

FFSK 1200 bps

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

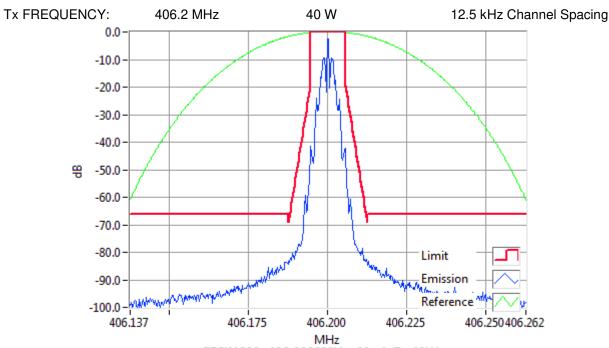

FFSK1200 406.2000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

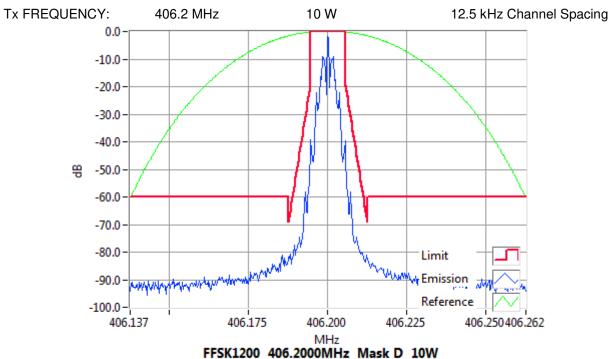


FFSK1200 406.2000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 25 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

FFSK 1200 bps

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

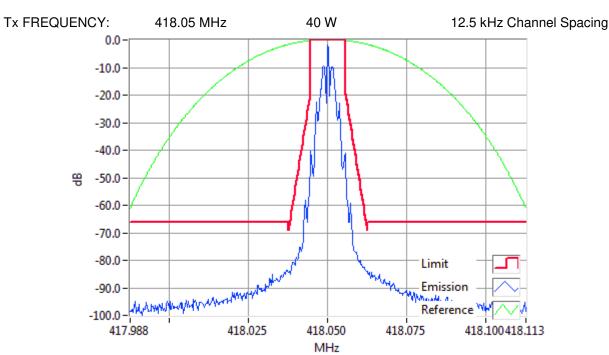

FFSK1200 418.0500MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

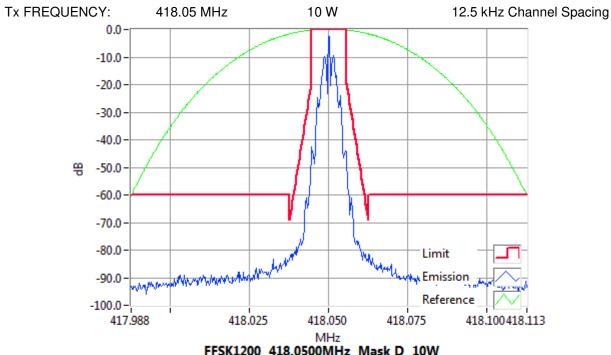


FFSK1200 418.0500MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 26 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

FFSK 1200 bps

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

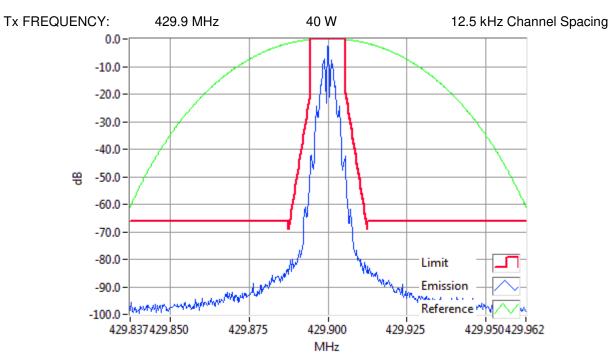

FFSK1200 429.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

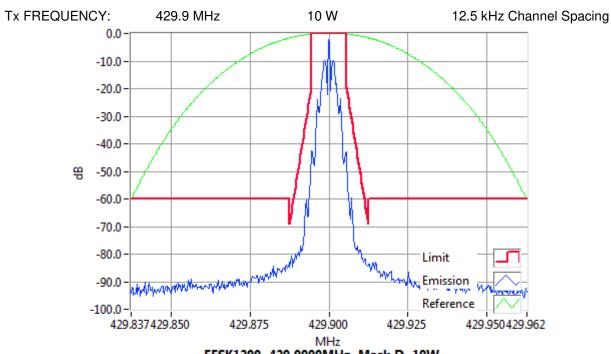


FFSK1200 429.9000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 27 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

FFSK 1200 bps

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

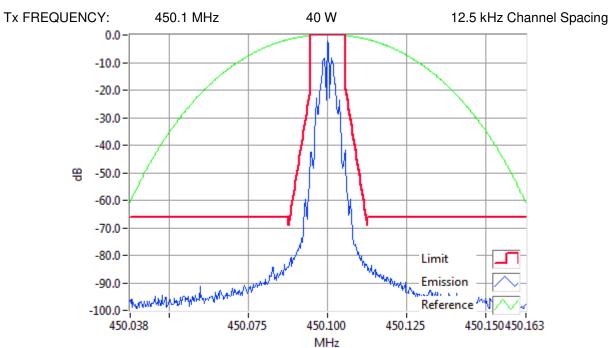

FFSK1200 450.1000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

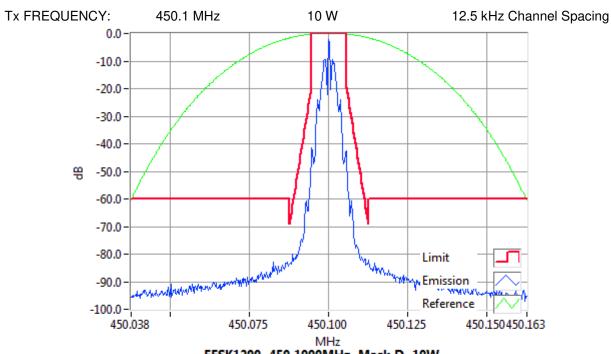


FFSK1200 450.1000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 28 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

FFSK 1200 bps

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

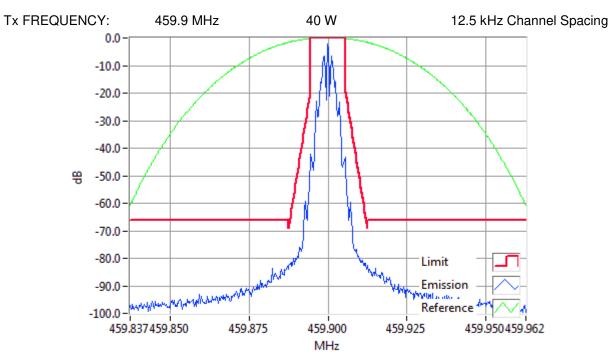

FFSK1200 459.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

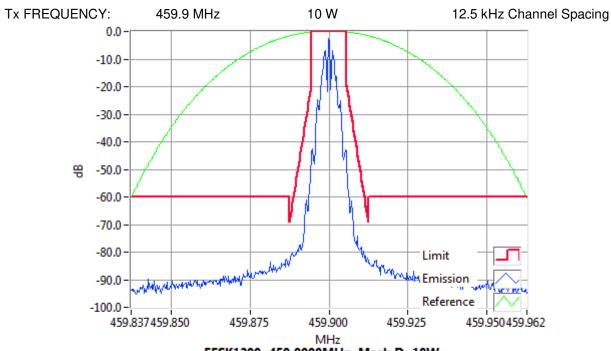


FFSK1200 459.9000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 29 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

FFSK 1200 bps

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

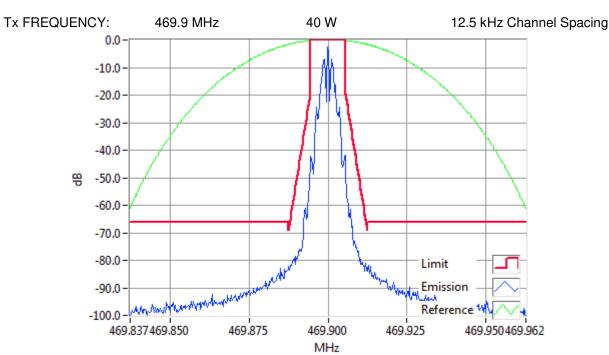

FFSK1200 469.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

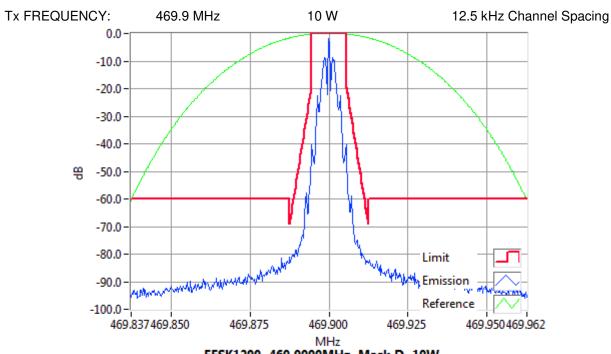


FFSK1200 469.9000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 30 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

FFSK 2400 bps

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

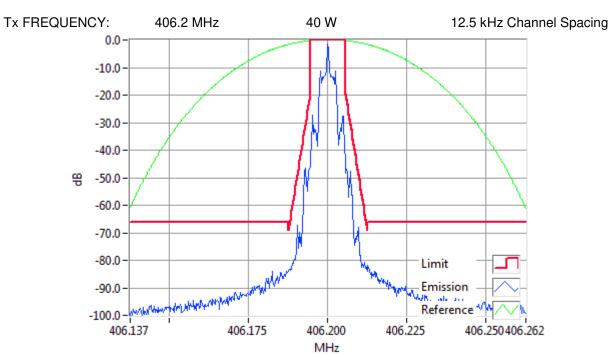

FFSK2400 406.2000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

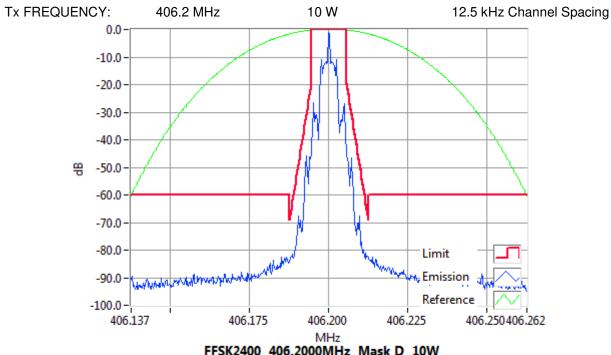


FFSK2400 406.2000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 31 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

FFSK 2400 bps

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

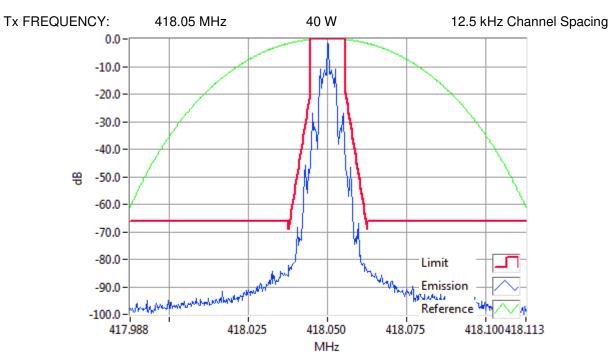

FFSK2400 418.0500MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

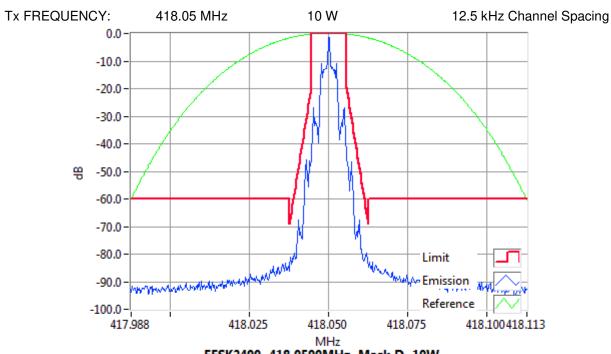


FFSK2400 418.0500MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 32 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

FFSK 2400 bps

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

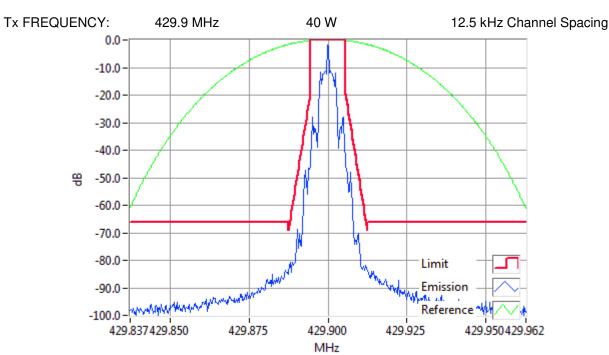

FFSK2400 429.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

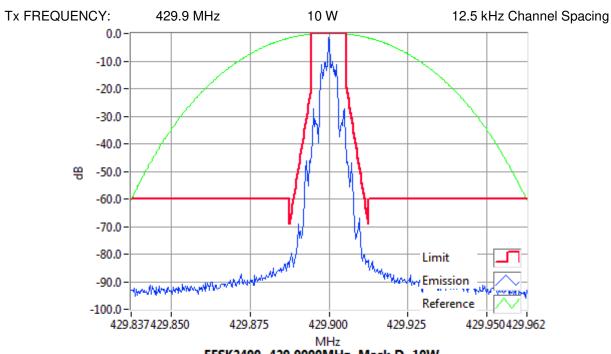


FFSK2400 429.9000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 33 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

FFSK 2400 bps

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

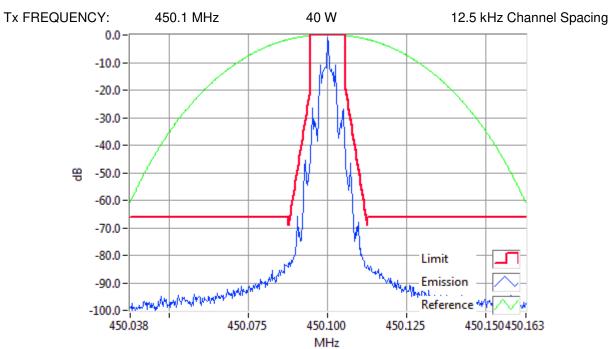

FFSK2400 450.1000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

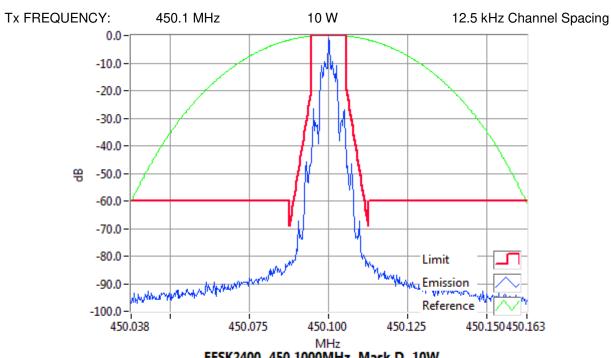

FFSK2400 450.1000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass


FCC ID: CASTMBHKB Page 34 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Occupied Bandwidth and Spectrum Masks


FFSK 2400 bps

IC: 737A-TMBHKB

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

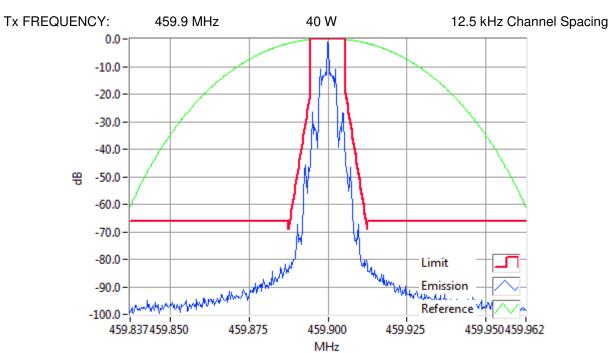

FFSK2400 459.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

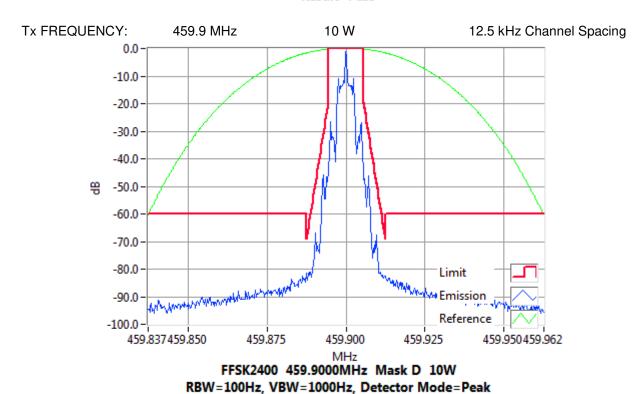

FCC ID: CASTMBHKB Page 35 of 96 Report Revision: 1


Issue Date: 5 June 2018

Result=Pass


Occupied Bandwidth and Spectrum Masks

FFSK 2400 bps

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

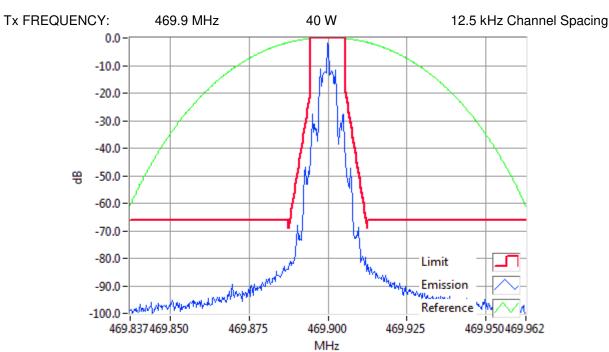

FFSK2400 469.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

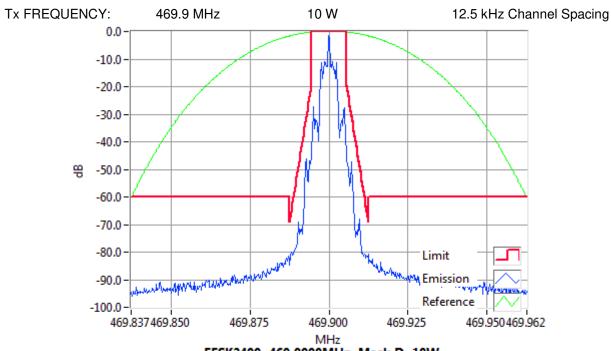


FFSK2400 469.9000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass


FCC ID: CASTMBHKB Page 36 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Occupied Bandwidth and Spectrum Masks

DMR

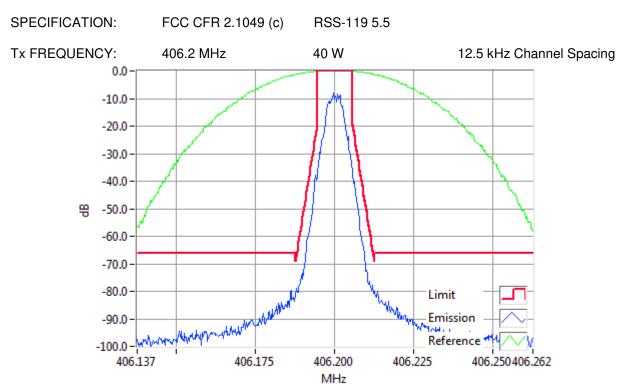


DMR 406.2000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

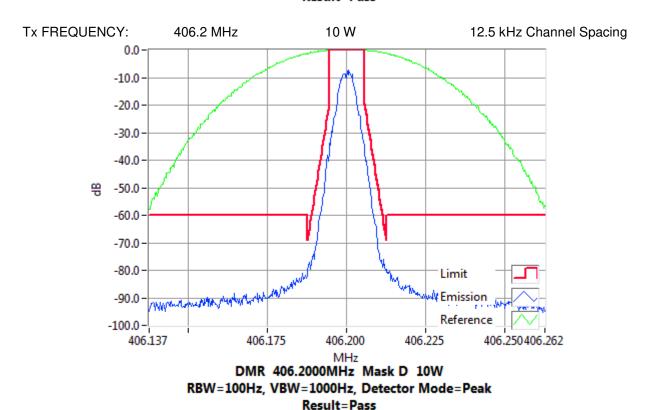


FCC ID: CASTMBHKB Page 37 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Occupied Bandwidth and Spectrum Masks

DMR

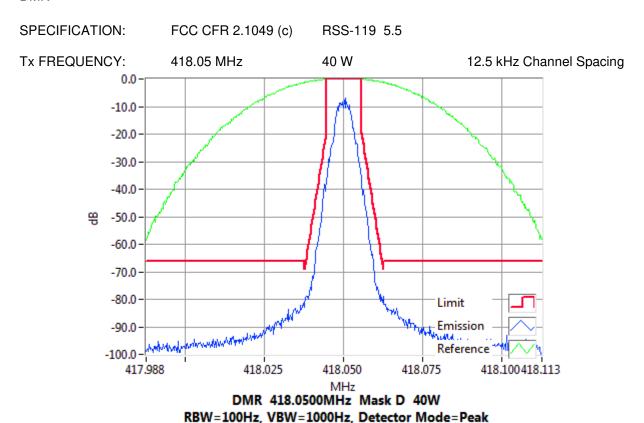

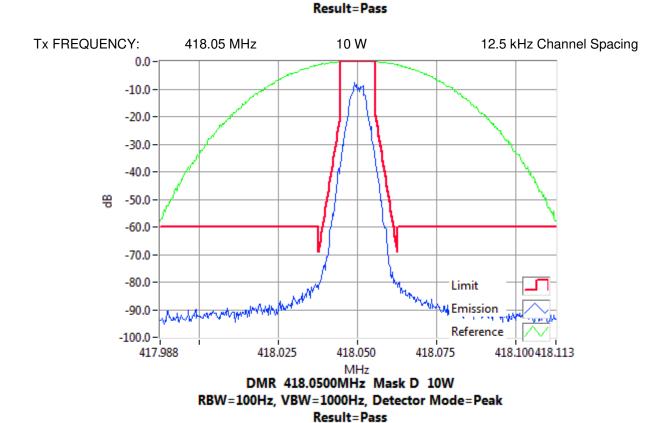

FCC ID: CASTMBHKB Page 38 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

DMR

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5 429.9 MHz 40 W Tx FREQUENCY: 12.5 kHz Channel Spacing 0.0 - 0.0-10.0 -20.0 -30.0 -40.0 吳 -50.0 -60.0 -70.0 -80.0 Limit Emission -90.0 Reference -100.0 - NY/N 429.837429.850 429,900 429,925 429.950429.962 429.875

DMR 429.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

MHz

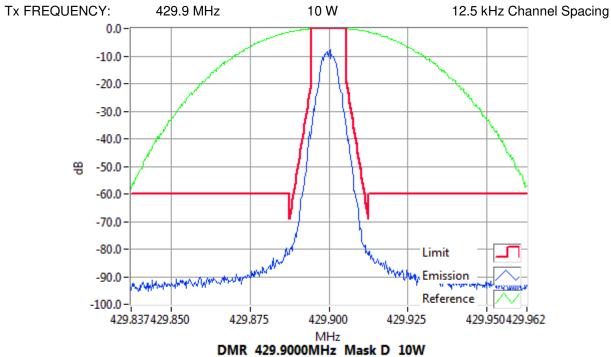


RBW=100Hz, VBW=1000Hz, Detector Mode=Peak
Result=Pass


FCC ID: CASTMBHKB Page 39 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Occupied Bandwidth and Spectrum Masks

DMR

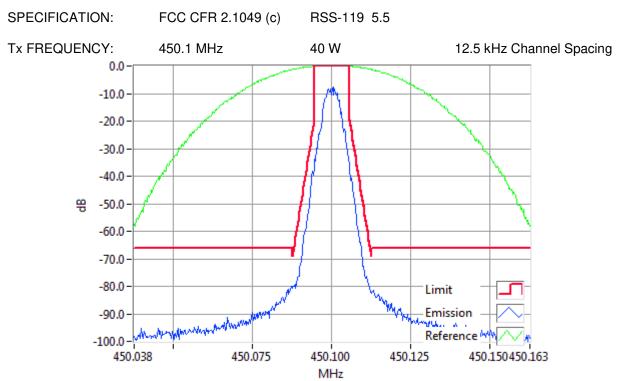


DMR 450.1000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

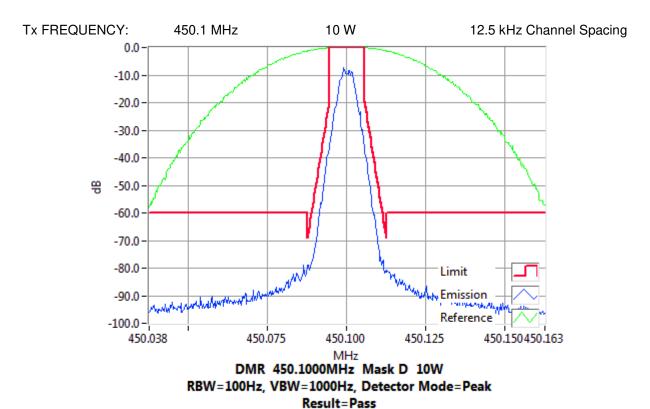


FCC ID: CASTMBHKB Page 40 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Occupied Bandwidth and Spectrum Masks

DMR

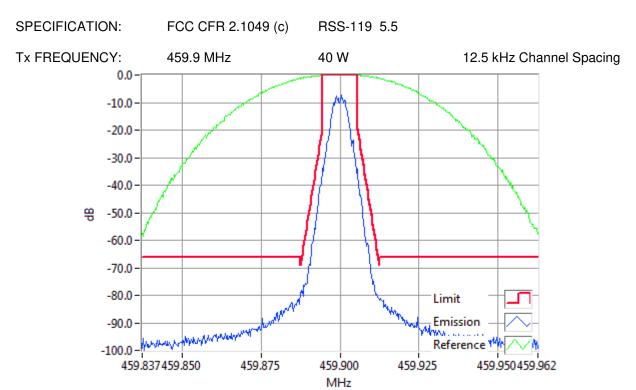


DMR 459.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

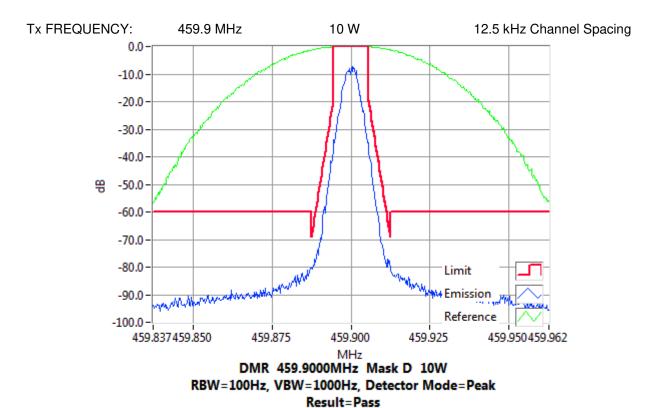


FCC ID: CASTMBHKB Page 41 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Occupied Bandwidth and Spectrum Masks

DMR

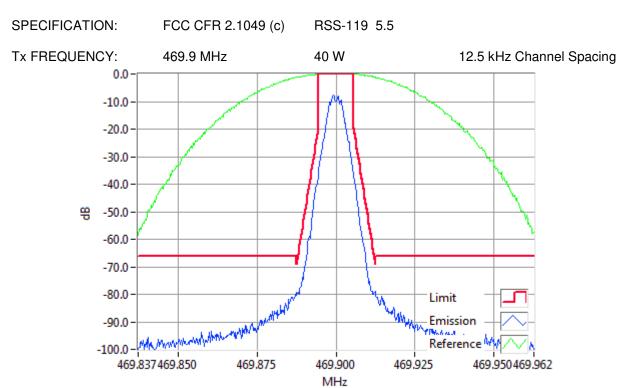


DMR 469.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

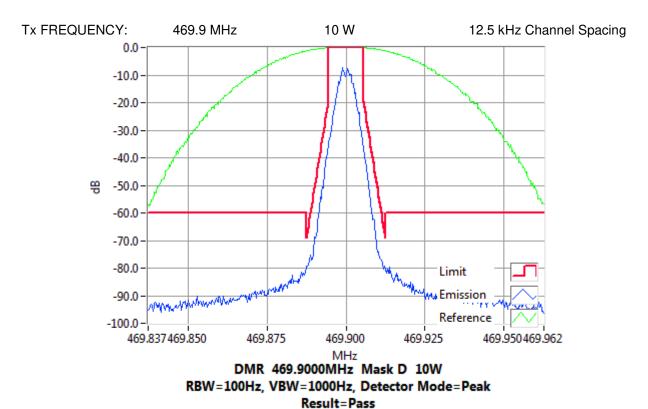


FCC ID: CASTMBHKB Page 42 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Occupied Bandwidth and Spectrum Masks

APCO P25 phase I C4FM

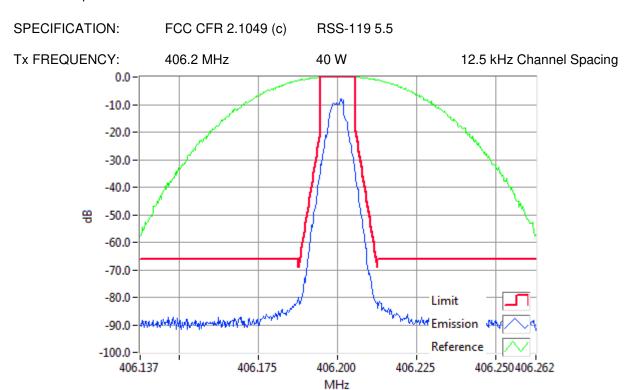


P25I C4FM 406.2000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

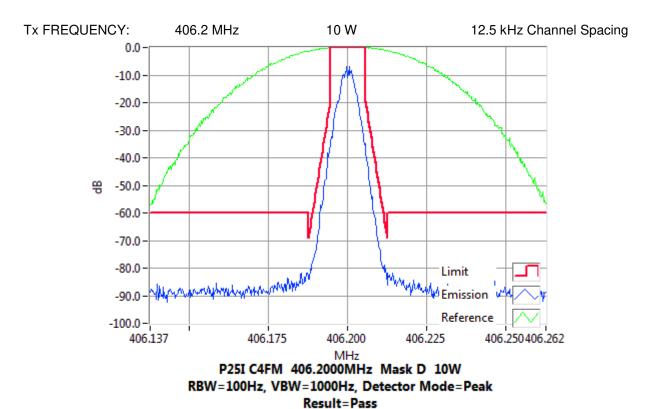


FCC ID: CASTMBHKB Page 43 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Occupied Bandwidth and Spectrum Masks

APCO P25 phase I C4FM

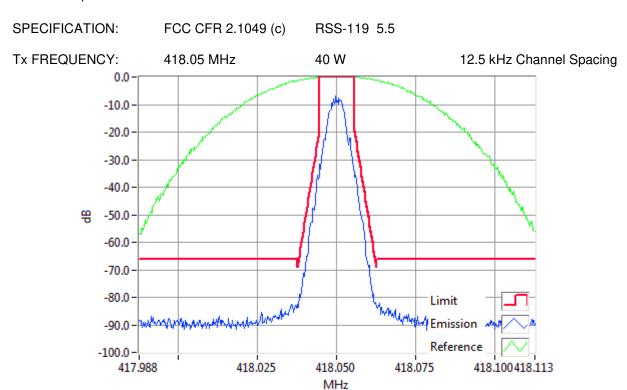


P25I C4FM 418.0500MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

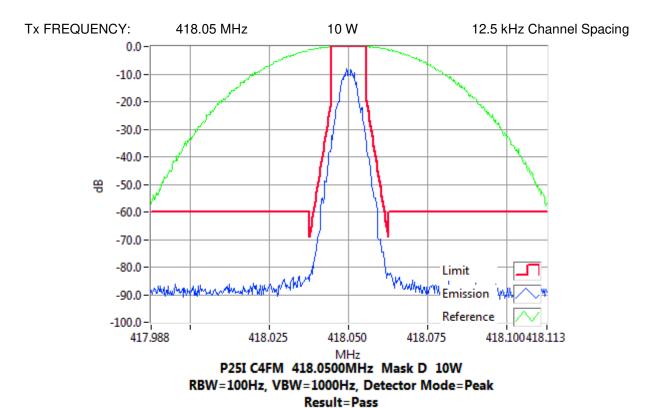

FCC ID: CASTMBHKB Page 44 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

APCO P25 phase I C4FM

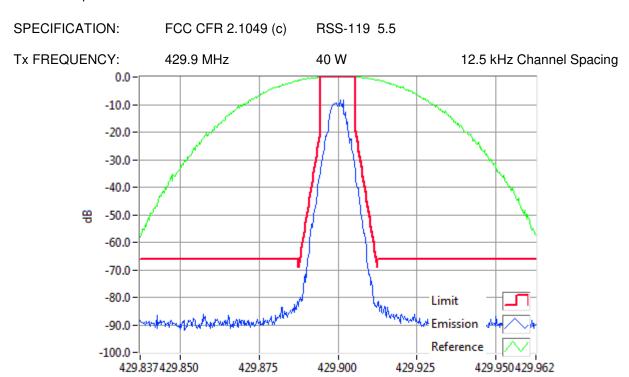

P25I C4FM 429.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

MHz

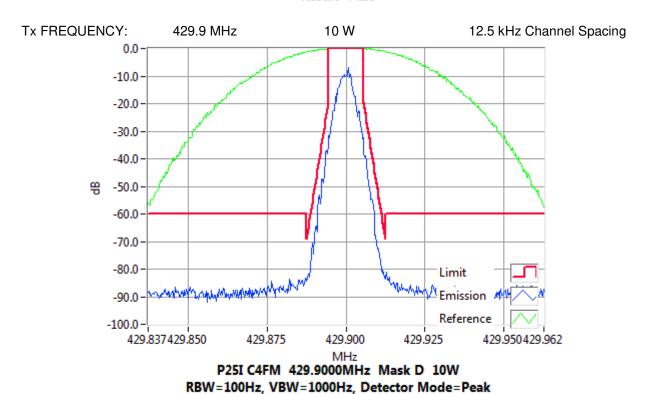


FCC ID: CASTMBHKB Page 45 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Result=Pass

Occupied Bandwidth and Spectrum Masks

APCO P25 phase I C4FM

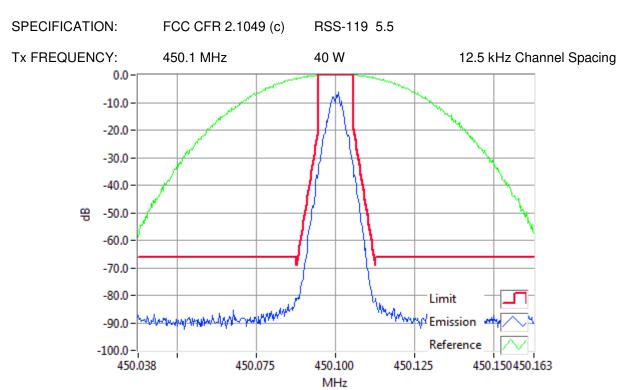


P25I C4FM 450.1000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

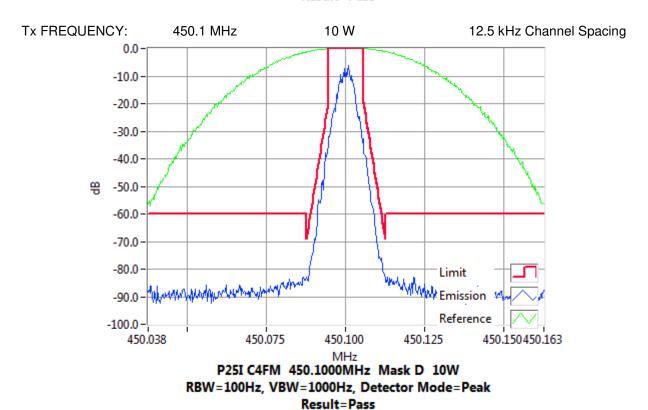

FCC ID: CASTMBHKB Page 46 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

APCO P25 phase I C4FM

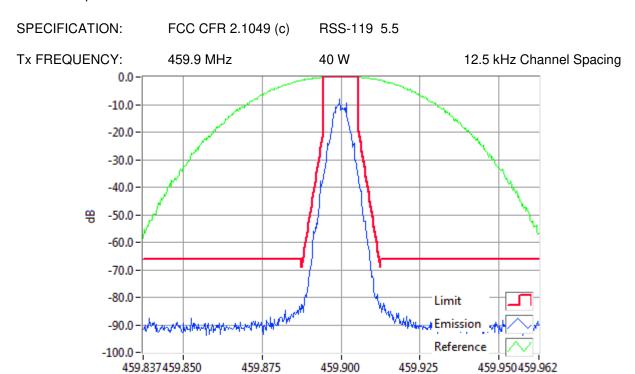

P25I C4FM 459.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

MHz

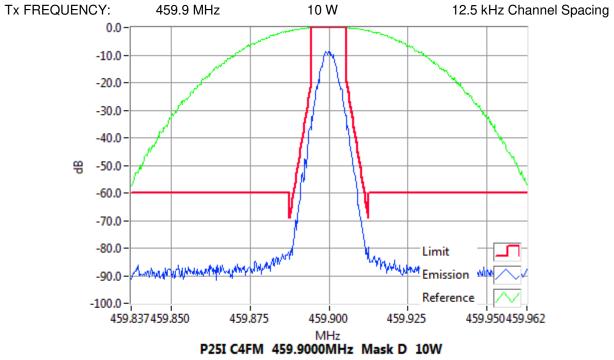


RBW=100Hz, VBW=1000Hz, Detector Mode=Peak
Result=Pass


FCC ID: CASTMBHKB Page 47 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Occupied Bandwidth and Spectrum Masks

APCO P25 phase I C4FM

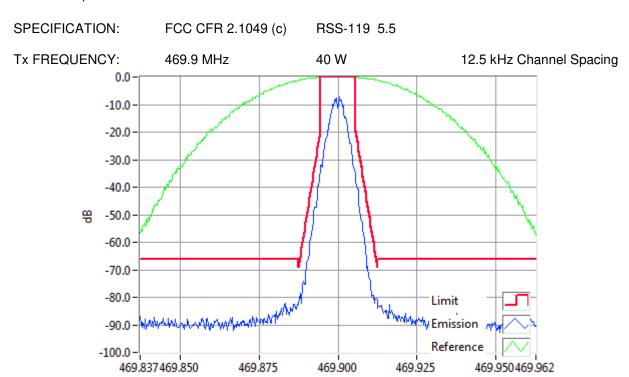

P25I C4FM 469.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

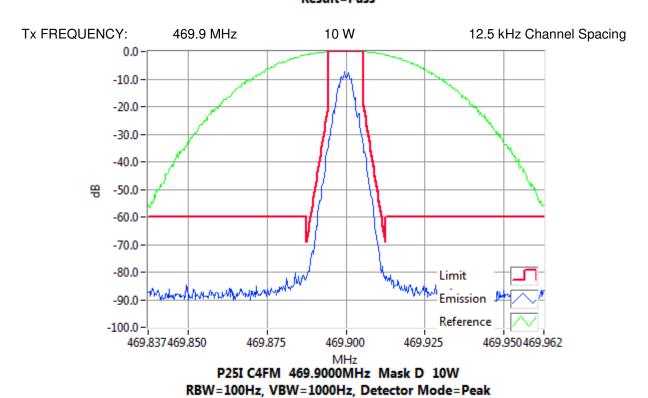


FCC ID: CASTMBHKB Page 48 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Result=Pass


Occupied Bandwidth and Spectrum Masks

APCO P25 phase II H-CPM

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

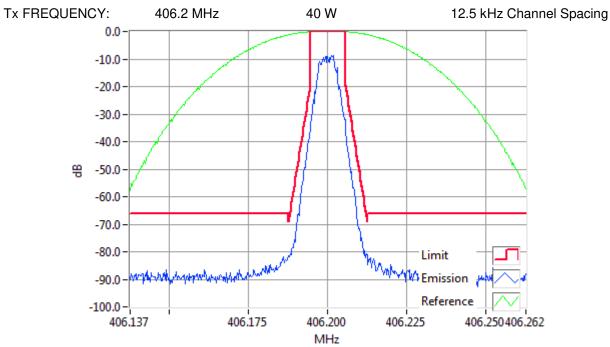

P25II H-CPM 406.2000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

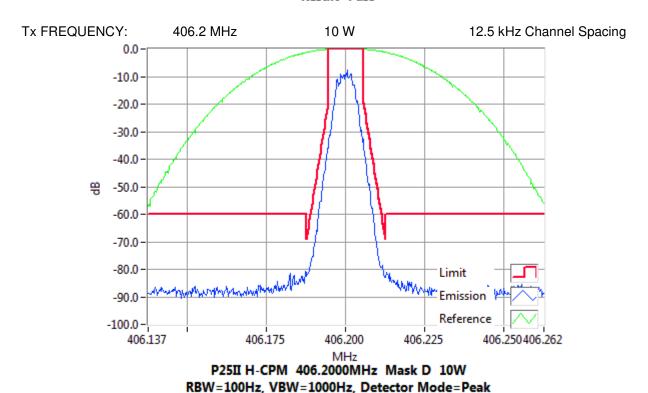


FCC ID: CASTMBHKB Page 49 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Result=Pass

Occupied Bandwidth and Spectrum Masks

APCO P25 phase II H-CPM

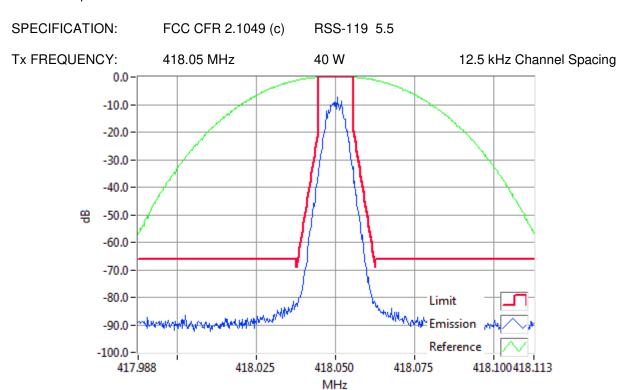

P25II H-CPM 418.0500MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

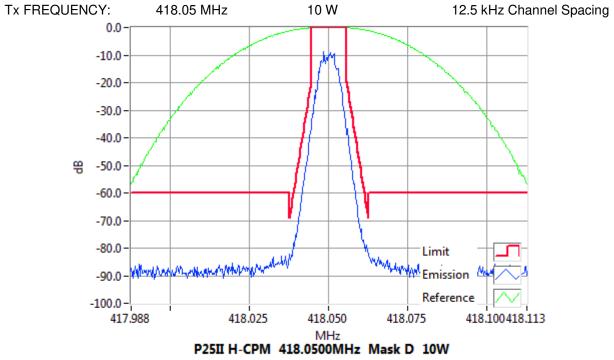


P25II H-CPM 418.0500MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 50 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Occupied Bandwidth and Spectrum Masks

APCO P25 phase II H-CPM

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

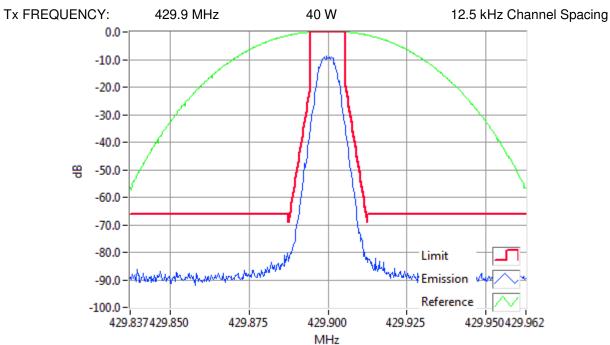

P25II H-CPM 429.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

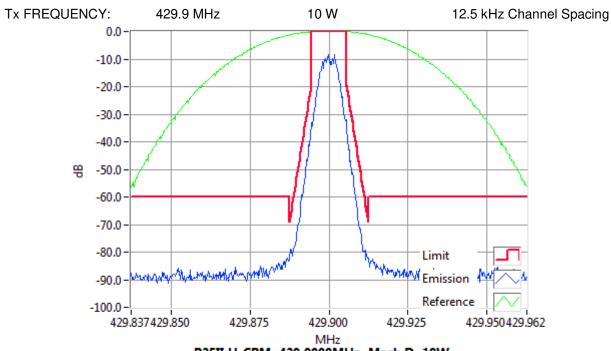

P25II H-CPM 429.9000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 51 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Occupied Bandwidth and Spectrum Masks

APCO P25 phase II H-CPM

-100.0 -450.038

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5 40 W Tx FREQUENCY: 450.1 MHz 12.5 kHz Channel Spacing 0.0 -10.0 -20.0 -30.0 -40.0 吳 -50.0 -60.0 -70.0 -80.0 Limit -90.0

P25II H-CPM 450.1000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

450.100


MHz

450.075

Reference

450.150450.163

450.125

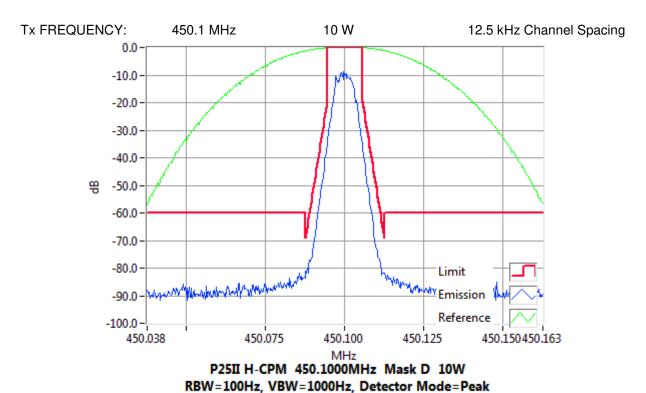

FCC ID: CASTMBHKB Page 52 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Result=Pass

Occupied Bandwidth and Spectrum Masks

APCO P25 phase II H-CPM

-90.0

-100.0 -

459.837459.850

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5 459.9 MHz 40 W Tx FREQUENCY: 12.5 kHz Channel Spacing 0.0 -10.0 -20.0 -30.0 -40.0 吳 -50.0 -60.0 -70.0 -80.0 Limit

P25II H-CPM 459.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

459,900

MHz


459.875

** Emission

459,925

Reference

459.950459.962

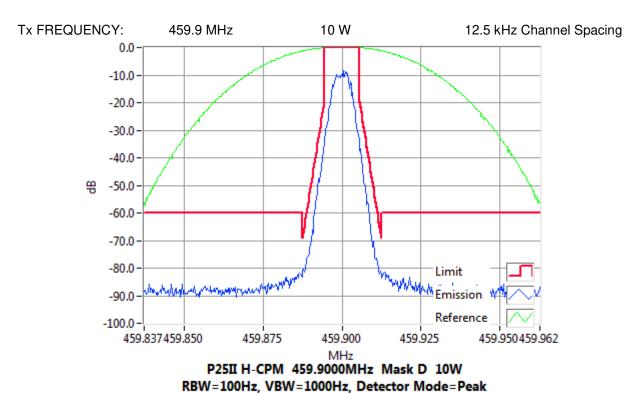


FCC ID: CASTMBHKB Page 53 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Result=Pass


Occupied Bandwidth and Spectrum Masks

APCO P25 phase II H-CPM

SPECIFICATION: FCC CFR 2.1049 (c) RSS-119 5.5

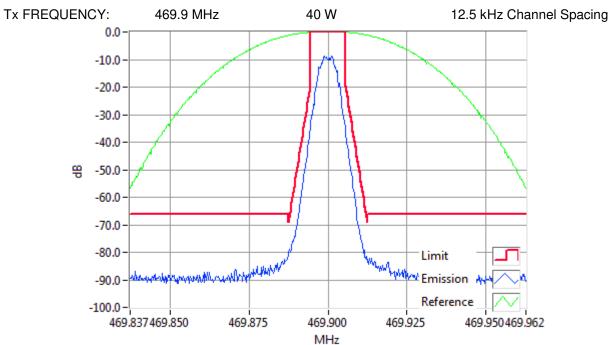

P25II H-CPM 469.9000MHz Mask D 40W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

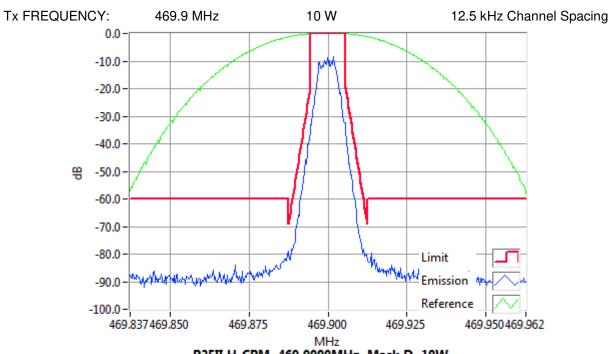

P25II H-CPM 469.9000MHz Mask D 10W RBW=100Hz, VBW=1000Hz, Detector Mode=Peak Result=Pass

FCC ID: CASTMBHKB Page 54 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

TRANSMITTER SPURIOUS EMISSIONS (CONDUCTED)

SPECIFICATIONS: FCC 47 CFR 2.1051 RSS-119 5.8

GUIDE: TIA/EIA-603D 2.2.13

MEASUREMENT PROCEDURE:

1. Refer Annex A for equipment set up.

2. The frequency range examined was from the lowest frequency generated within the EUT, to a frequency higher than the 10th Harmonic: 100 kHz to Fc-BW

Fc+ BW to 10Fc GHz

3. A Pre-scan is performed with a resolution bandwidth of 1 kHz, and a video bandwidth of 3 kHz. If any emissions are found to be within 20 dB of the limit a second measurement is made with the carrier modulated, and a resolution bandwidth of 10 kHz, and a video bandwidth of 30 kHz.

Spurious emissions which were attenuated by more than 20 dB below the limit were not recorded.

A photograph of the test set-up is included below.

MEASUREMENT RESULTS:

See the tables and plots on the following pages for 12.5 kHz channel spacing.

LIMIT CLAUSES: FCC 47 CFR 90.210 RSS-119 5.8



FCC ID: CASTMBHKB Page 55 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Spurious Emissions (Tx Conducted)

SPECIFICATION: FCC CFR 2.1051 RSS-119 5.8

12.5 kHz Channel Spacing 378.1 MHz @ 40 W Emission Mask D


Emission Frequency (MHz)	Level (dBm)	Level (dBc)
~	~	~

12.5 kHz Channel Spacing 378.1 MHz @ 10 W Emission Mask D

Emission Frequency (MHz) Level (dBm) Level (dBc)			
49.1520	-35.4 -75.4		
Measurement Uncertainty: ≤12.75 GHz ± 3.0 dB			
No other emissions were detected at a level greater than 20 dB below the limit.			

FCC ID: CASTMBHKB Page 56 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Spurious Emissions (Tx Conducted) 378.1 MHz 40 watts plots

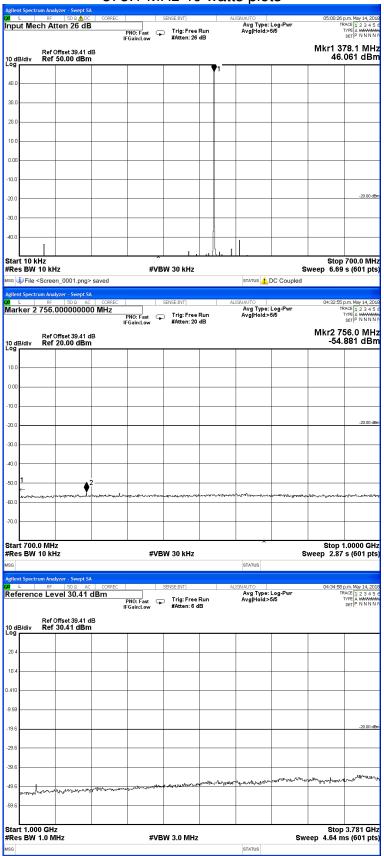

Spurious Emissions (Tx Conducted)


SPECIFICATION: FCC CFR 2.1051 RSS-119 5.8

12.0 KHZ OHAHIOI OPAGHIG 100.2 MHZ @ 10 M	12.5 kHz Channel Spacing	406.2 MHz @ 40 W	Emission Mask D
---	--------------------------	------------------	-----------------

Emission Frequency (MHz)	Level (dBm)	Level (dBc)
~	~	~

12.5 kHz Channel Spacing	406.2 MHz @ 10 W	Emission Mask D
Emission Frequency (MHz)	Level (dBm)	Level (dBc)
~	~	~
Measurement Uncertainty: ≤12.75 GHz ± 3.0 dB		
No emissions were detected at a level greater than 20 dB below the limit.		

Spurious Emissions (Tx Conducted) 406.2 MHz 40 watts plots

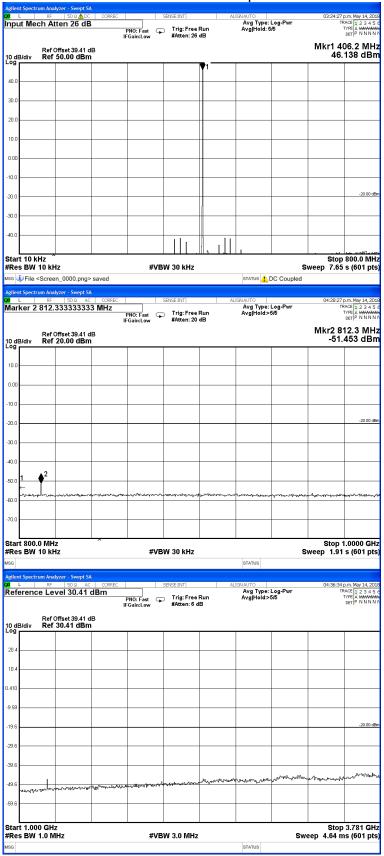

Spurious Emissions (Tx Conducted)

SPECIFICATION: FCC CFR 2.1051 RSS-119 5.8


Emission Frequency (MHz)	Level (dBm)	Level (dBc)
~	~	~

12.5 kHz Channel Spacing 418.05 MHz @ 10 W Emission Mask D

Emission Frequency (MHz)	Level (dBm)	Level (dBc)
~	~	~
Measurement Uncertainty: ≤12.75 GHz ± 3.0 dB		
No emissions were detected at a level greater than 20 dB below the limit.		

FCC ID: CASTMBHKB Page 60 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Spurious Emissions (Tx Conducted) 418.05 MHz 40 watts plots

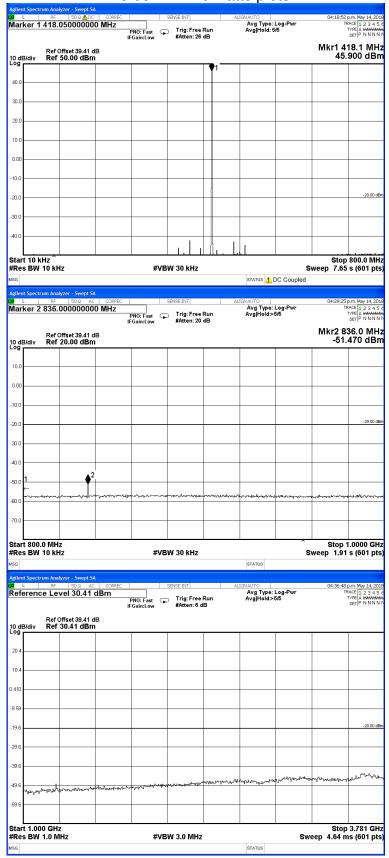

Spurious Emissions (Tx Conducted)

SPECIFICATION: FCC CFR 2.1051 RSS-119 5.8

12.5 kHz Channel Spacing	429.9 MHz @ 40 W	Emission Mask D
--------------------------	------------------	-----------------


Emission Frequency (MHz)	Level (dBm)	Level (dBc)
~	~	~

12.5 kHz Channel Spacing	429.9 MHz @ 10 W	Emission Mask D

Emission Frequency (MHz)	Level (dBm)	Level (dBc)
442.3681	-39.4	-79.4
Measurement Uncertainty: ≤12.75 GHz ± 3.0 dB		
No other emissions were detected at a level greater than 20 dB below the limit.		

FCC ID: CASTMBHKB Page 62 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Spurious Emissions (Tx Conducted) 429.9 MHz 40 watts plots

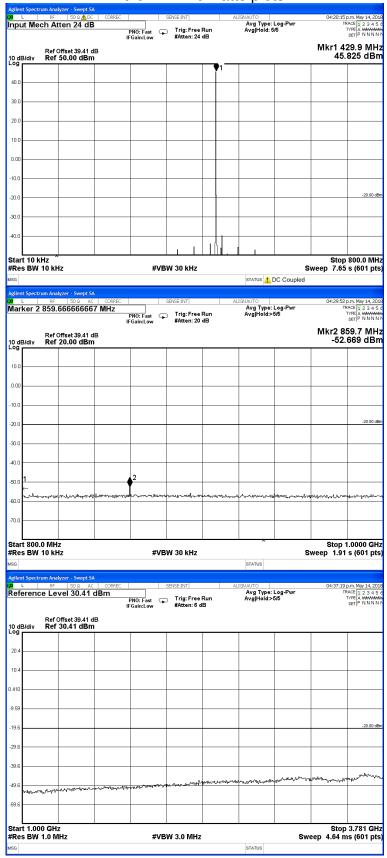

Spurious Emissions (Tx Conducted)

SPECIFICATION: FCC CFR 2.1051 RSS-119 5.8

12.5 kHz Channel Spacing 450.1 MHz @ 40 W

Emission Mask D


Emission Frequency (MHz)	Level (dBm)	Level (dBc)
442.3681	-37.4	-83.4

12.5 kHz Channel Spacing 450.1 MHz @ 10 W Emission Mask D

Emission Frequency (MHz)	Level (dBm)	Level (dBc)
442.3681	-38.2	-78.2
Measurement Uncertainty:	asurement Uncertainty: ≤12.75 GHz ± 3.0 dB	
No other emissions were detected at a level greater than 20 dB below the limit		

No other emissions were detected at a level greater than 20 dB below the limit.

Spurious Emissions (Tx Conducted) 450.1 MHz 40 watts plots

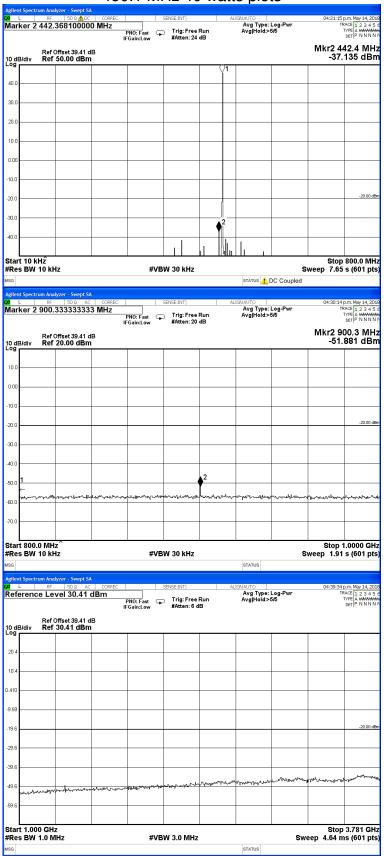

Spurious Emissions (Tx Conducted)

SPECIFICATION: FCC CFR 2.1051 RSS-119 5.8

12.5 kHz Channel Spacing 459.9 MHz @ 40 W Emission Mask D


Emission Frequency (MHz)	Level (dBm)	Level (dBc)
477.4320	-33.9	-79.9

12.5 kHz Channel Spacing 459.9 MHz @ 10 W Emission Mask D

Emission Frequency (MHz)	Level (dBm)	Level (dBc)
477.4320	-39.4	-79.4
Measurement Uncertainty:	≤12.75 GHz ± 3.0 dB	
No other emissions were detected at a level greater than 20 dB below the limit.		

FCC ID: CASTMBHKB Page 66 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Spurious Emissions (Tx Conducted) 459.9 MHz 40 watts plots

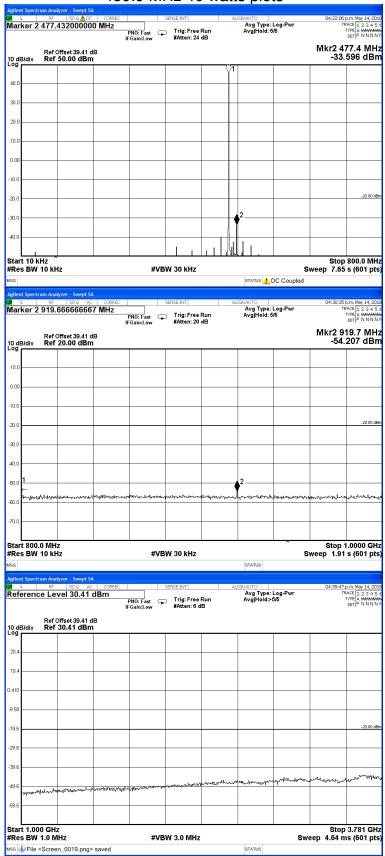

Spurious Emissions (Tx Conducted)

SPECIFICATION: FCC CFR 2.1051 RSS-119 5.8

12.5 kHz Channel Spacing 469.9 MHz @ 40 W

Emission Mask D


Emission Frequency (MHz)	Level (dBm)	Level (dBc)
442.3681	-39.3	-85.3
497.4320	-35.4	-81.4

12.5 kHz Channel Spacing 469.9 MHz @ 10 W Emission Mask D

Emission Frequency (MHz)	Level (dBm)	Level (dBc)
~	~	~
Measurement Uncertainty:	≤12.75 GHz ± 3.0 dB	
No other emissions were detected at a level greater than 20 dB below the limit.		

FCC ID: CASTMBHKB Page 68 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Spurious Emissions (Tx Conducted) 469.9 MHz 40 watts plots

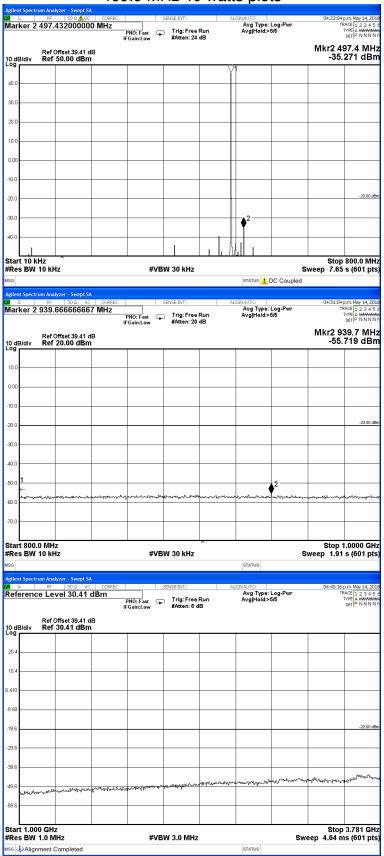

Spurious Emissions (Tx Conducted)

SPECIFICATION: FCC CFR 2.1051 RSS-119 5.8

LIMITS: FCC 47 CFR 90.210 RSS-119 5.8

Carrier Output Power	Emission Mask D 12.5 kHz Channel Spacing 50 + 10 Log ₁₀ (Pw _{atts})	
40 W	-20 dBm	-66 dBc
10 W	-20 dBm	-60 dBc

TRANSMITTER SPURIOUS EMISSIONS (RADIATED)

SPECIFICATION: FCC 47 CFR 2.1053

GUIDE: TIA/EIA-603D 2.2.12

MEASUREMENT PROCEDURE:

Initial Scan:

- 1. The EUT is placed in the S-Line TEM cell and emissions are measured from 30 MHz to 800 MHz. Any emission within 20 dB of the limit is then re-tested on the OATS.
- 2. The EUT is placed in the reverberation chamber and emissions are measured from 800 MHz to the upper frequency required. Any emission within 20 dB of the limit is then re-tested on the OATS.
- 3. The harmonics emissions up to the 6th harmonic of the fundamental frequency are measured on the OATS

OATS Measurement:

- 1. The EUT is placed on a wooden turntable at a distance of three metres from the test antenna. The output terminal is connected to an RF dummy load.
- 2. The test antenna is raised from 1 m to 4 m to obtain a maximum reading; the turntable is then rotated through 360° to obtain the maximum response of each spurious emission. Valid emissions are determined by switching the EUT on and off.
- 3. The EUT is then replaced by a signal generator and substitution antenna to make measurements by the substitution method.

MEASUREMENT RESULTS:

See the tables on the following pages

LIMIT CLAUSE: FCC 47 CFR 90.210

FCC ID: CASTMBHKB Page 71 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Spurious Emissions (Tx Radiated) - Continued

12.5 kHz Channel Spacing	378.1 MHz @ 40 W	Emission Mask I
Emission Frequency (MHz)	Level (dBm)	Level (dBc)
756.2	-38.47	-84.47
12.5 kHz Channel Spacing	378.1 MHz @ 10 W	Emission Mask D
Emission Frequency (MHz)	Level (dBm)	Level (dBc)
~	~	~
Measurement Uncertainty	± 4.6 c	dB
No other emissions were	e detected at a level greater than 2	0 dB below the limit.
2.5 kHz Channel Spacing	406.2 MHz @ 40 W	Emission Mask
Emission Frequency (MHz)	Level (dBm)	Level (dBc)
812.398	-27.04	-73.04
12.5 kHz Channel Spacing	406.2 MHz @ 10 W	Emission Mask
Emission Frequency (MHz)	Level (dBm)	Level (dBc)
812.398	-29.95	-69.95
Measurement Uncertainty	± 4.6 c	JB
,	ere detected at a level greater than 20 dB below the limit.	
12.5 kHz Channel Spacing	418.05 MHz @ 40 W	Emission Mask
Emission Frequency (MHz)	Level (dBm)	Level (dBc)
836.101	-27.01	-73.01
10 E ki la Chonnal Chasins	410 05 MUI- @ 10 W	Fusionian Mart. 5
12.5 kHz Channel Spacing	418.05 MHz @ 10 W	Emission Mask [
Emission Frequency (MHz)	Level (dBm)	Level (dBc)
836.101	-29.26	-69.26
Measurement Uncertainty	± 4.6 dB	
	e detected at a level greater than 2	

FCC ID: CASTMBHKB Page 72 of 96 Report Revision: 1 IC: 737A-TMBHKB Issue Date: 5 June 2018

Spurious Emissions (Tx Radiated) - Continued

12.5 kHz Channel Spacing	429.9 MHz @ 40 W	Emission Mask D		
Emission Frequency (MHz)	Level (dBm)	Level (dBc)		
859.798	-29.30	-75.30		
12.5 kHz Channel Spacing	429.9 MHz @ 10 W	Emission Mask D		
Emission Frequency (MHz)	Level (dBm)	Level (dBc)		
859.798	-32.13	-72.13		
Measurement Uncertainty	± 4.0	3 dB		
No other emissions we	ere detected at a level greater than	1 20 dB below the limit.		
12.5 kHz Channel Spacing	450.1 MHz @ 40 W	Emission Mask D		
Emission Frequency (MHz)	Level (dBm)	Level (dBc)		
~	~	~		
12.5 kHz Channel Spacing	450.1 MHz @ 10 W	Emission Mask D		
Emission Frequency (MHz)	Level (dBm)	Level (dBc)		
~	~	~		
Measurement Uncertainty	± 4.6 dB			
No emissions were	detected at a level greater than 20	dB below the limit.		
12.5 kHz Channel Spacing	459.9 MHz @ 40 W	Emission Mask D		
Emission Frequency (MHz)	Level (dBm)	Level (dBc)		
~	~	~		
12.5 kHz Channel Spacing	459.9 MHz @ 10 W	Emission Mask D		
Emission Frequency (MHz)	Level (dBm)	Level (dBc)		
~	~	~		
Measurement Uncertainty	Measurement Uncertainty ± 4.6 dB			
No emissions were	detected at a level greater than 20	dB below the limit.		

FCC ID: CASTMBHKB Page 73 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Spurious Emissions (Tx Radiated) - Continued

12.5 kHz Channel Spacing	469.9 MHz @ 40 W	Emission Mask D
12.0 Mile Onamio Opaomg	100.0 111112 @ 10 11	Zimoolon Maon B

Emission Frequency (MHz)	Level (dBm)	Level (dBc)
~	~	~

12.5 kHz Channel Spacing 469.9 MHz @ 10 W Emission Mask D

Emission Frequency (MHz)	Level (dBm)	Level (dBc)	
~	~	~	
Measurement Uncertainty	± 4.6 dB		
No emissions were detected at a level greater than 20 dB below the limit.			

LIMITS: FCC CFR 2.1053

Carrier Output Power	Emission Mask D 12.5 kHz Channel Spacing 50 + 10 Log ₁₀ (Pw _{atts})	
40 W	-20 dBm	-66 dBc
10 W	-20 dBm	-60 dBc

FCC ID: CASTMBHKB Page 74 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Spurious Emissions (Tx Radiated) - Continued

Open Area Test Site Results:

12.5 kHz Channel Spacing

429.9 MHz @ 40 W

Emission Mask D

Harmonics Emission Frequency (MHz)	Level (dBm)	Level (dBc)
859.798	-29.30	-75.30
1289.7	-45.55	-91.55
1719.6	-45.71	-91.71
2149.5	-60.56	-106.56
2579.4	-59.28	-105.28
3009.3	-60.42	-106.42
Measurement Uncertainty	± 4	.6 dB

Sample Calculation	Measurement						
	Reference	Reference Substitution			Res	ult	
Emission Frequency (MHz)	Reference Level (dBm)	Sig-gen Level	Cable and Attenuator Gain	Antenna Gain (dBd)	Path and Boresight corrections	dBm	nW
859.798	-61.33	-12.05	-16.83	-0.35	-0.08	-29.30	1174.22
	A B C D			E	-		

Result (E) = A+B+C+D





FCC ID: CASTMBHKB IC: 737A-TMBHKB

Page 75 of 96

Report Revision: 1 Issue Date: 5 June 2018

TRANSIENT FREQUENCY BEHAVIOR

SPECIFICATION: FCC 47 CFR 90.214 RSS-119 5.9

GUIDE: TIA/EIA-603D 2.2.19

MEASUREMENT PROCEDURE:

1. Refer Annex A for equipment set up.

2. Measurements and plots were made following the TIA/EIA procedure.

MEASUREMENT RESULTS:

See the tables and plots on the following pages for 12.5 kHz channel spacing.

LIMIT CLAUSES: FCC 47 CFR 90.214 RSS-119 5.9

FCC ID: CASTMBHKB Page 76 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Transient Frequency Behaviour

SPECIFICATION: FCC 47 CFR 90.214 RSS-119 5.9

Tx FREQUENCY: 406.2 MHz 40 W 12.5 kHz Channel Spacing

406.2 MHz @ 40 W Tx

TRANSIENT RESPONSE	CARRIER PEAK VARIATION FROM NORMAL		
PERIOD	Key ON (kHz)	Key OFF (kHz)	
t1	-0.5	N/A	
t2	-0.6	N/A	
t3	N/A	-0.5	

Confirm that during periods t1 and t3 the frequency difference	YES	NO
does not exceed the value of one channel separation.		
Confirm that during the period t2 the frequency difference does	YES	NO
not exceed half a channel separation.		
Confirm that during the period t2 to t3 the frequency difference	YES	NO
does not exceed the frequency error limit.		

Measurement Uncertainty: Frequency ± 130 Hz; Time ± 0.2%

LIMIT: FCC 47 CFR 90.214

TRANSIENT PERIODS	FREQUENCY RANGE		
TRANSIENT PERIODS	150 MHz – 174 MHz	421 MHz – 512 MHz	
t1 (ms)	5 ms	10 ms	
t2 (ms)	20 ms	25 ms	
t3 (ms)	5 ms	10 ms	

LIMIT: RSS-119 5.9

Transient Frequency Behaviour for Equipment Designed to Operate on 12.5 kHz Channels			
TRANSIENT PERIODS	Maximum Frequency FREQUENCY RANGE		
TRANSIENT FERIODS	Difference	138 – 174 MHz	406.1 – 470 MHz
t1 (ms)	± 12.5 kHz	5 ms	10 ms
t2 (ms)	± 6.25 kHz	20 ms	25 ms
t3 (ms)	± 12.5 kHz	5 ms	10 ms


Note: RSS-119 $\,$ 5.9 - If the transmitter carrier output power rating is 6 Watts or less, the frequency difference during the time periods $\,$ to $\,$ to


FCC ID: CASTMBHKB Page 77 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Transient Frequency Behaviour

SPECIFICATION: FCC 47 CFR 90.214 RSS-119 5.9

Tx FREQUENCY: 406.2 MHz 40 W 12.5 kHz Channel Spacing

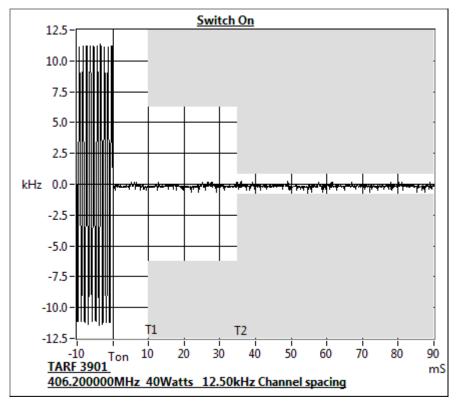

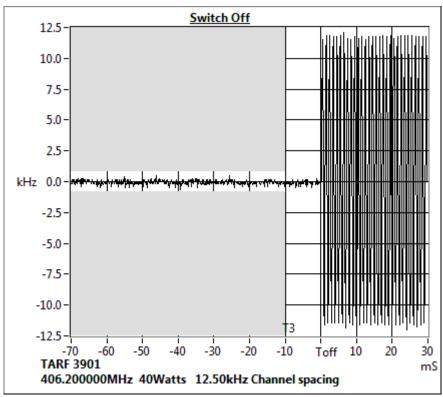

Transient Frequency Behaviour

SPECIFICATION: FCC 47 CFR 90.214

Tx FREQUENCY: 418.05 MHz 40 W 12.5 kHz Channel Spacing

418.05 MHz @ 40 W Tx

TRANSIENT RESPONSE	CARRIER PEAK VARIATION FROM NORMAL		
PERIOD	Key ON (kHz)	Key OFF (kHz)	
t1	-0.6	N/A	
t2	-0.8	N/A	
t3	N/A	-0.6	

Confirm that during periods t1 and t3 the frequency difference	YES	NO
does not exceed the value of one channel separation.		
Confirm that during the period t2 the frequency difference does	YES	NO
not exceed half a channel separation.		
Confirm that during the period t2 to t3 the frequency difference	YES	NO
does not exceed the frequency error limit.		

Measurement Uncertainty: Frequency ± 130 Hz; Time ± 0.2%

LIMIT: FCC 47 CFR 90.214

TRANSIENT PERIODS	FREQUENCY RANGE	
TRANSIENT FERIODS	150 MHz – 174 MHz	421 MHz – 512 MHz
t1 (ms)	5 ms	10 ms
t2 (ms)	20 ms	25 ms
t3 (ms)	5 ms	10 ms

LIMIT: RSS-119 5.9

Transient Frequency Behaviour for Equipment Designed to Operate on 12.5 kHz Channels			
TRANSIENT PERIODS	Maximum Frequency FREQUENCY RANGE		NCY RANGE
THANSIENT I EIRIODS	Difference	138 – 174 MHz	406.1 – 470 MHz
t1 (ms)	± 12.5 kHz	5 ms	10 ms
t2 (ms)	± 6.25 kHz	20 ms	25 ms
t3 (ms)	± 12.5 kHz	5 ms	10 ms


Note: RSS-119 5.9 - If the transmitter carrier output power rating is 6 Watts or less, the frequency difference during the time periods t1 and t3 may exceed the maximum frequency difference for these time periods,


FCC ID: CASTMBHKB Page 79 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Transient Frequency Behavior

SPECIFICATION: FCC 47 CFR 90.214

Tx FREQUENCY: 418.05 MHz 40 W 12.5 kHz Channel Spacing

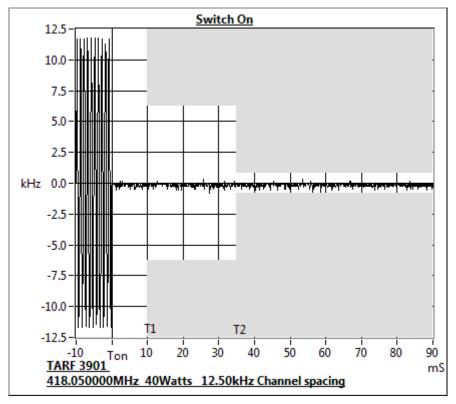

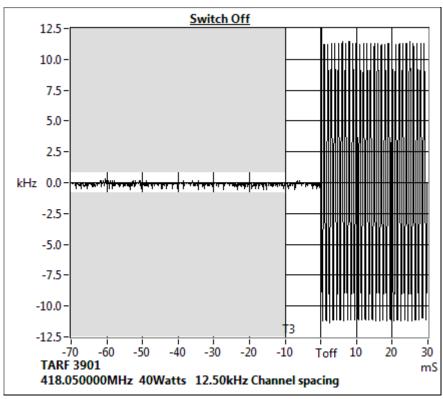

Transient Frequency Behaviour

SPECIFICATION: FCC 47 CFR 90.214 RSS-119 5.9

Tx FREQUENCY: 429.9 MHz 40 W 12.5 kHz Channel Spacing

429.9 MHz @ 40 W Tx

TRANSIENT RESPONSE	CARRIER PEAK VARIATION FROM NORMAL		
PERIOD	Key ON (kHz)	Key OFF (kHz)	
t1	-0.6	N/A	
t2	-0.6	N/A	
t3	N/A	-0.7	

Confirm that during periods t1 and t3 the frequency difference	YES	NO
does not exceed the value of one channel separation.		
Confirm that during the period t2 the frequency difference does	YES	NO
not exceed half a channel separation.		
Confirm that during the period t2 to t3 the frequency difference	YES	NO
does not exceed the frequency error limit.		

Measurement Uncertainty: Frequency ± 130 Hz; Time ± 0.2%

LIMIT: FCC 47 CFR 90.214

TRANSIENT PERIODS	FREQUENCY RANGE	
TRANSIENT FERIODS	150 MHz – 174 MHz	421 MHz – 512 MHz
t1 (ms)	5 ms	10 ms
t2 (ms)	20 ms	25 ms
t3 (ms)	5 ms	10 ms

LIMIT: RSS-119 5.9

Transient Frequency Behaviour for Equipment Designed to Operate on 12.5 kHz Channels			
TRANSIENT PERIODS	Maximum Frequency FREQUENCY RANGE		NCY RANGE
TRANSIENT FERIODS	Difference	138 – 174 MHz	406.1 – 470 MHz
t1 (ms)	± 12.5 kHz	5 ms	10 ms
t2 (ms)	± 6.25 kHz	20 ms	25 ms
t3 (ms)	± 12.5 kHz	5 ms	10 ms


Note: RSS-119 $\,$ 5.9 - If the transmitter carrier output power rating is 6 Watts or less, the frequency difference during the time periods $\,$ to $\,$ to


FCC ID: CASTMBHKB Page 81 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Transient Frequency Behaviour

SPECIFICATION: FCC 47 CFR 90.214 RSS-119 5.9

Tx FREQUENCY: 429.9 MHz 40 W 12.5 kHz Channel Spacing

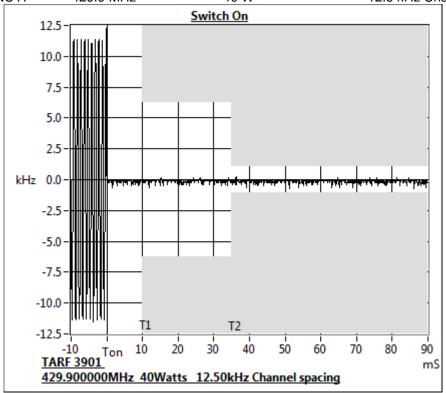

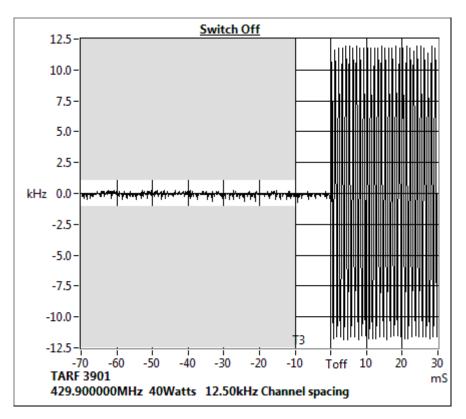

Transient Frequency Behaviour

SPECIFICATION: FCC 47 CFR 90.214 RSS-119 5.9

Tx FREQUENCY: 450.1 MHz 40 W 12.5 kHz Channel Spacing

450.1 MHz @ 40 W Tx

TRANSIENT RESPONSE	CARRIER PEAK VARIATION FROM NORMAL		
PERIOD	Key ON (kHz)	Key OFF (kHz)	
t1	1.2	N/A	
t2	-0.7	N/A	
t3	N/A	-0.5	

Confirm that during periods t1 and t3 the frequency difference	YES	NO
does not exceed the value of one channel separation.		
Confirm that during the period t2 the frequency difference does	YES	NO
not exceed half a channel separation.		
Confirm that during the period t2 to t3 the frequency difference	YES	NO
does not exceed the frequency error limit.		

Measurement Uncertainty: Frequency ± 130 Hz; Time ± 0.2%

LIMIT: FCC 47 CFR 90.214

TRANSIENT PERIODS	FREQUENCY RANGE	
TRANSIENT PERIODS	150 MHz – 174 MHz	421 MHz – 512 MHz
t1 (ms)	5 ms	10 ms
t2 (ms)	20 ms	25 ms
t3 (ms)	5 ms	10 ms

LIMIT: RSS-119 5.9

Transient Frequency Behaviour for Equipment Designed to Operate on 12.5 kHz Channels			
TRANSIENT PERIODS	Maximum Frequency FREQUENCY RANGE		NCY RANGE
THANSIENT I ENIODS	Difference	138 – 174 MHz	406.1 – 470 MHz
t1 (ms)	± 12.5 kHz	5 ms	10 ms
t2 (ms)	± 6.25 kHz	20 ms	25 ms
t3 (ms)	± 12.5 kHz	5 ms	10 ms


Note: RSS-119 $\,$ 5.9 - If the transmitter carrier output power rating is 6 Watts or less, the frequency difference during the time periods $\,$ to $\,$ to


FCC ID: CASTMBHKB Page 83 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Transient Frequency Behaviour

SPECIFICATION: FCC 47 CFR 90.214 RSS-119 5.9

Tx FREQUENCY: 450.1 MHz 40 W 12.5 kHz Channel Spacing

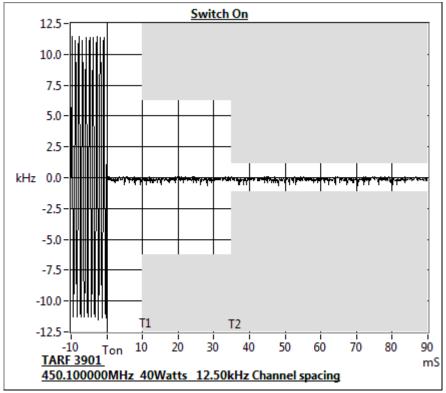

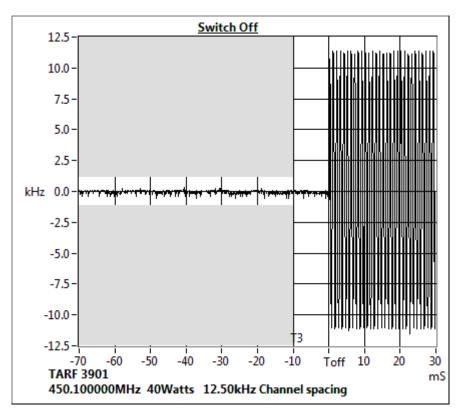

Transient Frequency Behaviour

SPECIFICATION: FCC 47 CFR 90.214 RSS-119 5.9

Tx FREQUENCY: 459.9 MHz 40 W 12.5 kHz Channel Spacing

459.9 MHz @ 40 W Tx

TRANSIENT RESPONSE	CARRIER PEAK VARIATION FROM NORMAL		
PERIOD	Key ON (kHz)	Key OFF (kHz)	
t1	0.6	N/A	
t2	-0.7	N/A	
t3	N/A	-0.7	

Confirm that during periods t1 and t3 the frequency difference	YES	NO
does not exceed the value of one channel separation.		
Confirm that during the period t2 the frequency difference does	YES	NO
not exceed half a channel separation.		
Confirm that during the period t2 to t3 the frequency difference	YES	NO
does not exceed the frequency error limit.		

Measurement Uncertainty: Frequency ± 130 Hz; Time ± 0.2%

LIMIT: FCC 47 CFR 90.214

TRANSIENT PERIODS	FREQUEN	CY RANGE
THANSIENT FERIODS	150 MHz – 174 MHz	421 MHz – 512 MHz
t1 (ms)	5 ms	10 ms
t2 (ms)	20 ms	25 ms
t3 (ms)	5 ms	10 ms

LIMIT: RSS-119 5.9

Transient Frequency Behaviour for Equipment Designed to Operate on 12.5 kHz Channels					
TRANSIENT PERIODS	Maximum Frequency	FREQUE	NCY RANGE		
THANSIENT I EIRIODS	Difference	138 – 174 MHz	406.1 – 470 MHz		
t1 (ms)	± 12.5 kHz	5 ms	10 ms		
t2 (ms)	± 6.25 kHz	20 ms	25 ms		
t3 (ms)	± 12.5 kHz	5 ms	10 ms		


Note: RSS-119 5.9 - If the transmitter carrier output power rating is 6 Watts or less, the frequency difference during the time periods 11 and 13 may exceed the maximum frequency difference for these time periods.


FCC ID: CASTMBHKB Page 85 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Transient Frequency Behaviour

SPECIFICATION: FCC 47 CFR 90.214 RSS-119 5.9

Tx FREQUENCY: 459.9 MHz 40 W 12.5 kHz Channel Spacing

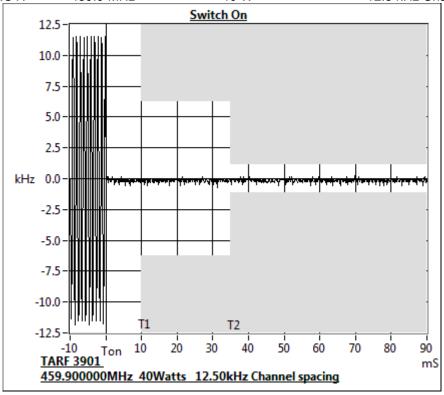

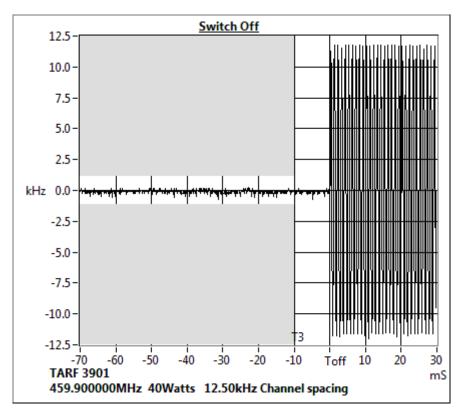

Transient Frequency Behaviour

SPECIFICATION: FCC 47 CFR 90.214 RSS-119 5.9

Tx FREQUENCY: 469.9 MHz 40 W 12.5 kHz Channel Spacing

469.9 MHz @ 40 W Tx

TRANSIENT RESPONSE	CARRIER PEAK VARIATION FROM NORMAL			
PERIOD	Key ON (kHz)	Key OFF (kHz)		
t1	-0.8	N/A		
t2	-0.9	N/A		
t3	N/A -0.5			

Confirm that during periods t1 and t3 the frequency difference	YES	NO
does not exceed the value of one channel separation.		
Confirm that during the period t2 the frequency difference does	YES	NO
not exceed half a channel separation.		
Confirm that during the period t2 to t3 the frequency difference	YES	NO
does not exceed the frequency error limit.		

Measurement Uncertainty: Frequency ± 130 Hz; Time ± 0.2%

LIMIT: FCC 47 CFR 90.214

TRANSIENT PERIODS	FREQUEN	CY RANGE
TRANSIENT FERIODS	150 MHz – 174 MHz	421 MHz – 512 MHz
t1 (ms)	5 ms	10 ms
t2 (ms)	20 ms	25 ms
t3 (ms)	5 ms	10 ms

LIMIT: RSS-119 5.9

Transient Frequency Behaviour for Equipment Designed to Operate on 12.5 kHz Channels					
TRANSIENT PERIODS	Maximum Frequency	FREQUE	NCY RANGE		
THANSIENT I EIRIODS	Difference	138 – 174 MHz	406.1 – 470 MHz		
t1 (ms)	± 12.5 kHz	5 ms	10 ms		
t2 (ms)	± 6.25 kHz	20 ms	25 ms		
t3 (ms)	± 12.5 kHz	5 ms	10 ms		


Note: RSS-119 $\,$ 5.9 - If the transmitter carrier output power rating is 6 Watts or less, the frequency difference during the time periods $\,$ to $\,$ to


FCC ID: CASTMBHKB Page 87 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Transient Frequency Behaviour

SPECIFICATION: FCC 47 CFR 90.214 RSS-119 5.9

Tx FREQUENCY: 469.9 MHz 40 W 12.5 kHz Channel Spacing

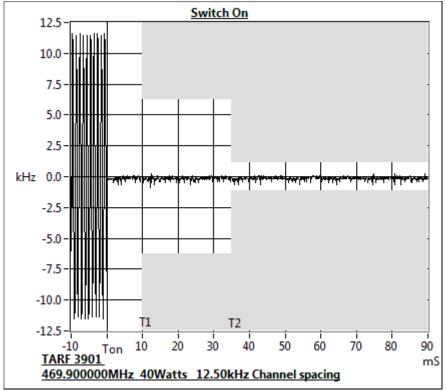

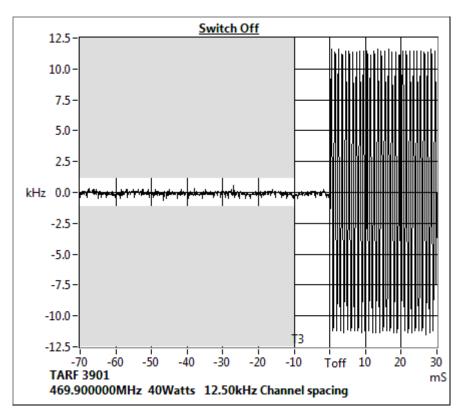

TRANSMITTER FREQUENCY STABILITY - TEMPERATURE

SPECIFICATION: FCC 47 CFR 2.1055 (a) (1) RSS-119 5.3

GUIDE: TIA/EIA-603D 2.2.2

MEASUREMENT PROCEDURE:

- 1. Refer Annex A for equipment set up.
- 2. The EUT was tested for frequency error from -30° C to +50° C in 10° C increments
- 3. The frequency error was recorded in parts per million (ppm).

MEASUREMENT RESULTS:

See the plots on the following pages for 12.5 kHz channel spacing.


	Error (ppm)					
Temperature (°C)	406.2 MHz	418.05 MHz	429.9 MHz	450.1 MHz	459.9 MHz	469.9 MHz
-30	-0.09	-0.08	-0.07	-0.07	-0.08	-0.09
-20	-0.07	-0.07	-0.06	-0.05	-0.03	-0.01
-10	0.00	0.00	0.00	-0.02	-0.03	-0.04
0	-0.06	-0.06	-0.07	-0.09	-0.10	-0.10
10	-0.07	-0.07	-0.06	-0.06	-0.05	-0.05
20	0.00	0.00	0.00	0.00	-0.01	-0.01
30	-0.05	-0.05	-0.06	-0.07	-0.08	-0.08
40	-0.10	-0.10	-0.10	-0.10	-0.10	-0.09
50	-0.04	-0.04	-0.03	-0.03	-0.02	-0.01
Measurement	Uncertaint	y	·		± 7 x 10 ⁻⁸	·


LIMIT: FCC 47 CFR 90.213 RSS-119 5.3


Channel Spacing (kHz)			Frequency	Error (ppm)		
12.5	406.2 MHz	418.05 MHz	429.9 MHz	450.1 MHz	459.9 MHz	469.9 MHz
12.5	2.0	2.0	2.5	2.5	2.5	2.5


FCC ID: CASTMBHKB Page 89 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


Transmitter Frequency Stability - Temperature

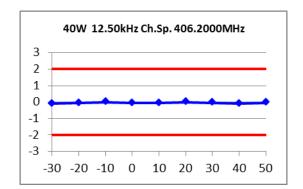


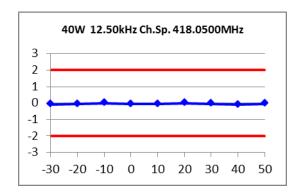

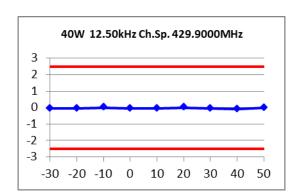

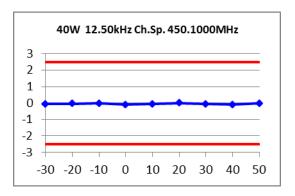

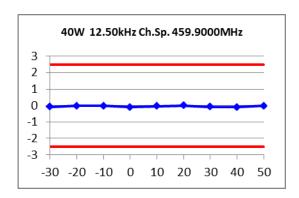

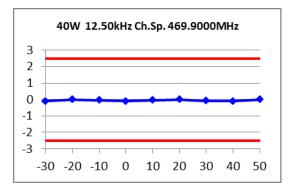

TRANSMITTER FREQUENCY STABILITY - VOLTAGE

SPECIFICATION: FCC 47 CFR 2.1055 (d) (1) RSS-119 5.3

GUIDE: TIA/EIA-603D 2.2.2

MEASUREMENT PROCEDURE:

1. Refer Annex A for equipment set up.

- 2. The EUT was tested for frequency error at an input voltage to the radio of 85% to 115%.
- 3. The frequency error was recorded in parts per million (ppm).

MEASUREMENT RESULTS:

	FREQUENCY ERROR (ppm) for 12.5 kHz			
	13.8 V _{DC}	11.7 V _{DC}	15.9 V _{DC}	
406.2 MHz	-0.10	-0.10	-0.10	
418.05 MHz	-0.01	-0.01	-0.02	
429.9 MHz	0.00	-0.01	-0.01	
450.1 MHz	-0.05	-0.05	-0.06	
459.9 MHz	-0.02	-0.05	-0.07	
469.9 MHz	-0.01	-0.01	-0.02	
Measuremer	nt Uncertainty	± 7 x 10 ⁻⁸		

LIMIT CLAUSES: FCC 47 CFR 90.213 RSS-119 5.3

Channel Spacing (kHz)			Frequency	Error (ppm)		
12.5	406.2 MHz	418.05 MHz	429.9 MHz	450.1 MHz	459.9 MHz	469.9 MHz
12.0	2.0	2.0	2.5	2.5	2.5	2.5

FCC ID: CASTMBHKB Page 91 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

RECEIVER SPURIOUS EMISSIONS (CONDUCTED)

SPECIFICATION: RSS-119 5.11

GUIDE: TIA/EIA-603D 2.1.2

MEASUREMENT PROCEDURE:

- 1. Refer Annex A for Equipment set up diagram.
- 2. The frequency range examined was from 30 MHz to 3 times highest tunable frequency.
- 3. Spurious emissions which were attenuated more than 20 dB below the limit were not recorded.

378.1 MHz Receive					
Emission Frequency (MHz) Level (nW) Level (dBm)					
~	~ ~				
Measurement Uncertainty ≤12.75 GHz ± 3.0 dB					
No emissions were detected within 20 dB of Limit.					

406.2 MHz Receive				
Emission Frequency (MHz) Level (nW) Level (dBm)				
~	~	~		
Measurement Uncertainty	≤12.75 GHz ± 3.0 dB			
No emissions were detected within 20 dB of Limit.				

418.05 MHz Receive				
Emission Frequency (MHz) Level (nW) Level (dBm)				
~	~	~		
Measurement Uncertainty ≤12.75 GHz ± 3.0 dB				
No emissions were detected within 20 dB of Limit.				

429.9 MHz Receive				
Emission Frequency (MHz) Level (nW) Level (dBm)				
~	~	~		
Measurement Uncertainty	≤12.75 GHz ± 3.0 dB			
No emissions were detected within 20 dB of Limit.				

FCC ID: CASTMBHKB Page 92 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

Receiver Spurious Emissions (Conducted) - Continued

450.1 MHz Receive				
Emission Frequency (MHz) Level (nW) Level (dBm)				
~	~	~		
Measurement Uncertainty	ainty ≤12.75 GHz ± 3.0 dB			
No emissions were detected within 20 dB of Limit.				

459.9 MHz Receive					
Emission Frequency (MHz) Level (nW) Level (dBm)					
~	~	~			
Measurement Uncertainty	≤12.75 GHz ± 3.0 dB				
No emissions were detected within 20 dB of Limit.					

469.9 MHz Receive				
Emission Frequency (MHz) Level (nW) Level (dBm)				
~	~	~		
Measurement Uncertainty	≤12.75 GHz ± 3.0 dB			
No emissions were detected within 20 dB of Limit.				

LIMIT CLAUSE: RSS-Gen 6(b)

LIMIT	30 → 1000 MHz	2 nW	- 57 dBm
LIIVIII	> 1000 MHz	5 nW	- 53 dBm

FCC ID: CASTMBHKB Page 93 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018

TEST EQUIPMENT LIST


Equipment Type	Information	Manufacturer	Model No	Serial No#	Tait ID	Cal Due
Antenna	Reference Dipoles	Emco	3121C DB1	9510-1164	E3559	14-Apr-19
Antenna	18GHz DRG	Emco	DRG3115	9512-4638	E3560	15-May-20
Antenna	18GHz DRG	Emco	DRG3115	2084	E3076	
Antenna	Log Periodic	Schwarzbeck	VUSLP	9111-219	E4617	
Antenna	Reverb - 1-18GHz DRG	Schwarzbeck	BBHA 9120 D	9120D-885	E4857	
Antenna	Reverb - 1-18GHz DRG	Schwarzbeck	BBHA 9120 D	9120D-884	E4858	
Audio Analyser	TREVA1	Hewlett Packard	HP8903A	2437A04625	E4986	28-Sep-18
Coax Cable	2m Black	Suhner	RG214HF/Nm/ Nm/2000	TeltestBlack2	E4623	20-Dec-18
Coax Cable	2m Black	Suhner	RG214HF/Nm/ Nm/2000	TeltestBlack3	E4624	20-Dec-18
Coax Cable	2m Black	Suhner	RG214HF/Nm/ Nm/2000	TeltestBlack4	E4653	21-Dec-18
Coax Cable	OATS Turntable Cable 1	Intelcom	RG214	OATS1	E4621	1-Jan-19
Coax Cable	OATS Tower Cable	Intelcom	RG214	OATS2	E4622	1-Jan-19
Coax Cable	2m Black	Suhner	RG214HF/Nm/ Nm/2000	TeltestBlack5	E4850	20-Dec-18
Coax Cable	2m Black	Suhner	RG214HF/Nm/ Nm/2000	TeltestBlack6	E4849	20-Dec-18
Coax Cable	Reverb - 4.5m Multiflex 141	TeltestBlue6	MF 141	TeltestBlue6	E4843	20-Dec-18
Coax Cable	Reverb - 2m Multiflex 141	TeltestBlue5	MF 141	TeltestBlue5	E4844	20-Dec-18
Coax Cable	Reverb - 2m Multiflex 141	TeltestBlue4	MF 141	TeltestBlue4	E4845	20-Dec-18
Coax Cable	Reverb - 1m Multiflex 141	TeltestBlue2	MF 141	TeltestBlue2	E4847	20-Dec-18
Coax Cable	Reverb - 1m Multiflex 141	TeltestBlue1	MF 141	TeltestBlue1	E4848	20-Dec-18
Coax Cable	OATS Turntable Cable 2	Intelcom	RG215	OATS3	E4995	1-Jan-19
Coax Cable	2m Black	Suhner	RG214HF/Nm/ Nm/2000	TeltestBlack7	E5004	1-Jan-19
Environ. Chamber	Chest	Contherm	Chest	E3397	E3397	1-Aug-18
Modulation Analyser	TREVA1	Hewlett Packard	HP8901B (Opt 002)	2441A00393	E3073	3-Oct-18
Modulation Analyser	Includes Audio Analyser	Rohde & Schwarz	FMA0852. 8500.52	842541/001	E3554	8-Mar-19
Multimeter		Fluke	77	35069359	E3237	26-Sep-18
OATS	NSA	Tait				9-Jul-18
OATS	Antenna Tower	Electrometrics	EM-4720-2	112	E4447	
OATS	Controller	Electrometrics	EM-4700	119	E4445	
OATS	Turntable	Electrometrics	EM-4704A	105	E4446	
OATS	FCC Listing Registration			837095		
Oscilloscope	100 MHz Digital	Tektronics	TDS340	BO13611	E3585	28-Sep-19
Power Meter	TREVA1 Power Head for HP8901	Hewlett Packard	HP11722A	3111A05573	E7054	30-Sep-18
Power Supply		Rohde & Schwarz	NGS M32/10 192.0810.31	Fnr 434	E3556	24-Apr-19
Power Supply	60V/50A/1000W	Hewlett Packard	HP6012B	2524A00616	E3712	30-Sep-19
Power Supply	60V/25A	Agilent	N5767A	3111A05573	E4979	10-Oct-18
Power Supply	40V/38A	Agilent	N5766A	US09E4663L	E4719	26-Sep-19
RF Amplifier	+21.7 dB 1GHz	Tait	ZFL-1000LN	E3660	E3360	17-Apr-19
RF Amplifier	Pre-amplifier	Agilent	87405C	MY47010688	E4941	9-Oct-18
RF Attenuator	30dB 350W	Weinschel	67-30-33	BR0531	E4280	20-Dec-18

FCC ID: CASTMBHKB Page 94 of 96 Report Revision: 1
IC: 737A-TMBHKB Issue Date: 5 June 2018


RF Attenuator	10dB 50W	Weinschel	24-10-34	AZ0401	E3388	20-Dec-18
RF Attenuator	20dB 25W	Weinschel	33-20-33	BD5871	E3673	20-Dec-18
RF Attenuator	TREVA1 3dB	Weinschel	Model 1	BL9958	E4081	20-Dec-18
RF Attenuator	TREVA 1 20dB 150W	Weinschel	40-20-23	MF817	E4082	20-Dec-18
RF Chamber	S-LINE TEM CELL	Rohde & Schwarz	1089.9296.02	338232/003	E3636	
RF Chamber	Reverb - Stirrer controller for reverb chamber	Teseq	Stirrer Controller	29765.1	E4854	
RF Chamber	Reverb - 0.5 - 18GHz Reverberation Chamber	Teseq	RVC XS	29765	E4855	
RF Combiner	TREVA1	Minicircuits	ZFSC-4-1	-	E4083	
RF Load	50W	Weinschel	F1426	BF0487	E3675	20-Dec-18
Signal Generator	Analog 1GHz	Hewlett Packard	HP8648A	3430U00344	E3579	25-Sep-18
Signal Generator	Analog 4GHz	Agilent	E4422B	GB40050320	E3788	28-Sep-18
Signal Generator	TREVA1 Analog 3.2GHz	Agilent	E8663D	MY50420224	E4908	20-Oct-18
Spectrum Analyser	26.5GHz	Agilent	PXA N9030A	MY49432161	E4907	18-Oct-18
Spectrum Analyser	13.2GHz	Agilent	E4445A	MY42510072	E4139	15-Oct-18
Temp & Humidity Datalogger		Hobo	U21-011	10134276	E4981	22-Apr-19
Testware	Conducted Emissions		March 2019	-	-	
Testware	Frequency Vs Temperature		April 2021	-	-	
Testware	Occupied Bandwidth		5/10/2012	-	-	
Testware	Radiated Emissions		September 2015	-	-	
Testware	Reverb Emissions		March 2020	-	-	
Testware	Sideband Spectrum		February 2017	-	-	
Testware	S-Line Radiated Emissions		May 2016	-	-	
Testware	TREVA		April 2018	-	-	
TREVA 1		Teltest	-	1	-	19-Oct-18

^{*} NOTE: Items without calibration dates are calibrated immediately before use, or set using calibrated instruments.

ANNEX A - TEST SETUP DETAILS

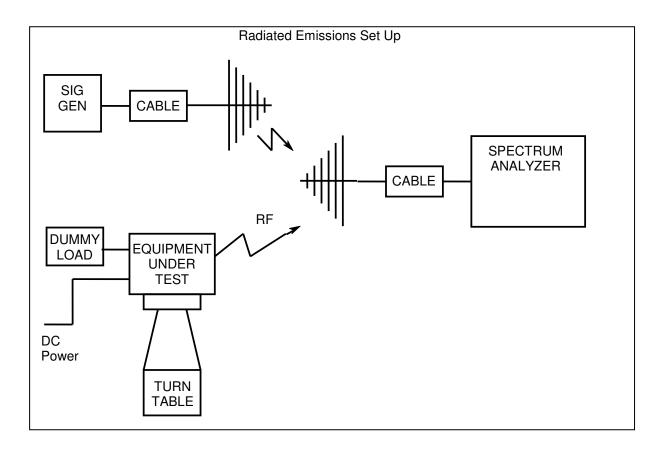

All other testing is performed using the **T**eltest **R**adio **EVA**luation system (TREVA), which is configured as shown below. The Spectrum Analyser is connected to the EUT via the attenuator network for Conducted Emissions testing, and Occupied Bandwidth.

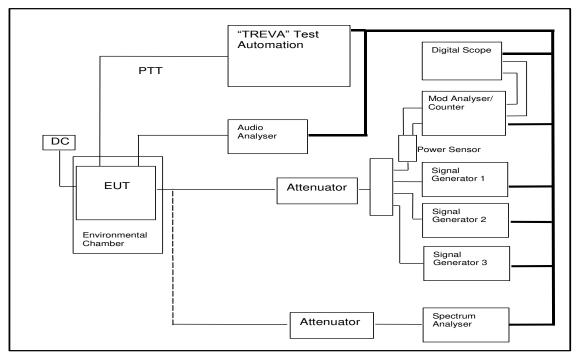

FCC ID: CASTMBHKB IC: 737A-TMBHKB

Page 96 of 96

Report Revision: 1 Issue Date: 5 June 2018