



Appendix L: Test Data for E-UTRA Band 41

Product Name: GNSS Receiver

Test Model: A100 Pro

Environmental Conditions

Temperature:	23.8 ° C
Relative Humidity:	52.1%
ATM Pressure:	100.0 kPa
Test Engineer:	Paddi Chen
Supervised by:	Nick Peng





L.1 Conducted Power Output Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	23.37	PASS
Band41	5MHz	16QAM	39675	1RB#0	22.72	PASS
Band41	5MHz	QPSK	39675	1RB#12	23.3	PASS
Band41	5MHz	16QAM	39675	1RB#12	22.84	PASS
Band41	5MHz	QPSK	39675	1RB#24	23.32	PASS
Band41	5MHz	16QAM	39675	1RB#24	23.17	PASS
Band41	5MHz	QPSK	39675	12RB#0	22.3	PASS
Band41	5MHz	16QAM	39675	12RB#0	21.6	PASS
Band41	5MHz	QPSK	39675	12RB#6	22.29	PASS
Band41	5MHz	16QAM	39675	12RB#6	21.68	PASS
Band41	5MHz	QPSK	39675	12RB#13	22.24	PASS
Band41	5MHz	16QAM	39675	12RB#13	21.61	PASS
Band41	5MHz	QPSK	39675	25RB#0	22.29	PASS
Band41	5MHz	16QAM	39675	25RB#0	21.78	PASS
Band41	5MHz	QPSK	40620	1RB#0	23.38	PASS
Band41	5MHz	16QAM	40620	1RB#0	23.17	PASS
Band41	5MHz	QPSK	40620	1RB#12	23.29	PASS
Band41	5MHz	16QAM	40620	1RB#12	23	PASS
Band41	5MHz	QPSK	40620	1RB#24	23.45	PASS
Band41	5MHz	16QAM	40620	1RB#24	23.17	PASS
Band41	5MHz	QPSK	40620	12RB#0	22.28	PASS
Band41	5MHz	16QAM	40620	12RB#0	21.58	PASS
Band41	5MHz	QPSK	40620	12RB#6	22.31	PASS
Band41	5MHz	16QAM	40620	12RB#6	21.67	PASS
Band41	5MHz	QPSK	40620	12RB#13	22.41	PASS
Band41	5MHz	16QAM	40620	12RB#13	21.75	PASS
Band41	5MHz	QPSK	40620	25RB#0	22.44	PASS
Band41	5MHz	16QAM	40620	25RB#0	21.88	PASS
Band41	5MHz	QPSK	41565	1RB#0	22.99	PASS
Band41	5MHz	16QAM	41565	1RB#0	22.56	PASS
Band41	5MHz	QPSK	41565	1RB#12	22.99	PASS
Band41	5MHz	16QAM	41565	1RB#12	22.8	PASS
Band41	5MHz	QPSK	41565	1RB#24	22.93	PASS
Band41	5MHz	16QAM	41565	1RB#24	22.6	PASS
Band41	5MHz	QPSK	41565	12RB#0	21.83	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	12RB#0	21.17	PASS
Band41	5MHz	QPSK	41565	12RB#6	21.83	PASS
Band41	5MHz	16QAM	41565	12RB#6	21.16	PASS
Band41	5MHz	QPSK	41565	12RB#13	21.89	PASS
Band41	5MHz	16QAM	41565	12RB#13	21.08	PASS
Band41	5MHz	QPSK	41565	25RB#0	21.79	PASS
Band41	5MHz	16QAM	41565	25RB#0	21.15	PASS
Band41	10MHz	QPSK	39700	1RB#0	23.77	PASS
Band41	10MHz	16QAM	39700	1RB#0	23.62	PASS
Band41	10MHz	QPSK	39700	1RB#24	23.7	PASS
Band41	10MHz	16QAM	39700	1RB#24	23.51	PASS
Band41	10MHz	QPSK	39700	1RB#49	23.65	PASS
Band41	10MHz	16QAM	39700	1RB#49	23.49	PASS
Band41	10MHz	QPSK	39700	25RB#0	22.67	PASS
Band41	10MHz	16QAM	39700	25RB#0	21.97	PASS
Band41	10MHz	QPSK	39700	25RB#12	22.69	PASS
Band41	10MHz	16QAM	39700	25RB#12	21.81	PASS
Band41	10MHz	QPSK	39700	25RB#25	22.28	PASS
Band41	10MHz	16QAM	39700	25RB#25	21.7	PASS
Band41	10MHz	QPSK	39700	50RB#0	22.33	PASS
Band41	10MHz	16QAM	39700	50RB#0	21.74	PASS
Band41	10MHz	QPSK	40620	1RB#0	23.84	PASS
Band41	10MHz	16QAM	40620	1RB#0	23.77	PASS
Band41	10MHz	QPSK	40620	1RB#24	23.69	PASS
Band41	10MHz	16QAM	40620	1RB#24	23.65	PASS
Band41	10MHz	QPSK	40620	1RB#49	23.69	PASS
Band41	10MHz	16QAM	40620	1RB#49	23.64	PASS
Band41	10MHz	QPSK	40620	25RB#0	22.58	PASS
Band41	10MHz	16QAM	40620	25RB#0	22.01	PASS
Band41	10MHz	QPSK	40620	25RB#12	22.54	PASS
Band41	10MHz	16QAM	40620	25RB#12	22.01	PASS
Band41	10MHz	QPSK	40620	25RB#25	22.56	PASS
Band41	10MHz	16QAM	40620	25RB#25	21.95	PASS
Band41	10MHz	QPSK	40620	50RB#0	22.6	PASS
Band41	10MHz	16QAM	40620	50RB#0	22.02	PASS
Band41	10MHz	QPSK	41540	1RB#0	23.19	PASS
Band41	10MHz	16QAM	41540	1RB#0	22.98	PASS
Band41	10MHz	QPSK	41540	1RB#24	23.26	PASS
Band41	10MHz	16QAM	41540	1RB#24	23.09	PASS
Band41	10MHz	QPSK	41540	1RB#49	23.28	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	16QAM	41540	1RB#49	23.07	PASS
Band41	10MHz	QPSK	41540	25RB#0	22.03	PASS
Band41	10MHz	16QAM	41540	25RB#0	21.4	PASS
Band41	10MHz	QPSK	41540	25RB#12	22.04	PASS
Band41	10MHz	16QAM	41540	25RB#12	21.41	PASS
Band41	10MHz	QPSK	41540	25RB#25	21.95	PASS
Band41	10MHz	16QAM	41540	25RB#25	21.27	PASS
Band41	10MHz	QPSK	41540	50RB#0	21.91	PASS
Band41	10MHz	16QAM	41540	50RB#0	21.27	PASS
Band41	15MHz	QPSK	39725	1RB#0	23.77	PASS
Band41	15MHz	16QAM	39725	1RB#0	23.74	PASS
Band41	15MHz	QPSK	39725	1RB#38	23.63	PASS
Band41	15MHz	16QAM	39725	1RB#38	23.52	PASS
Band41	15MHz	QPSK	39725	1RB#74	23.51	PASS
Band41	15MHz	16QAM	39725	1RB#74	23.45	PASS
Band41	15MHz	QPSK	39725	38RB#0	22.5	PASS
Band41	15MHz	16QAM	39725	38RB#0	22.5	PASS
Band41	15MHz	QPSK	39725	38RB#18	22.5	PASS
Band41	15MHz	16QAM	39725	38RB#18	22.5	PASS
Band41	15MHz	QPSK	39725	38RB#37	22.5	PASS
Band41	15MHz	16QAM	39725	38RB#37	22.62	PASS
Band41	15MHz	QPSK	39725	75RB#0	22.61	PASS
Band41	15MHz	16QAM	39725	75RB#0	21.99	PASS
Band41	15MHz	QPSK	40620	1RB#0	23.88	PASS
Band41	15MHz	16QAM	40620	1RB#0	23.75	PASS
Band41	15MHz	QPSK	40620	1RB#38	23.75	PASS
Band41	15MHz	16QAM	40620	1RB#38	23.63	PASS
Band41	15MHz	QPSK	40620	1RB#74	23.56	PASS
Band41	15MHz	16QAM	40620	1RB#74	23.54	PASS
Band41	15MHz	QPSK	40620	38RB#0	22.55	PASS
Band41	15MHz	16QAM	40620	38RB#0	22.55	PASS
Band41	15MHz	QPSK	40620	38RB#18	22.55	PASS
Band41	15MHz	16QAM	40620	38RB#18	22.56	PASS
Band41	15MHz	QPSK	40620	38RB#37	22.56	PASS
Band41	15MHz	16QAM	40620	38RB#37	22.56	PASS
Band41	15MHz	QPSK	40620	75RB#0	22.54	PASS
Band41	15MHz	16QAM	40620	75RB#0	22	PASS
Band41	15MHz	QPSK	41515	1RB#0	23.2	PASS
Band41	15MHz	16QAM	41515	1RB#0	22.97	PASS
Band41	15MHz	QPSK	41515	1RB#38	23.32	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	41515	1RB#38	23.13	PASS
Band41	15MHz	QPSK	41515	1RB#74	23.35	PASS
Band41	15MHz	16QAM	41515	1RB#74	23.17	PASS
Band41	15MHz	QPSK	41515	38RB#0	21.95	PASS
Band41	15MHz	16QAM	41515	38RB#0	21.96	PASS
Band41	15MHz	QPSK	41515	38RB#18	21.96	PASS
Band41	15MHz	16QAM	41515	38RB#18	21.96	PASS
Band41	15MHz	QPSK	41515	38RB#37	21.96	PASS
Band41	15MHz	16QAM	41515	38RB#37	21.96	PASS
Band41	15MHz	QPSK	41515	75RB#0	21.96	PASS
Band41	15MHz	16QAM	41515	75RB#0	21.35	PASS
Band41	20MHz	QPSK	39750	1RB#0	23.36	PASS
Band41	20MHz	16QAM	39750	1RB#0	22.85	PASS
Band41	20MHz	QPSK	39750	1RB#49	23.17	PASS
Band41	20MHz	16QAM	39750	1RB#49	22.71	PASS
Band41	20MHz	QPSK	39750	1RB#99	23.12	PASS
Band41	20MHz	16QAM	39750	1RB#99	22.65	PASS
Band41	20MHz	QPSK	39750	50RB#0	22.36	PASS
Band41	20MHz	16QAM	39750	50RB#0	21.89	PASS
Band41	20MHz	QPSK	39750	50RB#25	22.37	PASS
Band41	20MHz	16QAM	39750	50RB#25	21.89	PASS
Band41	20MHz	QPSK	39750	50RB#50	22.05	PASS
Band41	20MHz	16QAM	39750	50RB#50	21.6	PASS
Band41	20MHz	QPSK	39750	100RB#0	22.29	PASS
Band41	20MHz	16QAM	39750	100RB#0	21.69	PASS
Band41	20MHz	QPSK	40620	1RB#0	23.54	PASS
Band41	20MHz	16QAM	40620	1RB#0	23.77	PASS
Band41	20MHz	QPSK	40620	1RB#49	23.74	PASS
Band41	20MHz	16QAM	40620	1RB#49	23.44	PASS
Band41	20MHz	QPSK	40620	1RB#99	23.18	PASS
Band41	20MHz	16QAM	40620	1RB#99	23.17	PASS
Band41	20MHz	QPSK	40620	50RB#0	22.77	PASS
Band41	20MHz	16QAM	40620	50RB#0	22.27	PASS
Band41	20MHz	QPSK	40620	50RB#25	22.63	PASS
Band41	20MHz	16QAM	40620	50RB#25	22.25	PASS
Band41	20MHz	QPSK	40620	50RB#50	22.6	PASS
Band41	20MHz	16QAM	40620	50RB#50	22.08	PASS
Band41	20MHz	QPSK	40620	100RB#0	22.69	PASS
Band41	20MHz	16QAM	40620	100RB#0	22	PASS
Band41	20MHz	QPSK	41490	1RB#0	22.91	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	16QAM	41490	1RB#0	23.12	PASS
Band41	20MHz	QPSK	41490	1RB#49	23.15	PASS
Band41	20MHz	16QAM	41490	1RB#49	23.11	PASS
Band41	20MHz	QPSK	41490	1RB#99	22.96	PASS
Band41	20MHz	16QAM	41490	1RB#99	23.13	PASS
Band41	20MHz	QPSK	41490	50RB#0	22.2	PASS
Band41	20MHz	16QAM	41490	50RB#0	21.64	PASS
Band41	20MHz	QPSK	41490	50RB#25	22.22	PASS
Band41	20MHz	16QAM	41490	50RB#25	21.49	PASS
Band41	20MHz	QPSK	41490	50RB#50	22.21	PASS
Band41	20MHz	16QAM	41490	50RB#50	21.58	PASS
Band41	20MHz	QPSK	41490	100RB#0	21.97	PASS
Band41	20MHz	16QAM	41490	100RB#0	21.26	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



L.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	8.50	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	8.81	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	8.97	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	9.67	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	8.64	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	8.81	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	9.10	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	9.74	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	8.27	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	8.74	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	9.06	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	9.82	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	8.23	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	8.67	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.18	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.58	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	8.50	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	8.81	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.93	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.36	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	8.28	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	8.65	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.96	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.80	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	8.24	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	8.41	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	9.19	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	9.91	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	8.40	13	PASS
Band41	15MHz	16QAM	40620	1RB#0	8.76	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	9.31	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	9.90	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	8.16	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	8.78	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Band41	15MHz	QPSK	41515	75RB#0	9.42	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	9.98	13	PASS
Band41	20MHz	QPSK	39750	1RB#0	8.40	13	PASS
Band41	20MHz	16QAM	39750	1RB#0	8.84	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	9.37	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	9.78	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	8.15	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	8.49	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	8.96	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	9.87	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	8.17	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	8.24	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	8.78	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	9.80	13	PASS





Test Graphs

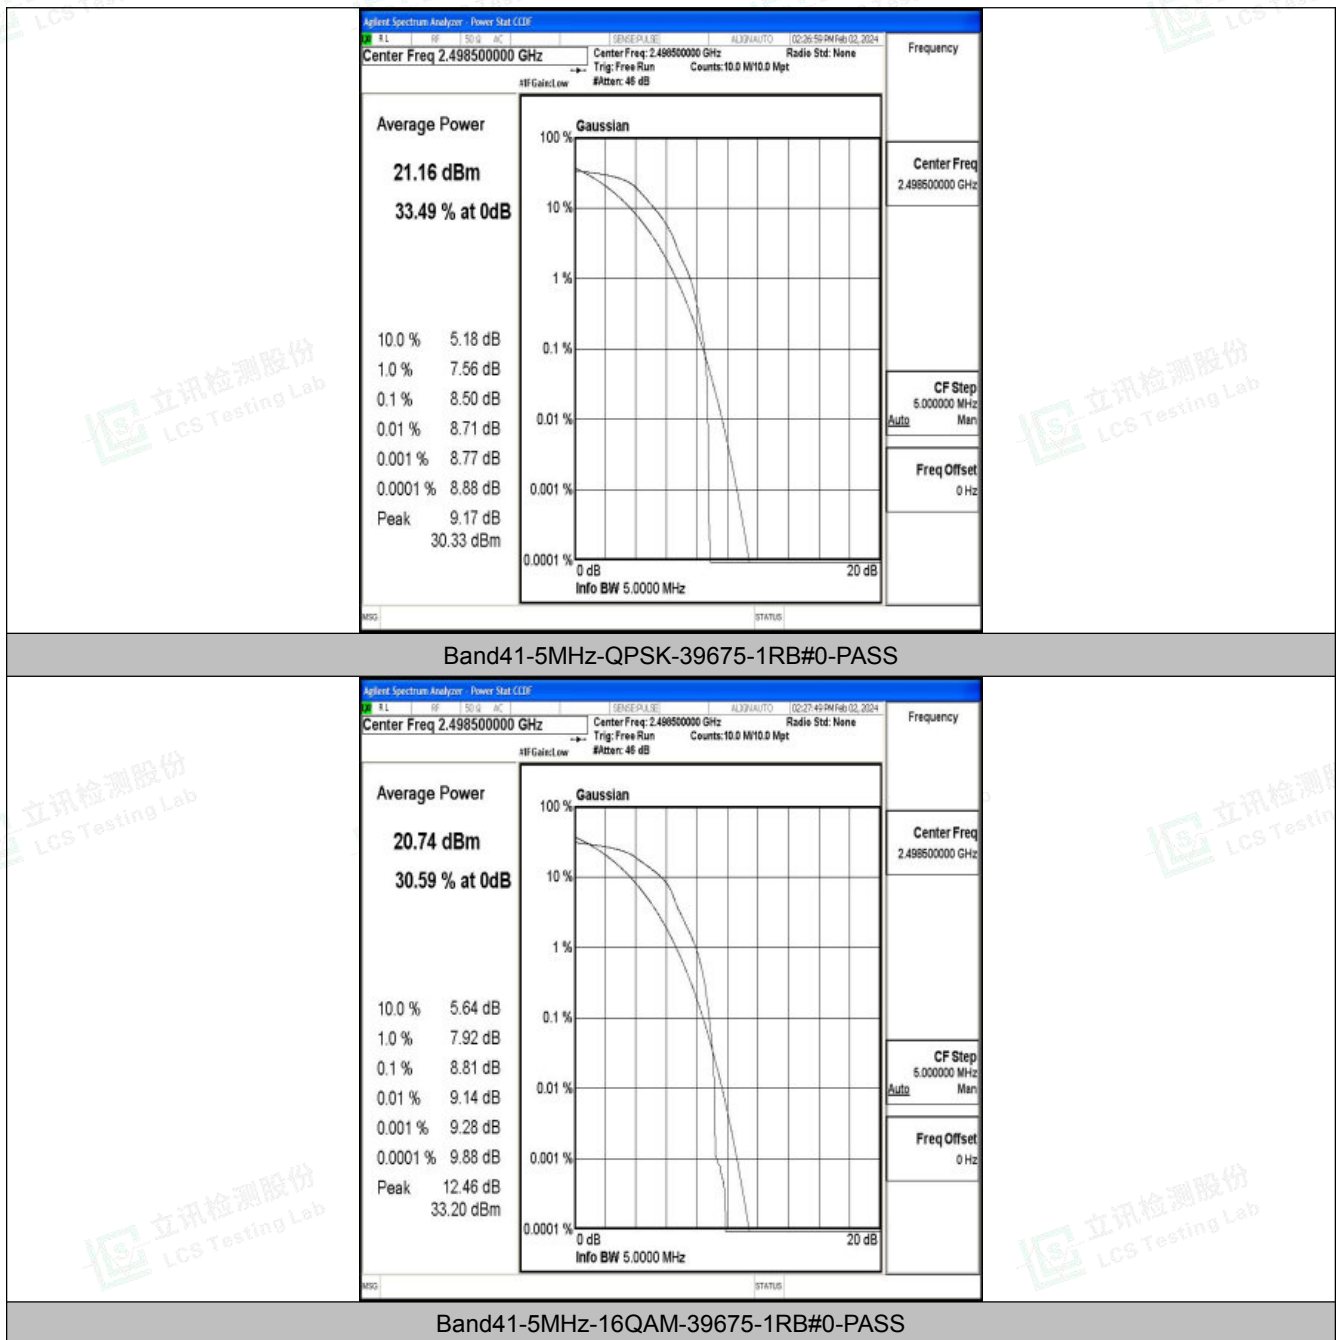


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

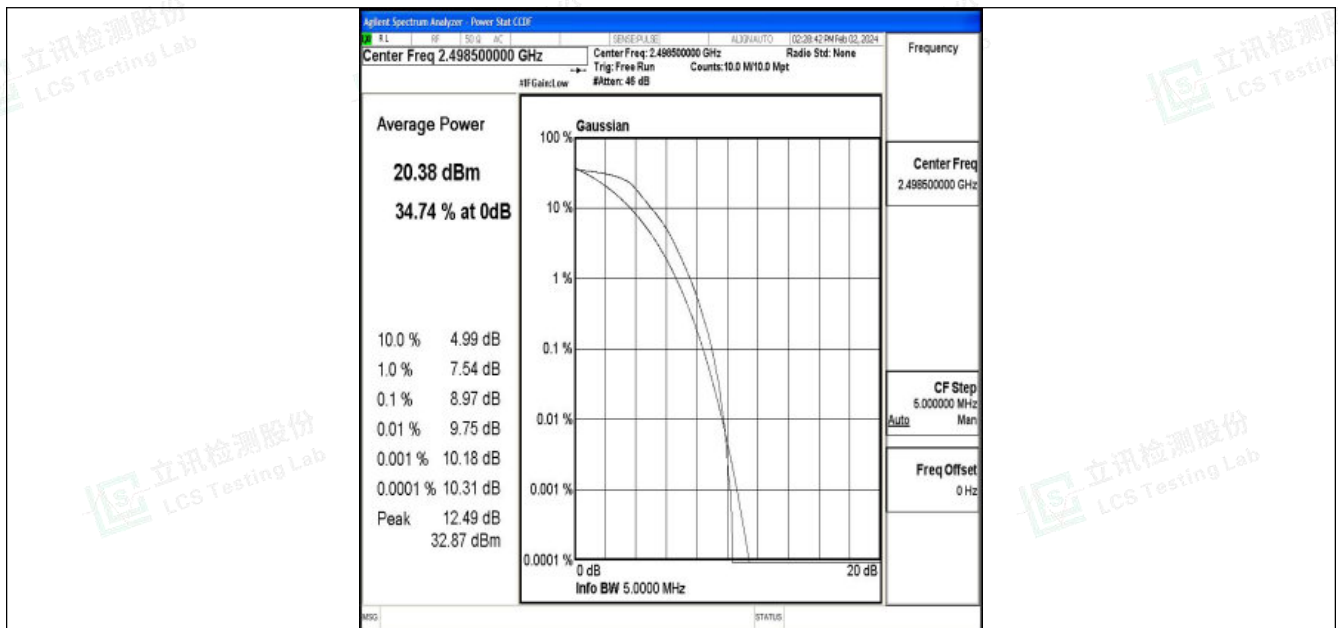

Band41-5MHz-QPSK-39675-25RB#0-PASS

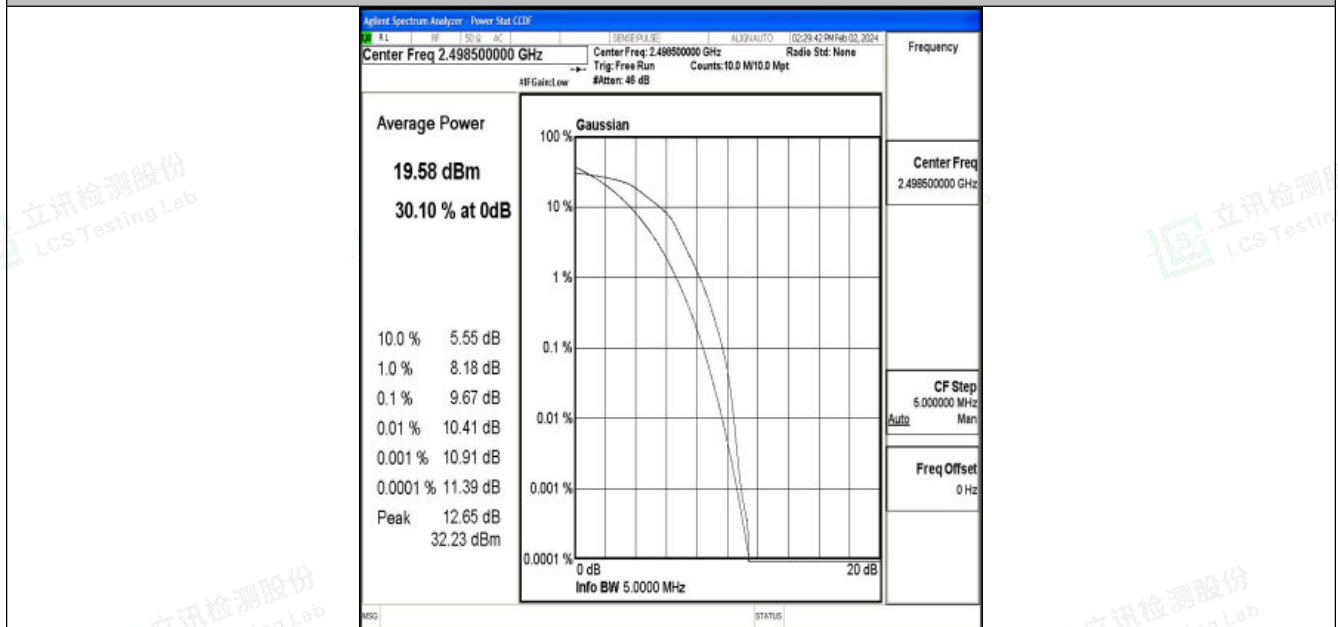

Band41-5MHz-16QAM-39675-25RB#0-PASS





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

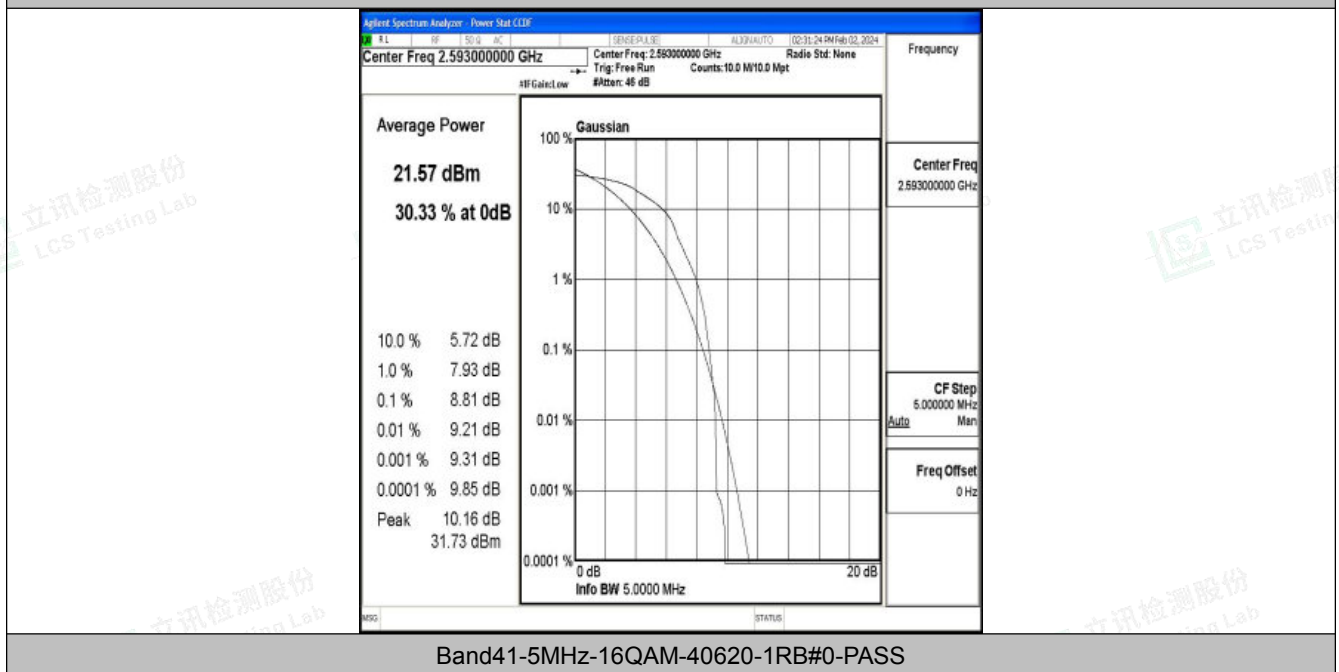
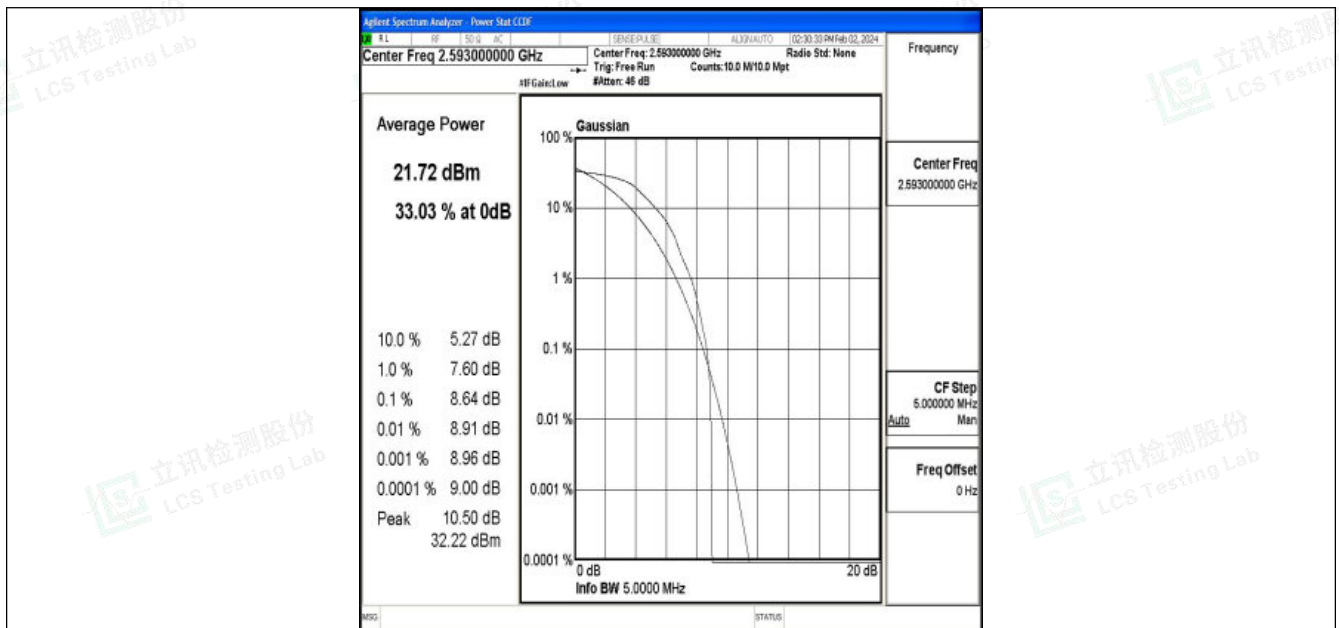


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

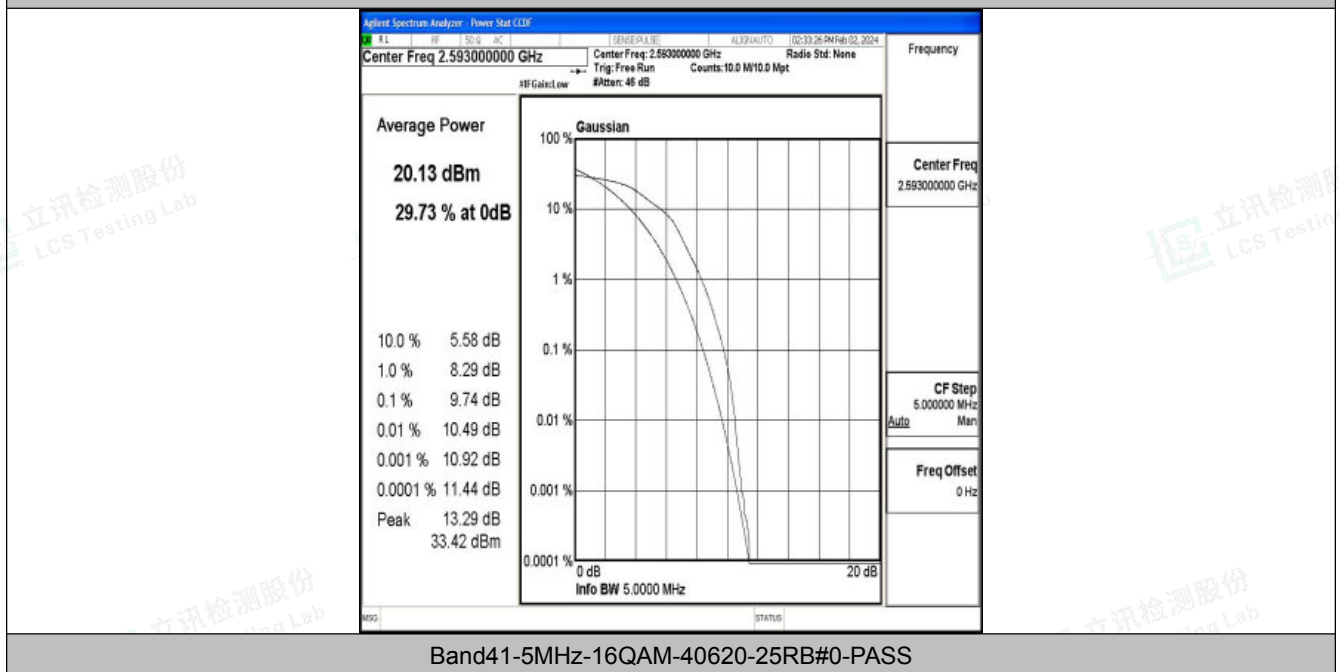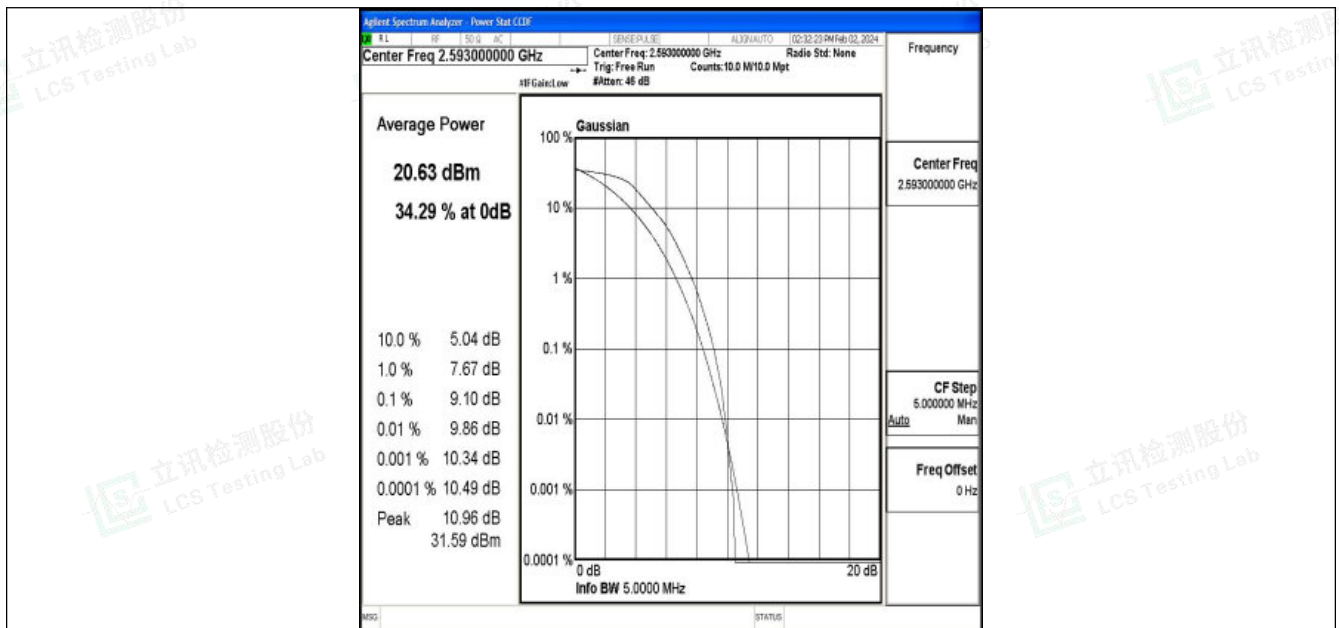


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

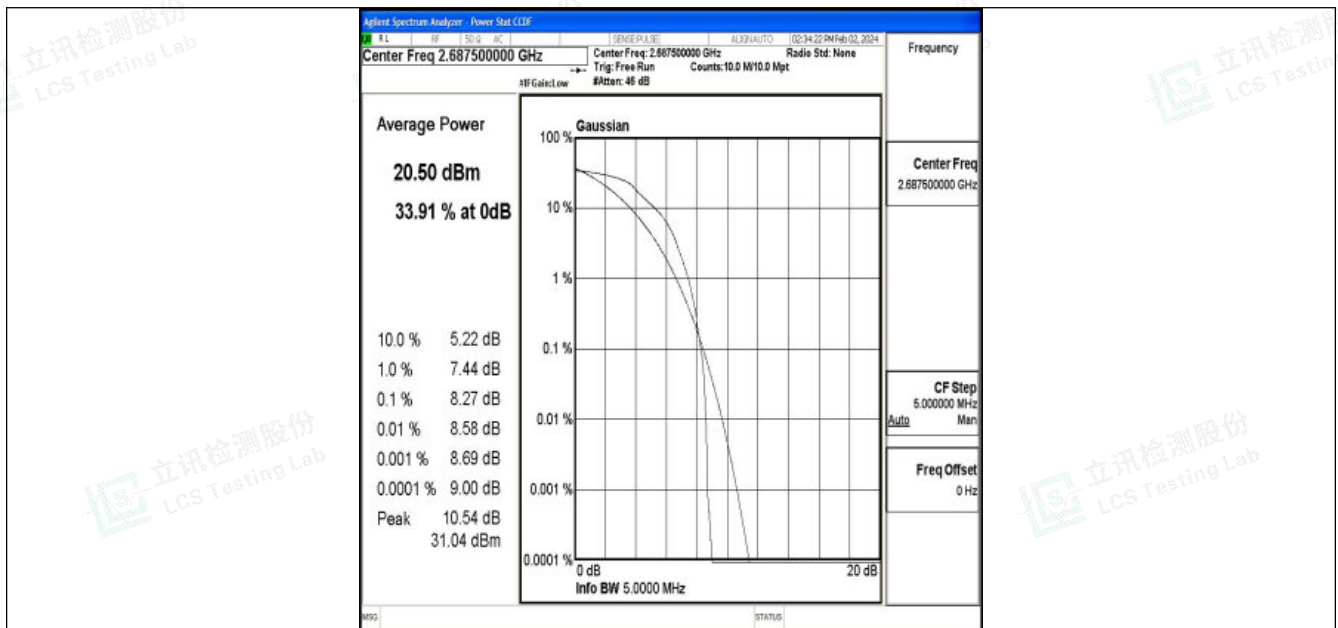

Band41-5MHz-QPSK-41565-1RB#0-PASS

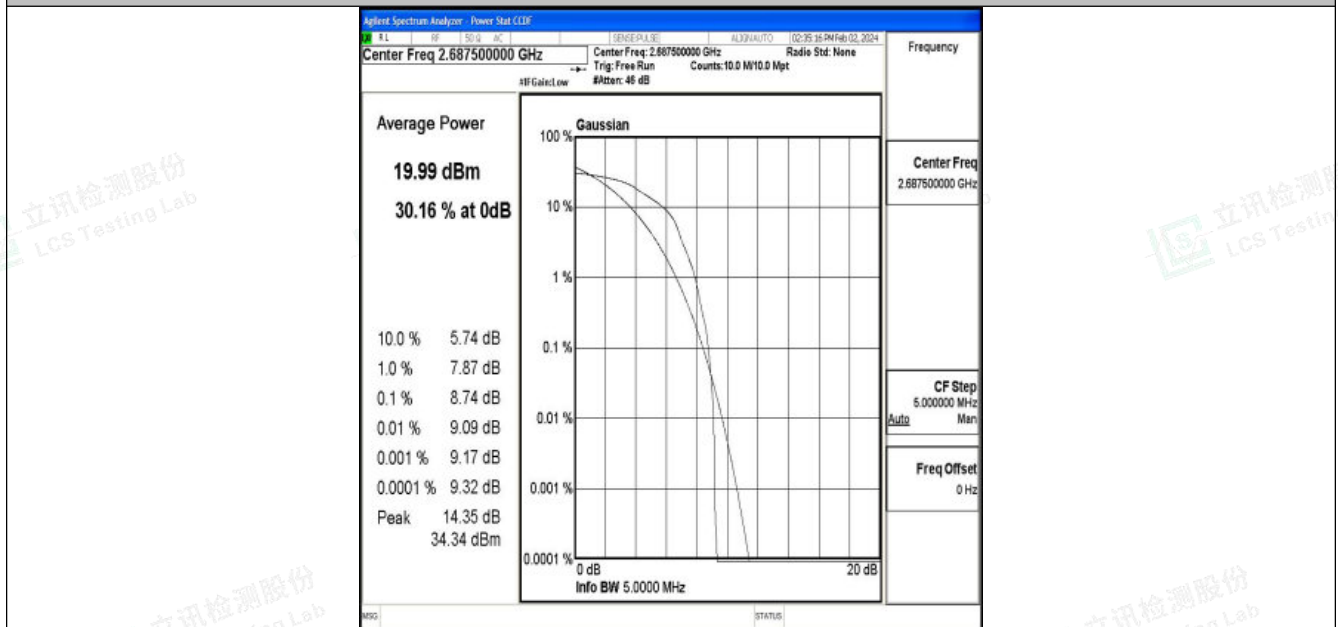

Band41-5MHz-16QAM-41565-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

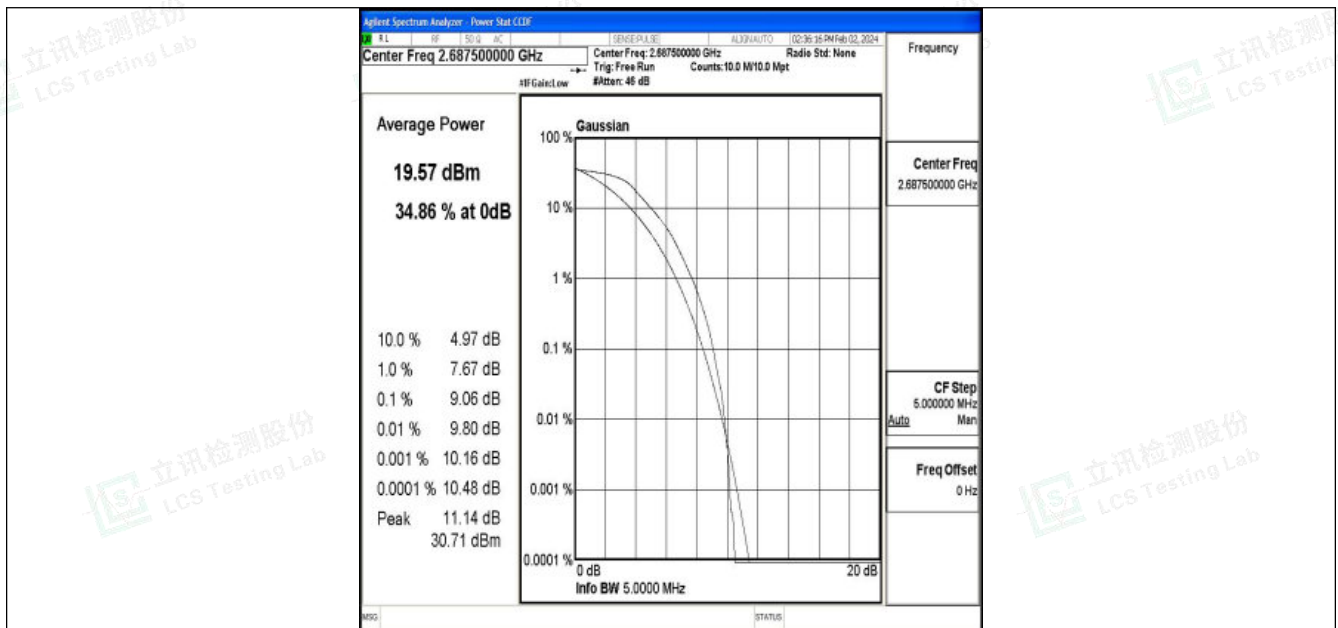

Band41-5MHz-QPSK-41565-25RB#0-PASS

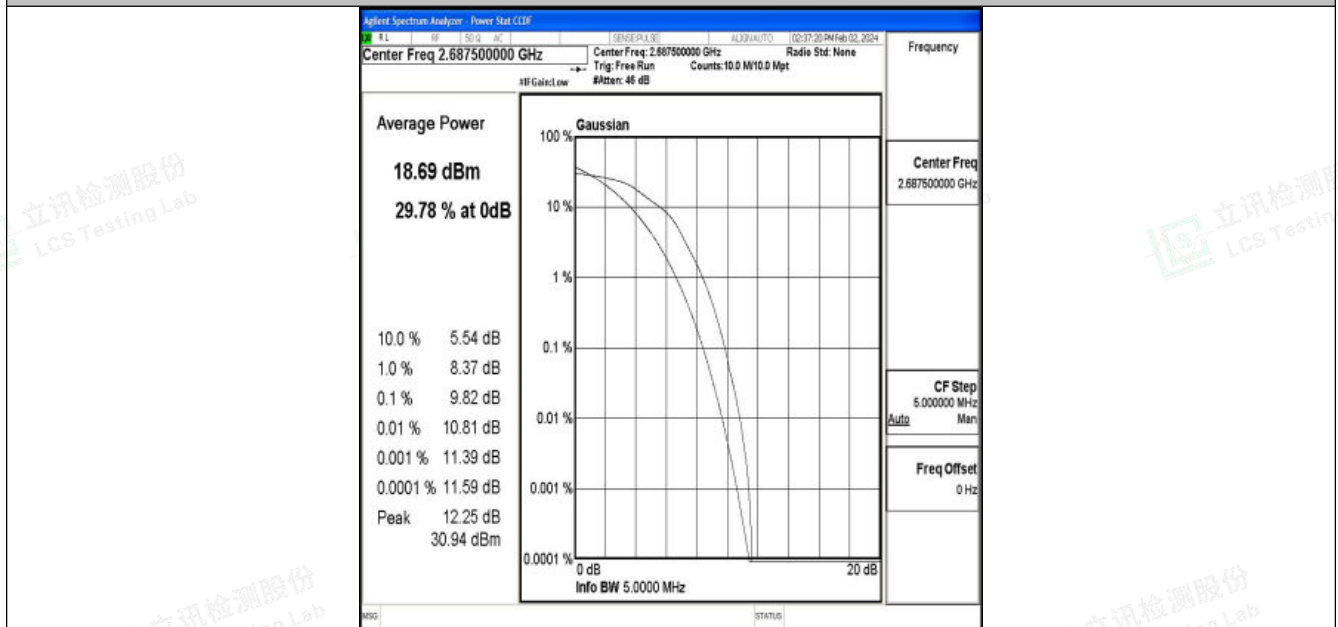

Band41-5MHz-16QAM-41565-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

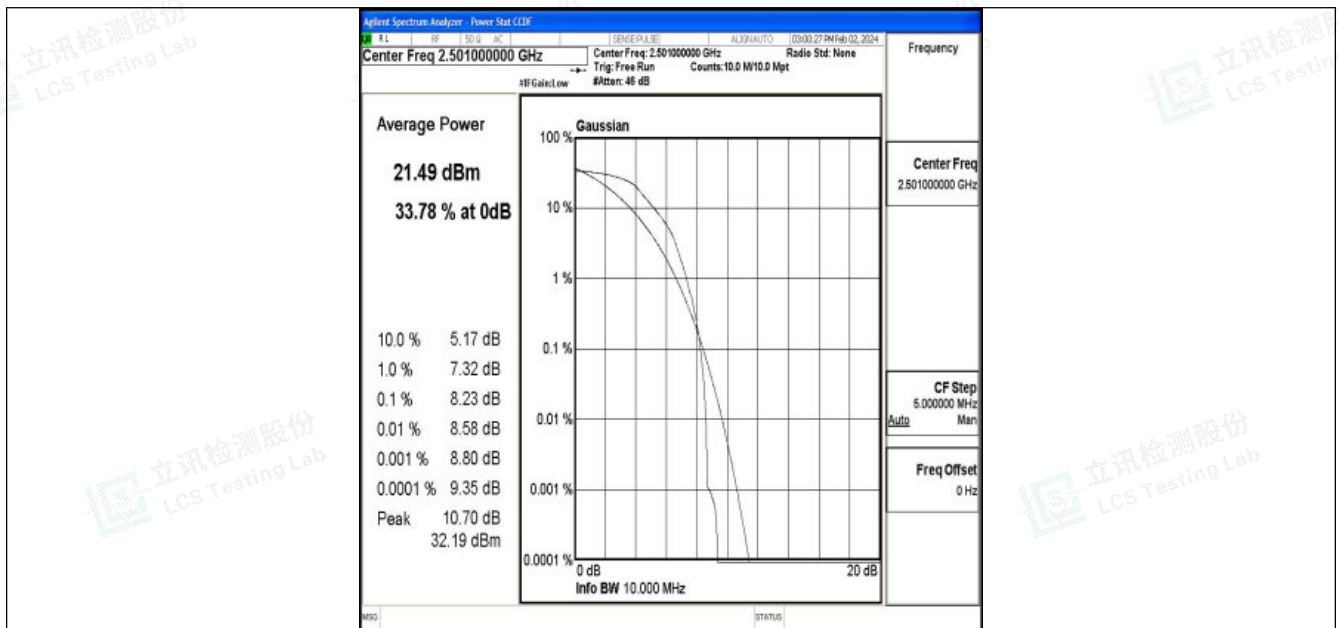

Band41-10MHz-QPSK-39700-1RB#0-PASS

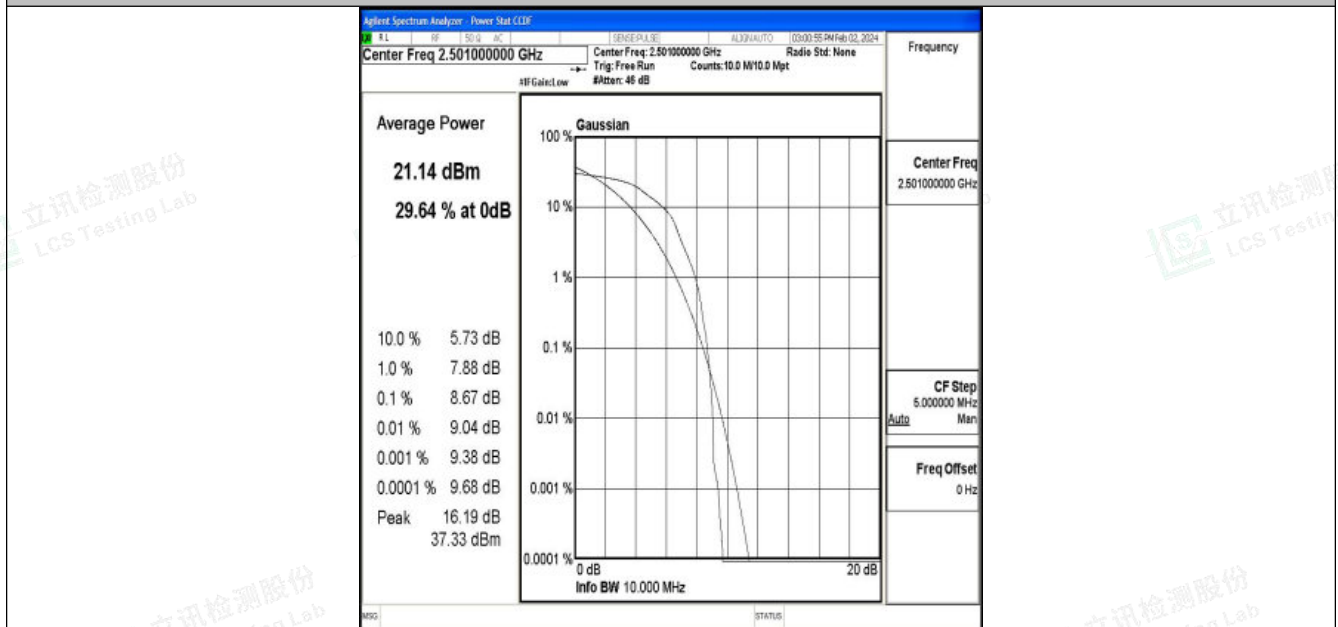

Band41-10MHz-16QAM-39700-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

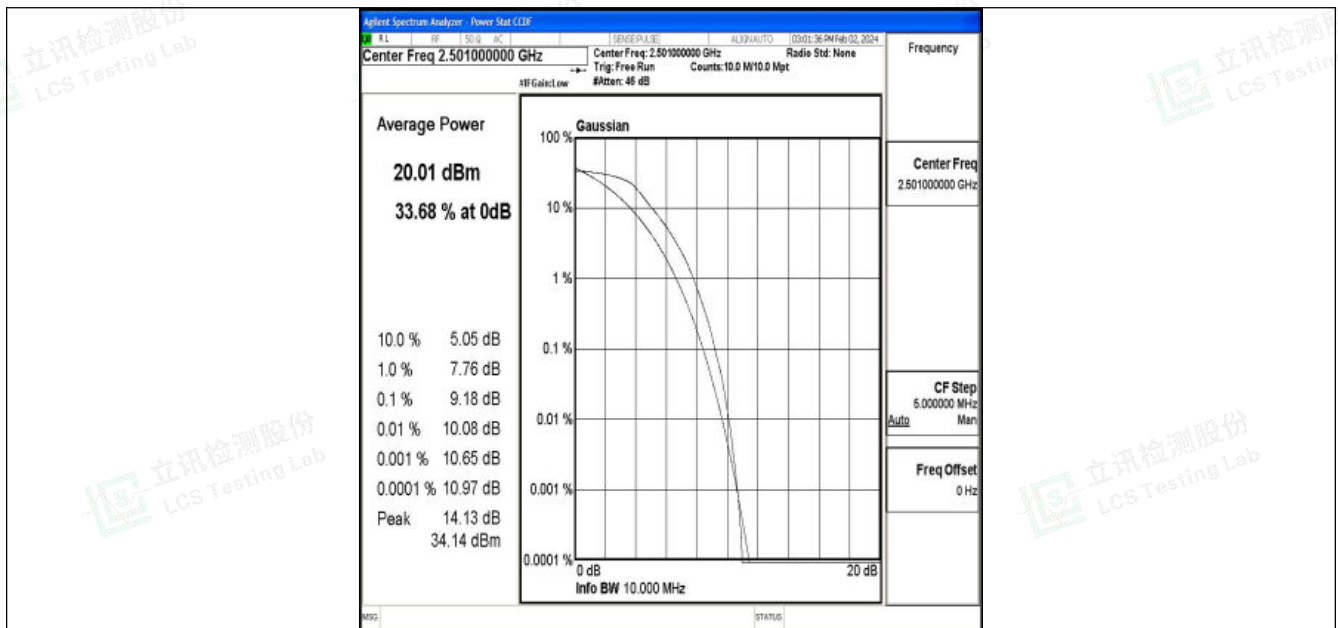

Band41-10MHz-QPSK-39700-50RB#0-PASS

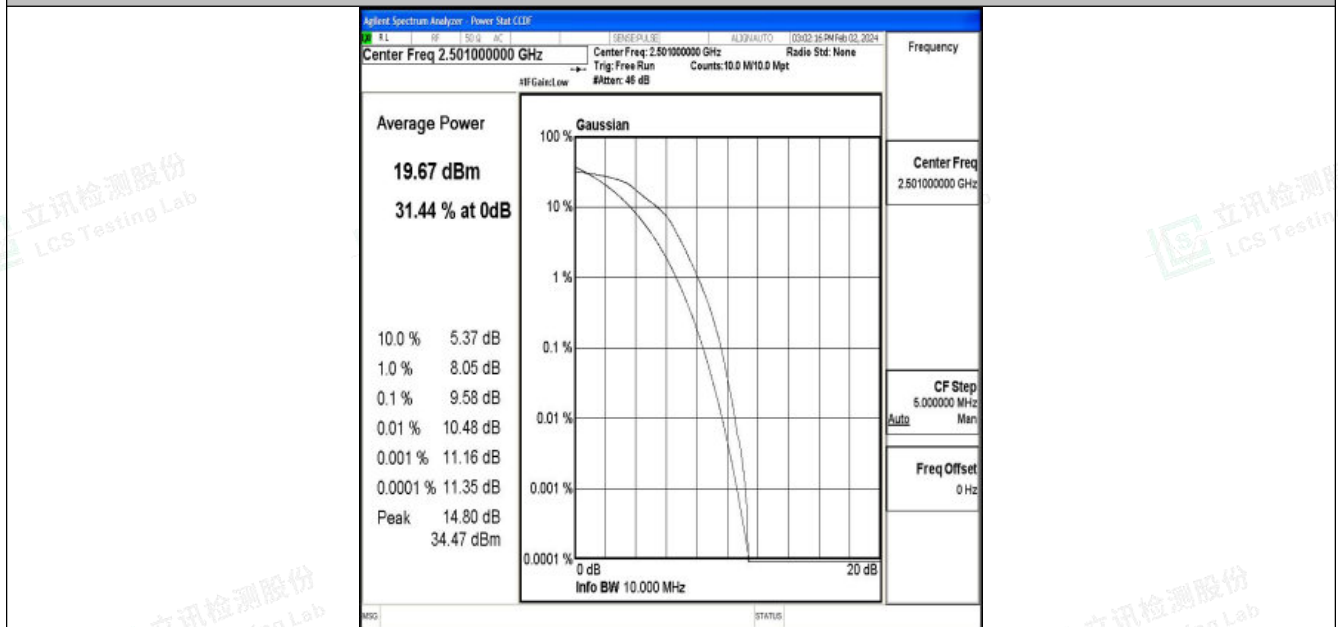

Band41-10MHz-16QAM-39700-50RB#0-PASS





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

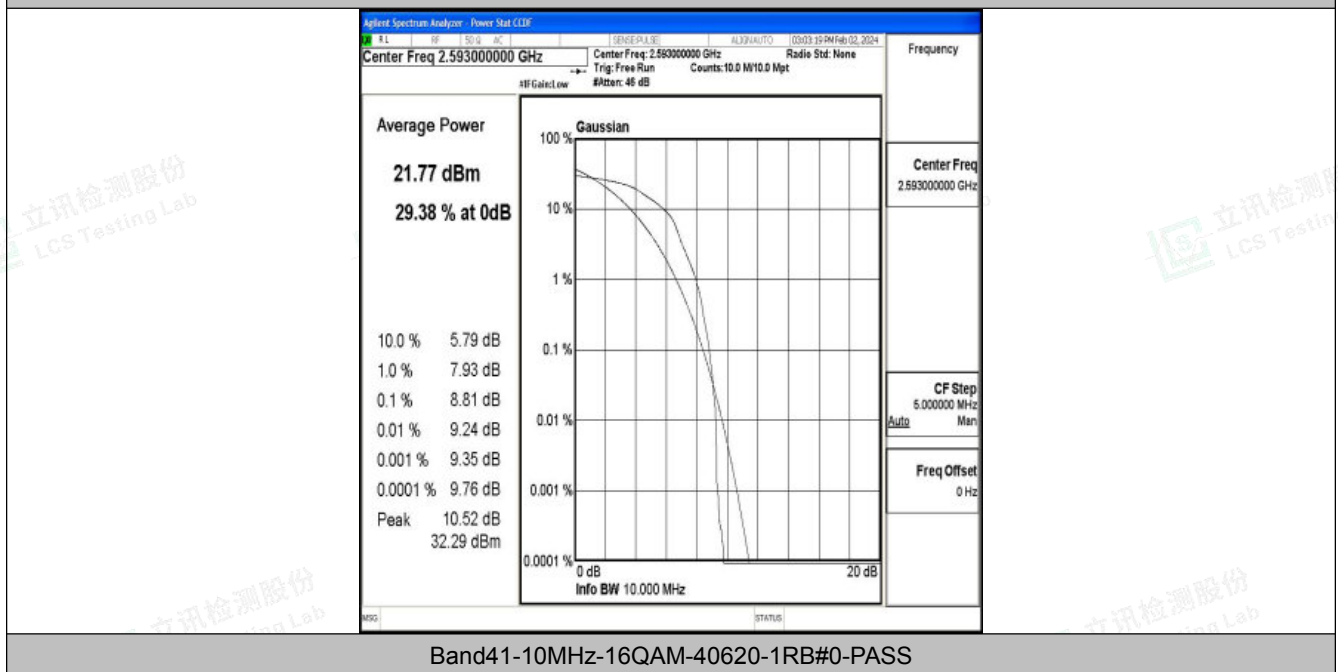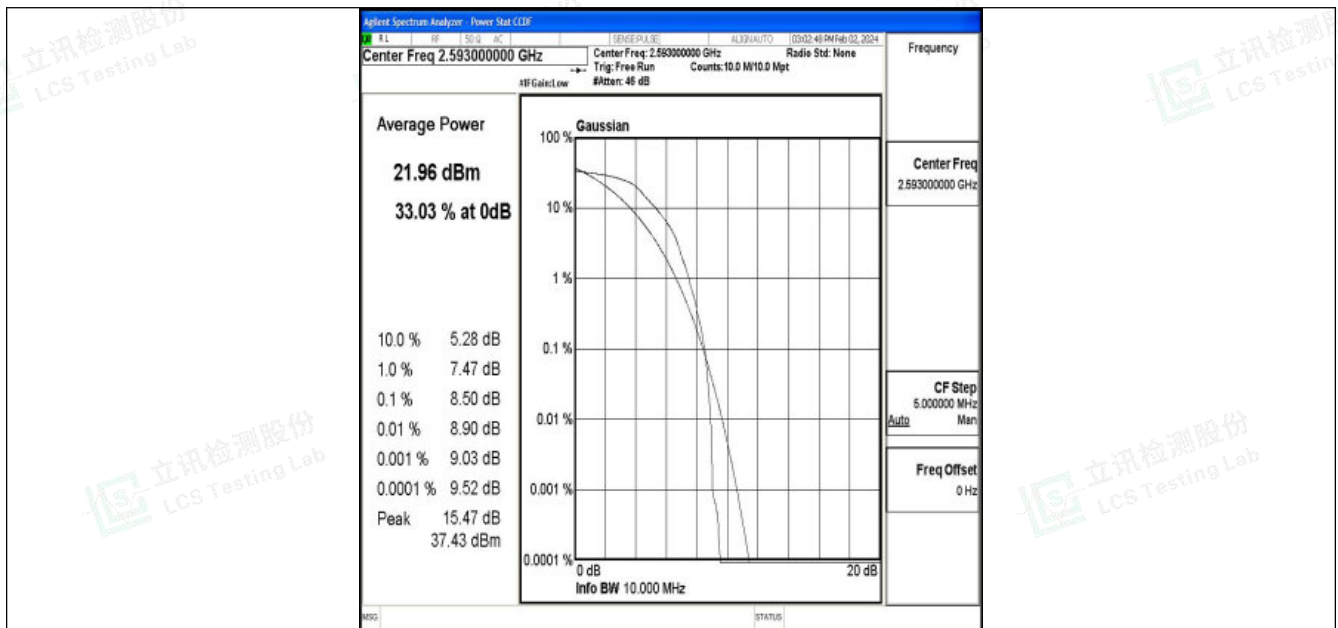


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

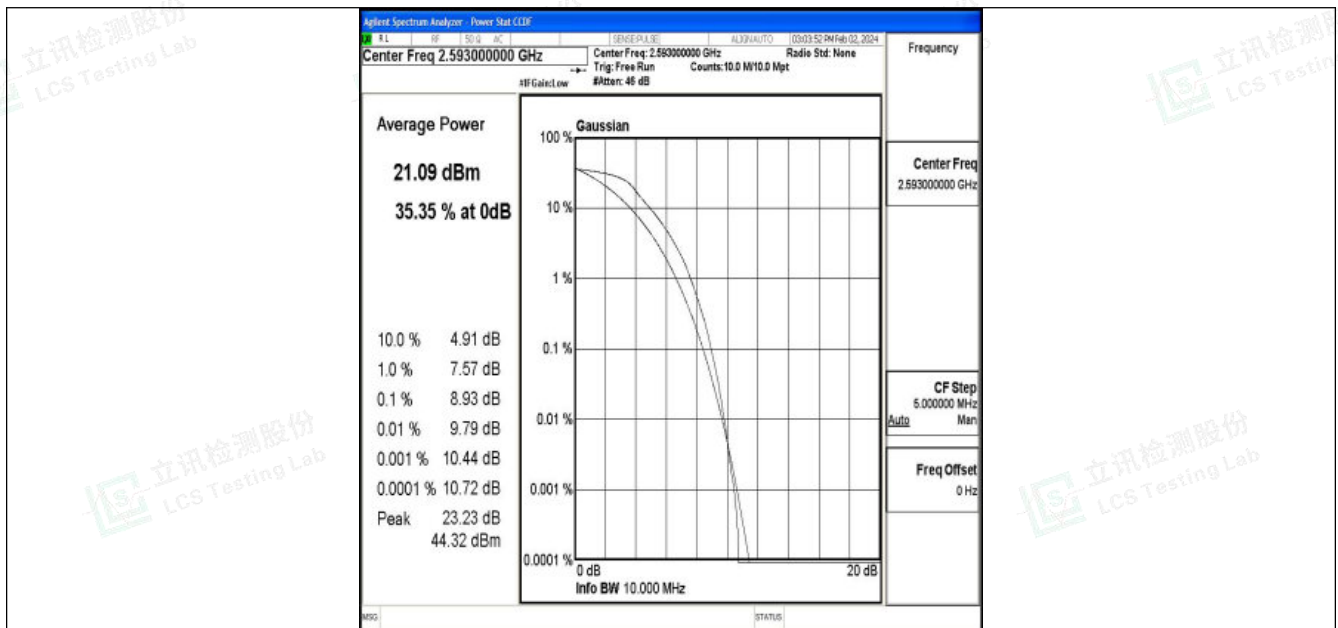

Band41-10MHz-QPSK-40620-50RB#0-PASS

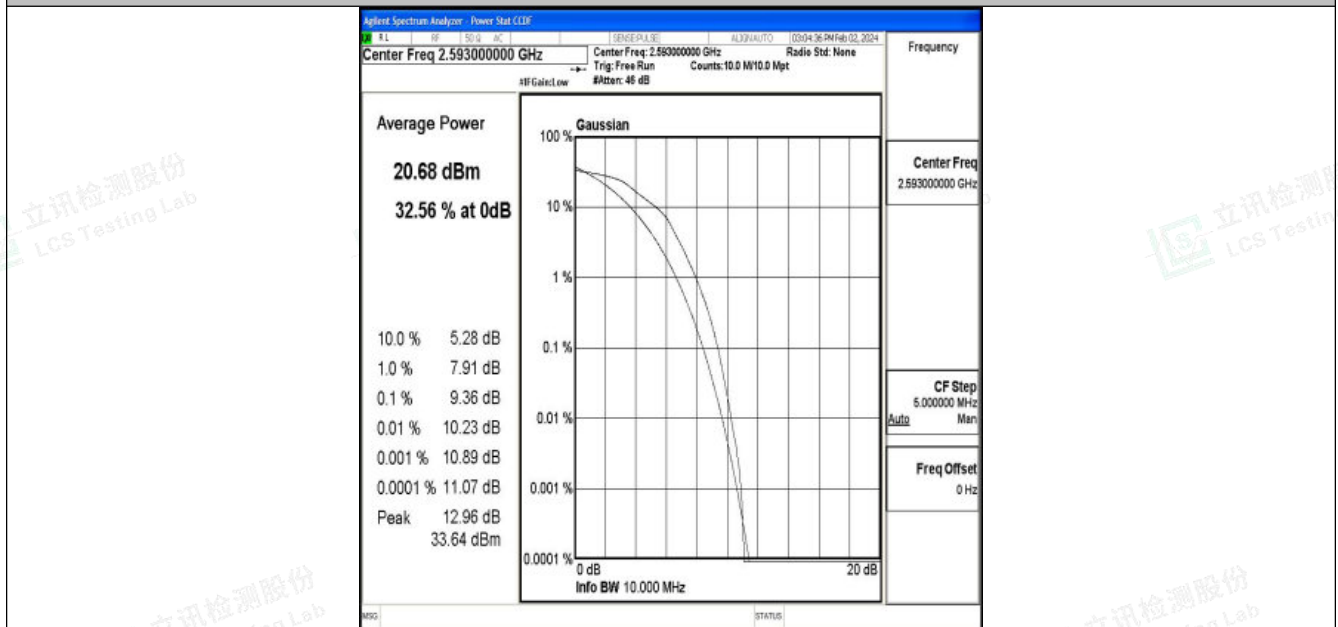

Band41-10MHz-16QAM-40620-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

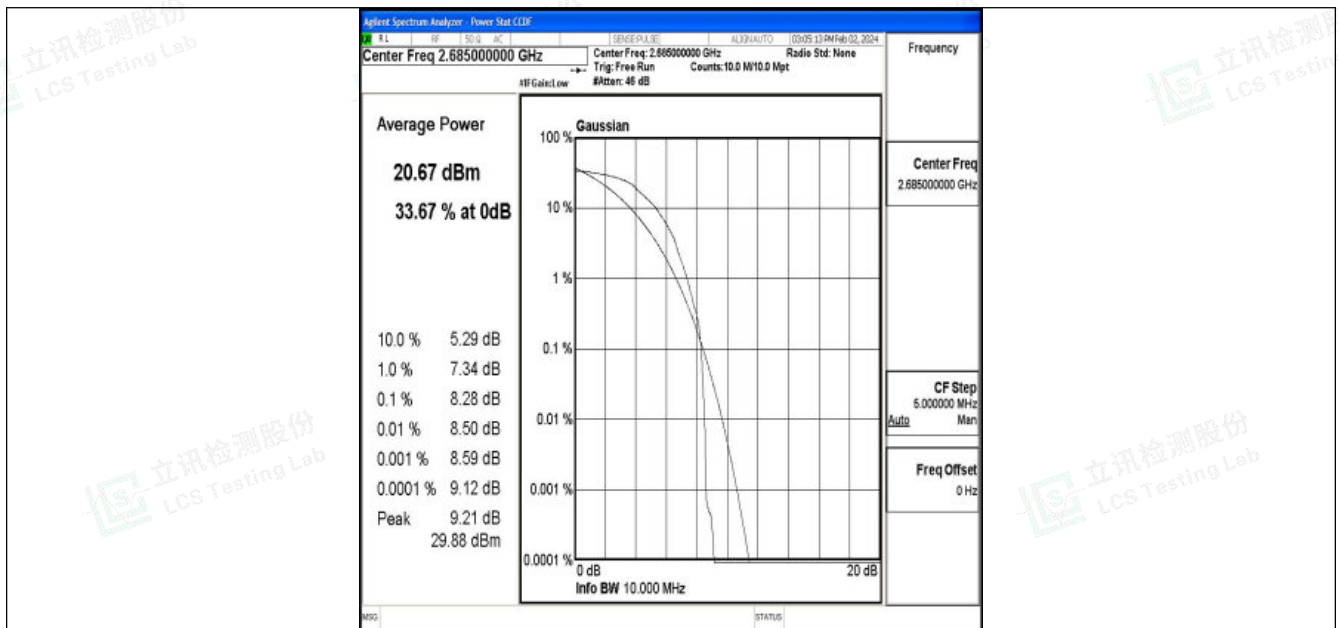

Band41-10MHz-QPSK-41540-1RB#0-PASS

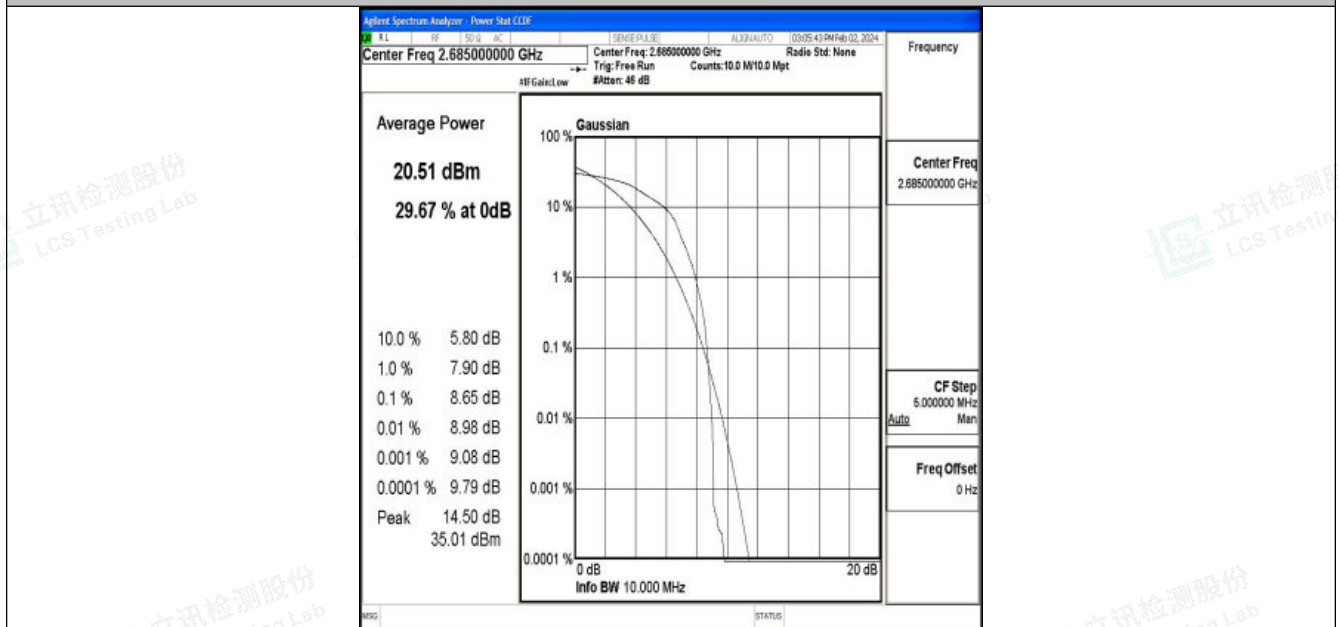

Band41-10MHz-16QAM-41540-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

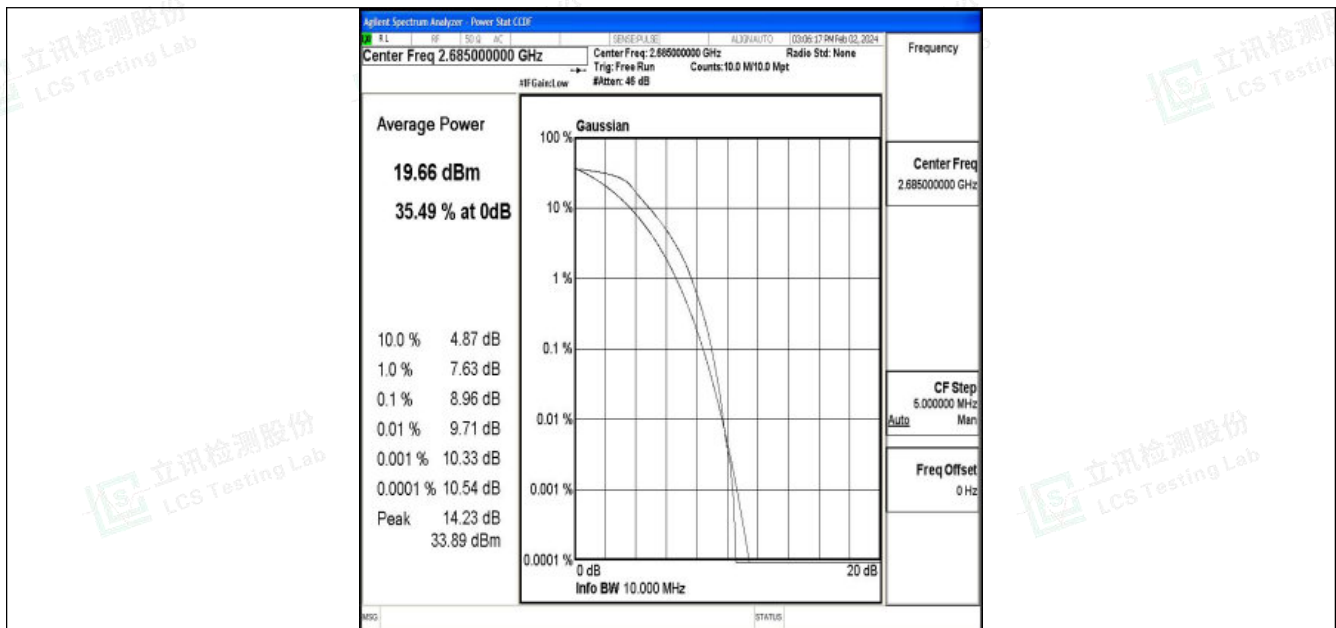

Band41-10MHz-QPSK-41540-50RB#0-PASS

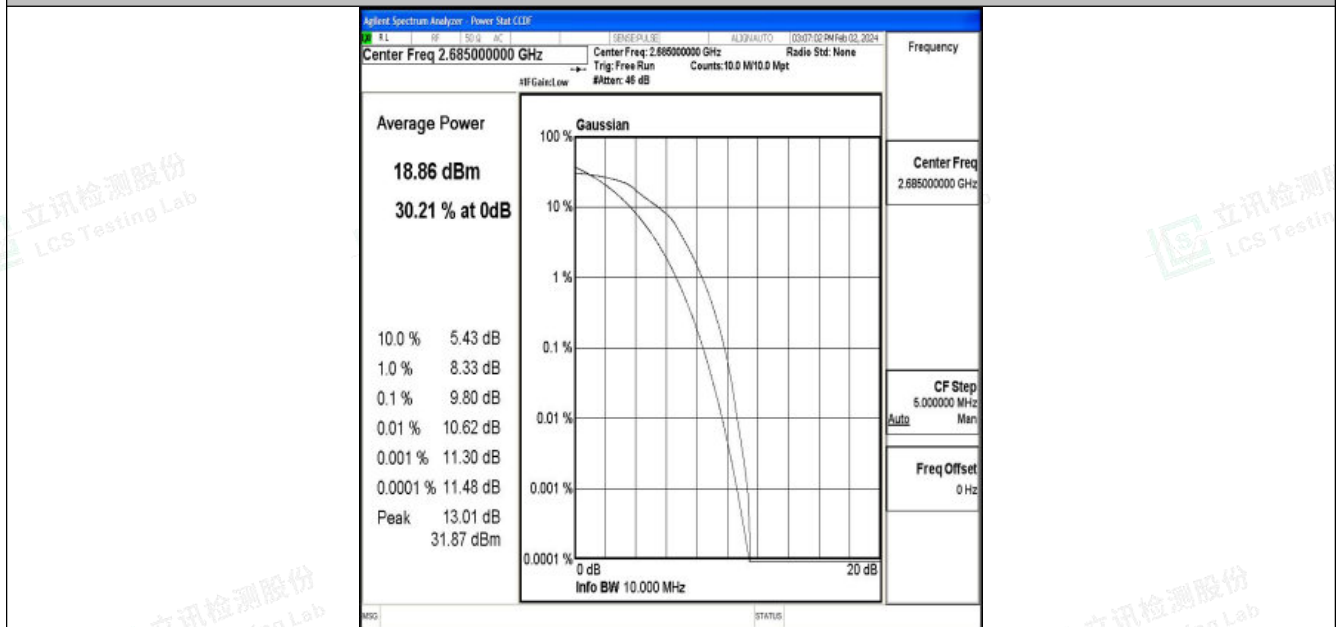

Band41-10MHz-16QAM-41540-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

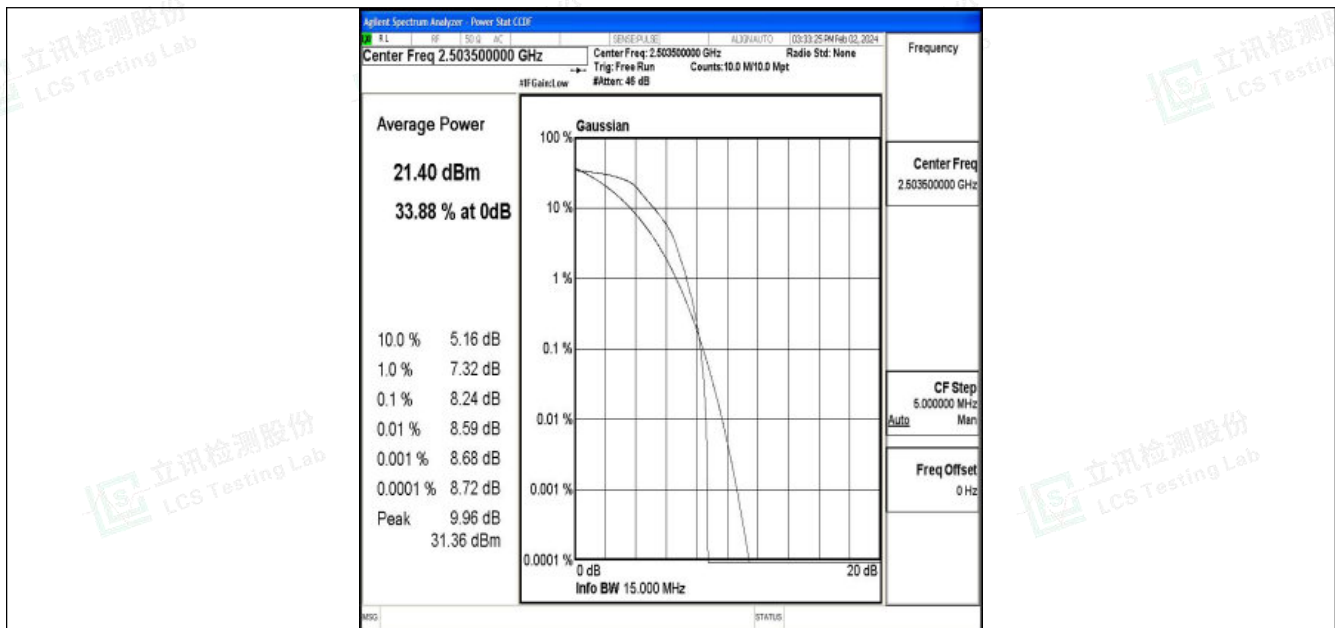

Band41-15MHz-QPSK-39725-1RB#0-PASS

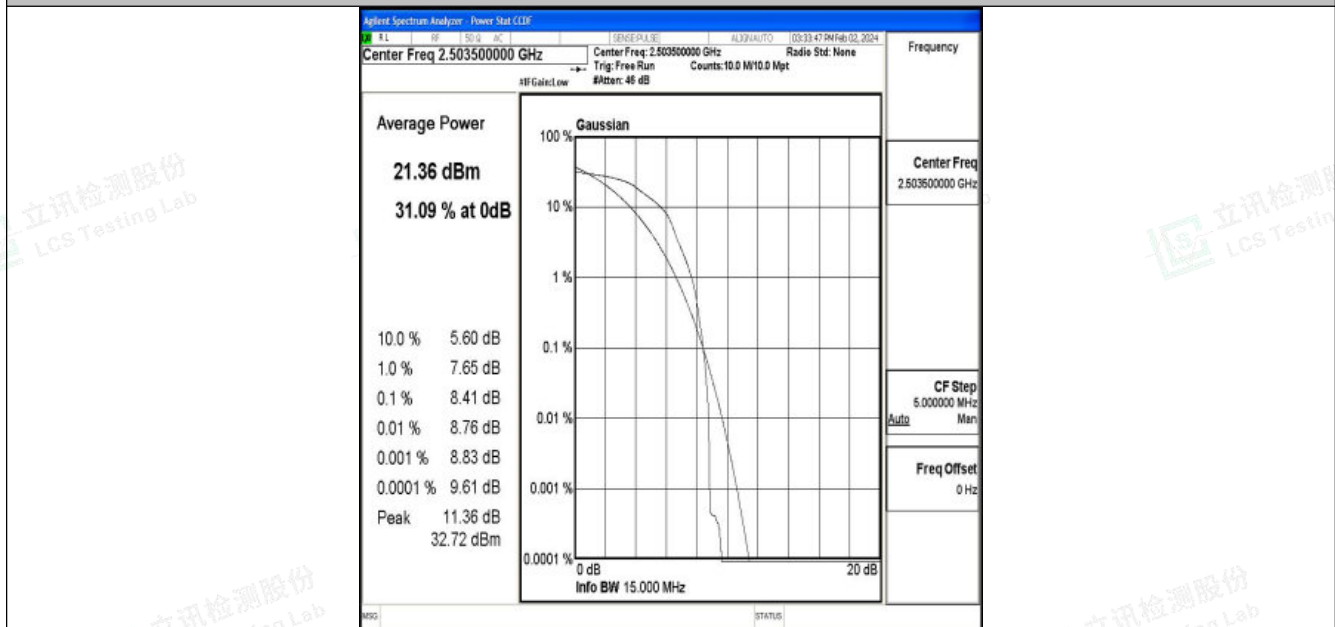

Band41-15MHz-16QAM-39725-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

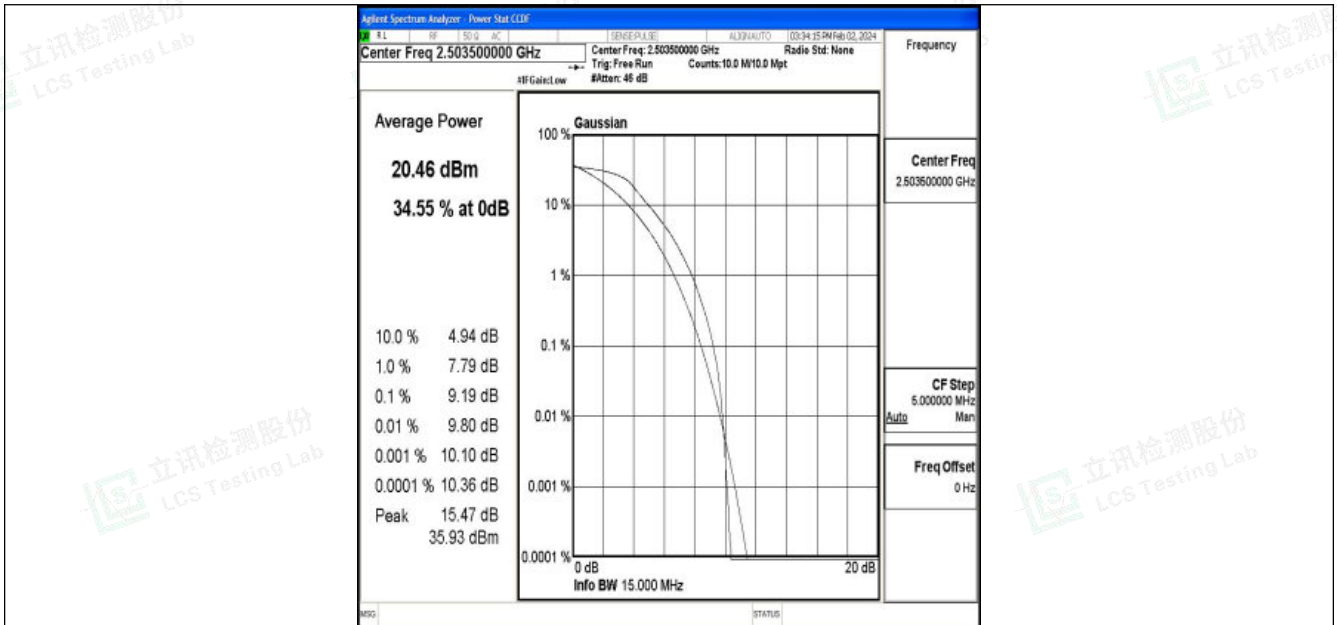

Band41-15MHz-QPSK-39725-75RB#0-PASS

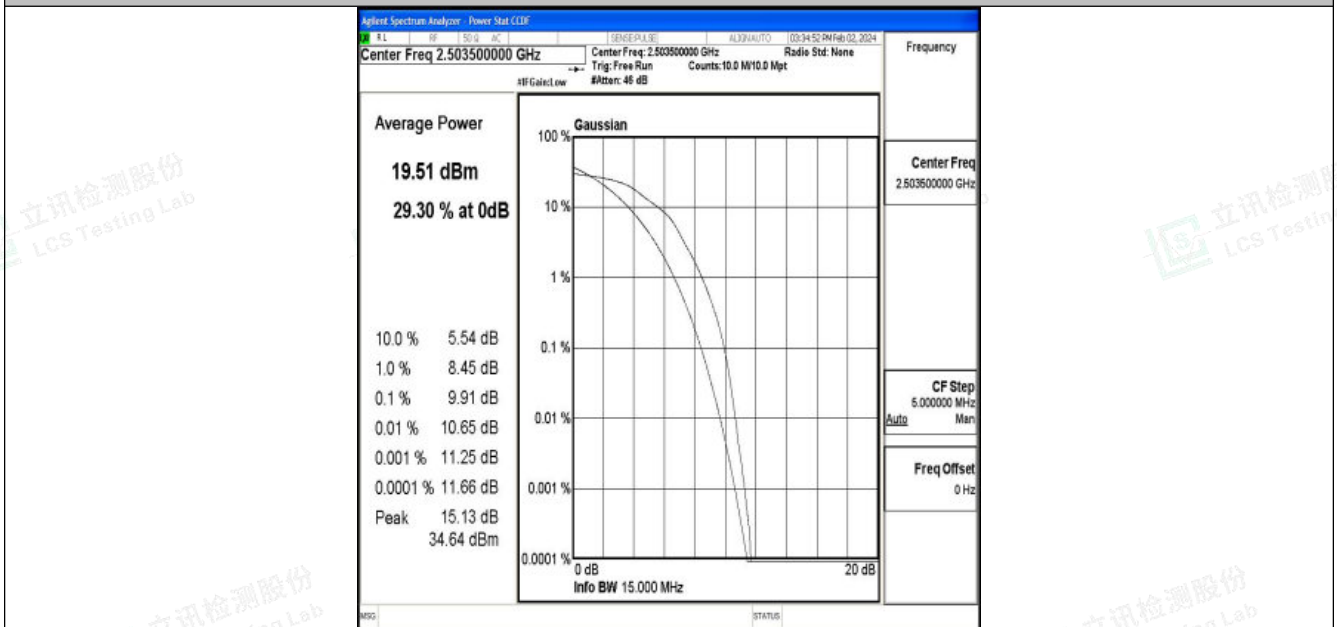

Band41-15MHz-16QAM-39725-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

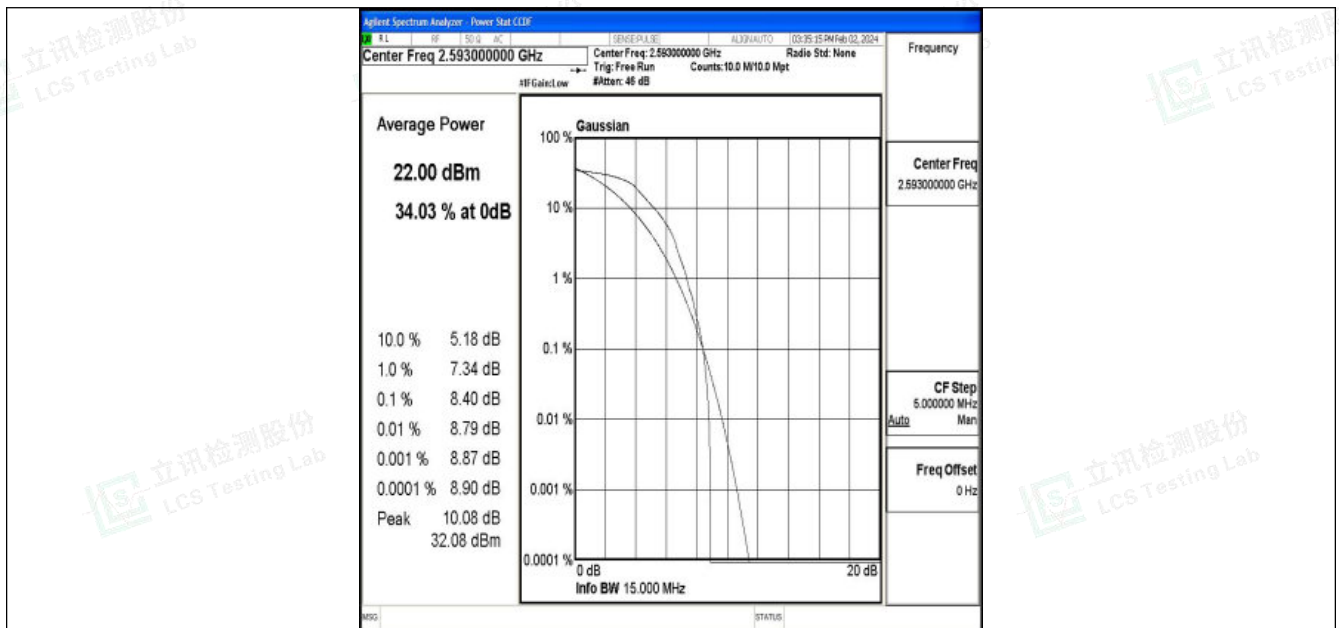

Band41-15MHz-QPSK-40620-1RB#0-PASS

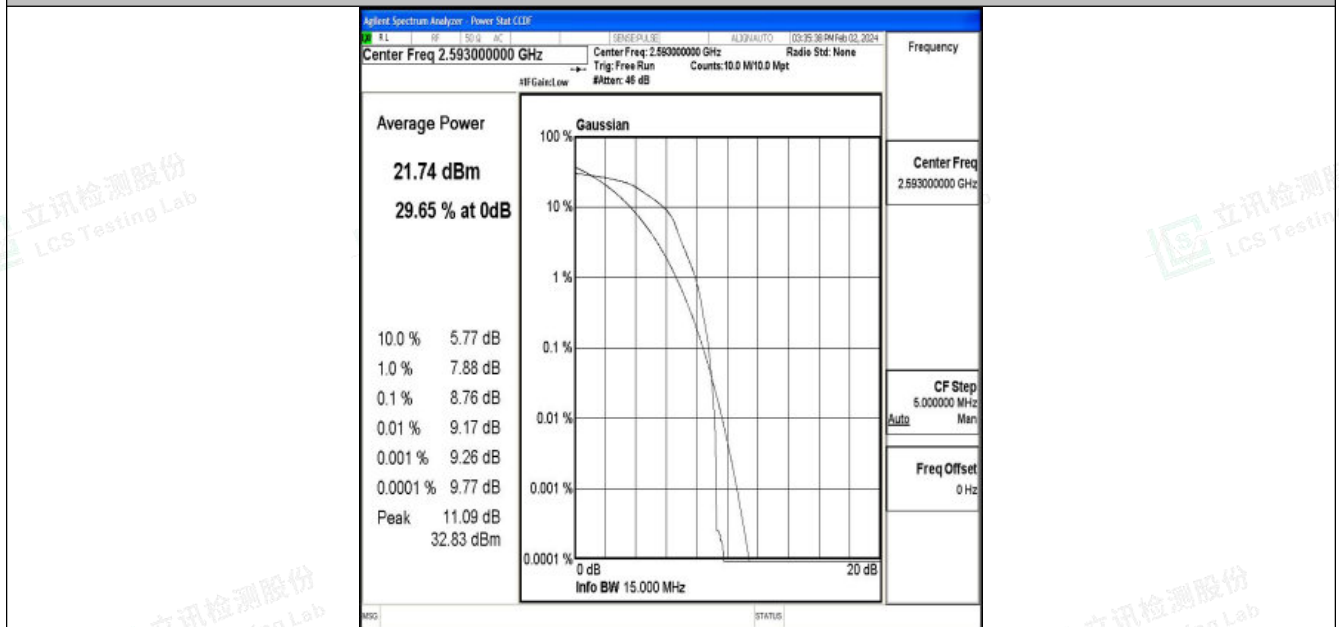

Band41-15MHz-16QAM-40620-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

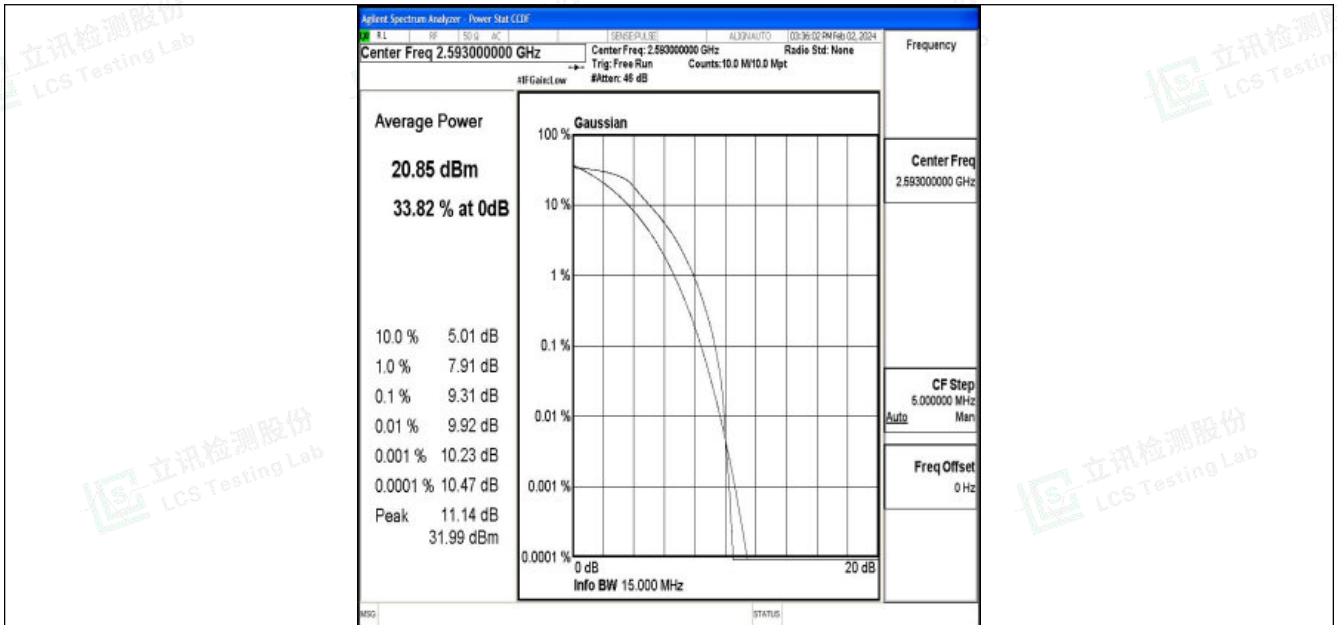

Band41-15MHz-QPSK-40620-75RB#0-PASS

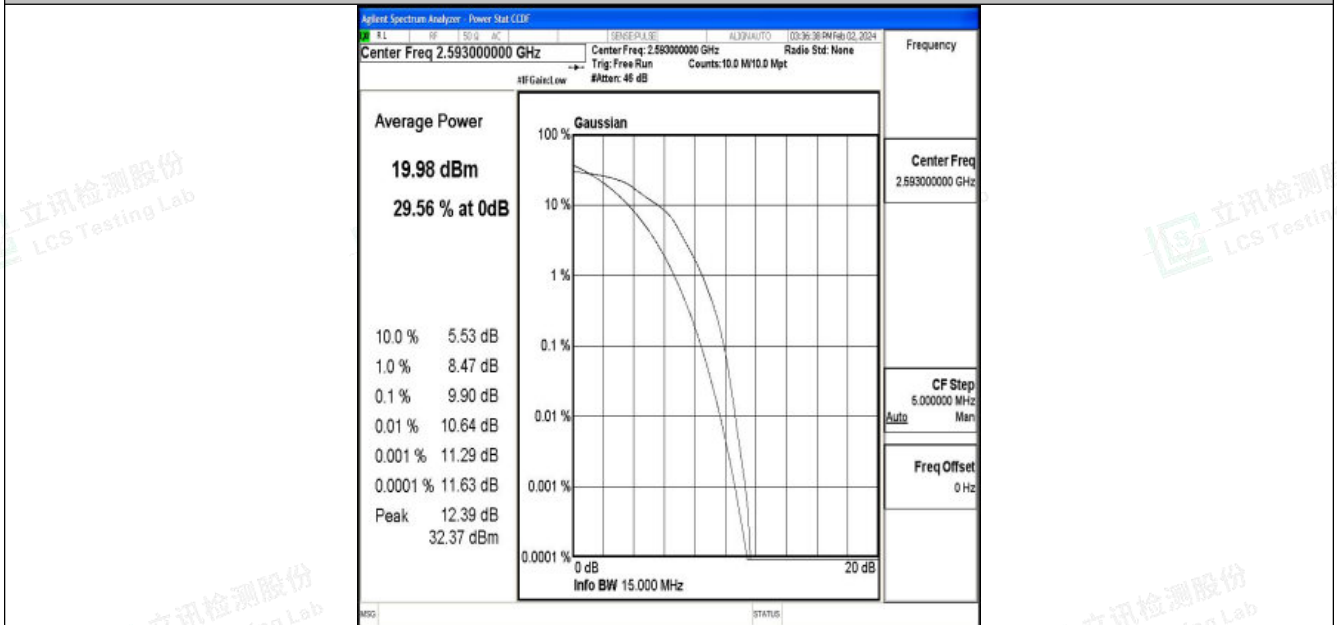

Band41-15MHz-16QAM-40620-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

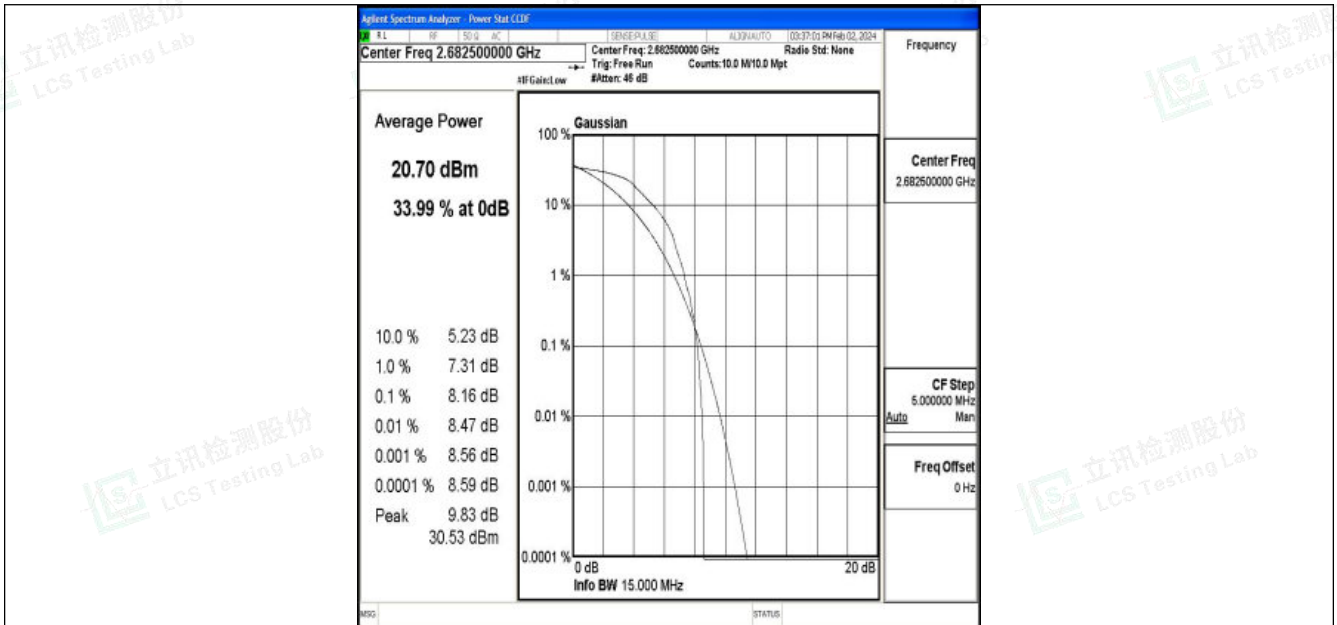

Band41-15MHz-QPSK-41515-1RB#0-PASS

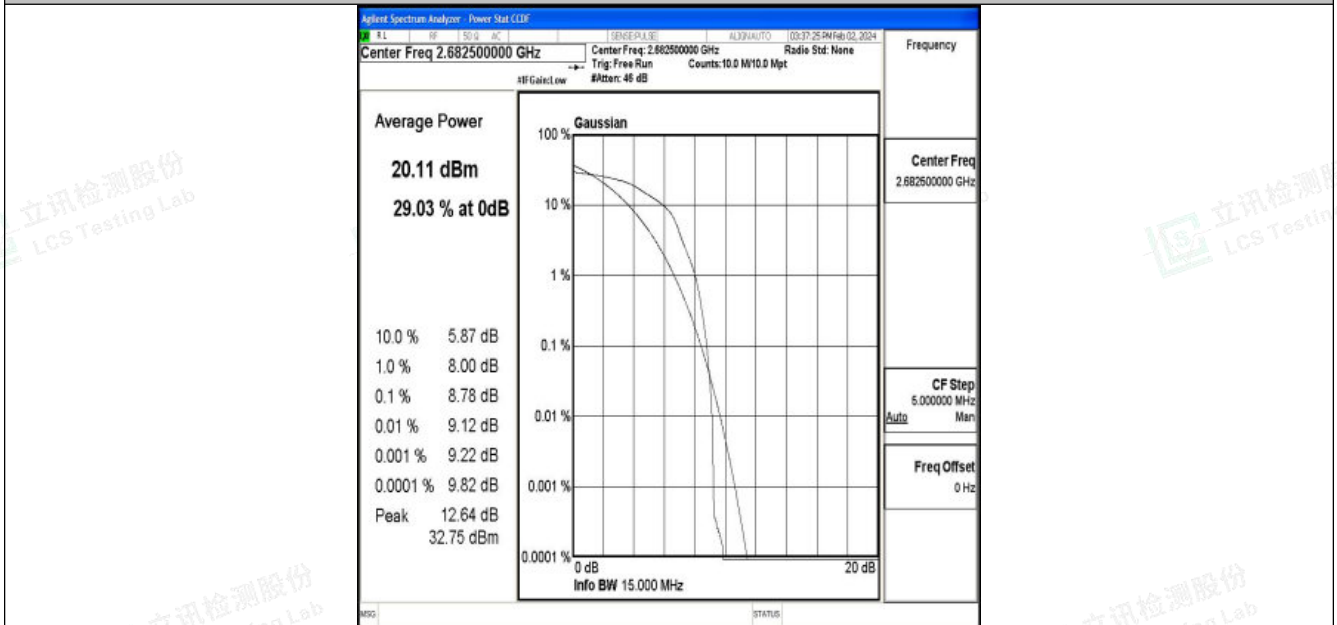

Band41-15MHz-16QAM-41515-1RB#0-PASS





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

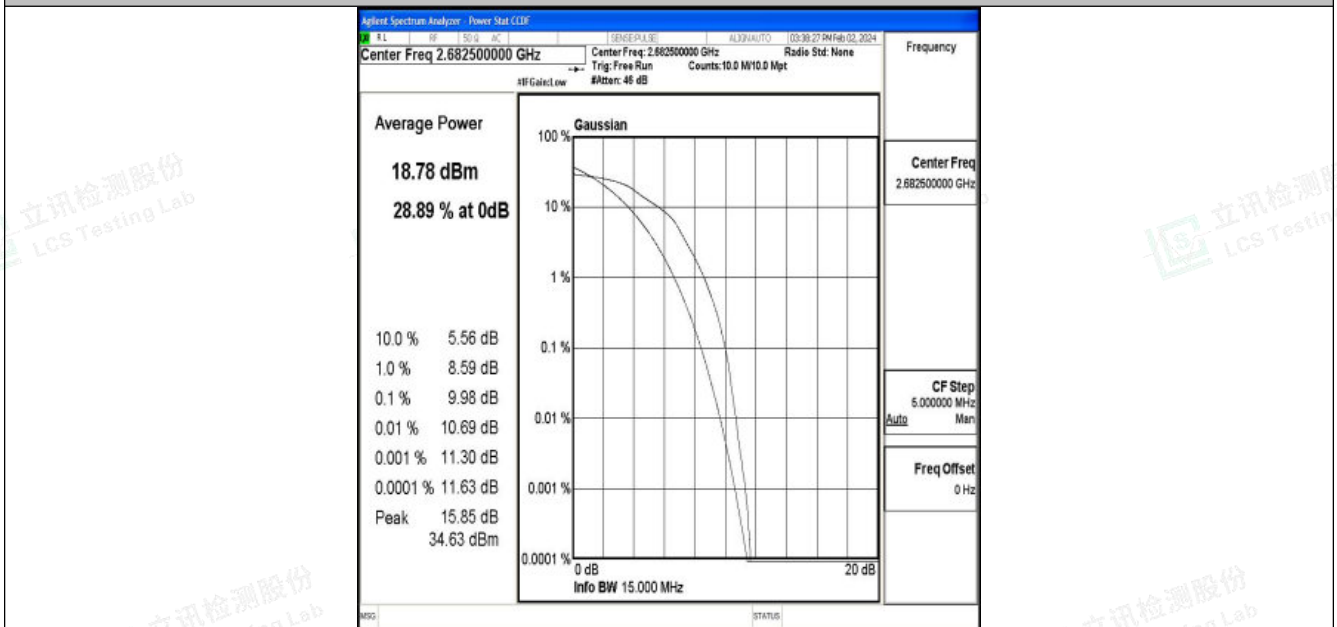
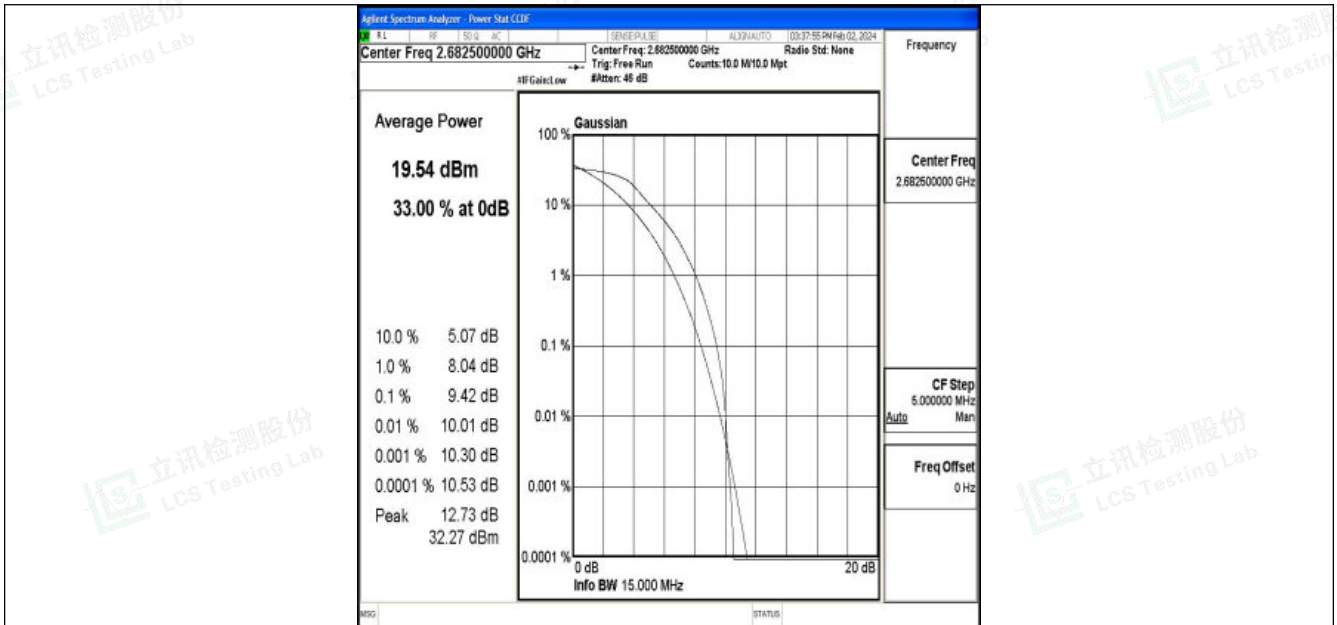


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

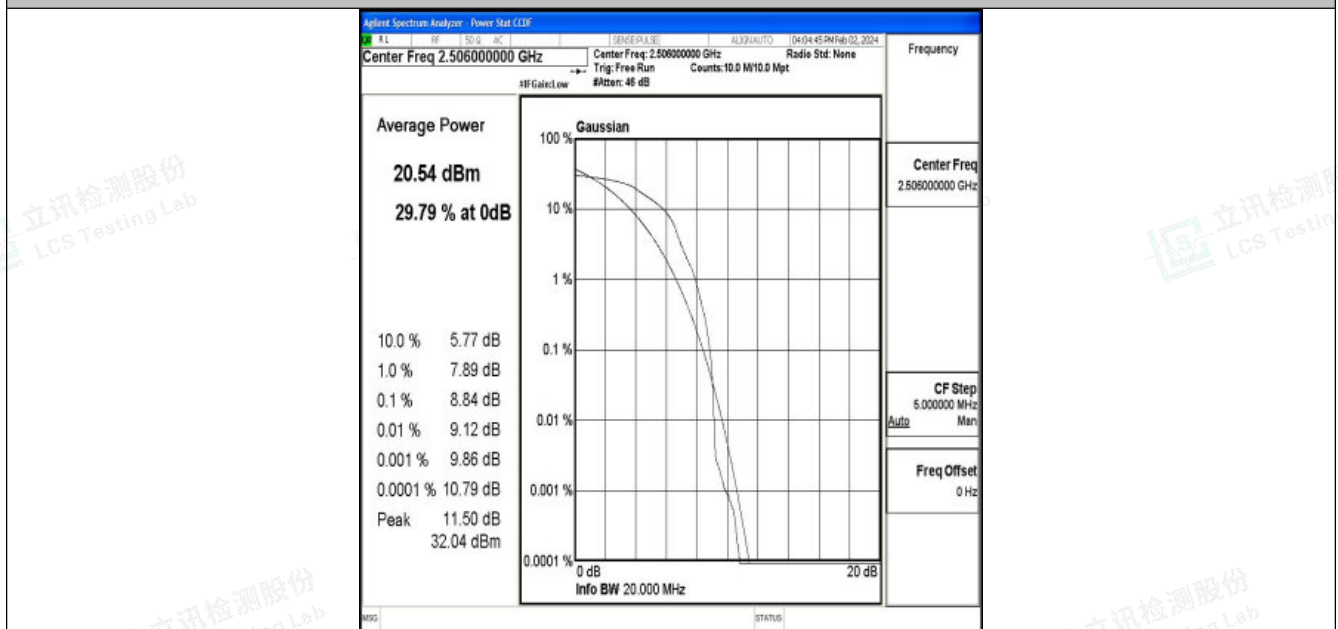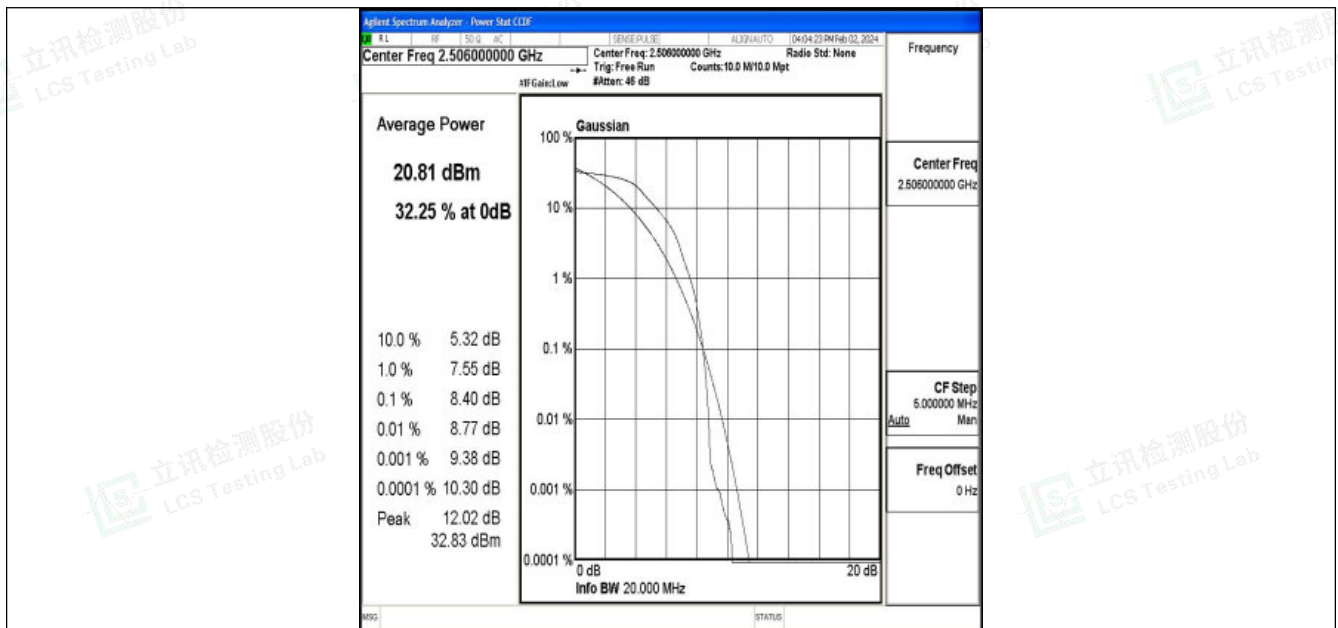


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

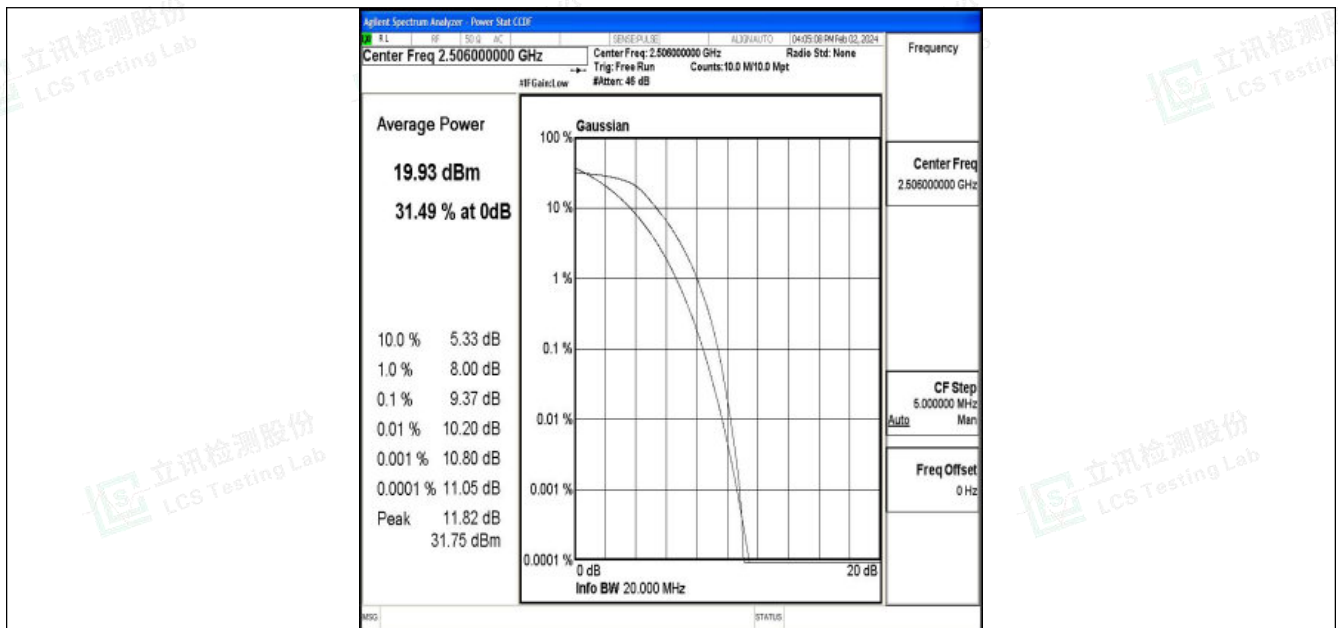

Band41-20MHz-QPSK-39750-100RB#0-PASS

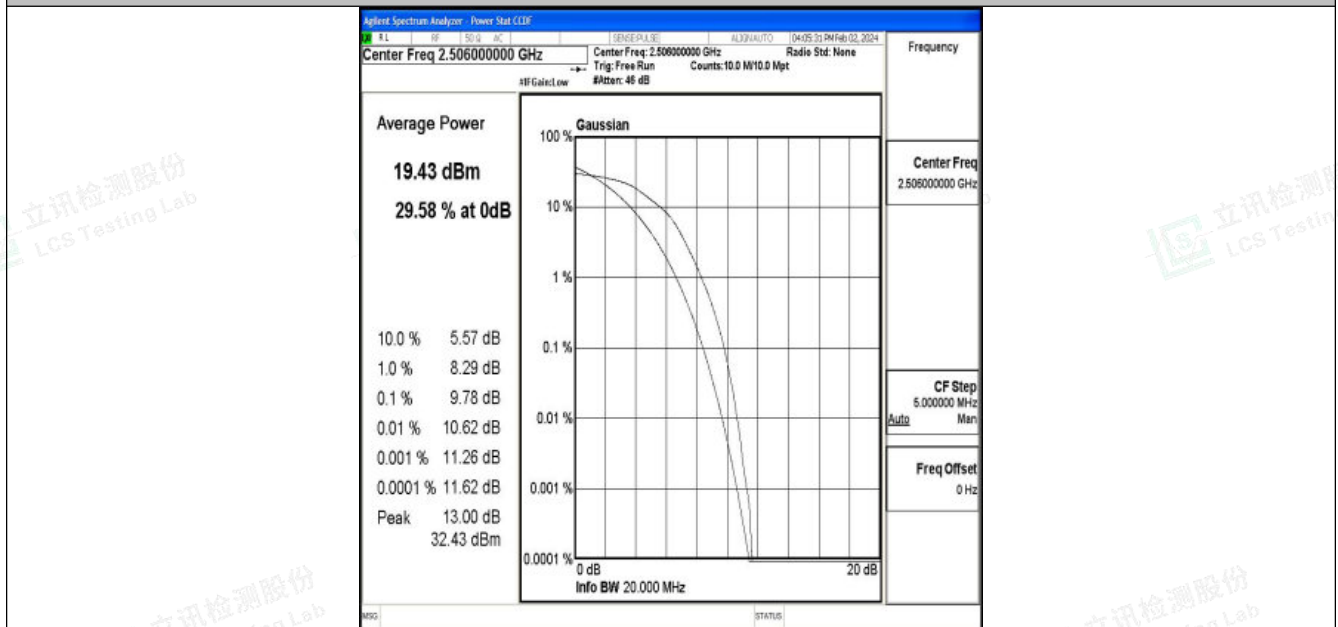

Band41-20MHz-16QAM-39750-100RB#0-PASS





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

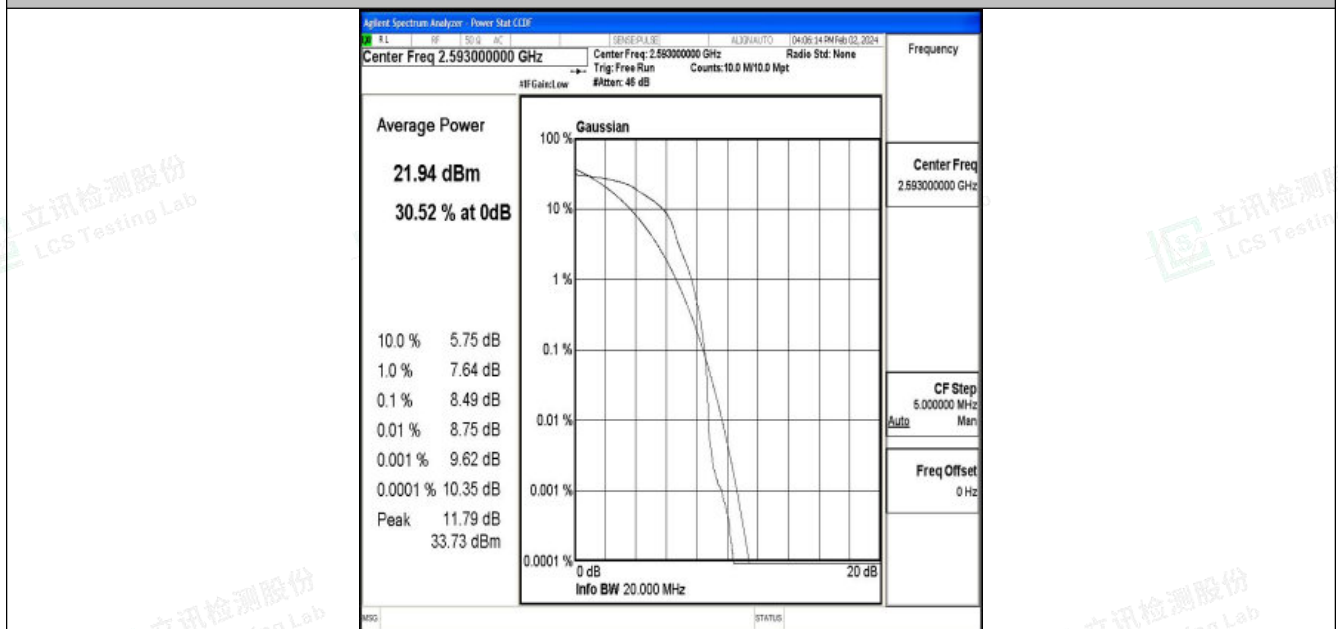
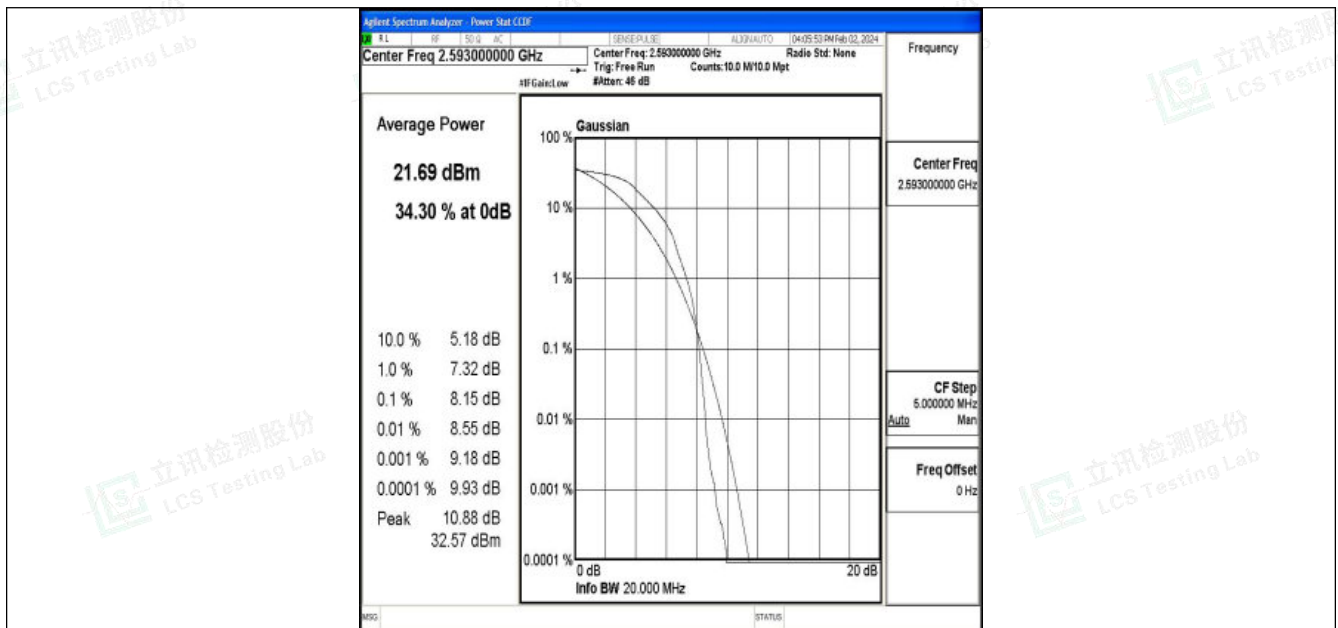


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

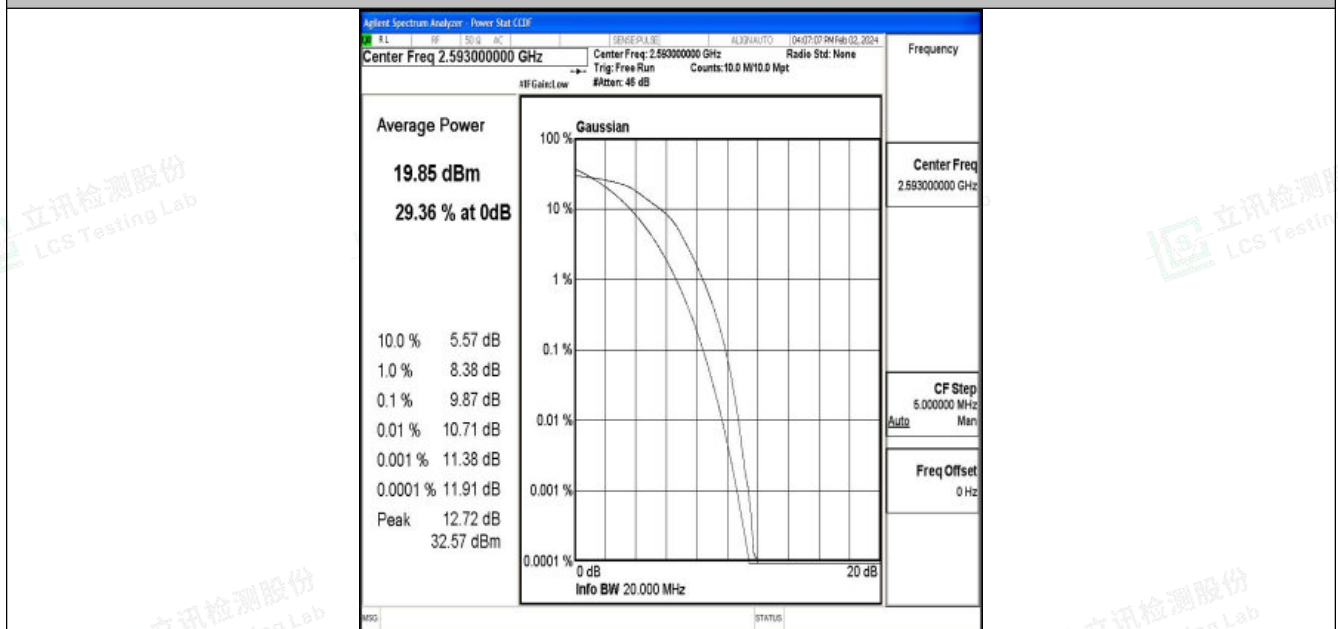
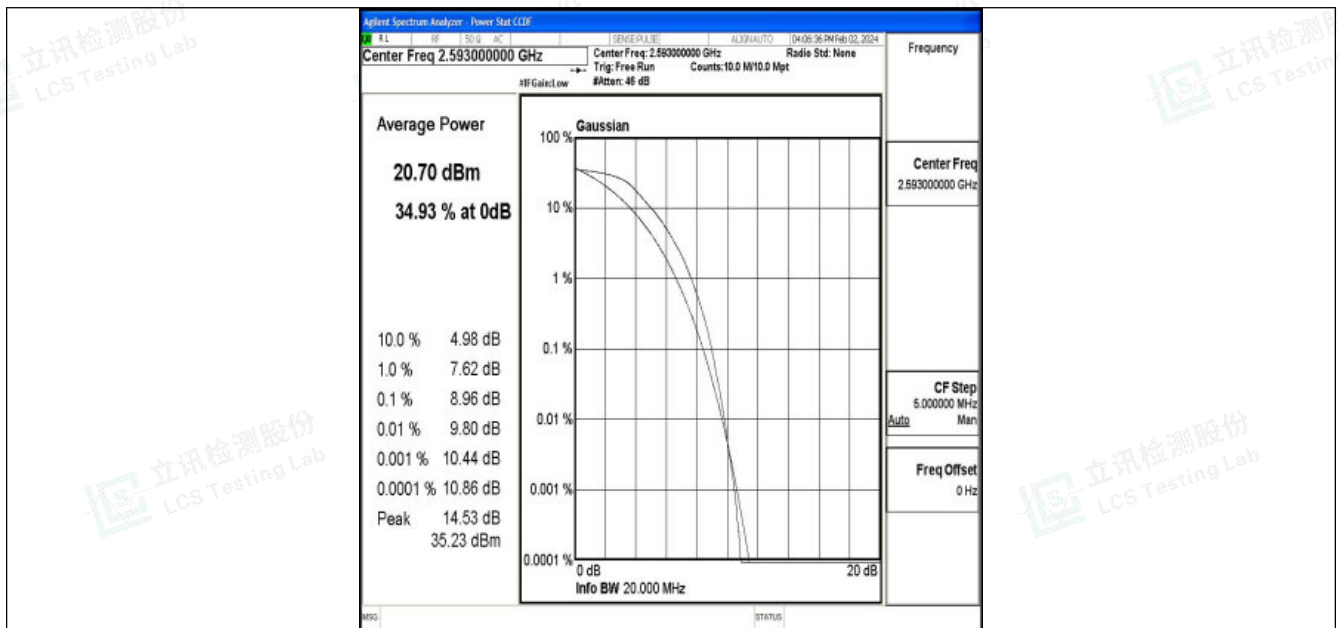



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

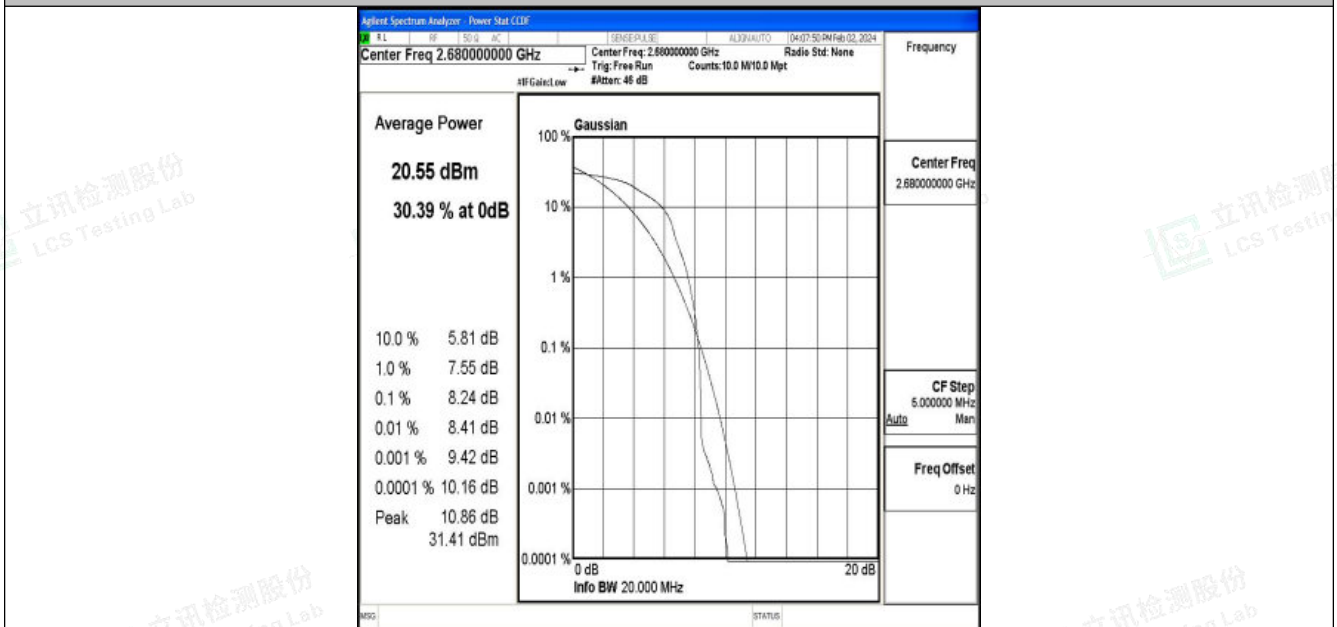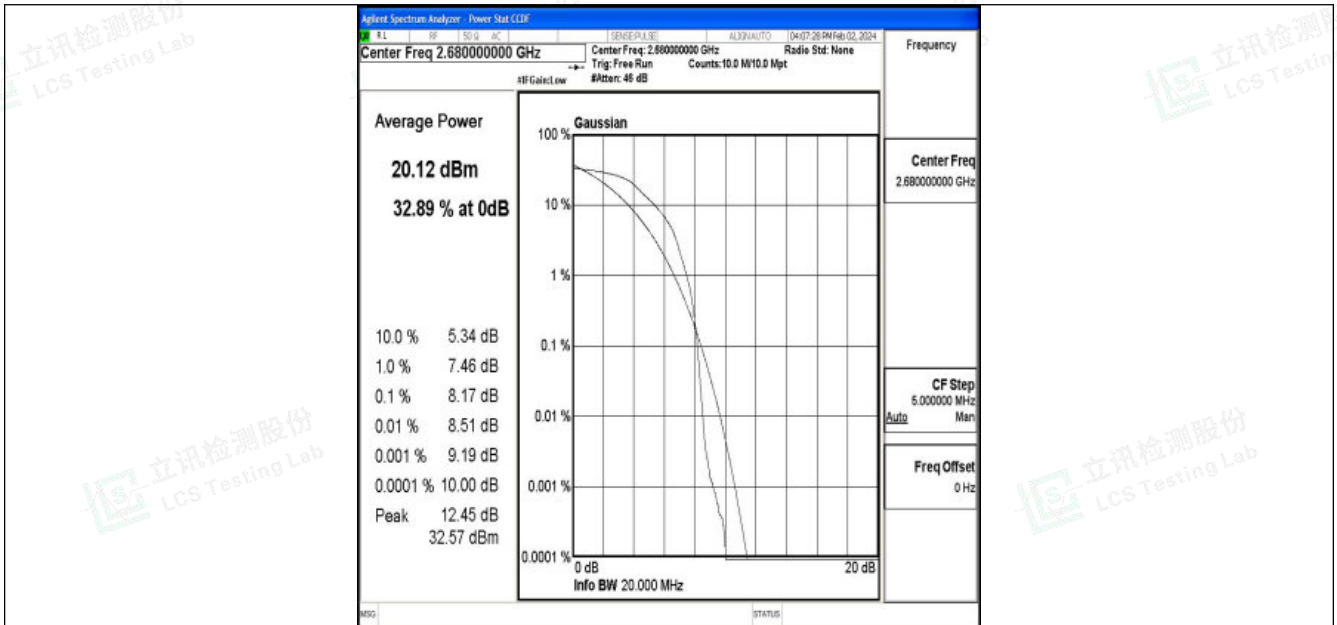

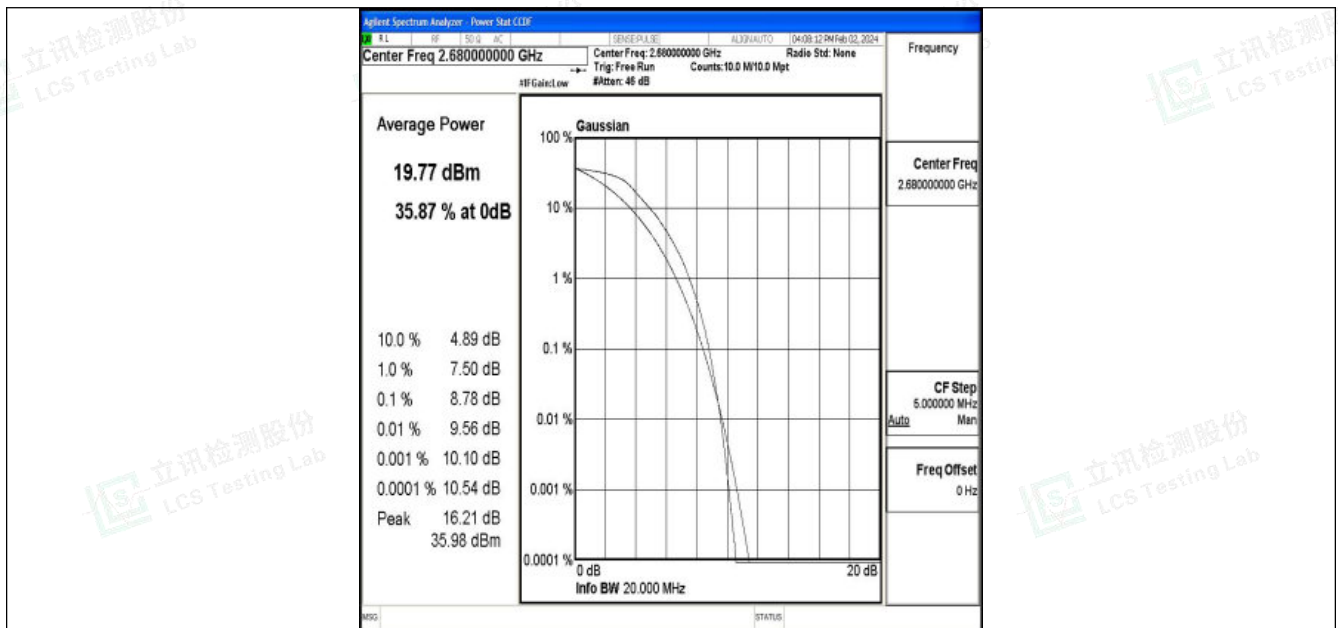

Band41-20MHz-QPSK-41490-100RB#0-PASS

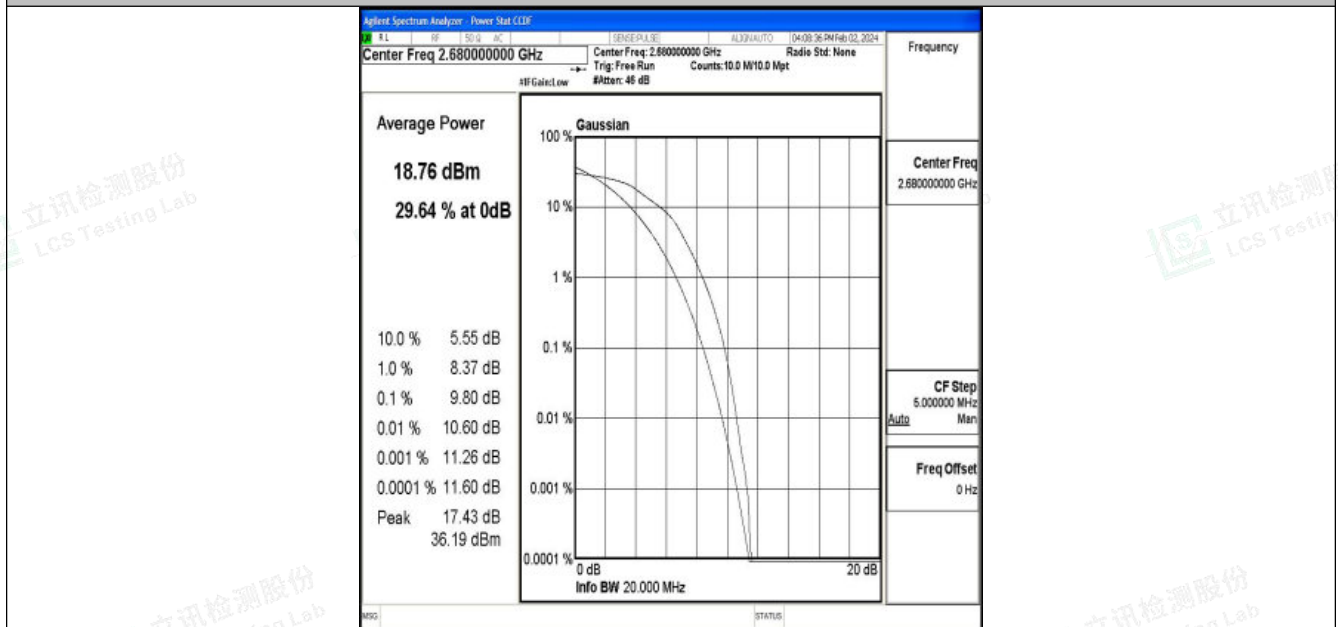

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



L.3 26dB Bandwidth and Occupied Bandwidth

Test Result



Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5249	5.233	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5119	5.386	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5204	5.249	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5163	5.403	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4979	5.125	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5036	5.281	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.0068	10.14	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9740	10.04	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.9919	10.16	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.0004	9.849	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.0269	10.15	PASS
Band41	10MHz	16QAM	41540	50RB#0	8.9989	11.14	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.541	16.32	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.494	15.01	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.536	16.56	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.517	15.34	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.543	16.17	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.506	15.34	PASS
Band41	20MHz	QPSK	39750	100RB#0	18.033	20.67	PASS
Band41	20MHz	16QAM	39750	100RB#0	18.024	20.16	PASS
Band41	20MHz	QPSK	40620	100RB#0	18.035	20.60	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.963	20.53	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.959	19.69	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.946	20.19	PASS





Test Graphs



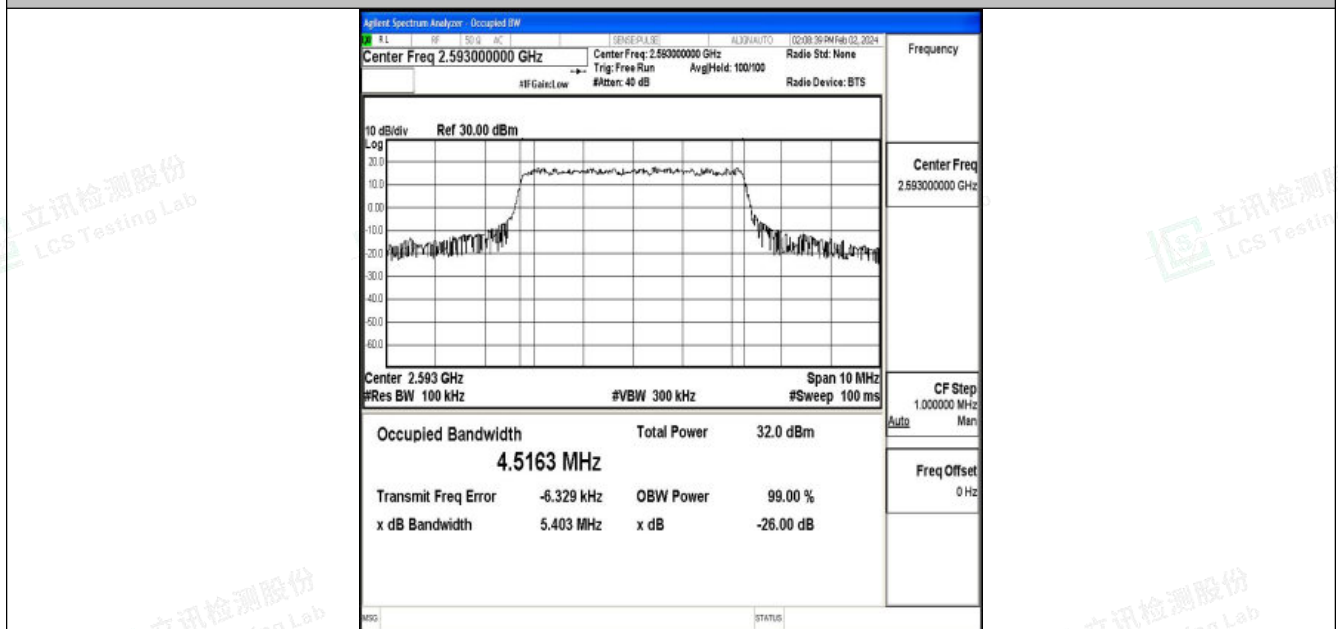
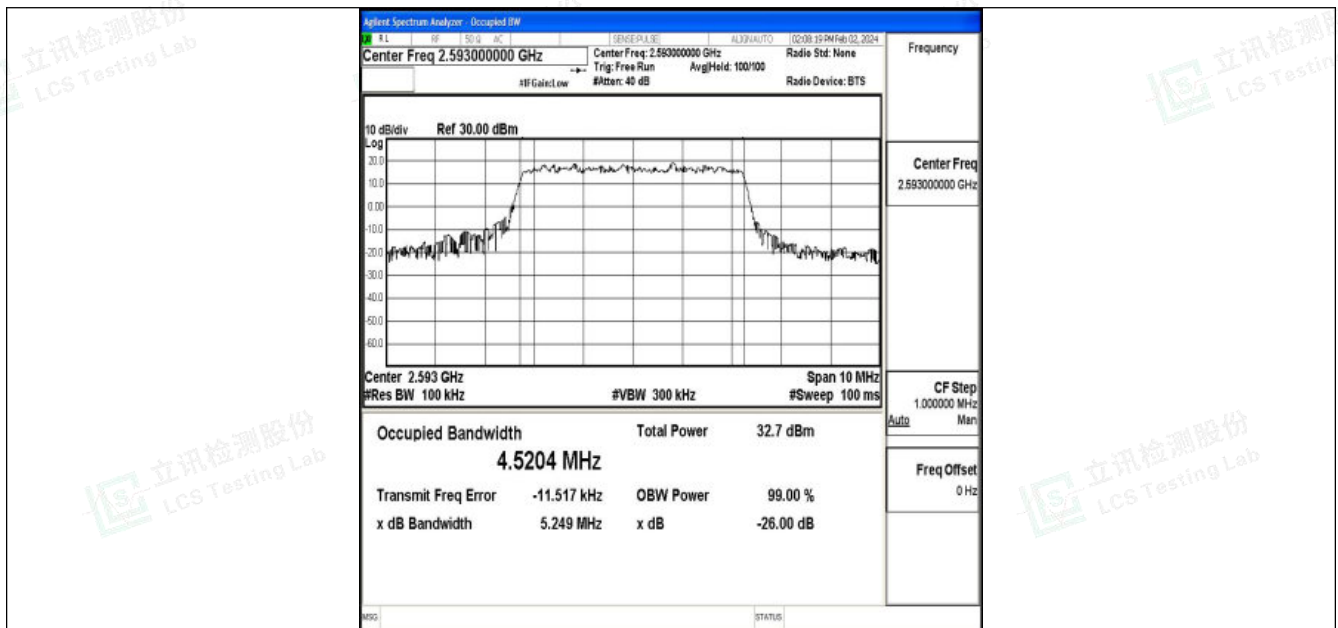


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

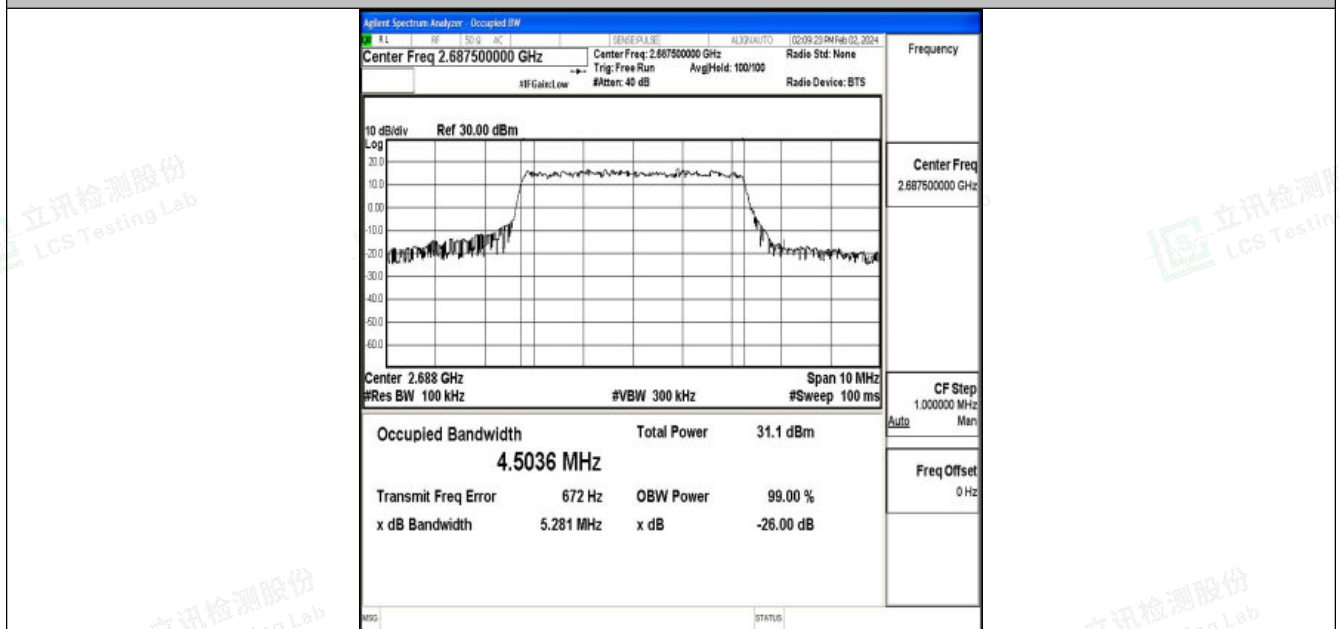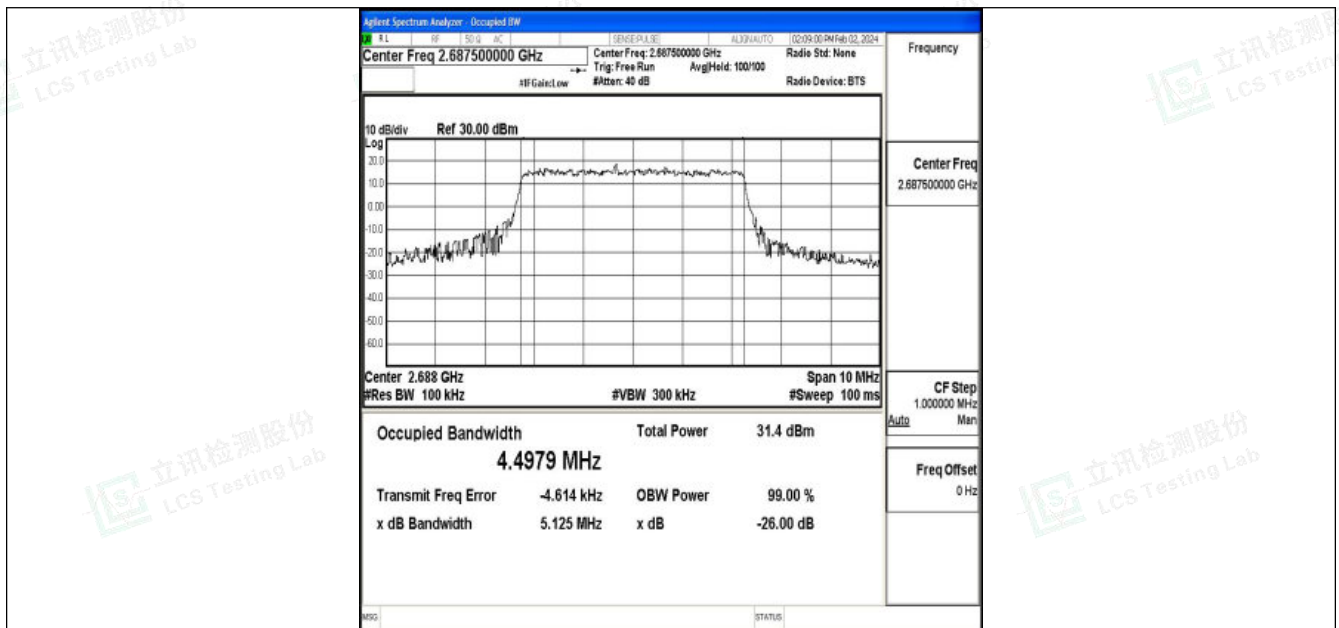


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

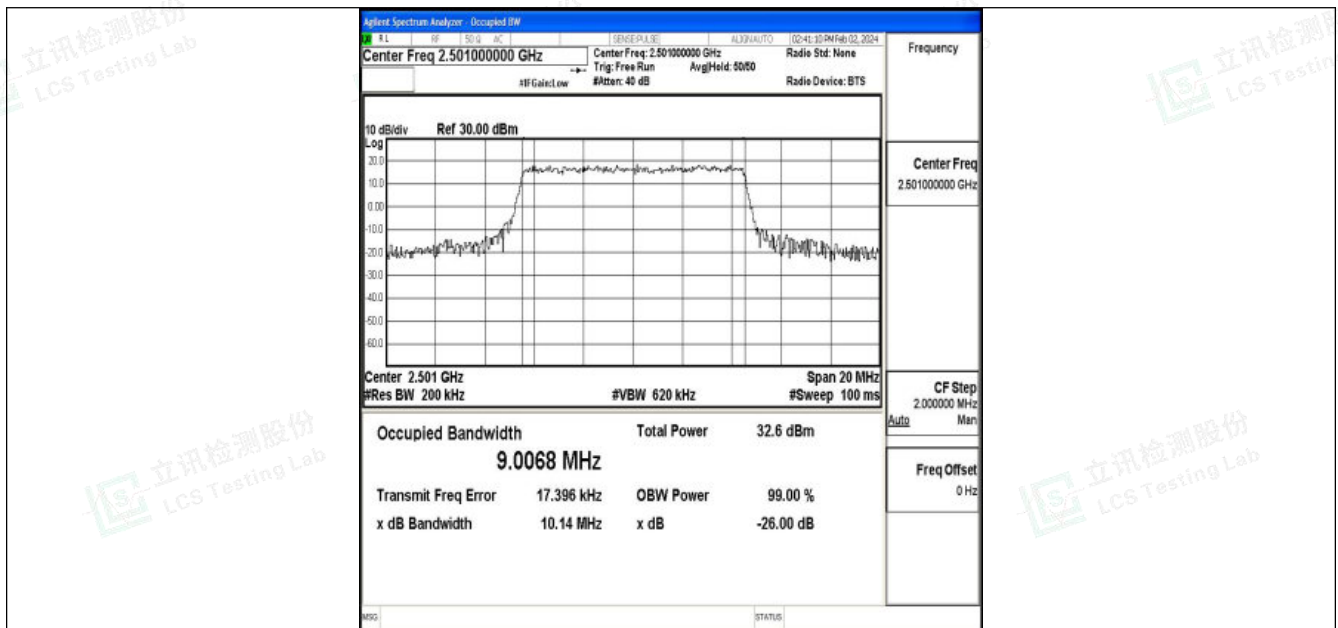

Band41-10MHz-QPSK-39700-50RB#0-PASS

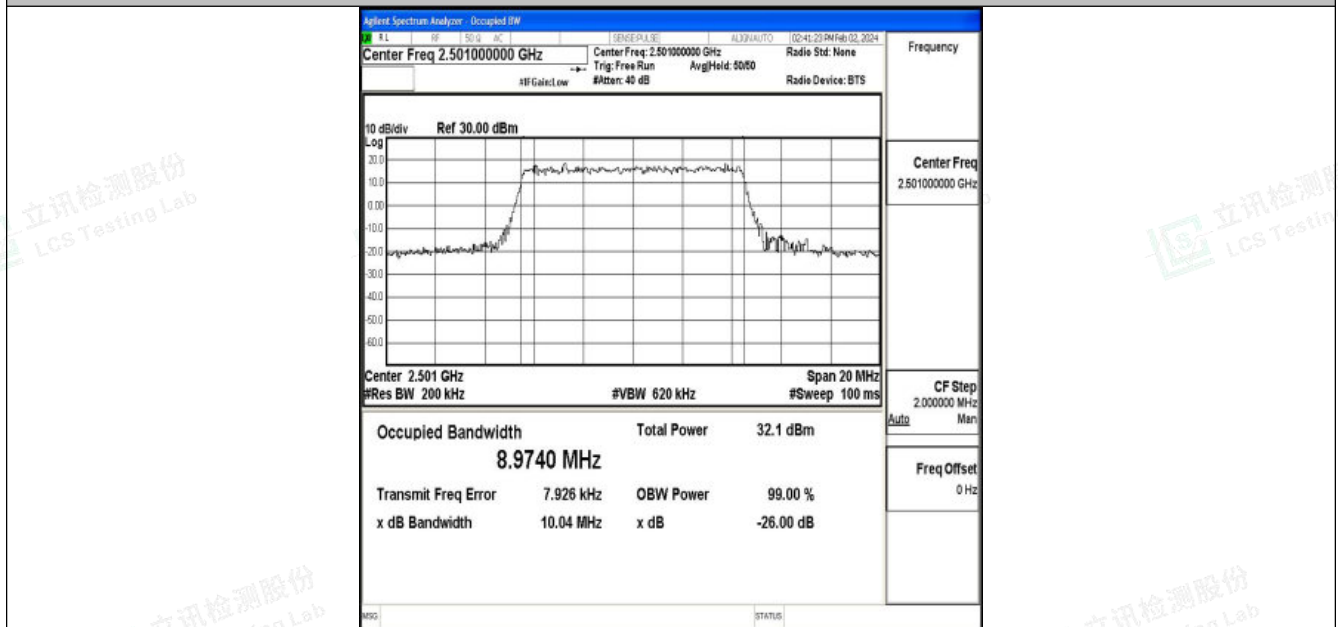

Band41-10MHz-16QAM-39700-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

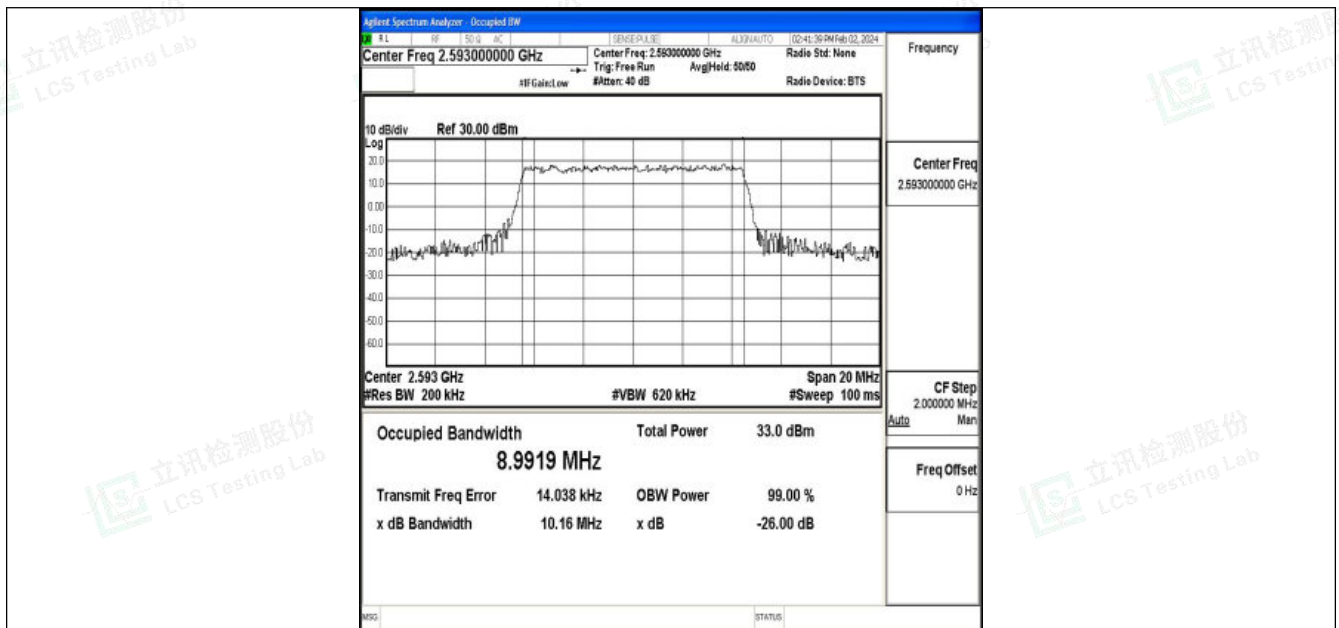

Band41-10MHz-QPSK-40620-50RB#0-PASS

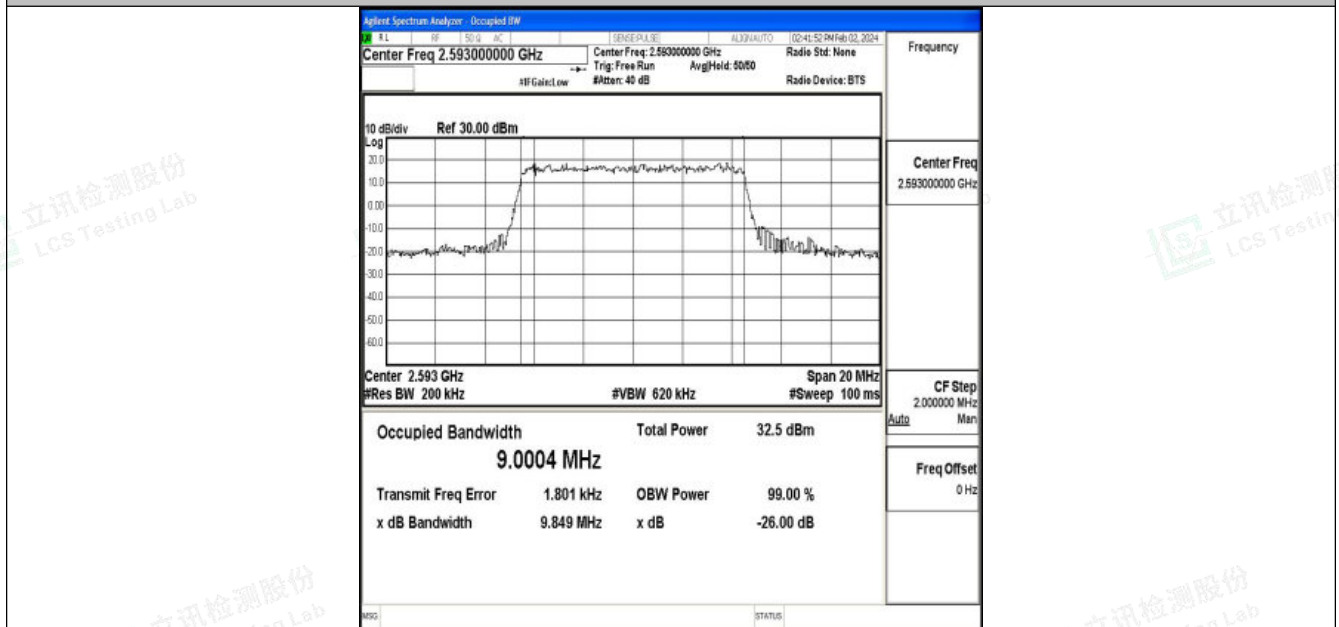

Band41-10MHz-16QAM-40620-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

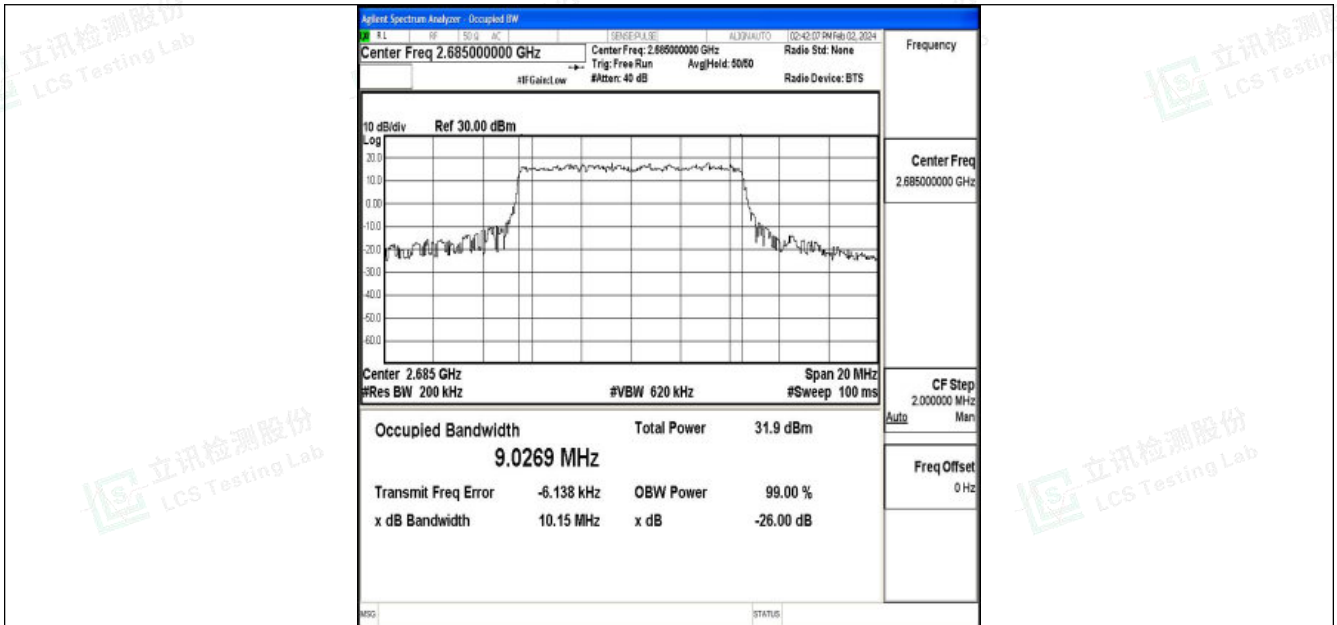

Band41-10MHz-QPSK-41540-50RB#0-PASS

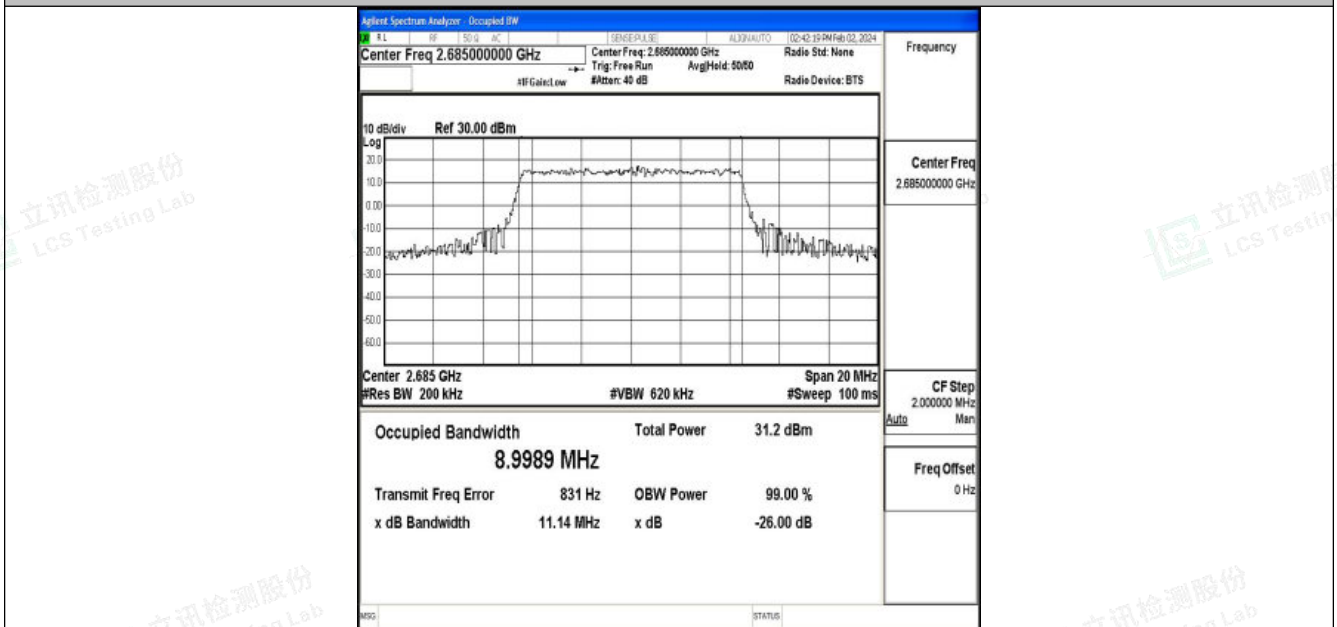

Band41-10MHz-16QAM-41540-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

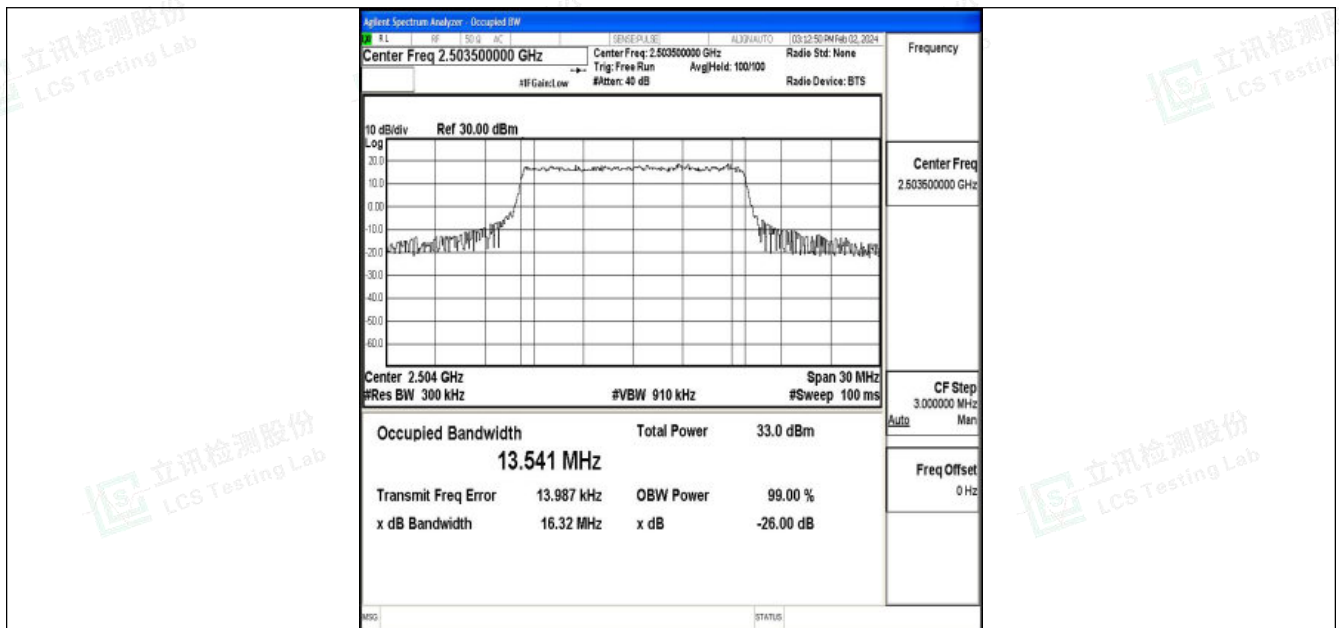

Band41-15MHz-QPSK-39725-75RB#0-PASS

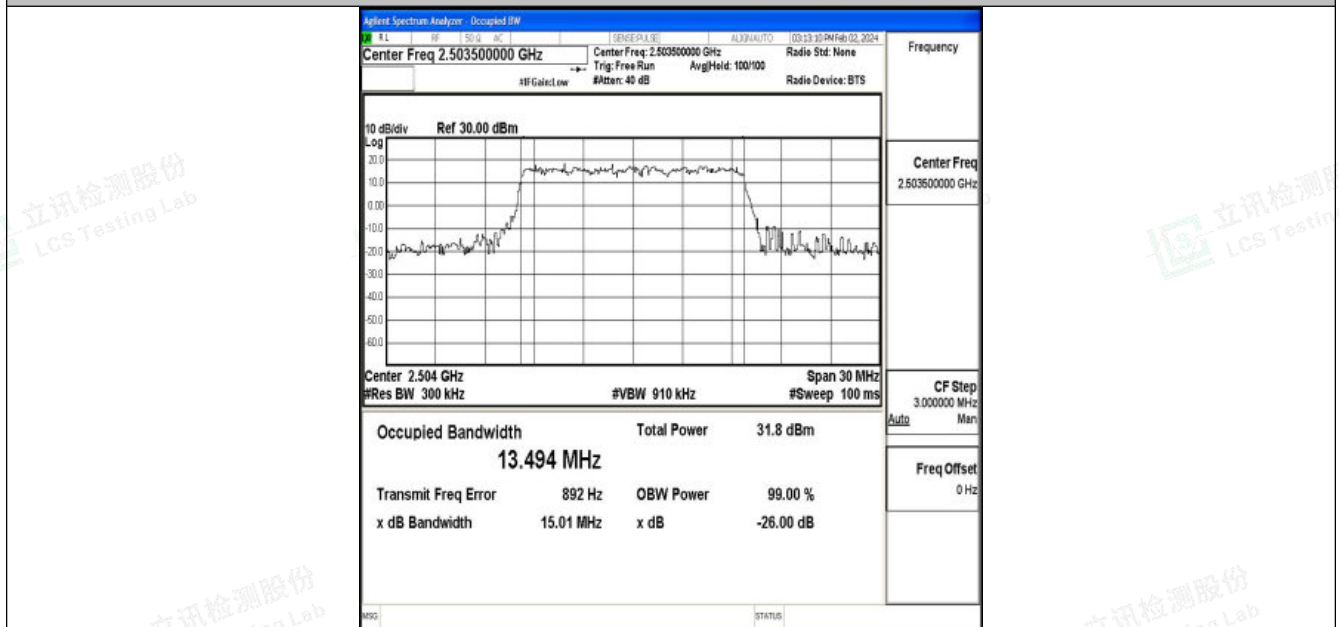

Band41-15MHz-16QAM-39725-75RB#0-PASS





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

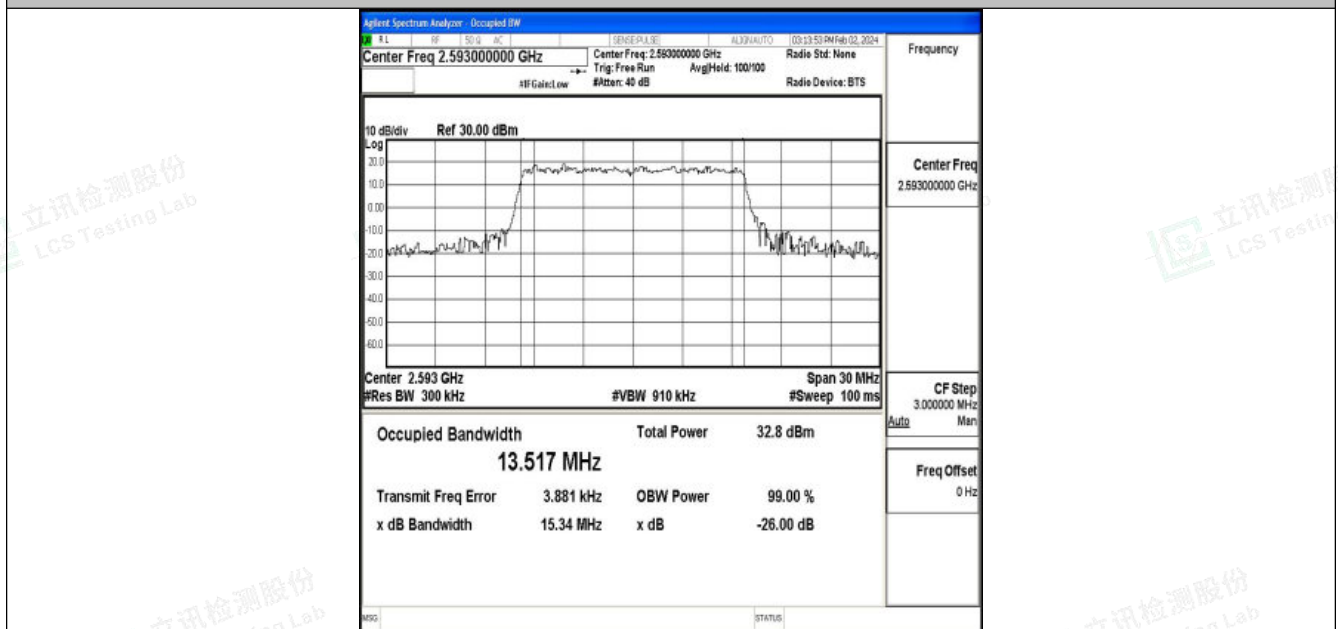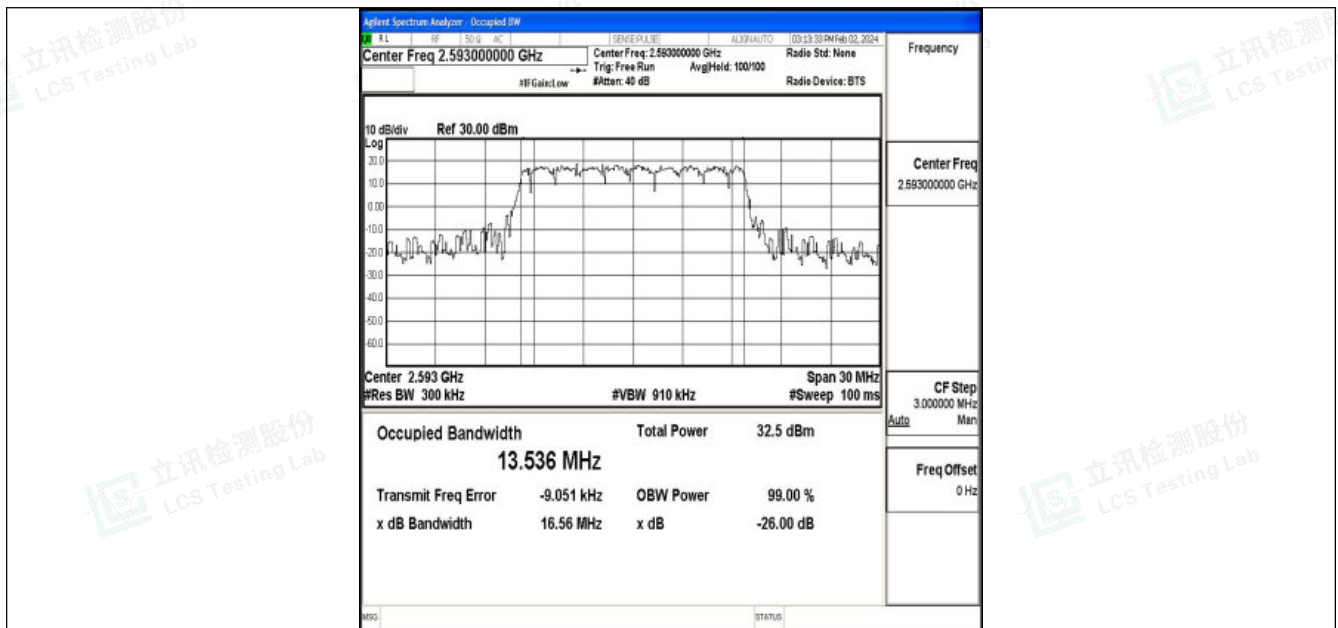


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

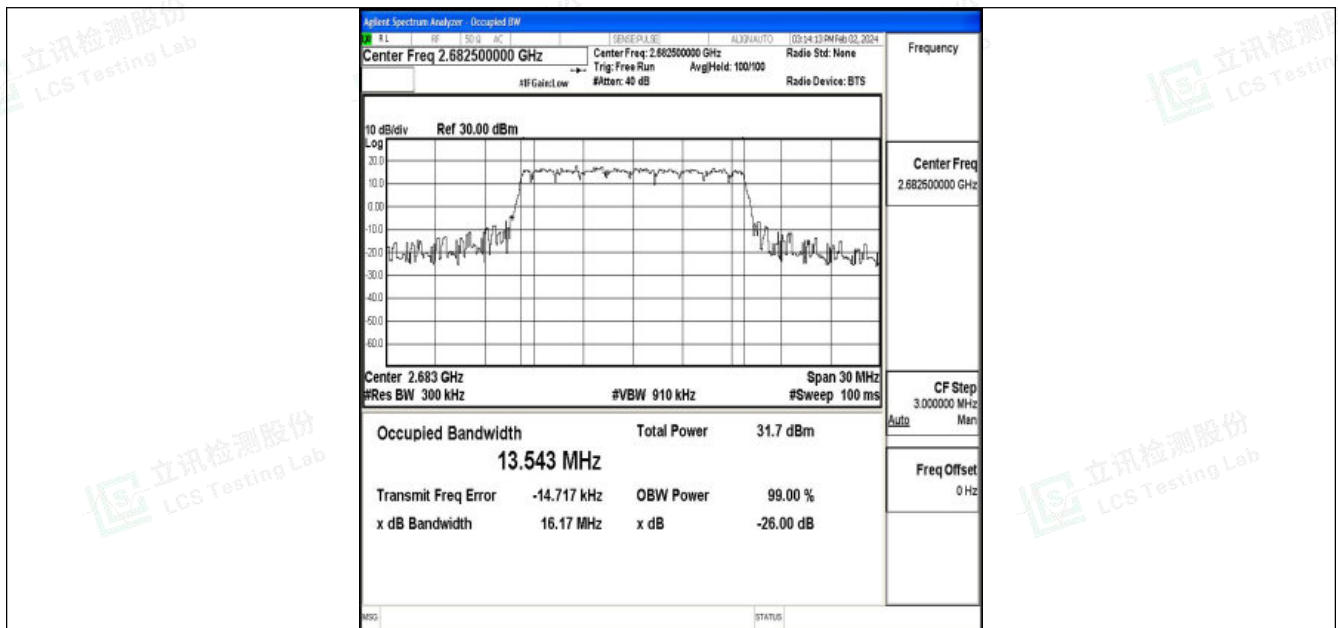

Band41-15MHz-QPSK-41515-75RB#0-PASS

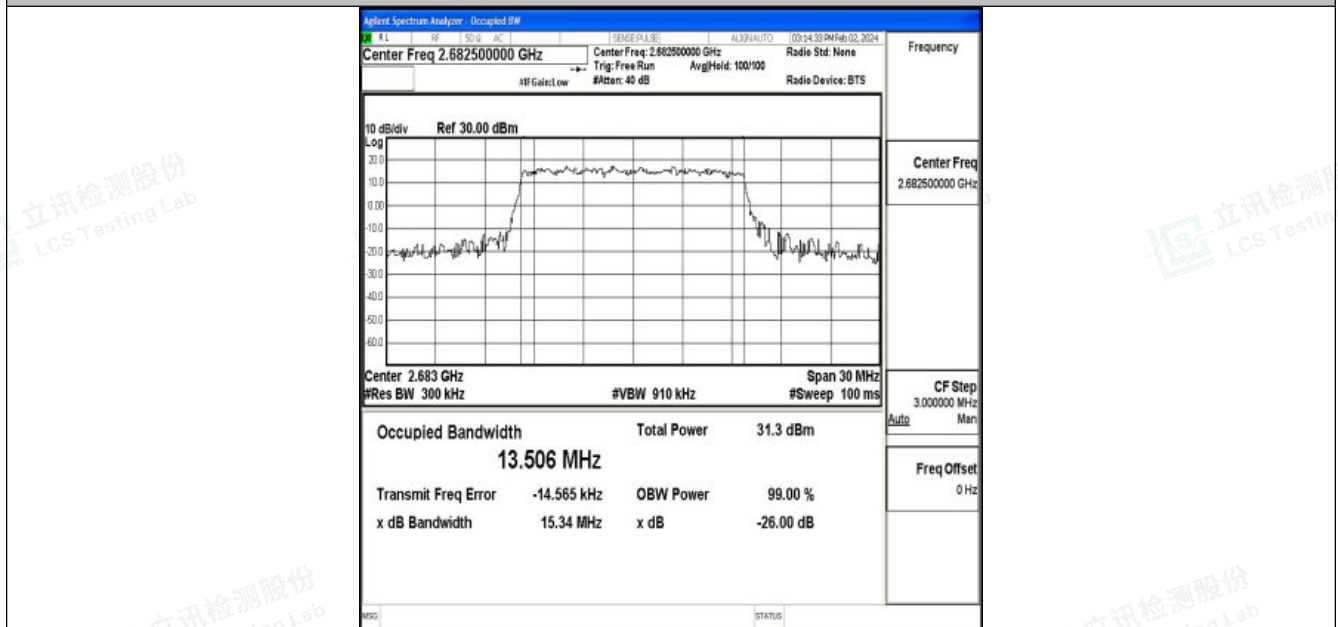

Band41-15MHz-16QAM-41515-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

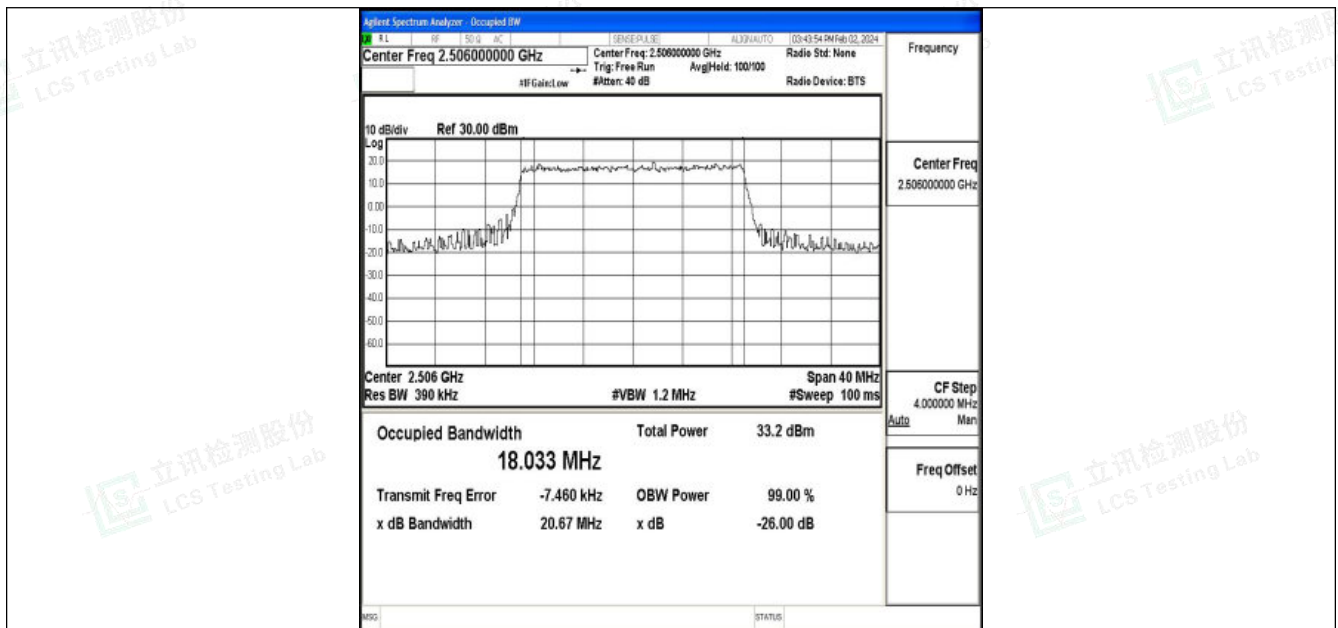


Band41-20MHz-QPSK-39750-100RB#0-PASS

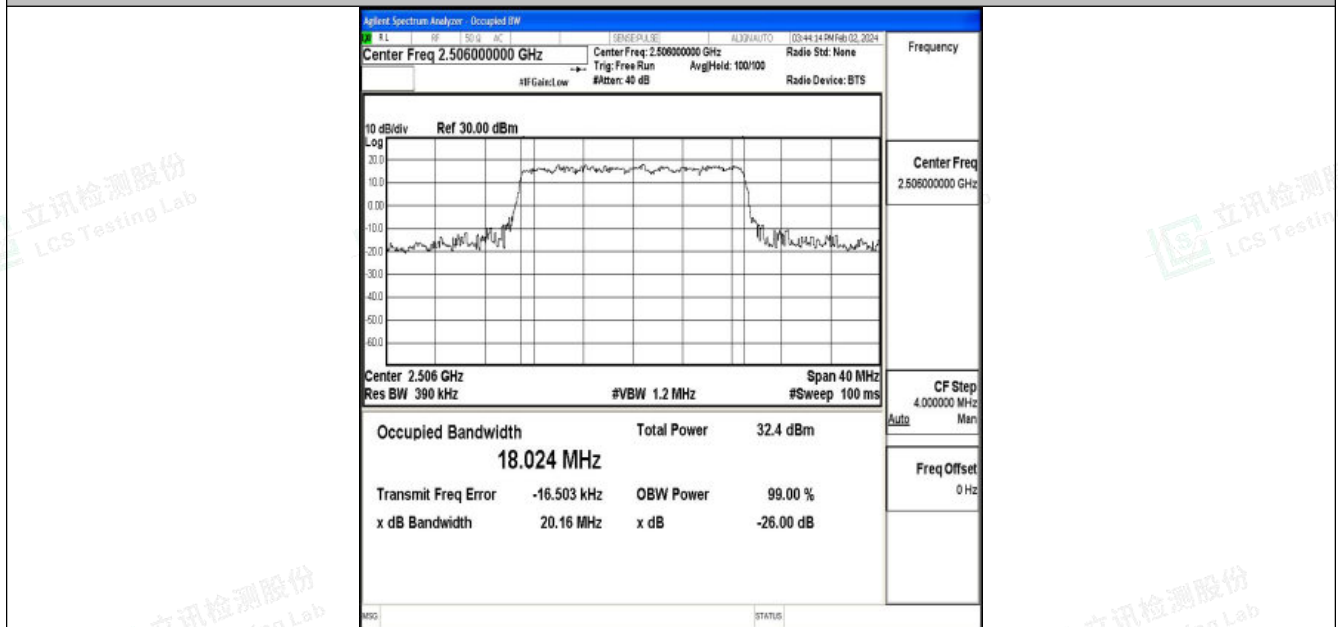


Band41-20MHz-16QAM-39750-100RB#0-PASS



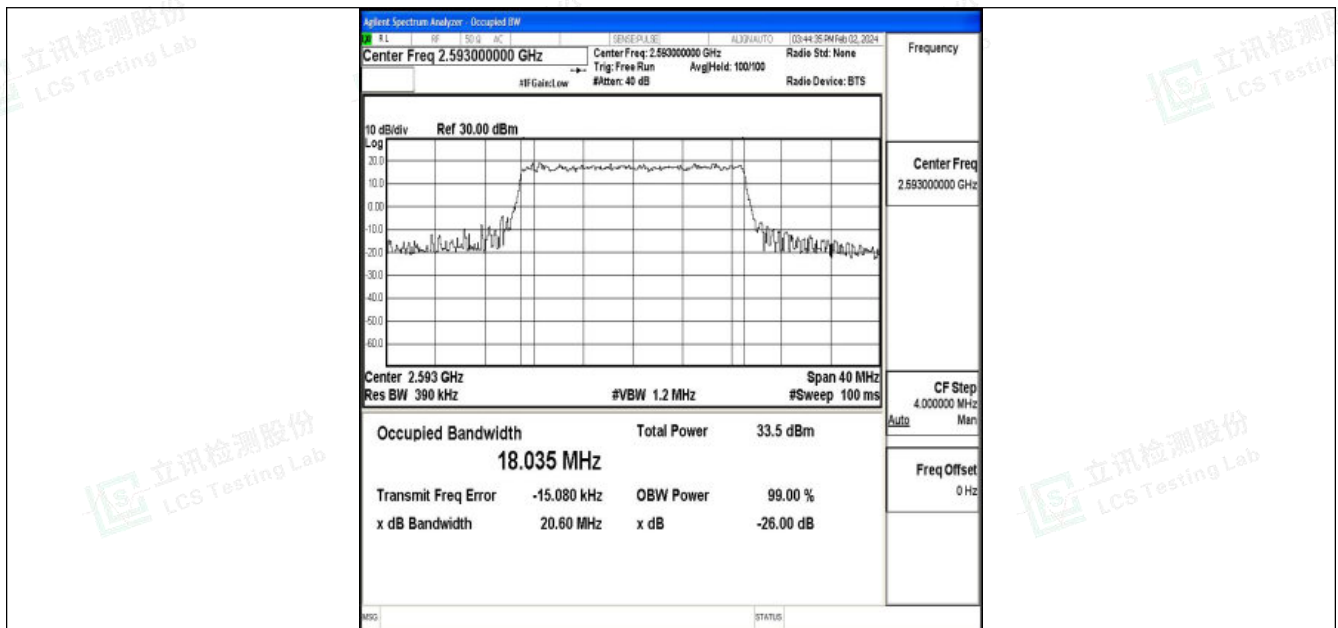

Band41-20MHz-QPSK-40620-100RB#0-PASS

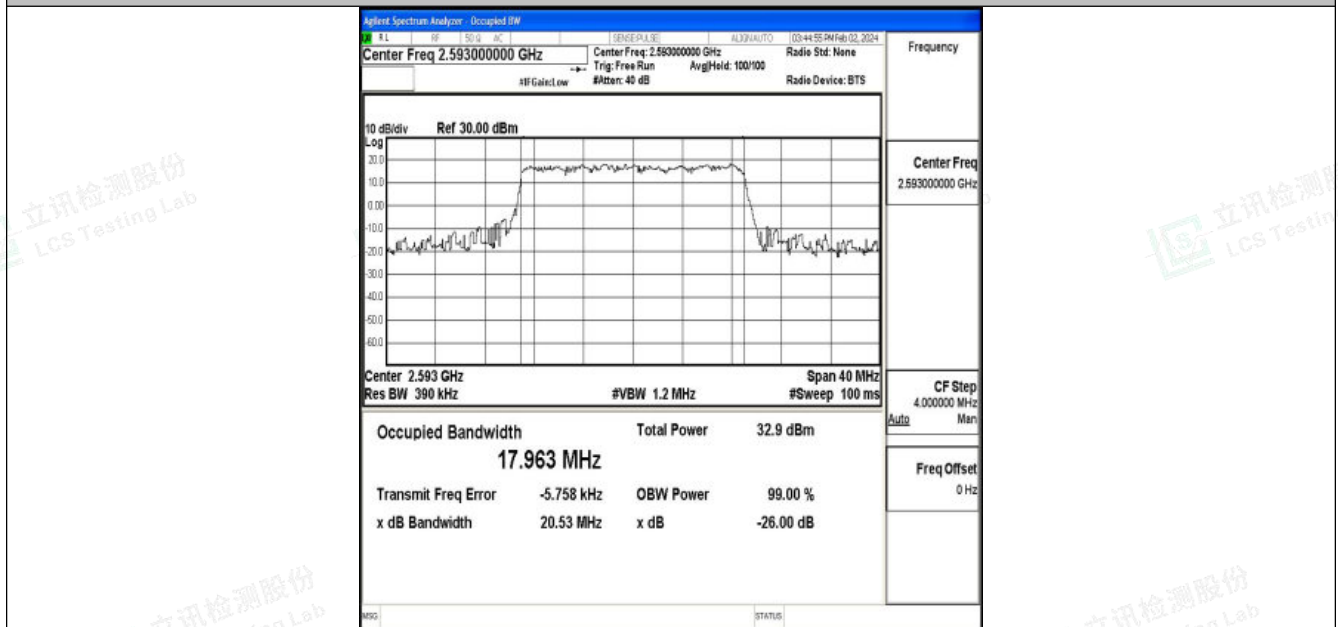

Band41-20MHz-16QAM-40620-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

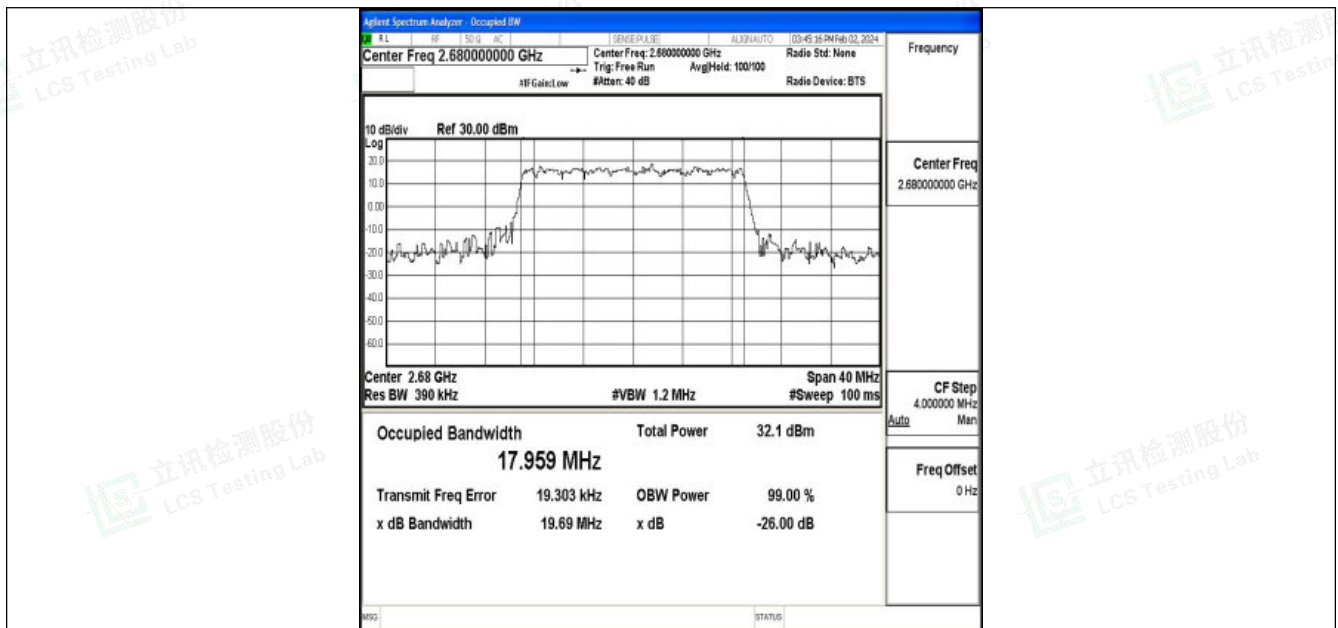

Band41-20MHz-QPSK-41490-100RB#0-PASS

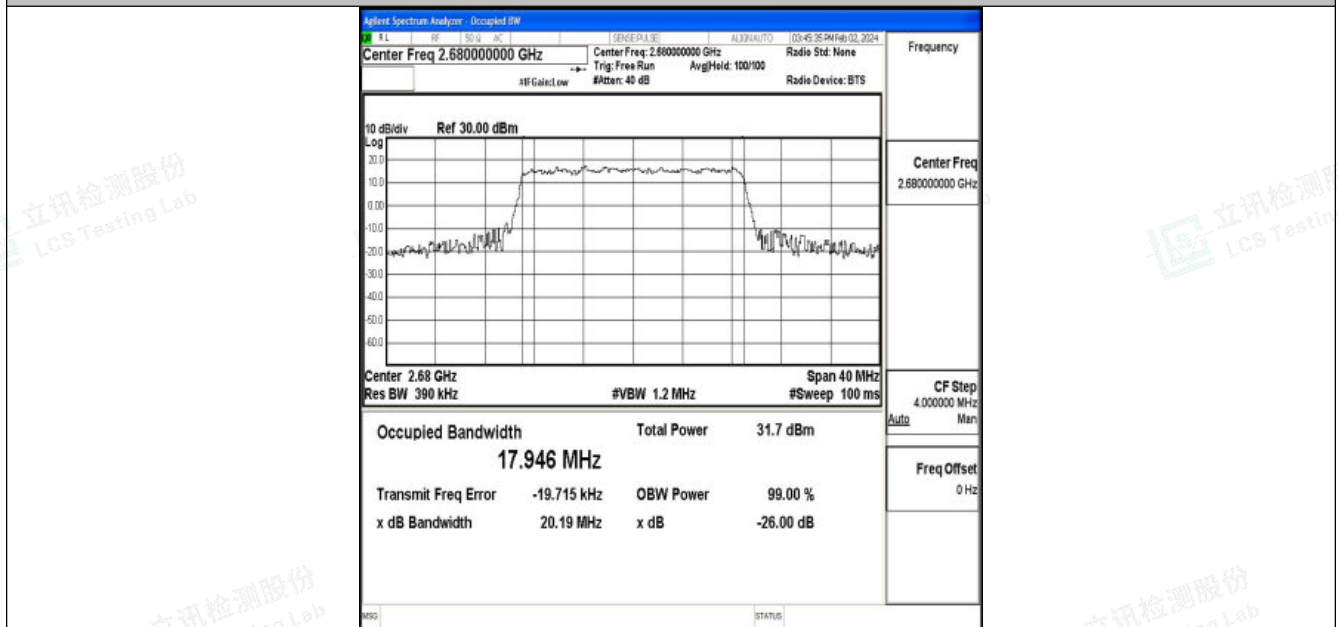

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




L.4 Band Edge


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Peak Frequency	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	2494.97	-35.82	PASS
Band41	5MHz	16QAM	39675	25RB#0	2490.46	-49.40	PASS
Band41	5MHz	QPSK	41565	25RB#0	2697.23	-44.51	PASS
Band41	5MHz	16QAM	41565	25RB#0	2696.27	-45.11	PASS
Band41	10MHz	QPSK	39700	50RB#0	2490.38	-39.96	PASS
Band41	10MHz	16QAM	39700	50RB#0	2490.32	-41.96	PASS
Band41	10MHz	QPSK	41540	50RB#0	2700.08	-43.70	PASS
Band41	10MHz	16QAM	41540	50RB#0	2700.23	-43.51	PASS
Band41	15MHz	QPSK	39725	75RB#0	2489.75	-37.62	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.73	-39.50	PASS
Band41	15MHz	QPSK	41515	75RB#0	2706.36	-42.35	PASS
Band41	15MHz	16QAM	41515	75RB#0	2706.05	-42.80	PASS
Band41	20MHz	QPSK	39750	100RB#0	2489.20	-38.79	PASS
Band41	20MHz	16QAM	39750	100RB#0	2490.46	-39.73	PASS
Band41	20MHz	QPSK	41490	100RB#0	2710.01	-42.66	PASS
Band41	20MHz	16QAM	41490	100RB#0	2712.35	-42.61	PASS


Test Graphs

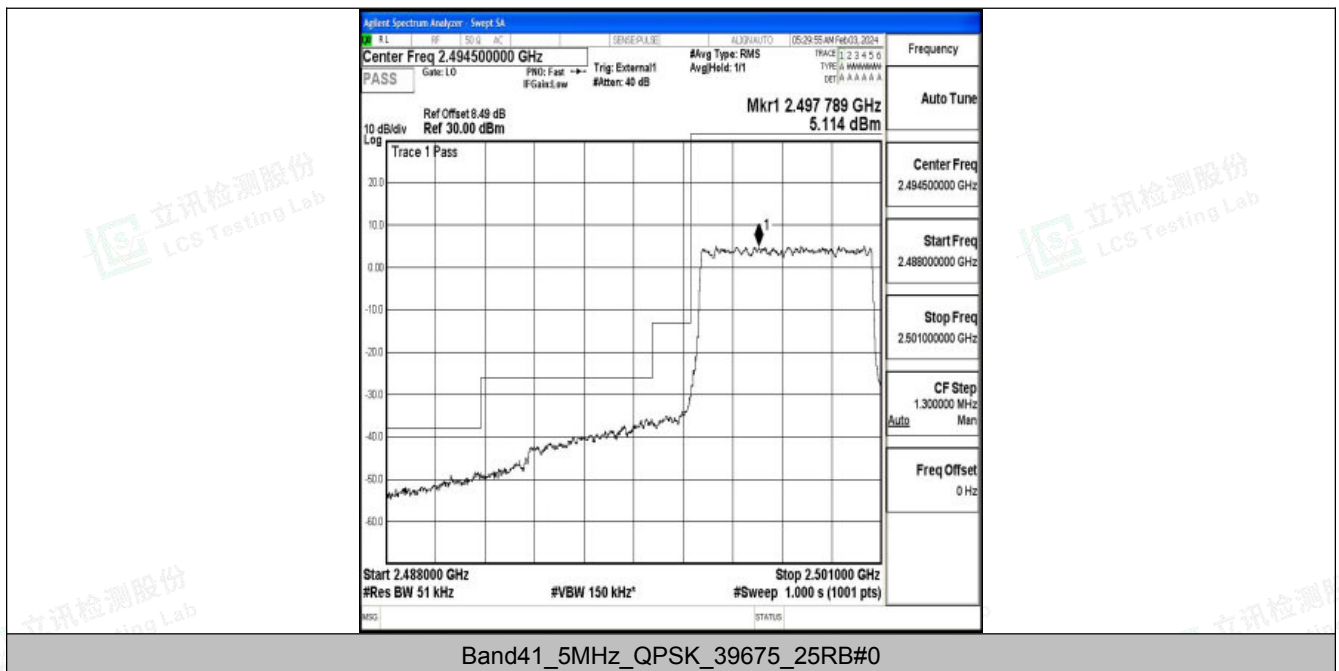

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

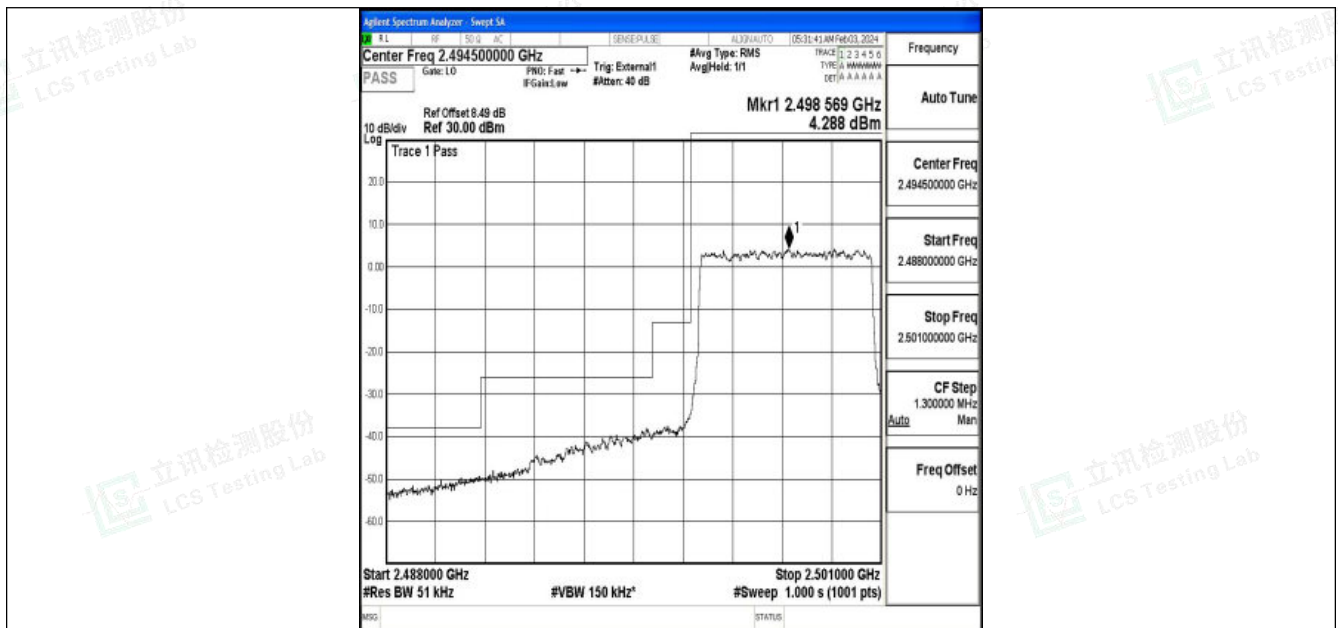

Band41_5MHz_16QAM_39675_25RB#0

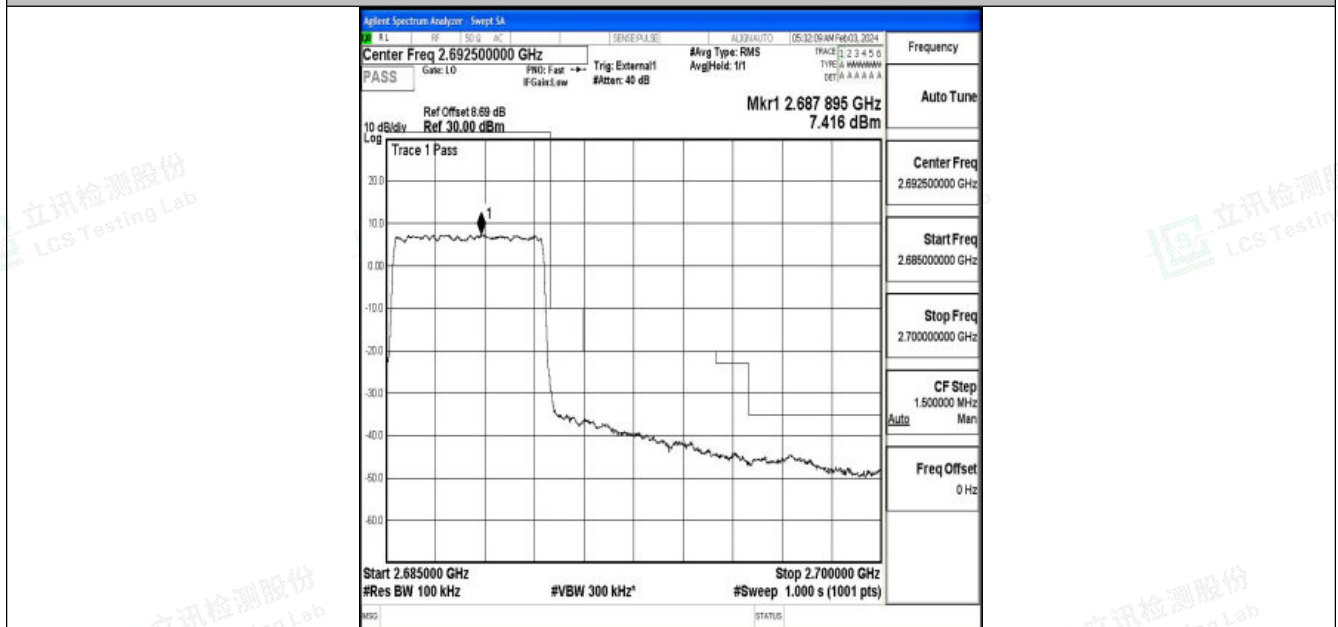

Band41_5MHz_QPSK_41565_25RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

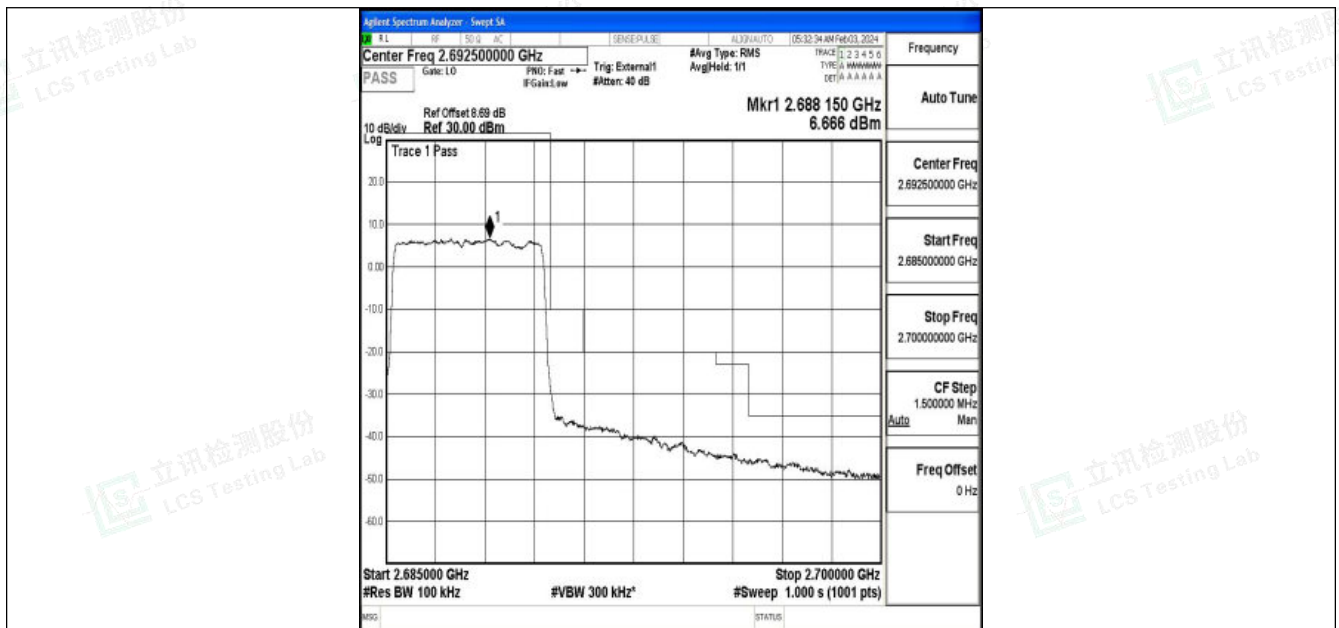


Band41_5MHz_16QAM_41565_25RB#0

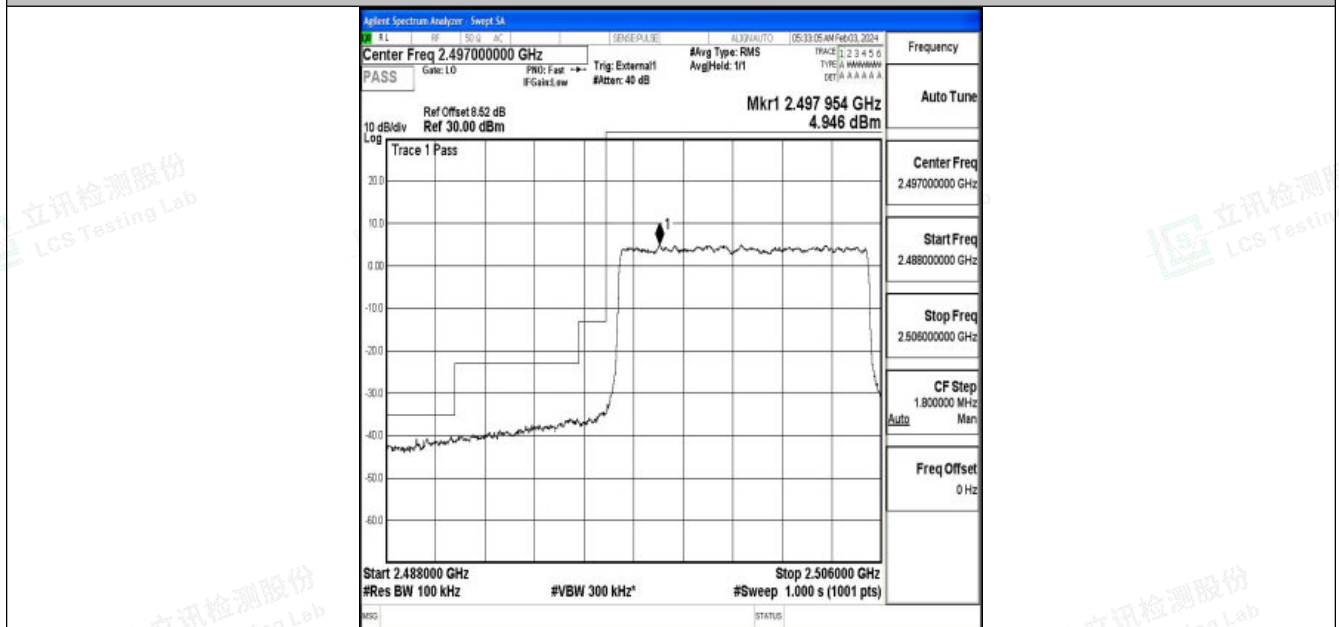


Band41_10MHz_QPSK_39700_50RB#0



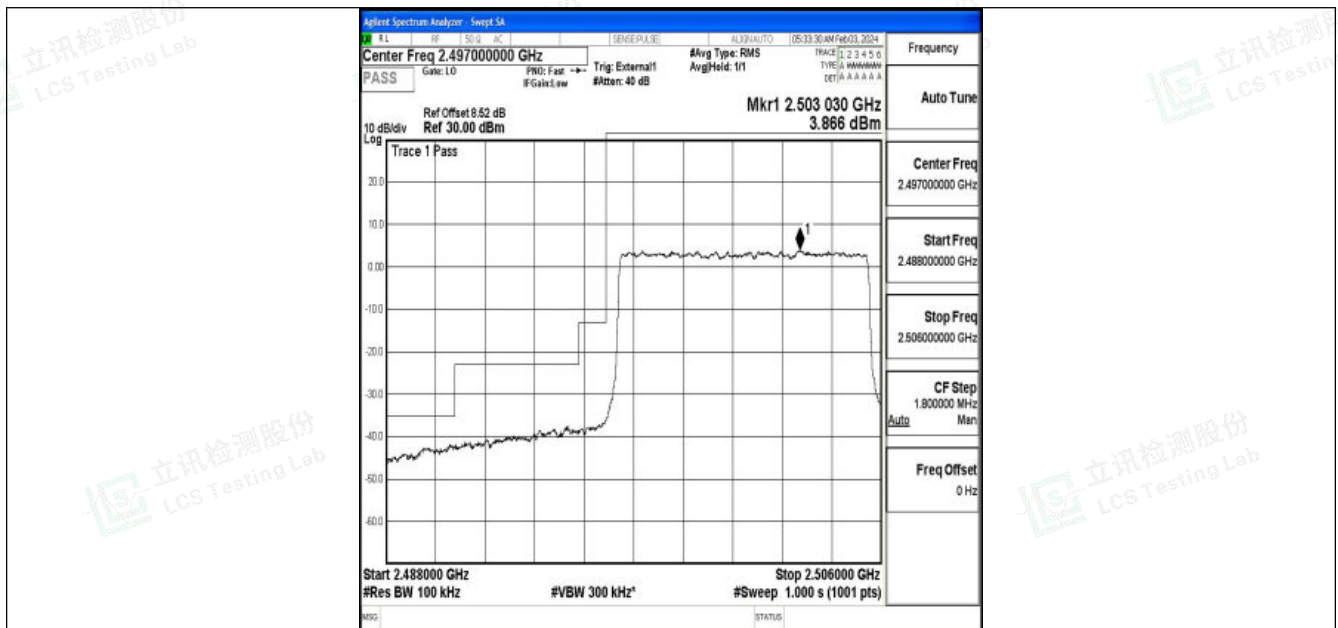

Band41_10MHz_16QAM_39700_50RB#0

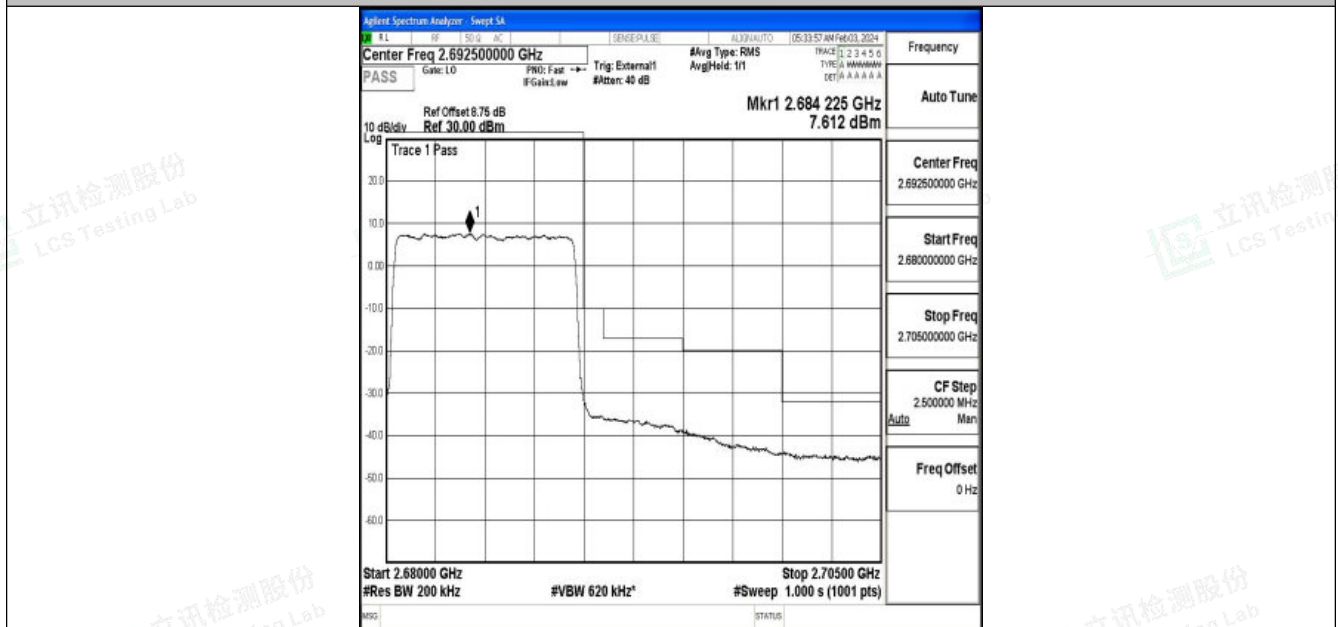

Band41_10MHz_QPSK_41540_50RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

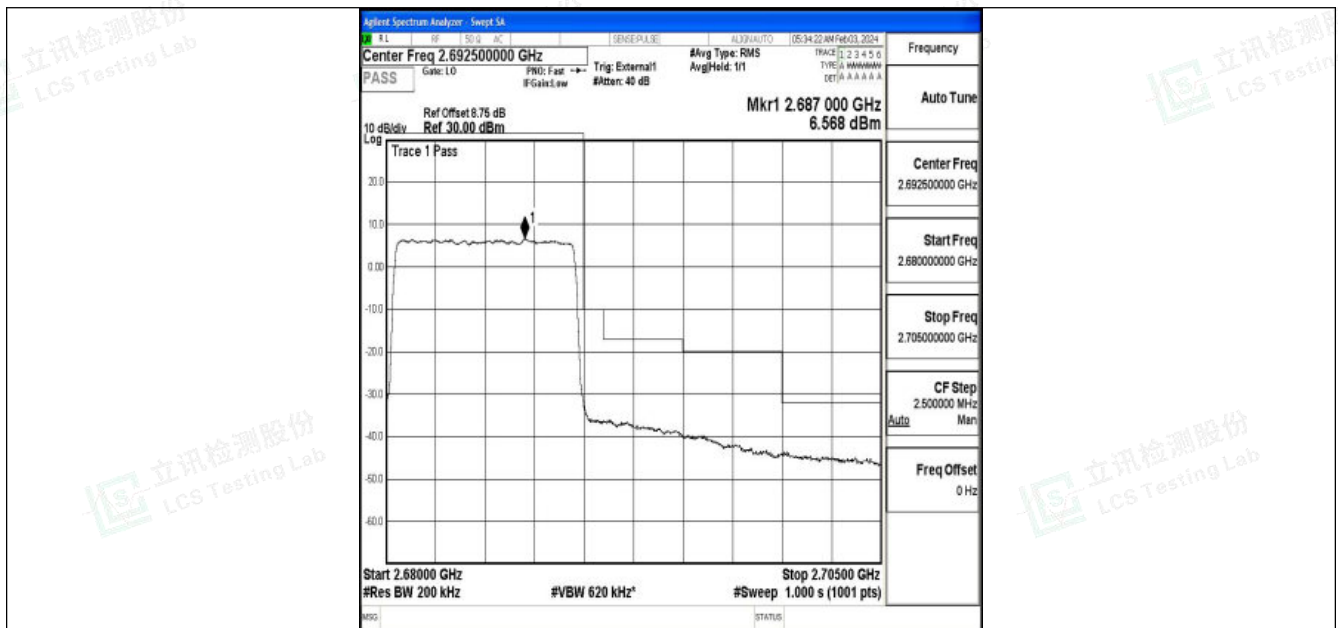


Band41_10MHz_16QAM_41540_50RB#0

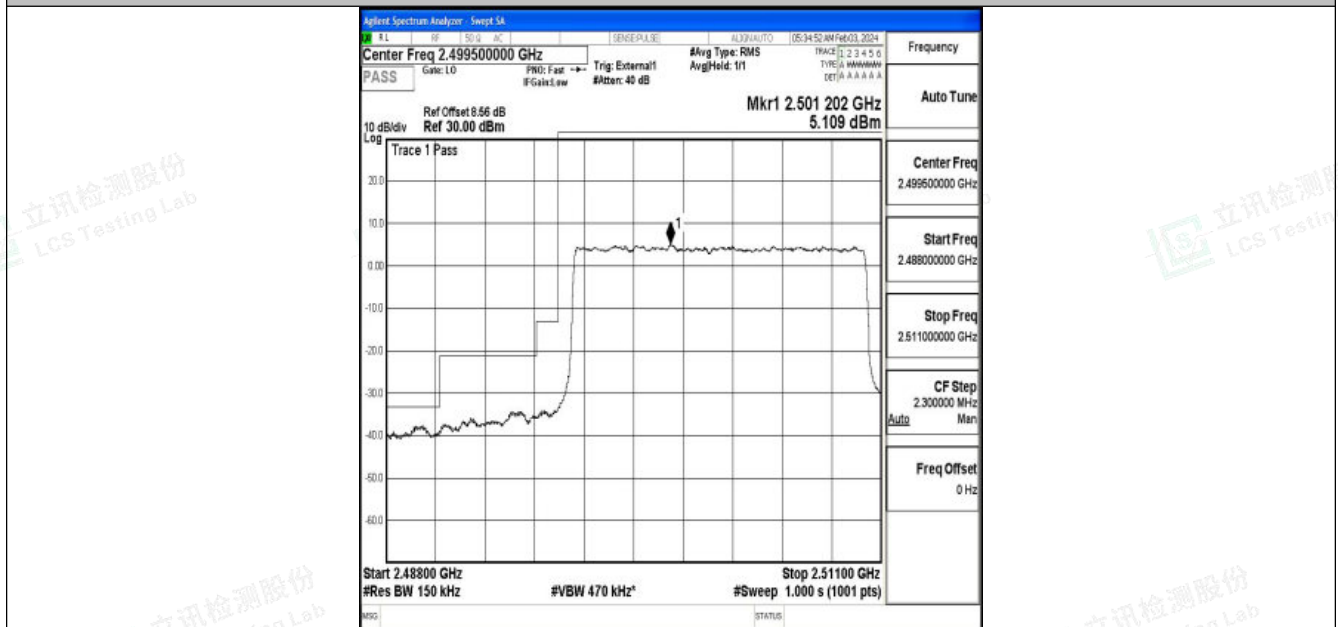


Band41_15MHz_QPSK_39725_75RB#0



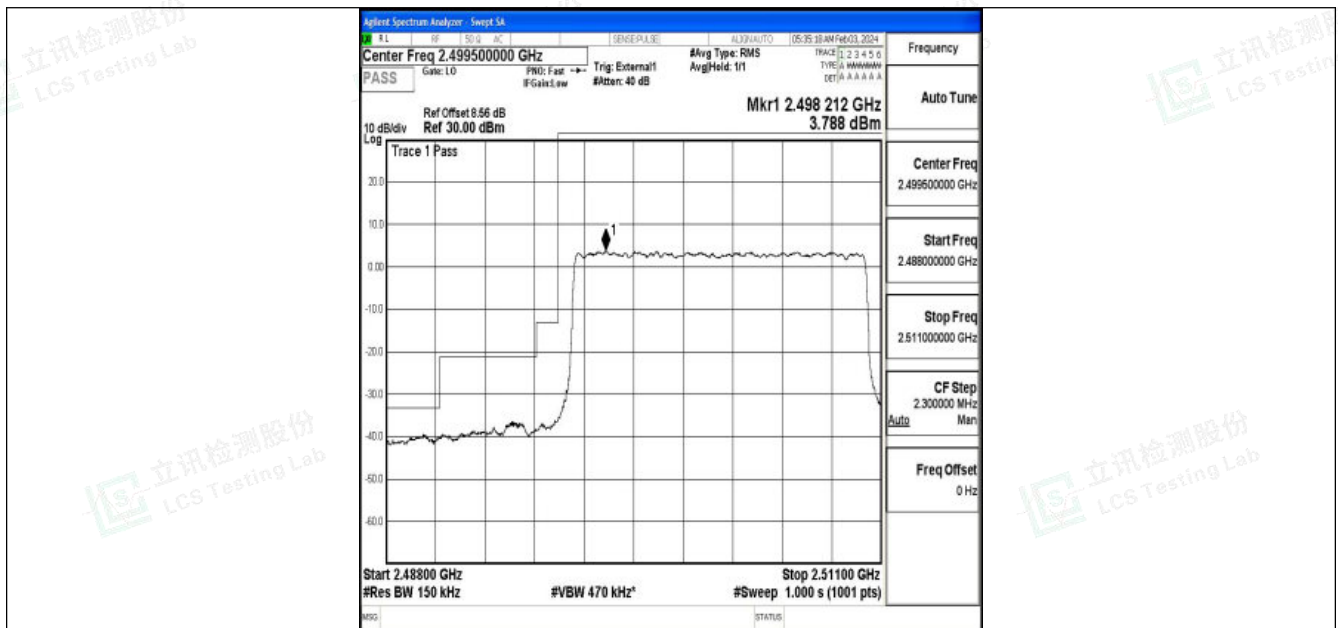

Band41_15MHz_16QAM_39725_75RB#0

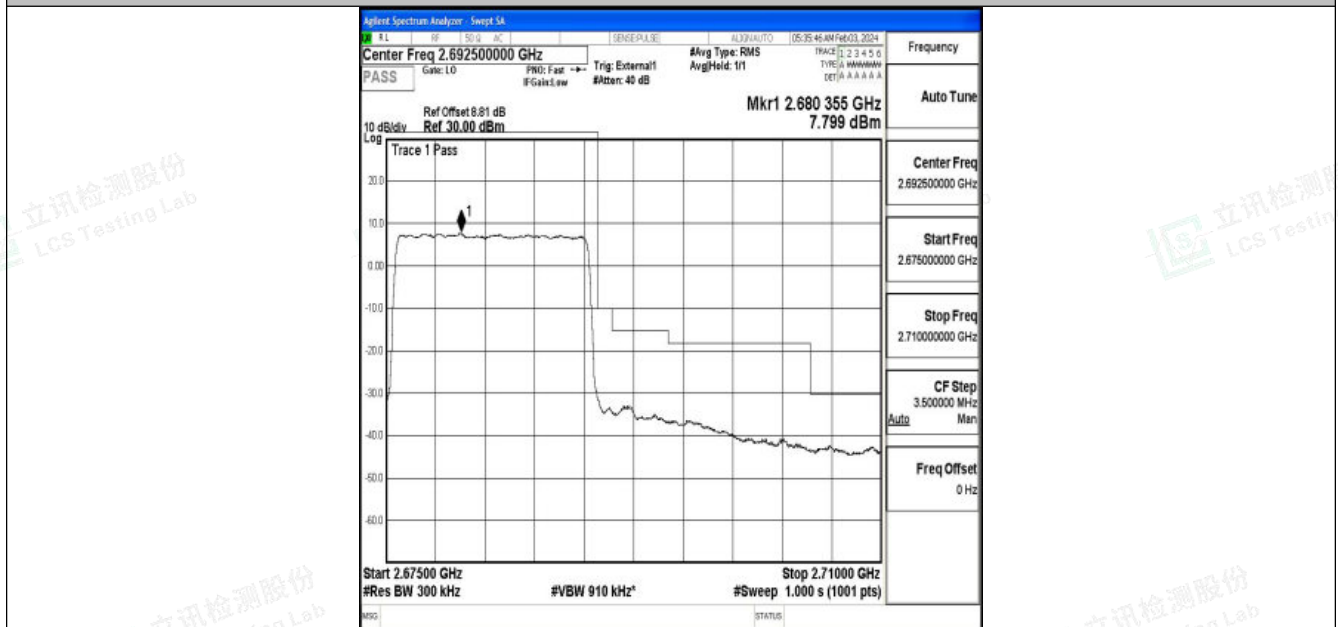

Band41_15MHz_QPSK_41515_75RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

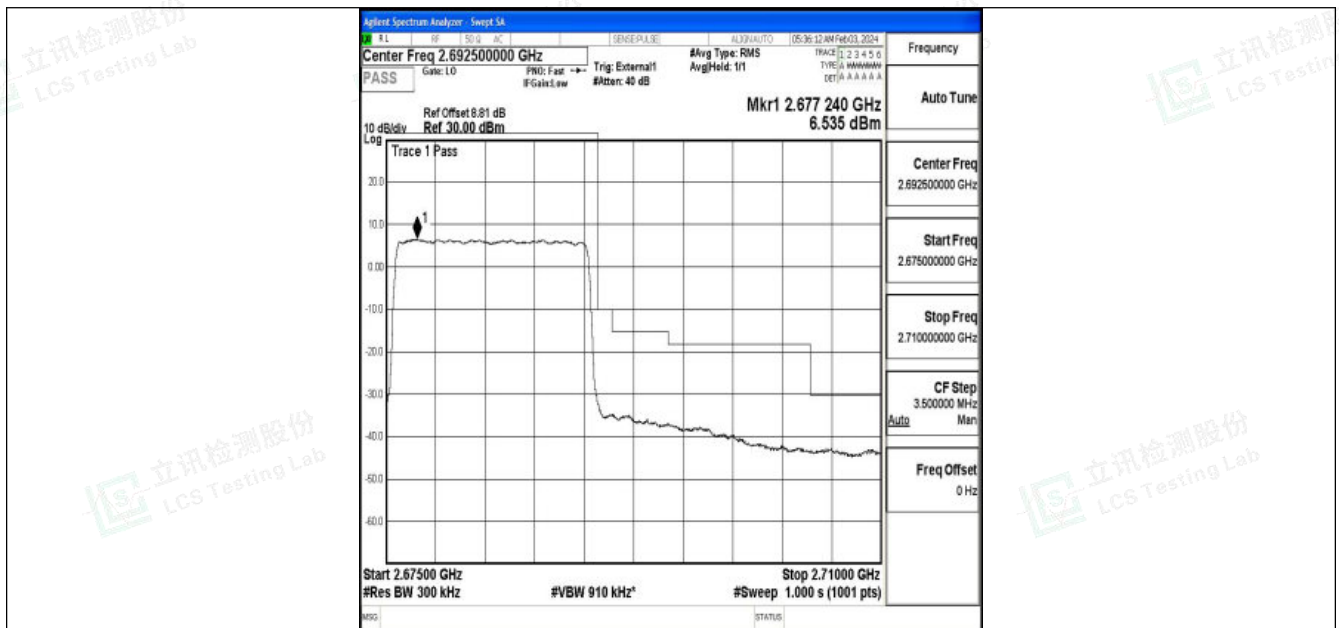


Band41_15MHz_16QAM_41515_75RB#0

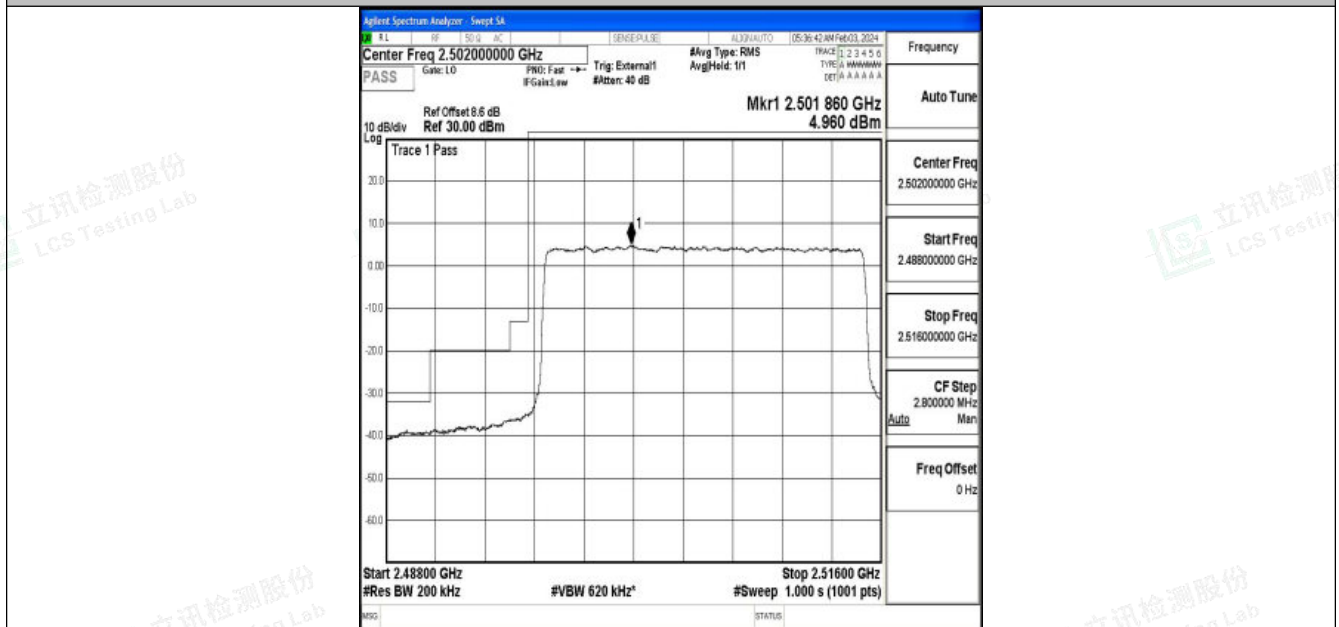


Band41_20MHz_QPSK_39750_100RB#0



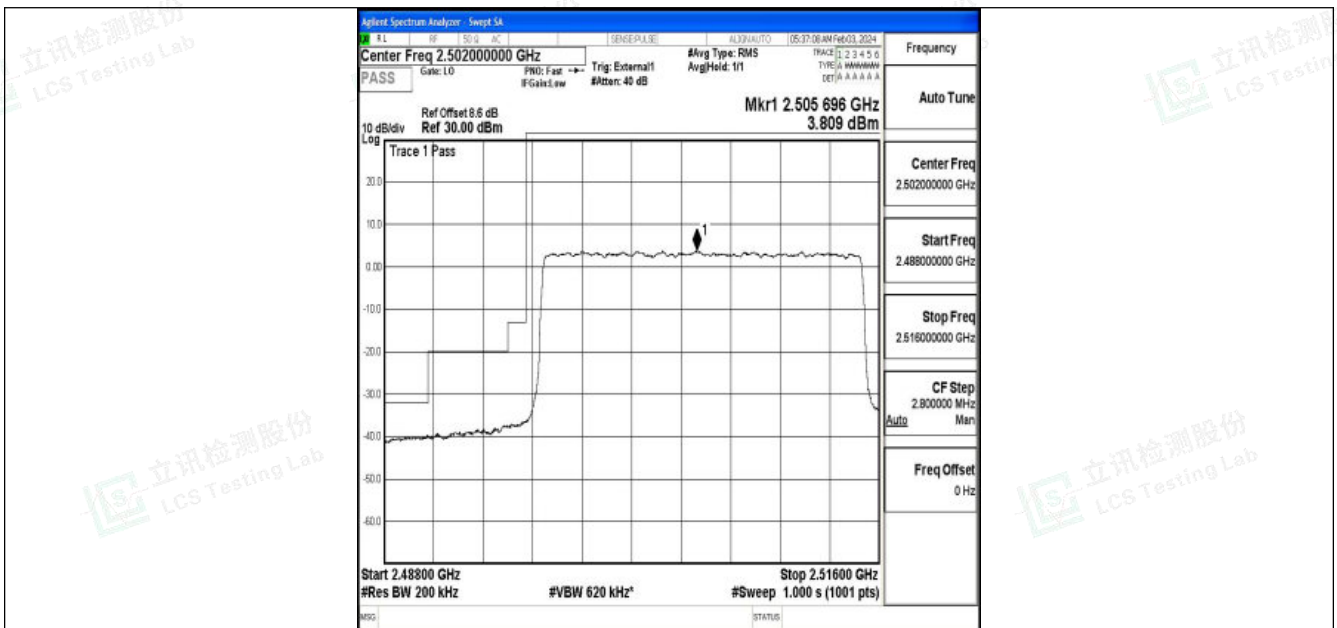

Band41_20MHz_16QAM_39750_100RB#0

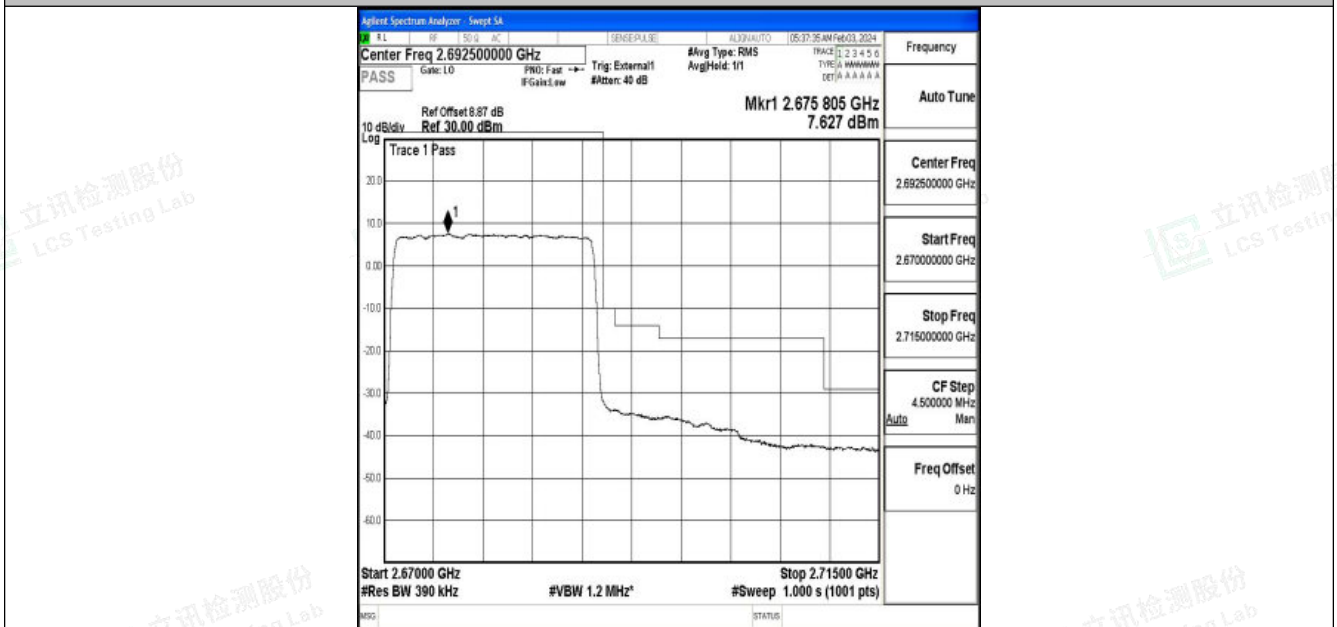

Band41_20MHz_QPSK_41490_100RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

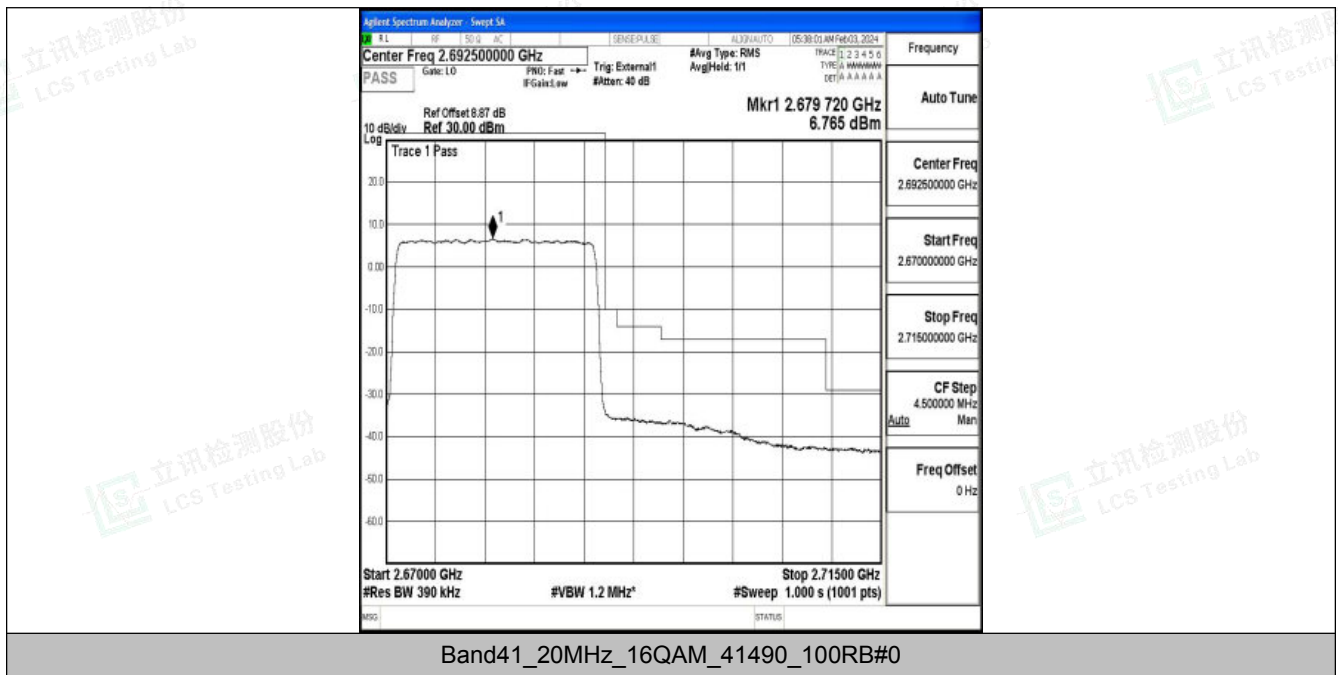



L.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-60.96	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-58.97	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-58.25	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-29.31	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-31.43	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-64.01	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-55.95	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-58.14	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-29.17	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-31.46	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-64.47	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-59.57	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-57.93	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-29.25	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-31.13	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-65.22	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-55.91	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-58.18	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-29.30	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-31.18	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-63.46	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-56.39	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-57.68	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-29.12	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-31.40	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-64.41	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-55.63	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-58.06	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-29.34	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-31.28	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-62.98	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-57.46	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-58.13	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-29.16	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-31.25	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-62.81	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-56.87	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-58.13	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-29.12	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-30.76	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-61.74	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-56.24	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-58.19	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-28.66	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-30.87	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-63.62	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-58.62	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-58.38	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-29.11	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-31.18	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-63.18	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-56.28	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-58.12	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-28.85	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-31.14	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-62.93	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-55.48	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-57.74	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-28.93	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-31.13	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-62.91	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-54.94	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-58.40	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-29.37	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-30.83	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-65.07	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-56.73	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-58.19	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-28.73	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-31.25	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-64.32	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-57.87	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-58.35	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-28.48	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-31.31	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-61.65	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-56.52	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-58.10	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-29.20	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-31.23	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-62.71	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-56.76	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-58.21	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-29.20	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-30.97	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-61.75	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-54.65	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-58.15	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-28.73	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-31.40	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-63.64	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-55.54	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-58.38	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-28.90	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-31.42	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-63.03	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-55.88	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-58.12	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-29.05	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-30.75	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-64.40	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-58.14	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-58.25	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-29.02	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-30.93	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-62.70	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-55.96	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-58.02	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-29.05	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-31.23	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-63.78	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-56.48	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-58.21	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-29.13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-31.21	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-64.53	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-57.58	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-58.24	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-29.32	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-31.23	PASS

Test Graphs

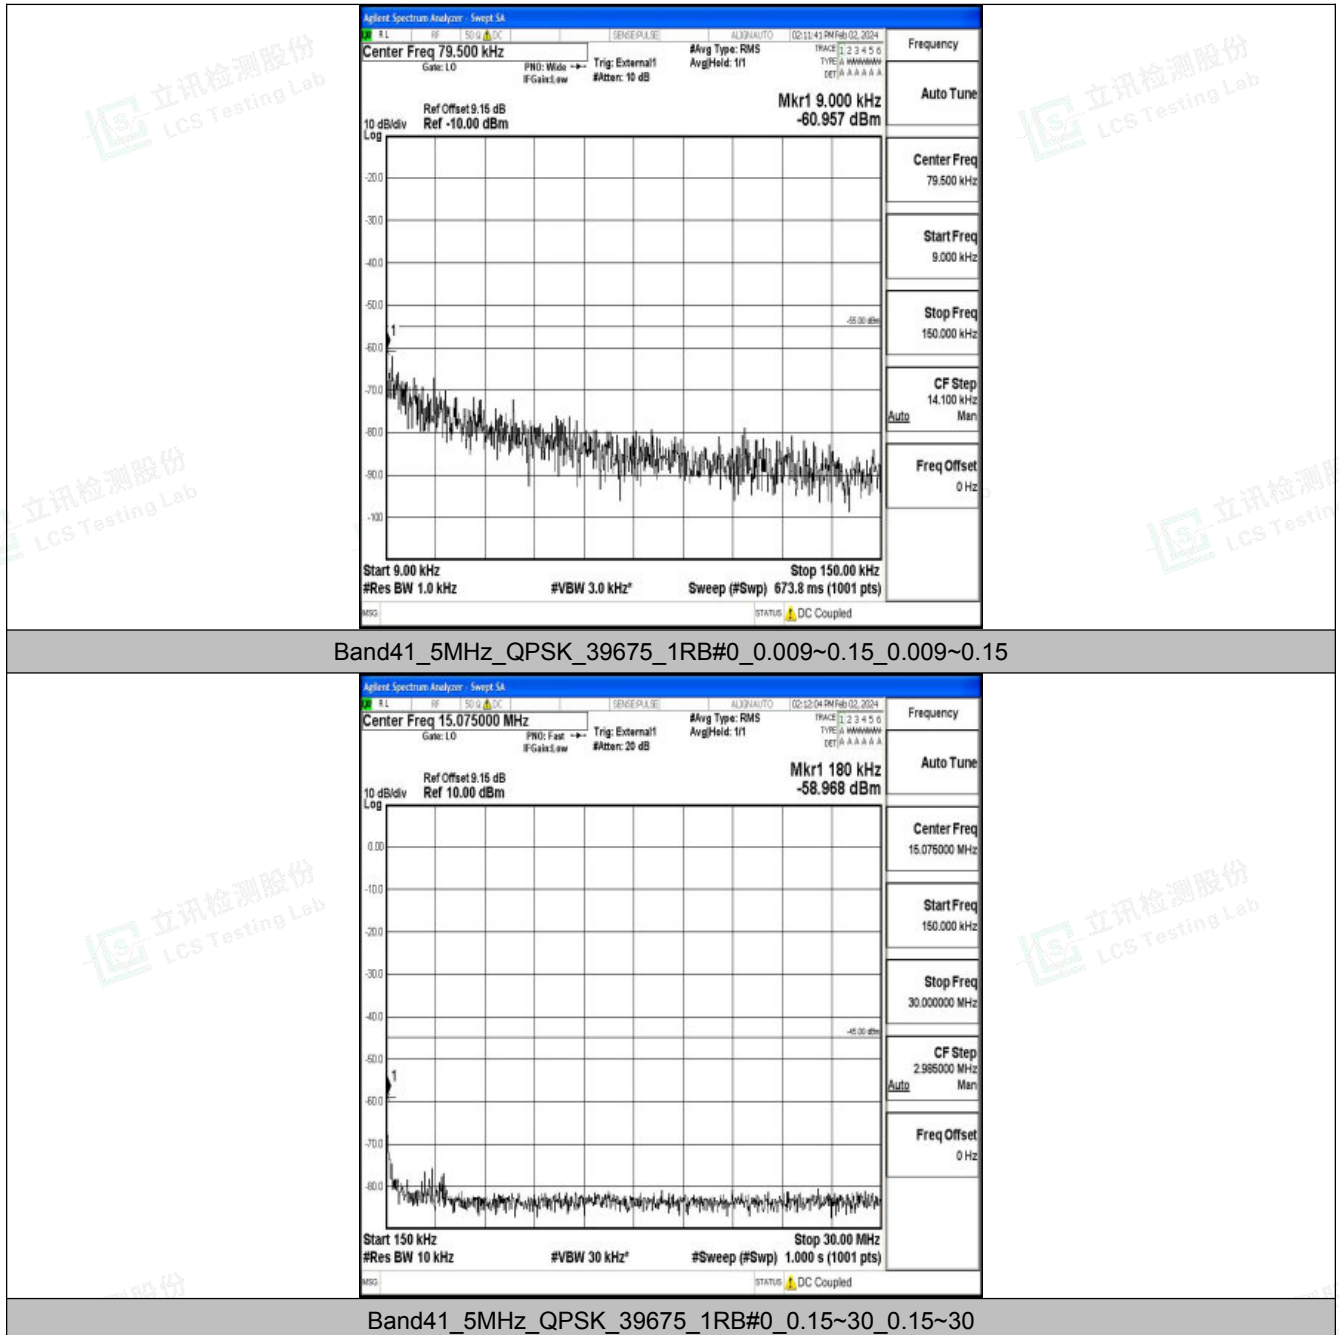

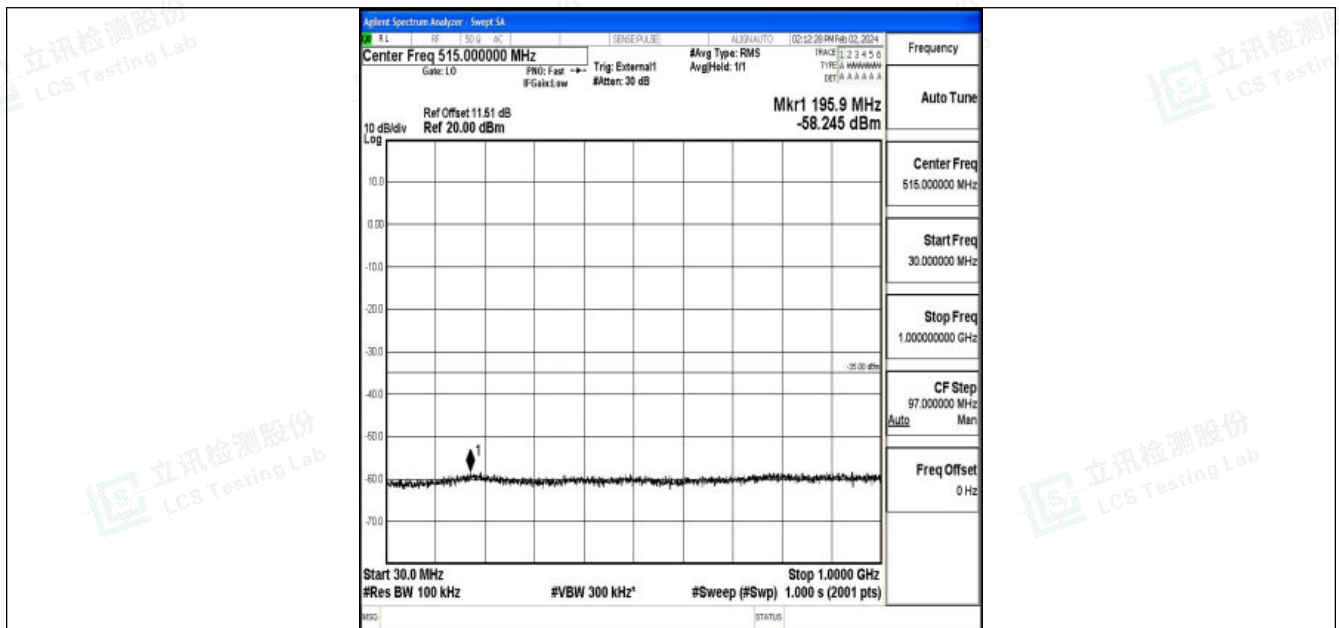


Band41_5MHz_QPSK_39675_1RB#0_30~1000_30~1000

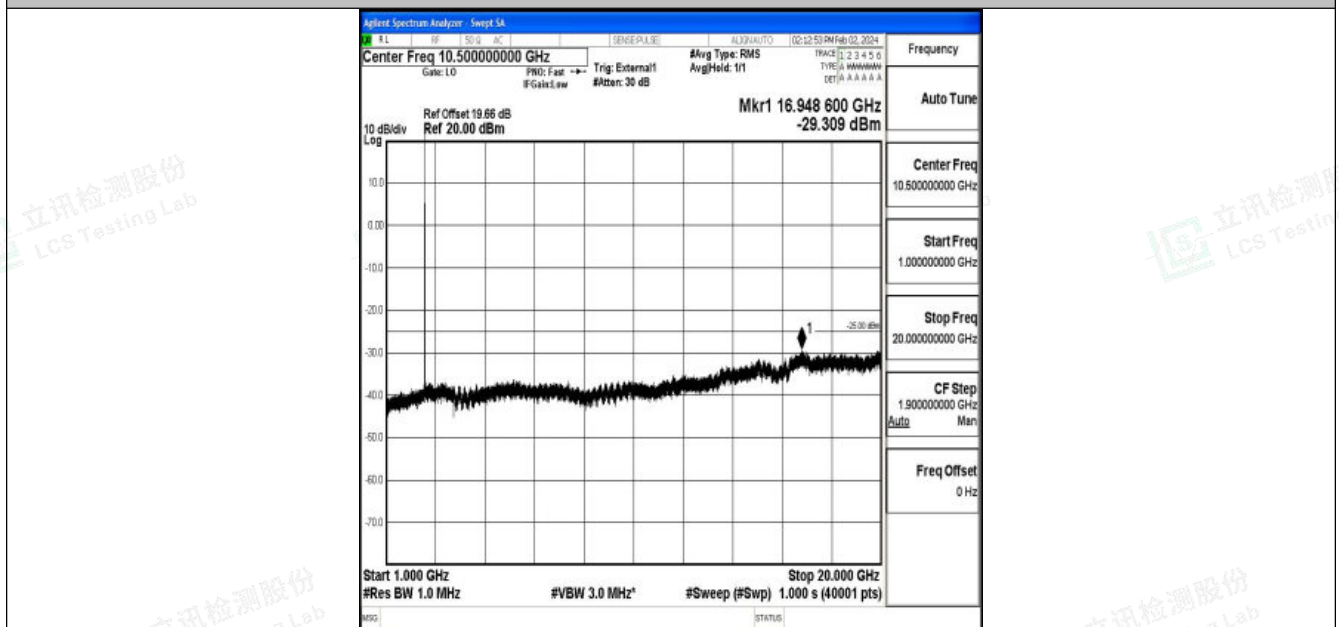


Band41_5MHz_QPSK_39675_1RB#0_1000~20000_1000~20000



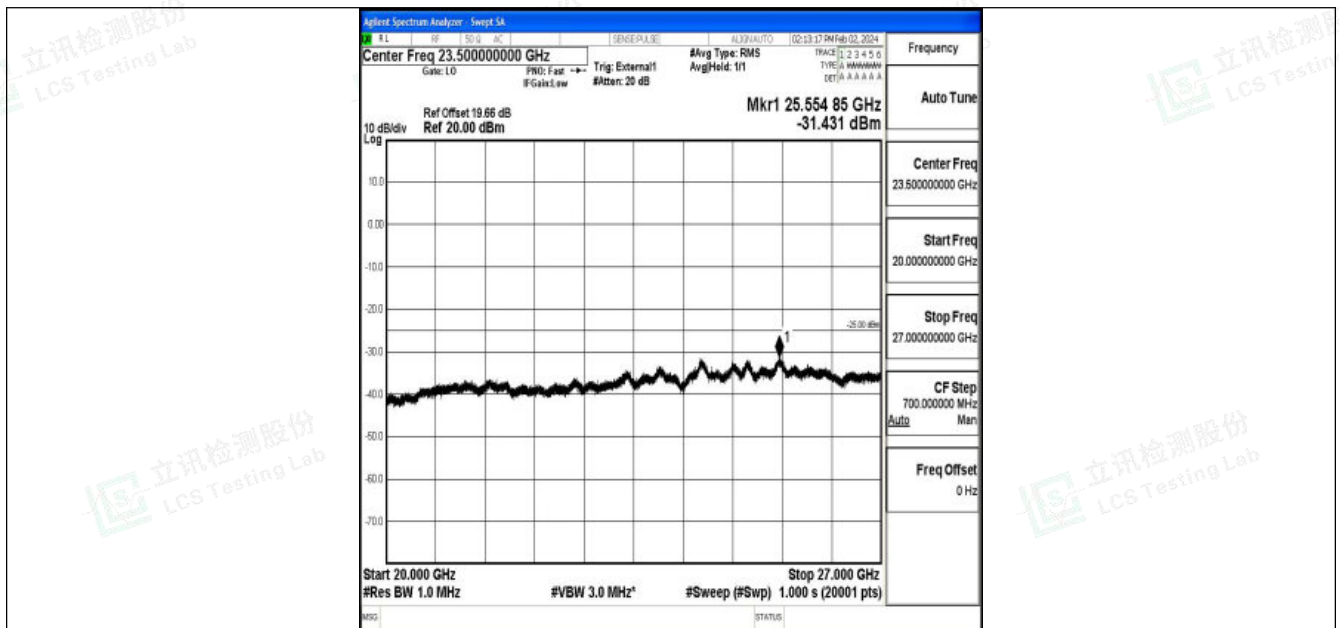

Band41_5MHz_QPSK_39675_1RB#0_20000~27000_20000~27000

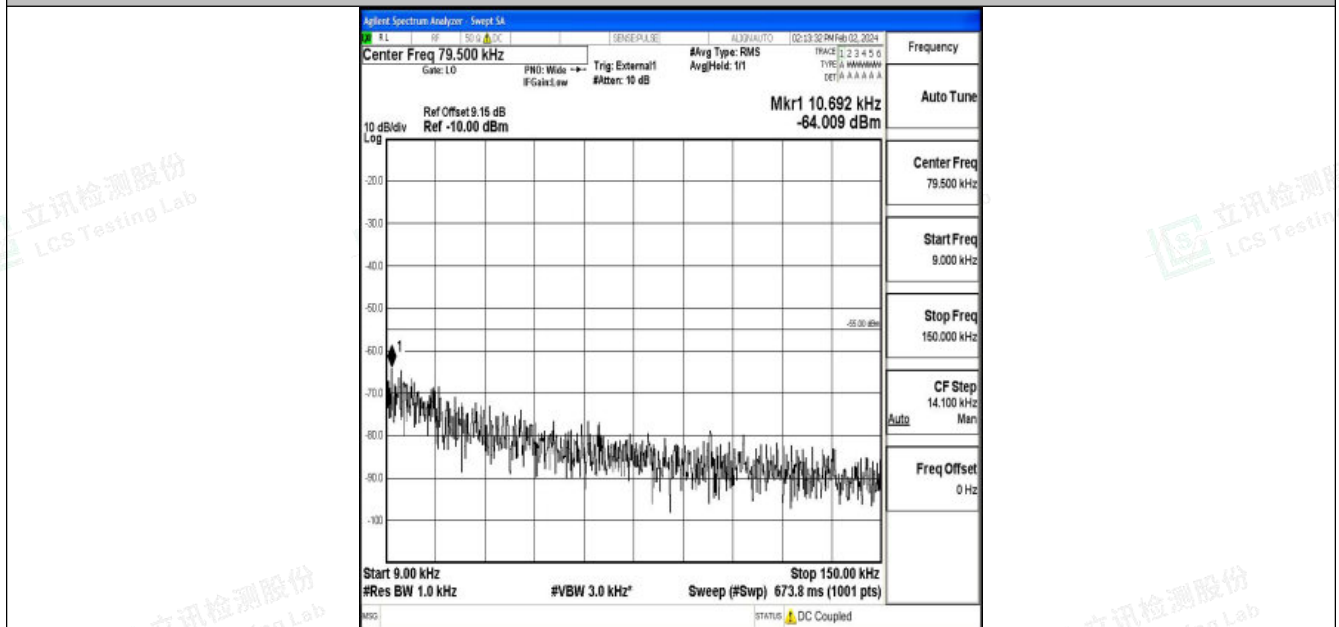

Band41_5MHz_16QAM_39675_1RB#0_0.009~0.15_0.009~0.15

