

|        |       |       |        |       |            |        |      |
|--------|-------|-------|--------|-------|------------|--------|------|
| Band66 | 15MHz | QPSK  | 132047 | 1RB#0 | 0.15~30    | -61.55 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 1RB#0 | 30~1000    | -66.55 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 1RB#0 | 1000~3000  | -50.17 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 1RB#0 | 3000~20000 | -31.41 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 1RB#0 | 0.009~0.15 | -66.35 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 1RB#0 | 0.15~30    | -61.13 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 1RB#0 | 30~1000    | -66.23 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 1RB#0 | 1000~3000  | -50.93 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 1RB#0 | 3000~20000 | -35.24 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 1RB#0 | 0.009~0.15 | -66.35 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 1RB#0 | 0.15~30    | -60.47 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 1RB#0 | 30~1000    | -66.43 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 1RB#0 | 1000~3000  | -52.63 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 1RB#0 | 3000~20000 | -37.00 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 1RB#0 | 0.009~0.15 | -62.97 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 1RB#0 | 0.15~30    | -59.58 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 1RB#0 | 30~1000    | -66.74 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 1RB#0 | 1000~3000  | -52.62 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 1RB#0 | 3000~20000 | -37.78 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 1RB#0 | 0.009~0.15 | -59.39 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 1RB#0 | 0.15~30    | -59.14 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 1RB#0 | 30~1000    | -66.42 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 1RB#0 | 1000~3000  | -52.62 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 1RB#0 | 3000~20000 | -38.32 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 1RB#0 | 0.009~0.15 | -63.09 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 1RB#0 | 0.15~30    | -58.62 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 1RB#0 | 30~1000    | -66.65 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 1RB#0 | 1000~3000  | -52.07 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 1RB#0 | 3000~20000 | -36.95 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 1RB#0 | 0.009~0.15 | -65.23 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 1RB#0 | 0.15~30    | -61.53 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 1RB#0 | 30~1000    | -66.68 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 1RB#0 | 1000~3000  | -44.09 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 1RB#0 | 3000~20000 | -33.25 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 1RB#0 | 0.009~0.15 | -62.93 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 1RB#0 | 0.15~30    | -59.82 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 1RB#0 | 30~1000    | -66.50 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 1RB#0 | 1000~3000  | -44.26 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 1RB#0 | 3000~20000 | -32.31 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 1RB#0 | 0.009~0.15 | -62.71 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 1RB#0 | 0.15~30    | -60.12 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 1RB#0 | 30~1000    | -66.40 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500


www.anbotek.com.cn



|        |       |       |        |       |            |        |      |
|--------|-------|-------|--------|-------|------------|--------|------|
| Band66 | 20MHz | QPSK  | 132322 | 1RB#0 | 1000~3000  | -52.76 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 1RB#0 | 3000~20000 | -35.94 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 1RB#0 | 0.009~0.15 | -64.32 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 1RB#0 | 0.15~30    | -59.51 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 1RB#0 | 30~1000    | -66.77 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 1RB#0 | 1000~3000  | -52.77 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 1RB#0 | 3000~20000 | -35.76 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 1RB#0 | 0.009~0.15 | -66.05 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 1RB#0 | 0.15~30    | -60.78 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 1RB#0 | 30~1000    | -66.40 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 1RB#0 | 1000~3000  | -47.42 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 1RB#0 | 3000~20000 | -40.10 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 1RB#0 | 0.009~0.15 | -65.59 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 1RB#0 | 0.15~30    | -60.55 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 1RB#0 | 30~1000    | -66.73 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 1RB#0 | 1000~3000  | -48.72 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 1RB#0 | 3000~20000 | -40.49 | PASS |



## Test Graphs

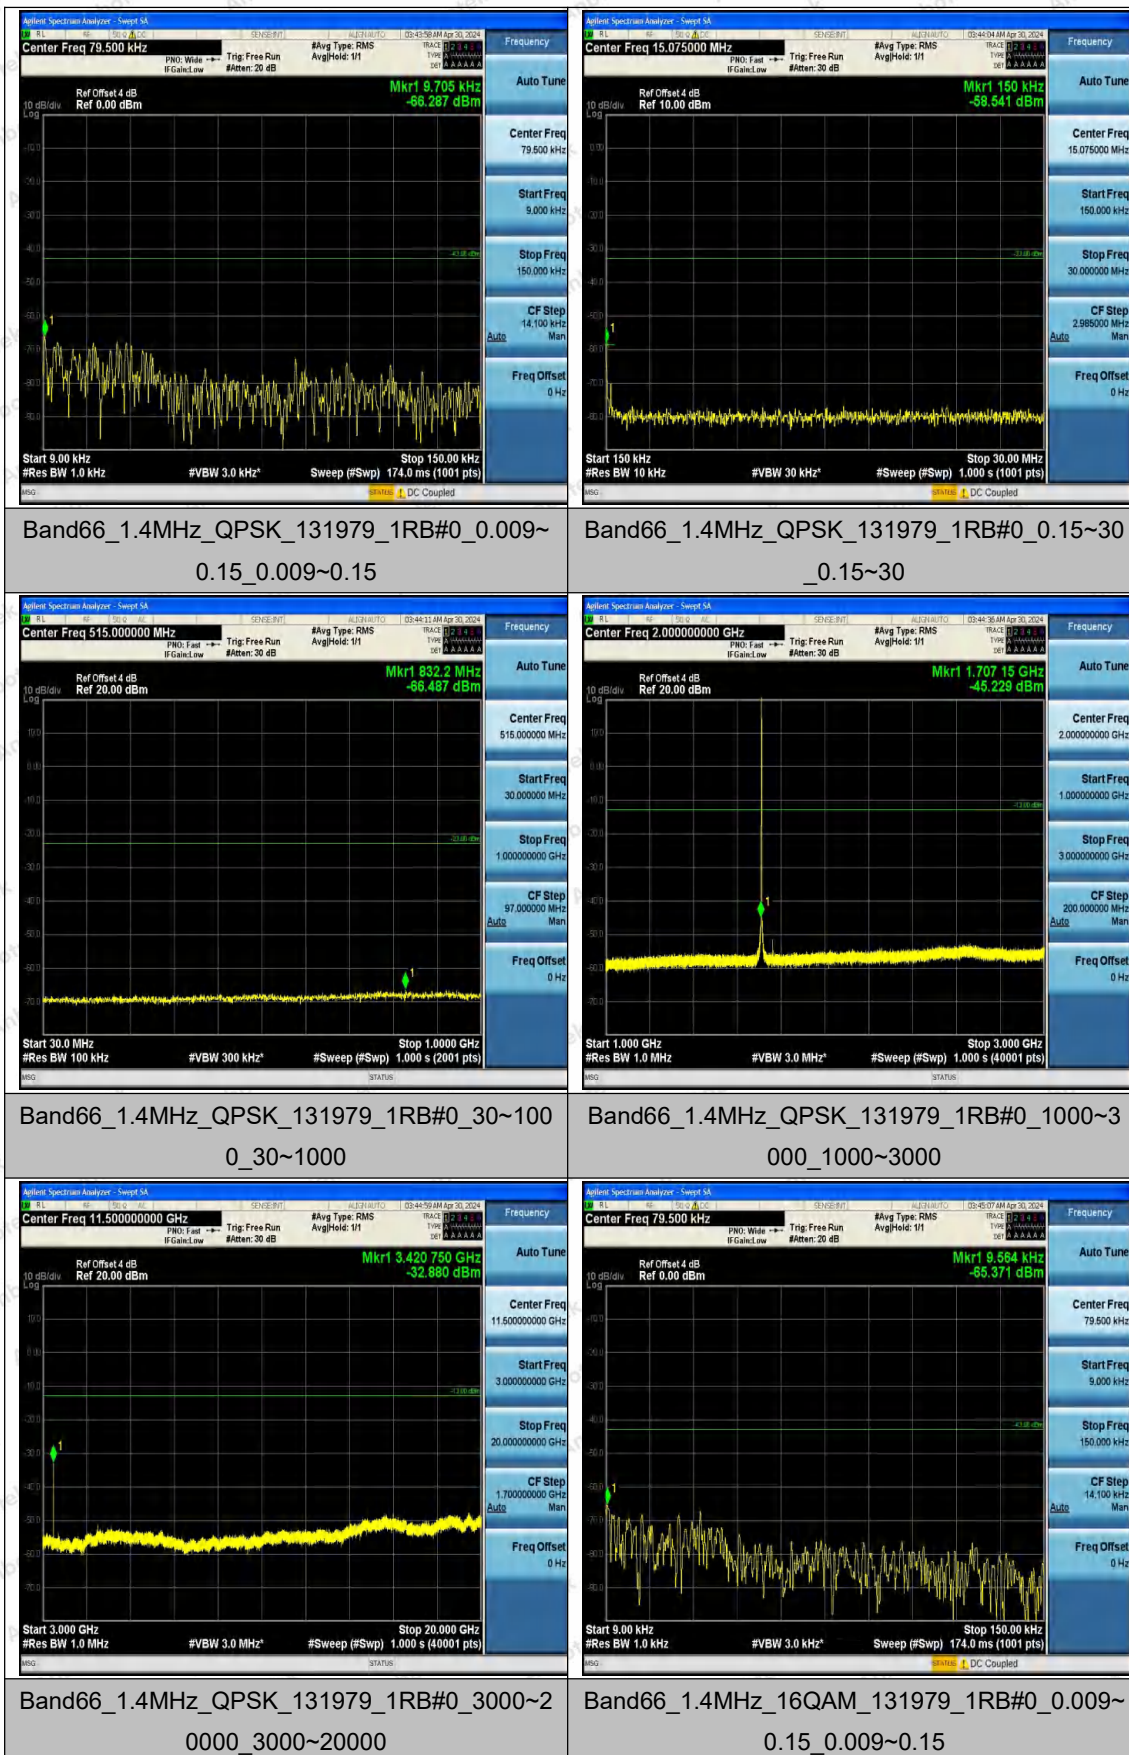


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



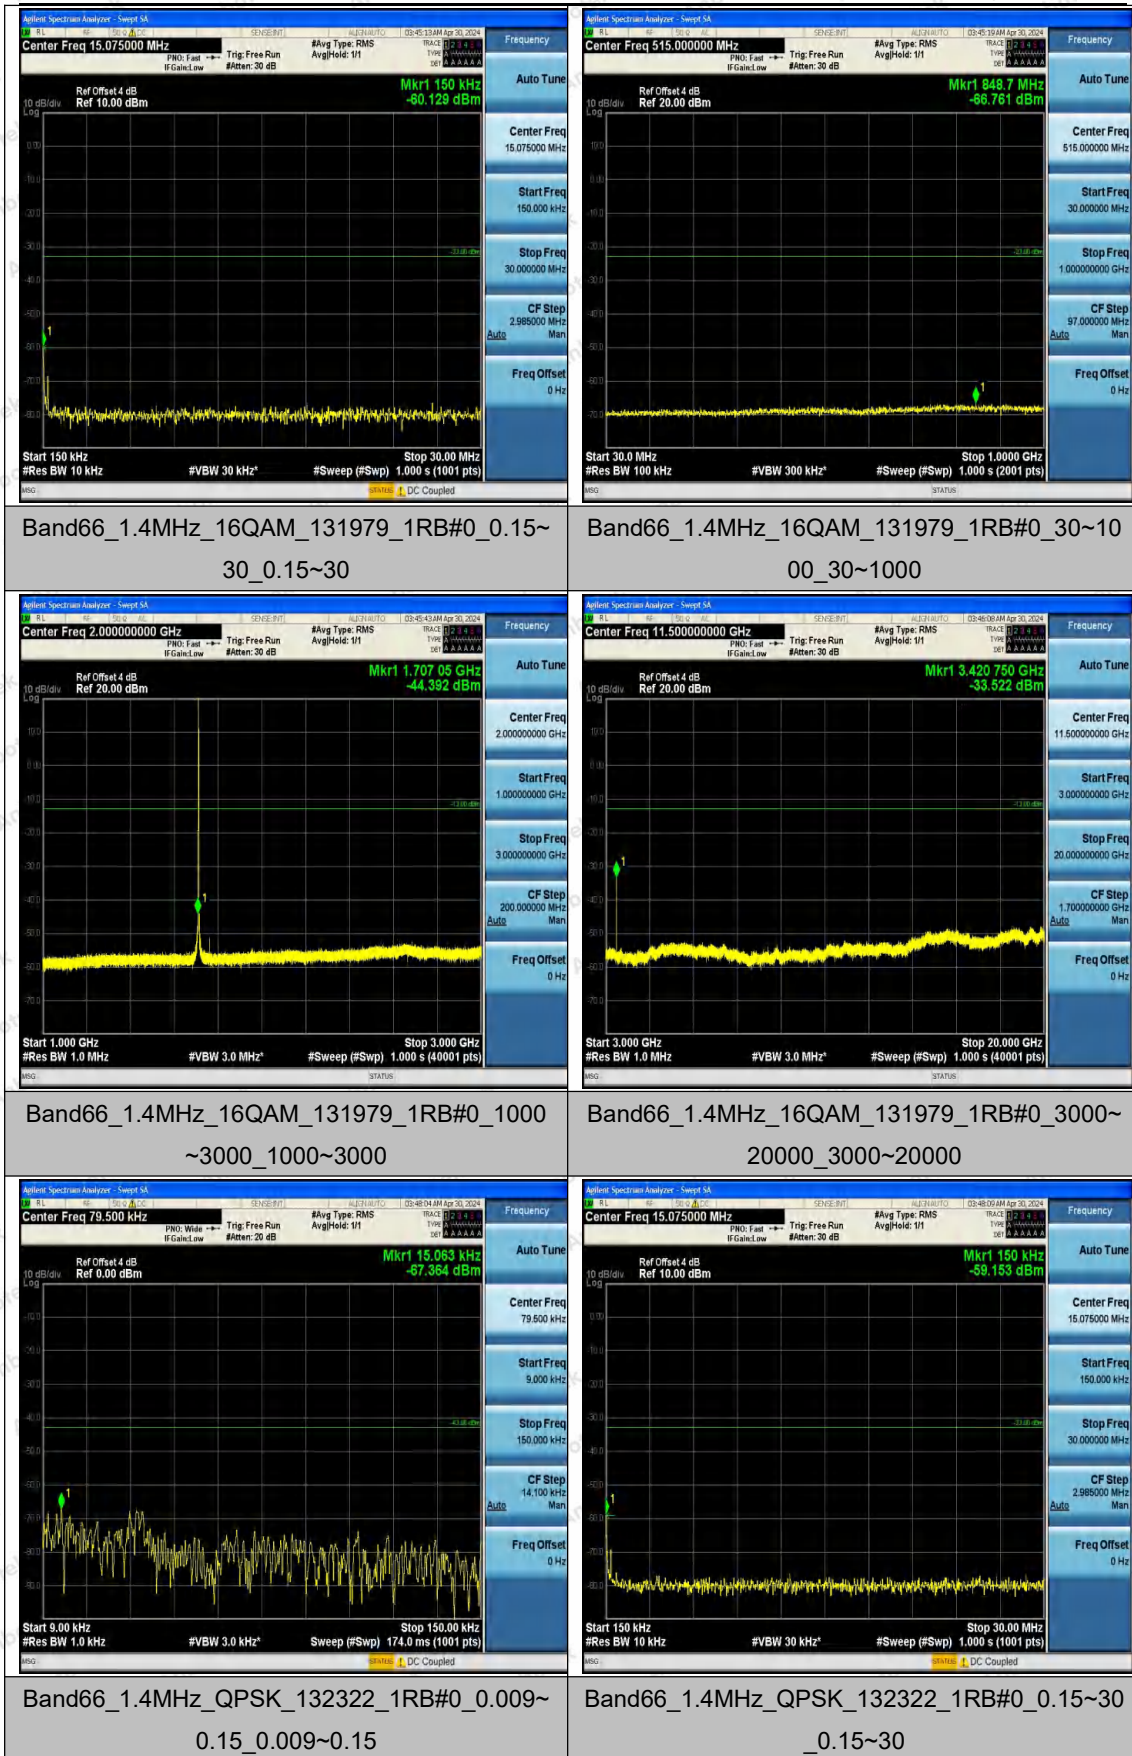


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



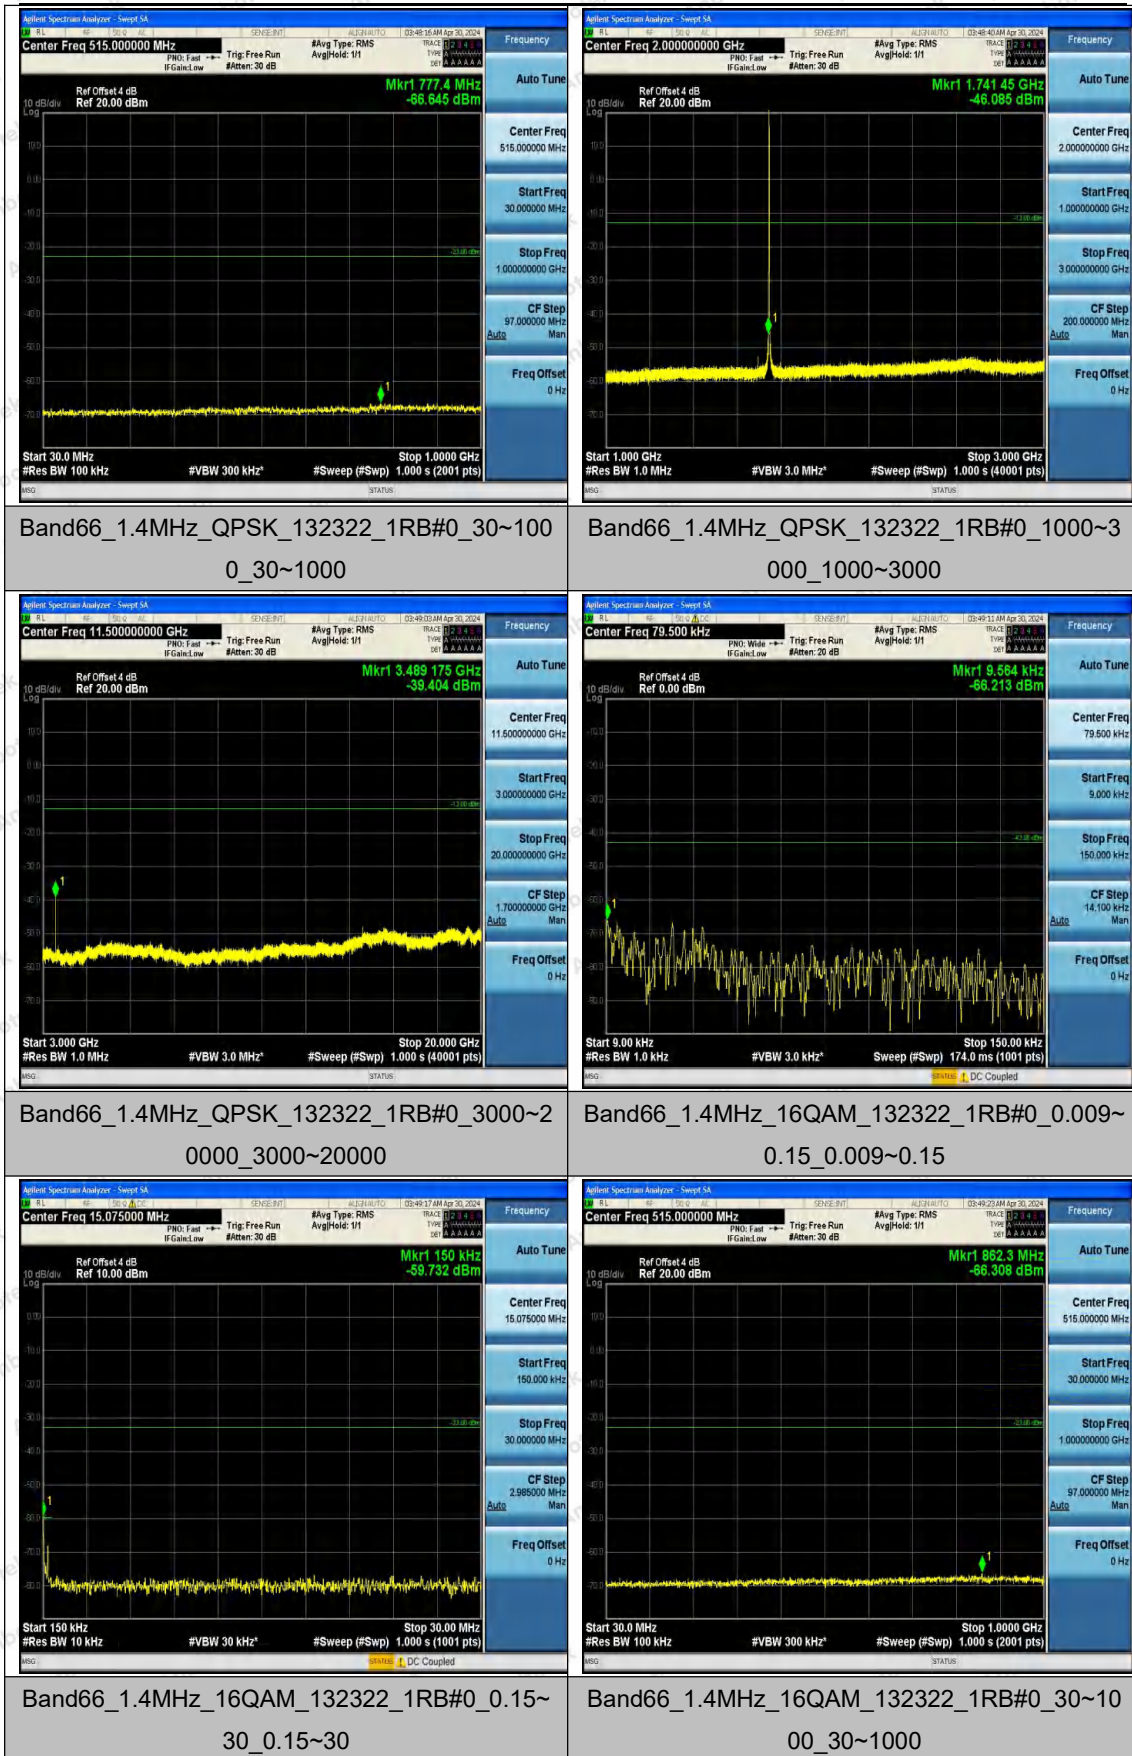


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



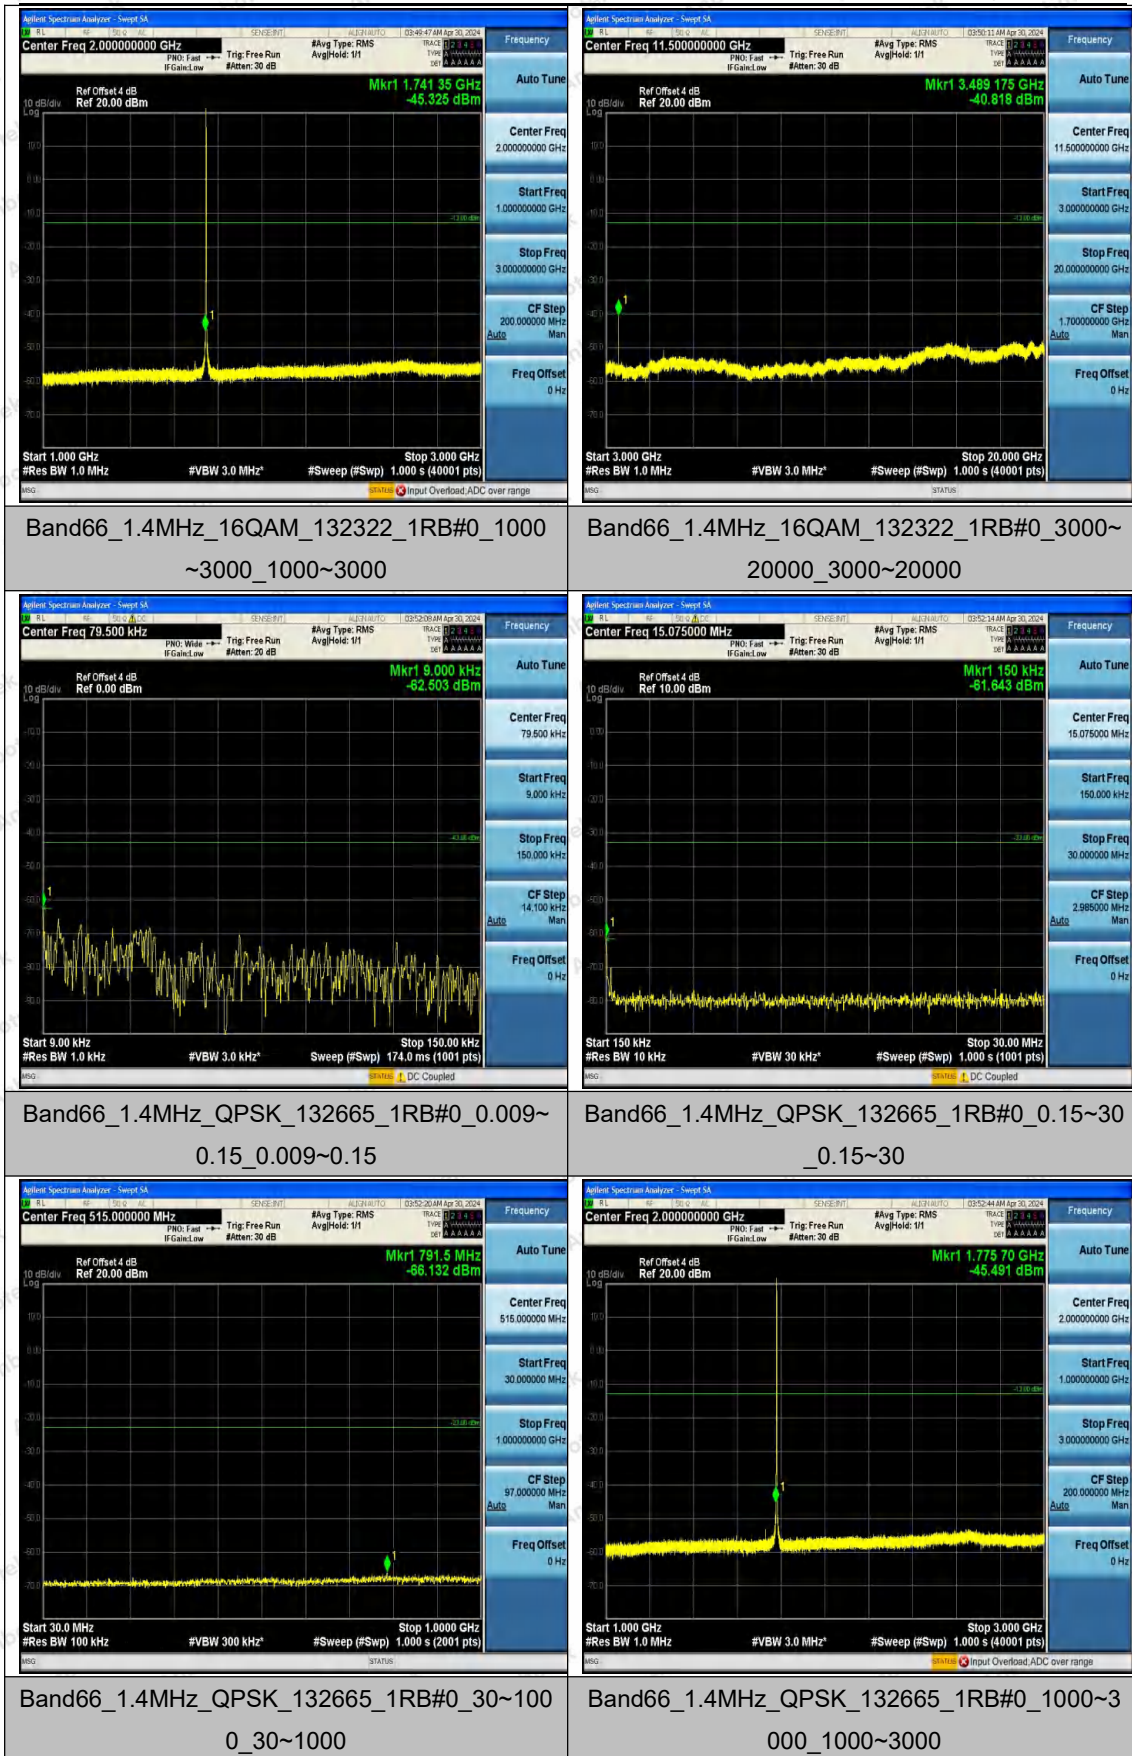


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



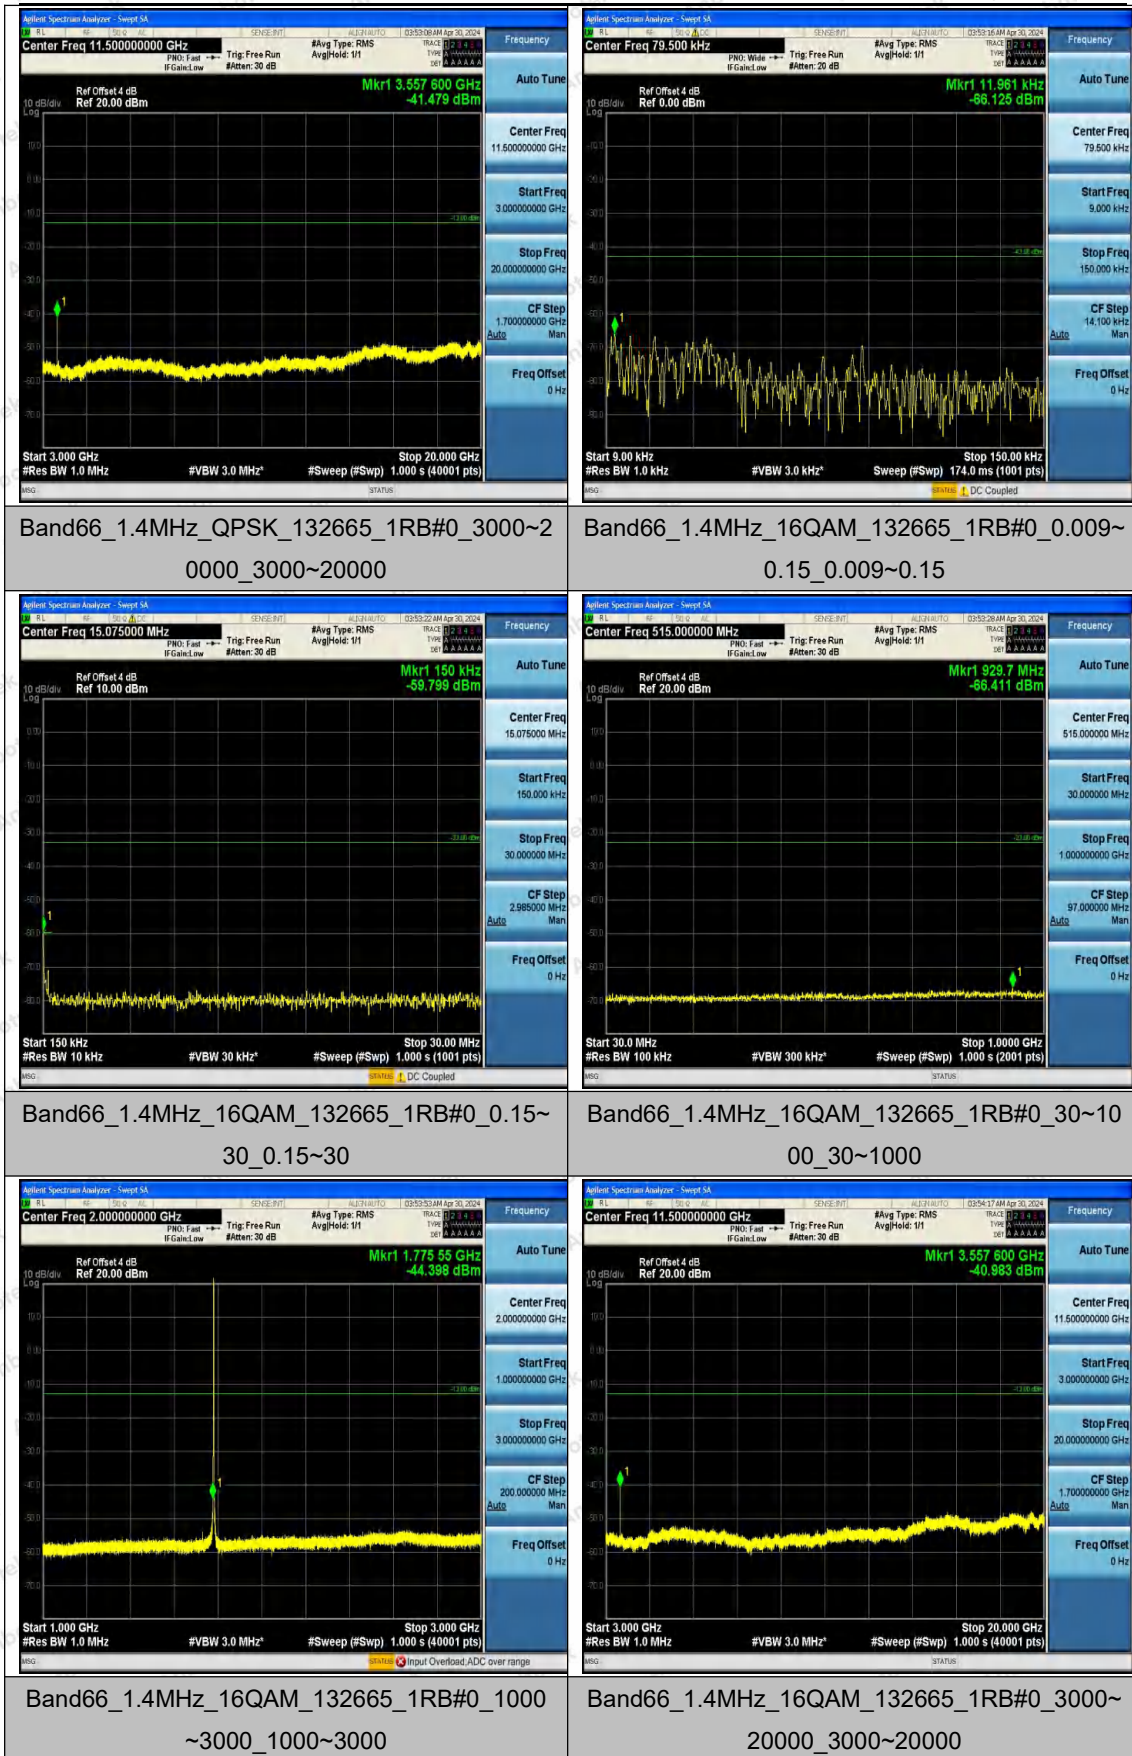


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



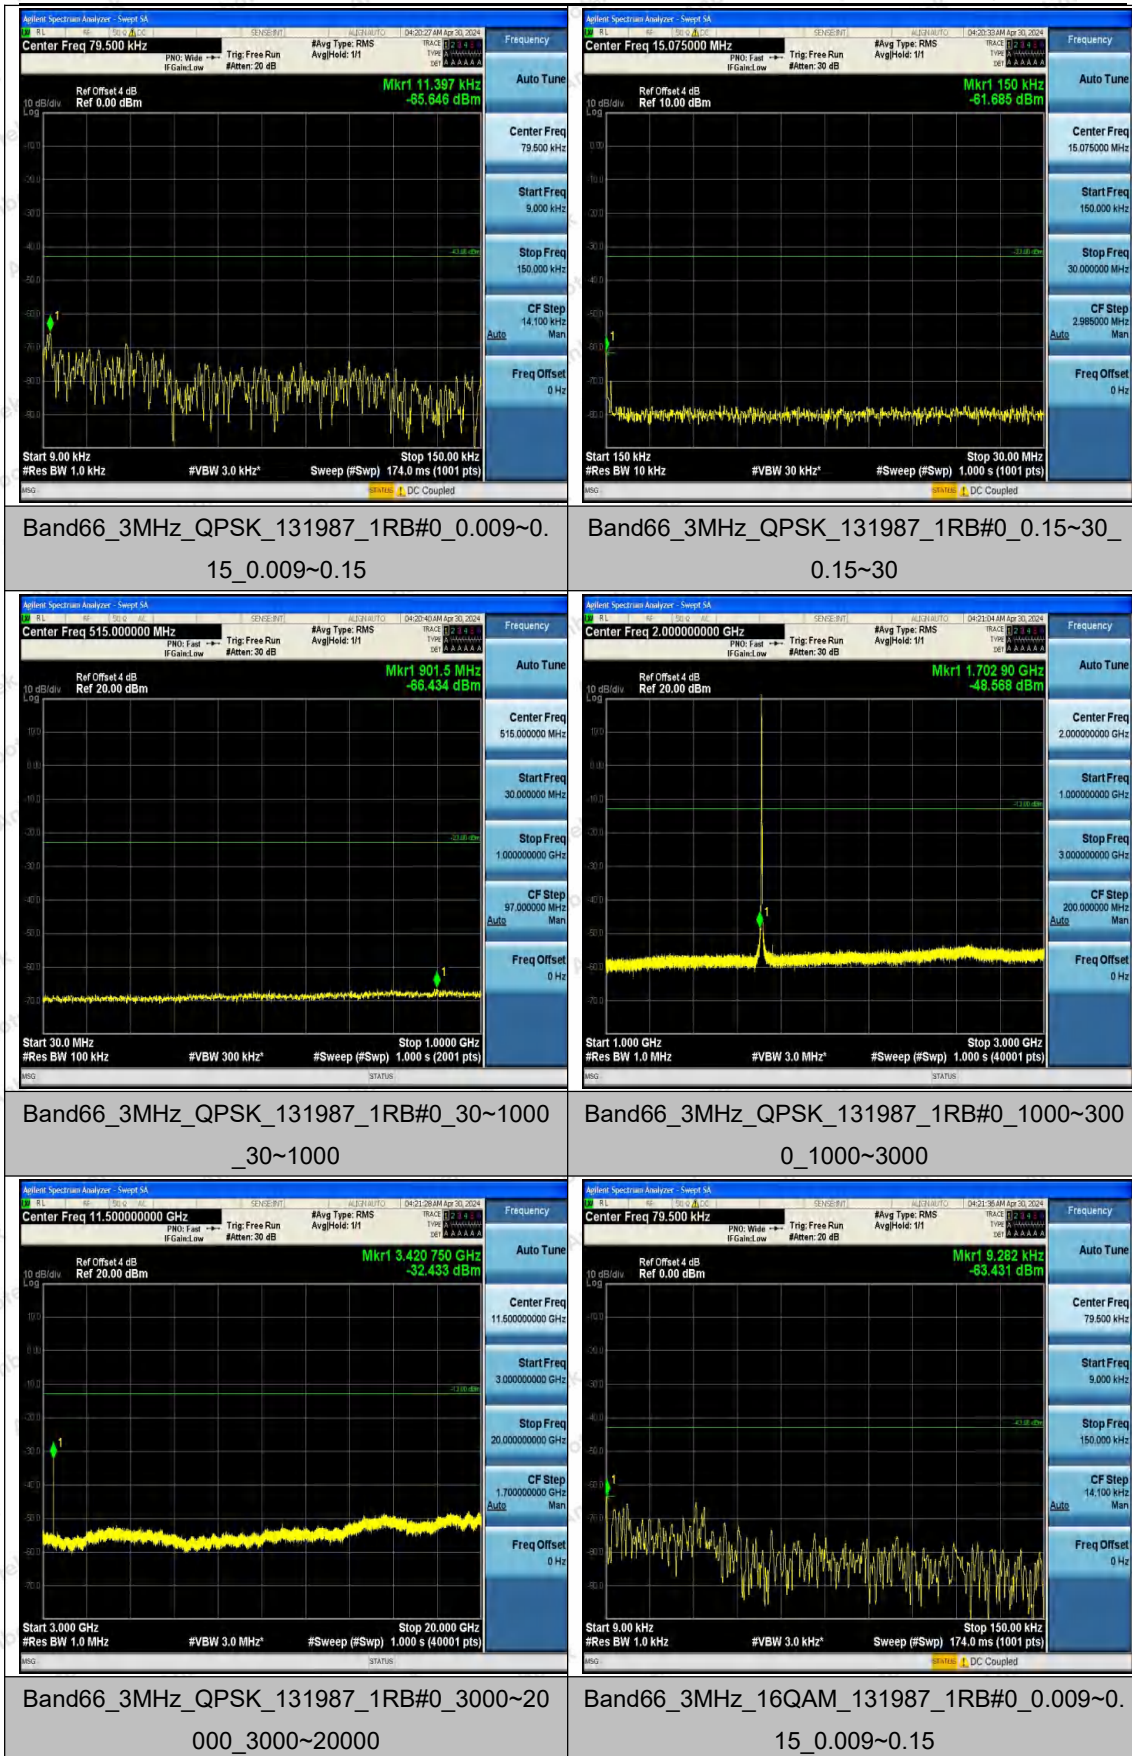


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



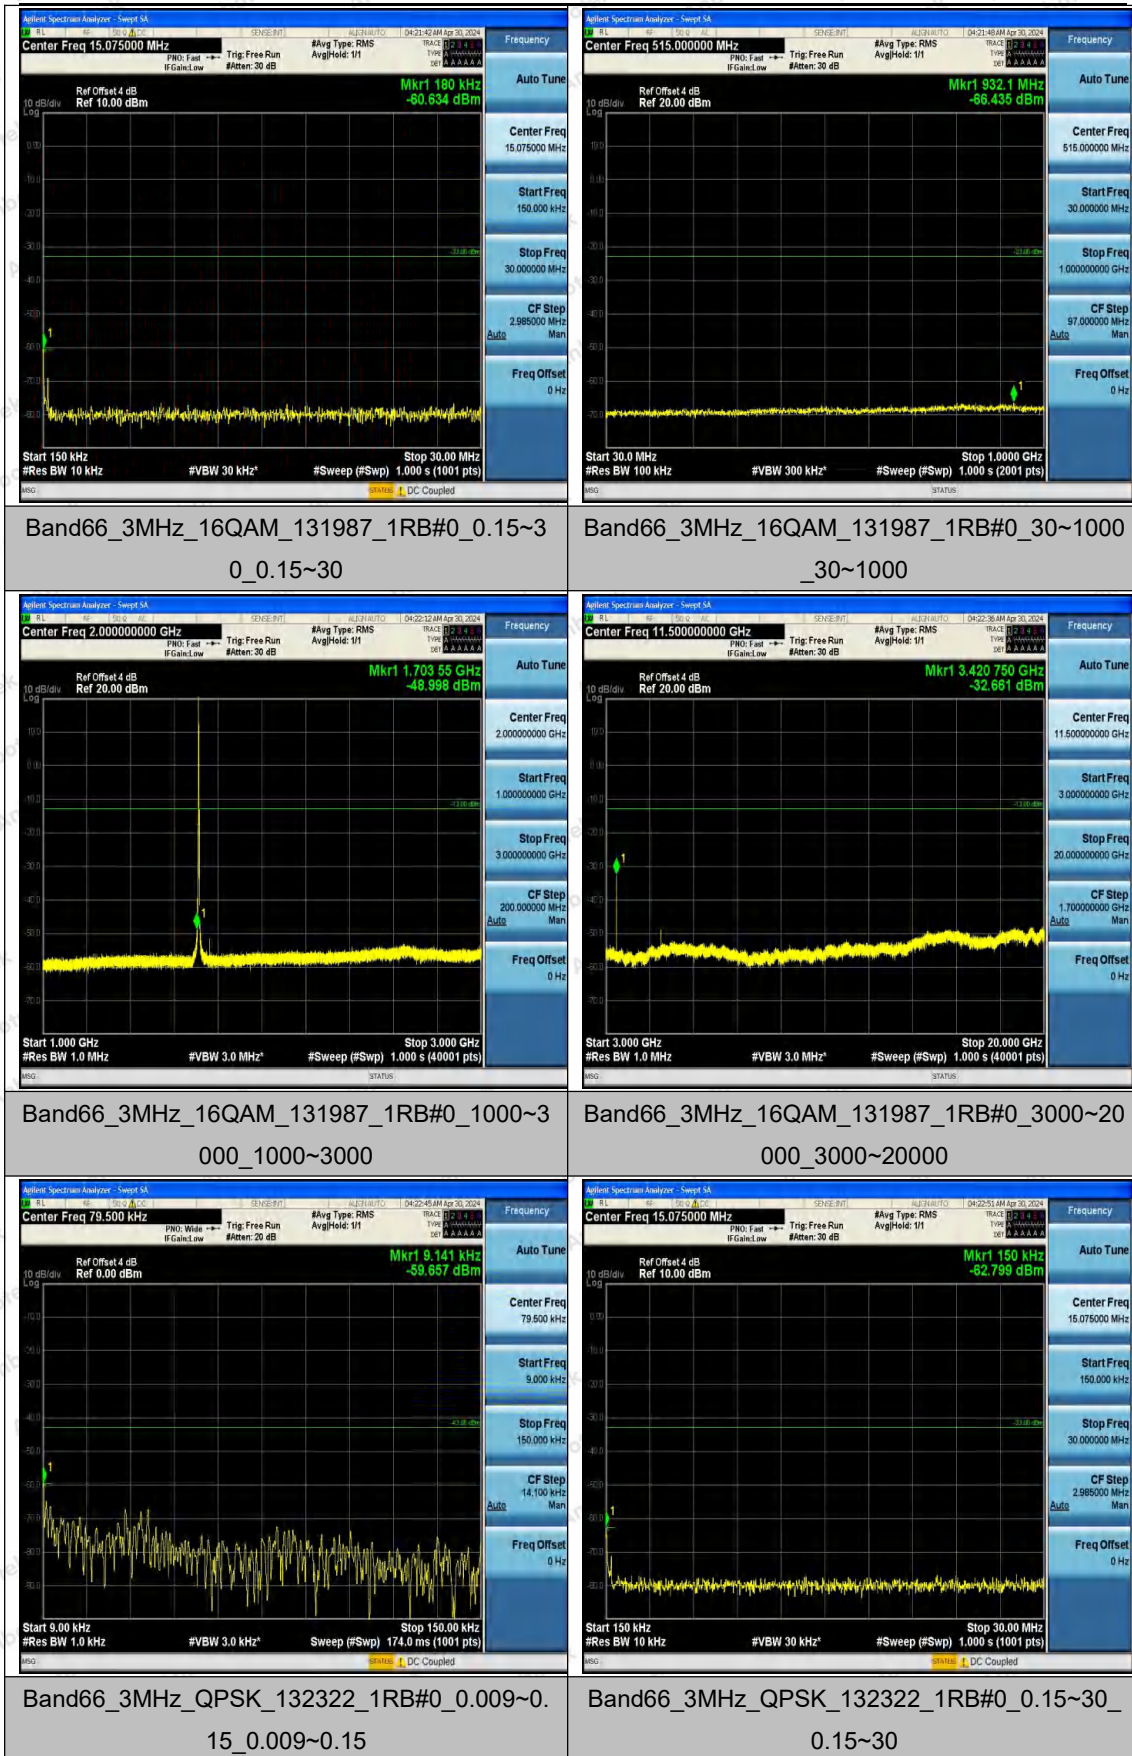


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



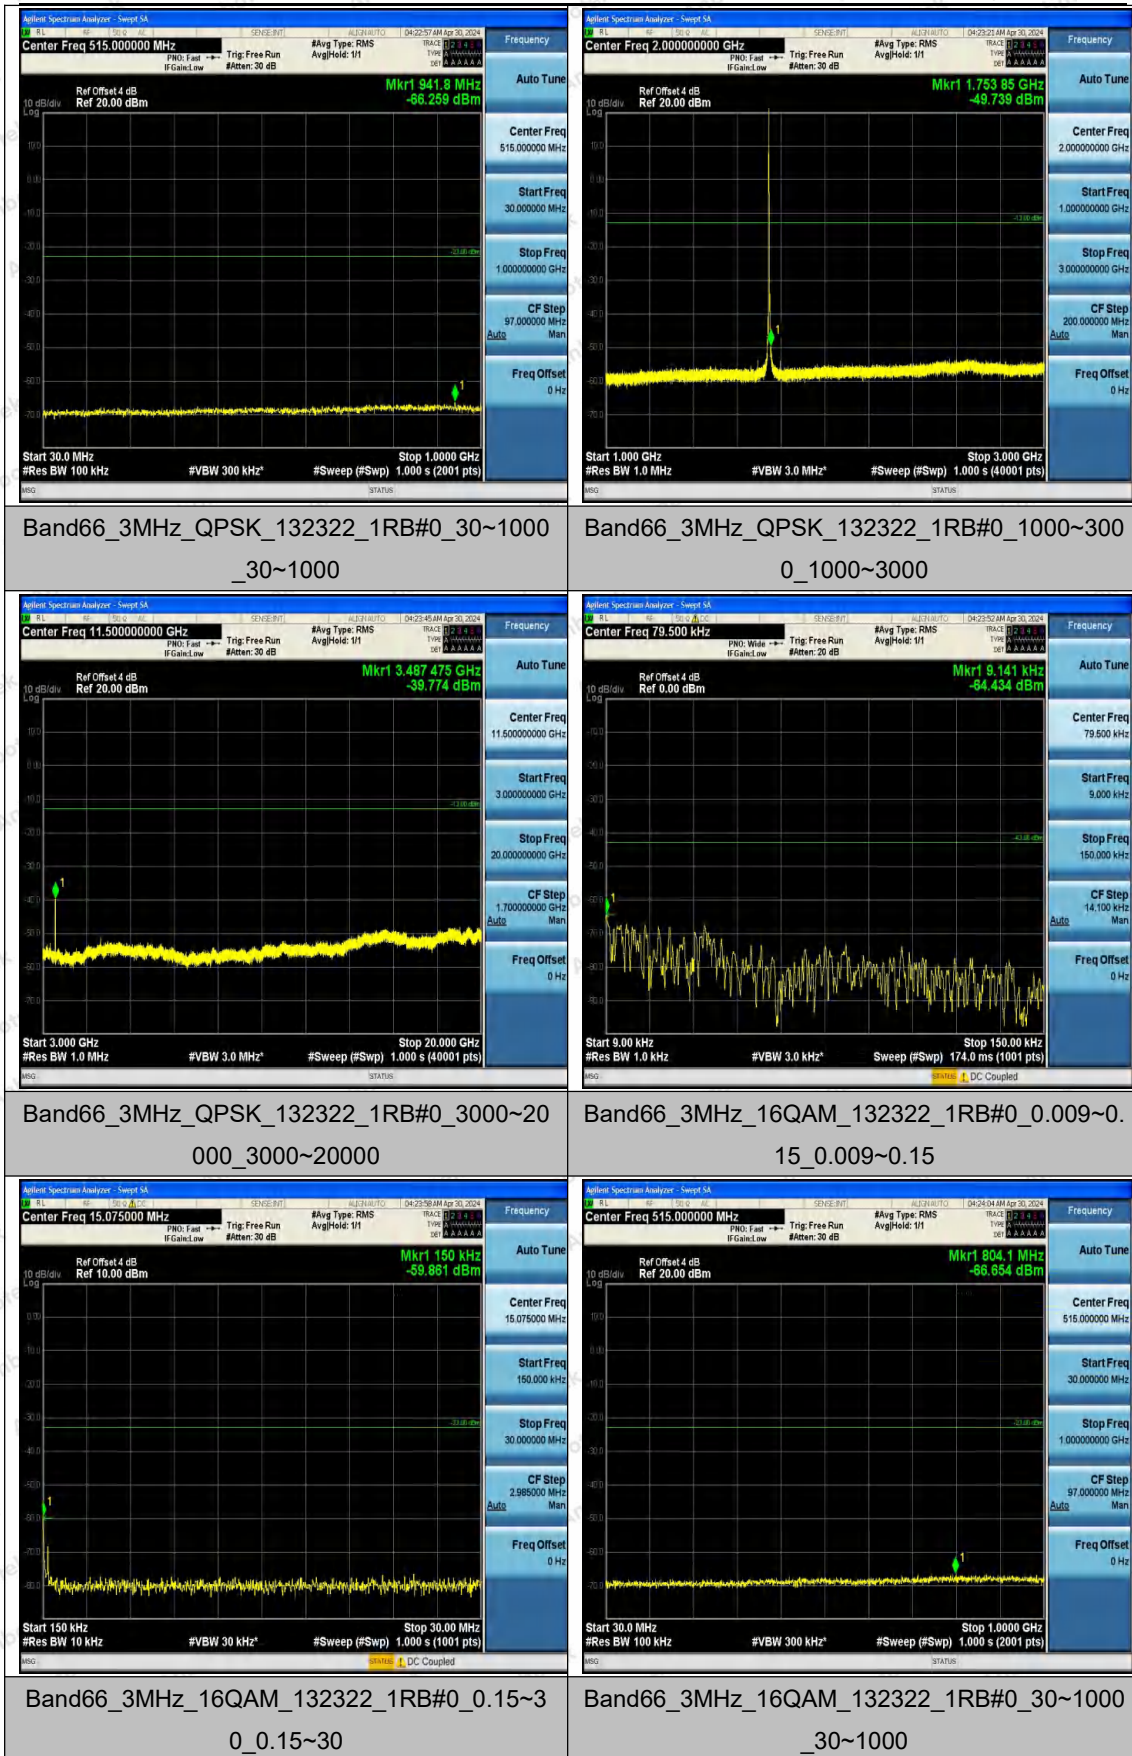


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



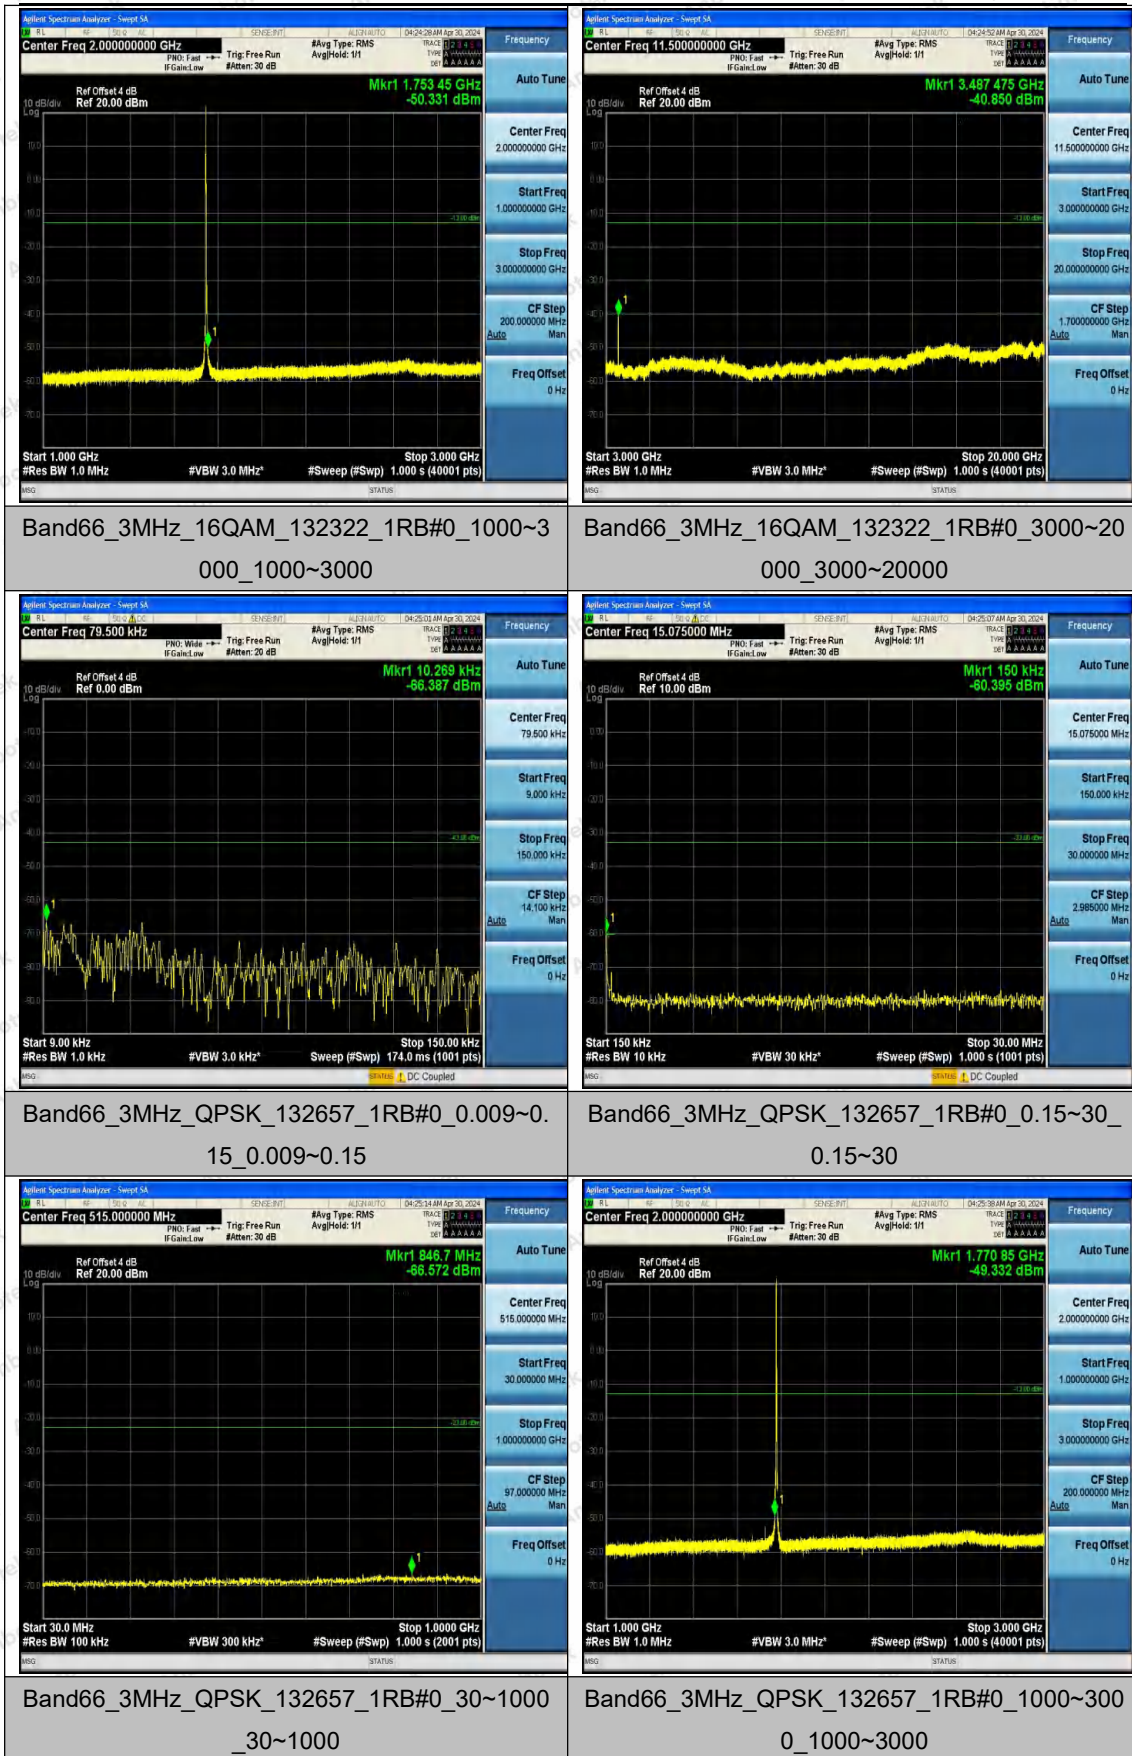


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



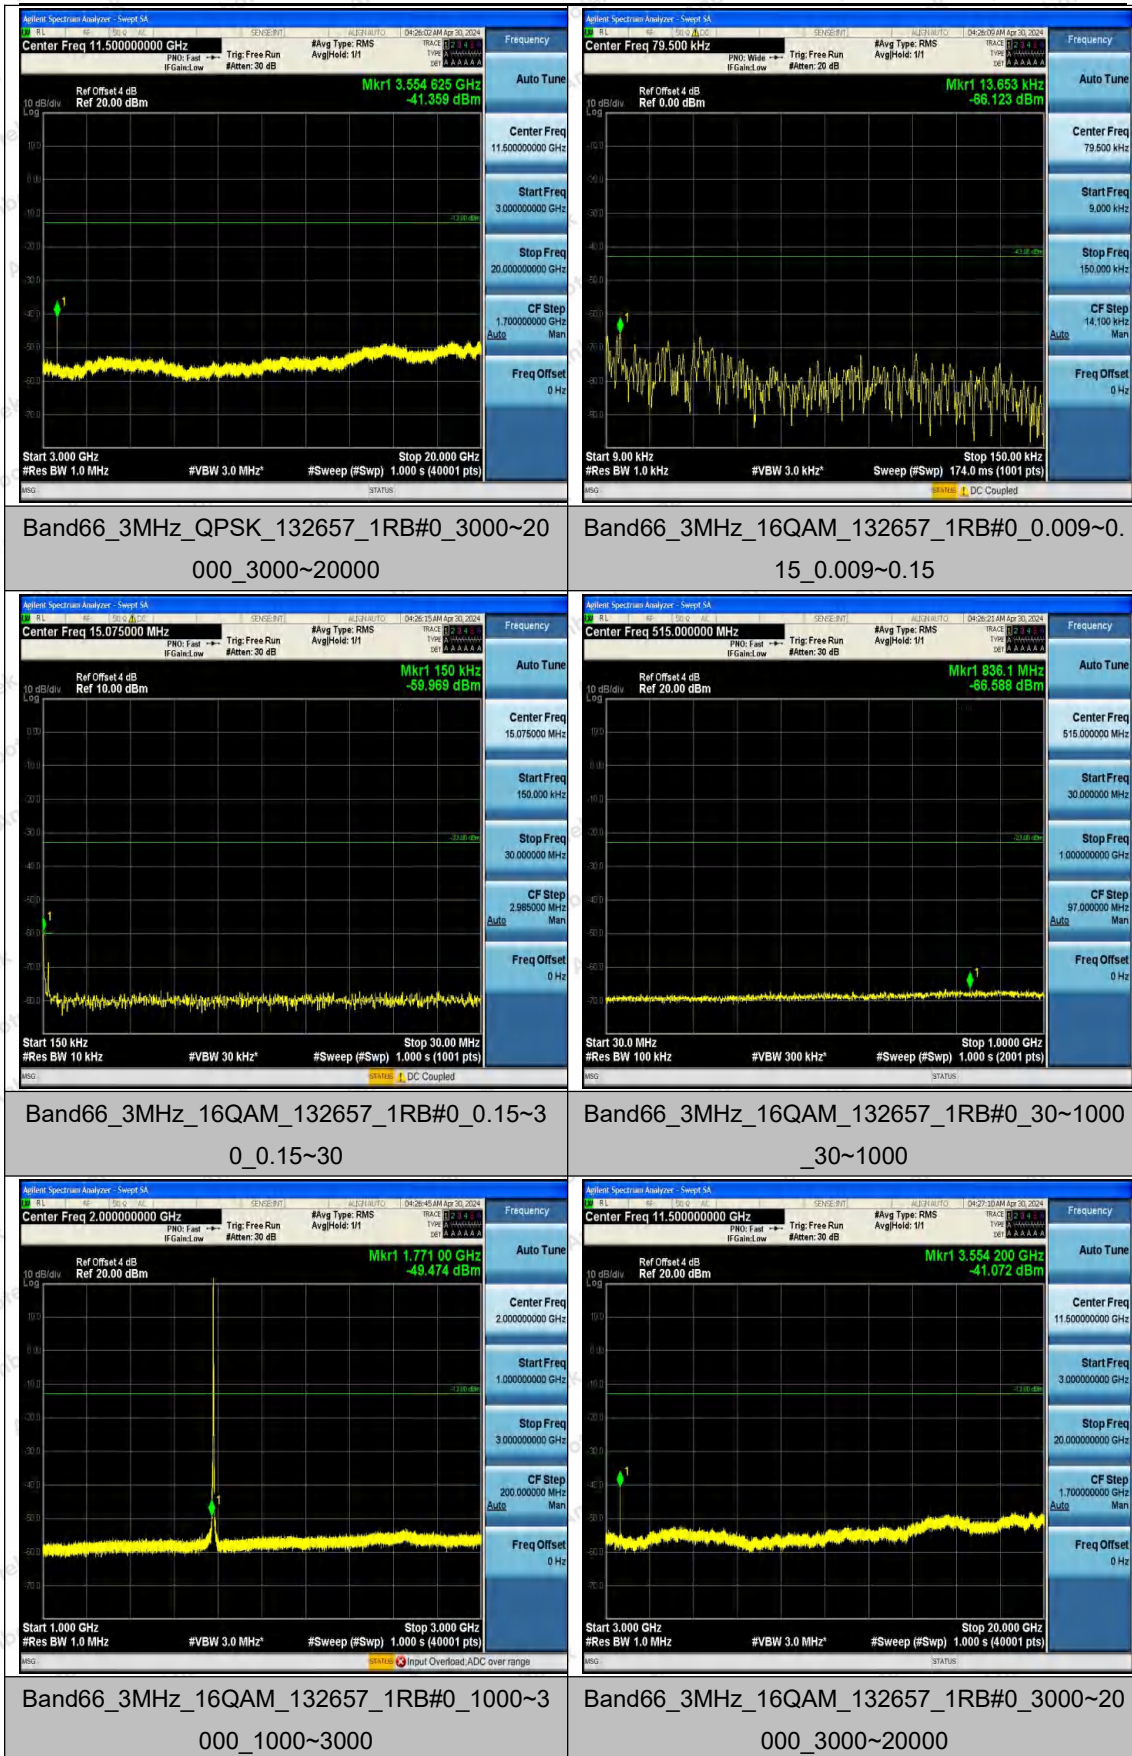


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



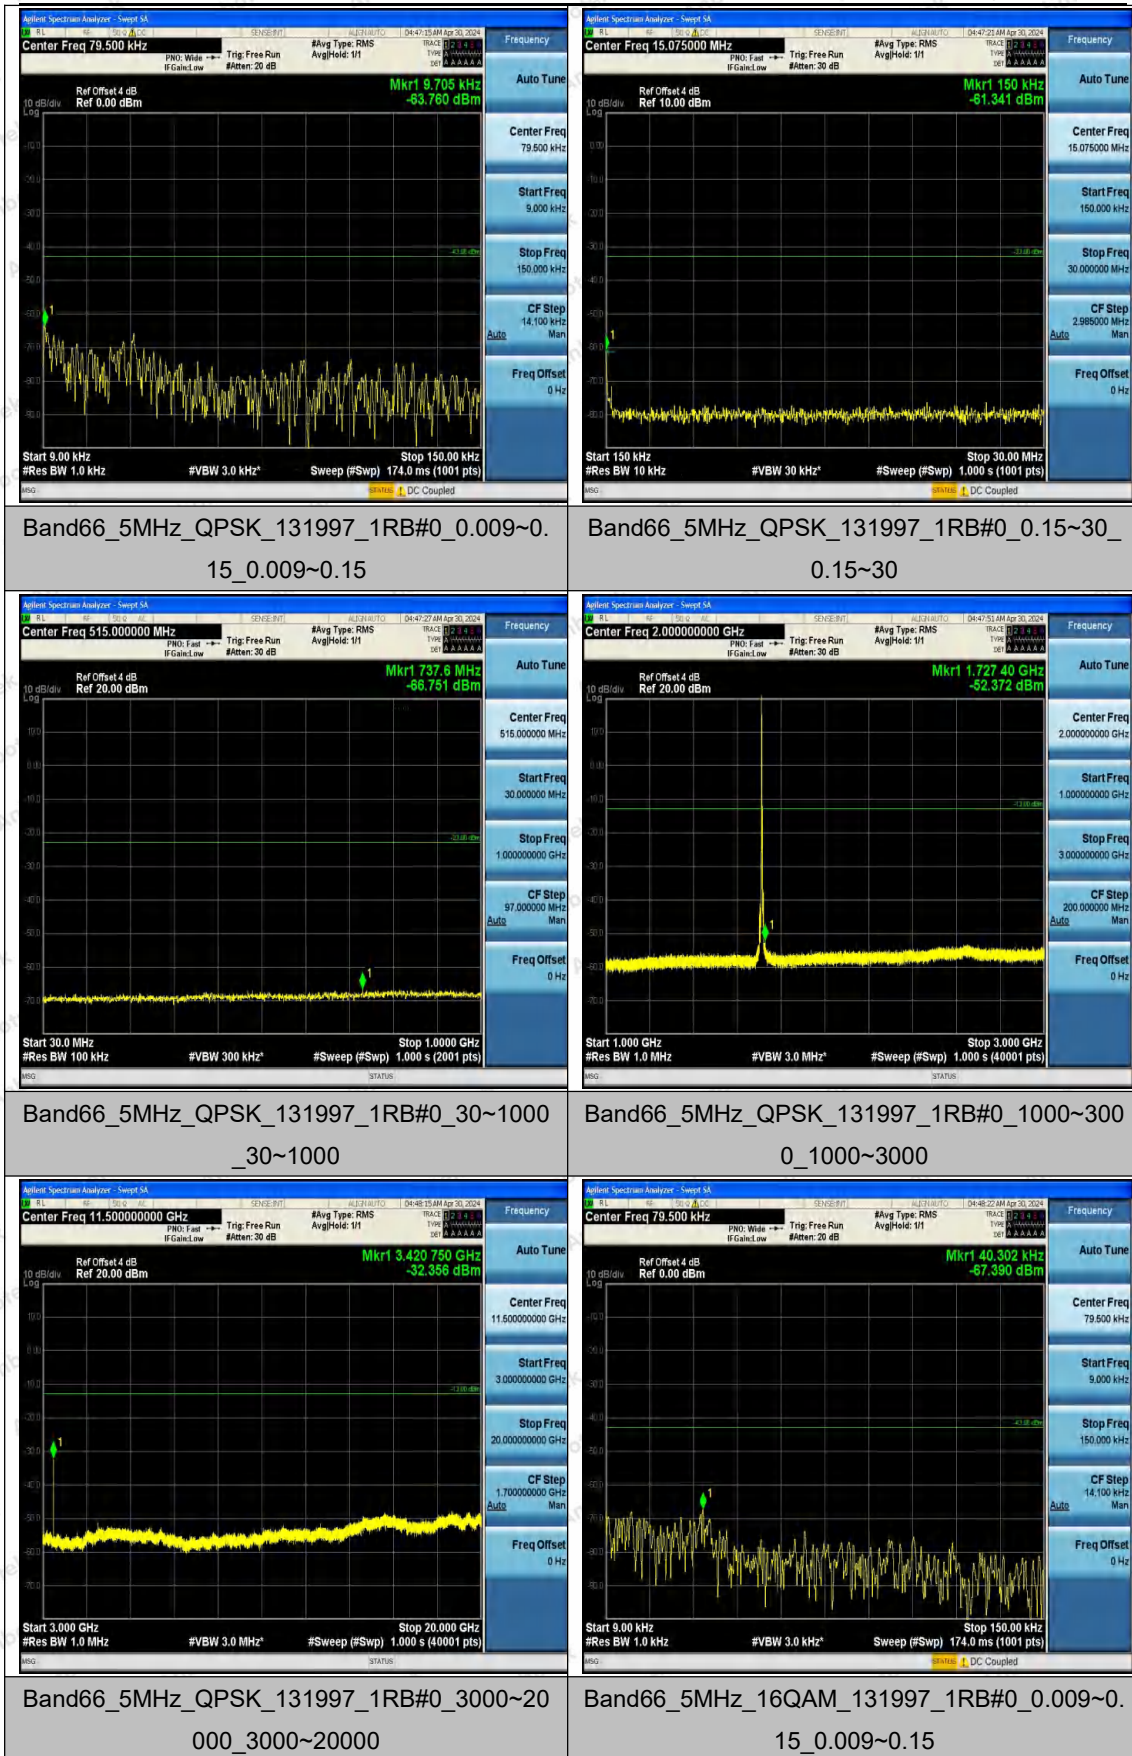


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



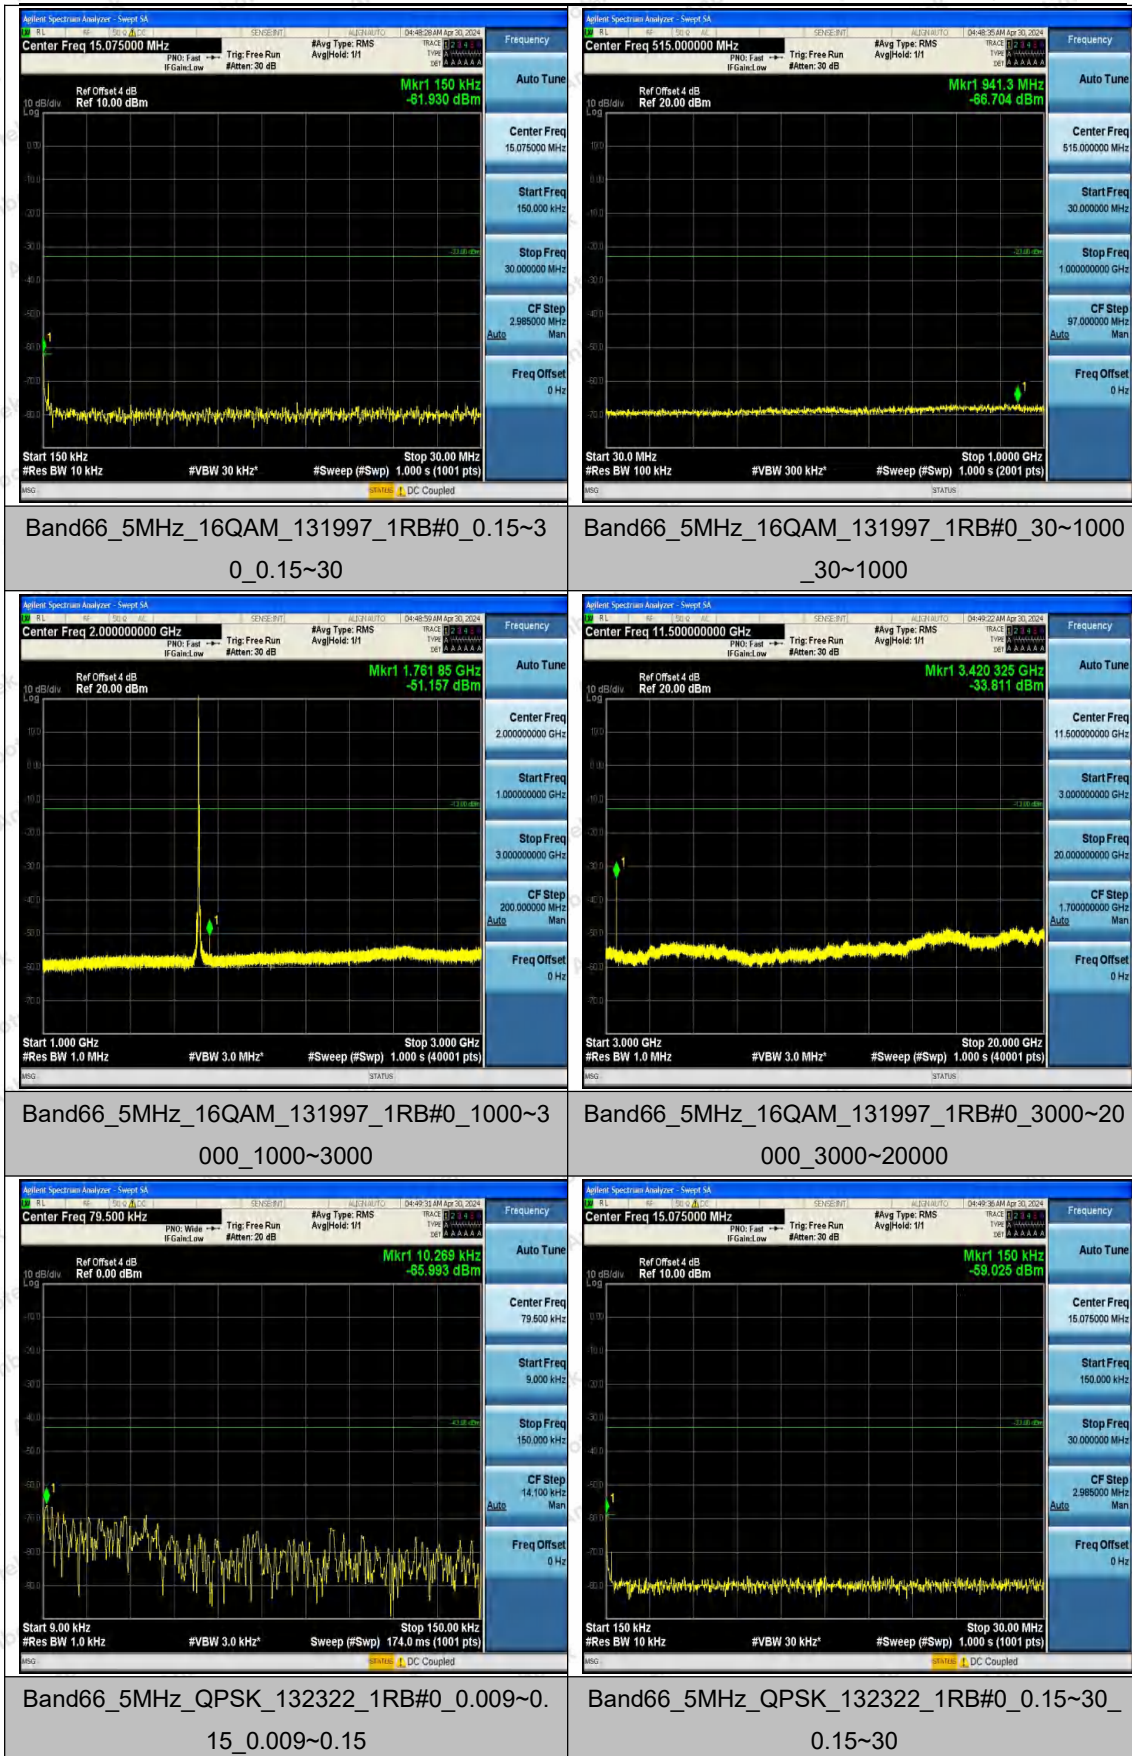


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



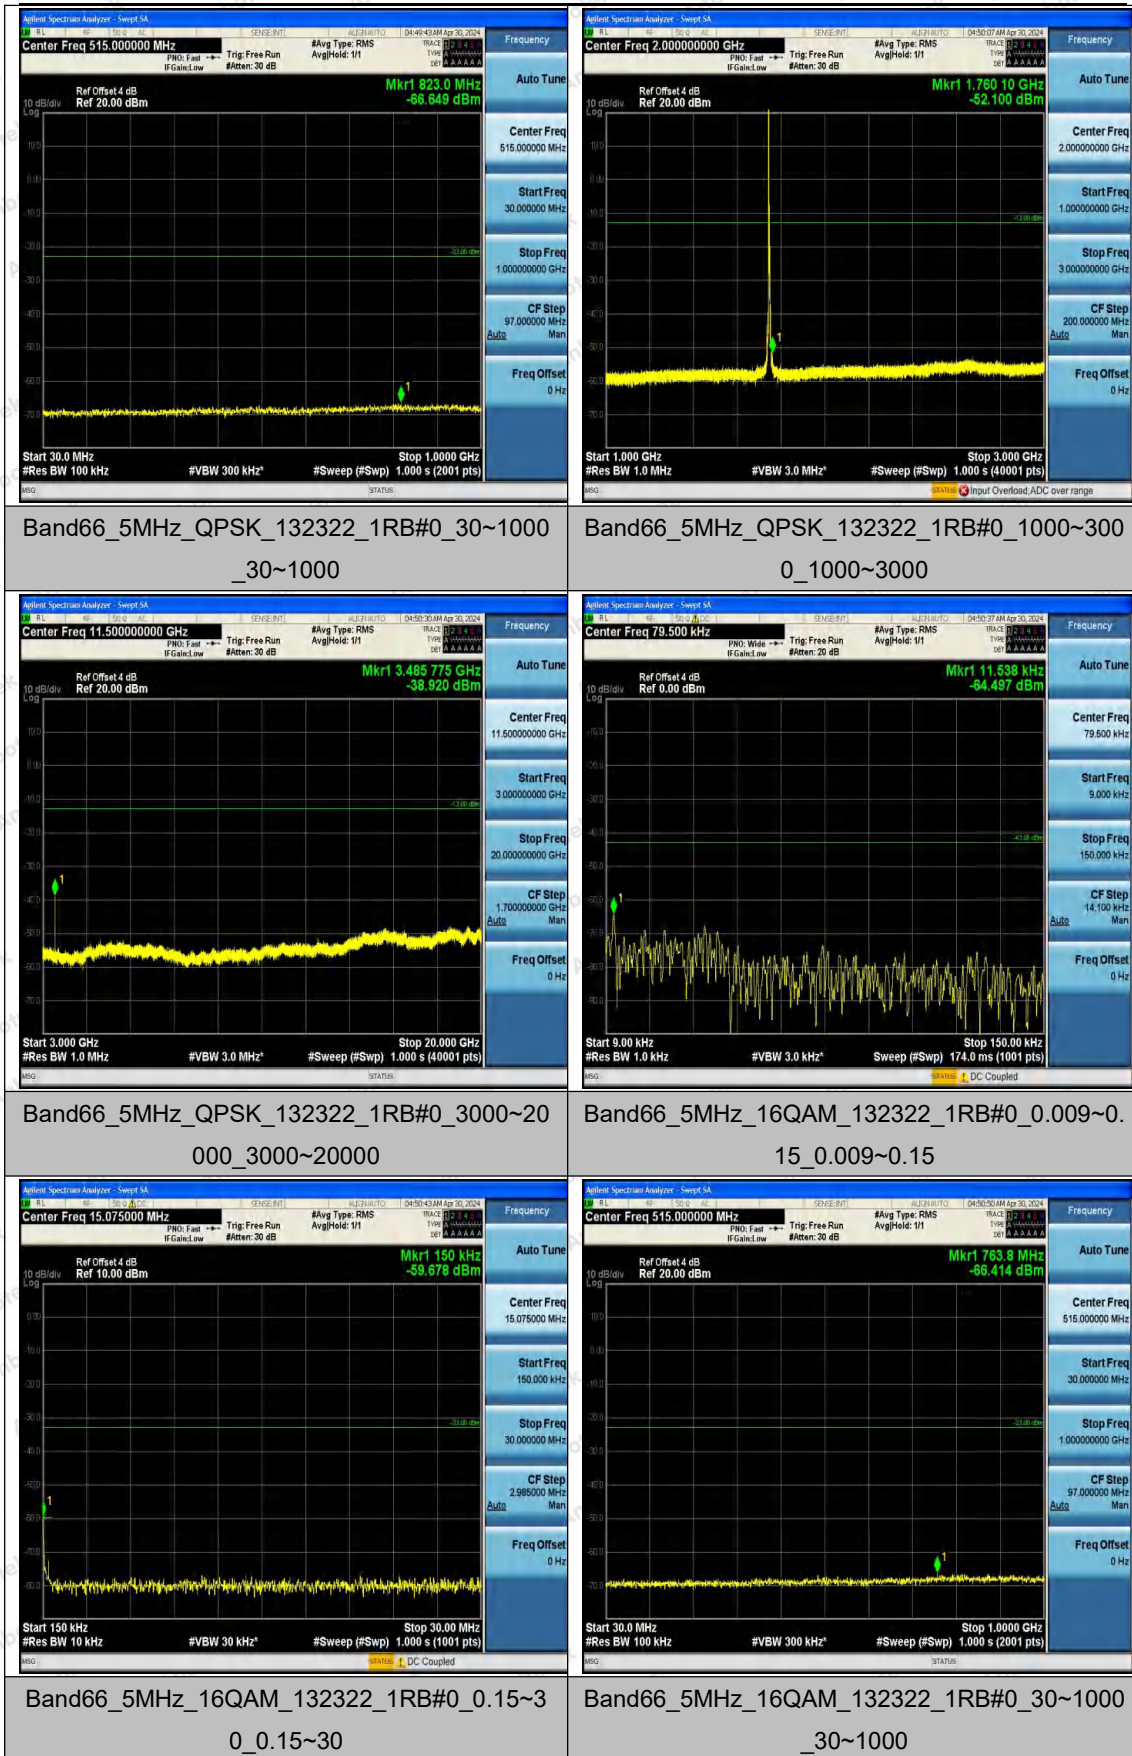


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



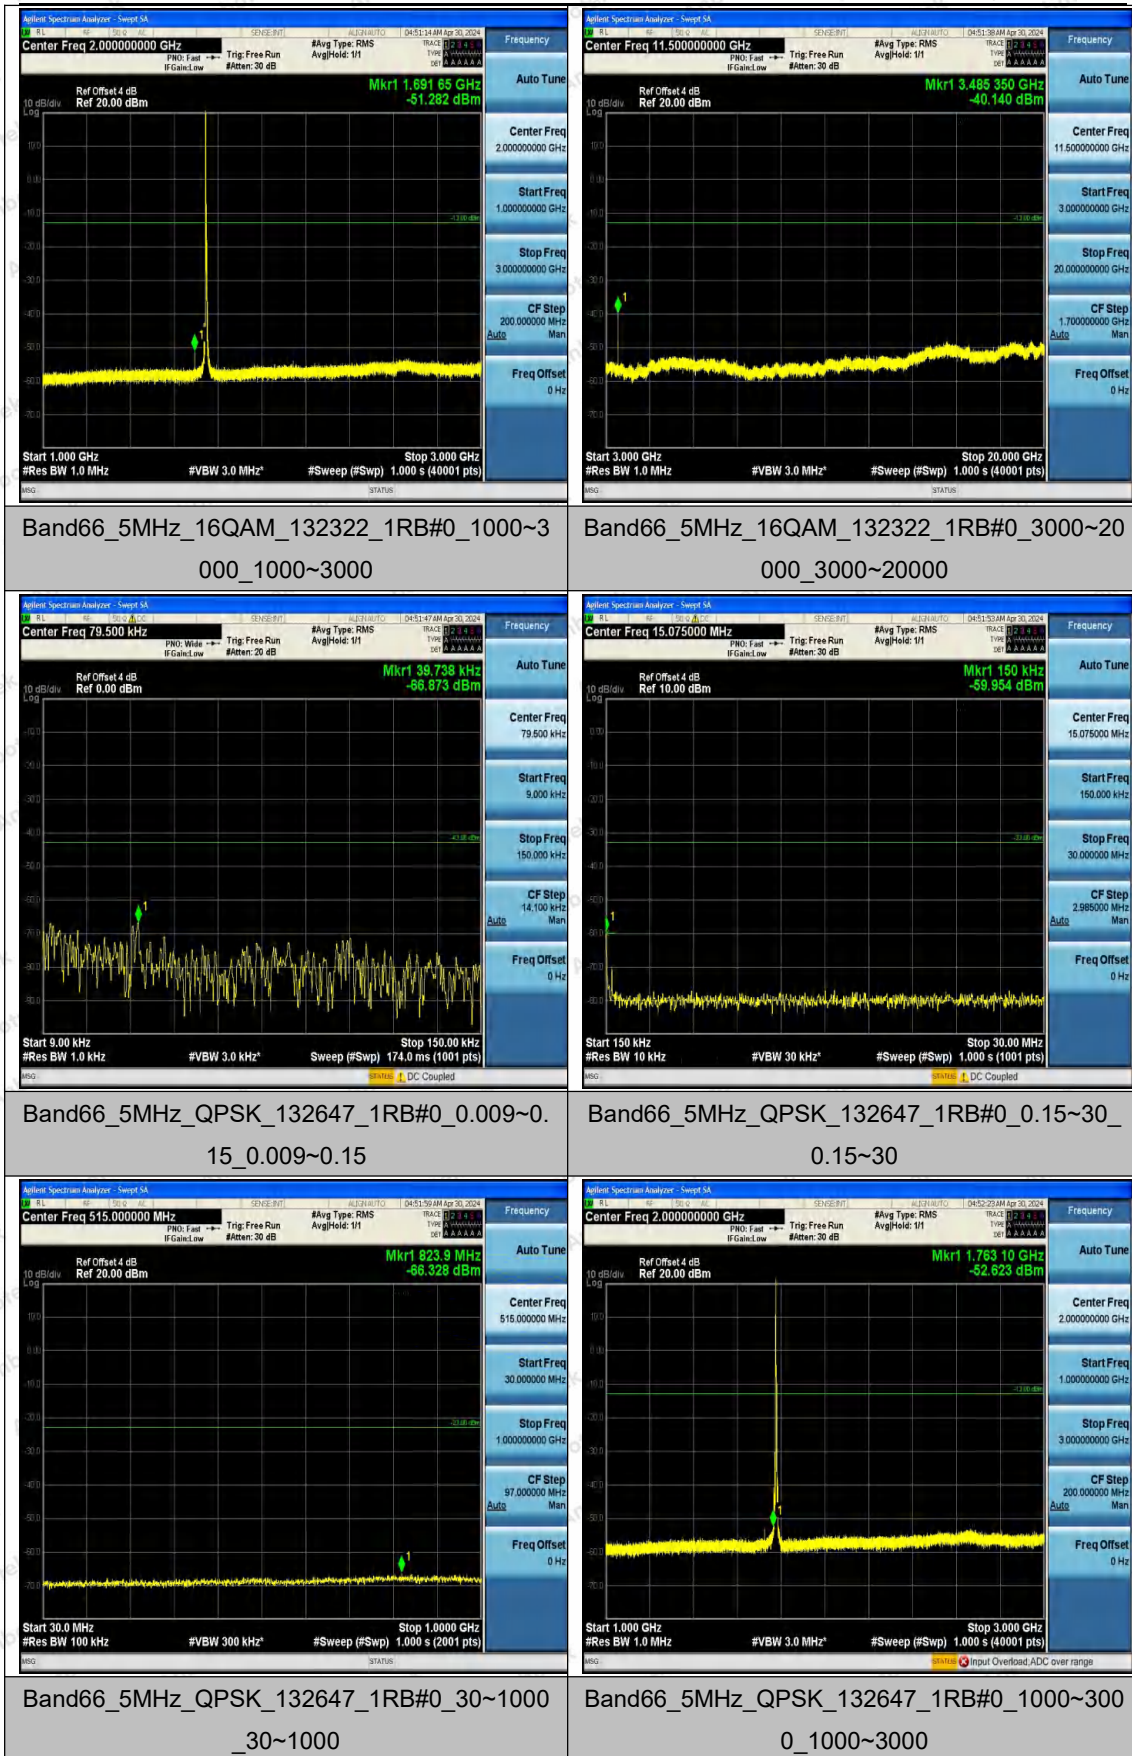


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



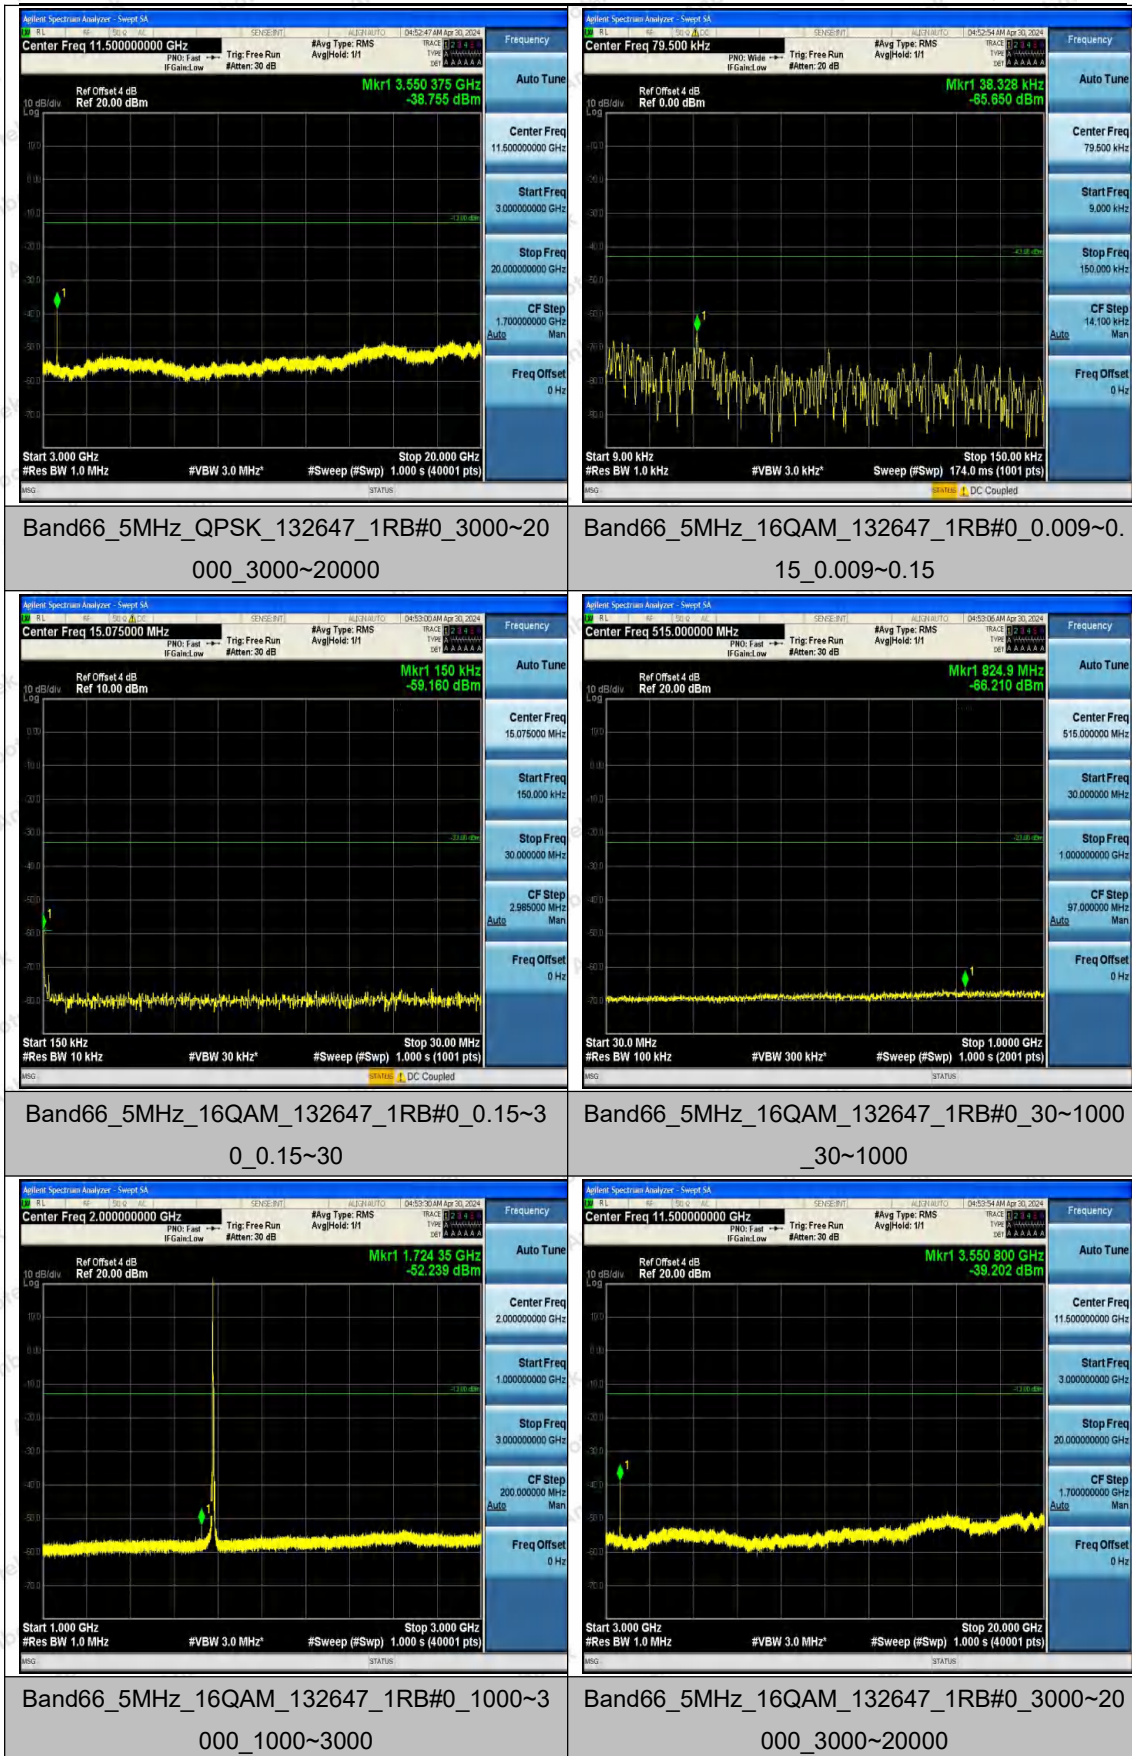


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



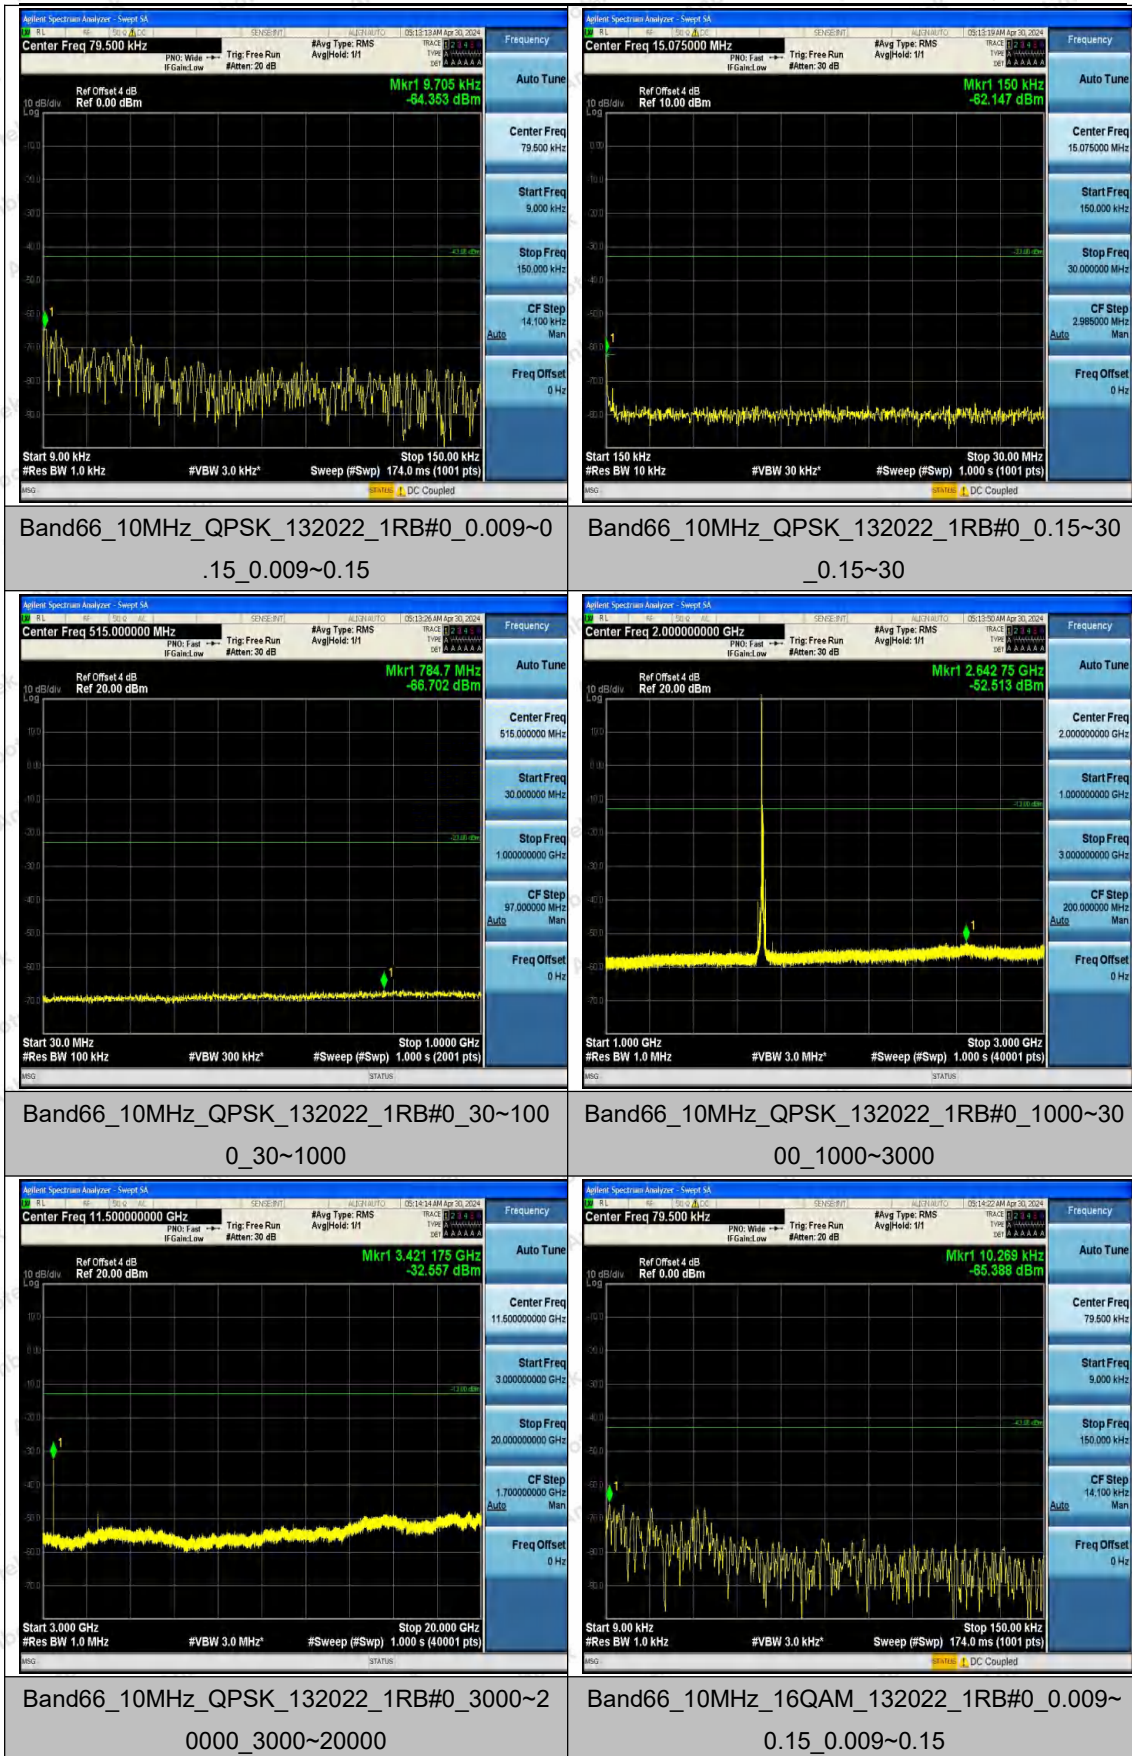


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



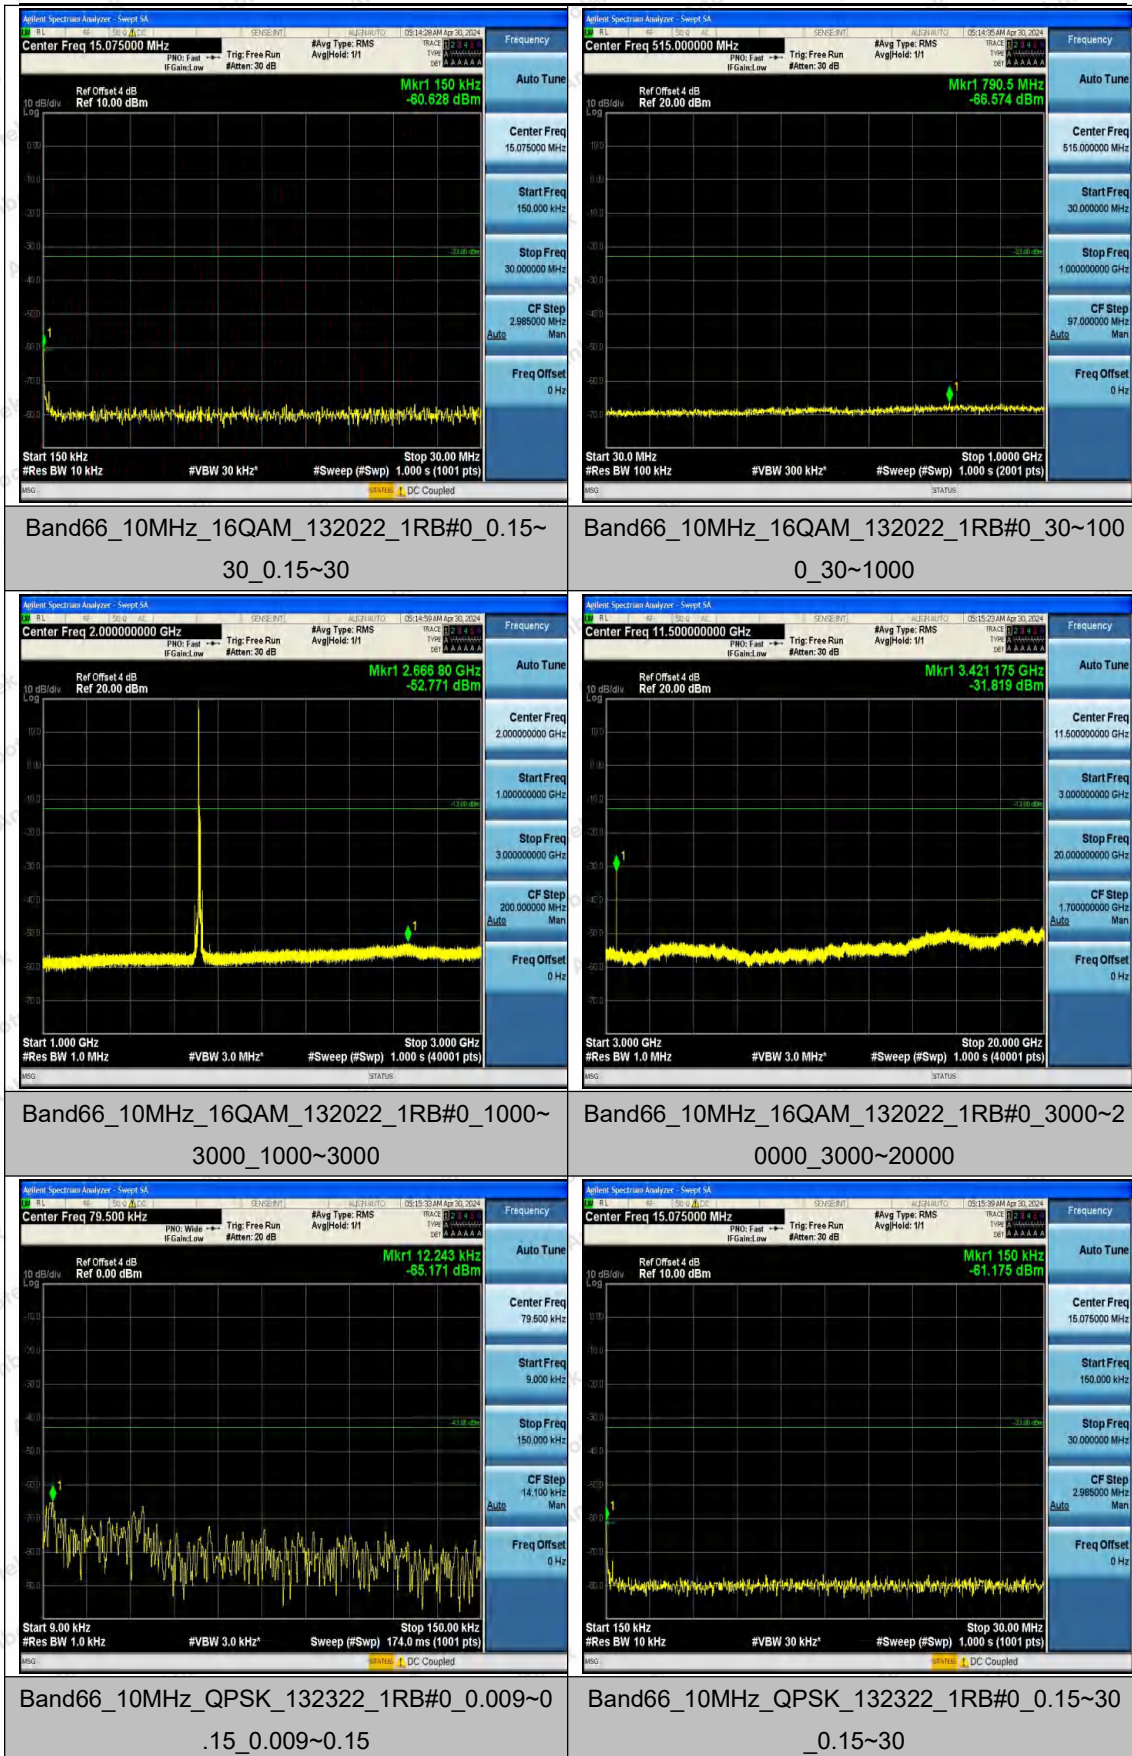


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



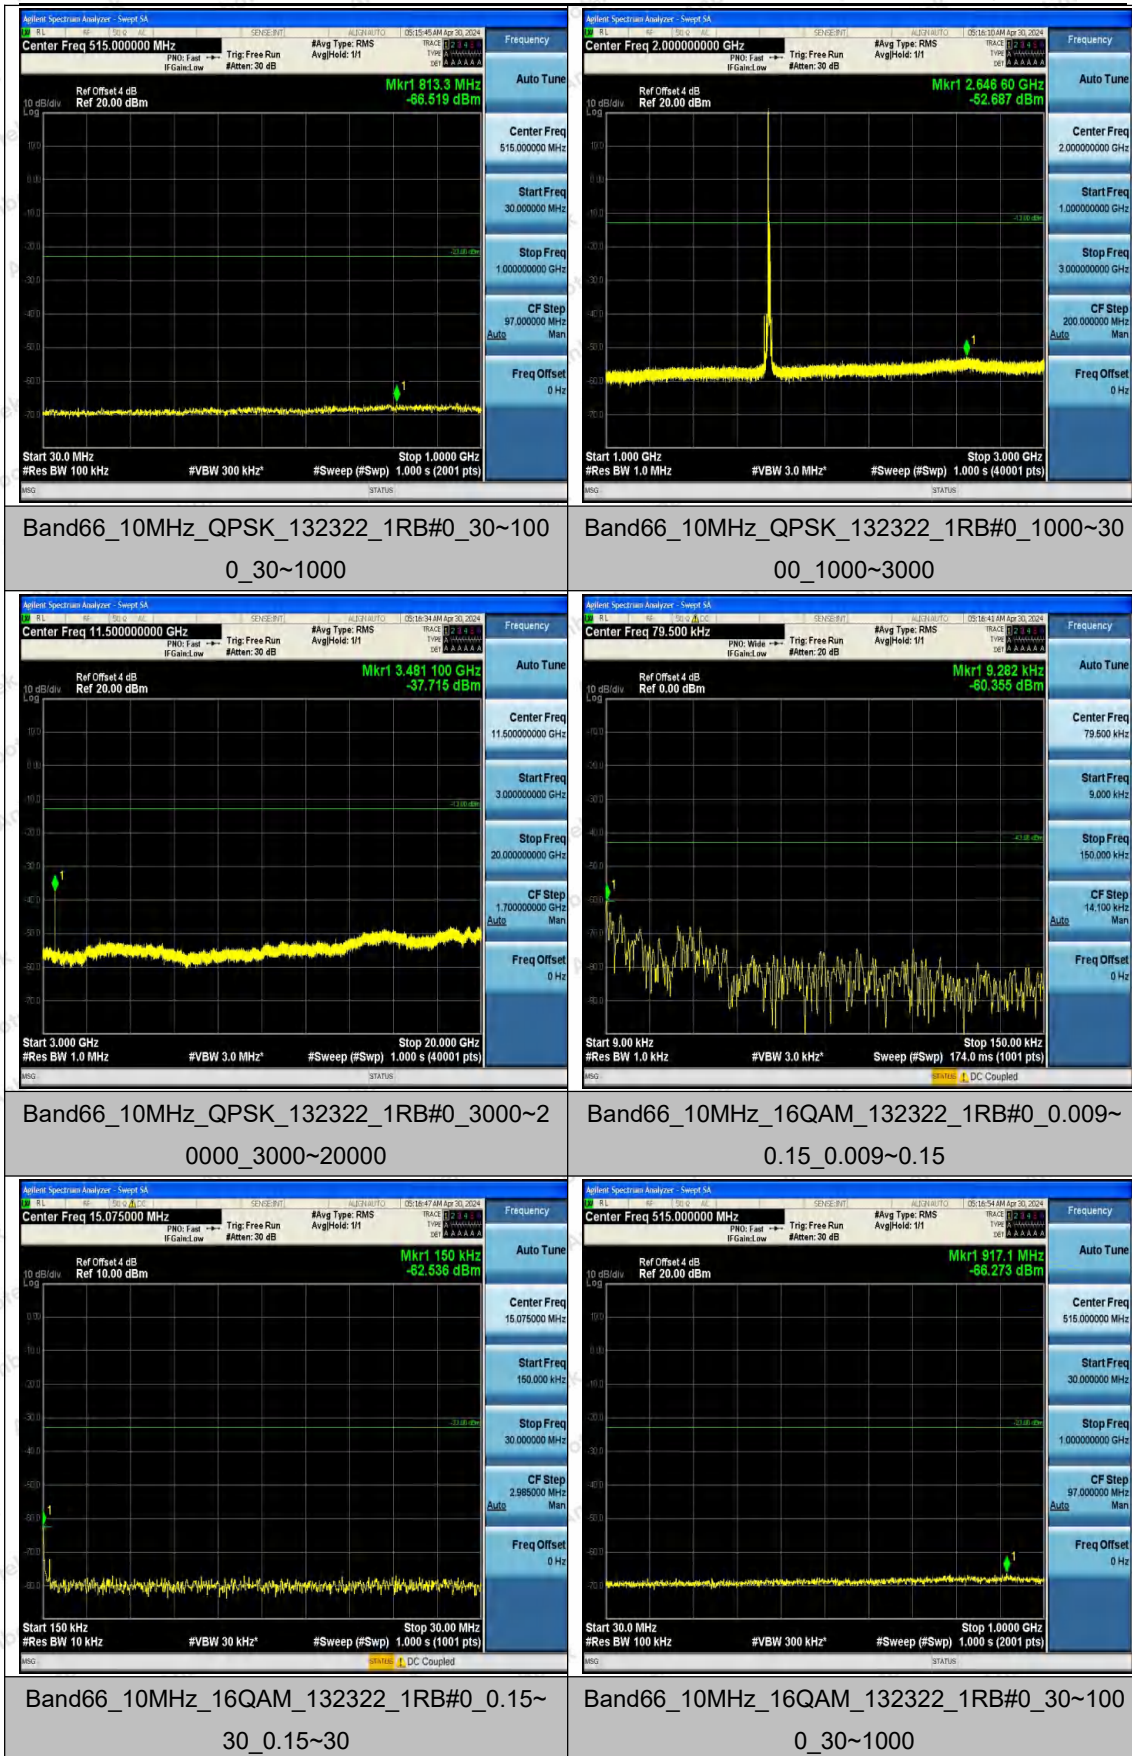


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



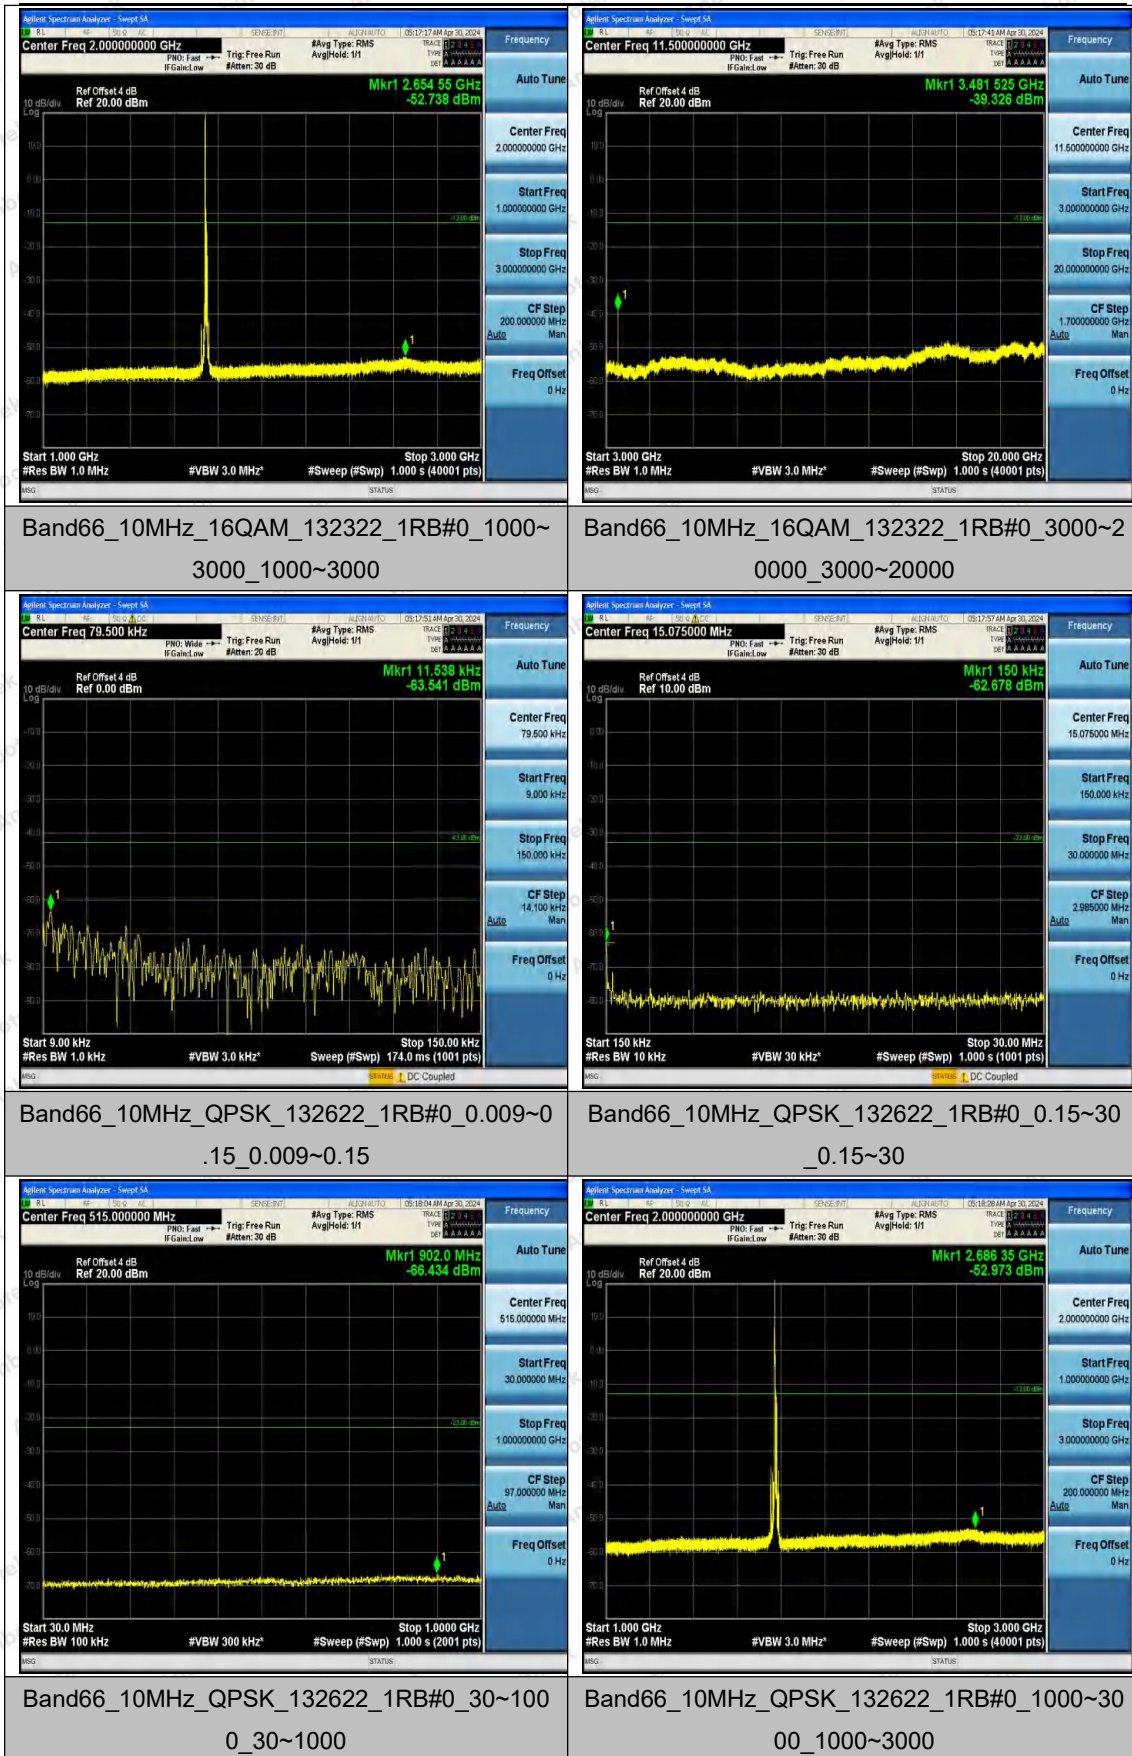


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



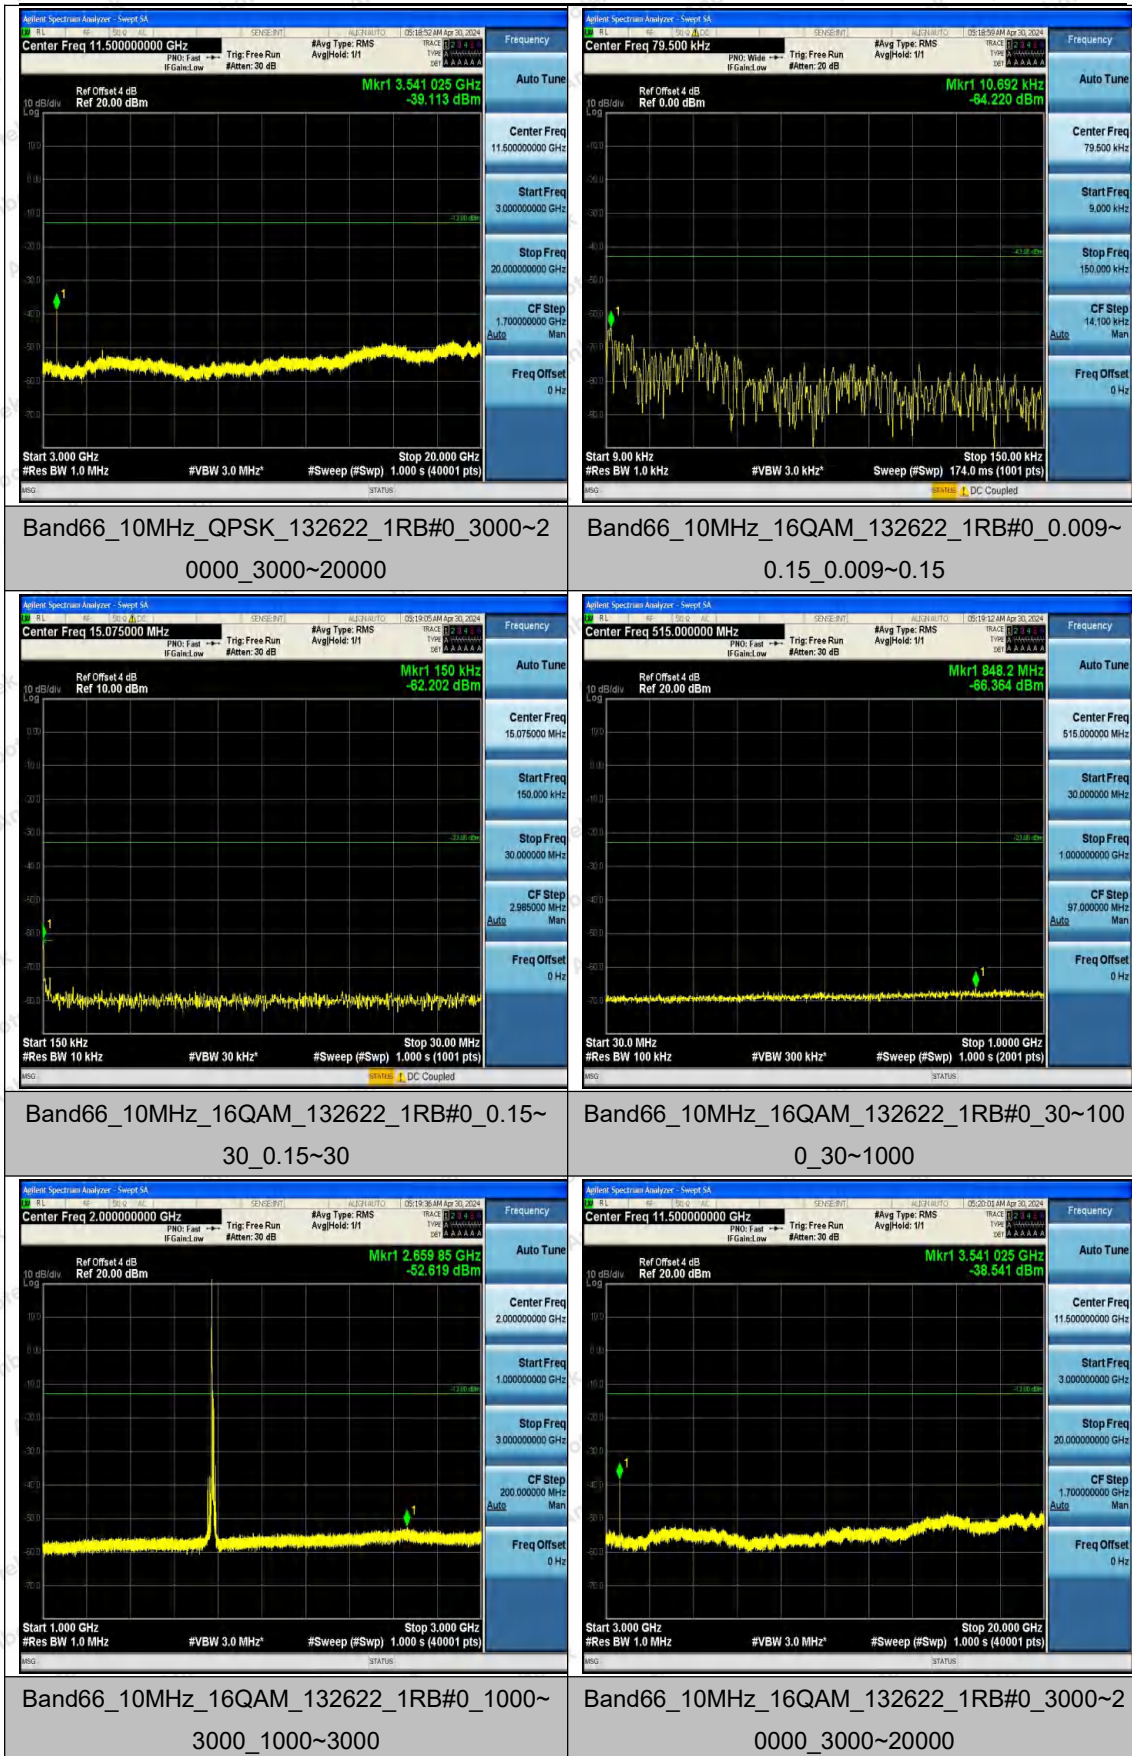


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



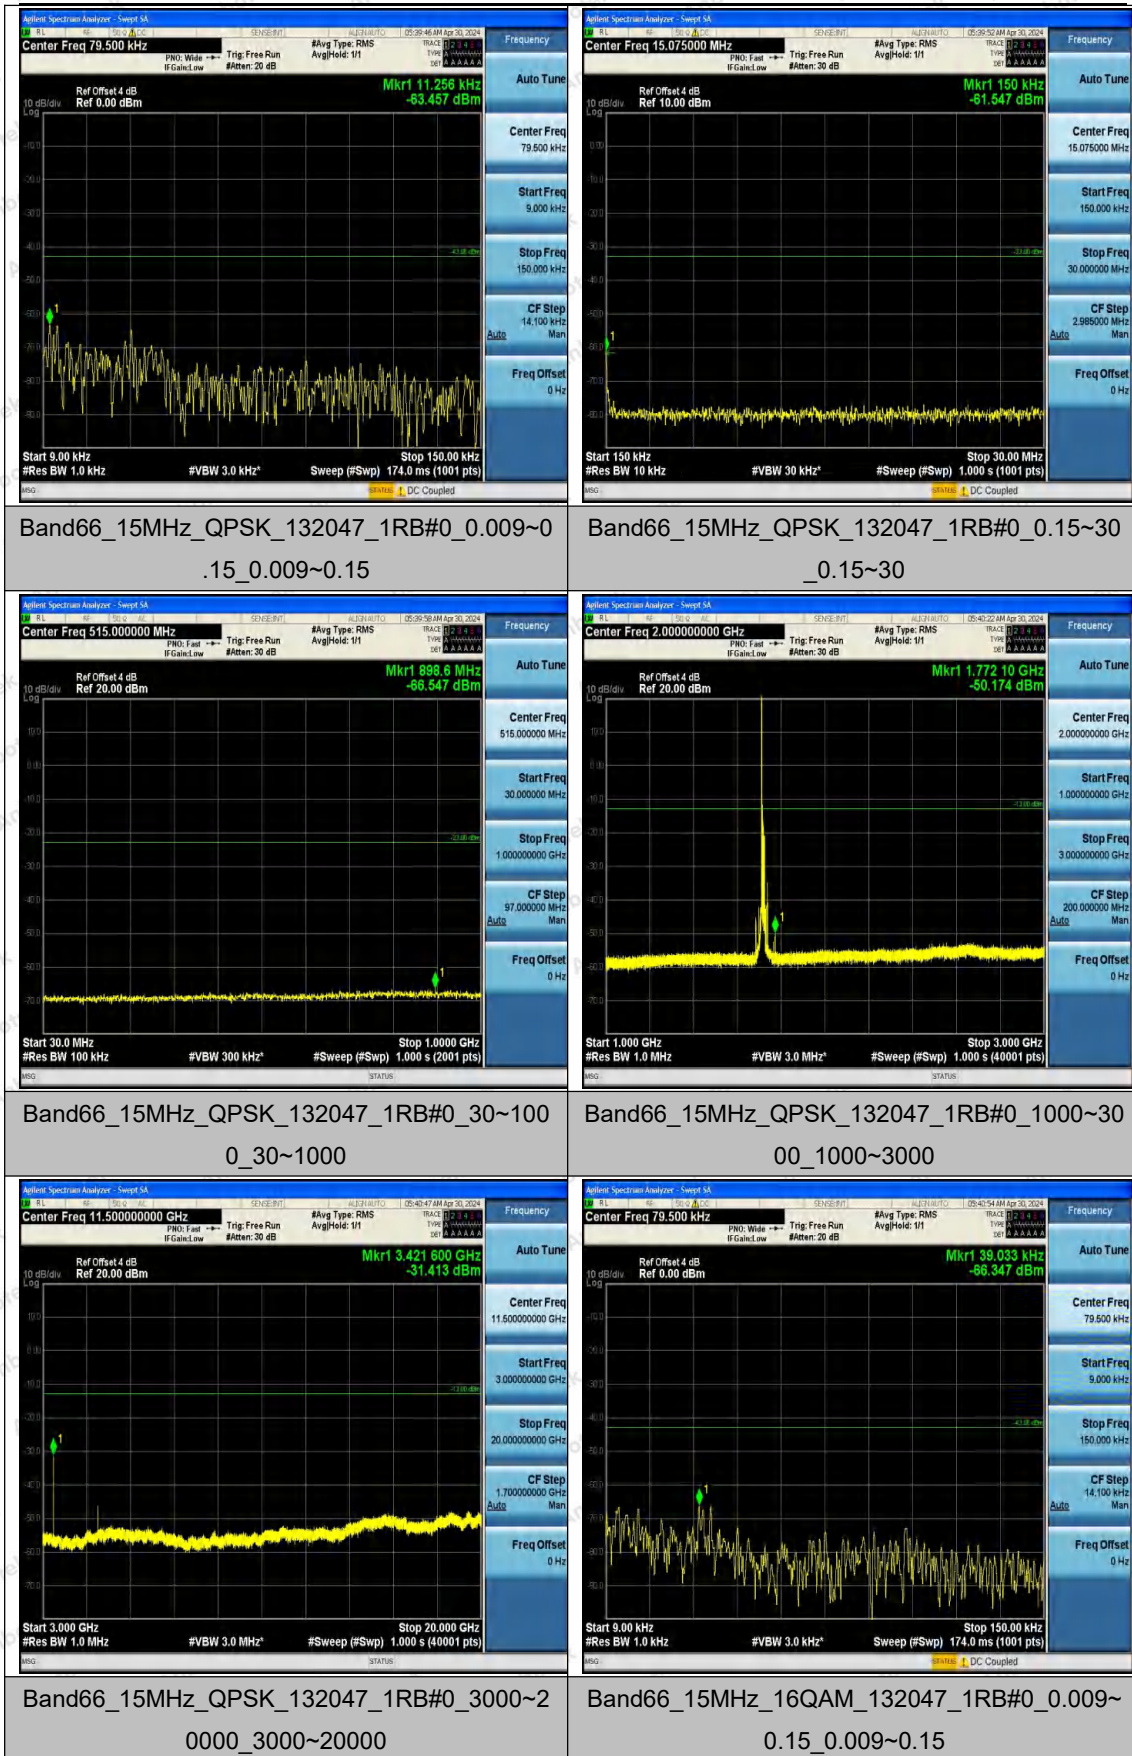


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



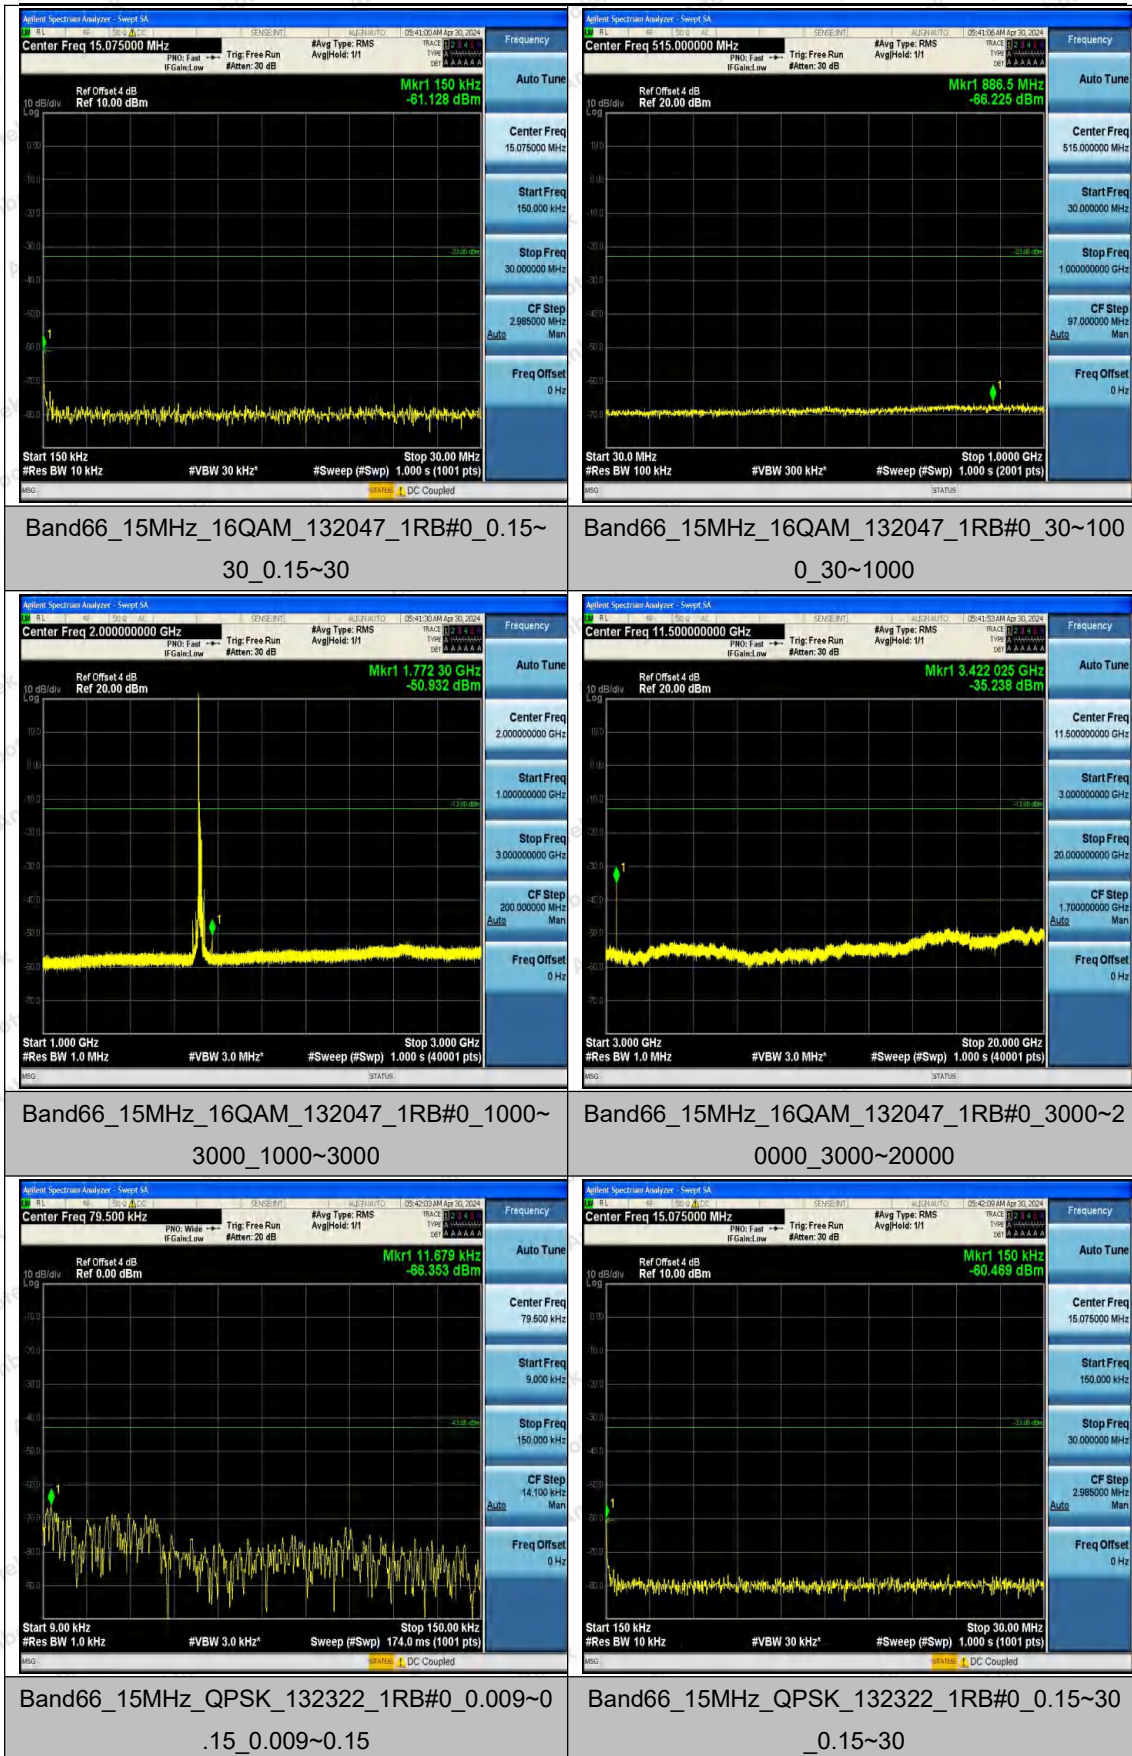


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
[www.anbotek.com.cn](http://www.anbotek.com.cn)



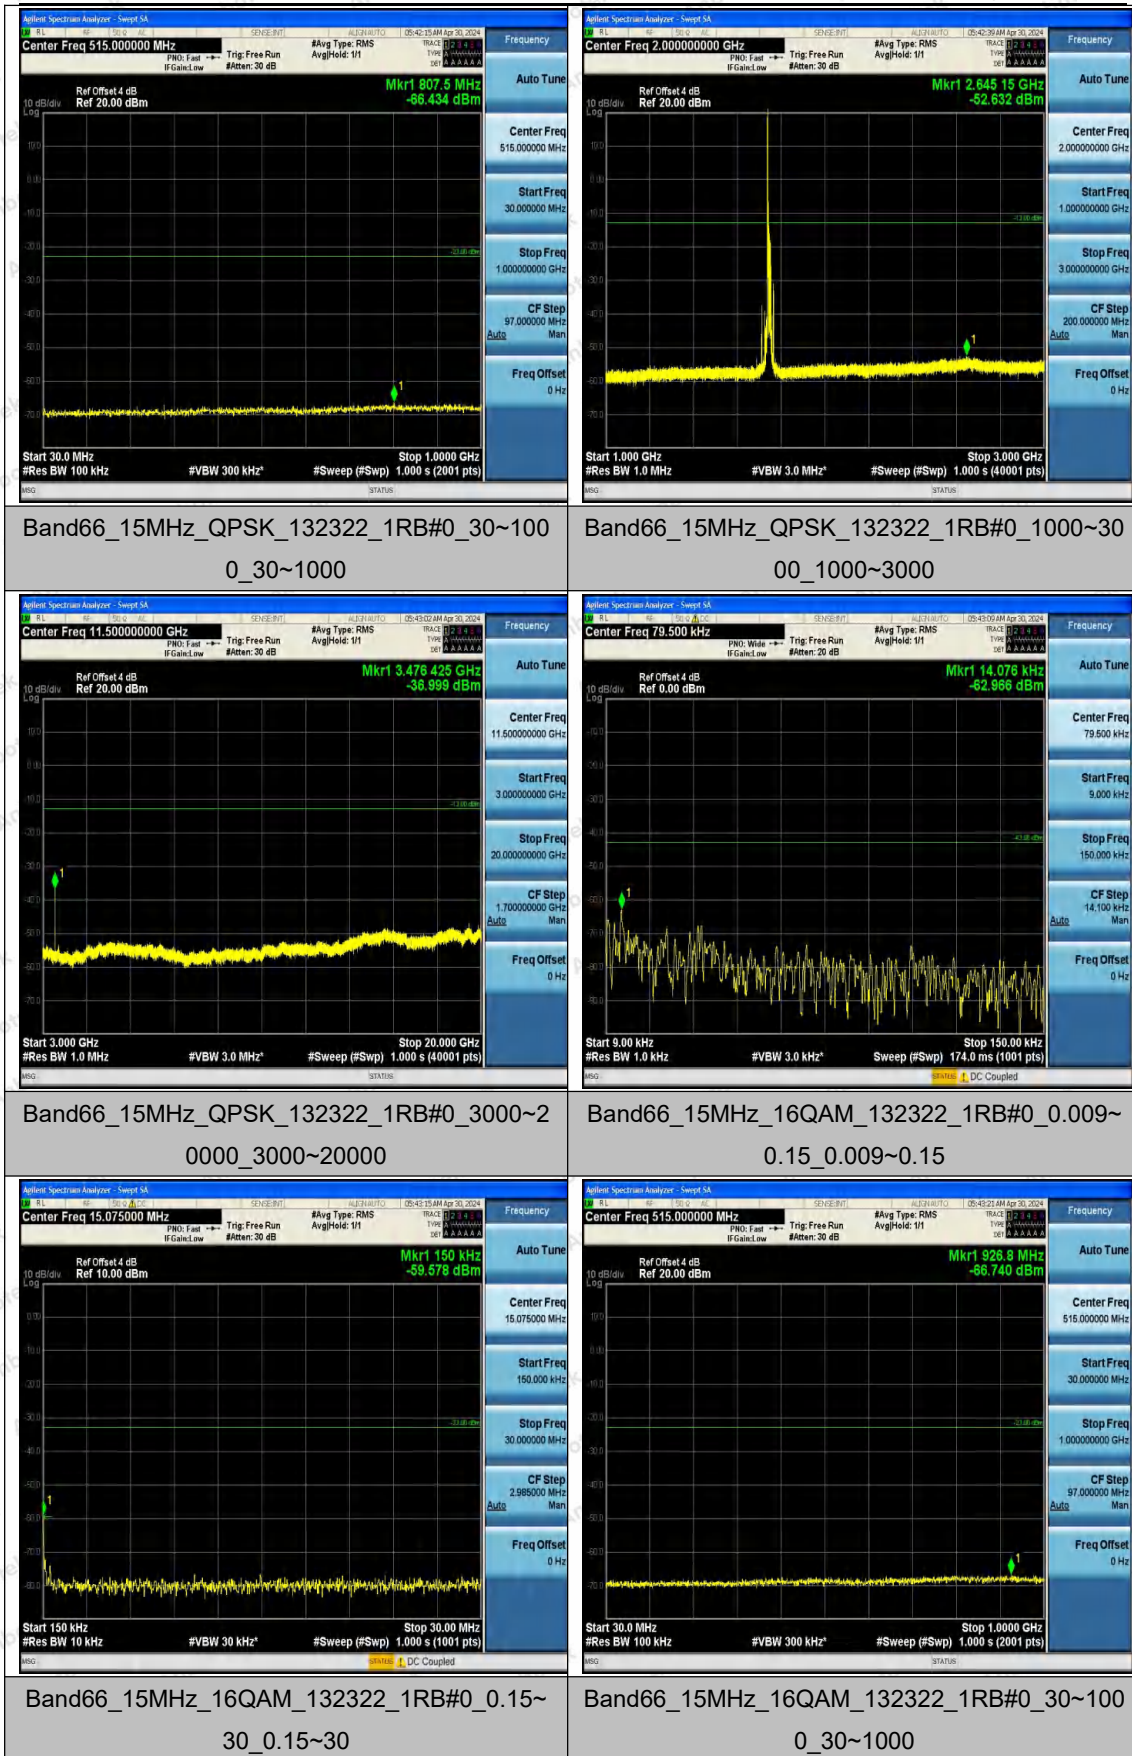


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



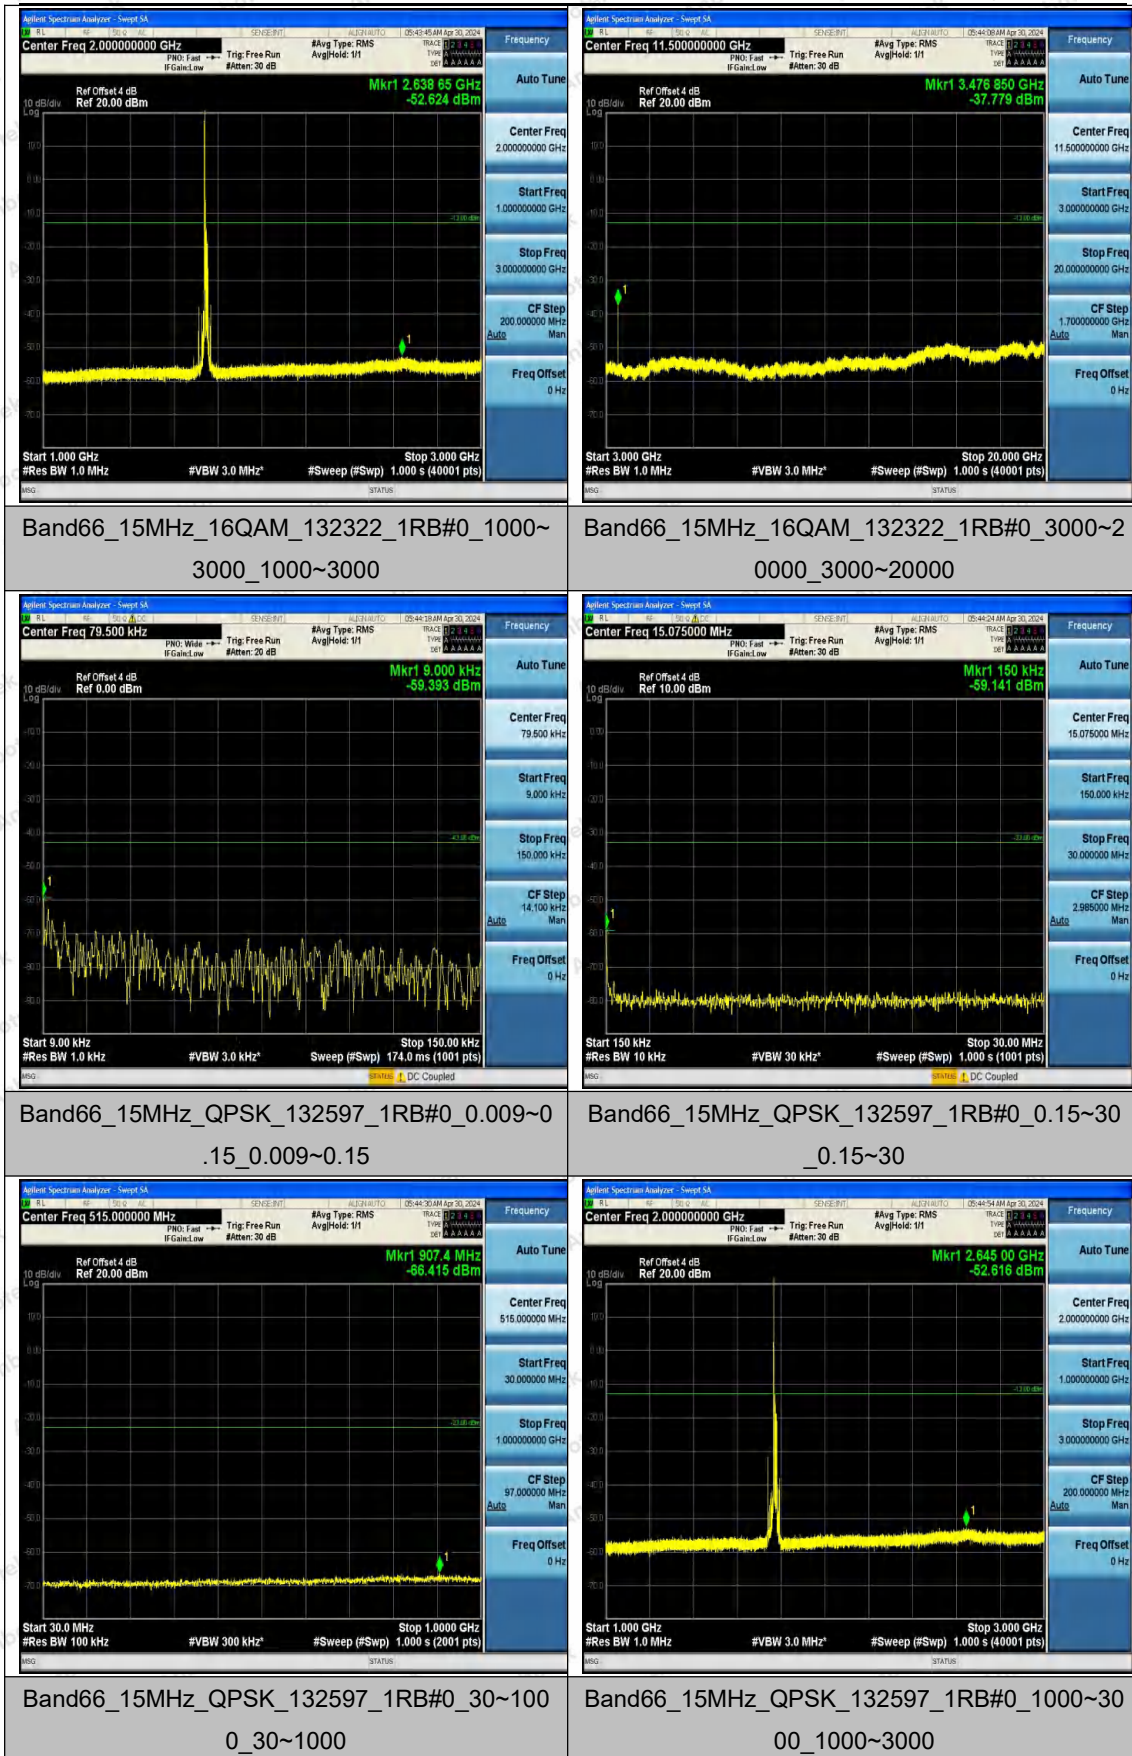


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



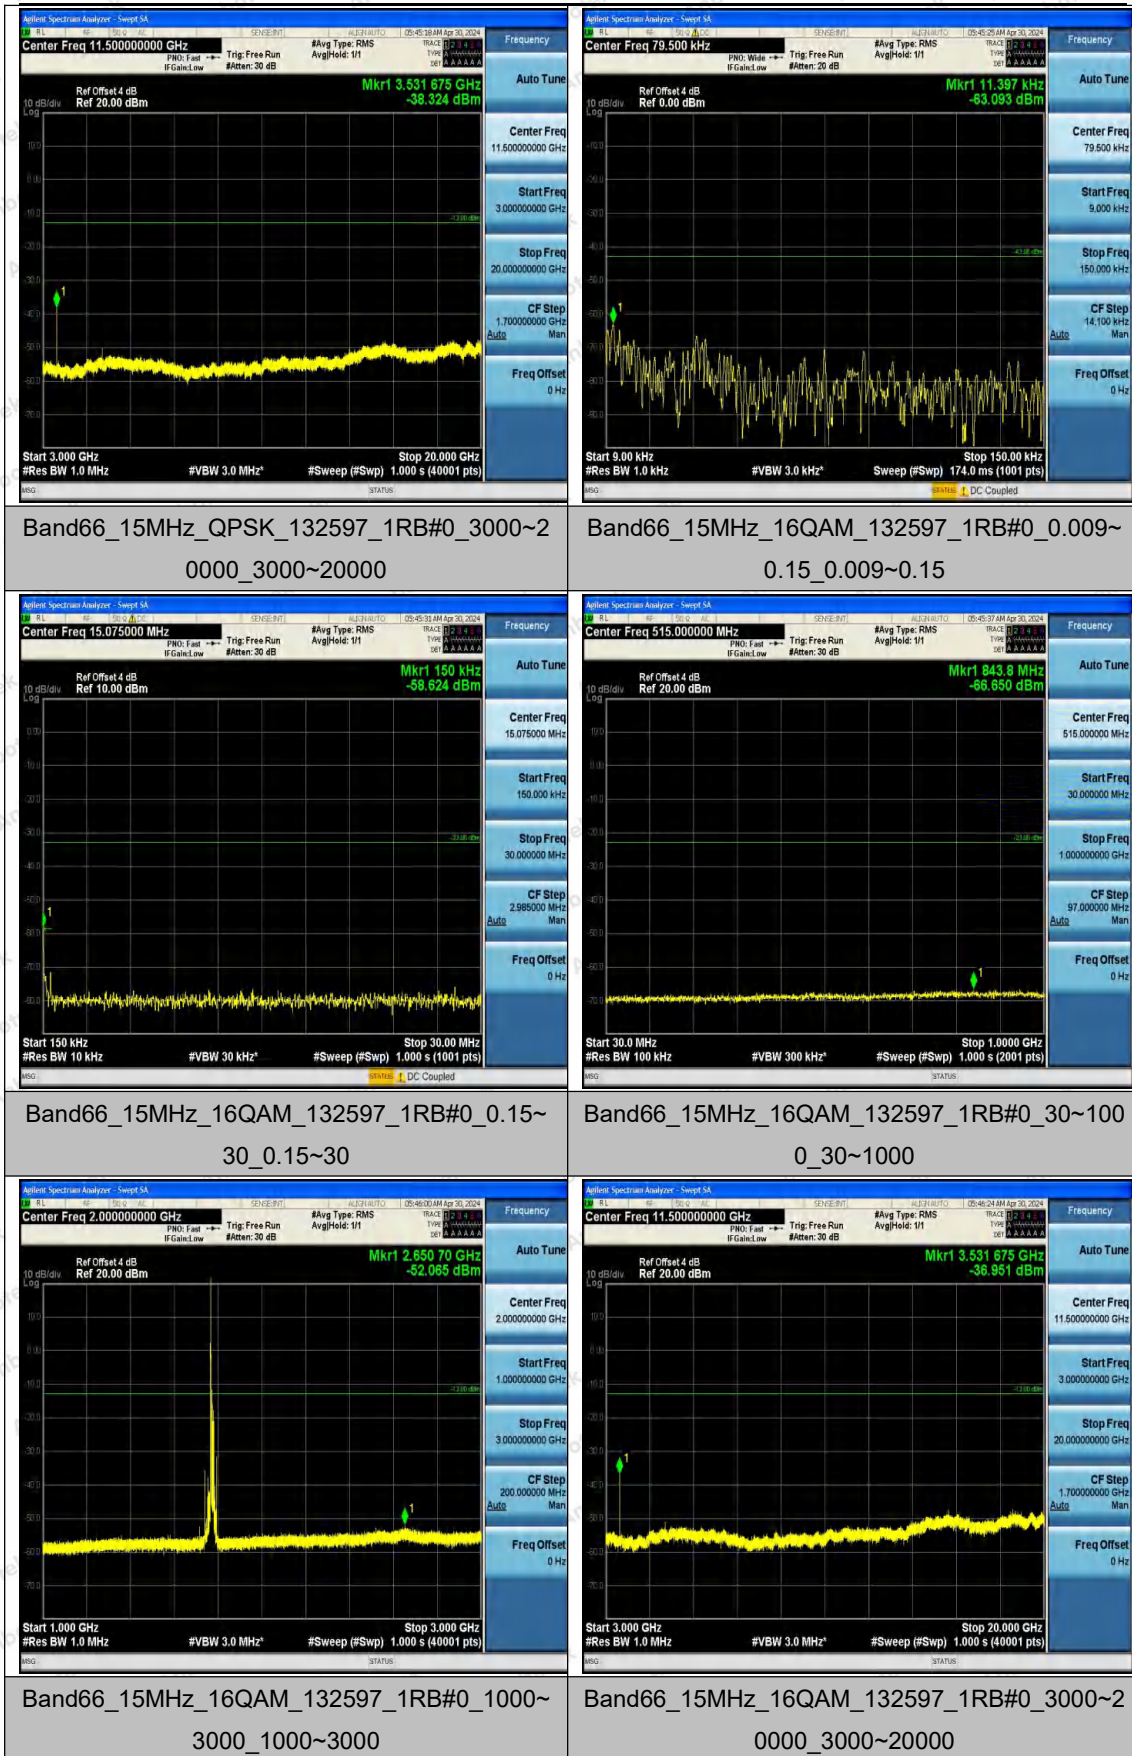


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



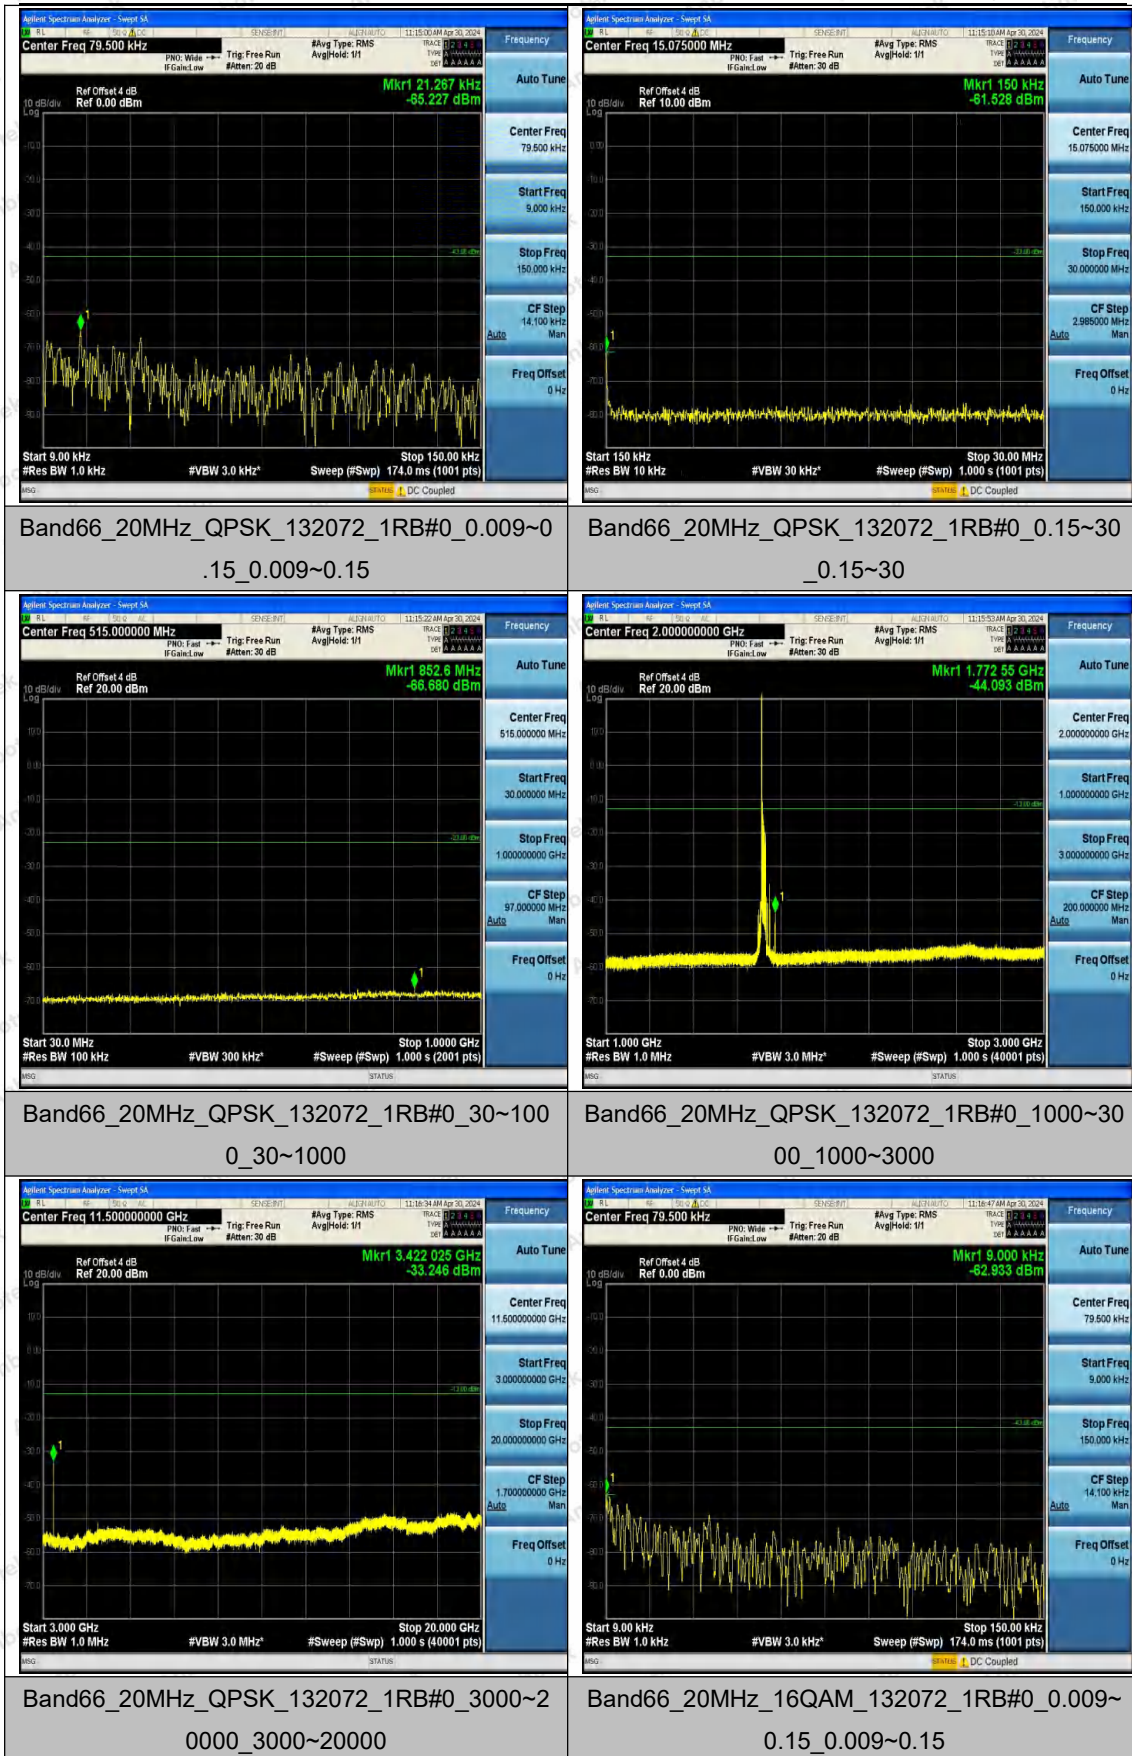


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



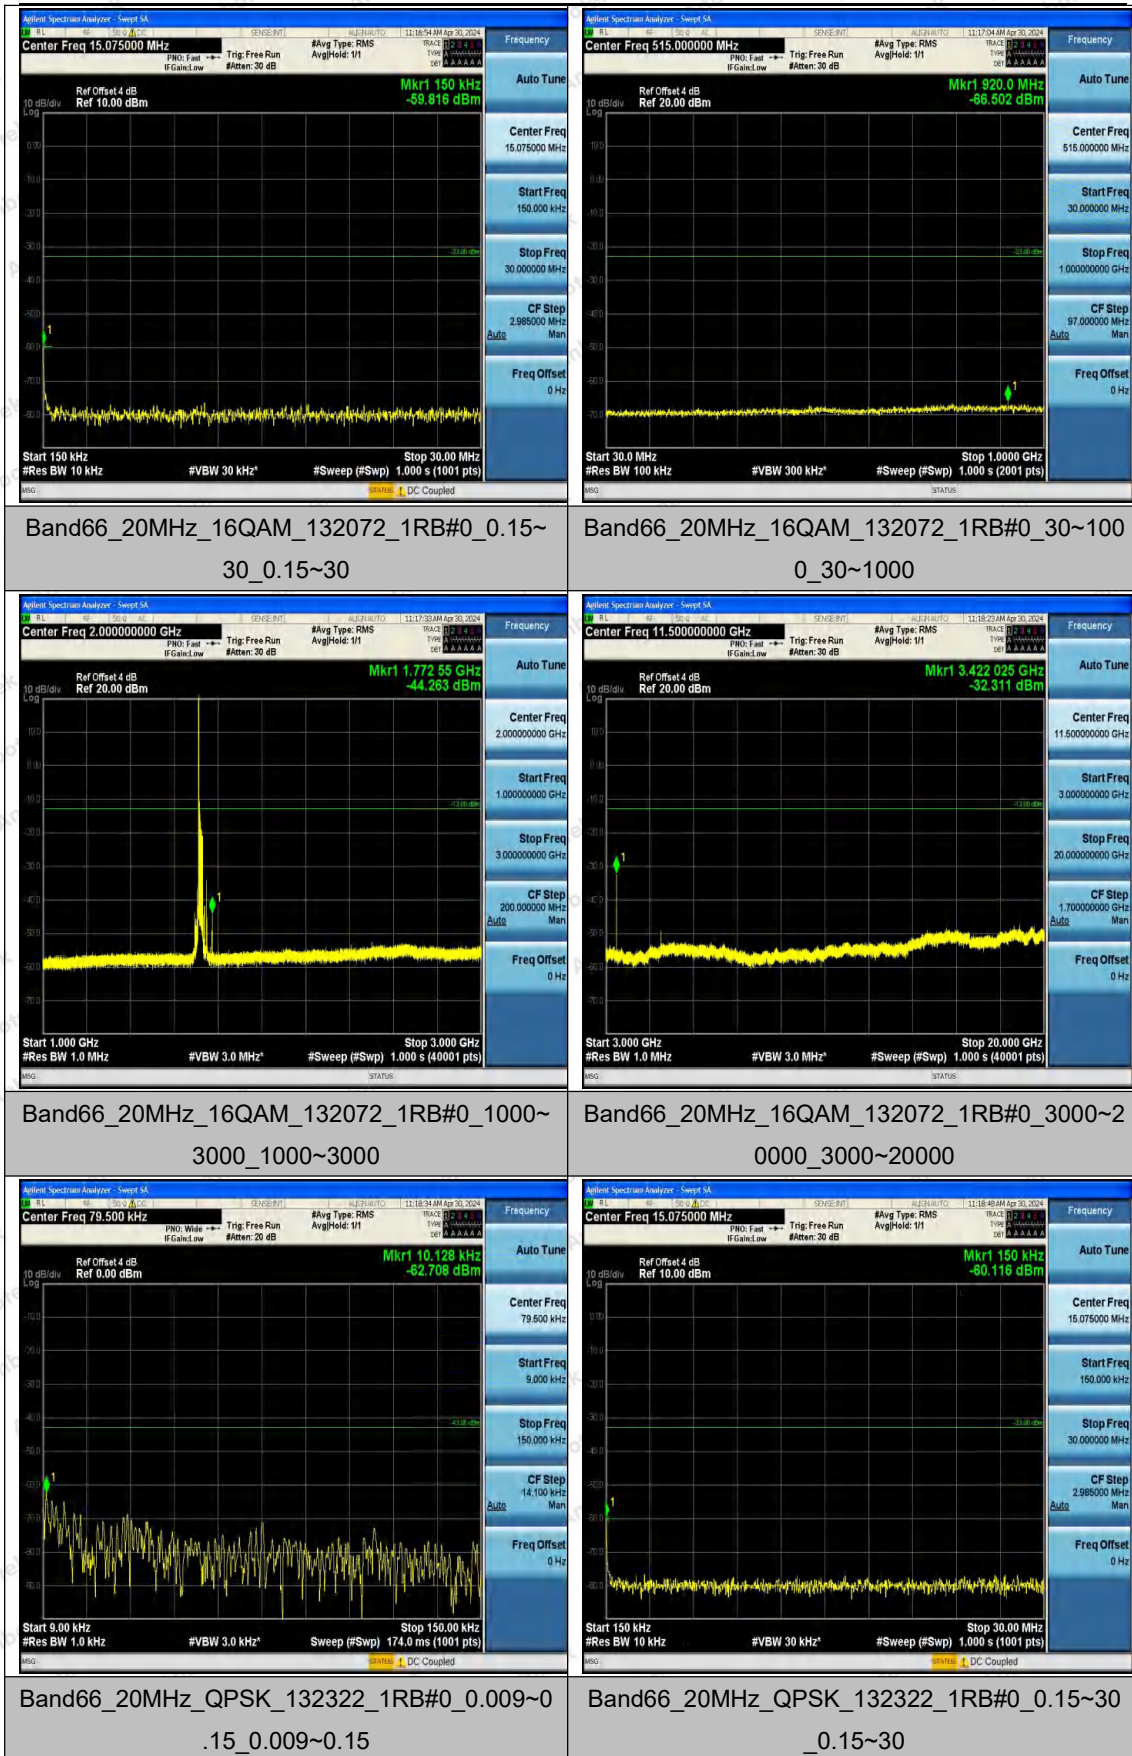


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



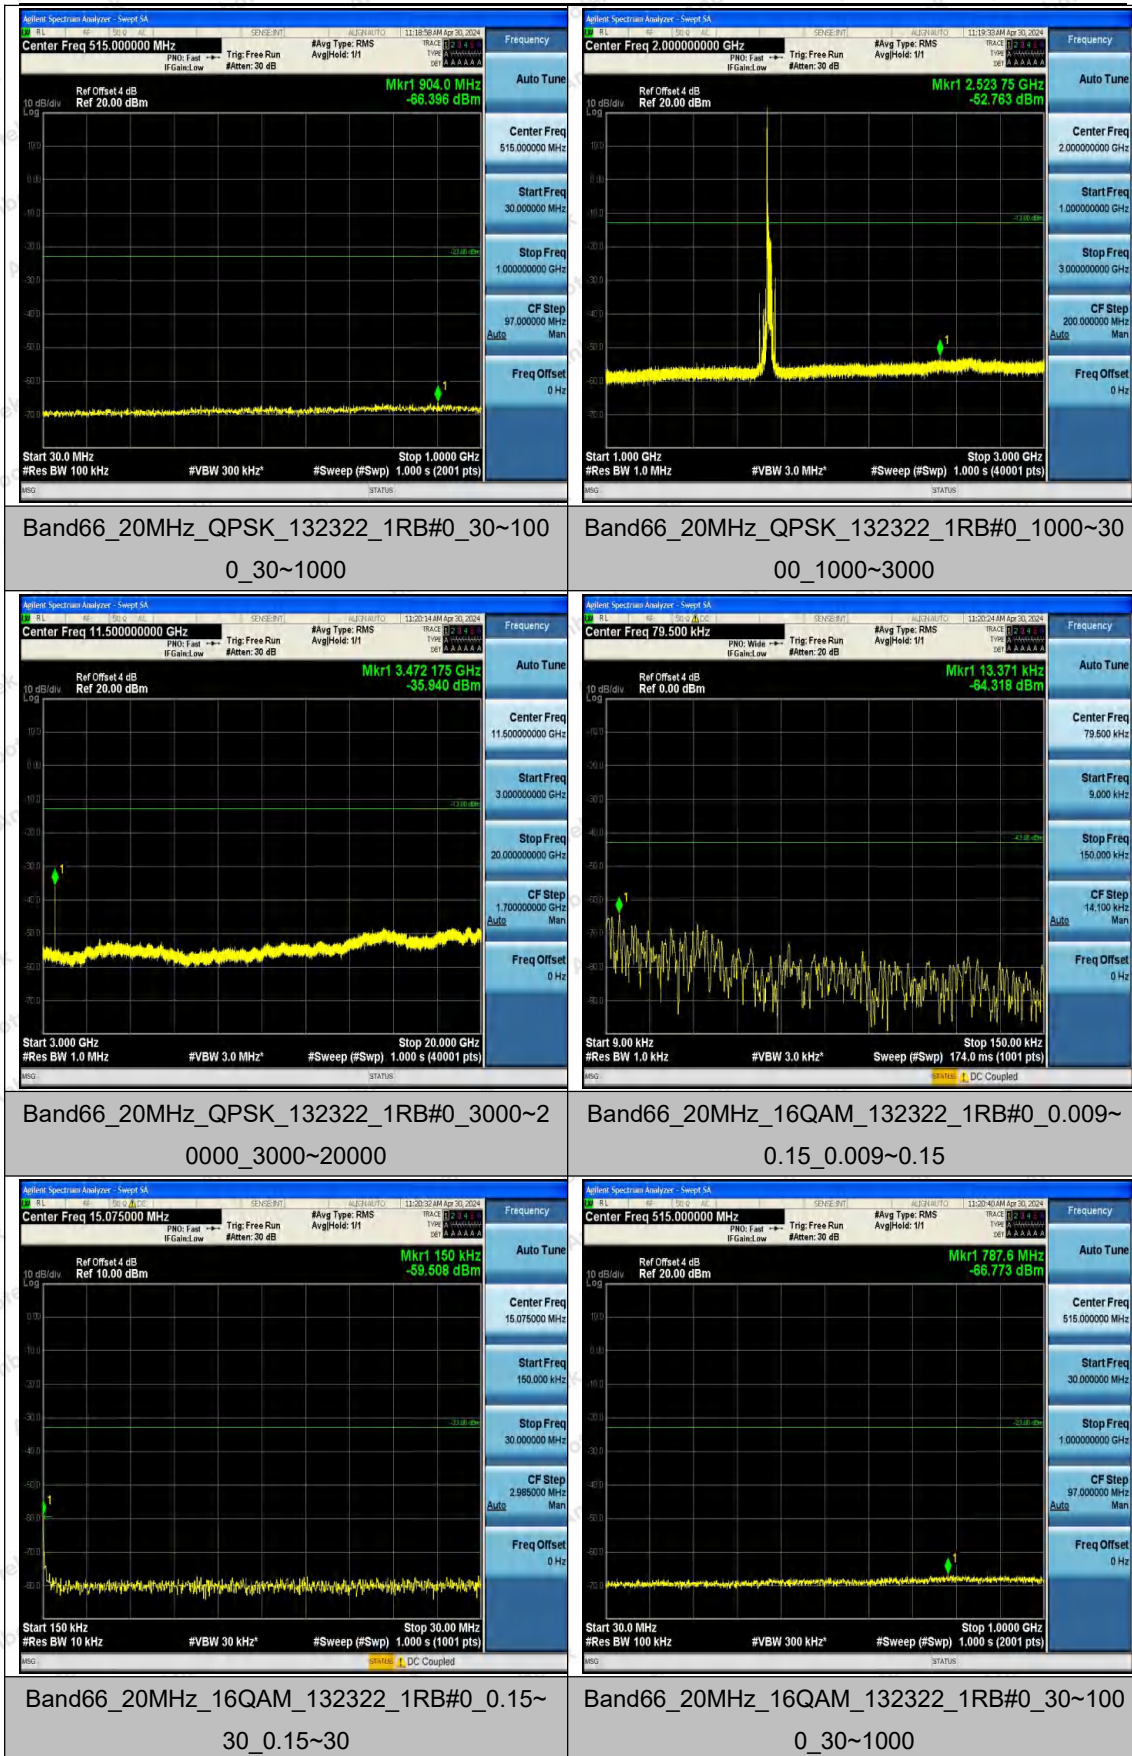


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



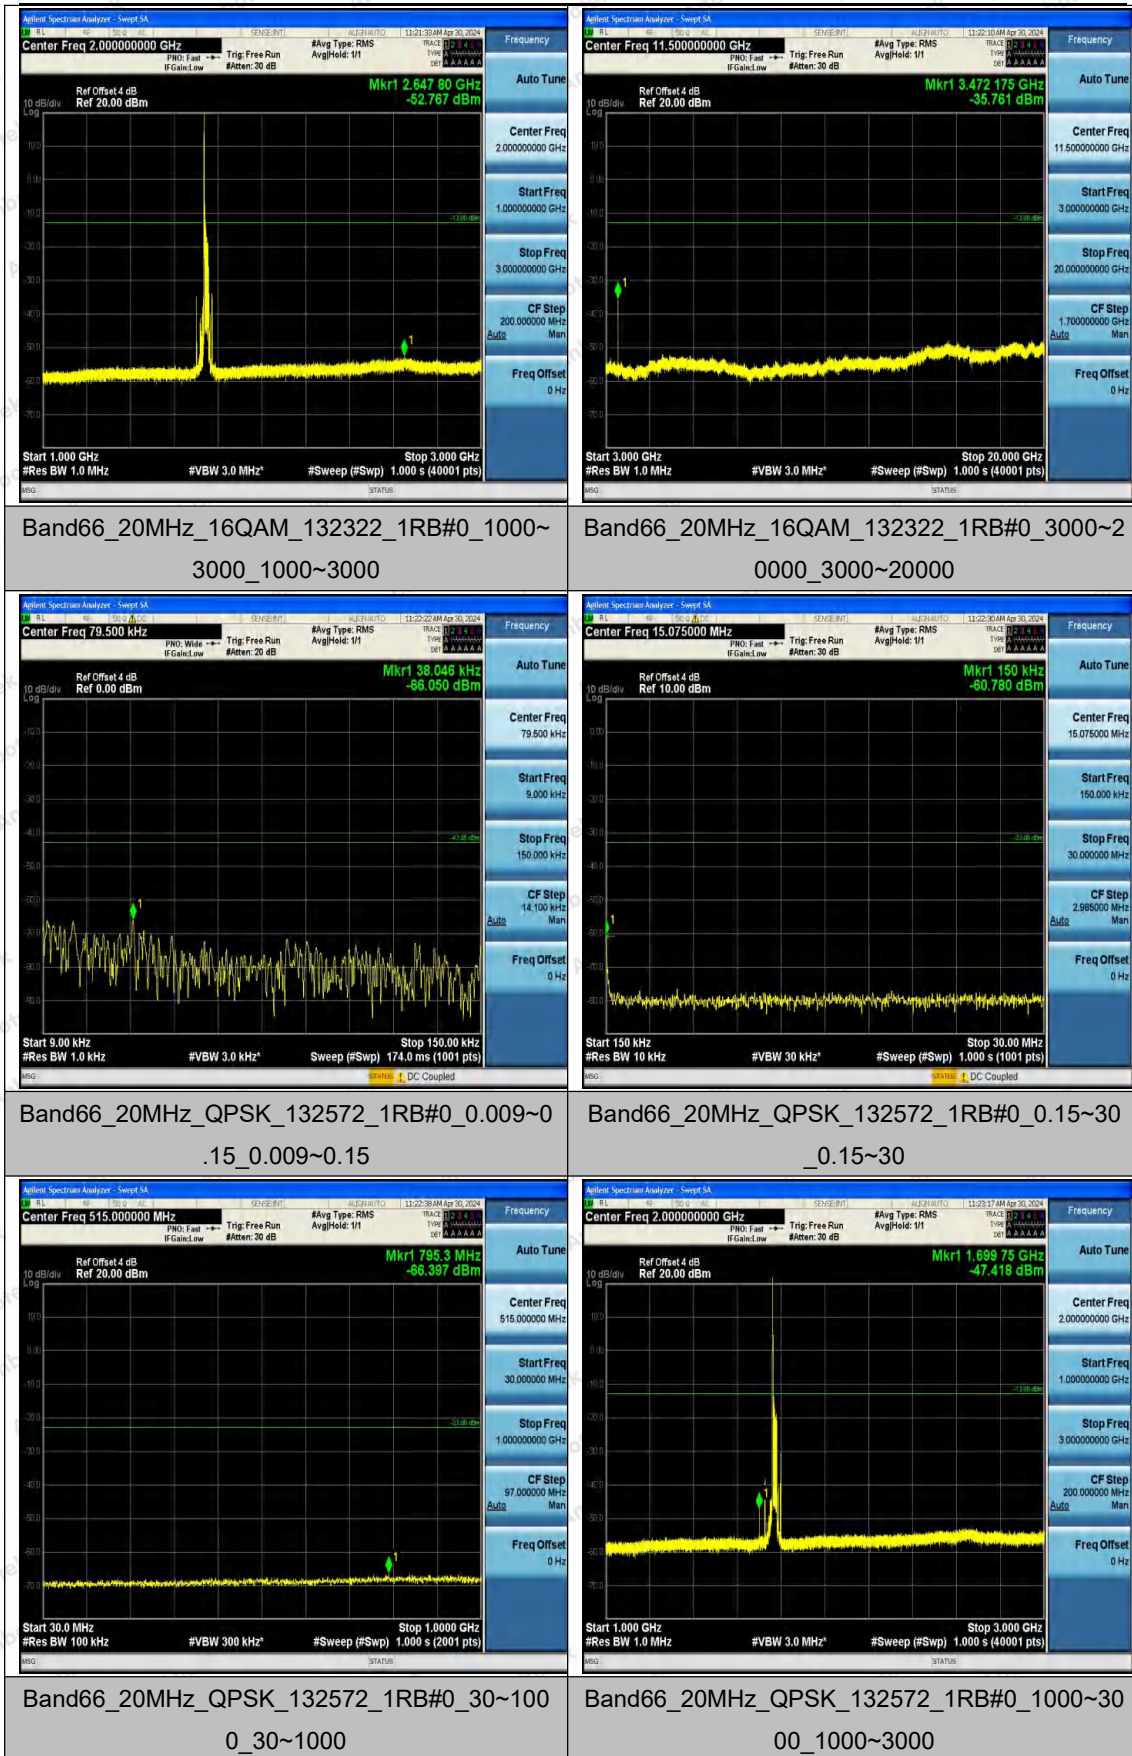


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



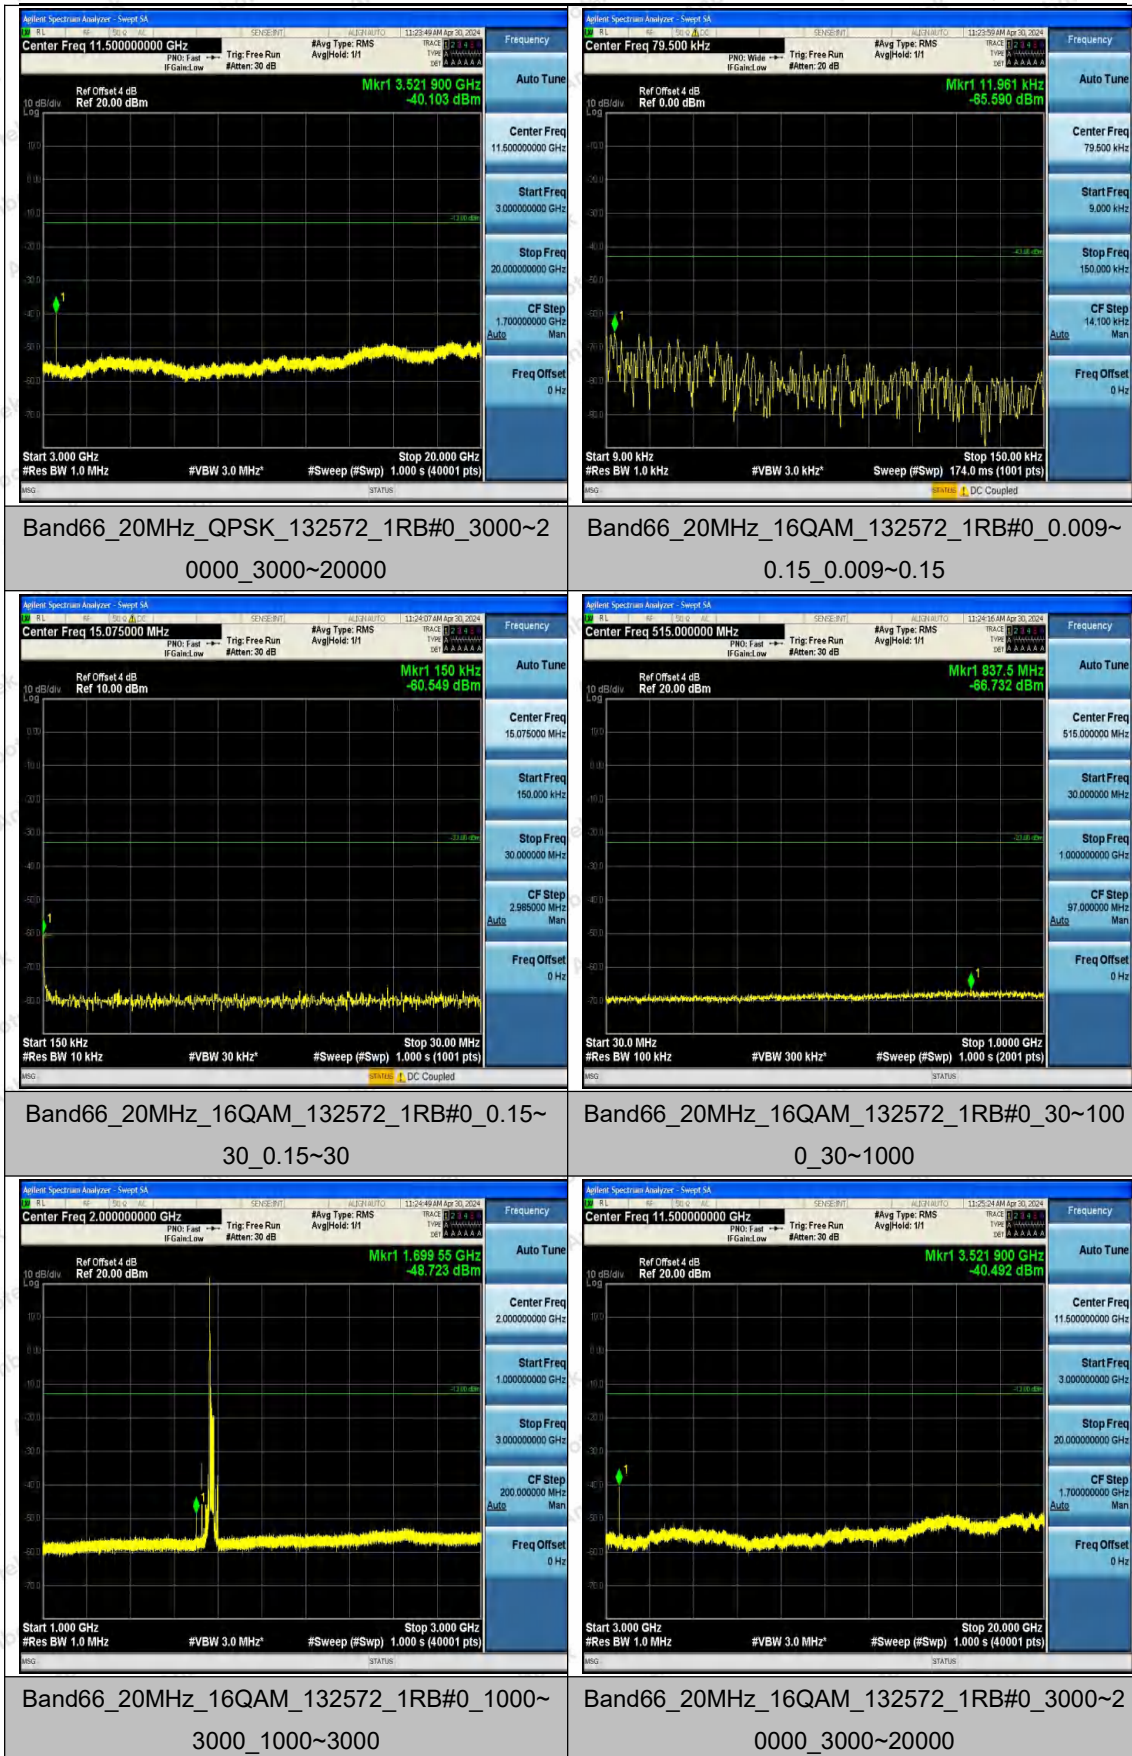

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



## Appendix F: Frequency stability VS Voltage measurement

### Test Result

| Band   | Bandwidth | Modulation | Channel | RB Configure | Voltage       |                  | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|--------|-----------|------------|---------|--------------|---------------|------------------|----------------|-----------------|-------------|---------|
|        |           |            |         |              | Voltage [Vdc] | Temperature (°C) |                |                 |             |         |
| Band66 | 1.4MHz    | QPSK       | 131979  | 6RB#0        | VN            | NT               | 21.20          | 0.012393        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | QPSK       | 131979  | 6RB#0        | VL            | NT               | 22.65          | 0.013240        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | QPSK       | 131979  | 6RB#0        | VH            | NT               | -9.64          | -0.005635       | ±2.5        | PASS    |
| Band66 | 1.4MHz    | 16QAM      | 131979  | 6RB#0        | VN            | NT               | 36.15          | 0.021132        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | 16QAM      | 131979  | 6RB#0        | VL            | NT               | 28.58          | 0.016707        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | 16QAM      | 131979  | 6RB#0        | VH            | NT               | 34.78          | 0.020331        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | QPSK       | 132322  | 6RB#0        | VN            | NT               | 32.23          | 0.018470        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | QPSK       | 132322  | 6RB#0        | VL            | NT               | 10.70          | 0.006132        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | QPSK       | 132322  | 6RB#0        | VH            | NT               | 46.42          | 0.026602        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | 16QAM      | 132322  | 6RB#0        | VN            | NT               | 34.62          | 0.019840        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | 16QAM      | 132322  | 6RB#0        | VL            | NT               | 7.81           | 0.004476        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | 16QAM      | 132322  | 6RB#0        | VH            | NT               | 33.14          | 0.018991        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | QPSK       | 132665  | 6RB#0        | VN            | NT               | 3.72           | 0.002091        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | QPSK       | 132665  | 6RB#0        | VL            | NT               | -23.30         | -0.013095       | ±2.5        | PASS    |
| Band66 | 1.4MHz    | QPSK       | 132665  | 6RB#0        | VH            | NT               | 16.94          | 0.009521        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | 16QAM      | 132665  | 6RB#0        | VN            | NT               | 12.79          | 0.007188        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | 16QAM      | 132665  | 6RB#0        | VL            | NT               | 18.63          | 0.010470        | ±2.5        | PASS    |
| Band66 | 1.4MHz    | 16QAM      | 132665  | 6RB#0        | VH            | NT               | 46.94          | 0.026381        | ±2.5        | PASS    |
| Band66 | 3MHz      | QPSK       | 131987  | 15RB#0       | VN            | NT               | -47.39         | -0.027689       | ±2.5        | PASS    |
| Band66 | 3MHz      | QPSK       | 131987  | 15RB#0       | VL            | NT               | -8.80          | -0.005142       | ±2.5        | PASS    |
| Band66 | 3MHz      | QPSK       | 131987  | 15RB#0       | VH            | NT               | 21.30          | 0.012445        | ±2.5        | PASS    |
| Band66 | 3MHz      | 16QAM      | 131987  | 15RB#0       | VN            | NT               | 6.58           | 0.003845        | ±2.5        | PASS    |
| Band66 | 3MHz      | 16QAM      | 131987  | 15RB#0       | VL            | NT               | -41.47         | -0.024230       | ±2.5        | PASS    |
| Band66 | 3MHz      | 16QAM      | 131987  | 15RB#0       | VH            | NT               | -25.12         | -0.014677       | ±2.5        | PASS    |
| Band66 | 3MHz      | QPSK       | 132322  | 15RB#0       | VN            | NT               | -20.64         | -0.011828       | ±2.5        | PASS    |
| Band66 | 3MHz      | QPSK       | 132322  | 15RB#0       | VL            | NT               | -27.15         | -0.015559       | ±2.5        | PASS    |
| Band66 | 3MHz      | QPSK       | 132322  | 15RB#0       | VH            | NT               | 9.76           | 0.005593        | ±2.5        | PASS    |
| Band66 | 3MHz      | 16QAM      | 132322  | 15RB#0       | VN            | NT               | 14.99          | 0.008590        | ±2.5        | PASS    |
| Band66 | 3MHz      | 16QAM      | 132322  | 15RB#0       | VL            | NT               | 24.00          | 0.013754        | ±2.5        | PASS    |
| Band66 | 3MHz      | 16QAM      | 132322  | 15RB#0       | VH            | NT               | -43.73         | -0.025060       | ±2.5        | PASS    |
| Band66 | 3MHz      | QPSK       | 132657  | 15RB#0       | VN            | NT               | -37.72         | -0.021209       | ±2.5        | PASS    |
| Band66 | 3MHz      | QPSK       | 132657  | 15RB#0       | VL            | NT               | -40.70         | -0.022884       | ±2.5        | PASS    |
| Band66 | 3MHz      | QPSK       | 132657  | 15RB#0       | VH            | NT               | 15.11          | 0.008496        | ±2.5        | PASS    |
| Band66 | 3MHz      | 16QAM      | 132657  | 15RB#0       | VN            | NT               | 11.69          | 0.006573        | ±2.5        | PASS    |
| Band66 | 3MHz      | 16QAM      | 132657  | 15RB#0       | VL            | NT               | 28.11          | 0.015805        | ±2.5        | PASS    |



|        |       |       |        |        |    |    |        |           |      |      |
|--------|-------|-------|--------|--------|----|----|--------|-----------|------|------|
| Band66 | 3MHz  | 16QAM | 132657 | 15RB#0 | VH | NT | -20.21 | -0.011364 | ±2.5 | PASS |
| Band66 | 5MHz  | QPSK  | 131997 | 25RB#0 | VN | NT | -34.48 | -0.020134 | ±2.5 | PASS |
| Band66 | 5MHz  | QPSK  | 131997 | 25RB#0 | VL | NT | 31.64  | 0.018476  | ±2.5 | PASS |
| Band66 | 5MHz  | QPSK  | 131997 | 25RB#0 | VH | NT | 8.51   | 0.004969  | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 131997 | 25RB#0 | VN | NT | -24.60 | -0.014365 | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 131997 | 25RB#0 | VL | NT | -8.80  | -0.005139 | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 131997 | 25RB#0 | VH | NT | -38.18 | -0.022295 | ±2.5 | PASS |
| Band66 | 5MHz  | QPSK  | 132322 | 25RB#0 | VN | NT | 34.00  | 0.019484  | ±2.5 | PASS |
| Band66 | 5MHz  | QPSK  | 132322 | 25RB#0 | VL | NT | -12.83 | -0.007352 | ±2.5 | PASS |
| Band66 | 5MHz  | QPSK  | 132322 | 25RB#0 | VH | NT | -45.80 | -0.026246 | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 132322 | 25RB#0 | VN | NT | -14.13 | -0.008097 | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 132322 | 25RB#0 | VL | NT | -39.34 | -0.022544 | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 132322 | 25RB#0 | VH | NT | -34.92 | -0.020011 | ±2.5 | PASS |
| Band66 | 5MHz  | QPSK  | 132647 | 25RB#0 | VN | NT | -25.89 | -0.014565 | ±2.5 | PASS |
| Band66 | 5MHz  | QPSK  | 132647 | 25RB#0 | VL | NT | -30.64 | -0.017238 | ±2.5 | PASS |
| Band66 | 5MHz  | QPSK  | 132647 | 25RB#0 | VH | NT | 9.60   | 0.005401  | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 132647 | 25RB#0 | VN | NT | 34.39  | 0.019347  | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 132647 | 25RB#0 | VL | NT | -3.59  | -0.002020 | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 132647 | 25RB#0 | VH | NT | 25.16  | 0.014155  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132022 | 50RB#0 | VN | NT | -52.69 | -0.030723 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132022 | 50RB#0 | VL | NT | -15.54 | -0.009061 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132022 | 50RB#0 | VH | NT | 20.69  | 0.012064  | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132022 | 50RB#0 | VN | NT | -37.08 | -0.021621 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132022 | 50RB#0 | VL | NT | -36.25 | -0.021137 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132022 | 50RB#0 | VH | NT | -40.28 | -0.023487 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132322 | 50RB#0 | VN | NT | -55.05 | -0.031547 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132322 | 50RB#0 | VL | NT | -42.10 | -0.024126 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132322 | 50RB#0 | VH | NT | -27.01 | -0.015479 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132322 | 50RB#0 | VN | NT | -31.40 | -0.017994 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132322 | 50RB#0 | VL | NT | -43.27 | -0.024797 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132322 | 50RB#0 | VH | NT | -42.70 | -0.024470 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132622 | 50RB#0 | VN | NT | -47.15 | -0.026563 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132622 | 50RB#0 | VL | NT | 20.43  | 0.011510  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132622 | 50RB#0 | VH | NT | 42.36  | 0.023865  | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132622 | 50RB#0 | VN | NT | 31.49  | 0.017741  | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132622 | 50RB#0 | VL | NT | 33.00  | 0.018592  | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132622 | 50RB#0 | VH | NT | -25.71 | -0.014485 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 75RB#0 | VN | NT | -39.48 | -0.022987 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 75RB#0 | VL | NT | 42.60  | 0.024803  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 75RB#0 | VH | NT | 53.03  | 0.030876  | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 75RB#0 | VN | NT | -20.83 | -0.012128 | ±2.5 | PASS |



|        |       |       |        |         |    |    |        |           |      |      |
|--------|-------|-------|--------|---------|----|----|--------|-----------|------|------|
| Band66 | 15MHz | 16QAM | 132047 | 75RB#0  | VL | NT | -34.90 | -0.020320 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 75RB#0  | VH | NT | -42.07 | -0.024495 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 75RB#0  | VN | NT | -49.54 | -0.028390 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 75RB#0  | VL | NT | -48.75 | -0.027937 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 75RB#0  | VH | NT | -47.26 | -0.027083 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 75RB#0  | VN | NT | 37.62  | 0.021559  | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 75RB#0  | VL | NT | -47.74 | -0.027358 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 75RB#0  | VH | NT | -39.37 | -0.022562 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 75RB#0  | VN | NT | -50.61 | -0.028553 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 75RB#0  | VL | NT | -9.83  | -0.005546 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 75RB#0  | VH | NT | 46.95  | 0.026488  | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 75RB#0  | VN | NT | 19.04  | 0.010742  | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 75RB#0  | VL | NT | -22.99 | -0.012970 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 75RB#0  | VH | NT | -7.61  | -0.004293 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 100RB#0 | VN | NT | -32.14 | -0.018686 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 100RB#0 | VL | NT | 23.36  | 0.013581  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 100RB#0 | VH | NT | 37.28  | 0.021674  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 100RB#0 | VN | NT | 37.59  | 0.021855  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 100RB#0 | VL | NT | -34.17 | -0.019866 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 100RB#0 | VH | NT | -43.02 | -0.025012 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 100RB#0 | VN | NT | -42.09 | -0.024120 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 100RB#0 | VL | NT | -42.11 | -0.024132 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 100RB#0 | VH | NT | -51.16 | -0.029318 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 100RB#0 | VN | NT | -46.19 | -0.026470 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 100RB#0 | VL | NT | -48.48 | -0.027782 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 100RB#0 | VH | NT | -59.34 | -0.034006 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 100RB#0 | VN | NT | -31.36 | -0.017718 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 100RB#0 | VL | NT | -12.43 | -0.007023 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 100RB#0 | VH | NT | 36.64  | 0.020701  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 100RB#0 | VN | NT | 34.63  | 0.019565  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 100RB#0 | VL | NT | 32.19  | 0.018186  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 100RB#0 | VH | NT | 7.40   | 0.004181  | ±2.5 | PASS |



## Appendix G: Frequency stability VS Temperature

### measurement

### Test Result

| Temperature |           |            |         |              |               |                  |                |                 |             |         |
|-------------|-----------|------------|---------|--------------|---------------|------------------|----------------|-----------------|-------------|---------|
| Band        | Bandwidth | Modulation | Channel | RB Configure | Voltage [Vdc] | Temperature (°C) | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
| Band66      | 1.4MHz    | QPSK       | 131979  | 6RB#0        | NV            | -30              | 39.91          | 0.023330        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 131979  | 6RB#0        | NV            | -20              | 48.94          | 0.028608        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 131979  | 6RB#0        | NV            | -10              | 32.79          | 0.019168        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 131979  | 6RB#0        | NV            | 0                | 42.60          | 0.024902        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 131979  | 6RB#0        | NV            | 10               | 10.50          | 0.006138        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 131979  | 6RB#0        | NV            | 20               | 14.10          | 0.008242        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 131979  | 6RB#0        | NV            | 30               | 26.97          | 0.015765        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 131979  | 6RB#0        | NV            | 40               | 9.97           | 0.005828        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 131979  | 6RB#0        | NV            | 50               | 51.28          | 0.029976        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 131979  | 6RB#0        | NV            | -30              | 24.48          | 0.014310        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 131979  | 6RB#0        | NV            | -20              | 46.58          | 0.027229        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 131979  | 6RB#0        | NV            | -10              | 14.53          | 0.008494        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 131979  | 6RB#0        | NV            | 0                | 10.87          | 0.006354        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 131979  | 6RB#0        | NV            | 10               | 11.22          | 0.006559        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 131979  | 6RB#0        | NV            | 20               | 30.57          | 0.017870        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 131979  | 6RB#0        | NV            | 30               | 35.45          | 0.020723        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 131979  | 6RB#0        | NV            | 40               | 47.12          | 0.027544        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 131979  | 6RB#0        | NV            | 50               | 19.08          | 0.011153        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 132322  | 6RB#0        | NV            | -30              | 41.77          | 0.023937        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 132322  | 6RB#0        | NV            | -20              | 30.01          | 0.017198        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 132322  | 6RB#0        | NV            | -10              | 23.75          | 0.013610        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 132322  | 6RB#0        | NV            | 0                | 39.02          | 0.022361        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 132322  | 6RB#0        | NV            | 10               | 37.04          | 0.021226        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 132322  | 6RB#0        | NV            | 20               | 26.18          | 0.015003        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 132322  | 6RB#0        | NV            | 30               | 41.86          | 0.023989        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 132322  | 6RB#0        | NV            | 40               | 7.08           | 0.004057        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | QPSK       | 132322  | 6RB#0        | NV            | 50               | 28.88          | 0.016550        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 132322  | 6RB#0        | NV            | -30              | 43.63          | 0.025003        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 132322  | 6RB#0        | NV            | -20              | 12.77          | 0.007318        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 132322  | 6RB#0        | NV            | -10              | 47.92          | 0.027461        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 132322  | 6RB#0        | NV            | 0                | 45.28          | 0.025948        | ±2.5        | PASS    |
| Band66      | 1.4MHz    | 16QAM      | 132322  | 6RB#0        | NV            | 10               | 26.31          | 0.015077        | ±2.5        | PASS    |

### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



|        |        |       |        |        |    |     |        |           |      |      |
|--------|--------|-------|--------|--------|----|-----|--------|-----------|------|------|
| Band66 | 1.4MHz | 16QAM | 132322 | 6RB#0  | NV | 20  | 29.68  | 0.017009  | ±2.5 | PASS |
| Band66 | 1.4MHz | 16QAM | 132322 | 6RB#0  | NV | 30  | 50.25  | 0.028797  | ±2.5 | PASS |
| Band66 | 1.4MHz | 16QAM | 132322 | 6RB#0  | NV | 40  | 36.12  | 0.020699  | ±2.5 | PASS |
| Band66 | 1.4MHz | 16QAM | 132322 | 6RB#0  | NV | 50  | 21.93  | 0.012567  | ±2.5 | PASS |
| Band66 | 1.4MHz | QPSK  | 132665 | 6RB#0  | NV | -30 | 21.17  | 0.011898  | ±2.5 | PASS |
| Band66 | 1.4MHz | QPSK  | 132665 | 6RB#0  | NV | -20 | 48.01  | 0.026983  | ±2.5 | PASS |
| Band66 | 1.4MHz | QPSK  | 132665 | 6RB#0  | NV | -10 | 24.06  | 0.013522  | ±2.5 | PASS |
| Band66 | 1.4MHz | QPSK  | 132665 | 6RB#0  | NV | 0   | 46.56  | 0.026168  | ±2.5 | PASS |
| Band66 | 1.4MHz | QPSK  | 132665 | 6RB#0  | NV | 10  | 38.28  | 0.021514  | ±2.5 | PASS |
| Band66 | 1.4MHz | QPSK  | 132665 | 6RB#0  | NV | 20  | 43.64  | 0.024526  | ±2.5 | PASS |
| Band66 | 1.4MHz | QPSK  | 132665 | 6RB#0  | NV | 30  | 38.38  | 0.021570  | ±2.5 | PASS |
| Band66 | 1.4MHz | QPSK  | 132665 | 6RB#0  | NV | 40  | 34.80  | 0.019558  | ±2.5 | PASS |
| Band66 | 1.4MHz | QPSK  | 132665 | 6RB#0  | NV | 50  | 59.18  | 0.033260  | ±2.5 | PASS |
| Band66 | 1.4MHz | 16QAM | 132665 | 6RB#0  | NV | -30 | 27.39  | 0.015394  | ±2.5 | PASS |
| Band66 | 1.4MHz | 16QAM | 132665 | 6RB#0  | NV | -20 | 19.54  | 0.010982  | ±2.5 | PASS |
| Band66 | 1.4MHz | 16QAM | 132665 | 6RB#0  | NV | -10 | 43.17  | 0.024262  | ±2.5 | PASS |
| Band66 | 1.4MHz | 16QAM | 132665 | 6RB#0  | NV | 0   | 22.49  | 0.012640  | ±2.5 | PASS |
| Band66 | 1.4MHz | 16QAM | 132665 | 6RB#0  | NV | 10  | 26.91  | 0.015124  | ±2.5 | PASS |
| Band66 | 1.4MHz | 16QAM | 132665 | 6RB#0  | NV | 20  | 23.25  | 0.013067  | ±2.5 | PASS |
| Band66 | 1.4MHz | 16QAM | 132665 | 6RB#0  | NV | 30  | 28.11  | 0.015798  | ±2.5 | PASS |
| Band66 | 1.4MHz | 16QAM | 132665 | 6RB#0  | NV | 40  | 25.94  | 0.014579  | ±2.5 | PASS |
| Band66 | 1.4MHz | 16QAM | 132665 | 6RB#0  | NV | 50  | -4.99  | -0.002804 | ±2.5 | PASS |
| Band66 | 3MHz   | QPSK  | 131987 | 15RB#0 | NV | -30 | 28.37  | 0.016576  | ±2.5 | PASS |
| Band66 | 3MHz   | QPSK  | 131987 | 15RB#0 | NV | -20 | 26.85  | 0.015688  | ±2.5 | PASS |
| Band66 | 3MHz   | QPSK  | 131987 | 15RB#0 | NV | -10 | 2.66   | 0.001554  | ±2.5 | PASS |
| Band66 | 3MHz   | QPSK  | 131987 | 15RB#0 | NV | 0   | -25.16 | -0.014701 | ±2.5 | PASS |
| Band66 | 3MHz   | QPSK  | 131987 | 15RB#0 | NV | 10  | -37.34 | -0.021817 | ±2.5 | PASS |
| Band66 | 3MHz   | QPSK  | 131987 | 15RB#0 | NV | 20  | 38.75  | 0.022641  | ±2.5 | PASS |
| Band66 | 3MHz   | QPSK  | 131987 | 15RB#0 | NV | 30  | 9.48   | 0.005539  | ±2.5 | PASS |
| Band66 | 3MHz   | QPSK  | 131987 | 15RB#0 | NV | 40  | 32.01  | 0.018703  | ±2.5 | PASS |
| Band66 | 3MHz   | QPSK  | 131987 | 15RB#0 | NV | 50  | 40.64  | 0.023745  | ±2.5 | PASS |
| Band66 | 3MHz   | 16QAM | 131987 | 15RB#0 | NV | -30 | -42.47 | -0.024814 | ±2.5 | PASS |
| Band66 | 3MHz   | 16QAM | 131987 | 15RB#0 | NV | -20 | -16.28 | -0.009512 | ±2.5 | PASS |
| Band66 | 3MHz   | 16QAM | 131987 | 15RB#0 | NV | -10 | -37.54 | -0.021934 | ±2.5 | PASS |
| Band66 | 3MHz   | 16QAM | 131987 | 15RB#0 | NV | 0   | -38.65 | -0.022583 | ±2.5 | PASS |
| Band66 | 3MHz   | 16QAM | 131987 | 15RB#0 | NV | 10  | 4.53   | 0.002647  | ±2.5 | PASS |
| Band66 | 3MHz   | 16QAM | 131987 | 15RB#0 | NV | 20  | -23.93 | -0.013982 | ±2.5 | PASS |
| Band66 | 3MHz   | 16QAM | 131987 | 15RB#0 | NV | 30  | -54.76 | -0.031995 | ±2.5 | PASS |
| Band66 | 3MHz   | 16QAM | 131987 | 15RB#0 | NV | 40  | -23.80 | -0.013906 | ±2.5 | PASS |
| Band66 | 3MHz   | 16QAM | 131987 | 15RB#0 | NV | 50  | 7.18   | 0.004195  | ±2.5 | PASS |
| Band66 | 3MHz   | QPSK  | 132322 | 15RB#0 | NV | -30 | -20.11 | -0.011524 | ±2.5 | PASS |



|        |      |       |        |        |    |     |        |           |      |      |
|--------|------|-------|--------|--------|----|-----|--------|-----------|------|------|
| Band66 | 3MHz | QPSK  | 132322 | 15RB#0 | NV | -20 | -46.94 | -0.026900 | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132322 | 15RB#0 | NV | -10 | -33.16 | -0.019003 | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132322 | 15RB#0 | NV | 0   | -42.49 | -0.024350 | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132322 | 15RB#0 | NV | 10  | -15.69 | -0.008991 | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132322 | 15RB#0 | NV | 20  | -37.84 | -0.021685 | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132322 | 15RB#0 | NV | 30  | -40.51 | -0.023215 | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132322 | 15RB#0 | NV | 40  | -12.02 | -0.006888 | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132322 | 15RB#0 | NV | 50  | -55.36 | -0.031725 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132322 | 15RB#0 | NV | -30 | -18.95 | -0.010860 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132322 | 15RB#0 | NV | -20 | -37.48 | -0.021479 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132322 | 15RB#0 | NV | -10 | -25.62 | -0.014682 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132322 | 15RB#0 | NV | 0   | 8.94   | 0.005123  | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132322 | 15RB#0 | NV | 10  | -40.34 | -0.023117 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132322 | 15RB#0 | NV | 20  | -43.80 | -0.025100 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132322 | 15RB#0 | NV | 30  | -19.21 | -0.011009 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132322 | 15RB#0 | NV | 40  | -35.13 | -0.020132 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132322 | 15RB#0 | NV | 50  | -23.72 | -0.013593 | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132657 | 15RB#0 | NV | -30 | 12.65  | 0.007113  | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132657 | 15RB#0 | NV | -20 | 44.69  | 0.025128  | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132657 | 15RB#0 | NV | -10 | 20.01  | 0.011251  | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132657 | 15RB#0 | NV | 0   | 46.41  | 0.026095  | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132657 | 15RB#0 | NV | 10  | 33.59  | 0.018887  | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132657 | 15RB#0 | NV | 20  | 12.06  | 0.006781  | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132657 | 15RB#0 | NV | 30  | 30.93  | 0.017391  | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132657 | 15RB#0 | NV | 40  | 26.74  | 0.015035  | ±2.5 | PASS |
| Band66 | 3MHz | QPSK  | 132657 | 15RB#0 | NV | 50  | 43.12  | 0.024245  | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132657 | 15RB#0 | NV | -30 | -17.58 | -0.009885 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132657 | 15RB#0 | NV | -20 | -30.54 | -0.017172 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132657 | 15RB#0 | NV | -10 | 37.82  | 0.021265  | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132657 | 15RB#0 | NV | 0   | 22.49  | 0.012645  | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132657 | 15RB#0 | NV | 10  | 10.79  | 0.006067  | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132657 | 15RB#0 | NV | 20  | -45.12 | -0.025370 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132657 | 15RB#0 | NV | 30  | -19.01 | -0.010689 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132657 | 15RB#0 | NV | 40  | -9.13  | -0.005134 | ±2.5 | PASS |
| Band66 | 3MHz | 16QAM | 132657 | 15RB#0 | NV | 50  | -27.69 | -0.015569 | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 131997 | 25RB#0 | NV | -30 | 38.35  | 0.022394  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 131997 | 25RB#0 | NV | -20 | 32.14  | 0.018768  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 131997 | 25RB#0 | NV | -10 | 19.41  | 0.011334  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 131997 | 25RB#0 | NV | 0   | 3.66   | 0.002137  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 131997 | 25RB#0 | NV | 10  | 10.51  | 0.006137  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 131997 | 25RB#0 | NV | 20  | 10.61  | 0.006196  | ±2.5 | PASS |



|        |      |       |        |        |    |     |        |           |      |      |
|--------|------|-------|--------|--------|----|-----|--------|-----------|------|------|
| Band66 | 5MHz | QPSK  | 131997 | 25RB#0 | NV | 30  | 35.25  | 0.020584  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 131997 | 25RB#0 | NV | 40  | 18.27  | 0.010669  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 131997 | 25RB#0 | NV | 50  | 28.38  | 0.016572  | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 131997 | 25RB#0 | NV | -30 | -38.35 | -0.022394 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 131997 | 25RB#0 | NV | -20 | 5.12   | 0.002990  | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 131997 | 25RB#0 | NV | -10 | -18.80 | -0.010978 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 131997 | 25RB#0 | NV | 0   | -27.49 | -0.016053 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 131997 | 25RB#0 | NV | 10  | -39.08 | -0.022820 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 131997 | 25RB#0 | NV | 20  | -45.93 | -0.026820 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 131997 | 25RB#0 | NV | 30  | -22.76 | -0.013291 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 131997 | 25RB#0 | NV | 40  | -13.50 | -0.007883 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 131997 | 25RB#0 | NV | 50  | -39.15 | -0.022861 | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132322 | 25RB#0 | NV | -30 | -13.05 | -0.007479 | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132322 | 25RB#0 | NV | -20 | -24.63 | -0.014115 | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132322 | 25RB#0 | NV | -10 | -17.40 | -0.009971 | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132322 | 25RB#0 | NV | 0   | -13.68 | -0.007840 | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132322 | 25RB#0 | NV | 10  | -34.03 | -0.019501 | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132322 | 25RB#0 | NV | 20  | -26.45 | -0.015158 | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132322 | 25RB#0 | NV | 30  | -31.57 | -0.018092 | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132322 | 25RB#0 | NV | 40  | 9.40   | 0.005387  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132322 | 25RB#0 | NV | 50  | -4.22  | -0.002418 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 132322 | 25RB#0 | NV | -30 | -16.31 | -0.009347 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 132322 | 25RB#0 | NV | -20 | 29.70  | 0.017020  | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 132322 | 25RB#0 | NV | -10 | -39.93 | -0.022883 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 132322 | 25RB#0 | NV | 0   | -47.35 | -0.027135 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 132322 | 25RB#0 | NV | 10  | -43.97 | -0.025198 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 132322 | 25RB#0 | NV | 20  | -49.05 | -0.028109 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 132322 | 25RB#0 | NV | 30  | -7.98  | -0.004573 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 132322 | 25RB#0 | NV | 40  | -19.13 | -0.010963 | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 132322 | 25RB#0 | NV | 50  | -5.24  | -0.003003 | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132647 | 25RB#0 | NV | -30 | 49.70  | 0.027961  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132647 | 25RB#0 | NV | -20 | 13.63  | 0.007668  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132647 | 25RB#0 | NV | -10 | 37.69  | 0.021204  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132647 | 25RB#0 | NV | 0   | 43.57  | 0.024512  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132647 | 25RB#0 | NV | 10  | 18.75  | 0.010549  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132647 | 25RB#0 | NV | 20  | 7.97   | 0.004484  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132647 | 25RB#0 | NV | 30  | 12.90  | 0.007257  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132647 | 25RB#0 | NV | 40  | 34.66  | 0.019499  | ±2.5 | PASS |
| Band66 | 5MHz | QPSK  | 132647 | 25RB#0 | NV | 50  | 10.79  | 0.006070  | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 132647 | 25RB#0 | NV | -30 | 5.72   | 0.003218  | ±2.5 | PASS |
| Band66 | 5MHz | 16QAM | 132647 | 25RB#0 | NV | -20 | 19.84  | 0.011162  | ±2.5 | PASS |



|        |       |       |        |        |    |     |        |           |      |      |
|--------|-------|-------|--------|--------|----|-----|--------|-----------|------|------|
| Band66 | 5MHz  | 16QAM | 132647 | 25RB#0 | NV | -10 | -53.01 | -0.029823 | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 132647 | 25RB#0 | NV | 0   | -40.74 | -0.022920 | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 132647 | 25RB#0 | NV | 10  | -21.39 | -0.012034 | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 132647 | 25RB#0 | NV | 20  | -8.37  | -0.004709 | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 132647 | 25RB#0 | NV | 30  | -18.80 | -0.010577 | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 132647 | 25RB#0 | NV | 40  | 9.57   | 0.005384  | ±2.5 | PASS |
| Band66 | 5MHz  | 16QAM | 132647 | 25RB#0 | NV | 50  | -10.53 | -0.005924 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132022 | 50RB#0 | NV | -30 | 33.67  | 0.019633  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132022 | 50RB#0 | NV | -20 | 12.43  | 0.007248  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132022 | 50RB#0 | NV | -10 | 35.18  | 0.020513  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132022 | 50RB#0 | NV | 0   | 43.76  | 0.025516  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132022 | 50RB#0 | NV | 10  | 12.47  | 0.007271  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132022 | 50RB#0 | NV | 20  | 36.78  | 0.021446  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132022 | 50RB#0 | NV | 30  | 39.77  | 0.023190  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132022 | 50RB#0 | NV | 40  | 16.98  | 0.009901  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132022 | 50RB#0 | NV | 50  | -14.52 | -0.008466 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132022 | 50RB#0 | NV | -30 | -35.61 | -0.020764 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132022 | 50RB#0 | NV | -20 | -40.97 | -0.023889 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132022 | 50RB#0 | NV | -10 | -50.81 | -0.029627 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132022 | 50RB#0 | NV | 0   | -32.34 | -0.018857 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132022 | 50RB#0 | NV | 10  | -11.13 | -0.006490 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132022 | 50RB#0 | NV | 20  | -25.95 | -0.015131 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132022 | 50RB#0 | NV | 30  | -47.68 | -0.027802 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132022 | 50RB#0 | NV | 40  | -13.90 | -0.008105 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132022 | 50RB#0 | NV | 50  | -16.05 | -0.009359 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132322 | 50RB#0 | NV | -30 | -26.35 | -0.015100 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132322 | 50RB#0 | NV | -20 | -25.79 | -0.014779 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132322 | 50RB#0 | NV | -10 | -8.48  | -0.004860 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132322 | 50RB#0 | NV | 0   | -32.49 | -0.018619 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132322 | 50RB#0 | NV | 10  | -44.12 | -0.025284 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132322 | 50RB#0 | NV | 20  | -29.13 | -0.016693 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132322 | 50RB#0 | NV | 30  | -58.08 | -0.033284 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132322 | 50RB#0 | NV | 40  | -9.00  | -0.005158 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132322 | 50RB#0 | NV | 50  | 14.86  | 0.008516  | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132322 | 50RB#0 | NV | -30 | -34.42 | -0.019725 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132322 | 50RB#0 | NV | -20 | -31.56 | -0.018086 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132322 | 50RB#0 | NV | -10 | -44.85 | -0.025702 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132322 | 50RB#0 | NV | 0   | -32.32 | -0.018521 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132322 | 50RB#0 | NV | 10  | -30.13 | -0.017266 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132322 | 50RB#0 | NV | 20  | -47.71 | -0.027341 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132322 | 50RB#0 | NV | 30  | -43.85 | -0.025129 | ±2.5 | PASS |



|        |       |       |        |        |    |     |        |           |      |      |
|--------|-------|-------|--------|--------|----|-----|--------|-----------|------|------|
| Band66 | 10MHz | 16QAM | 132322 | 50RB#0 | NV | 40  | -28.45 | -0.016304 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132322 | 50RB#0 | NV | 50  | -16.62 | -0.009524 | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132622 | 50RB#0 | NV | -30 | 47.95  | 0.027014  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132622 | 50RB#0 | NV | -20 | 34.55  | 0.019465  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132622 | 50RB#0 | NV | -10 | 45.70  | 0.025746  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132622 | 50RB#0 | NV | 0   | 53.52  | 0.030152  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132622 | 50RB#0 | NV | 10  | 32.09  | 0.018079  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132622 | 50RB#0 | NV | 20  | 38.34  | 0.021600  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132622 | 50RB#0 | NV | 30  | 30.74  | 0.017318  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132622 | 50RB#0 | NV | 40  | 39.05  | 0.022000  | ±2.5 | PASS |
| Band66 | 10MHz | QPSK  | 132622 | 50RB#0 | NV | 50  | 40.96  | 0.023076  | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132622 | 50RB#0 | NV | -30 | -4.59  | -0.002586 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132622 | 50RB#0 | NV | -20 | 20.33  | 0.011454  | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132622 | 50RB#0 | NV | -10 | -36.49 | -0.020558 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132622 | 50RB#0 | NV | 0   | -25.36 | -0.014287 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132622 | 50RB#0 | NV | 10  | 19.03  | 0.010721  | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132622 | 50RB#0 | NV | 20  | 17.85  | 0.010056  | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132622 | 50RB#0 | NV | 30  | -6.34  | -0.003572 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132622 | 50RB#0 | NV | 40  | -43.69 | -0.024614 | ±2.5 | PASS |
| Band66 | 10MHz | 16QAM | 132622 | 50RB#0 | NV | 50  | -42.44 | -0.023910 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 75RB#0 | NV | -30 | 38.35  | 0.022329  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 75RB#0 | NV | -20 | 38.12  | 0.022195  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 75RB#0 | NV | -10 | 33.66  | 0.019598  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 75RB#0 | NV | 0   | 27.52  | 0.016023  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 75RB#0 | NV | 10  | 43.42  | 0.025281  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 75RB#0 | NV | 20  | 45.48  | 0.026480  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 75RB#0 | NV | 30  | 46.05  | 0.026812  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 75RB#0 | NV | 40  | -32.62 | -0.018993 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132047 | 75RB#0 | NV | 50  | -6.51  | -0.003790 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 75RB#0 | NV | -30 | -13.85 | -0.008064 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 75RB#0 | NV | -20 | -41.97 | -0.024437 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 75RB#0 | NV | -10 | -9.78  | -0.005694 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 75RB#0 | NV | 0   | -49.52 | -0.028833 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 75RB#0 | NV | 10  | -47.68 | -0.027761 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 75RB#0 | NV | 20  | -47.05 | -0.027394 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 75RB#0 | NV | 30  | -29.27 | -0.017042 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 75RB#0 | NV | 40  | 2.02   | 0.001176  | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132047 | 75RB#0 | NV | 50  | -40.96 | -0.023849 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 75RB#0 | NV | -30 | -46.62 | -0.026716 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 75RB#0 | NV | -20 | -46.68 | -0.026751 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 75RB#0 | NV | -10 | -27.69 | -0.015868 | ±2.5 | PASS |



|        |       |       |        |         |    |     |        |           |      |      |
|--------|-------|-------|--------|---------|----|-----|--------|-----------|------|------|
| Band66 | 15MHz | QPSK  | 132322 | 75RB#0  | NV | 0   | -36.89 | -0.021140 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 75RB#0  | NV | 10  | -42.92 | -0.024596 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 75RB#0  | NV | 20  | -39.98 | -0.022911 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 75RB#0  | NV | 30  | -46.66 | -0.026739 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 75RB#0  | NV | 40  | -44.27 | -0.025370 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132322 | 75RB#0  | NV | 50  | -45.88 | -0.026292 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 75RB#0  | NV | -30 | -49.34 | -0.028275 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 75RB#0  | NV | -20 | -45.33 | -0.025977 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 75RB#0  | NV | -10 | -49.41 | -0.028315 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 75RB#0  | NV | 0   | -35.69 | -0.020453 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 75RB#0  | NV | 10  | -38.18 | -0.021880 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 75RB#0  | NV | 20  | -45.00 | -0.025788 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 75RB#0  | NV | 30  | 31.56  | 0.018086  | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 75RB#0  | NV | 40  | -47.39 | -0.027158 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132322 | 75RB#0  | NV | 50  | -38.04 | -0.021799 | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 75RB#0  | NV | -30 | 38.67  | 0.021817  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 75RB#0  | NV | -20 | 44.03  | 0.024841  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 75RB#0  | NV | -10 | 45.56  | 0.025704  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 75RB#0  | NV | 0   | 21.39  | 0.012068  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 75RB#0  | NV | 10  | 18.75  | 0.010578  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 75RB#0  | NV | 20  | 28.85  | 0.016276  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 75RB#0  | NV | 30  | 20.69  | 0.011673  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 75RB#0  | NV | 40  | 39.34  | 0.022195  | ±2.5 | PASS |
| Band66 | 15MHz | QPSK  | 132597 | 75RB#0  | NV | 50  | 43.60  | 0.024598  | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 75RB#0  | NV | -30 | -38.41 | -0.021670 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 75RB#0  | NV | -20 | 33.02  | 0.018629  | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 75RB#0  | NV | -10 | 23.12  | 0.013044  | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 75RB#0  | NV | 0   | -17.70 | -0.009986 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 75RB#0  | NV | 10  | -46.42 | -0.026189 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 75RB#0  | NV | 20  | -34.40 | -0.019408 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 75RB#0  | NV | 30  | -8.85  | -0.004993 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 75RB#0  | NV | 40  | -35.41 | -0.019977 | ±2.5 | PASS |
| Band66 | 15MHz | 16QAM | 132597 | 75RB#0  | NV | 50  | 18.81  | 0.010612  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 100RB#0 | NV | -30 | 18.57  | 0.010797  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 100RB#0 | NV | -20 | 26.61  | 0.015471  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 100RB#0 | NV | -10 | 44.95  | 0.026134  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 100RB#0 | NV | 0   | 40.28  | 0.023419  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 100RB#0 | NV | 10  | 42.60  | 0.024767  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 100RB#0 | NV | 20  | 31.69  | 0.018424  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 100RB#0 | NV | 30  | 38.74  | 0.022523  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132072 | 100RB#0 | NV | 40  | 15.89  | 0.009238  | ±2.5 | PASS |



|        |       |       |        |         |    |     |        |           |      |      |
|--------|-------|-------|--------|---------|----|-----|--------|-----------|------|------|
| Band66 | 20MHz | QPSK  | 132072 | 100RB#0 | NV | 50  | 47.22  | 0.027453  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 100RB#0 | NV | -30 | -40.68 | -0.023651 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 100RB#0 | NV | -20 | -21.54 | -0.012523 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 100RB#0 | NV | -10 | -38.62 | -0.022453 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 100RB#0 | NV | 0   | -23.95 | -0.013924 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 100RB#0 | NV | 10  | -26.21 | -0.015238 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 100RB#0 | NV | 20  | 21.84  | 0.012698  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 100RB#0 | NV | 30  | 27.62  | 0.016058  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 100RB#0 | NV | 40  | -34.68 | -0.020163 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132072 | 100RB#0 | NV | 50  | -46.71 | -0.027157 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 100RB#0 | NV | -30 | 15.05  | 0.008625  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 100RB#0 | NV | -20 | -25.98 | -0.014888 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 100RB#0 | NV | -10 | -40.94 | -0.023461 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 100RB#0 | NV | 0   | -34.66 | -0.019862 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 100RB#0 | NV | 10  | -41.10 | -0.023553 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 100RB#0 | NV | 20  | -45.46 | -0.026052 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 100RB#0 | NV | 30  | -30.11 | -0.017255 | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 100RB#0 | NV | 40  | 25.29  | 0.014493  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132322 | 100RB#0 | NV | 50  | -30.24 | -0.017330 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 100RB#0 | NV | -30 | -37.16 | -0.021295 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 100RB#0 | NV | -20 | -38.11 | -0.021840 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 100RB#0 | NV | -10 | -38.09 | -0.021828 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 100RB#0 | NV | 0   | -27.44 | -0.015725 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 100RB#0 | NV | 10  | 37.67  | 0.021587  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 100RB#0 | NV | 20  | -46.95 | -0.026905 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 100RB#0 | NV | 30  | -47.94 | -0.027473 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 100RB#0 | NV | 40  | -12.95 | -0.007421 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132322 | 100RB#0 | NV | 50  | 40.87  | 0.023421  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 100RB#0 | NV | -30 | 41.27  | 0.023316  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 100RB#0 | NV | -20 | 45.08  | 0.025469  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 100RB#0 | NV | -10 | 49.01  | 0.027689  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 100RB#0 | NV | 0   | 40.83  | 0.023068  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 100RB#0 | NV | 10  | 41.94  | 0.023695  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 100RB#0 | NV | 20  | 36.69  | 0.020729  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 100RB#0 | NV | 30  | 48.34  | 0.027311  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 100RB#0 | NV | 40  | 34.30  | 0.019379  | ±2.5 | PASS |
| Band66 | 20MHz | QPSK  | 132572 | 100RB#0 | NV | 50  | 31.07  | 0.017554  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 100RB#0 | NV | -30 | -14.16 | -0.008000 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 100RB#0 | NV | -20 | -31.89 | -0.018017 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 100RB#0 | NV | -10 | -11.94 | -0.006746 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 100RB#0 | NV | 0   | 31.99  | 0.018073  | ±2.5 | PASS |



|        |       |       |        |         |    |    |        |           |      |      |
|--------|-------|-------|--------|---------|----|----|--------|-----------|------|------|
| Band66 | 20MHz | 16QAM | 132572 | 100RB#0 | NV | 10 | 21.09  | 0.011915  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 100RB#0 | NV | 20 | 37.68  | 0.021288  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 100RB#0 | NV | 30 | 41.34  | 0.023356  | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 100RB#0 | NV | 40 | -36.96 | -0.020881 | ±2.5 | PASS |
| Band66 | 20MHz | 16QAM | 132572 | 100RB#0 | NV | 50 | -24.78 | -0.014000 | ±2.5 | PASS |

---END---

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn

