

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	0.009~0.15	-67.95	PASS
Band38	5MHz	QPSK	37775	1RB#0	0.15~30	-58.38	PASS
Band38	5MHz	QPSK	37775	1RB#0	30~1000	-66.68	PASS
Band38	5MHz	QPSK	37775	1RB#0	20000~27000	-41.96	PASS
Band38	5MHz	16QAM	37775	1RB#0	0.009~0.15	-69.22	PASS
Band38	5MHz	16QAM	37775	1RB#0	0.15~30	-60.75	PASS
Band38	5MHz	16QAM	37775	1RB#0	30~1000	-66.93	PASS
Band38	5MHz	16QAM	37775	1RB#0	20000~27000	-42.14	PASS
Band38	5MHz	QPSK	38000	1RB#0	0.009~0.15	-67.87	PASS
Band38	5MHz	QPSK	38000	1RB#0	0.15~30	-68.27	PASS
Band38	5MHz	QPSK	38000	1RB#0	30~1000	-62.73	PASS
Band38	5MHz	QPSK	38000	1RB#0	20000~27000	-42.11	PASS
Band38	5MHz	16QAM	38000	1RB#0	0.009~0.15	-68.48	PASS
Band38	5MHz	16QAM	38000	1RB#0	0.15~30	-70.34	PASS
Band38	5MHz	16QAM	38000	1RB#0	30~1000	-64.23	PASS
Band38	5MHz	16QAM	38000	1RB#0	20000~27000	-41.89	PASS
Band38	5MHz	QPSK	38225	1RB#0	0.009~0.15	-69.71	PASS
Band38	5MHz	QPSK	38225	1RB#0	0.15~30	-71.74	PASS
Band38	5MHz	QPSK	38225	1RB#0	30~1000	-63.38	PASS
Band38	5MHz	QPSK	38225	1RB#0	20000~27000	-42.20	PASS
Band38	5MHz	16QAM	38225	1RB#0	0.009~0.15	-66.23	PASS
Band38	5MHz	16QAM	38225	1RB#0	0.15~30	-70.03	PASS
Band38	5MHz	16QAM	38225	1RB#0	30~1000	-63.94	PASS
Band38	5MHz	16QAM	38225	1RB#0	20000~27000	-42.05	PASS
Band38	10MHz	QPSK	37800	1RB#0	0.009~0.15	-65.96	PASS
Band38	10MHz	QPSK	37800	1RB#0	0.15~30	-58.04	PASS
Band38	10MHz	QPSK	37800	1RB#0	30~1000	-66.84	PASS
Band38	10MHz	QPSK	37800	1RB#0	20000~27000	-42.30	PASS
Band38	10MHz	16QAM	37800	1RB#0	0.009~0.15	-69.35	PASS
Band38	10MHz	16QAM	37800	1RB#0	0.15~30	-60.05	PASS
Band38	10MHz	16QAM	37800	1RB#0	30~1000	-66.85	PASS
Band38	10MHz	16QAM	37800	1RB#0	20000~27000	-42.29	PASS
Band38	10MHz	QPSK	38000	1RB#0	0.009~0.15	-69.67	PASS
Band38	10MHz	QPSK	38000	1RB#0	0.15~30	-58.98	PASS
Band38	10MHz	QPSK	38000	1RB#0	30~1000	-66.78	PASS
Band38	10MHz	QPSK	38000	1RB#0	20000~27000	-42.21	PASS
Band38	10MHz	16QAM	38000	1RB#0	0.009~0.15	-67.30	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	10MHz	16QAM	38000	1RB#0	0.15~30	-60.33	PASS
Band38	10MHz	16QAM	38000	1RB#0	30~1000	-66.81	PASS
Band38	10MHz	16QAM	38000	1RB#0	20000~27000	-42.08	PASS
Band38	10MHz	QPSK	38200	1RB#0	0.009~0.15	-67.94	PASS
Band38	10MHz	QPSK	38200	1RB#0	0.15~30	-68.54	PASS
Band38	10MHz	QPSK	38200	1RB#0	30~1000	-63.02	PASS
Band38	10MHz	QPSK	38200	1RB#0	20000~27000	-42.18	PASS
Band38	10MHz	16QAM	38200	1RB#0	0.009~0.15	-68.56	PASS
Band38	10MHz	16QAM	38200	1RB#0	0.15~30	-70.19	PASS
Band38	10MHz	16QAM	38200	1RB#0	30~1000	-64.94	PASS
Band38	10MHz	16QAM	38200	1RB#0	20000~27000	-42.13	PASS
Band38	15MHz	QPSK	37825	1RB#0	0.009~0.15	-69.99	PASS
Band38	15MHz	QPSK	37825	1RB#0	0.15~30	-60.30	PASS
Band38	15MHz	QPSK	37825	1RB#0	30~1000	-66.80	PASS
Band38	15MHz	QPSK	37825	1RB#0	20000~27000	-42.26	PASS
Band38	15MHz	16QAM	37825	1RB#0	0.009~0.15	-68.26	PASS
Band38	15MHz	16QAM	37825	1RB#0	0.15~30	-62.35	PASS
Band38	15MHz	16QAM	37825	1RB#0	30~1000	-66.68	PASS
Band38	15MHz	16QAM	37825	1RB#0	20000~27000	-42.00	PASS
Band38	15MHz	QPSK	38000	1RB#0	0.009~0.15	-67.56	PASS
Band38	15MHz	QPSK	38000	1RB#0	0.15~30	-58.44	PASS
Band38	15MHz	QPSK	38000	1RB#0	30~1000	-66.79	PASS
Band38	15MHz	QPSK	38000	1RB#0	20000~27000	-42.24	PASS
Band38	15MHz	16QAM	38000	1RB#0	0.009~0.15	-67.66	PASS
Band38	15MHz	16QAM	38000	1RB#0	0.15~30	-59.63	PASS
Band38	15MHz	16QAM	38000	1RB#0	30~1000	-66.73	PASS
Band38	15MHz	16QAM	38000	1RB#0	20000~27000	-41.90	PASS
Band38	15MHz	QPSK	38175	1RB#0	0.009~0.15	-68.30	PASS
Band38	15MHz	QPSK	38175	1RB#0	0.15~30	-69.71	PASS
Band38	15MHz	QPSK	38175	1RB#0	30~1000	-63.26	PASS
Band38	15MHz	QPSK	38175	1RB#0	20000~27000	-41.96	PASS
Band38	15MHz	16QAM	38175	1RB#0	0.009~0.15	-68.60	PASS
Band38	15MHz	16QAM	38175	1RB#0	0.15~30	-66.02	PASS
Band38	15MHz	16QAM	38175	1RB#0	30~1000	-64.65	PASS
Band38	15MHz	16QAM	38175	1RB#0	20000~27000	-42.02	PASS
Band38	20MHz	QPSK	37850	1RB#0	0.009~0.15	-68.49	PASS
Band38	20MHz	QPSK	37850	1RB#0	0.15~30	-58.83	PASS
Band38	20MHz	QPSK	37850	1RB#0	30~1000	-66.72	PASS
Band38	20MHz	QPSK	37850	1RB#0	20000~27000	-42.49	PASS
Band38	20MHz	16QAM	37850	1RB#0	0.009~0.15	-68.86	PASS
Band38	20MHz	16QAM	37850	1RB#0	0.15~30	-60.60	PASS
Band38	20MHz	16QAM	37850	1RB#0	30~1000	-66.36	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	20MHz	16QAM	37850	1RB#0	20000~27000	-42.39	PASS
Band38	20MHz	QPSK	38000	1RB#0	0.009~0.15	-70.94	PASS
Band38	20MHz	QPSK	38000	1RB#0	0.15~30	-57.68	PASS
Band38	20MHz	QPSK	38000	1RB#0	30~1000	-66.69	PASS
Band38	20MHz	QPSK	38000	1RB#0	20000~27000	-41.99	PASS
Band38	20MHz	16QAM	38000	1RB#0	0.009~0.15	-68.37	PASS
Band38	20MHz	16QAM	38000	1RB#0	0.15~30	-59.52	PASS
Band38	20MHz	16QAM	38000	1RB#0	30~1000	-66.89	PASS
Band38	20MHz	16QAM	38000	1RB#0	20000~27000	-42.05	PASS
Band38	20MHz	QPSK	38150	1RB#0	0.009~0.15	-67.21	PASS
Band38	20MHz	QPSK	38150	1RB#0	0.15~30	-71.14	PASS
Band38	20MHz	QPSK	38150	1RB#0	30~1000	-62.53	PASS
Band38	20MHz	QPSK	38150	1RB#0	20000~27000	-42.08	PASS
Band38	20MHz	16QAM	38150	1RB#0	0.009~0.15	-68.04	PASS
Band38	20MHz	16QAM	38150	1RB#0	0.15~30	-72.10	PASS
Band38	20MHz	16QAM	38150	1RB#0	30~1000	-64.19	PASS
Band38	20MHz	16QAM	38150	1RB#0	20000~27000	-41.81	PASS

Test Graphs

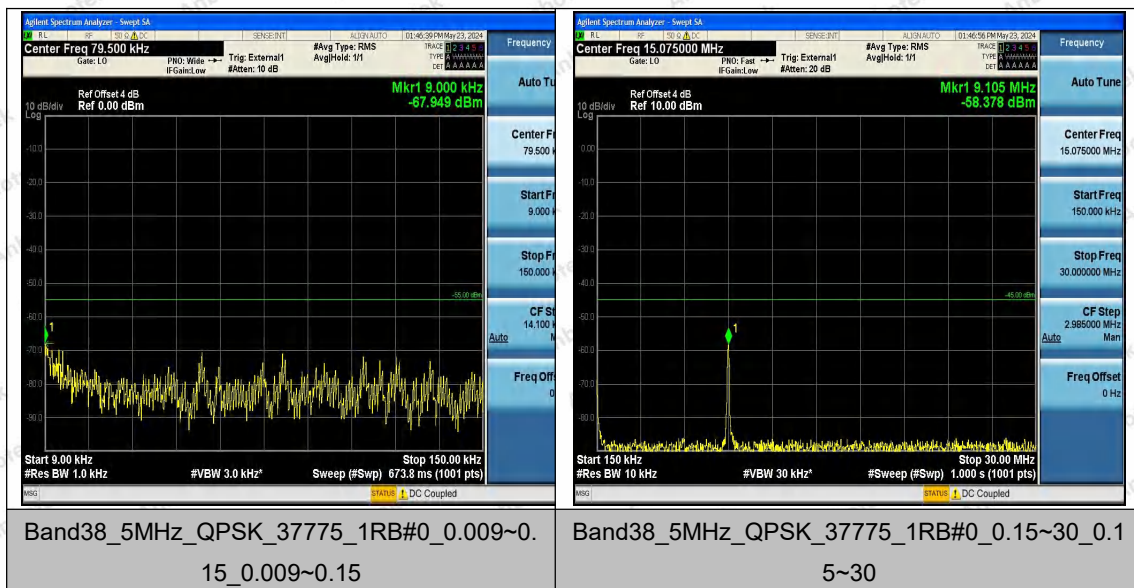


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



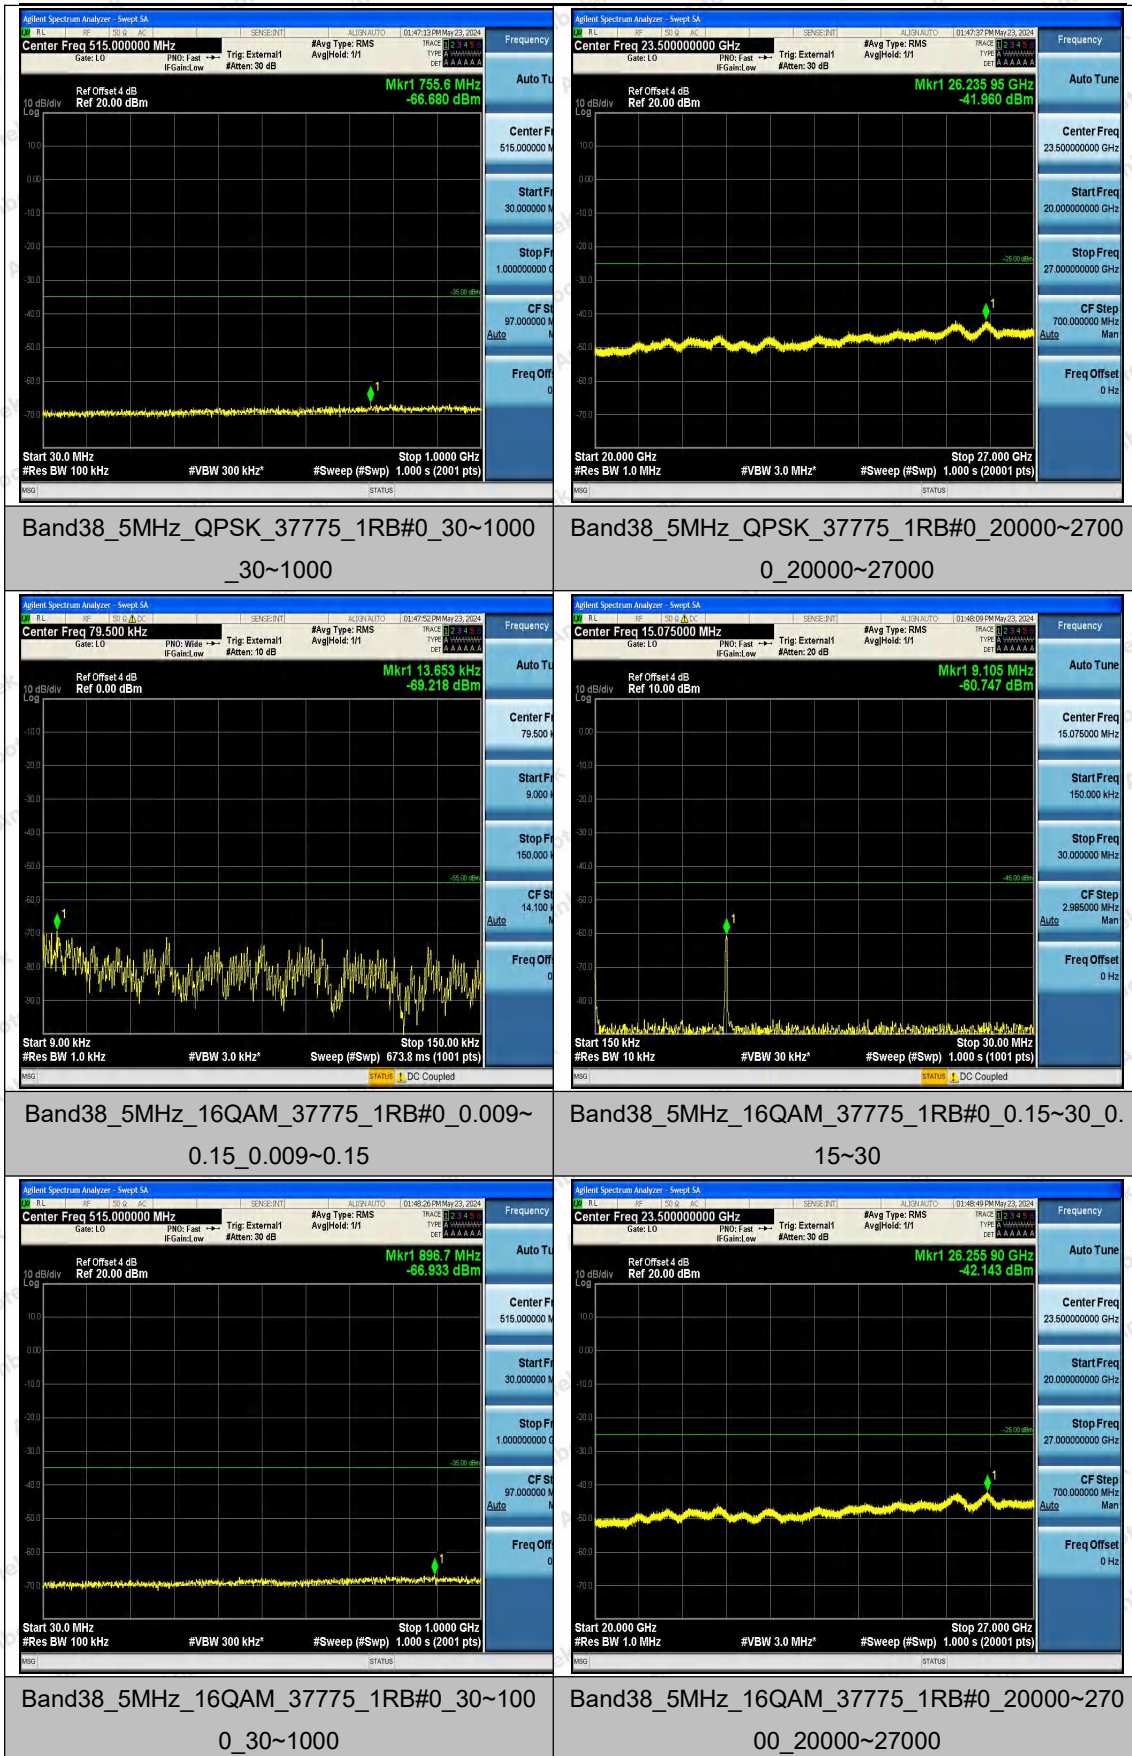


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



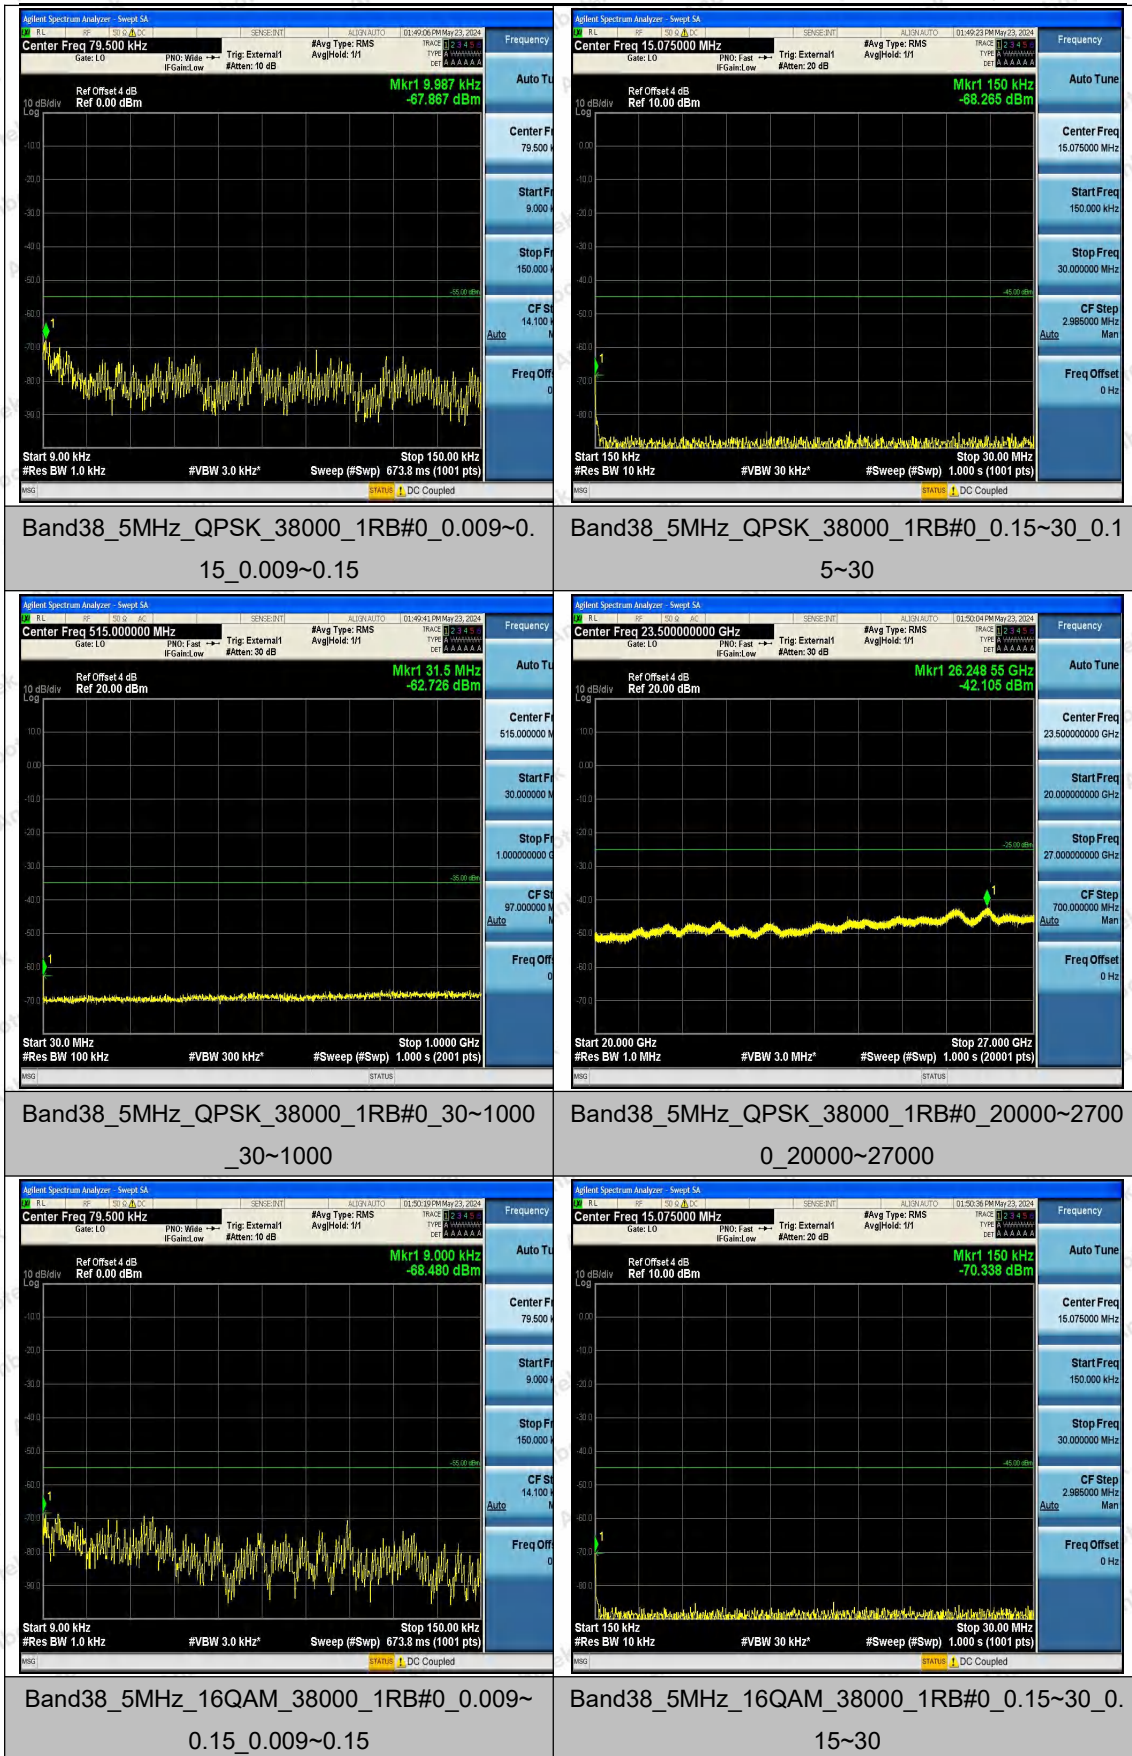


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



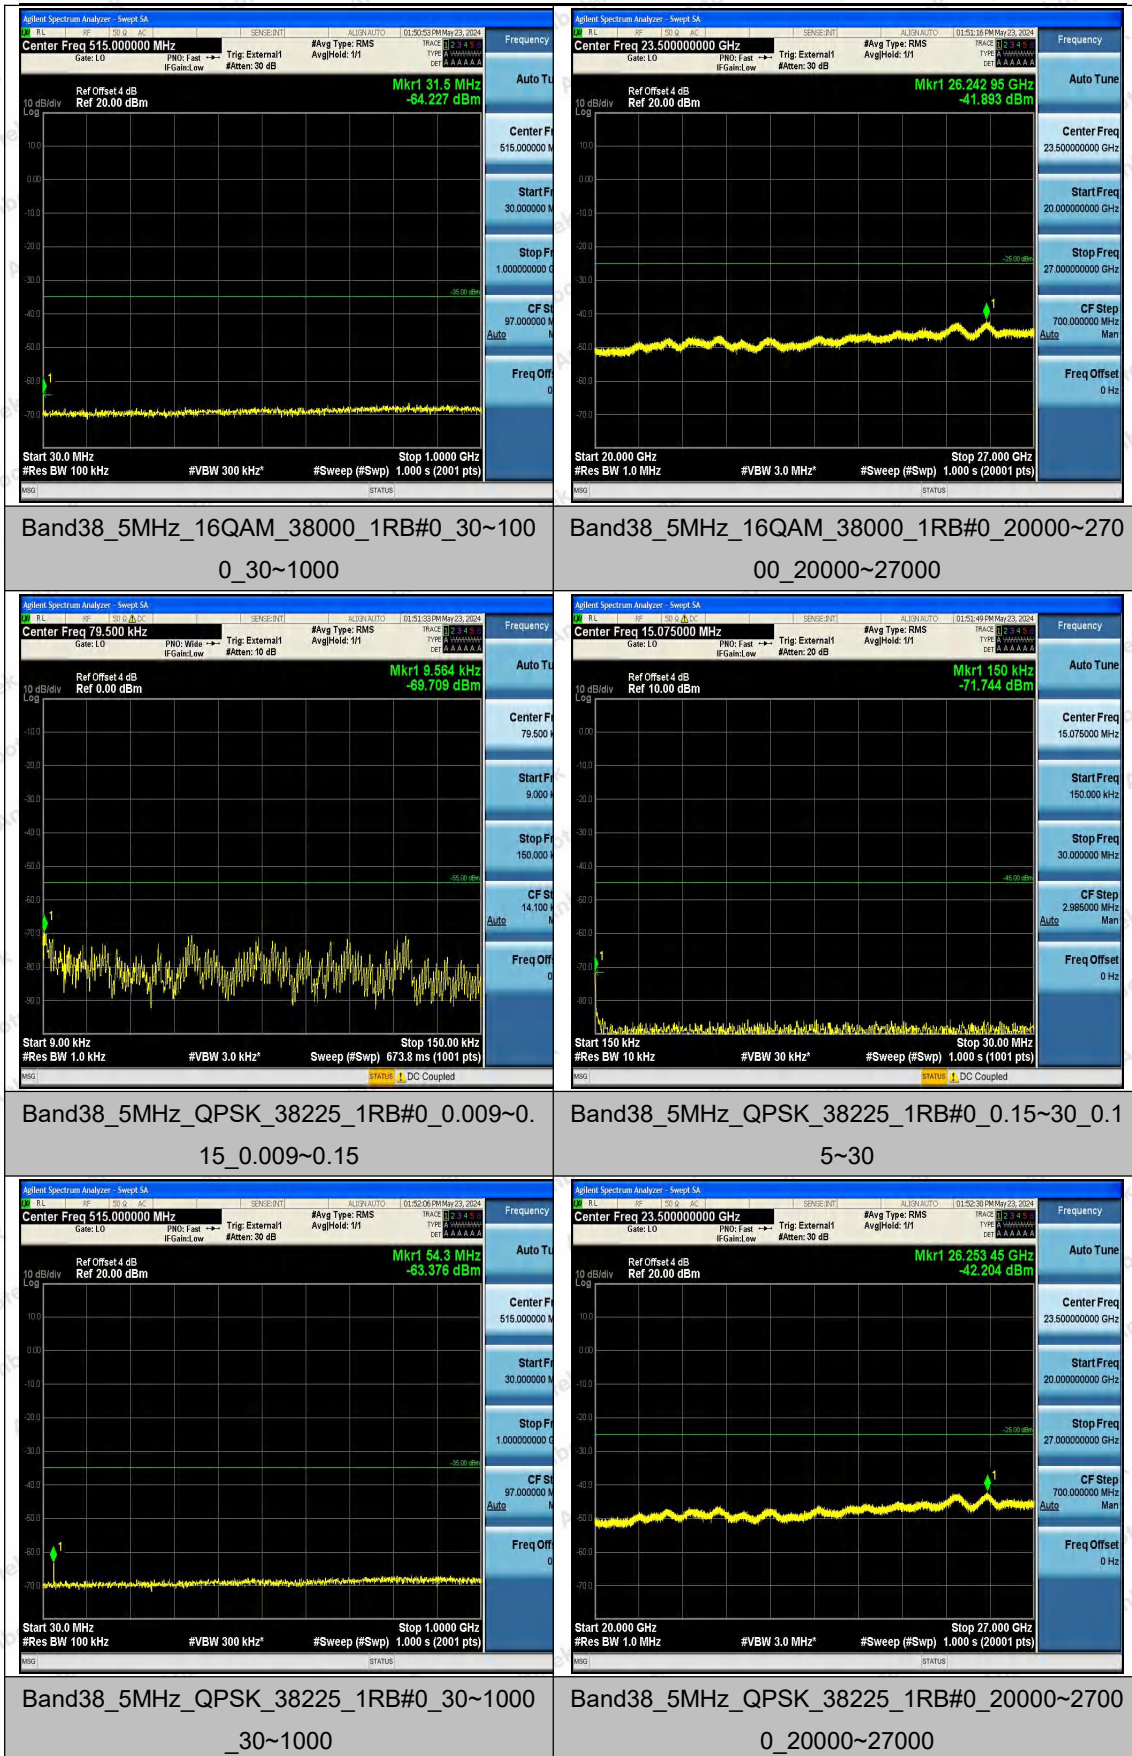


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



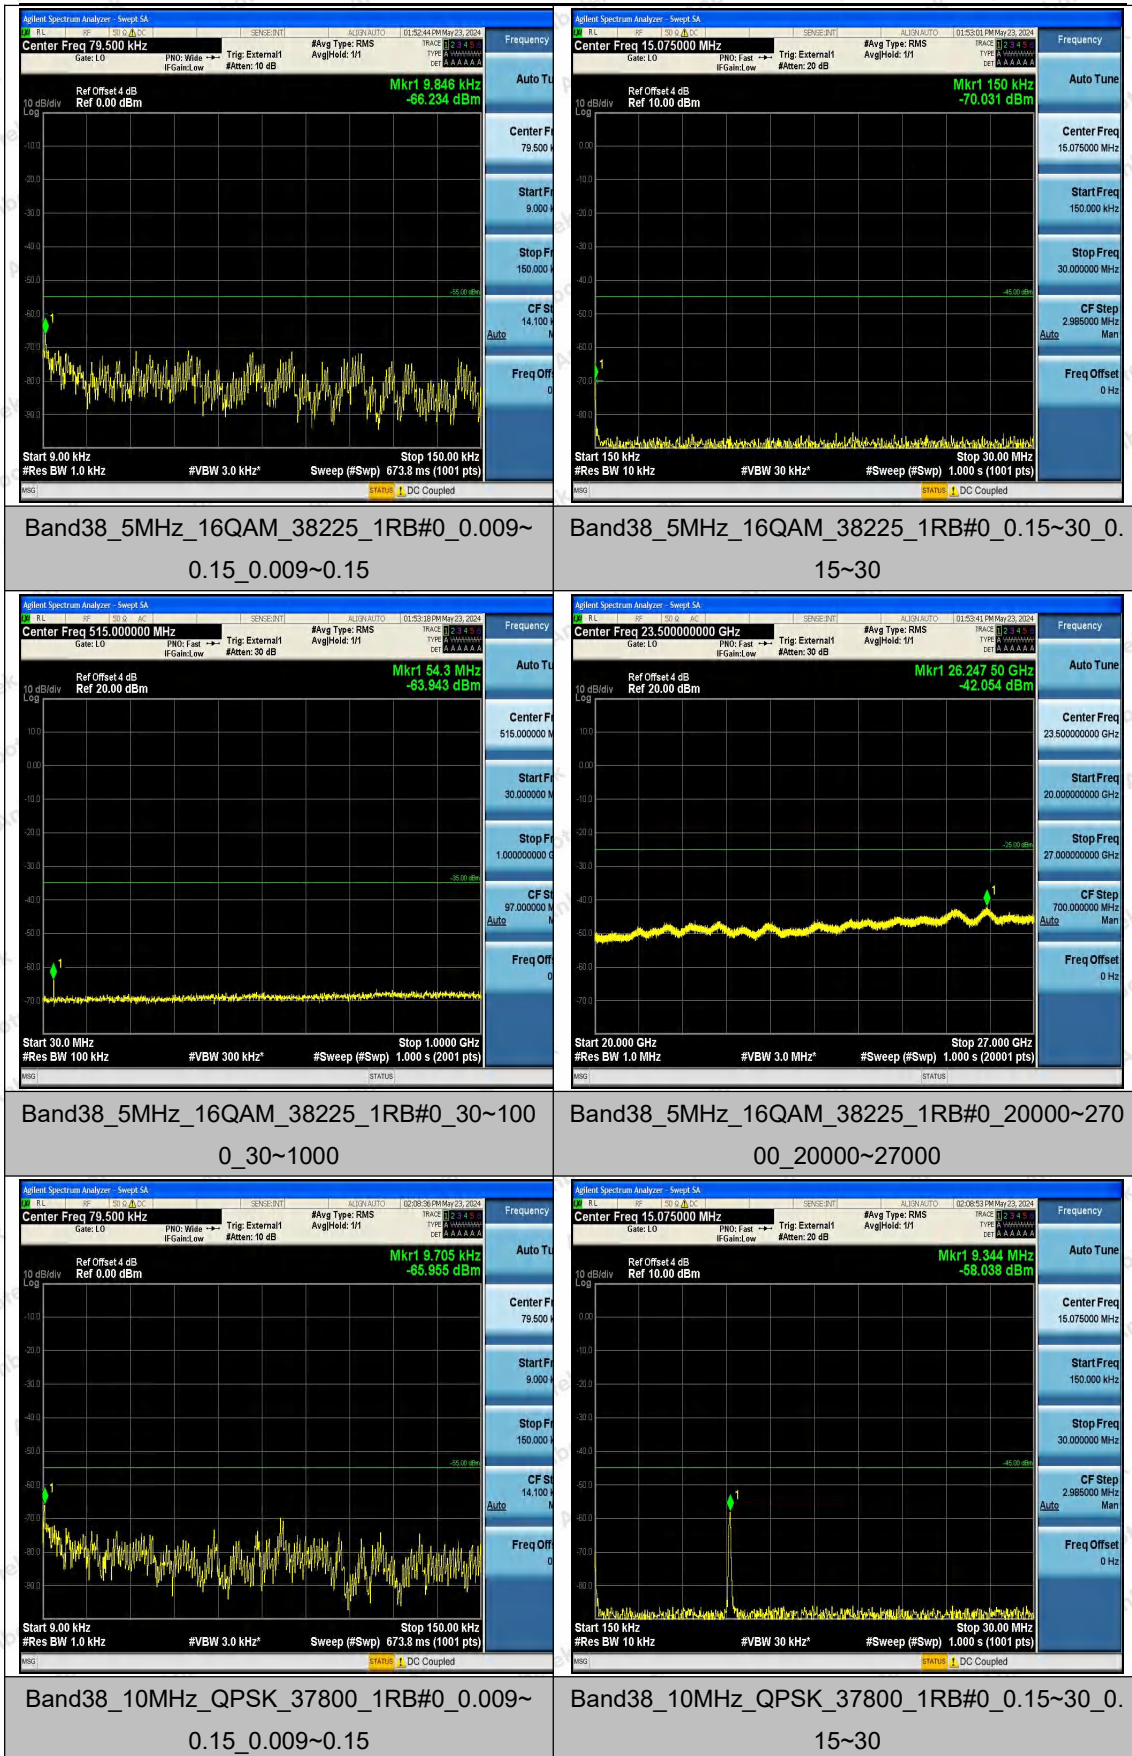


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



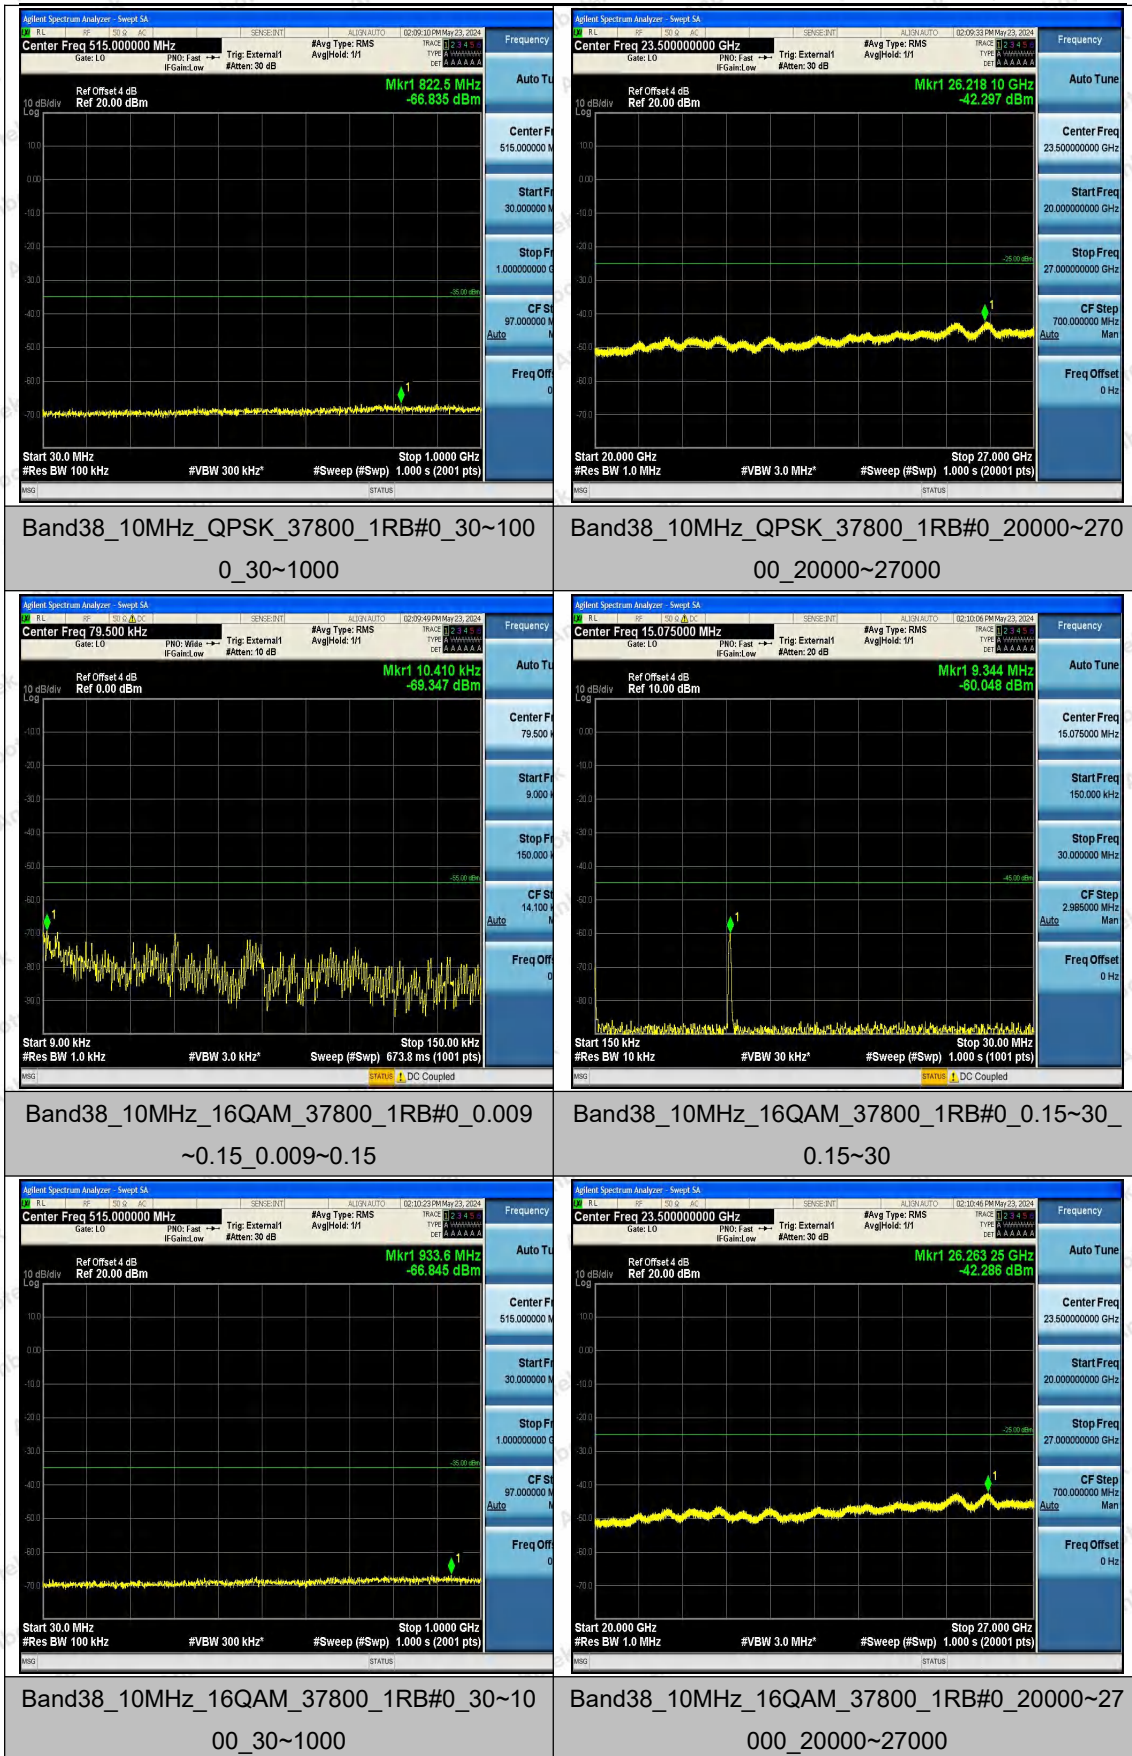


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



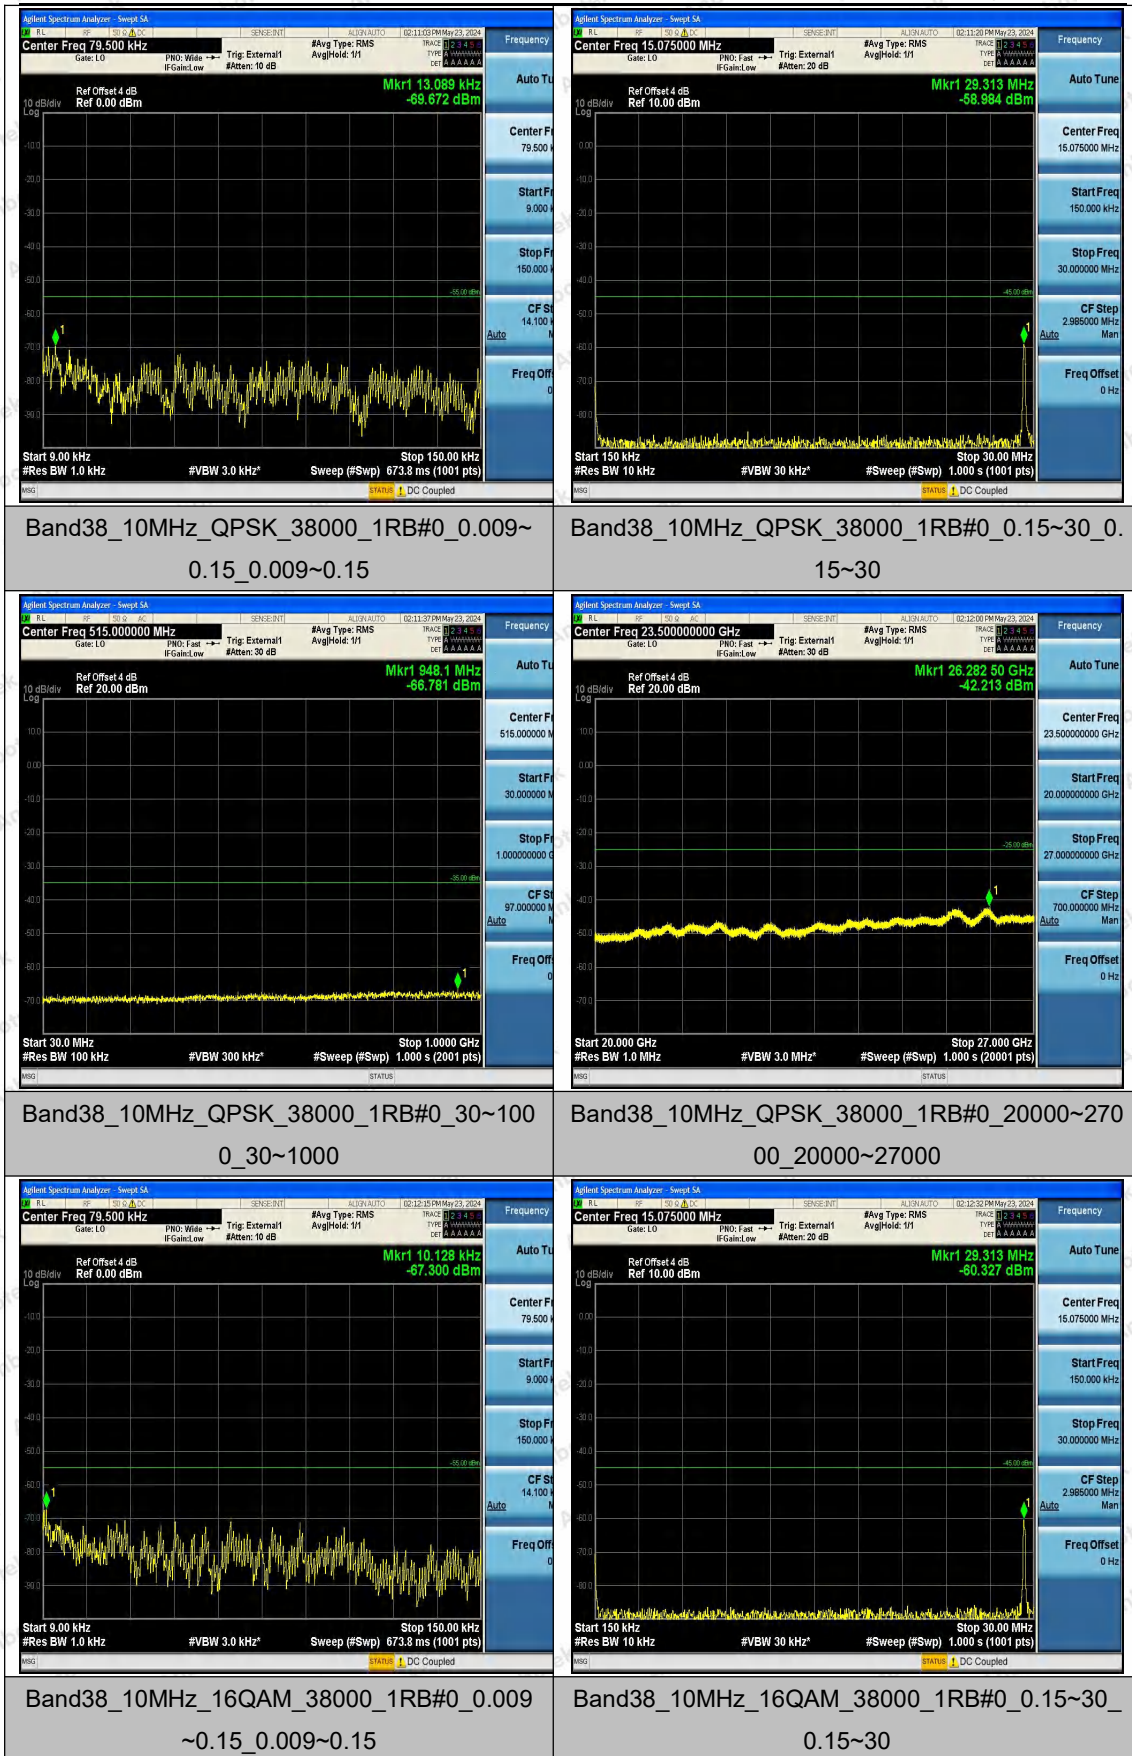


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



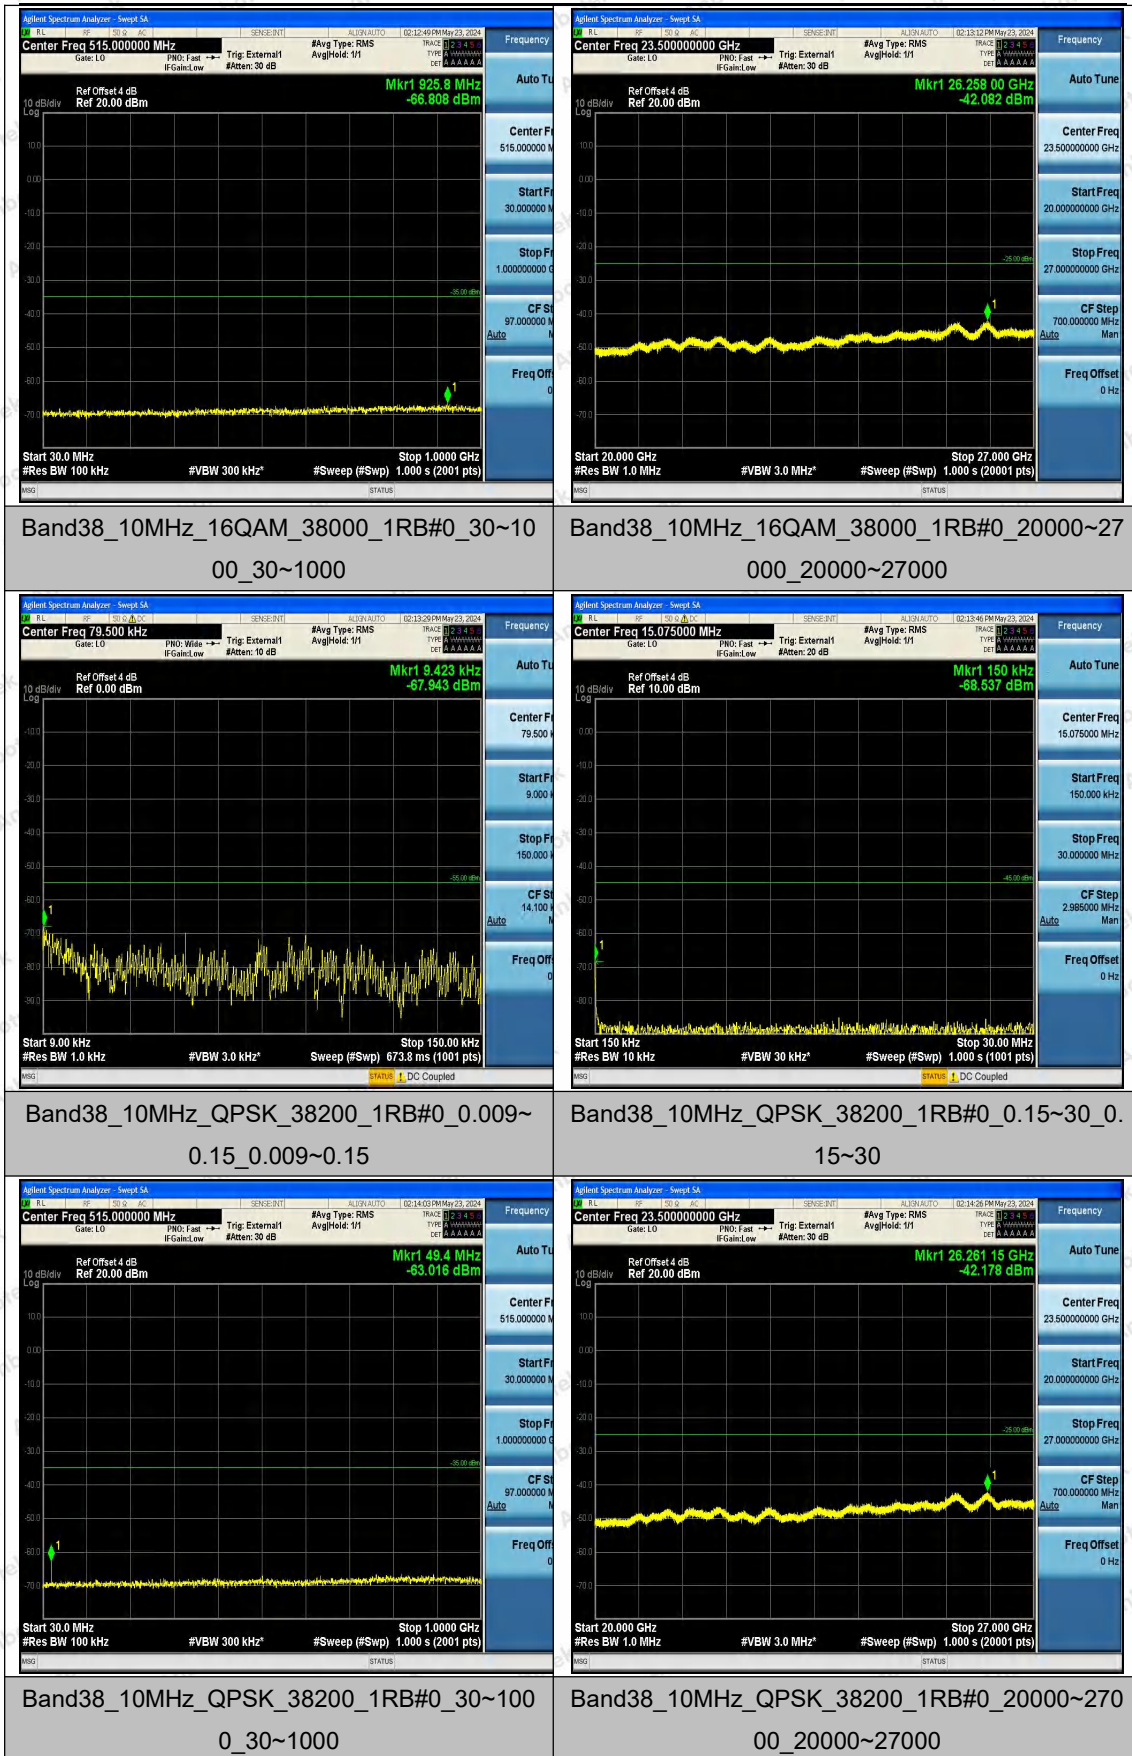


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



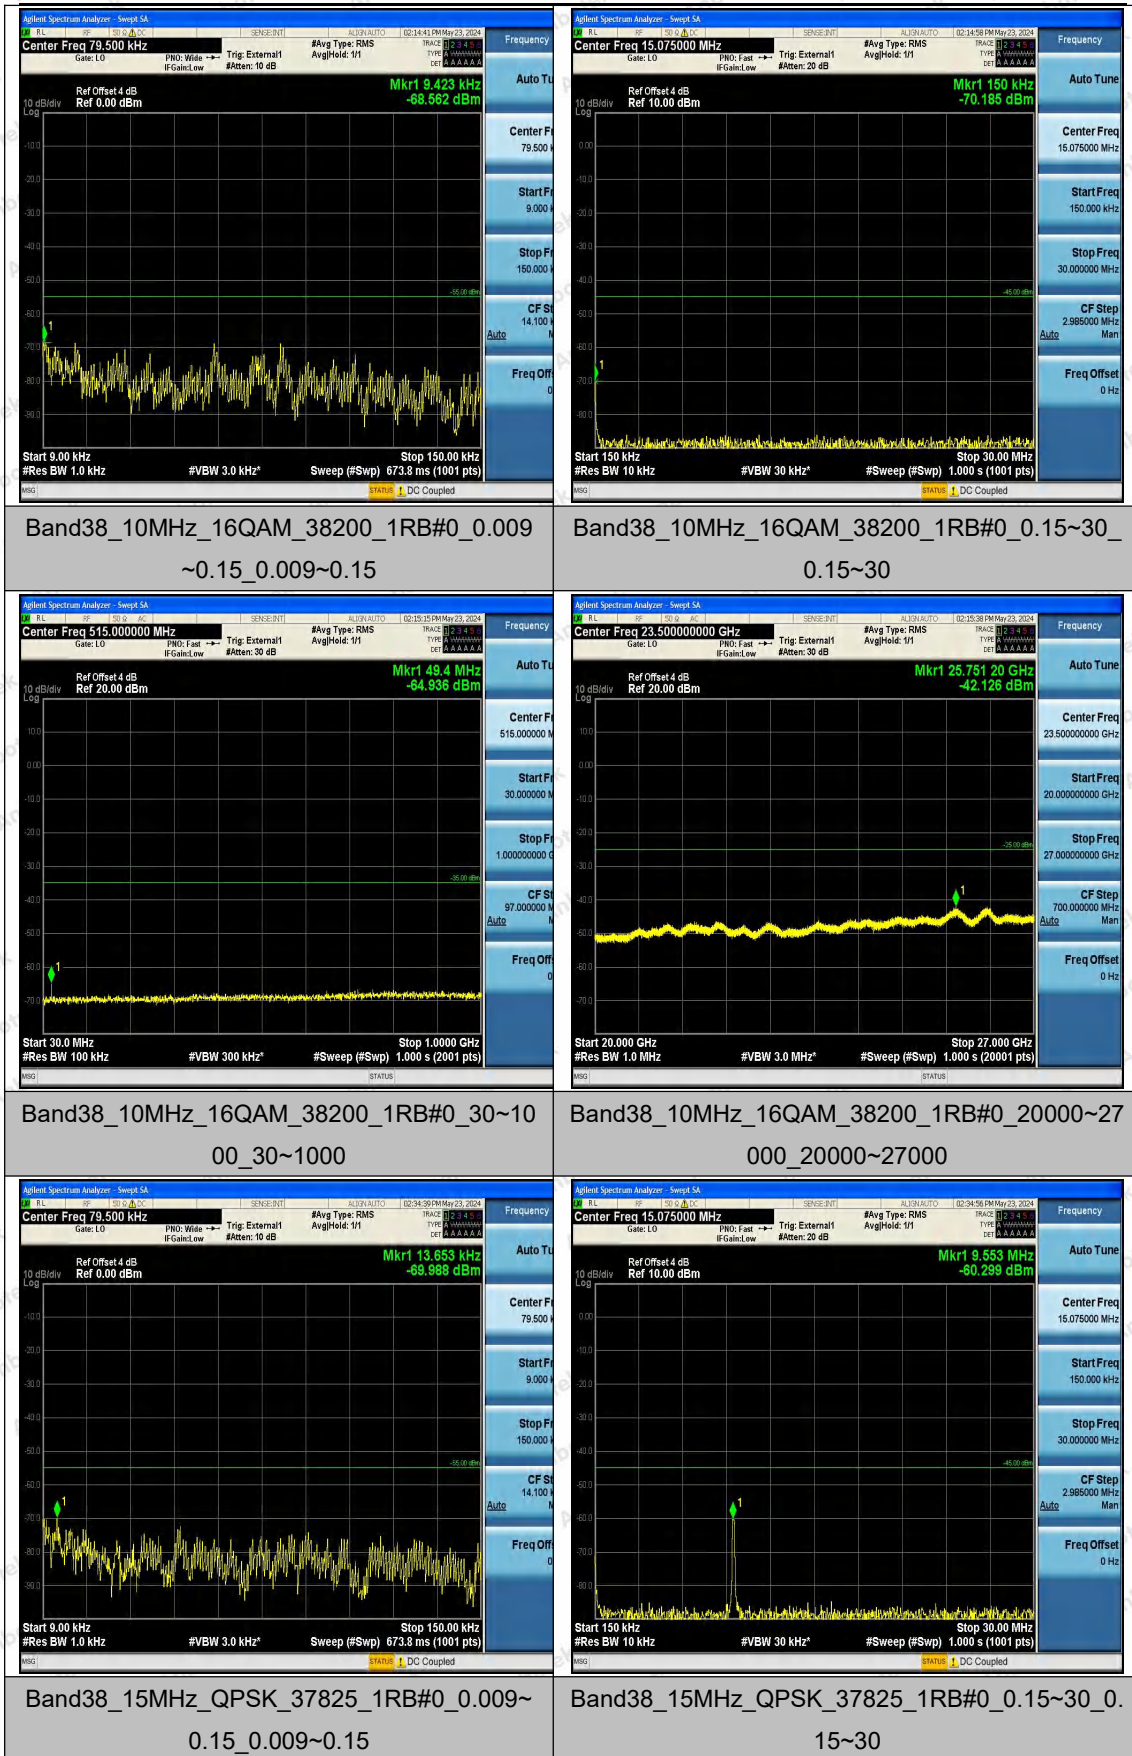


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



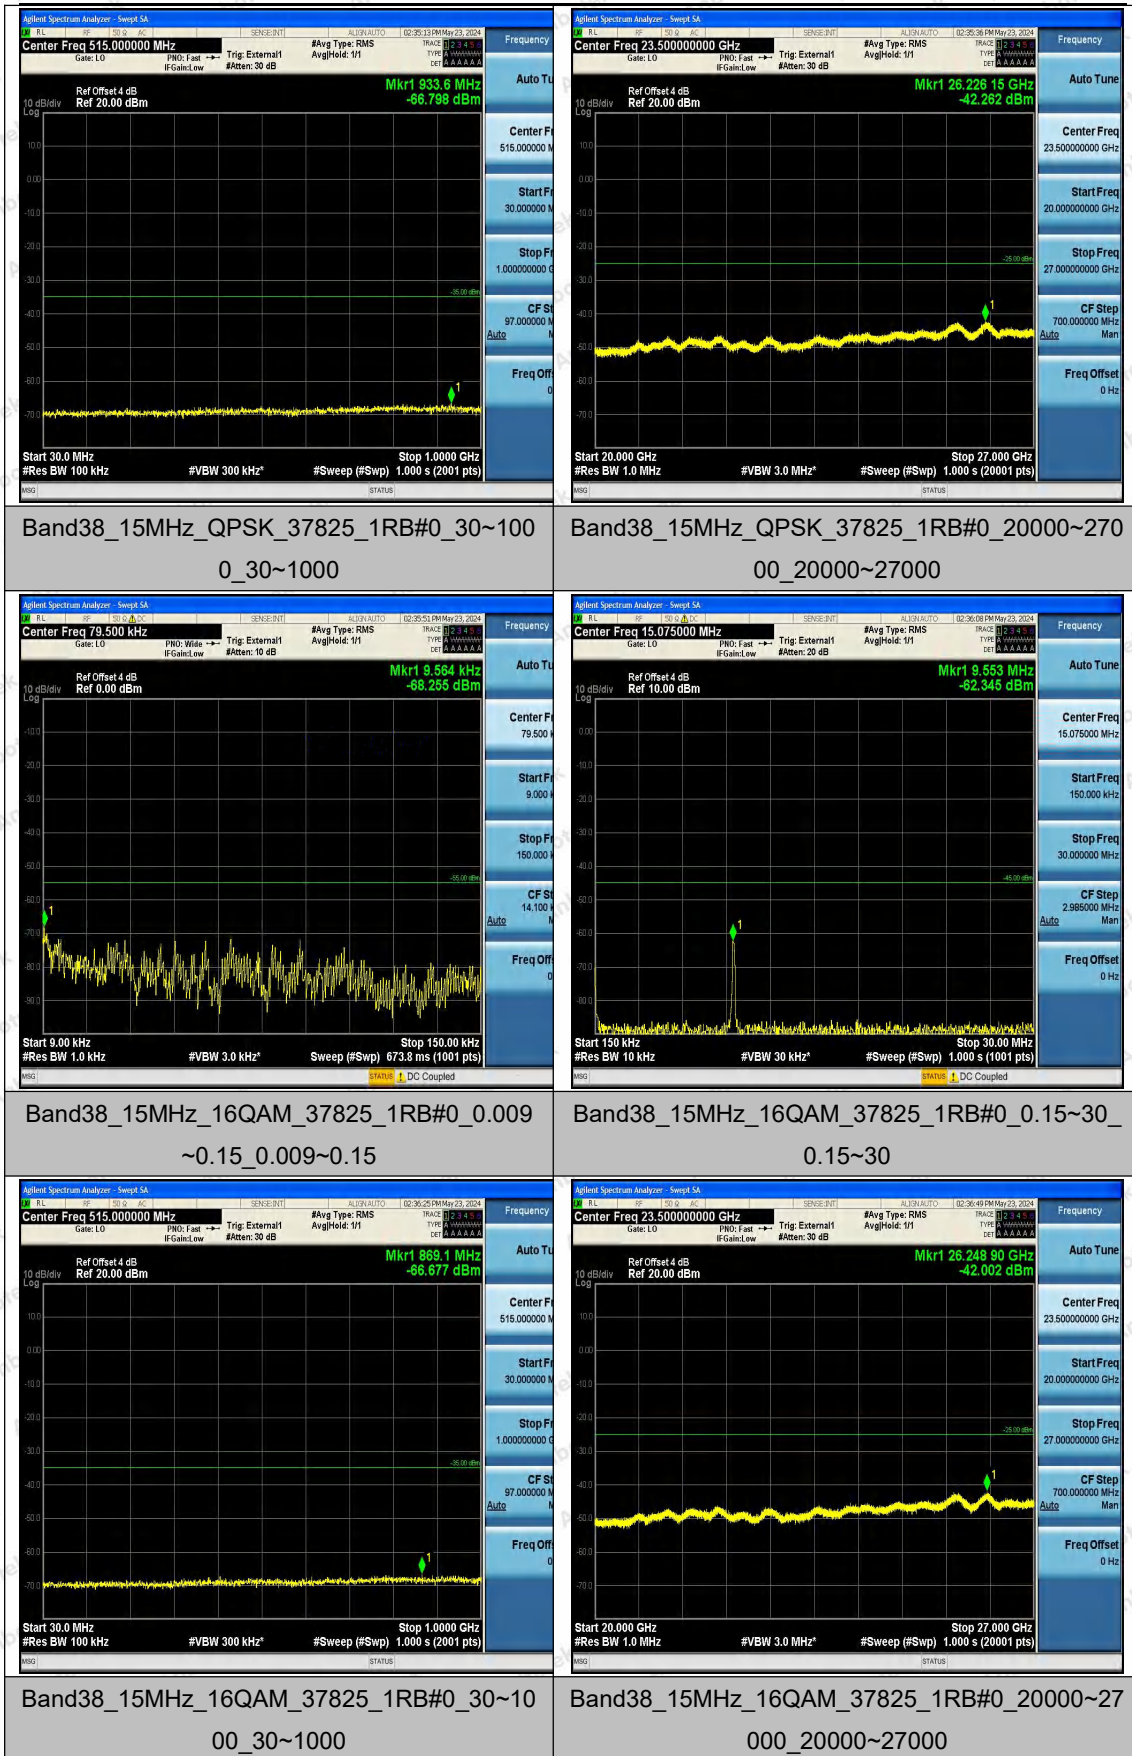


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



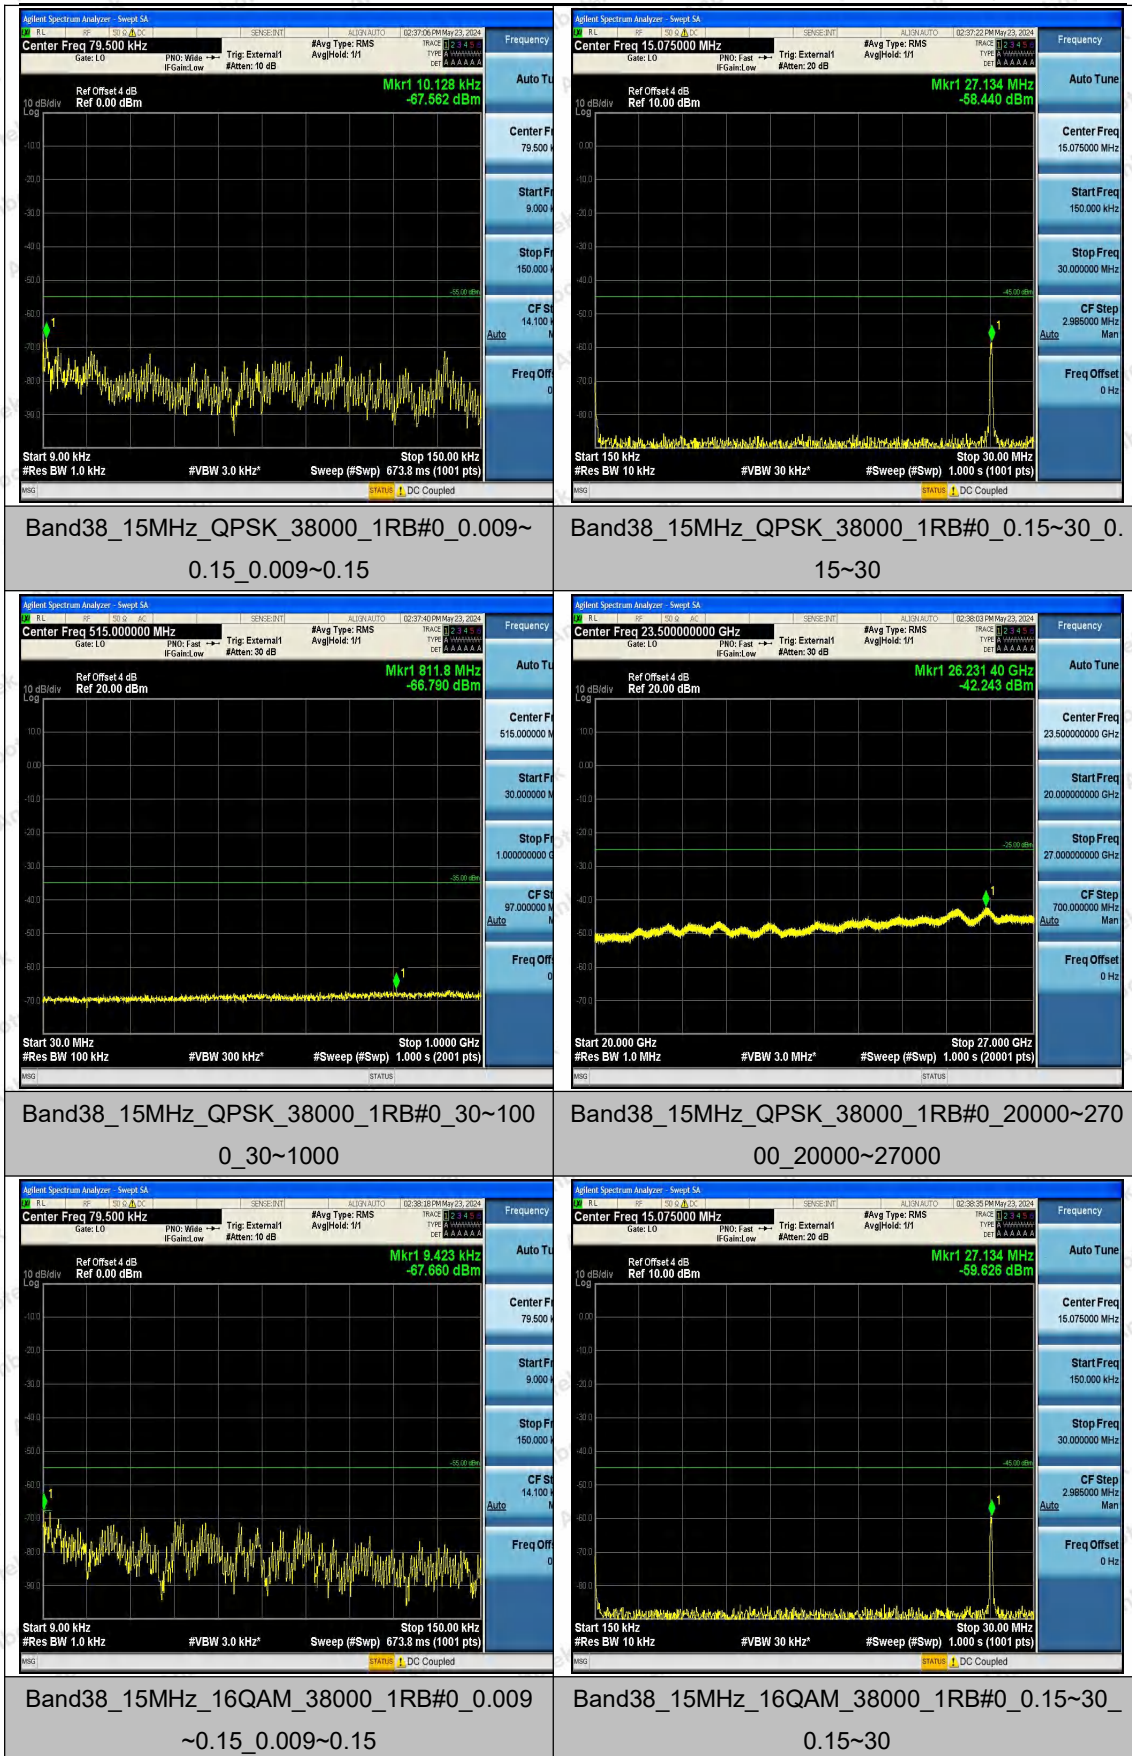

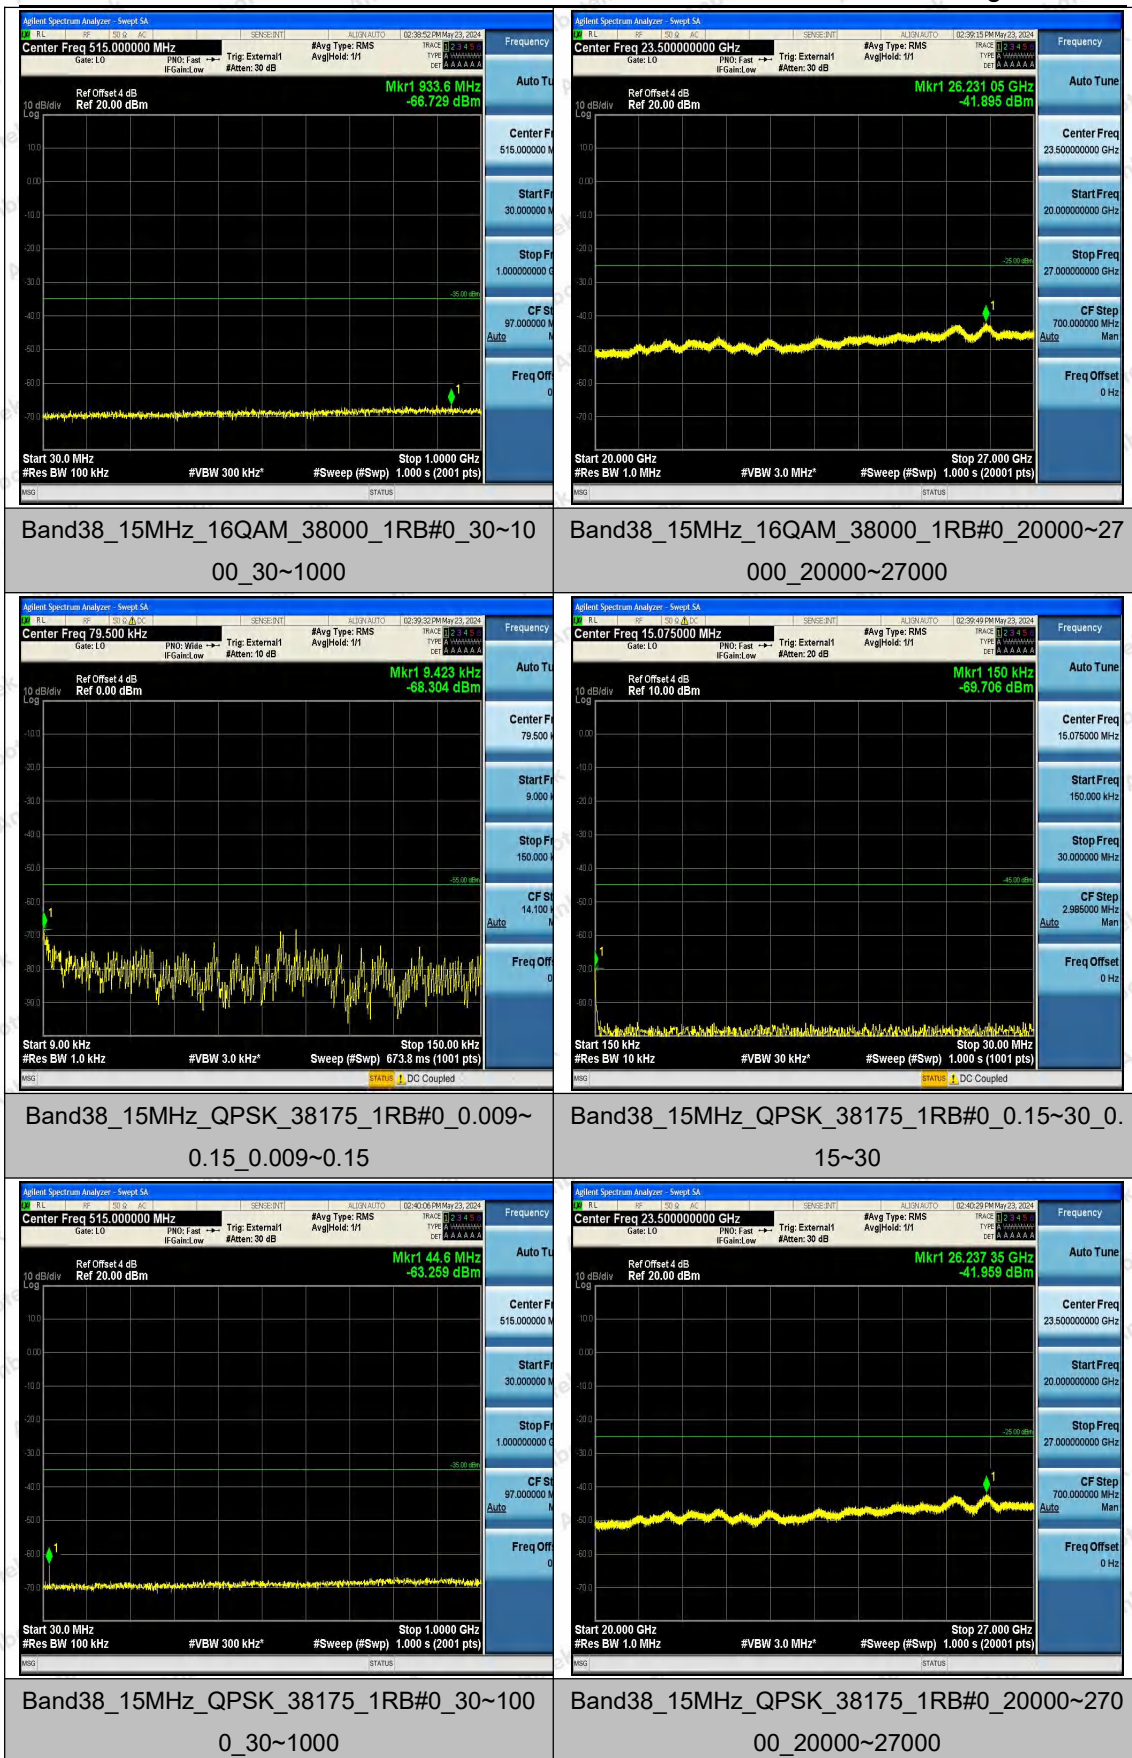


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



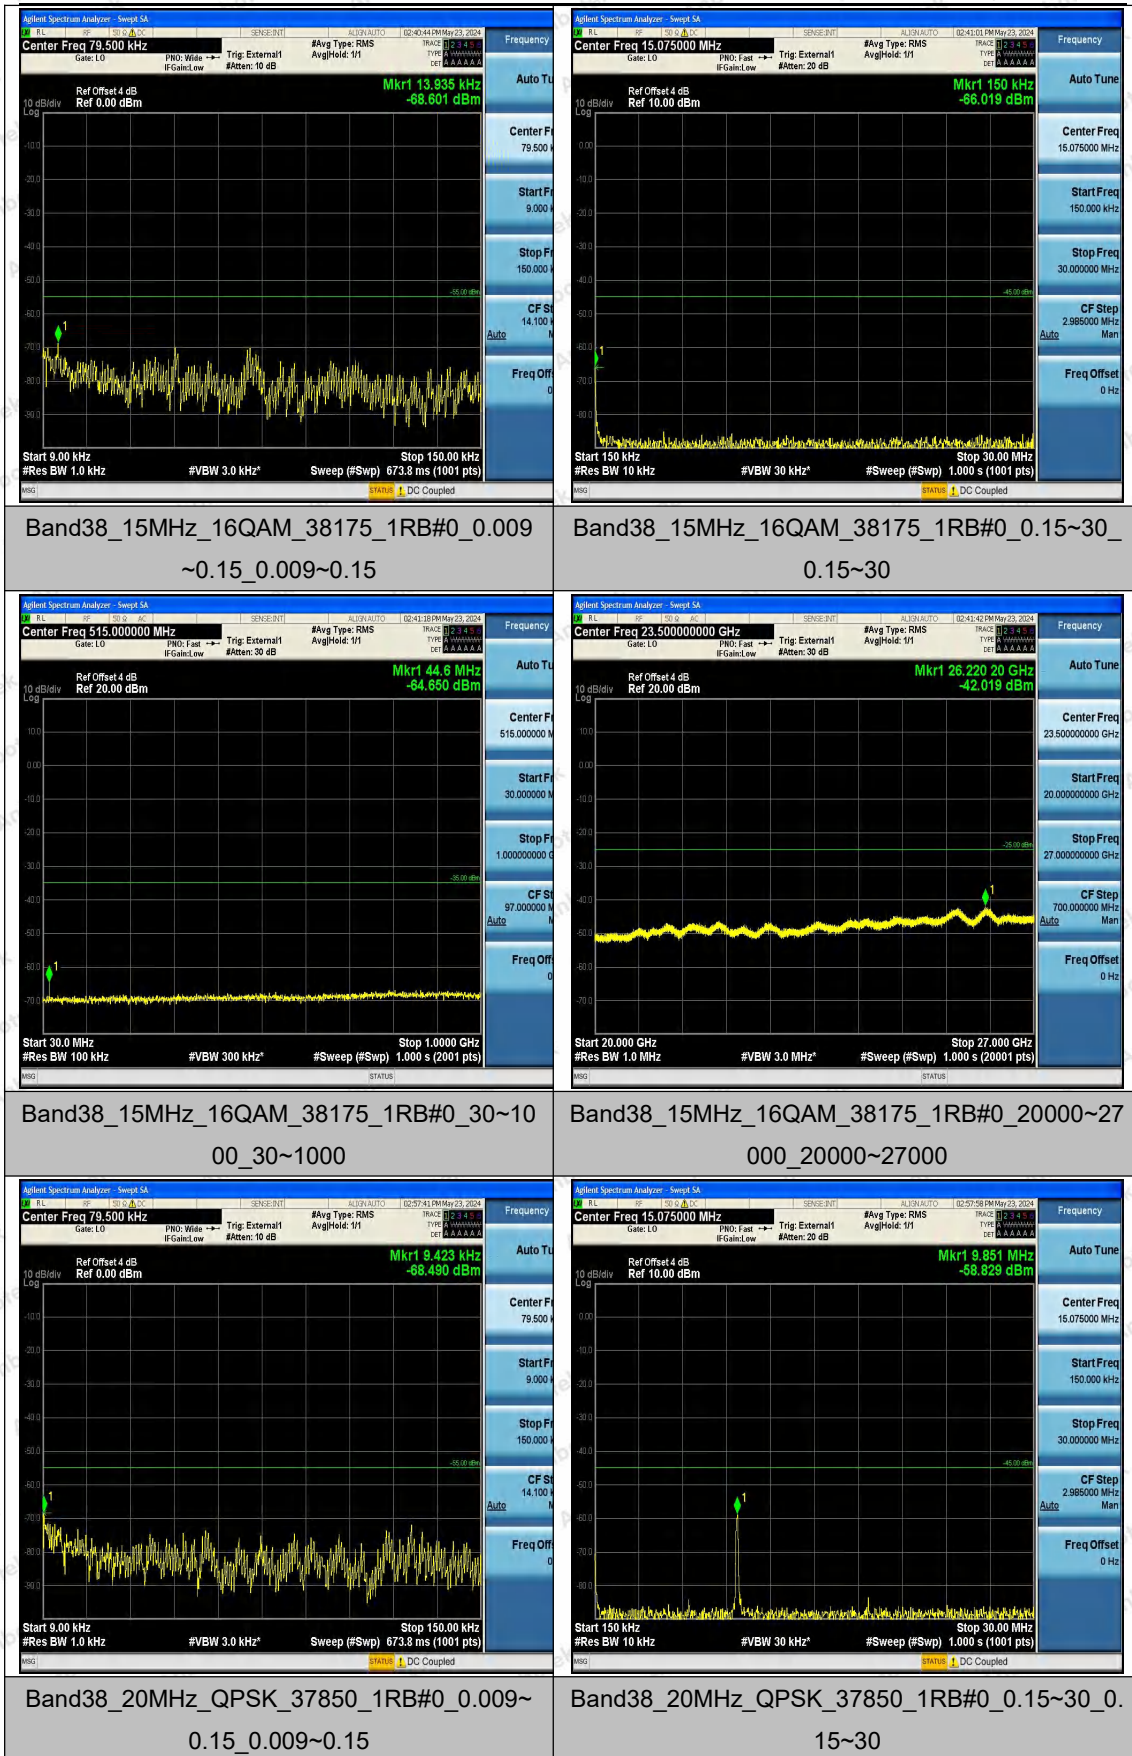


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



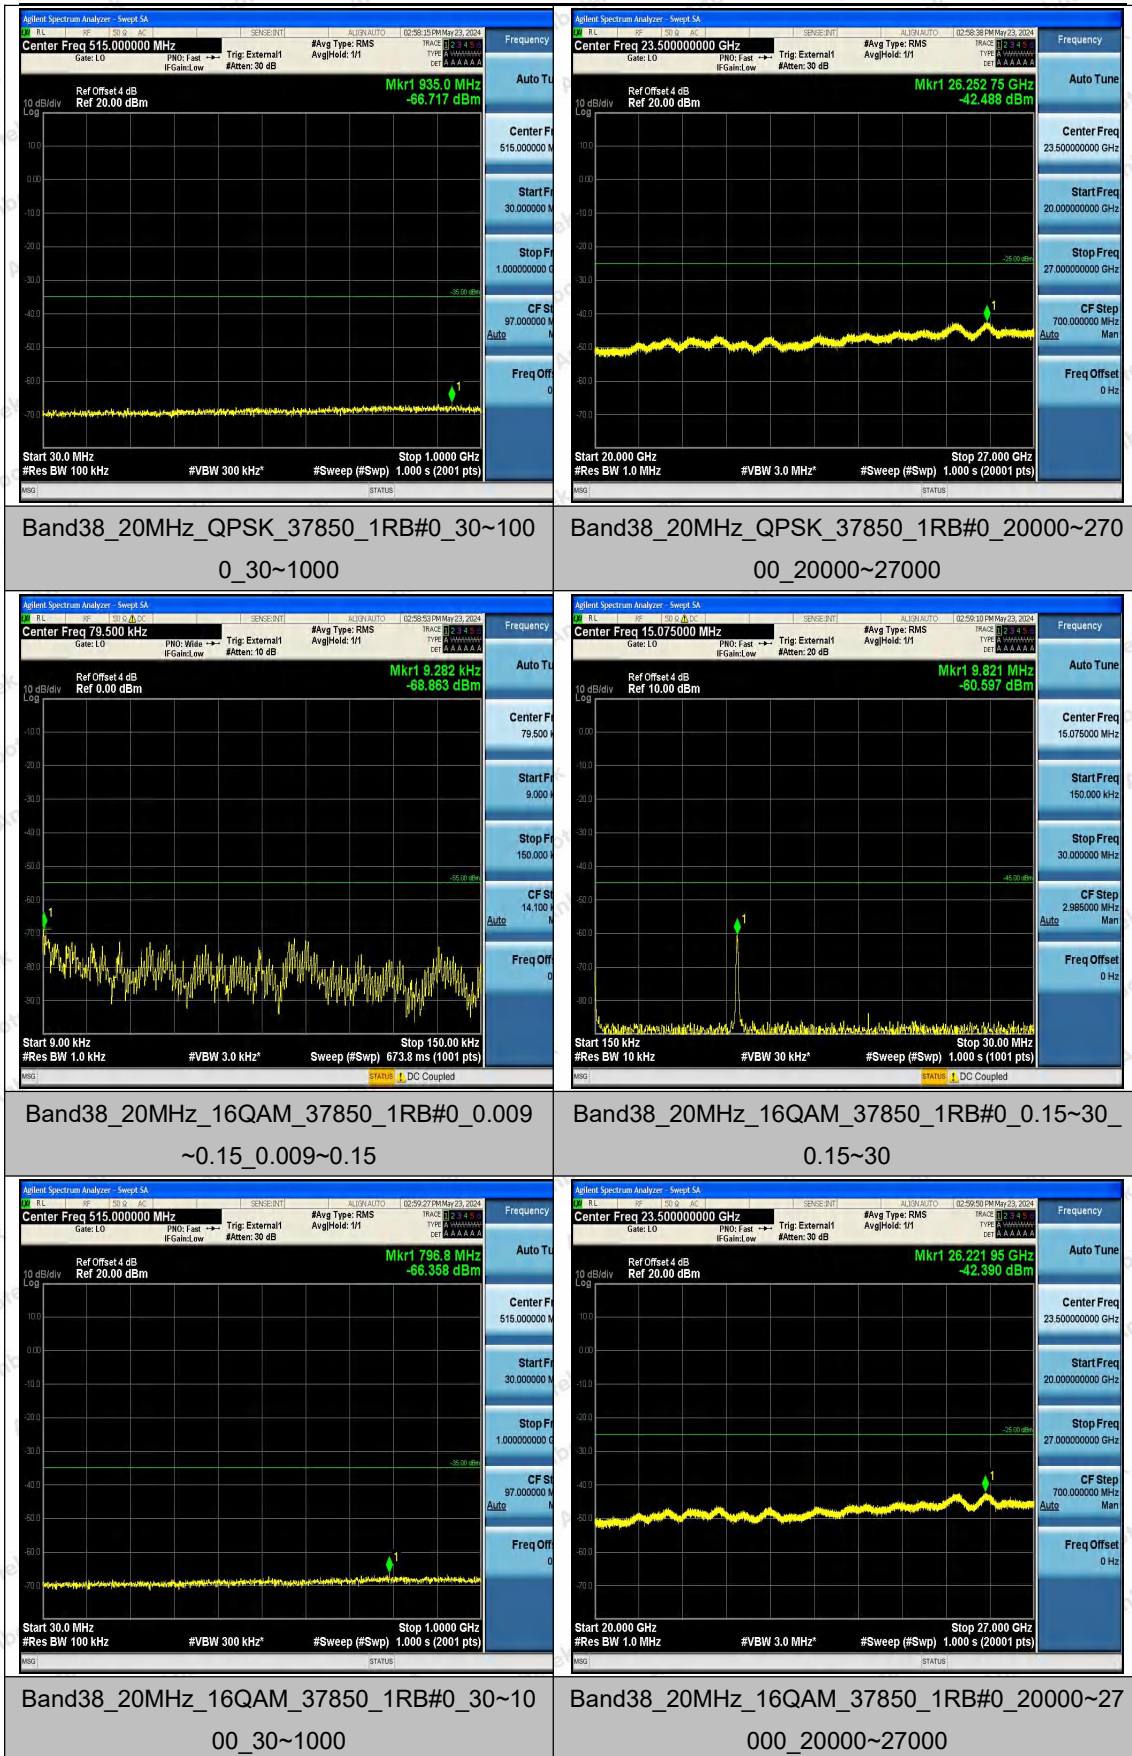

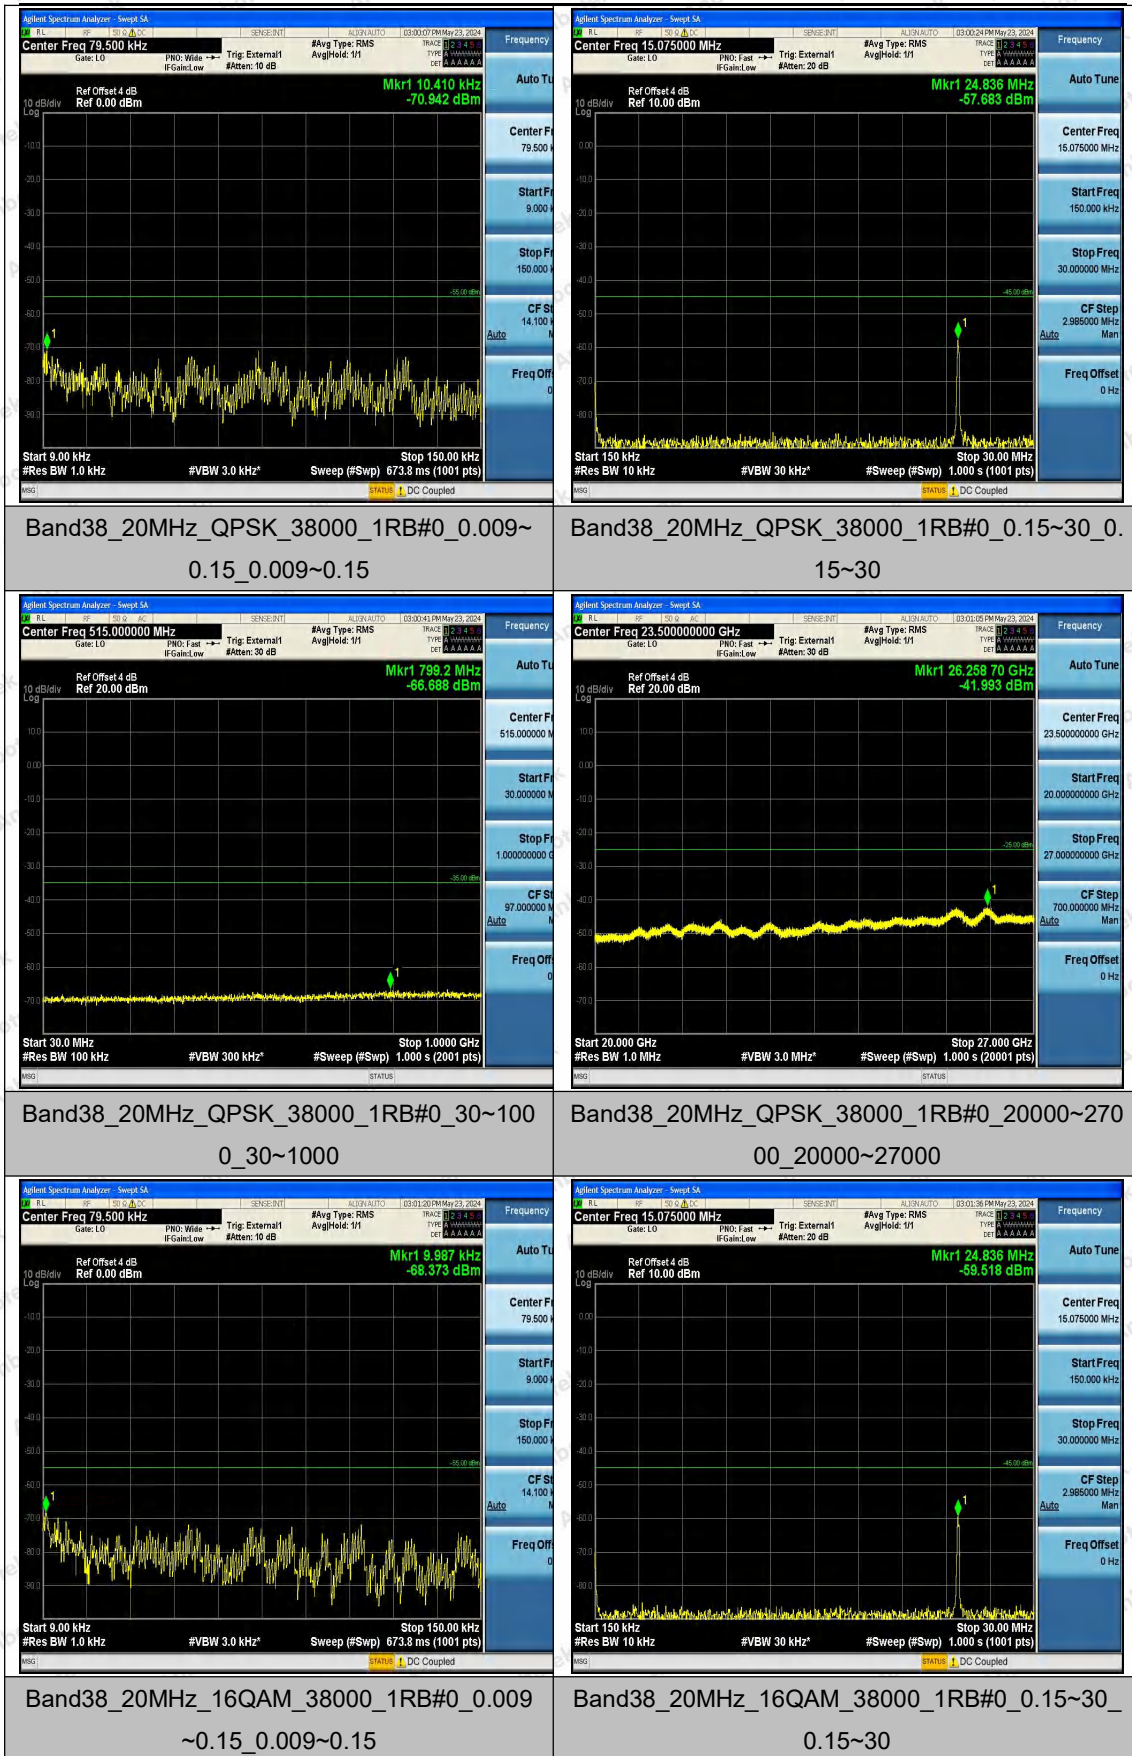


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



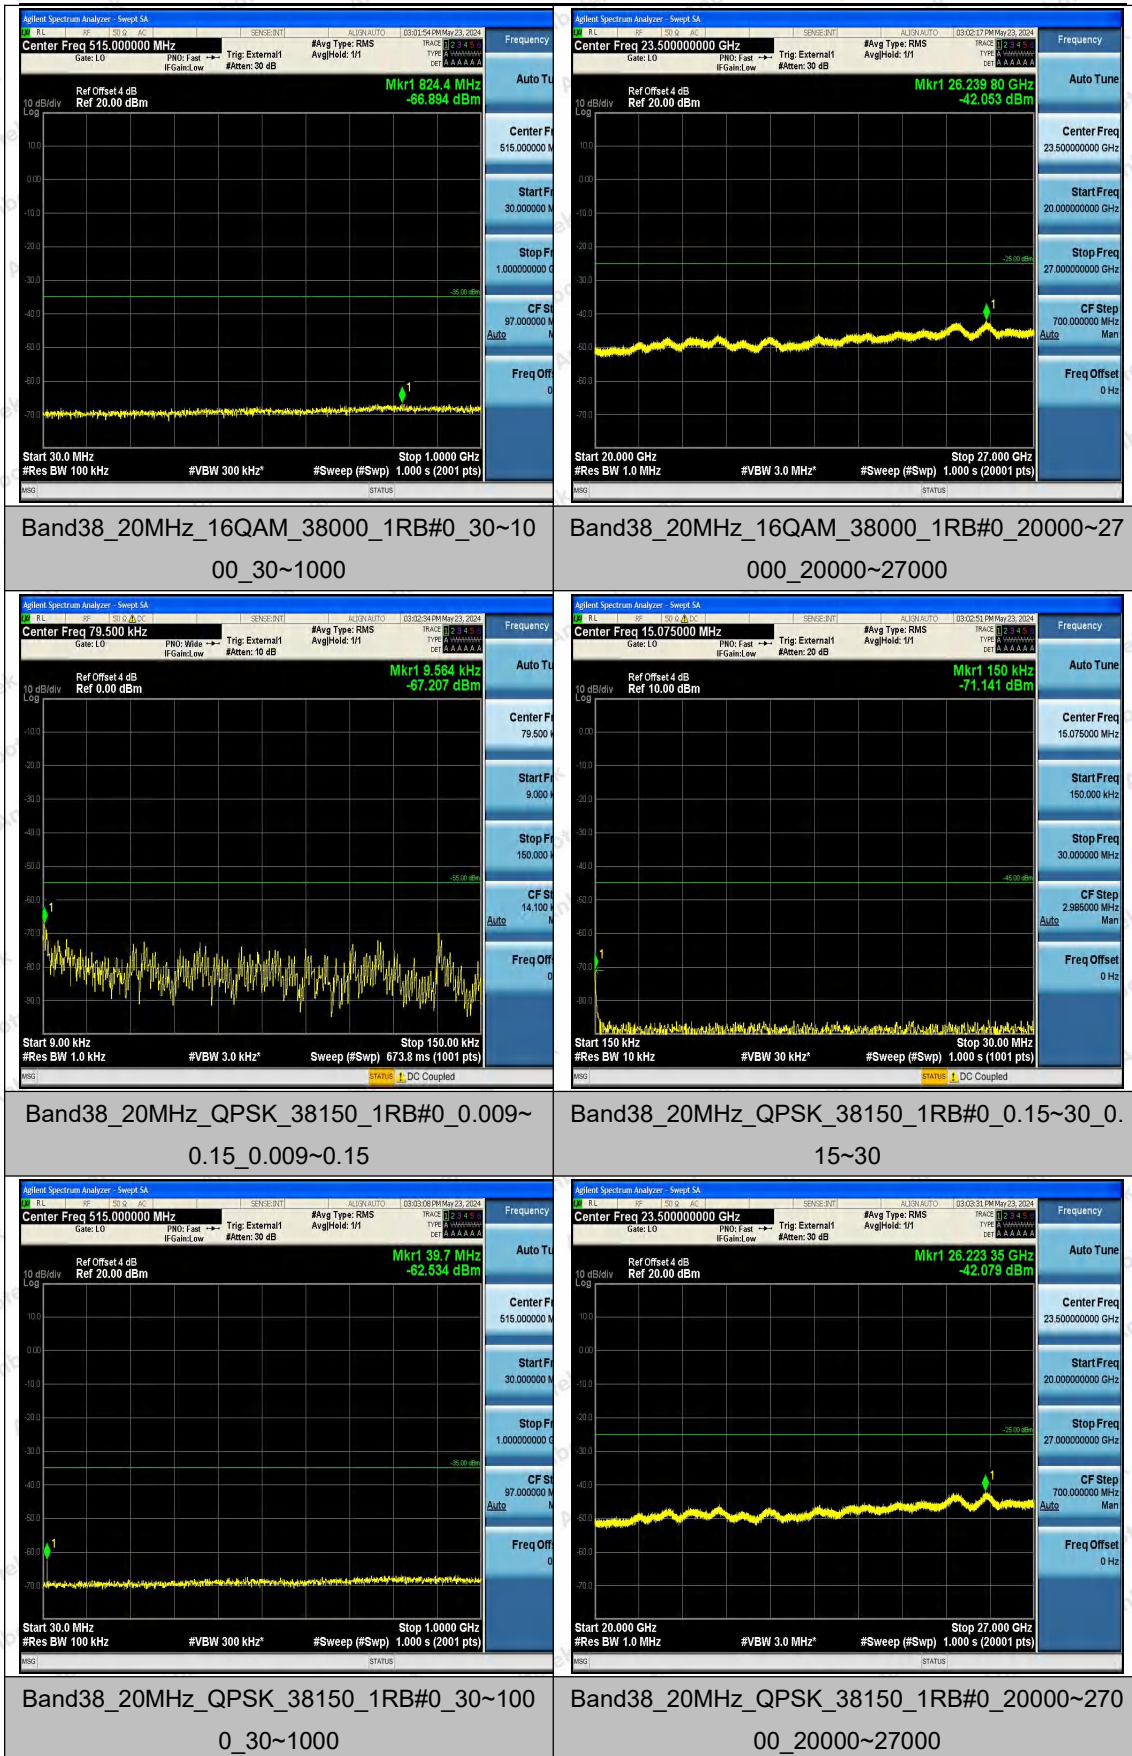


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn

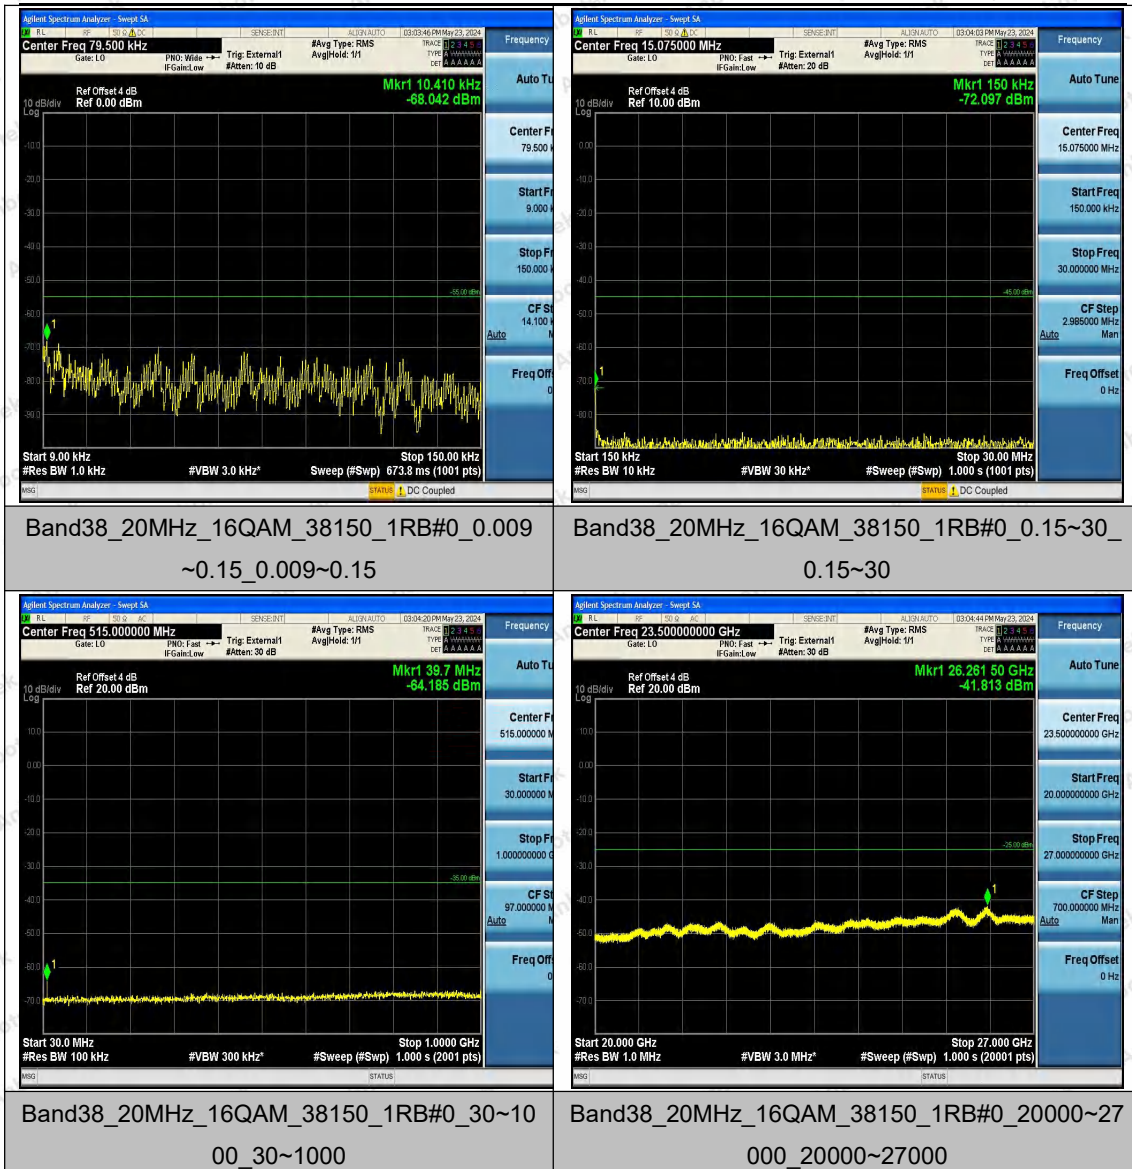

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band38	5MHz	QPSK	37775	25RB#0	VN	NT	-24.73	-0.009613	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	VL	NT	10.83	0.004210	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	VH	NT	-11.32	-0.004400	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VN	NT	10.76	0.004183	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VL	NT	-12.27	-0.004770	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VH	NT	-10.00	-0.003887	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VN	NT	12.07	0.004651	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VL	NT	-18.54	-0.007145	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VH	NT	-18.18	-0.007006	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VN	NT	-7.61	-0.002933	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VL	NT	-15.12	-0.005827	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VH	NT	-13.78	-0.005310	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VN	NT	29.57	0.011297	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VL	NT	-16.44	-0.006281	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VH	NT	-15.89	-0.006071	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VN	NT	10.16	0.003882	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VL	NT	-16.47	-0.006292	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VH	NT	-15.98	-0.006105	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VN	NT	-11.29	-0.004384	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VL	NT	-9.51	-0.003693	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VH	NT	6.14	0.002384	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VN	NT	-2.93	-0.001138	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VL	NT	-6.45	-0.002505	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VH	NT	-3.45	-0.001340	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VN	NT	5.51	0.002123	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VL	NT	-7.57	-0.002917	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VH	NT	-4.43	-0.001707	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VN	NT	-4.21	-0.001622	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VL	NT	-4.35	-0.001676	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VH	NT	-8.25	-0.003179	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VN	NT	15.79	0.006038	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VL	NT	-10.61	-0.004057	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VH	NT	-11.00	-0.004207	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VN	NT	12.06	0.004612	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VL	NT	-11.72	-0.004482	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	10MHz	16QAM	38200	50RB#0	VH	NT	-11.24	-0.004298	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VN	NT	7.02	0.002724	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VL	NT	6.58	0.002553	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VH	NT	-5.16	-0.002002	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VN	NT	-3.65	-0.001416	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VL	NT	-6.48	-0.002514	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VH	NT	-5.42	-0.002103	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VN	NT	-13.56	-0.005225	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VL	NT	7.14	0.002751	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VH	NT	25.43	0.009800	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VN	NT	-17.65	-0.006802	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VL	NT	-12.86	-0.004956	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VH	NT	-13.39	-0.005160	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VN	NT	16.58	0.006346	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VL	NT	-18.70	-0.007158	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VH	NT	-16.87	-0.006457	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VN	NT	-18.15	-0.006947	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VL	NT	-14.19	-0.005432	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VH	NT	-7.05	-0.002699	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VN	NT	-23.98	-0.009295	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VL	NT	-14.55	-0.005640	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VH	NT	-14.98	-0.005806	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VN	NT	-16.77	-0.006500	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VL	NT	-11.07	-0.004291	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VH	NT	5.97	0.002314	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VN	NT	-12.47	-0.004805	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VL	NT	-16.67	-0.006424	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VH	NT	-12.82	-0.004940	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VN	NT	-19.97	-0.007696	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VL	NT	9.23	0.003557	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VH	NT	-14.20	-0.005472	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VN	NT	13.07	0.005008	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VL	NT	-14.35	-0.005498	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VH	NT	-18.44	-0.007065	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VN	NT	-12.69	-0.004862	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VL	NT	-10.39	-0.003981	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VH	NT	-11.90	-0.004559	±2.5	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	5MHz	QPSK	37775	25RB#0	NV	-30	10.19	0.003961	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-20	14.06	0.005466	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-10	9.06	0.003522	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	0	-14.23	-0.005532	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	10	-11.29	-0.004389	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	20	14.61	0.005679	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	30	9.64	0.003747	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	40	11.29	0.004389	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	50	13.20	0.005131	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-30	11.74	0.004564	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-20	-11.32	-0.004400	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-10	9.18	0.003569	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	0	-19.04	-0.007401	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	10	-14.38	-0.005590	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	20	-16.18	-0.006290	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	30	6.81	0.002647	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	40	-11.86	-0.004610	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	50	-13.12	-0.005100	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-30	6.72	0.002590	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-20	-12.79	-0.004929	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-10	-14.56	-0.005611	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	0	-18.48	-0.007121	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	10	-12.97	-0.004998	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	20	-11.34	-0.004370	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	30	-13.06	-0.005033	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	40	-10.43	-0.004019	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	50	7.48	0.002882	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-30	-13.23	-0.005098	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-20	-15.54	-0.005988	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-10	-21.40	-0.008247	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	0	-14.45	-0.005568	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	10	-14.69	-0.005661	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	20	-15.82	-0.006096	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	30	-16.35	-0.006301	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	40	-21.37	-0.008235	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	50	-12.12	-0.004671	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-30	-23.67	-0.009043	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-20	-13.23	-0.005054	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-10	10.26	0.003920	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	0	-10.57	-0.004038	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	10	-17.34	-0.006625	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500

www.anbotek.com.cn



Band38	5MHz	QPSK	38225	25RB#0	NV	20	-20.63	-0.007882	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	30	-16.61	-0.006346	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	40	-11.54	-0.004409	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	50	-17.42	-0.006655	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-30	-11.47	-0.004382	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-20	-13.16	-0.005028	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-10	-12.99	-0.004963	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	0	-12.35	-0.004718	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	10	-10.93	-0.004176	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	20	8.57	0.003274	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	30	-13.10	-0.005005	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	40	-17.74	-0.006777	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	50	-16.28	-0.006220	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-30	-7.34	-0.002850	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-20	-4.03	-0.001565	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-10	-6.78	-0.002633	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	0	14.26	0.005538	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	10	-10.50	-0.004078	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	20	-5.58	-0.002167	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	30	4.15	0.001612	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	40	-9.41	-0.003654	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	50	-3.56	-0.001383	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-30	-6.88	-0.002672	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-20	16.19	0.006287	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-10	-5.12	-0.001988	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	0	-3.50	-0.001359	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	10	-5.88	-0.002283	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	20	-4.32	-0.001678	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	30	-10.19	-0.003957	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	40	-5.29	-0.002054	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	50	4.46	0.001732	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-30	-8.80	-0.003391	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-20	-11.34	-0.004370	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-10	-6.42	-0.002474	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	0	-4.35	-0.001676	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	10	-9.48	-0.003653	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	20	-8.77	-0.003380	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	30	-3.53	-0.001360	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	40	-9.31	-0.003588	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	50	-7.05	-0.002717	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-30	-4.89	-0.001884	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500

www.anbotek.com.cn



Band38	10MHz	16QAM	38000	50RB#0	NV	-20	-5.31	-0.002046	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-10	-5.45	-0.002100	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	0	3.26	0.001256	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	10	-3.45	-0.001329	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	20	-9.27	-0.003572	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	30	-8.44	-0.003252	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	40	11.50	0.004432	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	50	-11.63	-0.004482	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-30	-8.68	-0.003319	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-20	-9.14	-0.003495	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-10	-8.34	-0.003189	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	0	3.91	0.001495	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	10	-6.71	-0.002566	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	20	-6.78	-0.002593	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	30	11.67	0.004463	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	40	-13.05	-0.004990	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	50	-16.69	-0.006382	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-30	-10.87	-0.004157	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-20	-14.16	-0.005415	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-10	-16.81	-0.006428	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	0	-11.34	-0.004337	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	10	-18.54	-0.007090	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	20	-13.19	-0.005044	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	30	-13.16	-0.005033	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	40	6.18	0.002363	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	50	-14.41	-0.005511	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-30	6.64	0.002576	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-20	-4.11	-0.001595	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-10	3.91	0.001517	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	0	-8.65	-0.003356	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	10	6.11	0.002371	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	20	-9.86	-0.003825	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	30	-5.74	-0.002227	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	40	-11.04	-0.004283	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	50	-5.69	-0.002208	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-30	-4.73	-0.001835	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-20	-8.68	-0.003368	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-10	-3.92	-0.001521	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	0	-8.85	-0.003434	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	10	-8.77	-0.003403	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	20	-8.35	-0.003240	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band38	15MHz	16QAM	37825	75RB#0	NV	30	-4.94	-0.001917	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	40	-9.61	-0.003728	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	50	-9.76	-0.003787	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-30	-16.82	-0.006482	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-20	-16.77	-0.006462	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-10	7.75	0.002987	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	0	-13.63	-0.005252	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	10	-12.23	-0.004713	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	20	-9.76	-0.003761	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	30	-18.37	-0.007079	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	40	-20.37	-0.007850	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	50	20.28	0.007815	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-30	-15.85	-0.006108	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-20	-15.26	-0.005881	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-10	-19.64	-0.007568	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	0	-18.75	-0.007225	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	10	-16.31	-0.006285	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	20	-17.25	-0.006647	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	30	10.94	0.004216	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	40	-17.74	-0.006836	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	50	-19.63	-0.007565	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-30	-13.83	-0.005294	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-20	-16.71	-0.006396	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-10	-9.87	-0.003778	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	0	-5.34	-0.002044	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	10	-14.81	-0.005669	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	20	-13.49	-0.005164	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	30	-12.80	-0.004900	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	40	-17.92	-0.006859	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	50	85.46	0.032712	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-30	-7.61	-0.002913	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-20	11.99	0.004589	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-10	-15.99	-0.006121	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	0	-10.44	-0.003996	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	10	-11.93	-0.004567	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	20	-14.98	-0.005734	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	30	12.32	0.004716	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	40	-20.33	-0.007782	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	50	-8.90	-0.003407	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-30	18.15	0.007035	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-20	-17.55	-0.006802	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	20MHz	QPSK	37850	100RB#0	NV	-10	-10.41	-0.004035	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	0	-11.00	-0.004264	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	10	8.37	0.003244	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	20	-6.95	-0.002694	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	30	-8.61	-0.003337	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	40	-13.76	-0.005333	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	50	-14.68	-0.005690	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-30	-11.42	-0.004426	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-20	-15.92	-0.006171	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-10	8.21	0.003182	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	0	-20.51	-0.007950	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	10	-11.36	-0.004403	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	20	7.81	0.003027	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	30	-13.25	-0.005136	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	40	16.87	0.006539	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	50	-10.01	-0.003880	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-30	-17.17	-0.006617	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-20	-15.99	-0.006162	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-10	4.75	0.001830	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	0	-3.02	-0.001164	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	10	5.36	0.002066	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	20	-6.51	-0.002509	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	30	-14.29	-0.005507	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	40	-19.57	-0.007541	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	50	-16.59	-0.006393	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-30	5.76	0.002220	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-20	-9.03	-0.003480	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-10	-13.79	-0.005314	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	0	8.53	0.003287	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	10	-14.55	-0.005607	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	20	-19.44	-0.007491	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	30	-13.09	-0.005044	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	40	-14.06	-0.005418	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	50	4.03	0.001553	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-30	-16.28	-0.006238	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-20	-17.95	-0.006877	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-10	-7.70	-0.002950	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	0	-13.59	-0.005207	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	10	-14.73	-0.005644	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	20	-10.76	-0.004123	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	30	-11.19	-0.004287	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	20MHz	QPSK	38150	100RB#0	NV	40	-11.17	-0.004280	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	50	-13.43	-0.005146	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-30	-6.15	-0.002356	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-20	9.33	0.003575	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-10	-15.72	-0.006023	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	0	-12.72	-0.004874	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	10	-8.65	-0.003314	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	20	-14.78	-0.005663	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	30	-7.62	-0.002920	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	40	10.10	0.003870	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	50	-15.23	-0.005835	±2.5	PASS

---END---

