




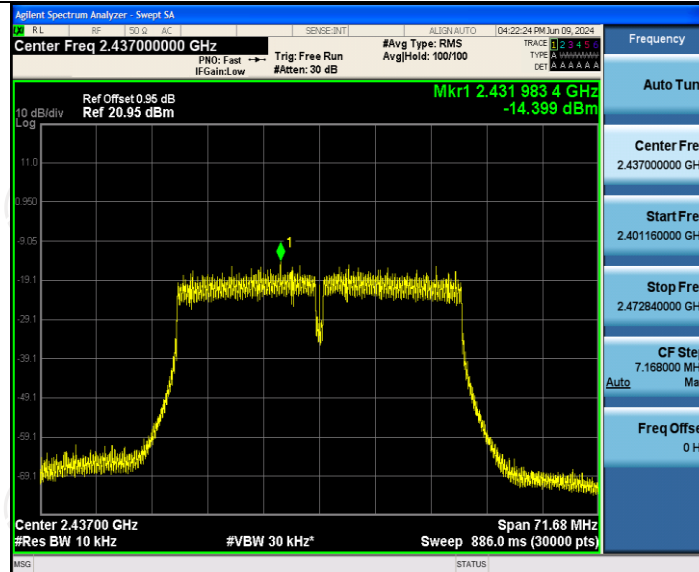


11N40SISO Ant3 2452

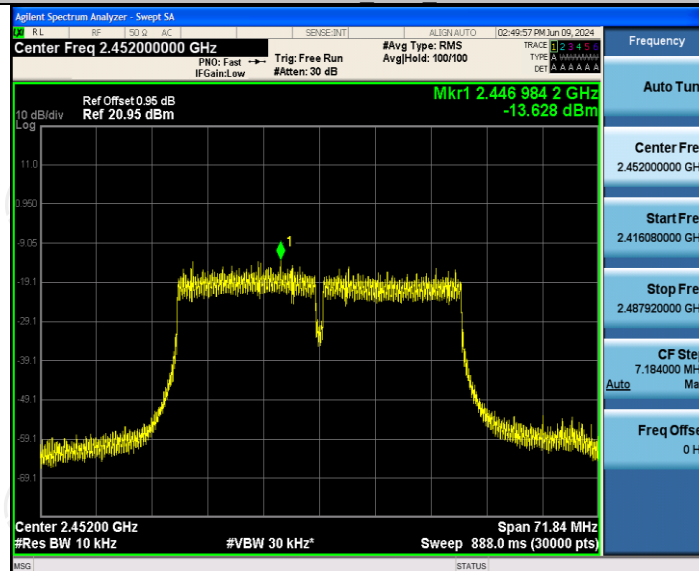


11N40SISO Ant2 2452

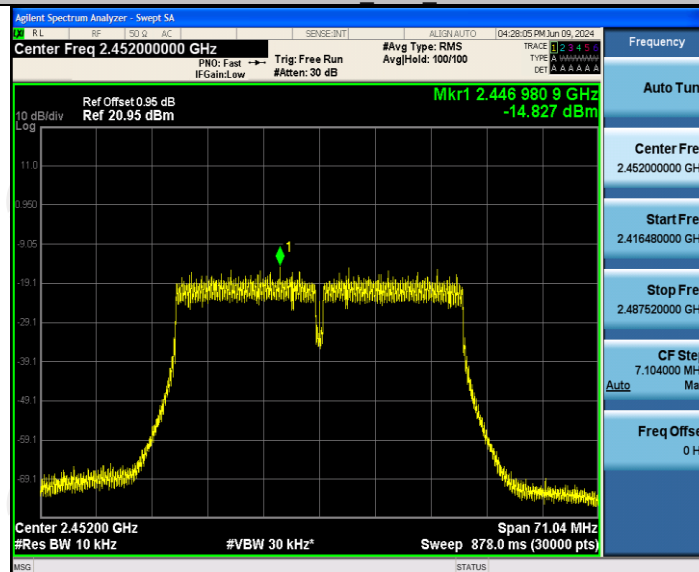


11AX20SISO Ant3 2412

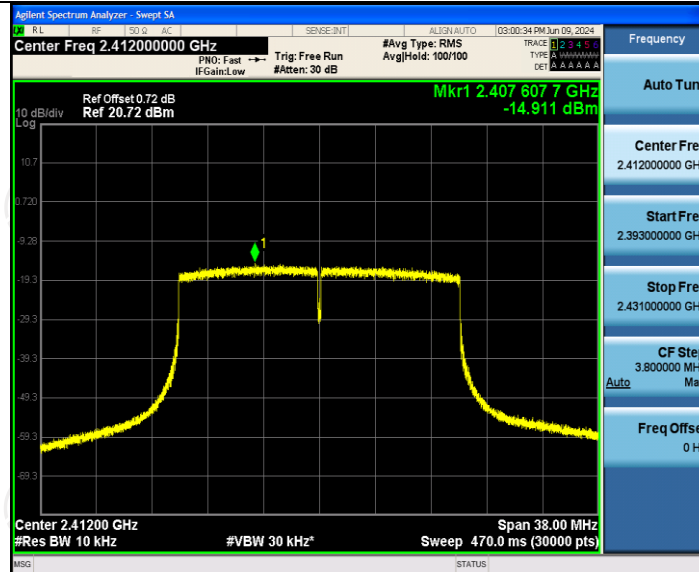


11AX20SISO Ant2 2412

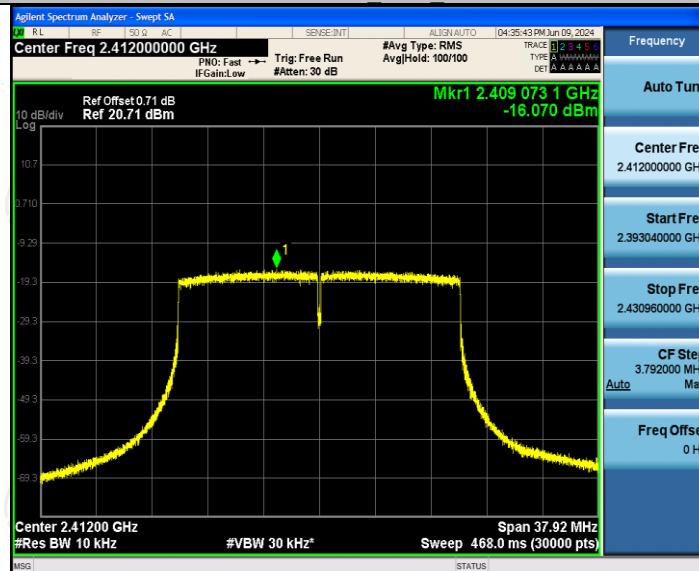


11AX40SISO Ant3 2422

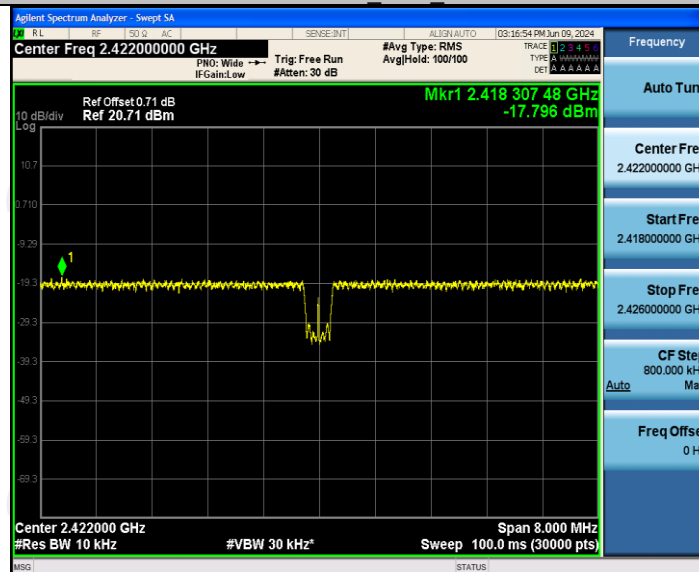


11AX40SISO Ant2 2422

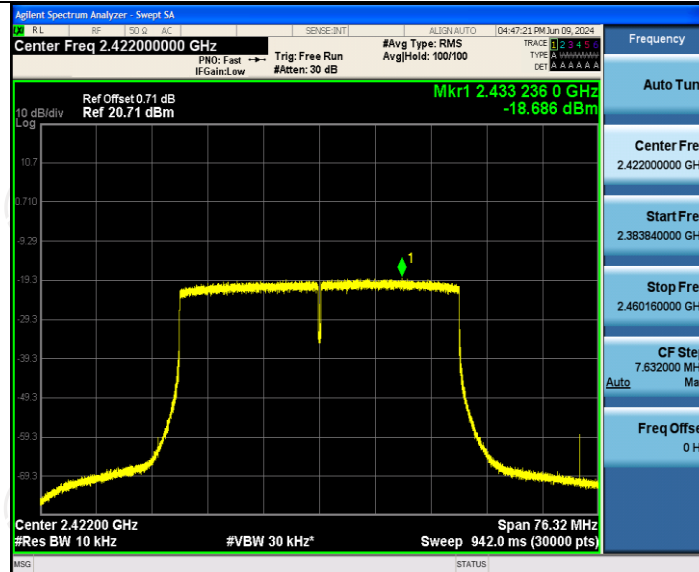


11AX20SISO Ant3 2437

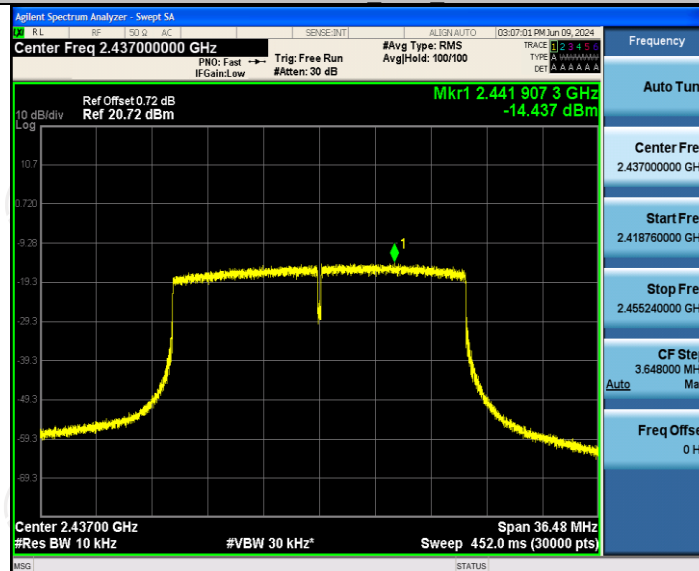


11AX40SISO Ant3 2437

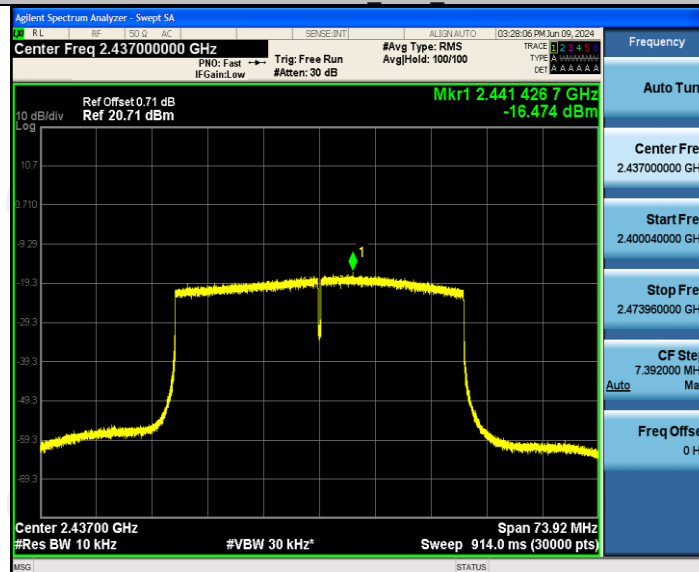


11AX20SISO Ant2 2437

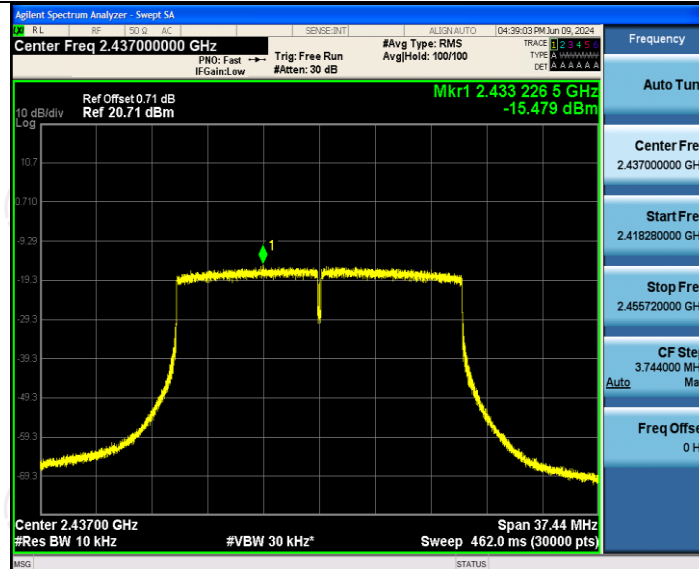


11AX40SISO Ant2 2437

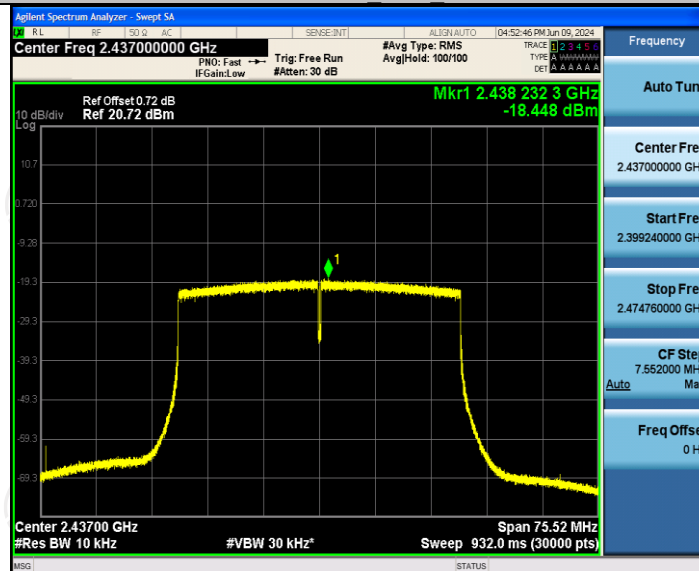


11AX40SISO Ant3 2452

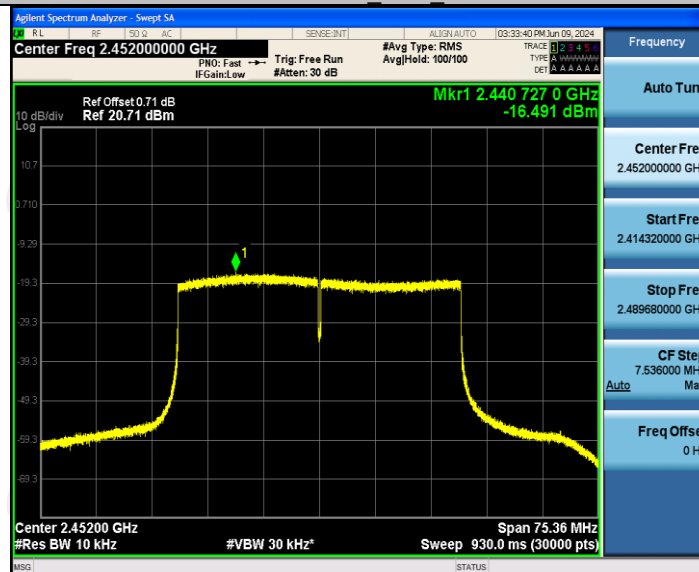


11AX40SISO Ant2 2452

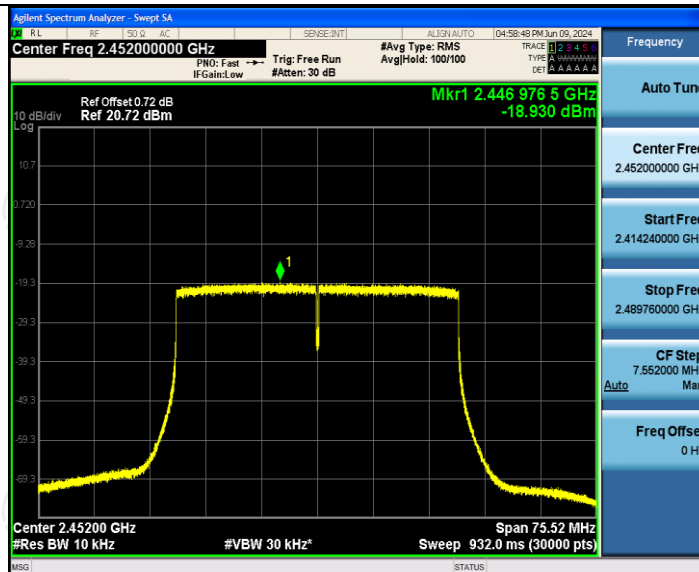

11AX20SISO Ant3 2462

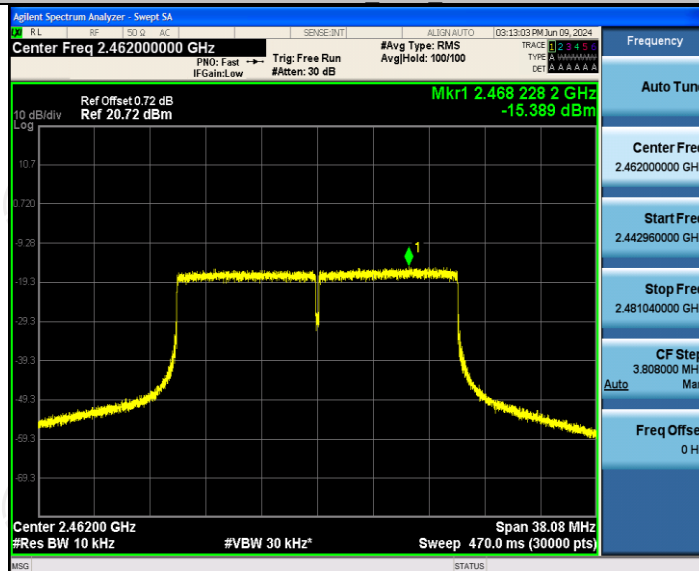

11AX20SISO Ant2 2462

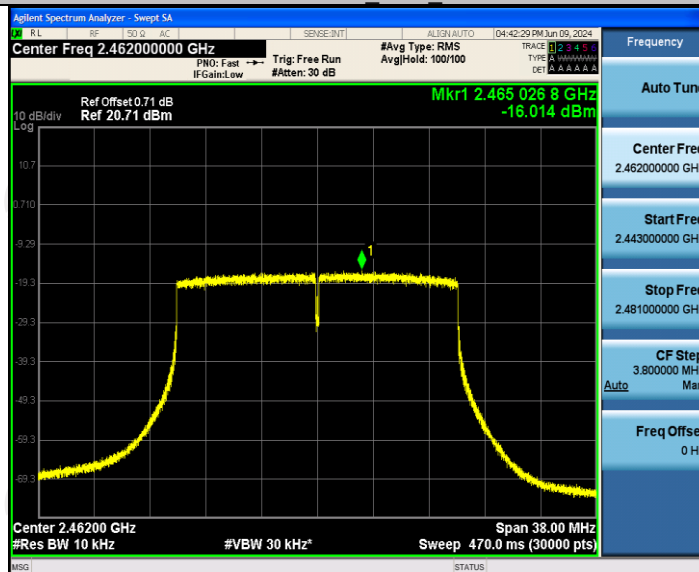


Band edge measurements

Test Result


Test Mode	Antenna	Ch Name	Channel	Ref Level[dBm]	Result[dBm]	Limit[dBm]	Verdict
11B	Ant3	Low	2412	7.10	-45.32	<=-22.9	PASS
	Ant2	Low	2412	6.22	-46.58	<=-23.78	PASS
	Ant3	High	2462	6.19	-54.05	<=-23.81	PASS
	Ant2	High	2462	6.42	-55.82	<=-23.58	PASS
11G	Ant3	Low	2412	4.25	-31.39	<=-25.75	PASS
	Ant2	Low	2412	2.88	-37.71	<=-27.12	PASS
	Ant3	High	2462	4.27	-39.72	<=-25.73	PASS
	Ant2	High	2462	2.90	-52.95	<=-27.1	PASS
11N20SISO	Ant3	Low	2412	4.05	-33.61	<=-25.95	PASS
	Ant2	Low	2412	3.32	-37.11	<=-26.68	PASS
	Ant3	High	2462	3.75	-40.65	<=-26.25	PASS
	Ant2	High	2462	3.28	-54.61	<=-26.72	PASS
11N40SISO	Ant3	Low	2422	2.05	-34.95	<=-27.95	PASS
	Ant2	Low	2422	0.51	-42.02	<=-29.5	PASS
	Ant3	High	2452	2.50	-34.16	<=-27.5	PASS
	Ant2	High	2452	0.94	-50.97	<=-29.06	PASS
11AX20SISO	Ant3	Low	2412	3.58	-34.29	<=-26.42	PASS
	Ant2	Low	2412	3.16	-37.68	<=-26.84	PASS
11AX40SISO	Ant3	Low	2422	1.18	-34.76	<=-28.82	PASS
	Ant2	Low	2422	0.01	-42.54	<=-29.99	PASS
	Ant3	High	2452	1.74	-35.03	<=-28.26	PASS
	Ant2	High	2452	0.37	-48.60	<=-29.63	PASS
11AX20SISO	Ant3	High	2462	3.42	-38.02	<=-26.58	PASS
	Ant2	High	2462	3.25	-51.25	<=-26.75	PASS

Test Graphs


11B_Ant3_Low_2412

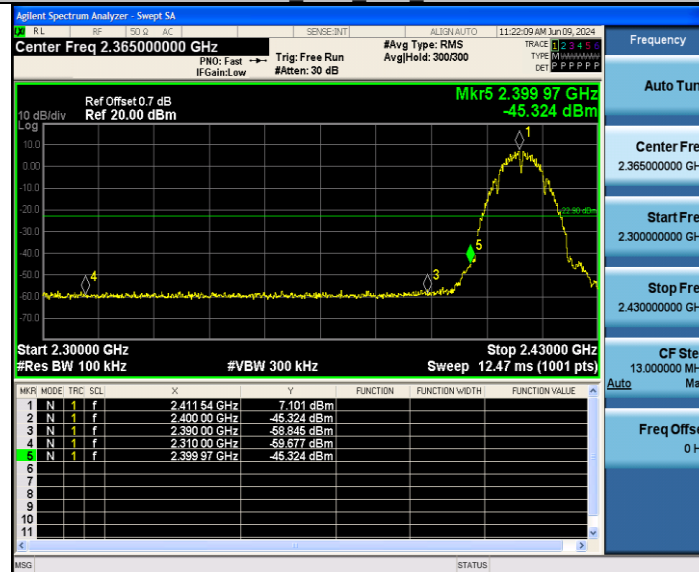


11B_Ant2_Low_2412

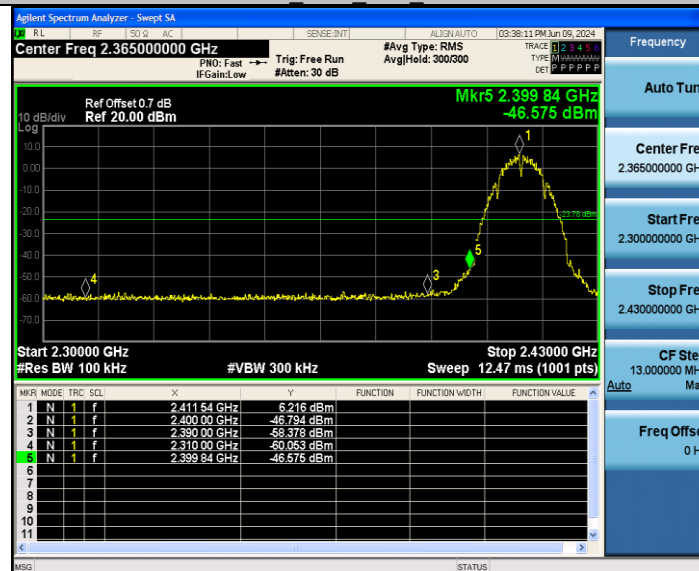


11B_Ant3_High_2462

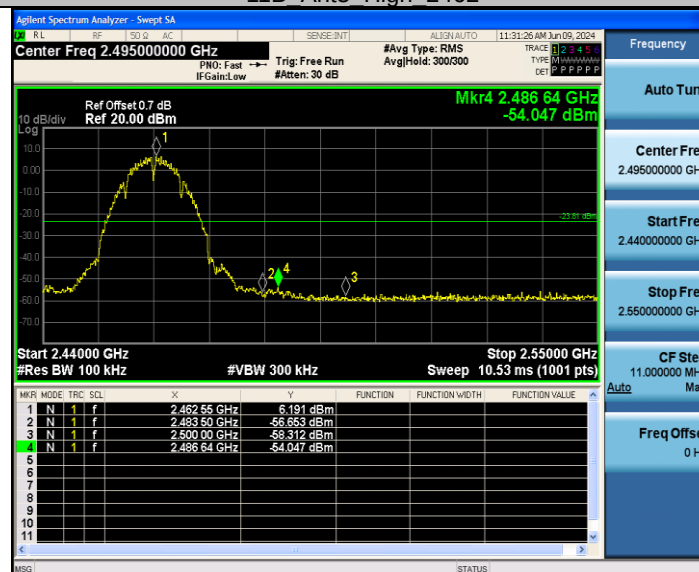


11B_Ant2_High_2462

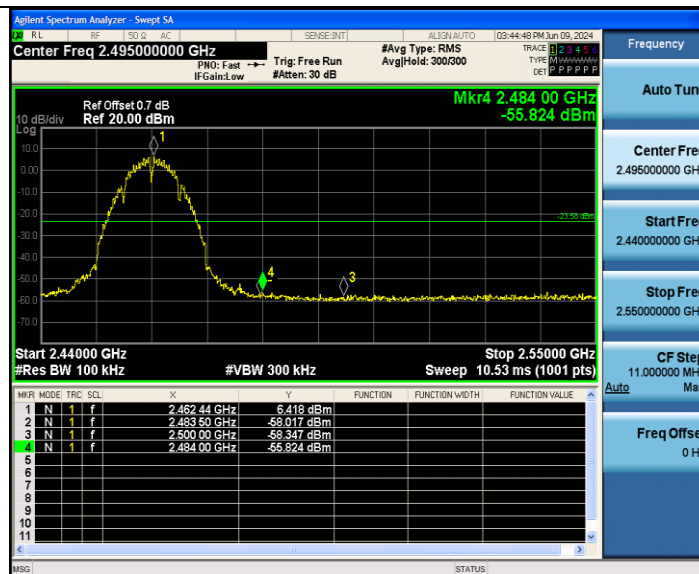


11G Ant3 Low 2412

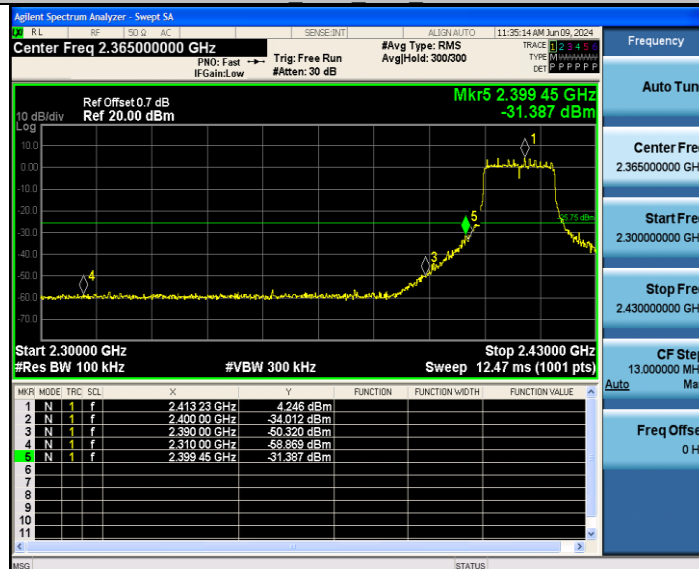


11G Ant2 Low 2412

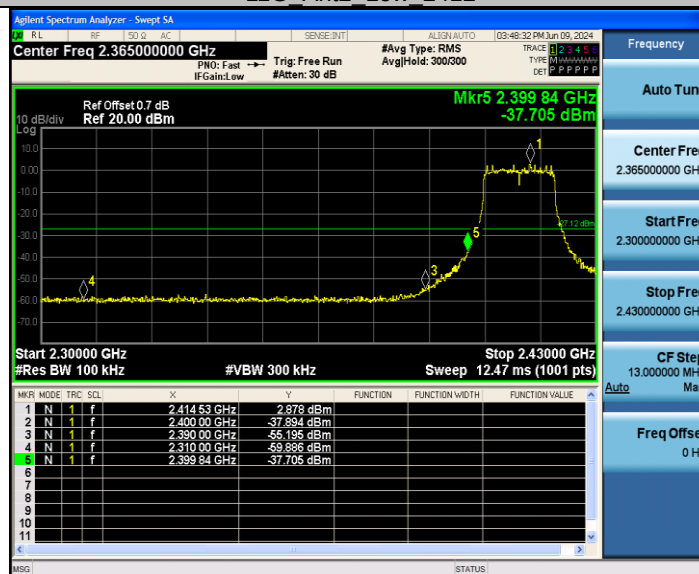


11G Ant3 High 2462

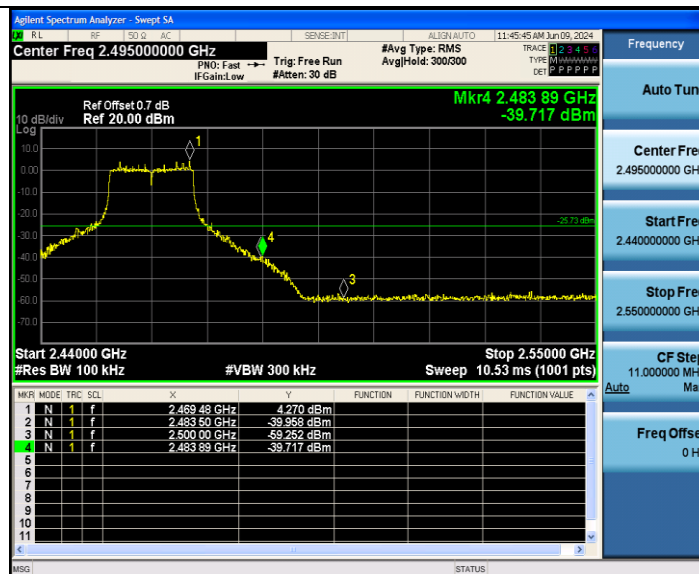


11G Ant2 High 2462

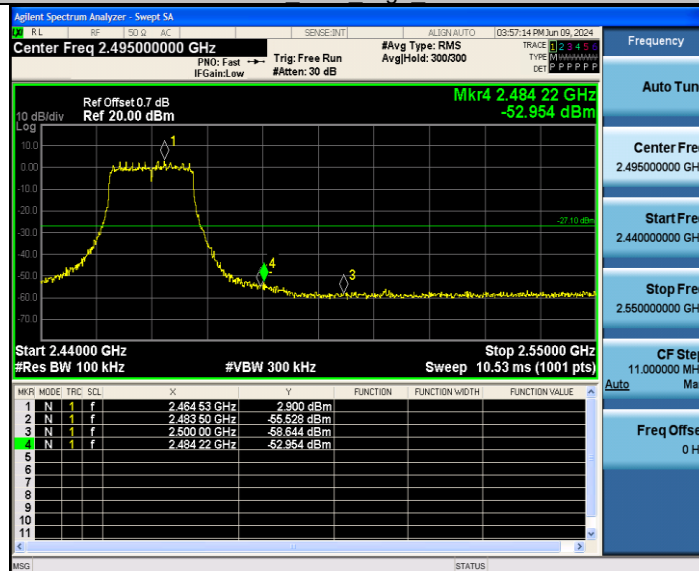


11N20SISO Ant3 Low 2412

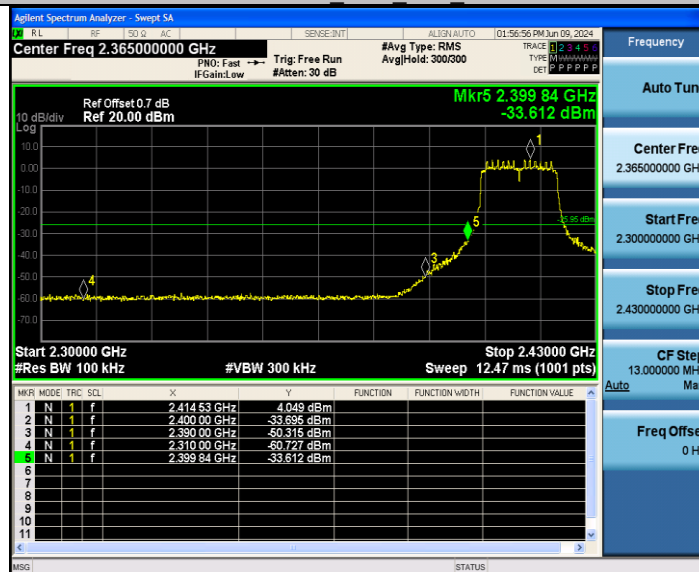


11N20SISO Ant2 Low 2412

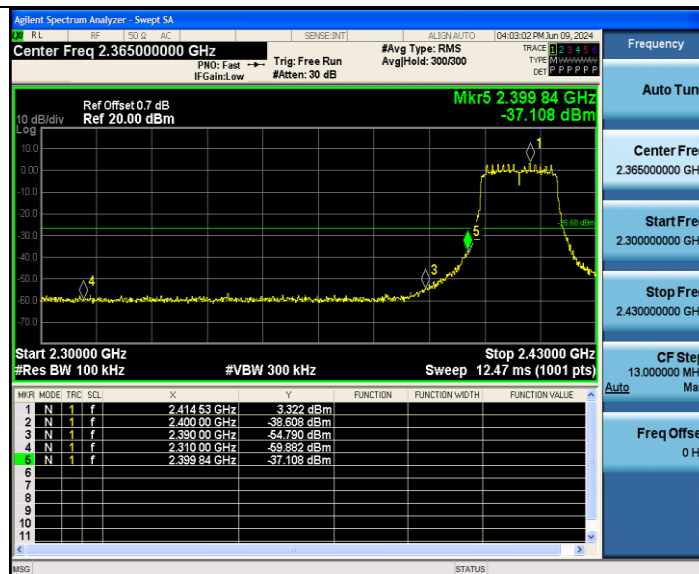


11N20SISO Ant3 High 2462

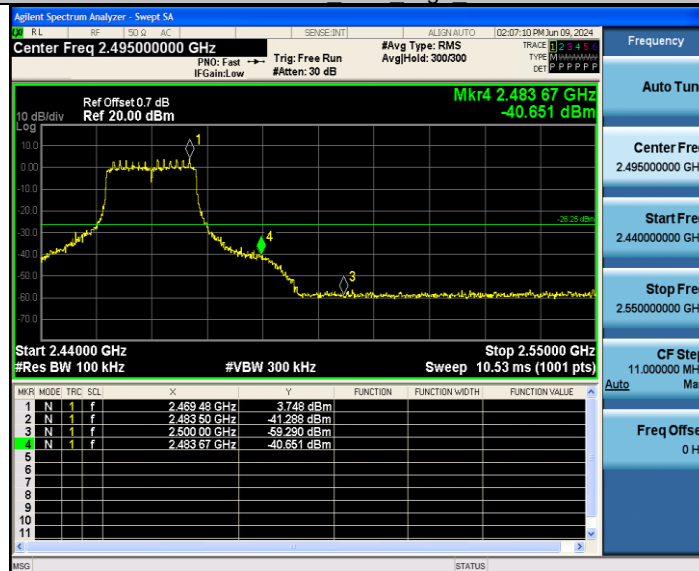


11N20SISO Ant2 High 2462

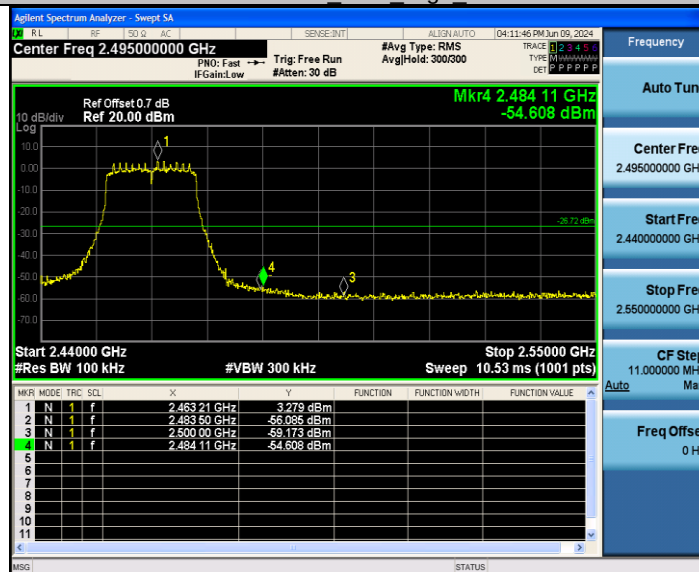

11N40SISO Ant3 Low 2422

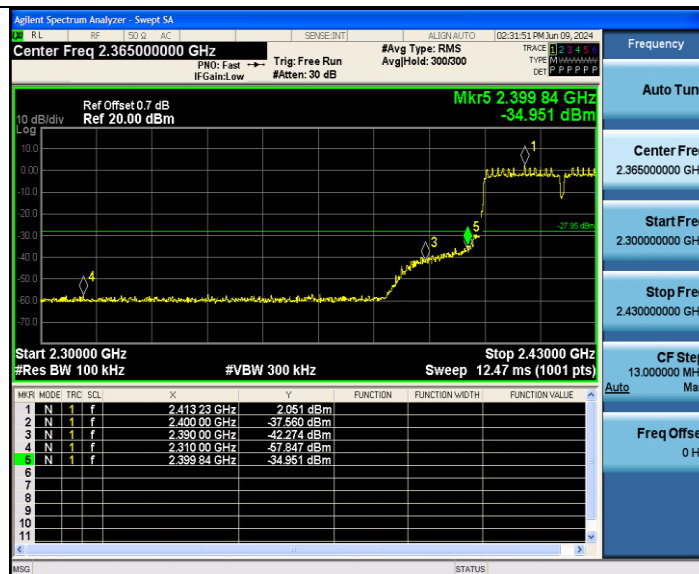


11N40SISO Ant2 Low 2422

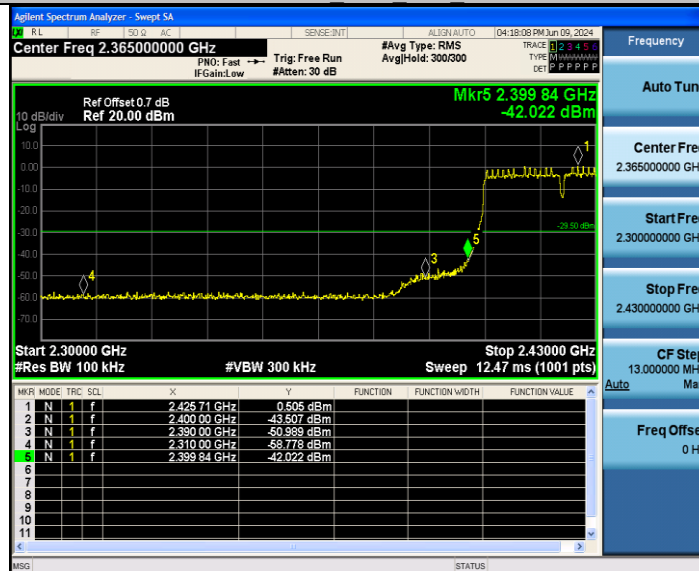


11N40SISO Ant3 High 2452




11N40SISO Ant2 High 2452

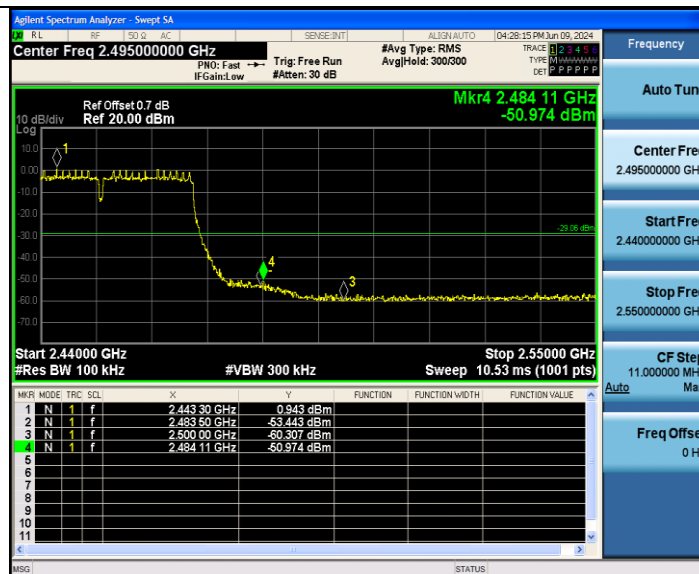

11AX20SISO Ant3 Low 2412

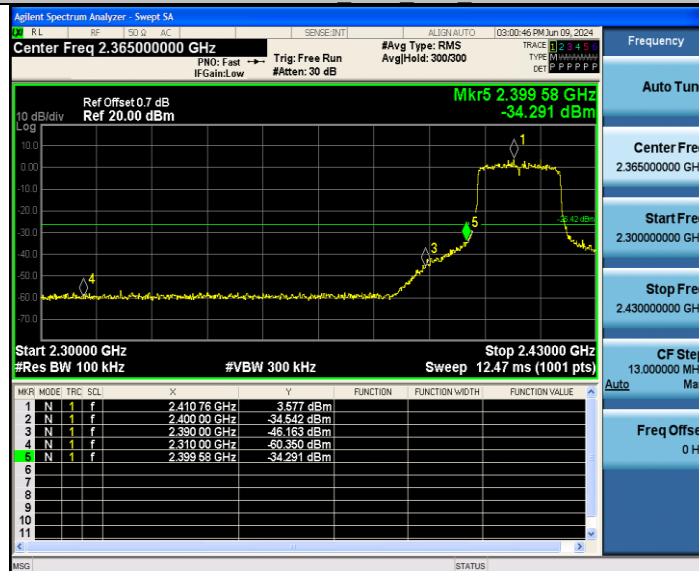


11AX20SISO Ant2 Low 2412

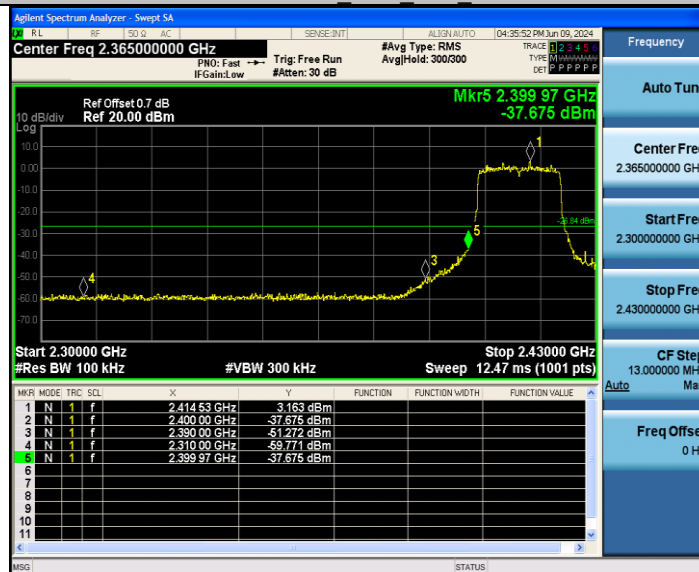

11AX40SISO Ant3 Low 2422




11AX40SISO Ant2 Low 2422

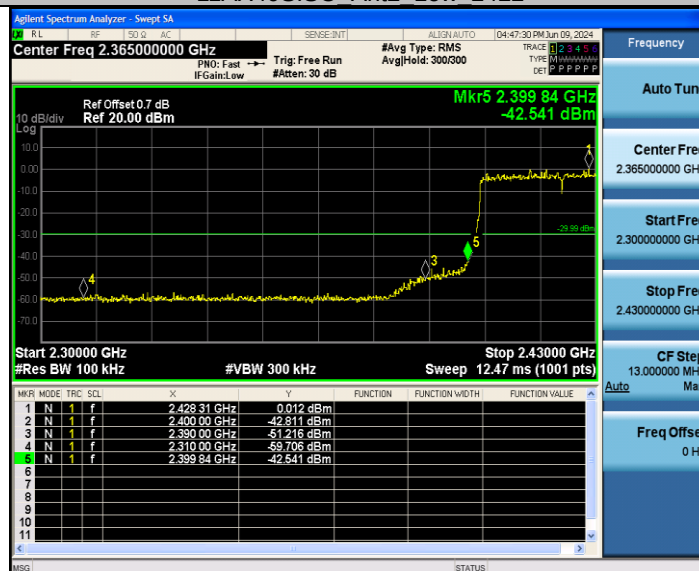


11AX40SISO Ant3 High 2452




11AX40SISO Ant2 High 2452

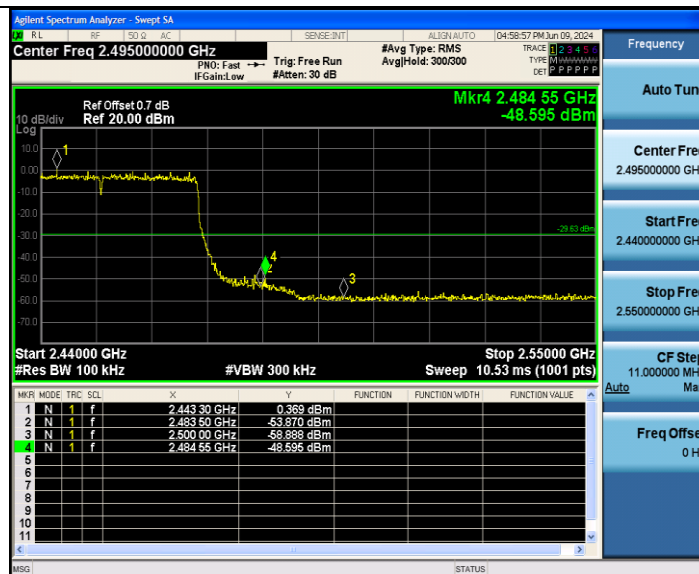

11AX20SISO Ant3 High 2462

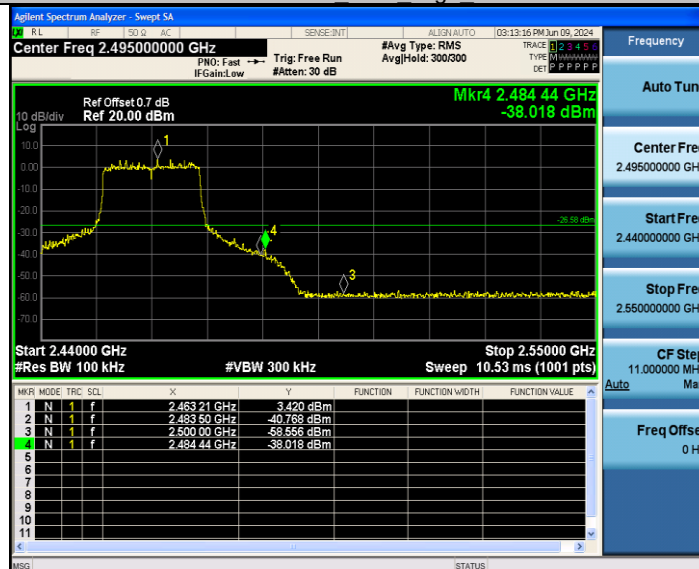

11AX20SISO Ant2 High 2462

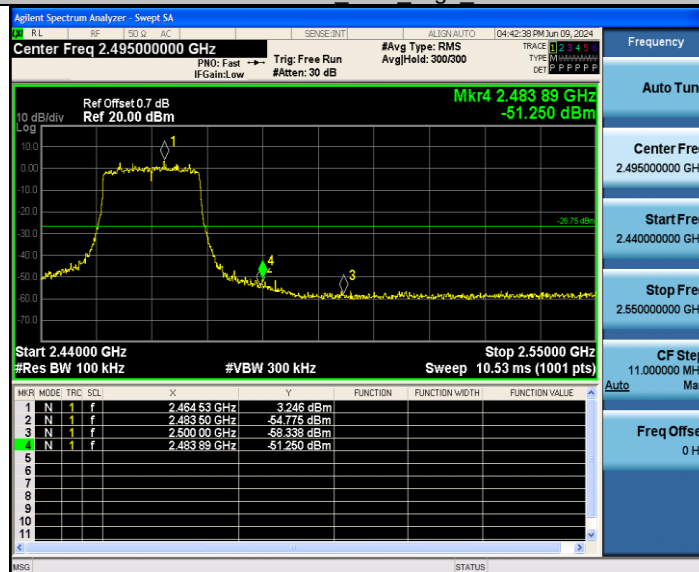

Conducted Spurious Emission

Test Result

Test Mode	Antenna	Channel	Freq Range [Mhz]	Ref Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant3	2412	Reference	7.07	7.07	---	PASS
			30~1000	30~1000	-68.551	<=-12.929	PASS
			1000~26500	1000~26500	-52.872	<=-12.929	PASS
	Ant2	2412	Reference	5.87	5.87	---	PASS
			30~1000	30~1000	-67.897	<=-14.133	PASS
			1000~26500	1000~26500	-52.04	<=-14.133	PASS
	Ant3	2437	Reference	7.49	7.49	---	PASS
			30~1000	30~1000	-68.498	<=-12.513	PASS
			1000~26500	1000~26500	-52.959	<=-12.513	PASS
	Ant2	2437	Reference	6.32	6.32	---	PASS
			30~1000	30~1000	-67.202	<=-13.68	PASS
			1000~26500	1000~26500	-52.915	<=-13.68	PASS
	Ant3	2462	Reference	6.60	6.60	---	PASS
			30~1000	30~1000	-67.845	<=-13.405	PASS
			1000~26500	1000~26500	-53.079	<=-13.405	PASS
	Ant2	2462	Reference	5.94	5.94	---	PASS
			30~1000	30~1000	-68.114	<=-14.064	PASS
			1000~26500	1000~26500	-52.475	<=-14.064	PASS
11G	Ant3	2412	Reference	4.24	4.24	---	PASS
			30~1000	30~1000	-68.408	<=-15.758	PASS
			1000~26500	1000~26500	-52.977	<=-15.758	PASS
	Ant2	2412	Reference	2.61	2.61	---	PASS
			30~1000	30~1000	-67.819	<=-17.389	PASS
			1000~26500	1000~26500	-52.07	<=-17.389	PASS
	Ant3	2437	Reference	4.85	4.85	---	PASS
			30~1000	30~1000	-68.06	<=-15.153	PASS
			1000~26500	1000~26500	-52.525	<=-15.153	PASS
	Ant2	2437	Reference	3.27	3.27	---	PASS
			30~1000	30~1000	-67.943	<=-16.733	PASS
			1000~26500	1000~26500	-51.91	<=-16.733	PASS
	Ant3	2462	Reference	3.79	3.79	---	PASS
			30~1000	30~1000	-68.262	<=-16.208	PASS
			1000~26500	1000~26500	-51.12	<=-16.208	PASS
	Ant2	2462	Reference	2.55	2.55	---	PASS
			30~1000	30~1000	-68.16	<=-17.454	PASS
			1000~26500	1000~26500	-53.61	<=-17.454	PASS
11N20SISO	Ant3	2412	Reference	2.89	2.89	---	PASS
			30~1000	30~1000	-68.339	<=-17.11	PASS
			1000~26500	1000~26500	-52.479	<=-17.11	PASS
	Ant2	2412	Reference	3.35	3.35	---	PASS
			30~1000	30~1000	-68.064	<=-16.65	PASS
			1000~26500	1000~26500	-52.256	<=-16.65	PASS
	Ant3	2437	Reference	4.97	4.97	---	PASS
			30~1000	30~1000	-68.348	<=-15.032	PASS
			1000~26500	1000~26500	-52.751	<=-15.032	PASS
	Ant2	2437	Reference	3.83	3.83	---	PASS
			30~1000	30~1000	-68.358	<=-16.17	PASS
			1000~26500	1000~26500	-52.67	<=-16.17	PASS
	Ant3	2462	Reference	3.44	3.44	---	PASS
			30~1000	30~1000	-68.508	<=-16.563	PASS
			1000~26500	1000~26500	-52.127	<=-16.563	PASS
	Ant2	2462	Reference	3.00	3.00	---	PASS
			30~1000	30~1000	-68.494	<=-17.002	PASS
			1000~26500	1000~26500	-53.108	<=-17.002	PASS
11N40SISO	Ant3	2422	Reference	2.42	2.42	---	PASS
			30~1000	30~1000	-68.29	<=-17.581	PASS
			1000~26500	1000~26500	-52.868	<=-17.581	PASS


	Ant2	2422	Reference	0.28	0.28	---	PASS
			30~1000	30~1000	-68.317	<=-19.715	PASS
			1000~26500	1000~26500	-52.476	<=-19.715	PASS
	Ant3	2437	Reference	2.19	2.19	---	PASS
			30~1000	30~1000	-67.988	<=-17.815	PASS
			1000~26500	1000~26500	-53.487	<=-17.815	PASS
	Ant2	2437	Reference	0.98	0.98	---	PASS
			30~1000	30~1000	-67.922	<=-19.019	PASS
			1000~26500	1000~26500	-52.614	<=-19.019	PASS
	Ant3	2452	Reference	1.84	1.84	---	PASS
			30~1000	30~1000	-67.896	<=-18.157	PASS
			1000~26500	1000~26500	-53.02	<=-18.157	PASS
Ant2	2452	Reference	0.10	0.10	---	PASS	
		30~1000	30~1000	-68.094	<=-19.896	PASS	
		1000~26500	1000~26500	-52.511	<=-19.896	PASS	
11AX20SISO	Ant3	2412	Reference	1.24	1.24	---	PASS
			30~1000	30~1000	-68.957	<=-18.76	PASS
			1000~26500	1000~26500	-52.604	<=-18.76	PASS
	Ant2	2412	Reference	2.04	2.04	---	PASS
			30~1000	30~1000	-68.544	<=-17.962	PASS
			1000~26500	1000~26500	-52.756	<=-17.962	PASS
11AX40SISO	Ant3	2422	Reference	1.40	1.40	---	PASS
			30~1000	30~1000	-67.862	<=-18.602	PASS
			1000~26500	1000~26500	-52.885	<=-18.602	PASS
	Ant2	2422	Reference	0.19	0.19	---	PASS
			30~1000	30~1000	-67.845	<=-19.815	PASS
			1000~26500	1000~26500	-53.085	<=-19.815	PASS
11AX20SISO	Ant3	2437	Reference	3.91	3.91	---	PASS
11AX40SISO	Ant3	2437	Reference	1.54	1.54	---	PASS
11AX20SISO	Ant3	2437	30~1000	30~1000	-68.081	<=-16.089	PASS
11AX40SISO	Ant3	2437	30~1000	30~1000	-67.104	<=-18.463	PASS
11AX20SISO	Ant3	2437	1000~26500	1000~26500	-52.813	<=-16.089	PASS
11AX40SISO	Ant3	2437	1000~26500	1000~26500	-53.173	<=-18.463	PASS
11AX20SISO	Ant2	2437	Reference	2.80	2.80	---	PASS
11AX40SISO	Ant2	2437	Reference	0.49	0.49	---	PASS
11AX20SISO	Ant2	2437	30~1000	30~1000	-67.191	<=-17.204	PASS
11AX40SISO	Ant2	2437	30~1000	30~1000	-68.622	<=-19.514	PASS
			1000~26500	1000~26500	-52.869	<=-19.514	PASS
11AX20SISO	Ant2	2437	1000~26500	1000~26500	-52.236	<=-17.204	PASS
11AX40SISO	Ant3	2452	Reference	3.11	3.11	---	PASS
			30~1000	30~1000	-67.787	<=-16.886	PASS
			1000~26500	1000~26500	-52.769	<=-16.886	PASS
	Ant2	2452	Reference	-0.02	-0.02	---	PASS
			30~1000	30~1000	-68.379	<=-20.018	PASS
			1000~26500	1000~26500	-52.522	<=-20.018	PASS
11AX20SISO	Ant3	2462	Reference	3.93	3.93	---	PASS
			30~1000	30~1000	-68.156	<=-16.069	PASS
			1000~26500	1000~26500	-52.545	<=-16.069	PASS
	Ant2	2462	Reference	3.24	3.24	---	PASS
			30~1000	30~1000	-68.254	<=-16.765	PASS
			1000~26500	1000~26500	-52.935	<=-16.765	PASS

Test Graphs


11B_Ant3_2412_0-Reference



11B_Ant3_2412_30~1000

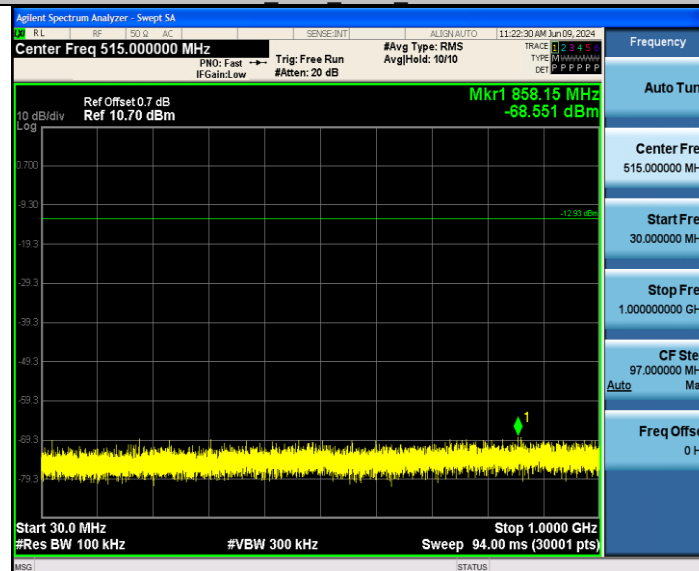


11B_Ant3_2412_1000~26500

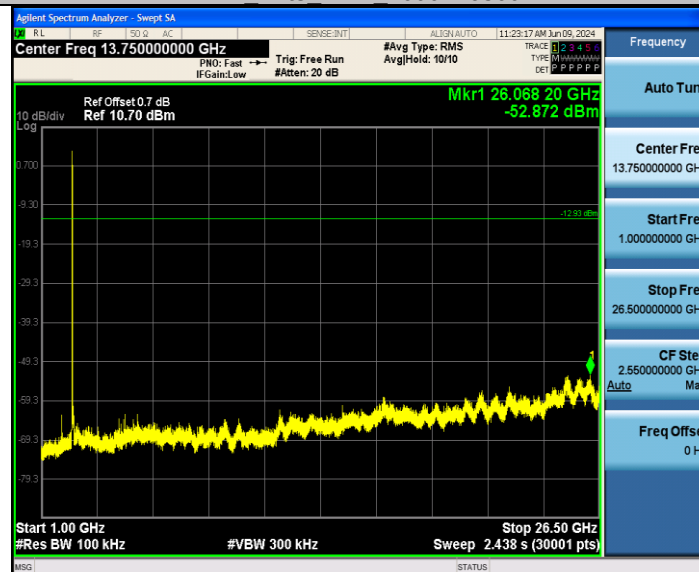


11B_Ant2_2412_0-Reference



11B Ant2 2412 30~1000

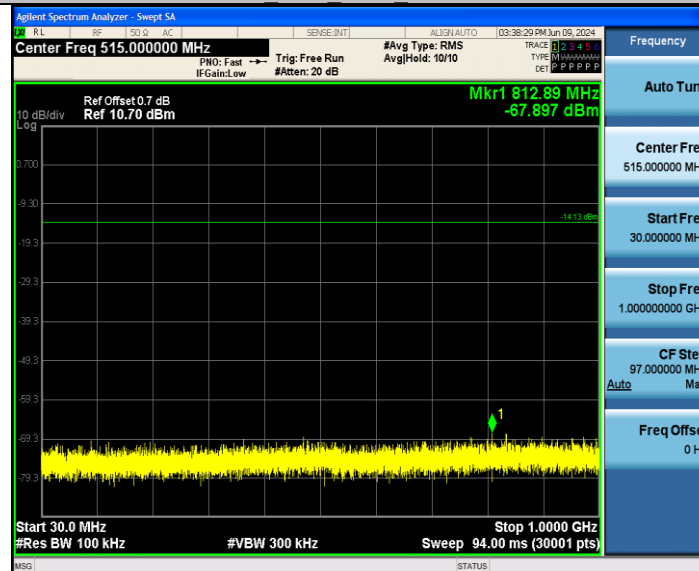


11B Ant2 2412 1000~26500

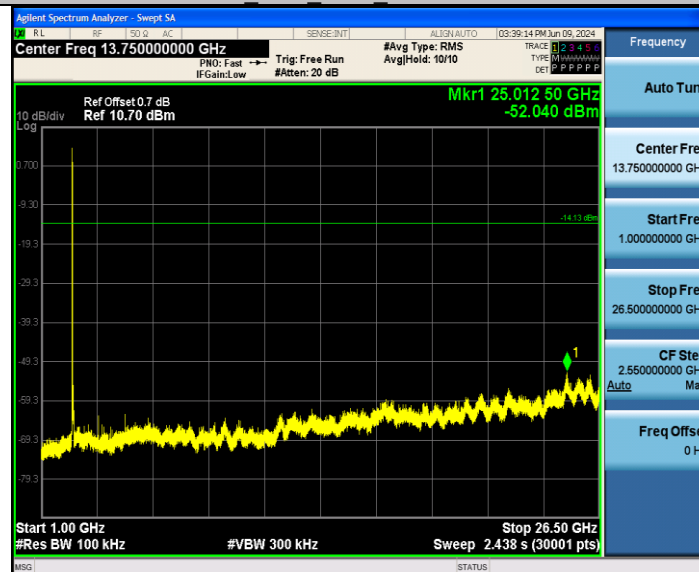


11B Ant3 2437 0~Reference



11B Ant3 2437 30~1000

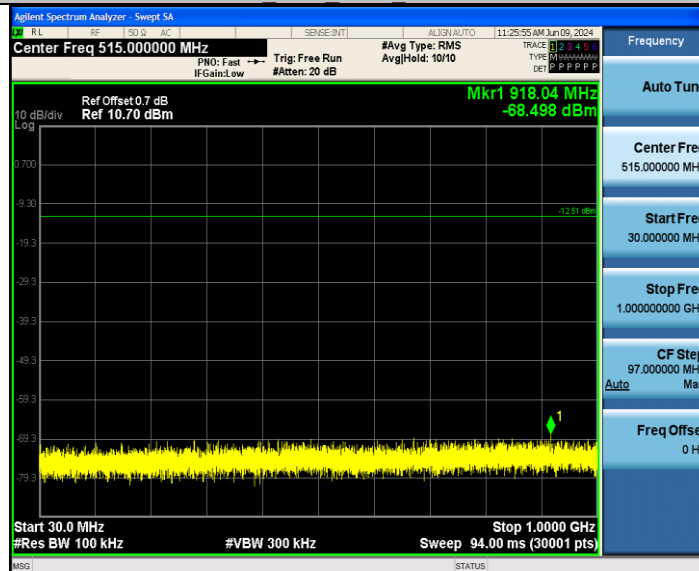


11B Ant3 2437 1000~26500

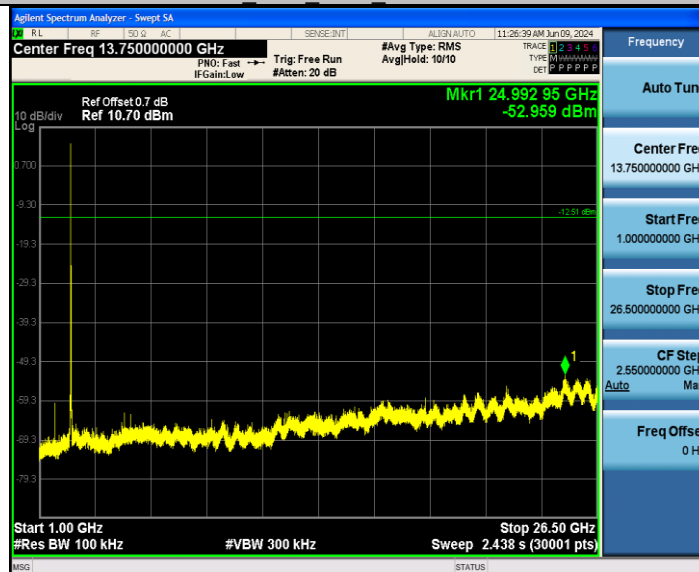


11B Ant2 2437 0~Reference



11B Ant2 2437 30~1000

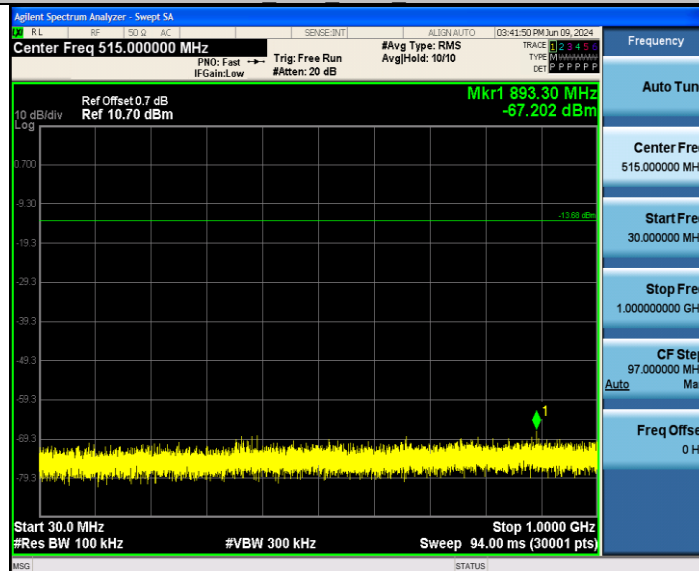


11B Ant2 2437 1000~26500

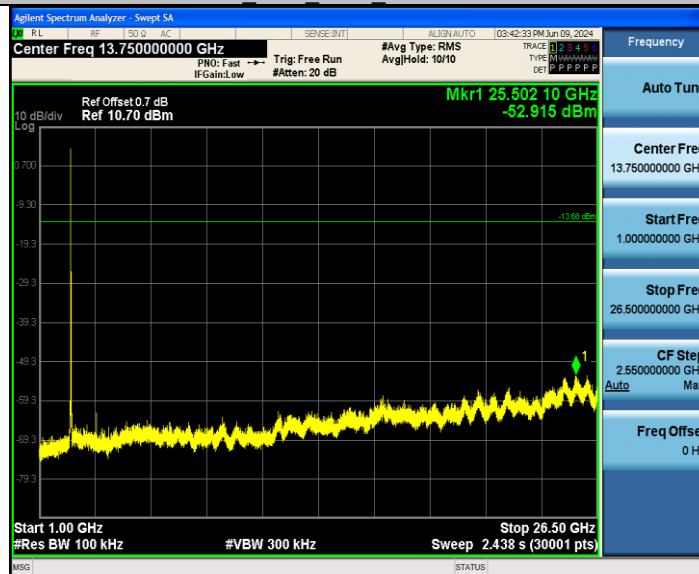


11B Ant3 2462 0-Reference



11B Ant3 2462 30~1000

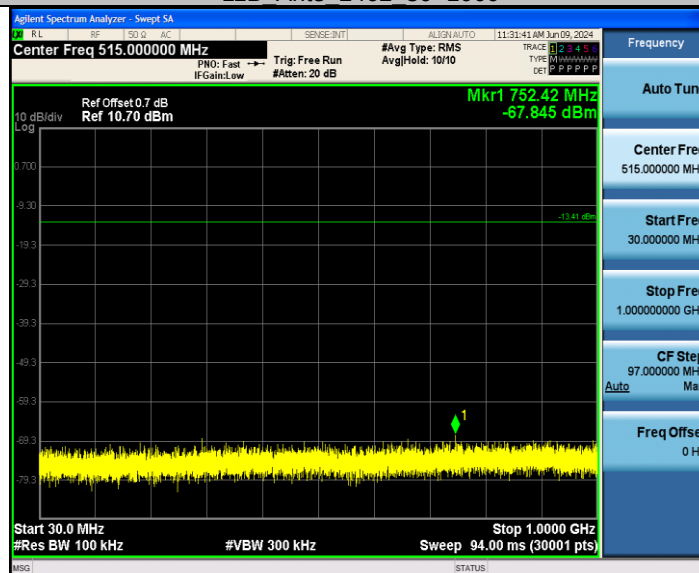


11B Ant3 2462 1000~26500

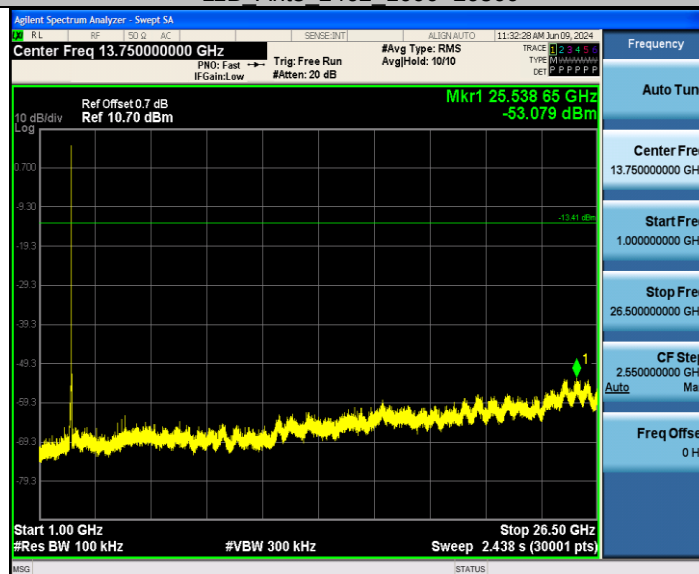


11B Ant2 2462 0~Reference



11B Ant2 2462 30~1000

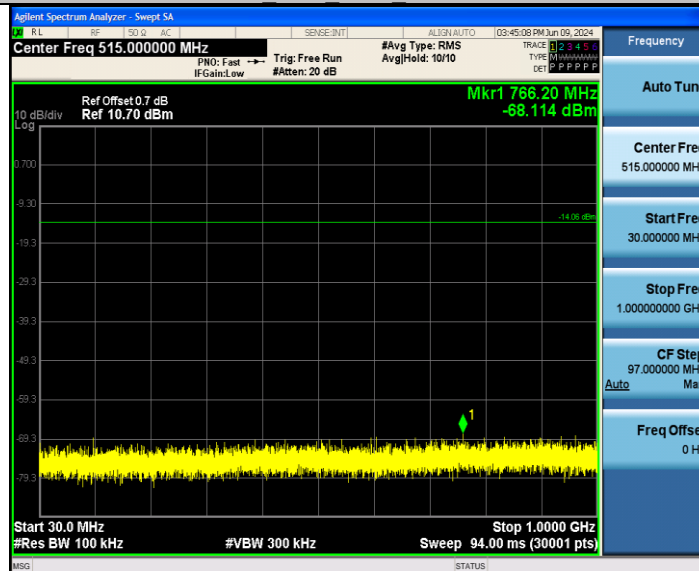

11B Ant2 2462 1000~26500

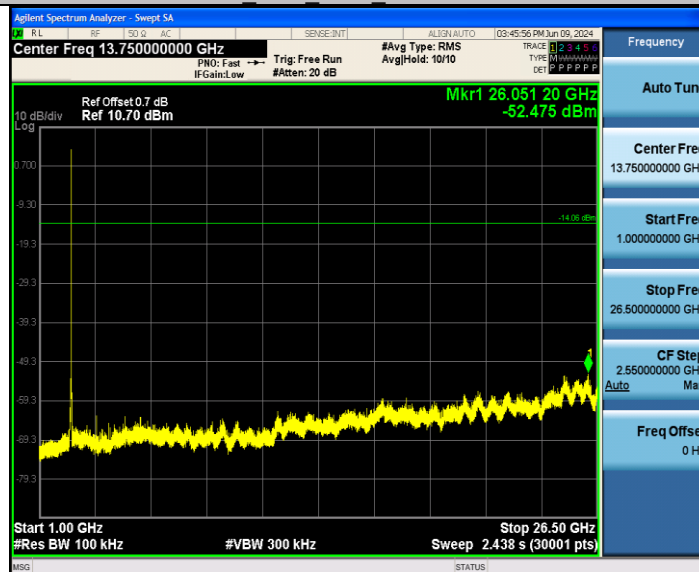

11G Ant3 2412 0-Reference