


Report No.: GZEM180900066801

Page: 51 of 101


2DH3	2441	1.65	220	0.36	0.4	PASS
2DH3	2480	1.65	150	0.25	0.4	PASS
2DH5	2402	2.89	80	0.23	0.4	PASS
2DH5	2441	2.89	90	0.26	0.4	PASS
2DH5	2480	2.89	130	0.38	0.4	PASS
3DH1	2402	0.39	320	0.13	0.4	PASS
3DH1	2441	0.39	960	0.38	0.4	PASS
3DH1	2480	0.39	640	0.25	0.4	PASS
3DH3	2402	1.65	230	0.38	0.4	PASS
3DH3	2441	1.65	180	0.30	0.4	PASS
3DH3	2480	1.65	160	0.27	0.4	PASS
3DH5	2402	2.89	70	0.20	0.4	PASS
3DH5	2441	2.89	60	0.17	0.4	PASS
3DH5	2480	2.89	130	0.38	0.4	PASS



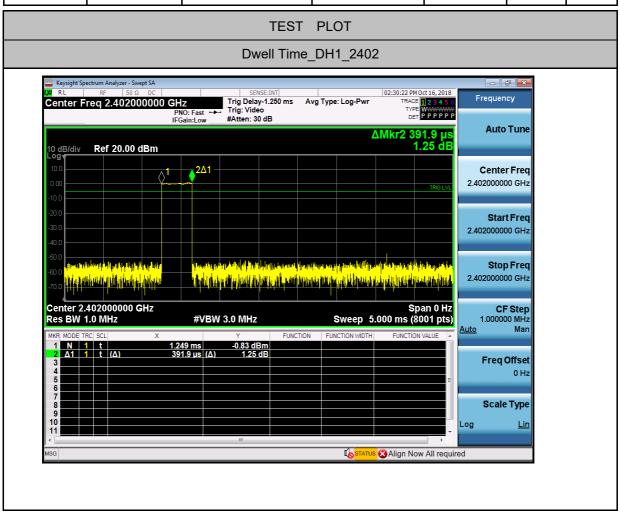


Report No.: GZEM180900066801

Page: 52 of 101

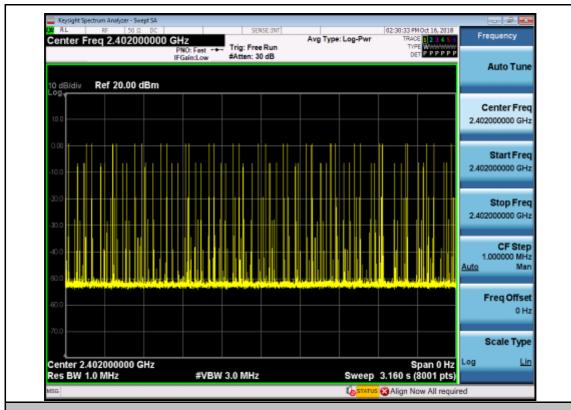


#### Dwell Time\_DH1\_2441

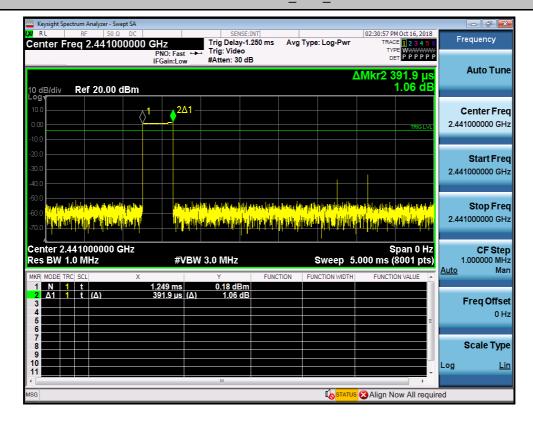




Report No.: GZEM180900066801

Page: 53 of 101

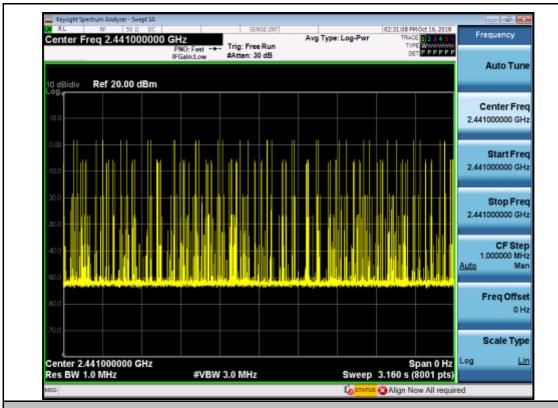


#### Dwell Time\_DH1\_2480

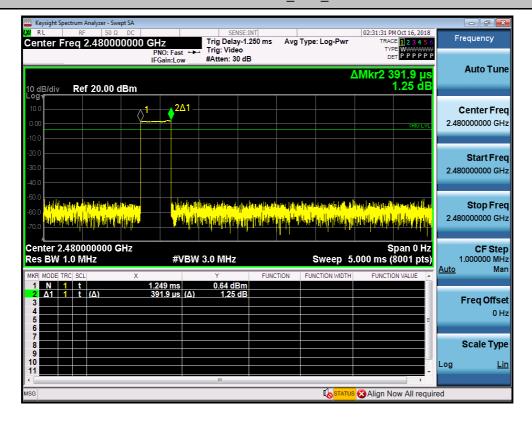




Report No.: GZEM180900066801

Page: 54 of 101

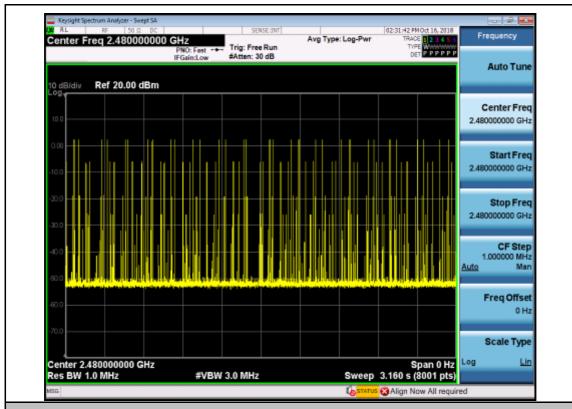


#### Dwell Time\_DH3\_2402

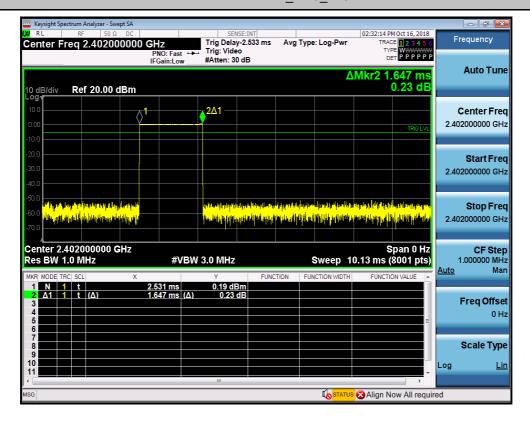




Report No.: GZEM180900066801

Page: 55 of 101

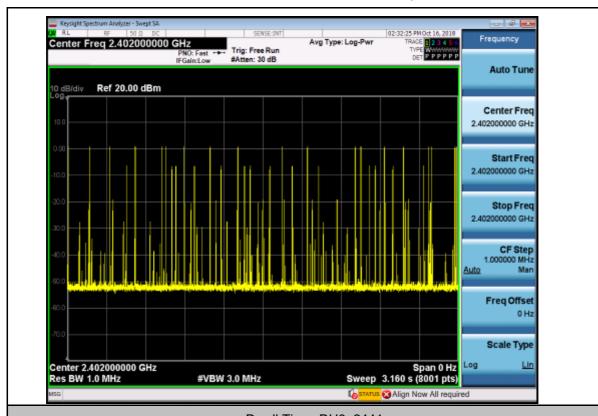


#### Dwell Time\_DH3\_2441

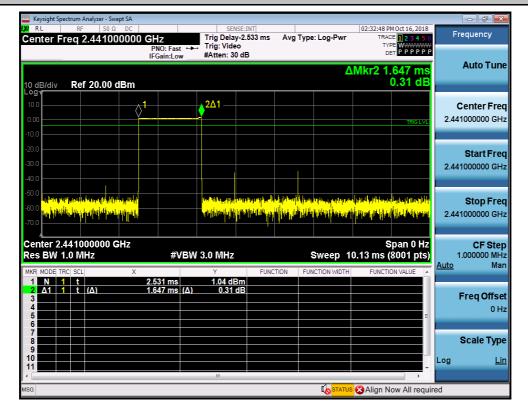




Report No.: GZEM180900066801

Page: 56 of 101

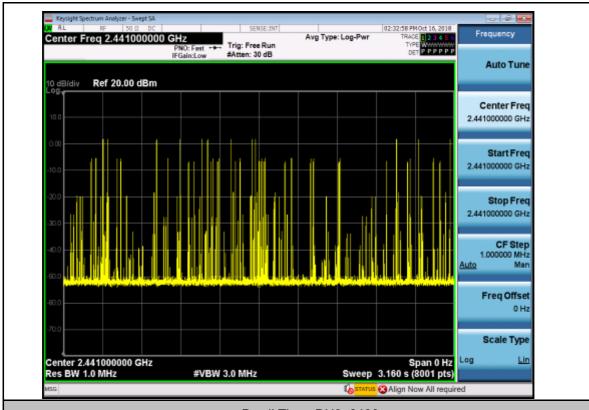


#### Dwell Time\_DH3\_2480

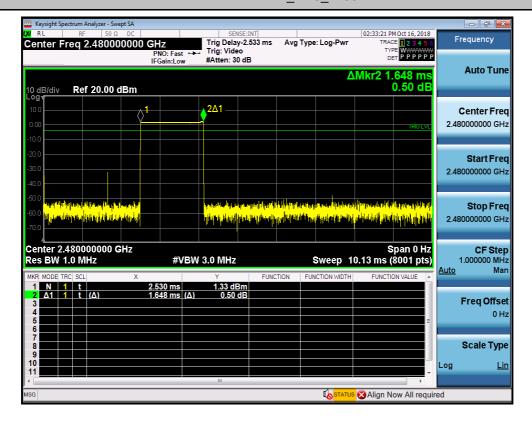




Report No.: GZEM180900066801

Page: 57 of 101

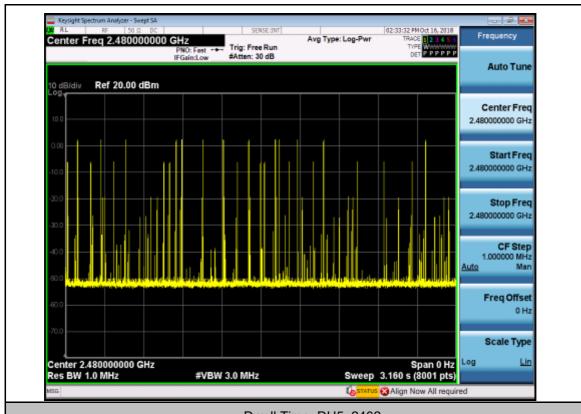


#### Dwell Time\_DH5\_2402

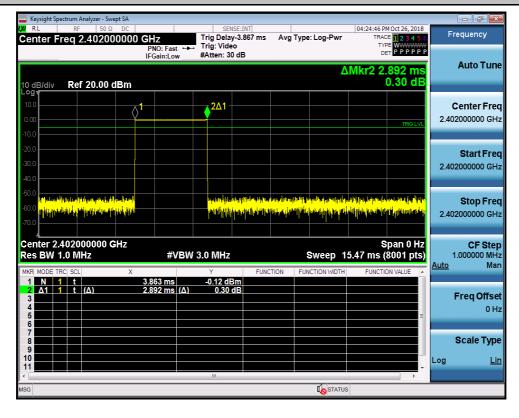




Report No.: GZEM180900066801

Page: 58 of 101

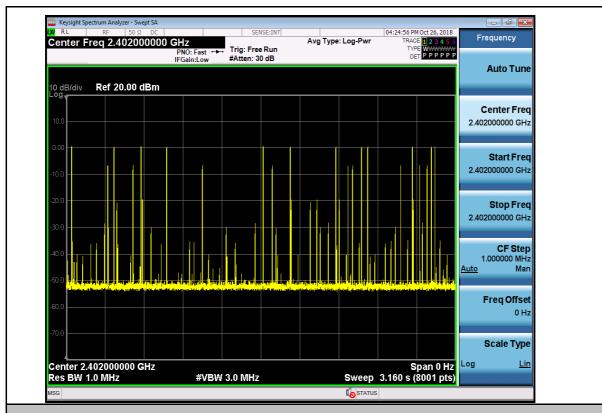


#### Dwell Time\_DH5\_2441

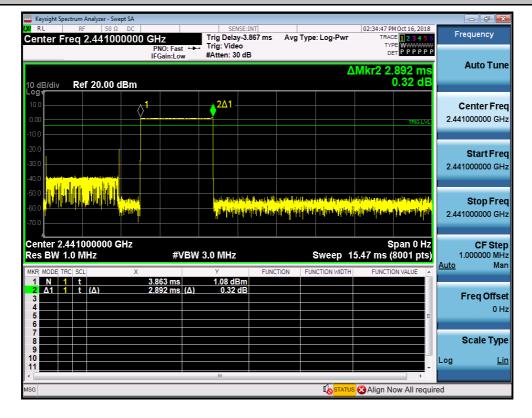




Report No.: GZEM180900066801

Page: 59 of 101

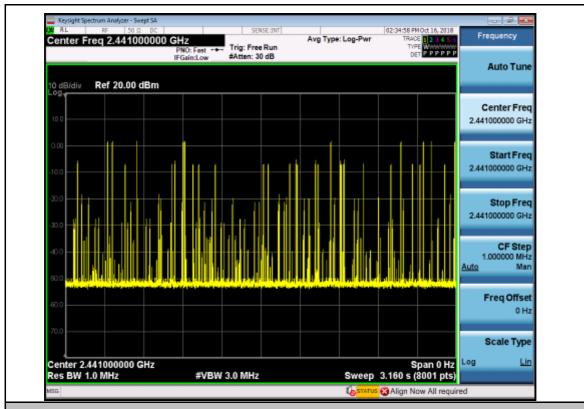


#### Dwell Time\_DH5\_2480

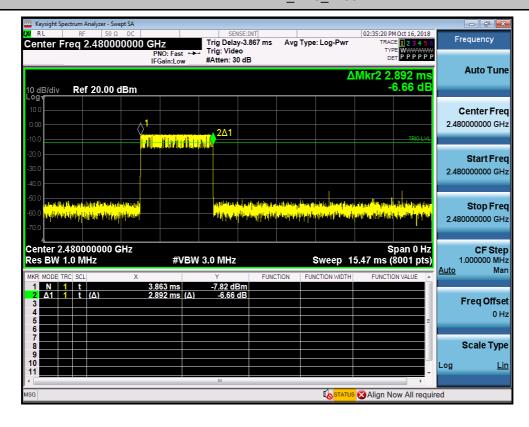




Report No.: GZEM180900066801

Page: 60 of 101

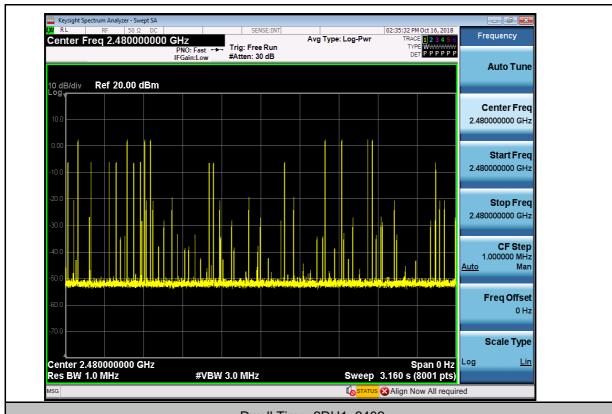


#### Dwell Time\_2DH1\_2402

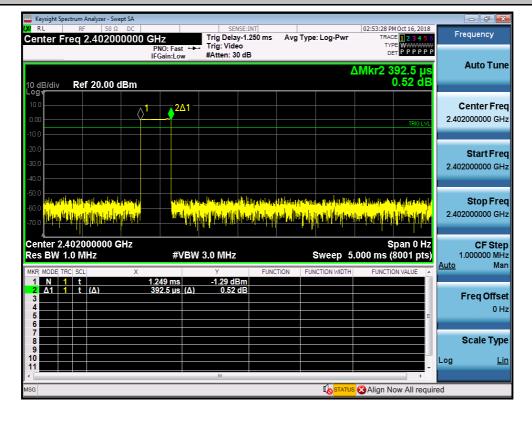




Report No.: GZEM180900066801

Page: 61 of 101

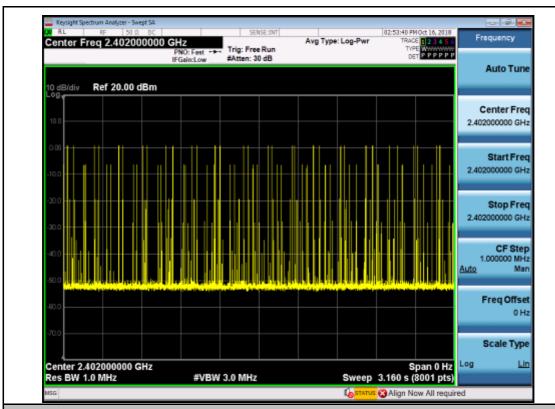


#### Dwell Time\_2DH1\_2441

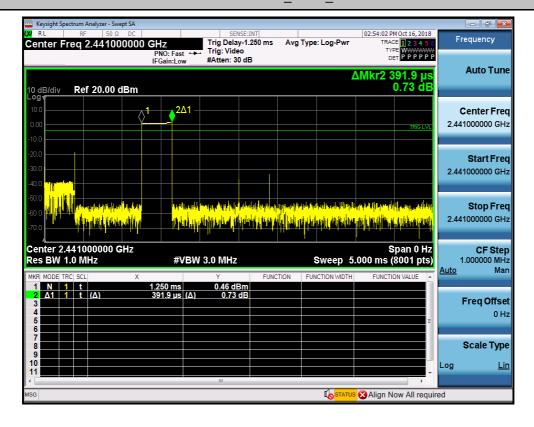




Report No.: GZEM180900066801

Page: 62 of 101

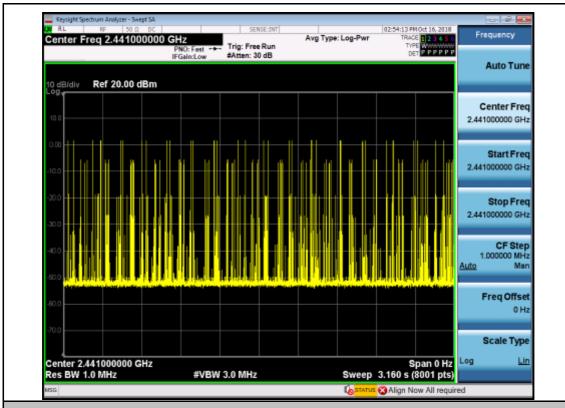


#### Dwell Time\_2DH1\_2480

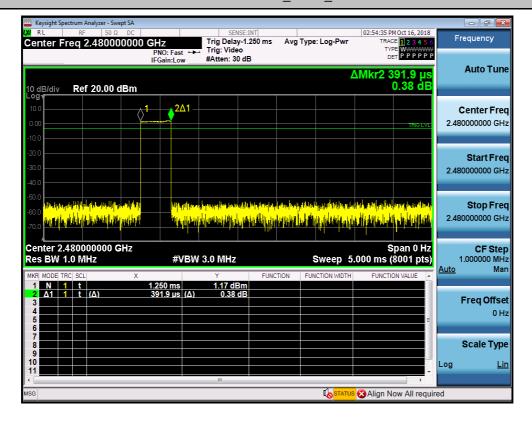




Report No.: GZEM180900066801

Page: 63 of 101

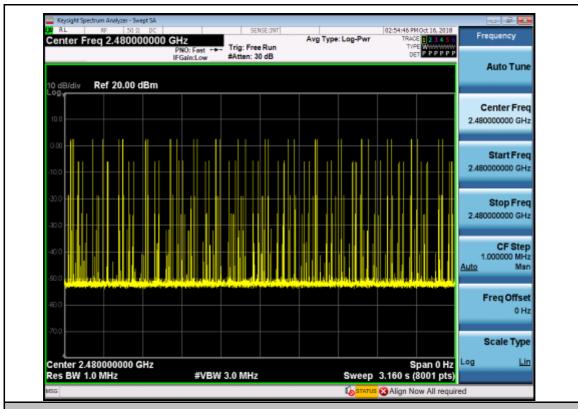


#### Dwell Time\_2DH3\_2402

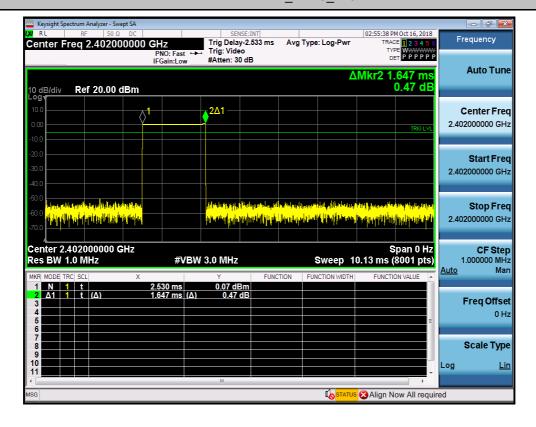




Report No.: GZEM180900066801

Page: 64 of 101

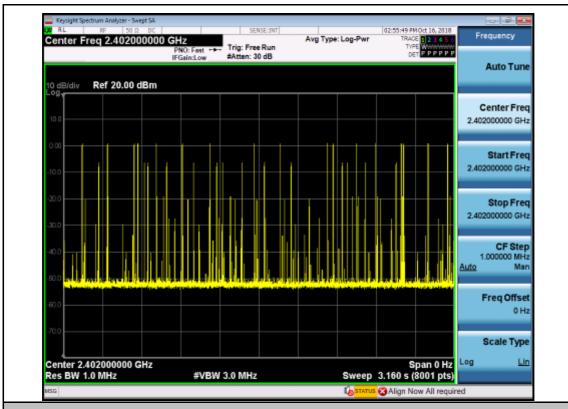


#### Dwell Time\_2DH3\_2441

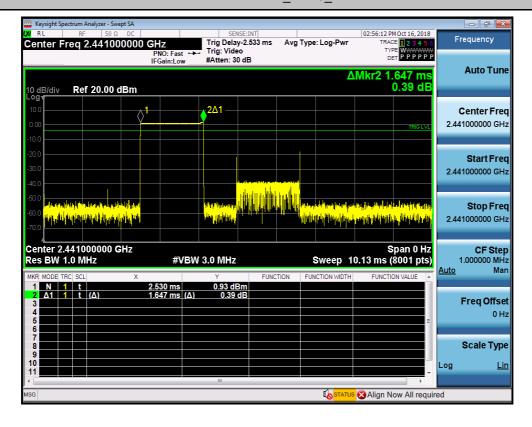




Report No.: GZEM180900066801

Page: 65 of 101

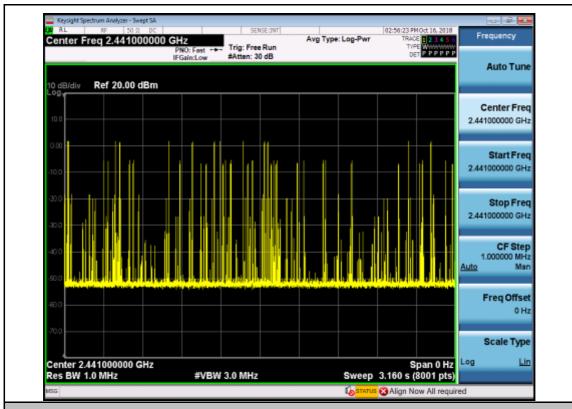


#### Dwell Time\_2DH3\_2480

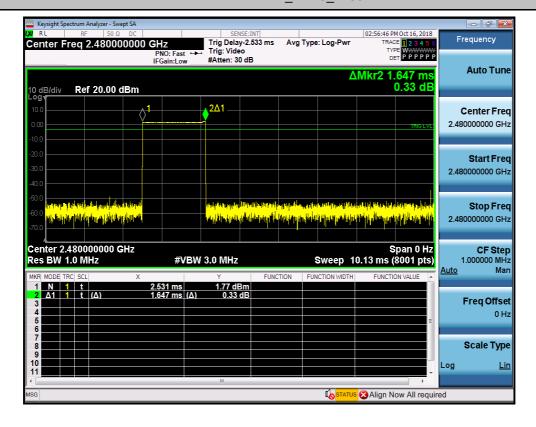




Report No.: GZEM180900066801

Page: 66 of 101

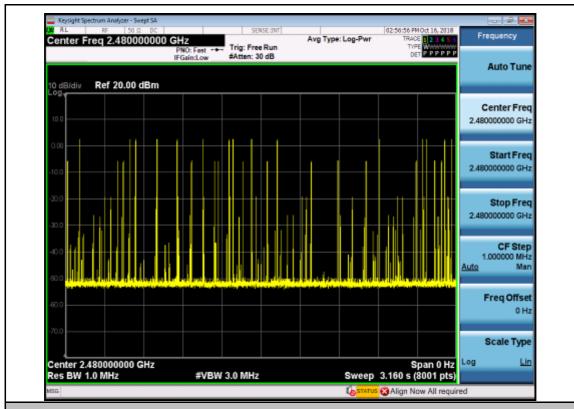


#### Dwell Time 2DH5 2402

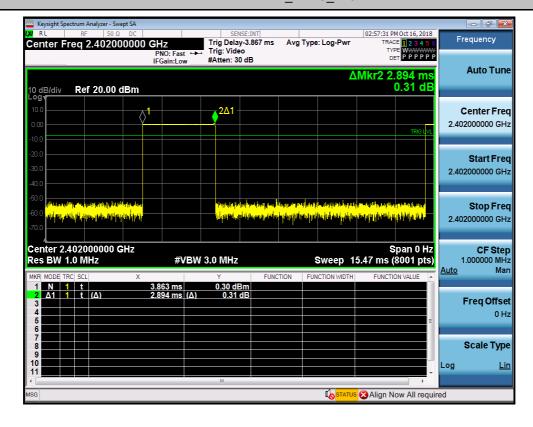




Report No.: GZEM180900066801

Page: 67 of 101

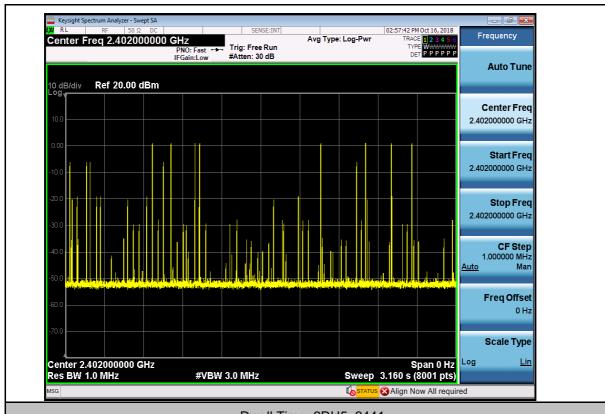


#### Dwell Time\_2DH5 2441

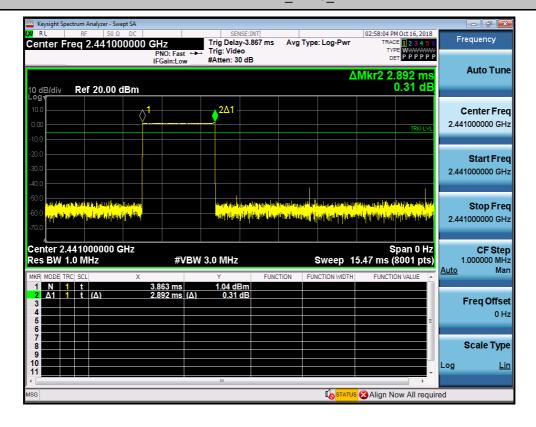




Report No.: GZEM180900066801

Page: 68 of 101

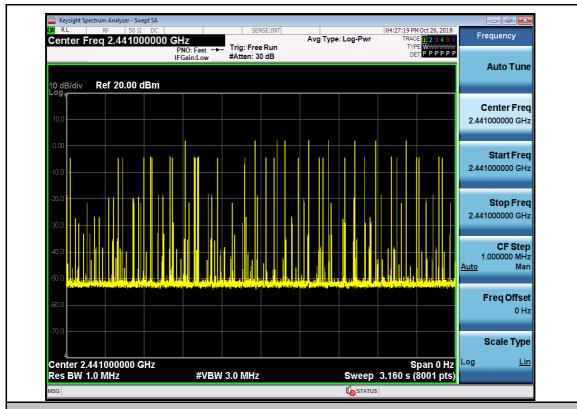


#### Dwell Time\_2DH5 2480

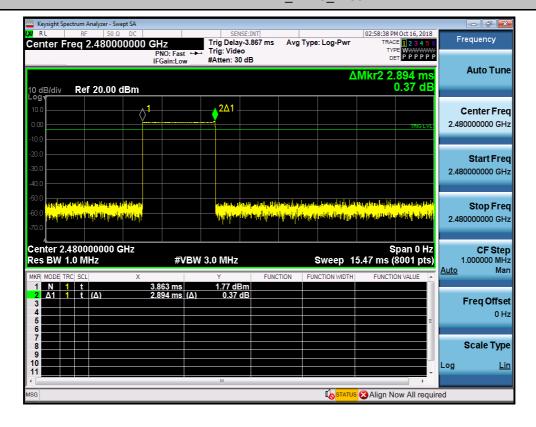




Report No.: GZEM180900066801

Page: 69 of 101

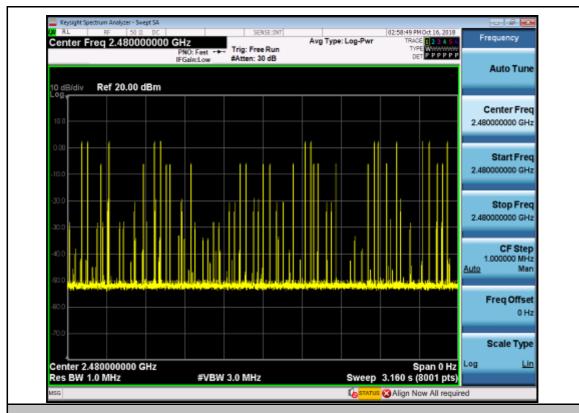


#### Dwell Time\_3DH1\_2402

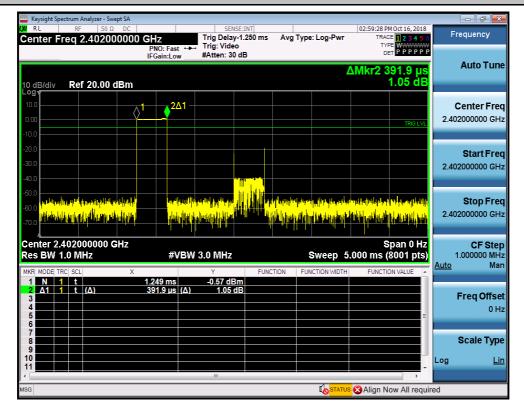




Report No.: GZEM180900066801

Page: 70 of 101

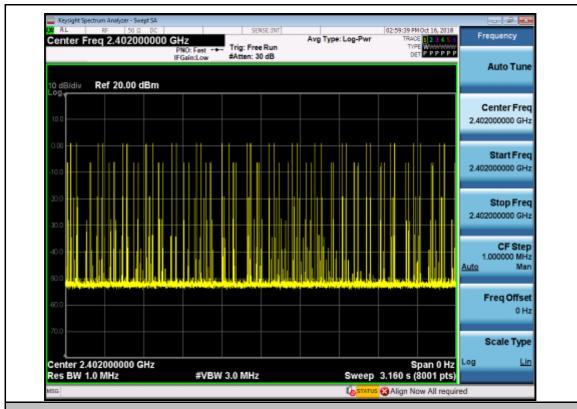


#### Dwell Time\_3DH1\_2441

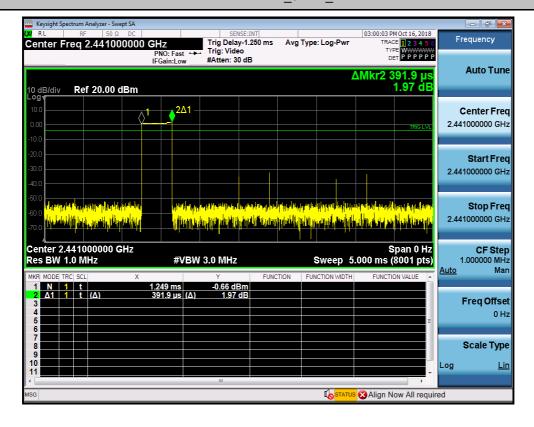




Report No.: GZEM180900066801

Page: 71 of 101

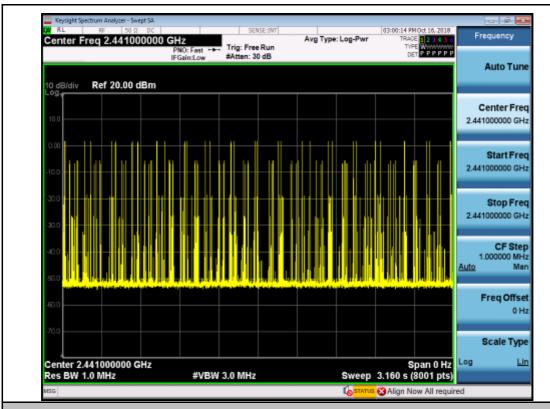


#### Dwell Time\_3DH1\_2480

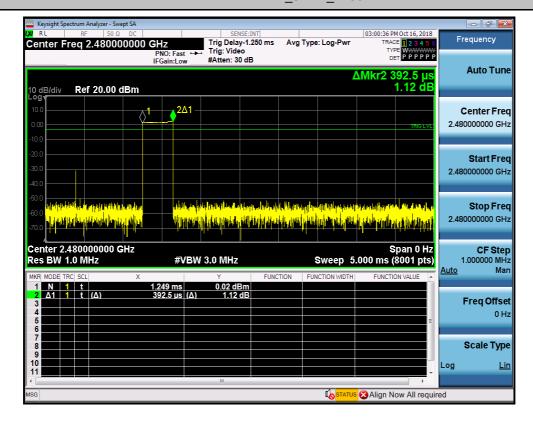




Report No.: GZEM180900066801

Page: 72 of 101

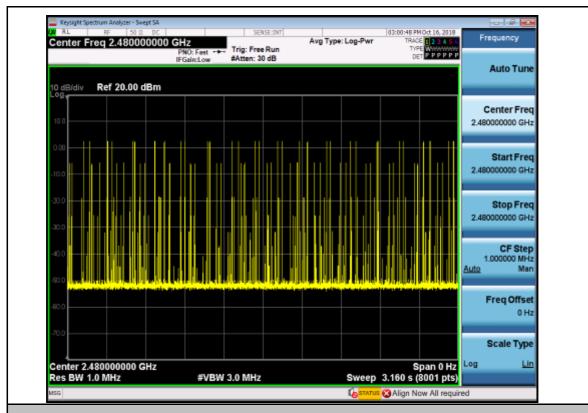


#### Dwell Time\_3DH3\_2402

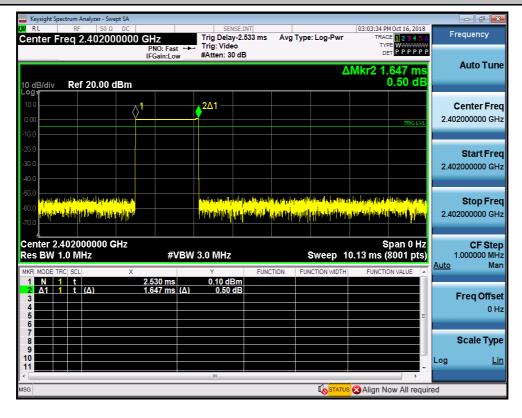




Report No.: GZEM180900066801

Page: 73 of 101

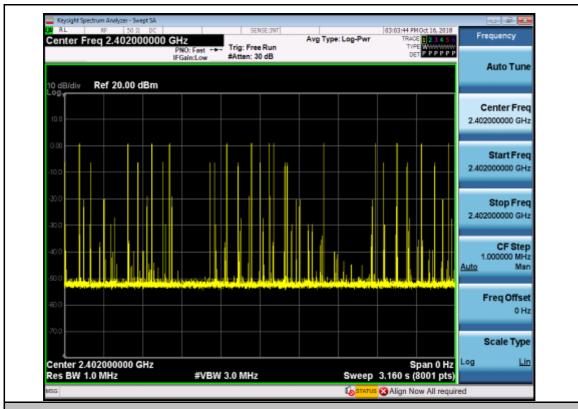


#### Dwell Time\_3DH3\_2441

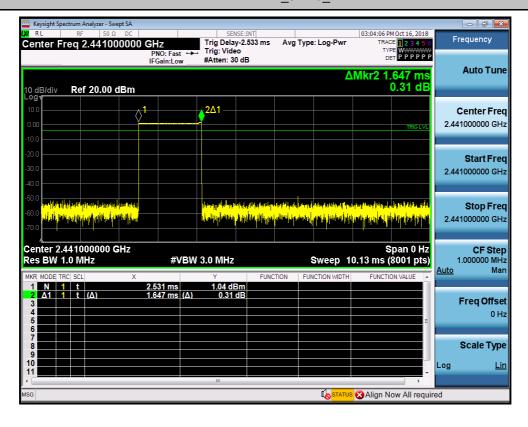




Report No.: GZEM180900066801

Page: 74 of 101

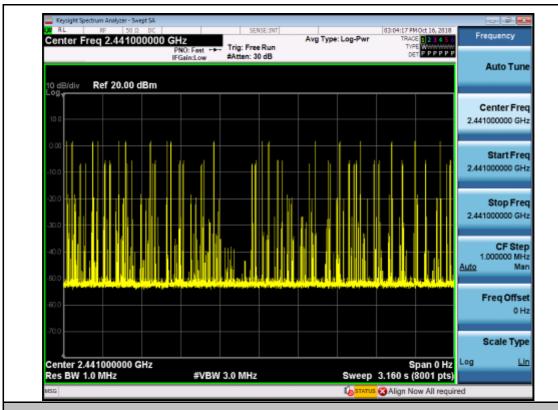


#### Dwell Time\_3DH3\_2480

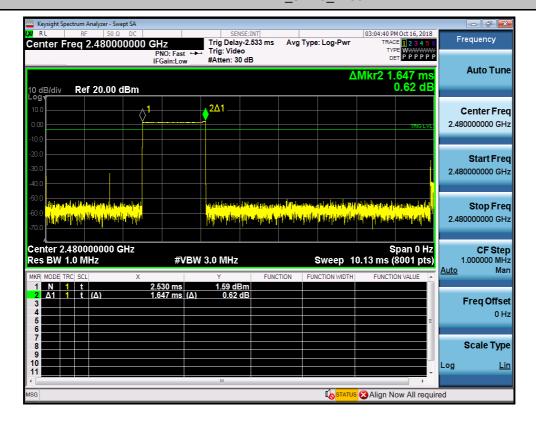




Report No.: GZEM180900066801

Page: 75 of 101

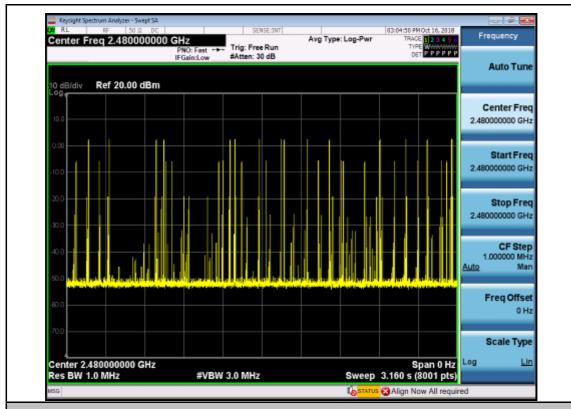


#### Dwell Time\_3DH5\_2402

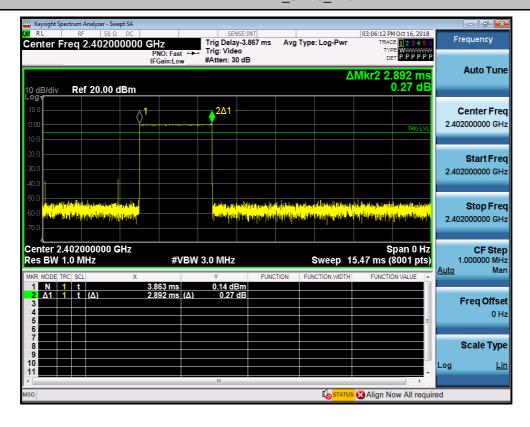




Report No.: GZEM180900066801

Page: 76 of 101

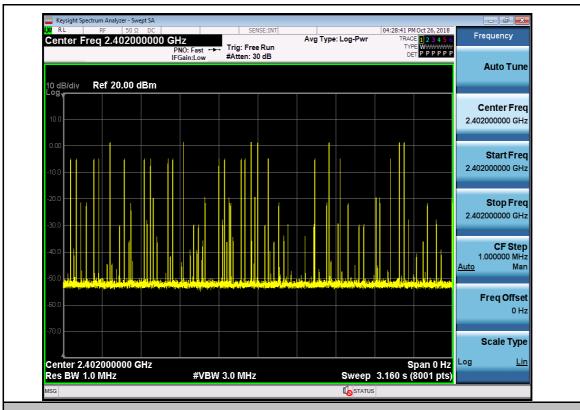


#### Dwell Time\_3DH5\_2441

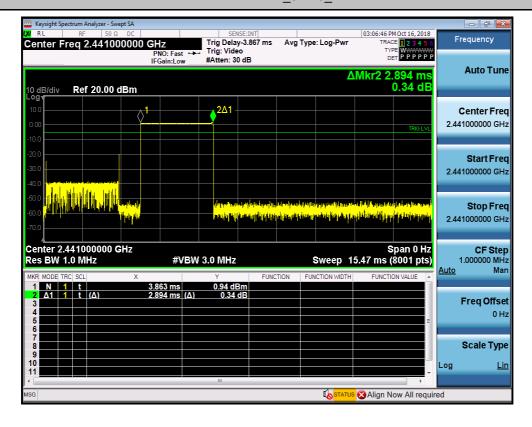




Report No.: GZEM180900066801

Page: 77 of 101

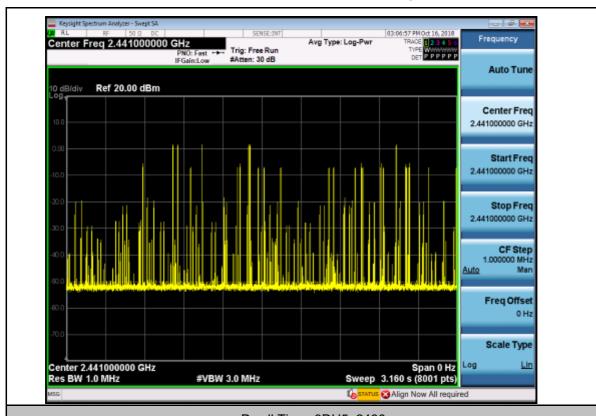


#### Dwell Time\_3DH5\_2480

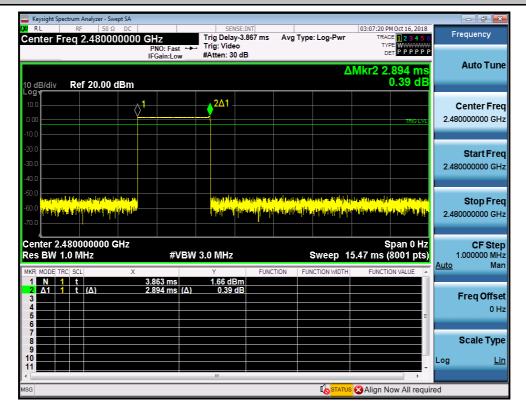



Report No.: GZEM180900066801

Page: 78 of 101

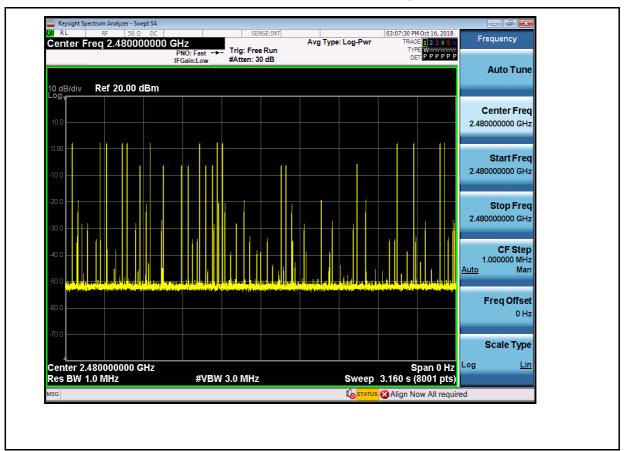


#### 5. Hopping Channel Number

Test Mode	Test Channel	Number of Hopping Channel[N]	Limit[N]	Verdict
DH5	2402	79	>=15	PASS
2DH5	2402	79	>=15	PASS
3DH5	2402	79	>=15	PASS



Report No.: GZEM180900066801


79 of 101 Page:

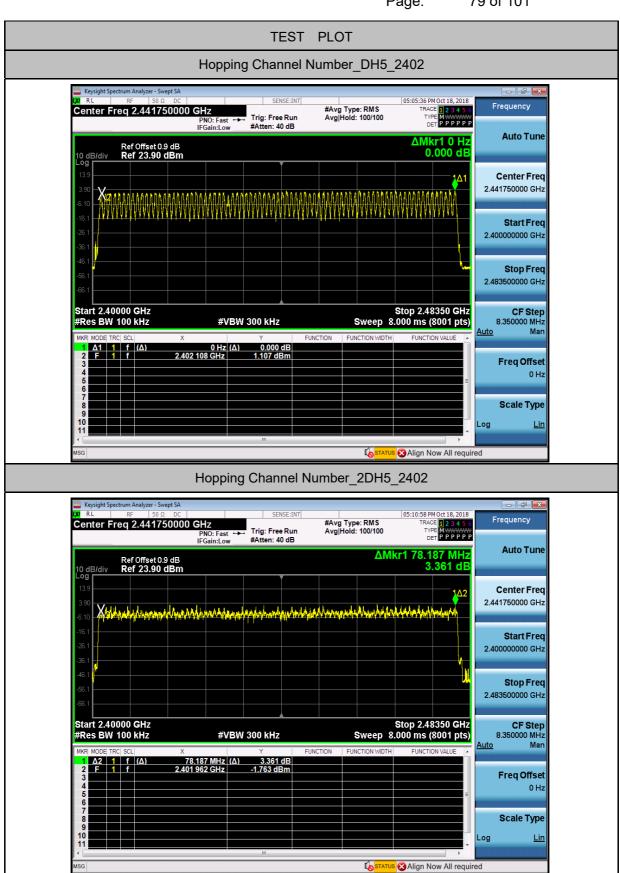



Report No.: GZEM180900066801

Page: 80 of 101

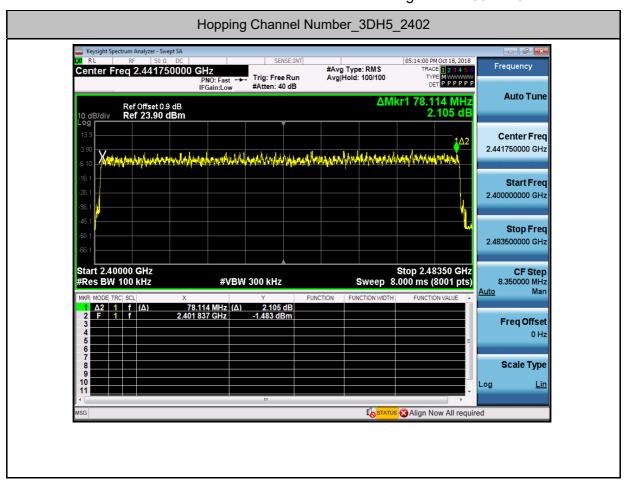


#### 6.Band-edge for RF Conducted Emissions

Test Mode	Test Channel	Hopping	Carrier Power[dBm]	Max. Spurious Level [dBm]	Limit[dBm]	Verdict
DH5	2402	On	2.457	-48.112	-17.54	PASS
DH5	2402	Off	2.095	-48.834	-17.91	PASS
DH5	2480	On	3.700	-45.761	-16.3	PASS
DH5	2480	Off	3.663	-47.163	-16.34	PASS
2DH5	2402	On	2.261	-48.177	-17.74	PASS
2DH5	2402	Off	2.066	-48.250	-17.93	PASS
2DH5	2480	On	3.311	-47.526	-16.69	PASS
2DH5	2480	Off	3.459	-46.043	-16.54	PASS
3DH5	2402	On	2.143	-47.726	-17.86	PASS
3DH5	2402	Off	2.188	-48.046	-17.81	PASS
3DH5	2480	On	3.404	-47.732	-16.6	PASS
3DH5	2480	Off	3.201	-46.120	-16.8	PASS




Report No.: GZEM180900066801

81 of 101 Page:

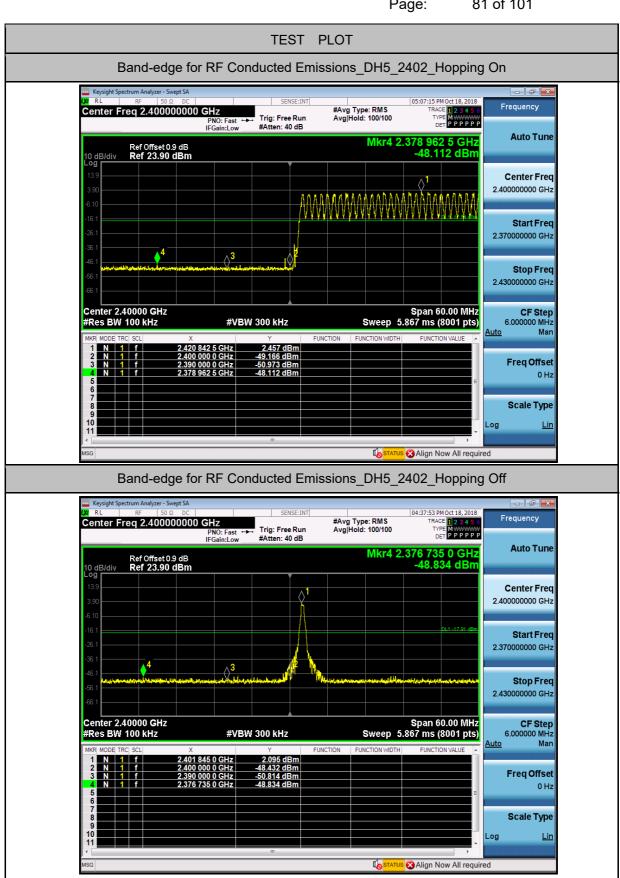




Report No.: GZEM180900066801

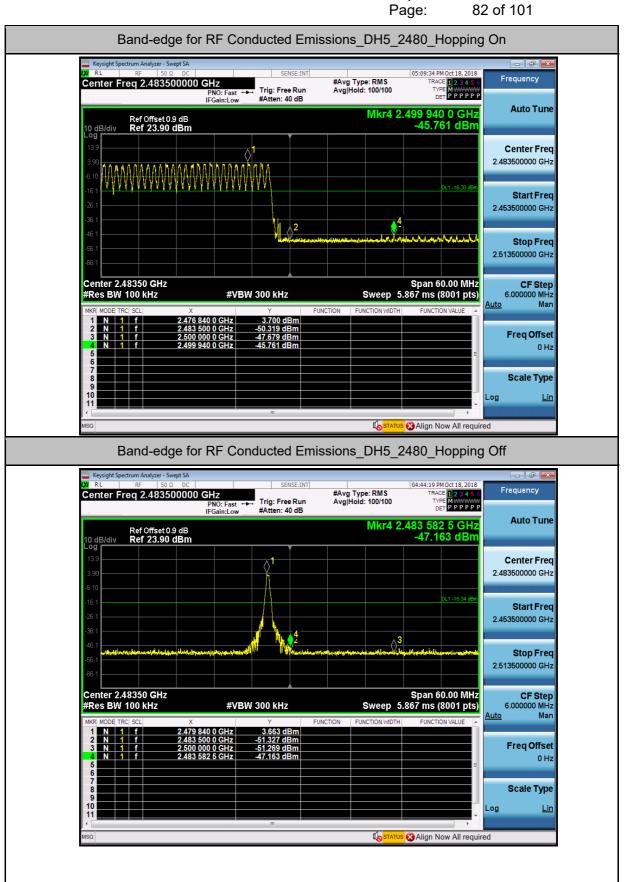



Report No.: GZEM180900066801


83 of 101 Page:

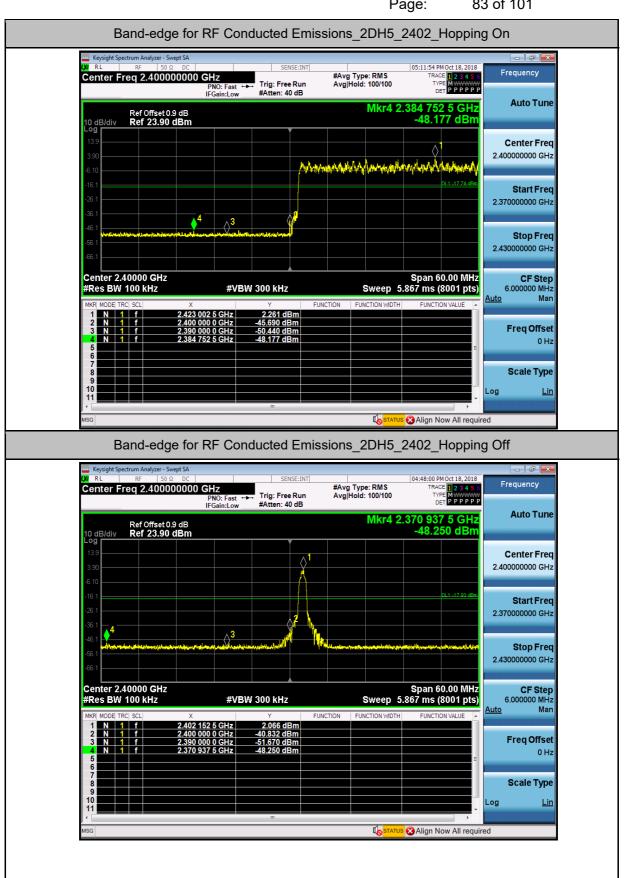



Report No.: GZEM180900066801


Page: 84 of 101

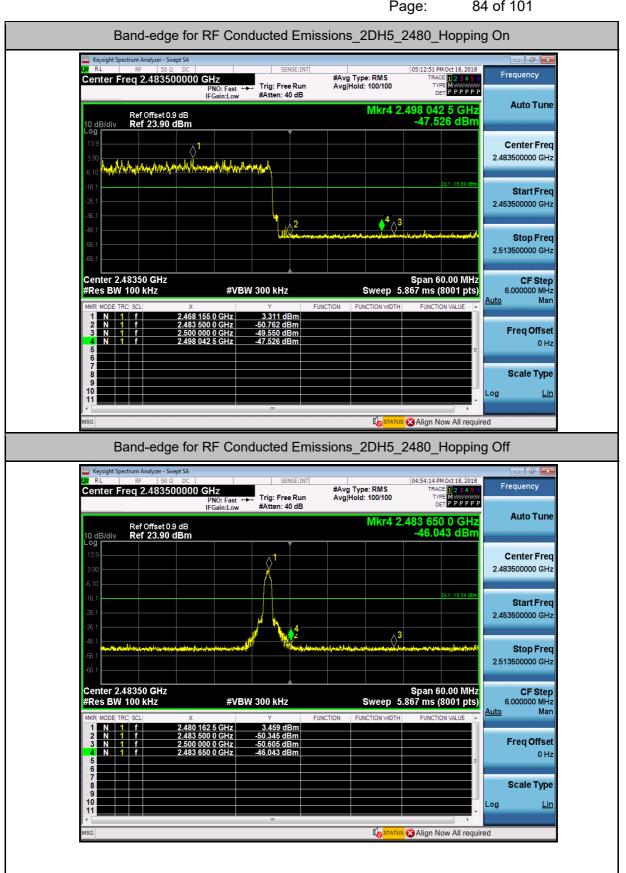



Report No.: GZEM180900066801


Page: 85 of 101

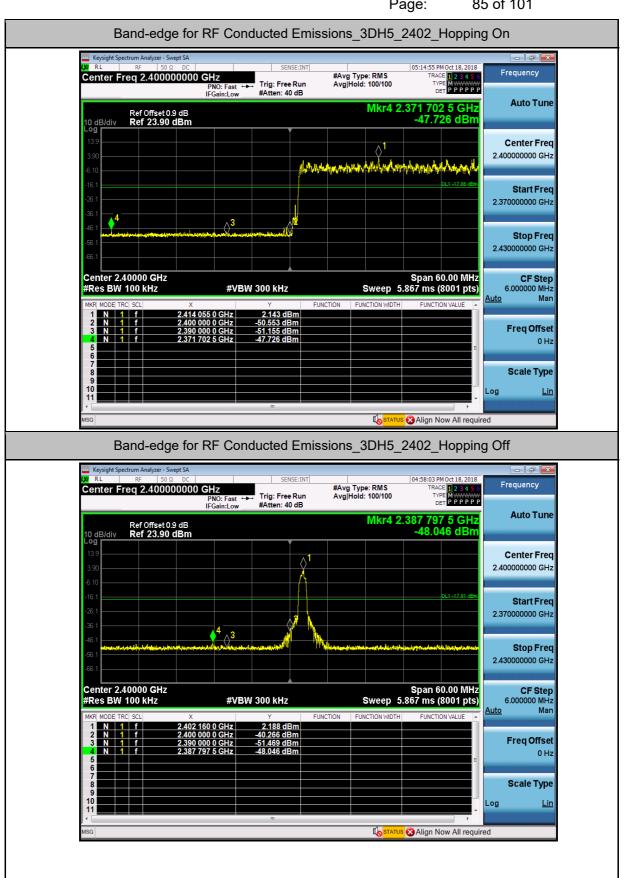



Report No.: GZEM180900066801

86 of 101 Page:

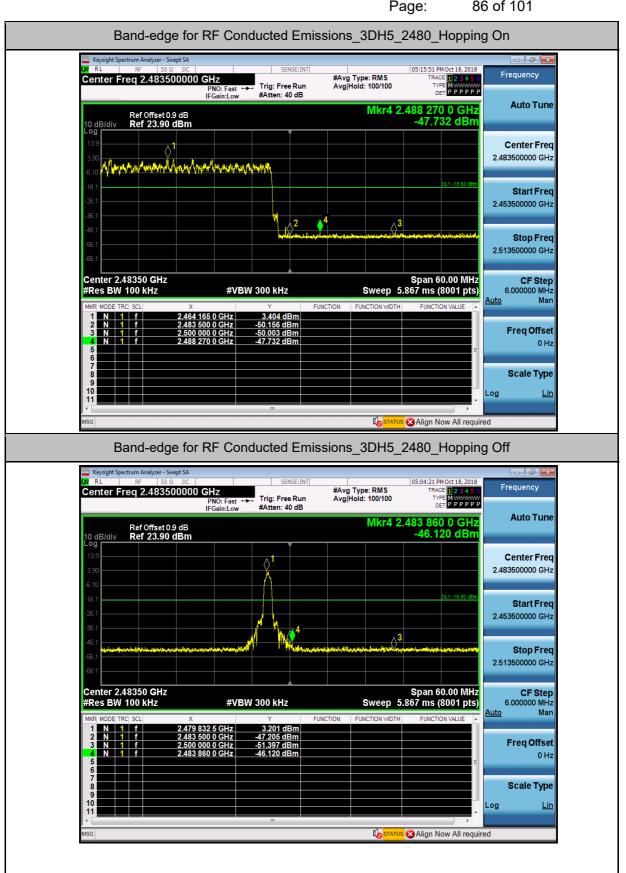



Report No.: GZEM180900066801

Page: 87 of 101


#### 7.RF Conducted Spurious Emissions

Test Mode	Test Channel	StartFre [MHz]	StopFre [MHz]	RBW [kHz]	VBW [kHz]	Pref[dBm]	Max. Level [dBm]	Limit [dBm]	Verdict
DH5	2402	30	10000	100	300	2.125	-49.731	<-17.875	PASS
DH5	2402	10000	26000	100	300	2.125	-51.826	<-17.875	PASS
DH5	2441	30	10000	100	300	2.806	-51.175	<-17.194	PASS
DH5	2441	10000	26000	100	300	2.806	-51.686	<-17.194	PASS
DH5	2480	30	10000	100	300	3.702	-45.663	<-16.298	PASS
DH5	2480	10000	26000	100	300	3.702	-51.669	<-16.298	PASS
2DH5	2402	30	10000	100	300	1.982	-47.922	<-18.018	PASS
2DH5	2402	10000	26000	100	300	1.982	-50.343	<-18.018	PASS
2DH5	2441	30	10000	100	300	2.705	-50.632	<-17.295	PASS
2DH5	2441	10000	26000	100	300	2.705	-51.848	<-17.295	PASS
2DH5	2480	30	10000	100	300	3.335	-49.353	<-16.665	PASS
2DH5	2480	10000	26000	100	300	3.335	-51.965	<-16.665	PASS
3DH5	2402	30	10000	100	300	1.94	-51.814	<-18.06	PASS
3DH5	2402	10000	26000	100	300	1.94	-51.639	<-18.06	PASS
3DH5	2441	30	10000	100	300	2.676	-50.030	<-17.324	PASS
3DH5	2441	10000	26000	100	300	2.676	-51.384	<-17.324	PASS
3DH5	2480	30	10000	100	300	3.4	-46.283	<-16.6	PASS
3DH5	2480	10000	26000	100	300	3.4	-51.667	<-16.6	PASS



Report No.: GZEM180900066801


Page: 88 of 101

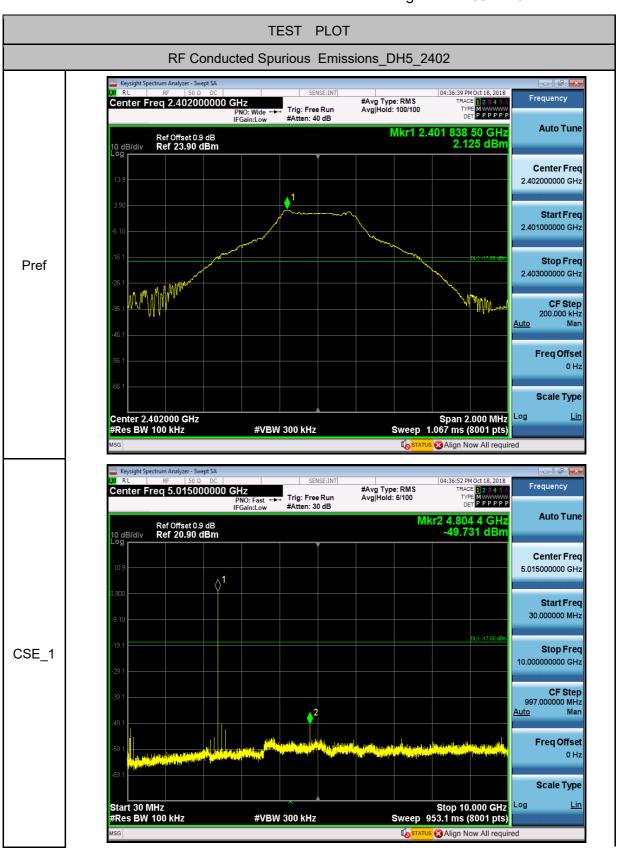



Report No.: GZEM180900066801


Page: 89 of 101

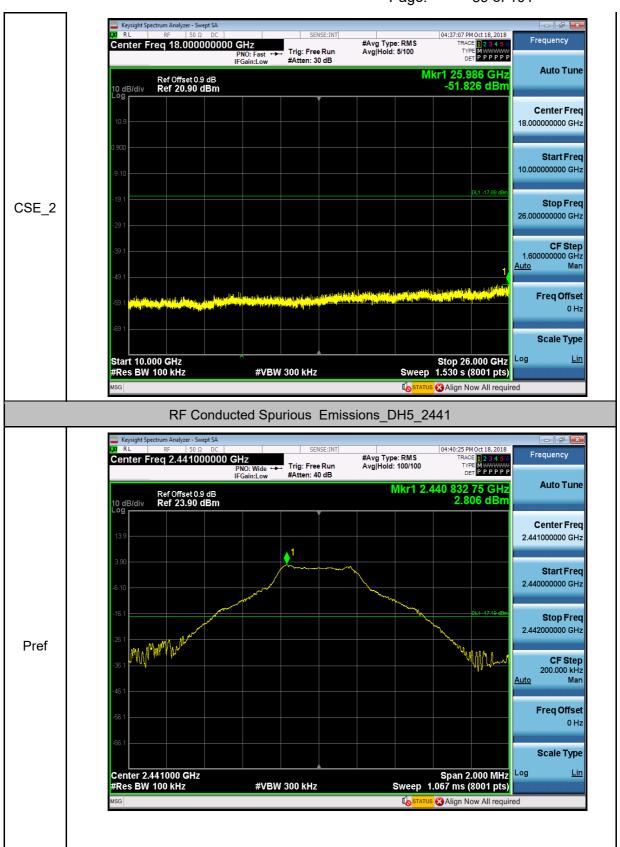




Report No.: GZEM180900066801

Page: 90 of 101

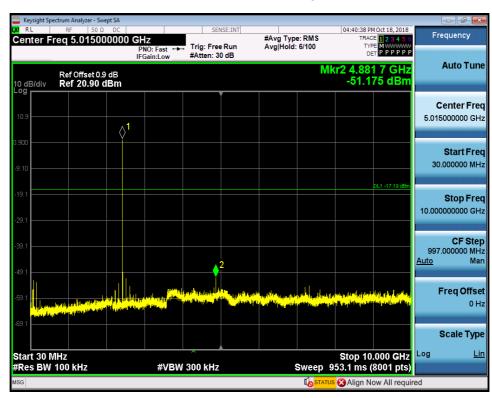

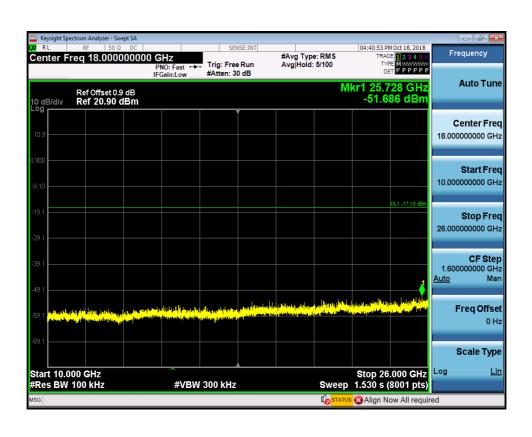


CSE\_1



Report No.: GZEM180900066801


91 of 101 Page:

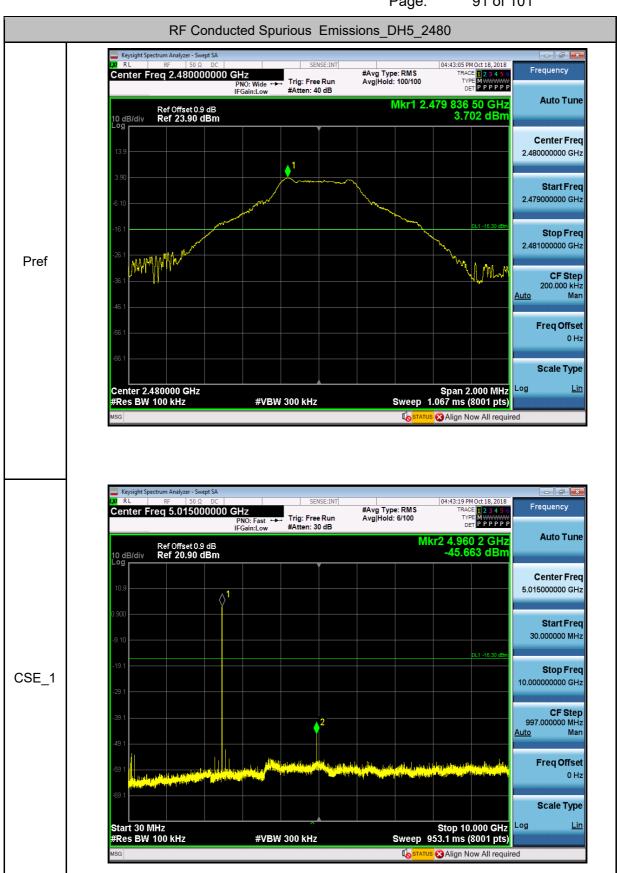



Report No.: GZEM180900066801


Page: 92 of 101

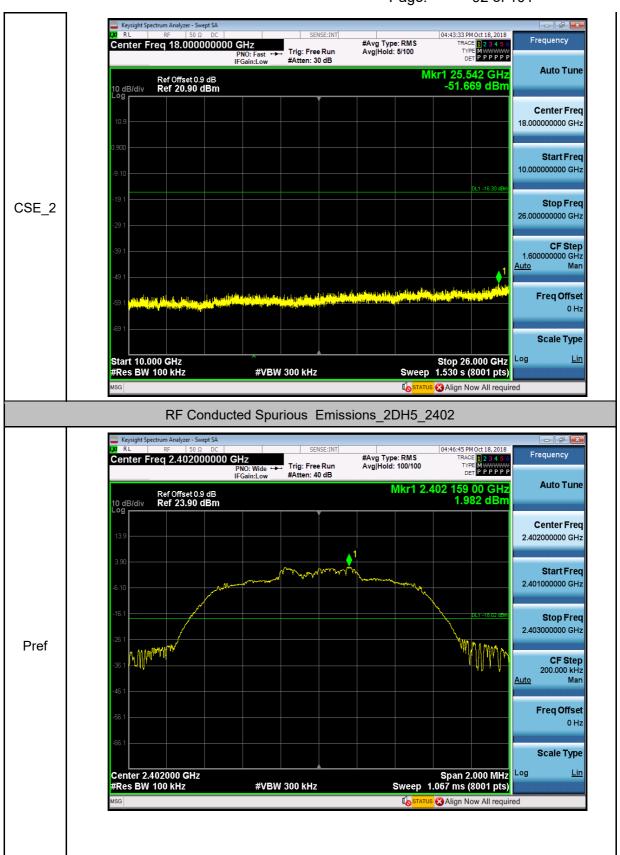




Report No.: GZEM180900066801

Page: 93 of 101

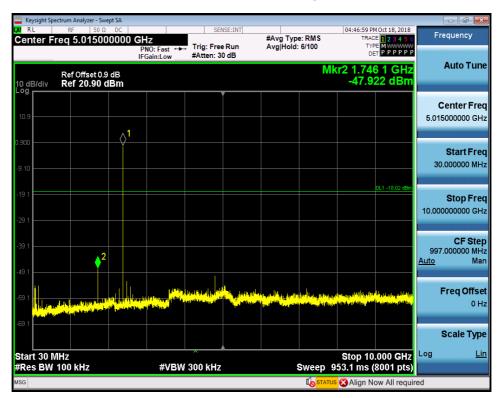

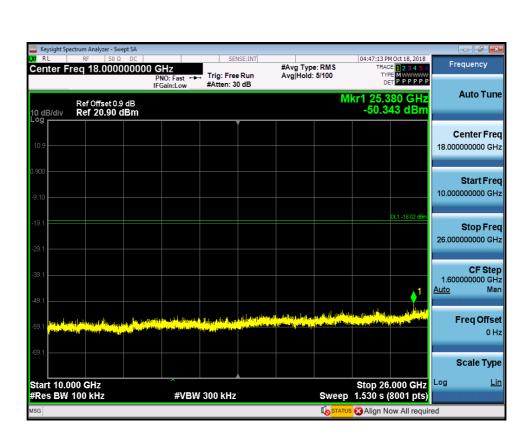


CSE\_1



Report No.: GZEM180900066801


Page: 94 of 101

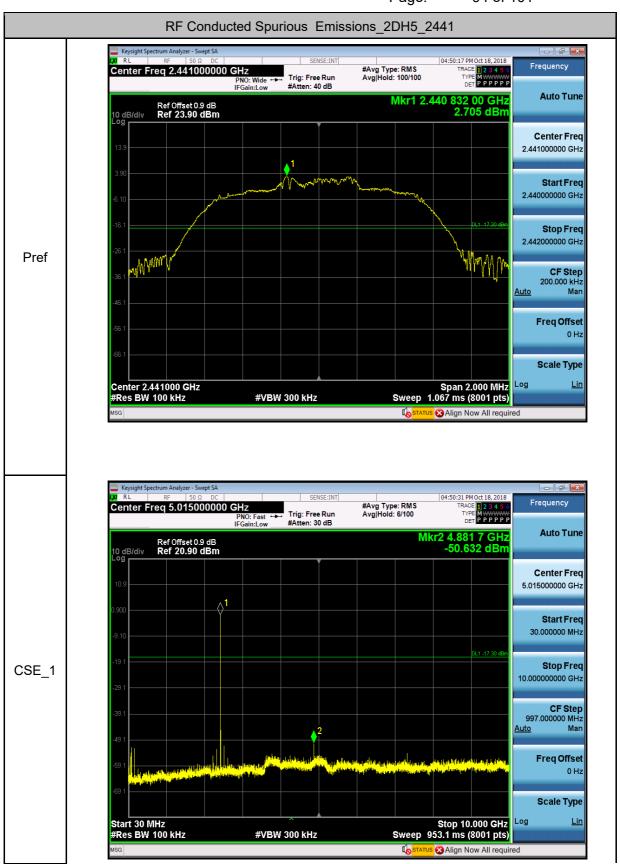



Report No.: GZEM180900066801


Page: 95 of 101

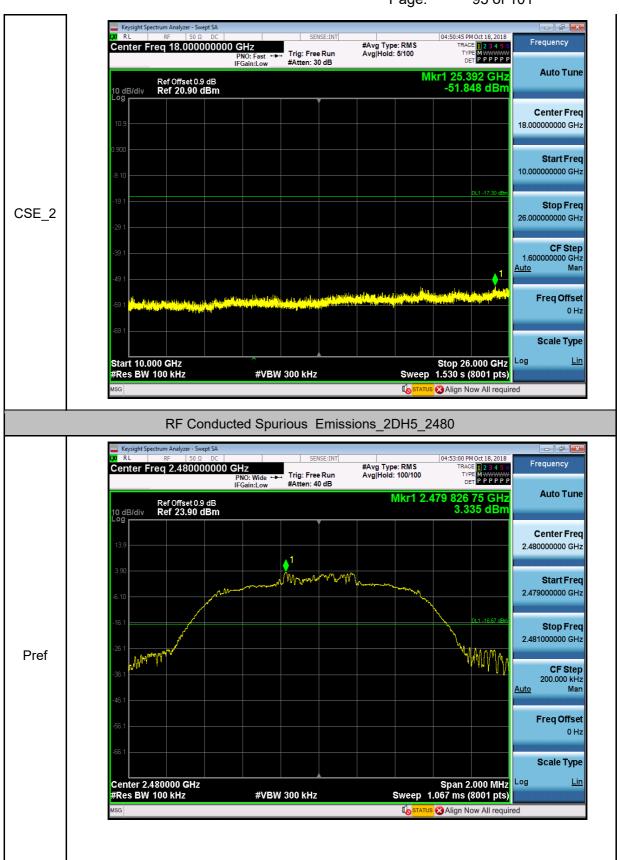




Report No.: GZEM180900066801

Page: 96 of 101

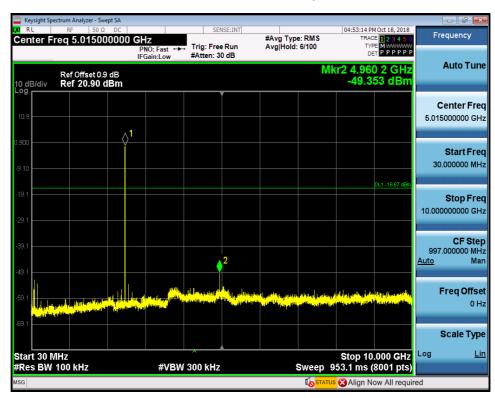

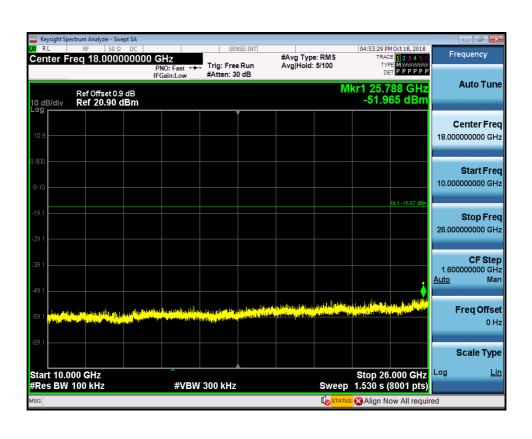


CSE\_1



Report No.: GZEM180900066801


Page: 97 of 101

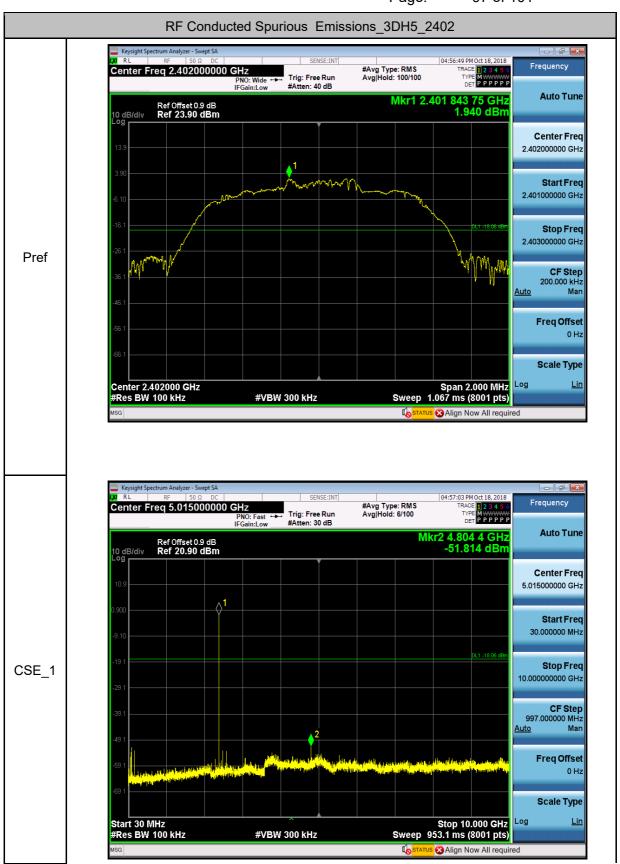



Report No.: GZEM180900066801


Page: 98 of 101

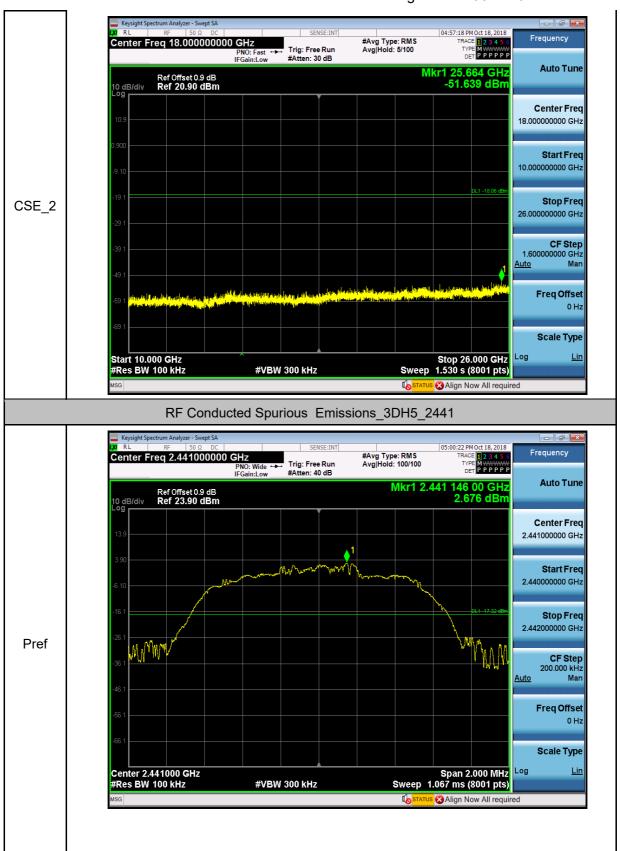




Report No.: GZEM180900066801

Page: 99 of 101

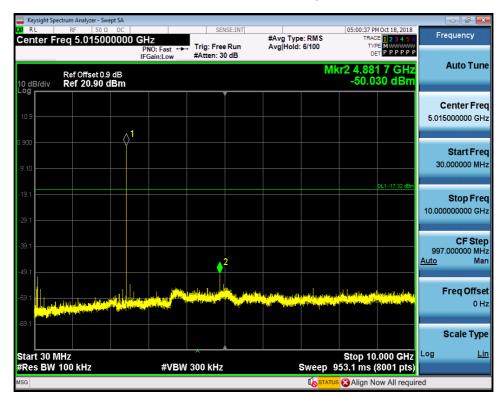

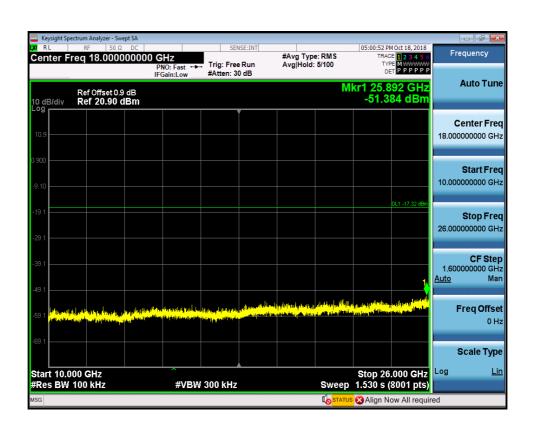


CSE\_1



Report No.: GZEM180900066801


100 of 101 Page:

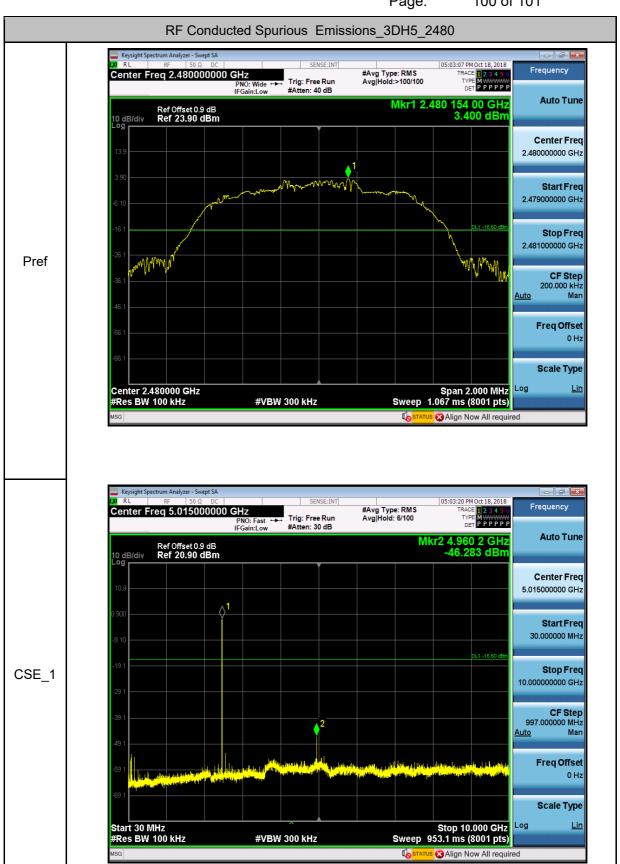



Report No.: GZEM180900066801

Page: 101 of 101

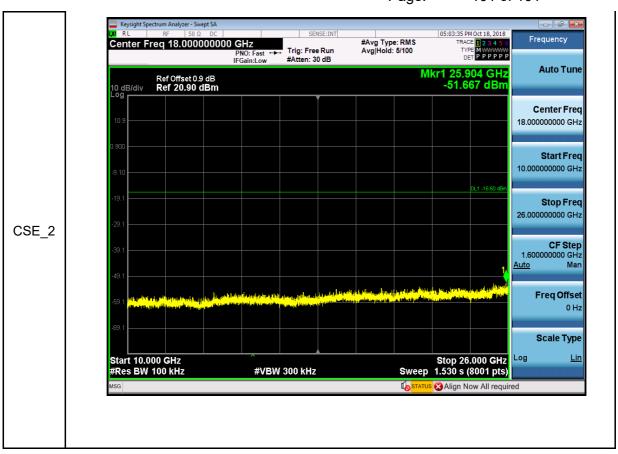

--End of Report—