

Appendix A: Effective (Isotropic) Radiated Power Output Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41(2535-2655)	5MHz	QPSK	40065	1RB#0	22.96	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#0	22.30	PASS
Band41(2535-2655)	5MHz	QPSK	40065	1RB#12	22.92	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#12	22.18	PASS
Band41(2535-2655)	5MHz	QPSK	40065	1RB#24	22.96	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#24	22.31	PASS
Band41(2535-2655)	5MHz	QPSK	40065	12RB#0	22.00	PASS
Band41(2535-2655)	5MHz	16QAM	40065	12RB#0	21.11	PASS
Band41(2535-2655)	5MHz	QPSK	40065	12RB#6	21.97	PASS
Band41(2535-2655)	5MHz	16QAM	40065	12RB#6	21.11	PASS
Band41(2535-2655)	5MHz	QPSK	40065	12RB#13	21.98	PASS
Band41(2535-2655)	5MHz	16QAM	40065	12RB#13	20.98	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	21.99	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	21.17	PASS
Band41(2535-2655)	5MHz	QPSK	40590	1RB#0	23.33	PASS
Band41(2535-2655)	5MHz	16QAM	40590	1RB#0	22.62	PASS
Band41(2535-2655)	5MHz	QPSK	40590	1RB#12	23.39	PASS
Band41(2535-2655)	5MHz	16QAM	40590	1RB#12	22.76	PASS
Band41(2535-2655)	5MHz	QPSK	40590	1RB#24	23.29	PASS
Band41(2535-2655)	5MHz	16QAM	40590	1RB#24	22.69	PASS
Band41(2535-2655)	5MHz	QPSK	40590	12RB#0	22.32	PASS
Band41(2535-2655)	5MHz	16QAM	40590	12RB#0	21.42	PASS
Band41(2535-2655)	5MHz	QPSK	40590	12RB#6	22.32	PASS
Band41(2535-2655)	5MHz	16QAM	40590	12RB#6	21.44	PASS
Band41(2535-2655)	5MHz	QPSK	40590	12RB#13	22.39	PASS
Band41(2535-2655)	5MHz	16QAM	40590	12RB#13	21.47	PASS
Band41(2535-2655)	5MHz	QPSK	40590	25RB#0	22.37	PASS
Band41(2535-2655)	5MHz	16QAM	40590	25RB#0	21.68	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#0	22.99	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#0	22.78	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#12	23.38	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#12	23.78	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#24	23.85	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#24	23.84	PASS
Band41(2535-2655)	5MHz	QPSK	41215	12RB#0	23.34	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band41(2535-2655)	5MHz	16QAM	41215	12RB#0	21.41	PASS
Band41(2535-2655)	5MHz	QPSK	41215	12RB#6	21.34	PASS
Band41(2535-2655)	5MHz	16QAM	41215	12RB#6	21.40	PASS
Band41(2535-2655)	5MHz	QPSK	41215	12RB#13	21.36	PASS
Band41(2535-2655)	5MHz	16QAM	41215	12RB#13	20.44	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	21.37	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	20.53	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#0	23.17	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#0	22.62	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#24	23.10	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#24	22.57	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#49	21.06	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#49	22.47	PASS
Band41(2535-2655)	10MHz	QPSK	40090	25RB#0	22.09	PASS
Band41(2535-2655)	10MHz	16QAM	40090	25RB#0	21.06	PASS
Band41(2535-2655)	10MHz	QPSK	40090	25RB#12	21.95	PASS
Band41(2535-2655)	10MHz	16QAM	40090	25RB#12	21.05	PASS
Band41(2535-2655)	10MHz	QPSK	40090	25RB#25	21.87	PASS
Band41(2535-2655)	10MHz	16QAM	40090	25RB#25	21.06	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	21.99	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	21.12	PASS
Band41(2535-2655)	10MHz	QPSK	40590	1RB#0	23.47	PASS
Band41(2535-2655)	10MHz	16QAM	40590	1RB#0	23.02	PASS
Band41(2535-2655)	10MHz	QPSK	40590	1RB#24	23.56	PASS
Band41(2535-2655)	10MHz	16QAM	40590	1RB#24	23.02	PASS
Band41(2535-2655)	10MHz	QPSK	40590	1RB#49	23.56	PASS
Band41(2535-2655)	10MHz	16QAM	40590	1RB#49	23.13	PASS
Band41(2535-2655)	10MHz	QPSK	40590	25RB#0	22.35	PASS
Band41(2535-2655)	10MHz	16QAM	40590	25RB#0	21.40	PASS
Band41(2535-2655)	10MHz	QPSK	40590	25RB#12	22.34	PASS
Band41(2535-2655)	10MHz	16QAM	40590	25RB#12	21.48	PASS
Band41(2535-2655)	10MHz	QPSK	40590	25RB#25	22.43	PASS
Band41(2535-2655)	10MHz	16QAM	40590	25RB#25	21.53	PASS
Band41(2535-2655)	10MHz	QPSK	40590	50RB#0	22.41	PASS
Band41(2535-2655)	10MHz	16QAM	40590	50RB#0	21.54	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#0	23.89	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#0	23.87	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#24	22.06	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#24	22.94	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band41(2535-2655)	10MHz	QPSK	41190	1RB#49	22.26	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#49	22.90	PASS
Band41(2535-2655)	10MHz	QPSK	41190	25RB#0	22.18	PASS
Band41(2535-2655)	10MHz	16QAM	41190	25RB#0	21.34	PASS
Band41(2535-2655)	10MHz	QPSK	41190	25RB#12	22.19	PASS
Band41(2535-2655)	10MHz	16QAM	41190	25RB#12	22.30	PASS
Band41(2535-2655)	10MHz	QPSK	41190	25RB#25	22.39	PASS
Band41(2535-2655)	10MHz	16QAM	41190	25RB#25	22.34	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	20.35	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	20.38	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#0	21.20	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#0	22.65	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#38	23.14	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#38	22.58	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#74	22.97	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#74	22.51	PASS
Band41(2535-2655)	15MHz	QPSK	40115	38RB#0	21.97	PASS
Band41(2535-2655)	15MHz	16QAM	40115	38RB#0	21.98	PASS
Band41(2535-2655)	15MHz	QPSK	40115	38RB#18	21.99	PASS
Band41(2535-2655)	15MHz	16QAM	40115	38RB#18	21.99	PASS
Band41(2535-2655)	15MHz	QPSK	40115	38RB#37	21.99	PASS
Band41(2535-2655)	15MHz	16QAM	40115	38RB#37	22.00	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	21.99	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	21.07	PASS
Band41(2535-2655)	15MHz	QPSK	40590	1RB#0	23.61	PASS
Band41(2535-2655)	15MHz	16QAM	40590	1RB#0	23.05	PASS
Band41(2535-2655)	15MHz	QPSK	40590	1RB#38	23.62	PASS
Band41(2535-2655)	15MHz	16QAM	40590	1RB#38	22.97	PASS
Band41(2535-2655)	15MHz	QPSK	40590	1RB#74	23.69	PASS
Band41(2535-2655)	15MHz	16QAM	40590	1RB#74	22.72	PASS
Band41(2535-2655)	15MHz	QPSK	40590	38RB#0	22.42	PASS
Band41(2535-2655)	15MHz	16QAM	40590	38RB#0	22.42	PASS
Band41(2535-2655)	15MHz	QPSK	40590	38RB#18	22.42	PASS
Band41(2535-2655)	15MHz	16QAM	40590	38RB#18	22.42	PASS
Band41(2535-2655)	15MHz	QPSK	40590	38RB#37	22.43	PASS
Band41(2535-2655)	15MHz	16QAM	40590	38RB#37	22.43	PASS
Band41(2535-2655)	15MHz	QPSK	40590	75RB#0	22.43	PASS
Band41(2535-2655)	15MHz	16QAM	40590	75RB#0	21.60	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#0	23.01	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band41(2535-2655)	15MHz	16QAM	41165	1RB#0	22.41	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#38	23.00	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#38	22.55	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#74	22.00	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#74	22.65	PASS
Band41(2535-2655)	15MHz	QPSK	41165	38RB#0	20.25	PASS
Band41(2535-2655)	15MHz	16QAM	41165	38RB#0	20.24	PASS
Band41(2535-2655)	15MHz	QPSK	41165	38RB#18	20.23	PASS
Band41(2535-2655)	15MHz	16QAM	41165	38RB#18	21.22	PASS
Band41(2535-2655)	15MHz	QPSK	41165	38RB#37	20.21	PASS
Band41(2535-2655)	15MHz	16QAM	41165	38RB#37	20.20	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	20.20	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	21.45	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#0	22.92	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#0	22.71	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#49	22.75	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#49	22.63	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#99	22.85	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#99	22.63	PASS
Band41(2535-2655)	20MHz	QPSK	40140	50RB#0	21.94	PASS
Band41(2535-2655)	20MHz	16QAM	40140	50RB#0	21.28	PASS
Band41(2535-2655)	20MHz	QPSK	40140	50RB#25	22.01	PASS
Band41(2535-2655)	20MHz	16QAM	40140	50RB#25	21.31	PASS
Band41(2535-2655)	20MHz	QPSK	40140	50RB#50	21.89	PASS
Band41(2535-2655)	20MHz	16QAM	40140	50RB#50	21.10	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	22.00	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	21.10	PASS
Band41(2535-2655)	20MHz	QPSK	40590	1RB#0	23.24	PASS
Band41(2535-2655)	20MHz	16QAM	40590	1RB#0	22.78	PASS
Band41(2535-2655)	20MHz	QPSK	40590	1RB#49	23.34	PASS
Band41(2535-2655)	20MHz	16QAM	40590	1RB#49	22.79	PASS
Band41(2535-2655)	20MHz	QPSK	40590	1RB#99	23.41	PASS
Band41(2535-2655)	20MHz	16QAM	40590	1RB#99	22.93	PASS
Band41(2535-2655)	20MHz	QPSK	40590	50RB#0	22.35	PASS
Band41(2535-2655)	20MHz	16QAM	40590	50RB#0	21.72	PASS
Band41(2535-2655)	20MHz	QPSK	40590	50RB#25	22.33	PASS
Band41(2535-2655)	20MHz	16QAM	40590	50RB#25	21.72	PASS
Band41(2535-2655)	20MHz	QPSK	40590	50RB#50	22.38	PASS
Band41(2535-2655)	20MHz	16QAM	40590	50RB#50	21.73	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band41(2535-2655)	20MHz	QPSK	40590	100RB#0	22.45	PASS
Band41(2535-2655)	20MHz	16QAM	40590	100RB#0	21.62	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#0	24.88	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#0	24.47	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#49	25.03	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#49	24.75	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#99	22.51	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#99	24.98	PASS
Band41(2535-2655)	20MHz	QPSK	41140	50RB#0	24.16	PASS
Band41(2535-2655)	20MHz	16QAM	41140	50RB#0	23.43	PASS
Band41(2535-2655)	20MHz	QPSK	41140	50RB#25	24.20	PASS
Band41(2535-2655)	20MHz	16QAM	41140	50RB#25	23.45	PASS
Band41(2535-2655)	20MHz	QPSK	41140	50RB#50	24.43	PASS
Band41(2535-2655)	20MHz	16QAM	41140	50RB#50	23.74	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	24.26	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	23.45	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41(2535-2655)	5MHz	QPSK	40065	1RB#0	3.82	13	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#0	4.67	13	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	5.06	13	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#0	4.02	13	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#0	4.66	13	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	5.13	13	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	5.82	13	PASS
Band41(2535-2655)	10MHz	QPSK	40590	1RB#0	5.51	13	PASS
Band41(2535-2655)	10MHz	16QAM	40590	1RB#0	6.41	13	PASS
Band41(2535-2655)	10MHz	QPSK	40590	50RB#0	6.00	13	PASS
Band41(2535-2655)	10MHz	16QAM	40590	50RB#0	6.74	13	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#0	4.69	13	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#0	4.94	13	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	5.43	13	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	6.13	13	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#0	3.98	13	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#0	4.68	13	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	5.36	13	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	5.97	13	PASS
Band41(2535-2655)	15MHz	QPSK	40590	1RB#0	5.59	13	PASS
Band41(2535-2655)	15MHz	16QAM	40590	1RB#0	6.46	13	PASS
Band41(2535-2655)	15MHz	QPSK	40590	75RB#0	6.22	13	PASS
Band41(2535-2655)	15MHz	16QAM	40590	75RB#0	6.82	13	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#0	4.32	13	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#0	5.00	13	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	5.58	13	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	6.20	13	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#0	3.94	13	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#0	4.28	13	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	5.18	13	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	5.94	13	PASS
Band41(2535-2655)	20MHz	QPSK	40590	1RB#0	5.50	13	PASS
Band41(2535-2655)	20MHz	16QAM	40590	1RB#0	5.96	13	PASS
Band41(2535-2655)	20MHz	QPSK	40590	100RB#0	5.77	13	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band41(2535-2655)	20MHz	16QAM	40590	100RB#0	6.63	13	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#0	3.87	13	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#0	4.38	13	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	5.20	13	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	5.99	13	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd


Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>


Test Graphs




Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

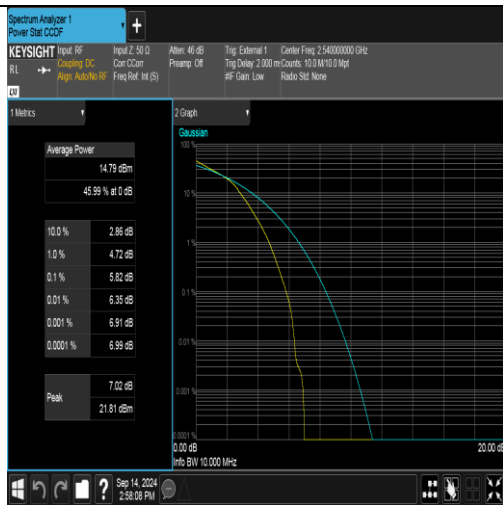


Band41(2535-2655)-10MHz-16QAM-40090-50RB#0-PASS

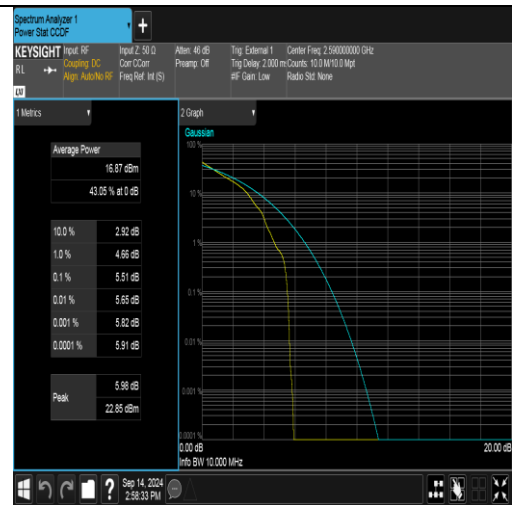


Band41(2535-2655)-10MHz-QPSK-40590-1RB#0-PASS

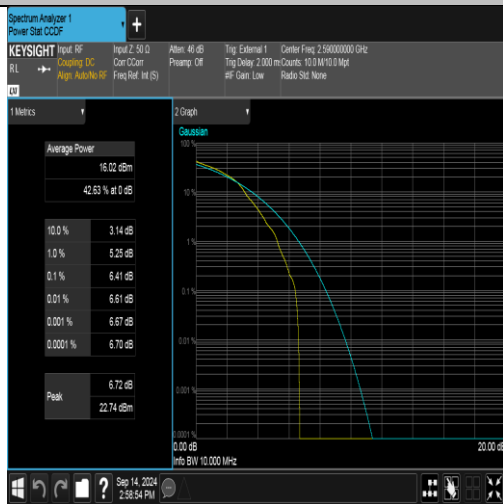


Band41(2535-2655)-10MHz-16QAM-40590-1RB#0-PASS

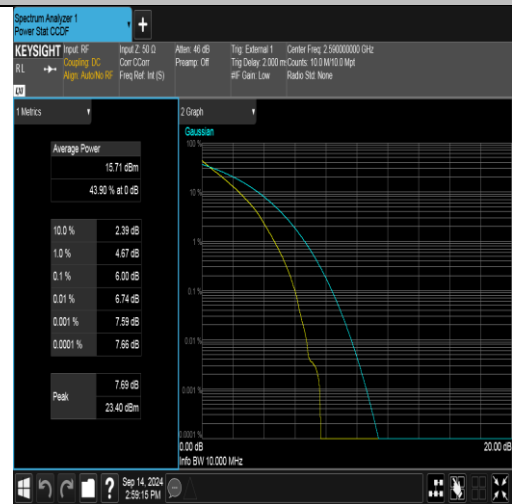

Band41(2535-2655)-10MHz-QPSK-40590-50RB#0-PASS

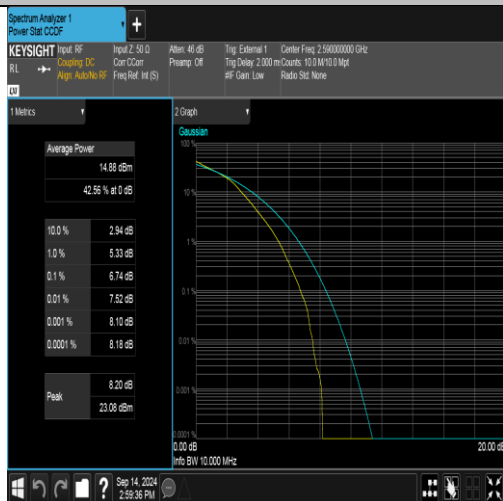


Band41(2535-2655)-10MHz-16QAM-40590-50RB#0-PASS

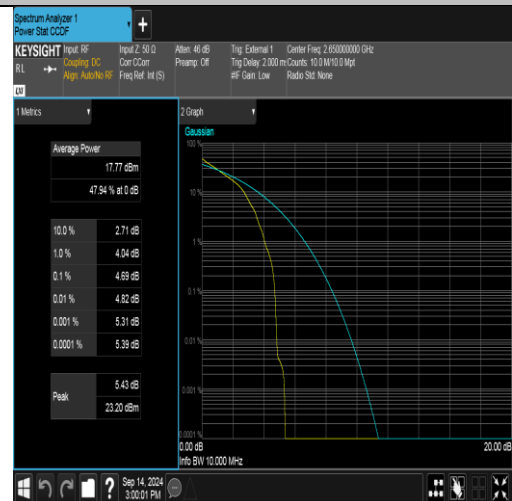


Band41(2535-2655)-10MHz-QPSK-41190-1RB#0-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

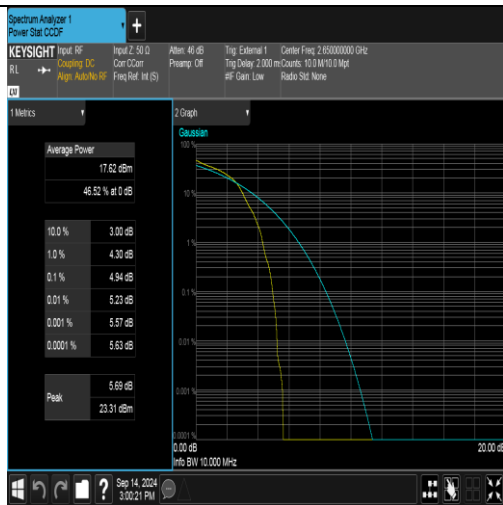


Band41(2535-2655)-10MHz-16QAM-41190-1RB#0-PASS

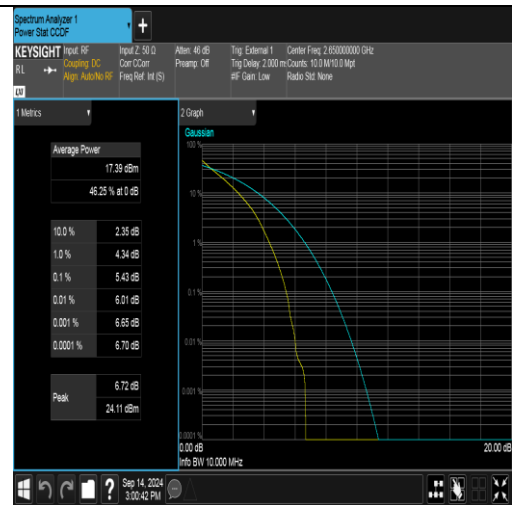


Band41(2535-2655)-10MHz-QPSK-41190-50RB#0-PASS




Band41(2535-2655)-10MHz-16QAM-41190-50RB#0-PASS

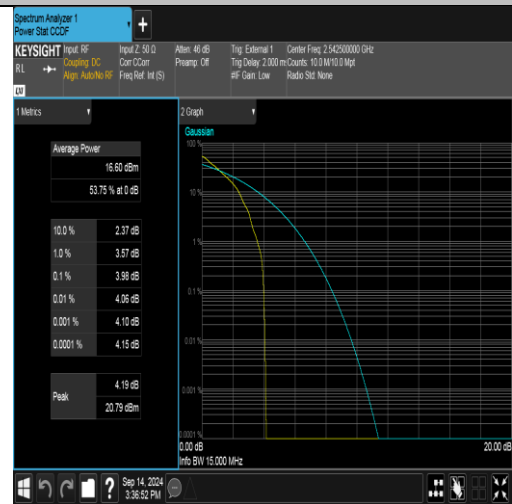

Band41(2535-2655)-15MHz-QPSK-40115-1RB#0-PASS

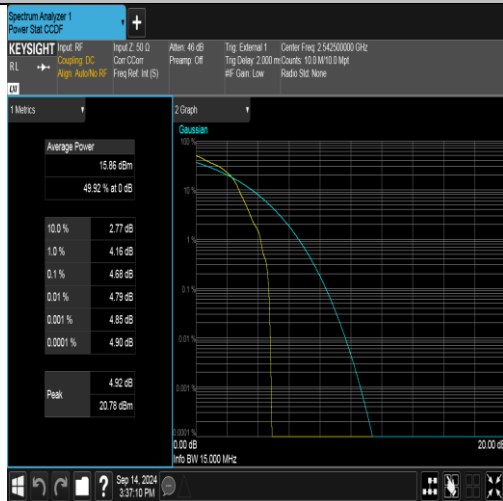

Band41(2535-2655)-15MHz-16QAM-40115-1RB#0-PASS

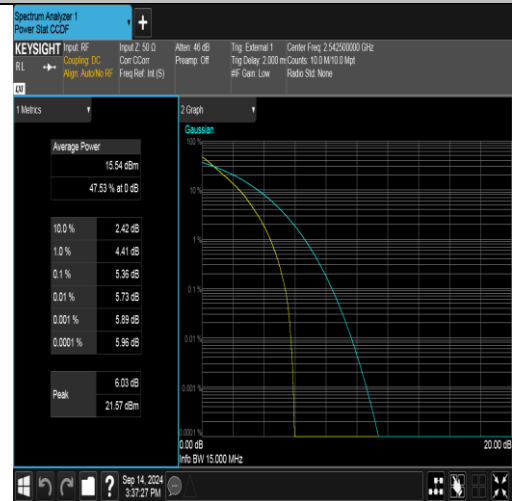


Band41(2535-2655)-15MHz-QPSK-40115-75RB#0-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.




Band41(2535-2655)-15MHz-16QAM-40115-75RB#0-PASS

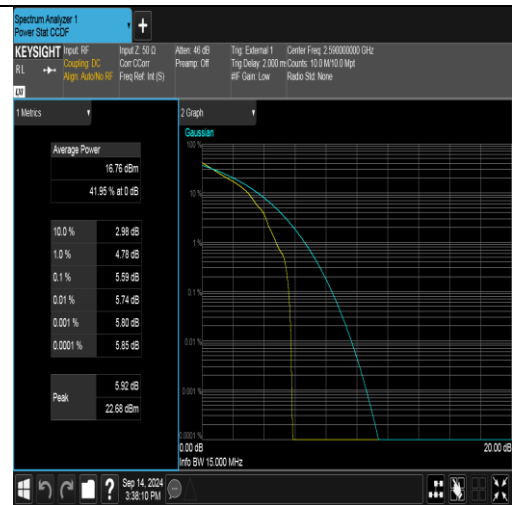


Band41(2535-2655)-15MHz-QPSK-40590-1RB#0-PASS

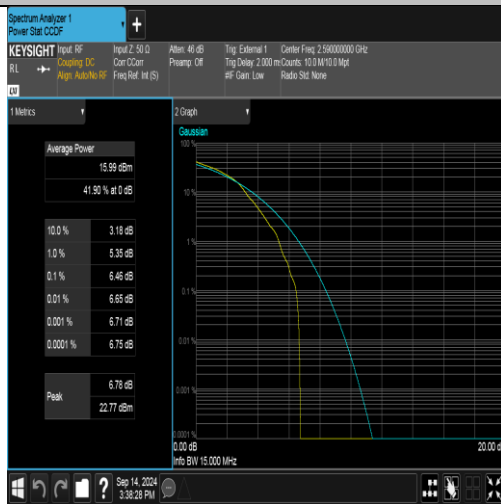


Band41(2535-2655)-15MHz-16QAM-40590-1RB#0-PASS

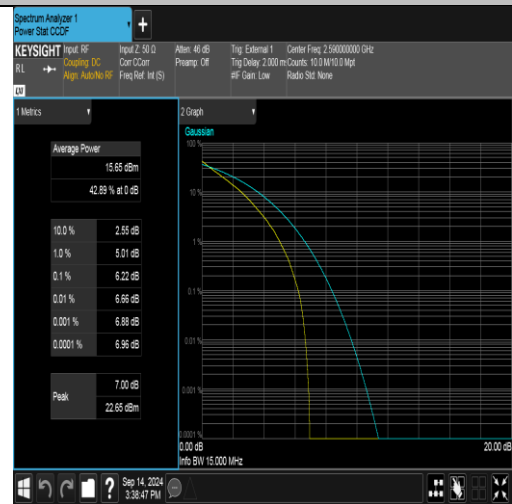

Band41(2535-2655)-15MHz-QPSK-40590-75RB#0-PASS

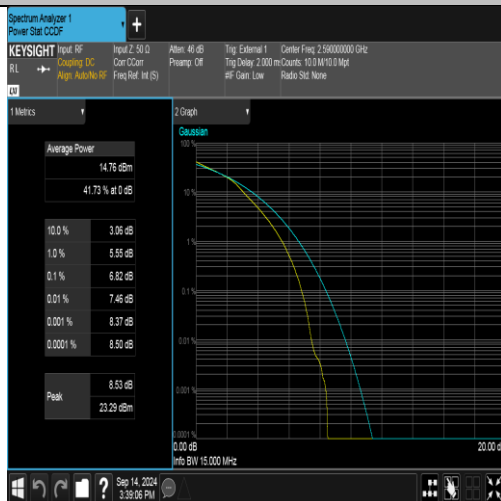


Band41(2535-2655)-15MHz-16QAM-40590-75RB#0-PASS

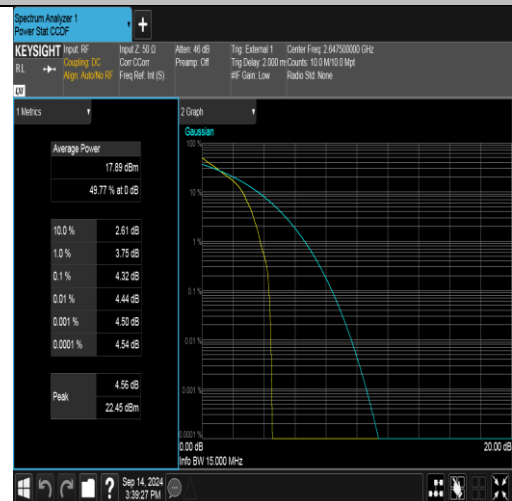


Band41(2535-2655)-15MHz-QPSK-41165-1RB#0-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

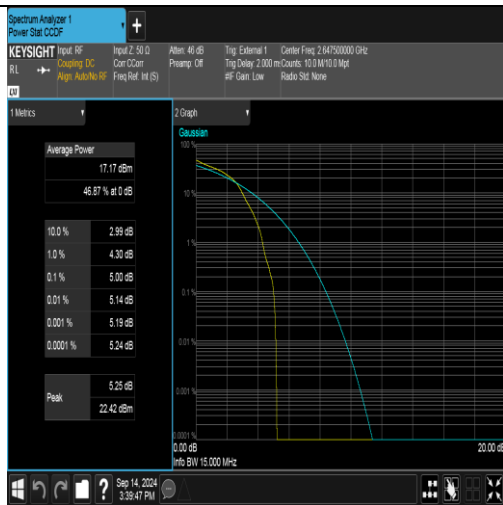


Band41(2535-2655)-15MHz-16QAM-41165-1RB#0-PASS

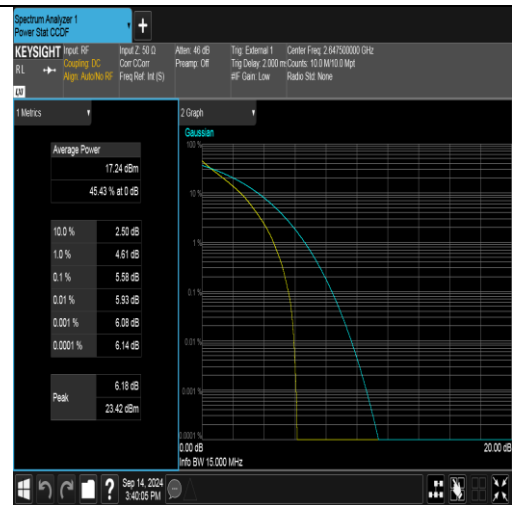


Band41(2535-2655)-15MHz-QPSK-41165-75RB#0-PASS

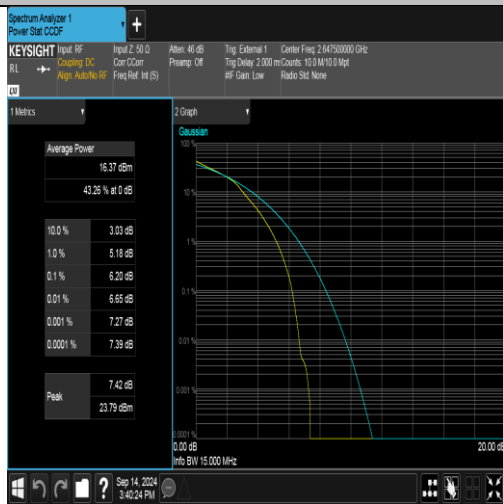


Band41(2535-2655)-15MHz-16QAM-41165-75RB#0-PASS

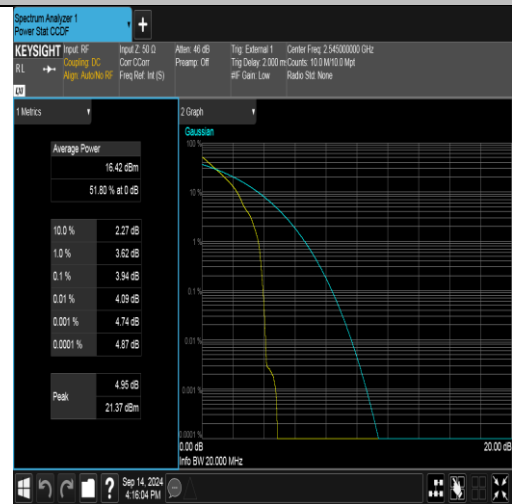

Band41(2535-2655)-20MHz-QPSK-40140-1RB#0-PASS

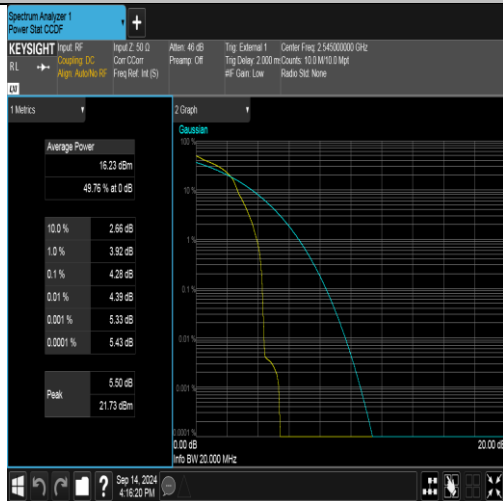

Band41(2535-2655)-20MHz-16QAM-40140-1RB#0-PASS

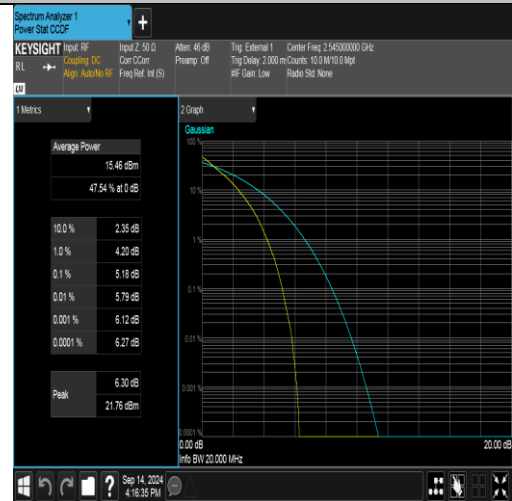

Band41(2535-2655)-20MHz-QPSK-40140-100RB#0-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.




Band41(2535-2655)-20MHz-16QAM-40140-100RB#0-PASS




Band41(2535-2655)-20MHz-QPSK-40590-1RB#0-PASS

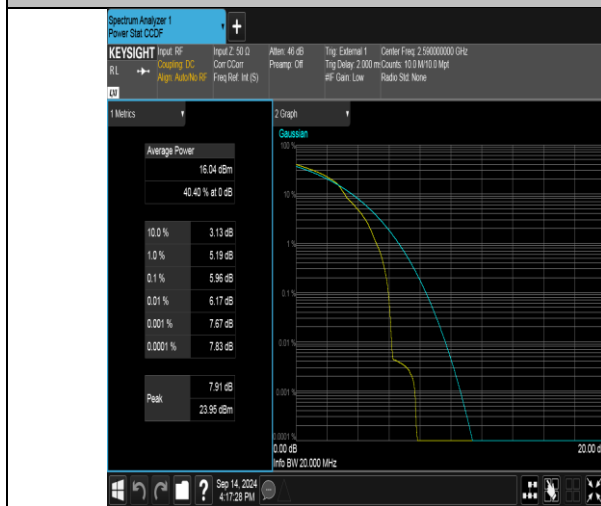


Band41(2535-2655)-20MHz-16QAM-40590-1RB#0-PASS

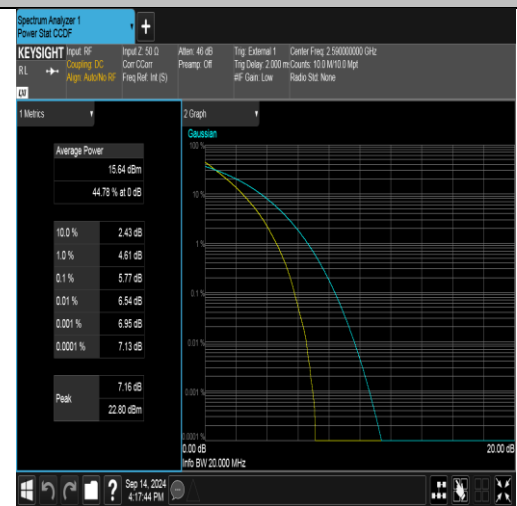

Band41(2535-2655)-20MHz-QPSK-40590-100RB#0-PASS

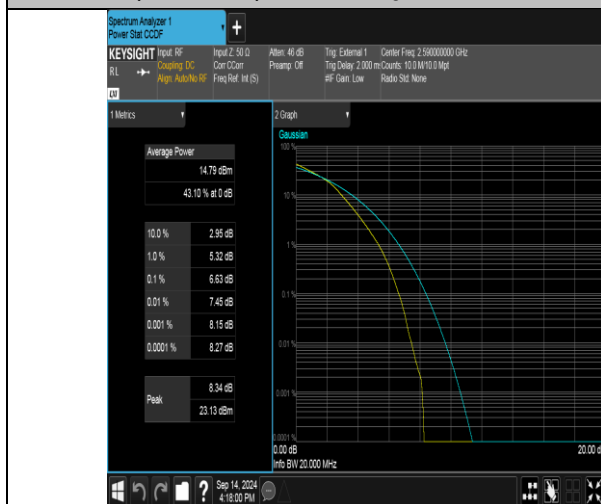


Band41(2535-2655)-20MHz-16QAM-40590-100RB#0-PASS

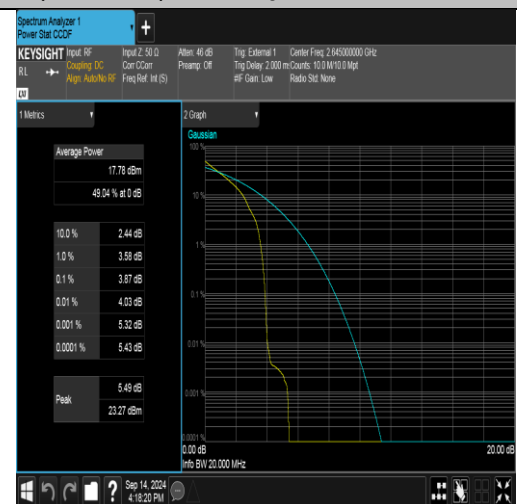

Band41(2535-2655)-20MHz-QPSK-41140-1RB#0-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

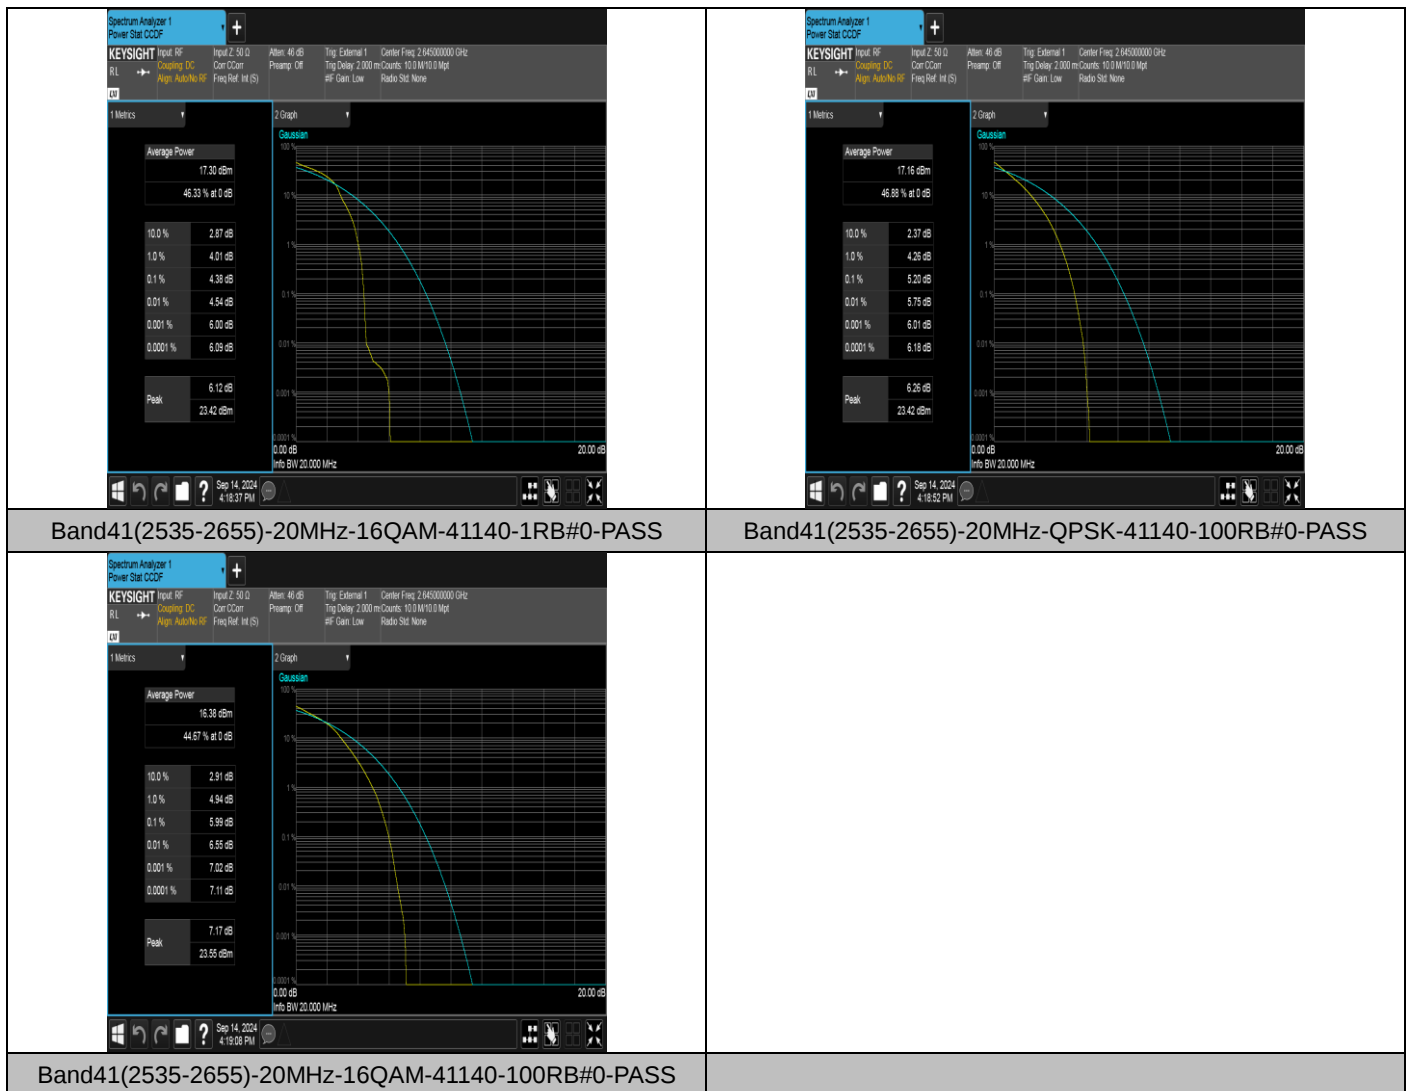

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>


Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	4.5100	5.055	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	4.5101	5.082	PASS
Band41(2535-2655)	5MHz	QPSK	40590	25RB#0	4.5141	5.367	PASS
Band41(2535-2655)	5MHz	16QAM	40590	25RB#0	4.5211	5.068	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	4.5100	5.282	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	4.5157	5.171	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	8.9957	10.42	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	8.9808	9.909	PASS
Band41(2535-2655)	10MHz	QPSK	40590	50RB#0	9.0159	10.77	PASS
Band41(2535-2655)	10MHz	16QAM	40590	50RB#0	8.9971	10.01	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	9.0013	10.72	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	9.0012	9.938	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	13.519	15.04	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	13.498	14.86	PASS
Band41(2535-2655)	15MHz	QPSK	40590	75RB#0	13.512	15.13	PASS
Band41(2535-2655)	15MHz	16QAM	40590	75RB#0	13.495	15.07	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	13.494	15.04	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	13.500	15.18	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	18.039	19.58	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	17.982	19.84	PASS
Band41(2535-2655)	20MHz	QPSK	40590	100RB#0	17.985	19.57	PASS
Band41(2535-2655)	20MHz	16QAM	40590	100RB#0	17.933	20.02	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	17.970	19.64	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	17.993	19.78	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Test Graphs

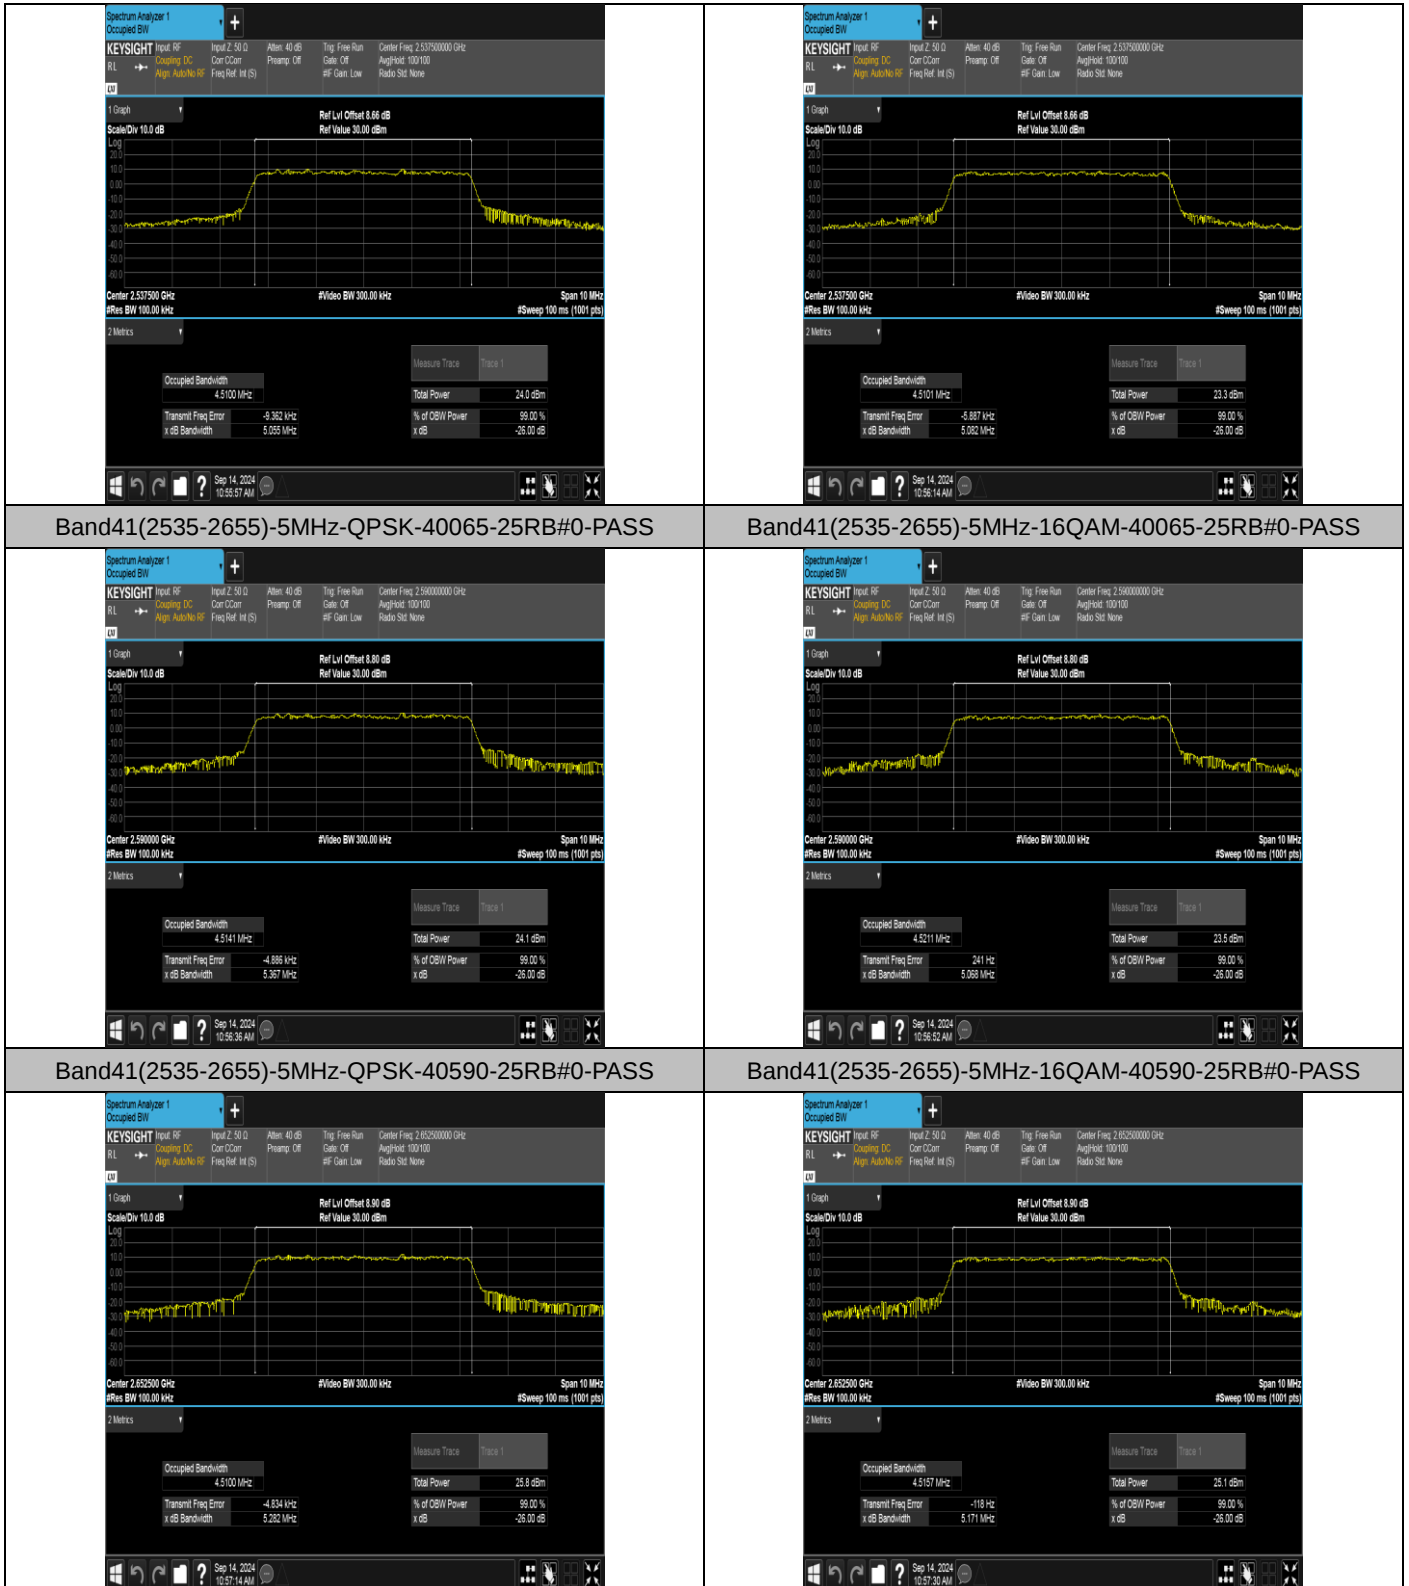

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

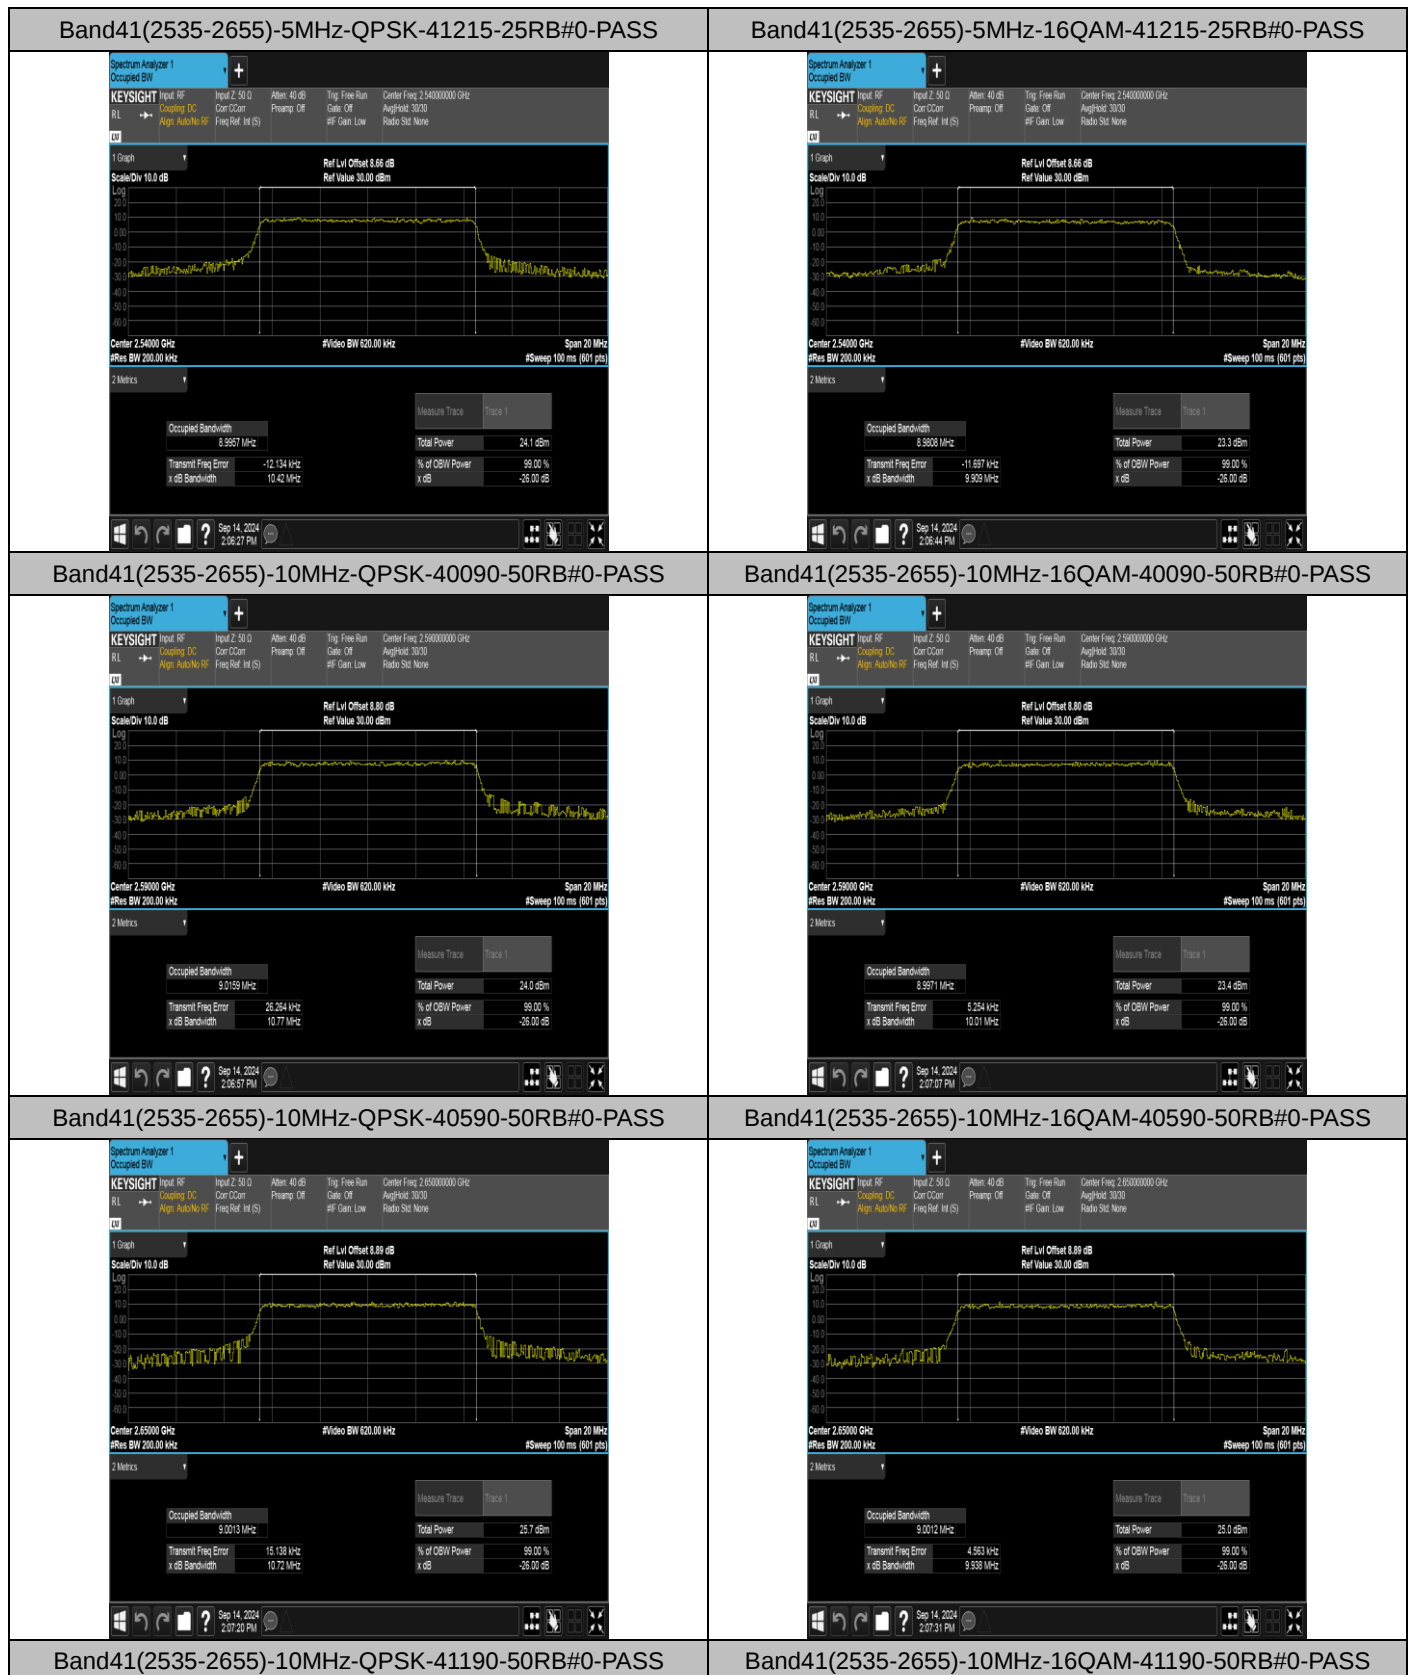


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

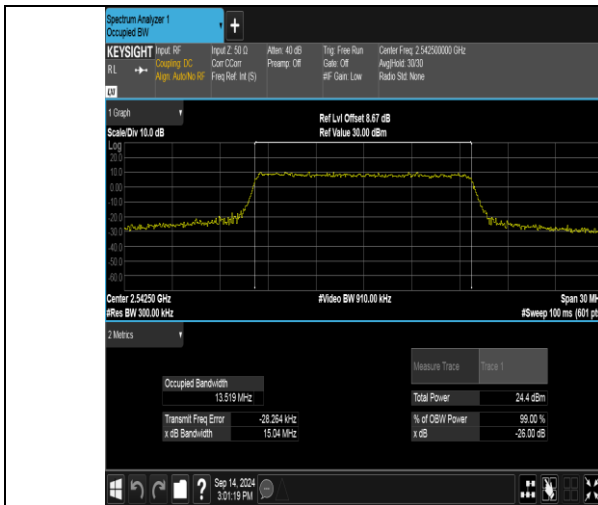


Band41(2535-2655)-15MHz-QPSK-40115-75RB#0-PASS




Band41(2535-2655)-15MHz-16QAM-40115-75RB#0-PASS

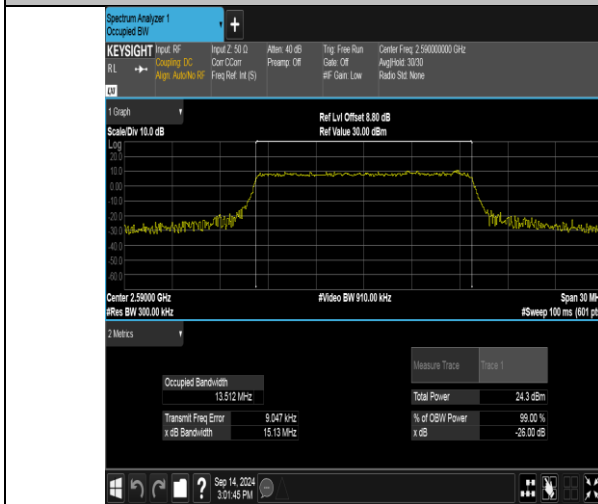


Band41(2535-2655)-15MHz-QPSK-40590-75RB#0-PASS

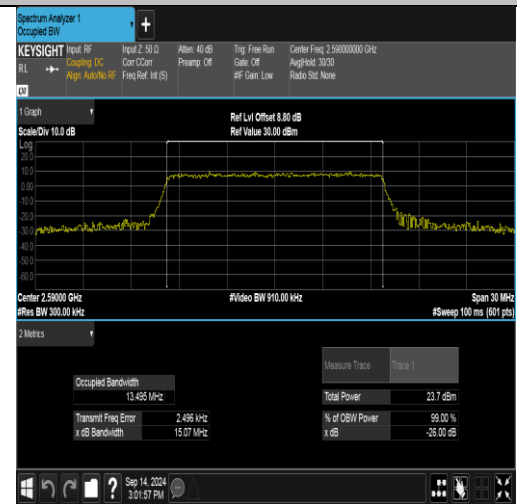

Band41(2535-2655)-15MHz-16QAM-40590-75RB#0-PASS

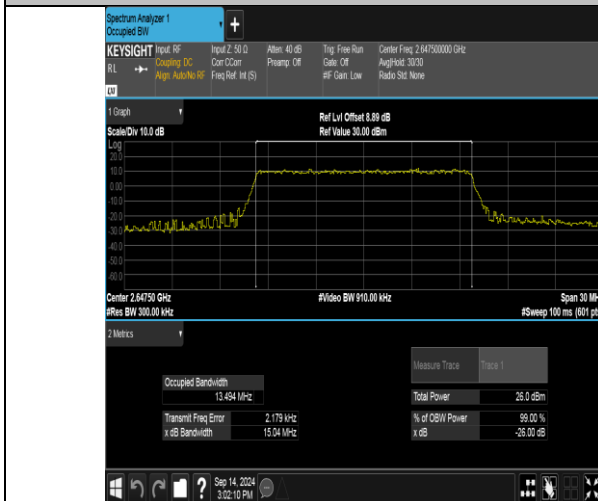


Band41(2535-2655)-15MHz-QPSK-41165-75RB#0-PASS

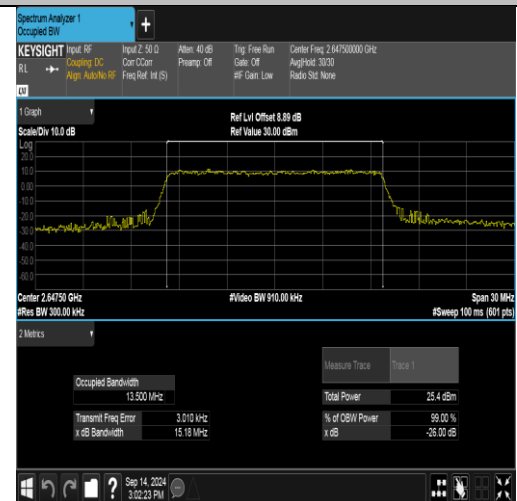


Band41(2535-2655)-15MHz-16QAM-41165-75RB#0-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

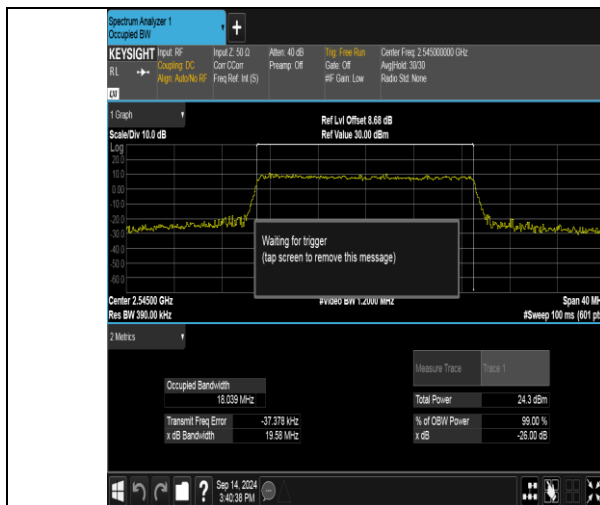


Band41(2535-2655)-20MHz-QPSK-40140-100RB#0-PASS

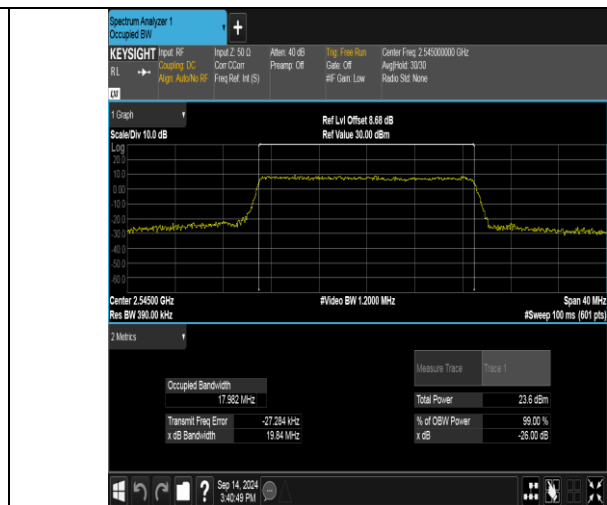


Band41(2535-2655)-20MHz-16QAM-40140-100RB#0-PASS

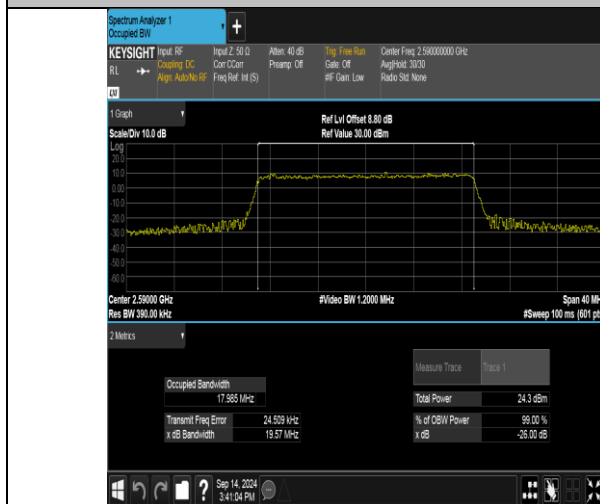


Band41(2535-2655)-20MHz-QPSK-40590-100RB#0-PASS

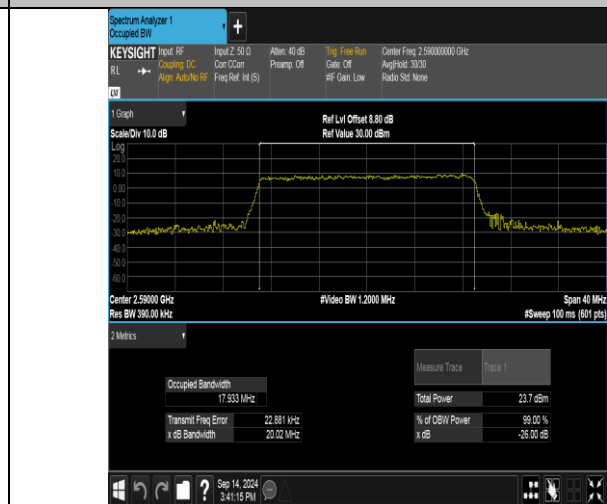

Band41(2535-2655)-20MHz-16QAM-40590-100RB#0-PASS

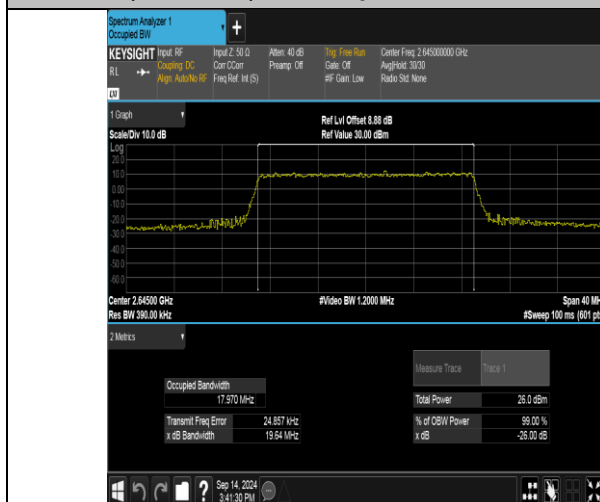

Band41(2535-2655)-20MHz-QPSK-41140-100RB#0-PASS

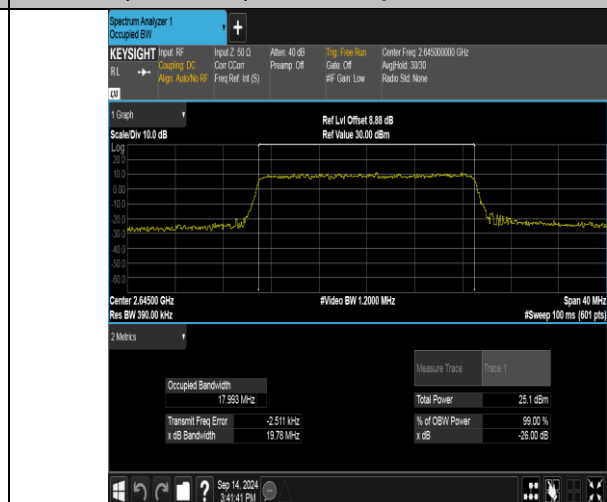

Band41(2535-2655)-20MHz-16QAM-41140-100RB#0-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix D: Band Edge


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41(2535-2655)	5MHz	QPSK	40065	1RB#0	-52.98	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#0	-53.94	PASS
Band41(2535-2655)	5MHz	QPSK	40065	1RB#24	-54.25	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#24	-54.08	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	-47.67	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	-47.76	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#0	-50.43	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#0	-50.54	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#24	-20.38	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#24	-22.94	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	-46.22	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	-47.04	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#0	-54.10	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#0	-54.20	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#49	-54.43	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#49	-54.46	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	-51.01	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	-51.05	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#0	-50.68	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#0	-50.63	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#49	-50.54	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#49	-50.60	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	-48.18	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	-47.93	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#0	-54.62	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#0	-54.60	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#74	-54.57	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#74	-54.66	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	-52.68	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	-52.85	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#0	-50.78	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#0	-50.81	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#74	-50.77	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#74	-50.70	PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	-49.00	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	-47.83	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#0	-54.68	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#0	-54.59	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#99	-54.67	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#99	-54.66	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	-54.14	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	-53.91	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#0	-50.71	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#0	-50.80	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#99	-50.75	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#99	-50.79	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	-49.50	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	-49.46	PASS


Test Graphs

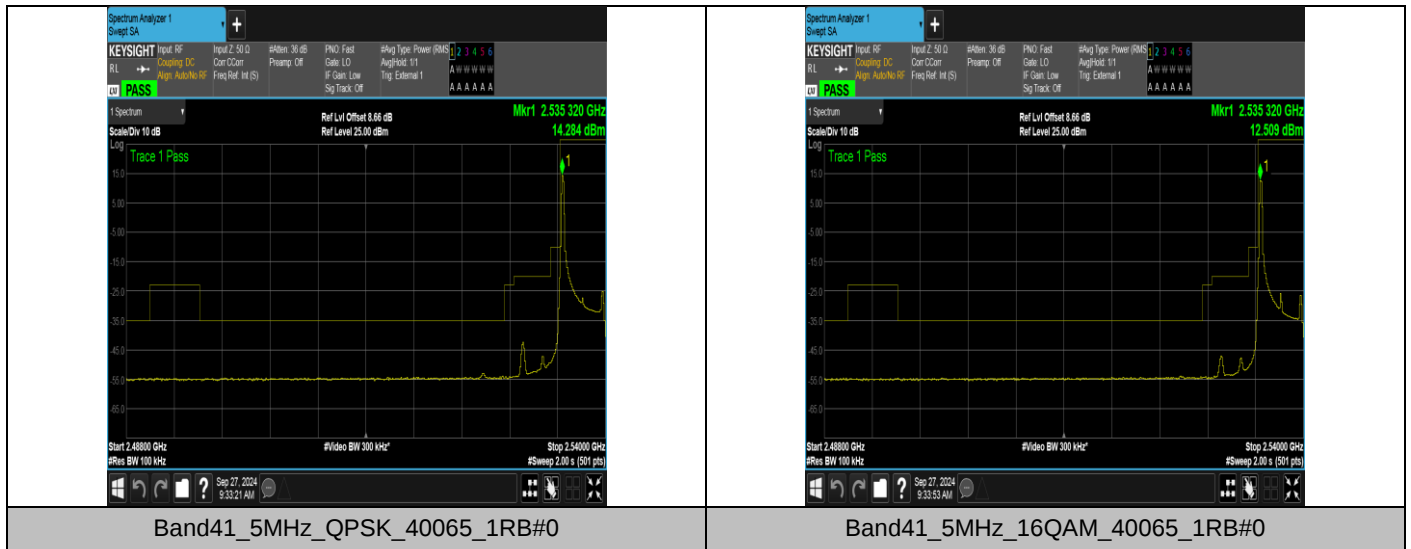

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

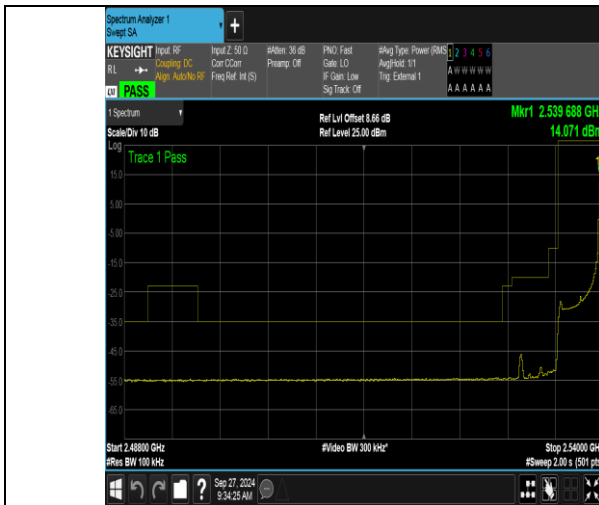


Band41_5MHz_QPSK_40065_1RB#24

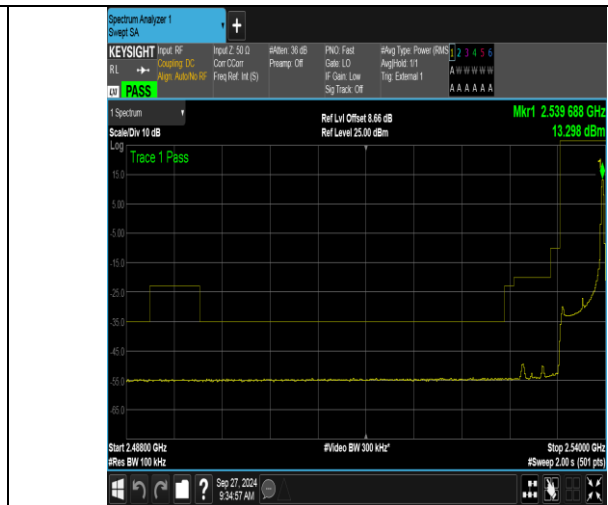


Band41_5MHz_16QAM_40065_1RB#24




Band41_5MHz_QPSK_40065_25RB#0

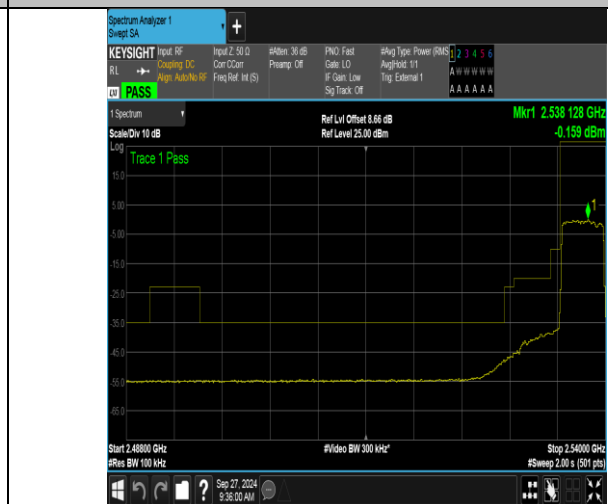

Band41_5MHz_16QAM_40065_25RB#0

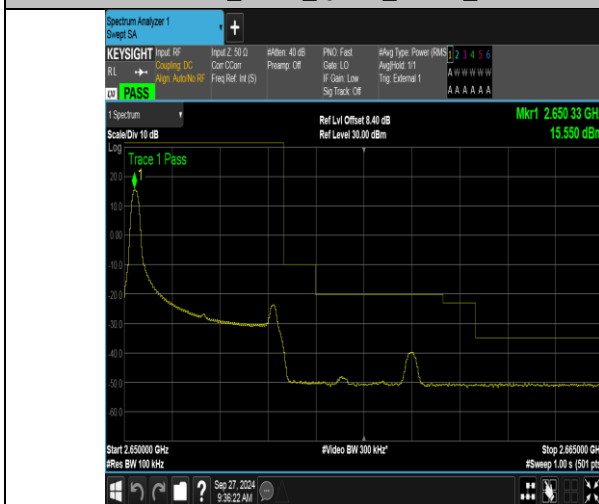


Band41_5MHz_QPSK_41215_1RB#0

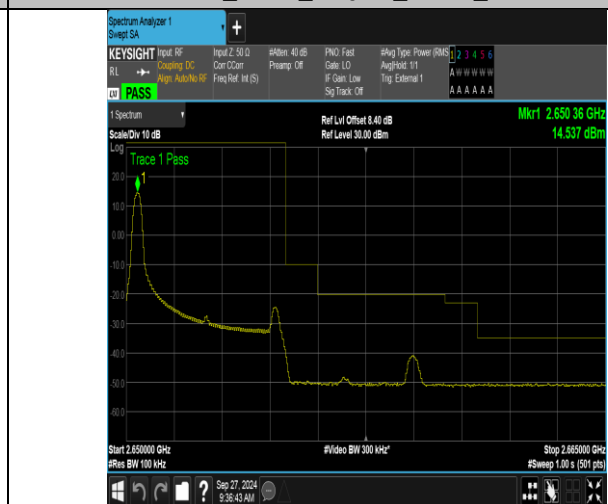


Band41_5MHz_16QAM_41215_1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

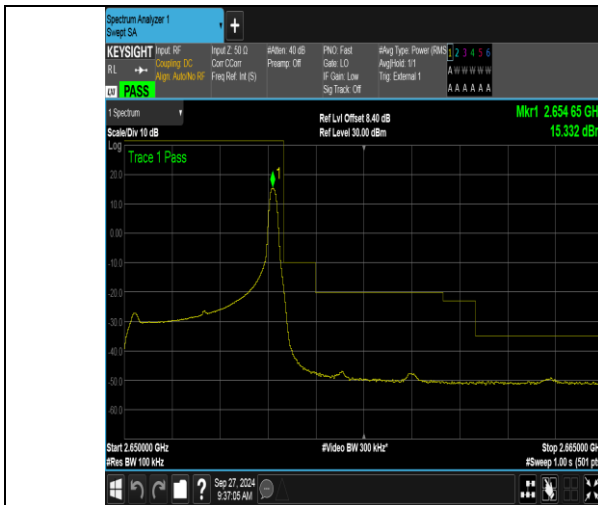

Band41_5MHz_QPSK_41215_1RB#24

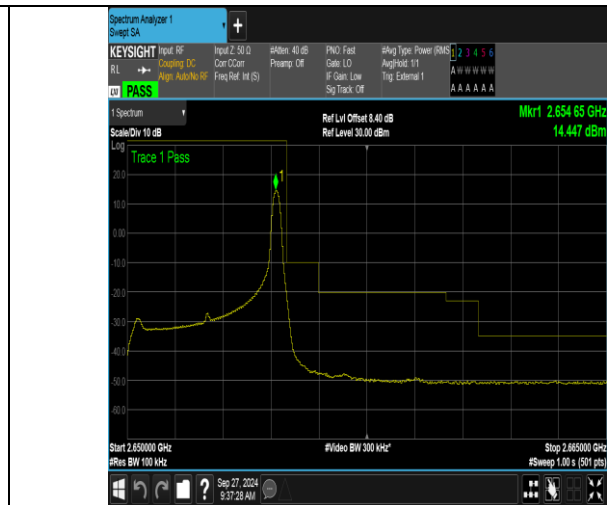


Band41_5MHz_16QAM_41215_1RB#24




Band41_5MHz_QPSK_41215_25RB#0



Band41_5MHz_16QAM_41215_25RB#0

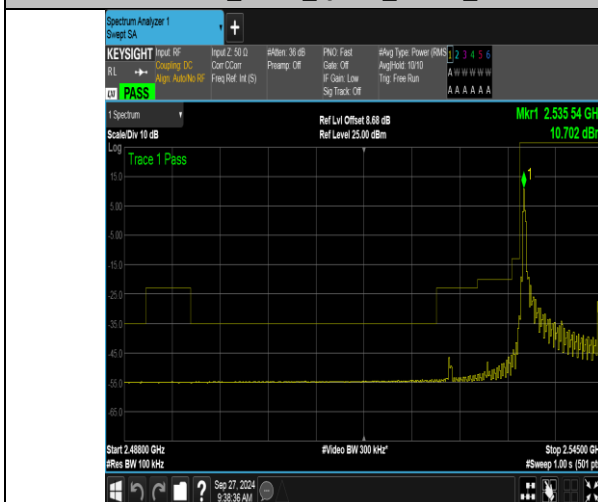







Band41_10MHz_QPSK_40090_1RB#0

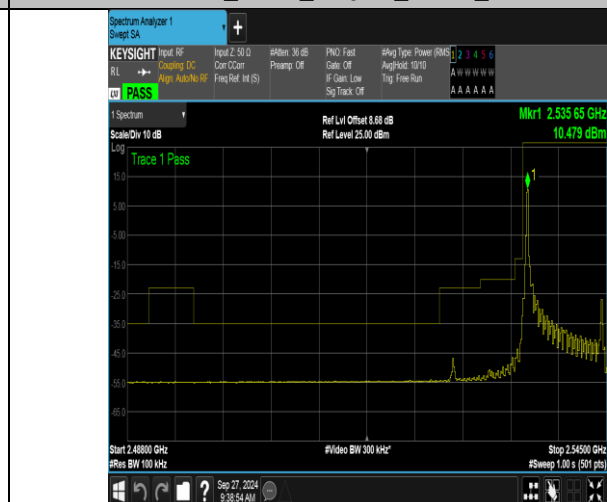


Band41_10MHz_16QAM_40090_1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

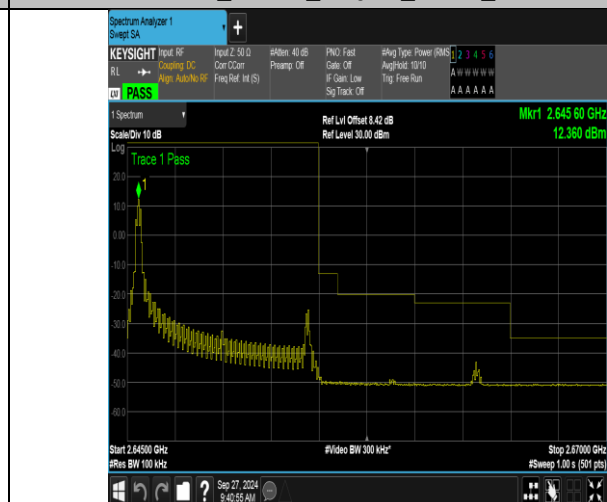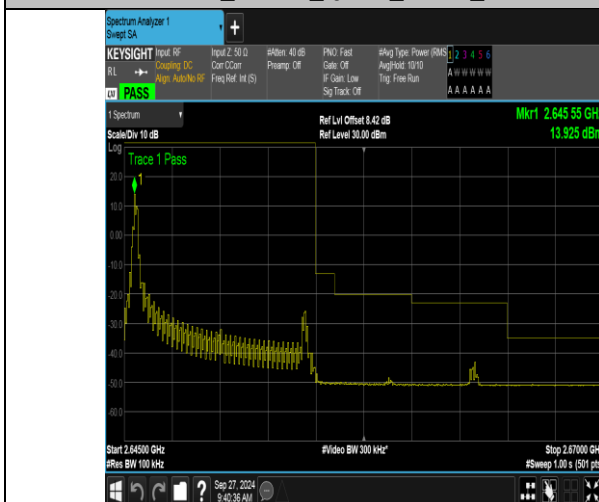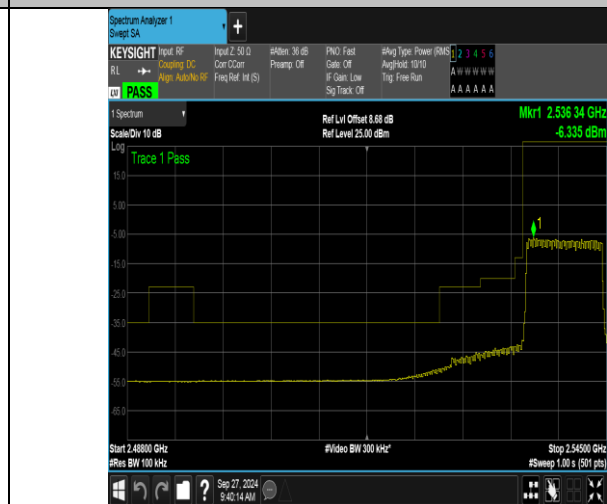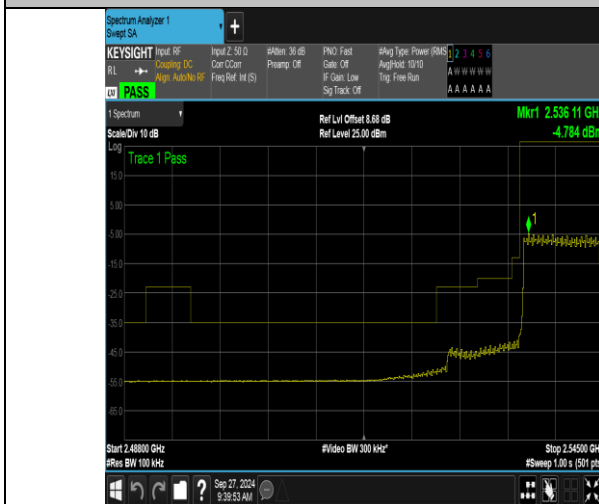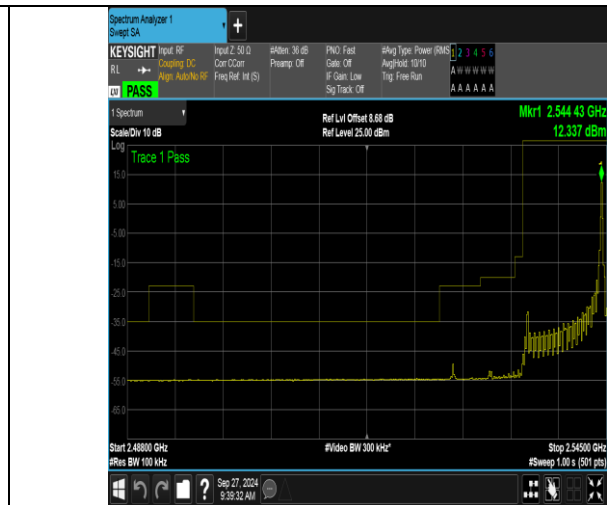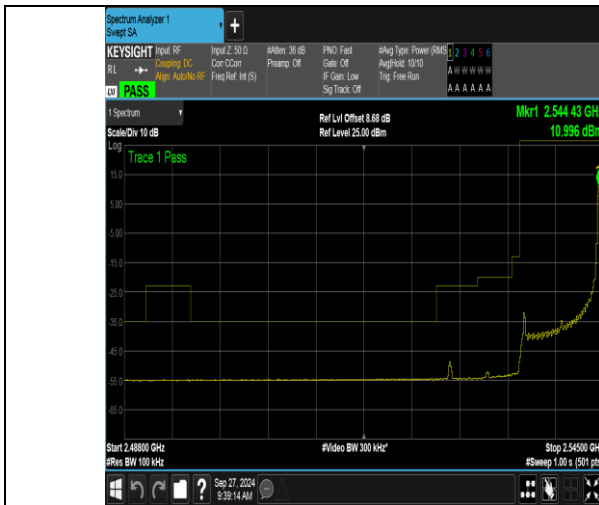


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

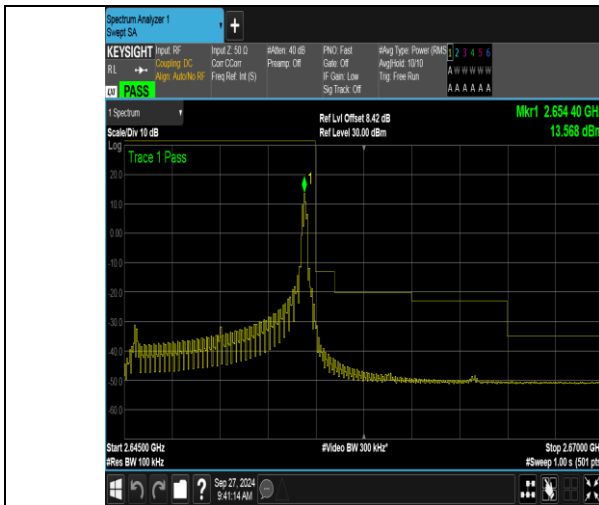


Band41_10MHz_QPSK_41190_1RB#49

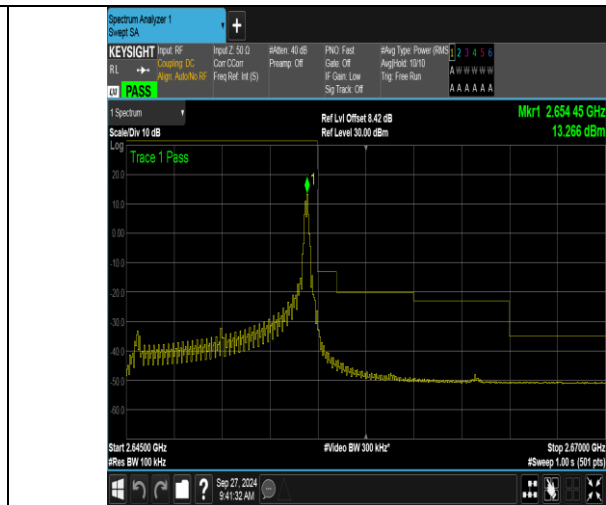


Band41_10MHz_16QAM_41190_1RB#49

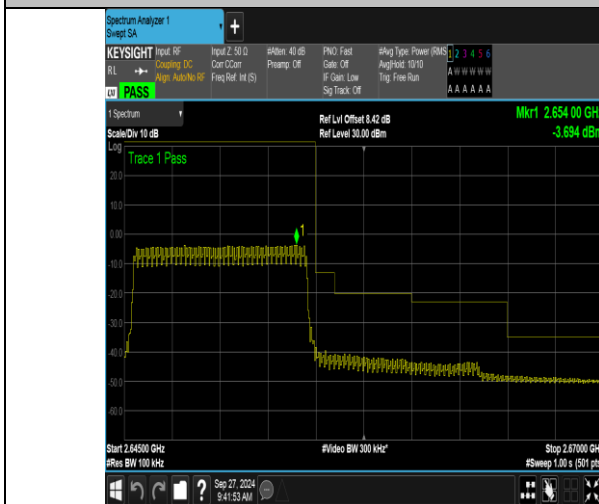


Band41_10MHz_QPSK_41190_50RB#0

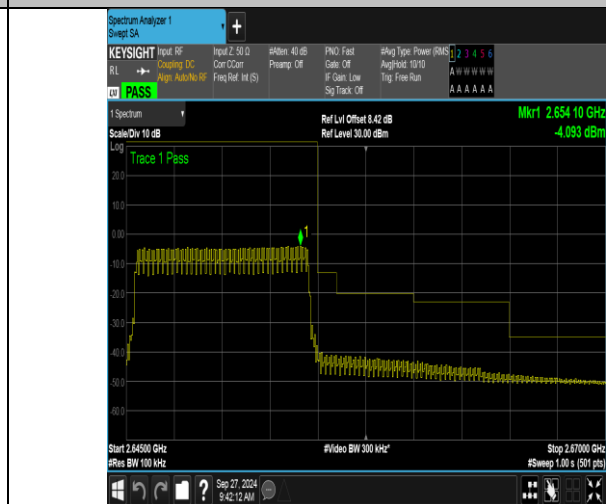

Band41_10MHz_16QAM_41190_50RB#0

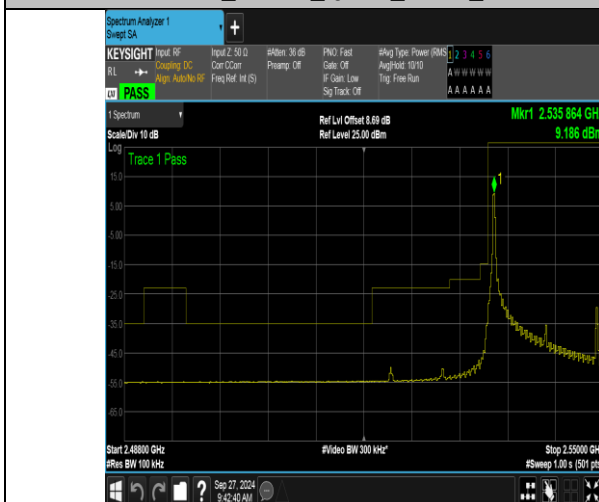

Band41_15MHz_QPSK_40115_1RB#0

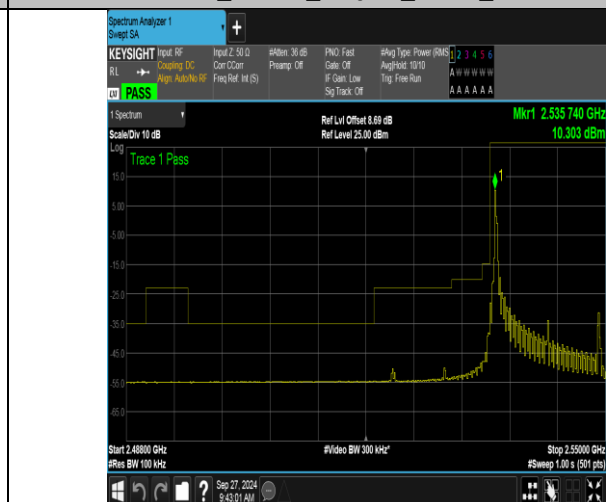

Band41_15MHz_16QAM_40115_1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.