




11A_Ant1_5745

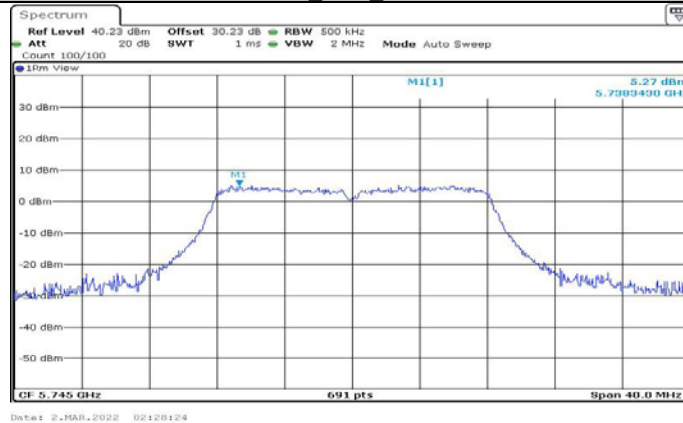



11A_Ant1_5785

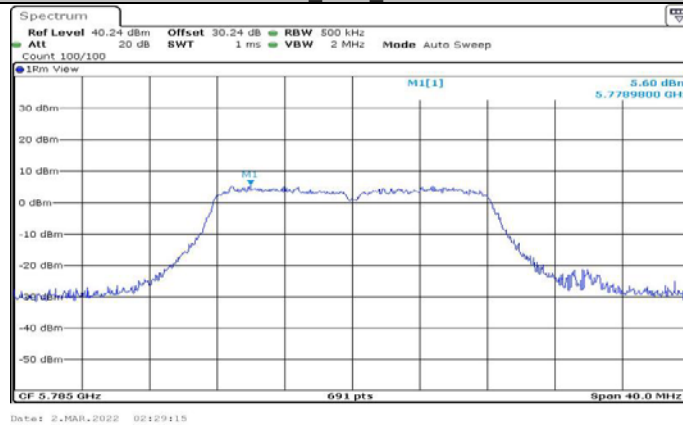



11A_Ant1_5825

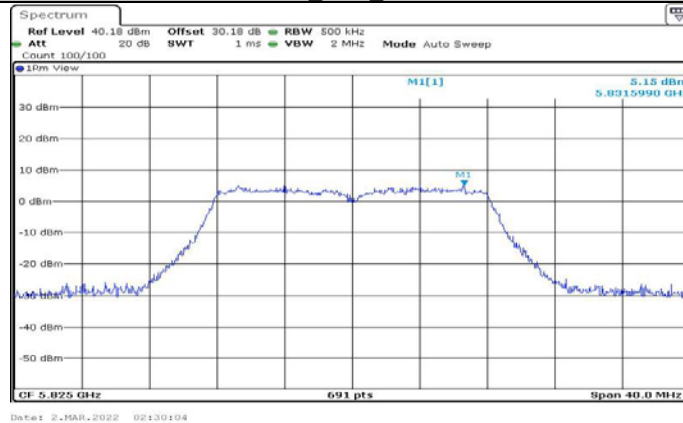

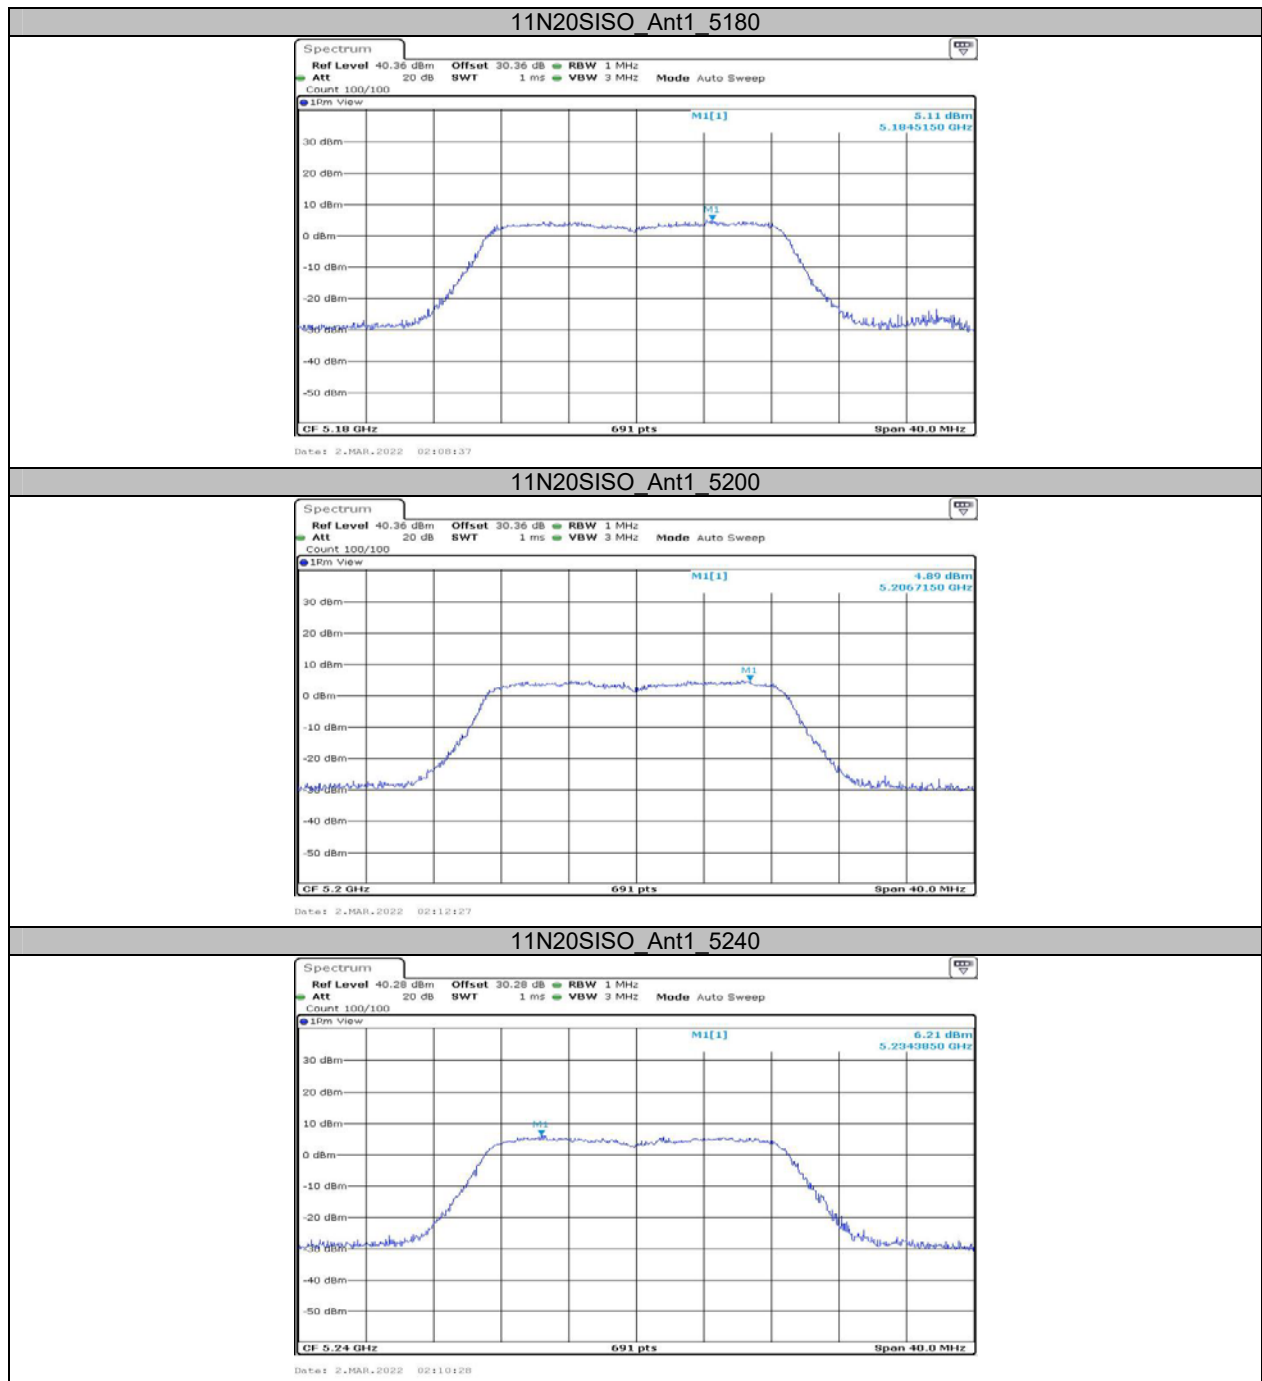


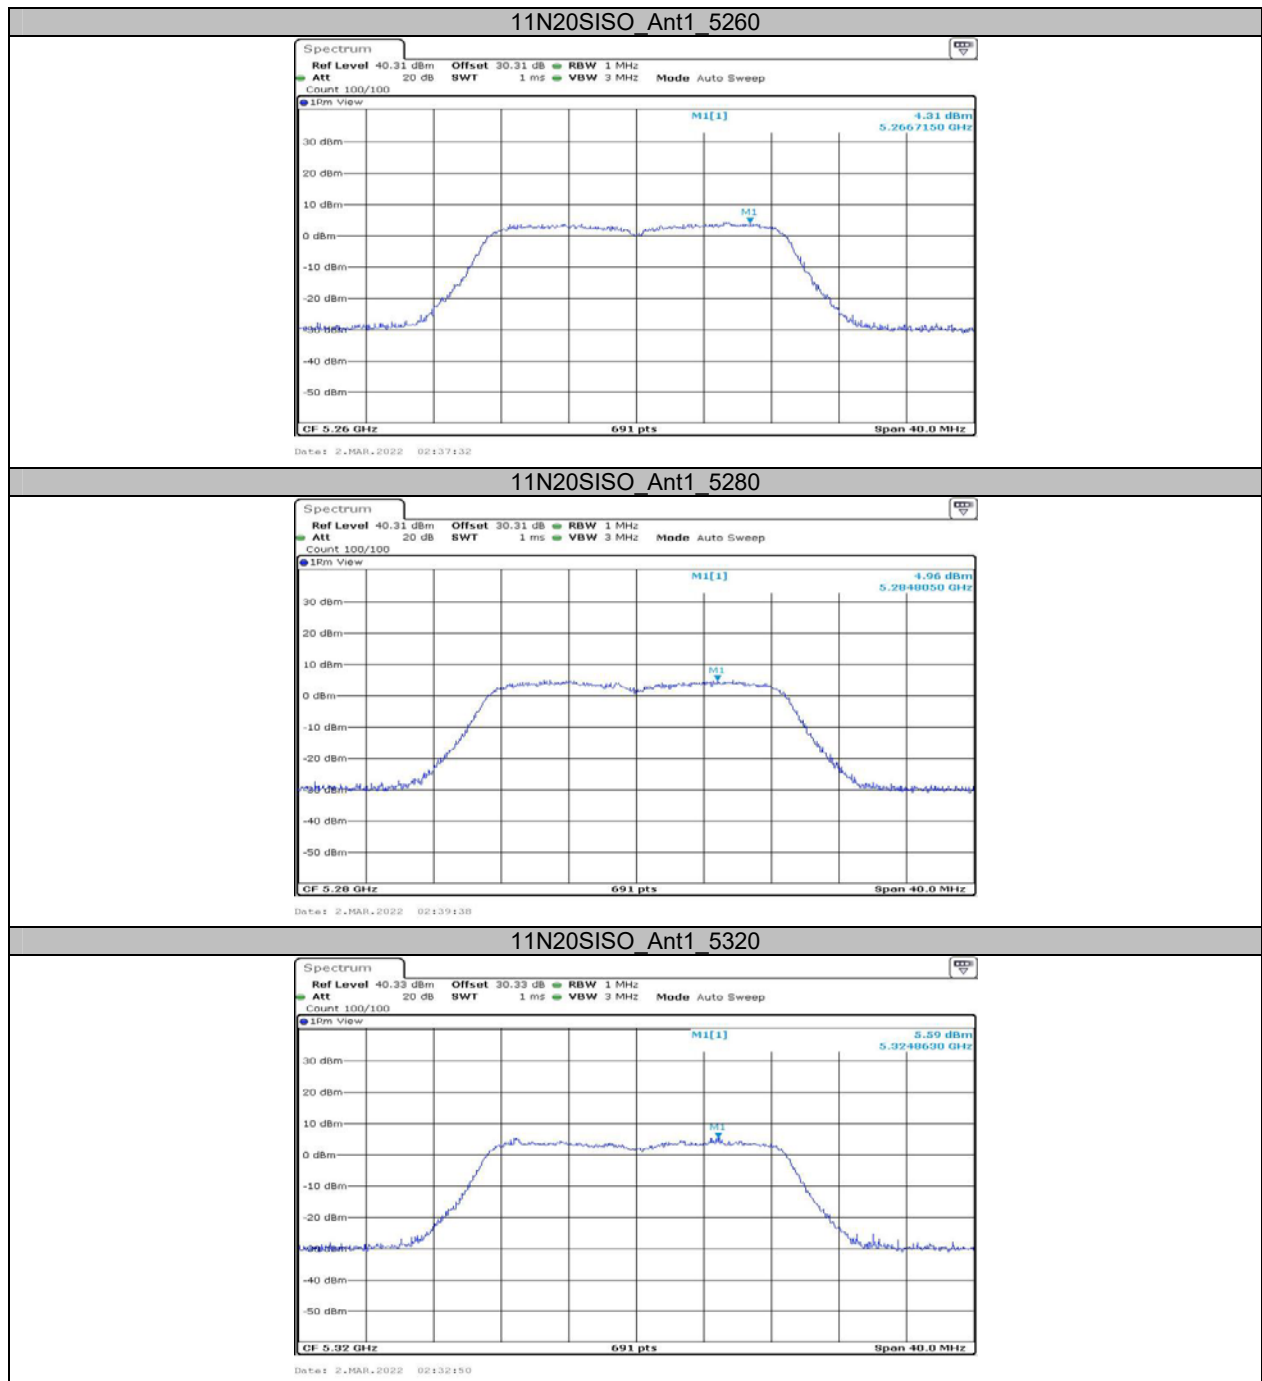

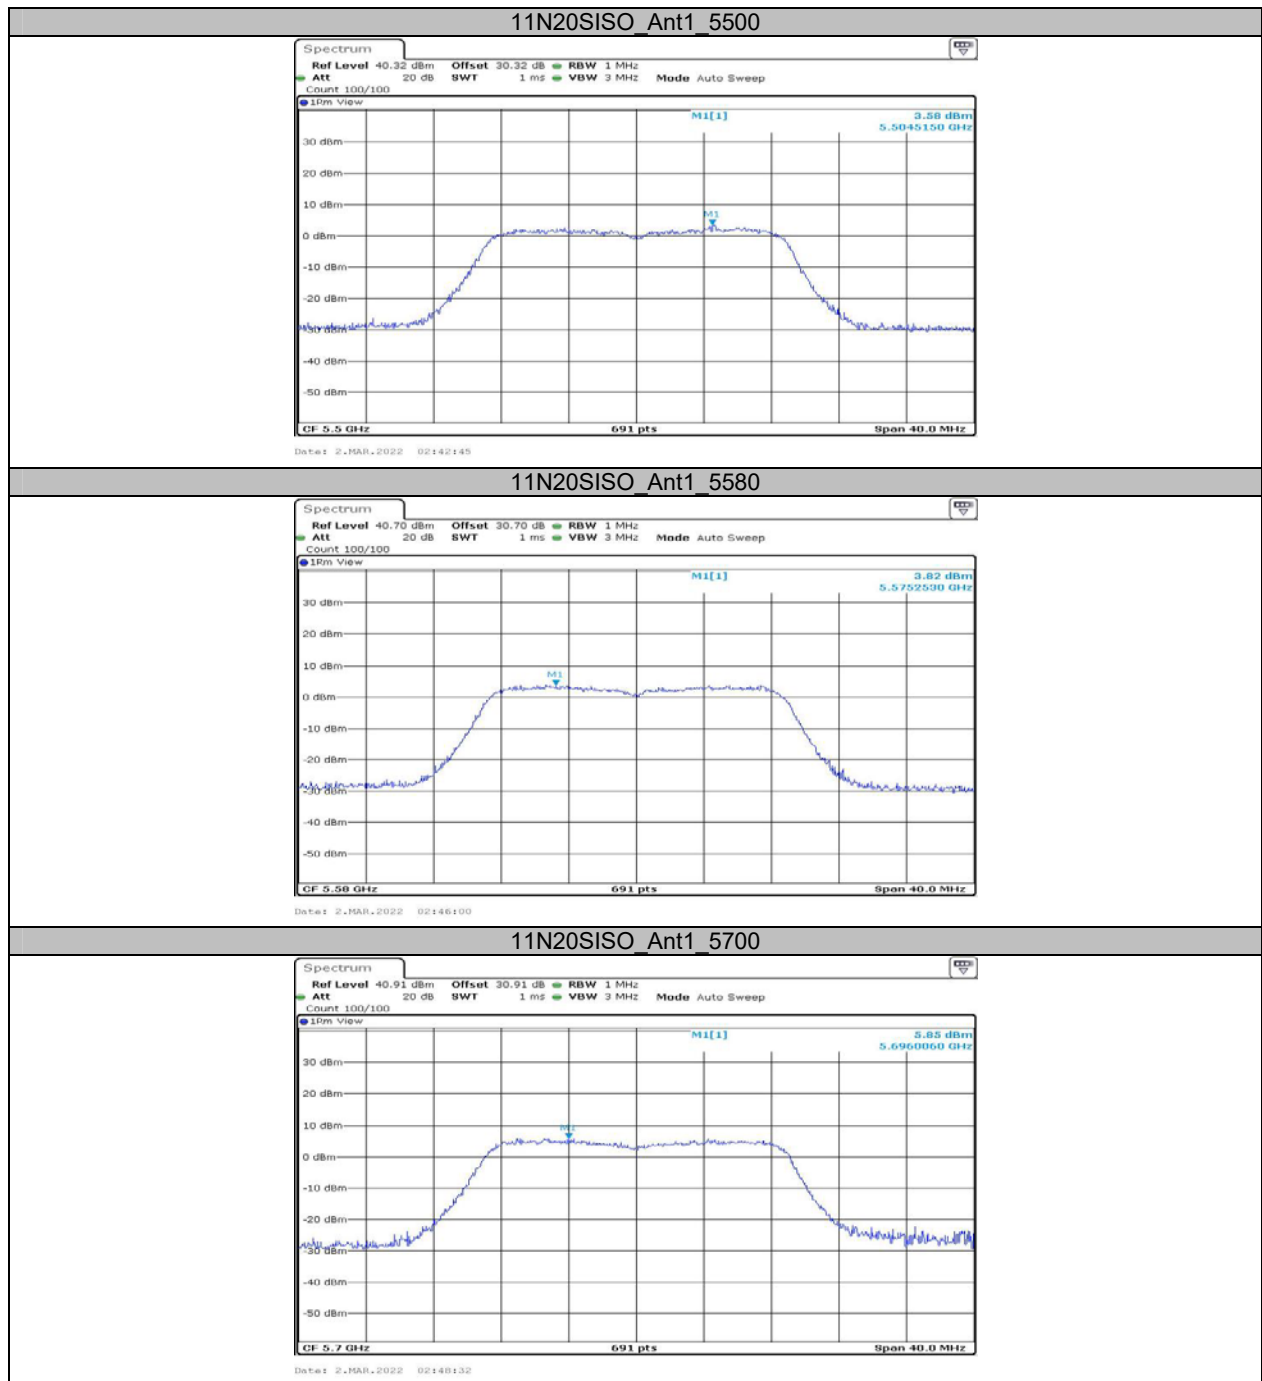


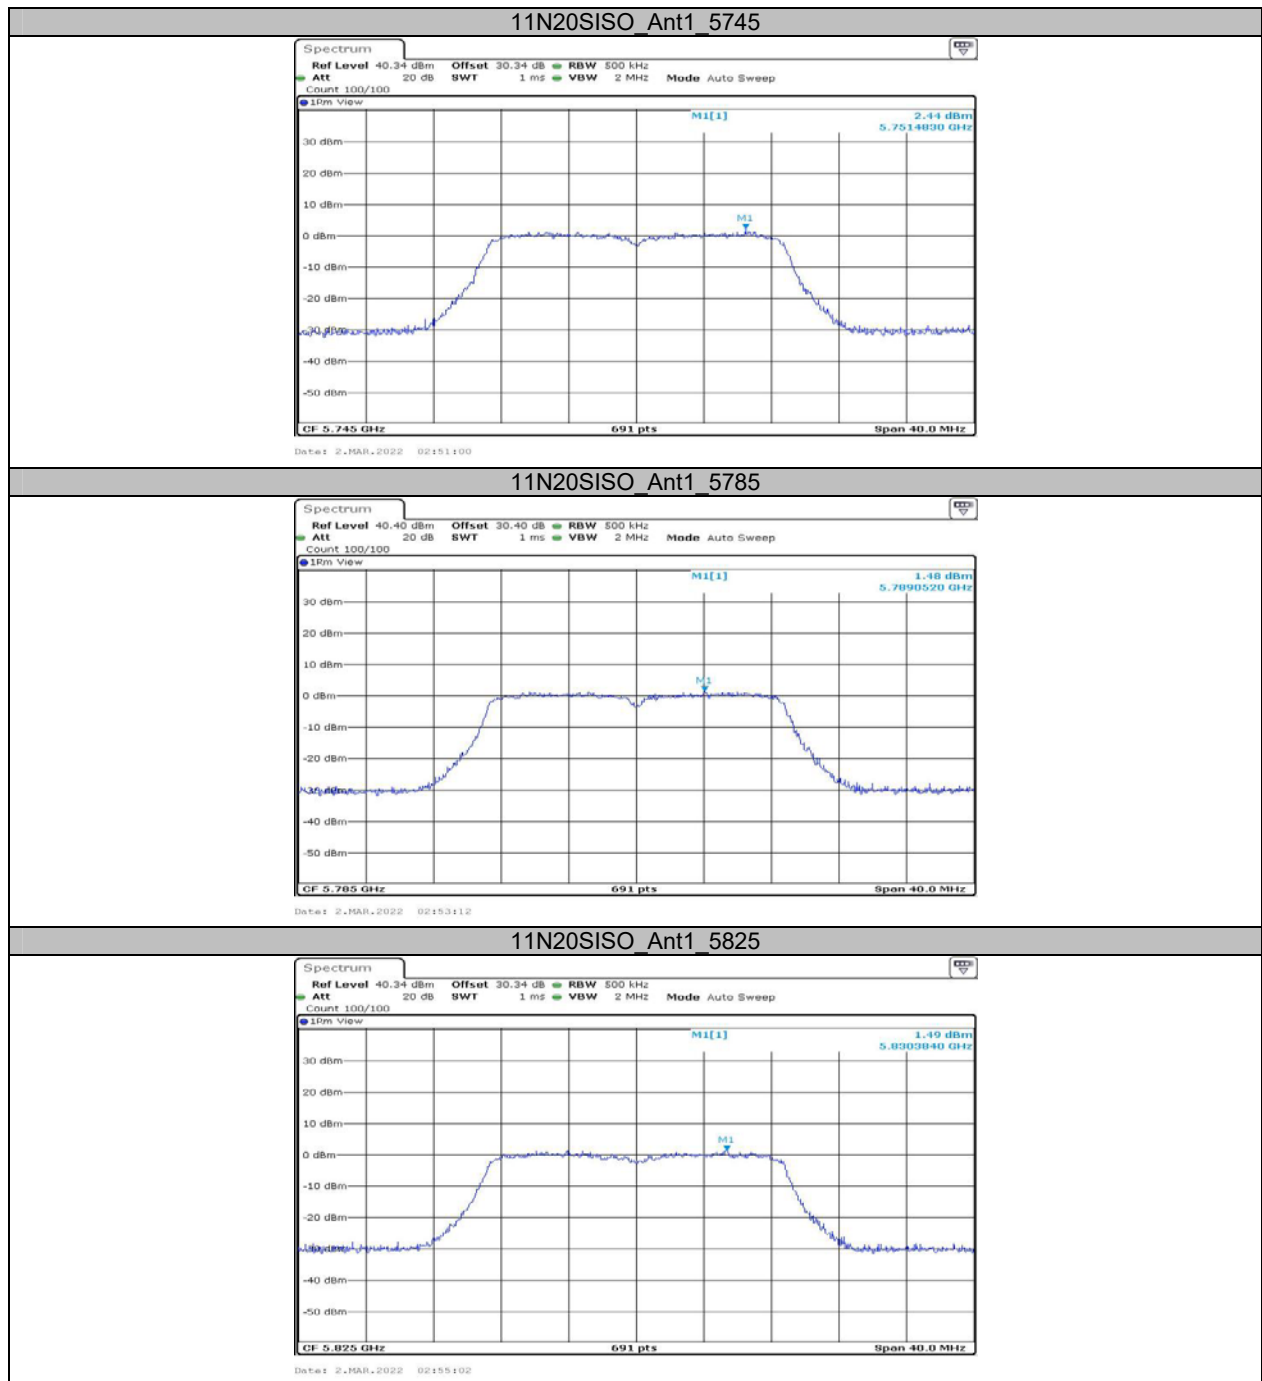


11N40SISO_Ant1_5190

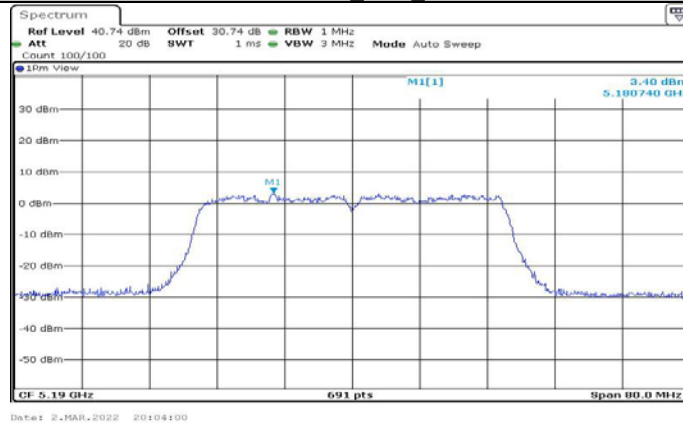



11N40SISO_Ant1_5230

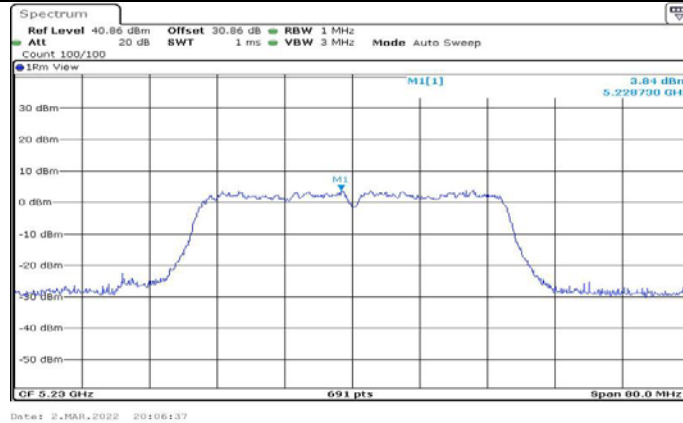


11N40SISO_Ant1_5270

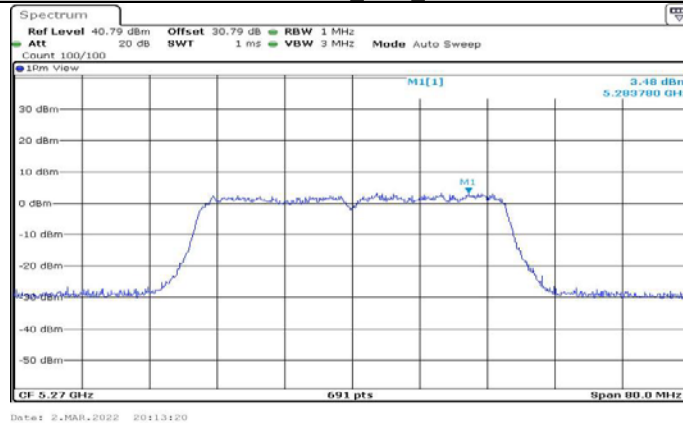

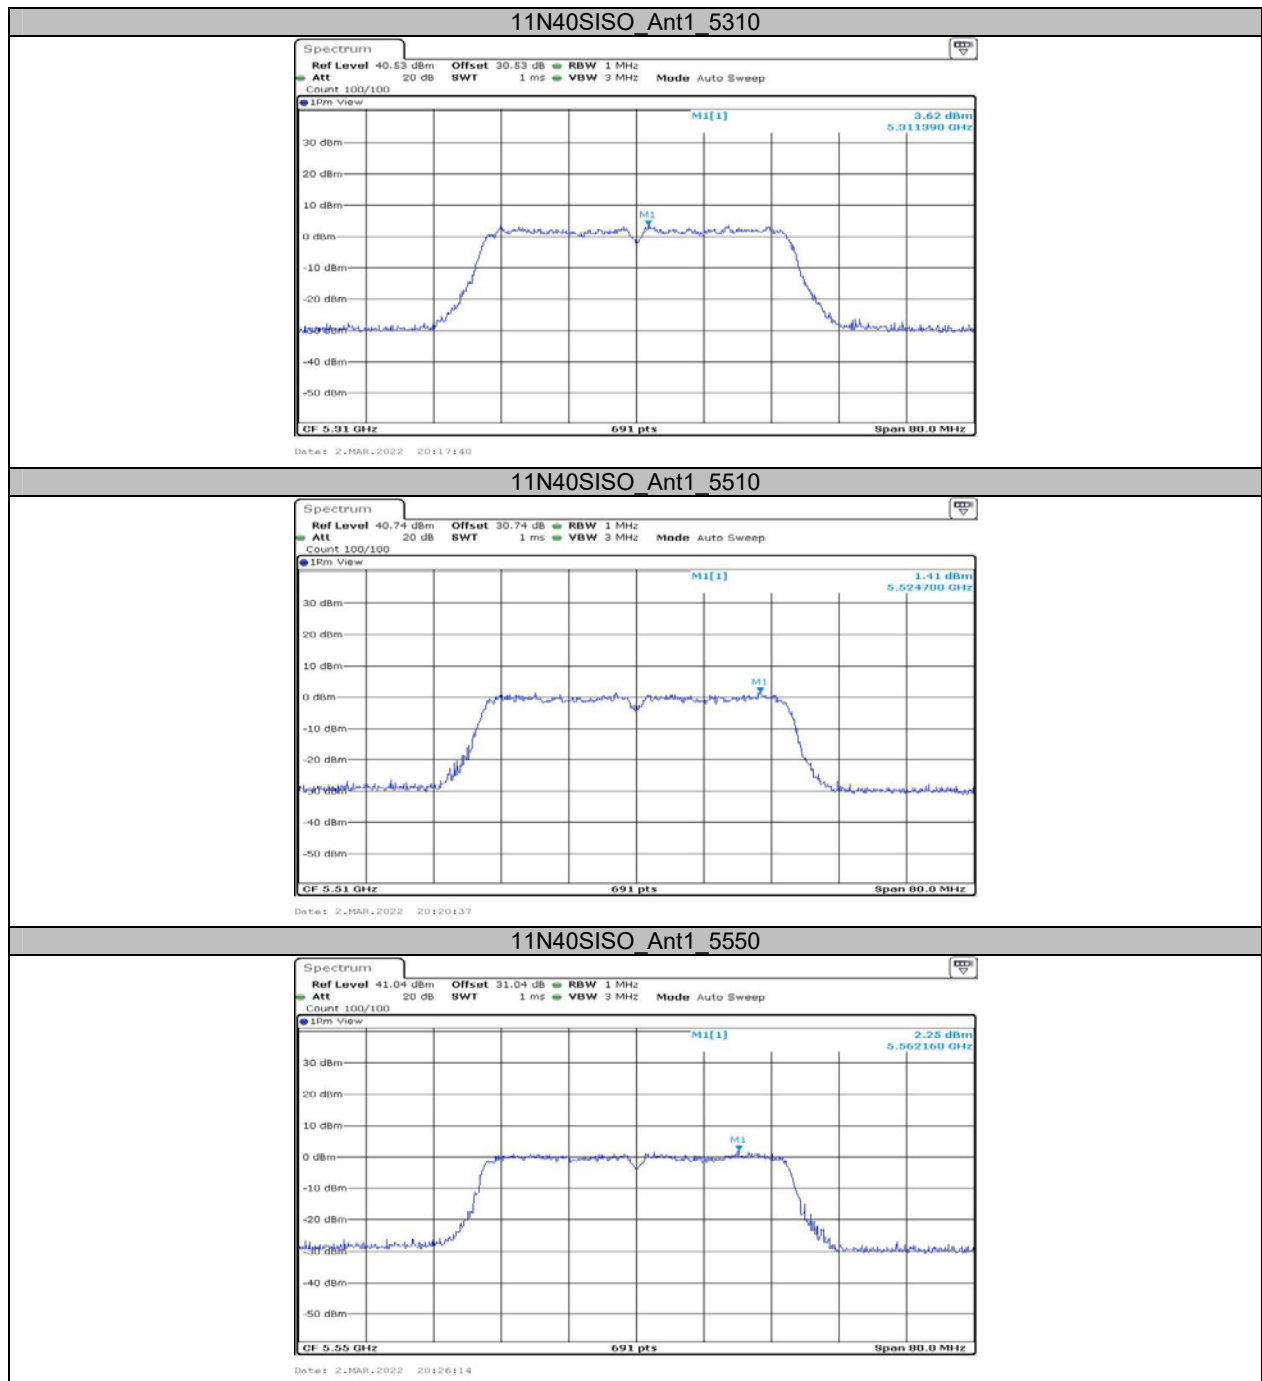


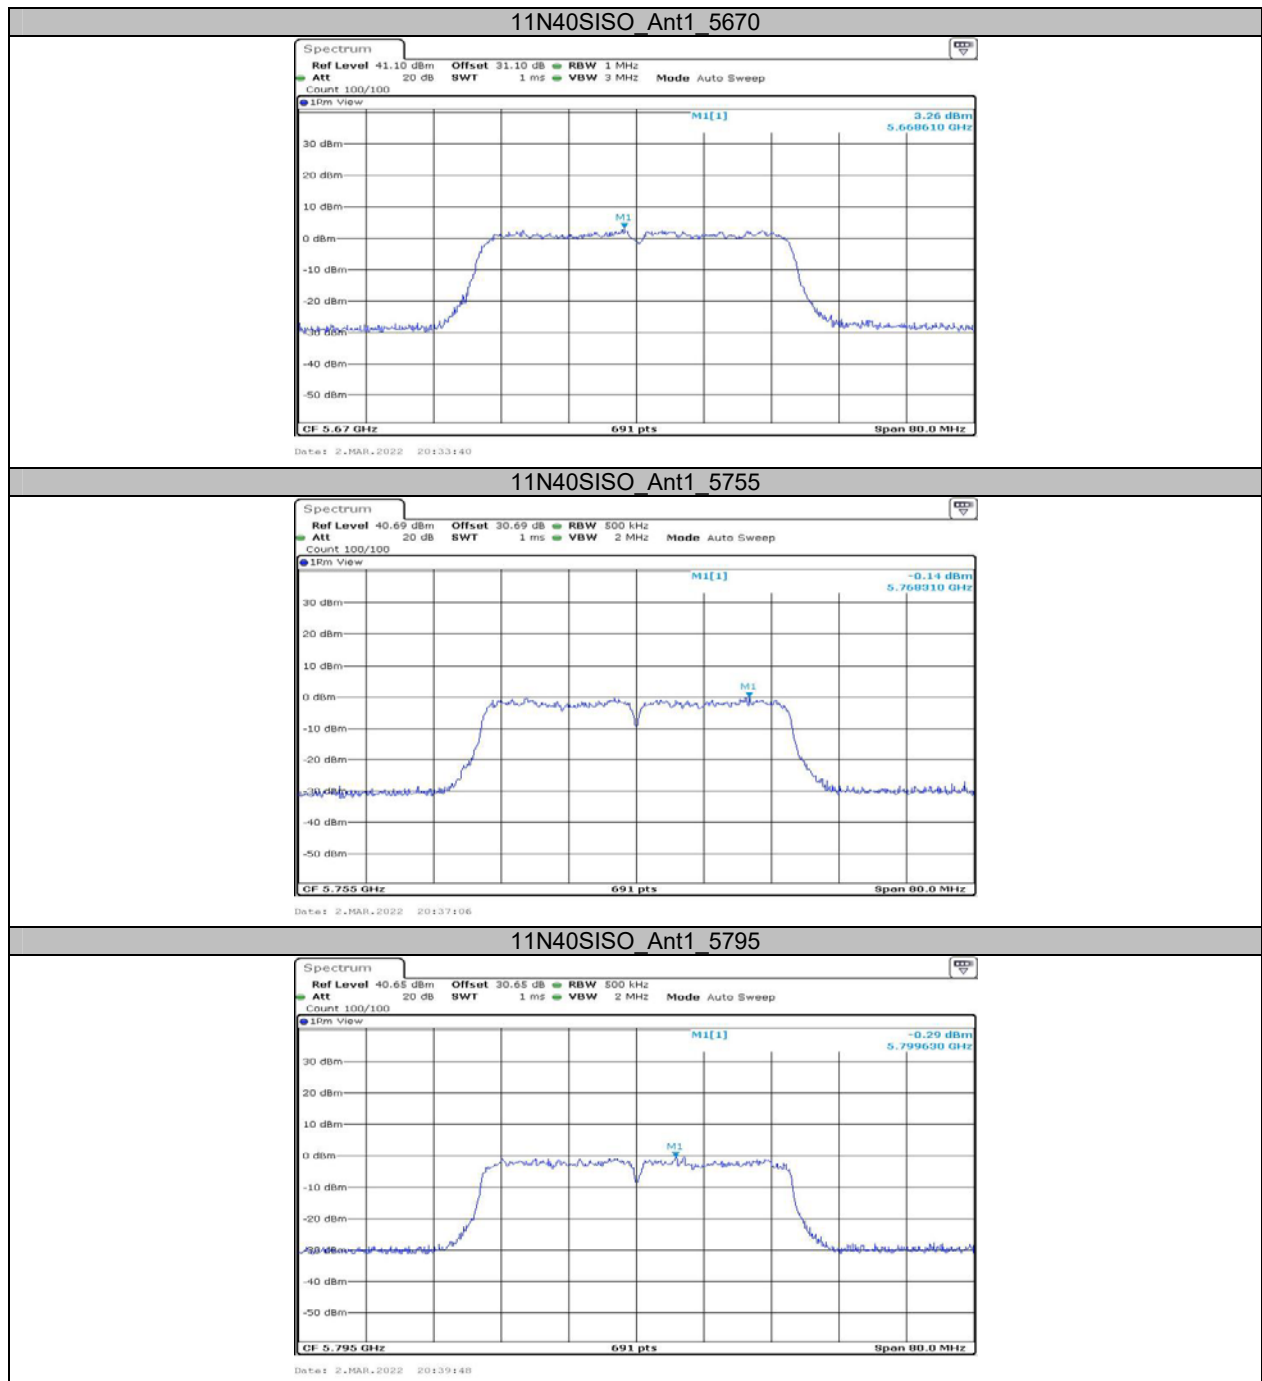


11AC20SISO_Ant1_5180

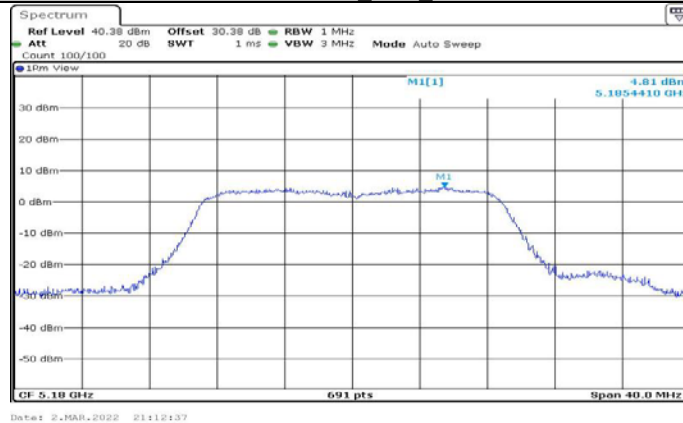


11AC20SISO_Ant1_5200

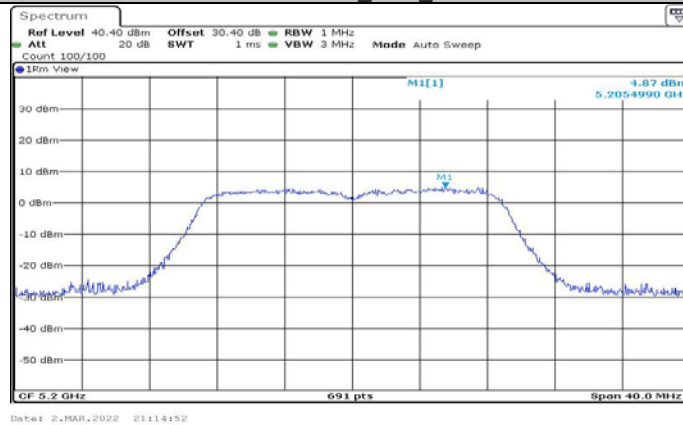


11AC20SISO_Ant1_5240

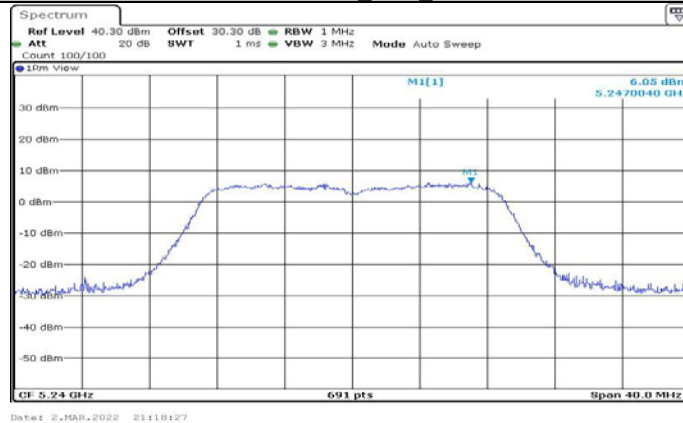


11AC20SISO_Ant1_5260

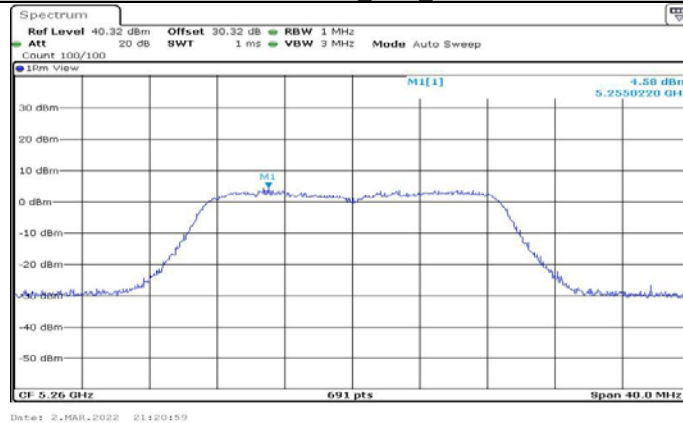



11AC20SISO_Ant1_5280

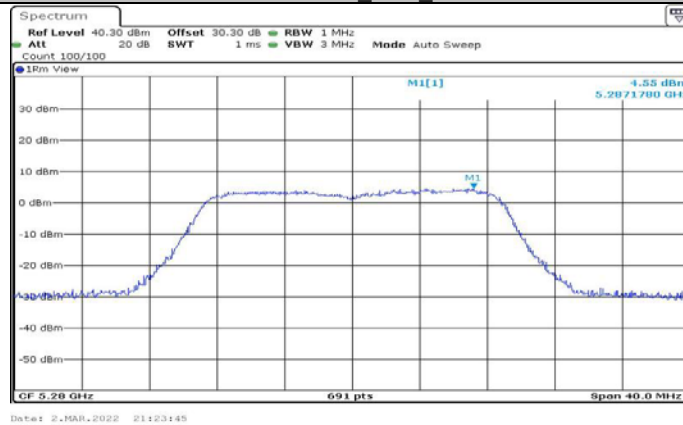


11AC20SISO_Ant1_5320

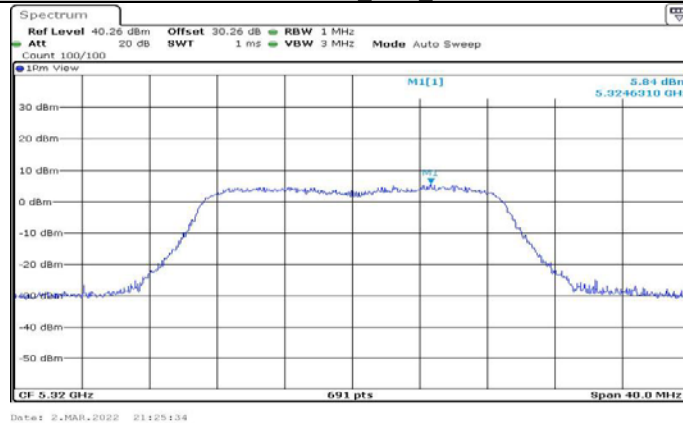

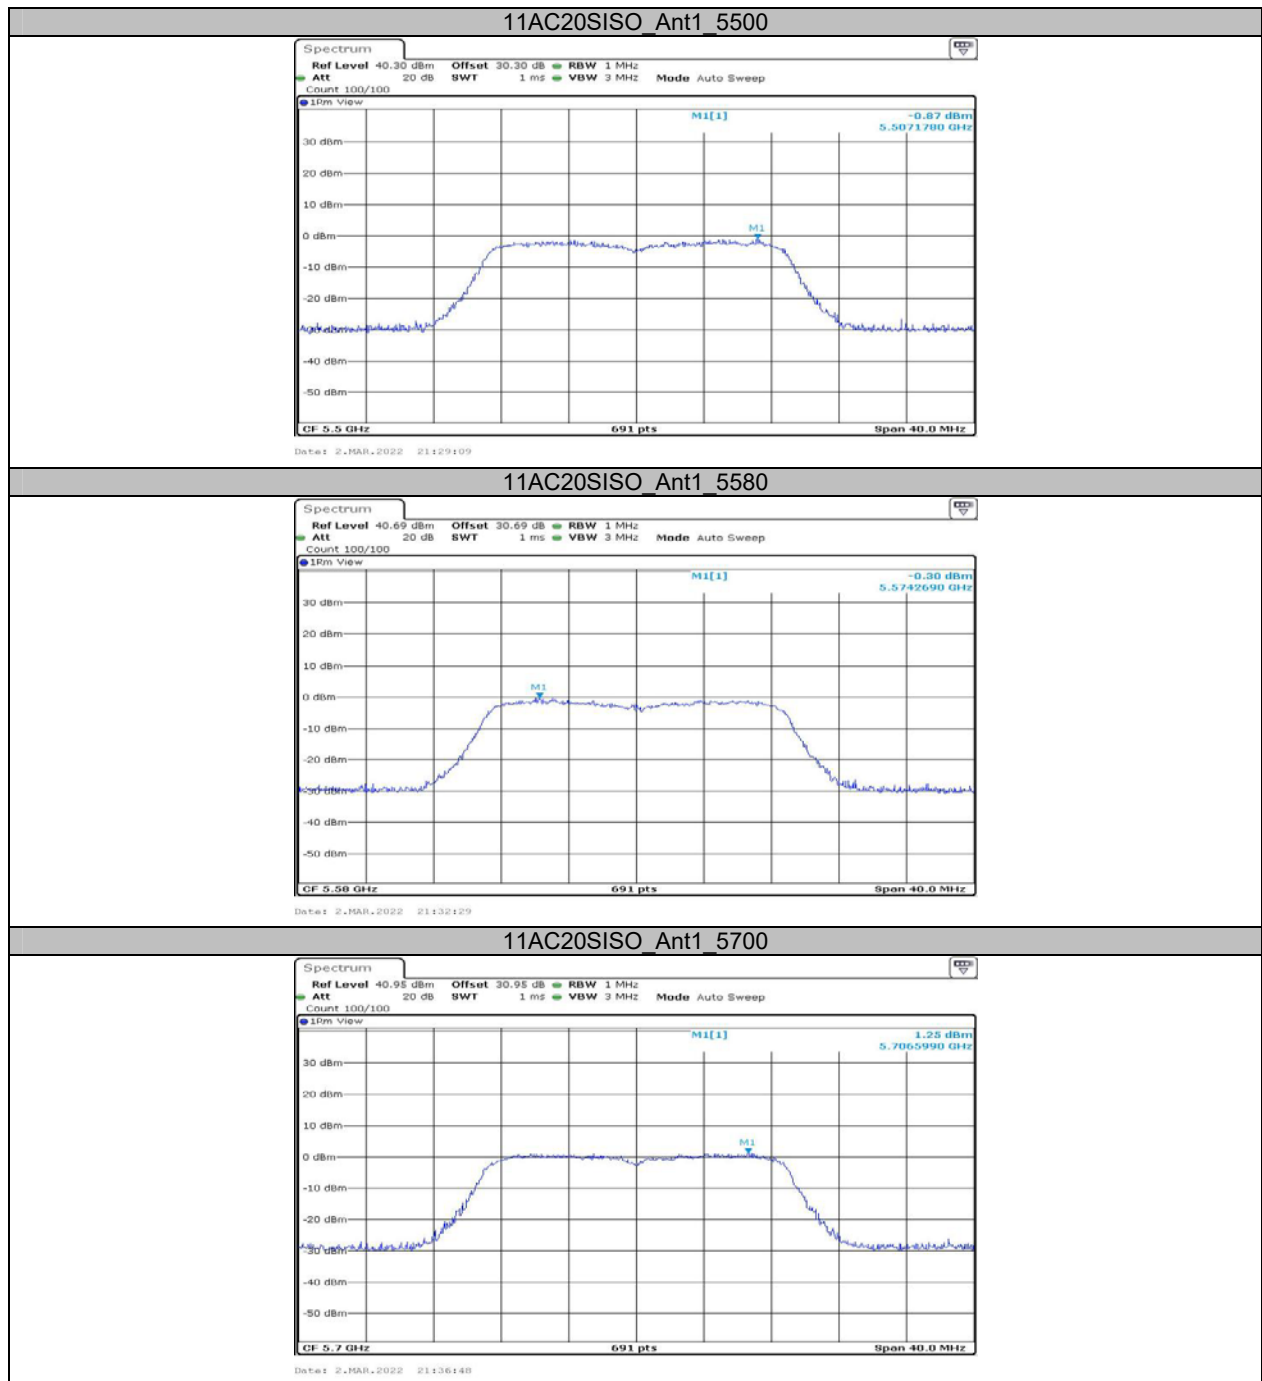


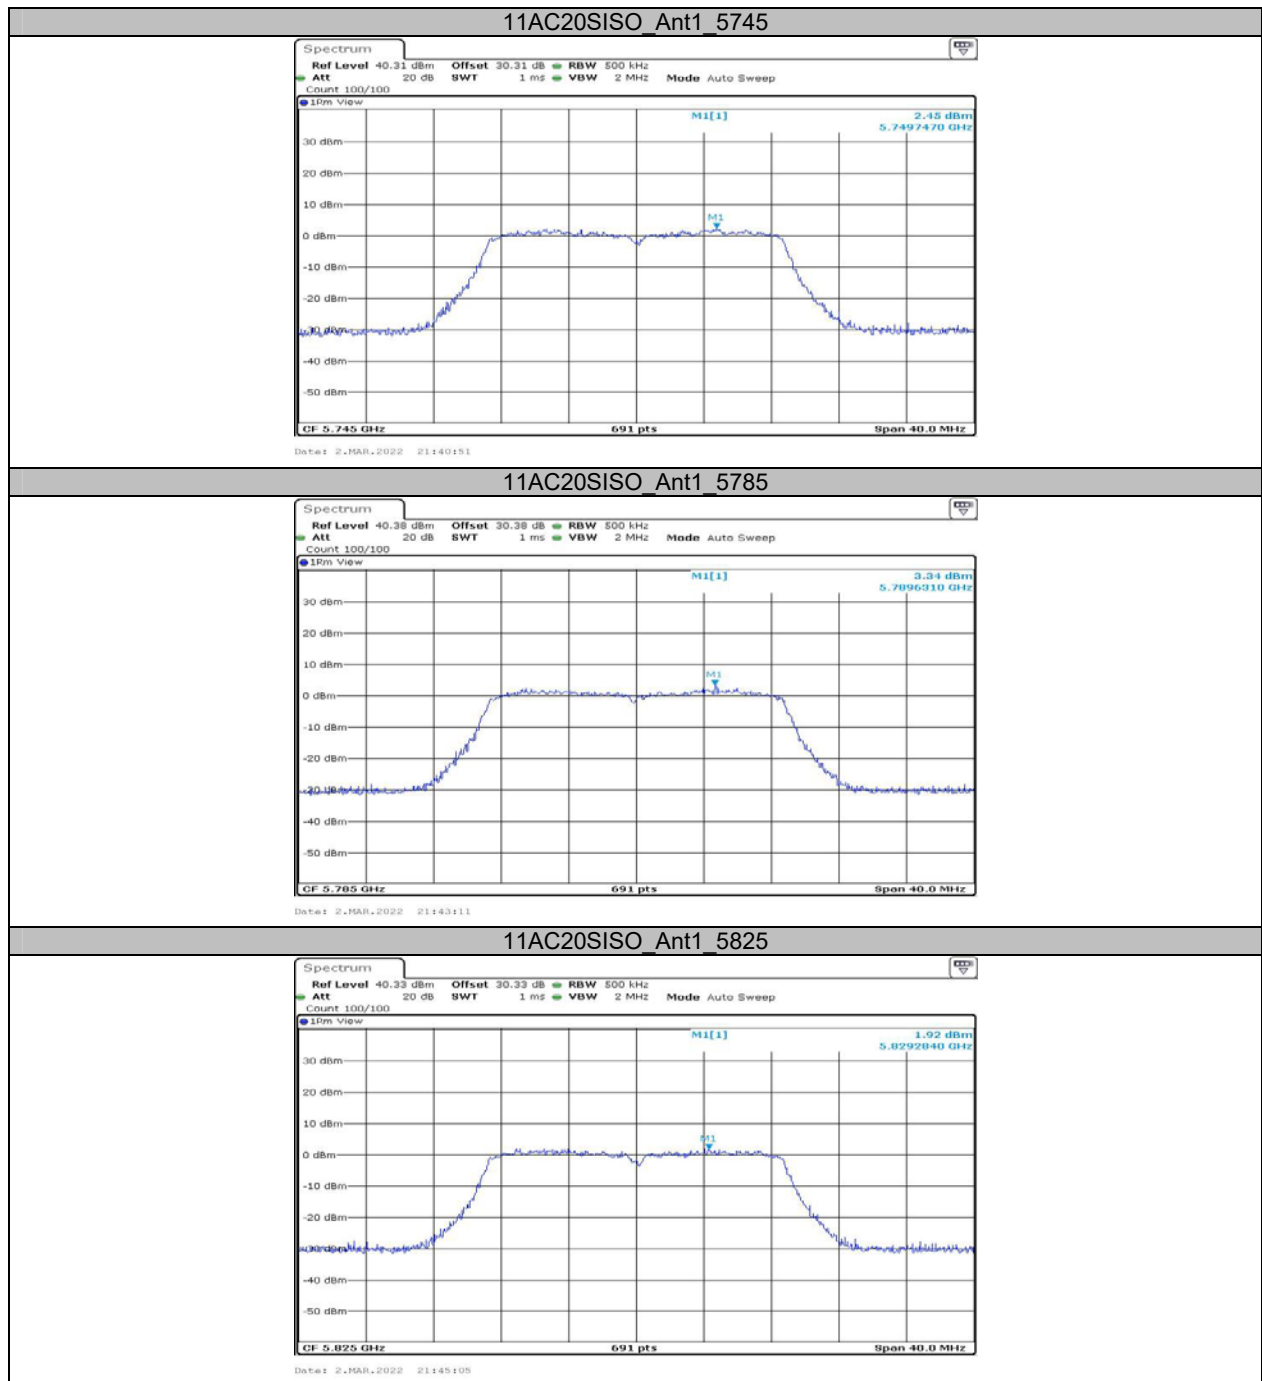


11AC40SISO_Ant1_5190

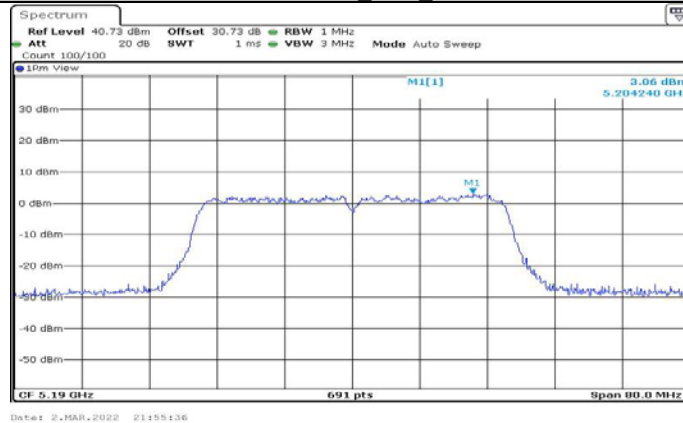


11AC40SISO_Ant1_5230

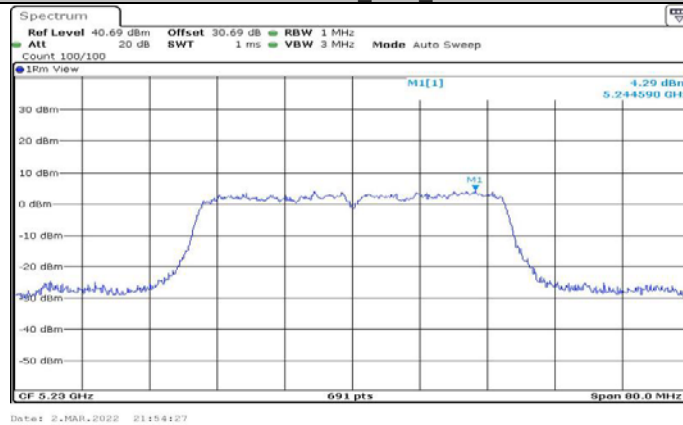


11AC40SISO_Ant1_5270

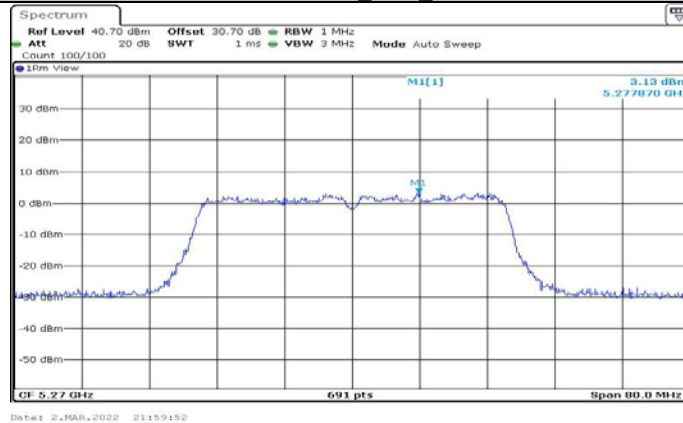


11AC40SISO_Ant1_5310

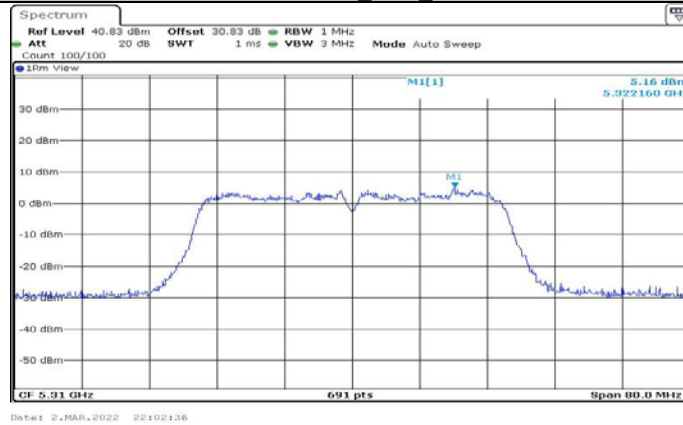


11AC40SISO_Ant1_5510

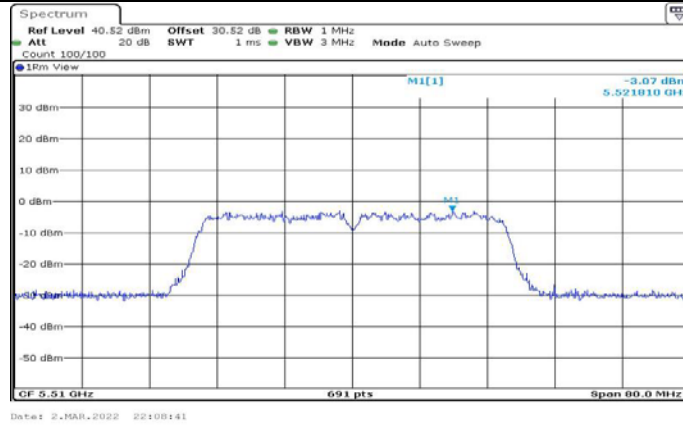

11AC40SISO_Ant1_5550

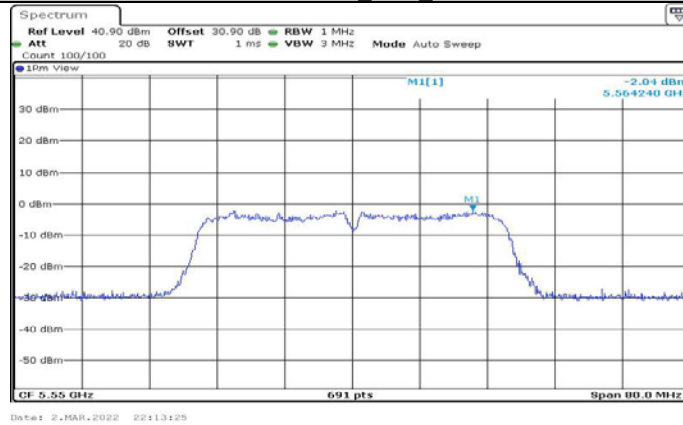


11AC40SISO_Ant1_5670

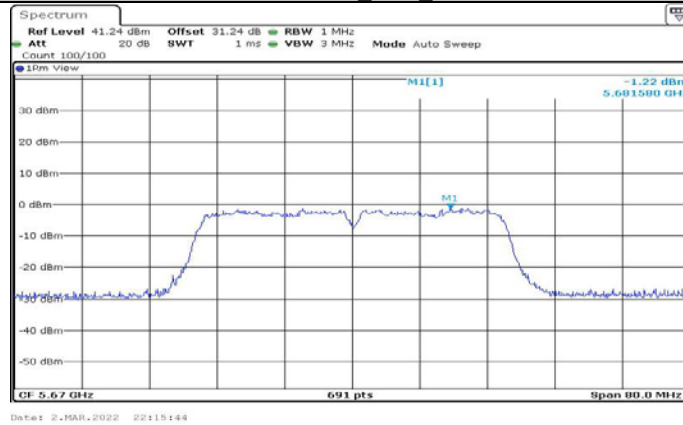


11AC40SISO_Ant1_5755




11AC40SISO_Ant1_5795

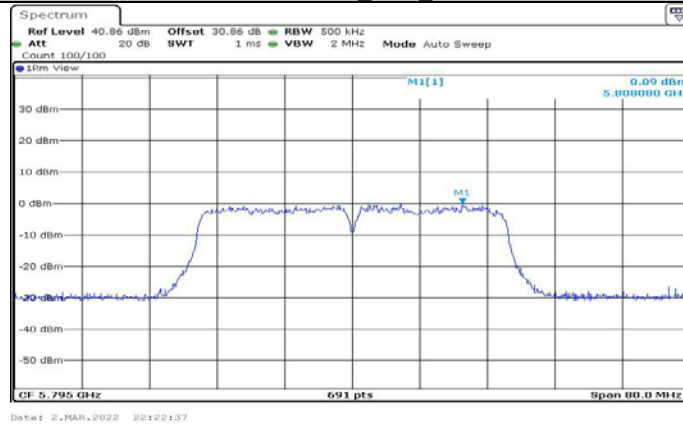


11AC80SISO_Ant1_5210

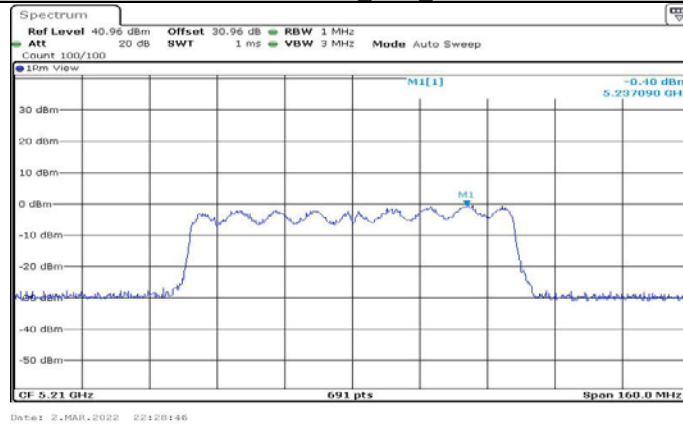


11AC80SISO_Ant1_5290

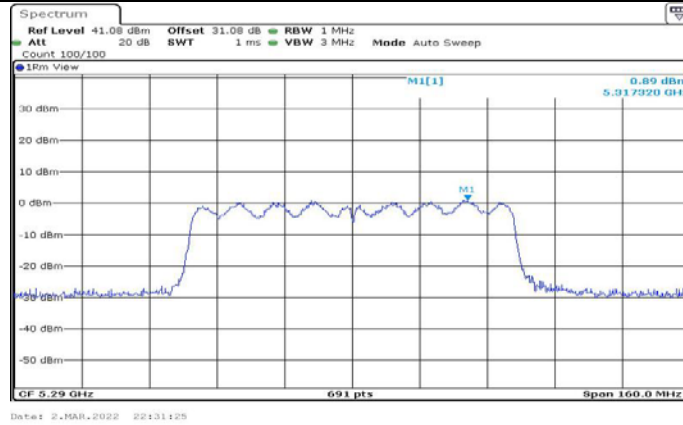

11AC80SISO_Ant1_5530

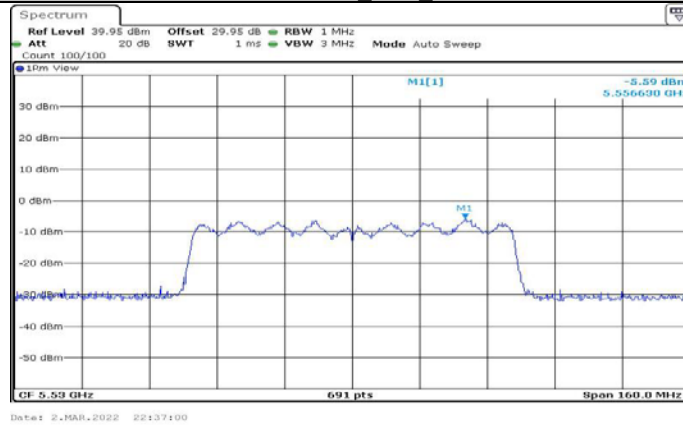

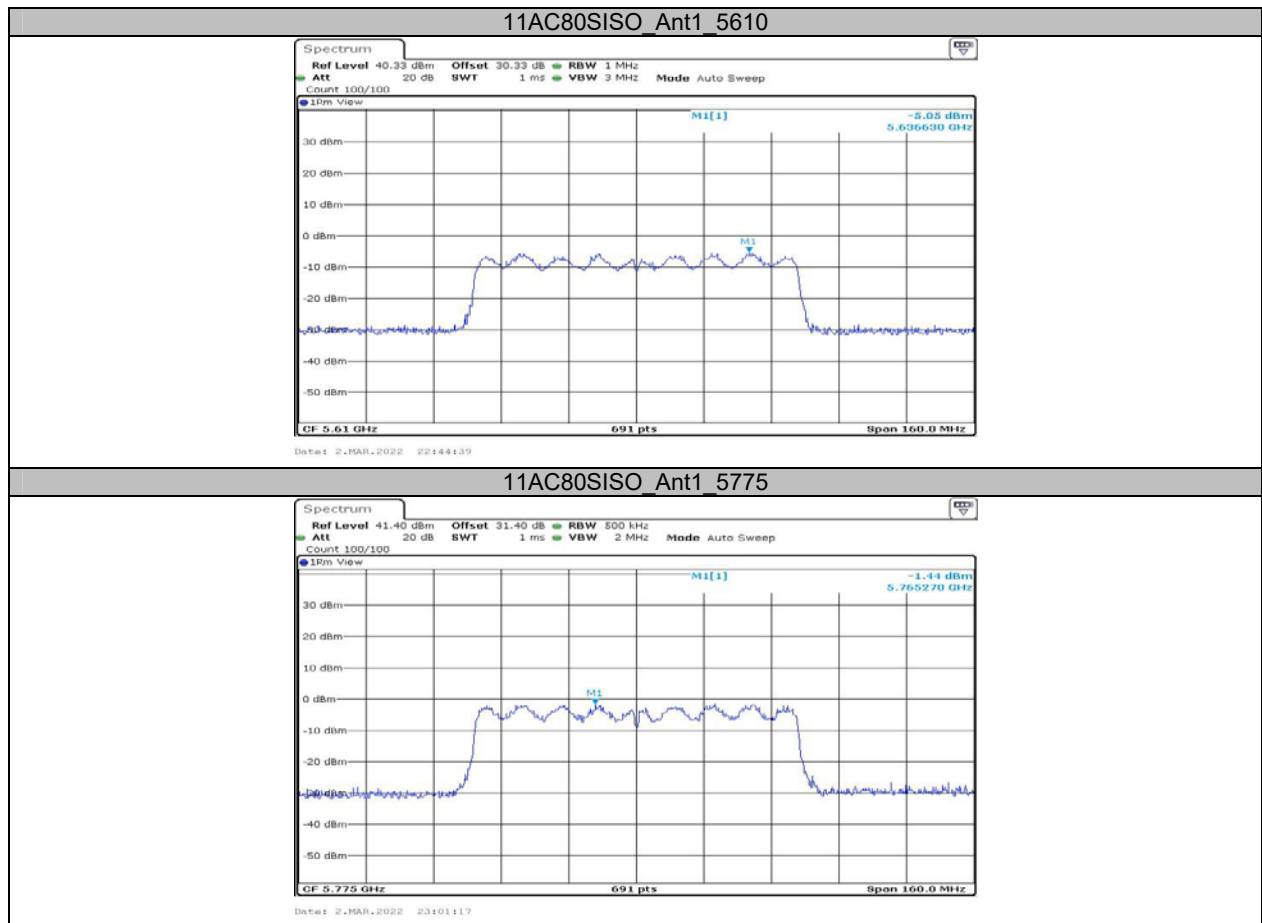


Appendix D: Duty Cycle Test Result

Test Mode	Antenna	Channel	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]
11A	Ant1	5200	2.07	2.15	96.28
		5280	2.06	2.15	95.81
		5580	2.06	2.18	94.50
		5785	2.06	2.16	95.37
11N20SISO	Ant1	5200	1.92	2.03	94.58
		5280	1.92	2.05	93.66
		5580	1.92	2.04	94.12
		5785	1.92	2.09	91.87
11N40SISO	Ant1	5190	0.85	0.98	86.73
		5270	0.85	0.94	90.43
		5550	0.85	0.97	87.63
		5755	0.85	0.99	85.86
11AC20SISO	Ant1	5200	1.93	2.06	93.69
		5280	1.93	2.07	93.24
		5580	1.93	2.09	92.34
		5785	1.93	2.09	92.34
11AC40SISO	Ant1	5190	0.86	0.99	86.87
		5270	0.86	0.99	86.87
		5550	0.86	0.98	87.76
		5755	0.86	0.99	86.87
11AC80SISO	Ant1	5210	0.47	0.57	82.46
		5290	0.46	0.59	77.97
		5530	0.46	0.58	79.31
		5775	0.46	0.59	77.97


Test Graphs




11A Ant1_5785

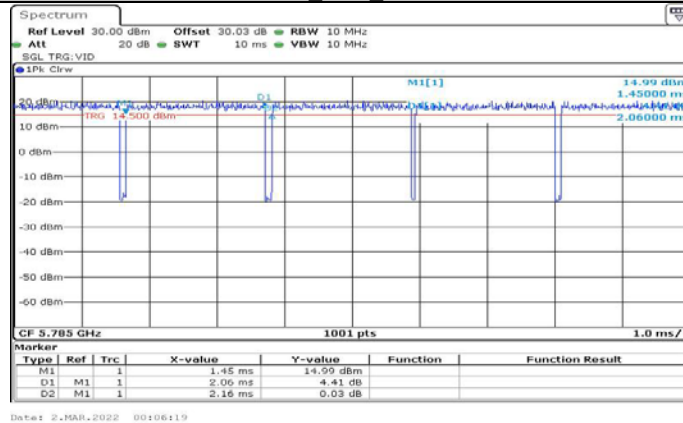

11N20SISO Ant1_5200

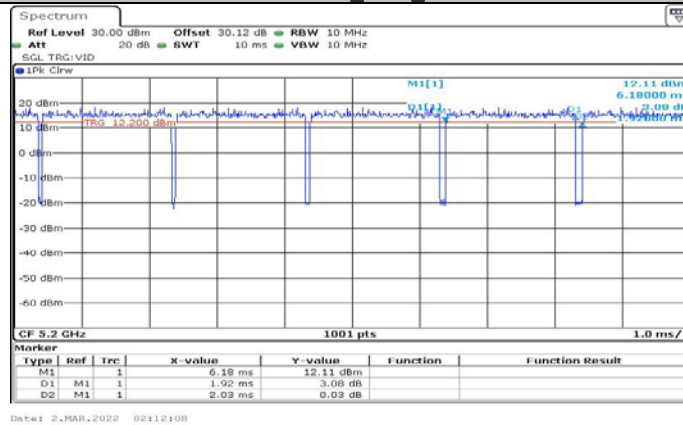


11N20SISO Ant1_5280

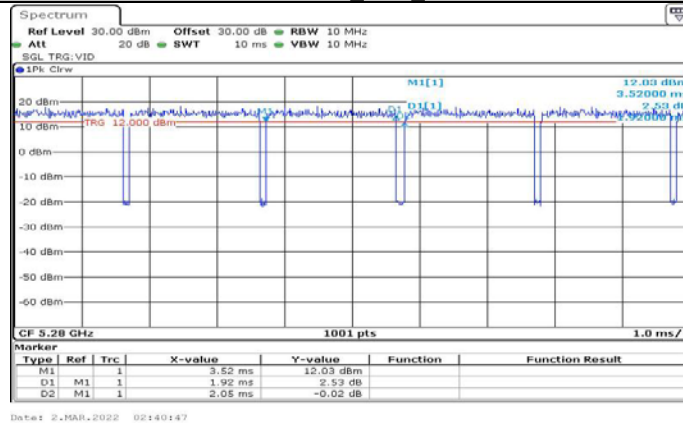




11N40SISO_Ant1_5270

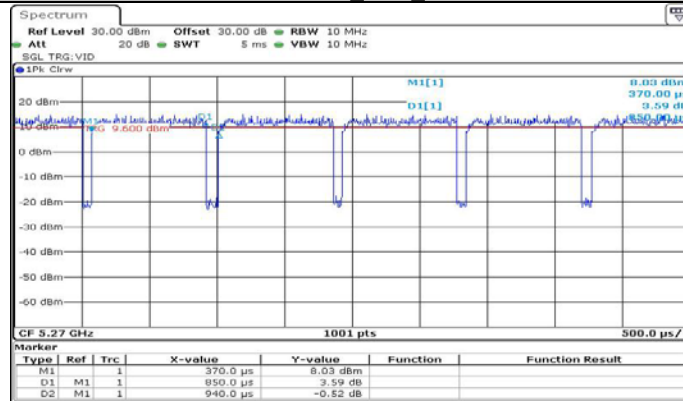


Date: 2.MAR.2022 20:14:06

11N40SISO_Ant1_5550

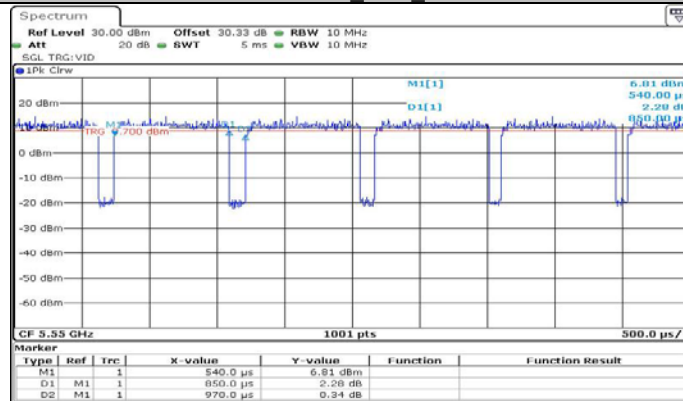


Date: 2.MAR.2022 20:12:25

11N40SISO_Ant1_5755

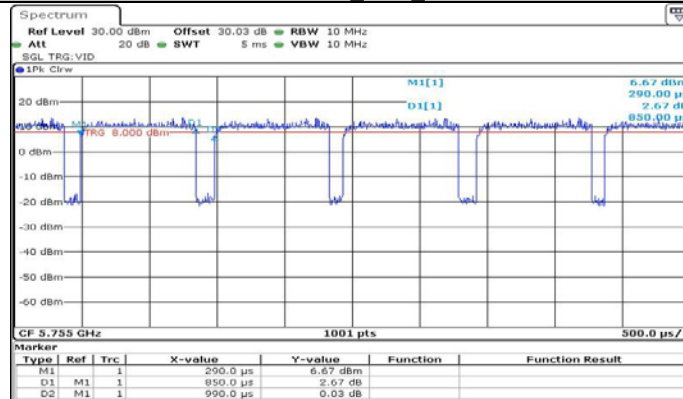


Date: 2.MAR.2022 20:16:46


11AC20SISO_Ant1_5200

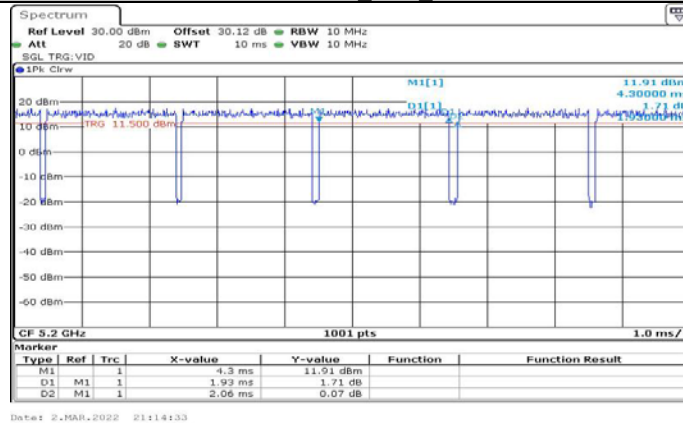


11AC20SISO_Ant1_5280

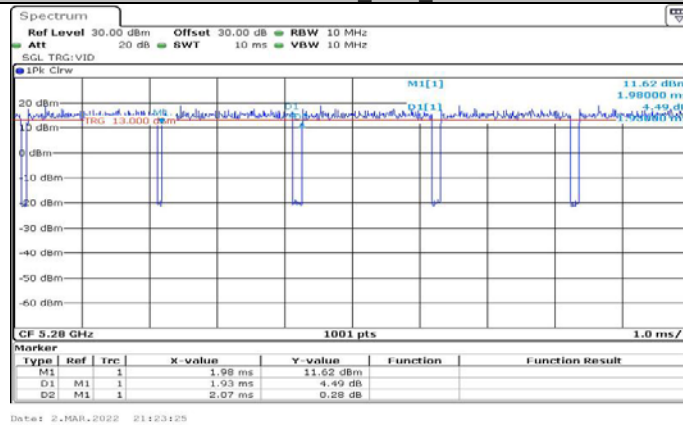


11AC20SISO_Ant1_5580

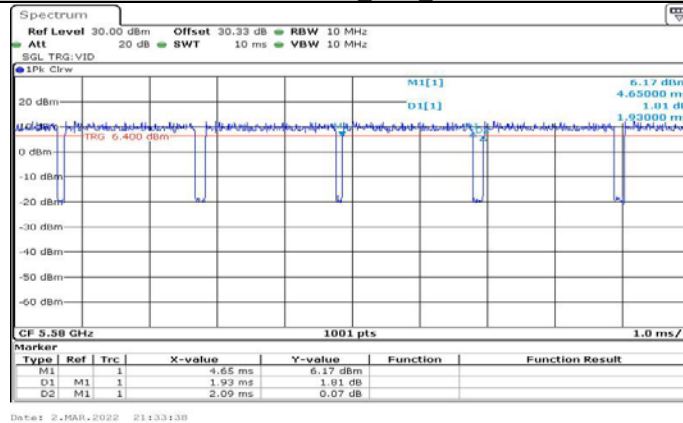


11AC20SISO_Ant1_5785

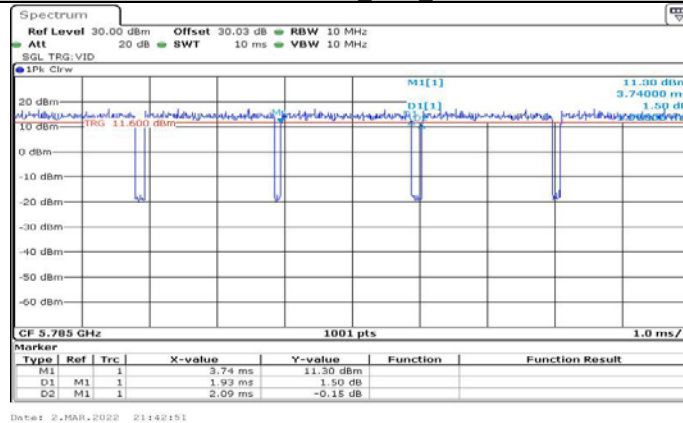


11AC40SISO_Ant1_5190

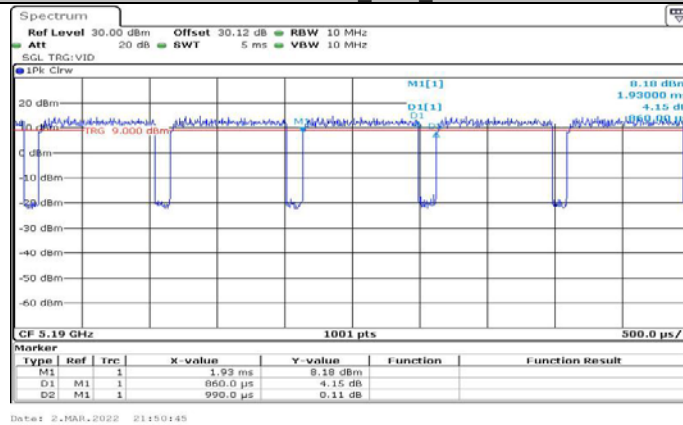

11AC40SISO_Ant1_5270

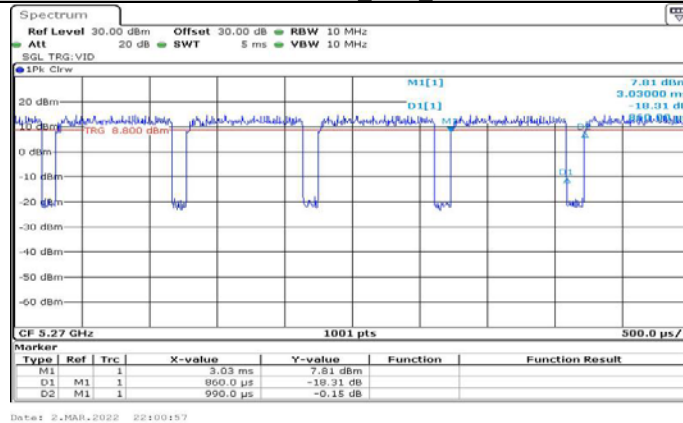


11AC40SISO_Ant1_5550

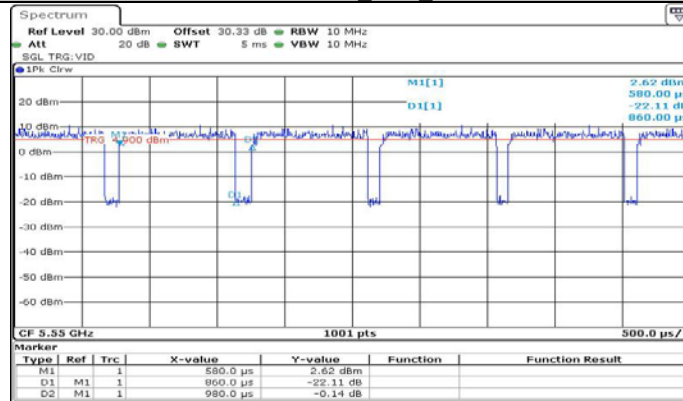


Date: 2.MAR.2022 22:13:06

11AC40SISO_Ant1_5755

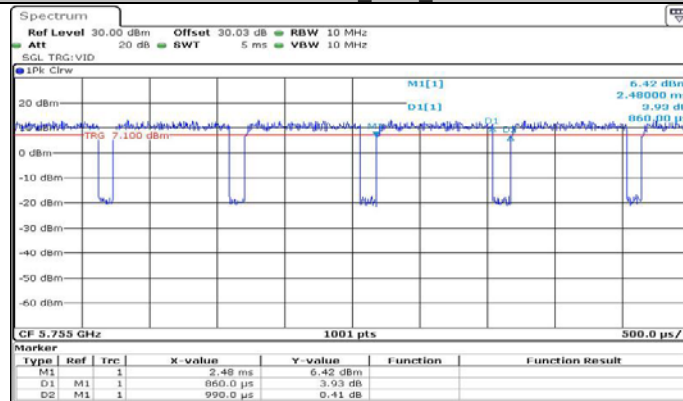


Date: 2.MAR.2022 22:10:46

11AC80SISO_Ant1_5210

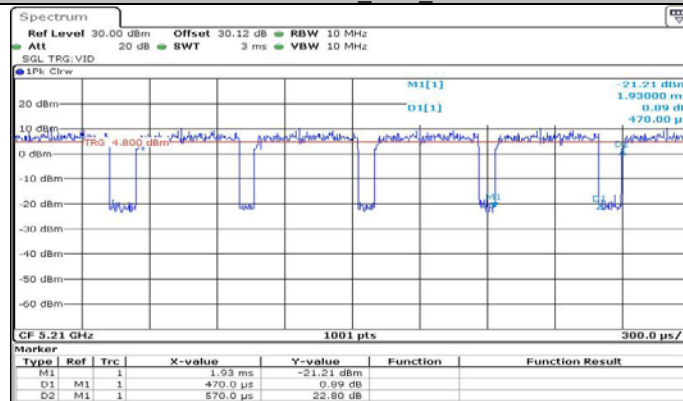

Date: 2.MAR.2022 22:10:27

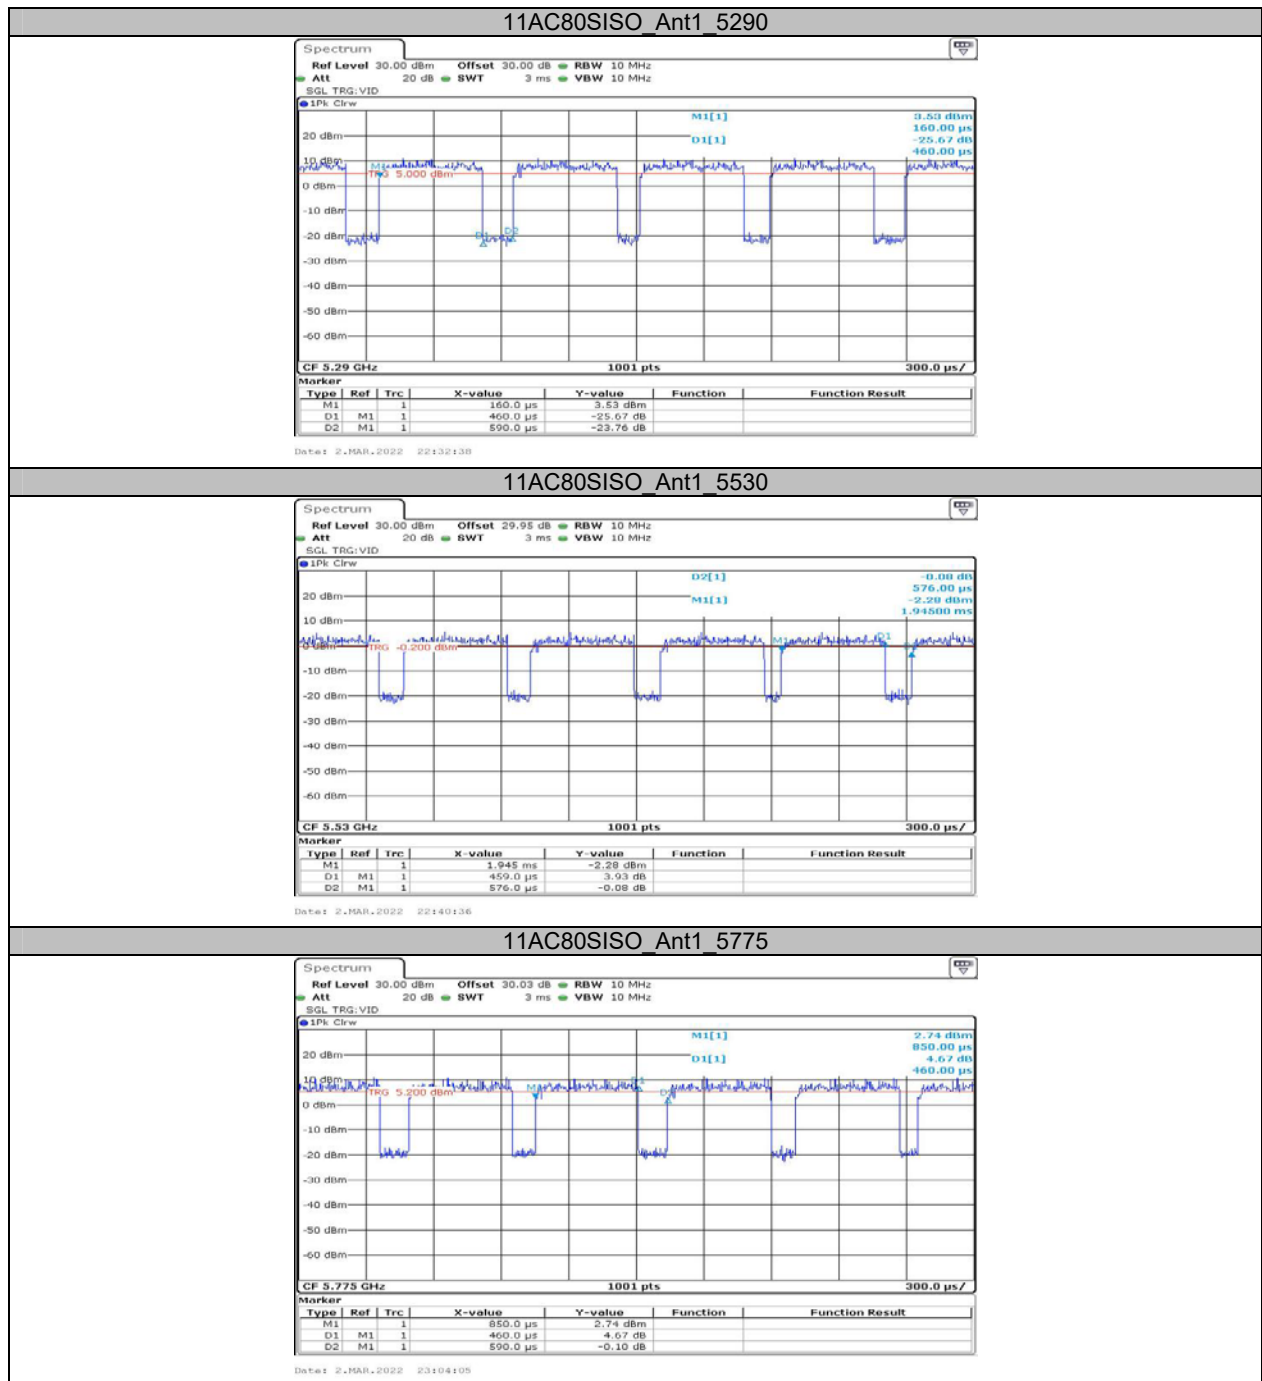

***** END OF REPORT *****