



|      |      |      |      |         |        |      |      |       |         |      |      |
|------|------|------|------|---------|--------|------|------|-------|---------|------|------|
| NVNT | ac20 | 5260 | Ant4 | 4500    | -58.41 | 5.19 | 0.12 | 42.13 | Average | 54   | Pass |
| NVNT | ac20 | 5260 | Ant4 | 4915.74 | -46.42 | 5.19 | -    | 54.00 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5260 | Ant4 | 5127.9  | -56.81 | 5.19 | 0.12 | 43.73 | Average | 54   | Pass |
| NVNT | ac20 | 5260 | Ant4 | 5150    | -49.07 | 5.19 | -    | 51.35 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5260 | Ant4 | 5150    | -57    | 5.19 | 0.12 | 43.54 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant4 | 5350    | -44.87 | 5.19 | -    | 55.55 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant4 | 5350    | -55.87 | 5.19 | 0.12 | 44.67 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant4 | 5350.4  | -42.61 | 5.19 | -    | 57.81 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant4 | 5351.2  | -54.96 | 5.19 | 0.12 | 45.58 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant4 | 5460    | -49.67 | 5.19 | -    | 50.75 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant4 | 5460    | -57.65 | 5.19 | 0.12 | 42.89 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant4 | 4500    | -50.47 | 5.19 | -    | 49.95 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant4 | 4500    | -59.31 | 5.19 | 0.12 | 41.23 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant4 | 5076.72 | -46.36 | 5.19 | -    | 54.06 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant4 | 4807.8  | -56.83 | 5.19 | 0.12 | 43.71 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant4 | 5150    | -49.69 | 5.19 | -    | 50.73 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant4 | 5150    | -57.29 | 5.19 | 0.12 | 43.25 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant4 | 5350    | -44.44 | 5.19 | -    | 55.98 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant4 | 5350    | -55.98 | 5.19 | 0.12 | 44.56 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant4 | 5350.2  | -42.47 | 5.19 | -    | 57.95 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant4 | 5350.8  | -55.71 | 5.19 | 0.12 | 44.83 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant4 | 5460    | -49.69 | 5.19 | -    | 50.73 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant4 | 5460    | -58.4  | 5.19 | 0.12 | 42.14 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant4 | 4500    | -51    | 5.19 | -    | 49.42 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant4 | 4500    | -59.72 | 5.19 | 0.25 | 40.95 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant4 | 4961.97 | -46.21 | 5.19 | -    | 54.21 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant4 | 5124.66 | -56.56 | 5.19 | 0.25 | 44.11 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant4 | 5150    | -48.62 | 5.19 | -    | 51.80 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant4 | 5150    | -56.8  | 5.19 | 0.25 | 43.87 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant4 | 5350    | -43.94 | 5.19 | -    | 56.48 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant4 | 5350    | -55.24 | 5.19 | 0.25 | 45.43 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant4 | 5351.5  | -43.82 | 5.19 | -    | 56.60 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant4 | 5350    | -55.24 | 5.19 | 0.25 | 45.43 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant4 | 5460    | -50.05 | 5.19 | -    | 50.37 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant4 | 5460    | -57.56 | 5.19 | 0.25 | 43.11 | Average | 54   | Pass |
| NVNT | ax20 | 5260 | Ant4 | 4500    | -50.55 | 5.19 | -    | 49.87 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5260 | Ant4 | 4500    | -59.8  | 5.19 | 0.12 | 40.74 | Average | 54   | Pass |
| NVNT | ax20 | 5260 | Ant4 | 5092.02 | -47.01 | 5.19 | -    | 53.41 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5260 | Ant4 | 5074.08 | -57    | 5.19 | 0.12 | 43.54 | Average | 54   | Pass |
| NVNT | ax20 | 5260 | Ant4 | 5150    | -48.75 | 5.19 | -    | 51.67 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5260 | Ant4 | 5150    | -57.35 | 5.19 | 0.12 | 43.19 | Average | 54   | Pass |





|      |       |      |      |         |        |      |      |       |         |      |      |
|------|-------|------|------|---------|--------|------|------|-------|---------|------|------|
| NVNT | ax20  | 5320 | Ant4 | 5350    | -45.66 | 5.19 | -    | 54.76 | Peak    | 68.2 | Pass |
| NVNT | ax20  | 5320 | Ant4 | 5350    | -55.28 | 5.19 | 0.12 | 45.26 | Average | 54   | Pass |
| NVNT | ax20  | 5320 | Ant4 | 5350.6  | -42.61 | 5.19 | -    | 57.81 | Peak    | 68.2 | Pass |
| NVNT | ax20  | 5320 | Ant4 | 5350    | -55.28 | 5.19 | 0.12 | 45.26 | Average | 54   | Pass |
| NVNT | ax20  | 5320 | Ant4 | 5460    | -50.83 | 5.19 | -    | 49.59 | Peak    | 68.2 | Pass |
| NVNT | ax20  | 5320 | Ant4 | 5460    | -57.99 | 5.19 | 0.12 | 42.55 | Average | 54   | Pass |
| NVNT | ax40  | 5270 | Ant4 | 4500    | -50.45 | 5.19 | -    | 49.97 | Peak    | 68.2 | Pass |
| NVNT | ax40  | 5270 | Ant4 | 4500    | -58.71 | 5.19 | 0.12 | 41.83 | Average | 54   | Pass |
| NVNT | ax40  | 5270 | Ant4 | 5079.96 | -46.09 | 5.19 | -    | 54.33 | Peak    | 68.2 | Pass |
| NVNT | ax40  | 5270 | Ant4 | 5062.95 | -56.78 | 5.19 | 0.12 | 43.76 | Average | 54   | Pass |
| NVNT | ax40  | 5270 | Ant4 | 5150    | -48.3  | 5.19 | -    | 52.12 | Peak    | 68.2 | Pass |
| NVNT | ax40  | 5270 | Ant4 | 5150    | -57.81 | 5.19 | 0.12 | 42.73 | Average | 54   | Pass |
| NVNT | ax40  | 5310 | Ant4 | 5350    | -43.09 | 5.19 | -    | 57.33 | Peak    | 68.2 | Pass |
| NVNT | ax40  | 5310 | Ant4 | 5350    | -55.57 | 5.19 | 0.12 | 44.97 | Average | 54   | Pass |
| NVNT | ax40  | 5310 | Ant4 | 5460    | -50.4  | 5.19 | -    | 50.02 | Peak    | 68.2 | Pass |
| NVNT | ax40  | 5310 | Ant4 | 5460    | -57.65 | 5.19 | 0.12 | 42.89 | Average | 54   | Pass |
| NVNT | ax80  | 5290 | Ant4 | 5350    | -47.43 | 5.19 | -    | 52.99 | Peak    | 68.2 | Pass |
| NVNT | ax80  | 5290 | Ant4 | 5350    | -54.82 | 5.19 | 0.25 | 45.85 | Average | 54   | Pass |
| NVNT | ax80  | 5290 | Ant4 | 5353.5  | -44.58 | 5.19 | -    | 55.84 | Peak    | 68.2 | Pass |
| NVNT | ax80  | 5290 | Ant4 | 5350    | -54.82 | 5.19 | 0.25 | 45.85 | Average | 54   | Pass |
| NVNT | ax80  | 5290 | Ant4 | 5460    | -50.68 | 5.19 | -    | 49.74 | Peak    | 68.2 | Pass |
| NVNT | ax80  | 5290 | Ant4 | 5460    | -58.21 | 5.19 | 0.25 | 42.46 | Average | 54   | Pass |
| NVNT | ax80  | 5290 | Ant4 | 4500    | -51.37 | 5.19 | -    | 49.05 | Peak    | 68.2 | Pass |
| NVNT | ax80  | 5290 | Ant4 | 4500    | -58.87 | 5.19 | 0.25 | 41.80 | Average | 54   | Pass |
| NVNT | ax80  | 5290 | Ant4 | 5145.54 | -45.9  | 5.19 | -    | 54.52 | Peak    | 68.2 | Pass |
| NVNT | ax80  | 5290 | Ant4 | 5138.58 | -56.38 | 5.19 | 0.25 | 44.29 | Average | 54   | Pass |
| NVNT | ax80  | 5290 | Ant4 | 5150    | -47.79 | 5.19 | -    | 52.63 | Peak    | 68.2 | Pass |
| NVNT | ax80  | 5290 | Ant4 | 5150    | -56.97 | 5.19 | 0.25 | 43.70 | Average | 54   | Pass |
| NVNT | ac160 | 5250 | Ant4 | 5350    | -49.21 | 5.19 | -    | 51.21 | Peak    | 68.2 | Pass |
| NVNT | ac160 | 5250 | Ant4 | 5350    | -57.35 | 5.19 | 0.24 | 43.31 | Average | 54   | Pass |
| NVNT | ac160 | 5250 | Ant4 | 5354.55 | -47.15 | 5.19 | -    | 53.27 | Peak    | 68.2 | Pass |
| NVNT | ac160 | 5250 | Ant4 | 5354.55 | -55.08 | 5.19 | 0.24 | 45.58 | Average | 54   | Pass |
| NVNT | ac160 | 5250 | Ant4 | 5460    | -55.44 | 5.19 | -    | 44.98 | Peak    | 68.2 | Pass |
| NVNT | ac160 | 5250 | Ant4 | 5460    | -65.5  | 5.19 | 0.24 | 35.16 | Average | 54   | Pass |
| NVNT | ac160 | 5250 | Ant4 | 4500    | -60.65 | 5.19 | -    | 39.77 | Peak    | 68.2 | Pass |
| NVNT | ac160 | 5250 | Ant4 | 4500    | -67.75 | 5.19 | 0.24 | 32.91 | Average | 54   | Pass |
| NVNT | ac160 | 5250 | Ant4 | 5147.01 | -48.76 | 5.19 | -    | 51.66 | Peak    | 68.2 | Pass |
| NVNT | ac160 | 5250 | Ant4 | 5144.28 | -56.55 | 5.19 | 0.24 | 44.11 | Average | 54   | Pass |
| NVNT | ac160 | 5250 | Ant4 | 5150    | -52.21 | 5.19 | -    | 48.21 | Peak    | 68.2 | Pass |
| NVNT | ac160 | 5250 | Ant4 | 5150    | -60.27 | 5.19 | 0.24 | 40.39 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | Ant4 | 5350    | -47.32 | 5.19 | -    | 53.10 | Peak    | 68.2 | Pass |






|      |       |      |      |         |        |      |      |       |         |      |      |
|------|-------|------|------|---------|--------|------|------|-------|---------|------|------|
| NVNT | ax160 | 5250 | Ant4 | 5350    | -55.81 | 5.19 | 0.63 | 45.24 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | Ant4 | 5372.68 | -44    | 5.19 | -    | 56.42 | Peak    | 68.2 | Pass |
| NVNT | ax160 | 5250 | Ant4 | 5353.07 | -55.8  | 5.19 | 0.63 | 45.25 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | Ant4 | 5460    | -56.69 | 5.19 | -    | 43.73 | Peak    | 68.2 | Pass |
| NVNT | ax160 | 5250 | Ant4 | 5460    | -65.58 | 5.19 | 0.63 | 35.47 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | Ant4 | 4500    | -59.83 | 5.19 | -    | 40.59 | Peak    | 68.2 | Pass |
| NVNT | ax160 | 5250 | Ant4 | 4500    | -67.82 | 5.19 | 0.63 | 33.23 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | Ant4 | 5134.27 | -43.08 | 5.19 | -    | 57.34 | Peak    | 68.2 | Pass |
| NVNT | ax160 | 5250 | Ant4 | 5122.44 | -55.8  | 5.19 | 0.63 | 45.25 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | Ant4 | 5150    | -46.36 | 5.19 | -    | 54.06 | Peak    | 68.2 | Pass |
| NVNT | ax160 | 5250 | Ant4 | 5150    | -57.02 | 5.19 | 0.63 | 44.03 | Average | 54   | Pass |






## Test Graphs

## Restrict Band NVNT a 5260MHz Ant4 Peak

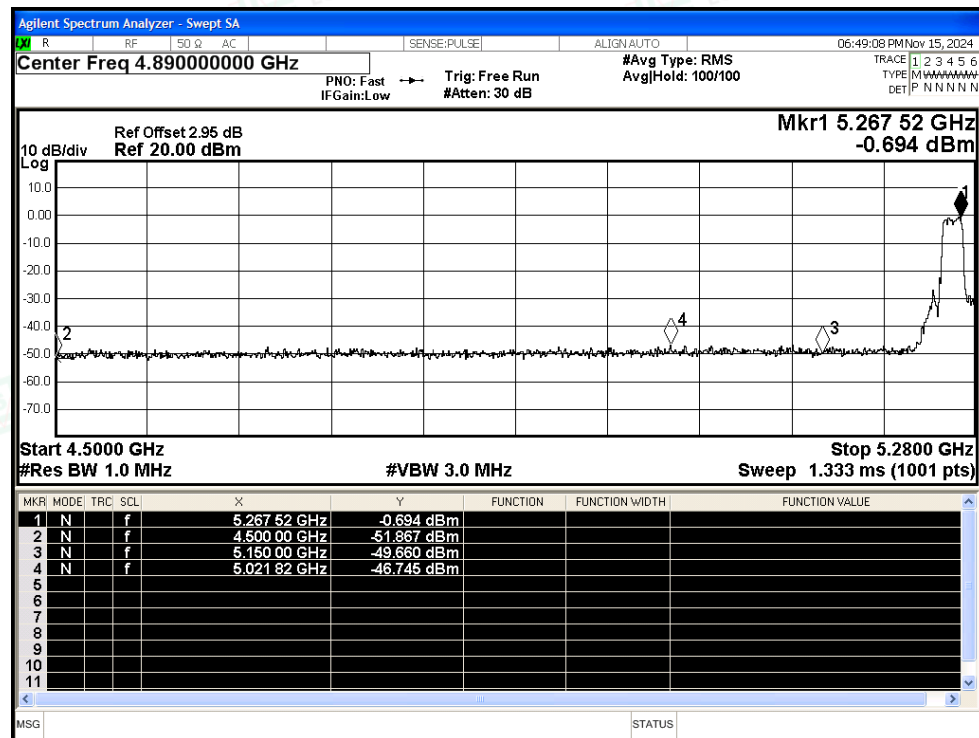

## Restrict Band NVNT a 5260MHz Ant4 Average

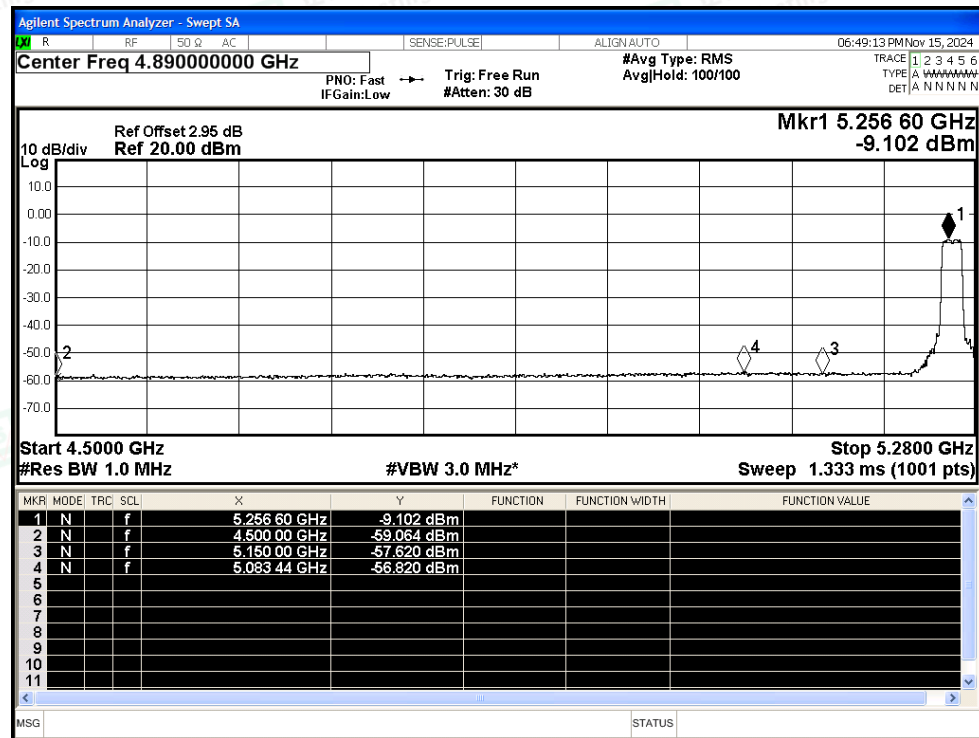

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT a 5320MHz Ant4 Peak

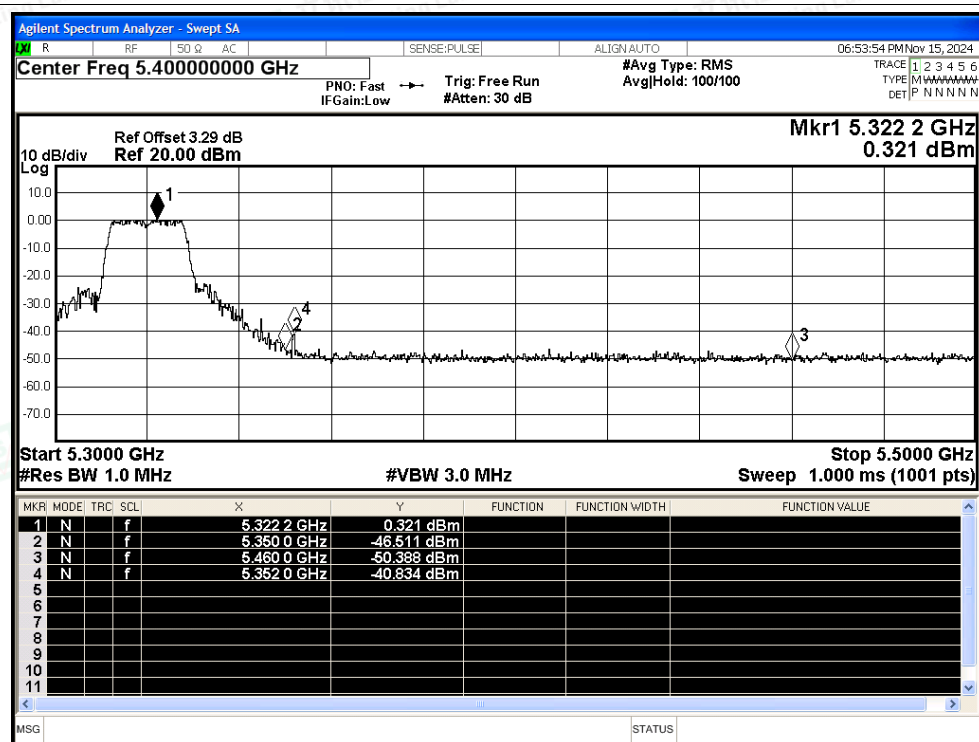

## Restrict Band NVNT a 5320MHz Ant4 Average

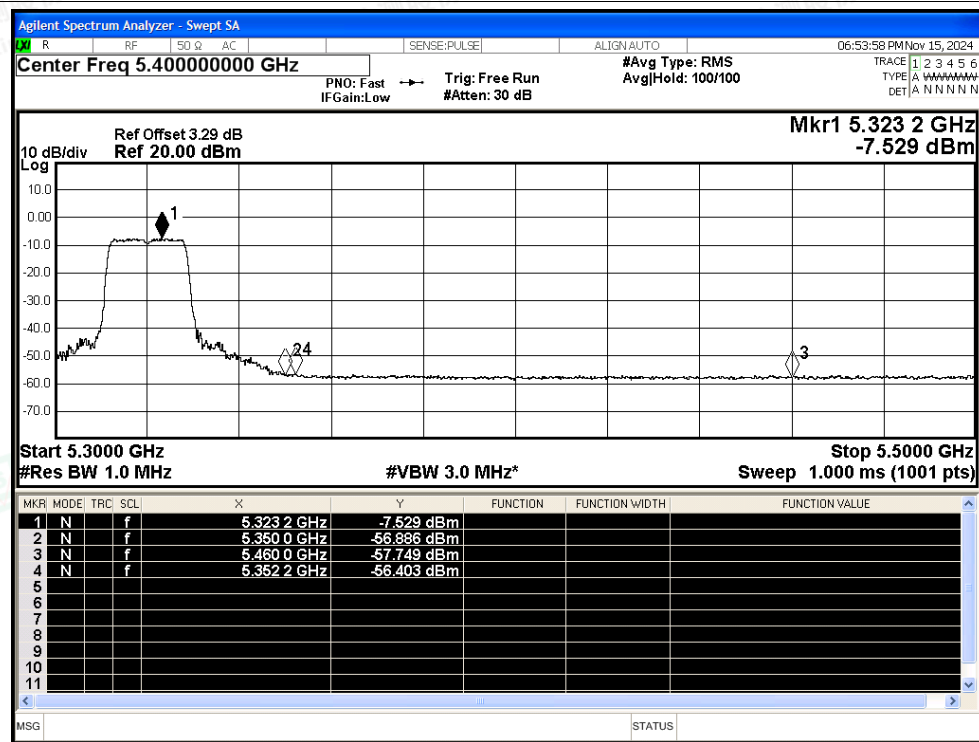

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5260MHz Ant4 Peak

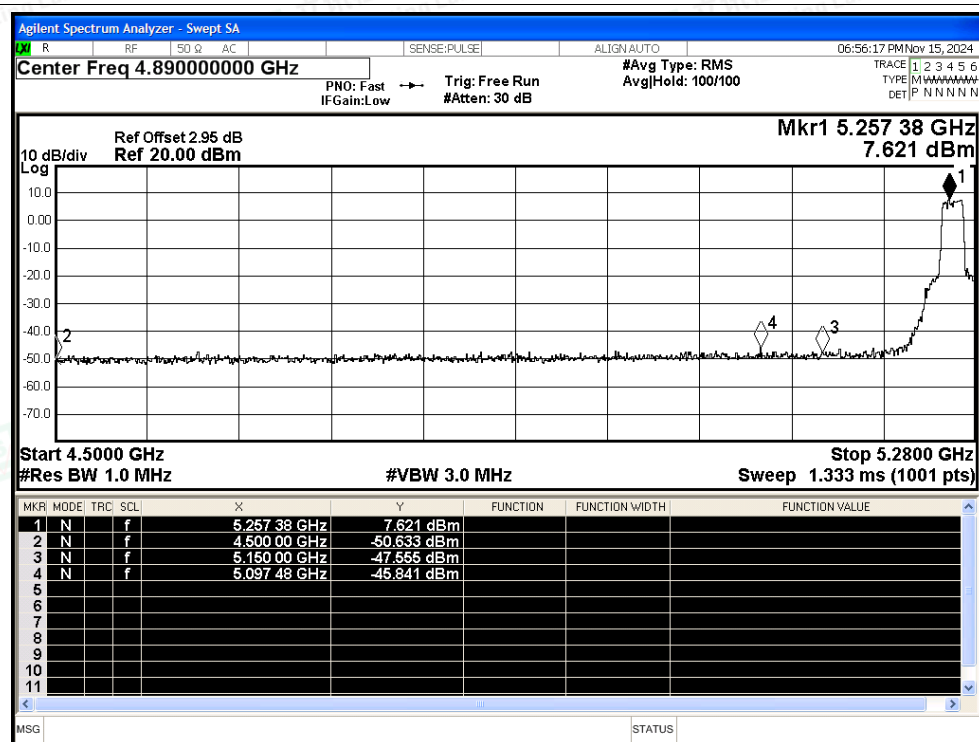

## Restrict Band NVNT n20 5260MHz Ant4 Average

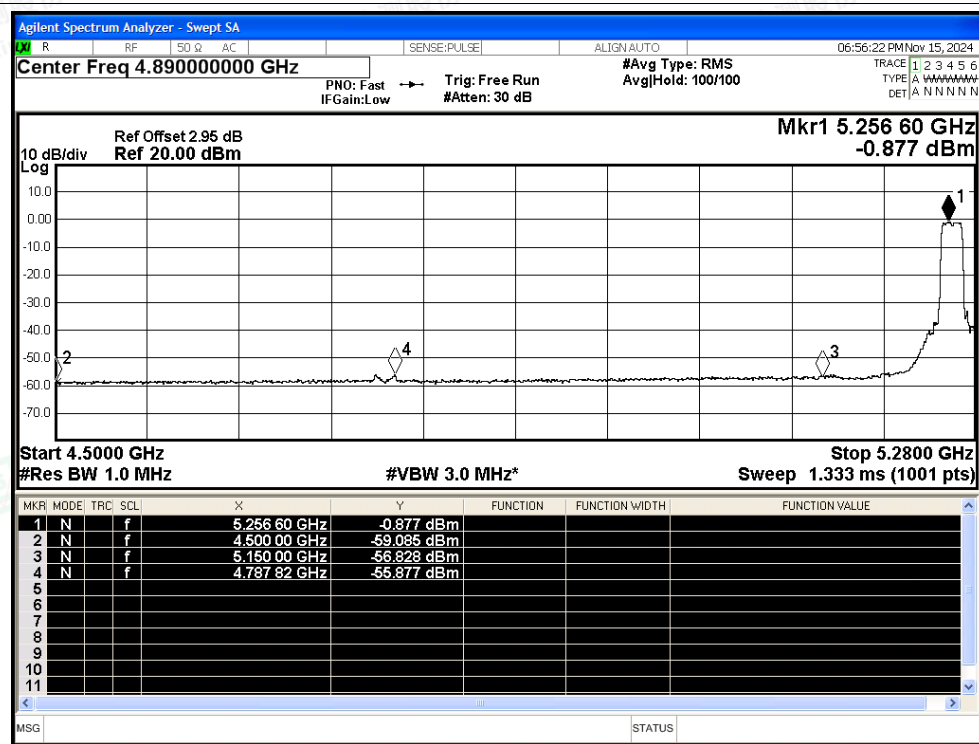

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT n20 5320MHz Ant4 Peak

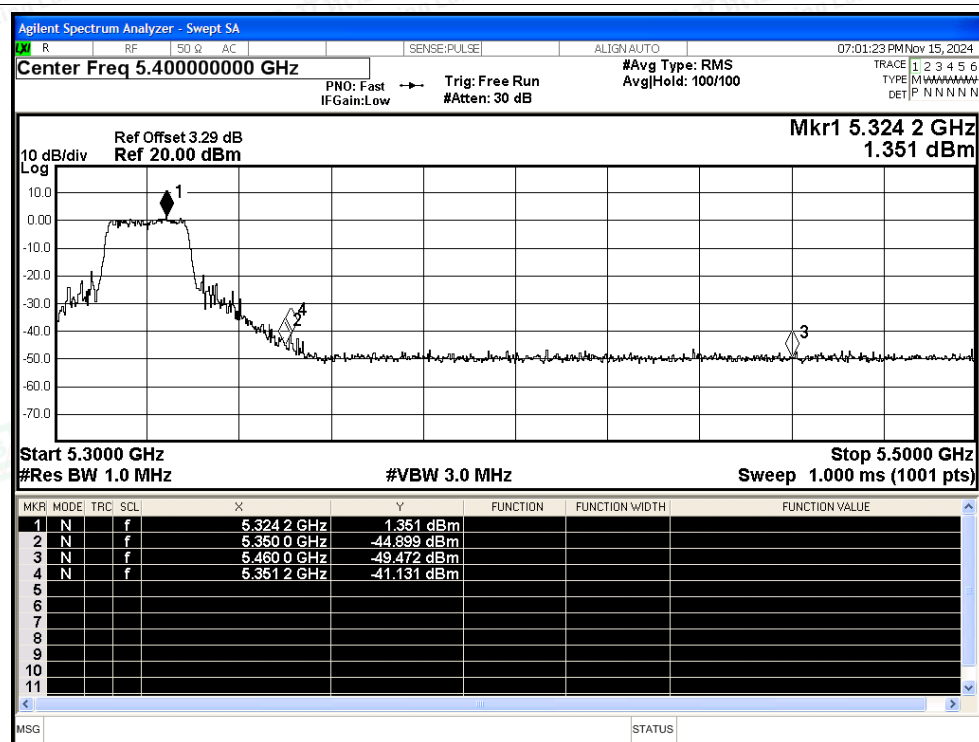

## Restrict Band NVNT n20 5320MHz Ant4 Average

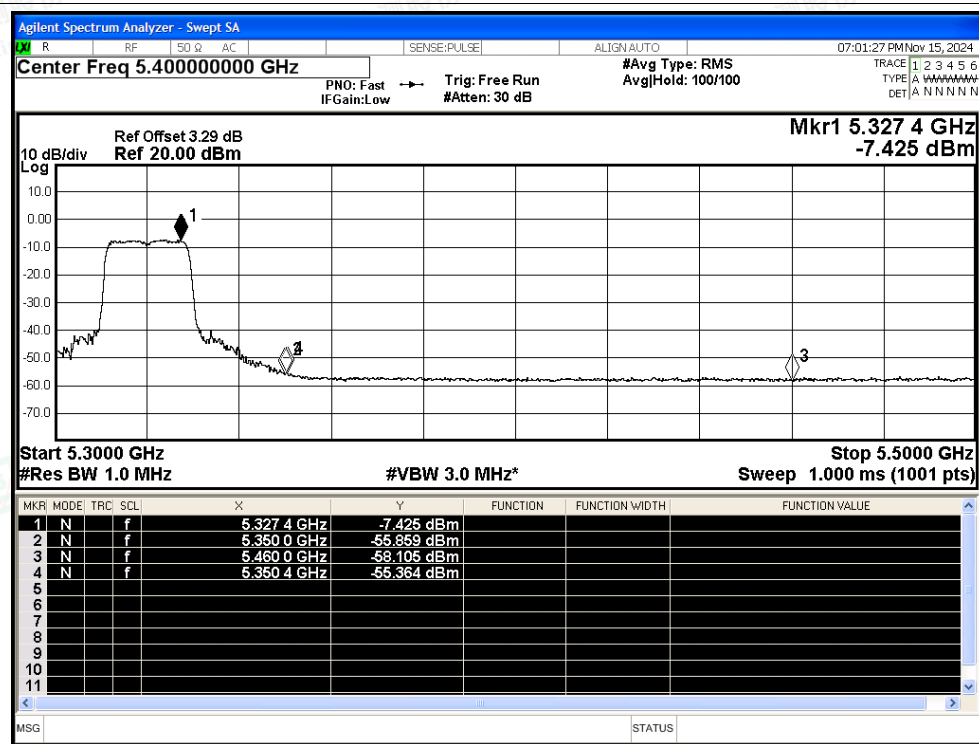

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5270MHz Ant4 Peak

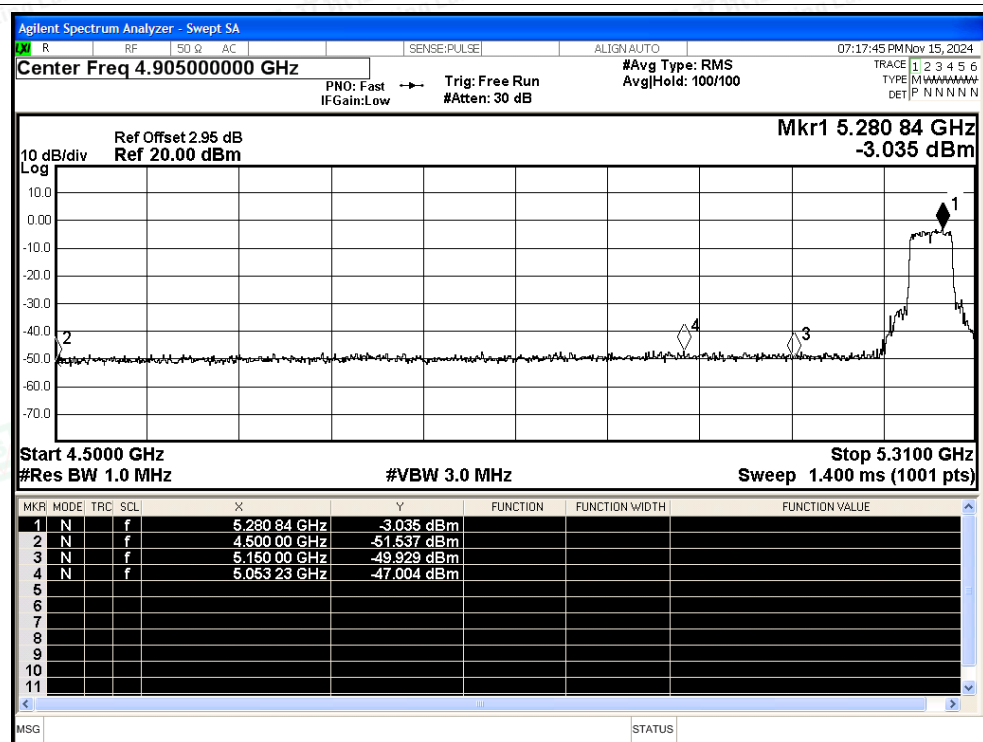


## Restrict Band NVNT n40 5270MHz Ant4 Average

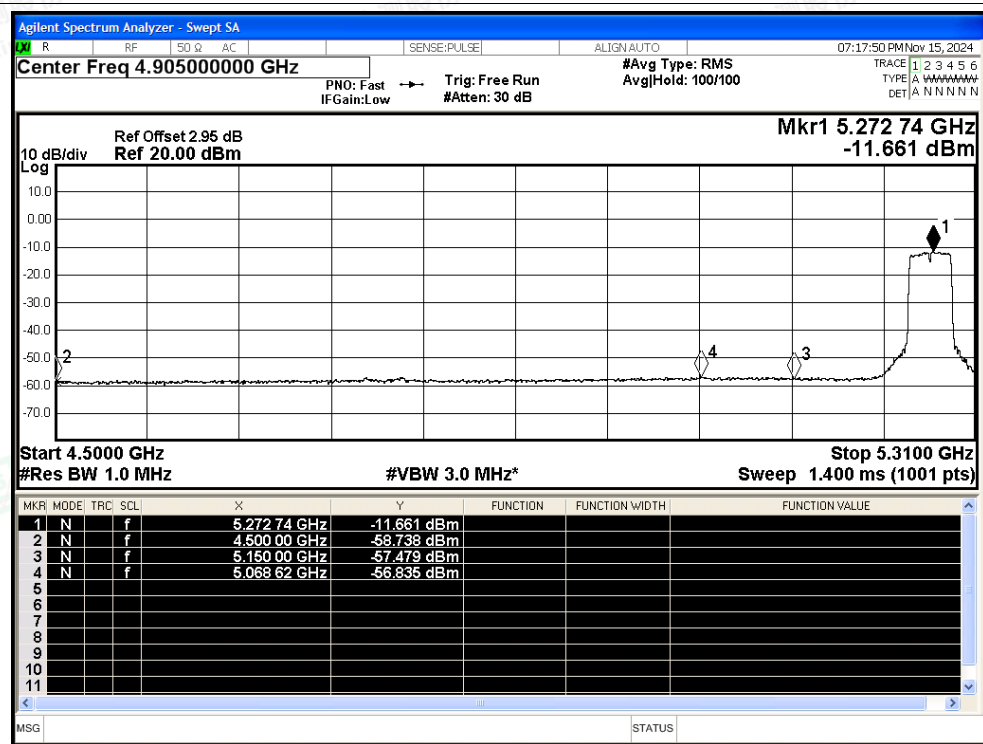






## Restrict Band NVNT n40 5310MHz Ant4 Peak

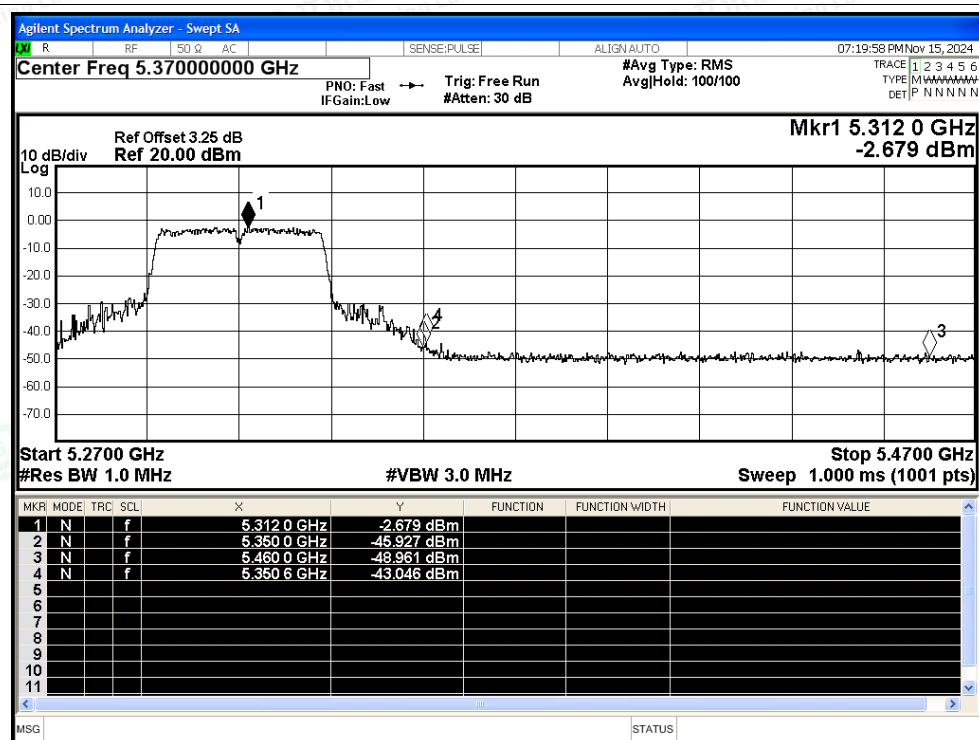

## Restrict Band NVNT n40 5310MHz Ant4 Average

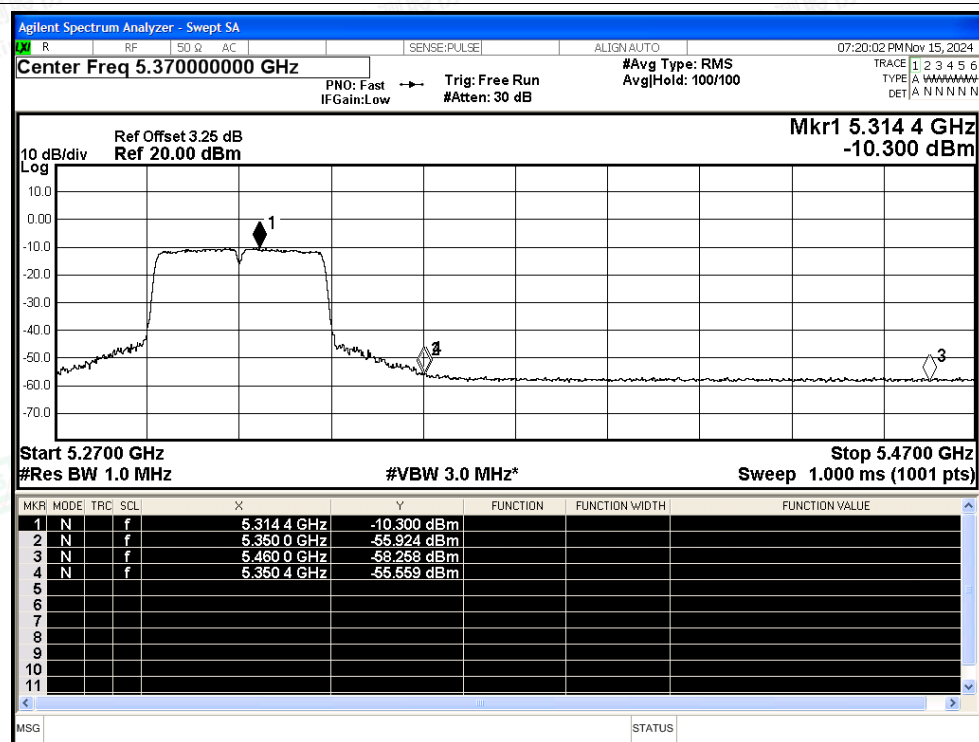

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5260MHz Ant4 Peak

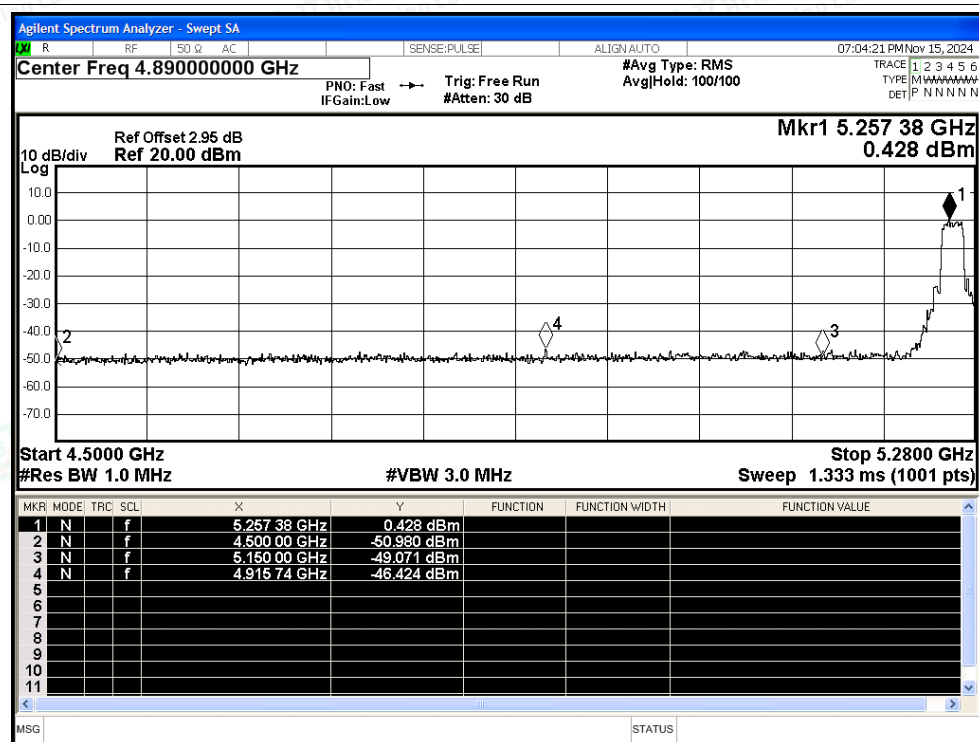

## Restrict Band NVNT ac20 5260MHz Ant4 Average

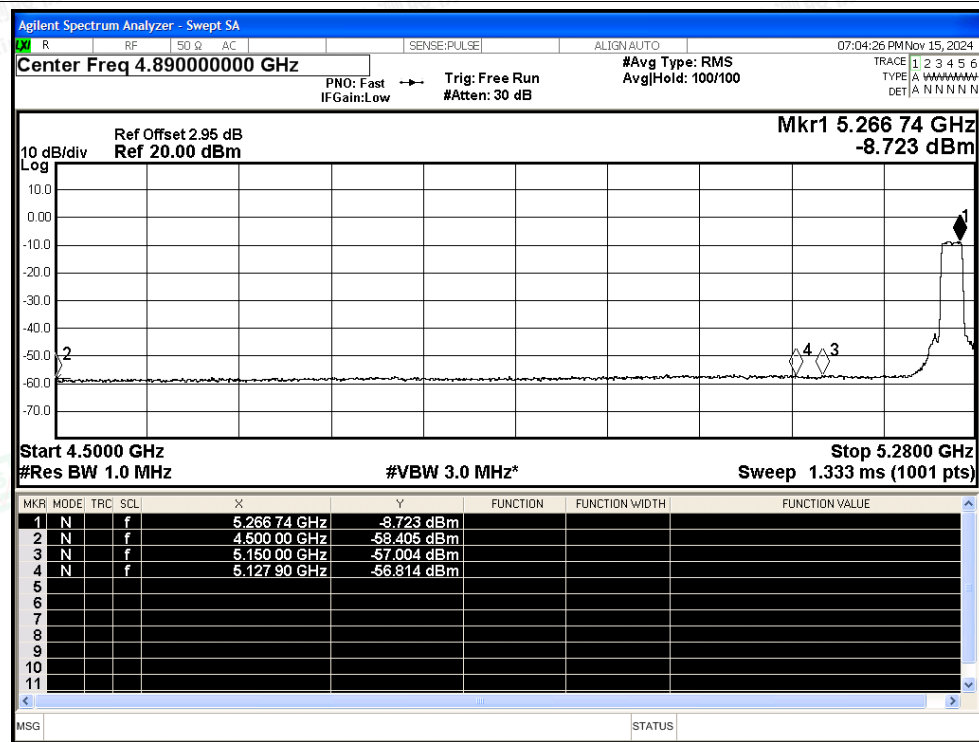

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5320MHz Ant4 Peak

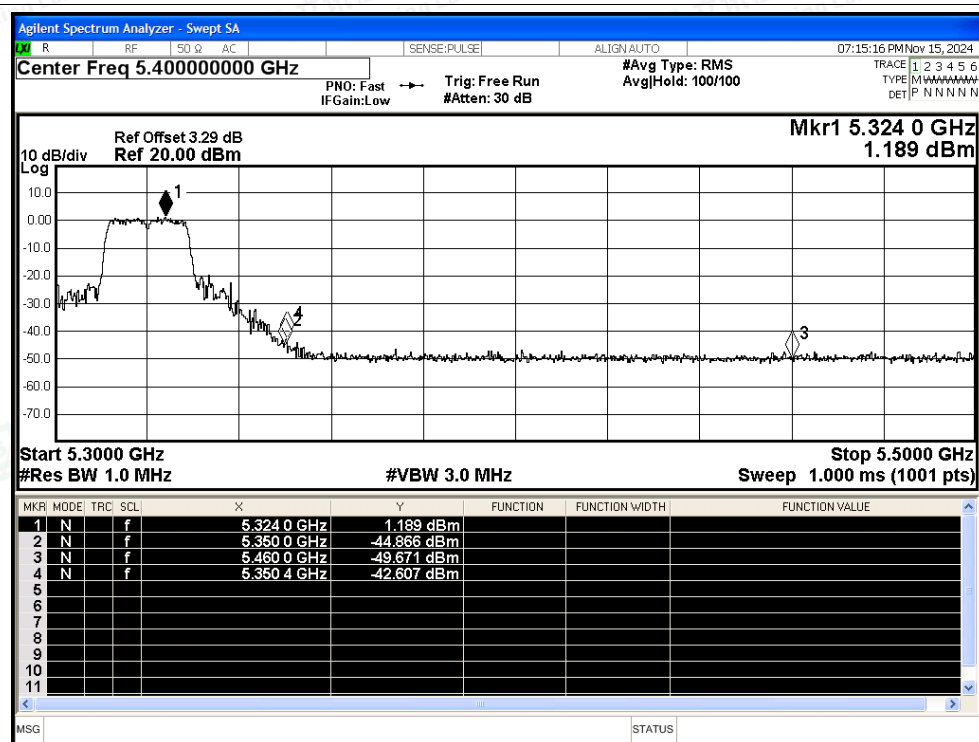


## Restrict Band NVNT ac20 5320MHz Ant4 Average

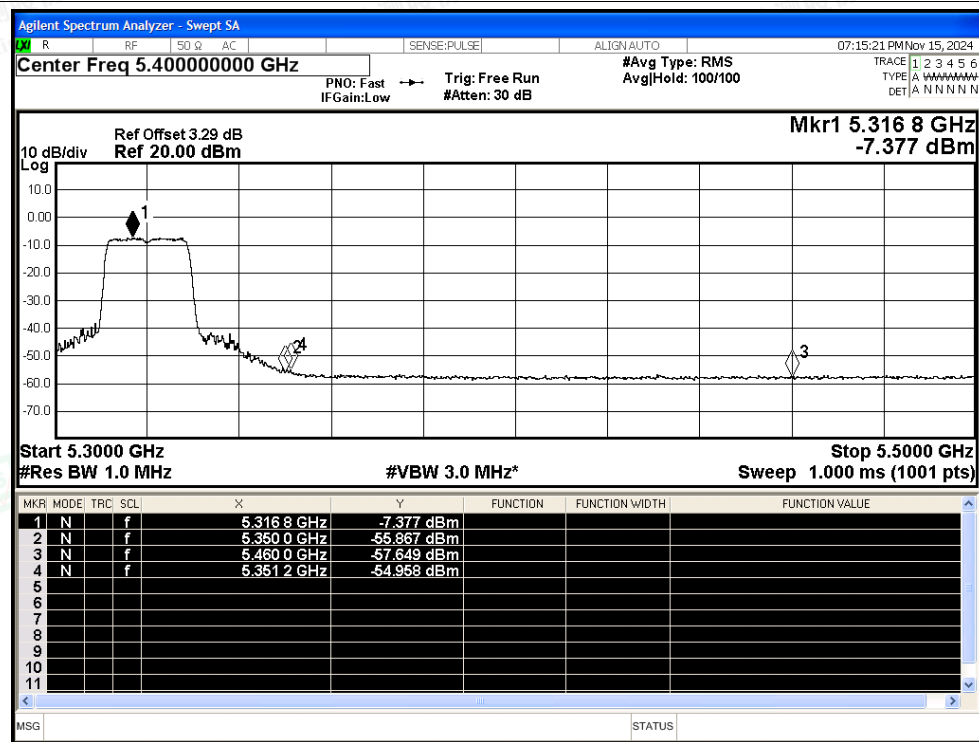




## Restrict Band NVNT ac40 5270MHz Ant4 Peak

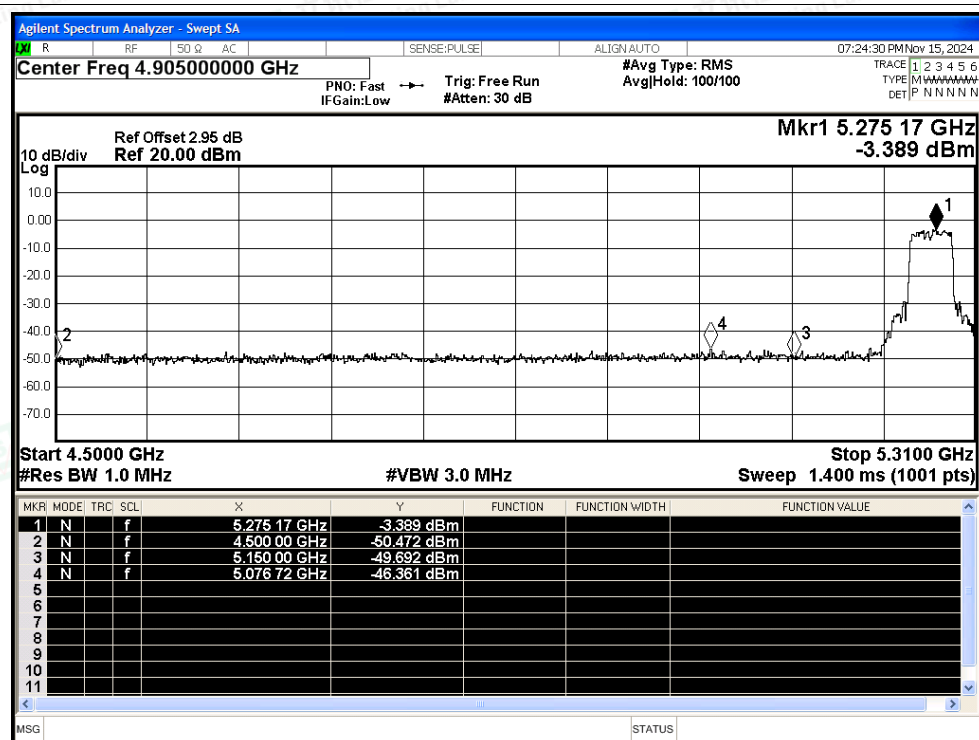

## Restrict Band NVNT ac40 5270MHz Ant4 Average

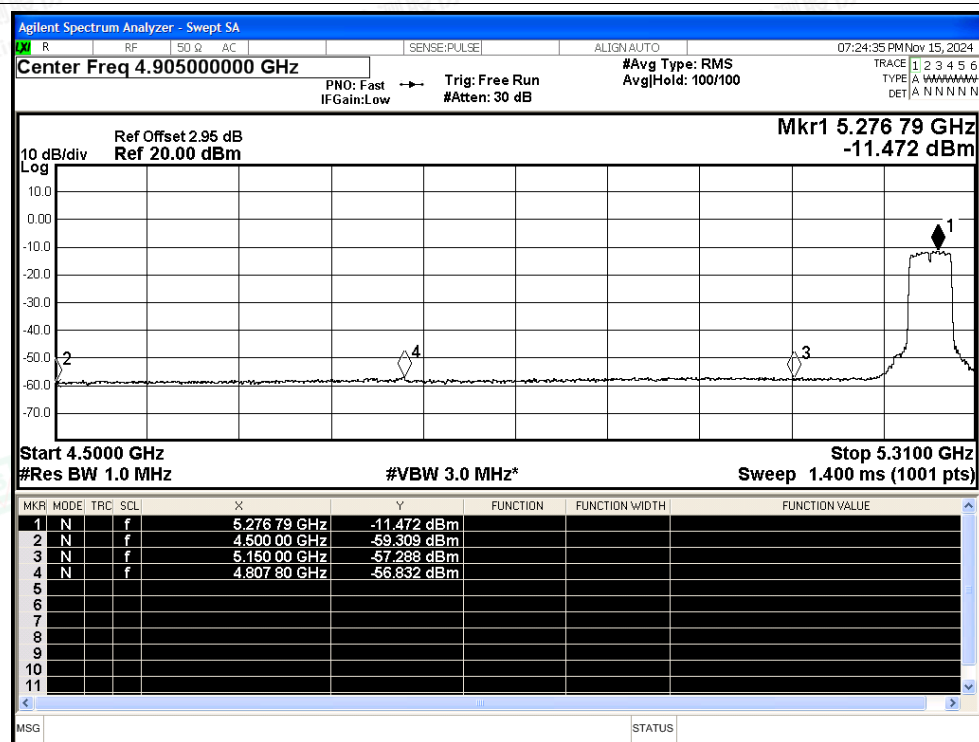

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5310MHz Ant4 Peak

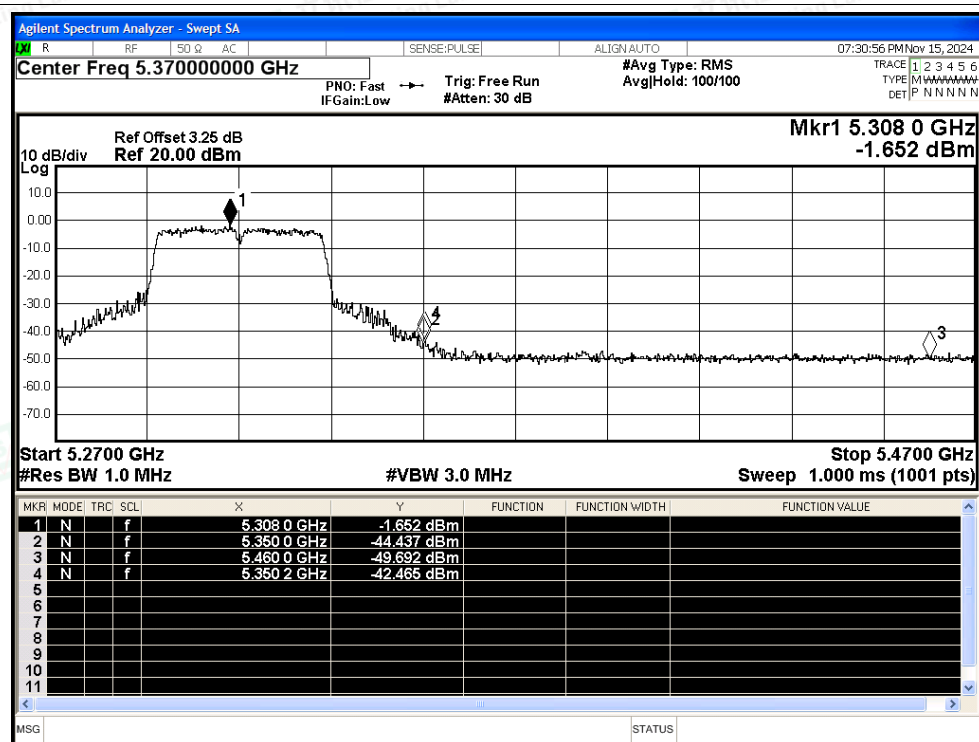

## Restrict Band NVNT ac40 5310MHz Ant4 Average

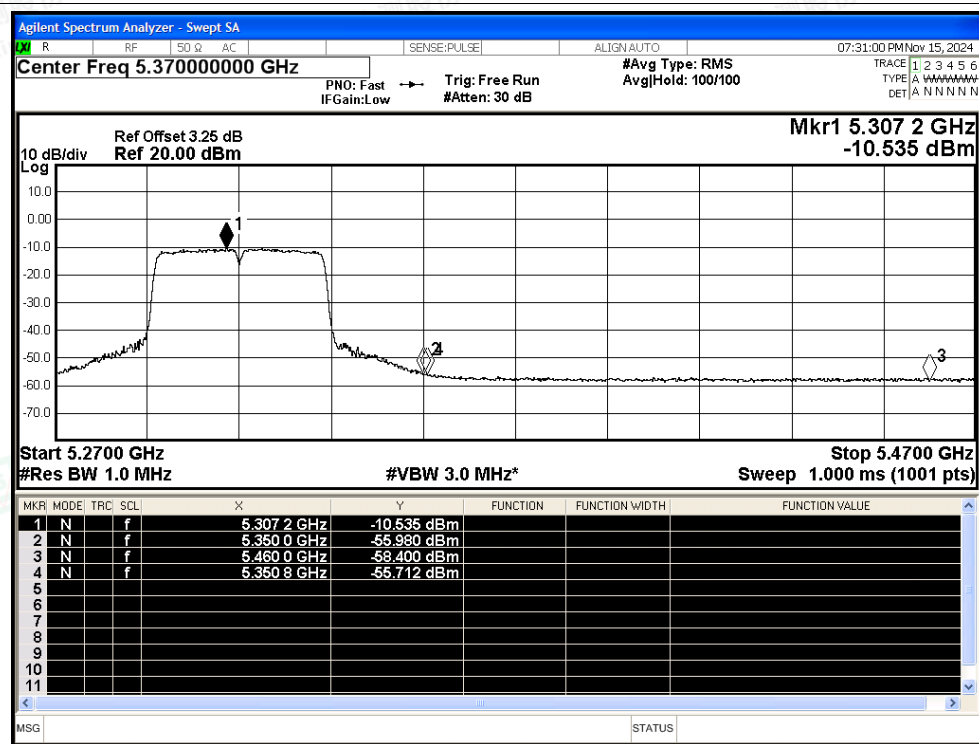

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5290MHz Ant4 Peak

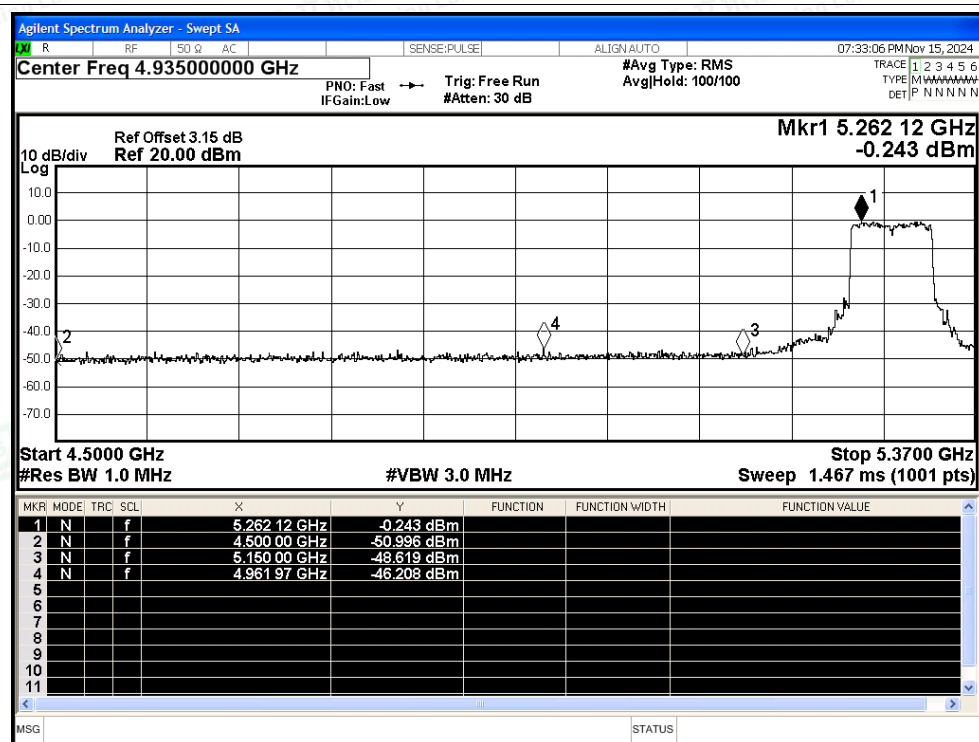

## Restrict Band NVNT ac80 5290MHz Ant4 Average

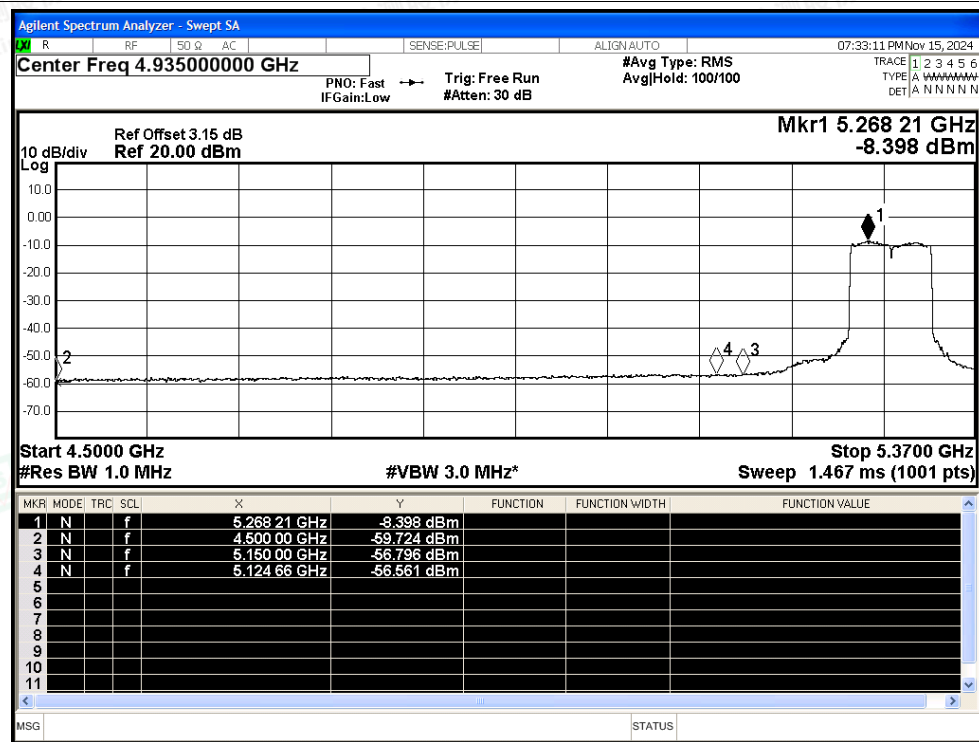

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT ac80 5290MHz Ant4 Peak

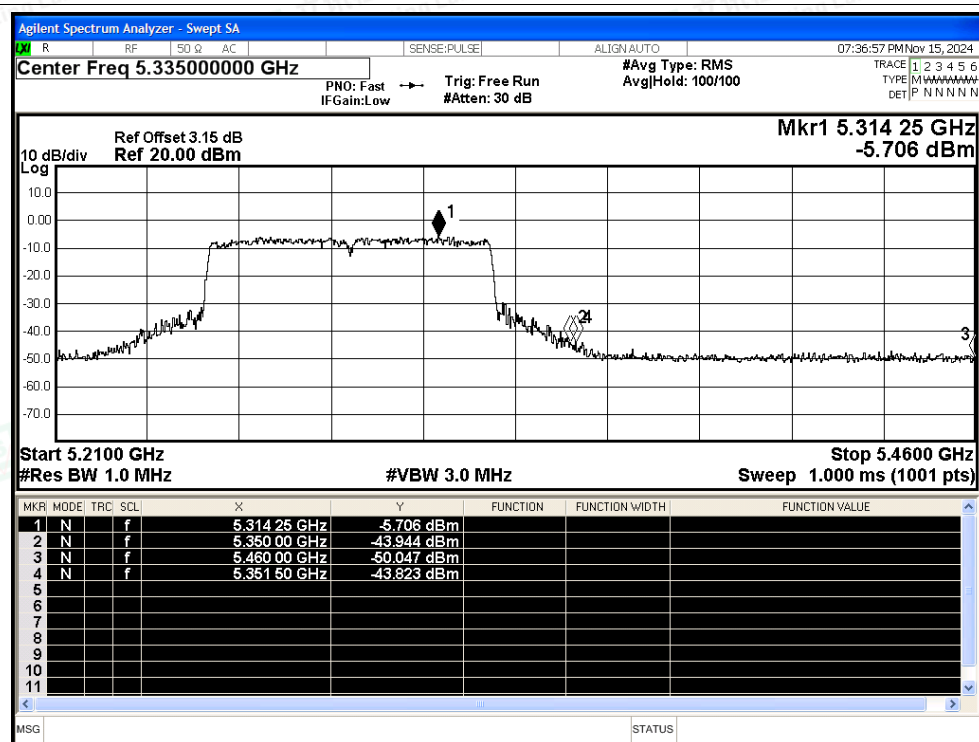

## Restrict Band NVNT ac80 5290MHz Ant4 Average

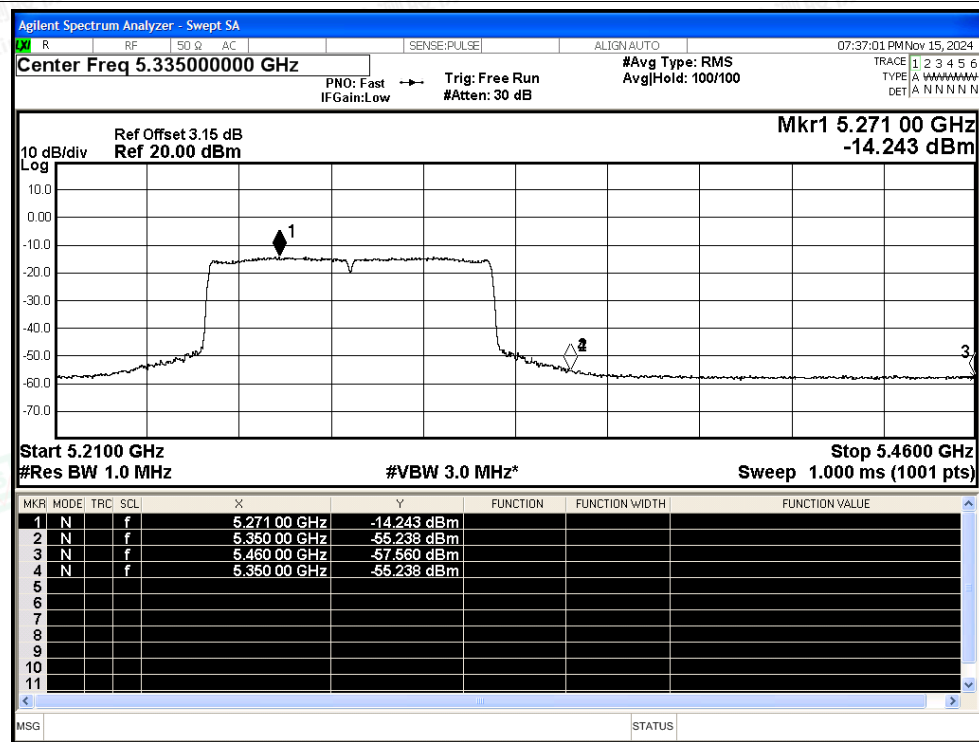

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax20 5260MHz Ant4 Peak

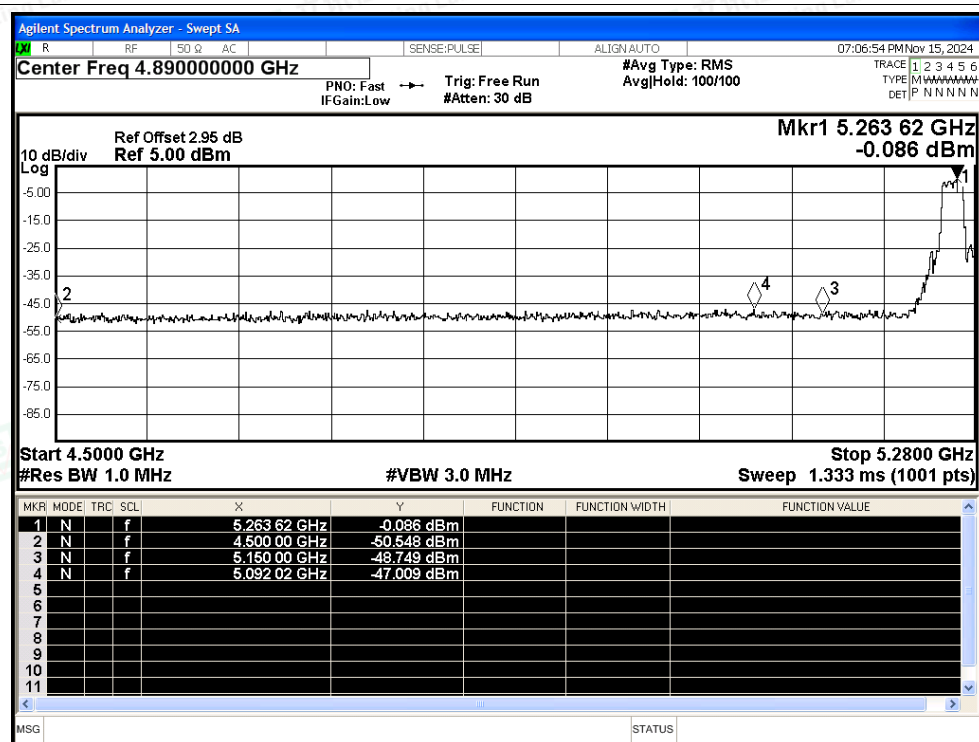

## Restrict Band NVNT ax20 5260MHz Ant4 Average

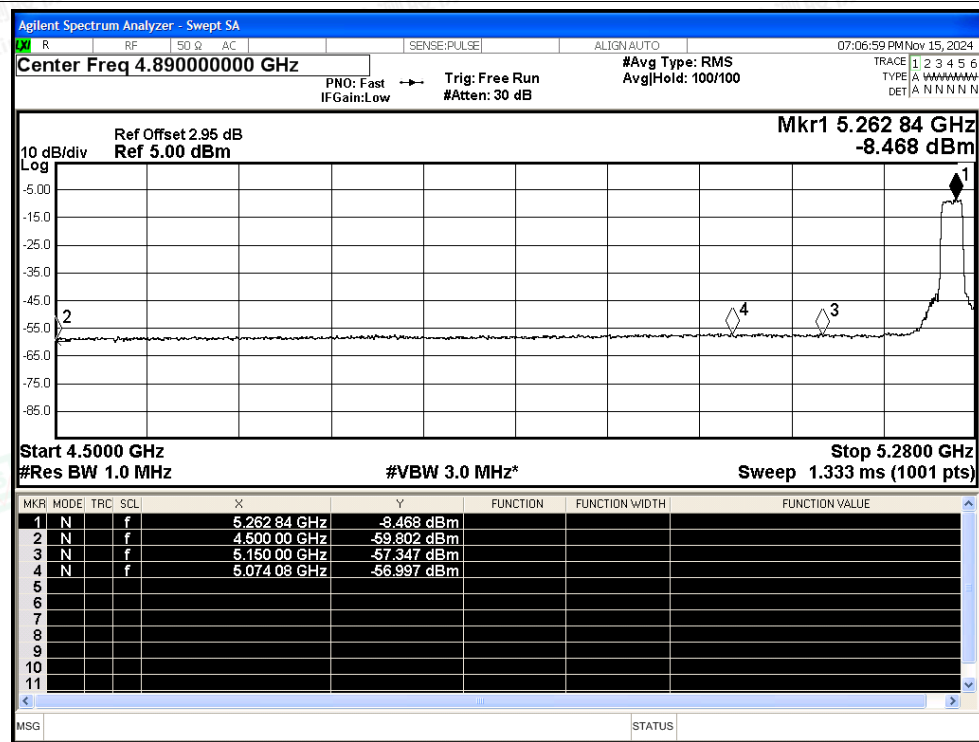

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax20 5320MHz Ant4 Peak

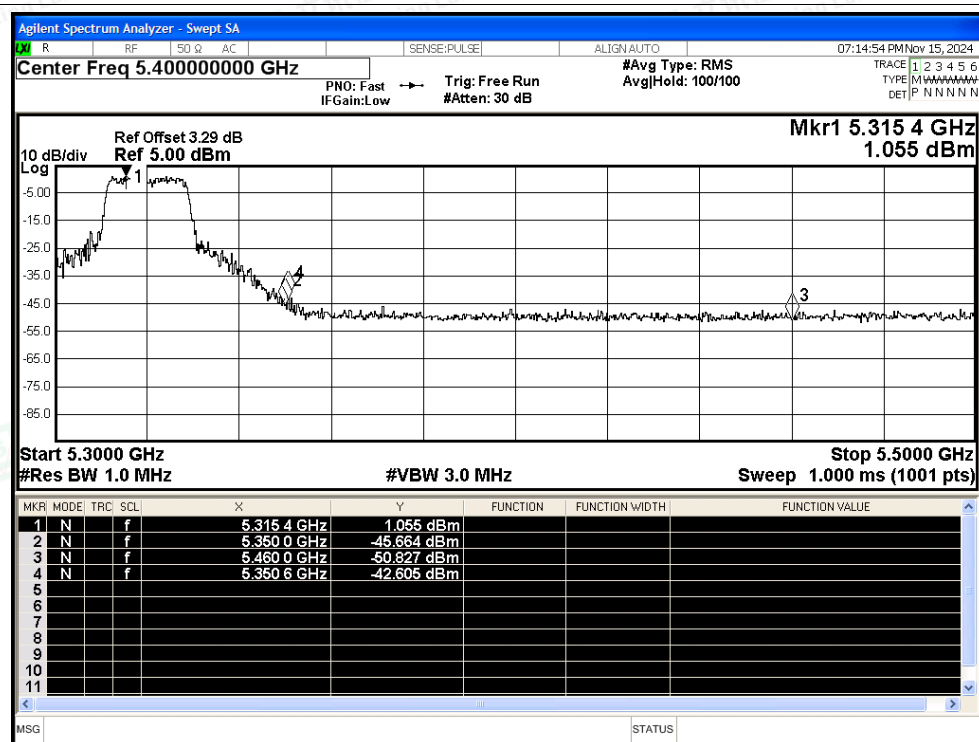

## Restrict Band NVNT ax20 5320MHz Ant4 Average

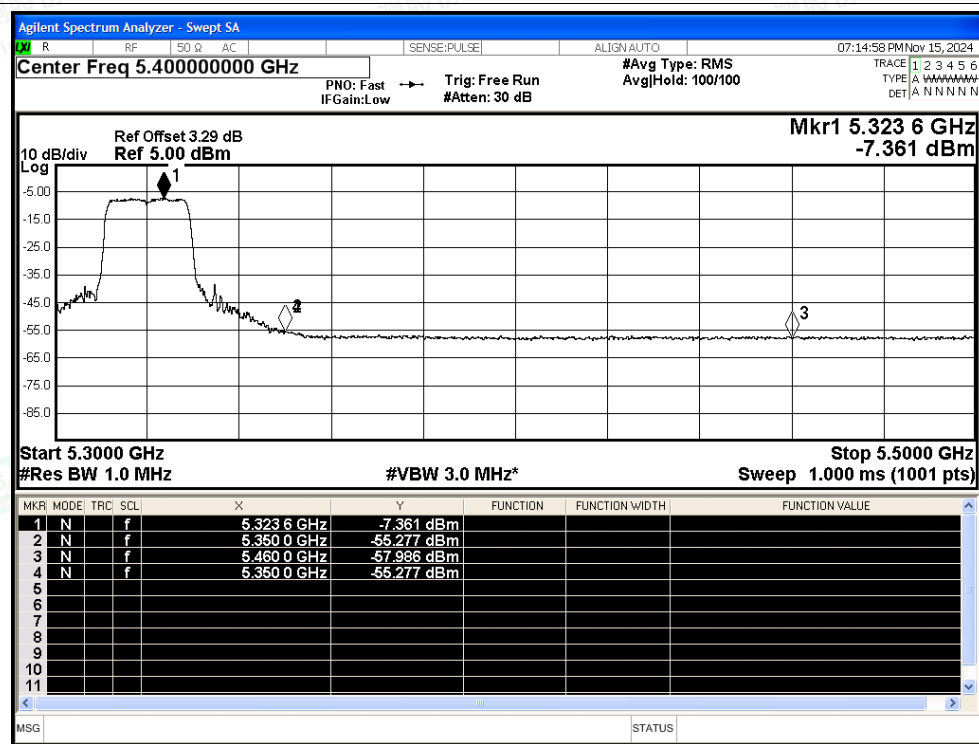

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5270MHz Ant4 Peak

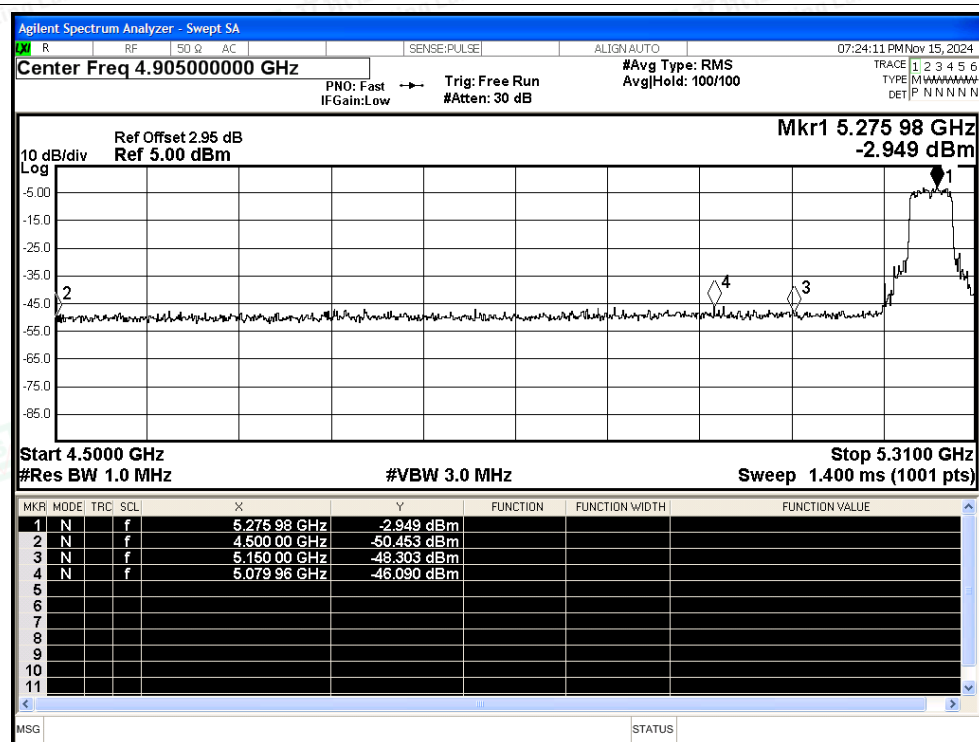

## Restrict Band NVNT ax40 5270MHz Ant4 Average

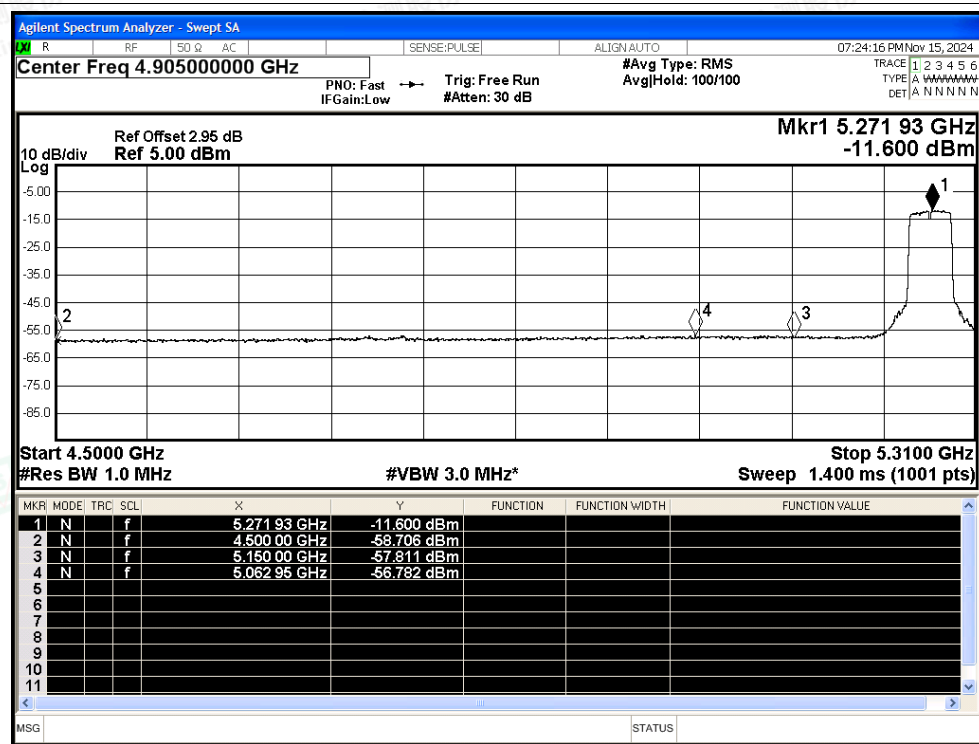

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5310MHz Ant4 Peak

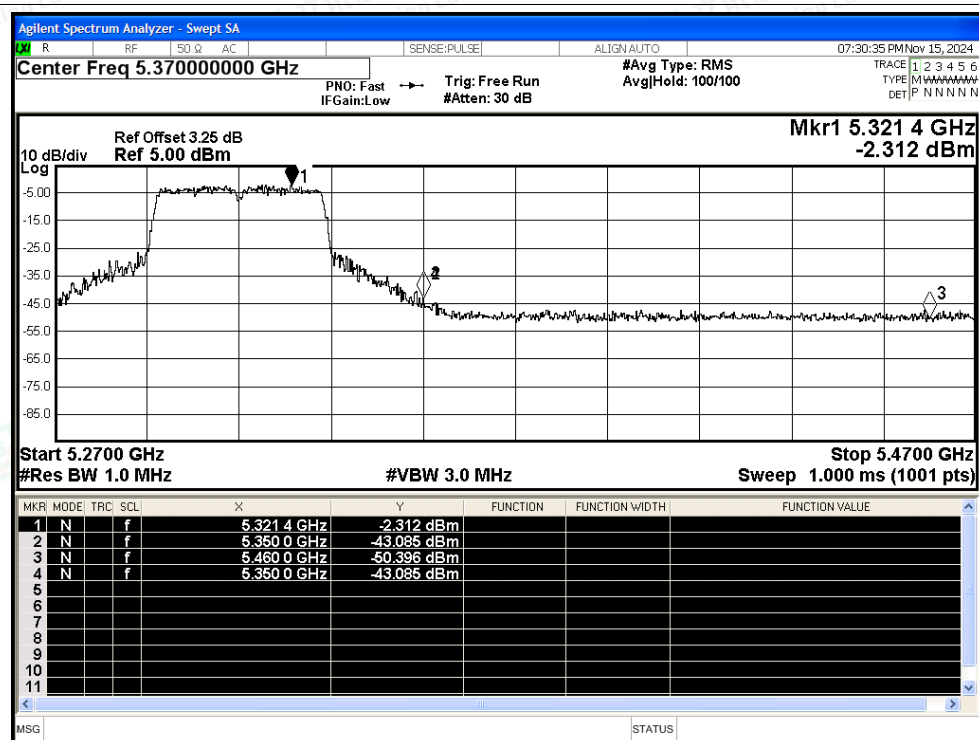

## Restrict Band NVNT ax40 5310MHz Ant4 Average

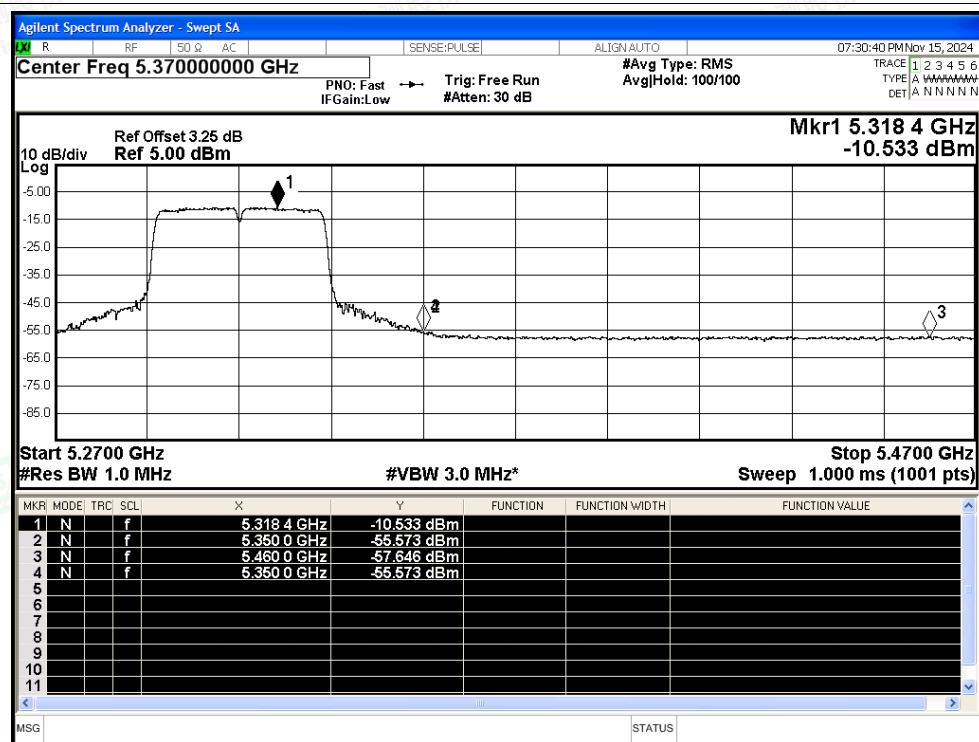

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5290MHz Ant4 Peak

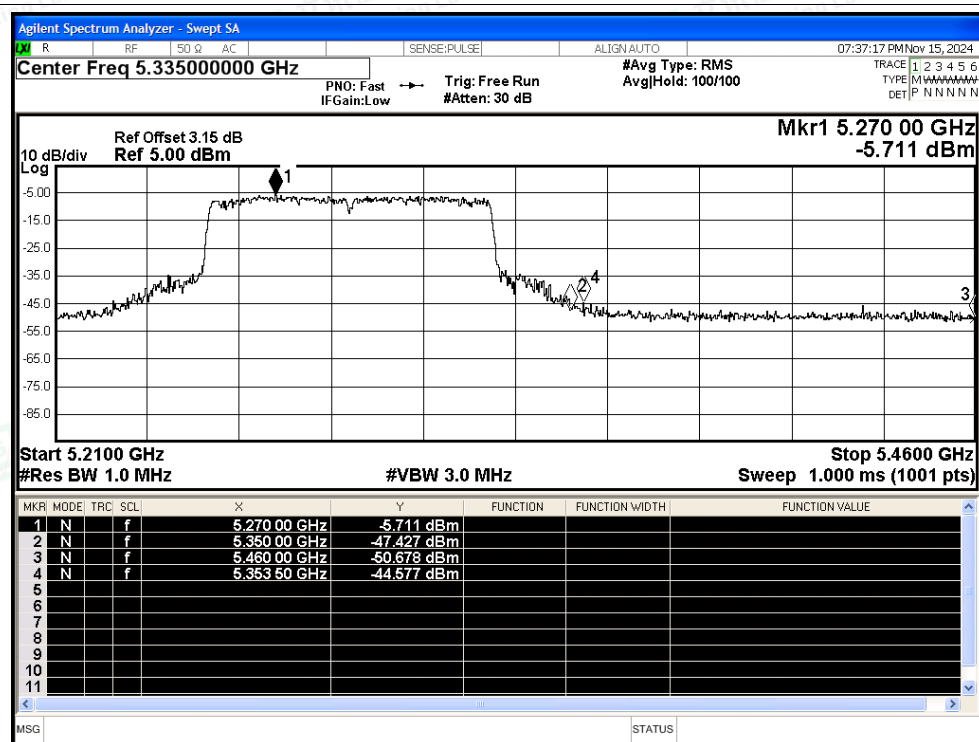

## Restrict Band NVNT ax80 5290MHz Ant4 Average

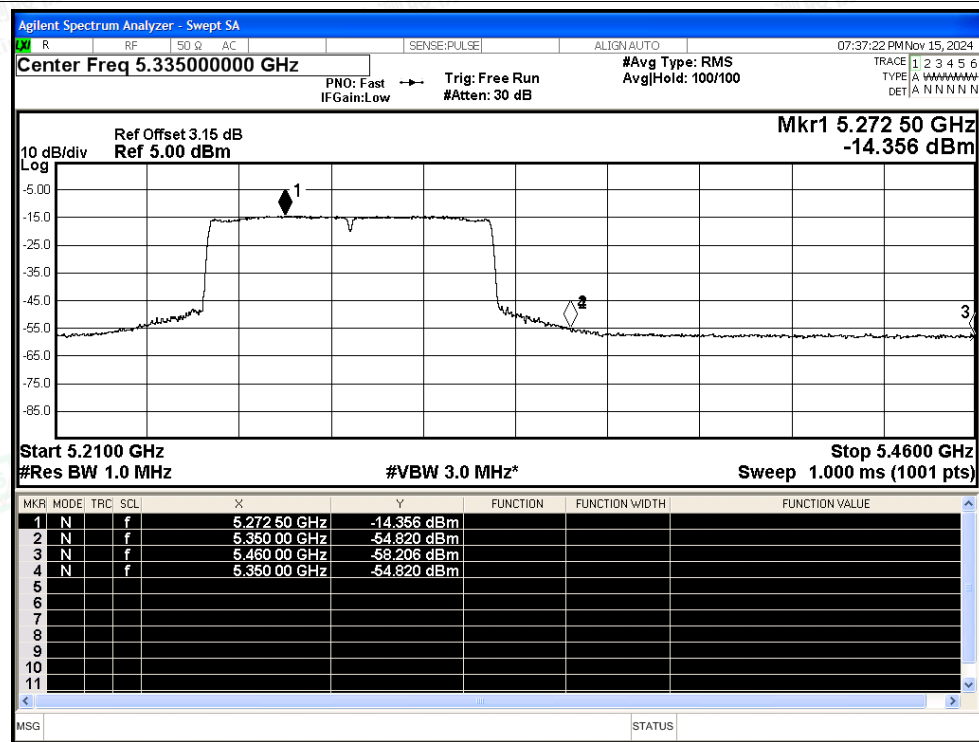

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5290MHz Ant4 Peak

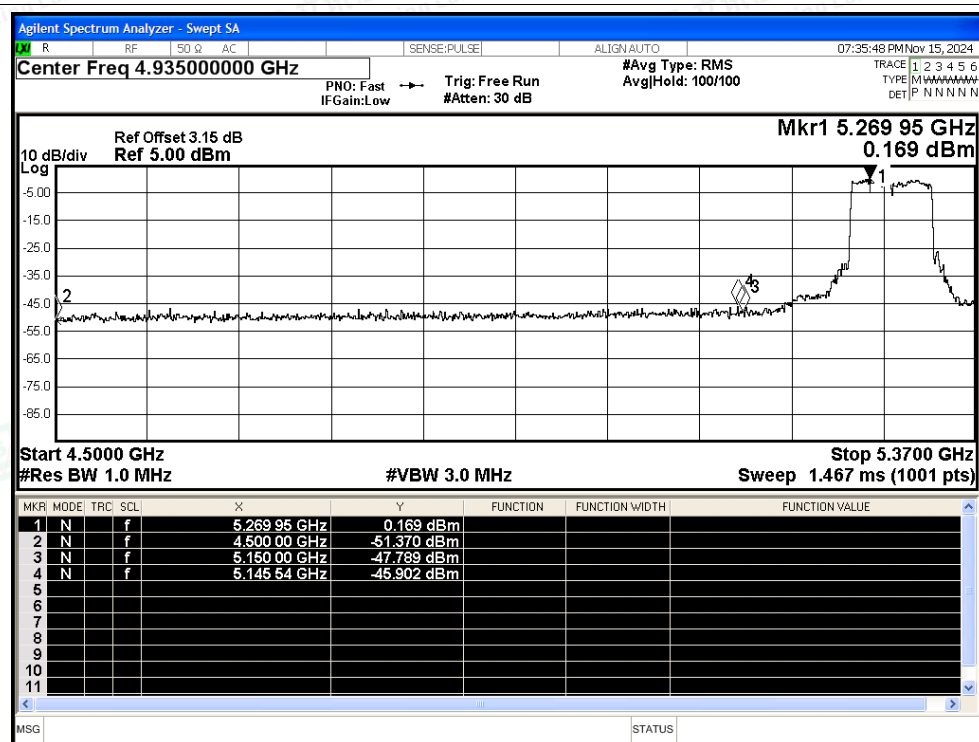

## Restrict Band NVNT ax80 5290MHz Ant4 Average

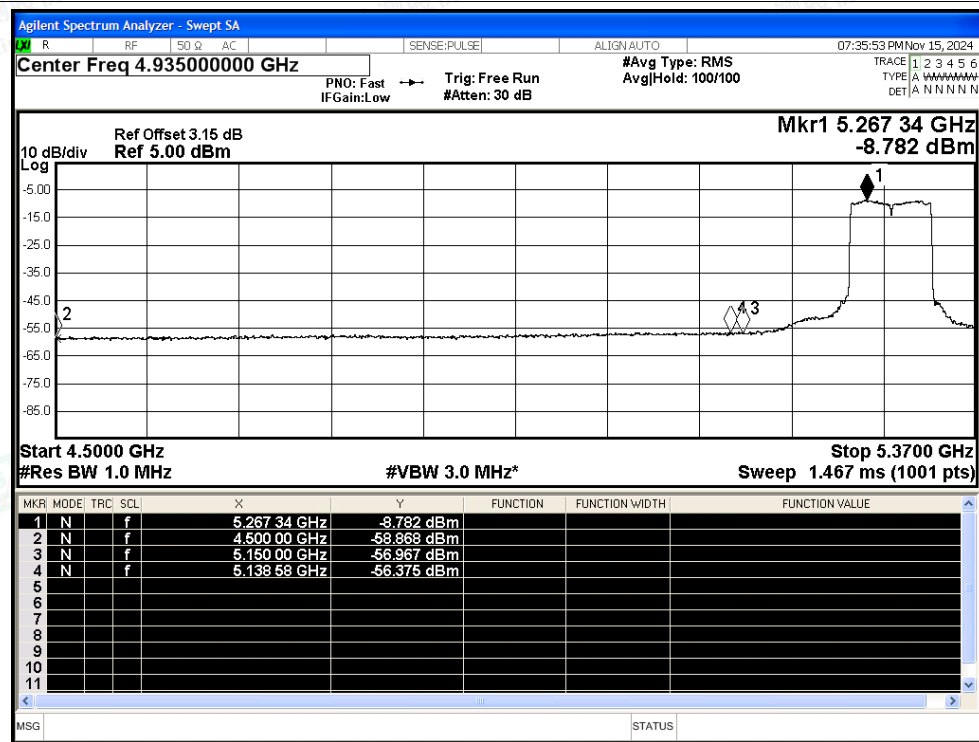

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT ac160 5250MHz Ant4 Peak

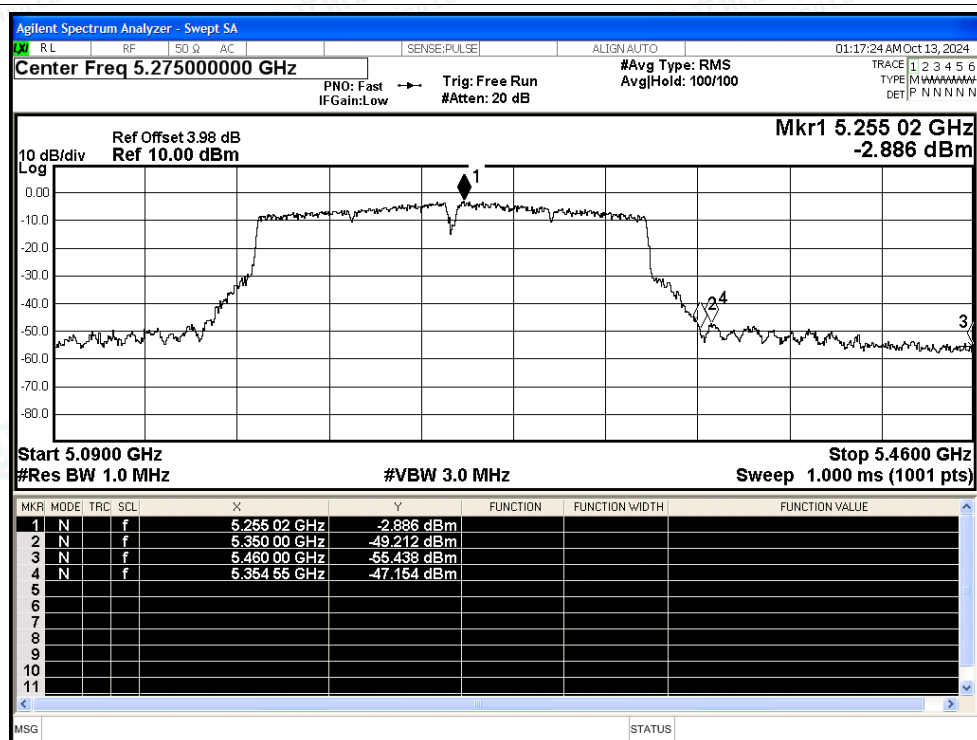

## Restrict Band NVNT ac160 5250MHz Ant4 Average

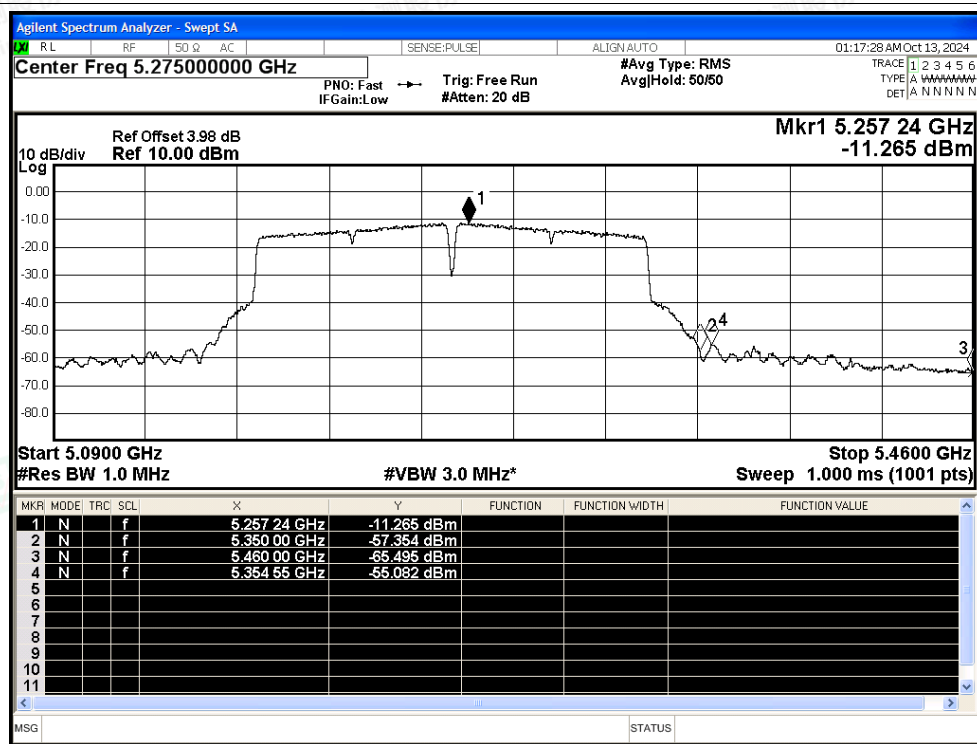

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac160 5250MHz Ant4 Peak

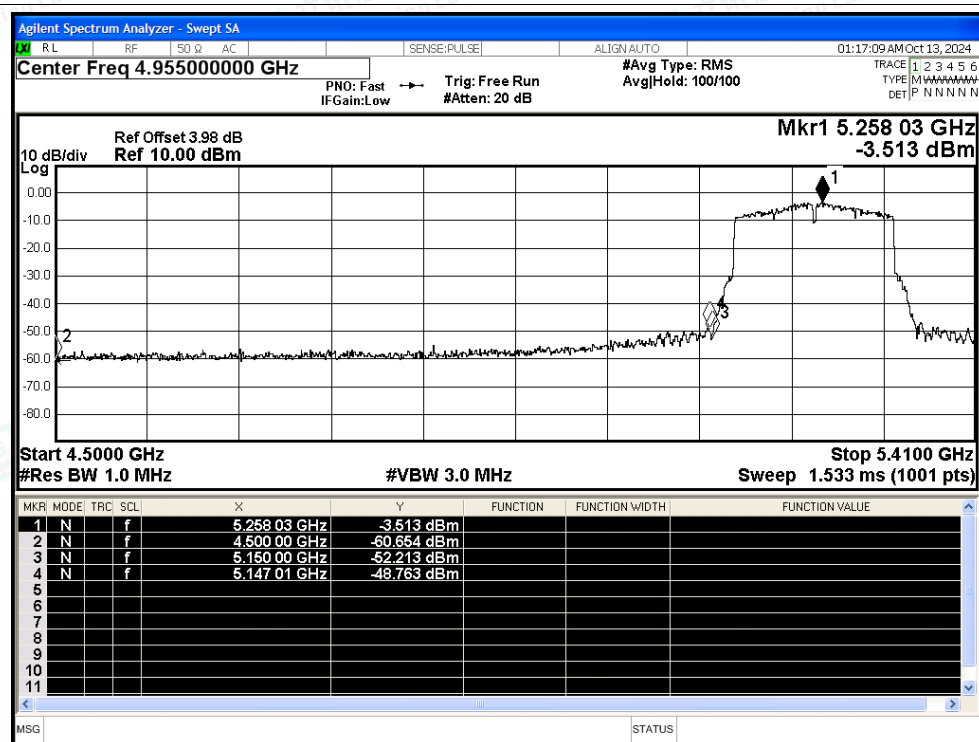


## Restrict Band NVNT ac160 5250MHz Ant4 Average

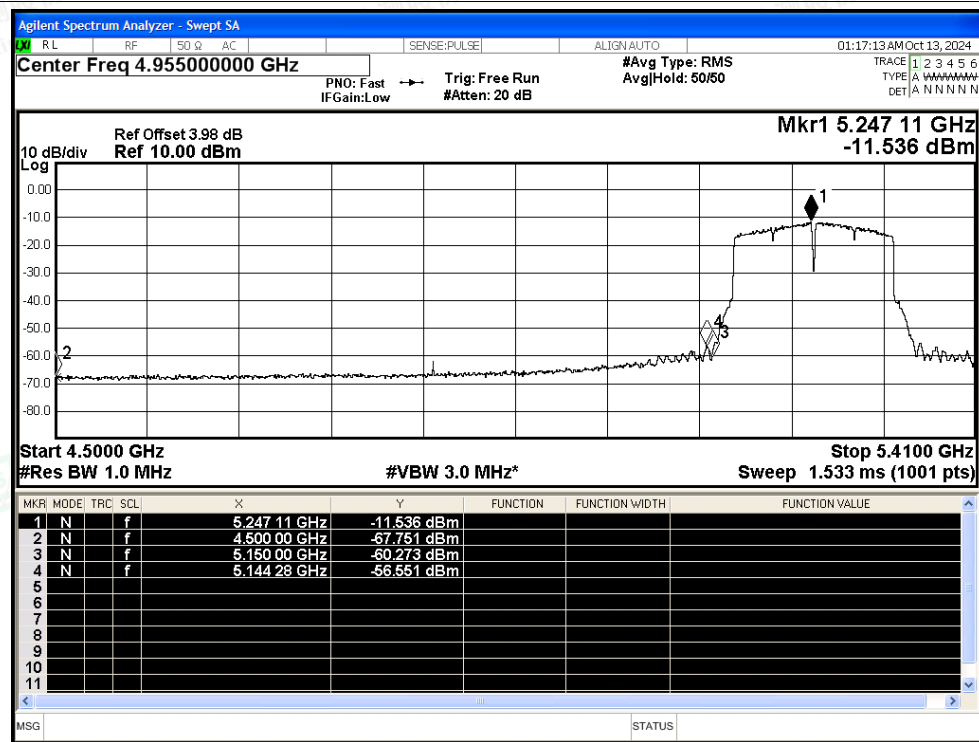




## Restrict Band NVNT ax160 5250MHz Ant4 Peak

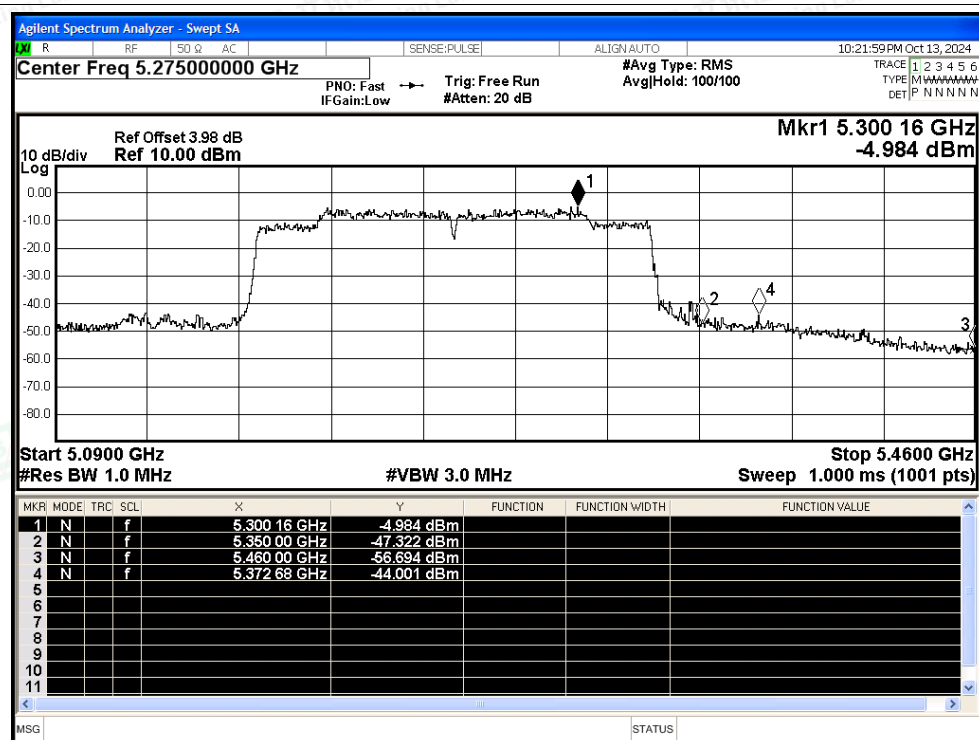

## Restrict Band NVNT ax160 5250MHz Ant4 Average

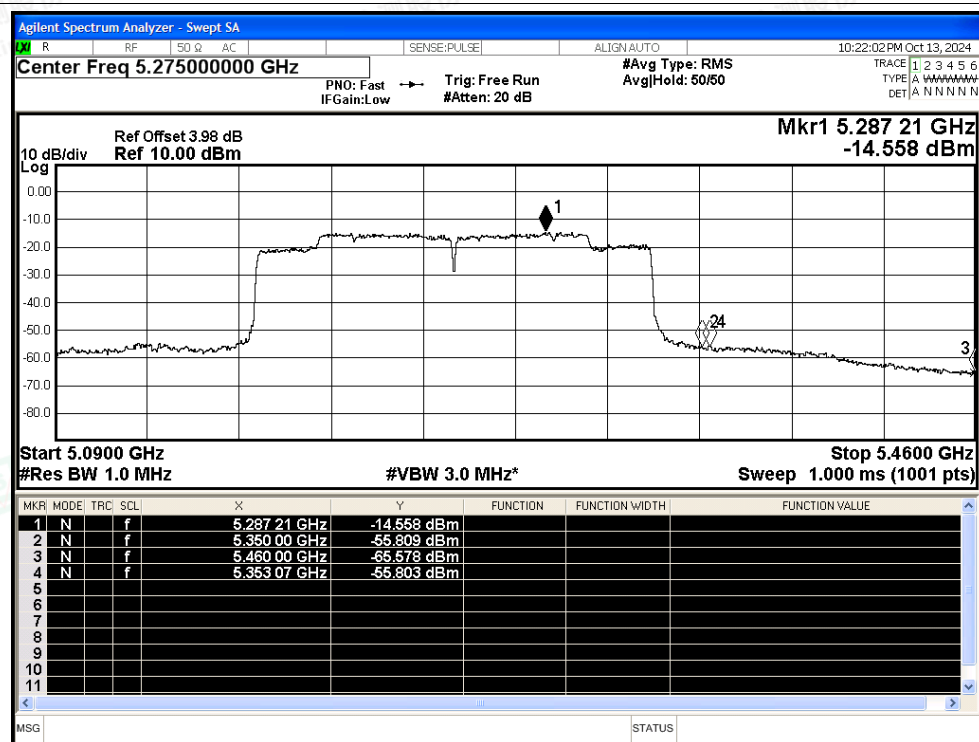

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax160 5250MHz Ant4 Peak

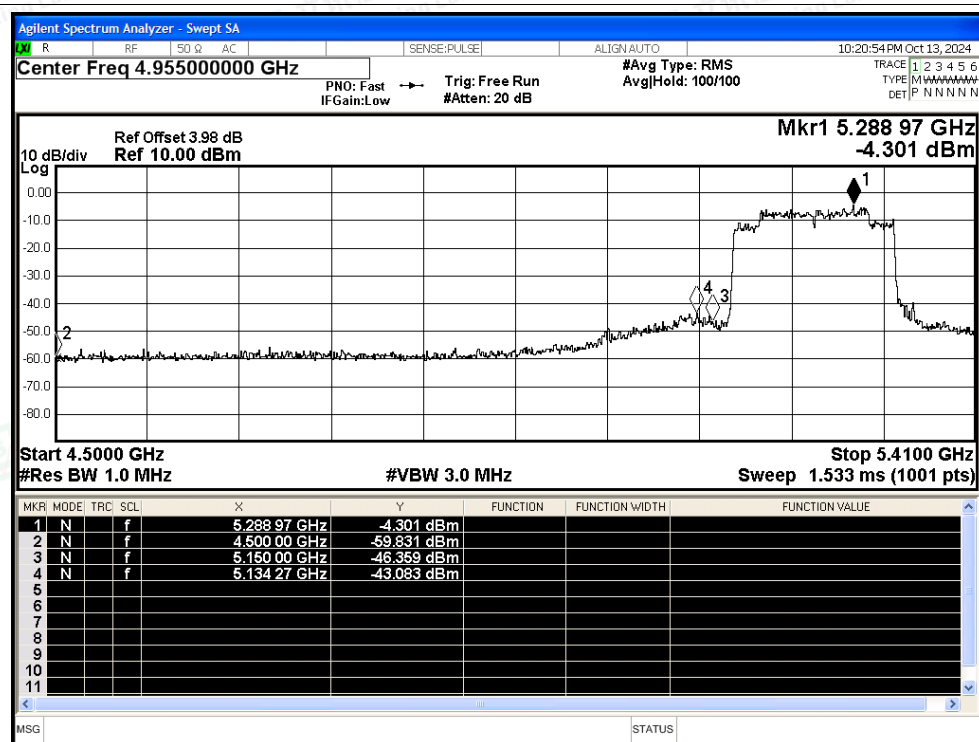

## Restrict Band NVNT ax160 5250MHz Ant4 Average

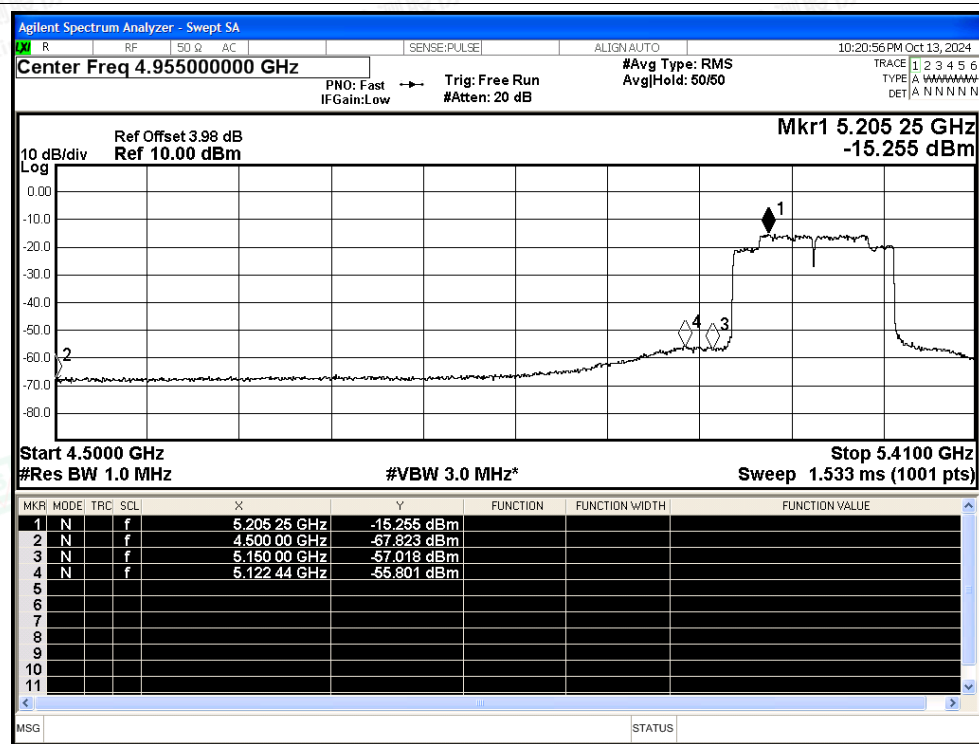



MIMO

| Condition | Mode | Frequency<br>(MHz) | Spur<br>Freq<br>(MHz) | Ant3<br>Power<br>(dBm) | Ant4<br>Power<br>(dBm) | Gain<br>(dBi) | E<br>(dBuV/m) | Detector | Limit<br>(dBuV/m) | Verdict |
|-----------|------|--------------------|-----------------------|------------------------|------------------------|---------------|---------------|----------|-------------------|---------|
| NVNT      | n20  | 5260               | 4500                  | -51.38                 | -50.63                 | 8.23          | 55.48         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5260               | 4500                  | -58.94                 | -59.09                 | 8.23          | 47.45         | Average  | 54                | Pass    |
| NVNT      | n20  | 5260               | 4804.98               | -46.91                 | -45.84                 | 8.23          | 60.13         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5260               | 5142.72               | -56.91                 | -55.88                 | 8.23          | 50.10         | Average  | 54                | Pass    |
| NVNT      | n20  | 5260               | 5150                  | -49.59                 | -47.56                 | 8.23          | 58.01         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5260               | 5150                  | -57.55                 | -56.83                 | 8.23          | 49.29         | Average  | 54                | Pass    |
| NVNT      | n20  | 5320               | 5350                  | -43.21                 | -44.9                  | 8.23          | 62.49         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5320               | 5350                  | -54.33                 | -55.86                 | 8.23          | 51.44         | Average  | 54                | Pass    |
| NVNT      | n20  | 5320               | 5352.2                | -40.32                 | -41.13                 | 8.23          | 65.76         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5320               | 5350.6                | -54.13                 | -55.36                 | 8.23          | 51.77         | Average  | 54                | Pass    |
| NVNT      | n20  | 5320               | 5460                  | -50.99                 | -49.47                 | 8.23          | 56.30         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5320               | 5460                  | -57.43                 | -58.11                 | 8.23          | 48.71         | Average  | 54                | Pass    |
| NVNT      | n40  | 5270               | 4500                  | -51.22                 | -51.54                 | 8.23          | 55.09         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5270               | 4500                  | -58.72                 | -58.74                 | 8.23          | 47.74         | Average  | 54                | Pass    |
| NVNT      | n40  | 5270               | 5092.92               | -46.4                  | -47                    | 8.23          | 59.78         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5270               | 5059.71               | -56.73                 | -56.84                 | 8.23          | 49.68         | Average  | 54                | Pass    |
| NVNT      | n40  | 5270               | 5150                  | -50.33                 | -49.93                 | 8.23          | 56.34         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5270               | 5150                  | -57.74                 | -57.48                 | 8.23          | 48.86         | Average  | 54                | Pass    |
| NVNT      | n40  | 5310               | 5350                  | -45.07                 | -45.93                 | 8.23          | 60.99         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5310               | 5350                  | -55.85                 | -55.92                 | 8.23          | 50.58         | Average  | 54                | Pass    |
| NVNT      | n40  | 5310               | 5355.2                | -43.61                 | -43.05                 | 8.23          | 63.15         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5310               | 5351                  | -55.66                 | -55.56                 | 8.23          | 50.86         | Average  | 54                | Pass    |
| NVNT      | n40  | 5310               | 5460                  | -49.49                 | -48.96                 | 8.23          | 57.25         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5310               | 5460                  | -57.66                 | -58.26                 | 8.23          | 48.52         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5260               | 4500                  | -51.64                 | -50.98                 | 8.23          | 55.17         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5260               | 4500                  | -59.25                 | -58.41                 | 8.23          | 47.66         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5260               | 4993.74               | -47.17                 | -46.42                 | 8.23          | 59.69         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5260               | 5067.06               | -56.74                 | -56.81                 | 8.23          | 49.69         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5260               | 5150                  | -50.68                 | -49.07                 | 8.23          | 56.67         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5260               | 5150                  | -57.11                 | -57                    | 8.23          | 49.41         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5320               | 5350                  | -44.2                  | -44.87                 | 8.23          | 61.95         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5320               | 5350                  | -55.43                 | -55.87                 | 8.23          | 50.82         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5320               | 5350.4                | -40.84                 | -42.61                 | 8.23          | 64.83         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5320               | 5351                  | -55.18                 | -54.96                 | 8.23          | 51.40         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5320               | 5460                  | -50.44                 | -49.67                 | 8.23          | 56.43         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5320               | 5460                  | -57.61                 | -57.65                 | 8.23          | 48.84         | Average  | 54                | Pass    |
| NVNT      | ac40 | 5270               | 4500                  | -50.17                 | -50.47                 | 8.23          | 56.15         | Peak     | 68.2              | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |         |        |        |      |       |         |      |      |
|------|------|------|---------|--------|--------|------|-------|---------|------|------|
| NVNT | ac40 | 5270 | 4500    | -59.56 | -59.31 | 8.23 | 47.03 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | 4971.42 | -46.09 | -46.36 | 8.23 | 60.24 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | 4807.8  | -56.75 | -56.83 | 8.23 | 49.68 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | 5150    | -49.36 | -49.69 | 8.23 | 56.95 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | 5150    | -57.55 | -57.29 | 8.23 | 49.05 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | 5350    | -42.14 | -44.44 | 8.23 | 63.33 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | 5350    | -54.83 | -55.98 | 8.23 | 51.10 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | 5352.4  | -41.58 | -42.47 | 8.23 | 64.47 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | 5350.2  | -54.29 | -55.71 | 8.23 | 51.53 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | 5460    | -49.27 | -49.69 | 8.23 | 56.99 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | 5460    | -57.72 | -58.4  | 8.23 | 48.42 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 4500    | -50.31 | -51    | 8.23 | 55.83 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 4500    | -58.73 | -59.72 | 8.23 | 47.27 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5120.31 | -45.59 | -46.21 | 8.23 | 60.58 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5138.58 | -56.21 | -56.56 | 8.23 | 50.09 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5150    | -48.6  | -48.62 | 8.23 | 57.86 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5150    | -56.55 | -56.8  | 8.23 | 49.79 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5350    | -46.21 | -43.94 | 8.23 | 61.54 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5350    | -55.75 | -55.24 | 8.23 | 50.98 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5350.75 | -42.07 | -43.82 | 8.23 | 63.61 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5351    | -55.41 | -55.24 | 8.23 | 51.14 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5460    | -49.94 | -50.05 | 8.23 | 56.47 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5460    | -57.65 | -57.56 | 8.23 | 48.86 | Average | 54   | Pass |
| NVNT | ax20 | 5260 | 4500    | -50.41 | -50.55 | 8.23 | 55.99 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5260 | 4500    | -58.9  | -59.8  | 8.23 | 47.14 | Average | 54   | Pass |
| NVNT | ax20 | 5260 | 5117.76 | -45.72 | -47.01 | 8.23 | 60.15 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5260 | 5045.22 | -56.73 | -57    | 8.23 | 49.60 | Average | 54   | Pass |
| NVNT | ax20 | 5260 | 5150    | -48.52 | -48.75 | 8.23 | 57.83 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5260 | 5150    | -57.91 | -57.35 | 8.23 | 48.85 | Average | 54   | Pass |
| NVNT | ax20 | 5320 | 5350    | -41.96 | -45.66 | 8.23 | 63.04 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5320 | 5350    | -55.74 | -55.28 | 8.23 | 50.96 | Average | 54   | Pass |
| NVNT | ax20 | 5320 | 5351.2  | -55.59 | -42.61 | 8.23 | 61.06 | Peak    | 54   | Pass |
| NVNT | ax20 | 5320 | 5460    | -48.84 | -55.28 | 8.23 | 55.51 | Average | 68.2 | Pass |
| NVNT | ax20 | 5320 | 5460    | -57.68 | -50.83 | 8.23 | 53.44 | Peak    | 54   | Pass |
| NVNT | ax40 | 5270 | 4500    | -49.52 | -57.99 | 8.23 | 54.52 | Average | 68.2 | Pass |
| NVNT | ax40 | 5270 | 4500    | -59.19 | -50.45 | 8.23 | 53.55 | Peak    | 54   | Pass |
| NVNT | ax40 | 5270 | 5007.87 | -46.37 | -58.71 | 8.23 | 57.33 | Average | 68.2 | Pass |
| NVNT | ax40 | 5270 | 5018.4  | -56.8  | -46.09 | 8.23 | 57.72 | Peak    | 54   | Pass |
| NVNT | ax40 | 5270 | 5150    | -49.22 | -56.78 | 8.23 | 54.94 | Average | 68.2 | Pass |
| NVNT | ax40 | 5270 | 5150    | -57.16 | -48.3  | 8.23 | 55.69 | Peak    | 54   | Pass |
| NVNT | ax40 | 5310 | 5350    | -45.84 | -57.81 | 8.23 | 57.89 | Average | 68.2 | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity





|      |       |      |         |        |        |      |       |         |      |      |
|------|-------|------|---------|--------|--------|------|-------|---------|------|------|
| NVNT | ax40  | 5310 | 5350    | -55.5  | -43.09 | 8.23 | 60.61 | Peak    | 54   | Pass |
| NVNT | ax40  | 5310 | 5351.2  | -43.58 | -55.57 | 8.23 | 60.14 | Average | 68.2 | Pass |
| NVNT | ax40  | 5310 | 5460    | -49.47 | -50.4  | 8.23 | 56.56 | Peak    | 68.2 | Pass |
| NVNT | ax40  | 5310 | 5460    | -58.27 | -57.65 | 8.23 | 48.52 | Average | 54   | Pass |
| NVNT | ax80  | 5290 | 5350    | -44.11 | -47.43 | 8.23 | 61.01 | Peak    | 68.2 | Pass |
| NVNT | ax80  | 5290 | 5350    | -55.64 | -54.82 | 8.23 | 51.26 | Average | 54   | Pass |
| NVNT | ax80  | 5290 | 5352    | -43.34 | -44.58 | 8.23 | 62.55 | Peak    | 68.2 | Pass |
| NVNT | ax80  | 5290 | 5351.5  | -55.48 | -54.82 | 8.23 | 51.33 | Average | 54   | Pass |
| NVNT | ax80  | 5290 | 5460    | -51.14 | -50.68 | 8.23 | 55.56 | Peak    | 68.2 | Pass |
| NVNT | ax80  | 5290 | 5460    | -57.78 | -58.21 | 8.23 | 48.48 | Average | 54   | Pass |
| NVNT | ax80  | 5290 | 4500    | -50.74 | -51.37 | 8.23 | 55.42 | Peak    | 68.2 | Pass |
| NVNT | ax80  | 5290 | 4500    | -59.11 | -58.87 | 8.23 | 47.48 | Average | 54   | Pass |
| NVNT | ax80  | 5290 | 5134.23 | -46.53 | -45.9  | 8.23 | 60.26 | Peak    | 68.2 | Pass |
| NVNT | ax80  | 5290 | 5149.02 | -56.34 | -56.38 | 8.23 | 50.11 | Average | 54   | Pass |
| NVNT | ax80  | 5290 | 5150    | -49.36 | -47.79 | 8.23 | 57.96 | Peak    | 68.2 | Pass |
| NVNT | ax80  | 5290 | 5150    | -56.45 | -56.97 | 8.23 | 49.77 | Average | 54   | Pass |
| NVNT | ac160 | 5250 | 5350    | -49.44 | -49.21 | 8.23 | 57.14 | Peak    | 68.2 | Pass |
| NVNT | ac160 | 5250 | 5350    | -56.46 | -57.35 | 8.23 | 49.59 | Average | 54   | Pass |
| NVNT | ac160 | 5250 | 5353.81 | -47.24 | -47.15 | 8.23 | 59.27 | Peak    | 68.2 | Pass |
| NVNT | ac160 | 5250 | 5355.29 | -54.87 | -55.08 | 8.23 | 51.49 | Average | 54   | Pass |
| NVNT | ac160 | 5250 | 5460    | -56.97 | -55.44 | 8.23 | 50.33 | Peak    | 68.2 | Pass |
| NVNT | ac160 | 5250 | 5460    | -63.03 | -65.5  | 8.23 | 42.38 | Average | 54   | Pass |
| NVNT | ac160 | 5250 | 4500    | -59.11 | -60.65 | 8.23 | 46.66 | Peak    | 68.2 | Pass |
| NVNT | ac160 | 5250 | 4500    | -67.45 | -67.75 | 8.23 | 38.87 | Average | 54   | Pass |
| NVNT | ac160 | 5250 | 5147.01 | -47.59 | -48.76 | 8.23 | 58.33 | Peak    | 68.2 | Pass |
| NVNT | ac160 | 5250 | 4874.01 | -53.68 | -56.55 | 8.23 | 51.59 | Average | 54   | Pass |
| NVNT | ac160 | 5250 | 5150    | -51.47 | -52.21 | 8.23 | 54.64 | Peak    | 68.2 | Pass |
| NVNT | ac160 | 5250 | 5150    | -57.83 | -60.27 | 8.23 | 47.59 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | 5350    | -50.14 | -47.32 | 8.23 | 57.96 | Peak    | 68.2 | Pass |
| NVNT | ax160 | 5250 | 5350    | -57.81 | -55.81 | 8.23 | 49.77 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | 5403.39 | -42.6  | -44    | 8.23 | 63.22 | Peak    | 68.2 | Pass |
| NVNT | ax160 | 5250 | 5381.93 | -56.76 | -55.8  | 8.23 | 50.21 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | 5460    | -54.41 | -56.69 | 8.23 | 51.07 | Peak    | 68.2 | Pass |
| NVNT | ax160 | 5250 | 5460    | -62.95 | -65.58 | 8.23 | 42.40 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | 4500    | -60.05 | -59.83 | 8.23 | 46.53 | Peak    | 68.2 | Pass |
| NVNT | ax160 | 5250 | 4500    | -68.03 | -67.82 | 8.23 | 38.54 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | 5137.91 | -44.95 | -43.08 | 8.23 | 62.55 | Peak    | 68.2 | Pass |
| NVNT | ax160 | 5250 | 5137    | -58.38 | -55.8  | 8.23 | 49.57 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | 5150    | -49.18 | -46.36 | 8.23 | 58.92 | Peak    | 68.2 | Pass |
| NVNT | ax160 | 5250 | 5150    | -59.13 | -57.02 | 8.23 | 48.52 | Average | 54   | Pass |
| NVNT | ax160 | 5250 | 5150    | -49.18 | -46.36 | 8.23 | 58.92 | Peak    | 68.2 | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity





|      |       |      |      |        |        |      |       |         |    |      |
|------|-------|------|------|--------|--------|------|-------|---------|----|------|
| NVNT | ax160 | 5250 | 5150 | -59.13 | -57.02 | 8.23 | 48.52 | Average | 54 | Pass |
|------|-------|------|------|--------|--------|------|-------|---------|----|------|



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



## C.5 Frequency Stability

| Condition | Mode  | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|-------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a     | 5260            | Ant3    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | a     | 5300            | Ant3    | 5299.98                  | -20000               | -3.77           | 25          | Pass    |
| NVNT      | a     | 5320            | Ant3    | 5319.98                  | -20000               | -3.76           | 25          | Pass    |
| NVNT      | n20   | 5260            | Ant3    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | n20   | 5300            | Ant3    | 5299.98                  | -20000               | -3.77           | 25          | Pass    |
| NVNT      | n20   | 5320            | Ant3    | 5320                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n40   | 5270            | Ant3    | 5269.96                  | -40000               | -7.59           | 25          | Pass    |
| NVNT      | n40   | 5310            | Ant3    | 5310                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20  | 5260            | Ant3    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | ac20  | 5300            | Ant3    | 5300                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20  | 5320            | Ant3    | 5319.98                  | -20000               | -3.76           | 25          | Pass    |
| NVNT      | ac40  | 5270            | Ant3    | 5269.96                  | -40000               | -7.59           | 25          | Pass    |
| NVNT      | ac40  | 5310            | Ant3    | 5310                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac80  | 5290            | Ant3    | 5290                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20  | 5260            | Ant3    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | ax20  | 5300            | Ant3    | 5300                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20  | 5320            | Ant3    | 5319.98                  | -20000               | -3.76           | 25          | Pass    |
| NVNT      | ax40  | 5270            | Ant3    | 5269.96                  | -40000               | -7.59           | 25          | Pass    |
| NVNT      | ax40  | 5310            | Ant3    | 5309.96                  | -40000               | -7.53           | 25          | Pass    |
| NVNT      | ax80  | 5290            | Ant3    | 5290                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac160 | 5250            | Ant3    | 5250                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax160 | 5250            | Ant3    | 5250                     | 0                    | 0               | 25          | Pass    |




Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity




## Test Graphs

## Freq. Stability NVNT a 5260MHz Ant3

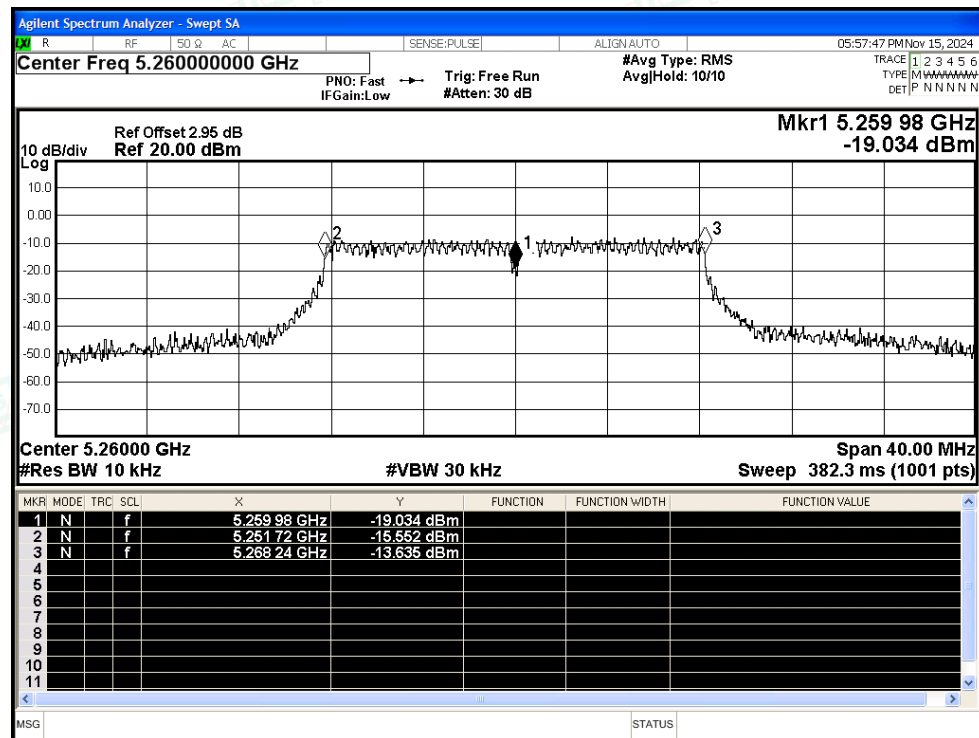

## Freq. Stability NVNT a 5300MHz Ant3

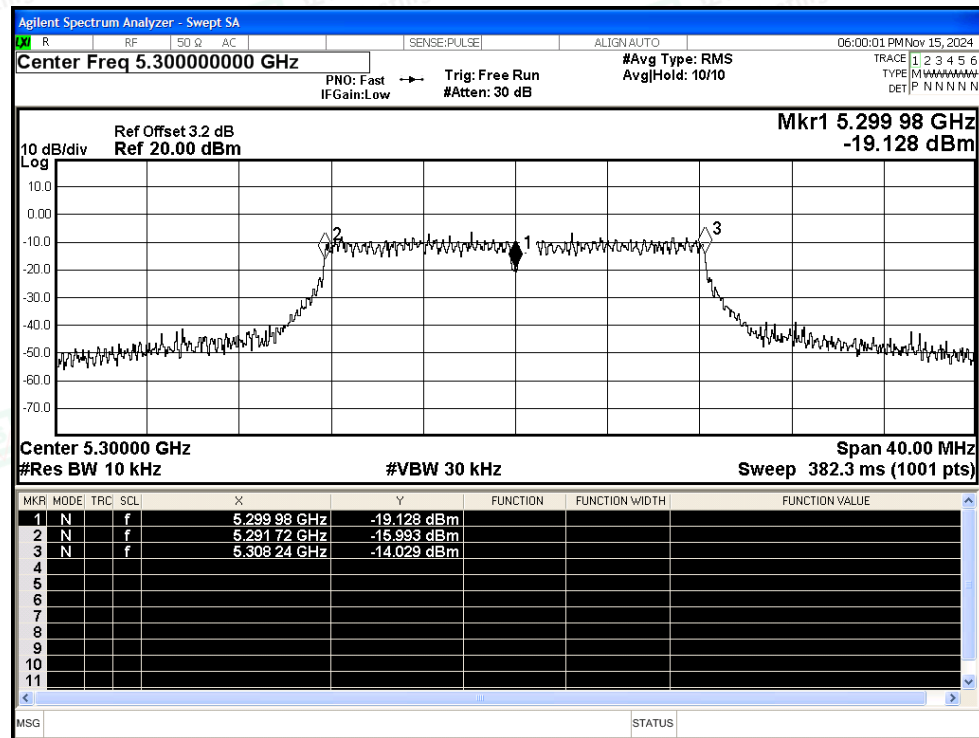

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT a 5320MHz Ant3

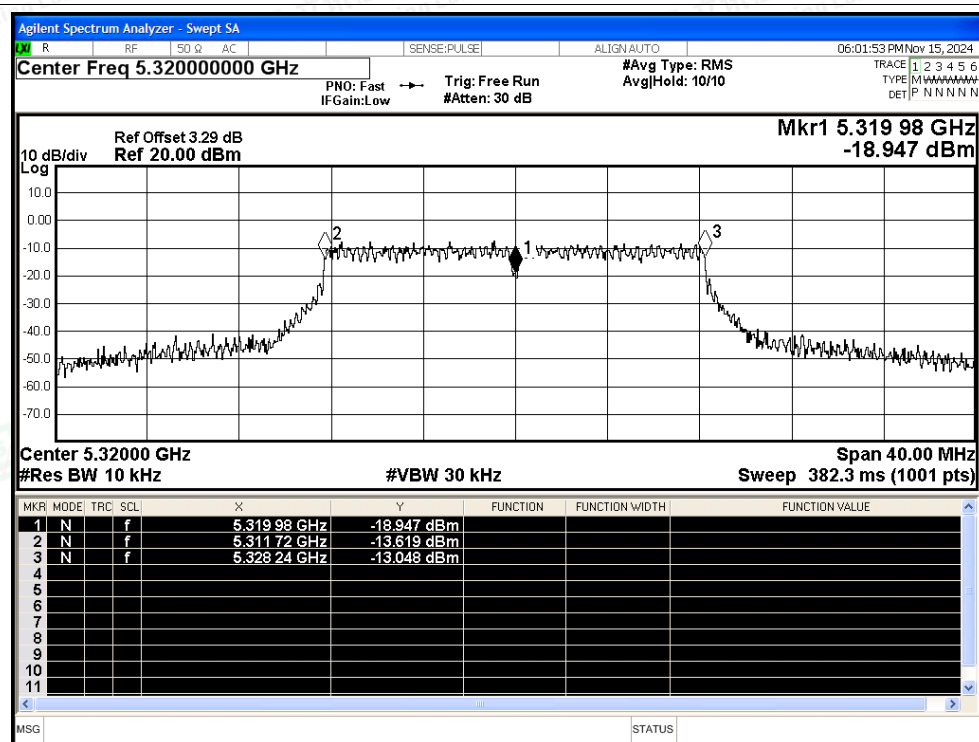

## Freq. Stability NVNT n20 5260MHz Ant3

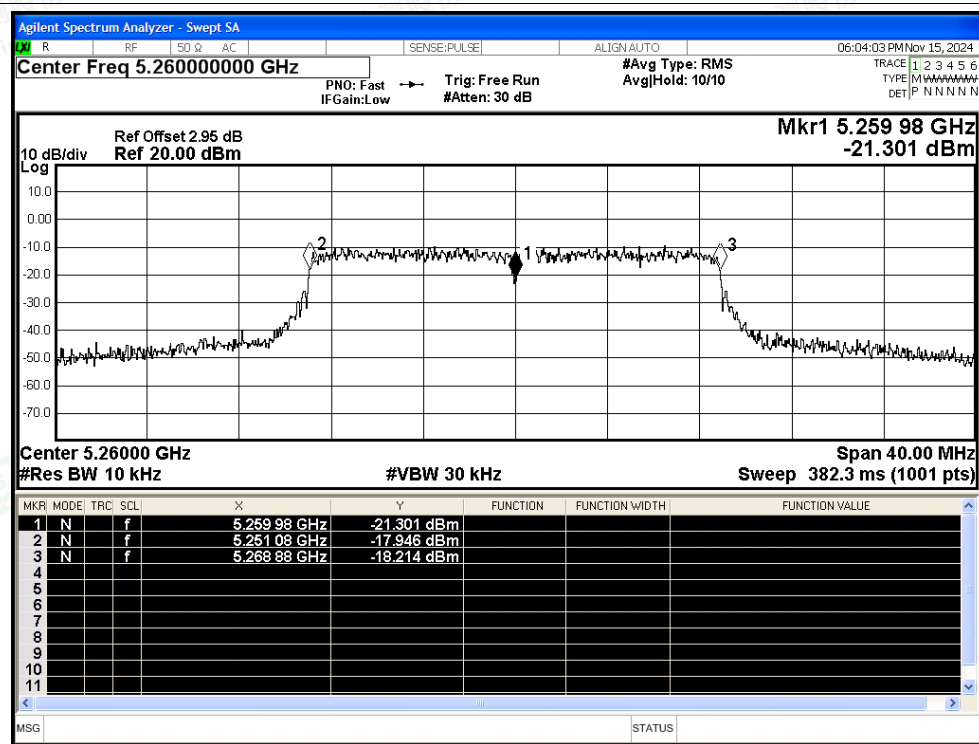

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n20 5300MHz Ant3

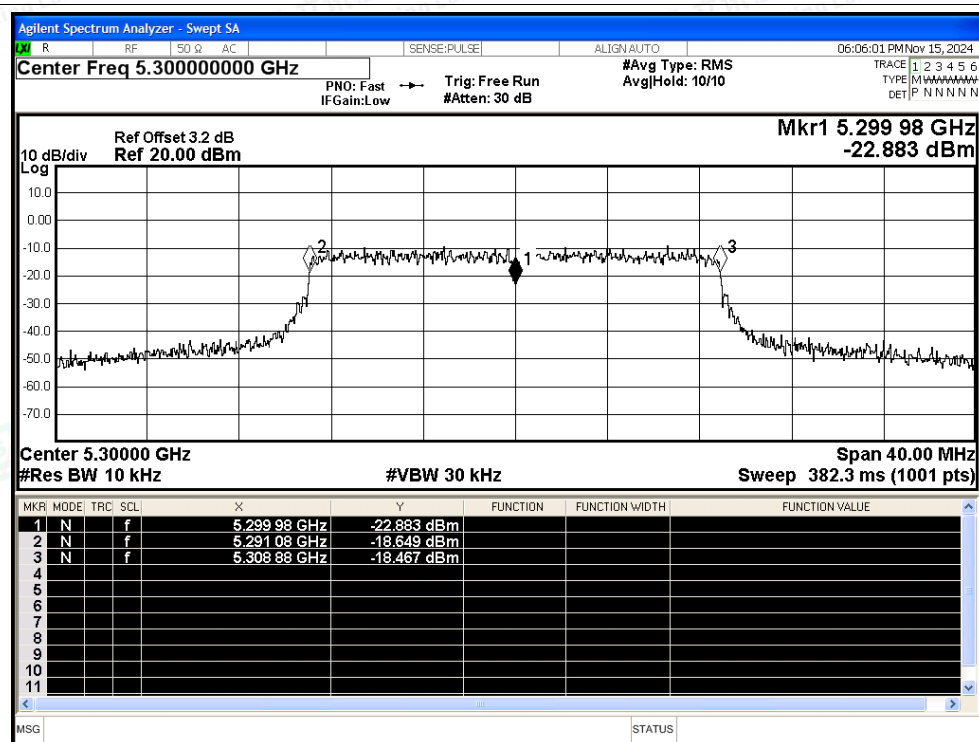

## Freq. Stability NVNT n20 5320MHz Ant3

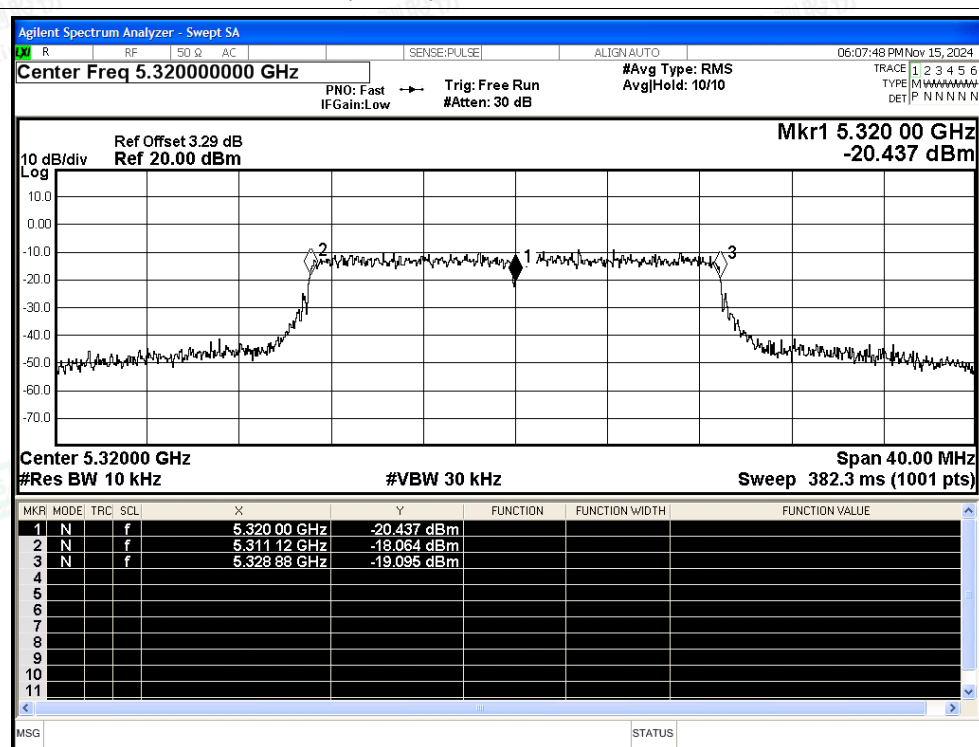

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n40 5270MHz Ant3

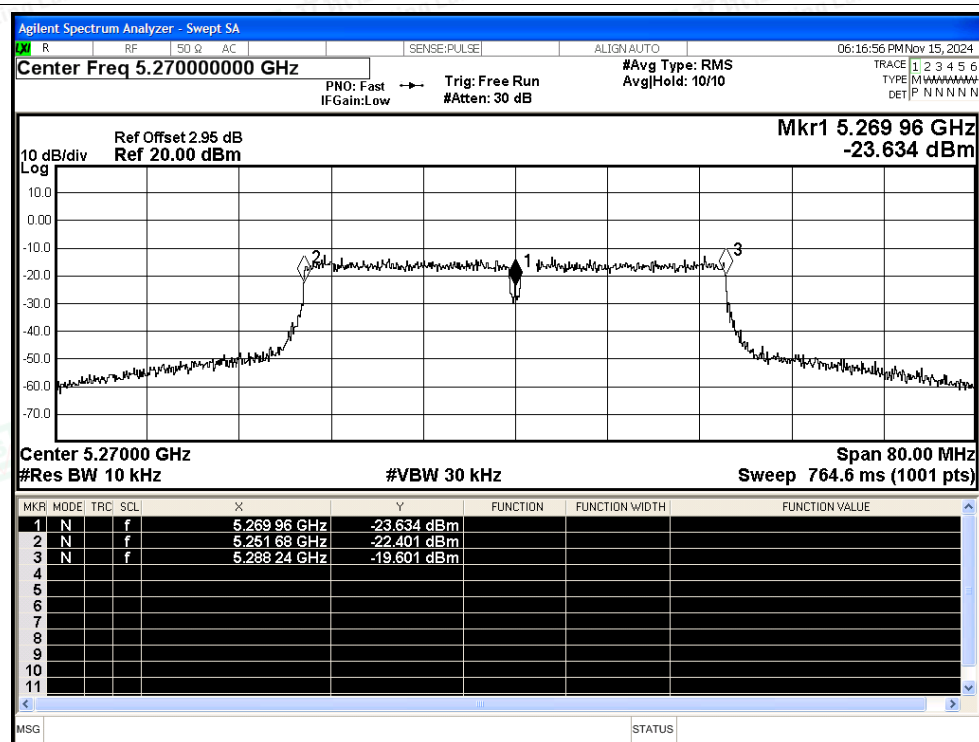

## Freq. Stability NVNT n40 5310MHz Ant3

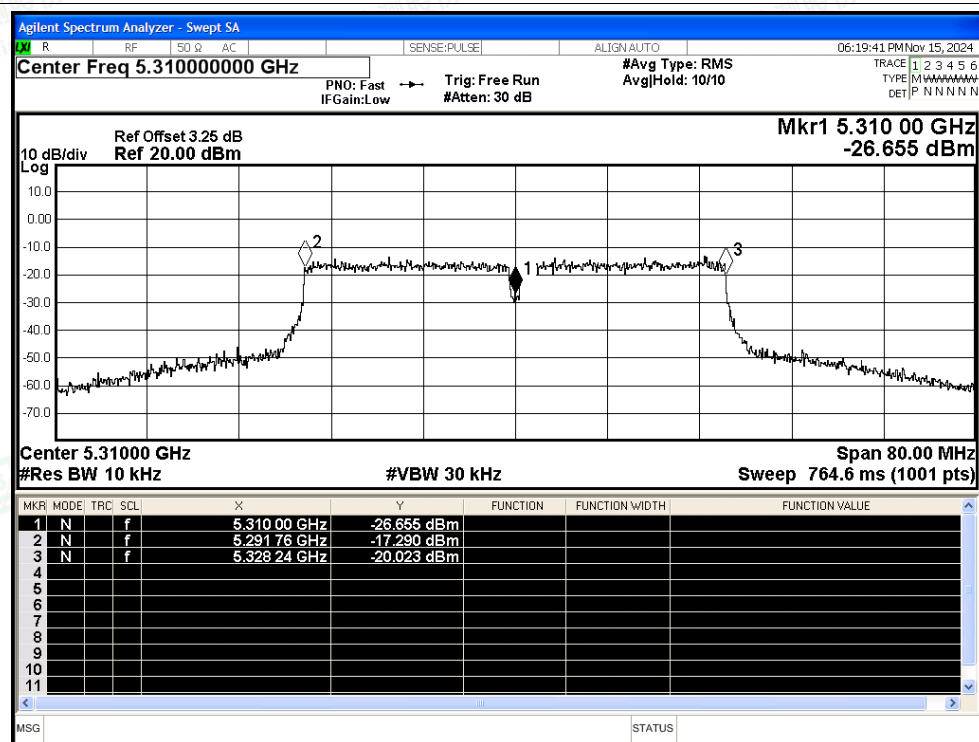

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5260MHz Ant3

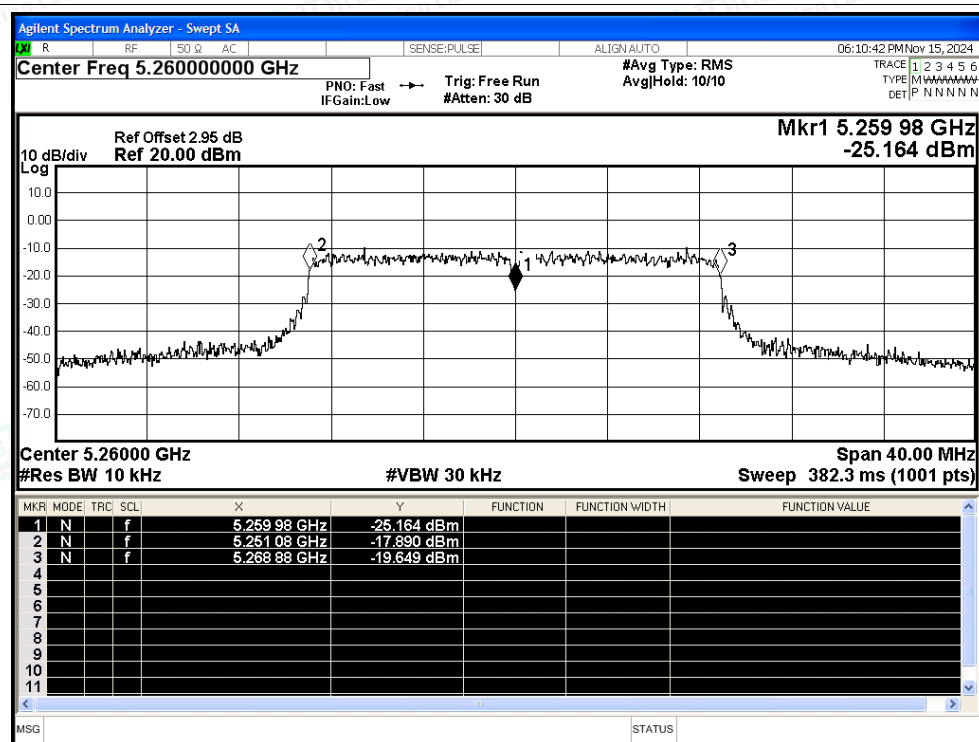

## Freq. Stability NVNT ac20 5300MHz Ant3

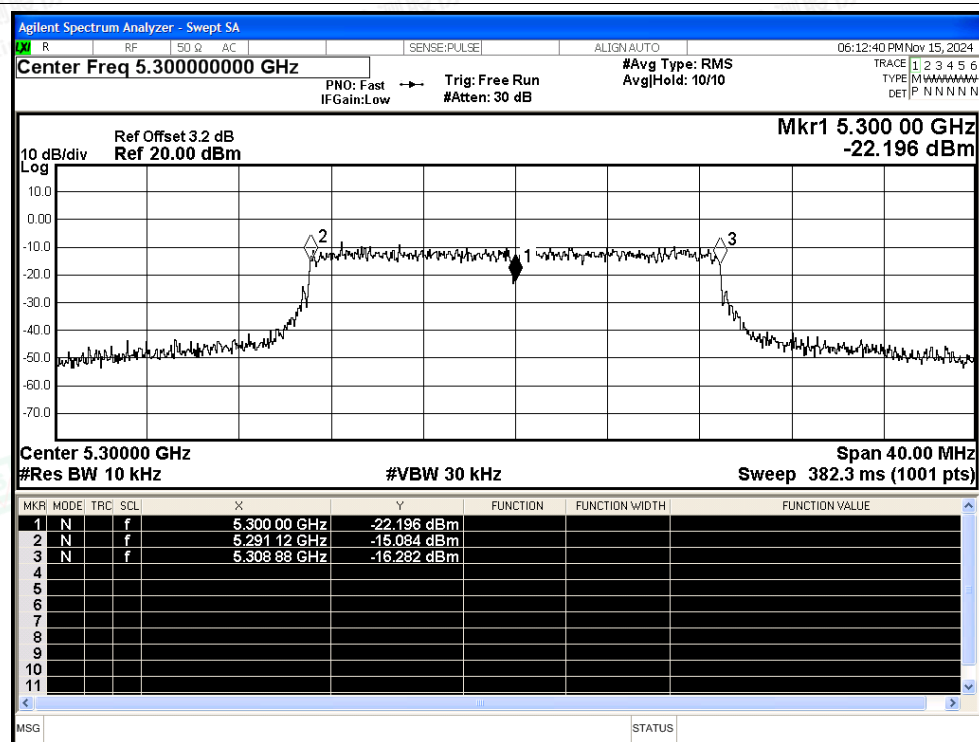

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Freq. Stability NVNT ac20 5320MHz Ant3

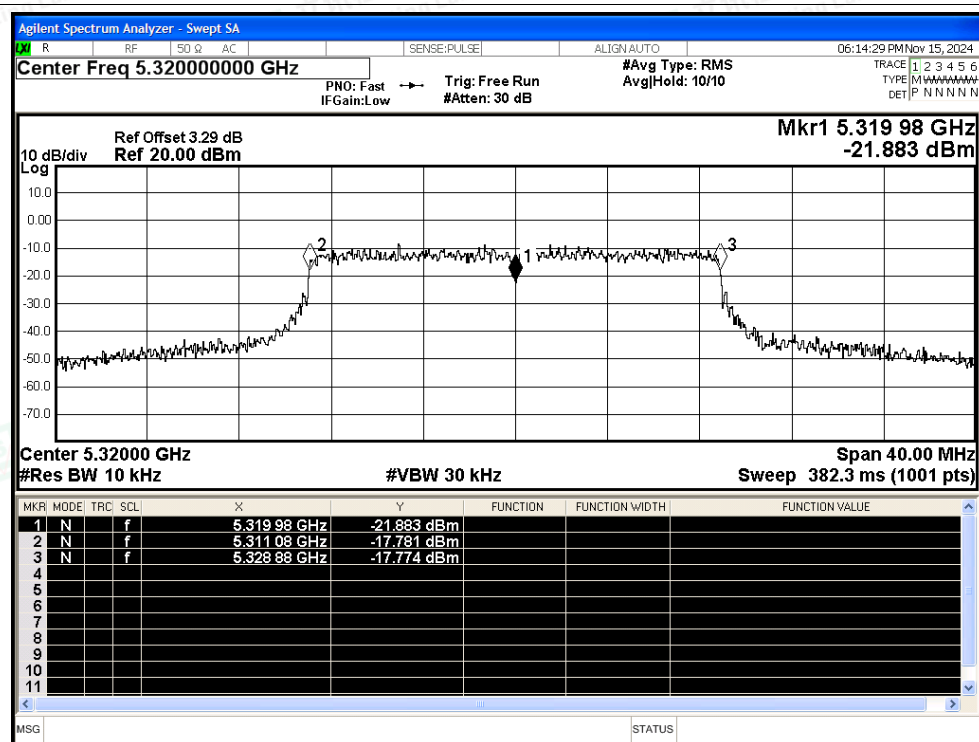


## Freq. Stability NVNT ac40 5270MHz Ant3

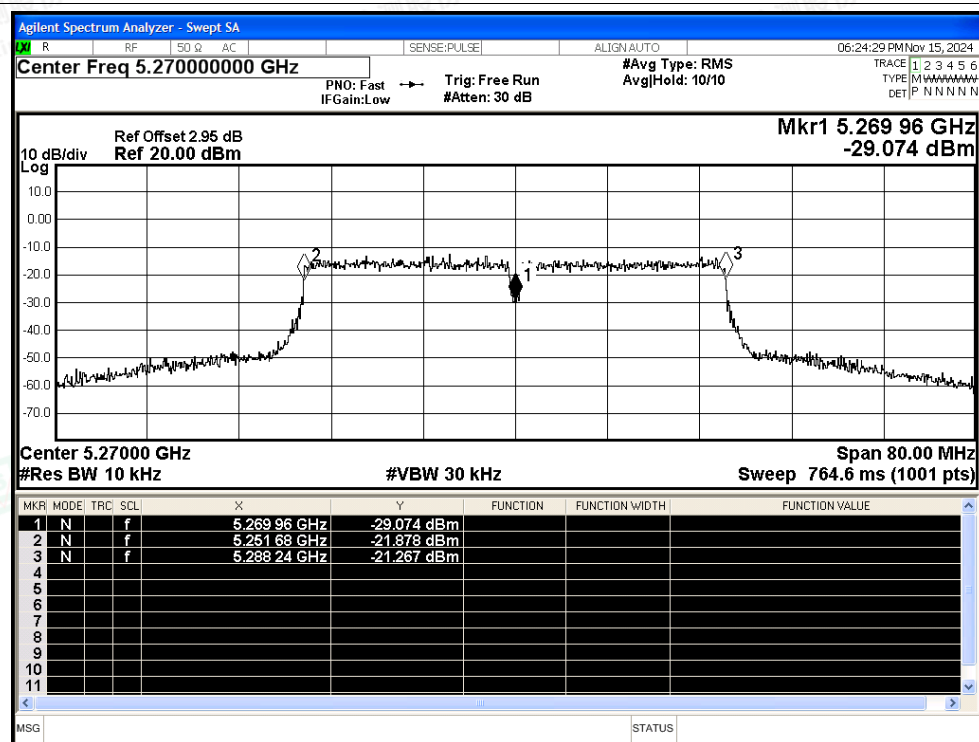




## Freq. Stability NVNT ac40 5310MHz Ant3

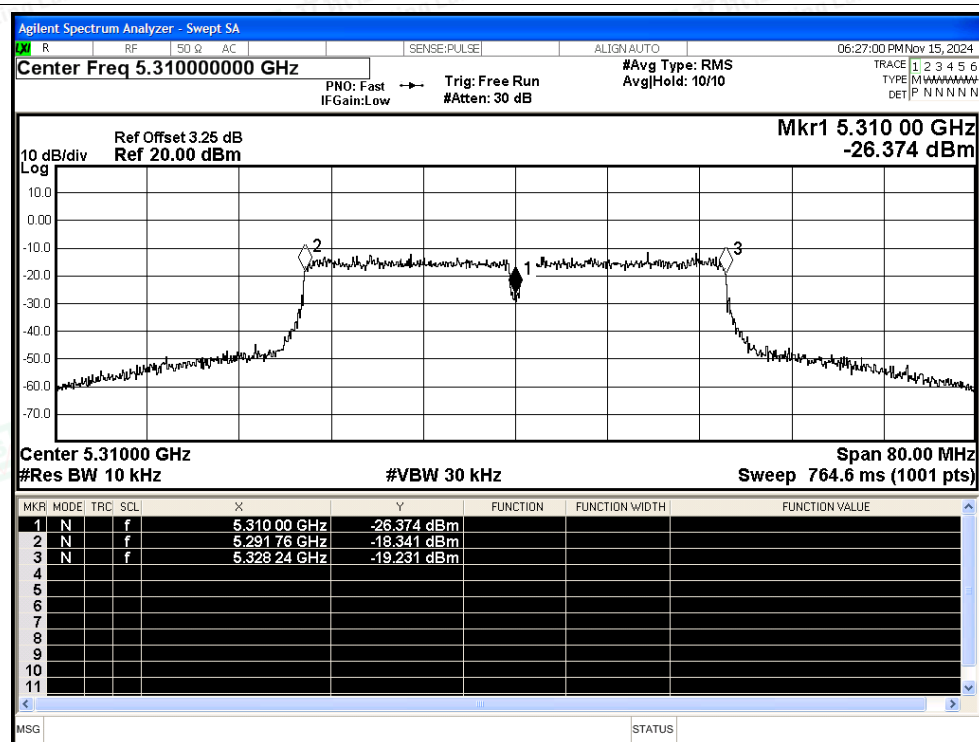

## Freq. Stability NVNT ac80 5290MHz Ant3

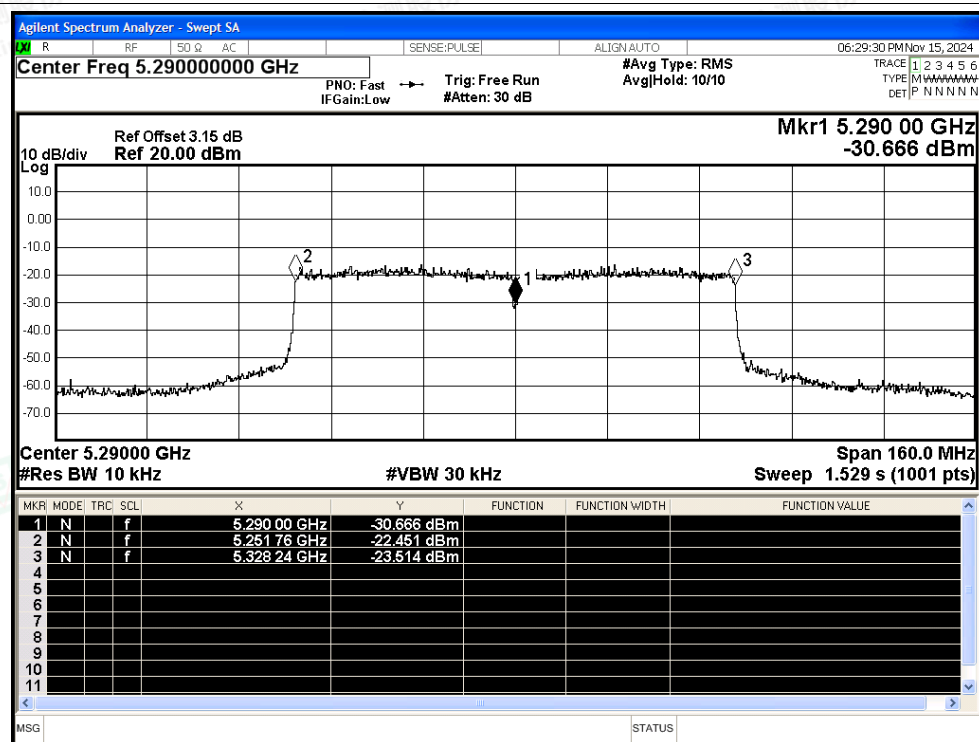

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5260MHz Ant3

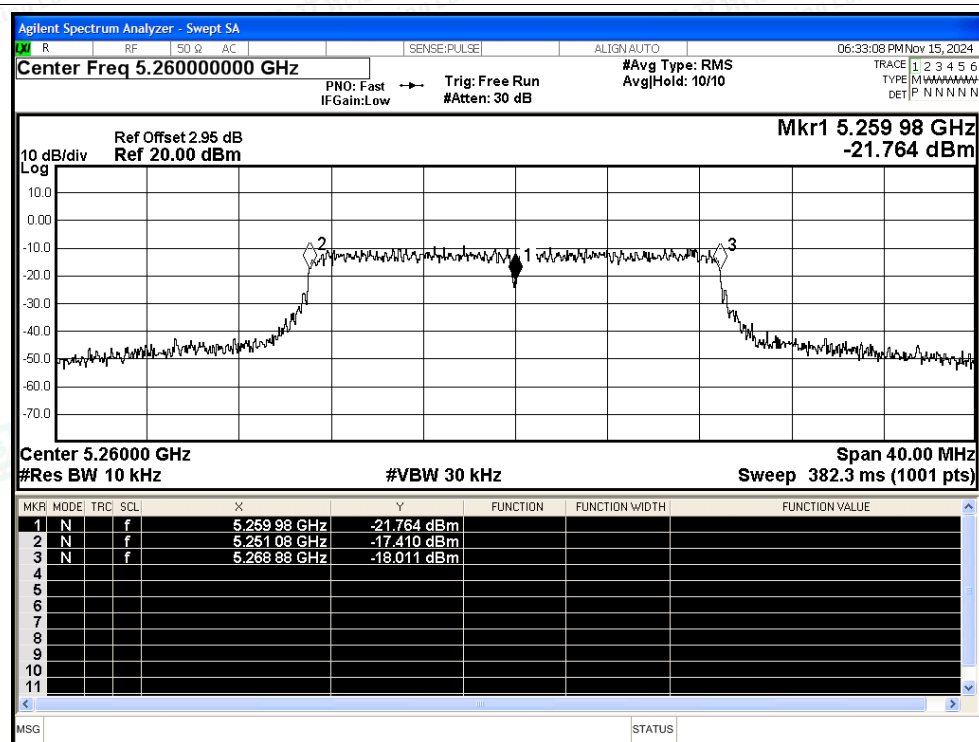

## Freq. Stability NVNT ax20 5300MHz Ant3

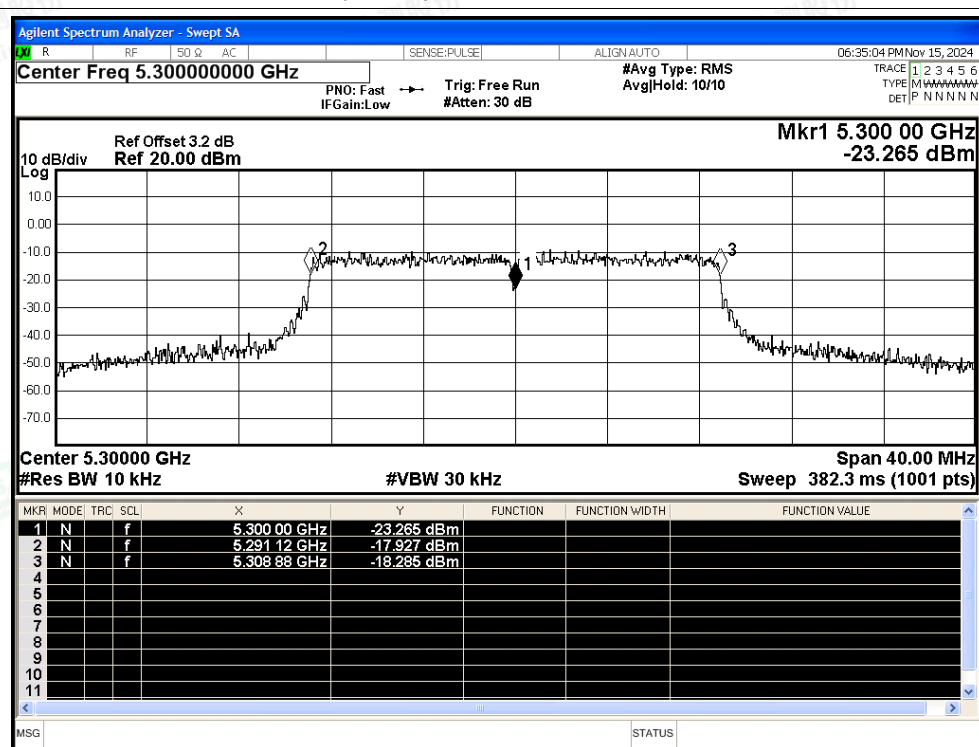

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5320MHz Ant3

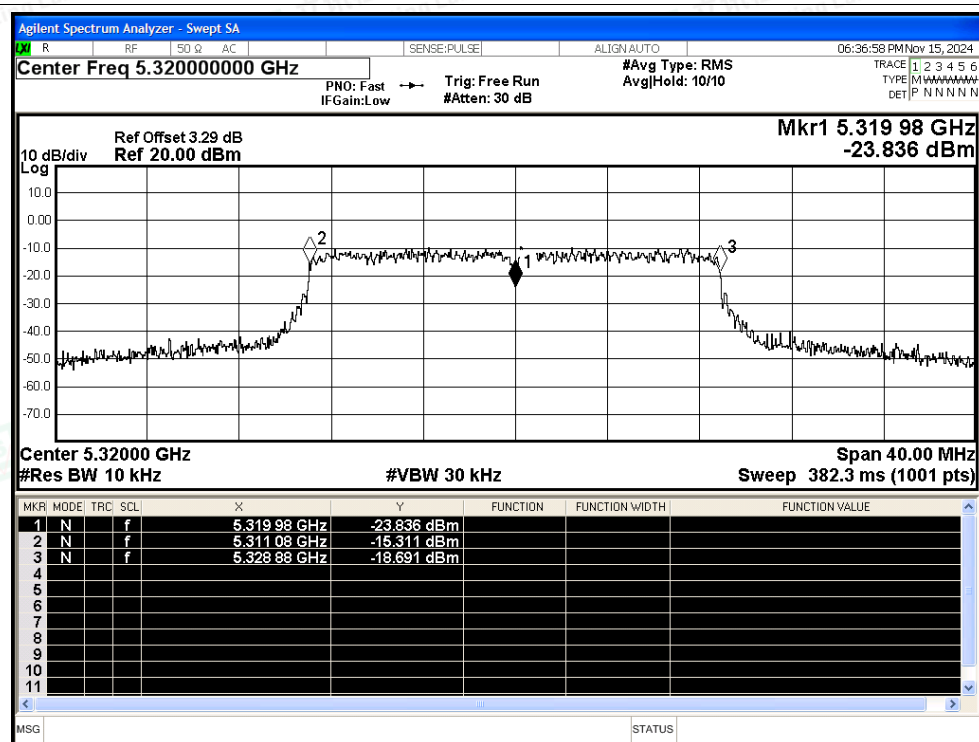

## Freq. Stability NVNT ax40 5270MHz Ant3

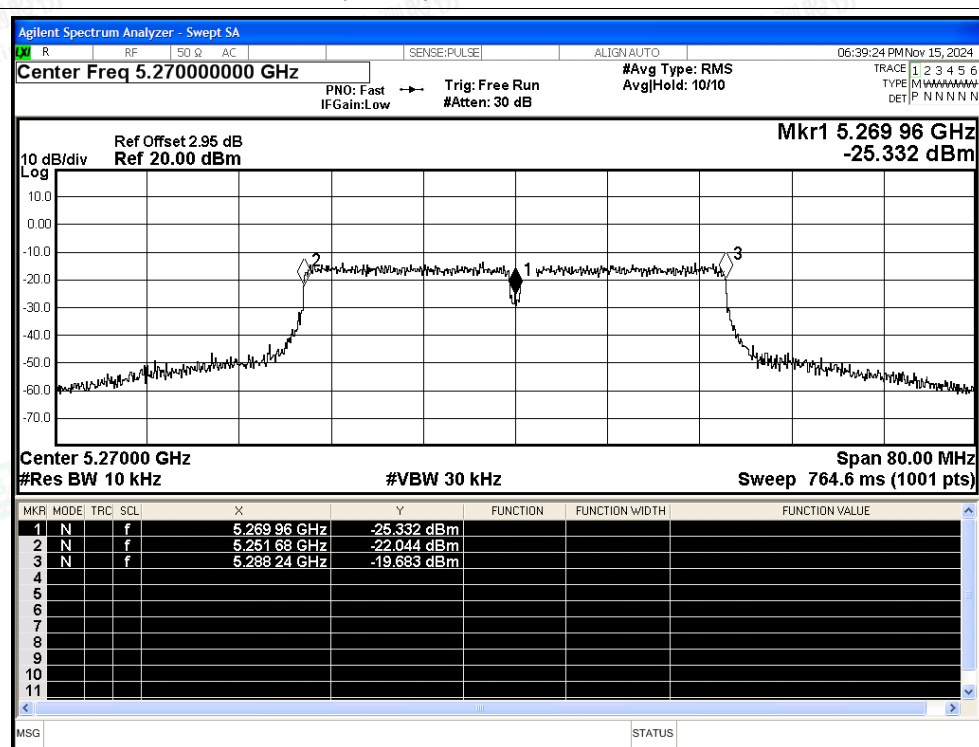

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax40 5310MHz Ant3

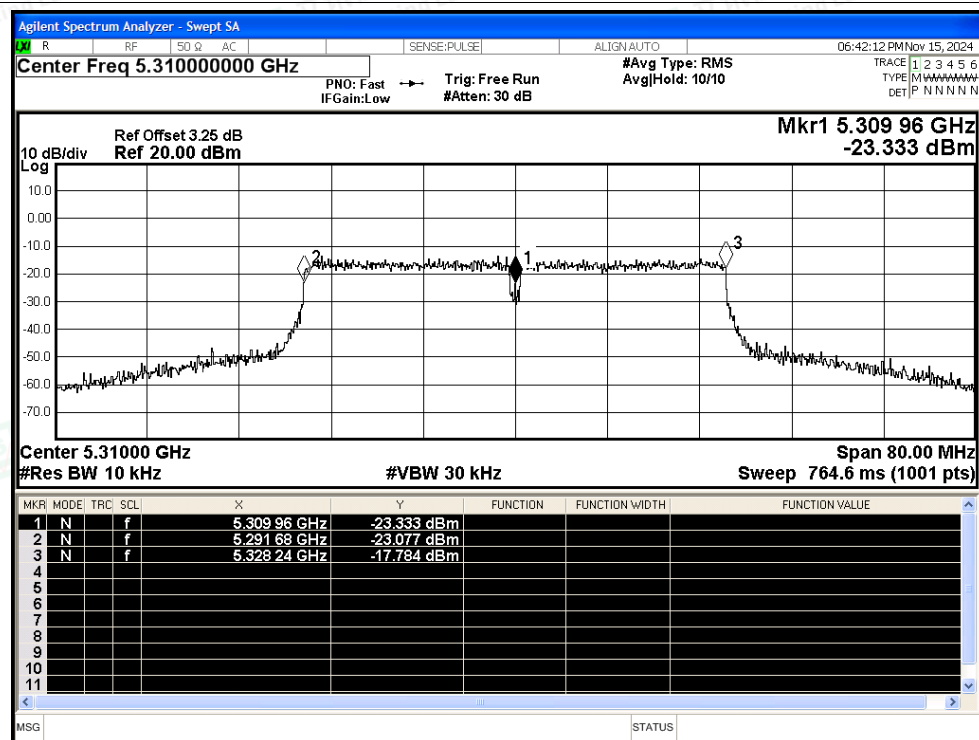


## Freq. Stability NVNT ax80 5290MHz Ant3

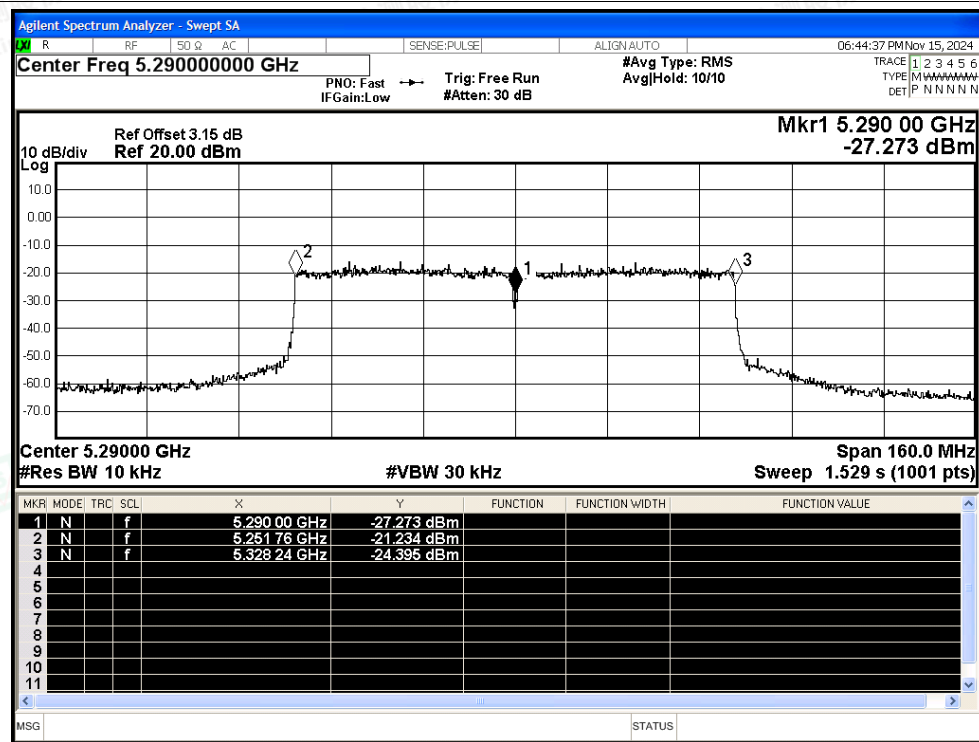




## Freq. Stability NVNT ac160 5250MHz Ant3

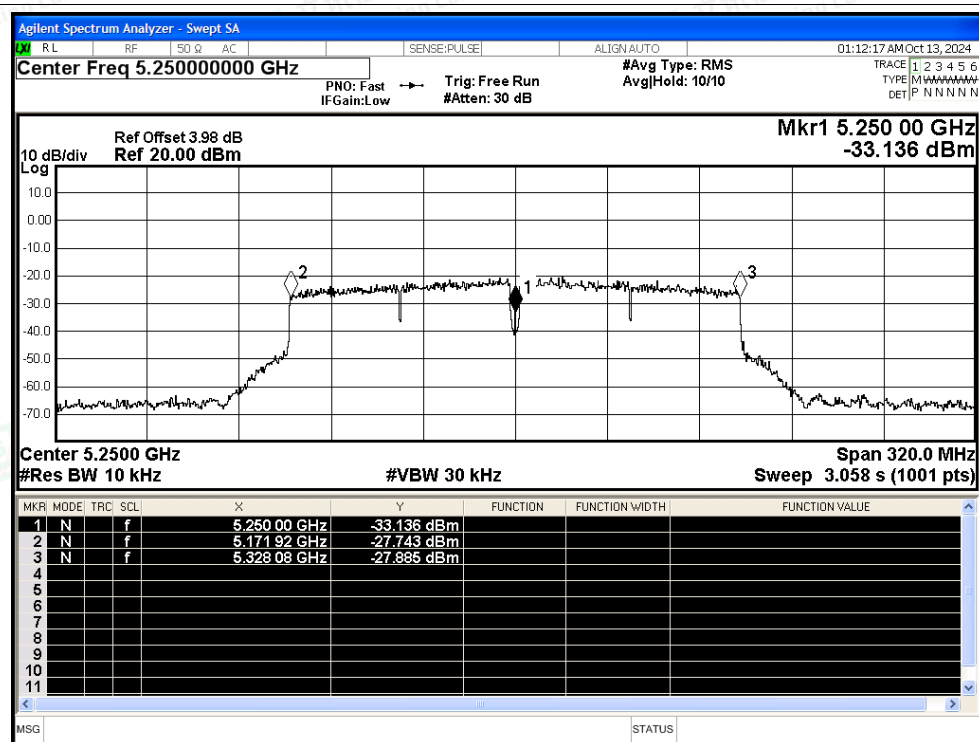

## Freq. Stability NVNT ax160 5250MHz Ant3

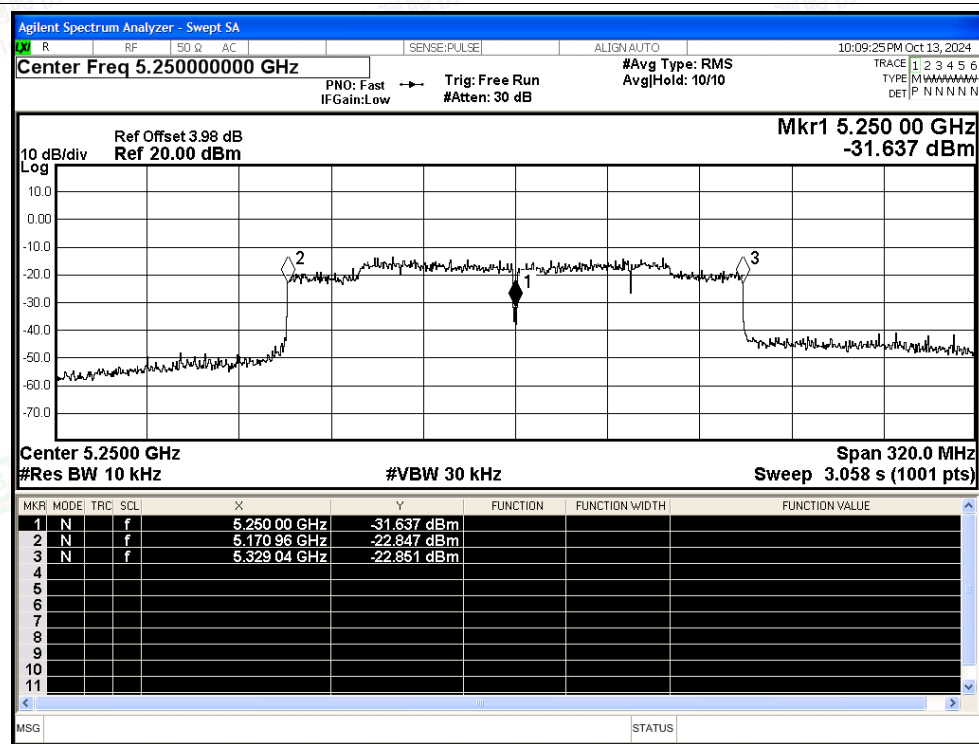



| Condition | Mode  | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|-------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a     | 5260            | Ant4    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | a     | 5300            | Ant4    | 5300                     | 0                    | 0               | 25          | Pass    |
| NVNT      | a     | 5320            | Ant4    | 5320                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n20   | 5260            | Ant4    | 5259.96                  | -40000               | -7.6            | 25          | Pass    |
| NVNT      | n20   | 5300            | Ant4    | 5299.98                  | -20000               | -3.77           | 25          | Pass    |
| NVNT      | n20   | 5320            | Ant4    | 5320                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n40   | 5270            | Ant4    | 5269.96                  | -40000               | -7.59           | 25          | Pass    |
| NVNT      | n40   | 5310            | Ant4    | 5310                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20  | 5260            | Ant4    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | ac20  | 5300            | Ant4    | 5299.98                  | -20000               | -3.77           | 25          | Pass    |
| NVNT      | ac20  | 5320            | Ant4    | 5320                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40  | 5270            | Ant4    | 5270                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40  | 5310            | Ant4    | 5309.96                  | -40000               | -7.53           | 25          | Pass    |
| NVNT      | ac80  | 5290            | Ant4    | 5290                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20  | 5260            | Ant4    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | ax20  | 5300            | Ant4    | 5300                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20  | 5320            | Ant4    | 5319.96                  | -40000               | -7.52           | 25          | Pass    |
| NVNT      | ax40  | 5270            | Ant4    | 5270                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax40  | 5310            | Ant4    | 5310                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax80  | 5290            | Ant4    | 5290                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac160 | 5250            | Ant4    | 5250                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax160 | 5250            | Ant4    | 5250                     | 0                    | 0               | 25          | Pass    |









## Test Graphs

## Freq. Stability NVNT a 5260MHz Ant4

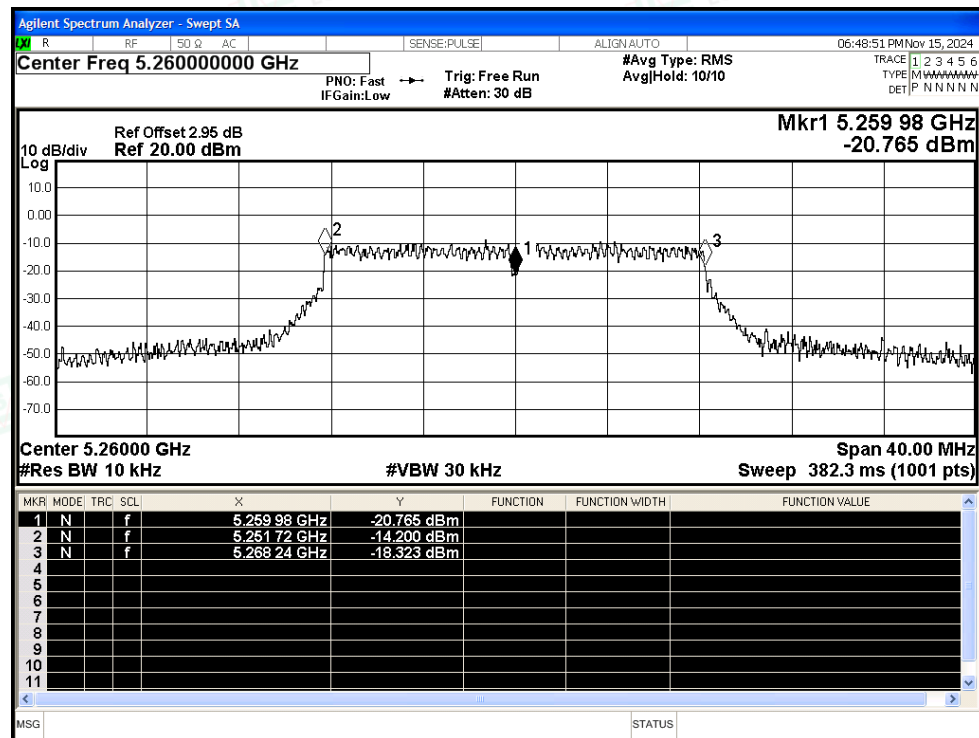


## Freq. Stability NVNT a 5300MHz Ant4

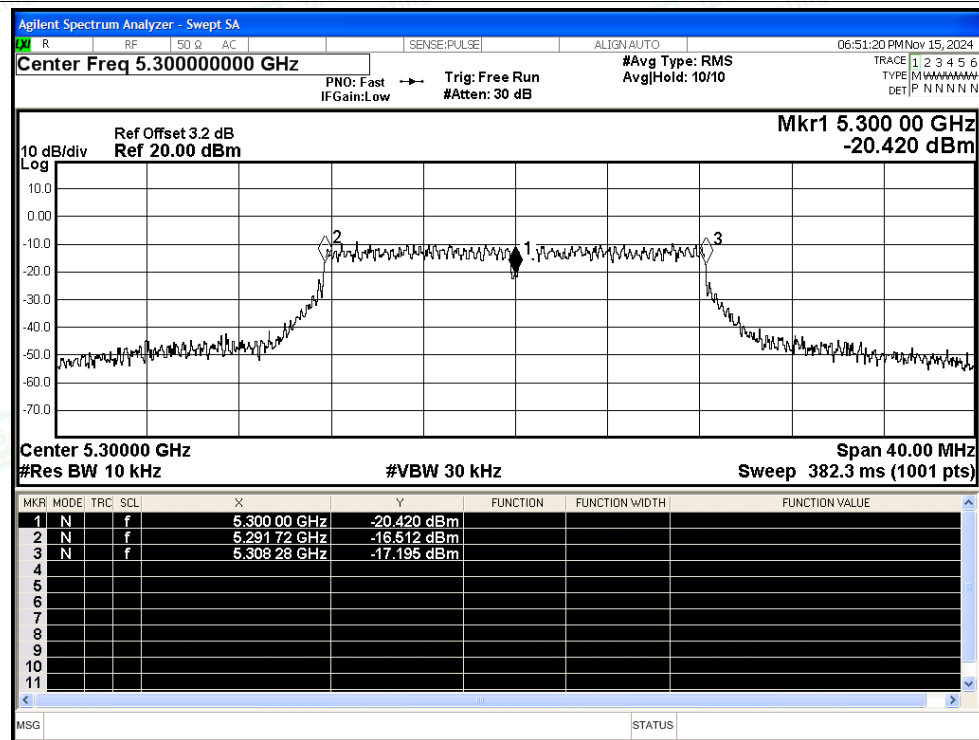




## Freq. Stability NVNT a 5320MHz Ant4

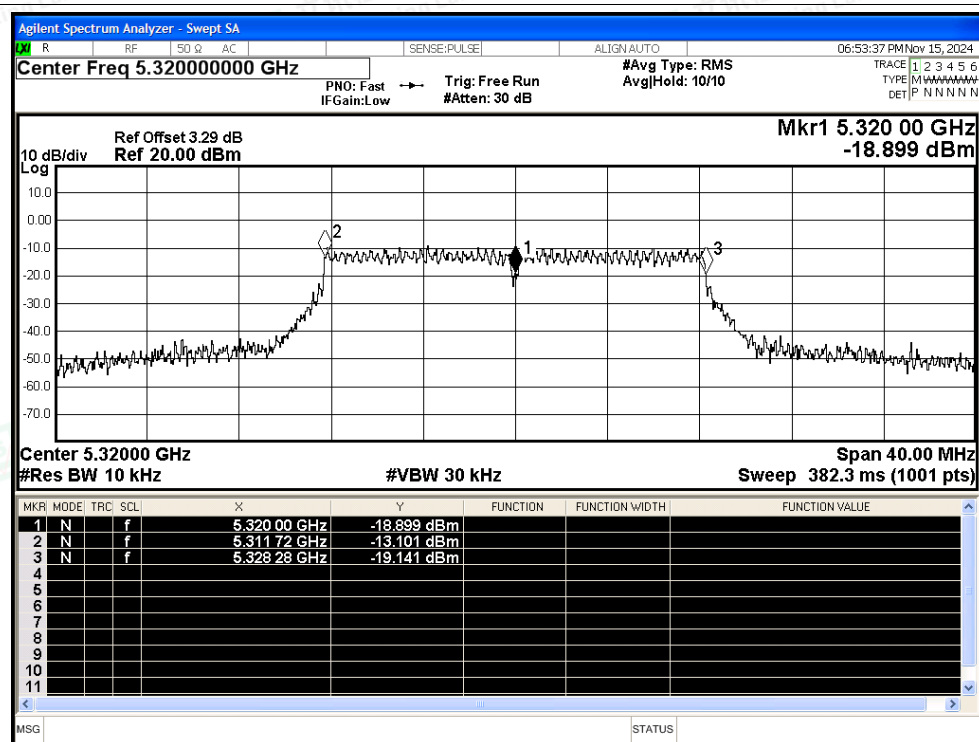


## Freq. Stability NVNT n20 5260MHz Ant4

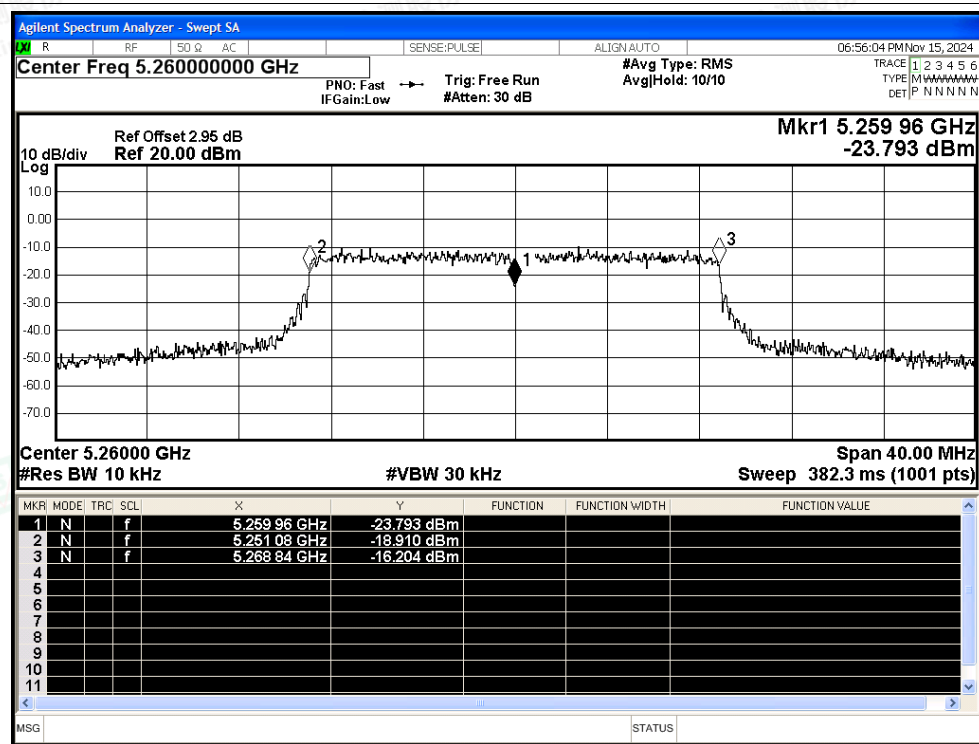




## Freq. Stability NVNT n20 5300MHz Ant4

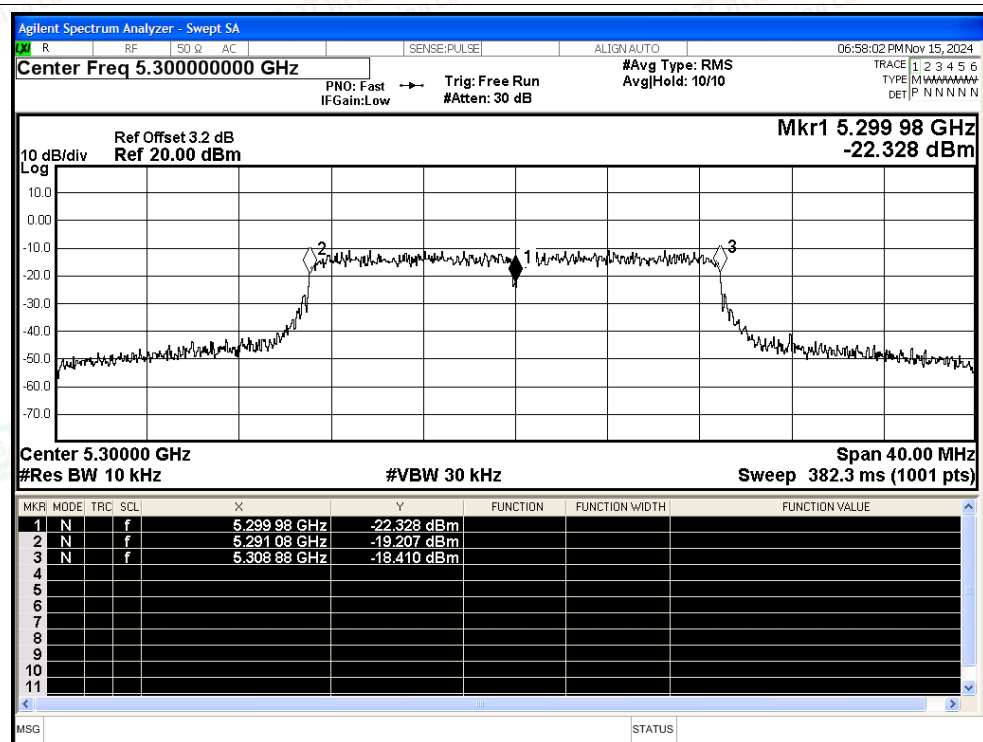

## Freq. Stability NVNT n20 5320MHz Ant4

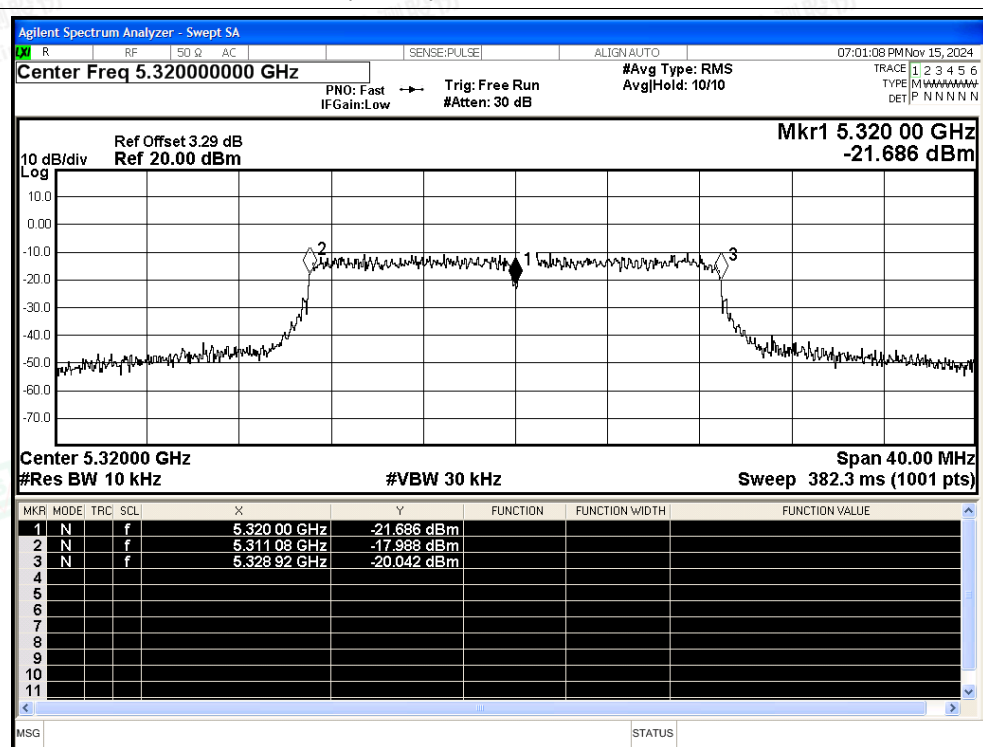

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n40 5270MHz Ant4

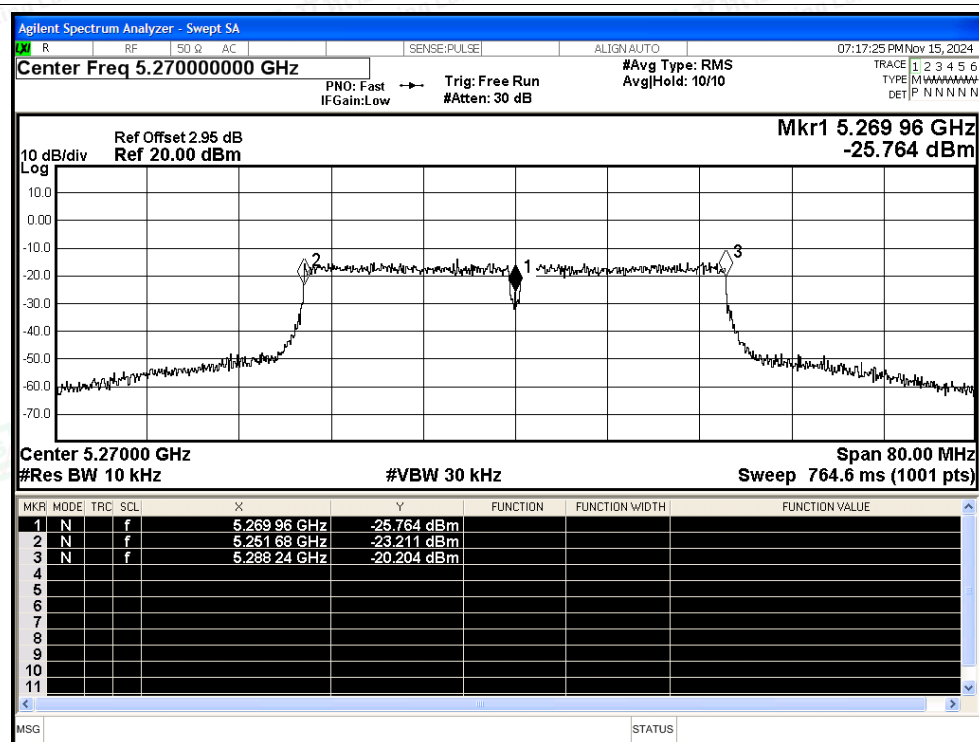


## Freq. Stability NVNT n40 5310MHz Ant4

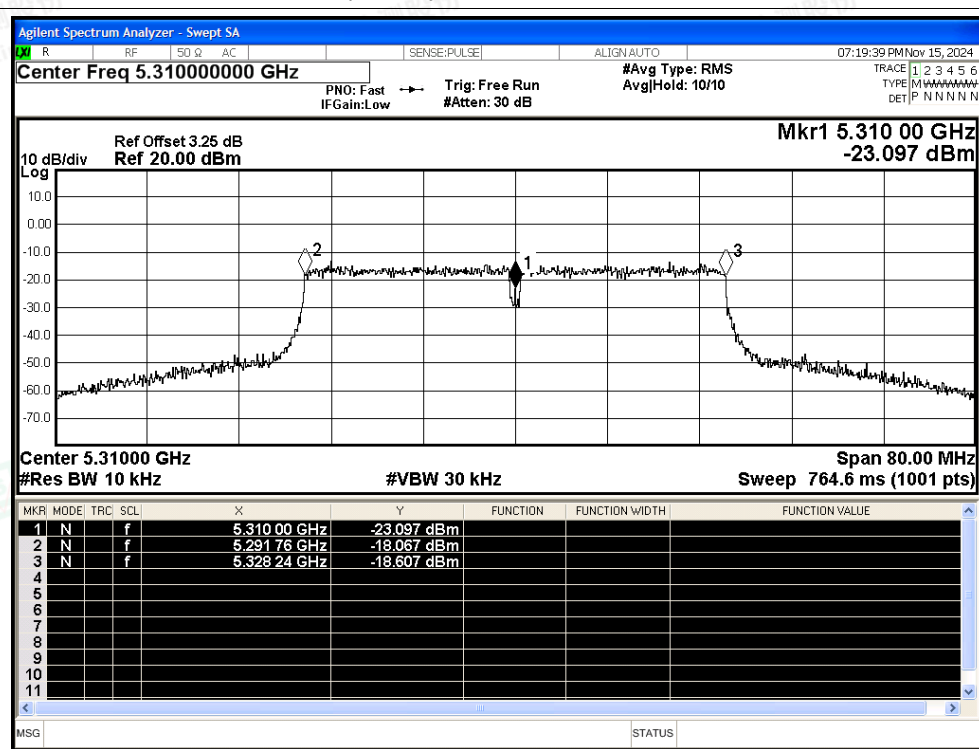




## Freq. Stability NVNT ac20 5260MHz Ant4

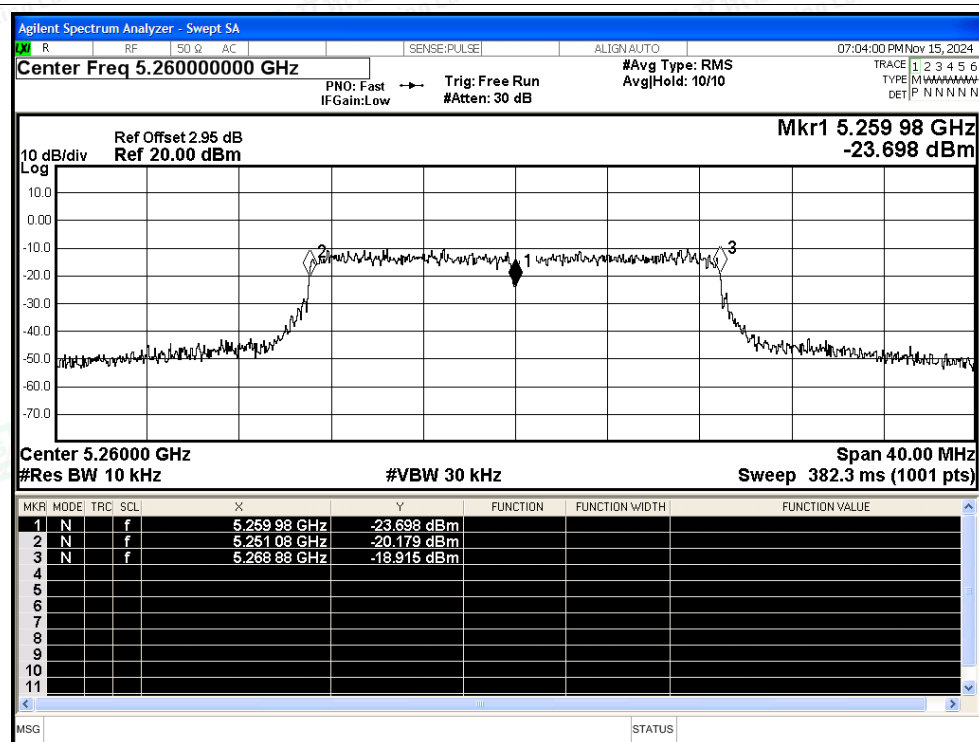

## Freq. Stability NVNT ac20 5300MHz Ant4

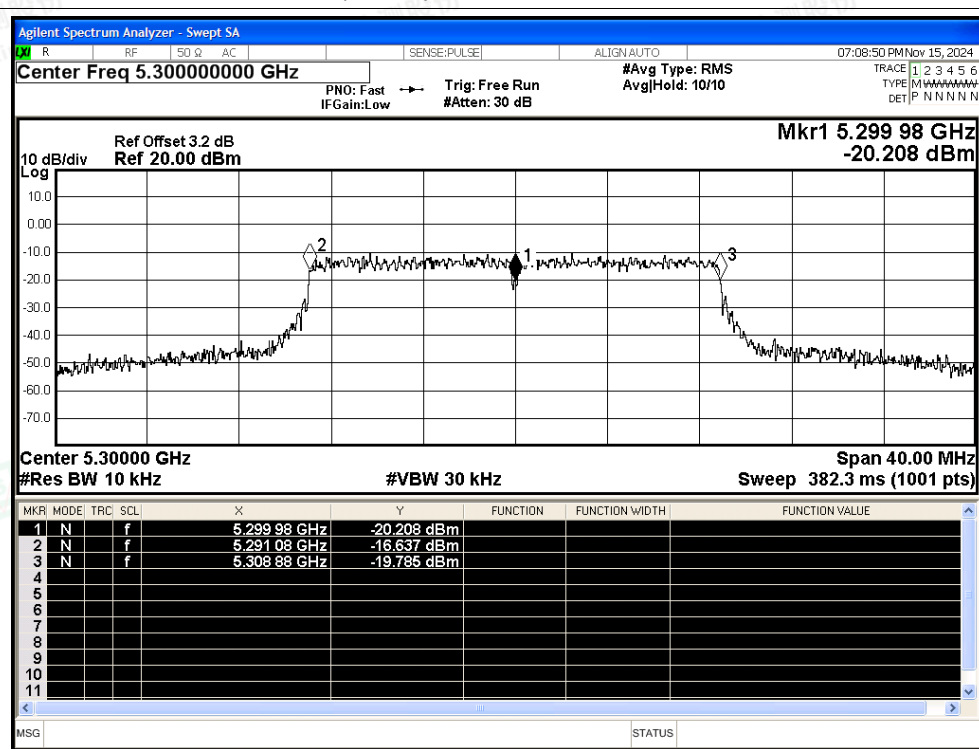

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5320MHz Ant4

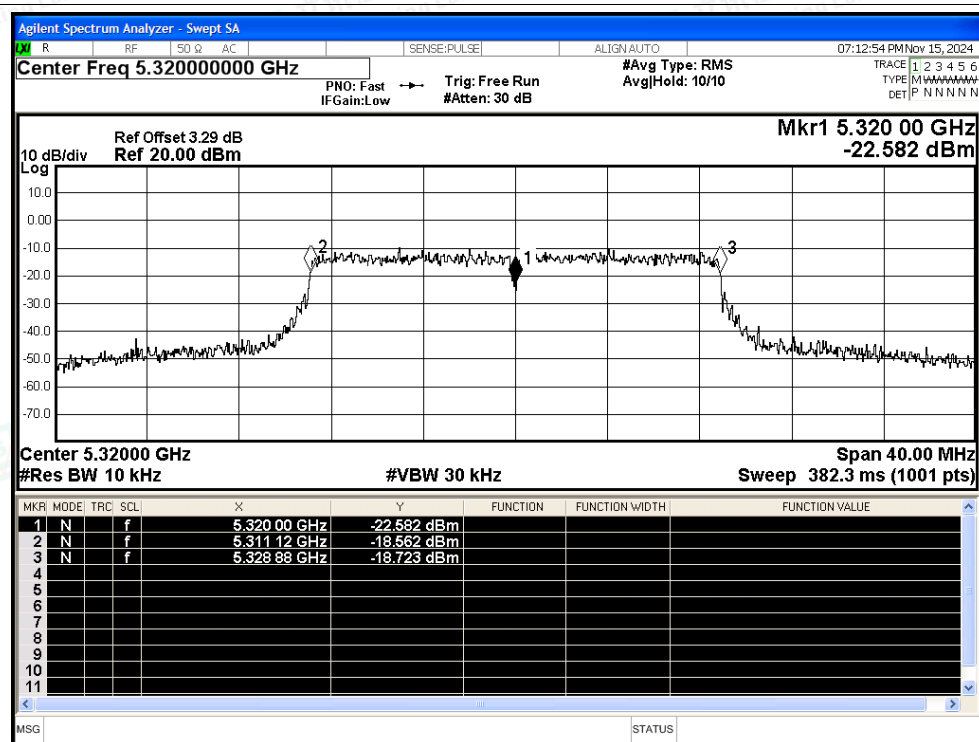


## Freq. Stability NVNT ac40 5270MHz Ant4

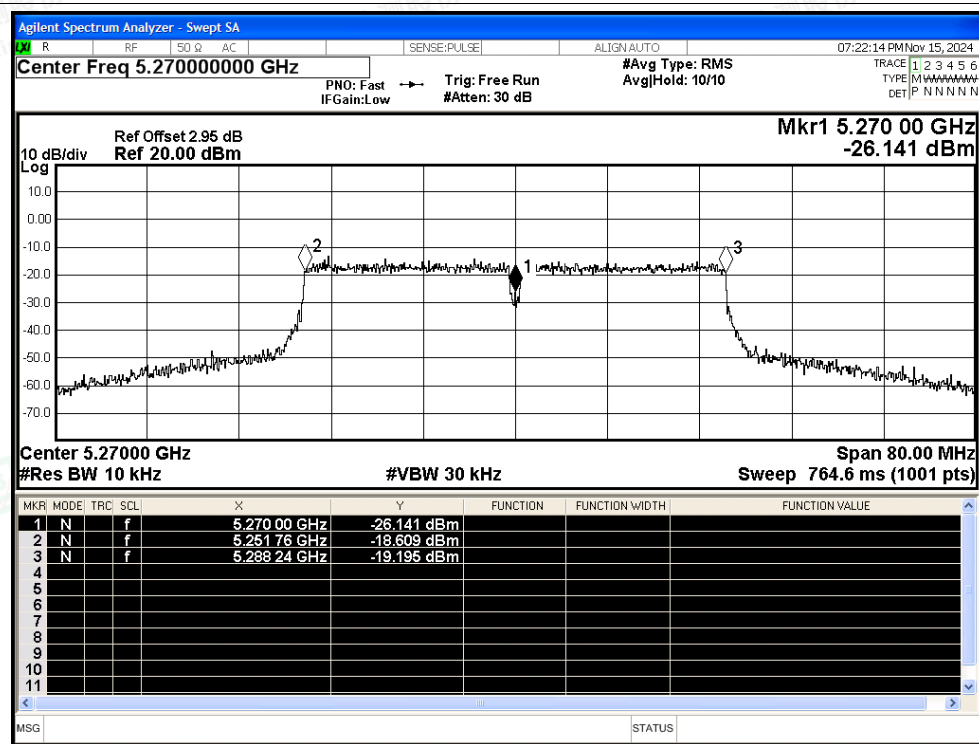




## Freq. Stability NVNT ac40 5310MHz Ant4

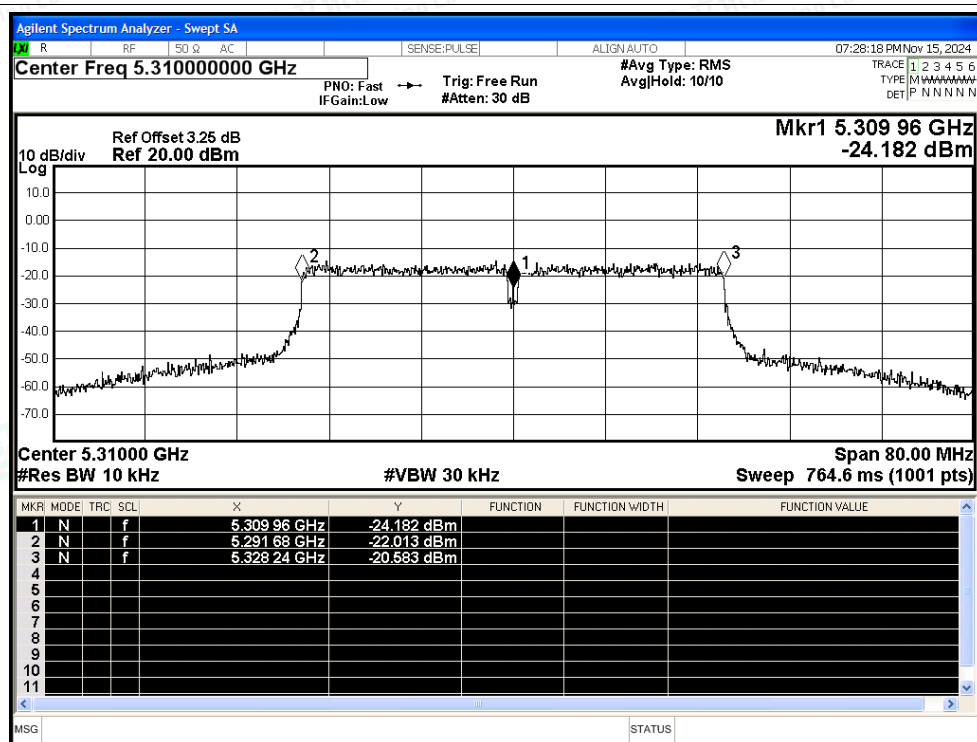

## Freq. Stability NVNT ac80 5290MHz Ant4

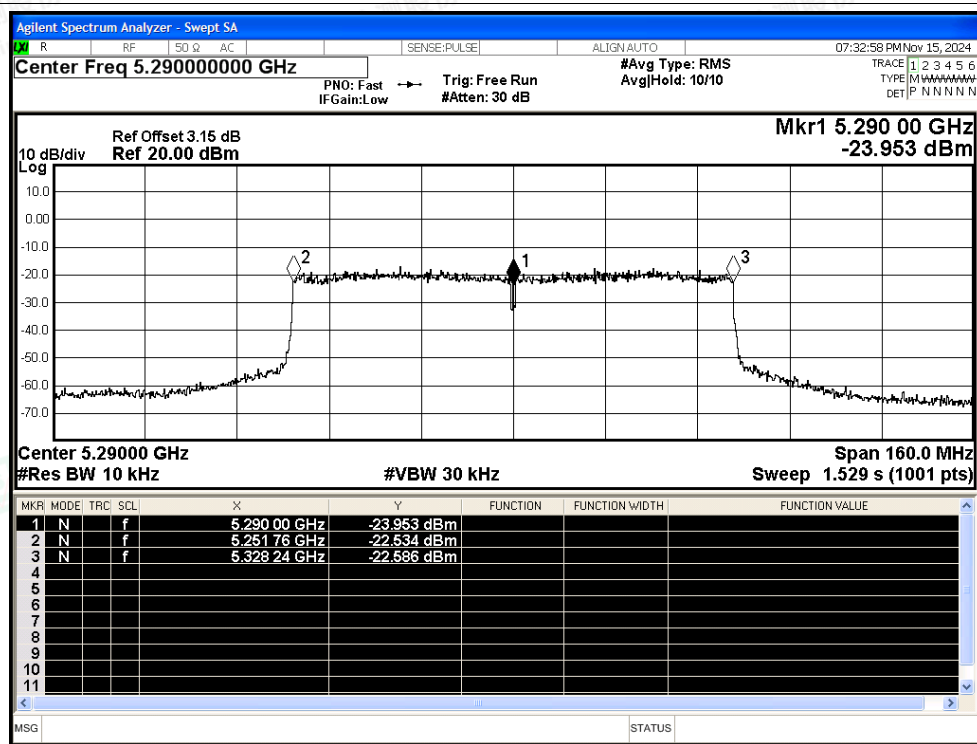

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Freq. Stability NVNT ax20 5260MHz Ant4

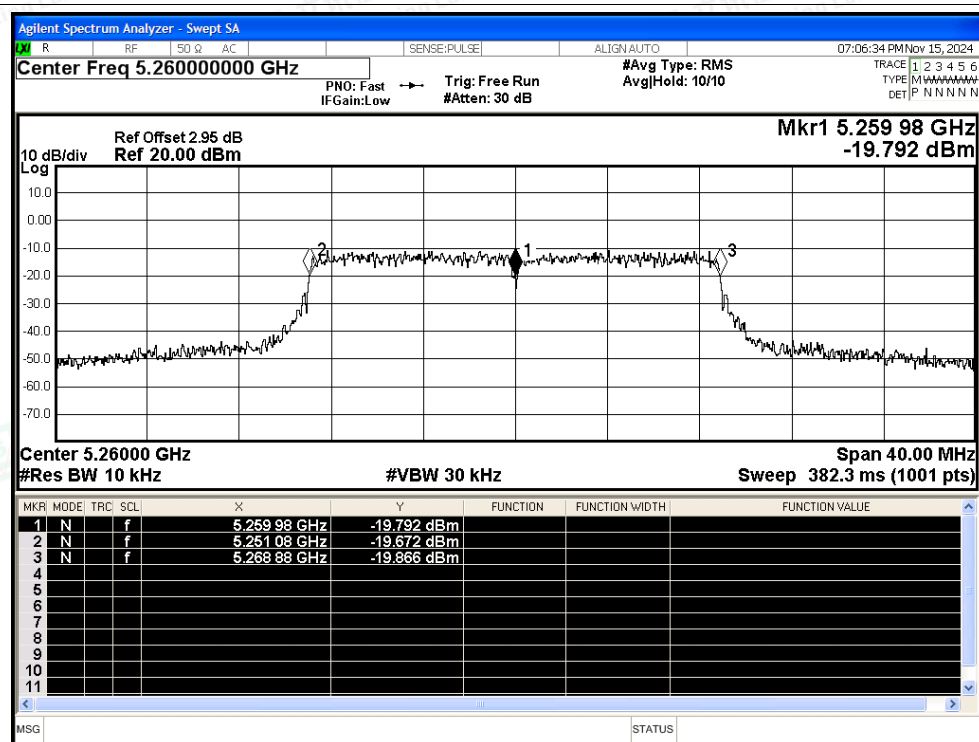

## Freq. Stability NVNT ax20 5300MHz Ant4

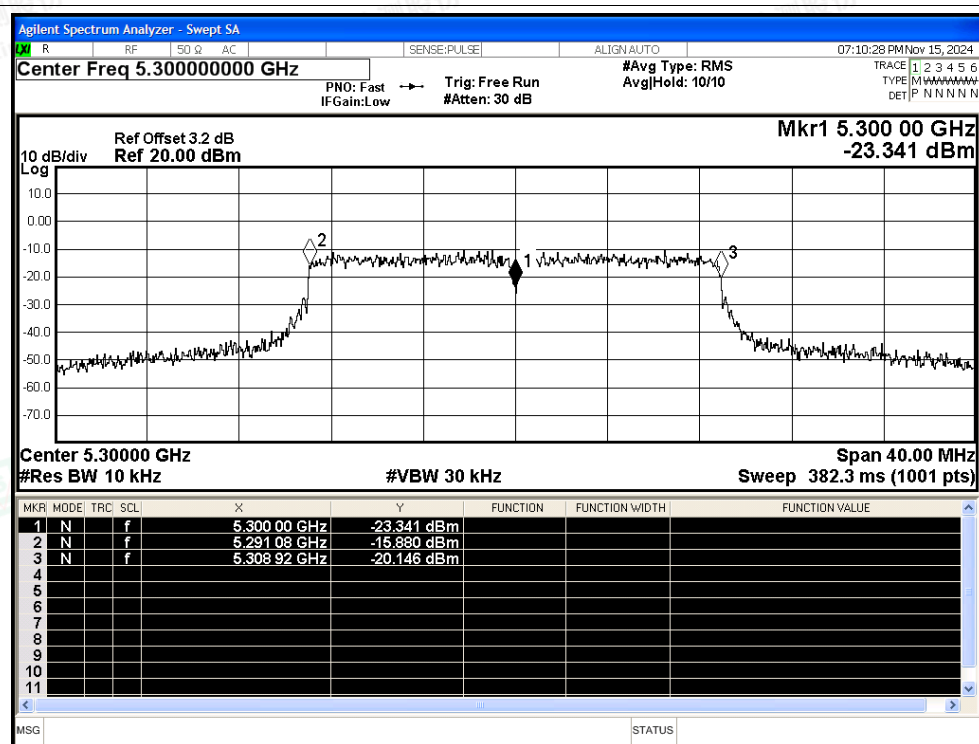

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5320MHz Ant4

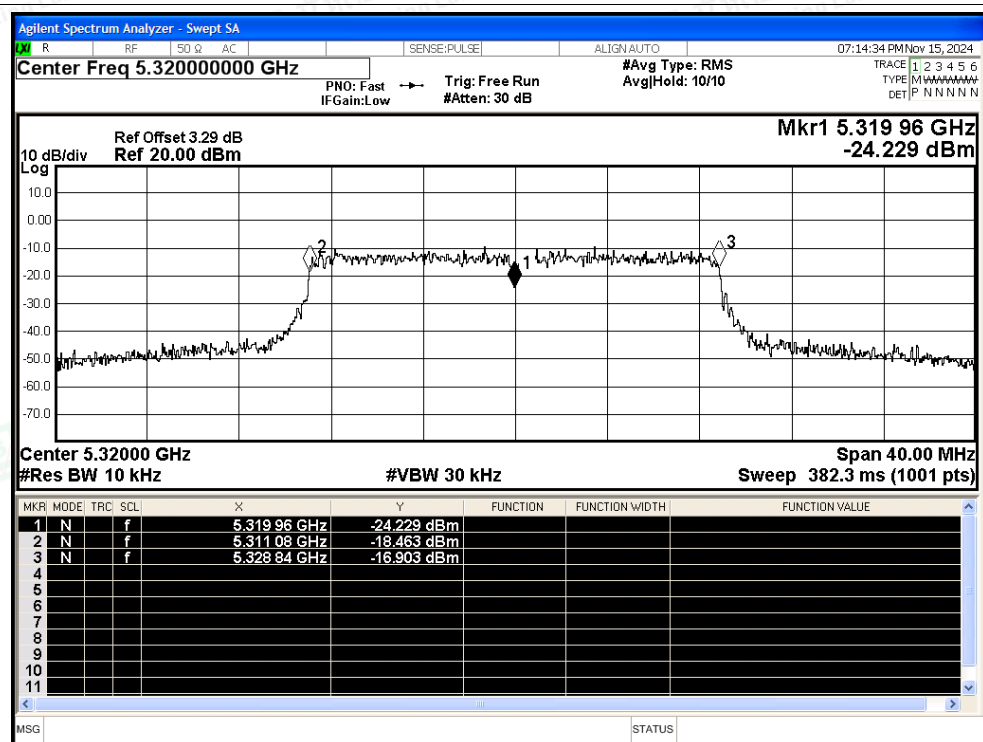

## Freq. Stability NVNT ax40 5270MHz Ant4

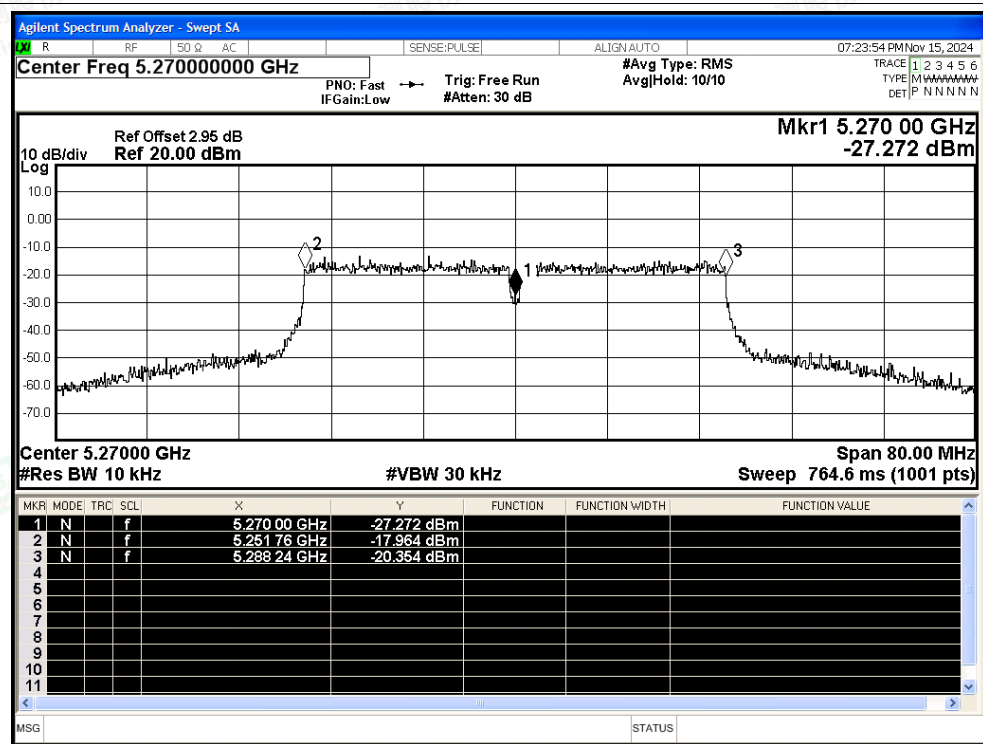

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax40 5310MHz Ant4

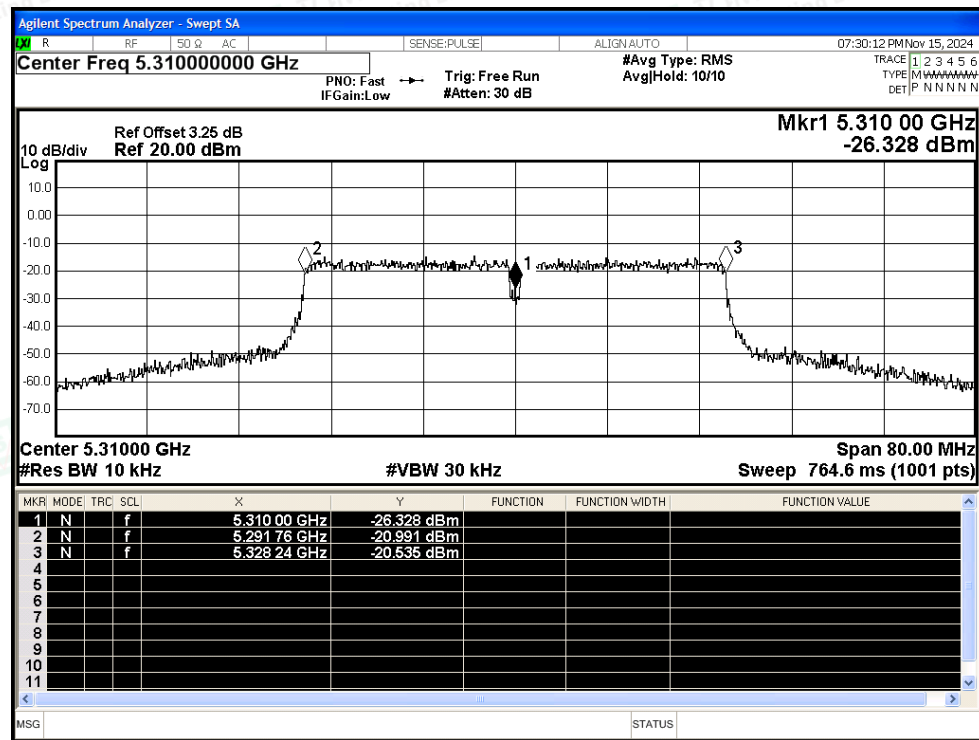


## Freq. Stability NVNT ax80 5290MHz Ant4

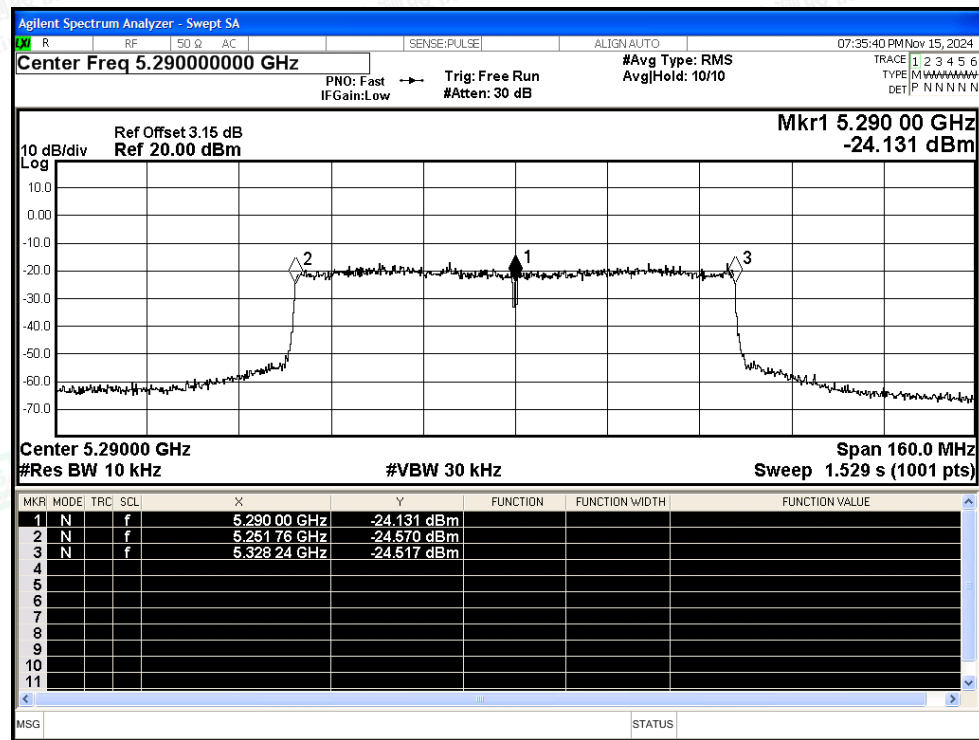




## Freq. Stability NVNT ac160 5250MHz Ant4

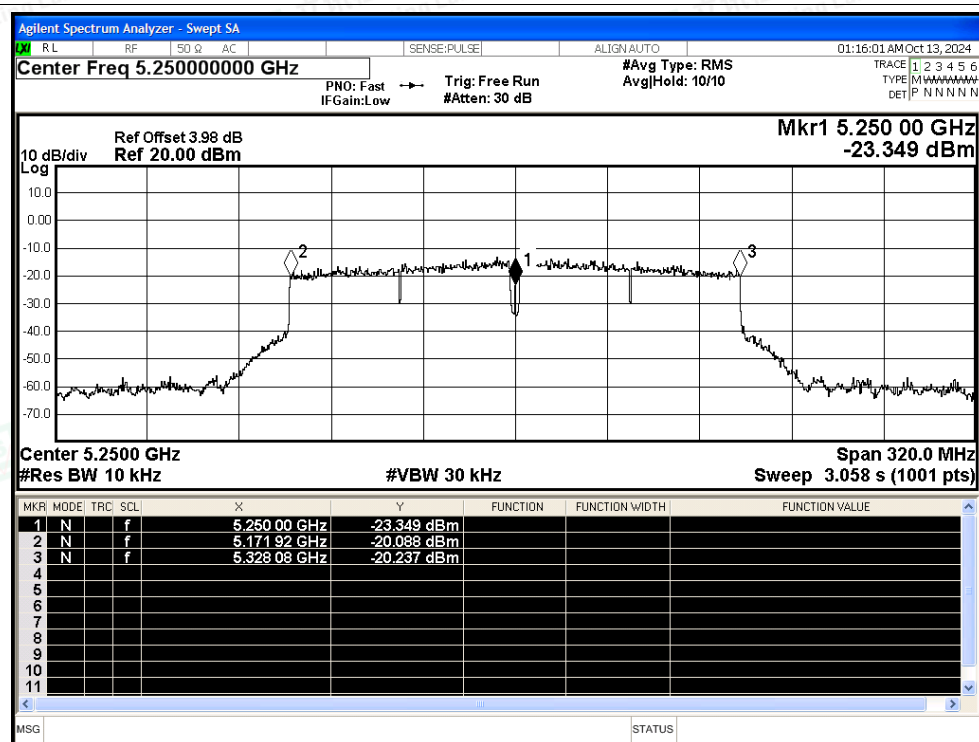

## Freq. Stability NVNT ax160 5250MHz Ant4

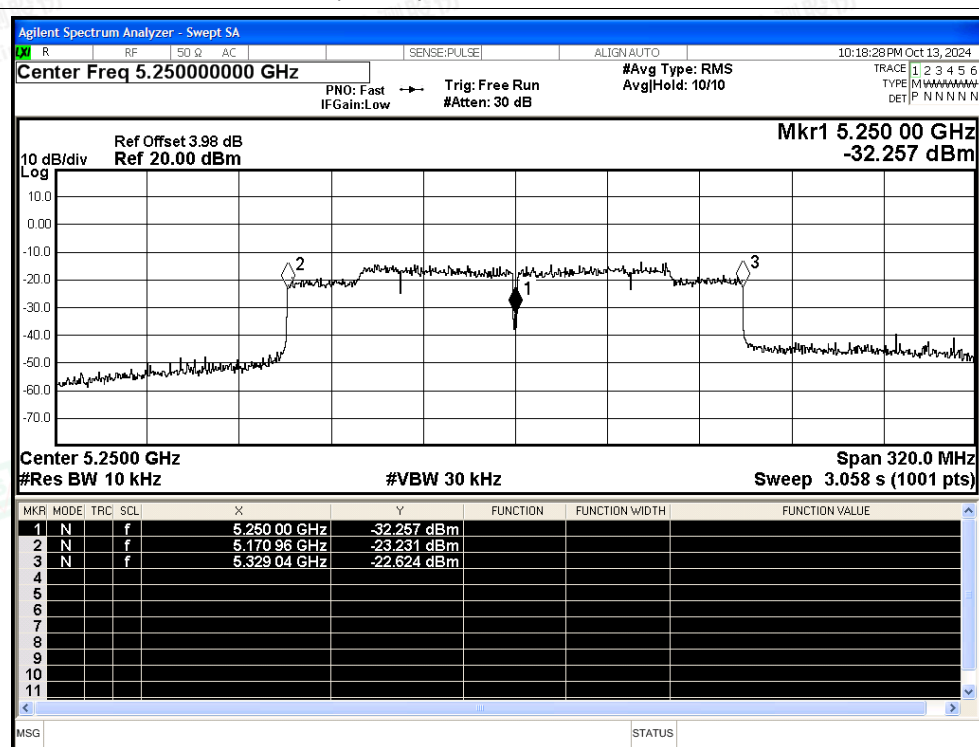



## C.6 Duty Cycle


| Condition | Mode  | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|-------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a     | 5260            | Ant3    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a     | 5300            | Ant3    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a     | 5320            | Ant3    | 94.56          | 0.24                   | 0.91      |
| NVNT      | n20   | 5260            | Ant3    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n20   | 5300            | Ant3    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n20   | 5320            | Ant3    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n40   | 5270            | Ant3    | 97.23          | 0.12                   | 0.46      |
| NVNT      | n40   | 5310            | Ant3    | 97.23          | 0.12                   | 0.46      |
| NVNT      | ac20  | 5260            | Ant3    | 97.3           | 0.12                   | 0.44      |
| NVNT      | ac20  | 5300            | Ant3    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac20  | 5320            | Ant3    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac40  | 5270            | Ant3    | 97.23          | 0.12                   | 0.46      |
| NVNT      | ac40  | 5310            | Ant3    | 97.23          | 0.12                   | 0.46      |
| NVNT      | ac80  | 5290            | Ant3    | 94.32          | 0.25                   | 0.97      |
| NVNT      | ax20  | 5260            | Ant3    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax20  | 5300            | Ant3    | 97.3           | 0.12                   | 0.44      |
| NVNT      | ax20  | 5320            | Ant3    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax40  | 5270            | Ant3    | 97.24          | 0.12                   | 0.46      |
| NVNT      | ax40  | 5310            | Ant3    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ax80  | 5290            | Ant3    | 94.32          | 0.25                   | 0.97      |
| NVNT      | ac160 | 5250            | Ant3    | 94.44          | 0.25                   | 1.03      |
| NVNT      | ax160 | 5250            | Ant3    | 86.63          | 0.62                   | 3.22      |






## Test Graphs

## Duty Cycle NVNT a 5260MHz Ant3

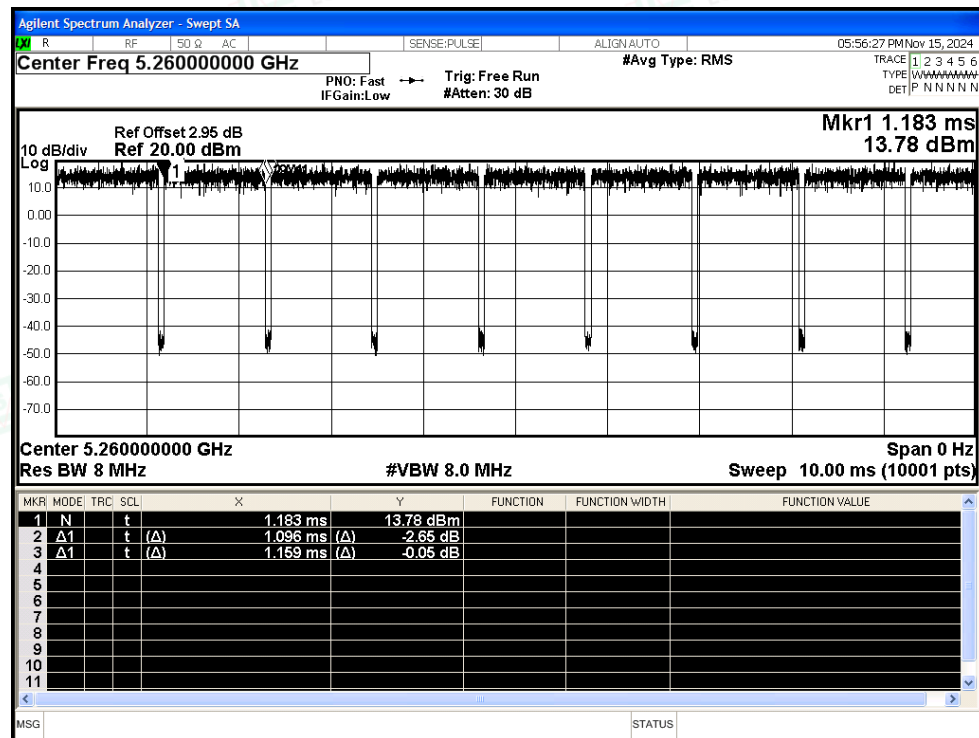

## Duty Cycle NVNT a 5300MHz Ant3

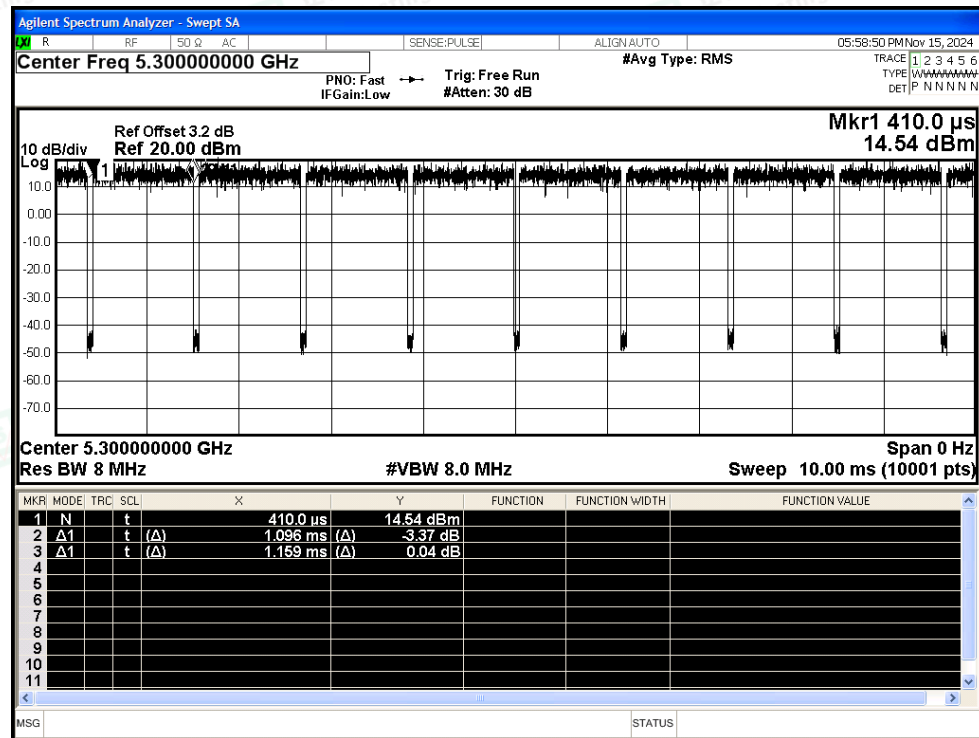

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity





## Duty Cycle NVNT a 5320MHz Ant3

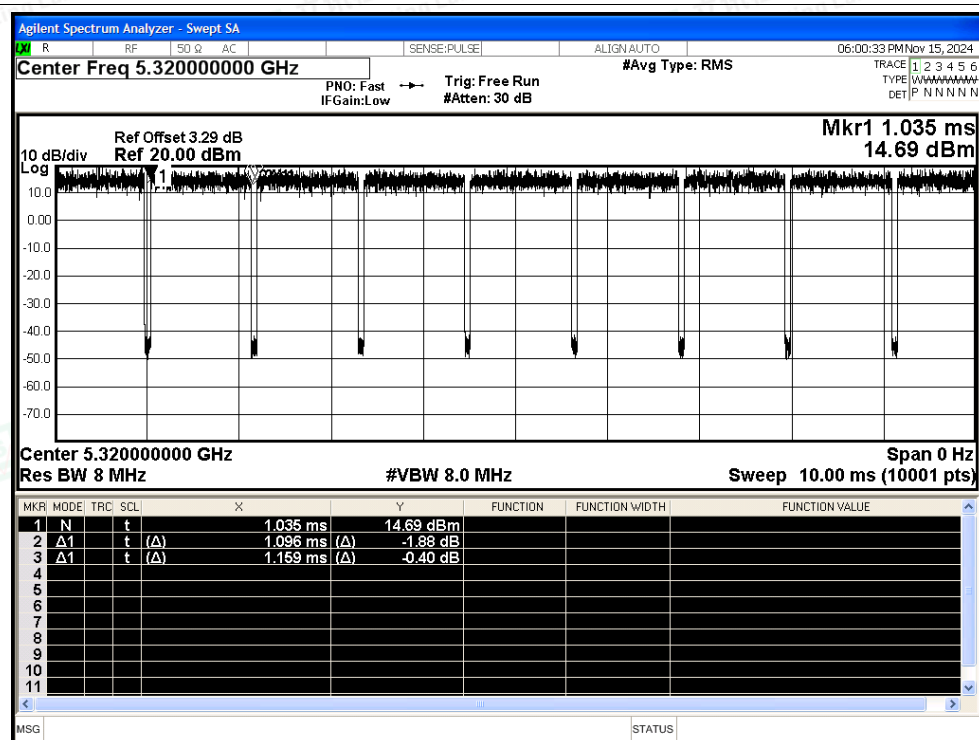

## Duty Cycle NVNT n20 5260MHz Ant3

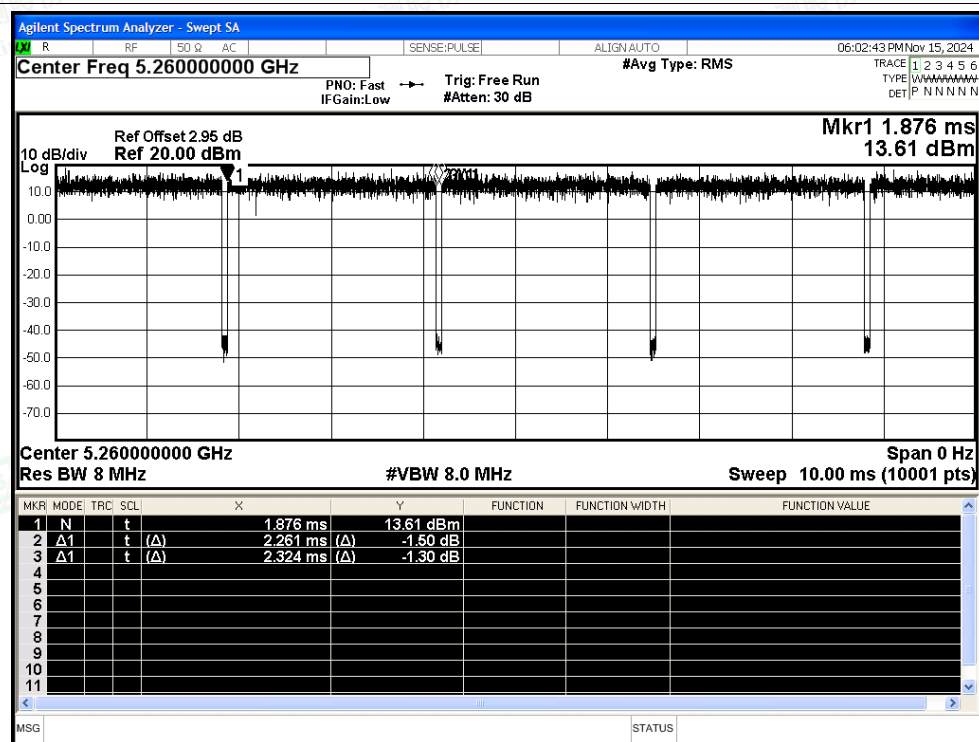




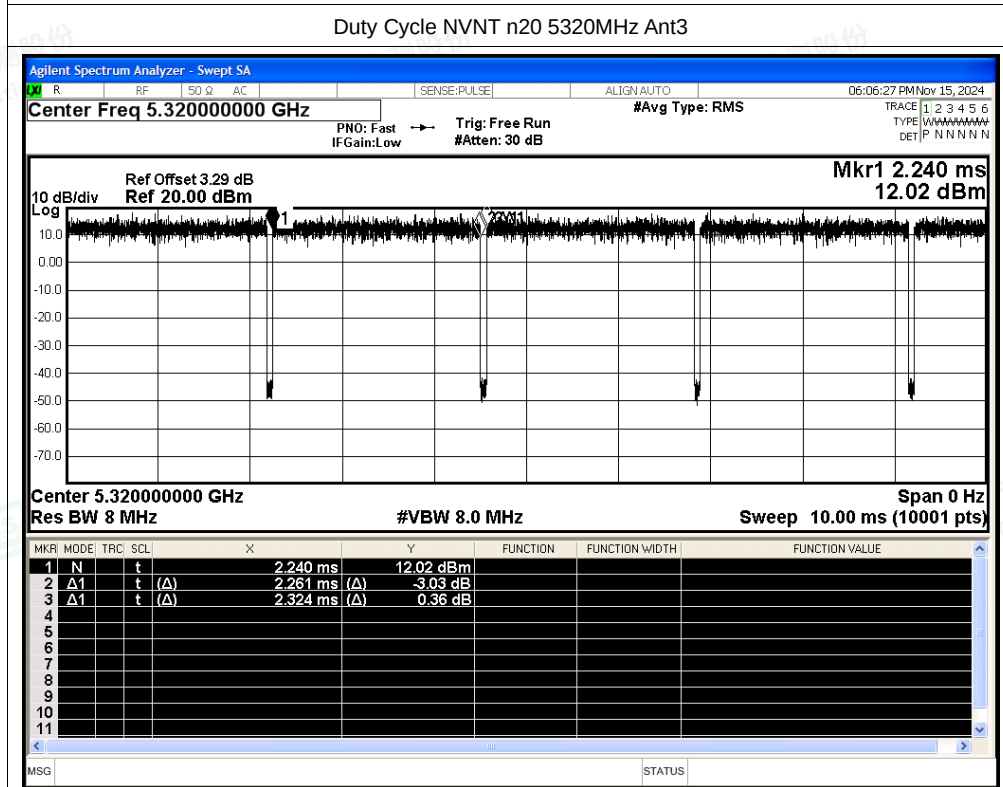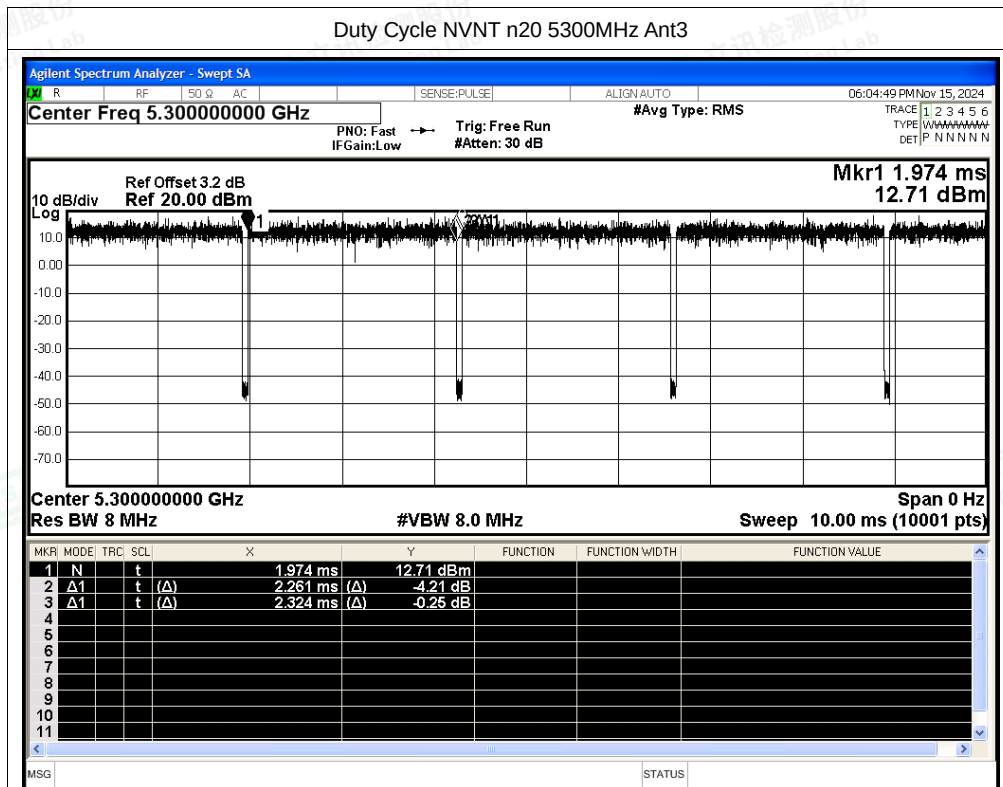




## Duty Cycle NVNT n40 5270MHz Ant3

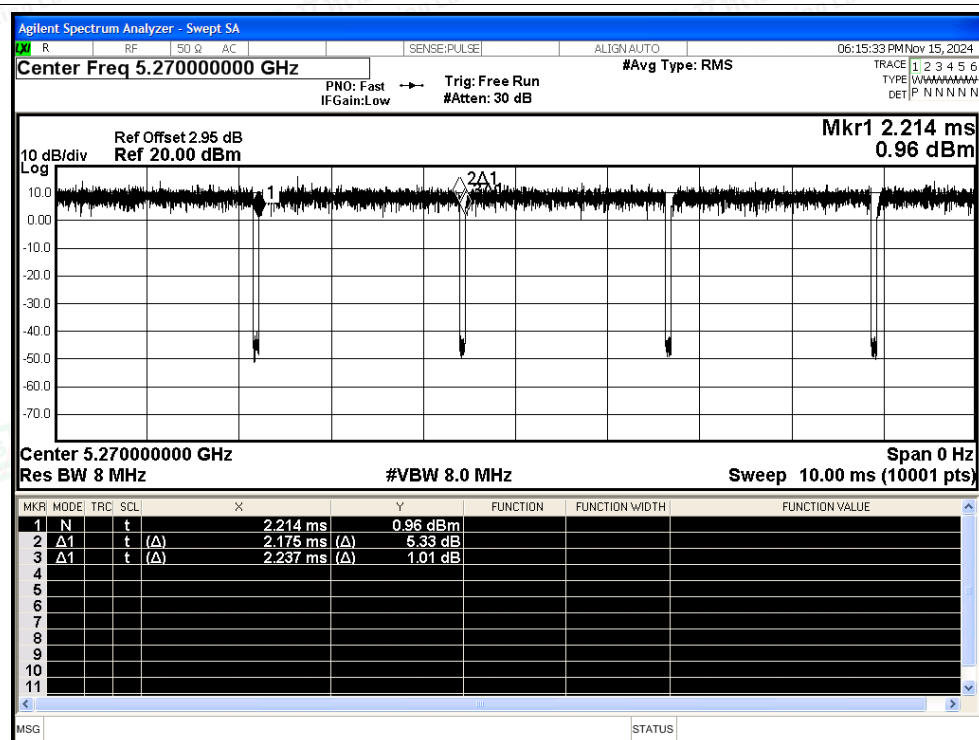


## Duty Cycle NVNT n40 5310MHz Ant3

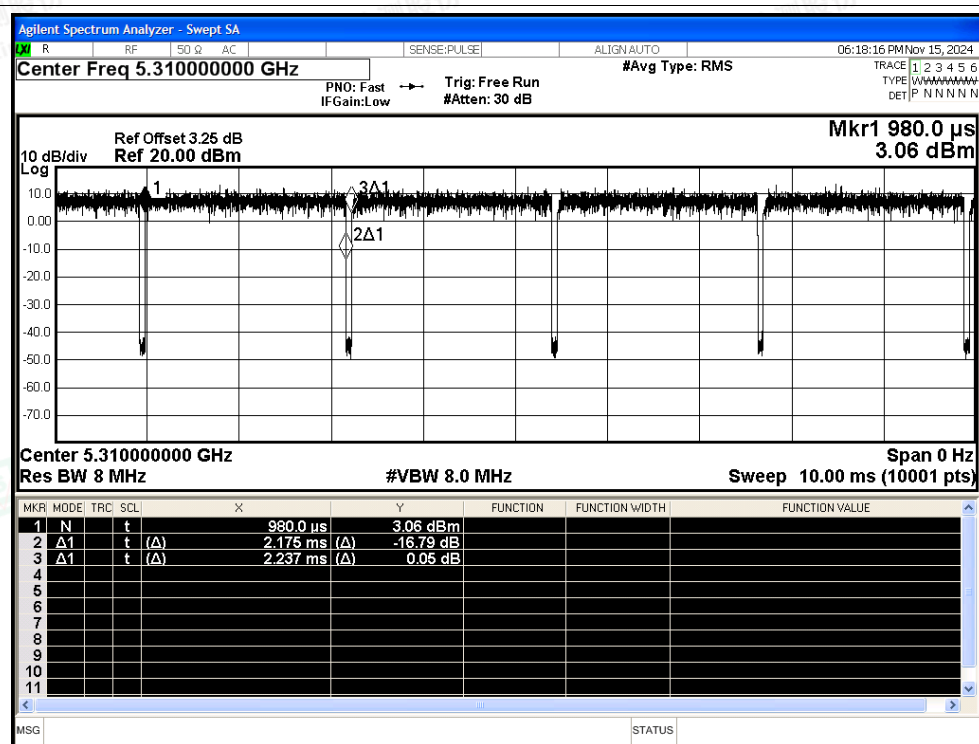




## Duty Cycle NVNT ac20 5260MHz Ant3

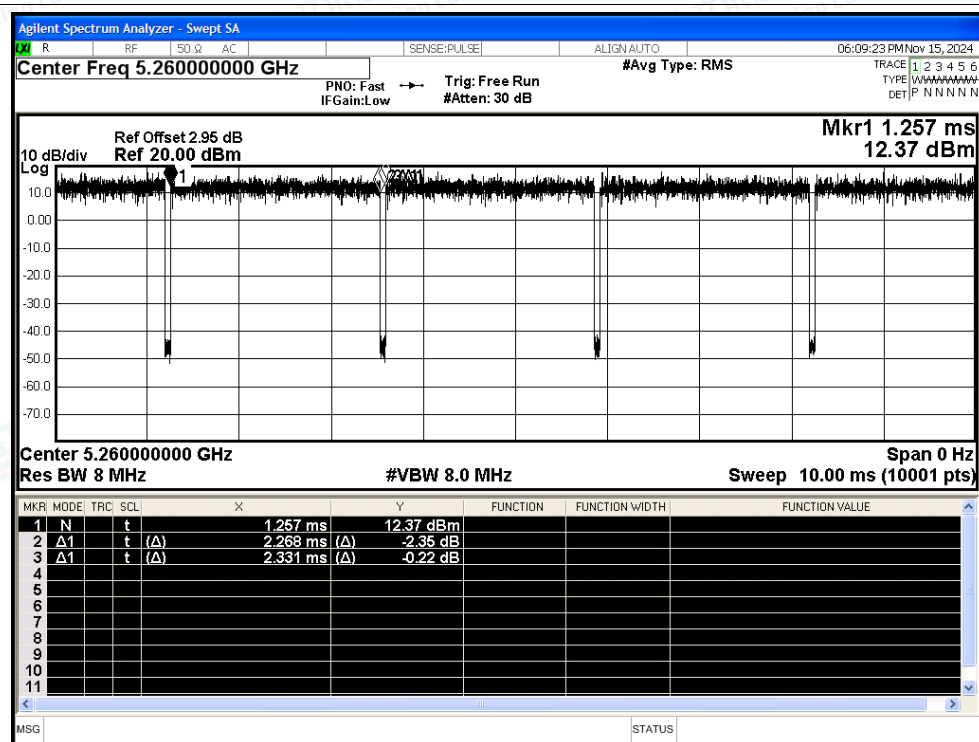


## Duty Cycle NVNT ac20 5300MHz Ant3

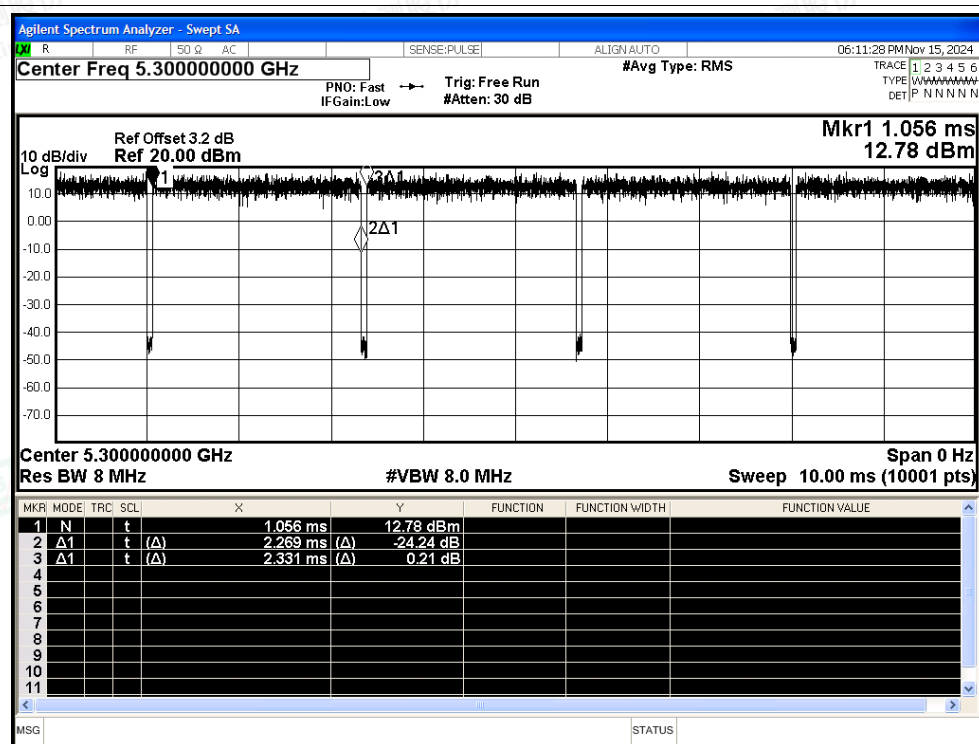




## Duty Cycle NVNT ac20 5320MHz Ant3

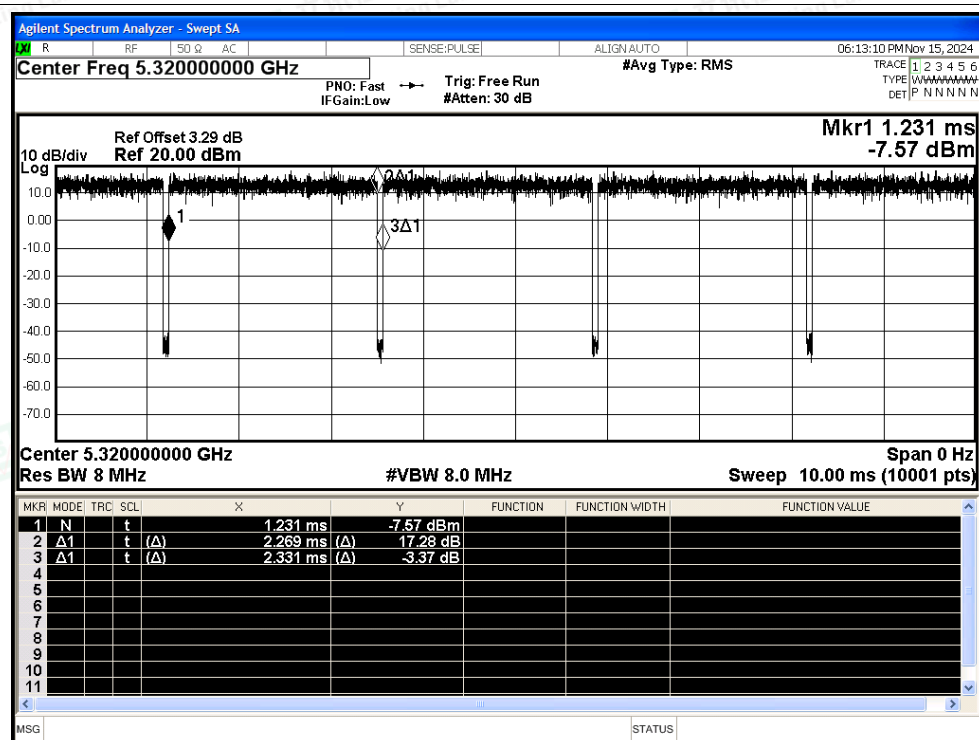


## Duty Cycle NVNT ac40 5270MHz Ant3

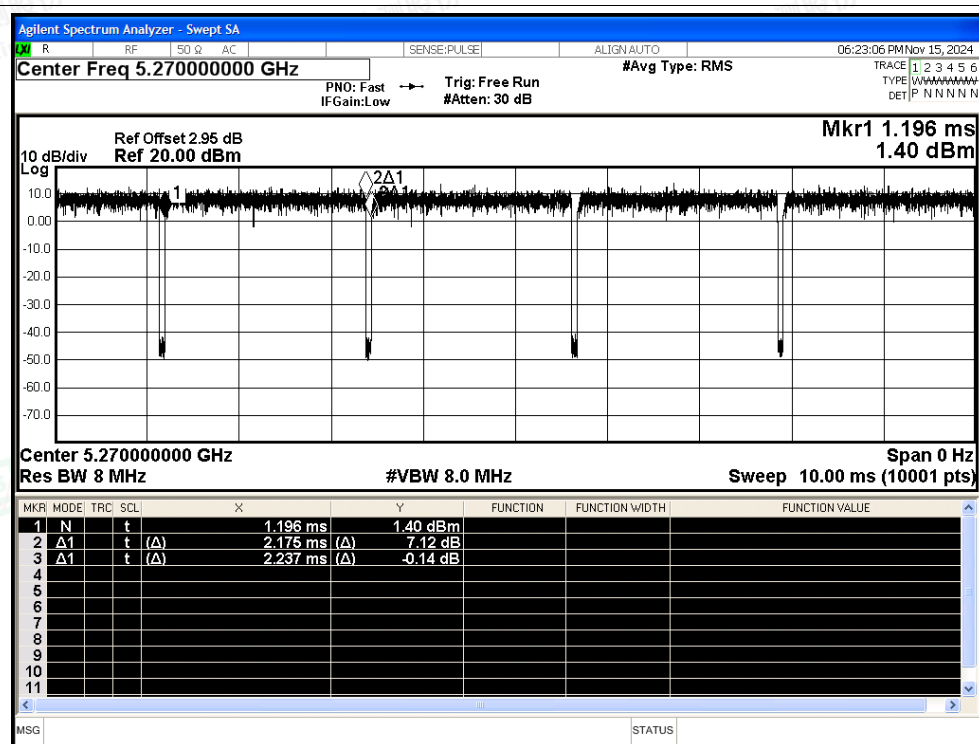




## Duty Cycle NVNT ac40 5310MHz Ant3

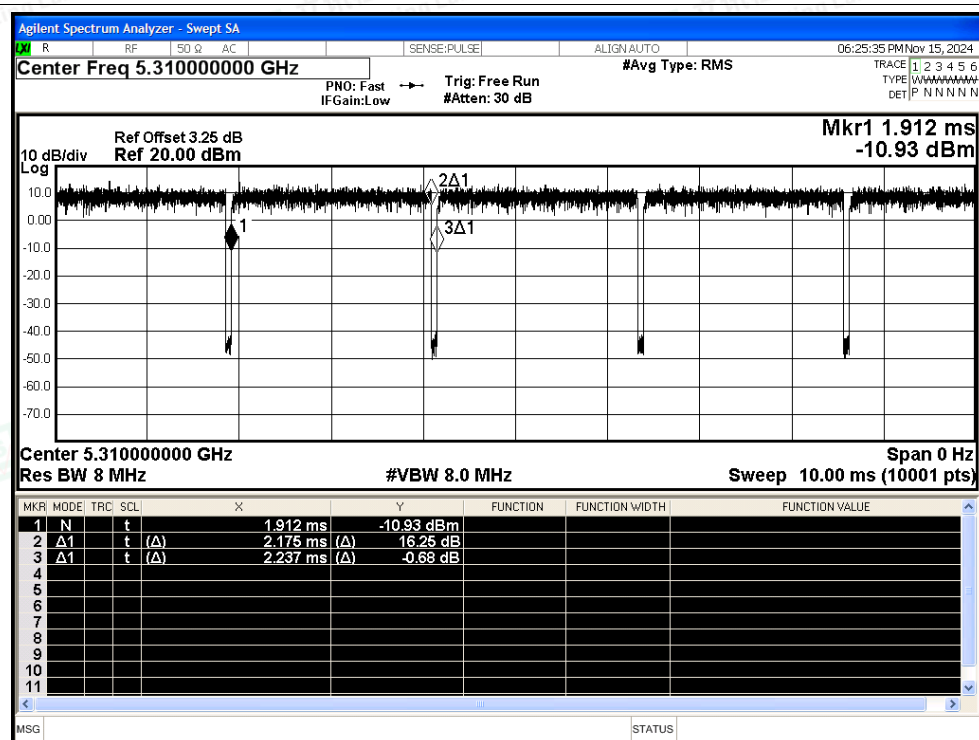

## Duty Cycle NVNT ac80 5290MHz Ant3

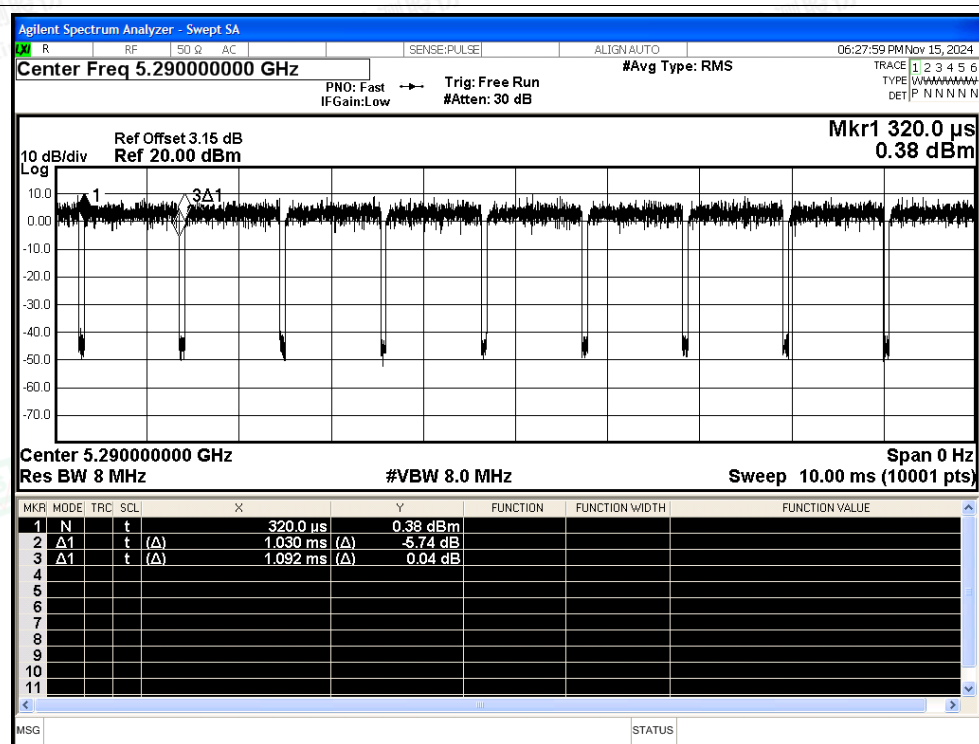

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5260MHz Ant3

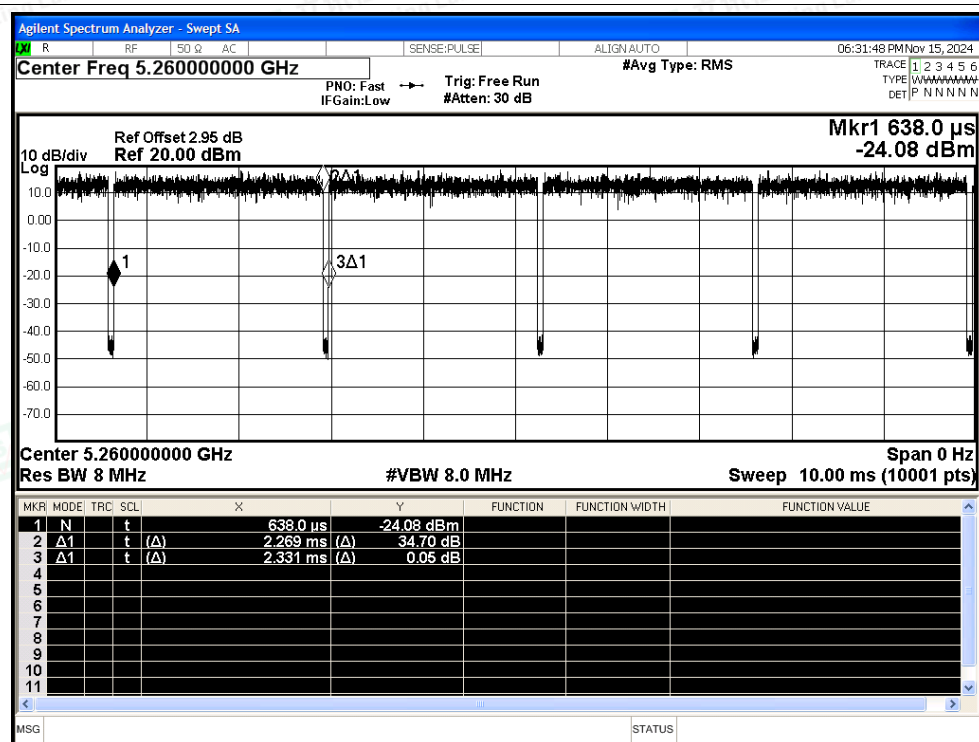


## Duty Cycle NVNT ax20 5300MHz Ant3

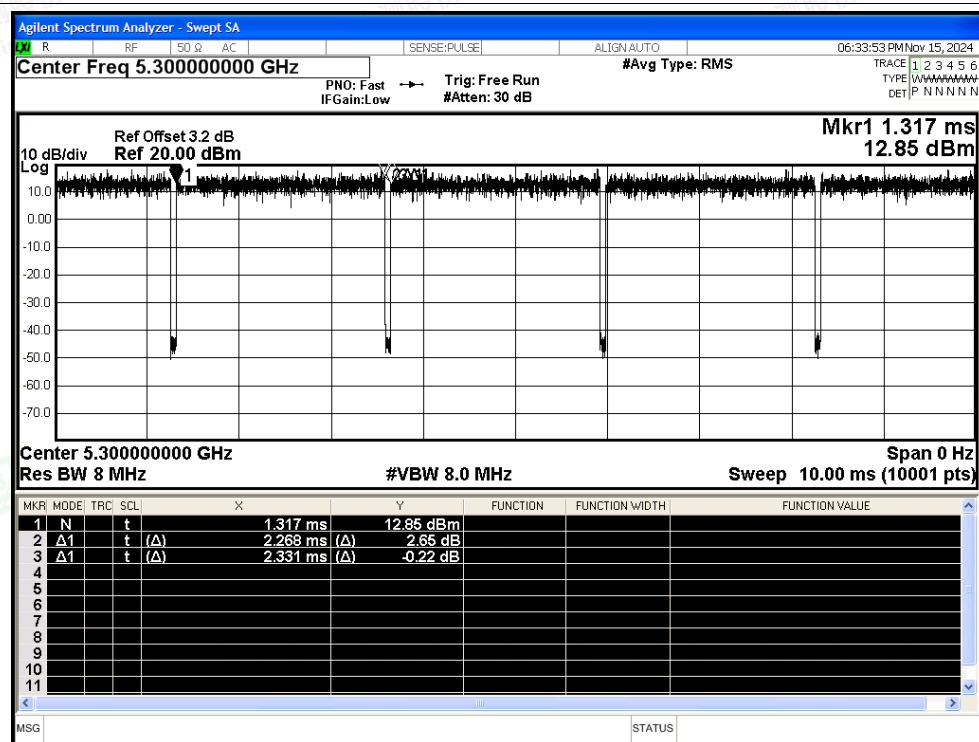




## Duty Cycle NVNT ax20 5320MHz Ant3

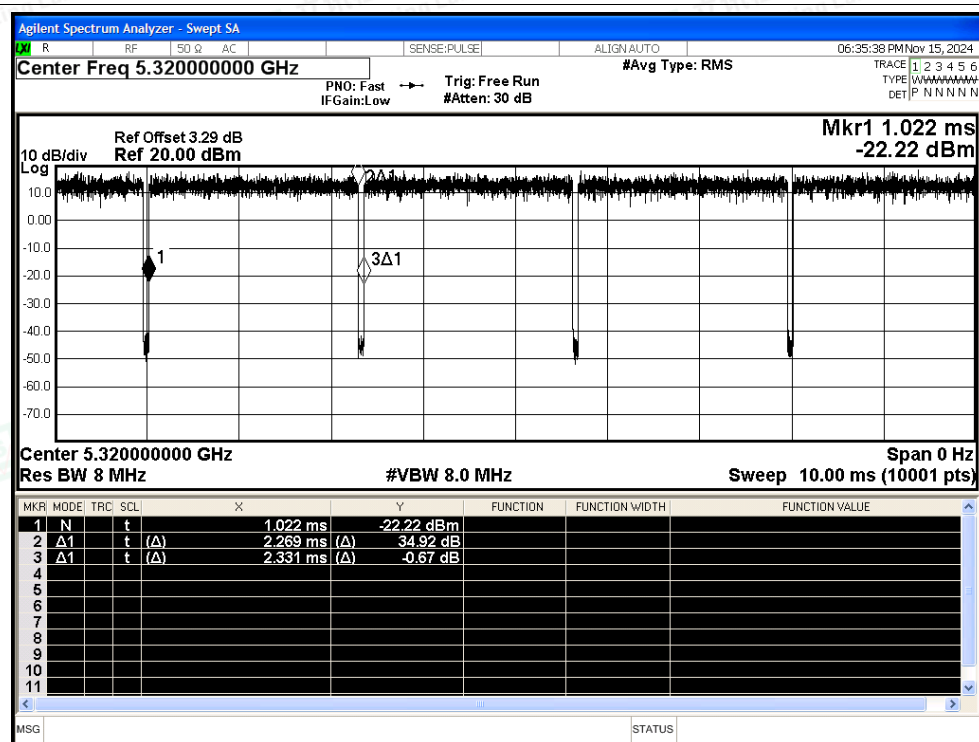


## Duty Cycle NVNT ax40 5270MHz Ant3

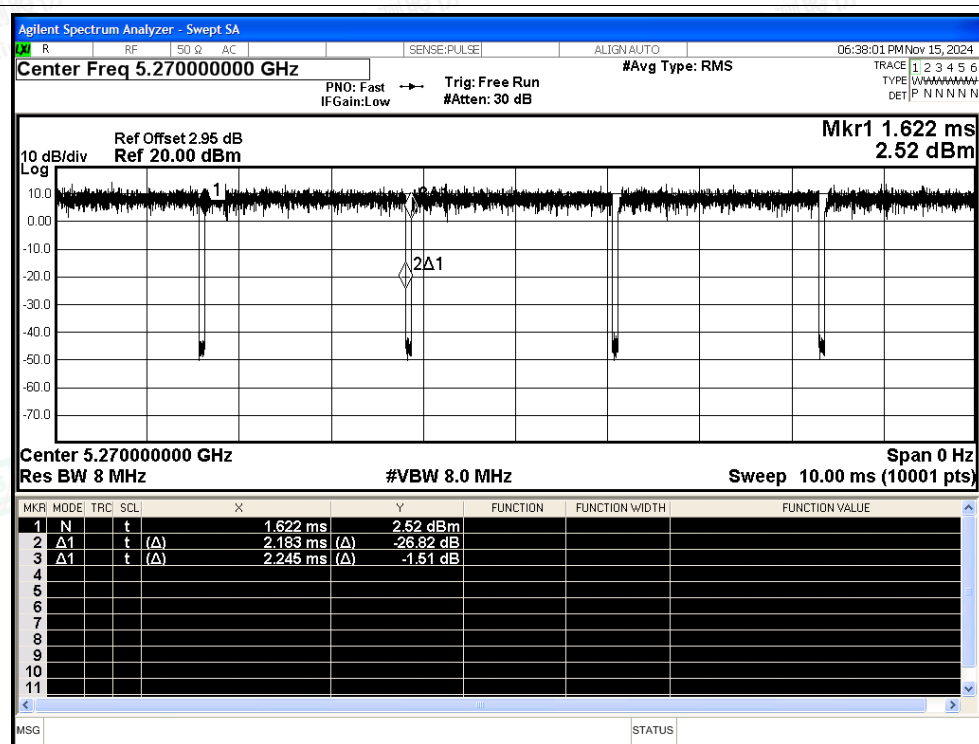






## Duty Cycle NVNT ax40 5310MHz Ant3

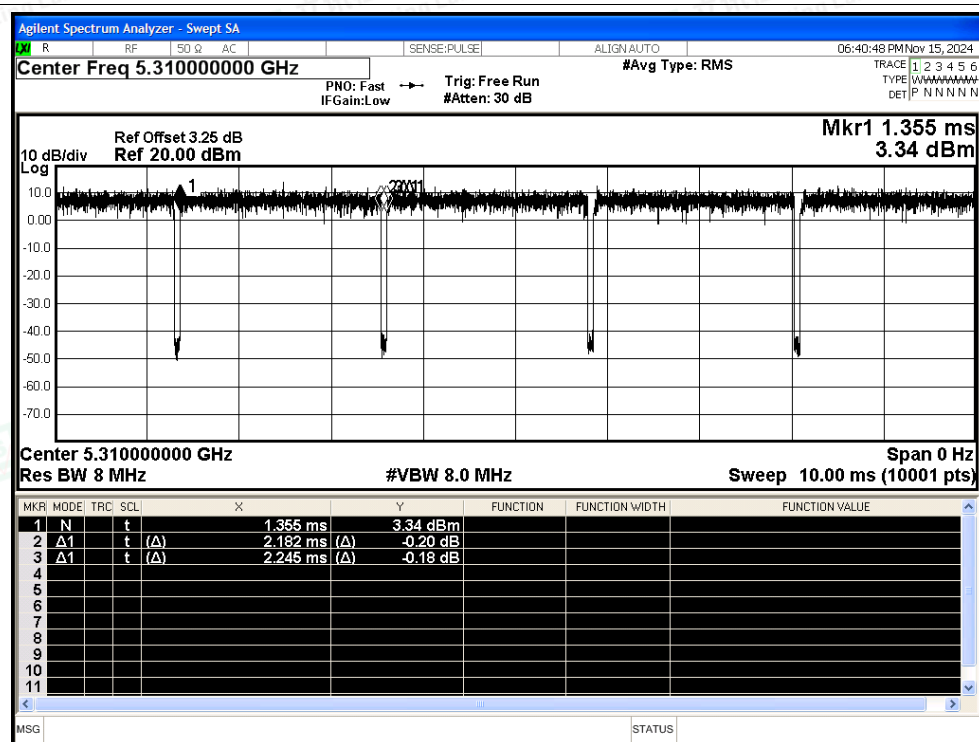

## Duty Cycle NVNT ax80 5290MHz Ant3

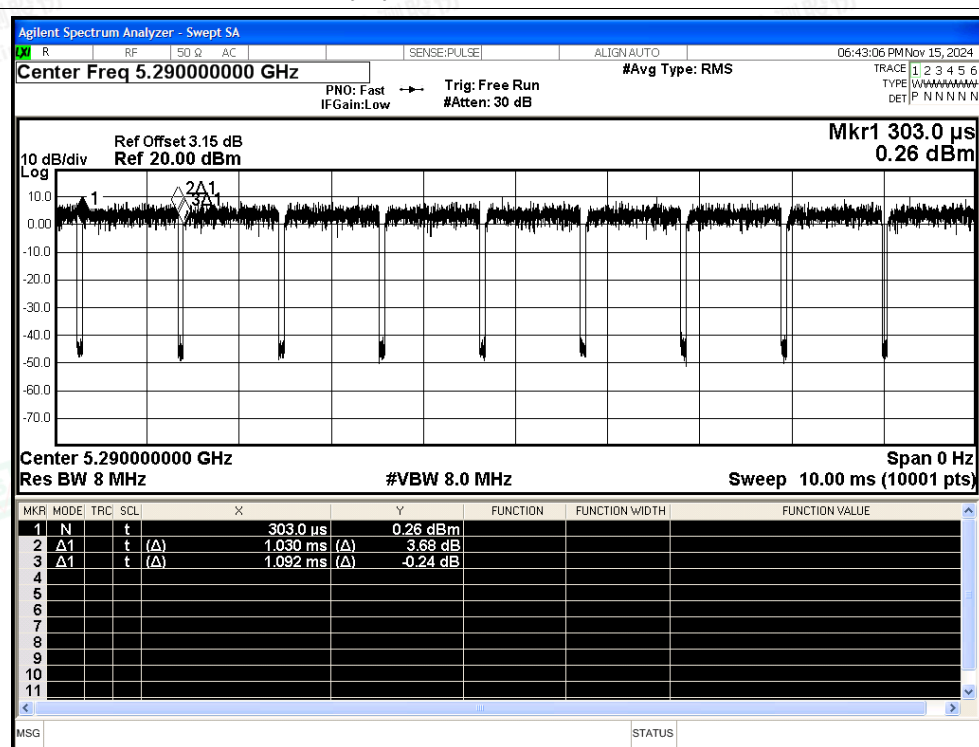

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac160 5250MHz Ant3

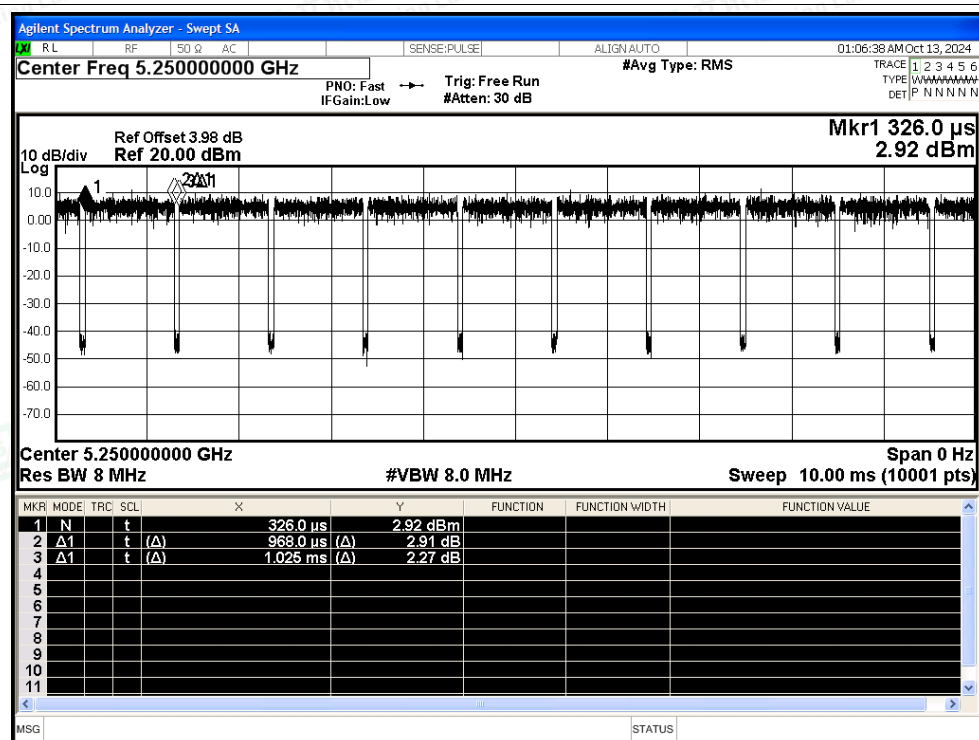

## Duty Cycle NVNT ax160 5250MHz Ant3

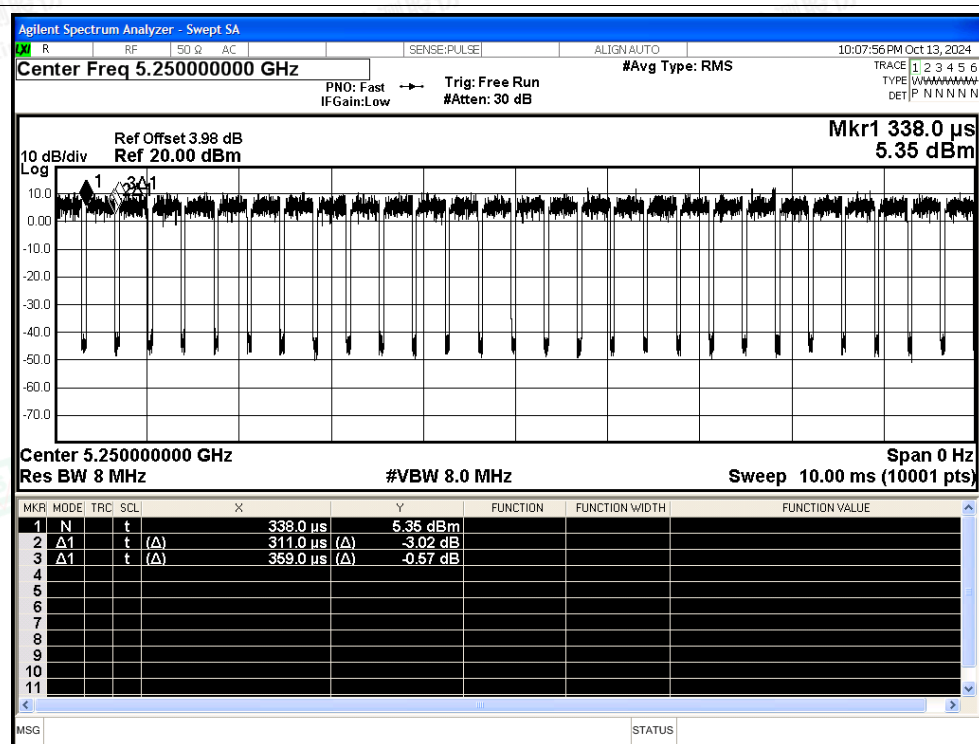




| Condition | Mode  | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|-------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a     | 5260            | Ant4    | 94.65          | 0.24                   | 0.91      |
| NVNT      | a     | 5300            | Ant4    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a     | 5320            | Ant4    | 94.56          | 0.24                   | 0.91      |
| NVNT      | n20   | 5260            | Ant4    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n20   | 5300            | Ant4    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n20   | 5320            | Ant4    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n40   | 5270            | Ant4    | 97.23          | 0.12                   | 0.46      |
| NVNT      | n40   | 5310            | Ant4    | 97.18          | 0.12                   | 0.46      |
| NVNT      | ac20  | 5260            | Ant4    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac20  | 5300            | Ant4    | 97.3           | 0.12                   | 0.44      |
| NVNT      | ac20  | 5320            | Ant4    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac40  | 5270            | Ant4    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ac40  | 5310            | Ant4    | 97.24          | 0.12                   | 0.46      |
| NVNT      | ac80  | 5290            | Ant4    | 94.32          | 0.25                   | 0.97      |
| NVNT      | ax20  | 5260            | Ant4    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax20  | 5300            | Ant4    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax20  | 5320            | Ant4    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax40  | 5270            | Ant4    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ax40  | 5310            | Ant4    | 97.24          | 0.12                   | 0.46      |
| NVNT      | ax80  | 5290            | Ant4    | 94.32          | 0.25                   | 0.97      |
| NVNT      | ac160 | 5250            | Ant4    | 94.53          | 0.24                   | 1.03      |
| NVNT      | ax160 | 5250            | Ant4    | 86.59          | 0.63                   | 3.23      |






## Test Graphs

## Duty Cycle NVNT a 5260MHz Ant4

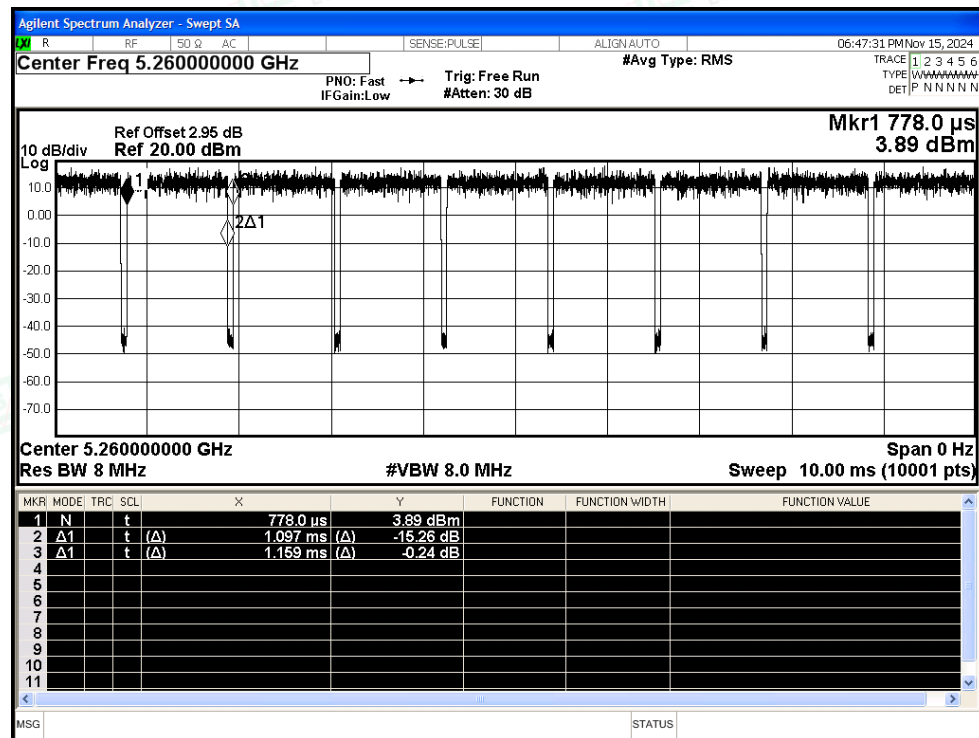

## Duty Cycle NVNT a 5300MHz Ant4

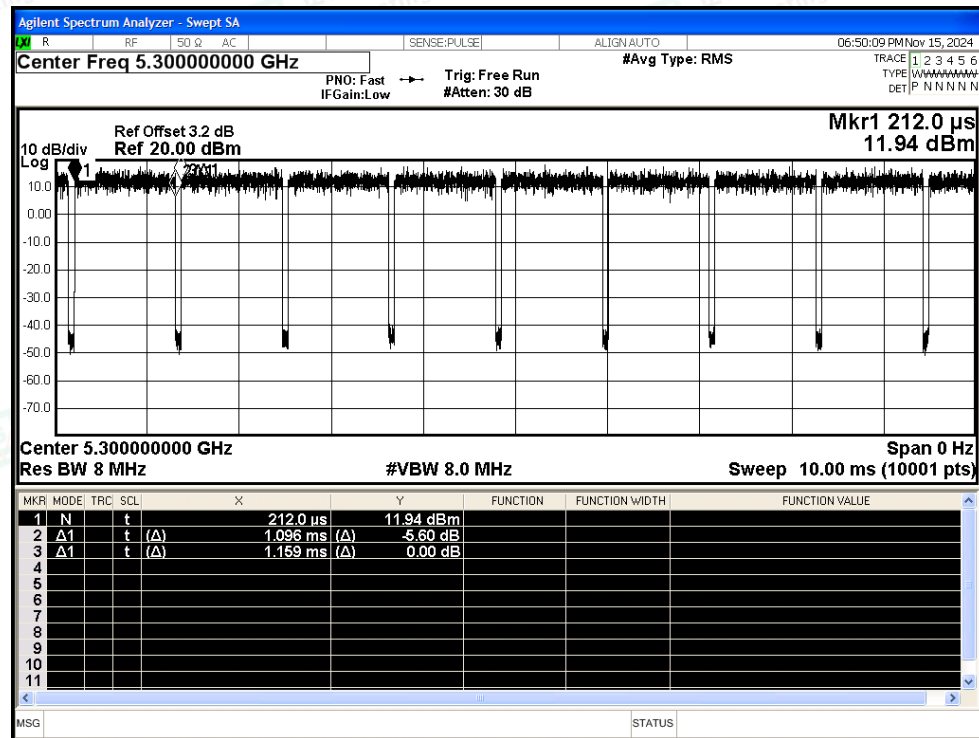

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT a 5320MHz Ant4

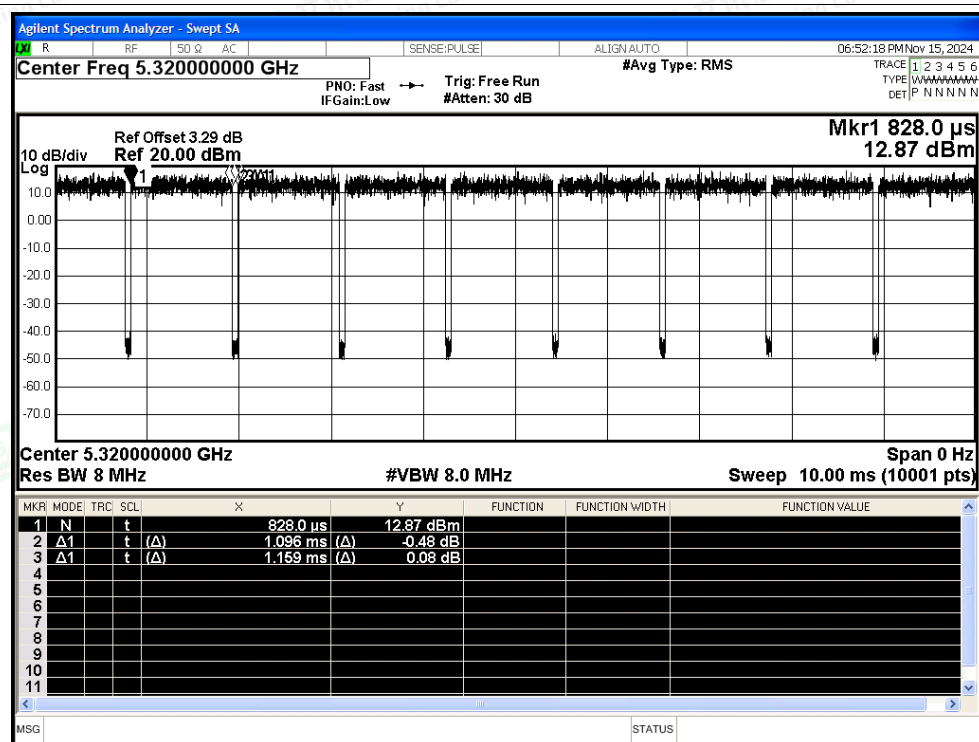


## Duty Cycle NVNT n20 5260MHz Ant4

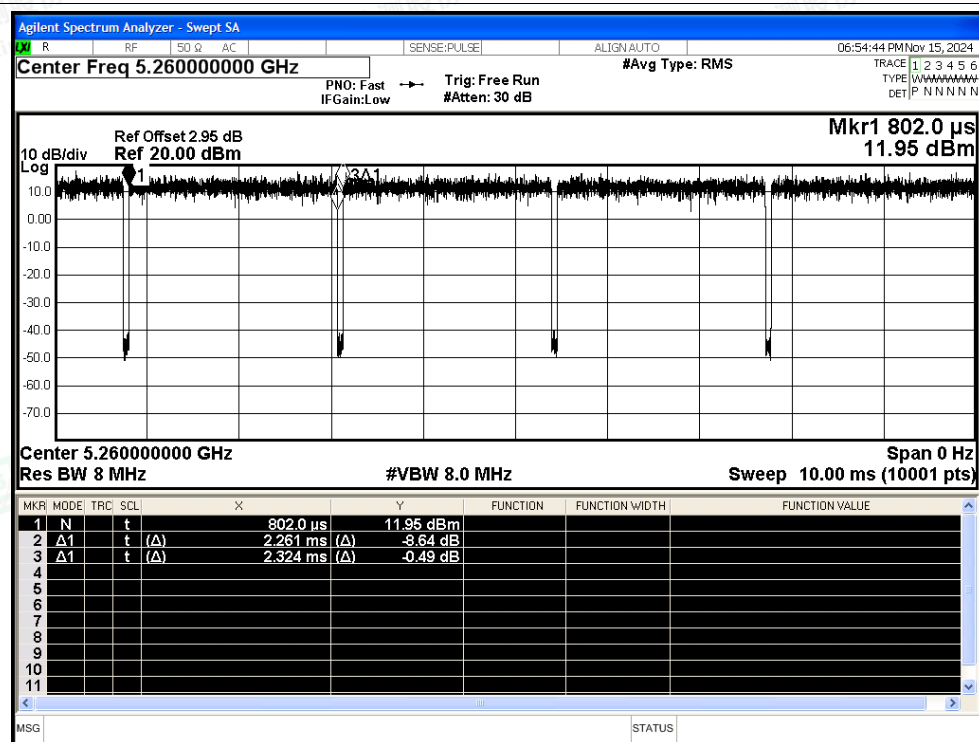




## Duty Cycle NVNT n20 5300MHz Ant4

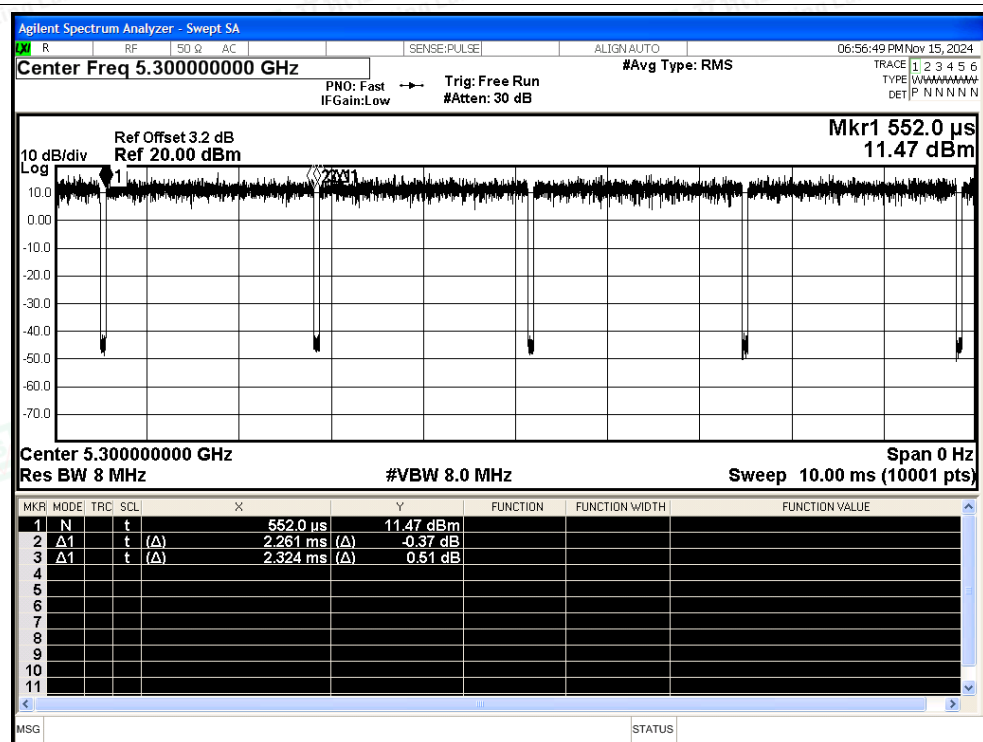


## Duty Cycle NVNT n20 5320MHz Ant4

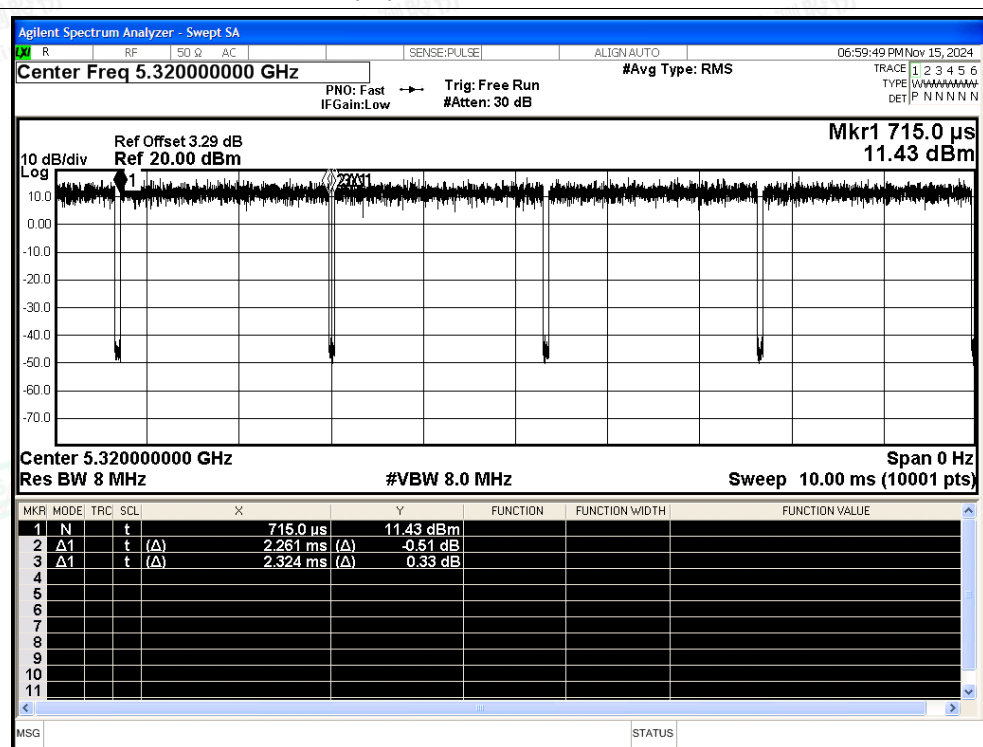




## Duty Cycle NVNT n40 5270MHz Ant4

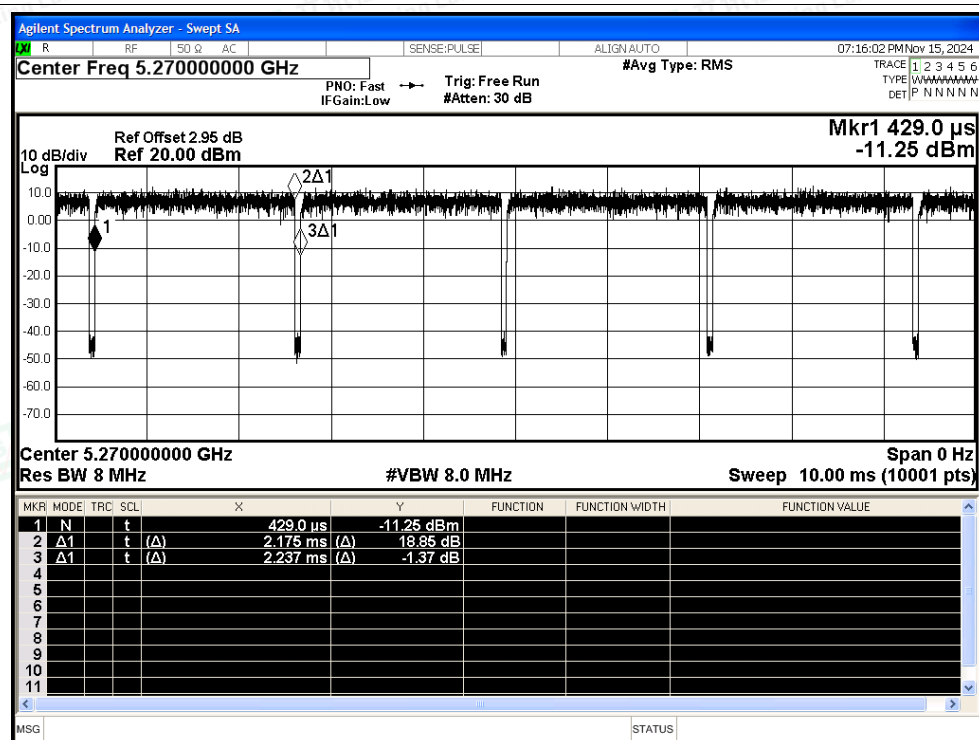


## Duty Cycle NVNT n40 5310MHz Ant4

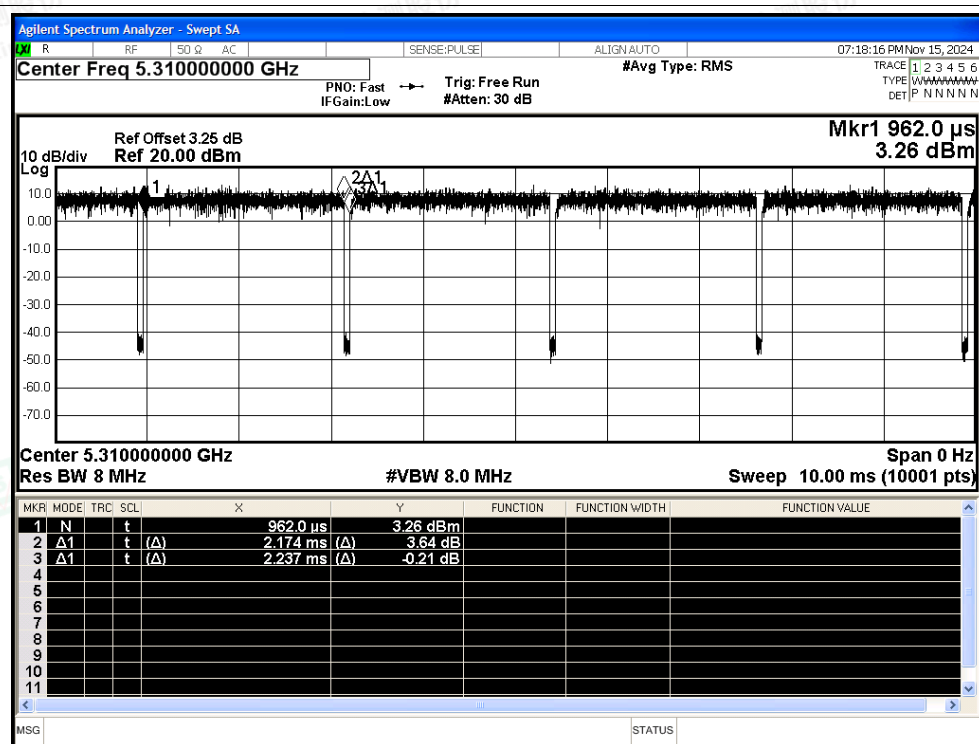






## Duty Cycle NVNT ac20 5260MHz Ant4

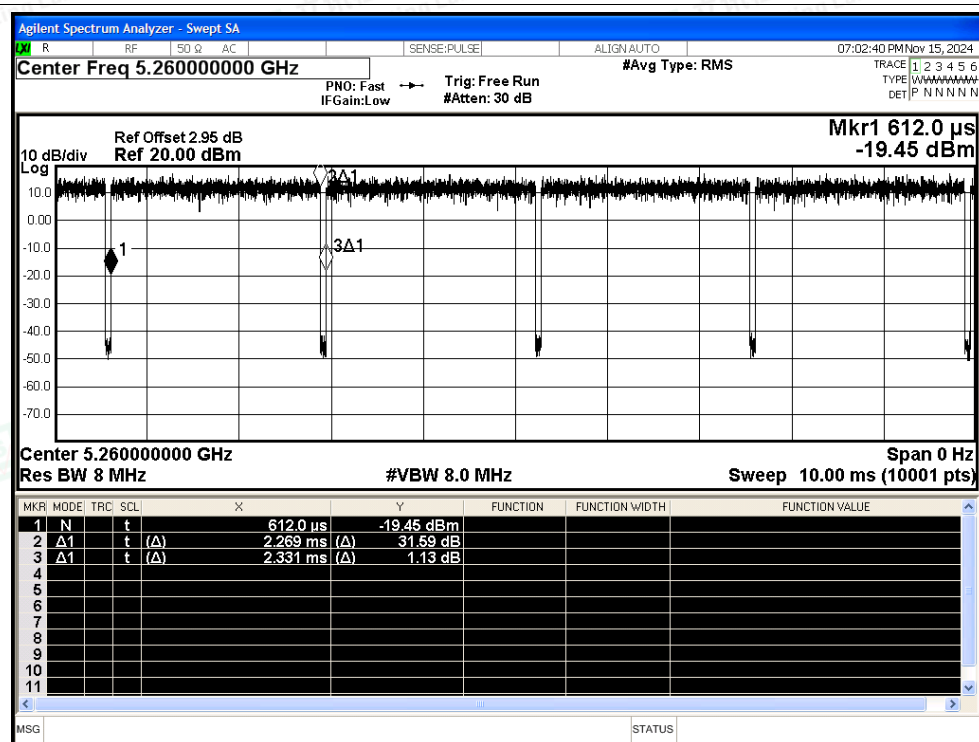


## Duty Cycle NVNT ac20 5300MHz Ant4

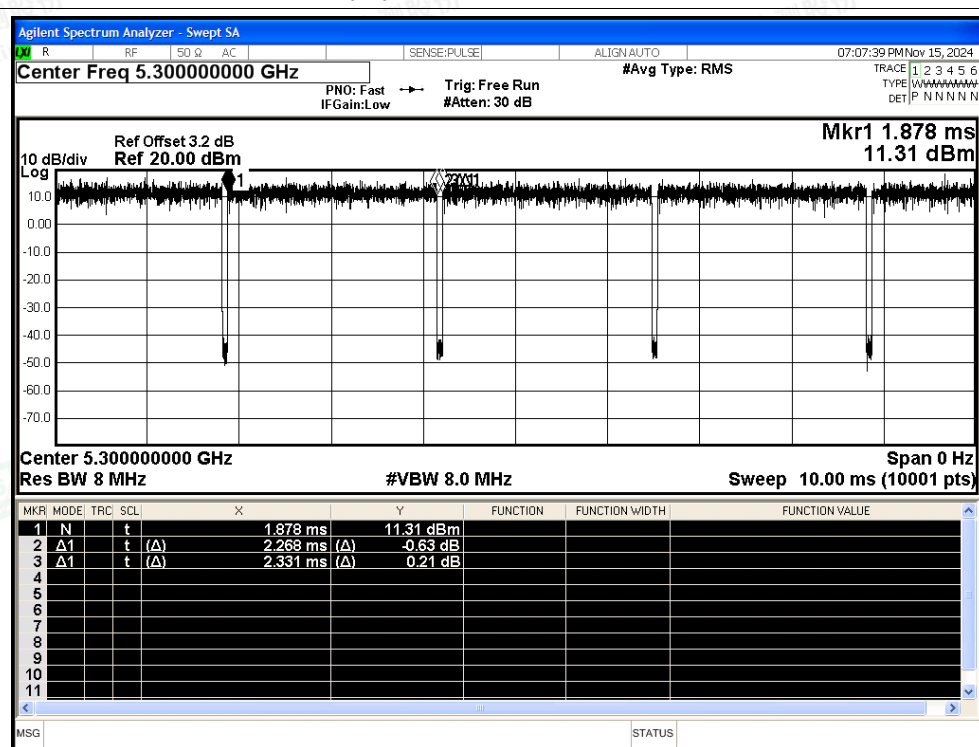




## Duty Cycle NVNT ac20 5320MHz Ant4

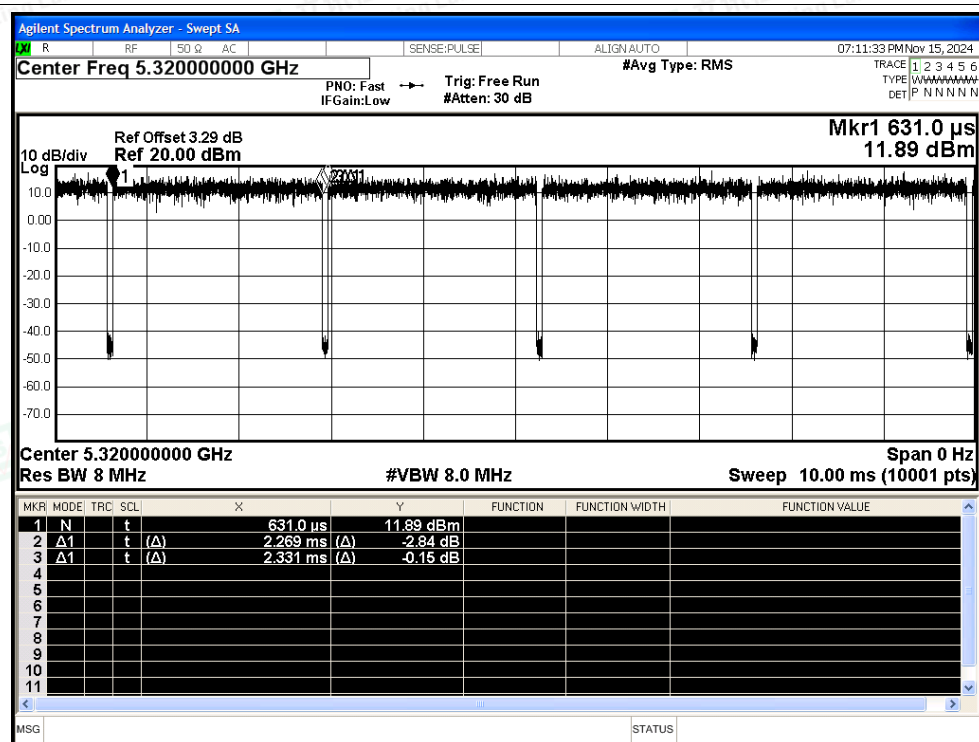


## Duty Cycle NVNT ac40 5270MHz Ant4

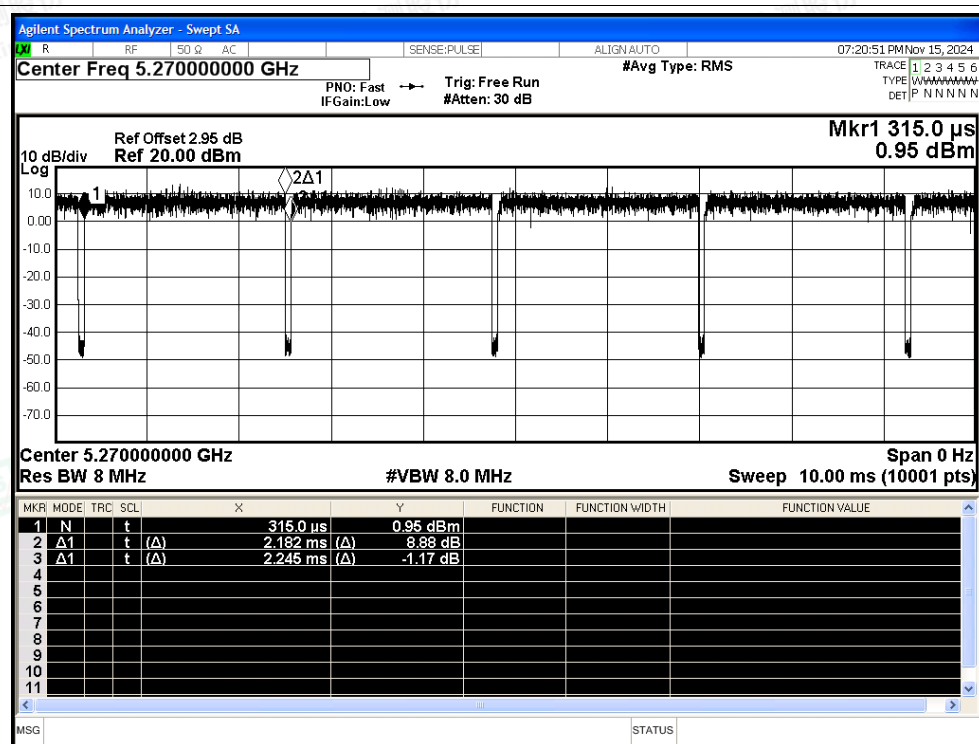




## Duty Cycle NVNT ac40 5310MHz Ant4

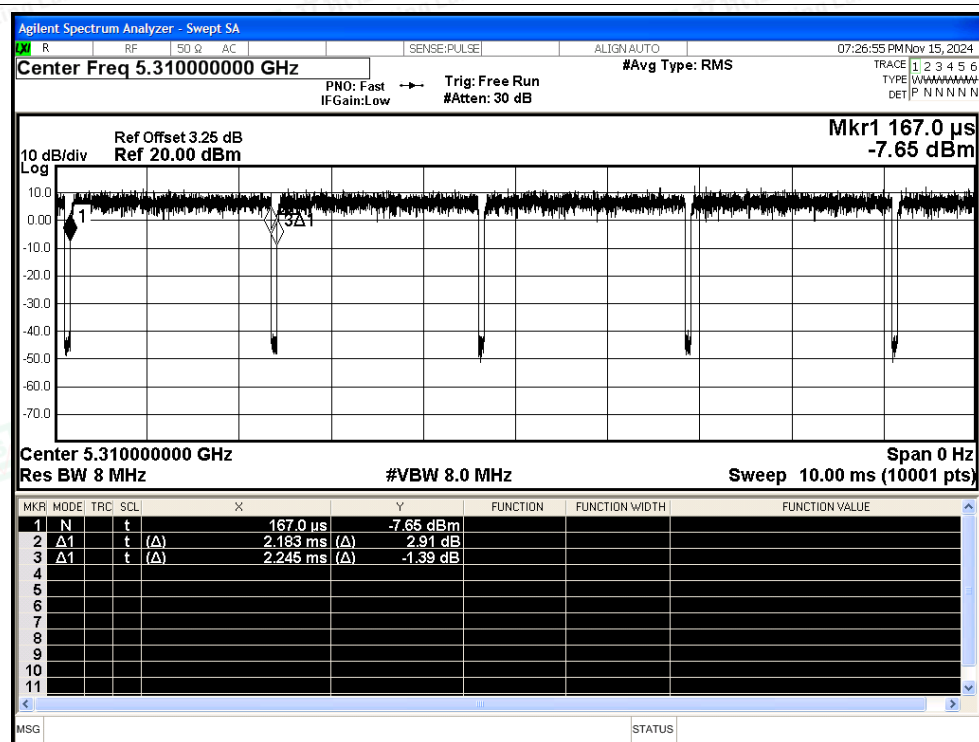


## Duty Cycle NVNT ac80 5290MHz Ant4

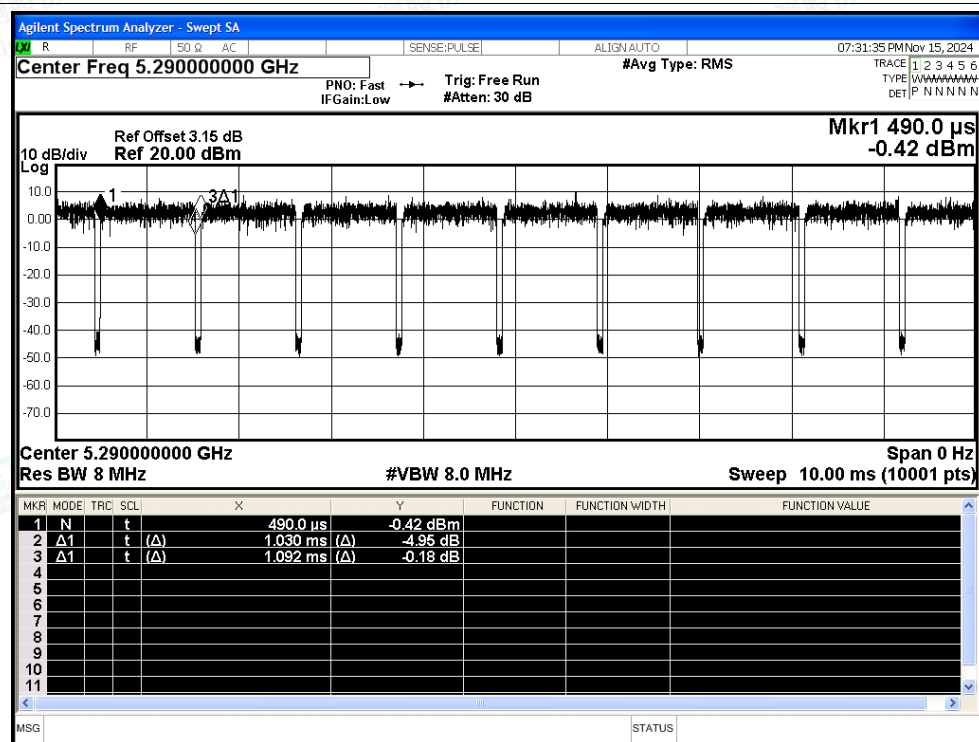




## Duty Cycle NVNT ax20 5260MHz Ant4

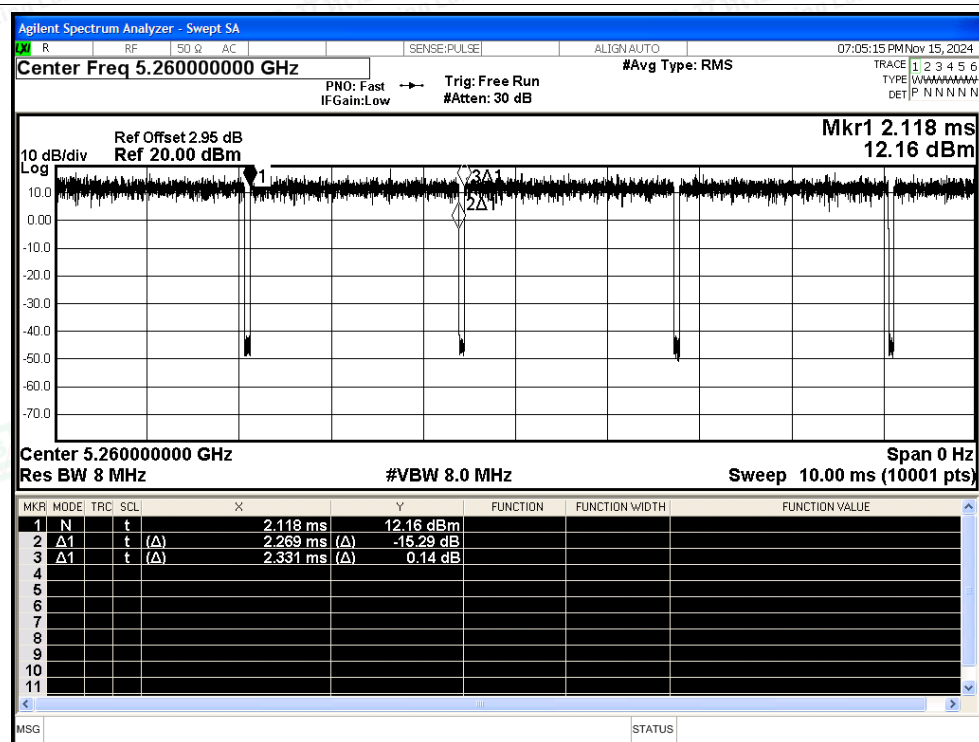


## Duty Cycle NVNT ax20 5300MHz Ant4

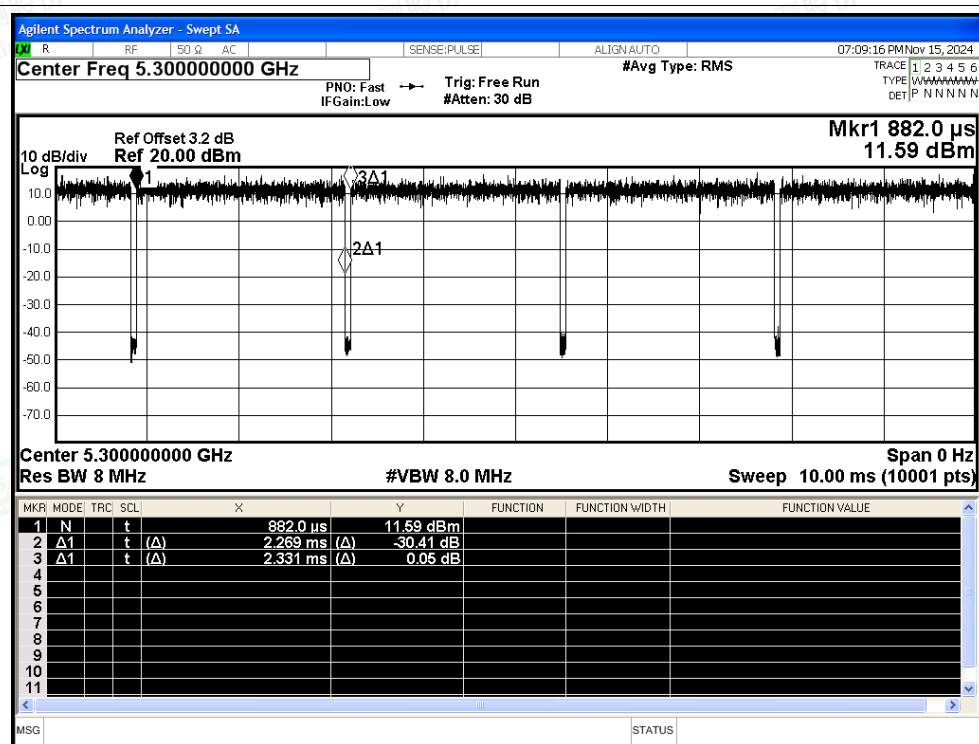




## Duty Cycle NVNT ax20 5320MHz Ant4

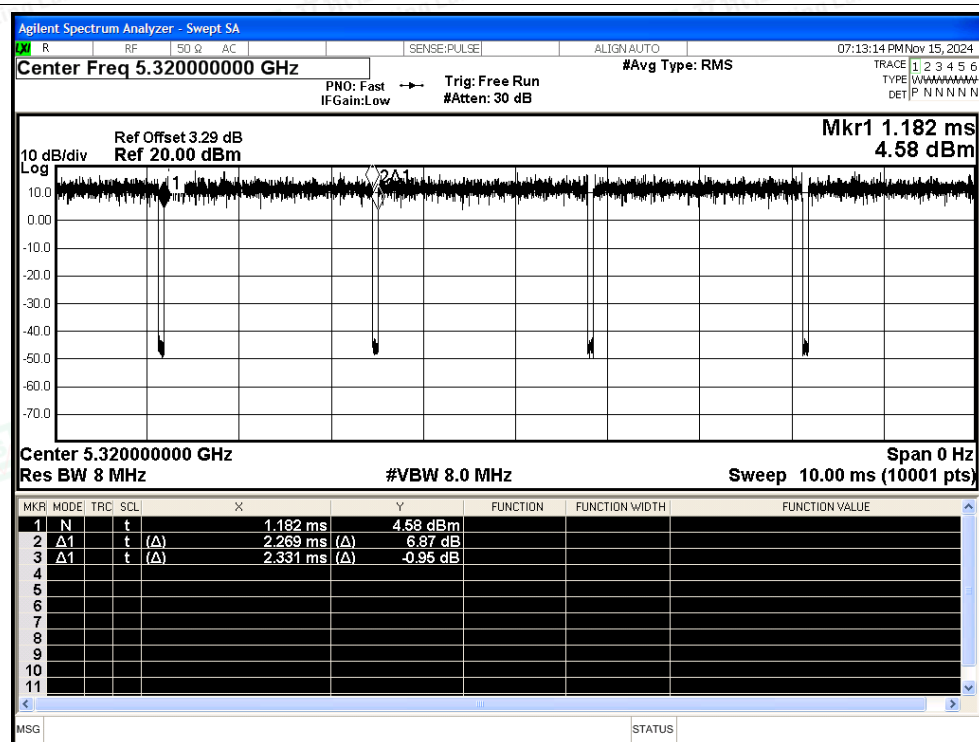


## Duty Cycle NVNT ax40 5270MHz Ant4

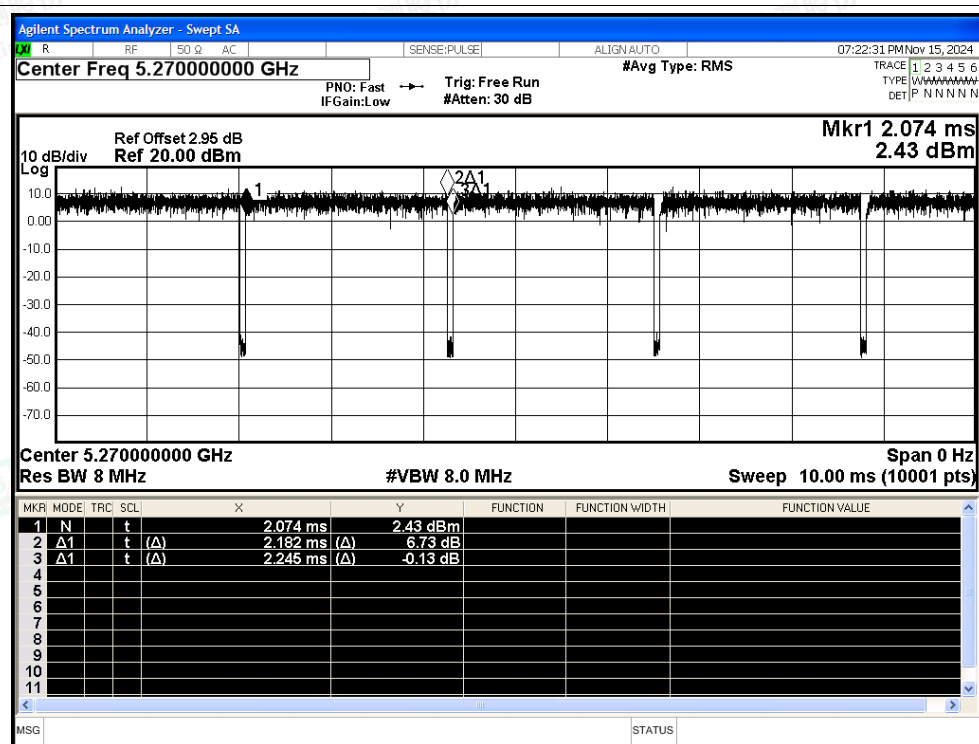




## Duty Cycle NVNT ax40 5310MHz Ant4

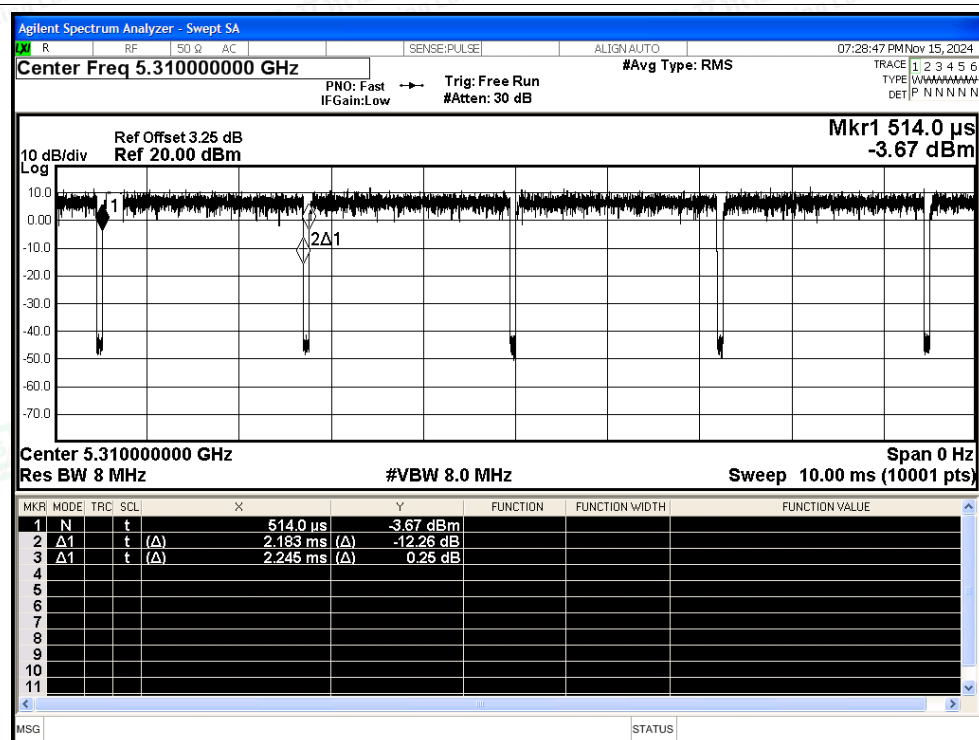


## Duty Cycle NVNT ax80 5290MHz Ant4

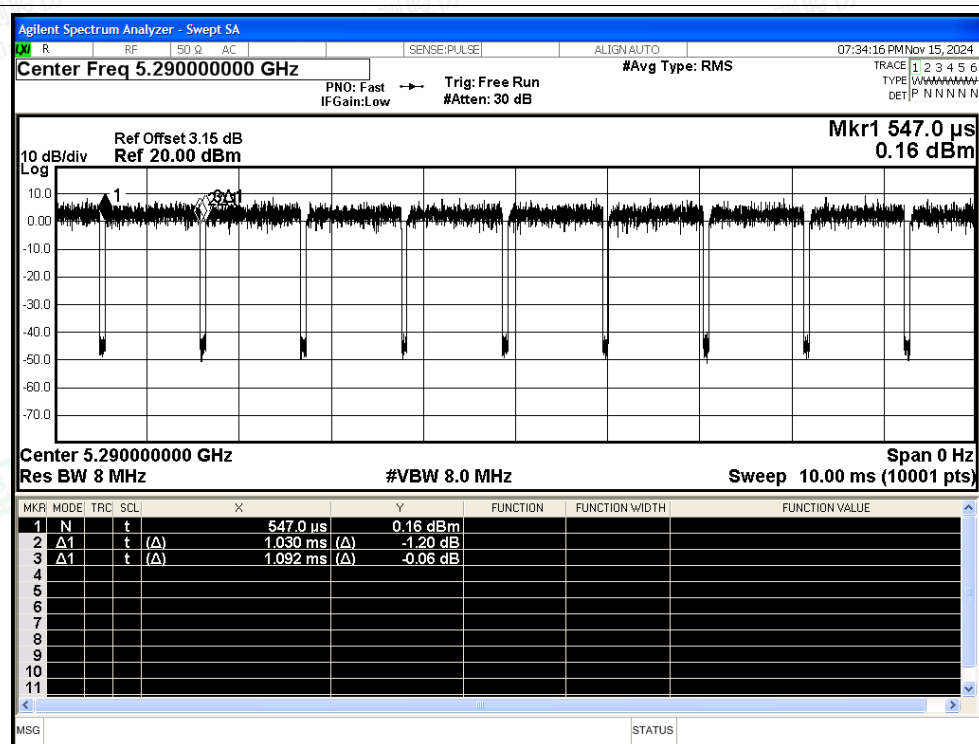

## Duty Cycle NVNT ac160 5250MHz Ant4



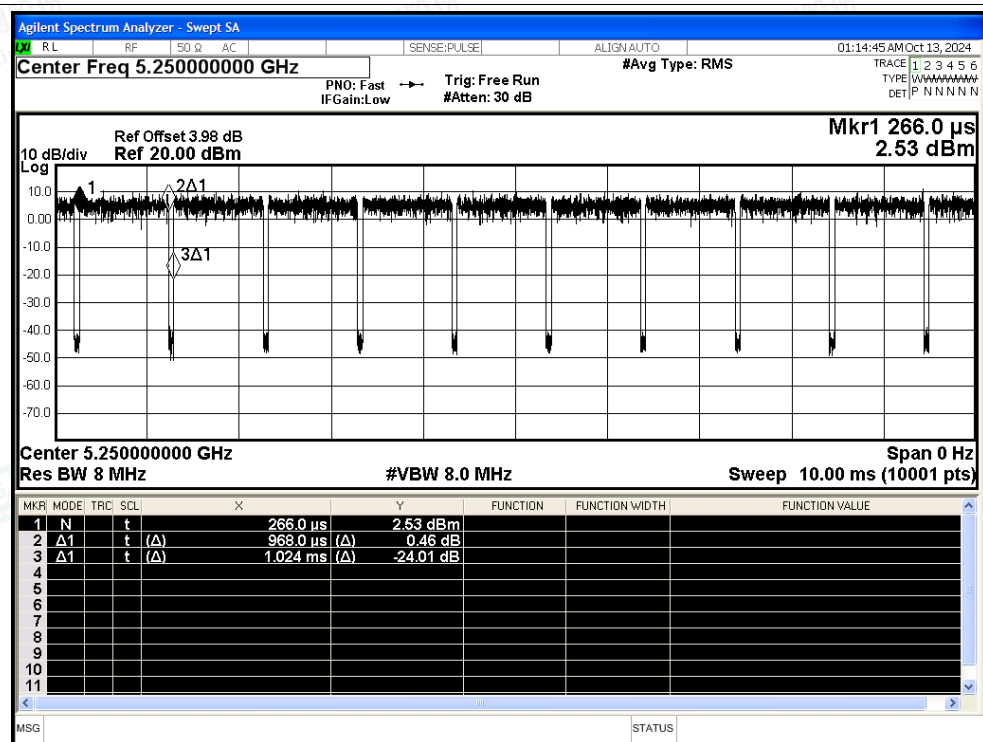

Duty Cycle NVNT ax160 5250MHz Ant4

