


Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 57 of 308

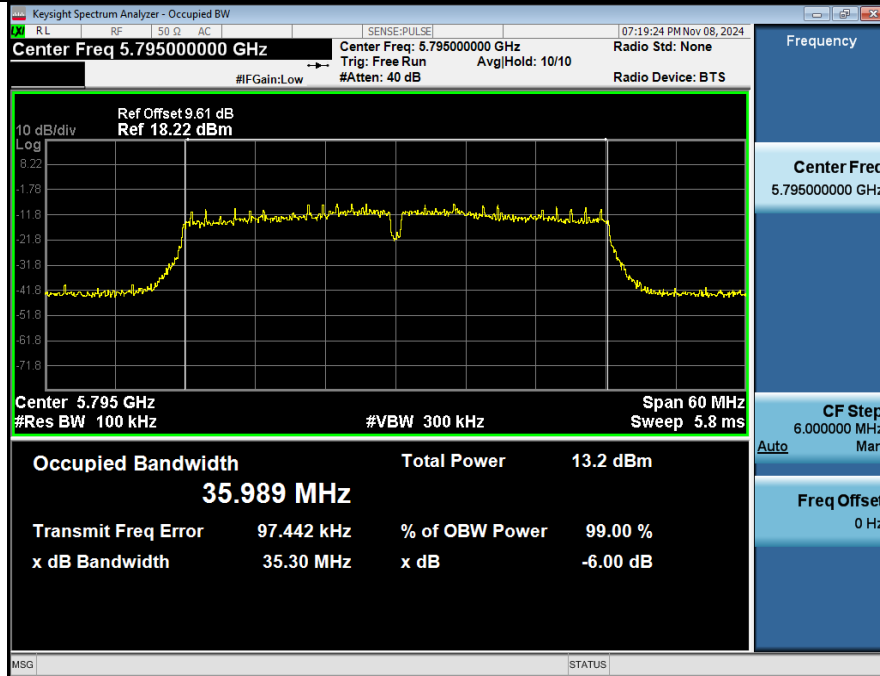

-6dB_Emission_Bandwidth_NVNT_ANT2_802_11n(HT40)_5795_40M

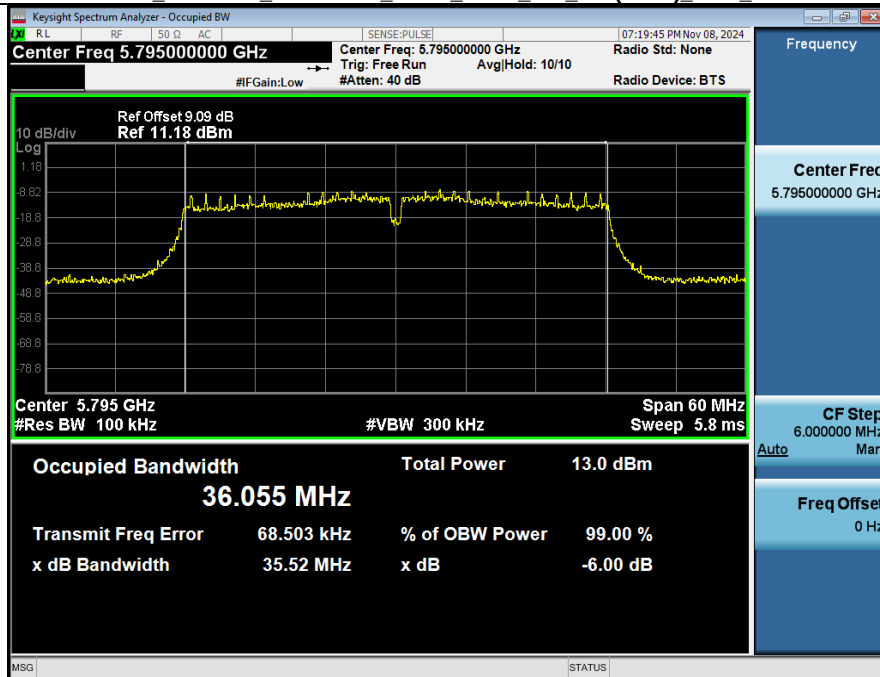


-6dB_Emission_Bandwidth_NVNT_ANT1_802_11ac(VHT40)_5755_40M

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 58 of 308

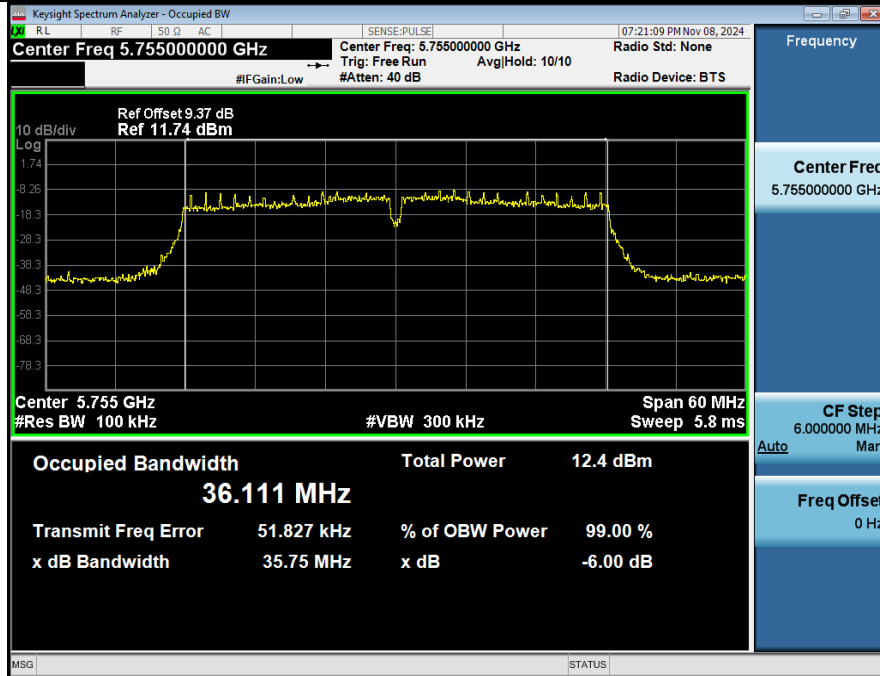

-6dB Emission Bandwidth_NVNT_ANT2_802_11ac(VHT40)_5755_40M

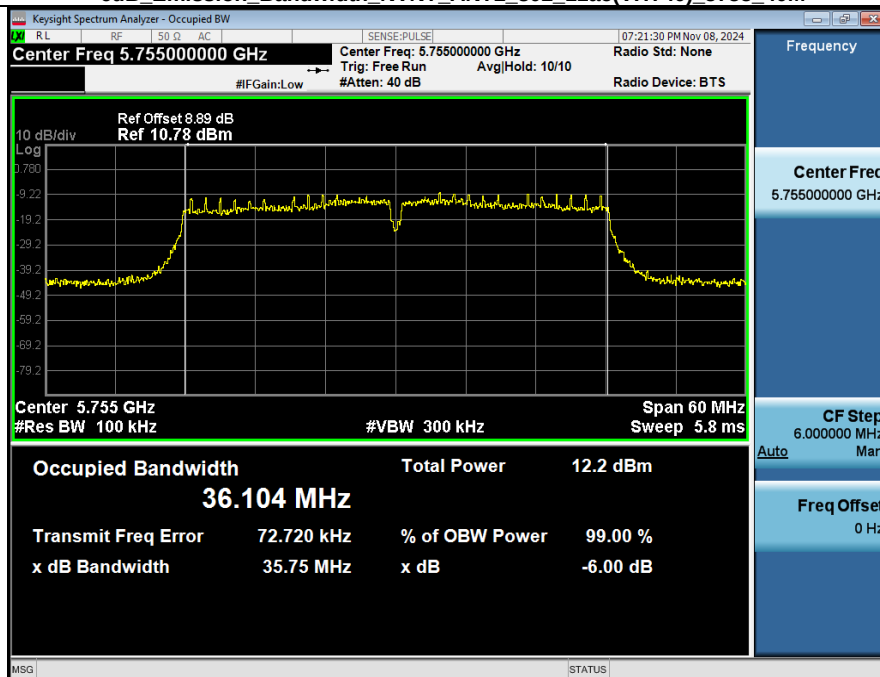


-6dB Emission Bandwidth_NVNT_ANT1_802_11ac(VHT40)_5795_40M

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 59 of 308

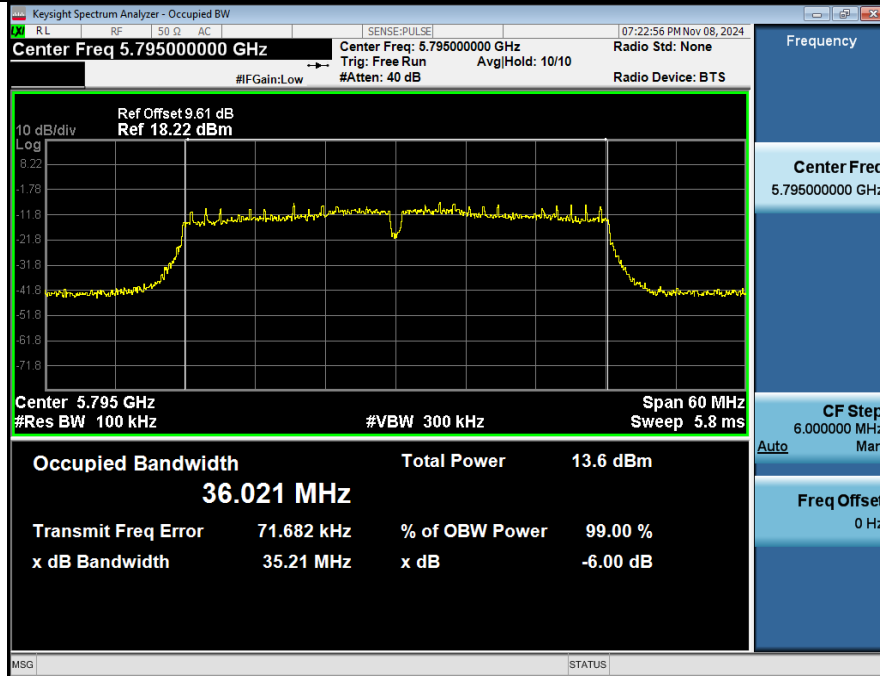

-6dB Emission Bandwidth_NVNT_ANT2_802_11ac(VHT40)_5795_40M

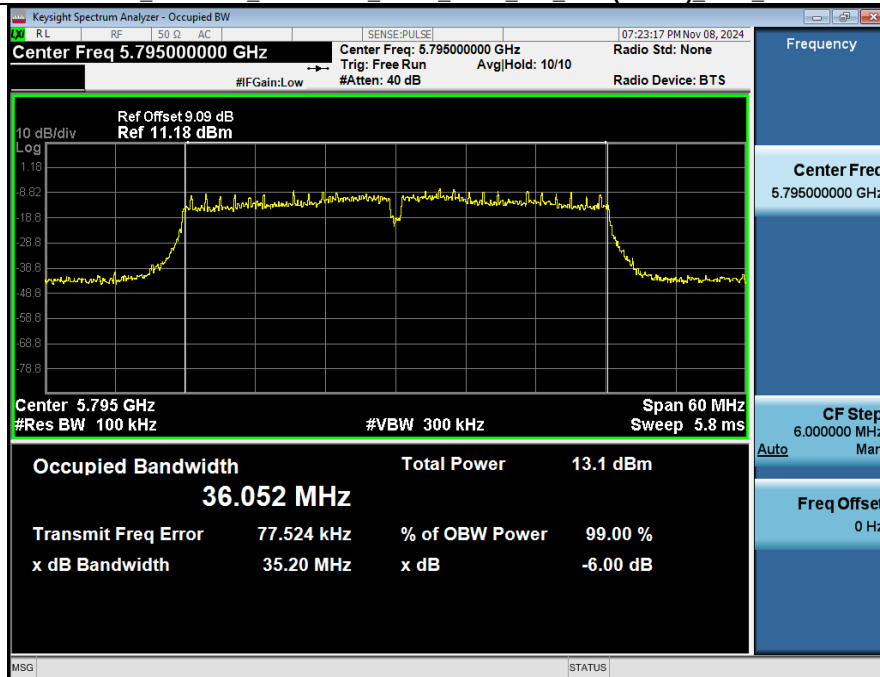


-6dB Emission Bandwidth_NVNT_ANT1_802_11ax(HE40)_5755_40M

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 60 of 308

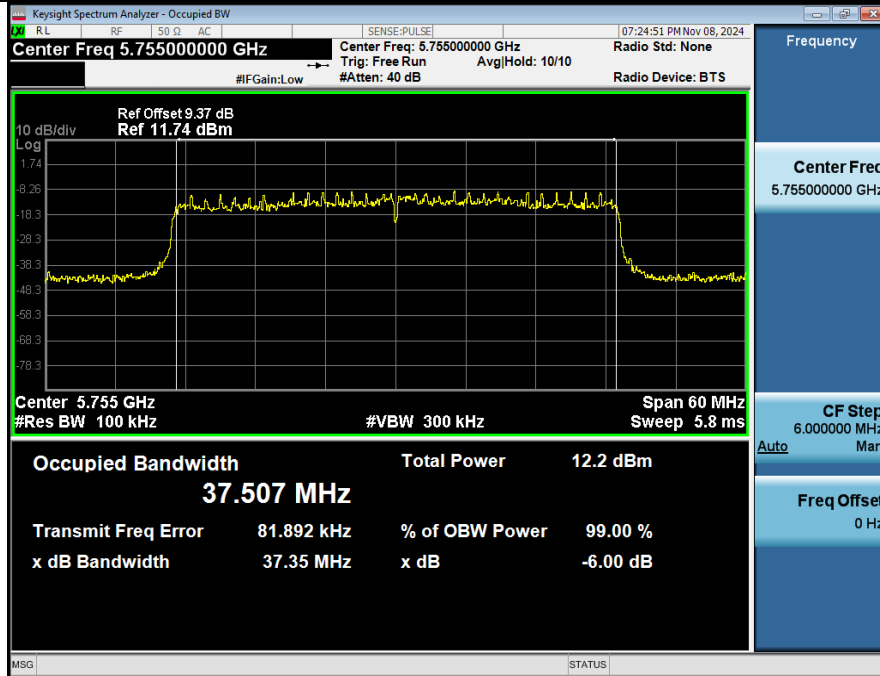

-6dB Emission Bandwidth_NVNT_ANT2_802_11ax(HE40)_5755_40M

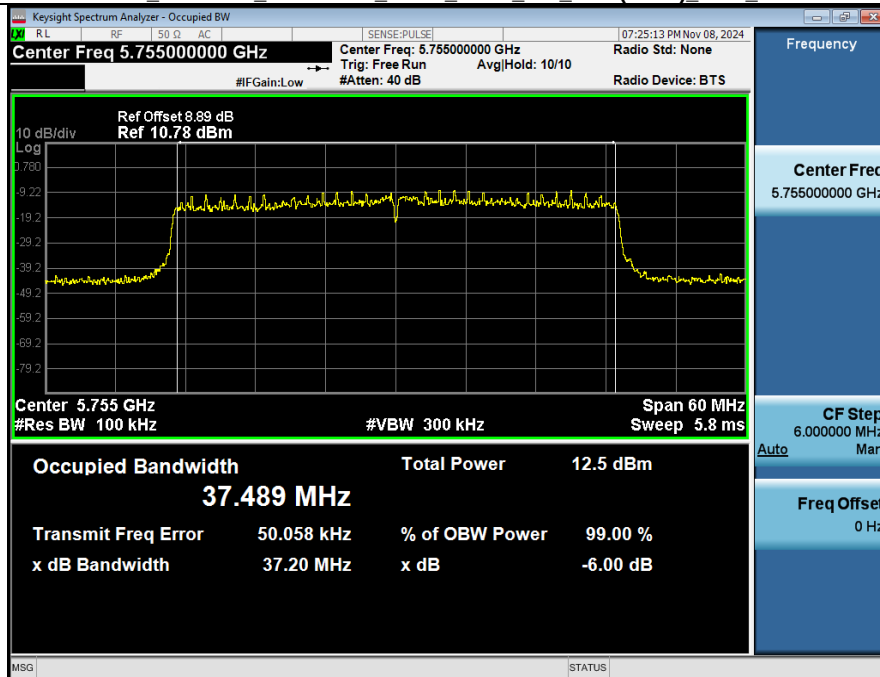


-6dB Emission Bandwidth_NVNT_ANT1_802_11ax(HE40)_5795_40M

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 61 of 308

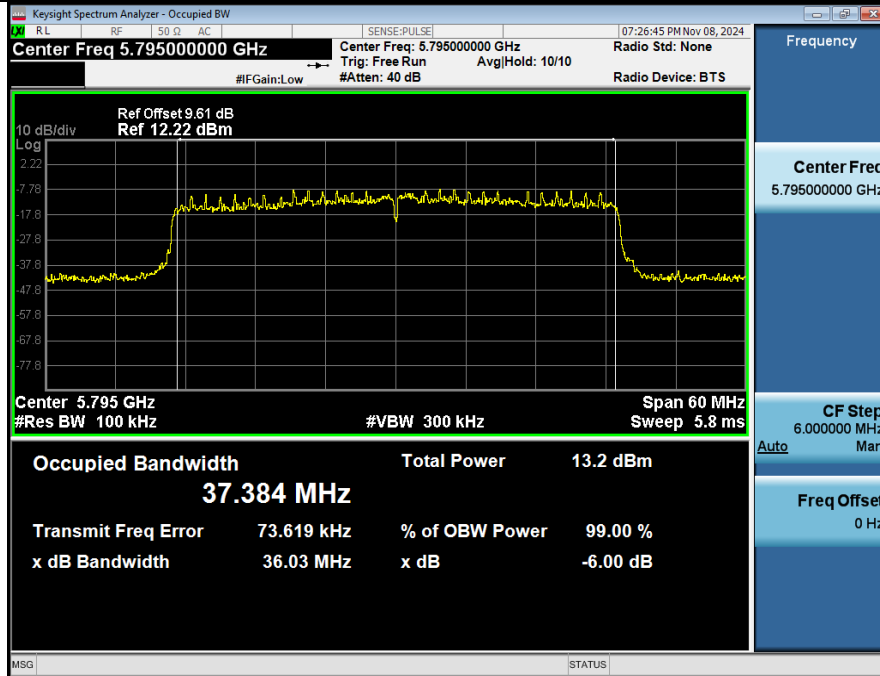

-6dB Emission Bandwidth_NVNT_ANT2_802_11ax(HE40)_5795_40M

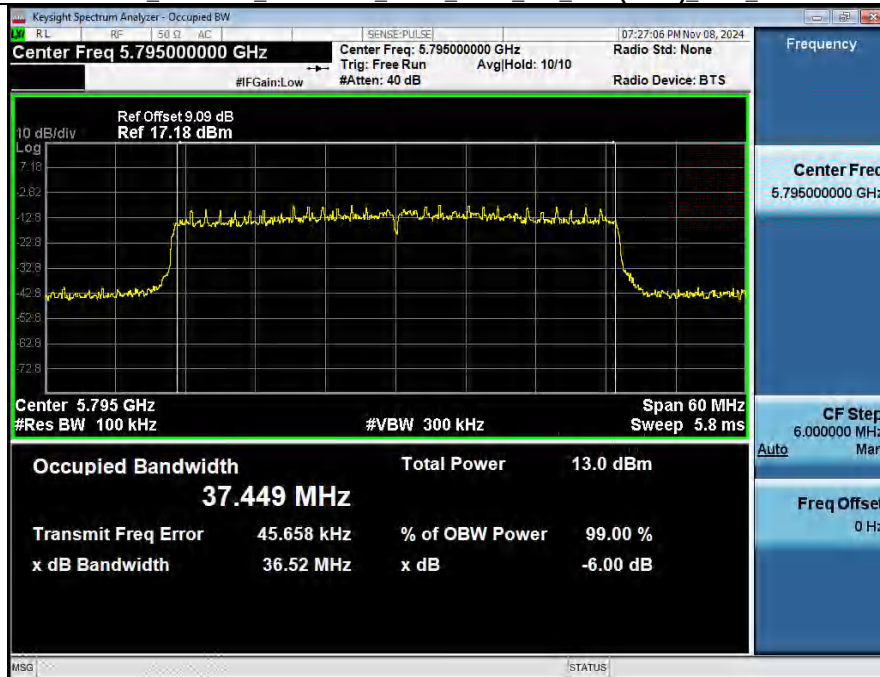


-6dB Emission Bandwidth_NVNT_ANT1_802_11ac(VHT80)_5775_80M

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 62 of 308

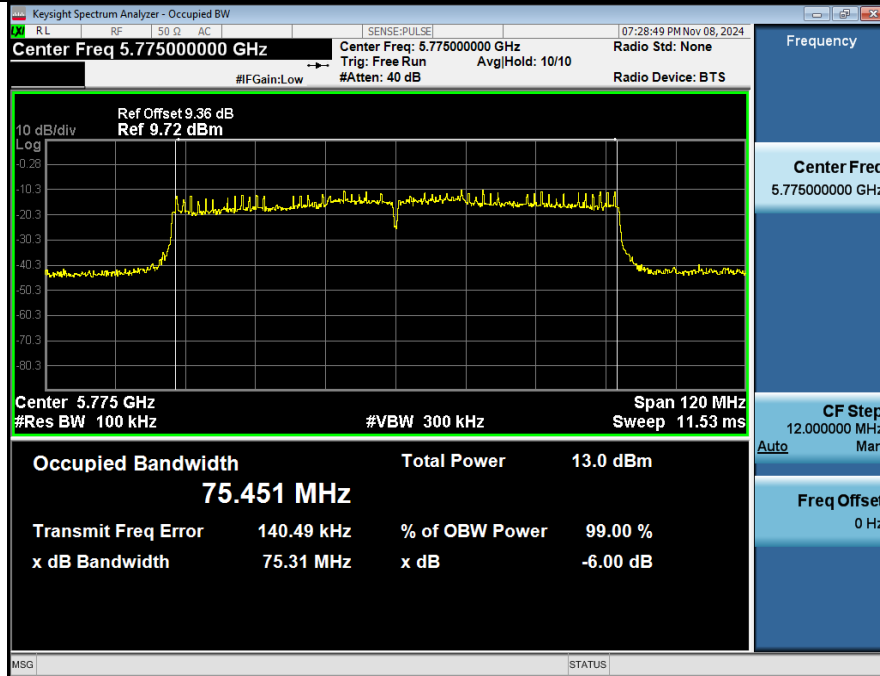

-6dB Emission Bandwidth_NVNT_ANT2_802_11ac(VHT80)_5775_80M

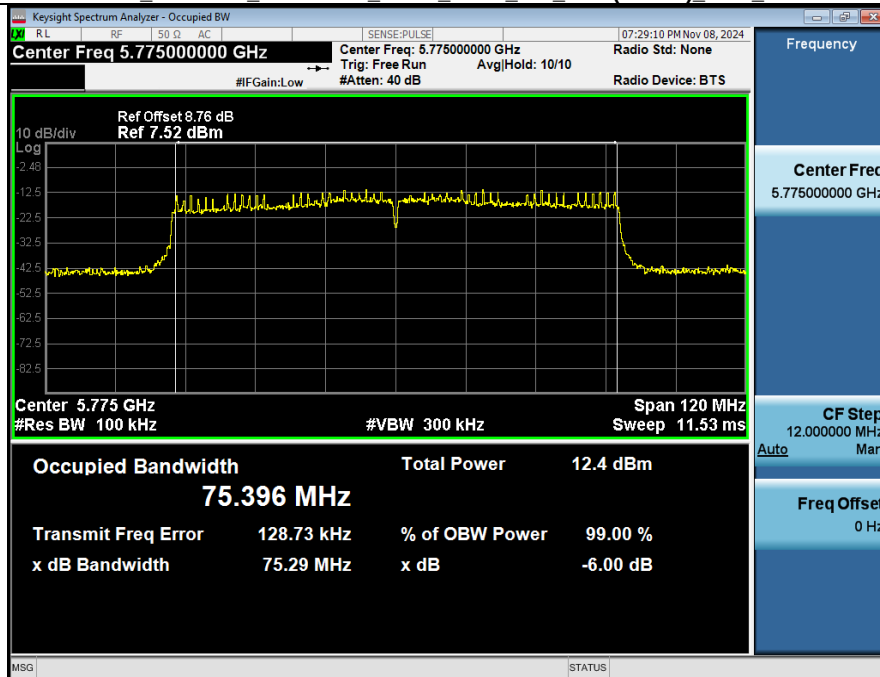


-6dB Emission Bandwidth_NVNT_ANT1_802_11ax(HE80)_5775_80M

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 63 of 308

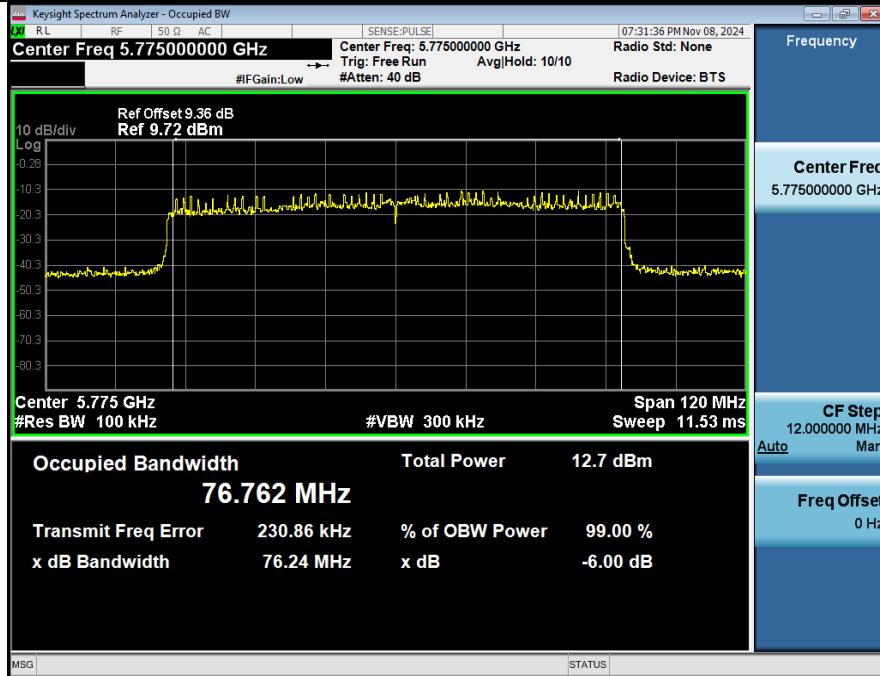

-6dB Emission Bandwidth_NVNT_ANT2_802_11ax(HE80)_5775_80M

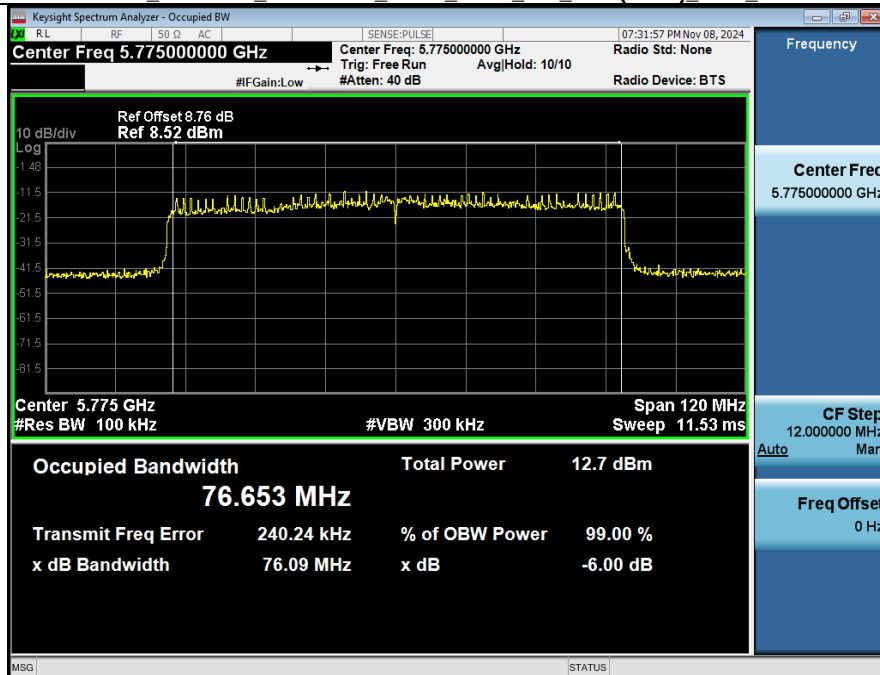

Appendix B

CN24XTFJ 003

Prüfbericht - Produkte

Test Report - Products

Page 64 of 308

1.3 Test Datas 99% Bandwidth (U-NII-3:)

Condition	Antenna	Modulation	Frequency(MHz)	- 26dB Emission Bandwidth(MHz)	Occupied Bandwidth(MHz)
NVNT	ANT1	802.11a	5745.00	21.49	19.14
NVNT	ANT2	802.11a	5745.00	21.44	19.16
NVNT	ANT1	802.11a	5785.00	21.20	19.09
NVNT	ANT2	802.11a	5785.00	21.17	19.12
NVNT	ANT1	802.11a	5825.00	21.37	19.18
NVNT	ANT2	802.11a	5825.00	21.74	19.18
NVNT	ANT1	802.11n(HT20)	5745.00	21.09	18.08
NVNT	ANT2	802.11n(HT20)	5745.00	20.95	17.99
NVNT	ANT1	802.11n(HT20)	5785.00	20.80	18.08
NVNT	ANT2	802.11n(HT20)	5785.00	20.82	18.01
NVNT	ANT1	802.11n(HT20)	5825.00	20.99	18.02
NVNT	ANT2	802.11n(HT20)	5825.00	20.96	18.00
NVNT	ANT1	802.11ac(VHT20)	5745.00	20.91	18.08
NVNT	ANT2	802.11ac(VHT20)	5745.00	21.00	18.00
NVNT	ANT1	802.11ac(VHT20)	5785.00	20.97	18.05
NVNT	ANT2	802.11ac(VHT20)	5785.00	21.13	18.06
NVNT	ANT1	802.11ac(VHT20)	5825.00	20.97	18.02
NVNT	ANT2	802.11ac(VHT20)	5825.00	20.90	18.03
NVNT	ANT1	802.11ax(HE20)	5745.00	21.59	19.14
NVNT	ANT2	802.11ax(HE20)	5745.00	21.35	19.14
NVNT	ANT1	802.11ax(HE20)	5785.00	21.34	19.15
NVNT	ANT2	802.11ax(HE20)	5785.00	21.35	19.19
NVNT	ANT1	802.11ax(HE20)	5825.00	21.39	19.11
NVNT	ANT2	802.11ax(HE20)	5825.00	21.33	19.08
NVNT	ANT1	802.11n(HT40)	5755.00	40.11	36.45
NVNT	ANT2	802.11n(HT40)	5755.00	40.25	36.43
NVNT	ANT1	802.11n(HT40)	5795.00	40.10	36.37
NVNT	ANT2	802.11n(HT40)	5795.00	40.01	36.40
NVNT	ANT1	802.11ac(VHT40)	5755.00	40.33	36.54
NVNT	ANT2	802.11ac(VHT40)	5755.00	39.74	36.46
NVNT	ANT1	802.11ac(VHT40)	5795.00	39.70	36.38
NVNT	ANT2	802.11ac(VHT40)	5795.00	39.73	36.35
NVNT	ANT1	802.11ax(HE40)	5755.00	40.51	37.74
NVNT	ANT2	802.11ax(HE40)	5755.00	40.04	37.71
NVNT	ANT1	802.11ax(HE40)	5795.00	40.11	37.63
NVNT	ANT2	802.11ax(HE40)	5795.00	40.08	37.62
NVNT	ANT1	802.11ac(VHT80)	5775.00	81.68	76.08
NVNT	ANT2	802.11ac(VHT80)	5775.00	80.81	75.96
NVNT	ANT1	802.11ax(HE80)	5775.00	81.74	77.36
NVNT	ANT2	802.11ax(HE80)	5775.00	81.21	77.20


Appendix B

CN24XTFJ 003


Prüfbericht - Produkte
Test Report - Products

Page 65 of 308

99%_OCB_NVNT_ANT1_802_11a_5745

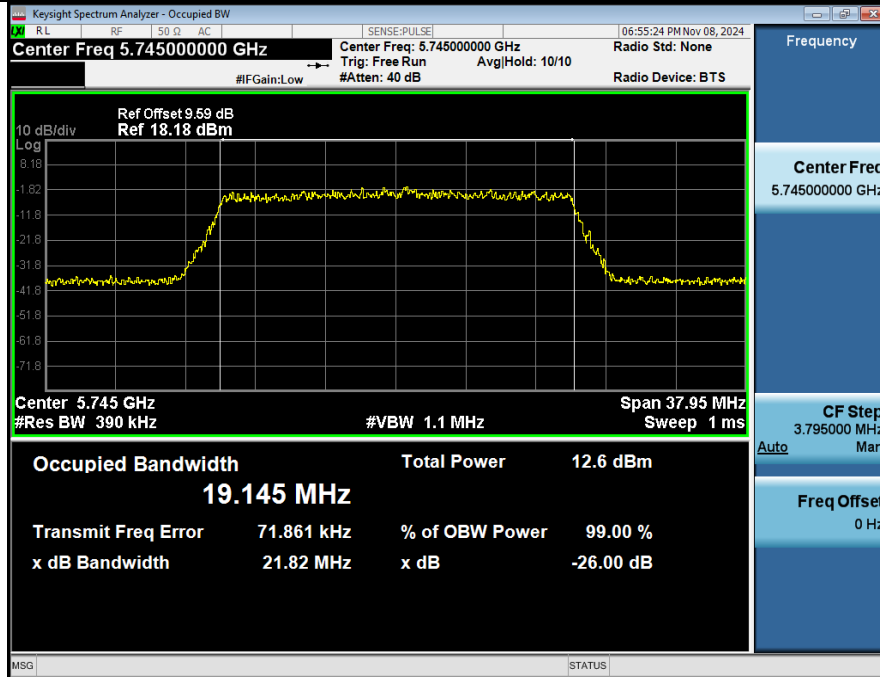

-26BW_NVNT_ANT1_802_11a_5745

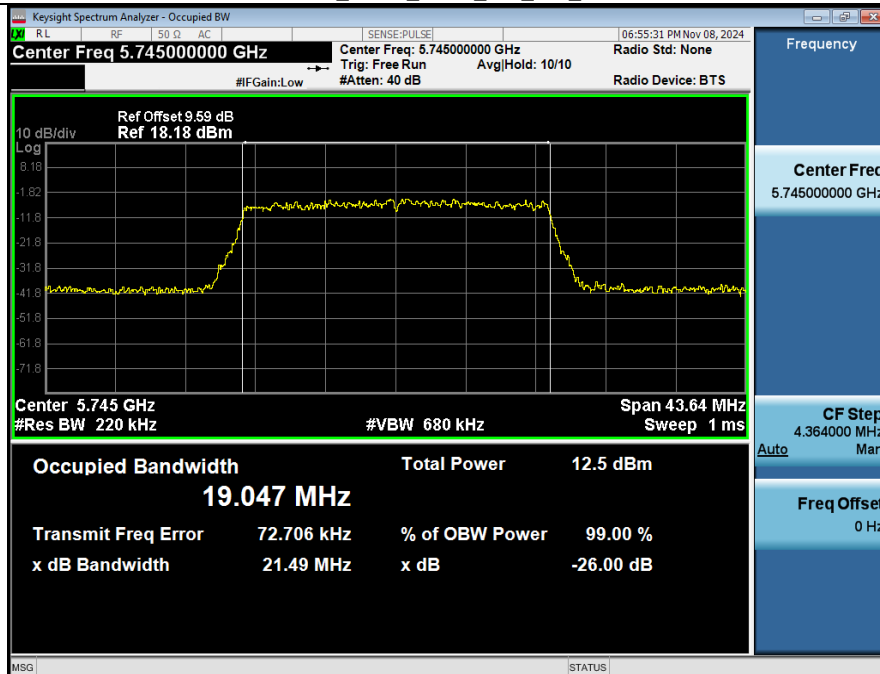


99%_OCB_NVNT_ANT2_802_11a_5745

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 66 of 308

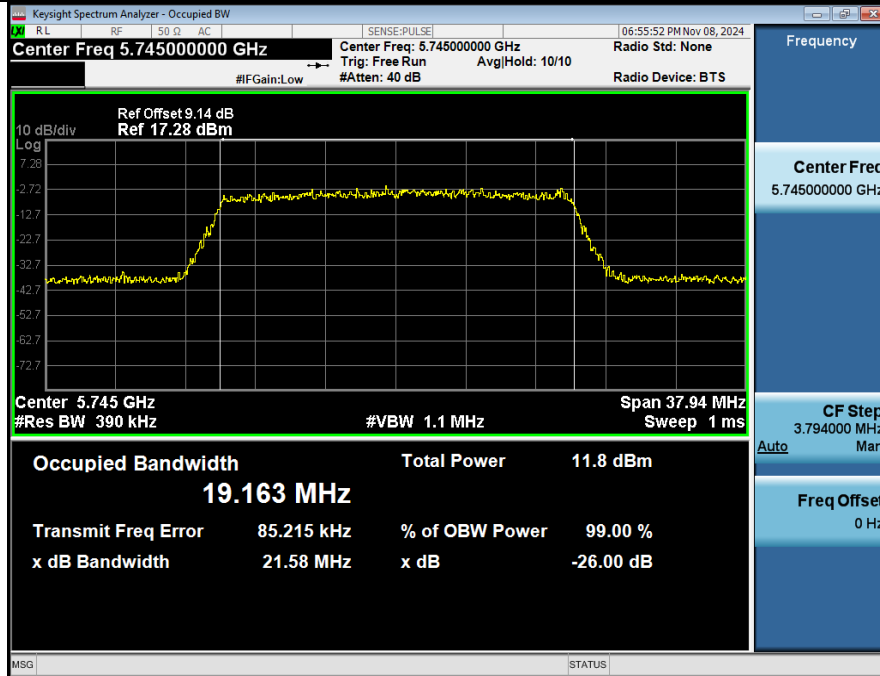

-26BW_NVNT_ANT2_802_11a_5745

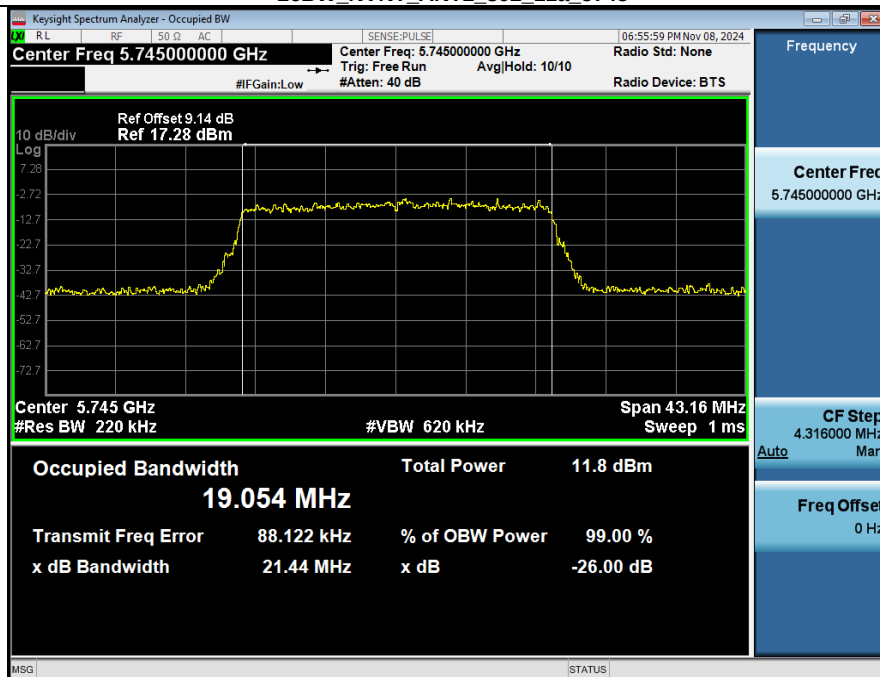


99%_OCB_NVNT_ANT1_802_11a_5785

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 67 of 308

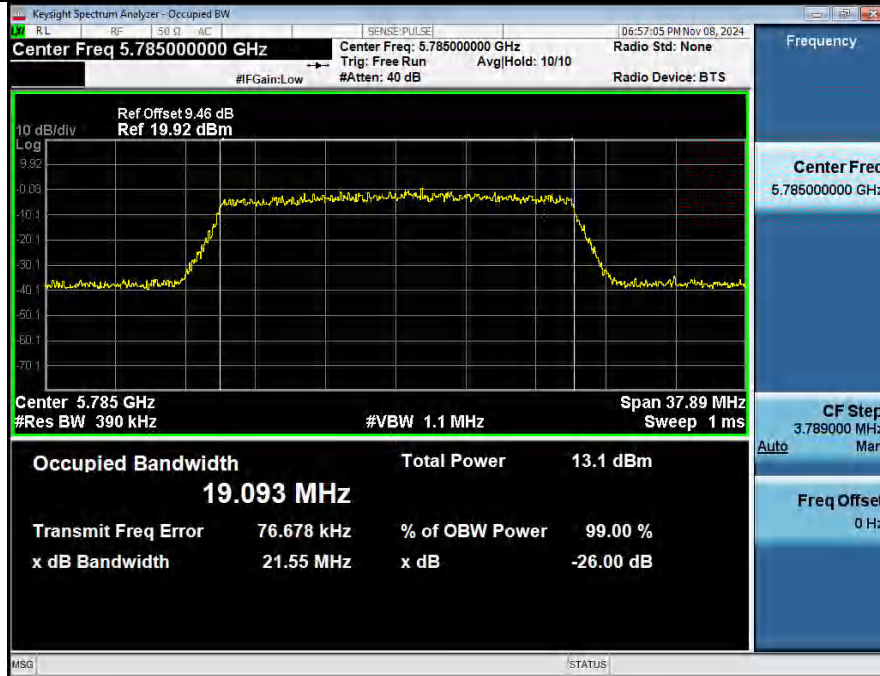

-26BW_NVNT_ANT1_802_11a_5785

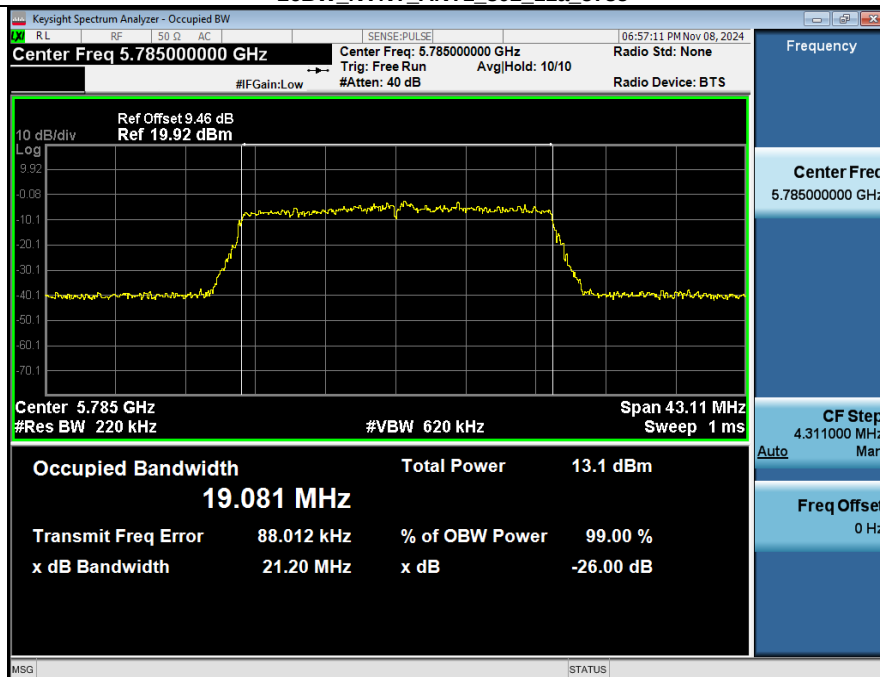

99%_OCB_NVNT_ANT2_802_11a_5785


Appendix B

CN24XTFJ 003


Page 68 of 308

Prüfbericht - Produkte

Test Report - Products

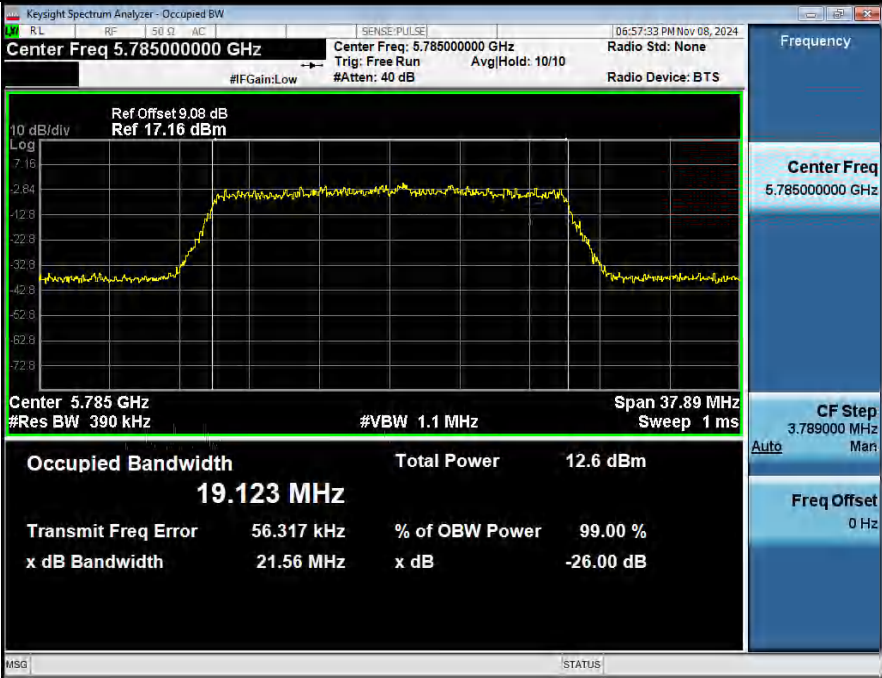

-26BW_NVNT_ANT2_802_11a_5785

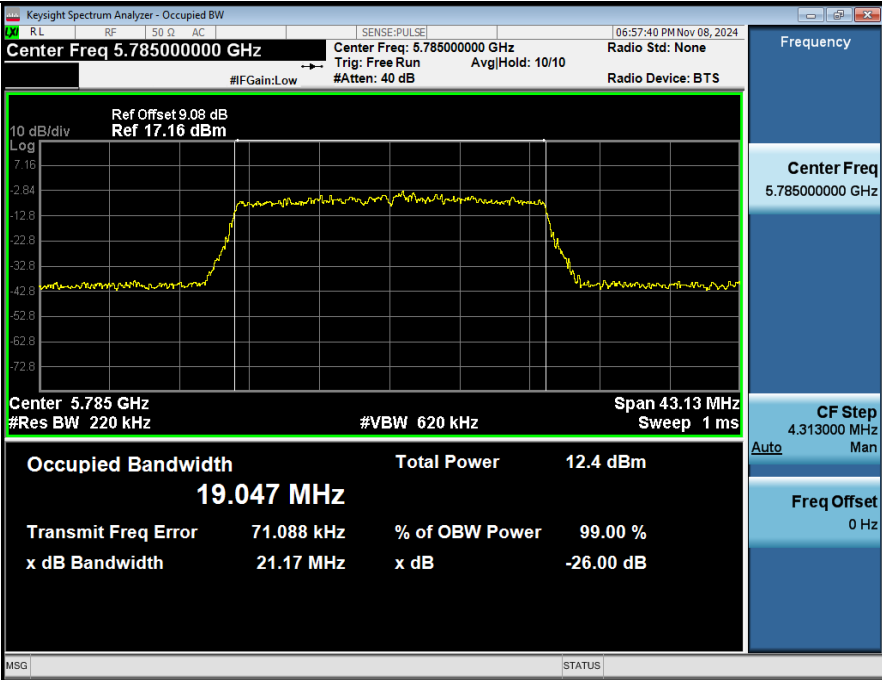


99%_OCB_NVNT_ANT1_802_11a_5825

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 69 of 308

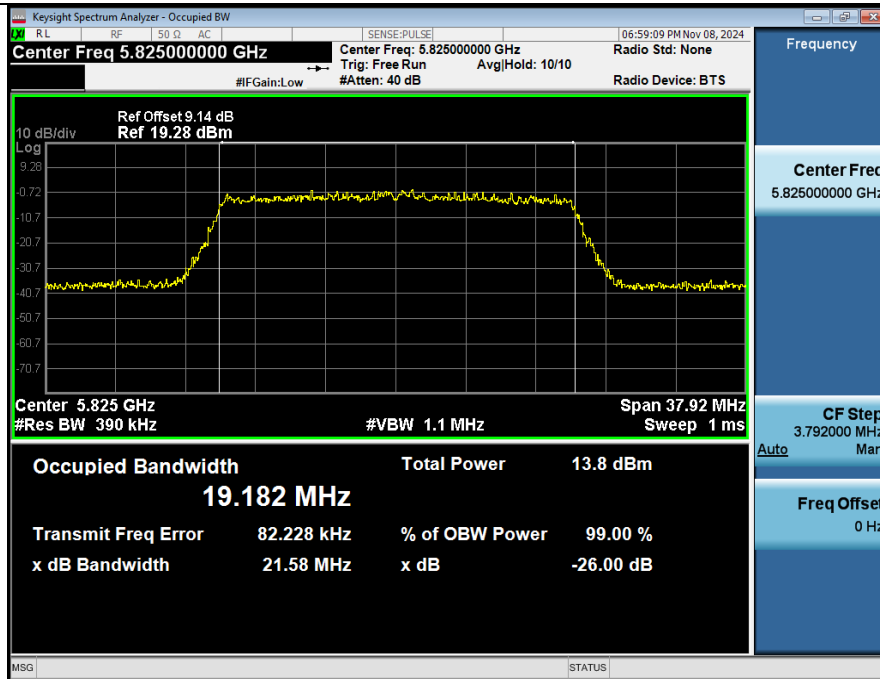

-26BW_NVNT_ANT1_802_11a_5825

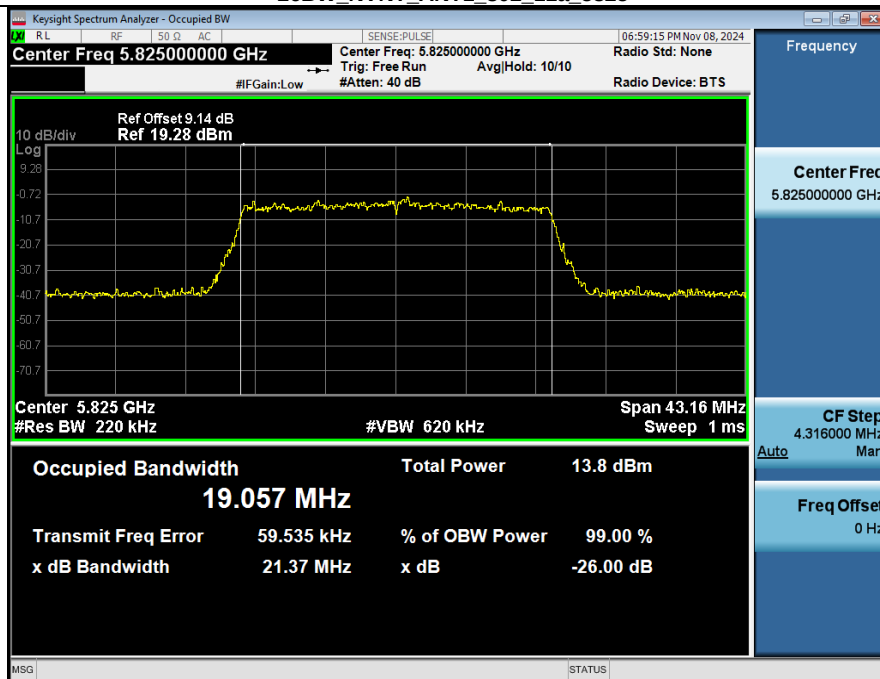


99%_OCB_NVNT_ANT2_802_11a_5825

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 70 of 308

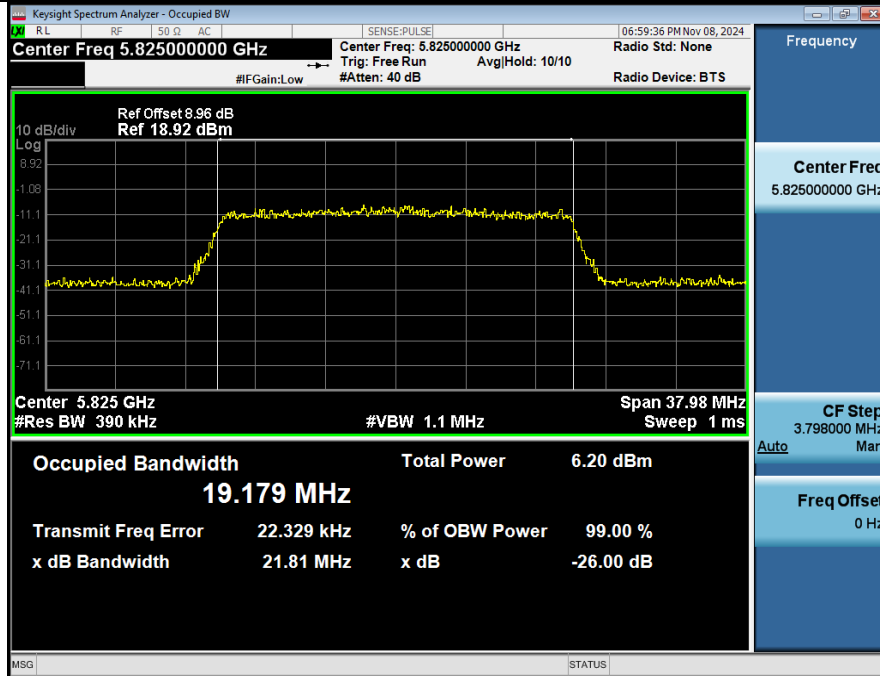


-26BW_NVNT_ANT2_802_11a_5825

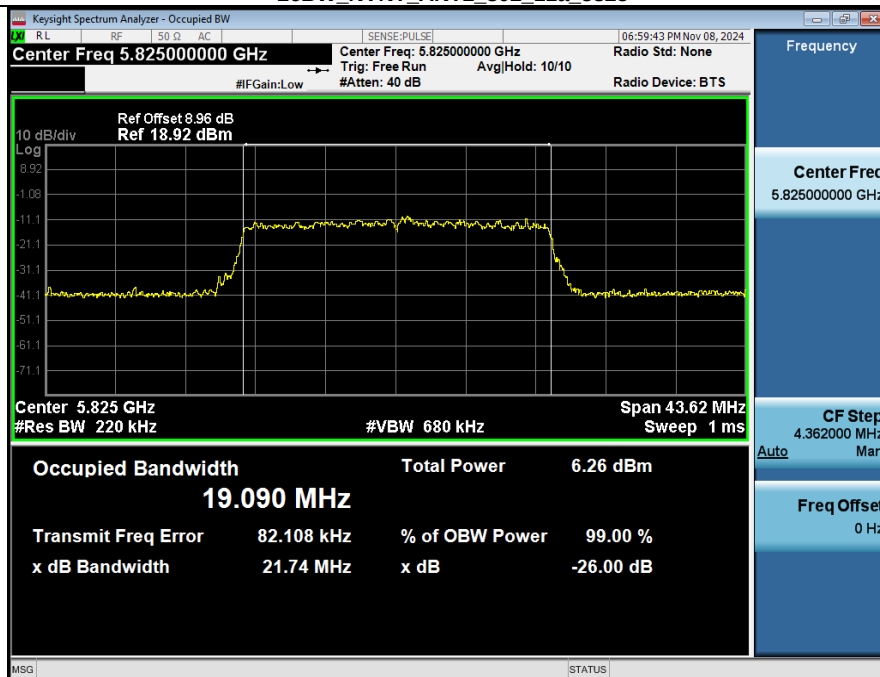


99% OCB_NVNT_ANT1_802_11n(HT20)_5745

Appendix B
CN24XTFJ 003
Page 71 of 308

Prüfbericht - Produkte
Test Report - Products

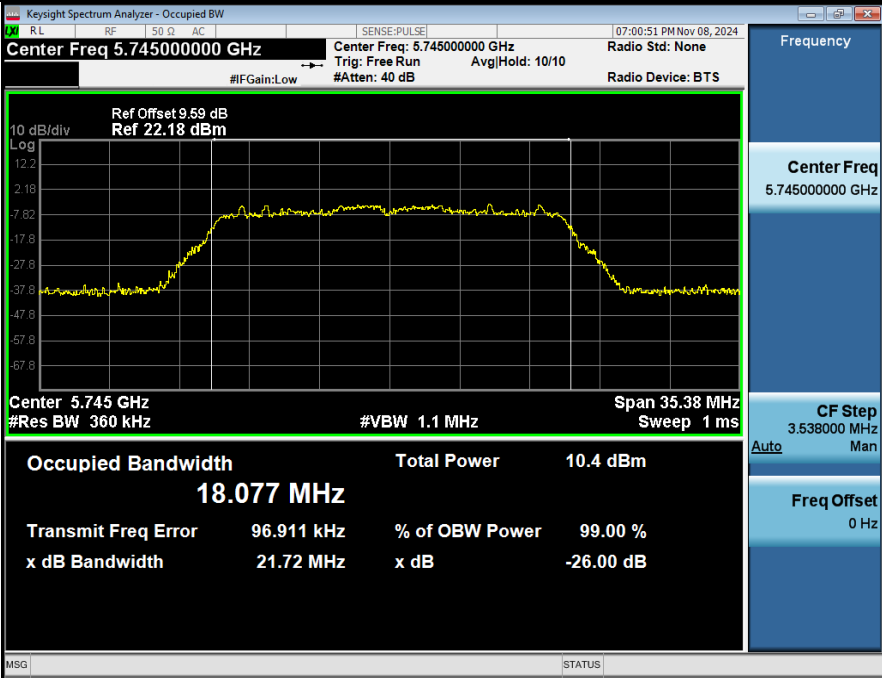

-26BW_NVNT_ANT1_802_11n(HT20)_5745

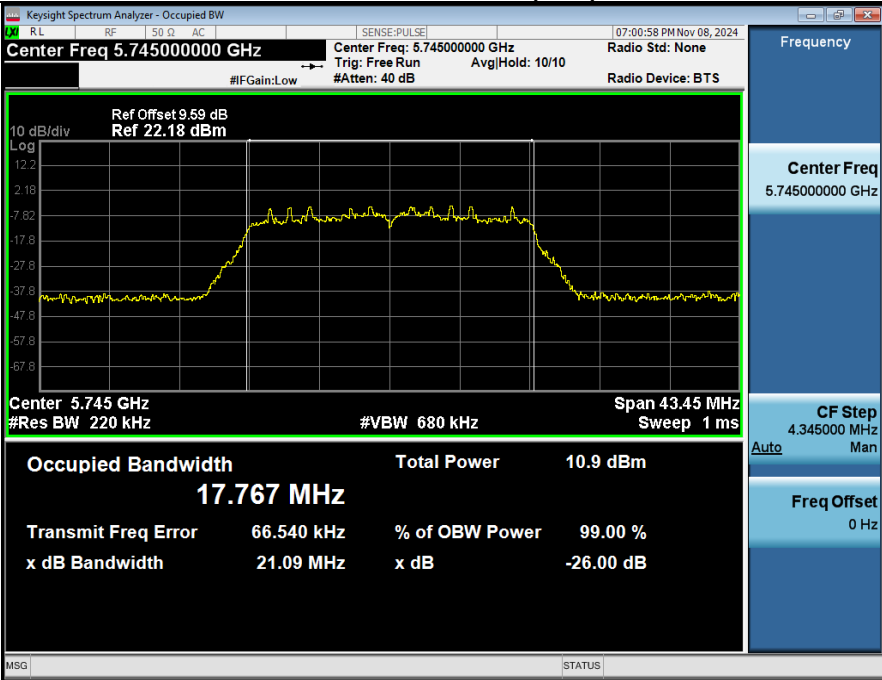

99%_OCB_NVNT_ANT2_802_11n(HT20)_5745


Appendix B

CN24XTFJ 003


Page 72 of 308

Prüfbericht - Produkte

Test Report - Products

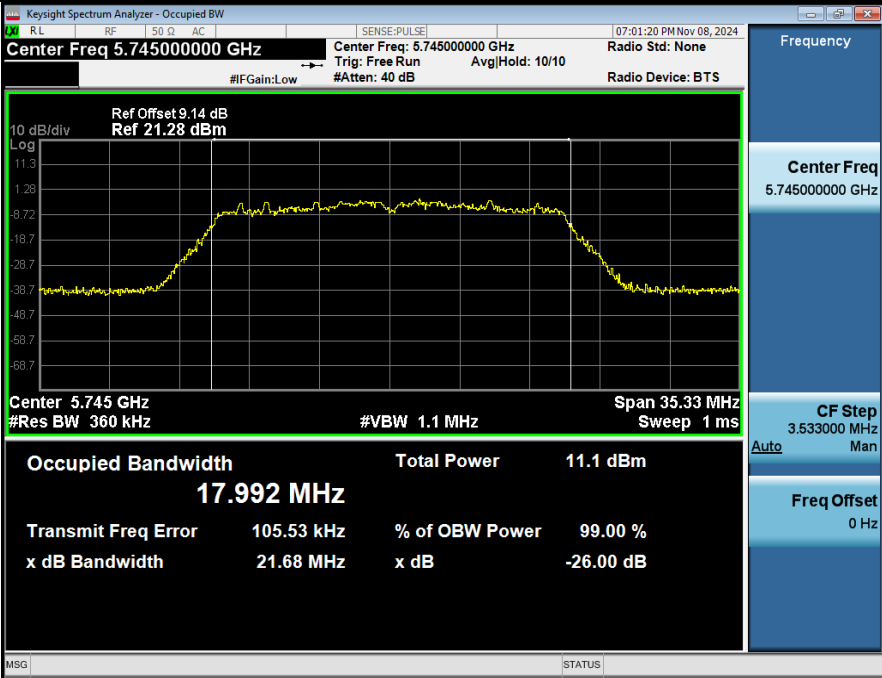

-26BW_NVNT_ANT2_802_11n(HT20)_5745

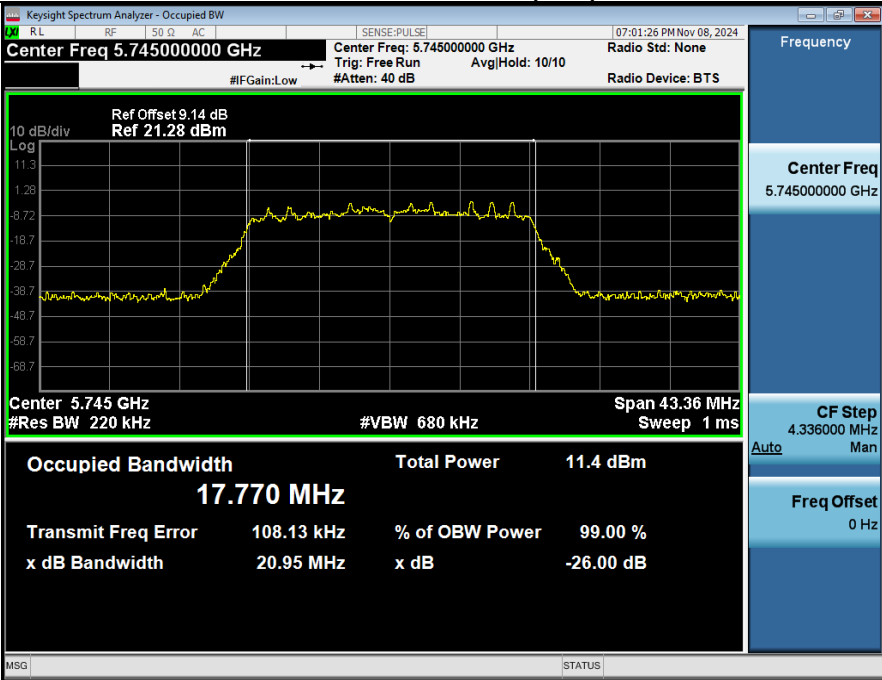

99%_OCB_NVNT_ANT1_802_11n(HT20)_5785


Appendix B

CN24XTFJ 003


Page 73 of 308

Prüfbericht - Produkte

Test Report - Products

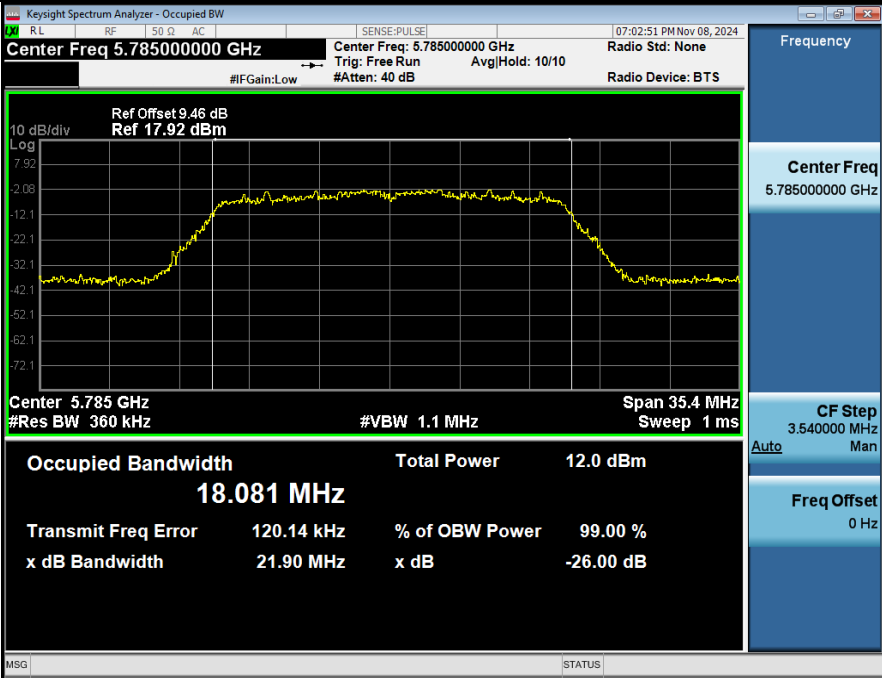

-26BW_NVNT_ANT1_802_11n(HT20)_5785

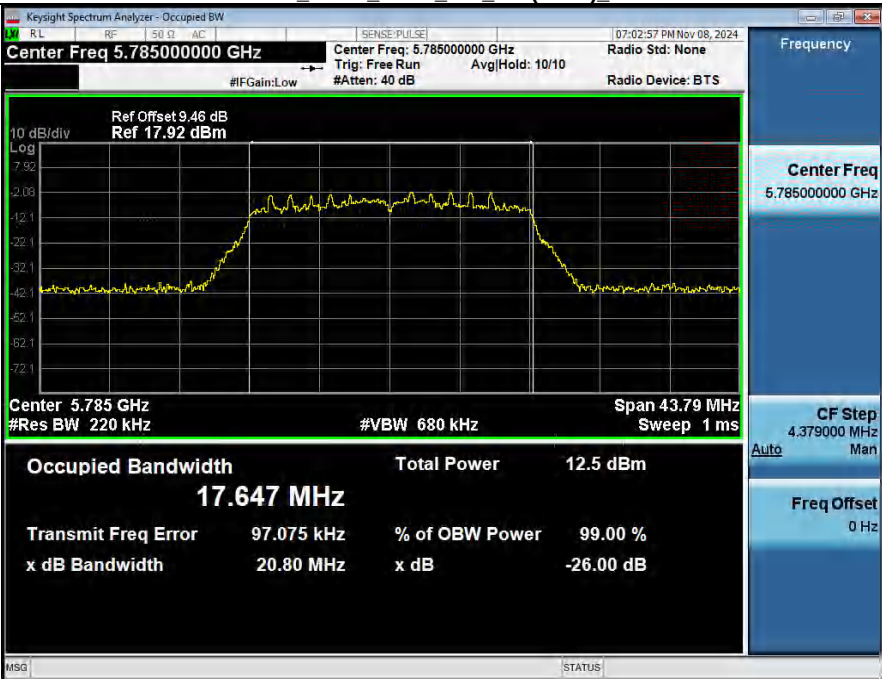

99%_OCB_NVNT_ANT2_802_11n(HT20)_5785


Appendix B

CN24XTFJ 003


Page 74 of 308

Prüfbericht - Produkte

Test Report - Products

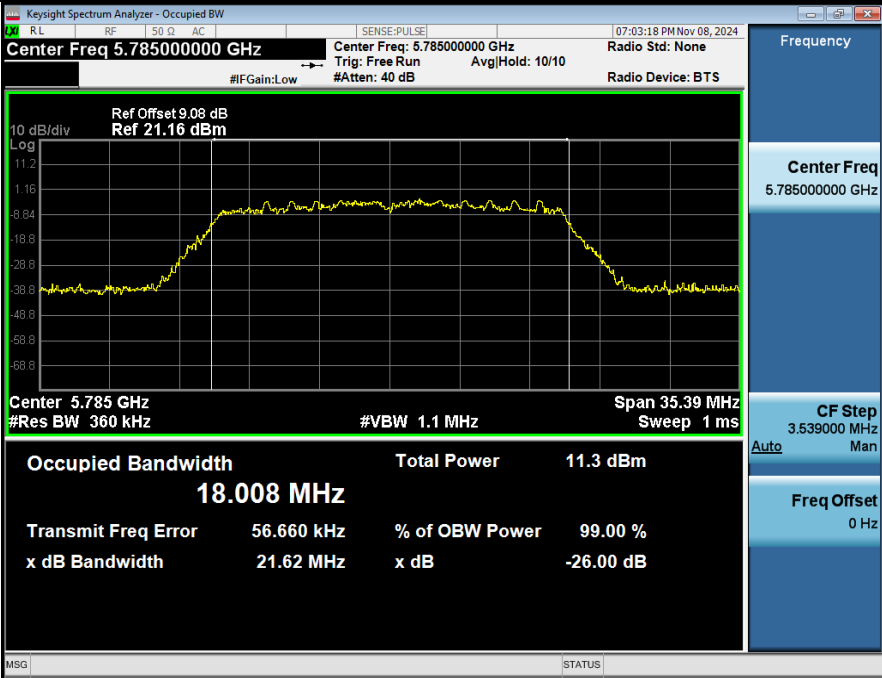

-26BW_NVNT_ANT2_802_11n(HT20)_5785

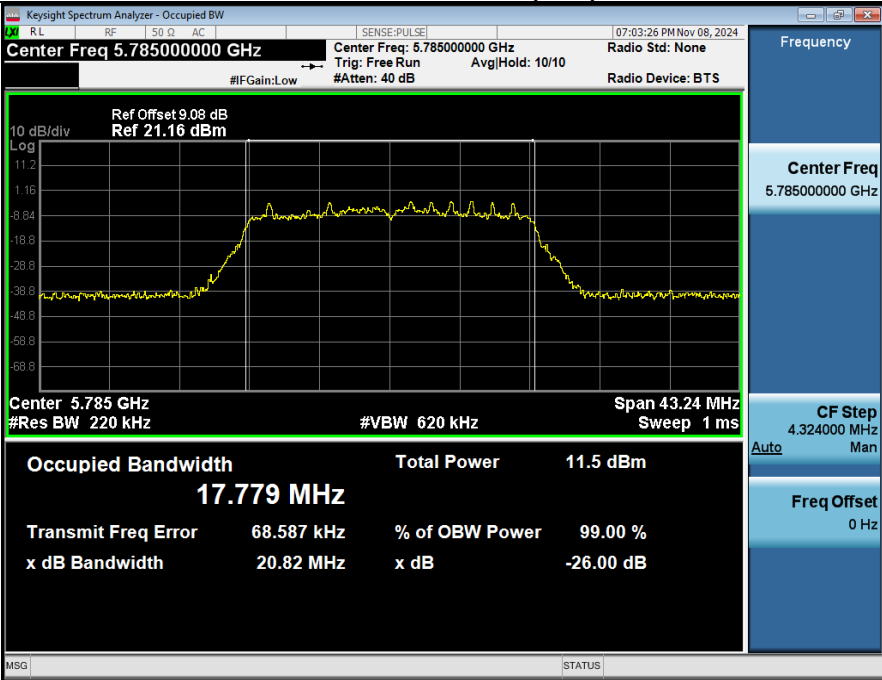


99%_OCB_NVNT_ANT1_802_11n(HT20)_5825

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 75 of 308

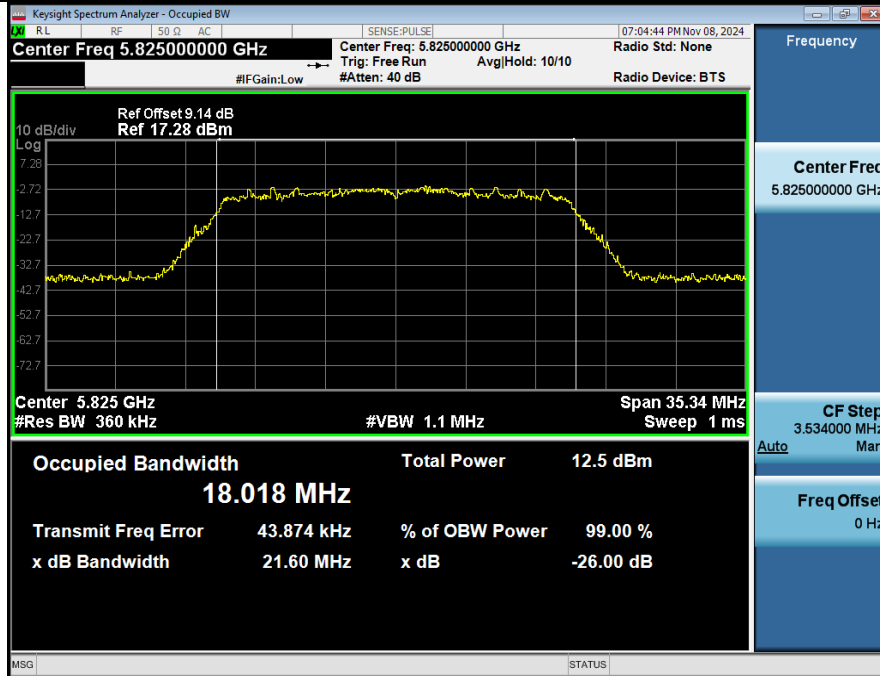

-26BW_NVNT_ANT1_802_11n(HT20)_5825

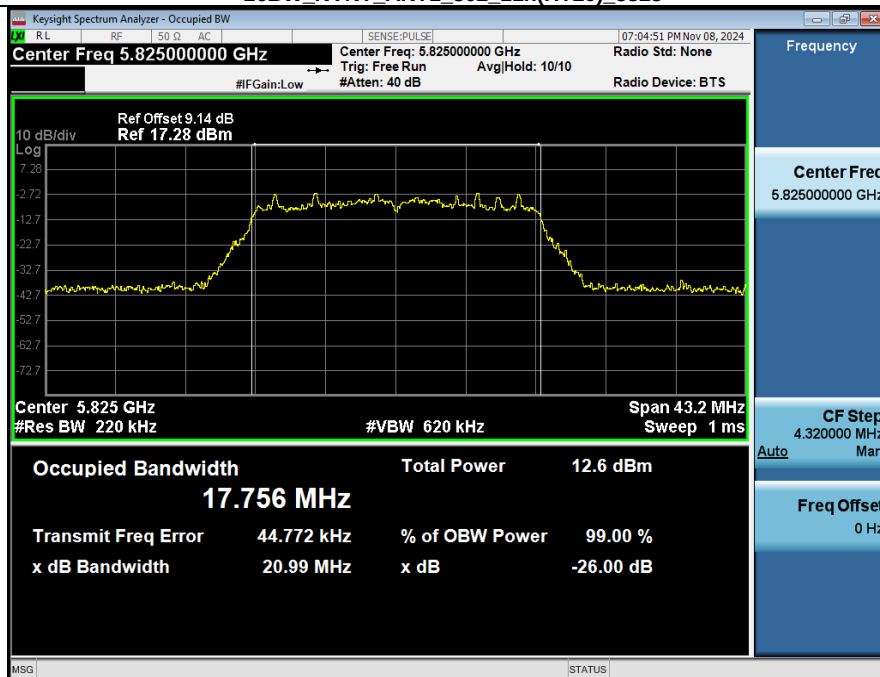


99%_OCB_NVNT_ANT2_802_11n(HT20)_5825

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 76 of 308

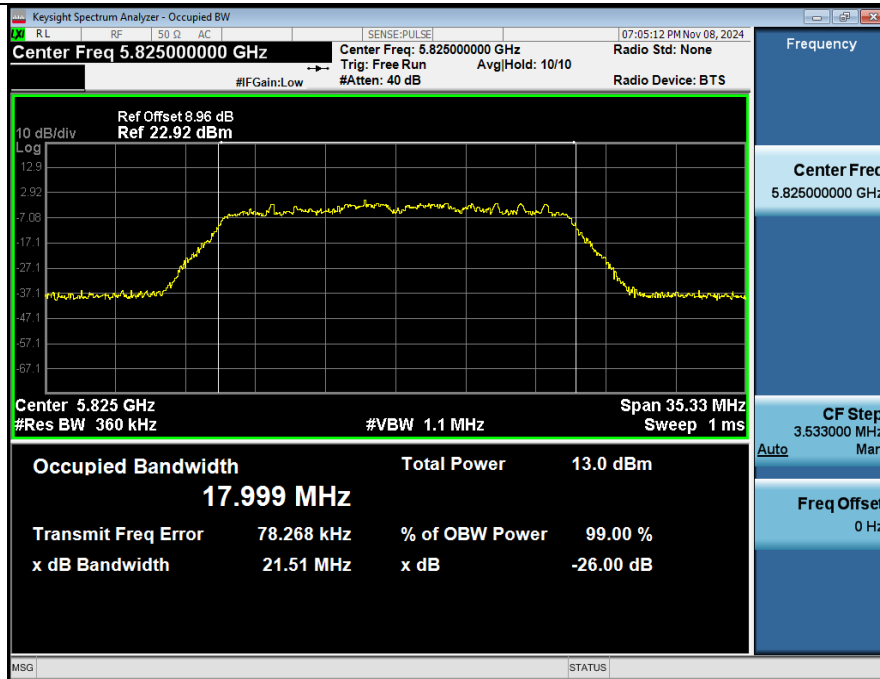

-26BW_NVNT_ANT2_802_11n(HT20)_5825

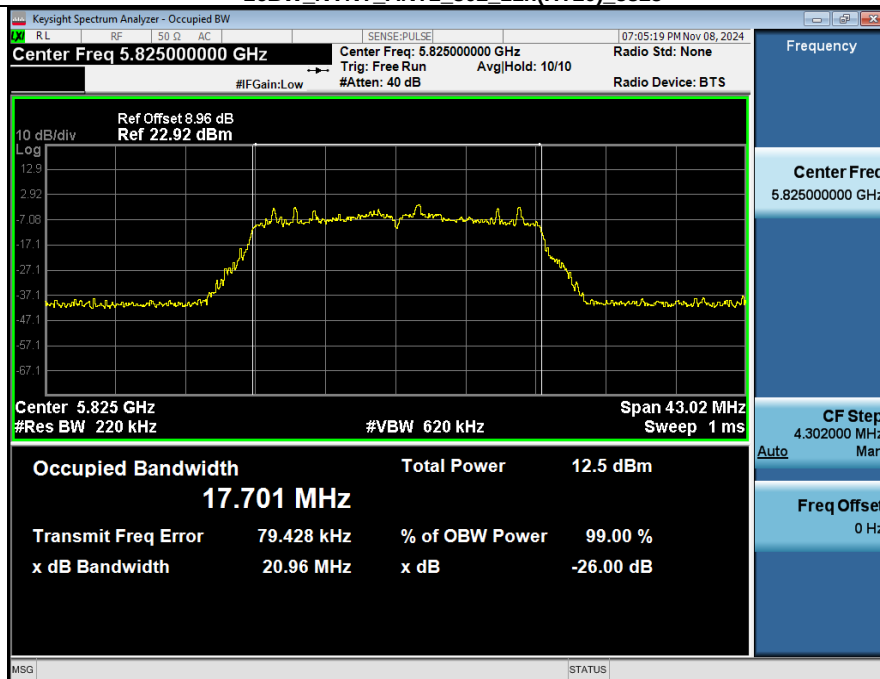


99%_OCB_NVNT_ANT1_802_11ac(VHT20)_5745

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 77 of 308

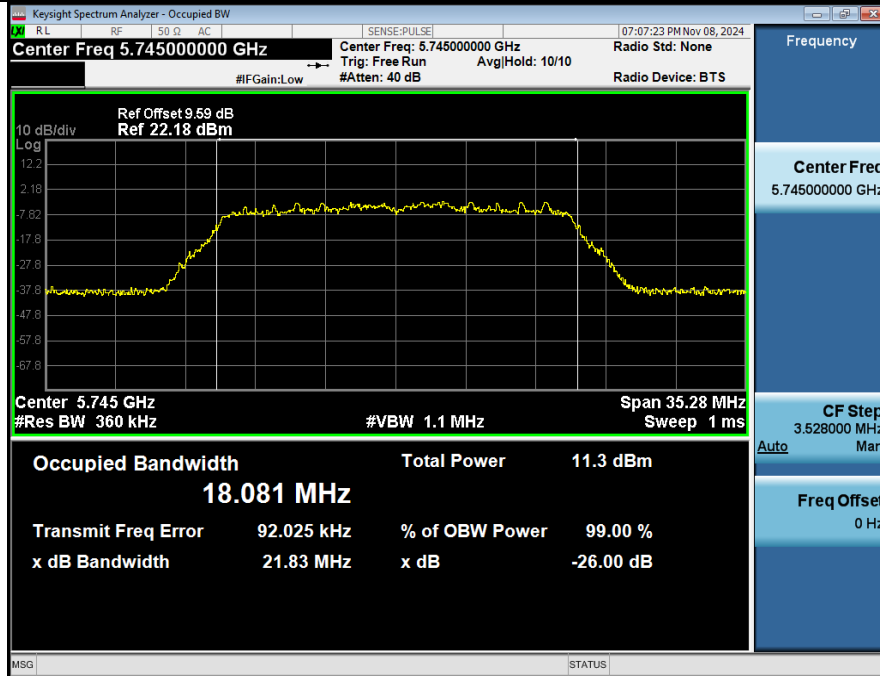

-26BW_NVNT_ANT1_802_11ac(VHT20)_5745

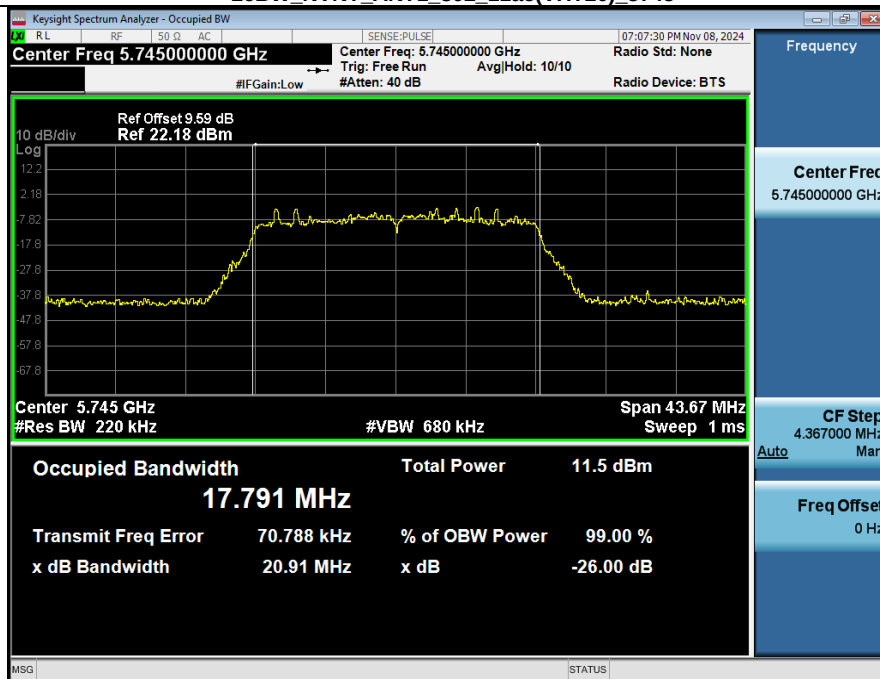


99%_OCB_NVNT_ANT2_802_11ac(VHT20)_5745

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 78 of 308

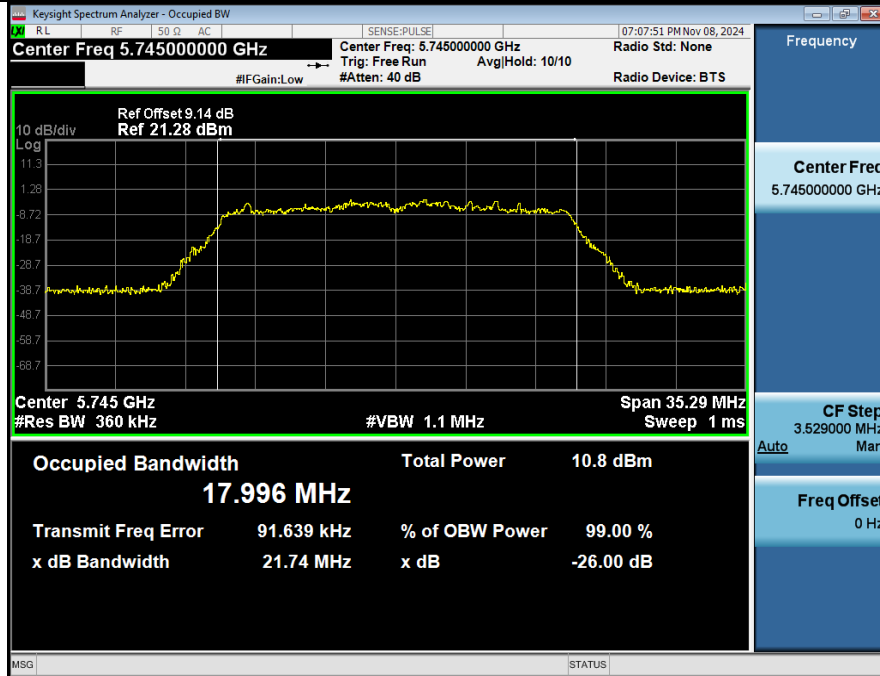

-26BW_NVNT_ANT2_802_11ac(VHT20)_5745

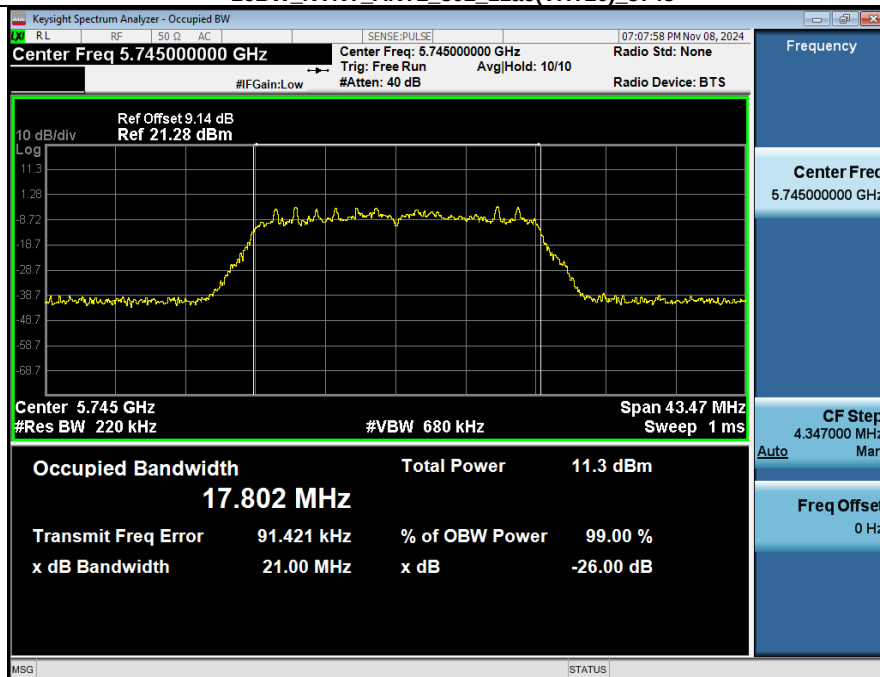


99%_OCB_NVNT_ANT1_802_11ac(VHT20)_5785

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 79 of 308

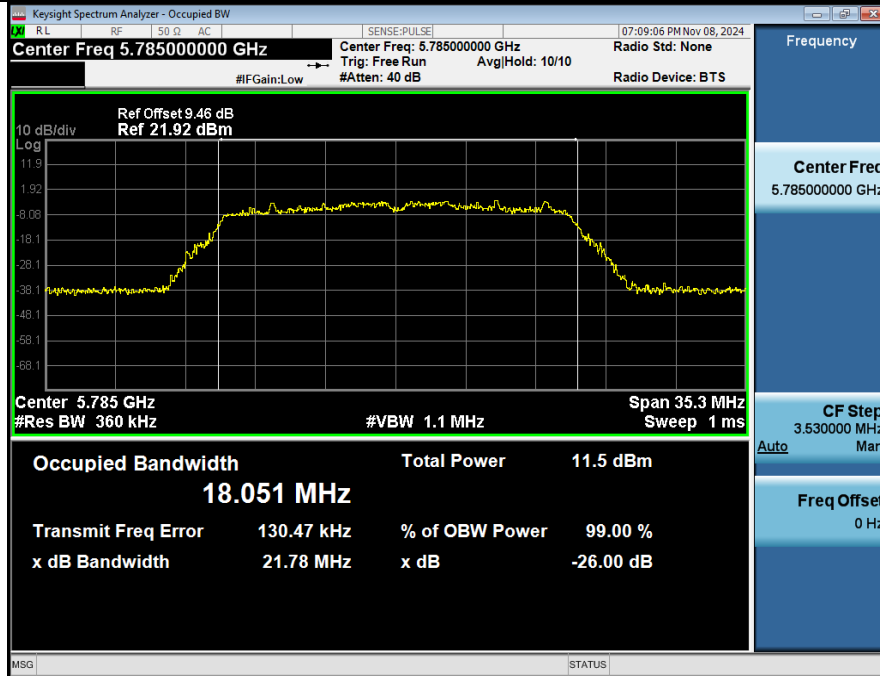

-26BW_NVNT_ANT1_802_11ac(VHT20)_5785

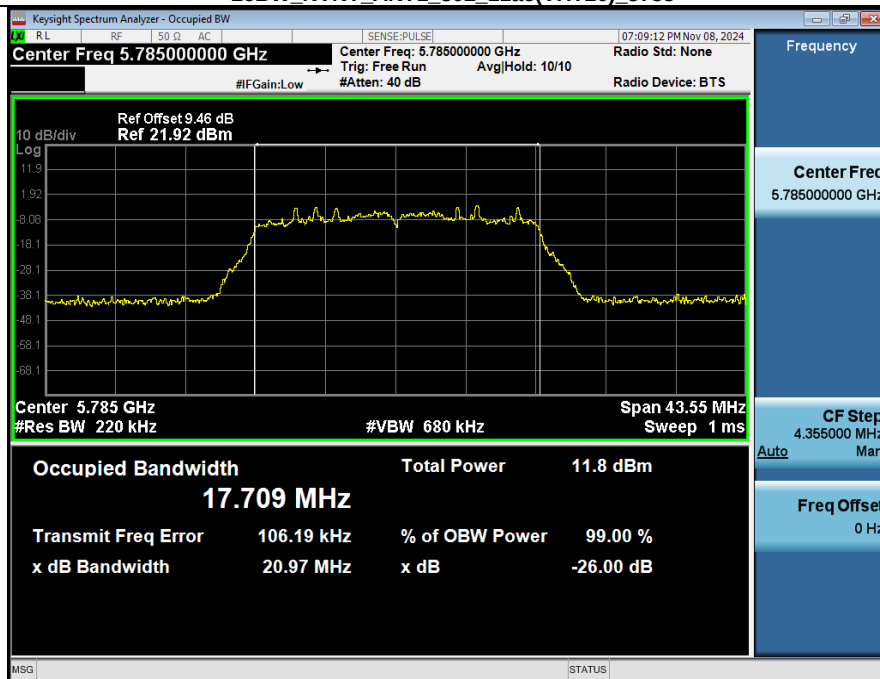

99%_OCB_NVNT_ANT2_802_11ac(VHT20)_5785

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 80 of 308



-26BW_NVNT_ANT2_802_11ac(VHT20)_5785

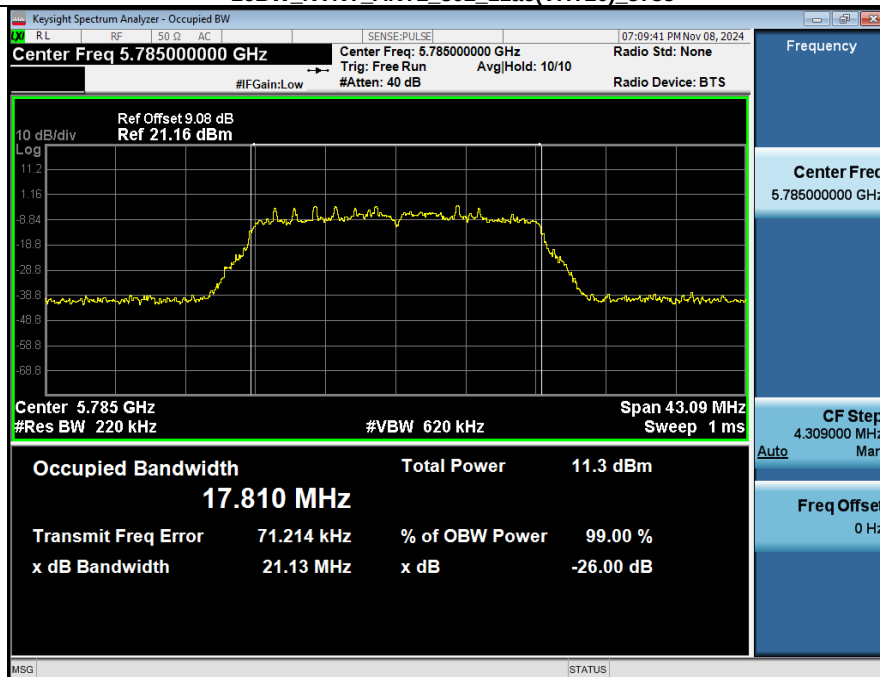


99%_OCB_NVNT_ANT1_802_11ac(VHT20)_5825

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 81 of 308

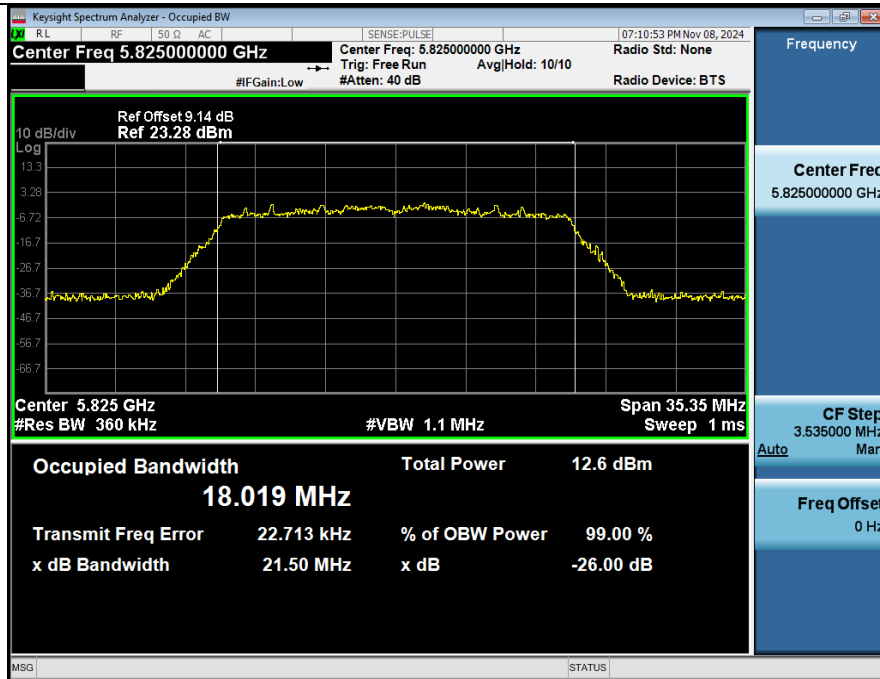

-26BW_NVNT_ANT1_802_11ac(VHT20)_5825

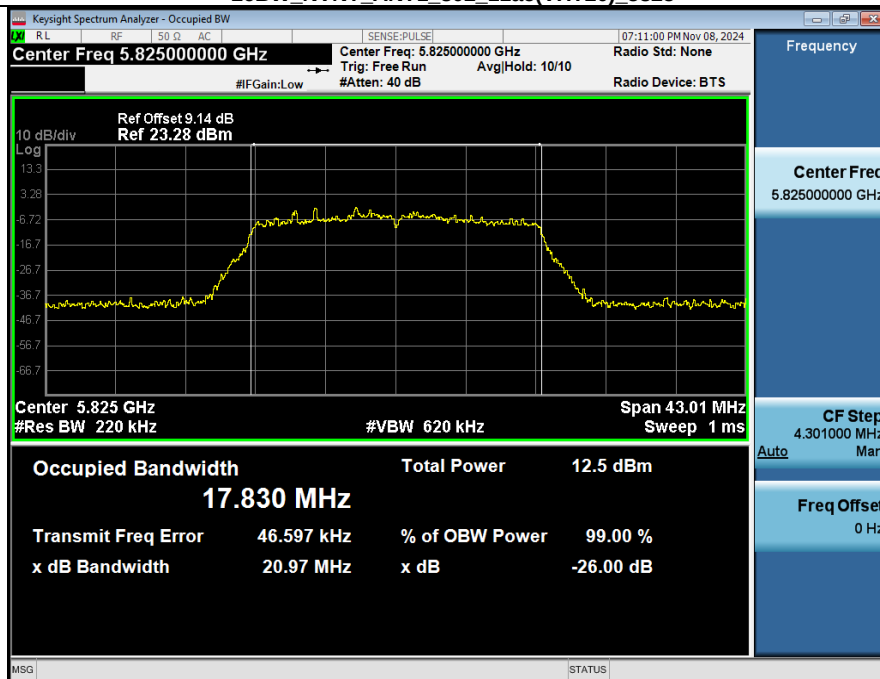


99%_OCB_NVNT_ANT2_802_11ac(VHT20)_5825

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 82 of 308

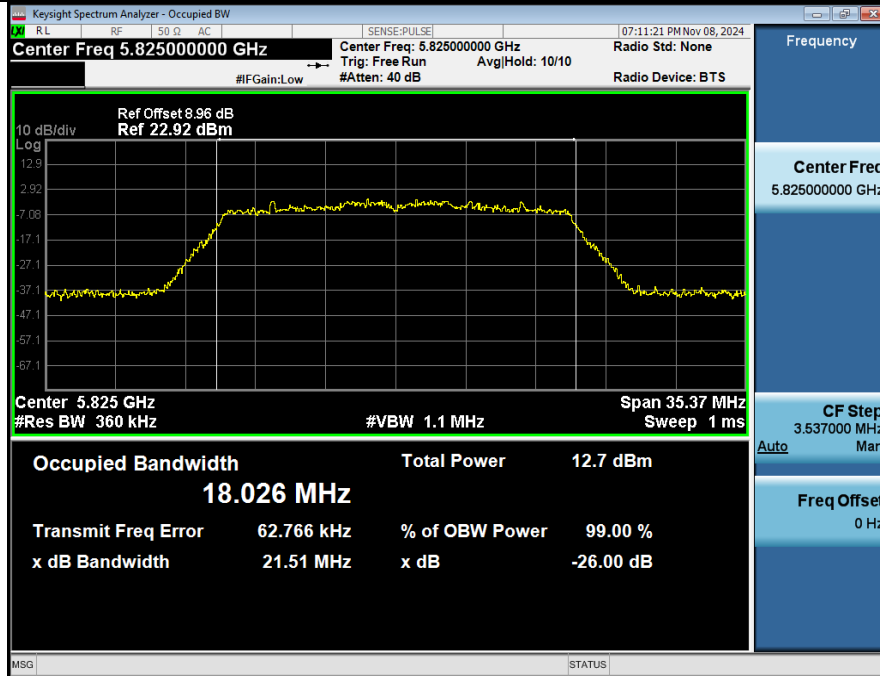

-26BW_NVNT_ANT2_802_11ac(VHT20)_5825

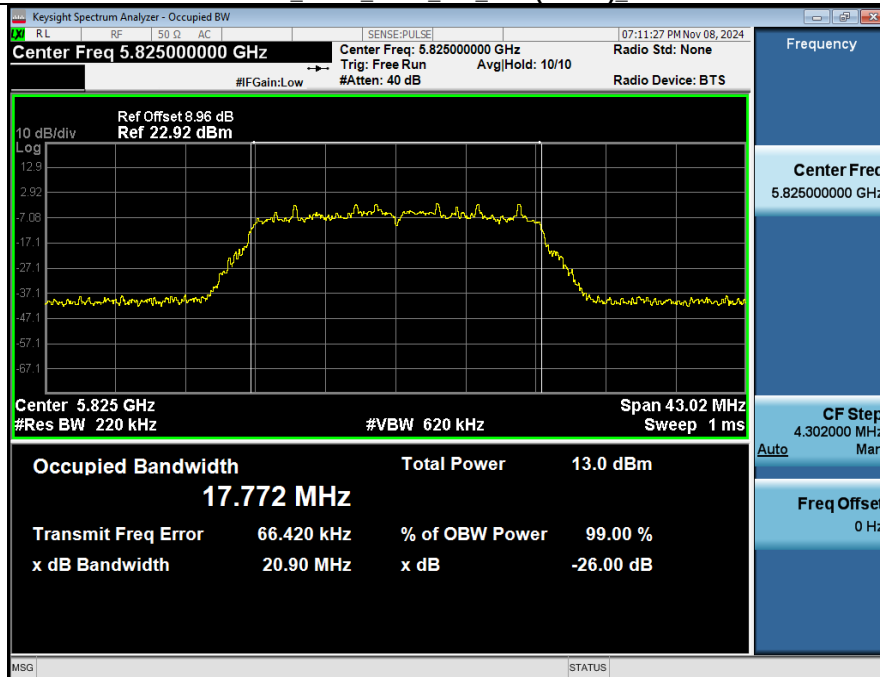


99%_OCB_NVNT_ANT1_802_11ax(HE20)_5745

Appendix B


CN24XTFJ 003

Prüfbericht - Produkte
Test Report - Products

Page 83 of 308

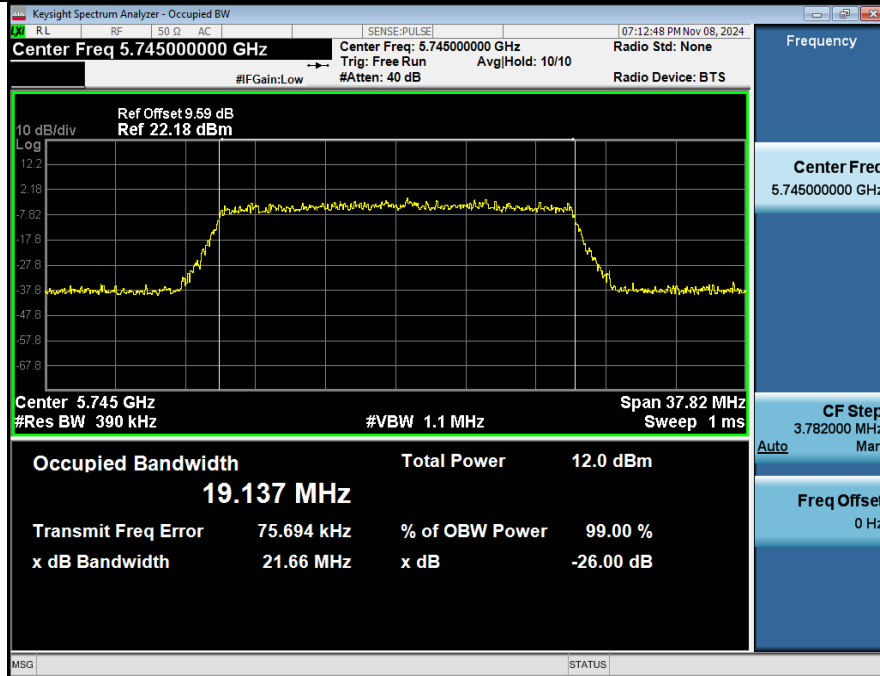

-26BW_NVNT_ANT1_802_11ax(HE20)_5745

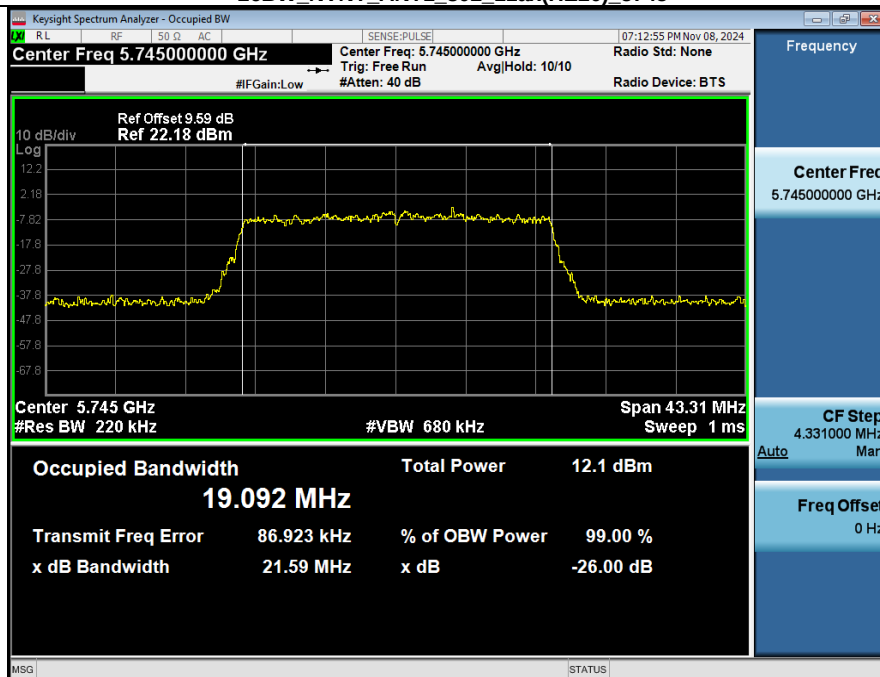

99% OCB_NVNT_ANT2_802_11ax(HE20)_5745


Appendix B

CN24XTFJ 003


Page 84 of 308

Prüfbericht - Produkte

Test Report - Products

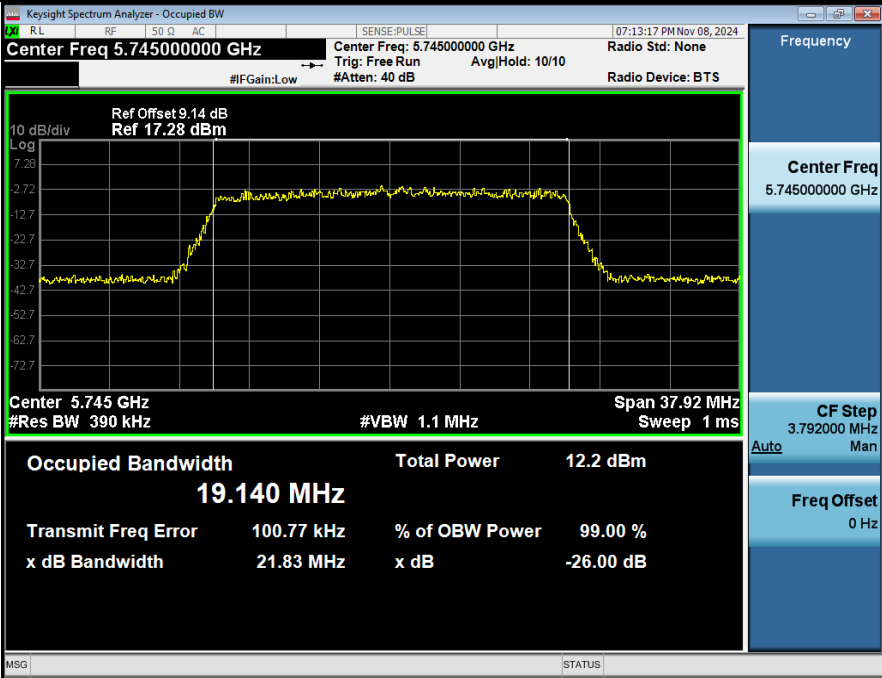

-26BW_NVNT_ANT2_802_11ax(HE20)_5745

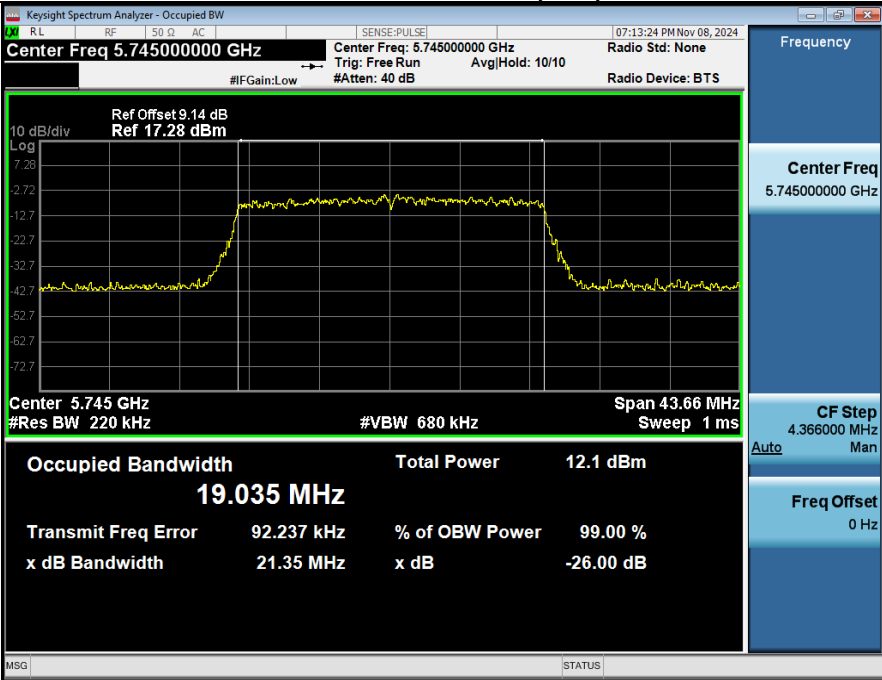

99%_OCB_NVNT_ANT1_802_11ax(HE20)_5785