


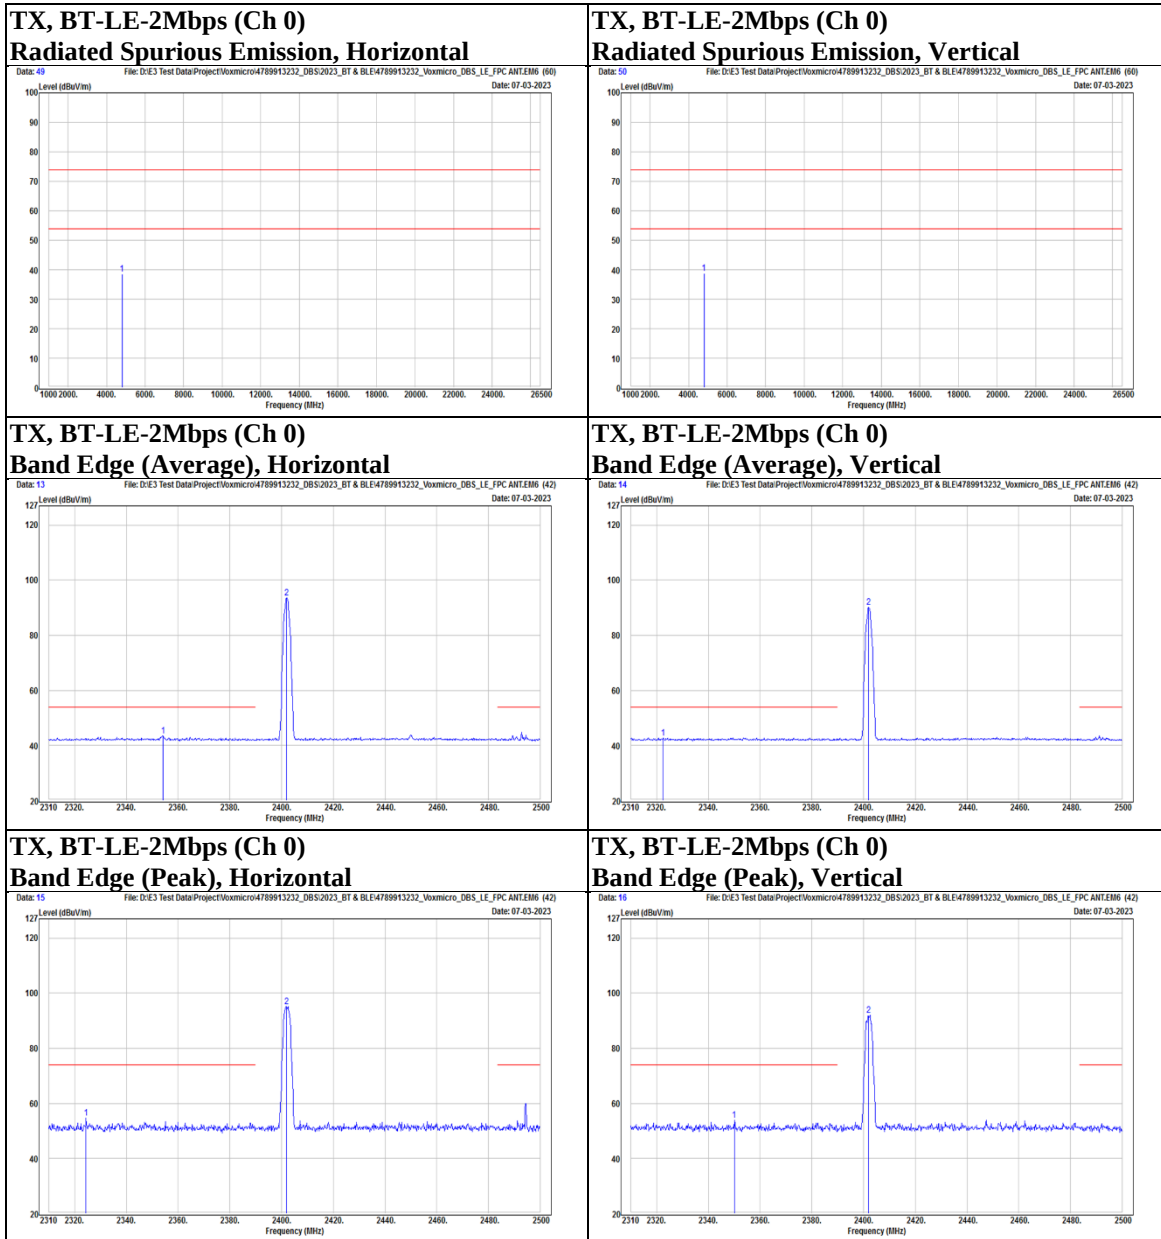

Mode	BT-LE-2Mbps	Channel	19
------	-------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2311.9	31.38	11.96	43.34	54	-10.66	AVG
		2371.18	42.88	11.91	54.79	74	-19.21	PK
	@	2440	84.03	11.99	96.02	N/A	N/A	PK
	@	2440	82.2	11.99	94.19	N/A	N/A	AVG
		2491.07	45.66	11.76	57.42	74	-16.58	PK
		2492.97	32.66	11.76	44.42	54	-9.58	AVG
	*	4880	37.33	2.21	39.54	74	-34.46	PK
	*	7320	33.39	10.25	43.64	74	-30.36	PK
Vertical		2318.36	42.09	11.95	54.04	74	-19.96	PK
		2376.88	30.94	11.89	42.83	54	-11.17	AVG
	@	2440	80.04	11.99	92.03	N/A	N/A	PK
	@	2440	78.49	11.99	90.48	N/A	N/A	AVG
		2490.31	43.22	11.77	54.99	74	-19.01	PK
		2491.07	31.55	11.76	43.31	54	-10.69	AVG
	*	4880	37.19	2.21	39.4	74	-34.6	PK
	*	7320	33.15	10.25	43.4	74	-30.6	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

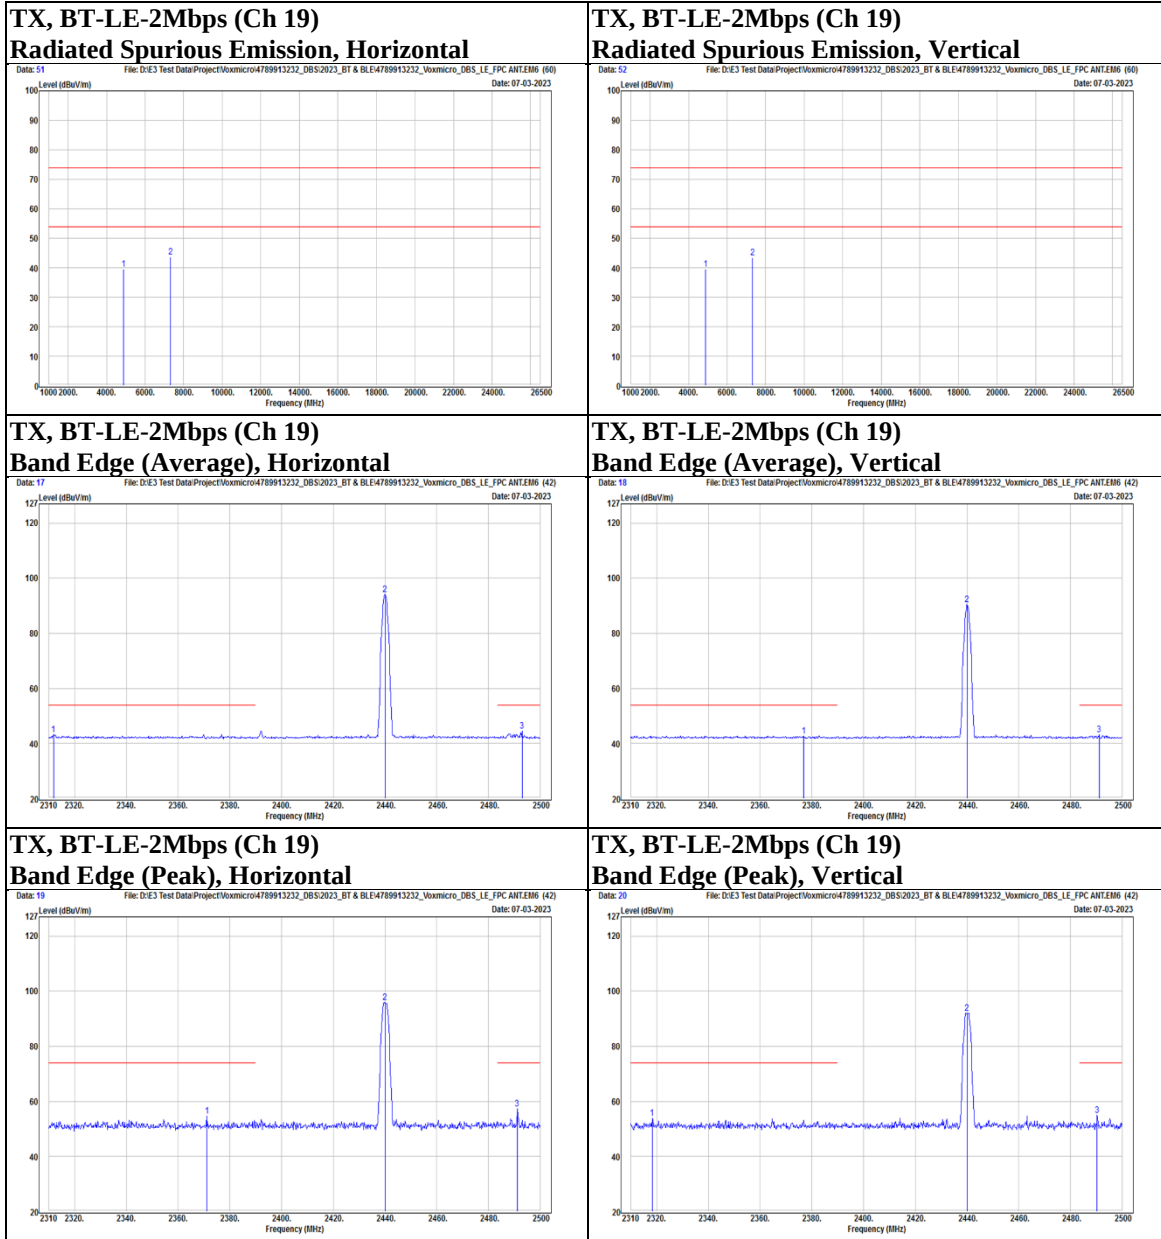

Mode	BT-LE-2Mbps	Channel	39
------	-------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2480	84.13	11.83	95.96	N/A	N/A	PK
	@	2480	82.49	11.83	94.32	N/A	N/A	AVG
		2489.55	32.01	11.77	43.78	54	-10.22	AVG
		2492.78	42.55	11.76	54.31	74	-19.69	PK
	*	4960	37.36	2.3	39.66	74	-34.34	PK
	*	7440	34.49	10.69	45.18	74	-28.82	PK
Vertical	@	2480	81.39	11.83	93.22	N/A	N/A	PK
	@	2480	79.56	11.83	91.39	N/A	N/A	AVG
		2490.88	32.2	11.76	43.96	54	-10.04	AVG
		2498.29	41.19	11.72	52.91	74	-21.09	PK
	*	4960	36.19	2.3	38.49	74	-35.51	PK
	*	7440	33.05	10.69	43.74	74	-30.26	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

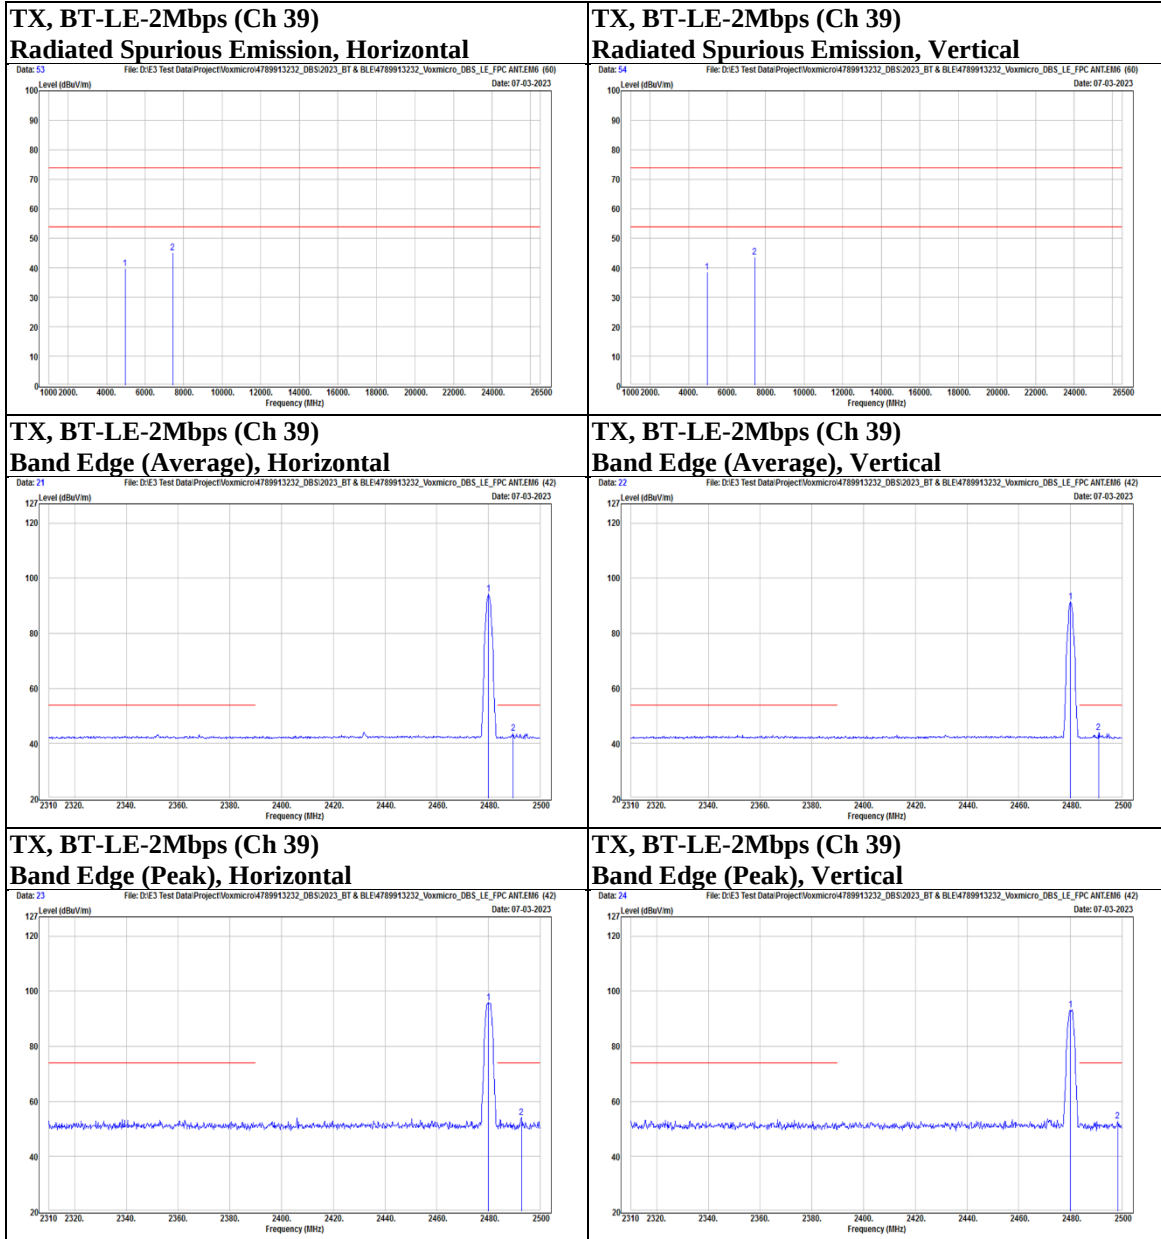


Below 1 GHz

Mode	BT-LE-2Mbps	Channel	0
------	-------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		61.04	46.27	-12.32	33.95	40	-6.05	PK
		99.84	52.73	-16.65	36.08	43.5	-7.42	PK
		126.03	50.52	-14.06	36.46	43.5	-7.04	PK
		146.4	49.16	-12.06	37.1	43.5	-6.4	PK
		199.75	54.36	-14.81	39.55	43.5	-3.95	PK
		331.67	41.03	-9.45	31.58	46	-14.42	PK
Vertical		44.55	47.6	-12.67	34.93	40	-5.07	PK
		62.01	48.69	-12.49	36.2	40	-3.8	PK
		83.35	49.74	-17.06	32.68	40	-7.32	PK
		123.12	47.61	-14.21	33.4	43.5	-10.1	PK
		145.43	47.32	-12.25	35.07	43.5	-8.43	PK
		299.66	44.54	-10.66	33.88	46	-12.12	PK


TX, BT-LE-2Mbps (Ch 0)

Radiated Spurious Emission, Horizontal

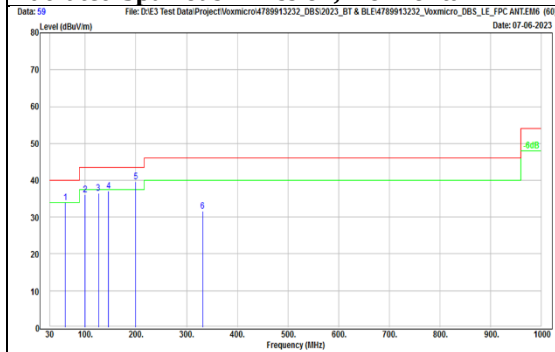

TX, BT-LE-2Mbps (Ch 0)

Radiated Spurious Emission, Vertical

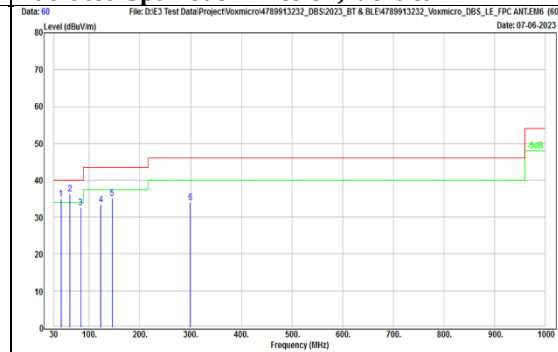

Dipole Antenna

Above 1 GHz

Mode	BT-LE-1Mbps	Channel	0
------	-------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2353.89	33.44	11.94	45.38	54	-8.62	AVG
		2387.14	41.65	11.87	53.52	74	-20.48	PK
	@	2402	85.38	11.85	97.23	N/A	N/A	PK
	@	2402	85.09	11.85	96.94	N/A	N/A	AVG
	*	4804	36.58	2.14	38.72	74	-35.28	PK
Vertical		2353.7	41.7	11.95	53.65	74	-20.35	PK
		2353.89	35.33	11.94	47.27	54	-6.73	AVG
	@	2402	89.95	11.85	101.8	N/A	N/A	PK
	@	2402	89.48	11.85	101.33	N/A	N/A	AVG
	*	4804	36.66	2.14	38.8	74	-35.2	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

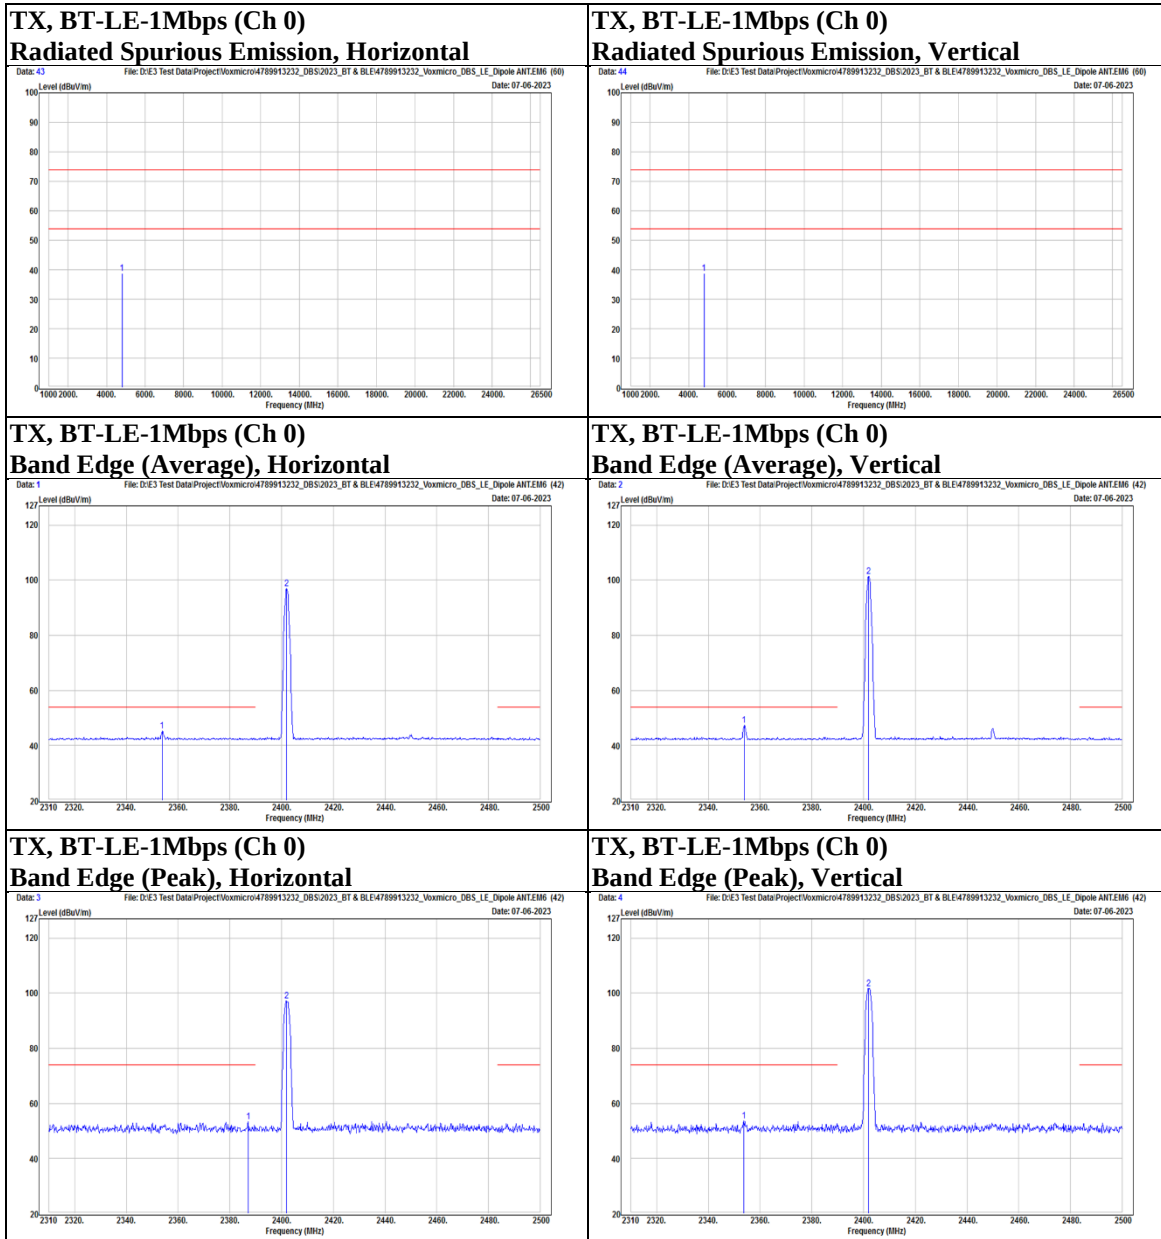

Mode	BT-LE-1Mbps	Channel	19
------	-------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2311.52	41.53	11.96	53.49	74	-20.51	PK
		2312.28	32.47	11.96	44.43	54	-9.57	AVG
	@	2440	85	11.99	96.99	N/A	N/A	PK
	@	2440	84.48	11.99	96.47	N/A	N/A	AVG
		2488.03	32.69	11.79	44.48	54	-9.52	AVG
		2496.01	40.85	11.73	52.58	74	-21.42	PK
	*	4880	37.74	2.21	39.95	74	-34.05	PK
	*	7320	33.17	10.25	43.42	74	-30.58	PK
Vertical		2311.9	41	11.96	52.96	74	-21.04	PK
		2312.28	34	11.96	45.96	54	-8.04	AVG
	@	2440	90.04	11.99	102.03	N/A	N/A	PK
	@	2440	89.52	11.99	101.51	N/A	N/A	AVG
		2487.84	35.2	11.79	46.99	54	-7.01	AVG
		2488.41	42.21	11.78	53.99	74	-20.01	PK
	*	4880	36.79	2.21	39	74	-35	PK
	*	7320	34.24	10.25	44.49	74	-29.51	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

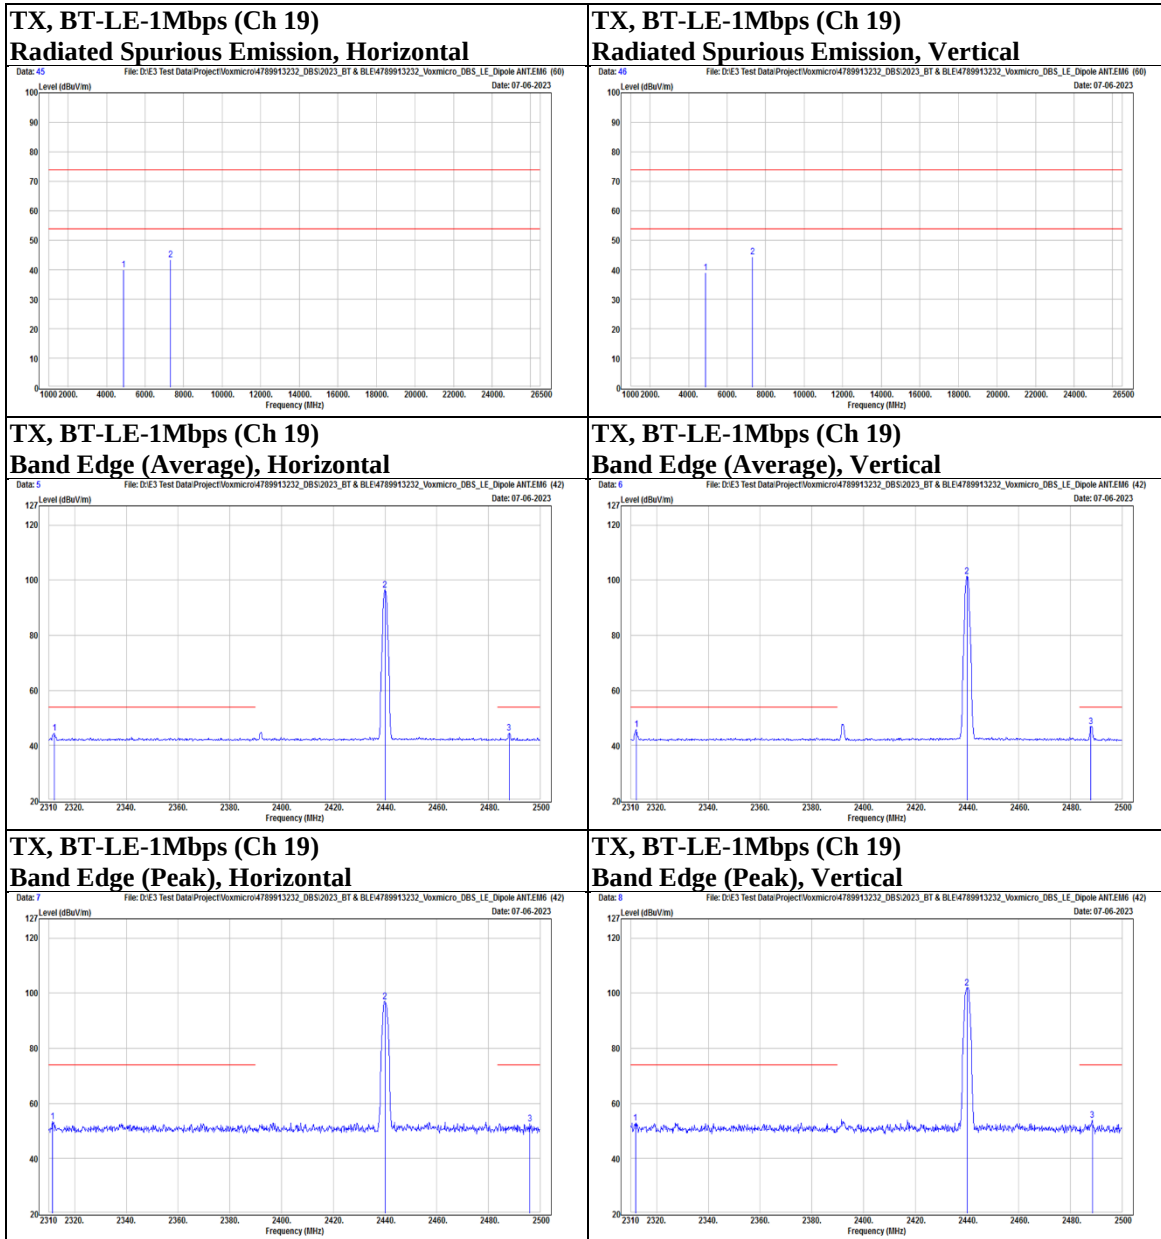

Mode	BT-LE-1Mbps	Channel	39
------	-------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2480	84.71	11.83	96.54	N/A	N/A	PK
	@	2480	84.01	11.83	95.84	N/A	N/A	AVG
		2484.99	40.92	11.8	52.72	74	-21.28	PK
		2484.99	31.11	11.8	42.91	54	-11.09	AVG
	*	4960	36.96	2.3	39.26	74	-34.74	PK
	*	7440	32.47	10.69	43.16	74	-30.84	PK
Vertical	@	2480	89.62	11.83	101.45	N/A	N/A	PK
	@	2480	89.02	11.83	100.85	N/A	N/A	AVG
		2486.13	31.01	11.79	42.8	54	-11.2	AVG
		2487.46	41.81	11.79	53.6	74	-20.4	PK
	*	4960	36.41	2.3	38.71	74	-35.29	PK
	*	7440	32.3	10.69	42.99	74	-31.01	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

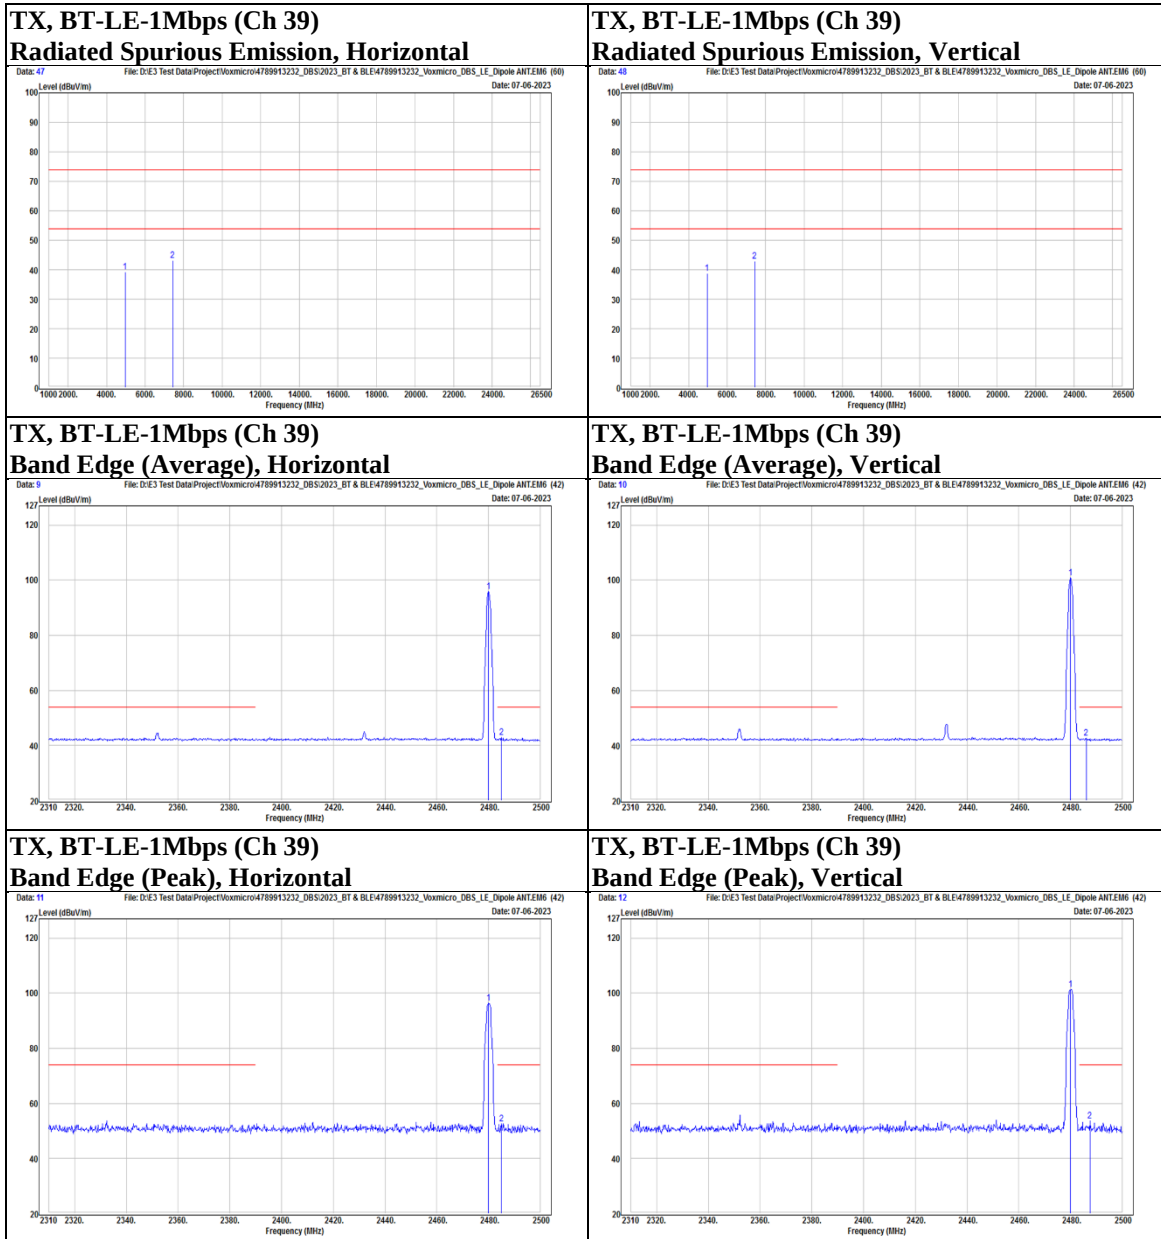

Mode	BT-LE-2Mbps	Channel	0
------	-------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2318.36	40.86	11.95	52.81	74	-21.19	PK
		2354.08	32.03	11.94	43.97	54	-10.03	AVG
	@	2402	85.63	11.85	97.48	N/A	N/A	PK
	@	2402	83.61	11.85	95.46	N/A	N/A	AVG
	*	4804	36.92	2.14	39.06	74	-34.94	PK
Vertical		2353.89	43.84	11.94	55.78	74	-18.22	PK
		2353.89	34.15	11.94	46.09	54	-7.91	AVG
	@	2402	89.53	11.85	101.38	N/A	N/A	PK
	@	2402	87.8	11.85	99.65	N/A	N/A	AVG
	*	4804	36.91	2.14	39.05	74	-34.95	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

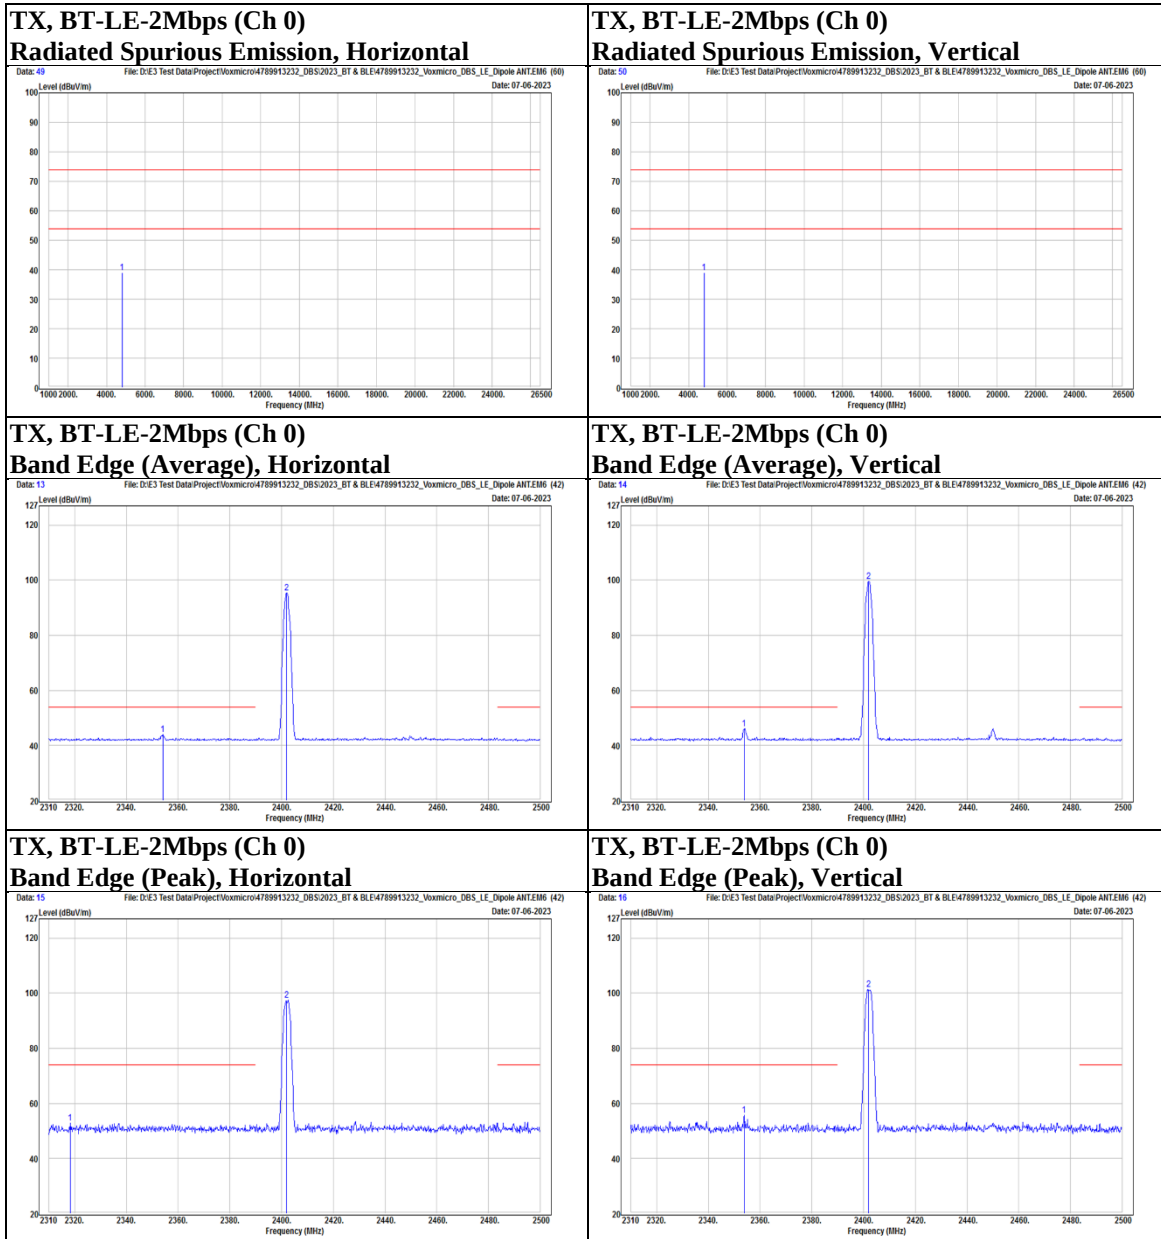

Mode	BT-LE-2Mbps	Channel	19
------	-------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2312.28	32.3	11.96	44.26	54	-9.74	AVG
		2386.95	41.67	11.87	53.54	74	-20.46	PK
	@	2440	84.62	11.99	96.61	N/A	N/A	PK
	@	2440	81.56	11.99	93.55	N/A	N/A	AVG
		2484.04	40.49	11.81	52.3	74	-21.7	PK
		2488.22	32.06	11.78	43.84	54	-10.16	AVG
	*	4880	36.21	2.21	38.42	74	-35.58	PK
	*	7320	34.13	10.25	44.38	74	-29.62	PK
Vertical		2312.28	33.4	11.96	45.36	54	-8.64	AVG
		2383.15	41.42	11.88	53.3	74	-20.7	PK
	@	2440	89.64	11.99	101.63	N/A	N/A	PK
	@	2440	88.07	11.99	100.06	N/A	N/A	AVG
		2488.03	34.05	11.79	45.84	54	-8.16	AVG
		2488.41	41.17	11.78	52.95	74	-21.05	PK
	*	4880	36.2	2.21	38.41	74	-35.59	PK
	*	7320	33.1	10.25	43.35	74	-30.65	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

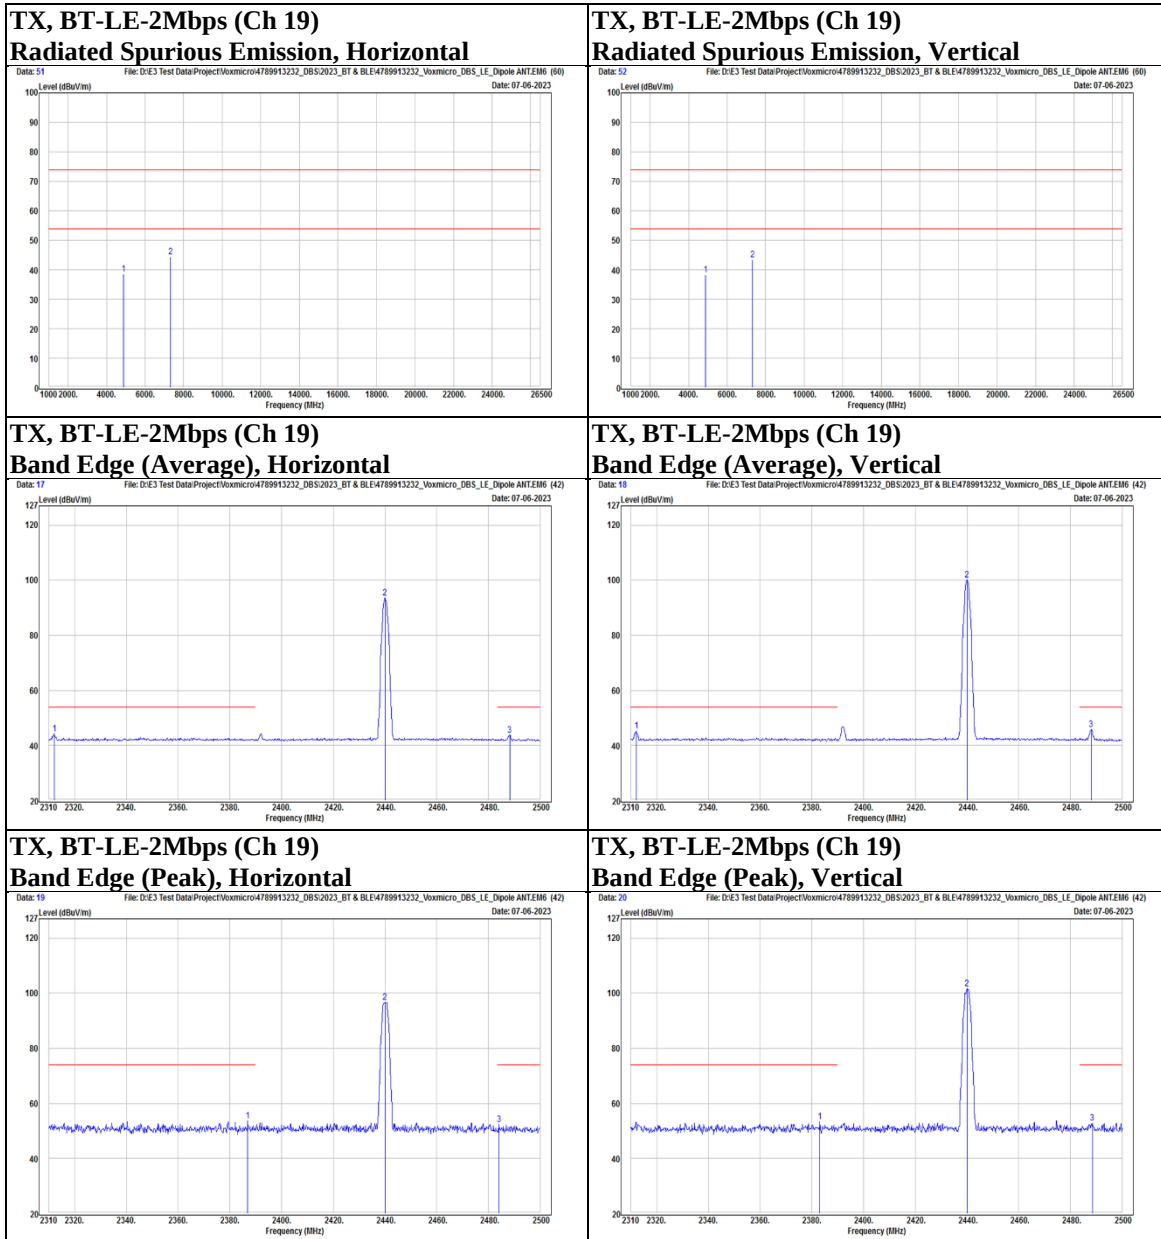

Mode	BT-LE-2Mbps	Channel	39
------	-------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2480	84.42	11.83	96.25	N/A	N/A	PK
	@	2480	82.24	11.83	94.07	N/A	N/A	AVG
		2487.27	40.19	11.79	51.98	74	-22.02	PK
		2487.46	30.63	11.79	42.42	54	-11.58	AVG
	*	4960	36.45	2.3	38.75	74	-35.25	PK
	*	7440	33.23	10.69	43.92	74	-30.08	PK
Vertical	@	2480	89.28	11.83	101.11	N/A	N/A	PK
	@	2480	87.02	11.83	98.85	N/A	N/A	AVG
		2484.42	41.82	11.8	53.62	74	-20.38	PK
		2495.82	30.97	11.73	42.7	54	-11.3	AVG
	*	4960	36.73	2.3	39.03	74	-34.97	PK
	*	7440	32.97	10.69	43.66	74	-30.34	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

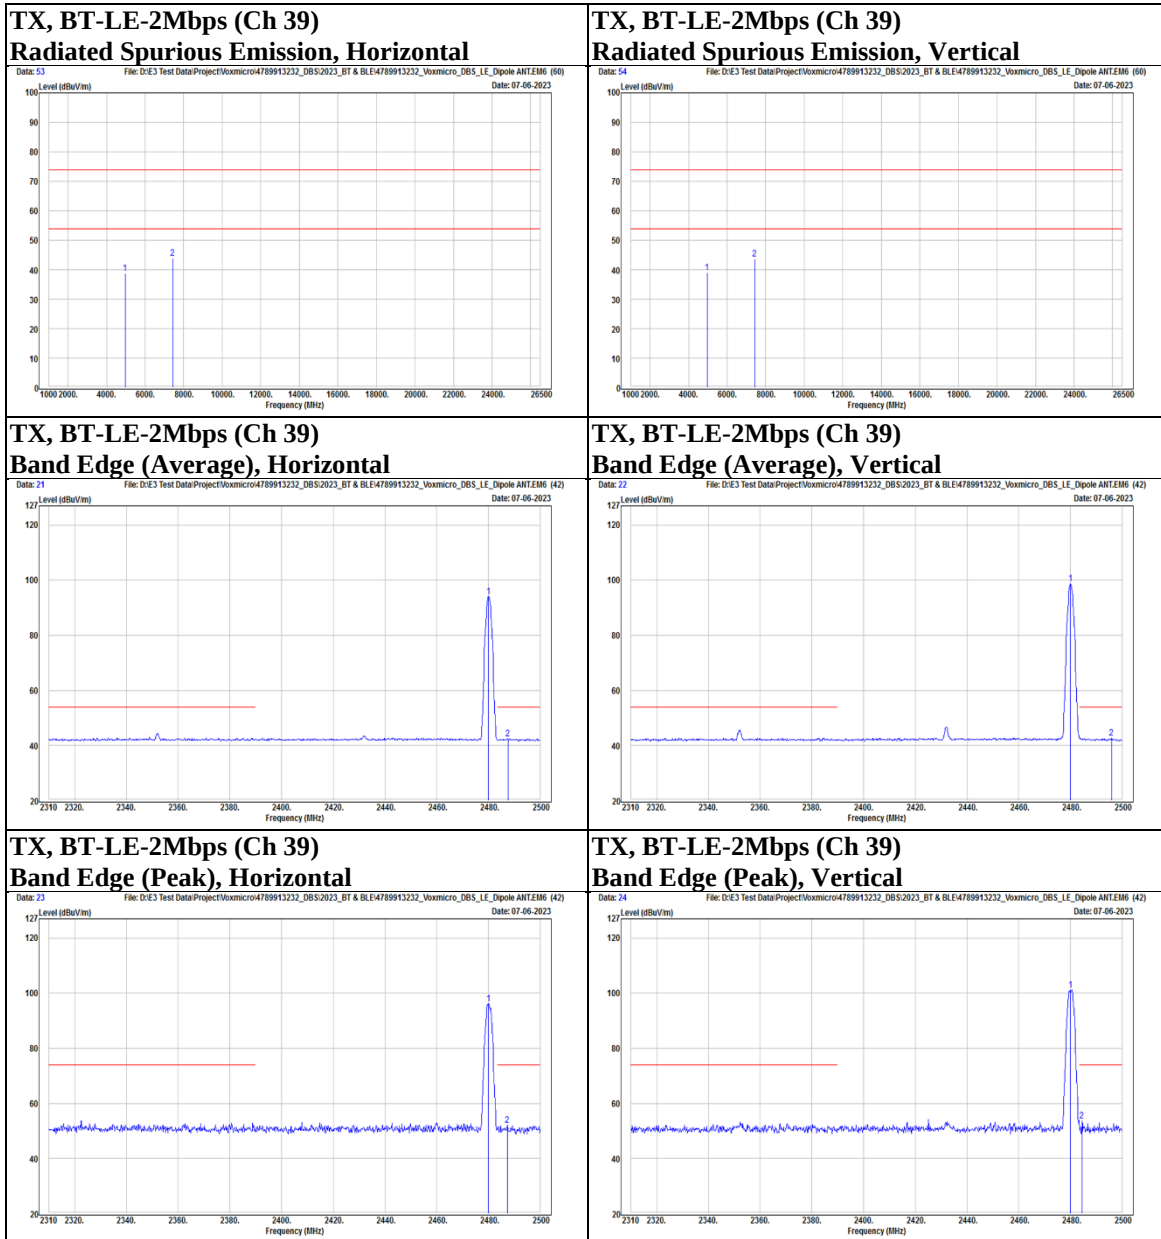


Below 1 GHz

Mode	BT-LE-2Mbps	Channel	0
------	-------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		62.01	48.81	-12.49	36.32	40	-3.68	PK
		99.84	52.02	-16.65	35.37	43.5	-8.13	PK
		144.46	50.01	-12.26	37.75	43.5	-5.75	PK
		159.01	50.14	-11.69	38.45	43.5	-5.05	PK
		199.75	54.72	-14.81	39.91	43.5	-3.59	PK
		698.33	35.27	-0.77	34.5	46	-11.5	PK
Vertical		44.55	46.42	-12.67	33.75	40	-6.25	PK
		62.01	48.85	-12.49	36.36	40	-3.64	PK
		84.32	49.95	-17.33	32.62	40	-7.38	PK
		142.52	47.12	-12.42	34.7	43.5	-8.8	PK
		299.66	42.14	-10.66	31.48	46	-14.52	PK
		331.67	41.46	-9.45	32.01	46	-13.99	PK


TX, BT-LE-2Mbps (Ch 0)

Radiated Spurious Emission, Horizontal

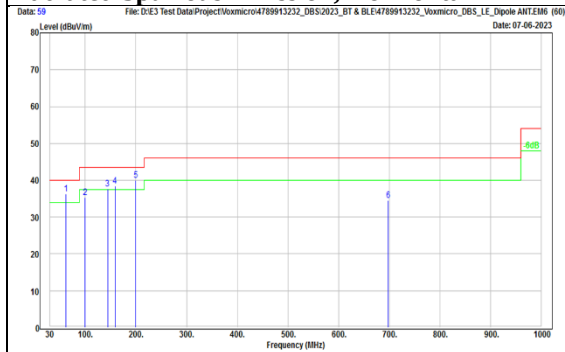

TX, BT-LE-2Mbps (Ch 0)

Radiated Spurious Emission, Vertical

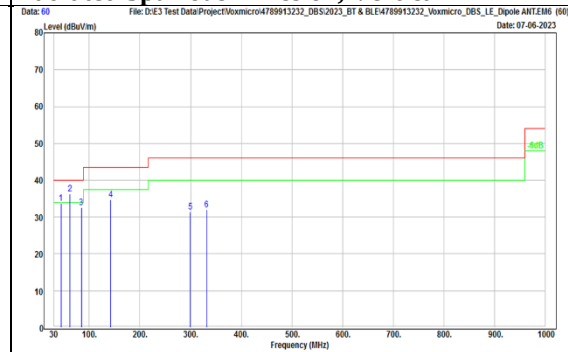

PCB Antenna

Above 1 GHz

Mode	BT-LE-1Mbps	Channel	0
------	-------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2339.83	42.9	11.95	54.85	74	-19.15	PK
		2353.89	31.38	11.94	43.32	54	-10.68	AVG
	@	2402	81.93	11.85	93.78	N/A	N/A	PK
	@	2402	80.63	11.85	92.48	N/A	N/A	AVG
		2496.96	42.76	11.72	54.48	74	-19.52	PK
	*	4804	36.87	2.14	39.01	74	-34.99	PK
Vertical		2353.7	44.11	11.95	56.06	74	-17.94	PK
		2354.08	37.19	11.94	49.13	54	-4.87	AVG
	@	2402	93.65	11.85	105.5	N/A	N/A	PK
	@	2402	93.16	11.85	105.01	N/A	N/A	AVG
		2491.26	42.39	11.76	54.15	74	-19.85	PK
	*	4804	36.61	2.14	38.75	74	-35.25	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

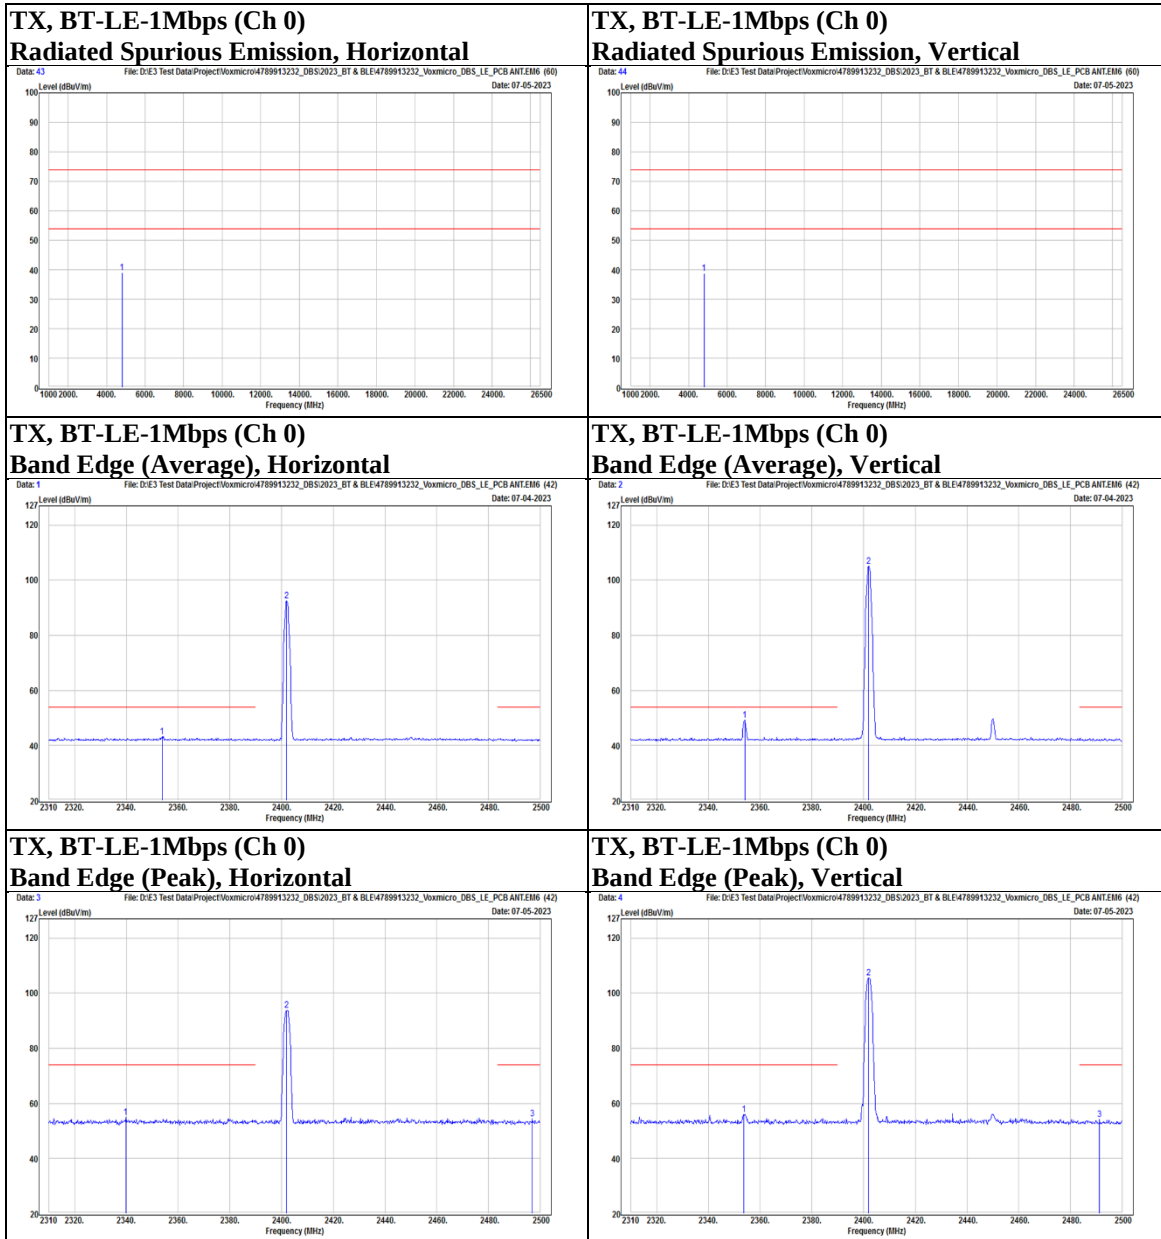

Mode	BT-LE-1Mbps	Channel	19
------	-------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2313.99	41.06	11.95	53.01	74	-20.99	PK
		2355.22	31.07	11.94	43.01	54	-10.99	AVG
	@	2440	82.79	11.99	94.78	N/A	N/A	PK
	@	2440	82.45	11.99	94.44	N/A	N/A	AVG
		2487.84	31.63	11.79	43.42	54	-10.58	AVG
		2494.3	40.68	11.75	52.43	74	-21.57	PK
	*	4880	37.18	2.21	39.39	74	-34.61	PK
	*	7320	33.2	10.25	43.45	74	-30.55	PK
Vertical		2312.09	37.53	11.96	49.49	54	-4.51	AVG
		2312.66	43.89	11.95	55.84	74	-18.16	PK
	@	2440	94.11	11.99	106.1	N/A	N/A	PK
	@	2440	93.43	11.99	105.42	N/A	N/A	AVG
		2487.84	38.24	11.79	50.03	54	-3.97	AVG
		2498.48	43.51	11.72	55.23	74	-18.77	PK
	*	4880	36.13	2.21	38.34	74	-35.66	PK
	*	7320	33.81	10.25	44.06	74	-29.94	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

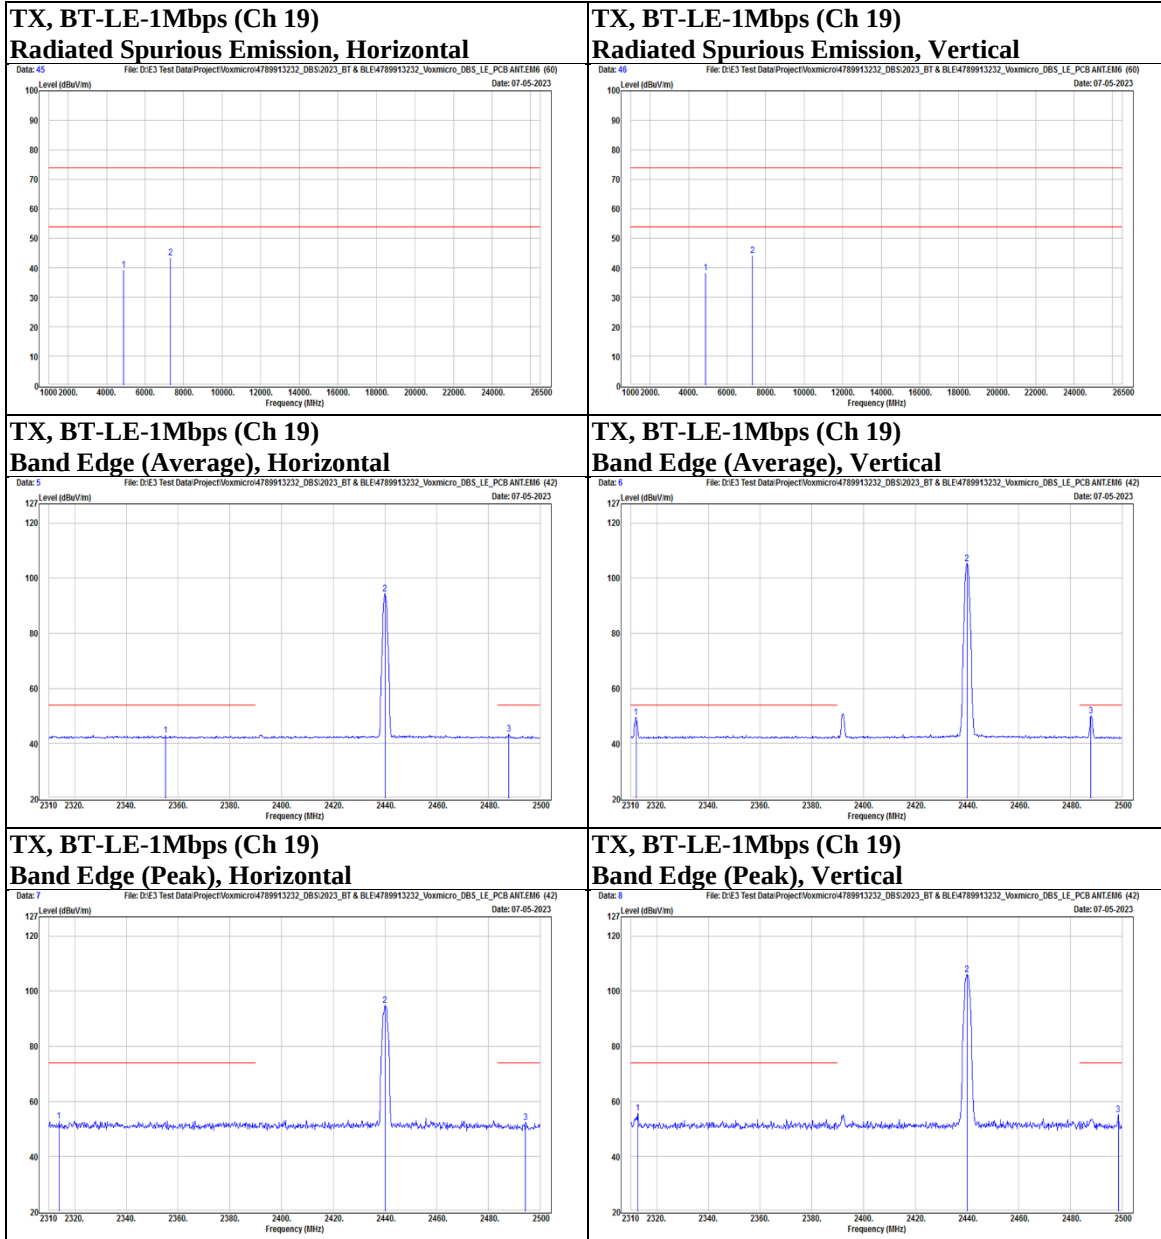

Mode	BT-LE-1Mbps	Channel	39
------	-------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2480	81.83	11.83	93.66	N/A	N/A	PK
	@	2480	81.06	11.83	92.89	N/A	N/A	AVG
		2489.93	41.17	11.77	52.94	74	-21.06	PK
		2498.48	30.95	11.72	42.67	54	-11.33	AVG
	*	4960	36.77	2.3	39.07	74	-34.93	PK
	*	7440	32.61	10.69	43.3	74	-30.7	PK
Vertical	@	2480	93.05	11.83	104.88	N/A	N/A	PK
	@	2480	92.42	11.83	104.25	N/A	N/A	AVG
		2484.99	31.27	11.8	43.07	54	-10.93	AVG
		2485.37	41.07	11.8	52.87	74	-21.13	PK
	*	4960	37.76	2.3	40.06	74	-33.94	PK
	*	7440	33.47	10.69	44.16	74	-29.84	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

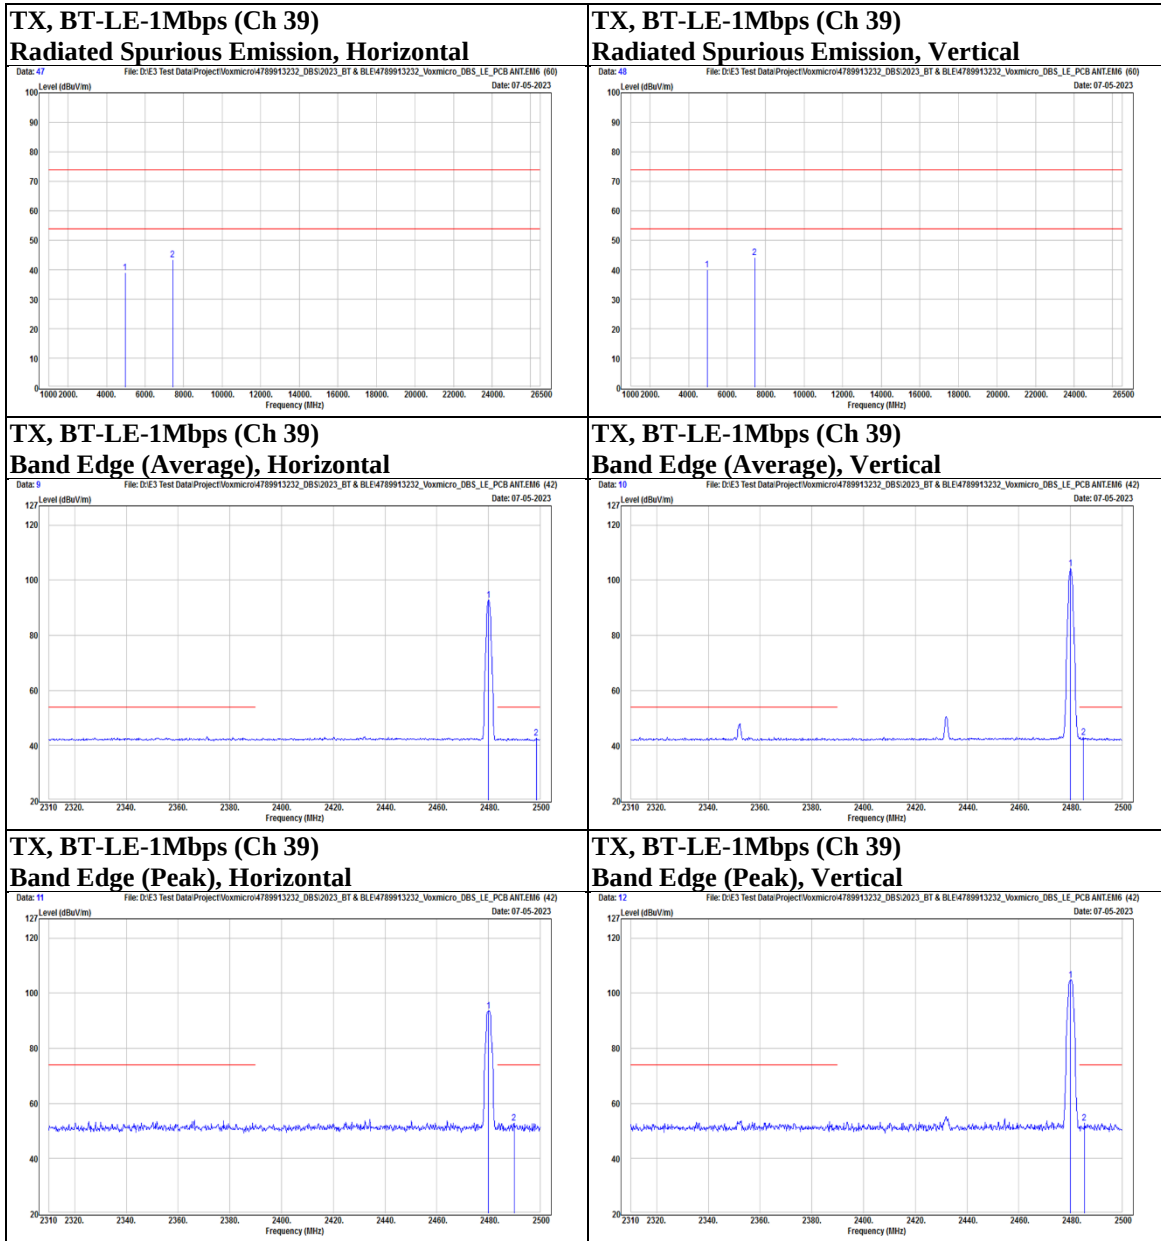

Mode	BT-LE-2Mbps	Channel	0
------	-------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2322.73	30.98	11.95	42.93	54	-11.07	AVG
		2365.48	41.94	11.91	53.85	74	-20.15	PK
	@	2402	81.19	11.85	93.04	N/A	N/A	PK
	@	2402	79.63	11.85	91.48	N/A	N/A	AVG
	*	4804	36.74	2.14	38.88	74	-35.12	PK
Vertical		2353.89	42.27	11.94	54.21	74	-19.79	PK
		2354.08	36.28	11.94	48.22	54	-5.78	AVG
	@	2402	93.22	11.85	105.07	N/A	N/A	PK
	@	2402	91.26	11.85	103.11	N/A	N/A	AVG
	*	4804	36.09	2.14	38.23	74	-35.77	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

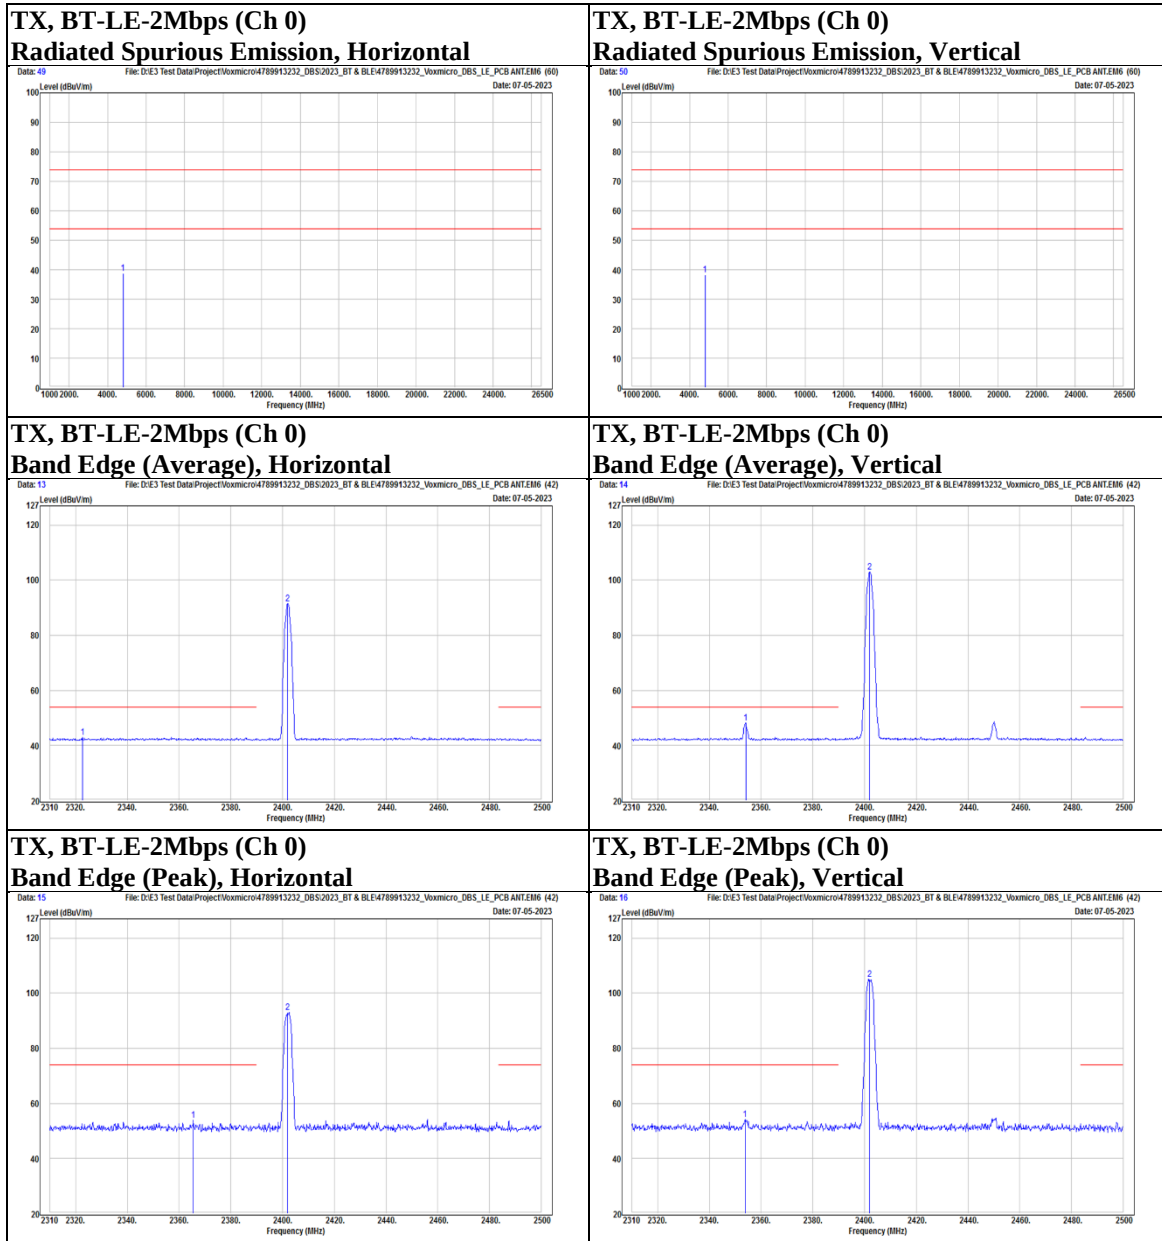

Mode	BT-LE-2Mbps	Channel	19
------	-------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2337.36	41.32	11.96	53.28	74	-20.72	PK
		2374.6	31.17	11.89	43.06	54	-10.94	AVG
	@	2440	82.59	11.99	94.58	N/A	N/A	PK
	@	2440	81.26	11.99	93.25	N/A	N/A	AVG
		2486.7	41.38	11.8	53.18	74	-20.82	PK
		2493.16	31.11	11.75	42.86	54	-11.14	AVG
	*	4880	37.15	2.21	39.36	74	-34.64	PK
	*	7320	33.71	10.25	43.96	74	-30.04	PK
Vertical		2312.09	36.8	11.96	48.76	54	-5.24	AVG
		2312.66	43.3	11.95	55.25	74	-18.75	PK
	@	2440	93.59	11.99	105.58	N/A	N/A	PK
	@	2440	92.02	11.99	104.01	N/A	N/A	AVG
		2488.03	36.68	11.79	48.47	54	-5.53	AVG
		2488.79	43.06	11.78	54.84	74	-19.16	PK
	*	4880	35.92	2.21	38.13	74	-35.87	PK
	*	7320	33.14	10.25	43.39	74	-30.61	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

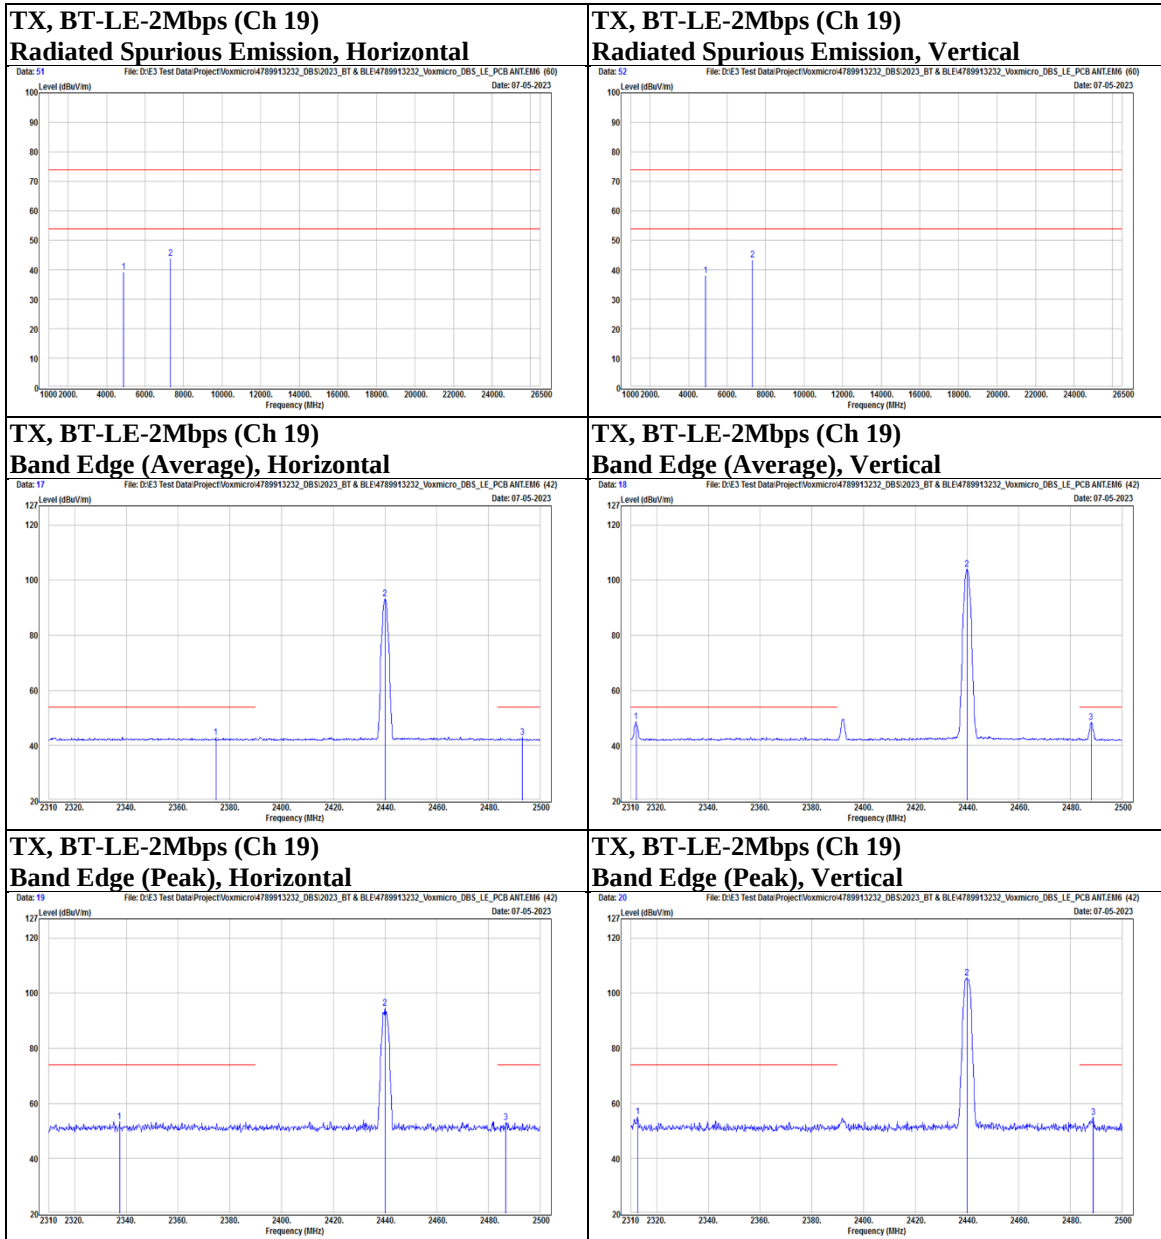

Mode	BT-LE-2Mbps	Channel	39
------	-------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2480	80.85	11.83	92.68	N/A	N/A	PK
	@	2480	79.47	11.83	91.3	N/A	N/A	AVG
		2489.17	42.15	11.78	53.93	74	-20.07	PK
		2490.5	30.86	11.77	42.63	54	-11.37	AVG
	*	4960	37.48	2.3	39.78	74	-34.22	PK
	*	7440	34.06	10.69	44.75	74	-29.25	PK
Vertical	@	2480	93.08	11.83	104.91	N/A	N/A	PK
	@	2480	91.18	11.83	103.01	N/A	N/A	AVG
		2483.66	31.44	11.81	43.25	54	-10.75	AVG
		2499.05	40.57	11.72	52.29	74	-21.71	PK
	*	4960	37.05	2.3	39.35	74	-34.65	PK
	*	7440	33.25	10.69	43.94	74	-30.06	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

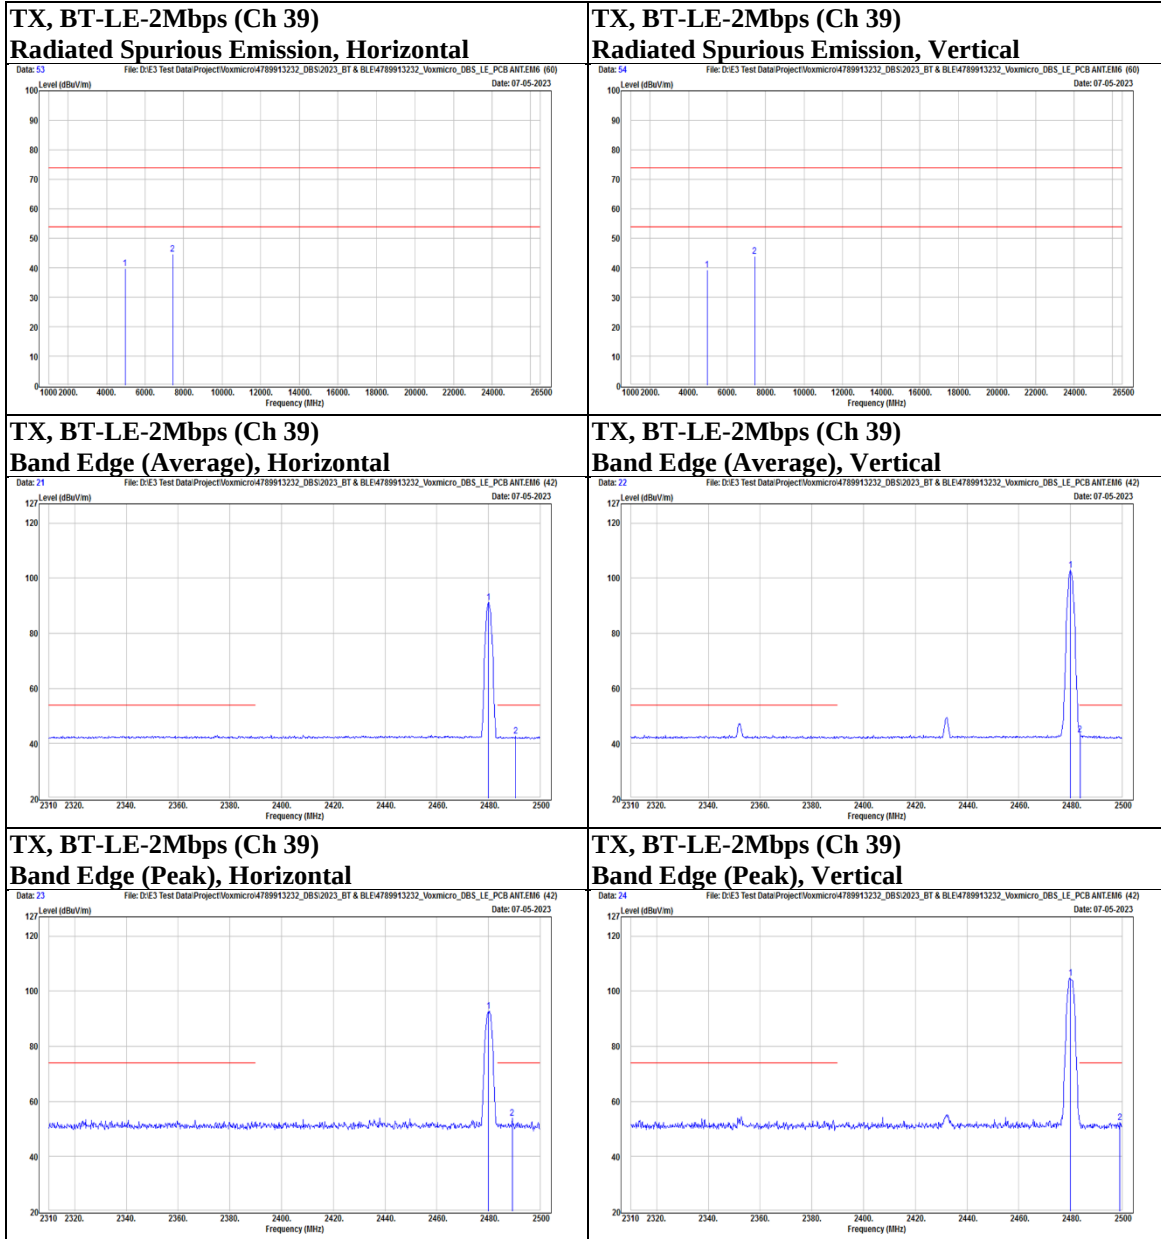


Below 1 GHz

Mode	BT-LE-2Mbps	Channel	0
------	-------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		62.01	49.65	-12.49	37.16	40	-2.84	PK
		106.63	51.85	-15.26	36.59	43.5	-6.91	PK
		120.21	49.26	-14.36	34.9	43.5	-8.6	PK
		145.43	47.51	-12.25	35.26	43.5	-8.24	PK
		198.78	53.75	-14.82	38.93	43.5	-4.57	PK
		332.64	39.89	-9.45	30.44	46	-15.56	PK
Vertical		44.55	47.48	-12.67	34.81	40	-5.19	PK
		62.01	48.56	-12.49	36.07	40	-3.93	PK
		82.38	49.63	-16.74	32.89	40	-7.11	PK
		139.61	45.59	-12.7	32.89	43.5	-10.61	PK
		298.69	44.04	-10.67	33.37	46	-12.63	PK
		331.67	42.2	-9.45	32.75	46	-13.25	PK


TX, BT-LE-2Mbps (Ch 0)

Radiated Spurious Emission, Horizontal

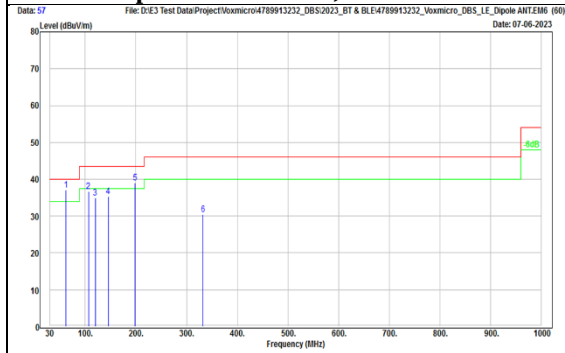

TX, BT-LE-2Mbps (Ch 0)

Radiated Spurious Emission, Vertical

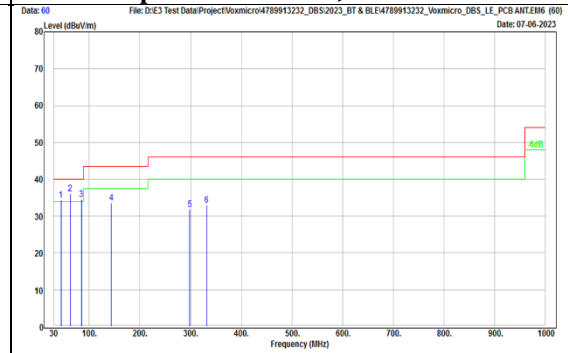

Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

9 kHz ~ 30 MHz Data:

For 9 kHz to 30 MHz radiated emission have performed all modes of operation were investigated. The amplitude of spurious emissions attenuated more than 20 dB below the permissible value is not required to be report.

No non-compliance noted:

KDB 414788 D01 OATS and Chamber Correlation Justification

- Base on FCC 15.31 (f) (2): measurements may be performed at a distance closer than that specified in the regulations; however, an attempt should be made to avoid making measurements in the near field.
- OATs and chamber correlation testing had been performed and chamber measured test results is the worst case test result.

Although these tests were performed other than open area test site, adequate comparison measurements were confirmed against 30m open area test site. Therefore sufficient tests were made to demonstrate that the alternative site produces results that correlate with the ones of tests made in an open field based on KDB 414788.

9.6. AC Power Line Conducted Emission

Requirements

Frequency (MHz)	Conducted limit (dB μ V)	
	Quasi-peak	Average
0.15 - 0.5	66 - 56	56 - 46
0.50 - 5.0	56	46
5.0 - 30	60	50

Note:

1. The lower limit shall apply at the transition frequencies.
2. The limit decreases in line with the logarithm of the frequency in the range of 0.15 to 0.50MHz.

Test Procedures

- a. The EUT was placed 0.4 meters from the conducting wall of the shielded room with EUT being connected to the power mains through a line impedance stabilization network (LISN). Other support units were connected to the power mains through another LISN. The two LISNs provide 50 ohm/ 50uH of coupling impedance for the measuring instrument.
- b. Both lines of the power mains connected to the EUT were checked for maximum conducted interference.
- c. The frequency range from 150kHz to 30MHz was searched. Emission levels under (Limit - 20dB) was not recorded.

NOTE:

1. The resolution bandwidth and video bandwidth of test receiver is 9kHz for quasi-peak detection (QP) and average detection (AV) at frequency 0.15MHz-30MHz.
2. All modes of operation were investigated (includes all external accessories) and the worst-case emissions are reported, the other emission levels were low against the limit.
3. Test data of Result value (dBuV) = Reading value (dBuV) + Correction Factor (dB).
4. Test data of Margin(dB) = Result value (dBuV) - Limit value (dBuV).
5. Test data of Correction Factor (dB) = Insertion loss(dB) + Cable loss(dB).

Underwriters Laboratories Taiwan Co., Ltd.


Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

Test Setup

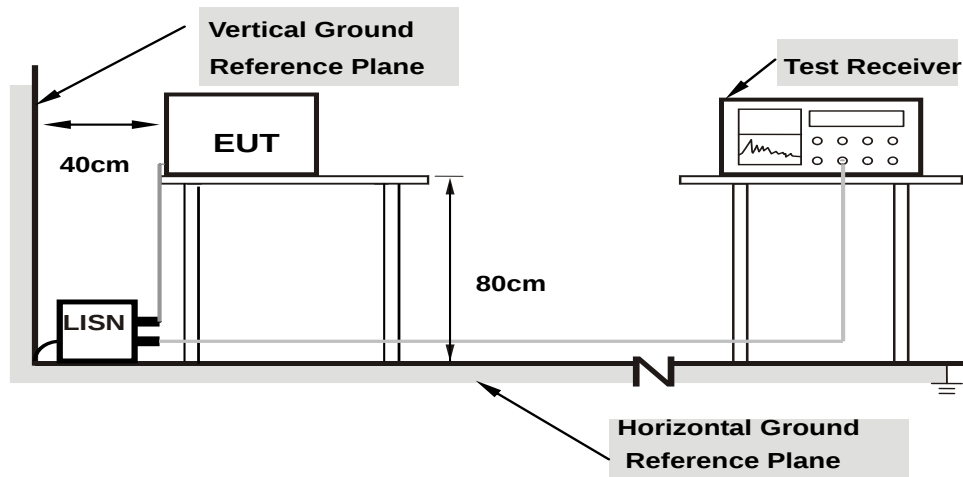


Note: 1.Support units were connected to second LISN.

For the actual test configuration, please refer to the Setup Configurations.

Test Data

Mode	LE2M_TX2402	Channel	0
------	-------------	---------	---

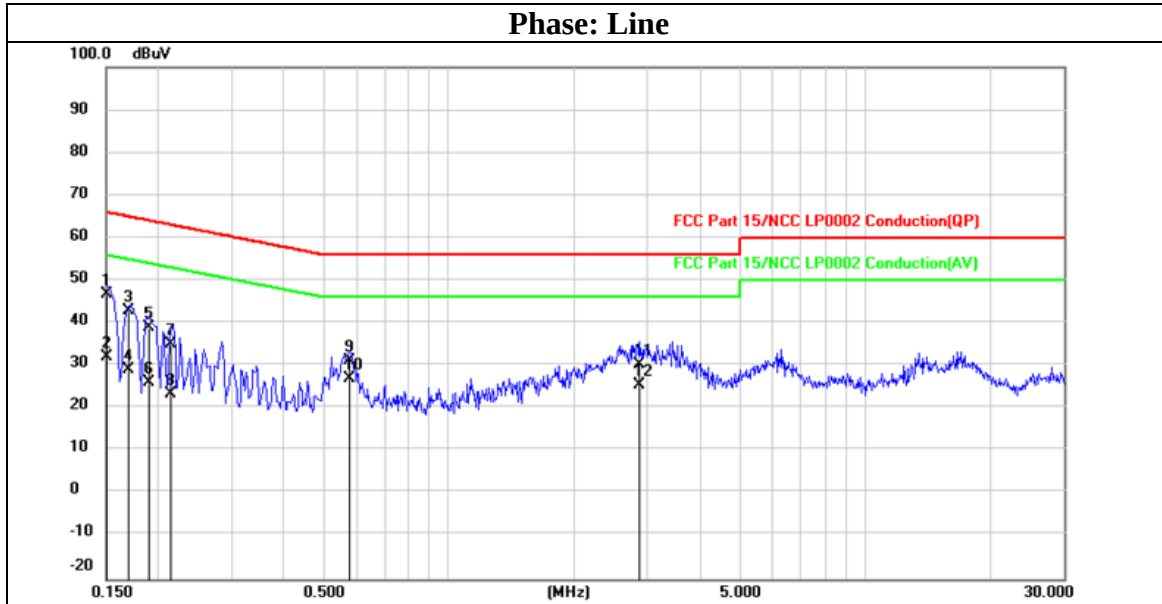

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1500	27.36	19.54	46.90	66.00	-19.10	QP
2	0.1500	12.53	19.54	32.07	56.00	-23.93	AVG
3	0.1700	23.16	19.54	42.70	64.96	-22.26	QP
4	0.1700	9.54	19.54	29.08	54.96	-25.88	AVG
5	0.1900	19.54	19.53	39.07	64.04	-24.97	QP
6	0.1900	6.42	19.53	25.95	54.04	-28.09	AVG
7	0.2140	15.64	19.53	35.17	63.05	-27.88	QP
8	0.2140	3.73	19.53	23.26	53.05	-29.79	AVG
9	0.5780	11.59	19.52	31.11	56.00	-24.89	QP
10	0.5780	7.38	19.52	26.90	46.00	-19.10	AVG
11	2.8820	10.70	19.56	30.26	56.00	-25.74	QP
12	2.8820	5.88	19.56	25.44	46.00	-20.56	AVG

Underwriters Laboratories Taiwan Co., Ltd.


Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

Mode	LE2M_TX2402	Channel	0
------	-------------	---------	---

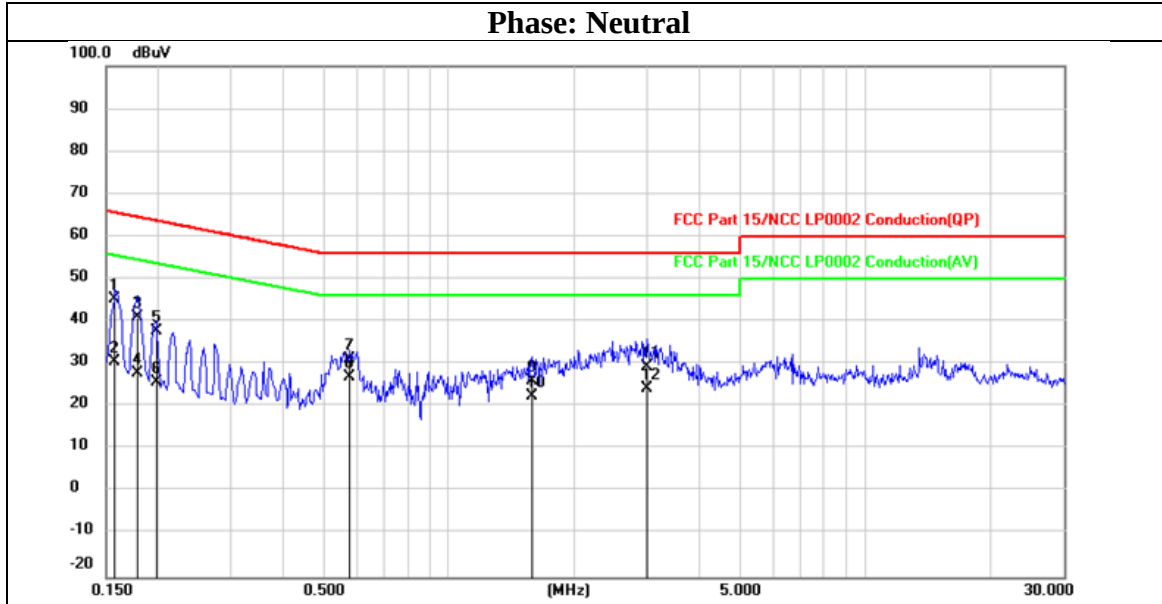

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1580	25.69	19.54	45.23	65.57	-20.34	QP
2	0.1580	10.95	19.54	30.49	55.57	-25.08	AVG
3	0.1780	21.60	19.53	41.13	64.58	-23.45	QP
4	0.1780	8.39	19.53	27.92	54.58	-26.66	AVG
5	0.1980	18.30	19.53	37.83	63.69	-25.86	QP
6	0.1980	6.21	19.53	25.74	53.69	-27.95	AVG
7	0.5780	11.61	19.52	31.13	56.00	-24.87	QP
8	0.5780	7.47	19.52	26.99	46.00	-19.01	AVG
9	1.5780	6.53	19.54	26.07	56.00	-29.93	QP
10	1.5780	2.81	19.54	22.35	46.00	-23.65	AVG
11	2.9940	9.93	19.56	29.49	56.00	-26.51	QP
12	2.9940	4.80	19.56	24.36	46.00	-21.64	AVG

END OF REPORT

Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1