




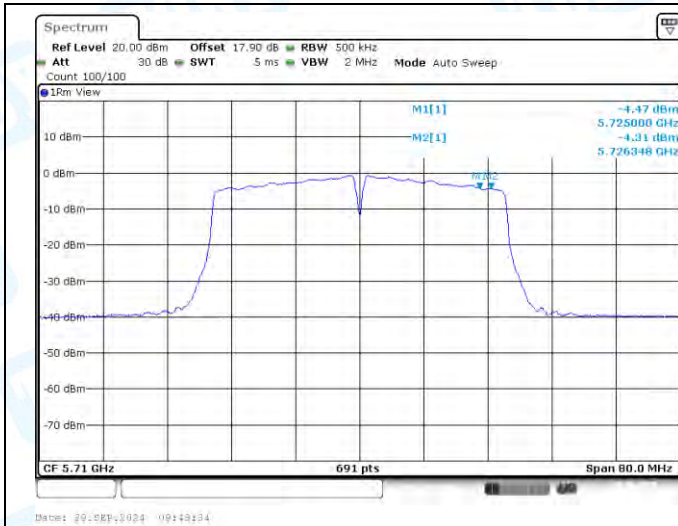

11N40-CDD-Ant1-5710_UNII-3-PASS

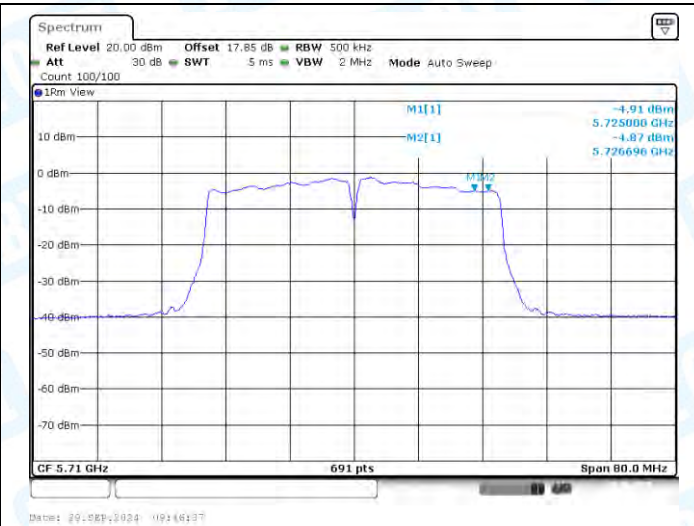

11N40-CDD-Ant2-5710_UNII-3-PASS

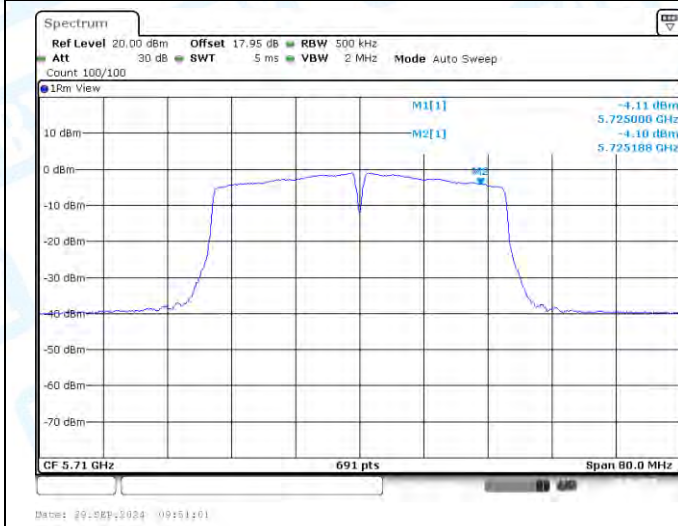


11N40-CDD-Ant3-5710_UNII-3-PASS



11N40-CDD-Ant1-5755-PASS



11N40-CDD-Ant2-5755-PASS

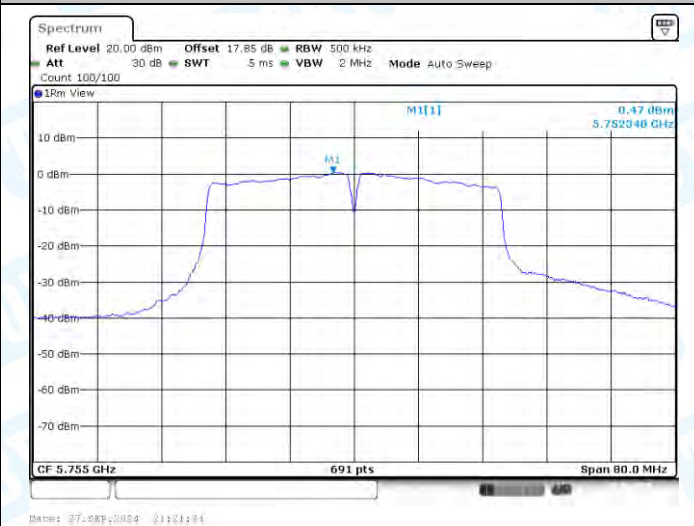

11N40-CDD-Ant3-5755-PASS




11N40-CDD-Ant1-5795-PASS




11N40-CDD-Ant2-5795-PASS




11N40-CDD-Ant3-5795-PASS

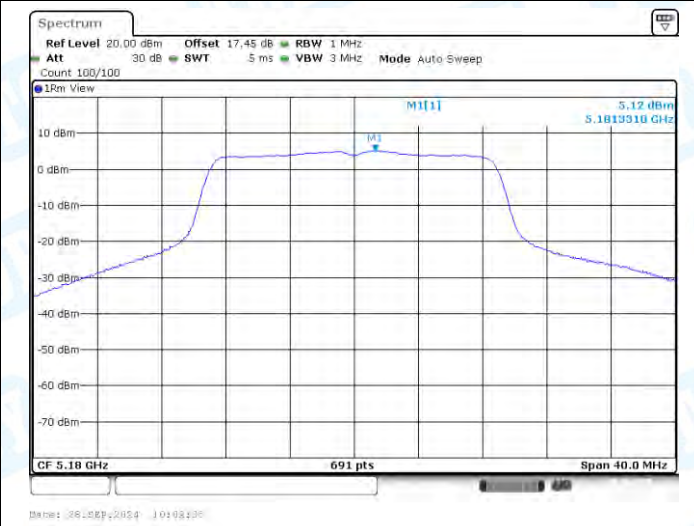

11AC20-CDD-Ant1-5180-PASS

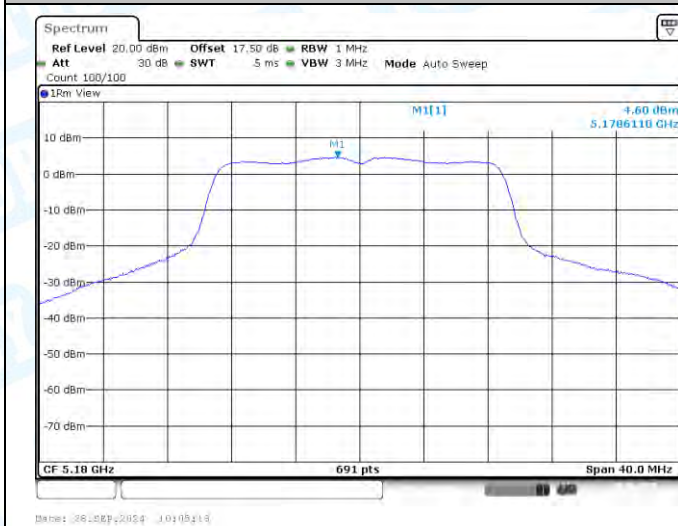


11AC20-CDD-Ant2-5180-PASS

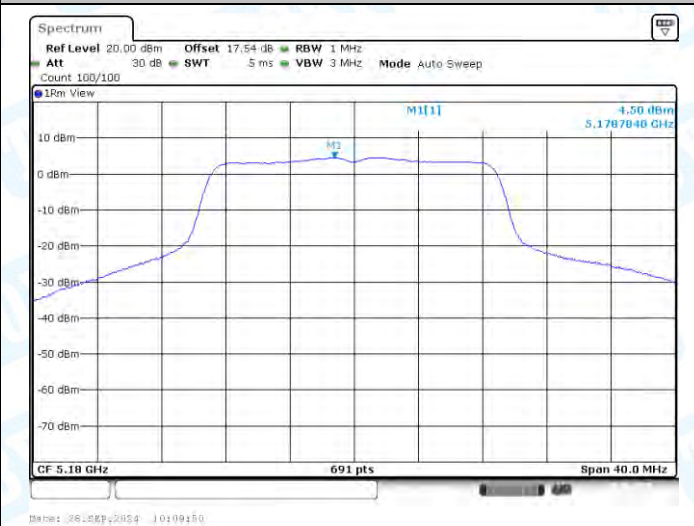

11AC20-CDD-Ant3-5180-PASS



11AC20-CDD-Ant1-5200-PASS

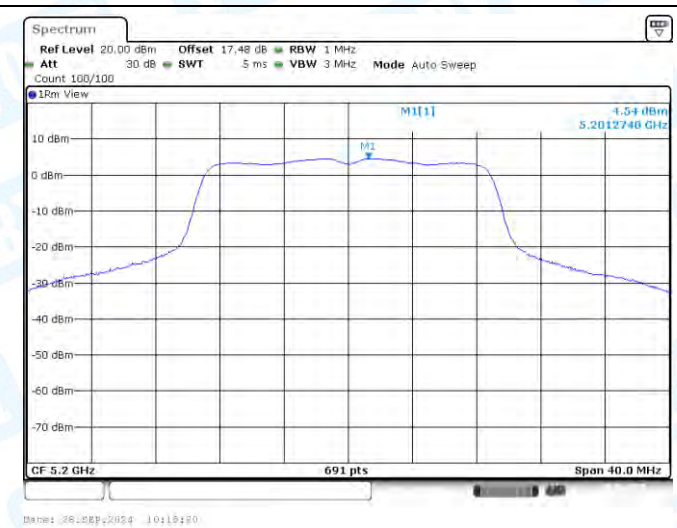

11AC20-CDD-Ant2-5200-PASS



11AC20-CDD-Ant3-5200-PASS



11AC20-CDD-Ant1-5240-PASS



11AC20-CDD-Ant2-5240-PASS



11AC20-CDD-Ant3-5240-PASS



11AC20-CDD-Ant1-5260-PASS




11AC20-CDD-Ant2-5260-PASS




11AC20-CDD-Ant3-5260-PASS



11AC20-CDD-Ant1-5280-PASS

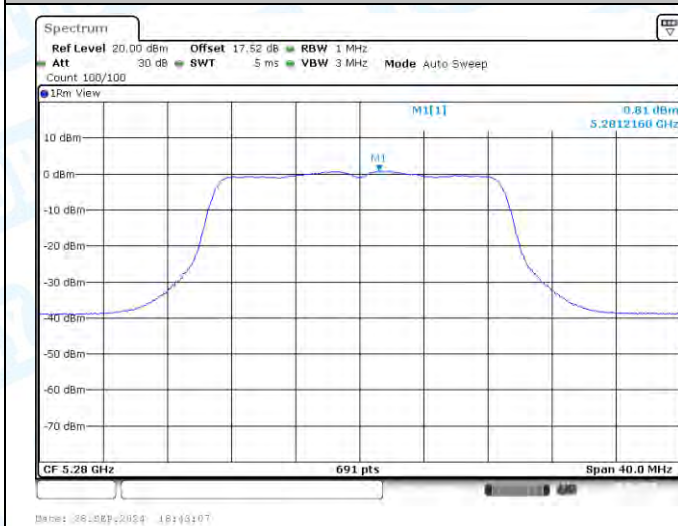

11AC20-CDD-Ant2-5280-PASS

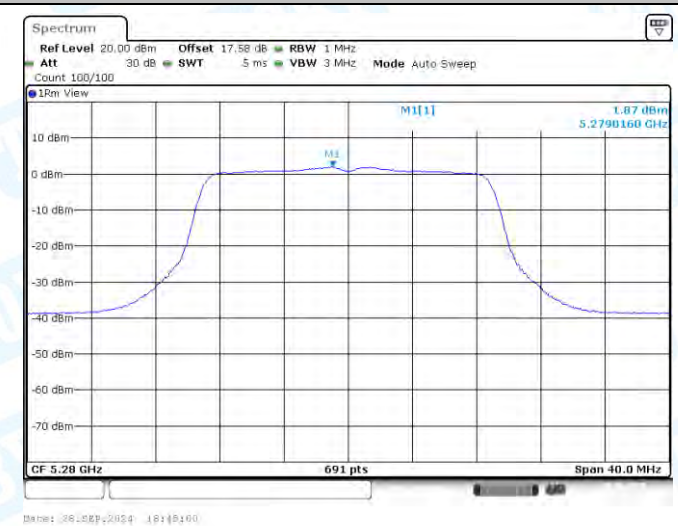

11AC20-CDD-Ant3-5280-PASS




11AC20-CDD-Ant1-5320-PASS



11AC20-CDD-Ant2-5320-PASS




11AC20-CDD-Ant3-5320-PASS

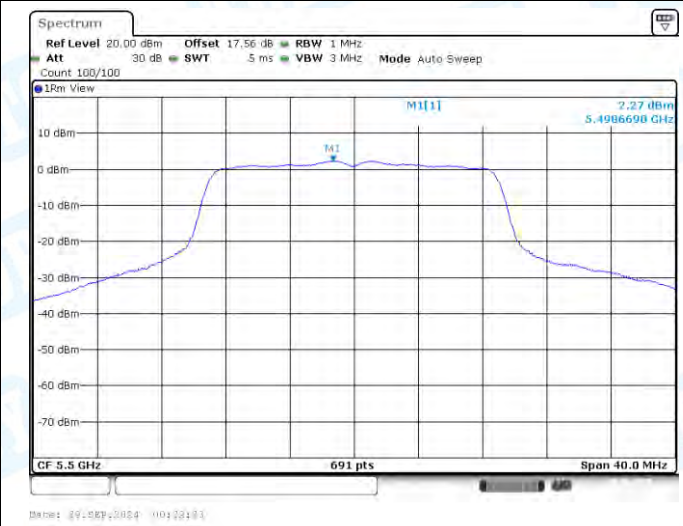

11AC20-CDD-Ant1-5500-PASS



11AC20-CDD-Ant2-5500-PASS

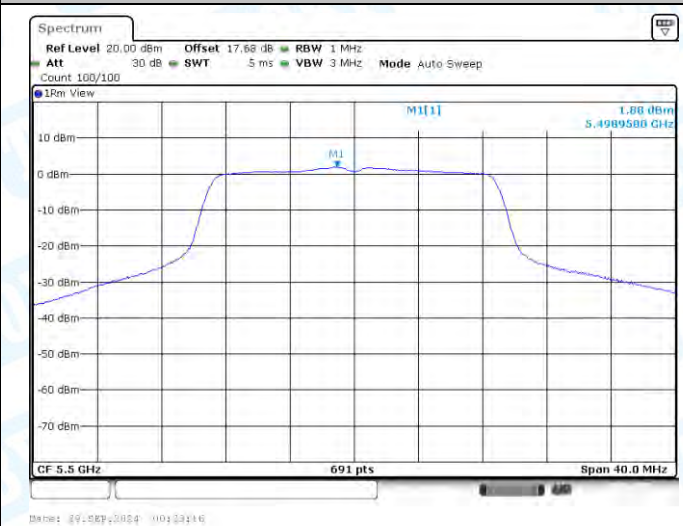

11AC20-CDD-Ant3-5500-PASS



11AC20-CDD-Ant1-5580-PASS




11AC20-CDD-Ant2-5580-PASS




11AC20-CDD-Ant3-5580-PASS




11AC20-CDD-Ant1-5720_UNII-2C-PASS

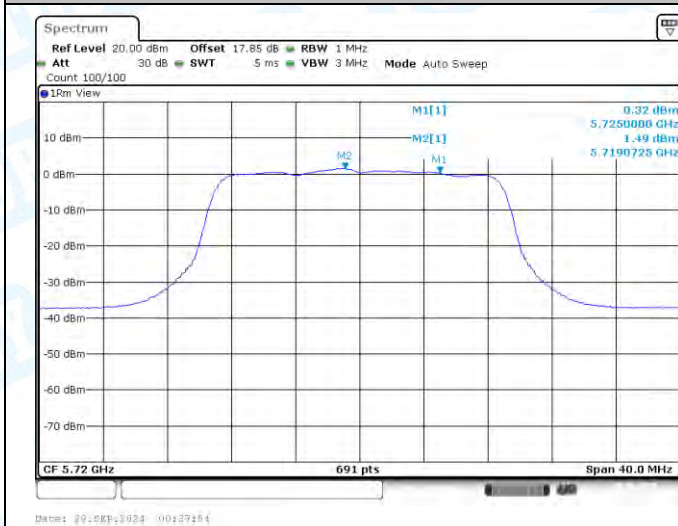


11AC20-CDD-Ant2-5720_UNII-2C-PASS

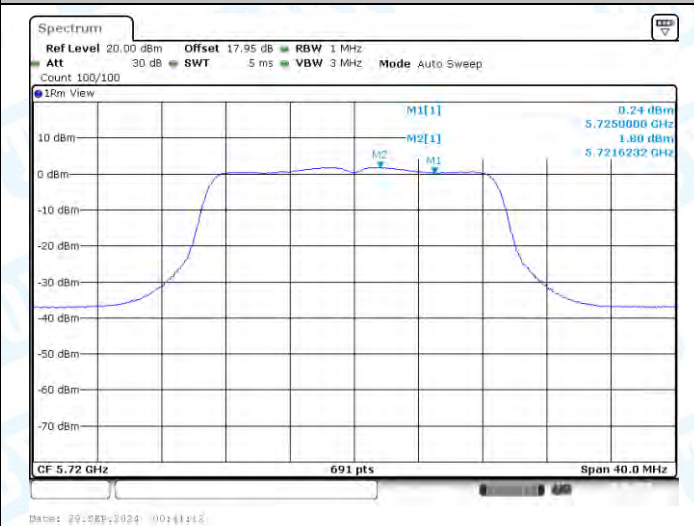

11AC20-CDD-Ant3-5720_UNII-2C-PASS

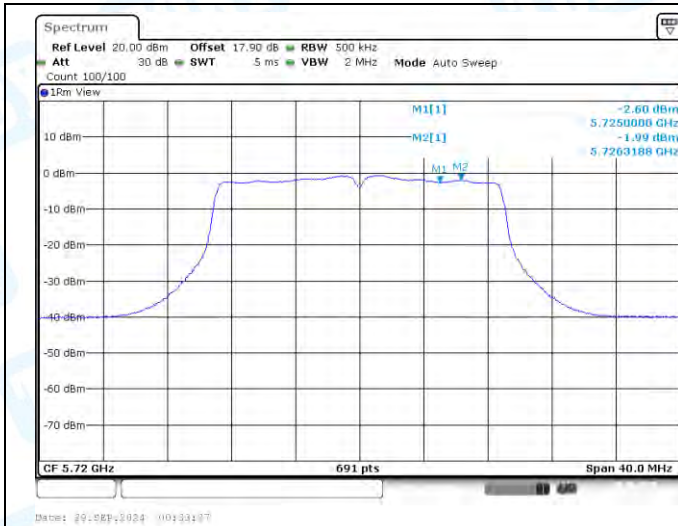

11AC20-CDD-Ant1-5720_UNII-3-PASS

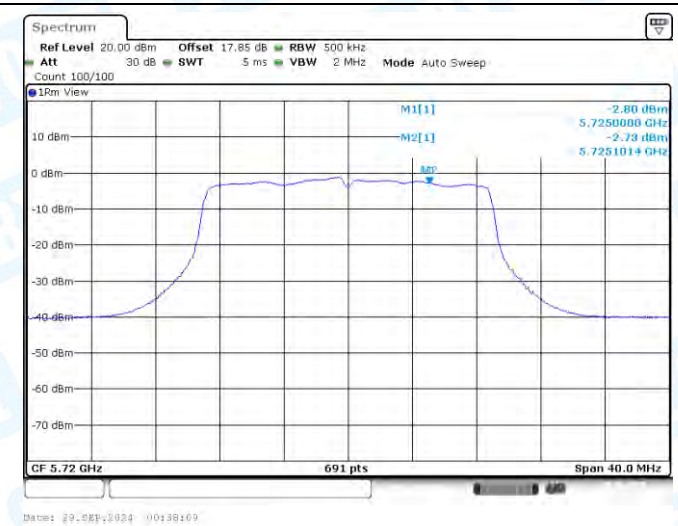

11AC20-CDD-Ant2-5720_UNII-3-PASS



11AC20-CDD-Ant3-5720_UNII-3-PASS




11AC20-CDD-Ant1-5745-PASS



11AC20-CDD-Ant2-5745-PASS



11AC20-CDD-Ant3-5745-PASS

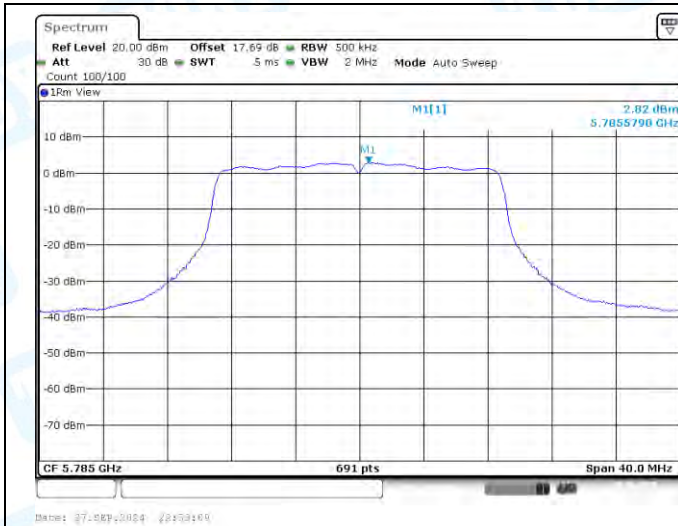

11AC20-CDD-Ant1-5785-PASS



11AC20-CDD-Ant2-5785-PASS




11AC20-CDD-Ant3-5785-PASS



11AC20-CDD-Ant1-5825-PASS



11AC20-CDD-Ant2-5825-PASS

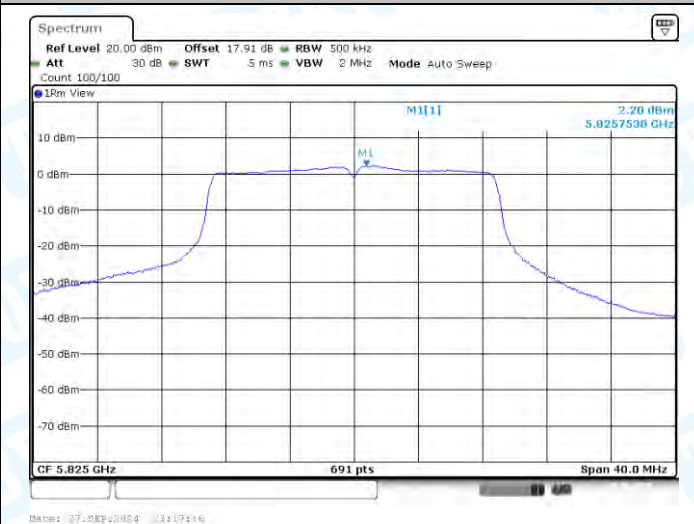

11AC20-CDD-Ant3-5825-PASS



11AC40-CDD-Ant1-5190-PASS



11AC40-CDD-Ant2-5190-PASS




11AC40-CDD-Ant3-5190-PASS



11AC40-CDD-Ant1-5230-PASS




11AC40-CDD-Ant2-5230-PASS

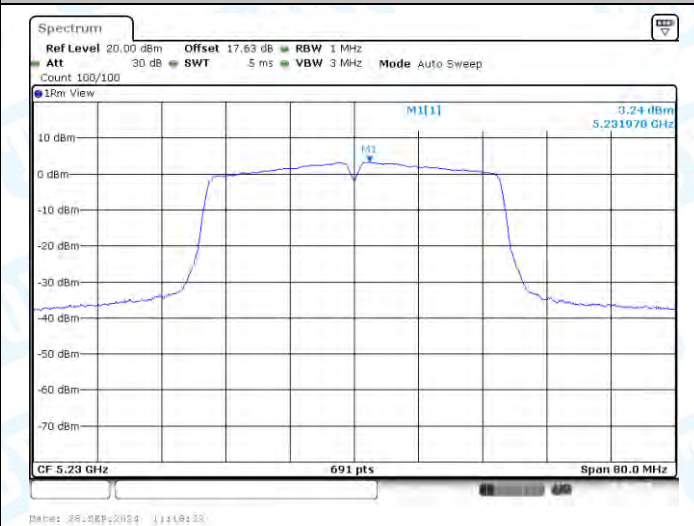

11AC40-CDD-Ant3-5230-PASS



11AC40-CDD-Ant1-5270-PASS

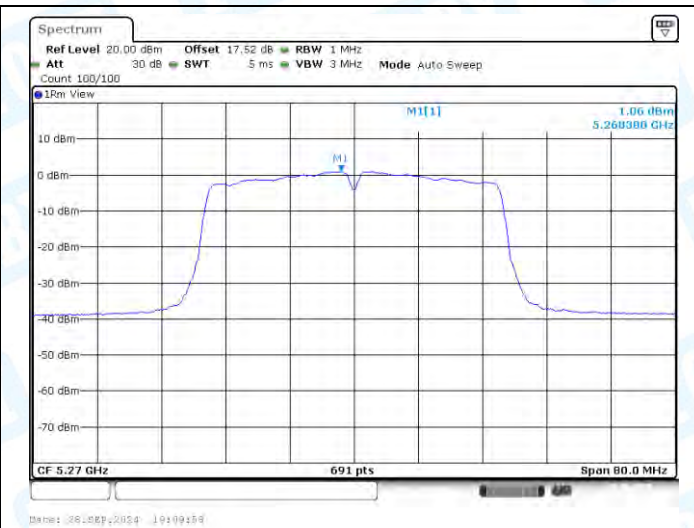

11AC40-CDD-Ant2-5270-PASS




11AC40-CDD-Ant3-5270-PASS




11AC40-CDD-Ant1-5310-PASS








11AC40-CDD-Ant2-5310-PASS

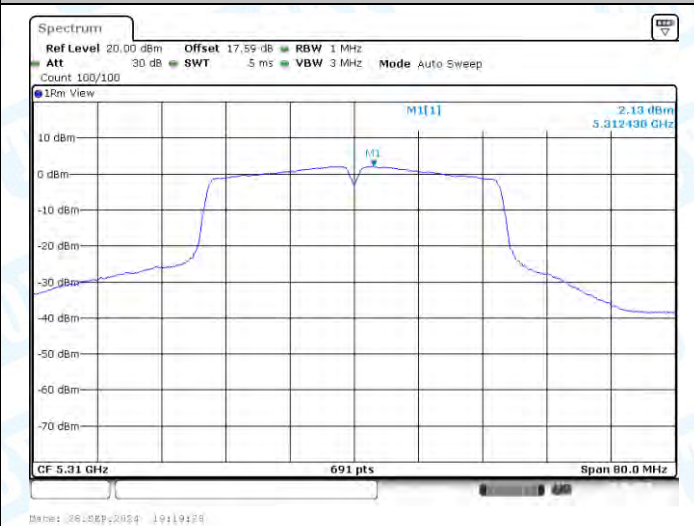

11AC40-CDD-Ant3-5310-PASS

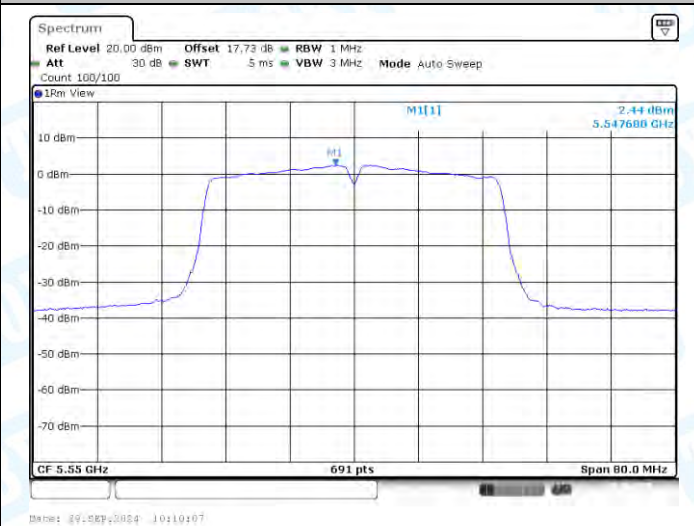

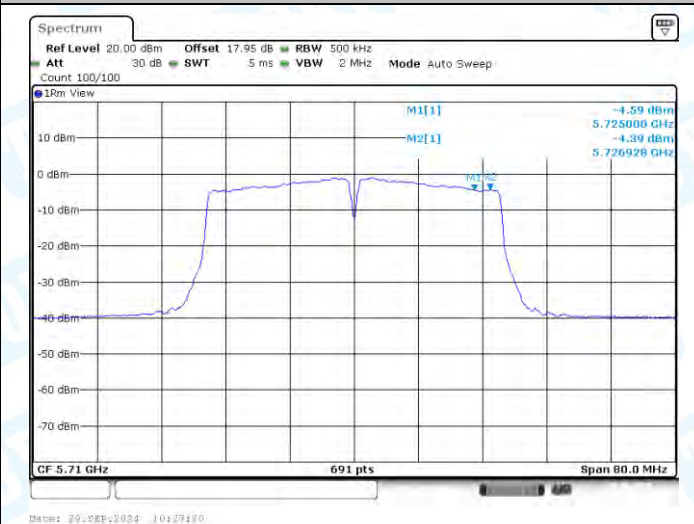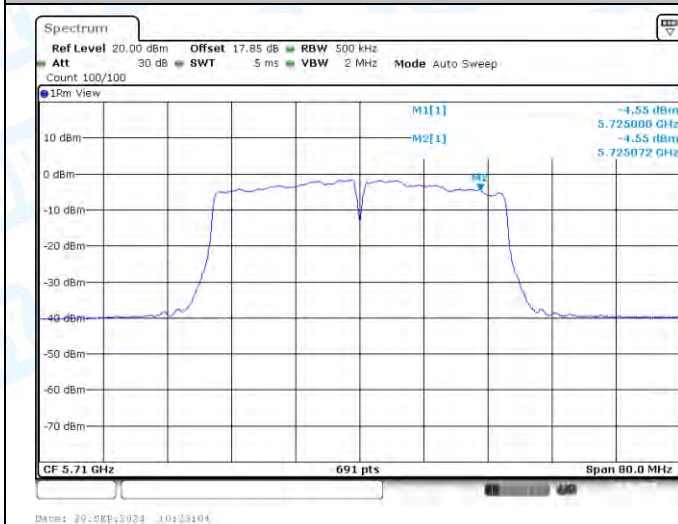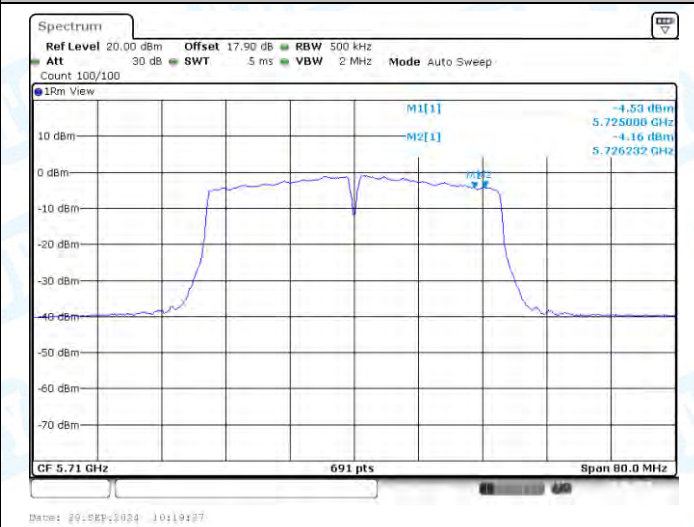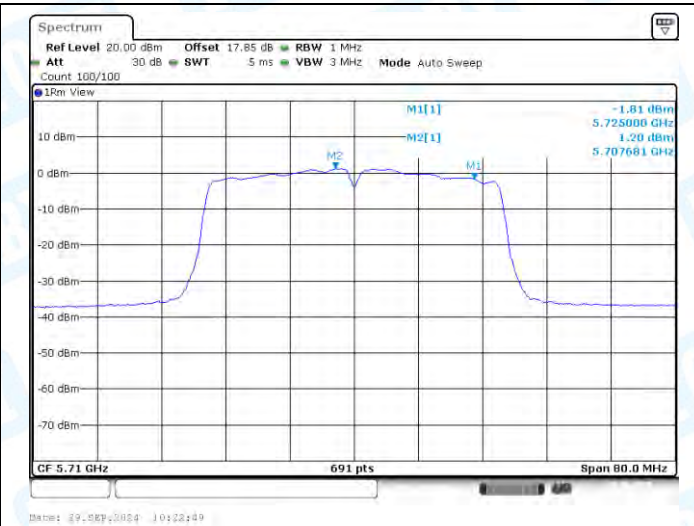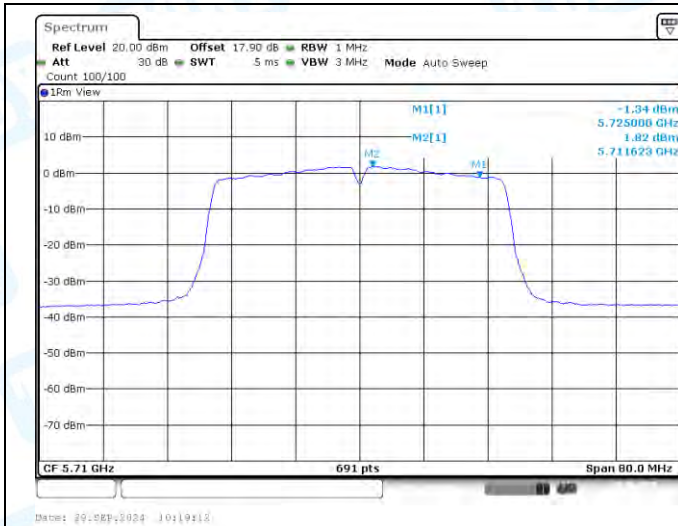




11AC40-CDD-Ant1-5755-PASS



11AC40-CDD-Ant2-5755-PASS




11AC40-CDD-Ant3-5755-PASS

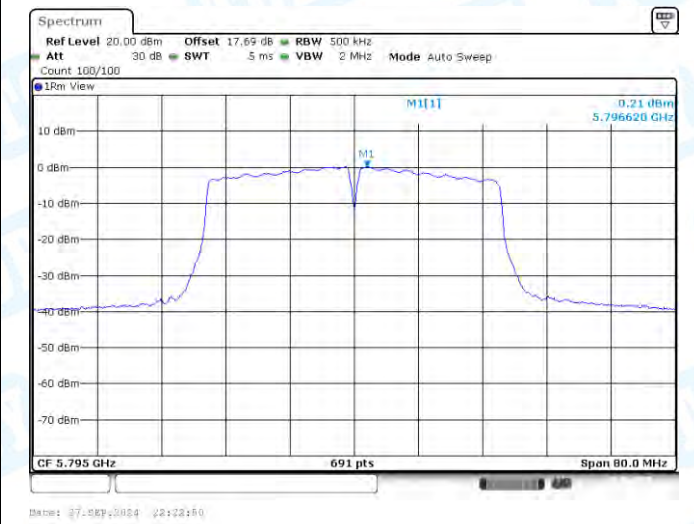

11AC40-CDD-Ant1-5795-PASS



11AC40-CDD-Ant2-5795-PASS

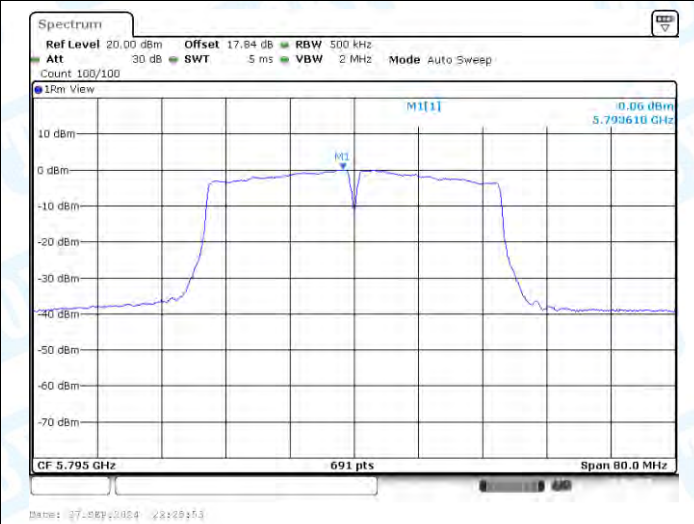

11AC40-CDD-Ant3-5795-PASS



11AC80-CDD-Ant1-5210-PASS



11AC80-CDD-Ant2-5210-PASS



11AC80-CDD-Ant3-5210-PASS



11AC80-CDD-Ant1-5290-PASS




11AC80-CDD-Ant2-5290-PASS



11AC80-CDD-Ant3-5290-PASS




11AC80-CDD-Ant1-5530-PASS

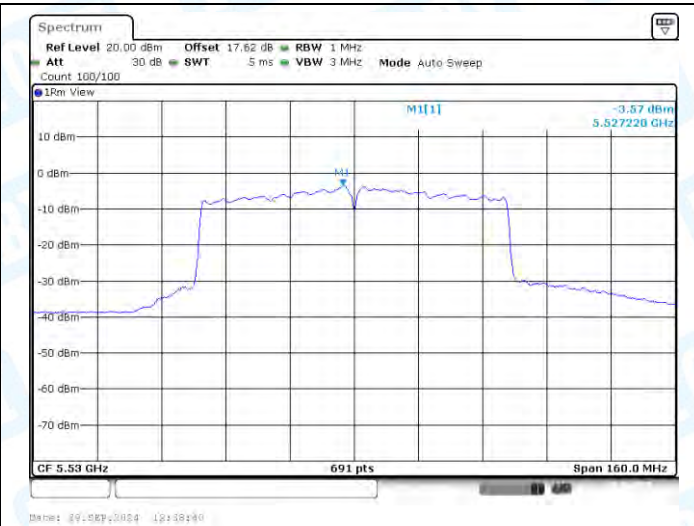


11AC80-CDD-Ant2-5530-PASS




11AC80-CDD-Ant3-5530-PASS

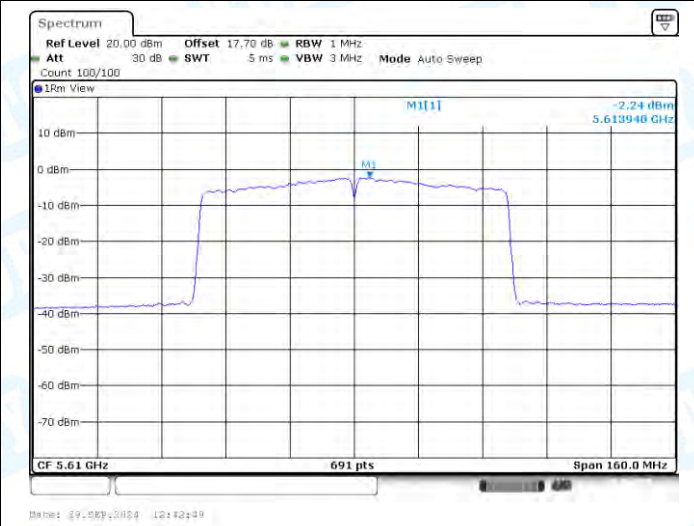

11AC80-CDD-Ant1-5610-PASS

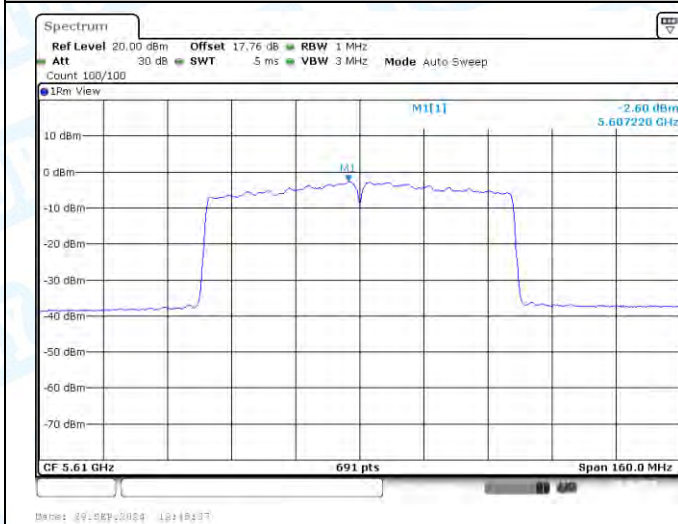


11AC80-CDD-Ant2-5610-PASS

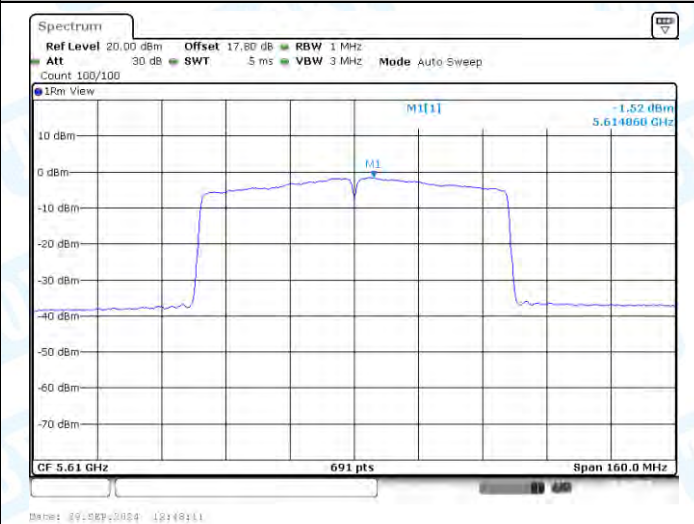

11AC80-CDD-Ant3-5610-PASS




11AC80-CDD-Ant1-5690_UNII-2C-PASS

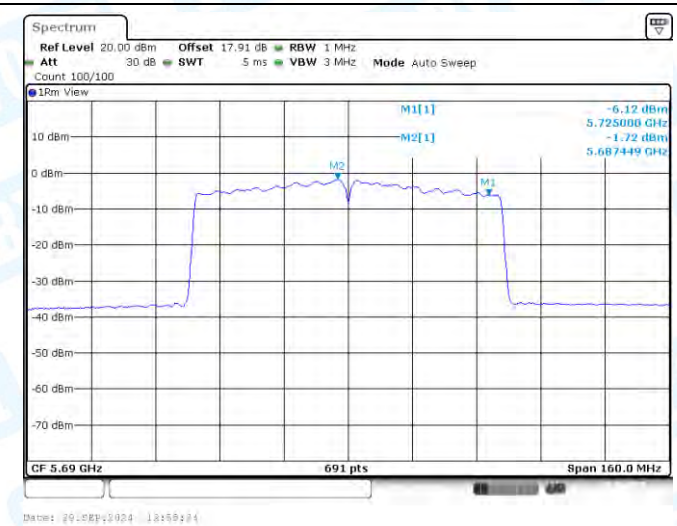


11AC80-CDD-Ant2-5690_UNII-2C-PASS




11AC80-CDD-Ant3-5690_UNII-2C-PASS

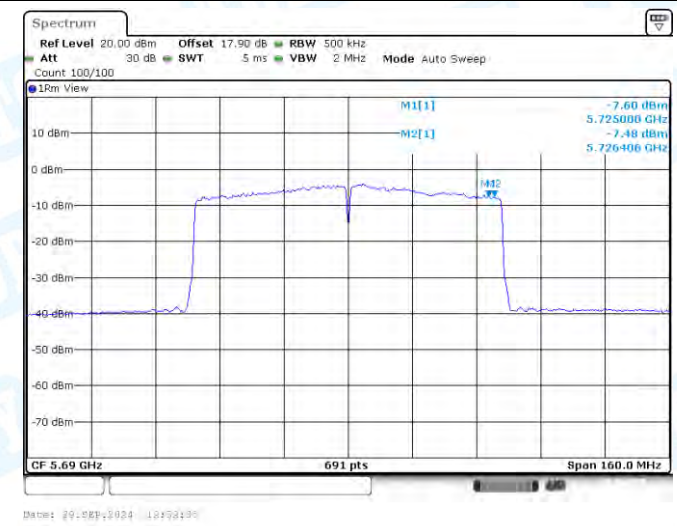


11AC80-CDD-Ant1-5690_UNII-3-PASS

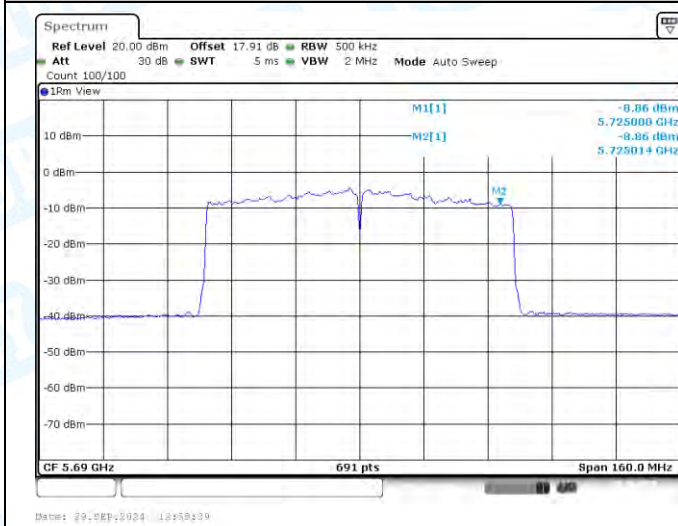


11AC80-CDD-Ant2-5690_UNII-3-PASS

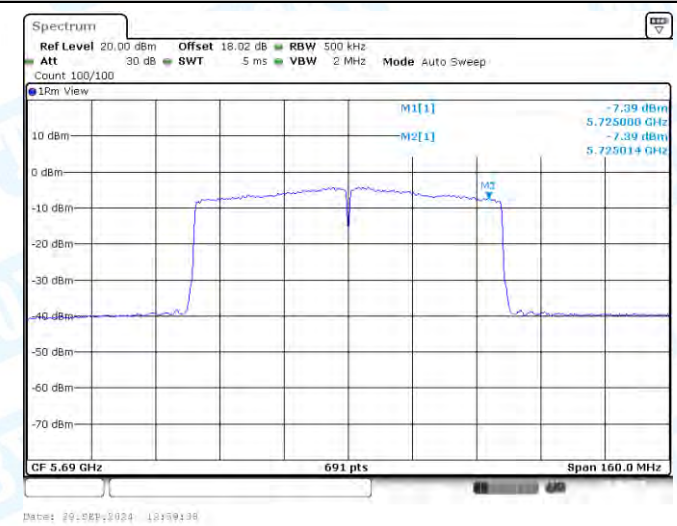

11AC80-CDD-Ant3-5690_UNII-3-PASS

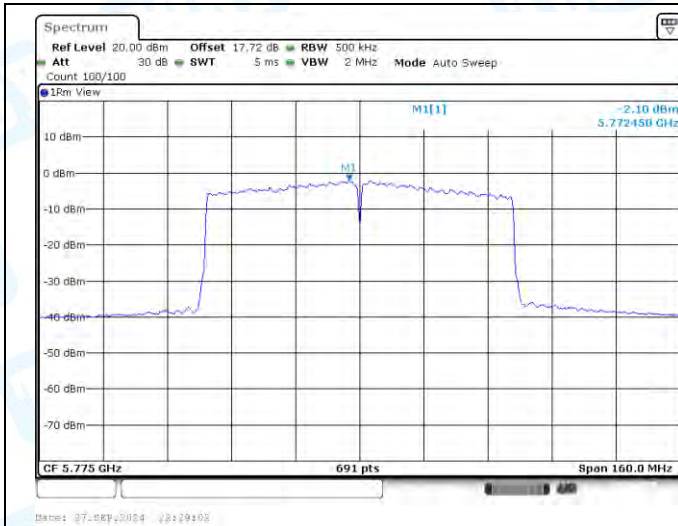


11AC80-CDD-Ant1-5775-PASS

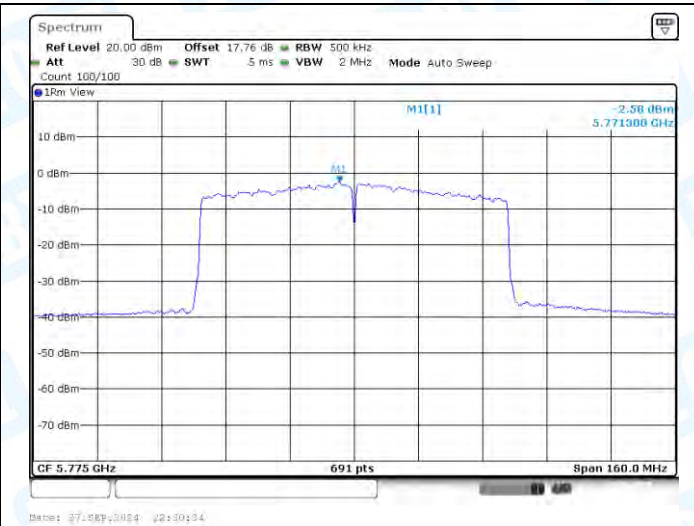


11AC80-CDD-Ant2-5775-PASS



11AC80-CDD-Ant3-5775-PASS

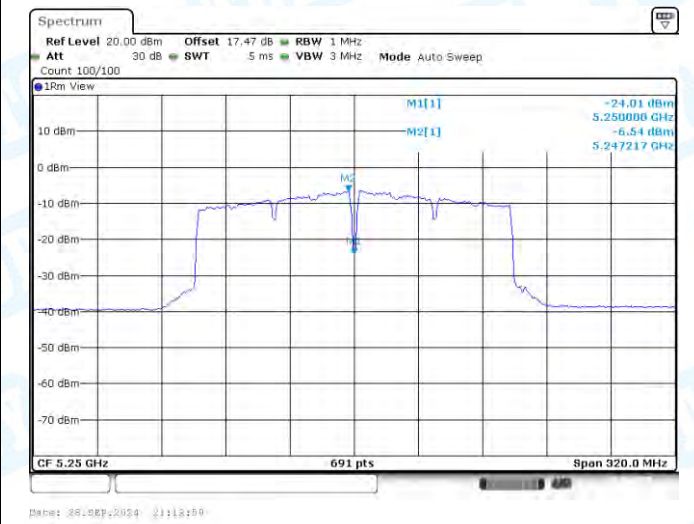


11AC160-CDD-Ant1-5250_UNII-1-PASS

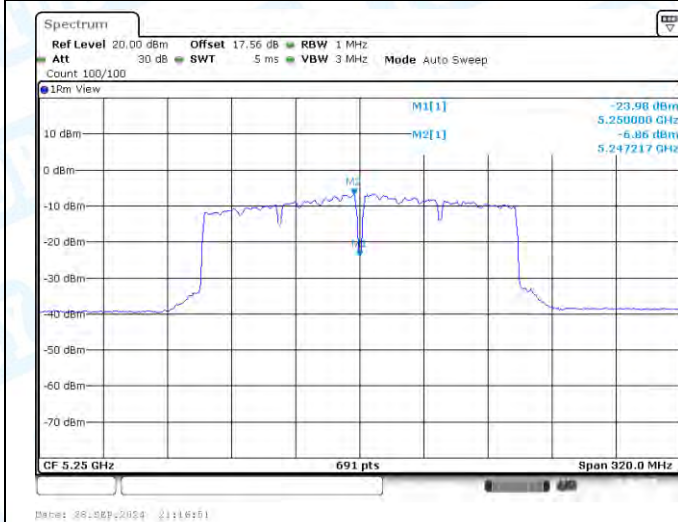


11AC160-CDD-Ant2-5250_UNII-1-PASS



11AC160-CDD-Ant3-5250_UNII-1-PASS

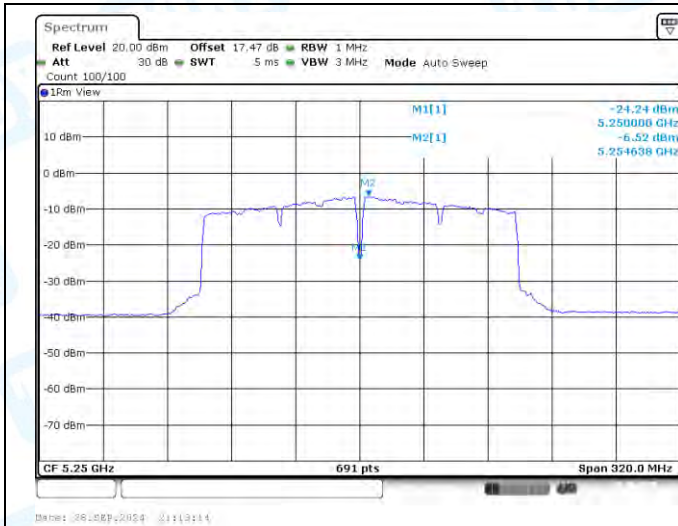

11AC160-CDD-Ant1-5250_UNII-2A-PASS

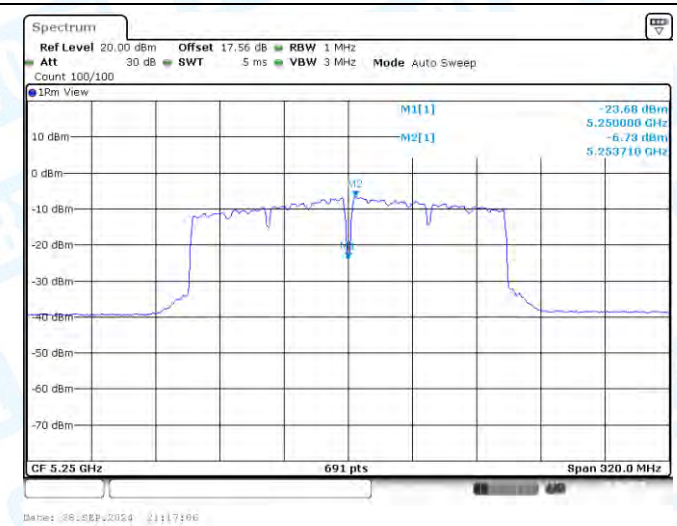

11AC160-CDD-Ant2-5250_UNII-2A-PASS




11AC160-CDD-Ant3-5250_UNII-2A-PASS



11AC160-CDD-Ant1-5570-PASS




11AC160-CDD-Ant2-5570-PASS

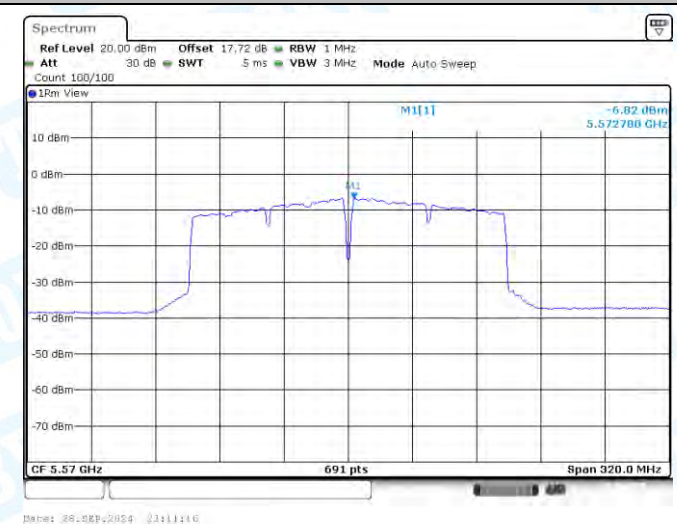

11AC160-CDD-Ant3-5570-PASS



11AX20-CDD-Ant1-5180-PASS

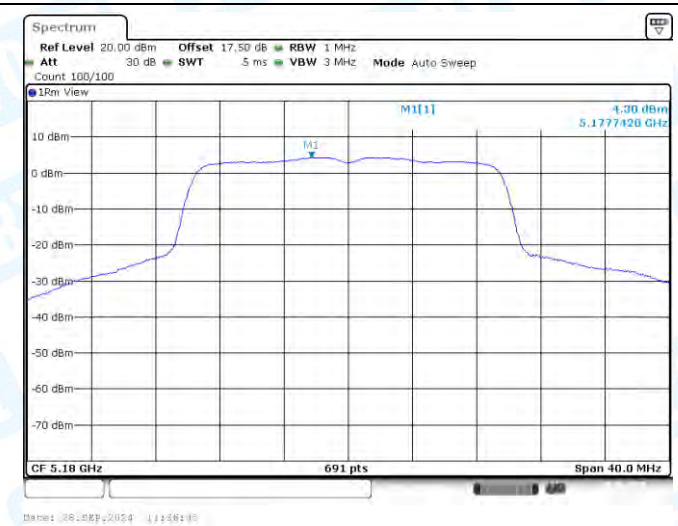


11AX20-CDD-Ant2-5180-PASS




11AX20-CDD-Ant3-5180-PASS




11AX20-CDD-Ant1-5200-PASS

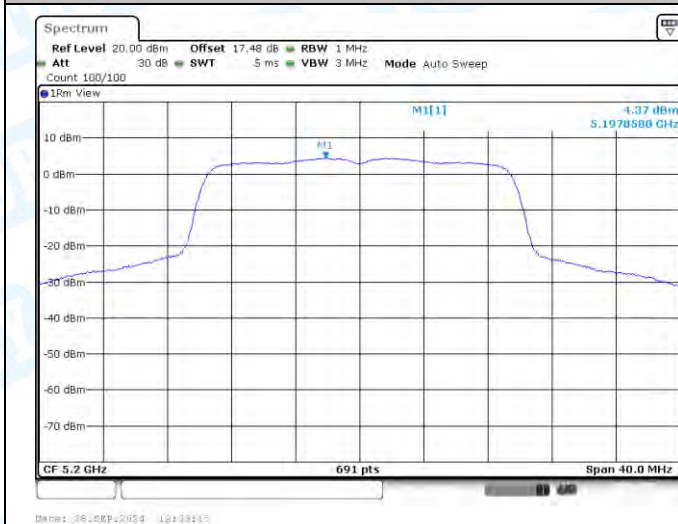

11AX20-CDD-Ant2-5200-PASS

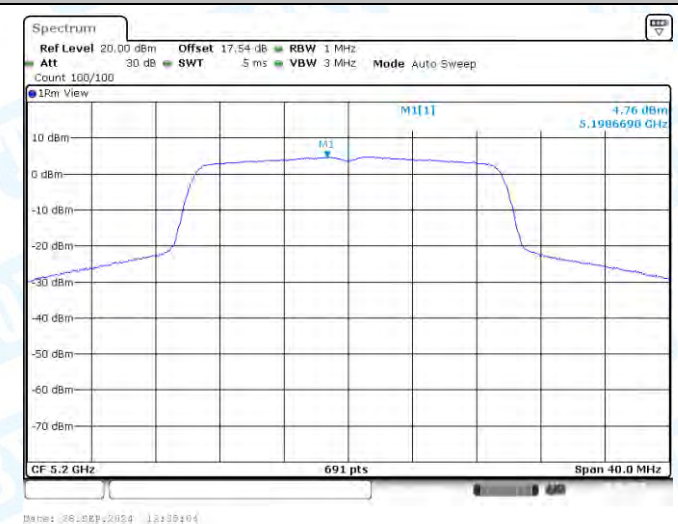

11AX20-CDD-Ant3-5200-PASS

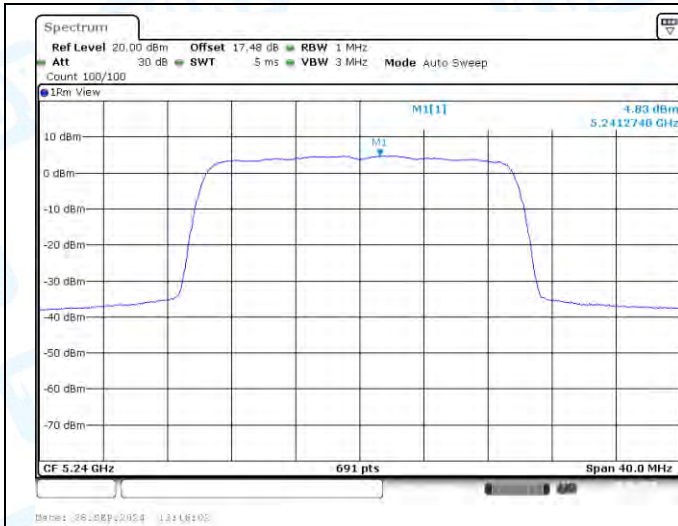

11AX20-CDD-Ant1-5240-PASS



11AX20-CDD-Ant2-5240-PASS




11AX20-CDD-Ant3-5240-PASS



11AX20-CDD-Ant1-5260-PASS




11AX20-CDD-Ant2-5260-PASS

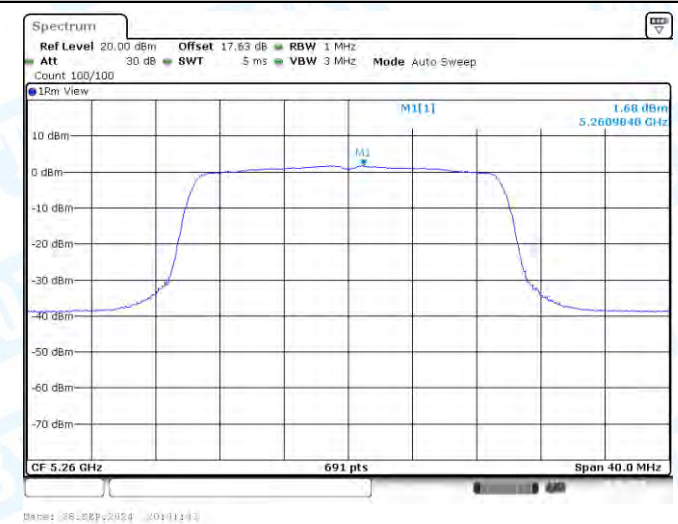

11AX20-CDD-Ant3-5260-PASS




11AX20-CDD-Ant1-5280-PASS

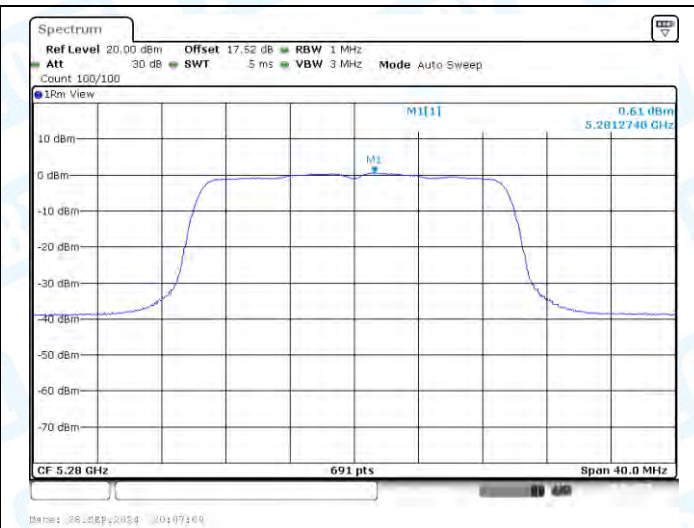


11AX20-CDD-Ant2-5280-PASS




11AX20-CDD-Ant3-5280-PASS

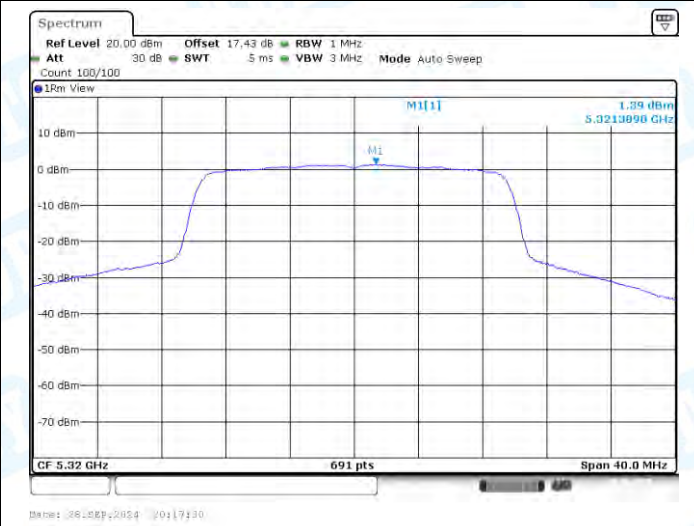

11AX20-CDD-Ant1-5320-PASS

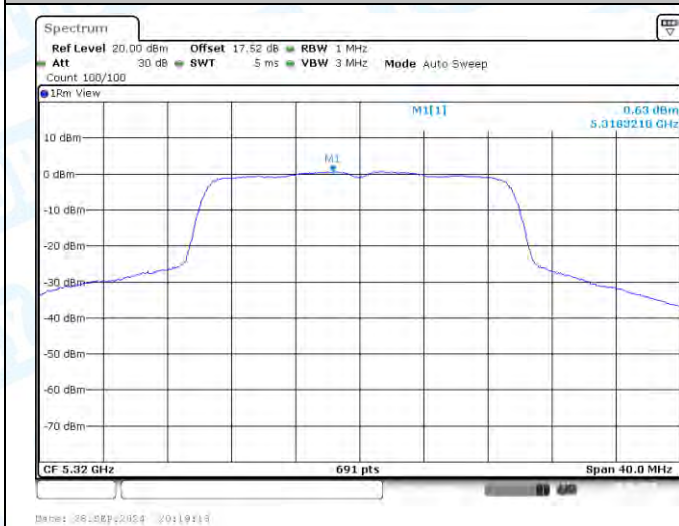


11AX20-CDD-Ant2-5320-PASS

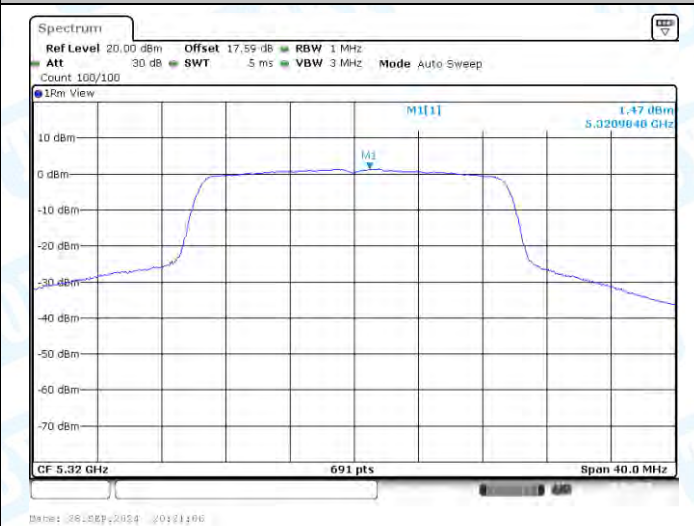

11AX20-CDD-Ant3-5320-PASS



11AX20-CDD-Ant1-5500-PASS

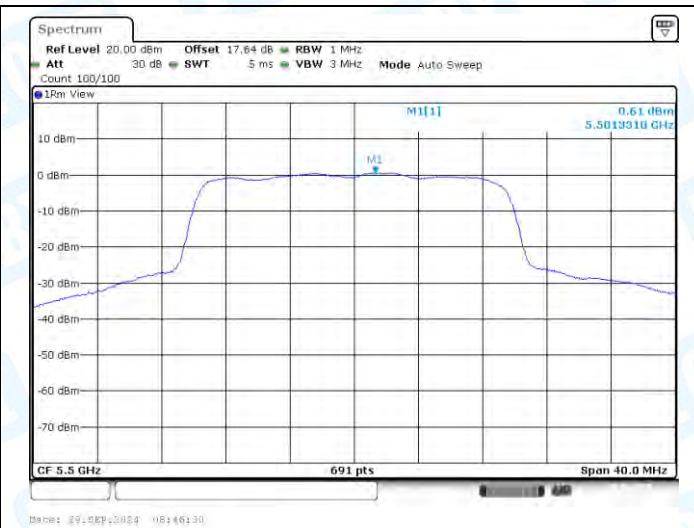

11AX20-CDD-Ant2-5500-PASS




11AX20-CDD-Ant3-5500-PASS




11AX20-CDD-Ant1-5580-PASS




11AX20-CDD-Ant2-5580-PASS

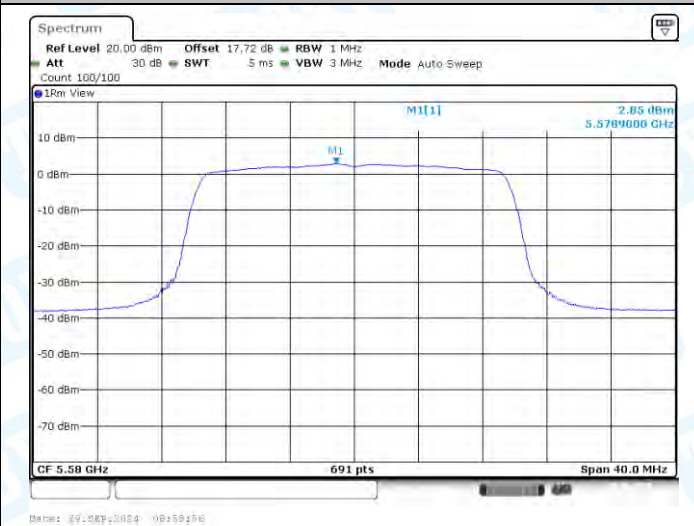

11AX20-CDD-Ant3-5580-PASS

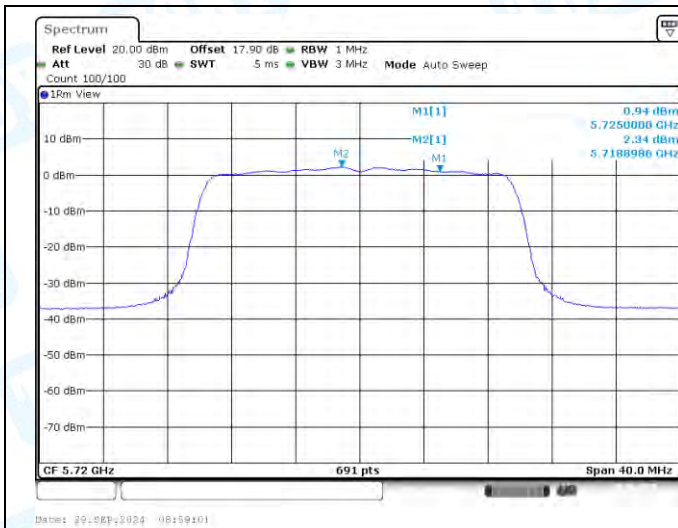

11AX20-CDD-Ant1-5720_UNII-2C-PASS

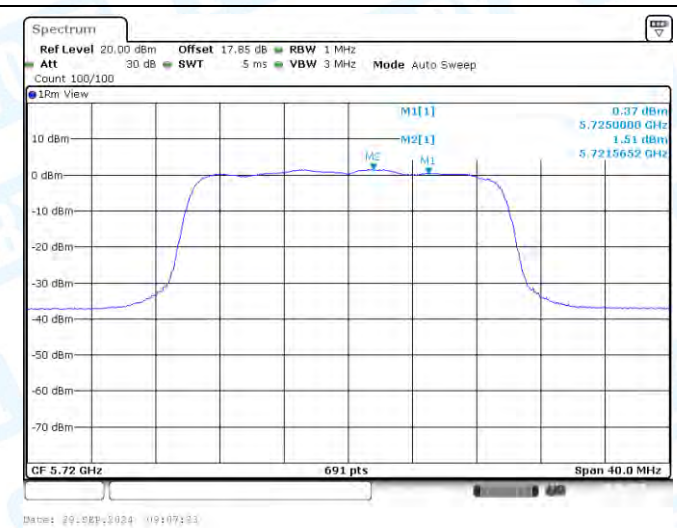


11AX20-CDD-Ant2-5720_UNII-2C-PASS




11AX20-CDD-Ant3-5720_UNII-2C-PASS




11AX20-CDD-Ant1-5720_UNII-3-PASS

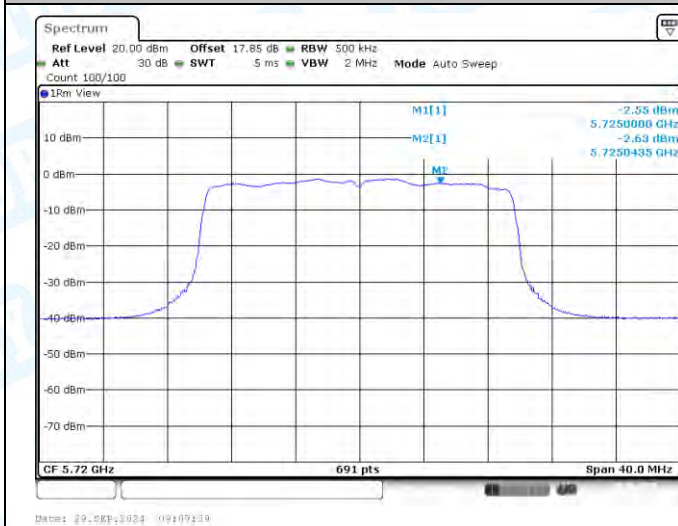

11AX20-CDD-Ant2-5720_UNII-3-PASS

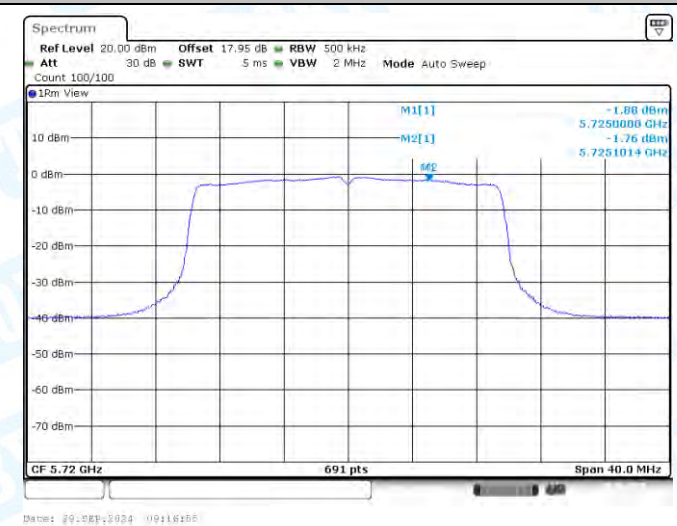

11AX20-CDD-Ant3-5720_UNII-3-PASS

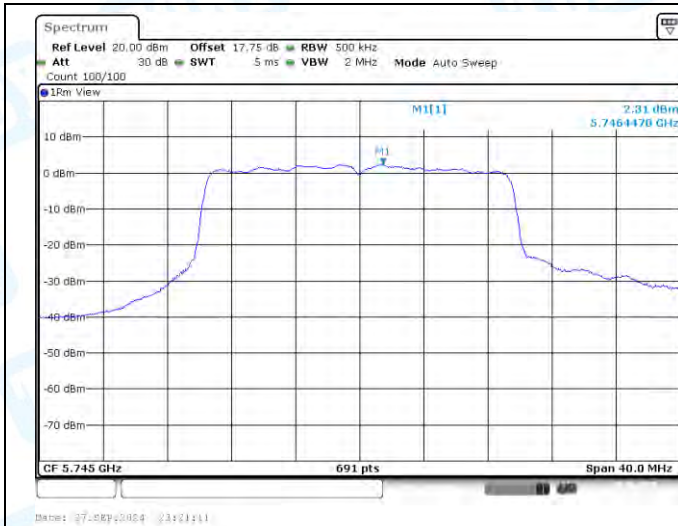

11AX20-CDD-Ant1-5745-PASS



11AX20-CDD-Ant2-5745-PASS




11AX20-CDD-Ant3-5745-PASS



11AX20-CDD-Ant1-5785-PASS



11AX20-CDD-Ant2-5785-PASS

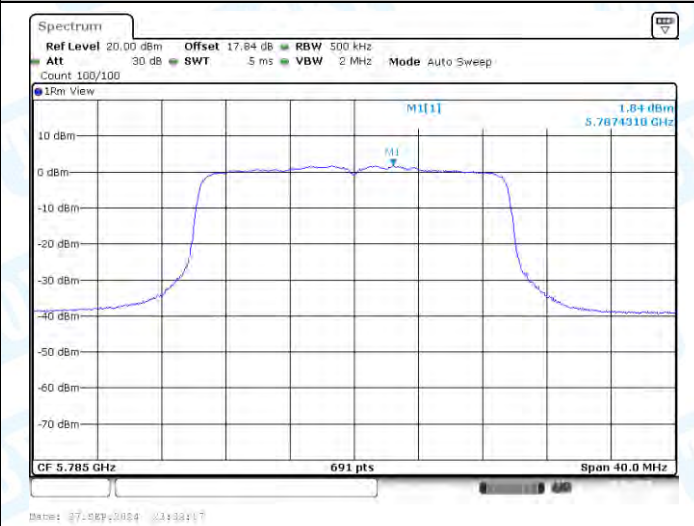


11AX20-CDD-Ant3-5785-PASS




11AX20-CDD-Ant1-5825-PASS



11AX20-CDD-Ant2-5825-PASS

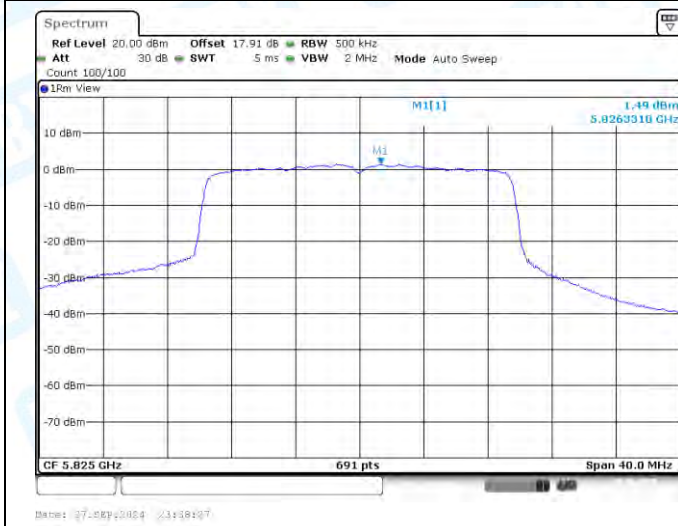


11AX20-CDD-Ant3-5825-PASS

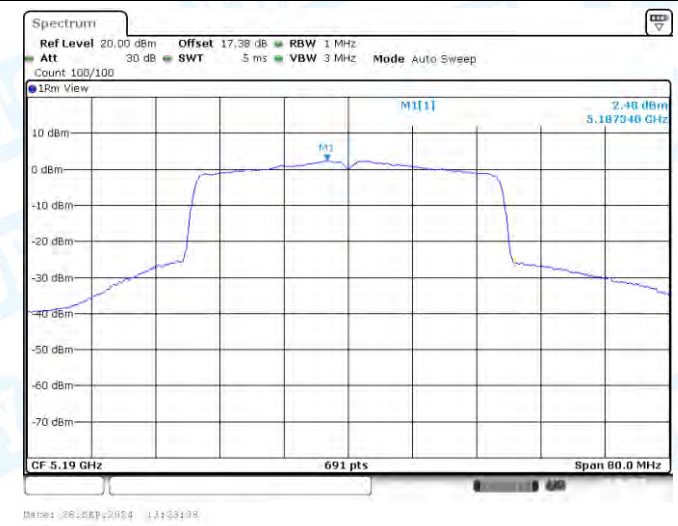




11AX40-CDD-Ant1-5190-PASS






11AX40-CDD-Ant2-5190-PASS

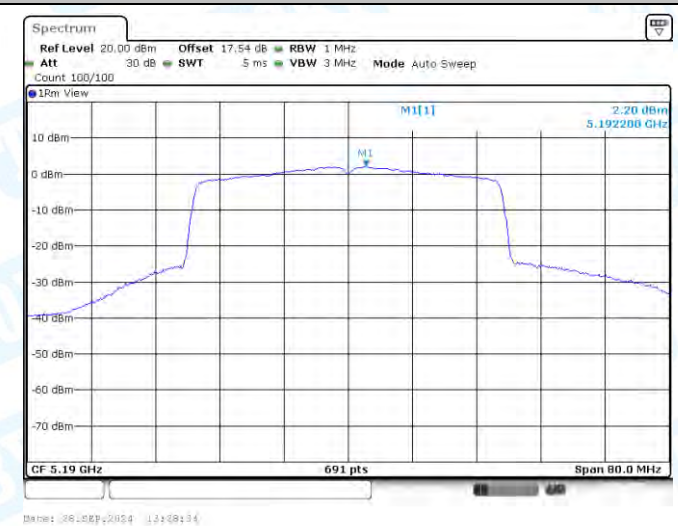


11AX40-CDD-Ant3-5190-PASS

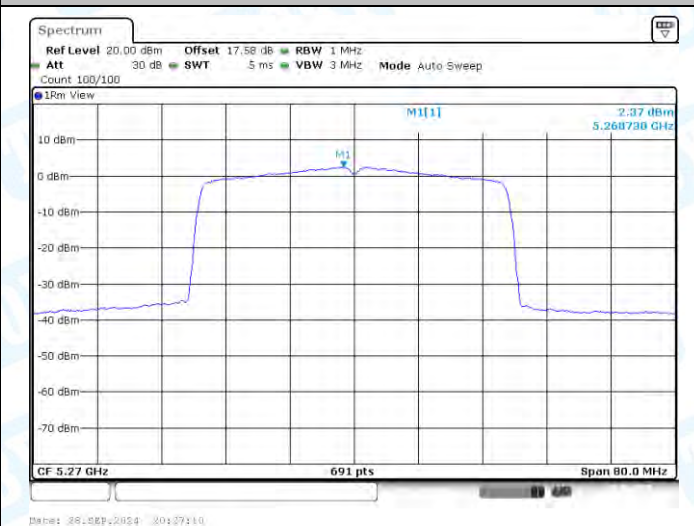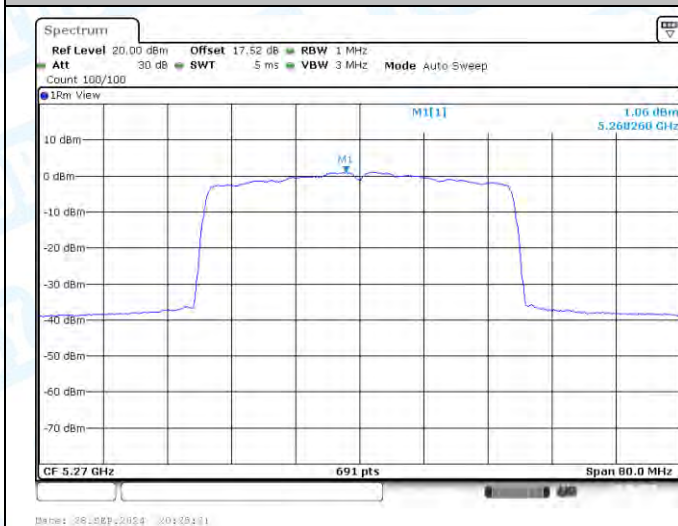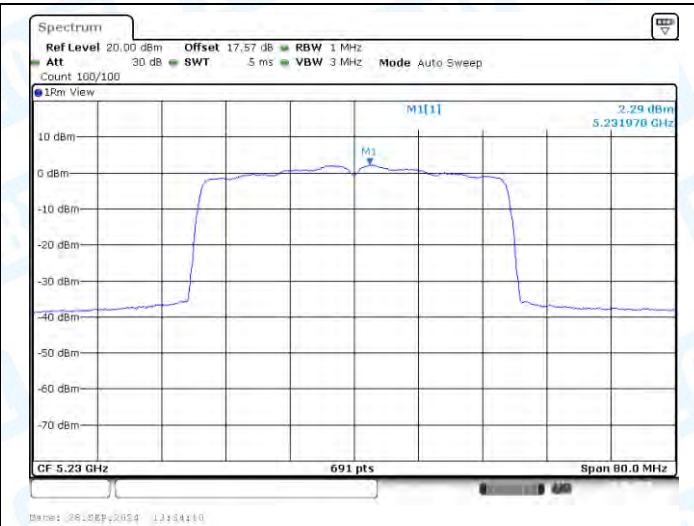

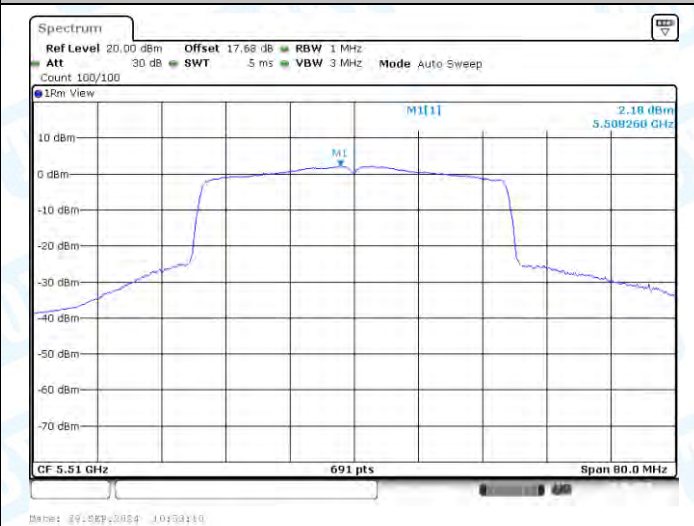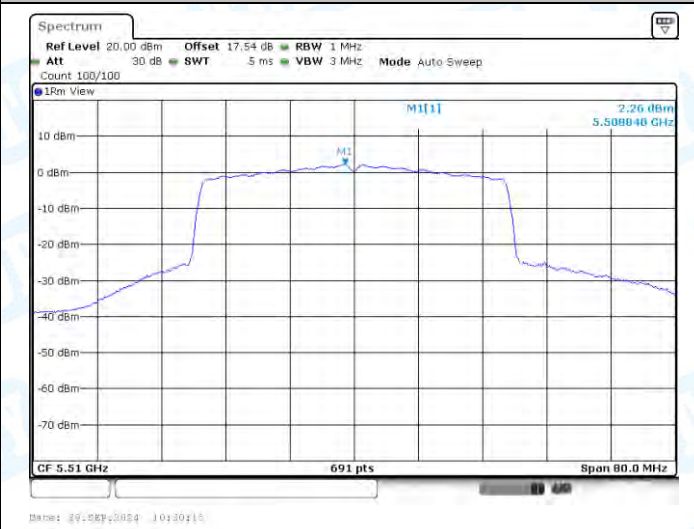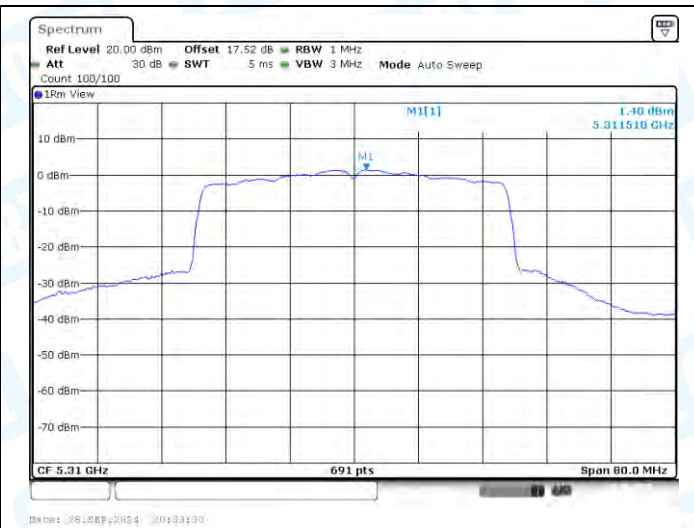



11AX40-CDD-Ant1-5550-PASS

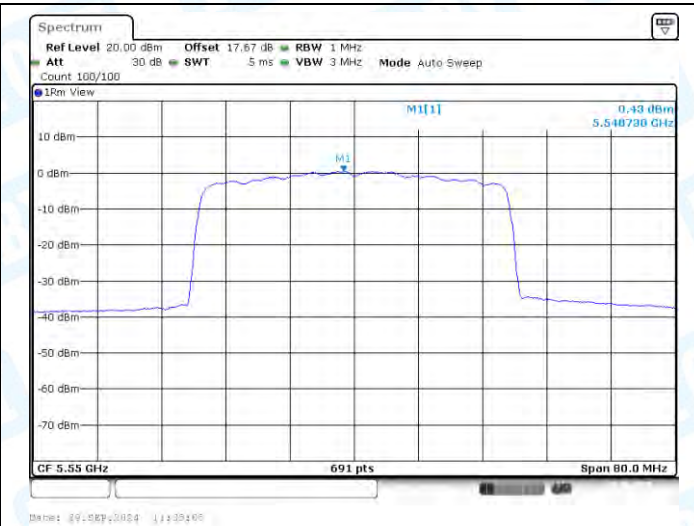

11AX40-CDD-Ant2-5550-PASS




11AX40-CDD-Ant3-5550-PASS




11AX40-CDD-Ant1-5710_UNII-2C-PASS




11AX40-CDD-Ant2-5710_UNII-2C-PASS

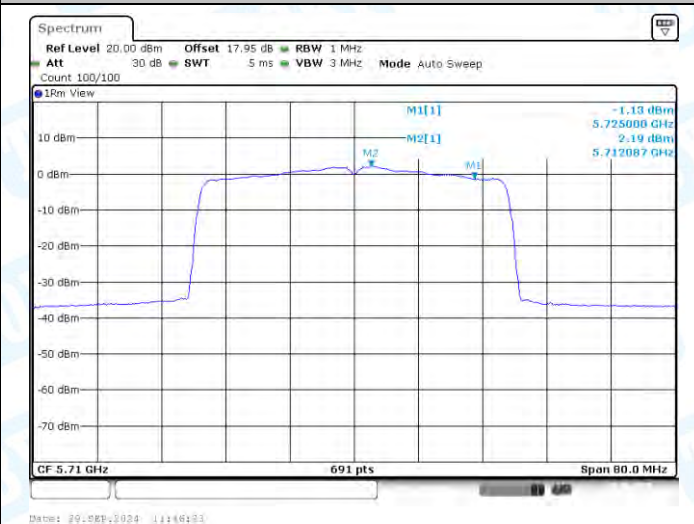


11AX40-CDD-Ant3-5710_UNII-2C-PASS

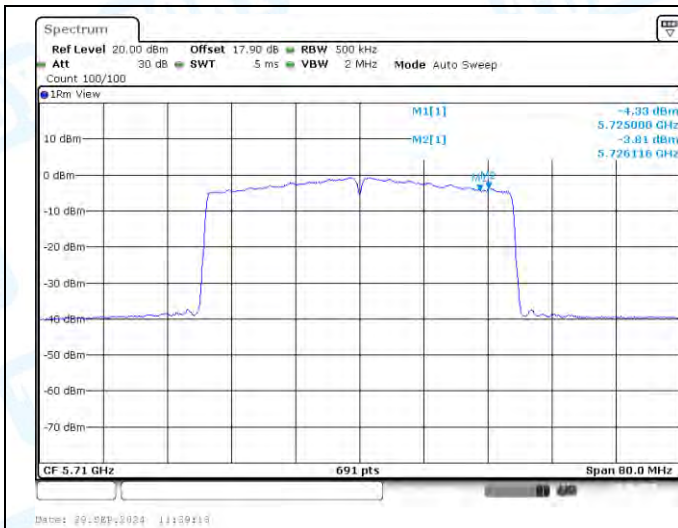

11AX40-CDD-Ant1-5710_UNII-3-PASS

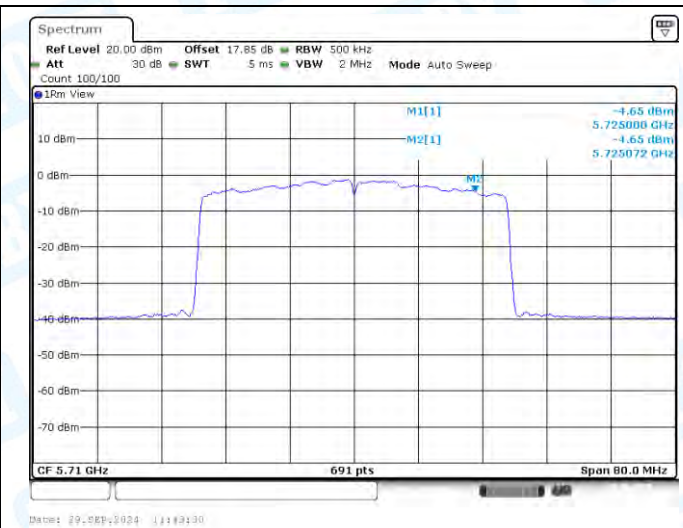

11AX40-CDD-Ant2-5710_UNII-3-PASS

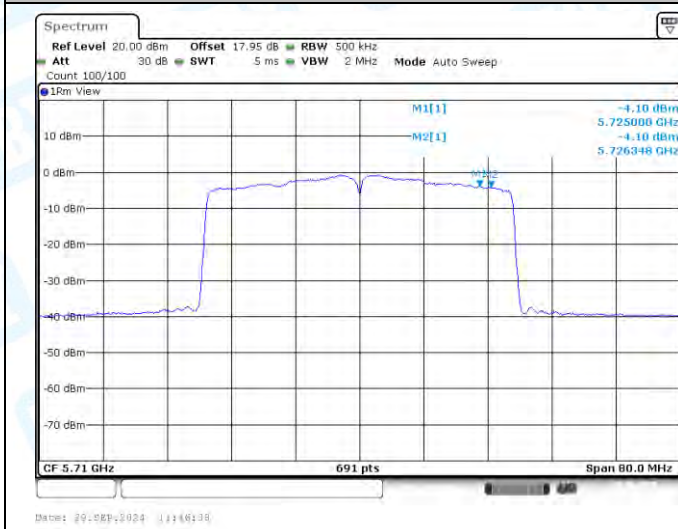


11AX40-CDD-Ant3-5710_UNII-3-PASS




11AX40-CDD-Ant1-5755-PASS




11AX40-CDD-Ant2-5755-PASS

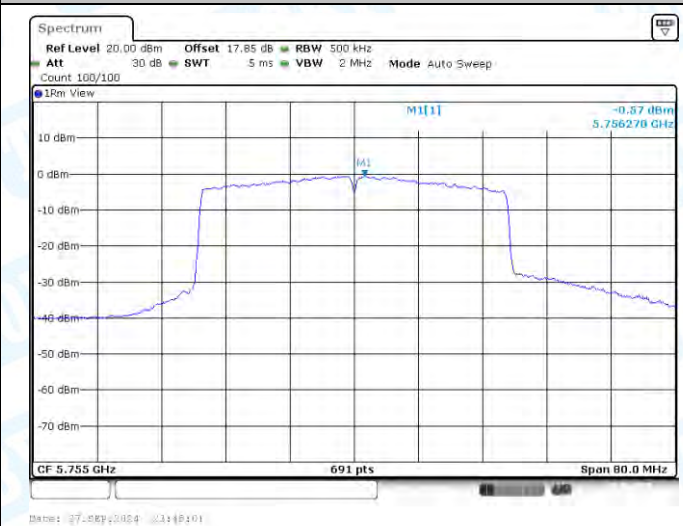


11AX40-CDD-Ant3-5755-PASS

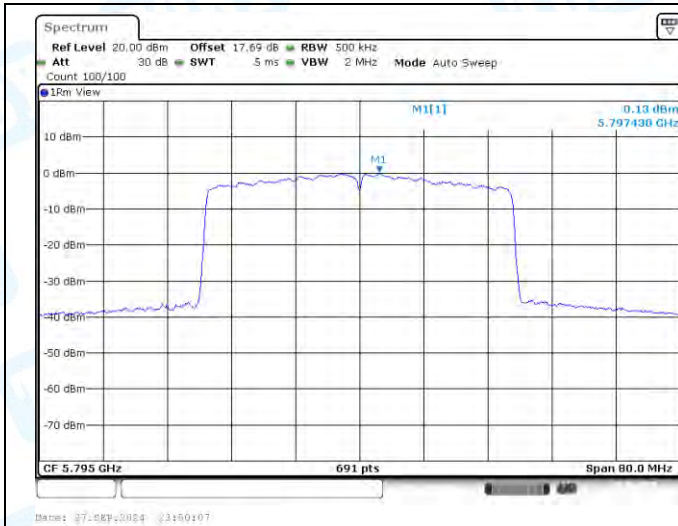

11AX40-CDD-Ant1-5795-PASS

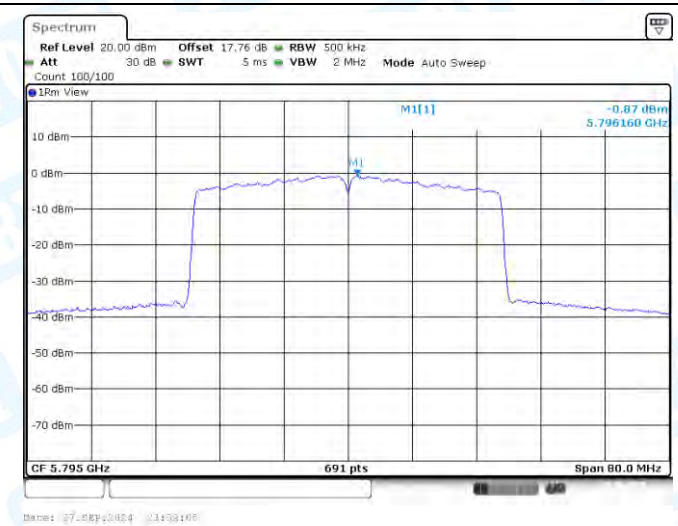

11AX40-CDD-Ant2-5795-PASS

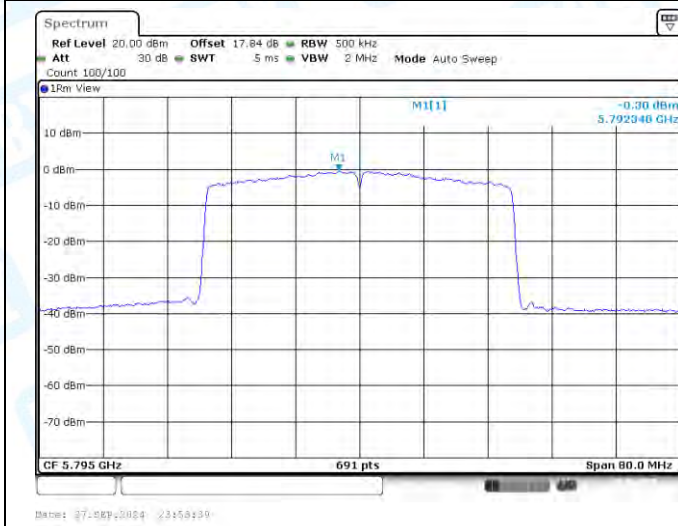

11AX40-CDD-Ant3-5795-PASS



11AX80-CDD-Ant1-5210-PASS



11AX80-CDD-Ant2-5210-PASS



11AX80-CDD-Ant3-5210-PASS



11AX80-CDD-Ant1-5290-PASS



11AX80-CDD-Ant2-5290-PASS




11AX80-CDD-Ant3-5290-PASS




11AX80-CDD-Ant1-5530-PASS




11AX80-CDD-Ant2-5530-PASS

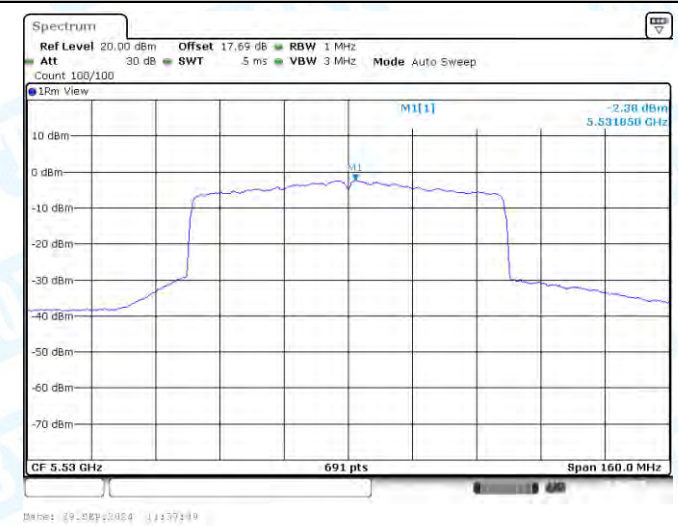


11AX80-CDD-Ant3-5530-PASS

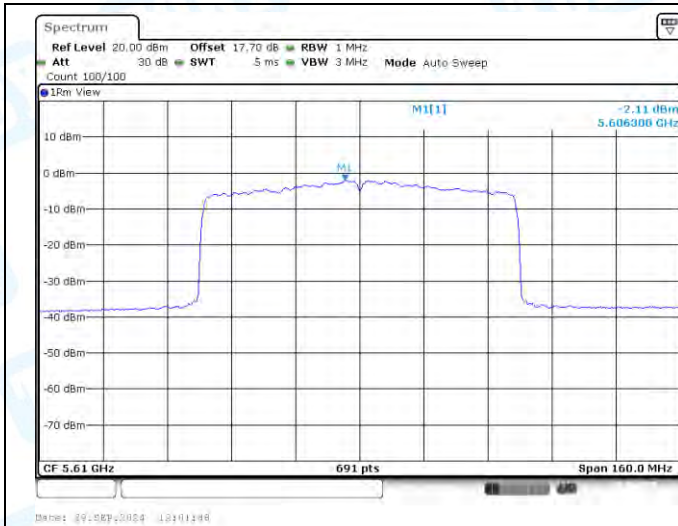

11AX80-CDD-Ant1-5610-PASS

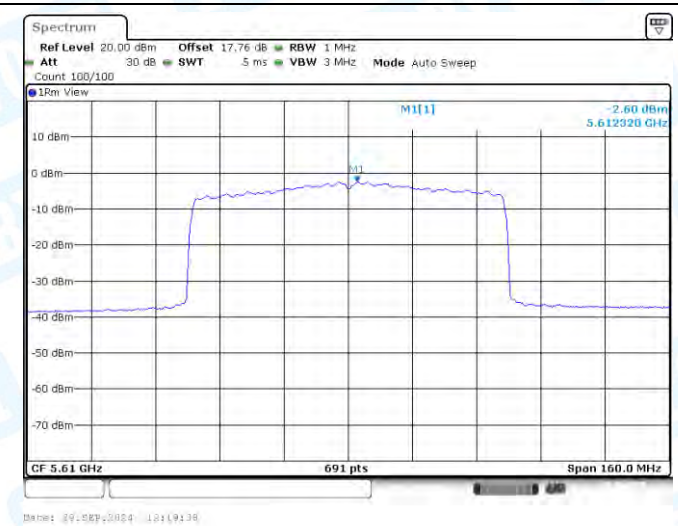

11AX80-CDD-Ant2-5610-PASS

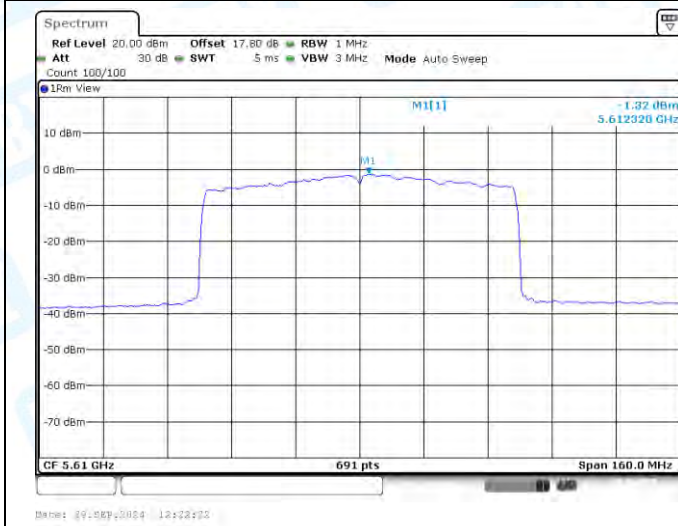


11AX80-CDD-Ant3-5610-PASS




11AX80-CDD-Ant1-5690_UNII-2C-PASS



11AX80-CDD-Ant2-5690_UNII-2C-PASS

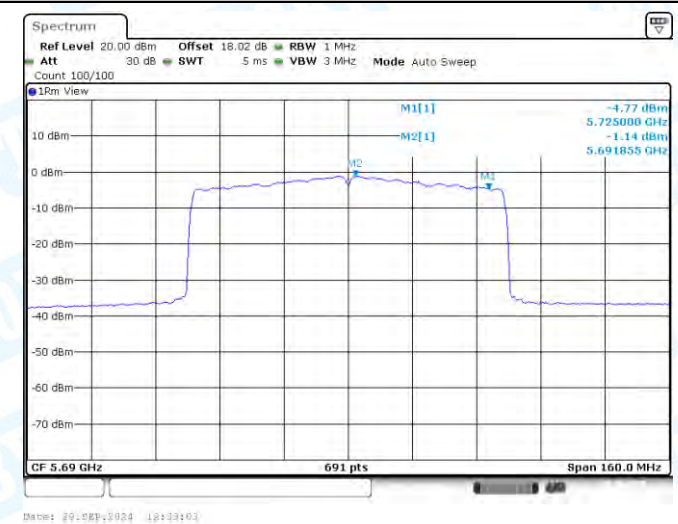


11AX80-CDD-Ant3-5690_UNII-2C-PASS

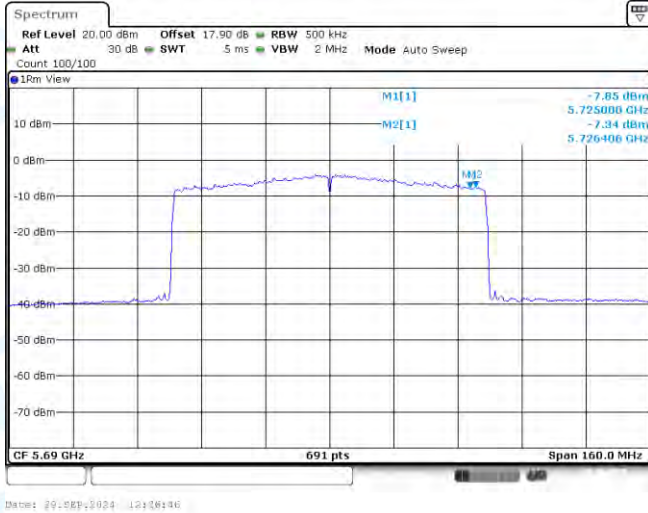

11AX80-CDD-Ant1-5690_UNII-3-PASS



11AX80-CDD-Ant2-5690_UNII-3-PASS

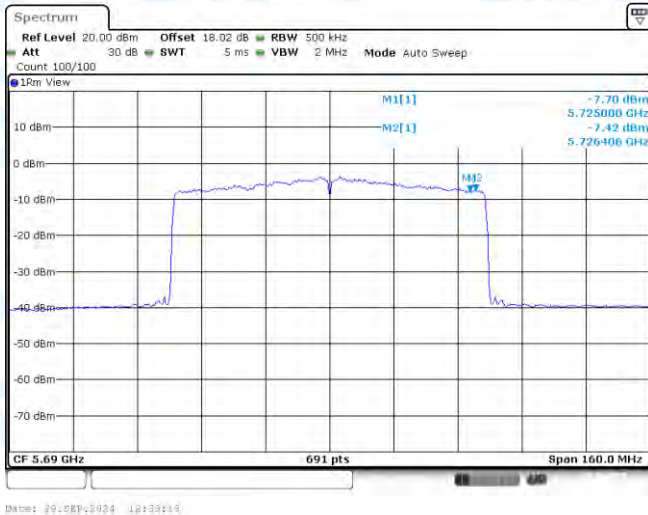

11AX80-CDD-Ant3-5690_UNII-3-PASS




11AX80-CDD-Ant1-5775-PASS




11AX80-CDD-Ant2-5775-PASS



11AX80-CDD-Ant3-5775-PASS

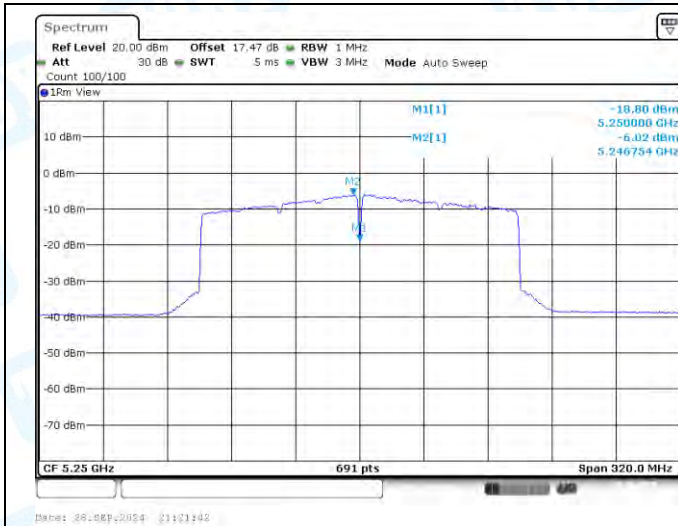

11AX160-CDD-Ant1-5250_UNII-1-PASS

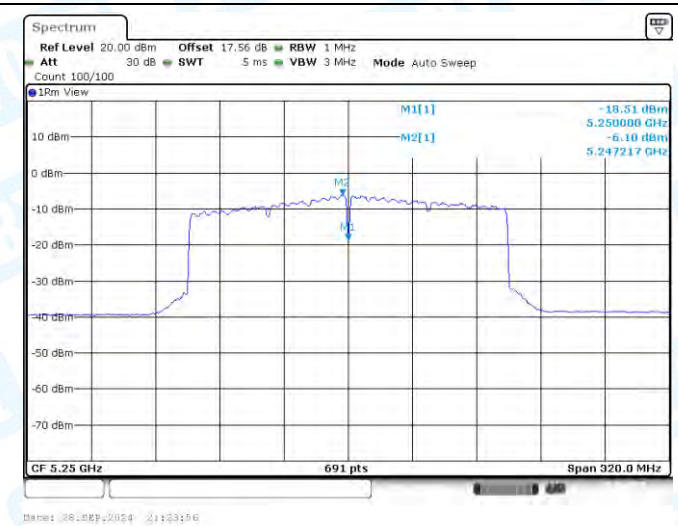


11AX160-CDD-Ant2-5250_UNII-1-PASS




11AX160-CDD-Ant3-5250_UNII-1-PASS




11AX160-CDD-Ant1-5250_UNII-2A-PASS

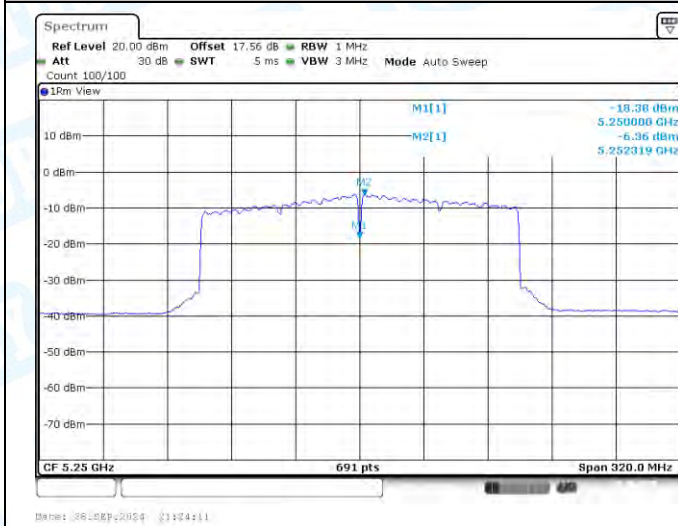


11AX160-CDD-Ant2-5250_UNII-2A-PASS

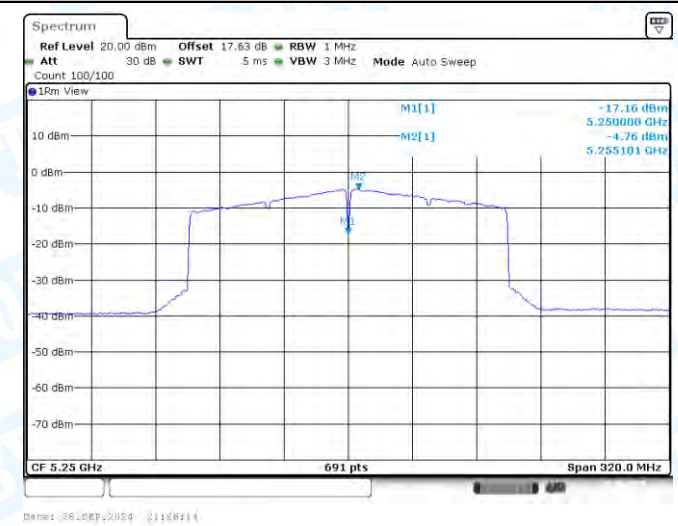

11AX160-CDD-Ant3-5250_UNII-2A-PASS

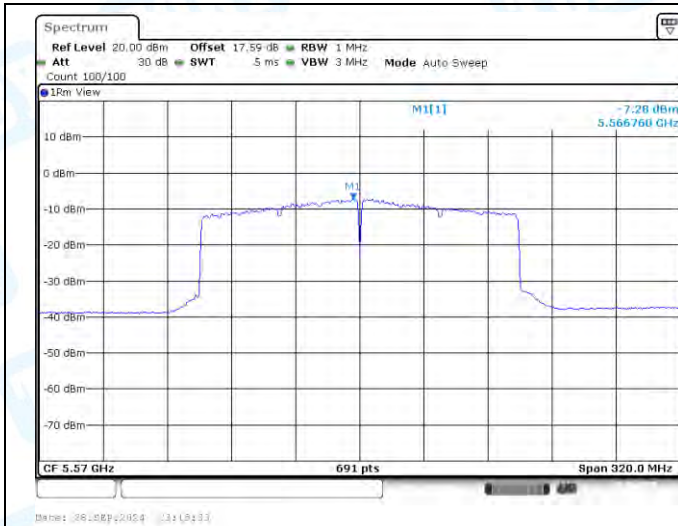

11AX160-CDD-Ant1-5570-PASS

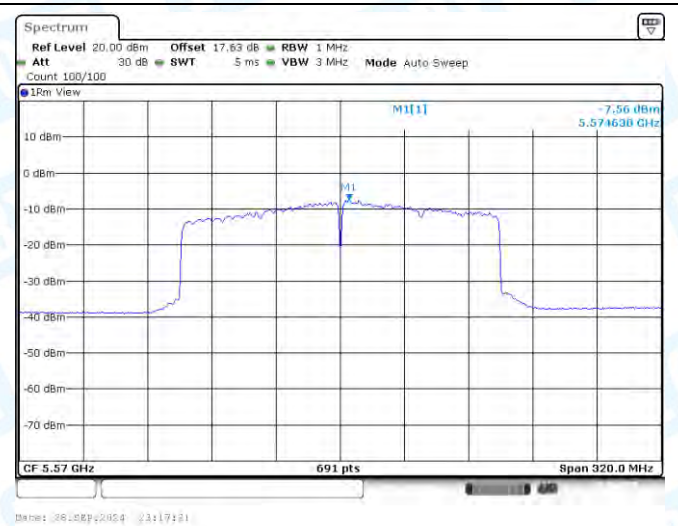

11AX160-CDD-Ant2-5570-PASS



11AX160-CDD-Ant3-5570-PASS

7: Conducted Spurious Emission

7.1 Test Result

TestMode	Antenna	Frequency [MHz]	FreqRange [MHz]	Max. Fre [MHz]	Max. Level [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	30~1000	115.02	-44.97	≤-27	PASS
11A	Ant2	5180	30~1000	892.74	-45.13	≤-27	PASS
11A	Ant3	5180	30~1000	891.15	-44.77	≤-27	PASS
11A	Ant1	5180	1000~40000	6231.2	-38.5	≤-27	PASS
11A	Ant2	5180	1000~40000	6935.8	-38.17	≤-27	PASS
11A	Ant3	5180	1000~40000	6889	-37.71	≤-27	PASS
11A	Ant1	5200	30~1000	860.7	-45.12	≤-27	PASS
11A	Ant2	5200	30~1000	891.44	-45.25	≤-27	PASS
11A	Ant3	5200	30~1000	860.24	-45.48	≤-27	PASS
11A	Ant1	5200	1000~40000	6968.3	-38.09	≤-27	PASS
11A	Ant2	5200	1000~40000	6991.7	-38.42	≤-27	PASS
11A	Ant3	5200	1000~40000	39924.6	-38.35	≤-27	PASS
11A	Ant1	5240	30~1000	891.83	-44.89	≤-27	PASS
11A	Ant2	5240	30~1000	890.35	-45.21	≤-27	PASS
11A	Ant3	5240	30~1000	888.11	-45.7	≤-27	PASS
11A	Ant1	5240	1000~40000	6943.6	-38.72	≤-27	PASS
11A	Ant2	5240	1000~40000	39994.8	-37.75	≤-27	PASS
11A	Ant3	5240	1000~40000	6924.1	-38.31	≤-27	PASS
11A	Ant1	5260	30~1000	872.66	-45.38	≤-27	PASS
11A	Ant2	5260	30~1000	888.44	-45.28	≤-27	PASS
11A	Ant3	5260	30~1000	867.55	-44.32	≤-27	PASS
11A	Ant1	5260	1000~40000	6995.6	-38.07	≤-27	PASS
11A	Ant2	5260	1000~40000	6999.5	-38.33	≤-27	PASS
11A	Ant3	5260	1000~40000	6969.6	-38.09	≤-27	PASS
11A	Ant1	5280	30~1000	859.95	-44.71	≤-27	PASS
11A	Ant2	5280	30~1000	888.86	-44.72	≤-27	PASS
11A	Ant3	5280	30~1000	859.99	-45.29	≤-27	PASS
11A	Ant1	5280	1000~40000	6983.9	-37.96	≤-27	PASS
11A	Ant2	5280	1000~40000	6950.1	-37.56	≤-27	PASS
11A	Ant3	5280	1000~40000	6855.2	-38.39	≤-27	PASS
11A	Ant1	5320	30~1000	860.57	-44.52	≤-27	PASS
11A	Ant2	5320	30~1000	897.69	-45.57	≤-27	PASS
11A	Ant3	5320	30~1000	889.89	-44.24	≤-27	PASS
11A	Ant1	5320	1000~40000	6753.8	-37.72	≤-27	PASS
11A	Ant2	5320	1000~40000	6986.5	-37.66	≤-27	PASS
11A	Ant3	5320	1000~40000	6931.9	-38.07	≤-27	PASS
11A	Ant1	5500	30~1000	890.47	-45.09	≤-27	PASS
11A	Ant2	5500	30~1000	510.41	-45.61	≤-27	PASS
11A	Ant3	5500	30~1000	870.88	-43.79	≤-27	PASS
11A	Ant1	5500	1000~40000	6989.1	-37.93	≤-27	PASS

11A	Ant2	5500	1000~40000	6921.5	-38.52	≤-27	PASS
11A	Ant3	5500	1000~40000	6983.9	-37.53	≤-27	PASS
11A	Ant1	5580	30~1000	959.89	-43.97	≤-27	PASS
11A	Ant2	5580	30~1000	959.76	-45.11	≤-27	PASS
11A	Ant3	5580	30~1000	890.77	-44.67	≤-27	PASS
11A	Ant1	5580	1000~40000	16748.2	-32.17	≤-27	PASS
11A	Ant2	5580	1000~40000	6964.4	-38.42	≤-27	PASS
11A	Ant3	5580	1000~40000	6891.6	-36.61	≤-27	PASS
11A	Ant1	5720	30~1000	706.8	-45.35	≤-27	PASS
11A	Ant2	5720	30~1000	860.79	-45.12	≤-27	PASS
11A	Ant3	5720	30~1000	861.34	-44.46	≤-27	PASS
11A	Ant1	5720	1000~40000	17165.5	-35.65	≤-27	PASS
11A	Ant2	5720	1000~40000	6996.9	-37.63	≤-27	PASS
11A	Ant3	5720	1000~40000	6934.5	-37.76	≤-27	PASS
11A	Ant1	5745	30~1000	865.51	-44.98	≤-27	PASS
11A	Ant2	5745	30~1000	958.53	-44.85	≤-27	PASS
11A	Ant3	5745	30~1000	888.37	-44.52	≤-27	PASS
11A	Ant1	5745	1000~40000	5850.3	-38.29	≤-27	PASS
11A	Ant2	5745	1000~40000	6989.1	-38.06	≤-27	PASS
11A	Ant3	5745	1000~40000	6978.7	-37.64	≤-27	PASS
11A	Ant1	5785	30~1000	895.78	-44.88	≤-27	PASS
11A	Ant2	5785	30~1000	893.61	-45.39	≤-27	PASS
11A	Ant3	5785	30~1000	890.38	-45.12	≤-27	PASS
11A	Ant1	5785	1000~40000	17361.8	-37.22	≤-27	PASS
11A	Ant2	5785	1000~40000	6902	-38.21	≤-27	PASS
11A	Ant3	5785	1000~40000	6918.9	-38.72	≤-27	PASS
11A	Ant1	5825	30~1000	862.15	-45.01	≤-27	PASS
11A	Ant2	5825	30~1000	961.06	-45.46	≤-27	PASS
11A	Ant3	5825	30~1000	966	-45.46	≤-27	PASS
11A	Ant1	5825	1000~40000	39399.4	-38.01	≤-27	PASS
11A	Ant2	5825	1000~40000	6973.5	-38.25	≤-27	PASS
11A	Ant3	5825	1000~40000	39340.9	-38.19	≤-27	PASS
11A-CDD	Ant1	5180	30~1000	958.44	-44.78	≤-27	PASS
11A-CDD	Ant2	5180	30~1000	862.48	-45.33	≤-27	PASS
11A-CDD	Ant3	5180	30~1000	954.23	-44.77	≤-27	PASS
11A-CDD	Ant1	5180	1000~40000	6983.9	-38.14	≤-27	PASS
11A-CDD	Ant2	5180	1000~40000	6987.8	-37.93	≤-27	PASS
11A-CDD	Ant3	5180	1000~40000	6968.3	-37.77	≤-27	PASS
11A-CDD	Ant1	5200	30~1000	860.02	-45.91	≤-27	PASS
11A-CDD	Ant2	5200	30~1000	866.36	-45.45	≤-27	PASS
11A-CDD	Ant3	5200	30~1000	959.34	-44.64	≤-27	PASS
11A-CDD	Ant1	5200	1000~40000	6950.1	-38.35	≤-27	PASS
11A-CDD	Ant2	5200	1000~40000	6964.4	-38.47	≤-27	PASS
11A-CDD	Ant3	5200	1000~40000	6938.4	-37.74	≤-27	PASS
11A-CDD	Ant1	5240	30~1000	889.76	-45.07	≤-27	PASS

11A-CDD	Ant2	5240	30~1000	712.29	-44.49	≤-27	PASS
11A-CDD	Ant3	5240	30~1000	891.87	-44.81	≤-27	PASS
11A-CDD	Ant1	5240	1000~40000	6963.1	-37.69	≤-27	PASS
11A-CDD	Ant2	5240	1000~40000	6916.3	-38	≤-27	PASS
11A-CDD	Ant3	5240	1000~40000	6938.4	-37.81	≤-27	PASS
11A-CDD	Ant1	5260	30~1000	860.99	-45.02	≤-27	PASS
11A-CDD	Ant2	5260	30~1000	891.09	-45.13	≤-27	PASS
11A-CDD	Ant3	5260	30~1000	890.6	-43.53	≤-27	PASS
11A-CDD	Ant1	5260	1000~40000	6994.3	-37.74	≤-27	PASS
11A-CDD	Ant2	5260	1000~40000	6956.6	-37.44	≤-27	PASS
11A-CDD	Ant3	5260	1000~40000	6999.5	-37.74	≤-27	PASS
11A-CDD	Ant1	5280	30~1000	516.33	-45.71	≤-27	PASS
11A-CDD	Ant2	5280	30~1000	930.86	-46.05	≤-27	PASS
11A-CDD	Ant3	5280	30~1000	890.51	-44.07	≤-27	PASS
11A-CDD	Ant1	5280	1000~40000	6976.1	-38.48	≤-27	PASS
11A-CDD	Ant2	5280	1000~40000	6939.7	-37.95	≤-27	PASS
11A-CDD	Ant3	5280	1000~40000	6972.2	-37.59	≤-27	PASS
11A-CDD	Ant1	5320	30~1000	861.38	-45.45	≤-27	PASS
11A-CDD	Ant2	5320	30~1000	117.09	-46.16	≤-27	PASS
11A-CDD	Ant3	5320	30~1000	707.99	-45.13	≤-27	PASS
11A-CDD	Ant1	5320	1000~40000	39291.5	-38.02	≤-27	PASS
11A-CDD	Ant2	5320	1000~40000	6947.5	-37.5	≤-27	PASS
11A-CDD	Ant3	5320	1000~40000	6860.4	-38.04	≤-27	PASS
11A-CDD	Ant1	5500	30~1000	861.12	-45.68	≤-27	PASS
11A-CDD	Ant2	5500	30~1000	860.44	-44.98	≤-27	PASS
11A-CDD	Ant3	5500	30~1000	860.41	-44.58	≤-27	PASS
11A-CDD	Ant1	5500	1000~40000	6985.2	-38.06	≤-27	PASS
11A-CDD	Ant2	5500	1000~40000	6703.1	-37.89	≤-27	PASS
11A-CDD	Ant3	5500	1000~40000	6980	-38.07	≤-27	PASS
11A-CDD	Ant1	5580	30~1000	509.41	-44.69	≤-27	PASS
11A-CDD	Ant2	5580	30~1000	892.87	-44.41	≤-27	PASS
11A-CDD	Ant3	5580	30~1000	863.67	-44.89	≤-27	PASS
11A-CDD	Ant1	5580	1000~40000	16732.6	-37.45	≤-27	PASS
11A-CDD	Ant2	5580	1000~40000	39763.4	-38.34	≤-27	PASS
11A-CDD	Ant3	5580	1000~40000	6892.9	-38.67	≤-27	PASS
11A-CDD	Ant1	5720	30~1000	861.83	-45.29	≤-27	PASS
11A-CDD	Ant2	5720	30~1000	863.38	-44.28	≤-27	PASS
11A-CDD	Ant3	5720	30~1000	698.52	-44.98	≤-27	PASS
11A-CDD	Ant1	5720	1000~40000	6967	-37.31	≤-27	PASS
11A-CDD	Ant2	5720	1000~40000	6981.3	-37.87	≤-27	PASS
11A-CDD	Ant3	5720	1000~40000	6957.9	-37.58	≤-27	PASS
11A-CDD	Ant1	5745	30~1000	891.77	-44.89	≤-27	PASS
11A-CDD	Ant2	5745	30~1000	888.89	-45.16	≤-27	PASS
11A-CDD	Ant3	5745	30~1000	866.16	-45.28	≤-27	PASS
11A-CDD	Ant1	5745	1000~40000	6983.9	-38.74	≤-27	PASS

11A-CDD	Ant2	5745	1000~40000	6973.5	-37.99	≤-27	PASS
11A-CDD	Ant3	5745	1000~40000	6968.3	-36.55	≤-27	PASS
11A-CDD	Ant1	5785	30~1000	706.57	-44.31	≤-27	PASS
11A-CDD	Ant2	5785	30~1000	861.08	-45.65	≤-27	PASS
11A-CDD	Ant3	5785	30~1000	707.86	-44.14	≤-27	PASS
11A-CDD	Ant1	5785	1000~40000	6941	-38.12	≤-27	PASS
11A-CDD	Ant2	5785	1000~40000	6885.1	-37.68	≤-27	PASS
11A-CDD	Ant3	5785	1000~40000	6937.1	-37.28	≤-27	PASS
11A-CDD	Ant1	5825	30~1000	980.49	-46.09	≤-27	PASS
11A-CDD	Ant2	5825	30~1000	825.29	-44.85	≤-27	PASS
11A-CDD	Ant3	5825	30~1000	890.31	-44.37	≤-27	PASS
11A-CDD	Ant1	5825	1000~40000	6886.4	-37.57	≤-27	PASS
11A-CDD	Ant2	5825	1000~40000	6968.3	-36.98	≤-27	PASS
11A-CDD	Ant3	5825	1000~40000	6904.6	-37.92	≤-27	PASS
11N20-CDD	Ant1	5180	30~1000	961.48	-43.61	≤-27	PASS
11N20-CDD	Ant2	5180	30~1000	888.44	-44.69	≤-27	PASS
11N20-CDD	Ant3	5180	30~1000	890.67	-45.58	≤-27	PASS
11N20-CDD	Ant1	5180	1000~40000	6964.4	-38.65	≤-27	PASS
11N20-CDD	Ant2	5180	1000~40000	6822.7	-37.99	≤-27	PASS
11N20-CDD	Ant3	5180	1000~40000	6960.5	-38.43	≤-27	PASS
11N20-CDD	Ant1	5200	30~1000	862.83	-45.23	≤-27	PASS
11N20-CDD	Ant2	5200	30~1000	707.7	-45.52	≤-27	PASS
11N20-CDD	Ant3	5200	30~1000	958.92	-42.54	≤-27	PASS
11N20-CDD	Ant1	5200	1000~40000	6970.9	-38.82	≤-27	PASS
11N20-CDD	Ant2	5200	1000~40000	6996.9	-38.3	≤-27	PASS
11N20-CDD	Ant3	5200	1000~40000	6995.6	-36.64	≤-27	PASS
11N20-CDD	Ant1	5240	30~1000	960.02	-44.81	≤-27	PASS
11N20-CDD	Ant2	5240	30~1000	889.7	-44.59	≤-27	PASS
11N20-CDD	Ant3	5240	30~1000	817.92	-44.49	≤-27	PASS
11N20-CDD	Ant1	5240	1000~40000	6872.1	-37.59	≤-27	PASS
11N20-CDD	Ant2	5240	1000~40000	6817.5	-38.01	≤-27	PASS
11N20-CDD	Ant3	5240	1000~40000	6995.6	-37.49	≤-27	PASS
11N20-CDD	Ant1	5260	30~1000	862.96	-45.86	≤-27	PASS
11N20-CDD	Ant2	5260	30~1000	889.44	-45.38	≤-27	PASS
11N20-CDD	Ant3	5260	30~1000	958.18	-44.7	≤-27	PASS
11N20-CDD	Ant1	5260	1000~40000	6954	-38.05	≤-27	PASS
11N20-CDD	Ant2	5260	1000~40000	39992.2	-37.37	≤-27	PASS
11N20-CDD	Ant3	5260	1000~40000	6976.1	-38.41	≤-27	PASS
11N20-CDD	Ant1	5280	30~1000	862.15	-45.24	≤-27	PASS
11N20-CDD	Ant2	5280	30~1000	706.7	-44.27	≤-27	PASS
11N20-CDD	Ant3	5280	30~1000	959.44	-44.94	≤-27	PASS
11N20-CDD	Ant1	5280	1000~40000	6898.1	-38.29	≤-27	PASS
11N20-CDD	Ant2	5280	1000~40000	6933.2	-38.45	≤-27	PASS
11N20-CDD	Ant3	5280	1000~40000	6974.8	-37.29	≤-27	PASS
11N20-CDD	Ant1	5320	30~1000	891.7	-45.62	≤-27	PASS

11N20-CDD	Ant2	5320	30~1000	865.77	-44.56	≤-27	PASS
11N20-CDD	Ant3	5320	30~1000	891.35	-44.38	≤-27	PASS
11N20-CDD	Ant1	5320	1000~40000	6981.3	-37.98	≤-27	PASS
11N20-CDD	Ant2	5320	1000~40000	6876	-38.07	≤-27	PASS
11N20-CDD	Ant3	5320	1000~40000	6938.4	-38.04	≤-27	PASS
11N20-CDD	Ant1	5500	30~1000	891.12	-46.11	≤-27	PASS
11N20-CDD	Ant2	5500	30~1000	962.12	-45.58	≤-27	PASS
11N20-CDD	Ant3	5500	30~1000	962.28	-45.59	≤-27	PASS
11N20-CDD	Ant1	5500	1000~40000	6960.5	-36.73	≤-27	PASS
11N20-CDD	Ant2	5500	1000~40000	6993	-37.61	≤-27	PASS
11N20-CDD	Ant3	5500	1000~40000	6697.9	-37.94	≤-27	PASS
11N20-CDD	Ant1	5580	30~1000	860.76	-43.29	≤-27	PASS
11N20-CDD	Ant2	5580	30~1000	512.51	-45.18	≤-27	PASS
11N20-CDD	Ant3	5580	30~1000	893.64	-44.35	≤-27	PASS
11N20-CDD	Ant1	5580	1000~40000	6894.2	-37.65	≤-27	PASS
11N20-CDD	Ant2	5580	1000~40000	6950.1	-37.9	≤-27	PASS
11N20-CDD	Ant3	5580	1000~40000	6805.8	-38.38	≤-27	PASS
11N20-CDD	Ant1	5720	30~1000	863.12	-44.37	≤-27	PASS
11N20-CDD	Ant2	5720	30~1000	888.34	-44.33	≤-27	PASS
11N20-CDD	Ant3	5720	30~1000	967.88	-45.18	≤-27	PASS
11N20-CDD	Ant1	5720	1000~40000	6943.6	-37.32	≤-27	PASS
11N20-CDD	Ant2	5720	1000~40000	6991.7	-37.6	≤-27	PASS
11N20-CDD	Ant3	5720	1000~40000	6774.6	-37.94	≤-27	PASS
11N20-CDD	Ant1	5745	30~1000	963.9	-45.69	≤-27	PASS
11N20-CDD	Ant2	5745	30~1000	890.83	-45.41	≤-27	PASS
11N20-CDD	Ant3	5745	30~1000	860.7	-45.53	≤-27	PASS
11N20-CDD	Ant1	5745	1000~40000	6931.9	-37.37	≤-27	PASS
11N20-CDD	Ant2	5745	1000~40000	6947.5	-37.58	≤-27	PASS
11N20-CDD	Ant3	5745	1000~40000	6859.1	-37.93	≤-27	PASS
11N20-CDD	Ant1	5785	30~1000	895.2	-45.47	≤-27	PASS
11N20-CDD	Ant2	5785	30~1000	887.99	-45.05	≤-27	PASS
11N20-CDD	Ant3	5785	30~1000	863.9	-45.16	≤-27	PASS
11N20-CDD	Ant1	5785	1000~40000	6764.2	-38.32	≤-27	PASS
11N20-CDD	Ant2	5785	1000~40000	6842.2	-38.03	≤-27	PASS
11N20-CDD	Ant3	5785	1000~40000	1926.9	-35.49	≤-27	PASS
11N20-CDD	Ant1	5825	30~1000	710.06	-45.28	≤-27	PASS
11N20-CDD	Ant2	5825	30~1000	889.73	-45.13	≤-27	PASS
11N20-CDD	Ant3	5825	30~1000	888.92	-43.33	≤-27	PASS
11N20-CDD	Ant1	5825	1000~40000	6973.5	-37.38	≤-27	PASS
11N20-CDD	Ant2	5825	1000~40000	6878.6	-37.55	≤-27	PASS
11N20-CDD	Ant3	5825	1000~40000	6902	-38.21	≤-27	PASS
11N40-CDD	Ant1	5190	30~1000	889.02	-45.16	≤-27	PASS
11N40-CDD	Ant2	5190	30~1000	508.89	-44.92	≤-27	PASS
11N40-CDD	Ant3	5190	30~1000	940.72	-44.95	≤-27	PASS
11N40-CDD	Ant1	5190	1000~40000	6961.8	-38.5	≤-27	PASS

11N40-CDD	Ant2	5190	1000~40000	6939.7	-38.09	≤-27	PASS
11N40-CDD	Ant3	5190	1000~40000	6925.4	-38.26	≤-27	PASS
11N40-CDD	Ant1	5230	30~1000	508.76	-45.4	≤-27	PASS
11N40-CDD	Ant2	5230	30~1000	860.66	-44.7	≤-27	PASS
11N40-CDD	Ant3	5230	30~1000	510.02	-45.69	≤-27	PASS
11N40-CDD	Ant1	5230	1000~40000	6985.2	-38.32	≤-27	PASS
11N40-CDD	Ant2	5230	1000~40000	6967	-38.22	≤-27	PASS
11N40-CDD	Ant3	5230	1000~40000	6967	-37.31	≤-27	PASS
11N40-CDD	Ant1	5270	30~1000	509.5	-45.9	≤-27	PASS
11N40-CDD	Ant2	5270	30~1000	891.22	-44.68	≤-27	PASS
11N40-CDD	Ant3	5270	30~1000	961.02	-45.67	≤-27	PASS
11N40-CDD	Ant1	5270	1000~40000	6973.5	-38.18	≤-27	PASS
11N40-CDD	Ant2	5270	1000~40000	6876	-37.96	≤-27	PASS
11N40-CDD	Ant3	5270	1000~40000	6964.4	-37.24	≤-27	PASS
11N40-CDD	Ant1	5310	30~1000	890.05	-43.68	≤-27	PASS
11N40-CDD	Ant2	5310	30~1000	860.47	-46.06	≤-27	PASS
11N40-CDD	Ant3	5310	30~1000	706.63	-42.49	≤-27	PASS
11N40-CDD	Ant1	5310	1000~40000	6963.1	-38.18	≤-27	PASS
11N40-CDD	Ant2	5310	1000~40000	6765.5	-38.7	≤-27	PASS
11N40-CDD	Ant3	5310	1000~40000	6883.8	-36.69	≤-27	PASS
11N40-CDD	Ant1	5510	30~1000	707.54	-45.54	≤-27	PASS
11N40-CDD	Ant2	5510	30~1000	860.47	-45.39	≤-27	PASS
11N40-CDD	Ant3	5510	30~1000	888.18	-45.93	≤-27	PASS
11N40-CDD	Ant1	5510	1000~40000	6964.4	-38.21	≤-27	PASS
11N40-CDD	Ant2	5510	1000~40000	6985.2	-37.4	≤-27	PASS
11N40-CDD	Ant3	5510	1000~40000	6959.2	-37.96	≤-27	PASS
11N40-CDD	Ant1	5550	30~1000	958.47	-45.65	≤-27	PASS
11N40-CDD	Ant2	5550	30~1000	895.32	-45.01	≤-27	PASS
11N40-CDD	Ant3	5550	30~1000	863.19	-45.6	≤-27	PASS
11N40-CDD	Ant1	5550	1000~40000	39990.9	-37.83	≤-27	PASS
11N40-CDD	Ant2	5550	1000~40000	6961.8	-38.34	≤-27	PASS
11N40-CDD	Ant3	5550	1000~40000	6863	-37.5	≤-27	PASS
11N40-CDD	Ant1	5710	30~1000	861.86	-44.74	≤-27	PASS
11N40-CDD	Ant2	5710	30~1000	959.57	-44.63	≤-27	PASS
11N40-CDD	Ant3	5710	30~1000	508.53	-43.72	≤-27	PASS
11N40-CDD	Ant1	5710	1000~40000	6981.3	-37.06	≤-27	PASS
11N40-CDD	Ant2	5710	1000~40000	6882.5	-37.84	≤-27	PASS
11N40-CDD	Ant3	5710	1000~40000	6999.5	-37.02	≤-27	PASS
11N40-CDD	Ant1	5755	30~1000	896.33	-44.56	≤-27	PASS
11N40-CDD	Ant2	5755	30~1000	706.99	-44.99	≤-27	PASS
11N40-CDD	Ant3	5755	30~1000	890.22	-44.25	≤-27	PASS
11N40-CDD	Ant1	5755	1000~40000	6937.1	-37.67	≤-27	PASS
11N40-CDD	Ant2	5755	1000~40000	6912.4	-37.91	≤-27	PASS
11N40-CDD	Ant3	5755	1000~40000	39981.8	-36.71	≤-27	PASS
11N40-CDD	Ant1	5795	30~1000	890.73	-44.2	≤-27	PASS

11N40-CDD	Ant2	5795	30~1000	959.57	-45.67	≤-27	PASS
11N40-CDD	Ant3	5795	30~1000	945.18	-44.94	≤-27	PASS
11N40-CDD	Ant1	5795	1000~40000	6756.4	-38.63	≤-27	PASS
11N40-CDD	Ant2	5795	1000~40000	6947.5	-38.46	≤-27	PASS
11N40-CDD	Ant3	5795	1000~40000	6931.9	-37.91	≤-27	PASS
11AC20-CDD	Ant1	5180	30~1000	864.67	-45.74	≤-27	PASS
11AC20-CDD	Ant2	5180	30~1000	705.44	-44.47	≤-27	PASS
11AC20-CDD	Ant3	5180	30~1000	115.96	-45.96	≤-27	PASS
11AC20-CDD	Ant1	5180	1000~40000	6960.5	-37.41	≤-27	PASS
11AC20-CDD	Ant2	5180	1000~40000	6959.2	-37.78	≤-27	PASS
11AC20-CDD	Ant3	5180	1000~40000	6887.7	-38.47	≤-27	PASS
11AC20-CDD	Ant1	5200	30~1000	891.09	-45.28	≤-27	PASS
11AC20-CDD	Ant2	5200	30~1000	861.02	-44.8	≤-27	PASS
11AC20-CDD	Ant3	5200	30~1000	897.72	-45.08	≤-27	PASS
11AC20-CDD	Ant1	5200	1000~40000	6844.8	-38.37	≤-27	PASS
11AC20-CDD	Ant2	5200	1000~40000	6756.4	-38.68	≤-27	PASS
11AC20-CDD	Ant3	5200	1000~40000	6972.2	-38.03	≤-27	PASS
11AC20-CDD	Ant1	5240	30~1000	890.9	-45.32	≤-27	PASS
11AC20-CDD	Ant2	5240	30~1000	709.87	-44.69	≤-27	PASS
11AC20-CDD	Ant3	5240	30~1000	968.14	-44.48	≤-27	PASS
11AC20-CDD	Ant1	5240	1000~40000	6895.5	-36.99	≤-27	PASS
11AC20-CDD	Ant2	5240	1000~40000	6816.2	-37.95	≤-27	PASS
11AC20-CDD	Ant3	5240	1000~40000	6736.9	-38.55	≤-27	PASS
11AC20-CDD	Ant1	5260	30~1000	594.51	-45.21	≤-27	PASS
11AC20-CDD	Ant2	5260	30~1000	116.38	-43.82	≤-27	PASS
11AC20-CDD	Ant3	5260	30~1000	889.18	-44.49	≤-27	PASS
11AC20-CDD	Ant1	5260	1000~40000	6980	-38.51	≤-27	PASS
11AC20-CDD	Ant2	5260	1000~40000	6993	-38.44	≤-27	PASS
11AC20-CDD	Ant3	5260	1000~40000	6989.1	-38.11	≤-27	PASS
11AC20-CDD	Ant1	5280	30~1000	888.34	-43.75	≤-27	PASS
11AC20-CDD	Ant2	5280	30~1000	973.05	-44.57	≤-27	PASS
11AC20-CDD	Ant3	5280	30~1000	861.54	-45.48	≤-27	PASS
11AC20-CDD	Ant1	5280	1000~40000	6990.4	-38.51	≤-27	PASS
11AC20-CDD	Ant2	5280	1000~40000	6980	-37.5	≤-27	PASS
11AC20-CDD	Ant3	5280	1000~40000	38958.7	-37.65	≤-27	PASS
11AC20-CDD	Ant1	5320	30~1000	863.93	-44.31	≤-27	PASS
11AC20-CDD	Ant2	5320	30~1000	861.99	-44.4	≤-27	PASS
11AC20-CDD	Ant3	5320	30~1000	862.28	-45.9	≤-27	PASS
11AC20-CDD	Ant1	5320	1000~40000	6690.1	-38.05	≤-27	PASS
11AC20-CDD	Ant2	5320	1000~40000	6902	-38.23	≤-27	PASS
11AC20-CDD	Ant3	5320	1000~40000	6985.2	-38.48	≤-27	PASS
11AC20-CDD	Ant1	5500	30~1000	860.05	-45.4	≤-27	PASS
11AC20-CDD	Ant2	5500	30~1000	890.86	-43.68	≤-27	PASS
11AC20-CDD	Ant3	5500	30~1000	889.76	-45.32	≤-27	PASS
11AC20-CDD	Ant1	5500	1000~40000	6935.8	-37.89	≤-27	PASS

11AC20-CDD	Ant2	5500	1000~40000	6820.1	-38.23	≤-27	PASS
11AC20-CDD	Ant3	5500	1000~40000	6951.4	-36.82	≤-27	PASS
11AC20-CDD	Ant1	5580	30~1000	965.49	-45.64	≤-27	PASS
11AC20-CDD	Ant2	5580	30~1000	860.24	-44.28	≤-27	PASS
11AC20-CDD	Ant3	5580	30~1000	864.84	-44.65	≤-27	PASS
11AC20-CDD	Ant1	5580	1000~40000	6969.6	-37.78	≤-27	PASS
11AC20-CDD	Ant2	5580	1000~40000	6995.6	-38.04	≤-27	PASS
11AC20-CDD	Ant3	5580	1000~40000	6989.1	-37.85	≤-27	PASS
11AC20-CDD	Ant1	5720	30~1000	860.05	-45.42	≤-27	PASS
11AC20-CDD	Ant2	5720	30~1000	521.24	-45.59	≤-27	PASS
11AC20-CDD	Ant3	5720	30~1000	860.11	-43.23	≤-27	PASS
11AC20-CDD	Ant1	5720	1000~40000	6870.8	-37.55	≤-27	PASS
11AC20-CDD	Ant2	5720	1000~40000	6969.6	-37.54	≤-27	PASS
11AC20-CDD	Ant3	5720	1000~40000	6965.7	-37.29	≤-27	PASS
11AC20-CDD	Ant1	5745	30~1000	893.74	-45.07	≤-27	PASS
11AC20-CDD	Ant3	5745	30~1000	860.57	-44.34	≤-27	PASS
11AC20-CDD	Ant2	5745	30~1000	960.57	-45.06	≤-27	PASS
11AC20-CDD	Ant1	5745	1000~40000	6964.4	-38.15	≤-27	PASS
11AC20-CDD	Ant2	5745	1000~40000	6864.3	-37.44	≤-27	PASS
11AC20-CDD	Ant3	5745	1000~40000	6873.4	-37.46	≤-27	PASS
11AC20-CDD	Ant1	5785	30~1000	960.67	-45.36	≤-27	PASS
11AC20-CDD	Ant3	5785	30~1000	888.11	-42.64	≤-27	PASS
11AC20-CDD	Ant2	5785	30~1000	484.93	-44.55	≤-27	PASS
11AC20-CDD	Ant1	5785	1000~40000	6990.4	-37.53	≤-27	PASS
11AC20-CDD	Ant2	5785	1000~40000	6929.3	-38.38	≤-27	PASS
11AC20-CDD	Ant3	5785	1000~40000	6993	-38.44	≤-27	PASS
11AC20-CDD	Ant1	5825	30~1000	958.41	-45.71	≤-27	PASS
11AC20-CDD	Ant2	5825	30~1000	116.83	-45.3	≤-27	PASS
11AC20-CDD	Ant3	5825	30~1000	959.7	-45.23	≤-27	PASS
11AC20-CDD	Ant1	5825	1000~40000	6900.7	-38.75	≤-27	PASS
11AC20-CDD	Ant2	5825	1000~40000	6857.8	-37.97	≤-27	PASS
11AC20-CDD	Ant3	5825	1000~40000	6942.3	-38.16	≤-27	PASS
11AC40-CDD	Ant1	5190	30~1000	861.86	-45.41	≤-27	PASS
11AC40-CDD	Ant2	5190	30~1000	509.73	-45.6	≤-27	PASS
11AC40-CDD	Ant3	5190	30~1000	888.54	-45.26	≤-27	PASS
11AC40-CDD	Ant1	5190	1000~40000	39751.7	-37.86	≤-27	PASS
11AC40-CDD	Ant2	5190	1000~40000	6834.4	-38.18	≤-27	PASS
11AC40-CDD	Ant3	5190	1000~40000	6986.5	-36.96	≤-27	PASS
11AC40-CDD	Ant1	5230	30~1000	965.55	-44.03	≤-27	PASS
11AC40-CDD	Ant2	5230	30~1000	892.8	-45.14	≤-27	PASS
11AC40-CDD	Ant3	5230	30~1000	862.77	-45.27	≤-27	PASS
11AC40-CDD	Ant1	5230	1000~40000	6853.9	-38.05	≤-27	PASS
11AC40-CDD	Ant2	5230	1000~40000	6996.9	-38.21	≤-27	PASS
11AC40-CDD	Ant3	5230	1000~40000	6933.2	-37.52	≤-27	PASS
11AC40-CDD	Ant1	5270	30~1000	889.38	-44.88	≤-27	PASS

11AC40-CDD	Ant2	5270	30~1000	888.86	-45.79	≤-27	PASS
11AC40-CDD	Ant3	5270	30~1000	708.32	-44.36	≤-27	PASS
11AC40-CDD	Ant1	5270	1000~40000	6994.3	-38.32	≤-27	PASS
11AC40-CDD	Ant2	5270	1000~40000	6934.5	-38.49	≤-27	PASS
11AC40-CDD	Ant3	5270	1000~40000	6954	-38.59	≤-27	PASS
11AC40-CDD	Ant1	5310	30~1000	889.44	-44.74	≤-27	PASS
11AC40-CDD	Ant2	5310	30~1000	888.7	-45.2	≤-27	PASS
11AC40-CDD	Ant3	5310	30~1000	888.05	-44.72	≤-27	PASS
11AC40-CDD	Ant1	5310	1000~40000	6957.9	-38.78	≤-27	PASS
11AC40-CDD	Ant2	5310	1000~40000	6985.2	-38.48	≤-27	PASS
11AC40-CDD	Ant3	5310	1000~40000	6947.5	-38.36	≤-27	PASS
11AC40-CDD	Ant1	5510	30~1000	513.03	-45.3	≤-27	PASS
11AC40-CDD	Ant2	5510	30~1000	958.83	-43.42	≤-27	PASS
11AC40-CDD	Ant3	5510	30~1000	860.7	-43.66	≤-27	PASS
11AC40-CDD	Ant1	5510	1000~40000	39762.1	-38.36	≤-27	PASS
11AC40-CDD	Ant2	5510	1000~40000	38889.8	-37.81	≤-27	PASS
11AC40-CDD	Ant3	5510	1000~40000	6961.8	-37.75	≤-27	PASS
11AC40-CDD	Ant1	5550	30~1000	959.83	-44.01	≤-27	PASS
11AC40-CDD	Ant2	5550	30~1000	889.83	-45.37	≤-27	PASS
11AC40-CDD	Ant3	5550	30~1000	826.52	-43.57	≤-27	PASS
11AC40-CDD	Ant1	5550	1000~40000	6998.2	-38.27	≤-27	PASS
11AC40-CDD	Ant2	5550	1000~40000	6795.4	-37.78	≤-27	PASS
11AC40-CDD	Ant3	5550	1000~40000	6995.6	-36.66	≤-27	PASS
11AC40-CDD	Ant1	5710	30~1000	958.44	-45.3	≤-27	PASS
11AC40-CDD	Ant2	5710	30~1000	830.69	-45.51	≤-27	PASS
11AC40-CDD	Ant3	5710	30~1000	830.08	-41.59	≤-27	PASS
11AC40-CDD	Ant1	5710	1000~40000	6769.4	-37.48	≤-27	PASS
11AC40-CDD	Ant2	5710	1000~40000	6876	-37.63	≤-27	PASS
11AC40-CDD	Ant3	5710	1000~40000	6937.1	-37.83	≤-27	PASS
11AC40-CDD	Ant1	5755	30~1000	863.12	-45.79	≤-27	PASS
11AC40-CDD	Ant2	5755	30~1000	930.28	-45.36	≤-27	PASS
11AC40-CDD	Ant3	5755	30~1000	896.17	-45.44	≤-27	PASS
11AC40-CDD	Ant1	5755	1000~40000	6974.8	-37.83	≤-27	PASS
11AC40-CDD	Ant2	5755	1000~40000	6891.6	-37.83	≤-27	PASS
11AC40-CDD	Ant3	5755	1000~40000	6954	-38.28	≤-27	PASS
11AC40-CDD	Ant1	5795	30~1000	963.35	-45.54	≤-27	PASS
11AC40-CDD	Ant2	5795	30~1000	864.74	-44.08	≤-27	PASS
11AC40-CDD	Ant3	5795	30~1000	891.15	-45.19	≤-27	PASS
11AC40-CDD	Ant1	5795	1000~40000	6973.5	-37.98	≤-27	PASS
11AC40-CDD	Ant2	5795	1000~40000	6959.2	-38.56	≤-27	PASS
11AC40-CDD	Ant3	5795	1000~40000	6959.2	-36.94	≤-27	PASS
11AC80-CDD	Ant1	5210	30~1000	959.15	-45.61	≤-27	PASS
11AC80-CDD	Ant2	5210	30~1000	958.57	-46.01	≤-27	PASS
11AC80-CDD	Ant3	5210	30~1000	890.15	-45.37	≤-27	PASS
11AC80-CDD	Ant1	5210	1000~40000	6972.2	-38.58	≤-27	PASS

11AC80-CDD	Ant2	5210	1000~40000	6970.9	-38.16	≤-27	PASS
11AC80-CDD	Ant3	5210	1000~40000	6610.8	-38.81	≤-27	PASS
11AC80-CDD	Ant1	5290	30~1000	959.12	-45.49	≤-27	PASS
11AC80-CDD	Ant2	5290	30~1000	862.44	-44.6	≤-27	PASS
11AC80-CDD	Ant3	5290	30~1000	888.18	-45.32	≤-27	PASS
11AC80-CDD	Ant1	5290	1000~40000	6946.2	-37.58	≤-27	PASS
11AC80-CDD	Ant2	5290	1000~40000	6952.7	-37.65	≤-27	PASS
11AC80-CDD	Ant3	5290	1000~40000	6969.6	-38.54	≤-27	PASS
11AC80-CDD	Ant1	5530	30~1000	962.38	-45.64	≤-27	PASS
11AC80-CDD	Ant2	5530	30~1000	706.34	-44.58	≤-27	PASS
11AC80-CDD	Ant3	5530	30~1000	861.54	-44.72	≤-27	PASS
11AC80-CDD	Ant1	5530	1000~40000	6982.6	-38.41	≤-27	PASS
11AC80-CDD	Ant2	5530	1000~40000	6915	-37.93	≤-27	PASS
11AC80-CDD	Ant3	5530	1000~40000	6911.1	-36.99	≤-27	PASS
11AC80-CDD	Ant1	5610	30~1000	706.08	-45.7	≤-27	PASS
11AC80-CDD	Ant2	5610	30~1000	865.51	-45.46	≤-27	PASS
11AC80-CDD	Ant3	5610	30~1000	862.83	-44.95	≤-27	PASS
11AC80-CDD	Ant1	5610	1000~40000	6853.9	-37.27	≤-27	PASS
11AC80-CDD	Ant2	5610	1000~40000	6929.3	-38.22	≤-27	PASS
11AC80-CDD	Ant3	5610	1000~40000	6987.8	-37.02	≤-27	PASS
11AC80-CDD	Ant1	5690	30~1000	707.6	-44.78	≤-27	PASS
11AC80-CDD	Ant2	5690	30~1000	958.95	-44.19	≤-27	PASS
11AC80-CDD	Ant3	5690	30~1000	864.25	-44.18	≤-27	PASS
11AC80-CDD	Ant1	5690	1000~40000	6877.3	-37.59	≤-27	PASS
11AC80-CDD	Ant2	5690	1000~40000	6916.3	-37.53	≤-27	PASS
11AC80-CDD	Ant3	5690	1000~40000	6989.1	-37.6	≤-27	PASS
11AC80-CDD	Ant1	5775	30~1000	898.11	-45.6	≤-27	PASS
11AC80-CDD	Ant2	5775	30~1000	888.7	-45.27	≤-27	PASS
11AC80-CDD	Ant3	5775	30~1000	714.72	-44.76	≤-27	PASS
11AC80-CDD	Ant1	5775	1000~40000	6985.2	-38.58	≤-27	PASS
11AC80-CDD	Ant2	5775	1000~40000	6766.8	-36.76	≤-27	PASS
11AC80-CDD	Ant3	5775	1000~40000	6943.6	-37.49	≤-27	PASS
11AC160-CDD	Ant1	5250	30~1000	959.12	-44.14	≤-27	PASS
11AC160-CDD	Ant2	5250	30~1000	961.54	-43.79	≤-27	PASS
11AC160-CDD	Ant3	5250	30~1000	959.76	-45.5	≤-27	PASS
11AC160-CDD	Ant1	5250	1000~40000	6985.2	-38.04	≤-27	PASS
11AC160-CDD	Ant2	5250	1000~40000	6996.9	-37.87	≤-27	PASS
11AC160-CDD	Ant3	5250	1000~40000	6967	-37.8	≤-27	PASS
11AC160-CDD	Ant1	5570	30~1000	966.07	-45.63	≤-27	PASS
11AC160-CDD	Ant2	5570	30~1000	860.21	-45.47	≤-27	PASS
11AC160-CDD	Ant3	5570	30~1000	892.77	-44.96	≤-27	PASS
11AC160-CDD	Ant1	5570	1000~40000	6999.5	-37.85	≤-27	PASS
11AC160-CDD	Ant2	5570	1000~40000	6840.9	-37.72	≤-27	PASS
11AC160-CDD	Ant3	5570	1000~40000	6991.7	-37.27	≤-27	PASS
11AX20-CDD	Ant1	5180	30~1000	860.02	-43.74	≤-27	PASS


11AX20-CDD	Ant2	5180	30~1000	959.31	-45.15	≤-27	PASS
11AX20-CDD	Ant3	5180	30~1000	708.64	-45.14	≤-27	PASS
11AX20-CDD	Ant1	5180	1000~40000	6994.3	-38.6	≤-27	PASS
11AX20-CDD	Ant2	5180	1000~40000	6928	-38.42	≤-27	PASS
11AX20-CDD	Ant3	5180	1000~40000	6954	-38.38	≤-27	PASS
11AX20-CDD	Ant1	5200	30~1000	892.03	-45.09	≤-27	PASS
11AX20-CDD	Ant2	5200	30~1000	892.22	-44.66	≤-27	PASS
11AX20-CDD	Ant3	5200	30~1000	958.76	-45.11	≤-27	PASS
11AX20-CDD	Ant1	5200	1000~40000	6876	-38.14	≤-27	PASS
11AX20-CDD	Ant2	5200	1000~40000	6967	-38.62	≤-27	PASS
11AX20-CDD	Ant3	5200	1000~40000	6922.8	-38.05	≤-27	PASS
11AX20-CDD	Ant1	5240	30~1000	892.22	-44.19	≤-27	PASS
11AX20-CDD	Ant2	5240	30~1000	889.34	-44.84	≤-27	PASS
11AX20-CDD	Ant3	5240	30~1000	893.97	-45.73	≤-27	PASS
11AX20-CDD	Ant1	5240	1000~40000	6974.8	-38.41	≤-27	PASS
11AX20-CDD	Ant2	5240	1000~40000	6990.4	-38.25	≤-27	PASS
11AX20-CDD	Ant3	5240	1000~40000	6865.6	-37.64	≤-27	PASS
11AX20-CDD	Ant1	5260	30~1000	890.51	-44.1	≤-27	PASS
11AX20-CDD	Ant2	5260	30~1000	862.35	-44.59	≤-27	PASS
11AX20-CDD	Ant3	5260	30~1000	860.86	-45.25	≤-27	PASS
11AX20-CDD	Ant1	5260	1000~40000	6959.2	-37.64	≤-27	PASS
11AX20-CDD	Ant2	5260	1000~40000	39996.1	-38.34	≤-27	PASS
11AX20-CDD	Ant3	5260	1000~40000	6965.7	-38.04	≤-27	PASS
11AX20-CDD	Ant1	5280	30~1000	959.28	-45.65	≤-27	PASS
11AX20-CDD	Ant2	5280	30~1000	958.83	-43.81	≤-27	PASS
11AX20-CDD	Ant3	5280	30~1000	862.9	-45.16	≤-27	PASS
11AX20-CDD	Ant1	5280	1000~40000	6807.1	-38.3	≤-27	PASS
11AX20-CDD	Ant2	5280	1000~40000	6800.6	-37.48	≤-27	PASS
11AX20-CDD	Ant3	5280	1000~40000	6960.5	-38.57	≤-27	PASS
11AX20-CDD	Ant1	5320	30~1000	888.63	-46.03	≤-27	PASS
11AX20-CDD	Ant2	5320	30~1000	865.45	-44.81	≤-27	PASS
11AX20-CDD	Ant3	5320	30~1000	710.03	-44.63	≤-27	PASS
11AX20-CDD	Ant1	5320	1000~40000	6903.3	-38.03	≤-27	PASS
11AX20-CDD	Ant2	5320	1000~40000	6891.6	-38.26	≤-27	PASS
11AX20-CDD	Ant3	5320	1000~40000	6957.9	-38.74	≤-27	PASS
11AX20-CDD	Ant1	5500	30~1000	861.54	-45.76	≤-27	PASS
11AX20-CDD	Ant2	5500	30~1000	888.76	-45.41	≤-27	PASS
11AX20-CDD	Ant3	5500	30~1000	958.66	-45.55	≤-27	PASS
11AX20-CDD	Ant1	5500	1000~40000	6994.3	-38.05	≤-27	PASS
11AX20-CDD	Ant2	5500	1000~40000	6998.2	-38.42	≤-27	PASS
11AX20-CDD	Ant3	5500	1000~40000	39989.6	-37.34	≤-27	PASS
11AX20-CDD	Ant1	5580	30~1000	860.54	-45.74	≤-27	PASS
11AX20-CDD	Ant2	5580	30~1000	874.73	-44.87	≤-27	PASS
11AX20-CDD	Ant3	5580	30~1000	861.18	-44.09	≤-27	PASS
11AX20-CDD	Ant1	5580	1000~40000	6928	-37.99	≤-27	PASS

11AX20-CDD	Ant2	5580	1000~40000	6960.5	-37.12	≤-27	PASS
11AX20-CDD	Ant3	5580	1000~40000	6860.4	-38.37	≤-27	PASS
11AX20-CDD	Ant1	5720	30~1000	889.05	-45.55	≤-27	PASS
11AX20-CDD	Ant2	5720	30~1000	888.54	-44.17	≤-27	PASS
11AX20-CDD	Ant3	5720	30~1000	863.35	-44.05	≤-27	PASS
11AX20-CDD	Ant1	5720	1000~40000	6961.8	-36.97	≤-27	PASS
11AX20-CDD	Ant2	5720	1000~40000	6961.8	-37.13	≤-27	PASS
11AX20-CDD	Ant3	5720	1000~40000	6913.7	-37.29	≤-27	PASS
11AX20-CDD	Ant1	5745	30~1000	888.21	-43.78	≤-27	PASS
11AX20-CDD	Ant2	5745	30~1000	862.05	-43.79	≤-27	PASS
11AX20-CDD	Ant3	5745	30~1000	958.89	-43.51	≤-27	PASS
11AX20-CDD	Ant1	5745	1000~40000	6869.5	-37.74	≤-27	PASS
11AX20-CDD	Ant2	5745	1000~40000	6954	-38.49	≤-27	PASS
11AX20-CDD	Ant3	5745	1000~40000	6955.3	-37.8	≤-27	PASS
11AX20-CDD	Ant1	5785	30~1000	711.52	-45.62	≤-27	PASS
11AX20-CDD	Ant2	5785	30~1000	897.85	-43.71	≤-27	PASS
11AX20-CDD	Ant3	5785	30~1000	859.79	-45.35	≤-27	PASS
11AX20-CDD	Ant1	5785	1000~40000	17364.4	-37.74	≤-27	PASS
11AX20-CDD	Ant2	5785	1000~40000	6911.1	-37.45	≤-27	PASS
11AX20-CDD	Ant3	5785	1000~40000	6905.9	-37.75	≤-27	PASS
11AX20-CDD	Ant1	5825	30~1000	958.66	-44.06	≤-27	PASS
11AX20-CDD	Ant2	5825	30~1000	889.44	-44.86	≤-27	PASS
11AX20-CDD	Ant3	5825	30~1000	961.51	-45.06	≤-27	PASS
11AX20-CDD	Ant1	5825	1000~40000	6021.9	-37.99	≤-27	PASS
11AX20-CDD	Ant2	5825	1000~40000	6899.4	-38.28	≤-27	PASS
11AX20-CDD	Ant3	5825	1000~40000	6981.3	-37.61	≤-27	PASS
11AX40-CDD	Ant1	5190	30~1000	862.31	-45.44	≤-27	PASS
11AX40-CDD	Ant2	5190	30~1000	969.75	-44.69	≤-27	PASS
11AX40-CDD	Ant3	5190	30~1000	706.63	-45.84	≤-27	PASS
11AX40-CDD	Ant1	5190	1000~40000	6904.6	-38.12	≤-27	PASS
11AX40-CDD	Ant2	5190	1000~40000	6933.2	-38.09	≤-27	PASS
11AX40-CDD	Ant3	5190	1000~40000	6989.1	-38.71	≤-27	PASS
11AX40-CDD	Ant1	5230	30~1000	768.91	-46.13	≤-27	PASS
11AX40-CDD	Ant2	5230	30~1000	859.95	-44.46	≤-27	PASS
11AX40-CDD	Ant3	5230	30~1000	511.31	-44.06	≤-27	PASS
11AX40-CDD	Ant1	5230	1000~40000	6965.7	-38.53	≤-27	PASS
11AX40-CDD	Ant2	5230	1000~40000	6977.4	-38.19	≤-27	PASS
11AX40-CDD	Ant3	5230	1000~40000	6955.3	-37.56	≤-27	PASS
11AX40-CDD	Ant1	5270	30~1000	964.32	-44.5	≤-27	PASS
11AX40-CDD	Ant2	5270	30~1000	891.12	-45.48	≤-27	PASS
11AX40-CDD	Ant3	5270	30~1000	508.66	-44.71	≤-27	PASS
11AX40-CDD	Ant1	5270	1000~40000	6976.1	-37.06	≤-27	PASS
11AX40-CDD	Ant2	5270	1000~40000	6920.2	-37.75	≤-27	PASS
11AX40-CDD	Ant3	5270	1000~40000	6981.3	-38.2	≤-27	PASS
11AX40-CDD	Ant1	5310	30~1000	897.56	-45.38	≤-27	PASS


11AX40-CDD	Ant2	5310	30~1000	115.5	-45.24	≤-27	PASS
11AX40-CDD	Ant3	5310	30~1000	890.64	-45.77	≤-27	PASS
11AX40-CDD	Ant1	5310	1000~40000	6994.3	-37.62	≤-27	PASS
11AX40-CDD	Ant2	5310	1000~40000	6928	-38.14	≤-27	PASS
11AX40-CDD	Ant3	5310	1000~40000	6948.8	-37.97	≤-27	PASS
11AX40-CDD	Ant1	5510	30~1000	959.34	-45.01	≤-27	PASS
11AX40-CDD	Ant2	5510	30~1000	510.28	-45.14	≤-27	PASS
11AX40-CDD	Ant3	5510	30~1000	960.38	-46.28	≤-27	PASS
11AX40-CDD	Ant1	5510	1000~40000	6915	-37.98	≤-27	PASS
11AX40-CDD	Ant2	5510	1000~40000	6946.2	-38.33	≤-27	PASS
11AX40-CDD	Ant3	5510	1000~40000	6688.8	-38.01	≤-27	PASS
11AX40-CDD	Ant1	5550	30~1000	891.8	-44.98	≤-27	PASS
11AX40-CDD	Ant2	5550	30~1000	959.76	-45.54	≤-27	PASS
11AX40-CDD	Ant3	5550	30~1000	959.25	-45.13	≤-27	PASS
11AX40-CDD	Ant1	5550	1000~40000	16639	-36.88	≤-27	PASS
11AX40-CDD	Ant2	5550	1000~40000	6772	-37.37	≤-27	PASS
11AX40-CDD	Ant3	5550	1000~40000	6991.7	-37.75	≤-27	PASS
11AX40-CDD	Ant1	5710	30~1000	797.52	-44.69	≤-27	PASS
11AX40-CDD	Ant2	5710	30~1000	825	-43.86	≤-27	PASS
11AX40-CDD	Ant3	5710	30~1000	121.71	-45.61	≤-27	PASS
11AX40-CDD	Ant1	5710	1000~40000	1929.5	-31.02	≤-27	PASS
11AX40-CDD	Ant2	5710	1000~40000	6883.8	-38.01	≤-27	PASS
11AX40-CDD	Ant3	5710	1000~40000	6976.1	-37.4	≤-27	PASS
11AX40-CDD	Ant1	5755	30~1000	860.18	-44.75	≤-27	PASS
11AX40-CDD	Ant2	5755	30~1000	862.51	-43.65	≤-27	PASS
11AX40-CDD	Ant3	5755	30~1000	860.83	-44.97	≤-27	PASS
11AX40-CDD	Ant1	5755	1000~40000	6649.8	-38.43	≤-27	PASS
11AX40-CDD	Ant2	5755	1000~40000	6774.6	-37.84	≤-27	PASS
11AX40-CDD	Ant3	5755	1000~40000	39985.7	-38.5	≤-27	PASS
11AX40-CDD	Ant1	5795	30~1000	893.9	-45.14	≤-27	PASS
11AX40-CDD	Ant2	5795	30~1000	862.18	-44.82	≤-27	PASS
11AX40-CDD	Ant3	5795	30~1000	958.83	-45.69	≤-27	PASS
11AX40-CDD	Ant1	5795	1000~40000	6889	-38.74	≤-27	PASS
11AX40-CDD	Ant2	5795	1000~40000	6844.8	-38.39	≤-27	PASS
11AX40-CDD	Ant3	5795	1000~40000	6970.9	-38.54	≤-27	PASS
11AX80-CDD	Ant1	5210	30~1000	867.29	-45.6	≤-27	PASS
11AX80-CDD	Ant2	5210	30~1000	862.28	-45.63	≤-27	PASS
11AX80-CDD	Ant3	5210	30~1000	118.38	-45.23	≤-27	PASS
11AX80-CDD	Ant1	5210	1000~40000	6912.4	-38.09	≤-27	PASS
11AX80-CDD	Ant2	5210	1000~40000	6874.7	-38.35	≤-27	PASS
11AX80-CDD	Ant3	5210	1000~40000	6920.2	-37.94	≤-27	PASS
11AX80-CDD	Ant1	5290	30~1000	958.37	-44.5	≤-27	PASS
11AX80-CDD	Ant2	5290	30~1000	990.87	-45.9	≤-27	PASS
11AX80-CDD	Ant3	5290	30~1000	966.75	-44.74	≤-27	PASS
11AX80-CDD	Ant1	5290	1000~40000	6968.3	-38.58	≤-27	PASS

11AX80-CDD	Ant2	5290	1000~40000	6821.4	-37.72	≤-27	PASS
11AX80-CDD	Ant3	5290	1000~40000	6967	-37.98	≤-27	PASS
11AX80-CDD	Ant1	5530	30~1000	893.77	-44.33	≤-27	PASS
11AX80-CDD	Ant2	5530	30~1000	861.18	-43.89	≤-27	PASS
11AX80-CDD	Ant3	5530	30~1000	708.86	-45.61	≤-27	PASS
11AX80-CDD	Ant1	5530	1000~40000	6961.8	-38.2	≤-27	PASS
11AX80-CDD	Ant2	5530	1000~40000	6955.3	-37.08	≤-27	PASS
11AX80-CDD	Ant3	5530	1000~40000	6935.8	-37.7	≤-27	PASS
11AX80-CDD	Ant1	5610	30~1000	958.99	-44.48	≤-27	PASS
11AX80-CDD	Ant2	5610	30~1000	869.3	-44.85	≤-27	PASS
11AX80-CDD	Ant3	5610	30~1000	959.41	-44.98	≤-27	PASS
11AX80-CDD	Ant1	5610	1000~40000	6998.2	-37.76	≤-27	PASS
11AX80-CDD	Ant2	5610	1000~40000	6757.7	-37.57	≤-27	PASS
11AX80-CDD	Ant3	5610	1000~40000	6993	-37.05	≤-27	PASS
11AX80-CDD	Ant1	5690	30~1000	960.12	-43.67	≤-27	PASS
11AX80-CDD	Ant2	5690	30~1000	889.41	-45.14	≤-27	PASS
11AX80-CDD	Ant3	5690	30~1000	864.35	-44.68	≤-27	PASS
11AX80-CDD	Ant1	5690	1000~40000	1934.7	-27.48	≤-27	PASS
11AX80-CDD	Ant2	5690	1000~40000	6933.2	-37.16	≤-27	PASS
11AX80-CDD	Ant3	5690	1000~40000	39455.3	-37.56	≤-27	PASS
11AX80-CDD	Ant1	5775	30~1000	860.08	-44.3	≤-27	PASS
11AX80-CDD	Ant2	5775	30~1000	961.8	-45	≤-27	PASS
11AX80-CDD	Ant3	5775	30~1000	860.28	-45.07	≤-27	PASS
11AX80-CDD	Ant1	5775	1000~40000	6999.5	-38.63	≤-27	PASS
11AX80-CDD	Ant2	5775	1000~40000	6926.7	-38.32	≤-27	PASS
11AX80-CDD	Ant3	5775	1000~40000	6952.7	-38.31	≤-27	PASS
11AX160-CDD	Ant1	5250	30~1000	709.9	-46.42	≤-27	PASS
11AX160-CDD	Ant2	5250	30~1000	707.41	-44.94	≤-27	PASS
11AX160-CDD	Ant3	5250	30~1000	888.7	-44.04	≤-27	PASS
11AX160-CDD	Ant1	5250	1000~40000	6948.8	-38.45	≤-27	PASS
11AX160-CDD	Ant2	5250	1000~40000	6970.9	-38.6	≤-27	PASS
11AX160-CDD	Ant3	5250	1000~40000	39295.4	-37.45	≤-27	PASS
11AX160-CDD	Ant1	5570	30~1000	889.08	-44.78	≤-27	PASS
11AX160-CDD	Ant2	5570	30~1000	897.36	-45.99	≤-27	PASS
11AX160-CDD	Ant3	5570	30~1000	890.99	-44.49	≤-27	PASS
11AX160-CDD	Ant1	5570	1000~40000	6931.9	-36.58	≤-27	PASS
11AX160-CDD	Ant2	5570	1000~40000	6916.3	-38.05	≤-27	PASS
11AX160-CDD	Ant3	5570	1000~40000	6777.2	-37.35	≤-27	PASS


7.2 Test Graphs

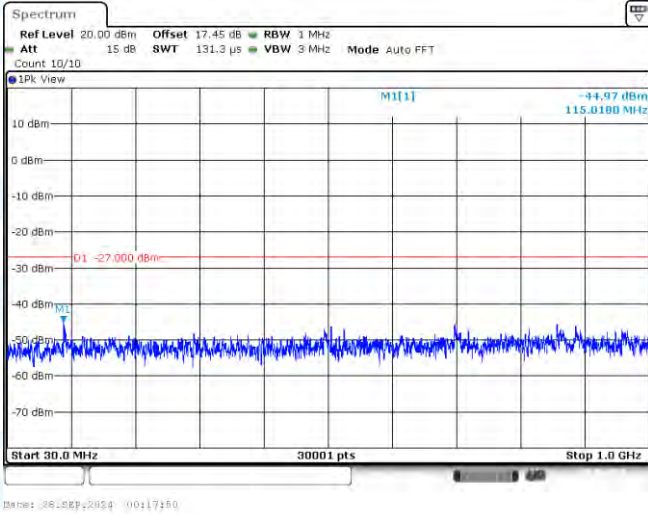


11A-Ant1-5180-30~1000-PASS

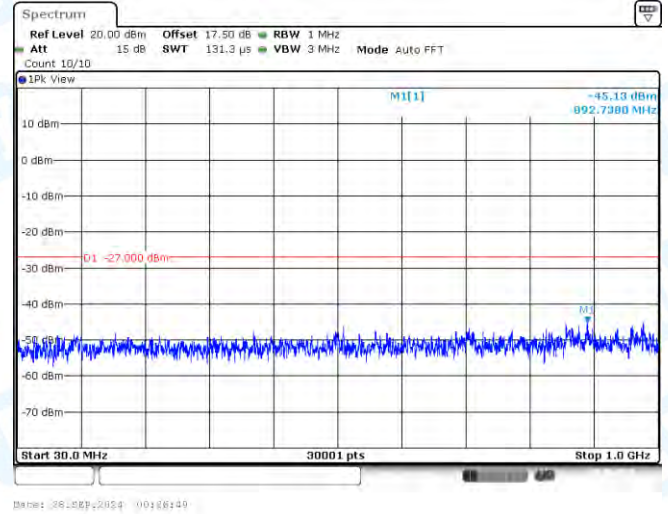


11A-Ant2-5180-30~1000-PASS

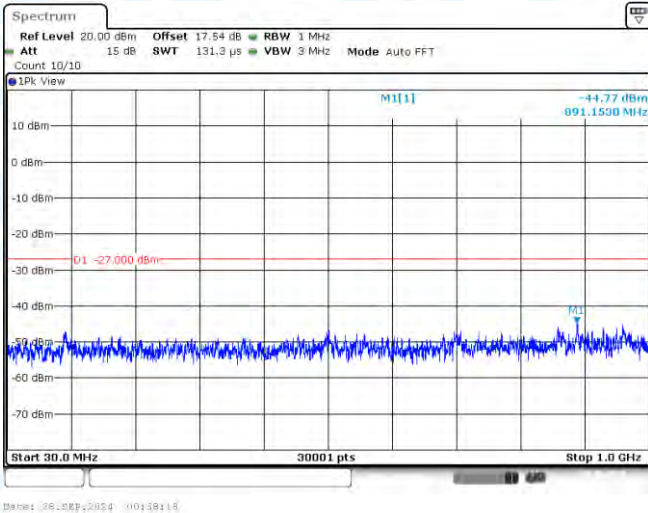


11A-Ant3-5180-30~1000-PASS

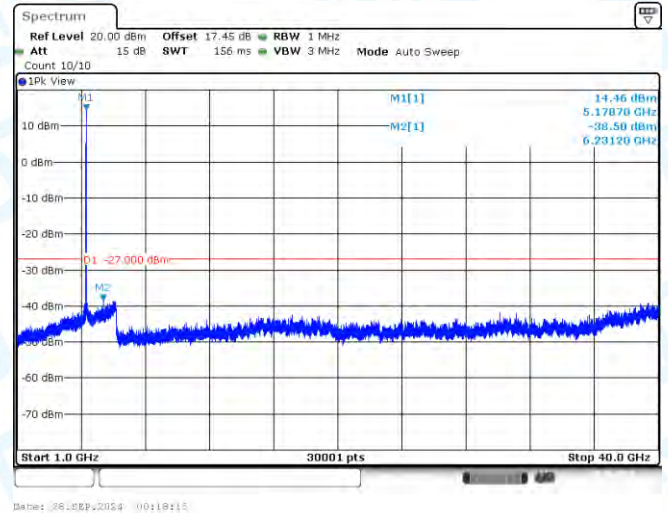


11A-Ant1-5180-1000~40000-PASS

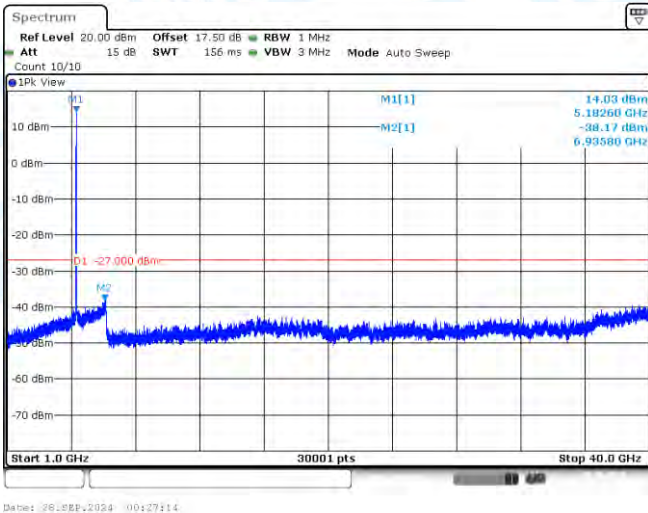


11A-Ant2-5180-1000~40000-PASS

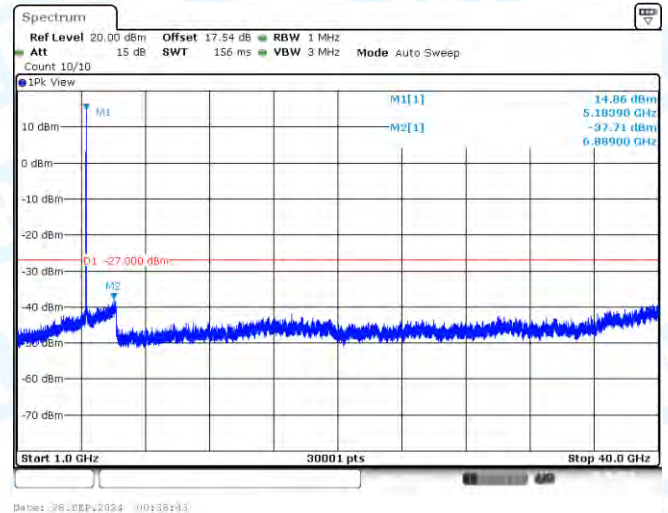


11A-Ant3-5180-1000~40000-PASS

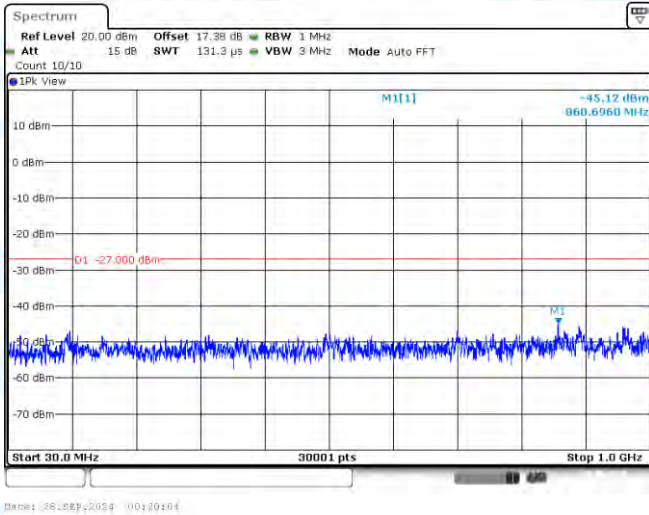


11A-Ant1-5200-30~1000-PASS

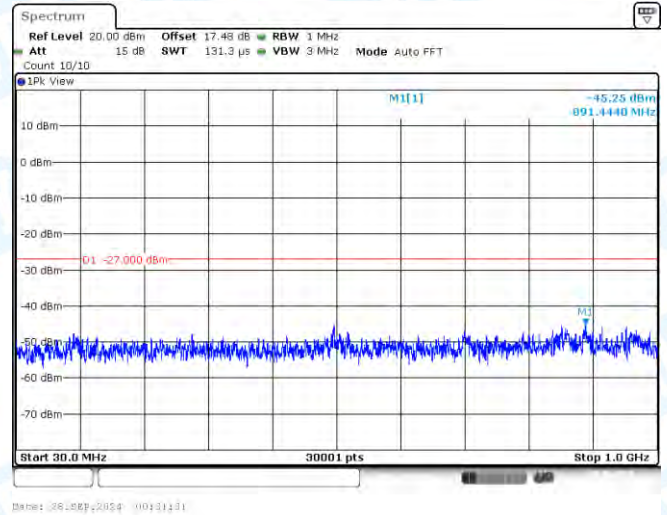


11A-Ant2-5200-30~1000-PASS

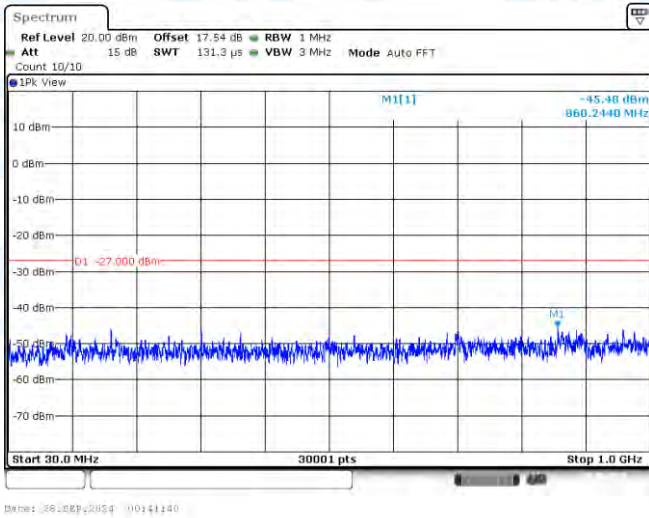


11A-Ant3-5200-30~1000-PASS

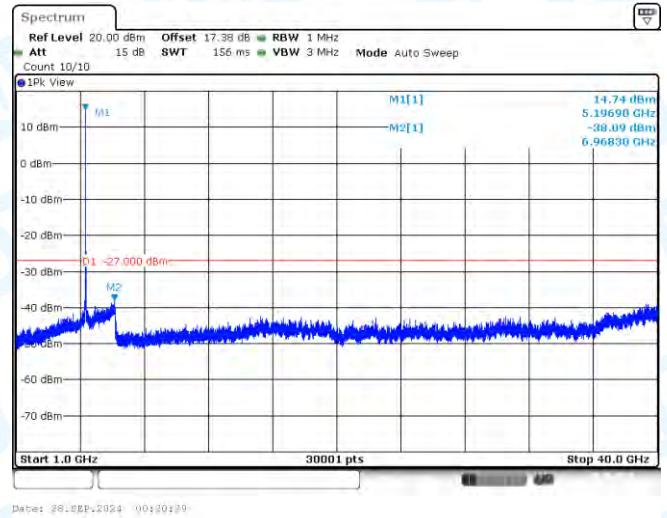


11A-Ant1-5200-1000~40000-PASS

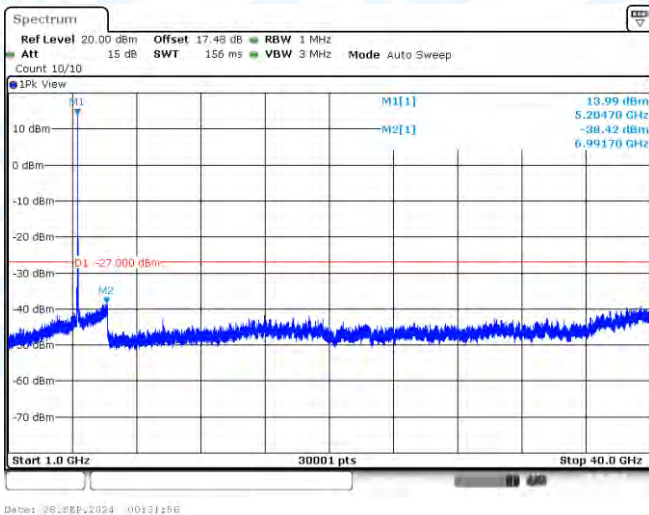


11A-Ant2-5200-1000~40000-PASS

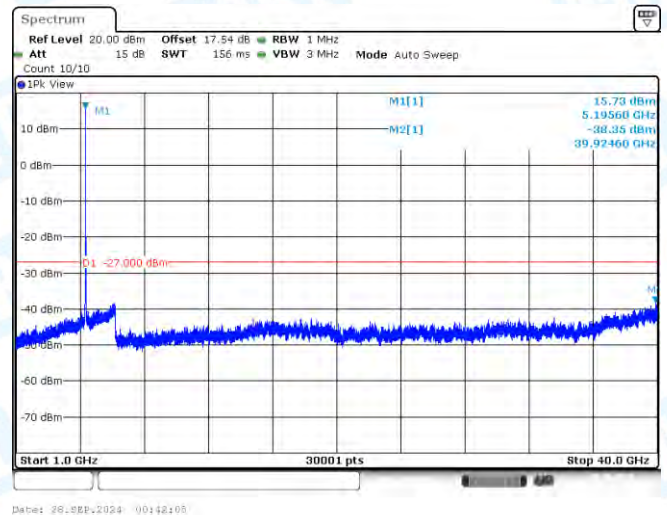


11A-Ant3-5200-1000~40000-PASS

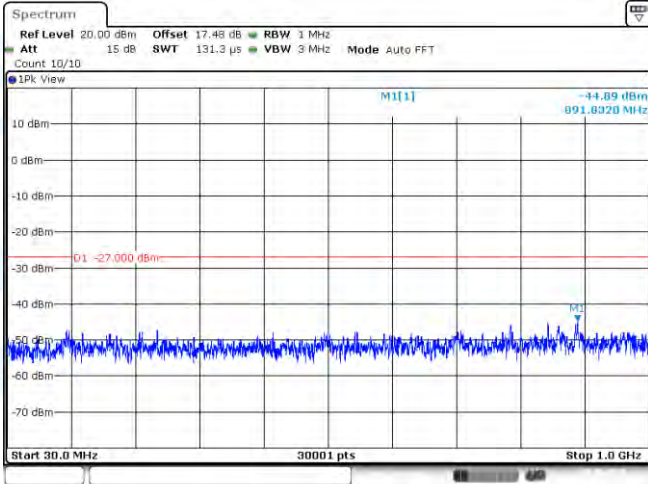


11A-Ant1-5240-30~1000-PASS

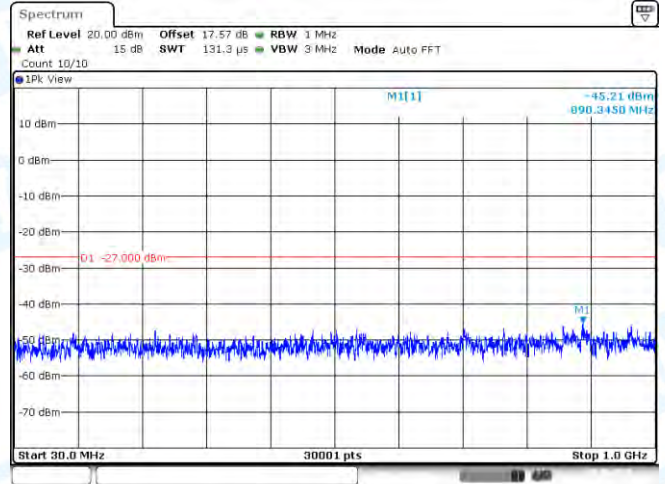


11A-Ant2-5240-30~1000-PASS

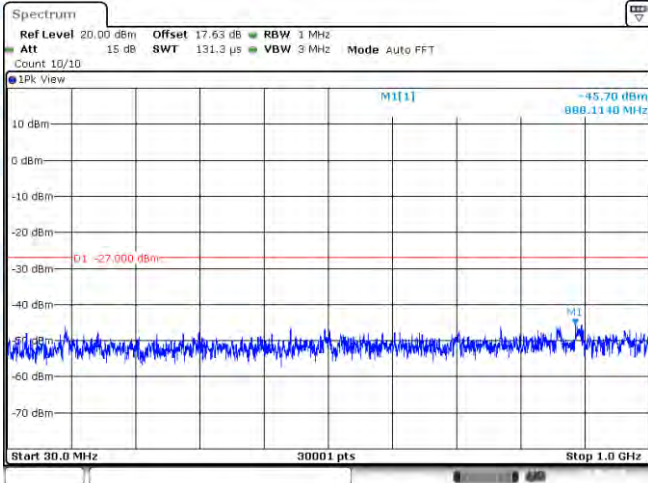


11A-Ant3-5240-30~1000-PASS

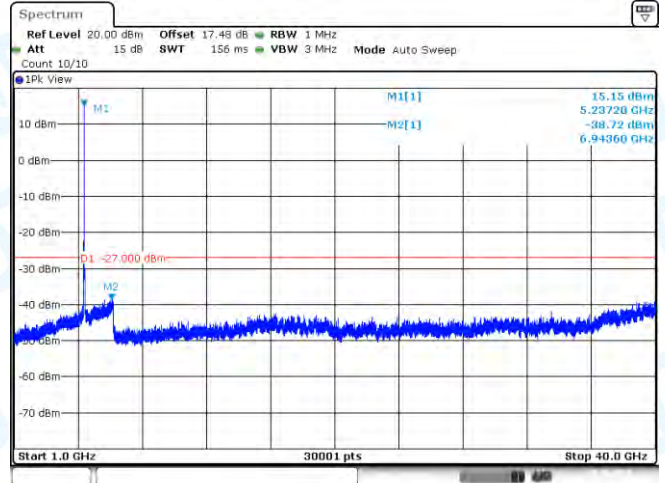



11A-Ant1-5240-1000~40000-PASS

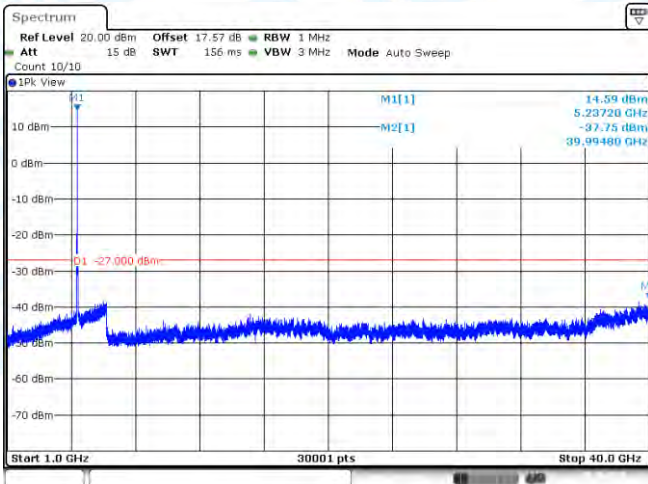

11A-Ant2-5240-1000~40000-PASS


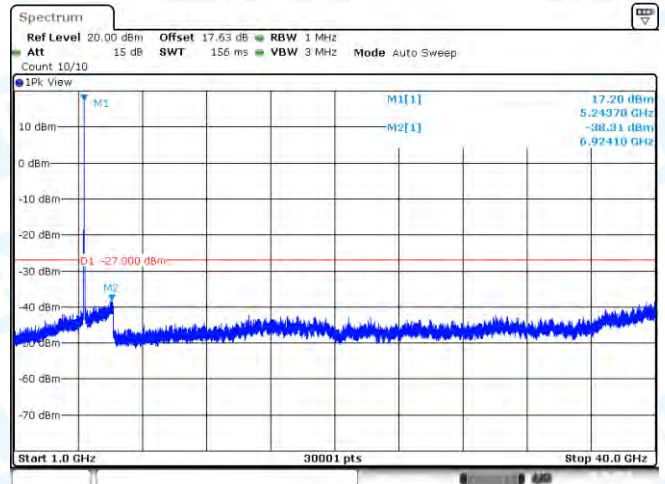


11A-Ant3-5240-1000~40000-PASS

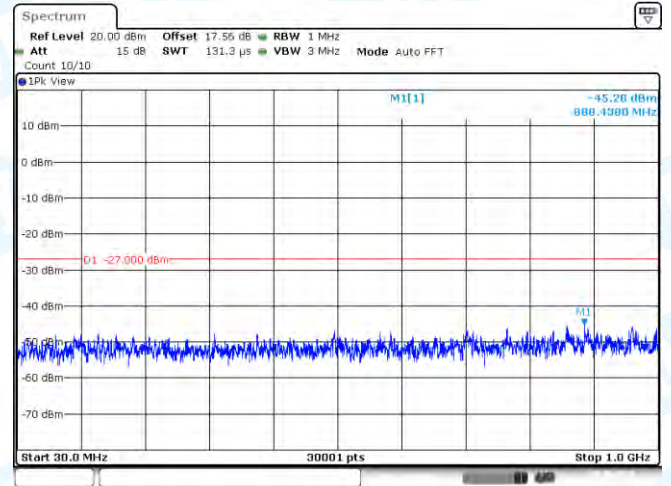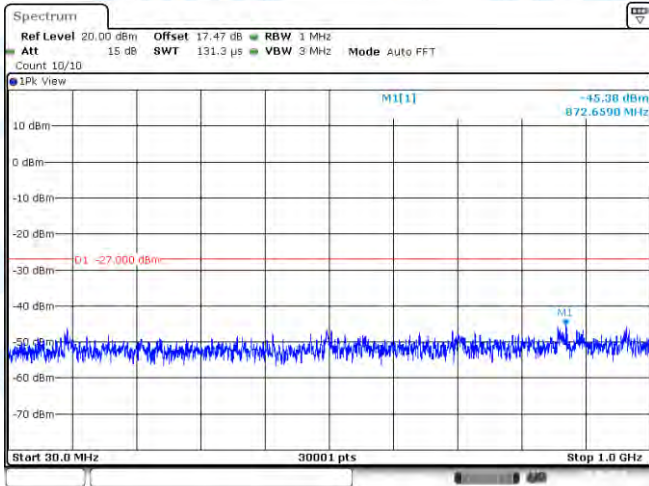



11A-Ant1-5260-30~1000-PASS

11A-Ant2-5260-30~1000-PASS

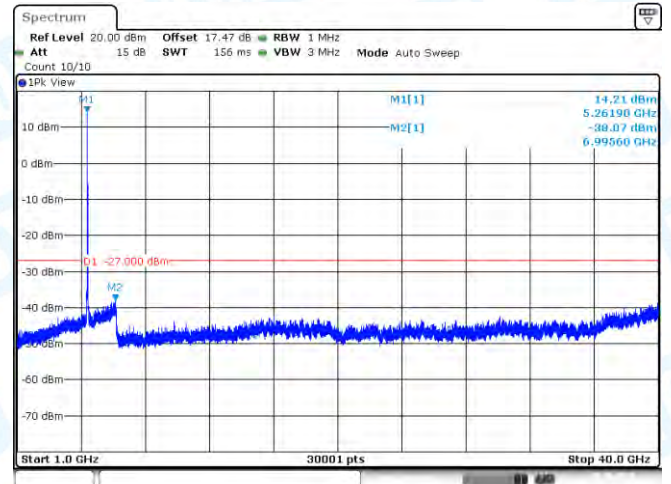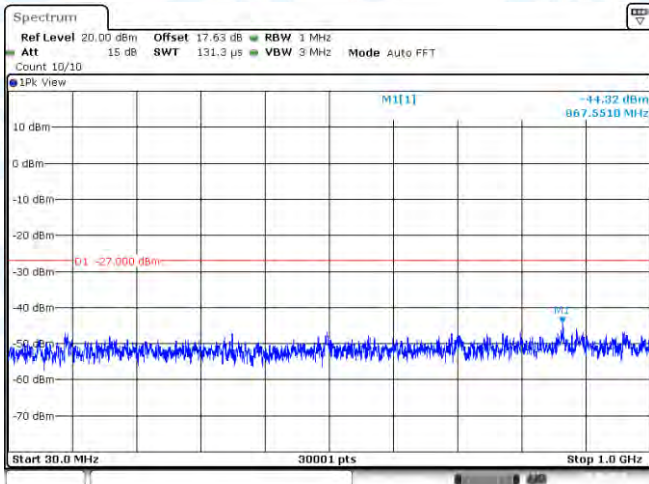

11A-Ant3-5260-30~1000-PASS

11A-Ant1-5260-1000~40000-PASS

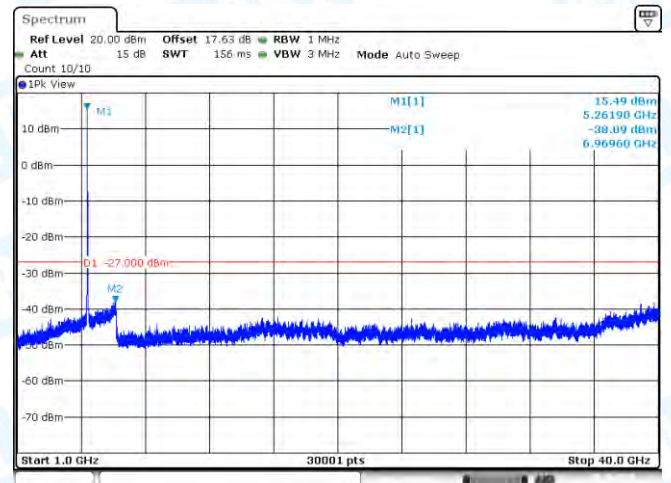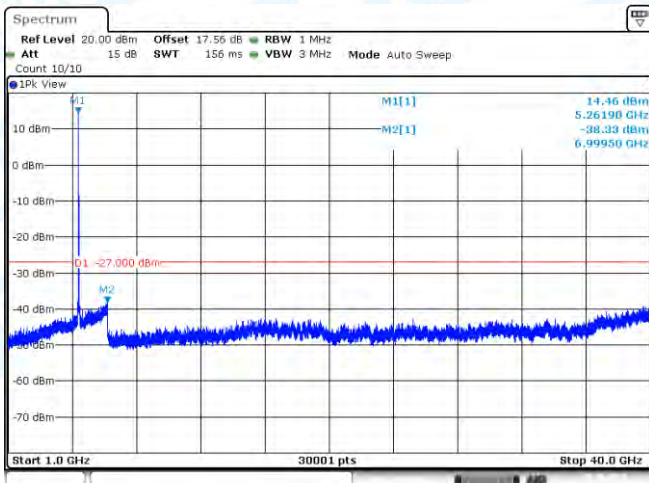

11A-Ant2-5260-1000~40000-PASS

11A-Ant3-5260-1000~40000-PASS