



Test report No. : 4790371368-US-R2-V0
Page : 128 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11a	Channel	117
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5902	41.59	14.98	56.57	88.2	-31.63	PK
		5909	30.68	14.97	45.65	68.2	-22.55	AVG
	@	6535	63.85	17.33	81.18	N/A	N/A	PK
	@	6535	59.3	17.33	76.63	N/A	N/A	AVG
		7178.8	39.96	20.01	59.97	88.2	-28.23	PK
		7220.8	30.24	20.23	50.47	68.2	-17.73	AVG
	*	13070	27.45	21.01	48.46	88.2	-39.74	PK
Vertical		5848.8	40.94	14.61	55.55	88.2	-32.65	PK
		5916	30.59	14.97	45.56	68.2	-22.64	AVG
	@	6535	80.25	17.33	97.58	N/A	N/A	PK
	@	6535	72.14	17.33	89.47	N/A	N/A	AVG
		7208.2	39.87	20.17	60.04	88.2	-28.16	PK
		7209.6	29.98	20.18	50.16	68.2	-18.04	AVG
	*	13070	27.66	21.01	48.67	88.2	-39.53	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

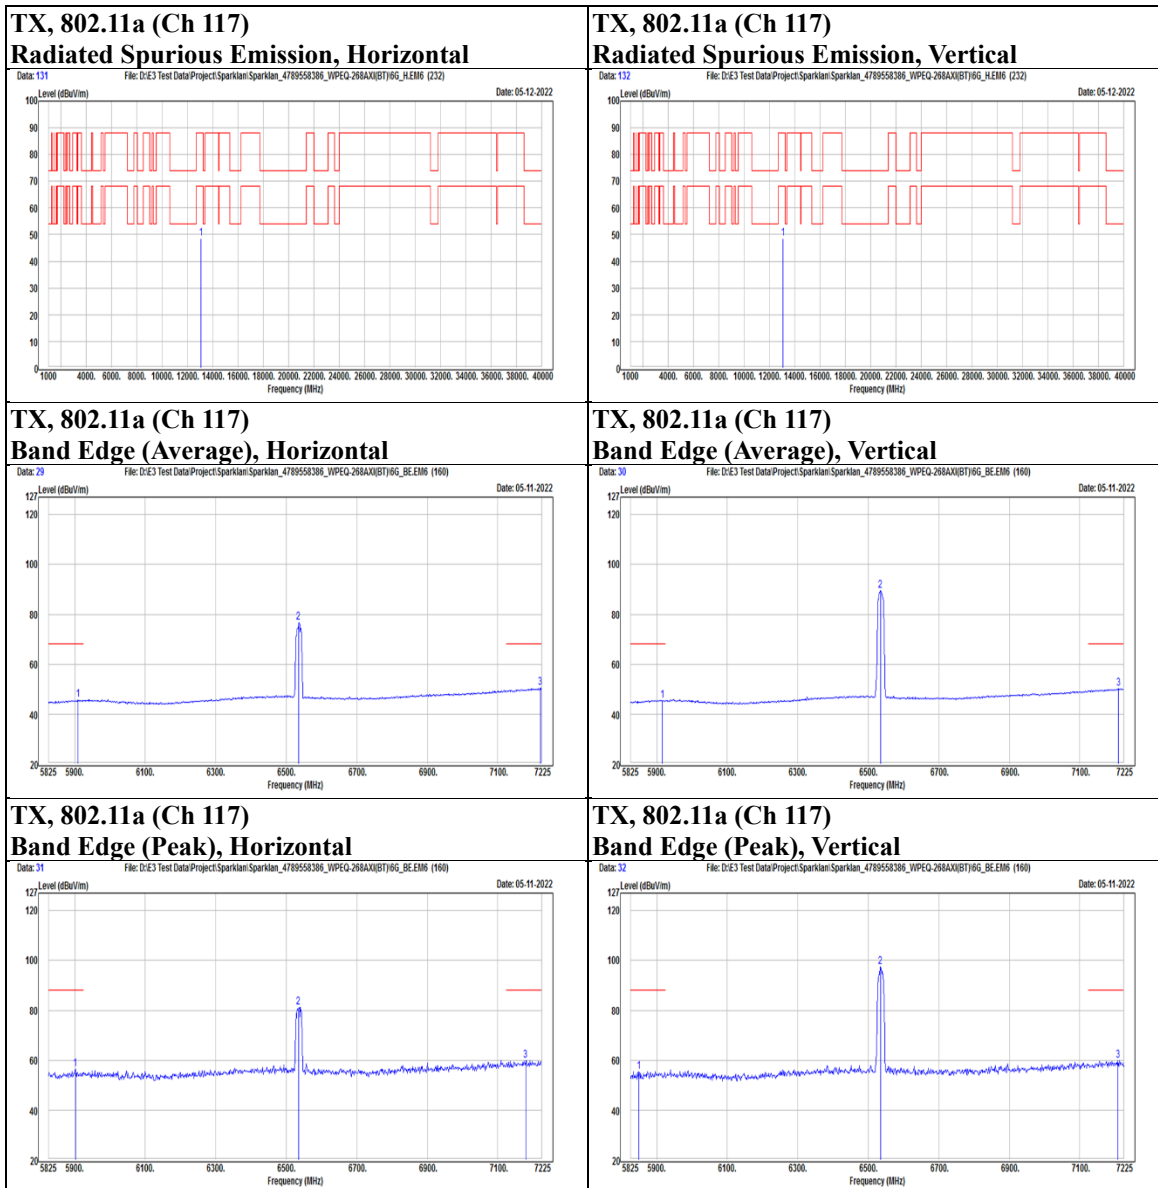



Test report No. : 4790371368-US-R2-V0
Page : 130 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11a	Channel	149
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5882.4	41.59	14.85	56.44	88.2	-31.76	PK
		5917.4	30.76	14.97	45.73	68.2	-22.47	AVG
	@	6695	67.42	17.5	84.92	N/A	N/A	PK
	@	6695	61.78	17.5	79.28	N/A	N/A	AVG
		7206.8	40.09	20.16	60.25	88.2	-27.95	PK
		7223.6	29.96	20.25	50.21	68.2	-17.99	AVG
	*	13390	27.88	22.07	49.95	74	-24.05	PK
Vertical		5892.2	40.75	14.92	55.67	88.2	-32.53	PK
		5920.2	30.66	14.96	45.62	68.2	-22.58	AVG
	@	6695	80.81	17.5	98.31	N/A	N/A	PK
	@	6695	72.6	17.5	90.1	N/A	N/A	AVG
		7211	40.87	20.18	61.05	88.2	-27.15	PK
		7225	29.97	20.26	50.23	68.2	-17.97	AVG
	*	13390	27.73	22.07	49.8	74	-24.2	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 131 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

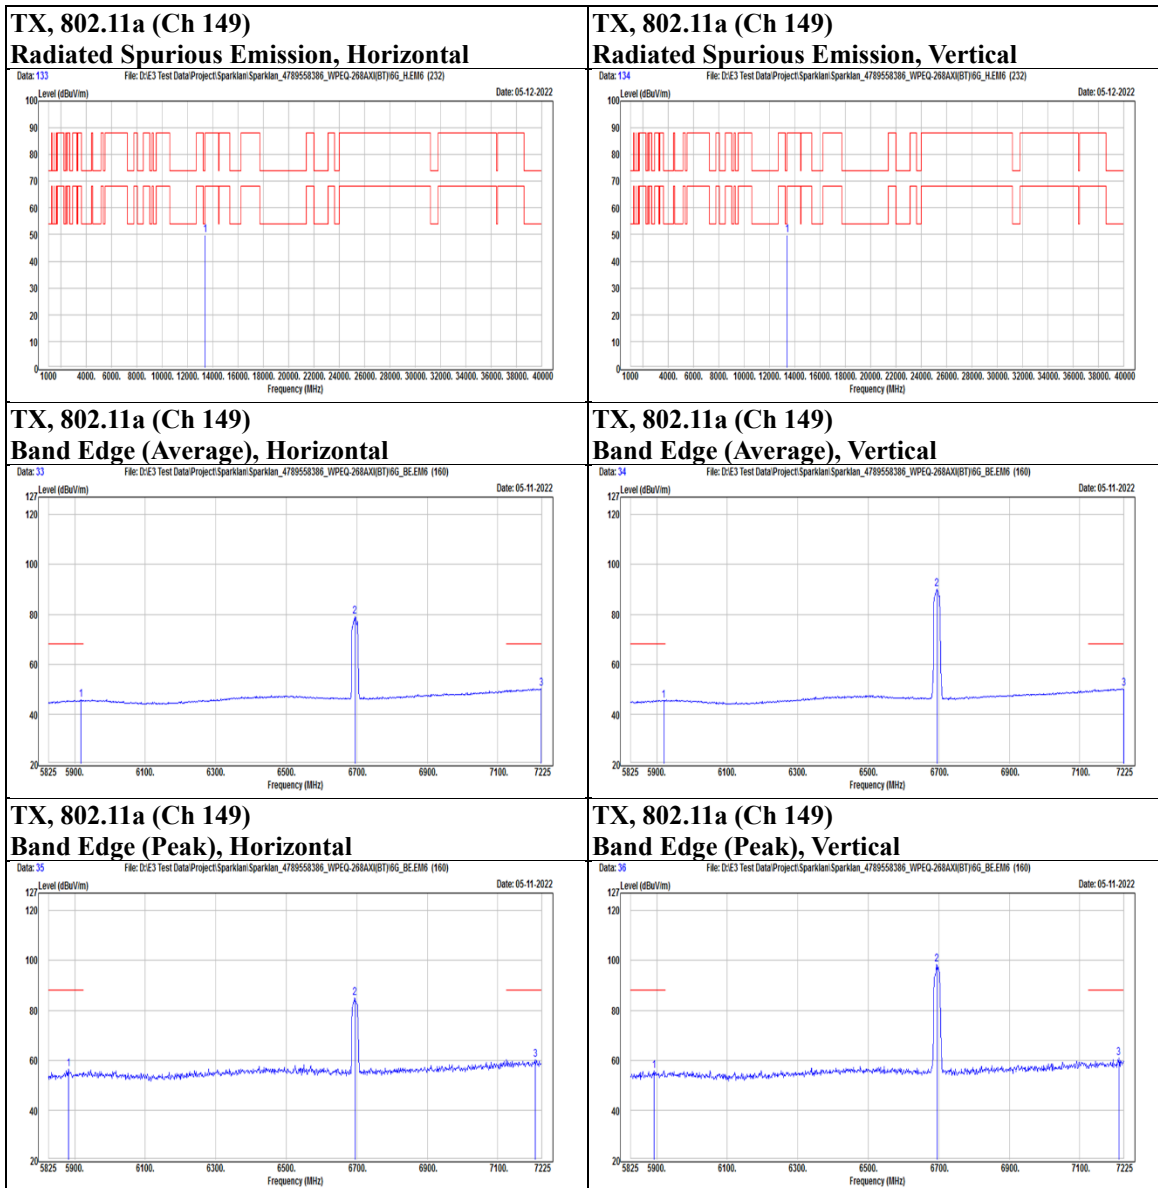

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 132 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11a	Channel	181
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5861.4	40.62	14.7	55.32	88.2	-32.88	PK
		5909	30.78	14.97	45.75	68.2	-22.45	AVG
	@	6855	67.28	18.28	85.56	N/A	N/A	PK
	@	6855	60	18.28	78.28	N/A	N/A	AVG
		7219.4	39.98	20.23	60.21	88.2	-27.99	PK
		7222.2	30.37	20.25	50.62	68.2	-17.58	AVG
	*	13710	28.2	22.78	50.98	88.2	-37.22	PK
Vertical		5867	31.12	14.74	45.86	68.2	-22.34	AVG
		5911.8	40.33	14.97	55.3	88.2	-32.9	PK
	@	6855	77.76	18.28	96.04	N/A	N/A	PK
	@	6855	72.15	18.28	90.43	N/A	N/A	AVG
		7209.6	39.71	20.18	59.89	88.2	-28.31	PK
		7218	29.98	20.22	50.2	68.2	-18	AVG
	*	13710	28.43	22.78	51.21	88.2	-36.99	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 133 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

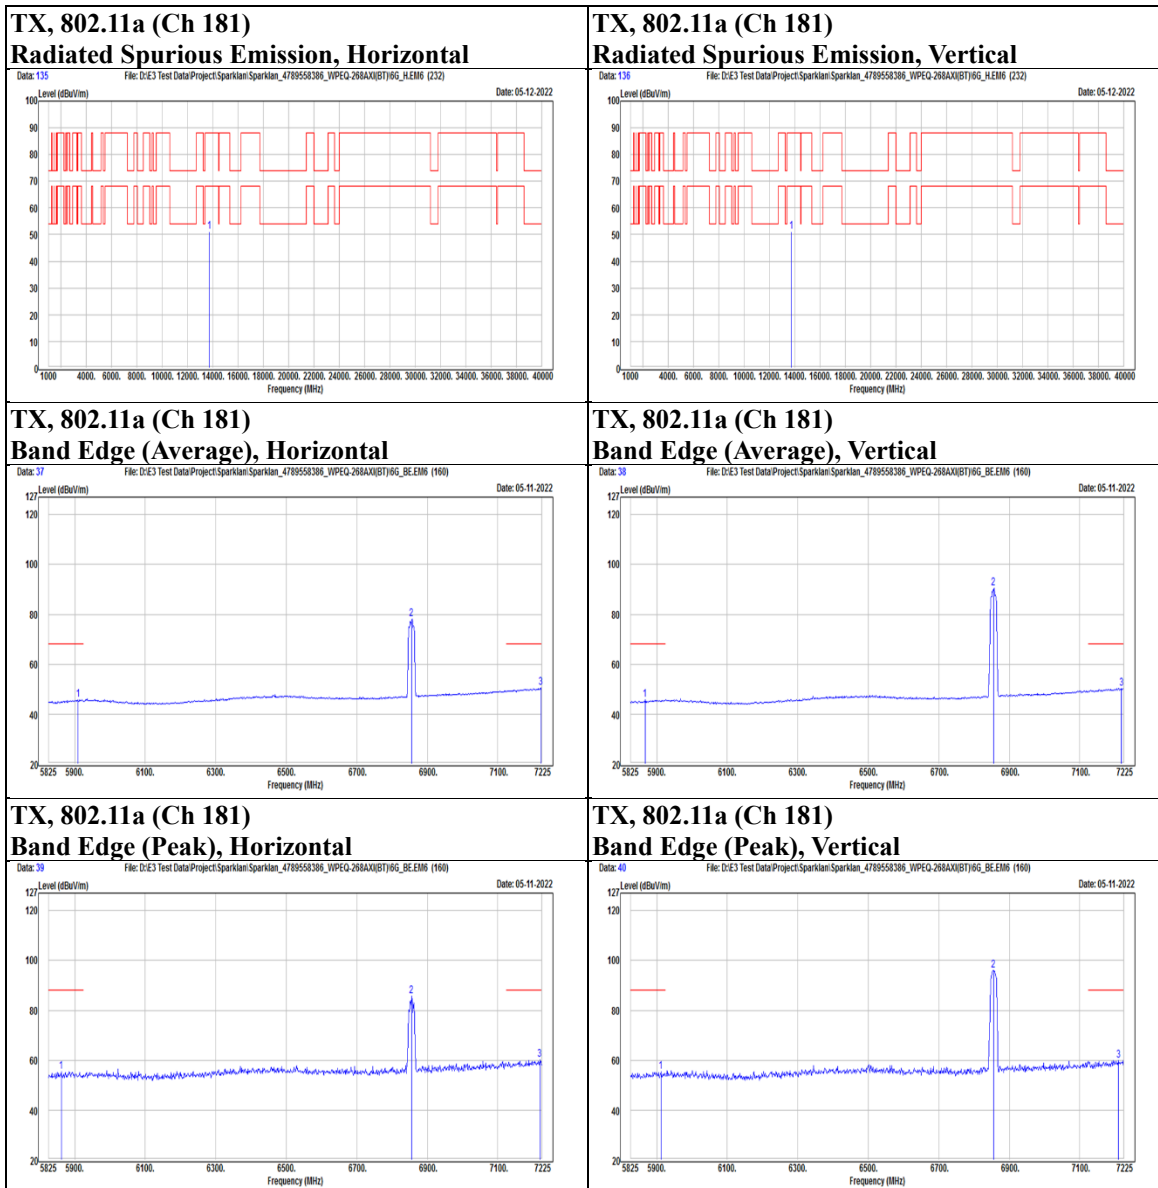

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 134 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11a	Channel	185
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5889.4	31.03	14.91	45.94	68.2	-22.26	AVG
		5913.2	41.49	14.96	56.45	88.2	-31.75	PK
	@	6875	66.04	18.3	84.34	N/A	N/A	PK
	@	6875	60.04	18.3	78.34	N/A	N/A	AVG
		7198.4	40.36	20.11	60.47	88.2	-27.73	PK
		7211	30.26	20.18	50.44	68.2	-17.76	AVG
	*	13750	28.3	22.94	51.24	88.2	-36.96	PK
Vertical		5865.6	31.04	14.73	45.77	68.2	-22.43	AVG
		5892.2	40.39	14.92	55.31	88.2	-32.89	PK
	@	6875	79.24	18.3	97.54	N/A	N/A	PK
	@	6875	71.99	18.3	90.29	N/A	N/A	AVG
		7156.4	41.07	19.89	60.96	88.2	-27.24	PK
		7215.2	29.91	20.21	50.12	68.2	-18.08	AVG
	*	13750	30.04	22.94	52.98	88.2	-35.22	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

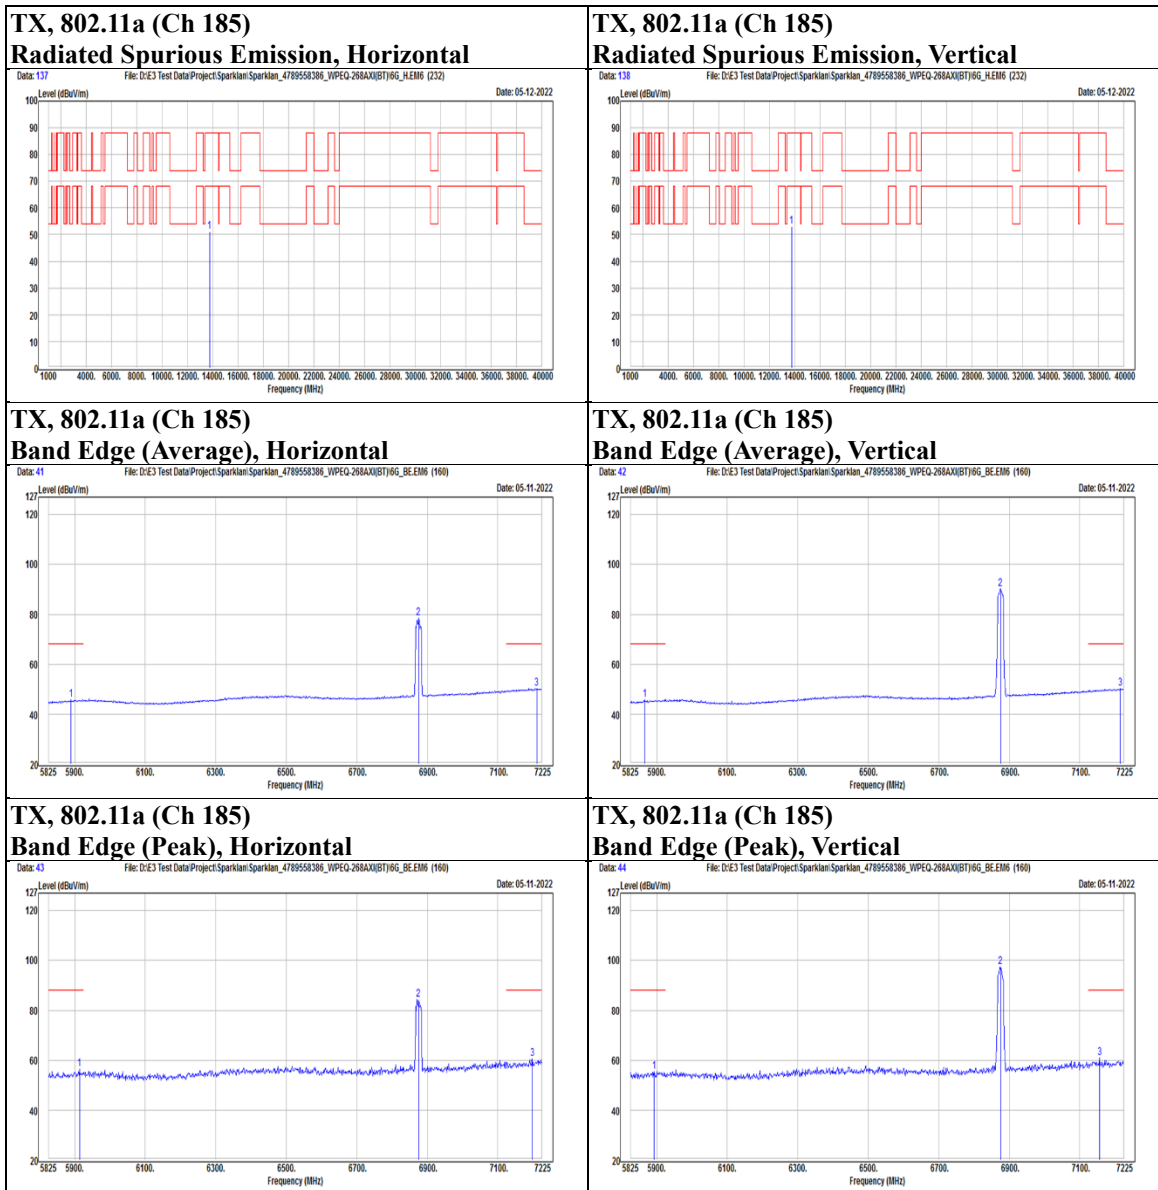



Test report No. : 4790371368-US-R2-V0
Page : 136 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11a	Channel	209
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	6995	63.95	18.71	82.66	N/A	N/A	PK
	@	6995	60.41	18.71	79.12	N/A	N/A	AVG
		7212.4	41.73	20.19	61.92	88.2	-26.28	PK
		7216.6	30.09	20.22	50.31	68.2	-17.89	AVG
	*	13990	28.74	23.87	52.61	88.2	-35.59	PK
Vertical	@	6995	77.03	18.71	95.74	N/A	N/A	PK
	@	6995	71.08	18.71	89.79	N/A	N/A	AVG
		7205.4	30.02	20.15	50.17	68.2	-18.03	AVG
		7223.6	40.17	20.25	60.42	88.2	-27.78	PK
	*	13990	28.69	23.87	52.56	88.2	-35.64	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 137 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

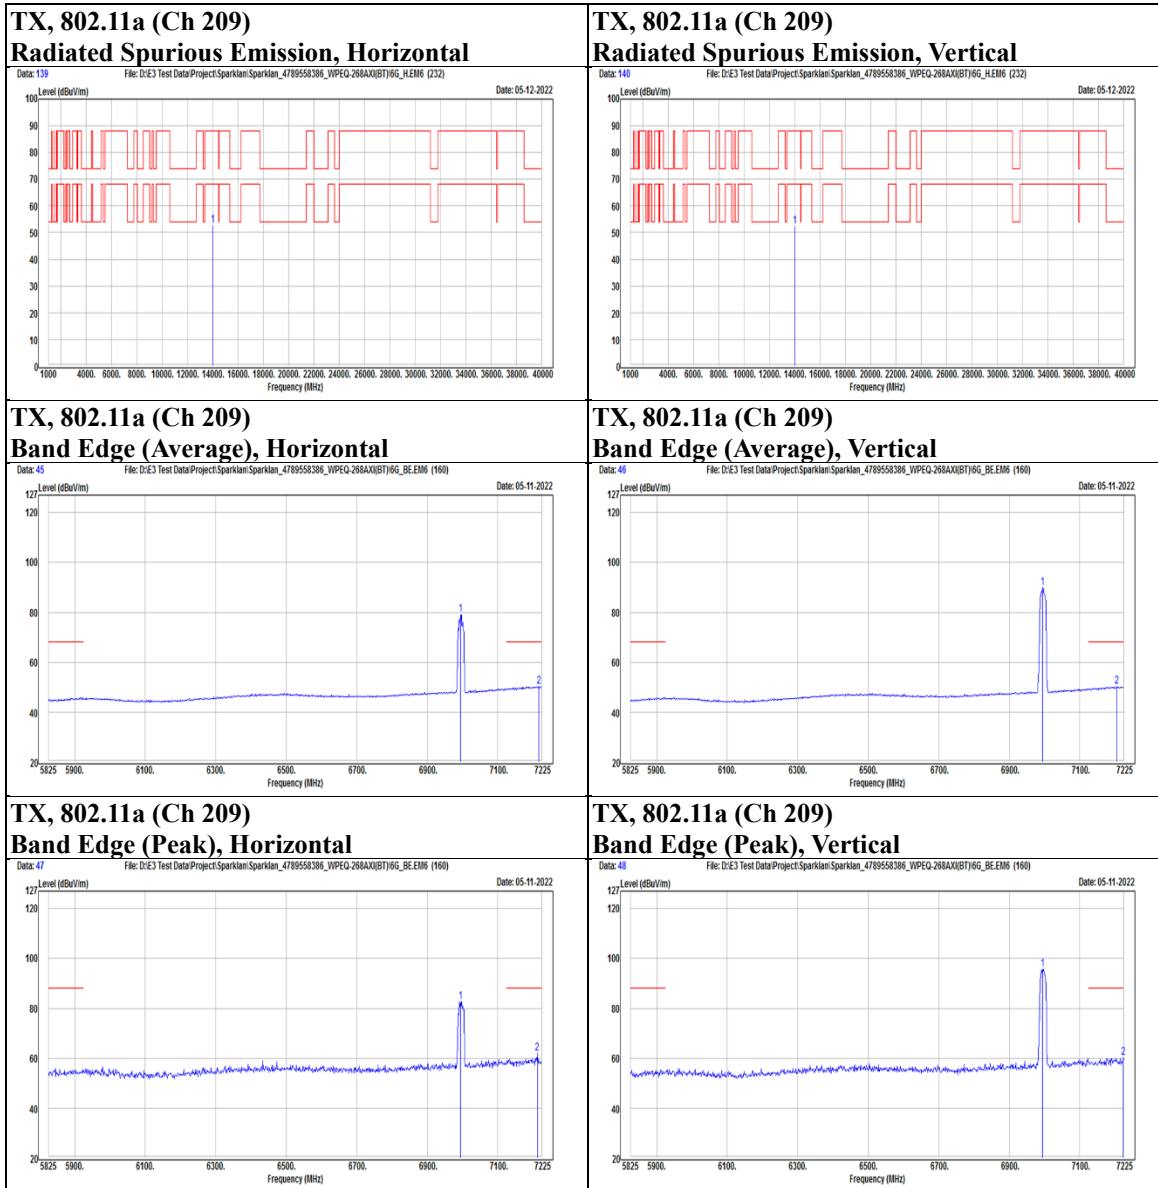

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 138 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11a	Channel	229
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	7095	60.64	19.54	80.18	N/A	N/A	PK
	@	7095	55.84	19.54	75.38	N/A	N/A	AVG
		7218	39.78	20.22	60	88.2	-28.2	PK
		7222.2	30.08	20.25	50.33	68.2	-17.87	AVG
	*	14190	28.62	24.68	53.3	88.2	-34.9	PK
Vertical	@	7095	75.71	19.54	95.25	N/A	N/A	PK
	@	7095	69.39	19.54	88.93	N/A	N/A	AVG
		7213.8	39.65	20.2	59.85	88.2	-28.35	PK
		7219.4	30.01	20.23	50.24	68.2	-17.96	AVG
	*	14190	28.23	24.68	52.91	88.2	-35.29	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

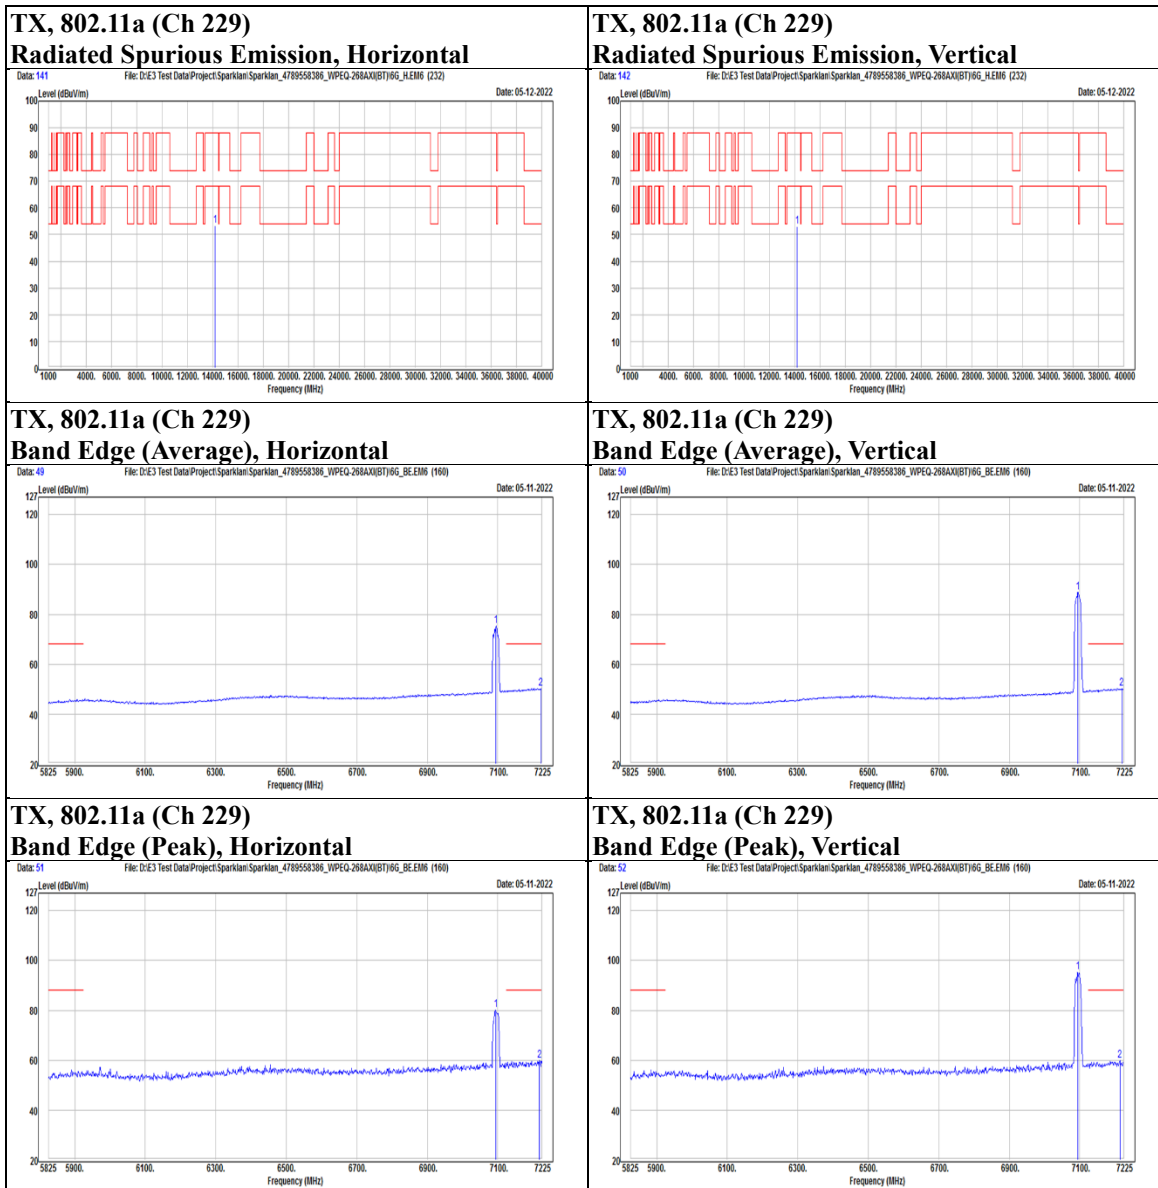



Test report No. : 4790371368-US-R2-V0
Page : 140 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11a	Channel	233
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	7115	61.83	19.66	81.49	N/A	N/A	PK
	@	7115	55.03	19.66	74.69	N/A	N/A	AVG
		7125	50.78	19.71	70.49	88.2	-17.71	PK
		7125	38.6	19.71	58.31	68.2	-9.89	AVG
	*	14230	29.1	24.79	53.89	88.2	-34.31	PK
Vertical	@	7115	75.33	19.66	94.99	N/A	N/A	PK
	@	7115	69.28	19.66	88.94	N/A	N/A	AVG
		7125	65.6	19.71	85.31	88.2	-2.89	PK
		7125.6	38.57	19.72	58.29	68.2	-9.91	AVG
	*	14230	28.76	24.79	53.55	88.2	-34.65	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 141 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

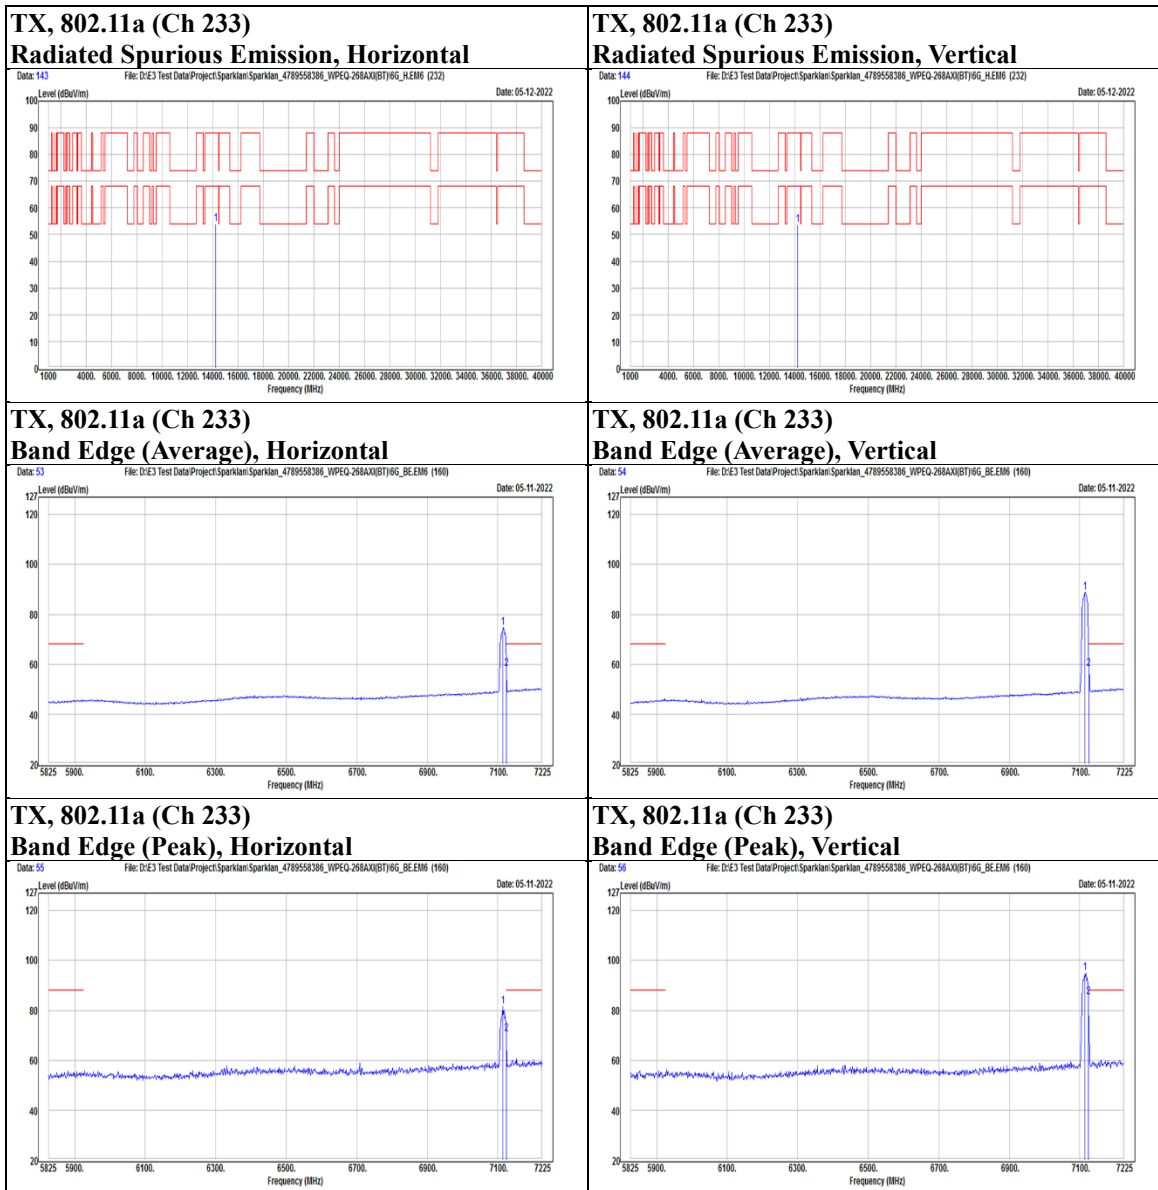

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 142 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	2
------	----------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5924.4	55.73	14.96	70.69	88.2	-17.51	PK
		5924.4	44.26	14.96	59.22	68.2	-8.98	AVG
	@	5935	74.01	14.95	88.96	N/A	N/A	PK
	@	5935	66.26	14.95	81.21	N/A	N/A	AVG
	*	11870	28.51	18.7	47.21	74	-26.79	PK
Vertical		5924.4	64.73	14.96	79.69	88.2	-8.51	PK
		5924.4	50.53	14.96	65.49	68.2	-2.71	AVG
	@	5935	84.07	14.95	99.02	N/A	N/A	PK
	@	5935	74.59	14.95	89.54	N/A	N/A	AVG
	*	11870	28.64	18.7	47.34	74	-26.66	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

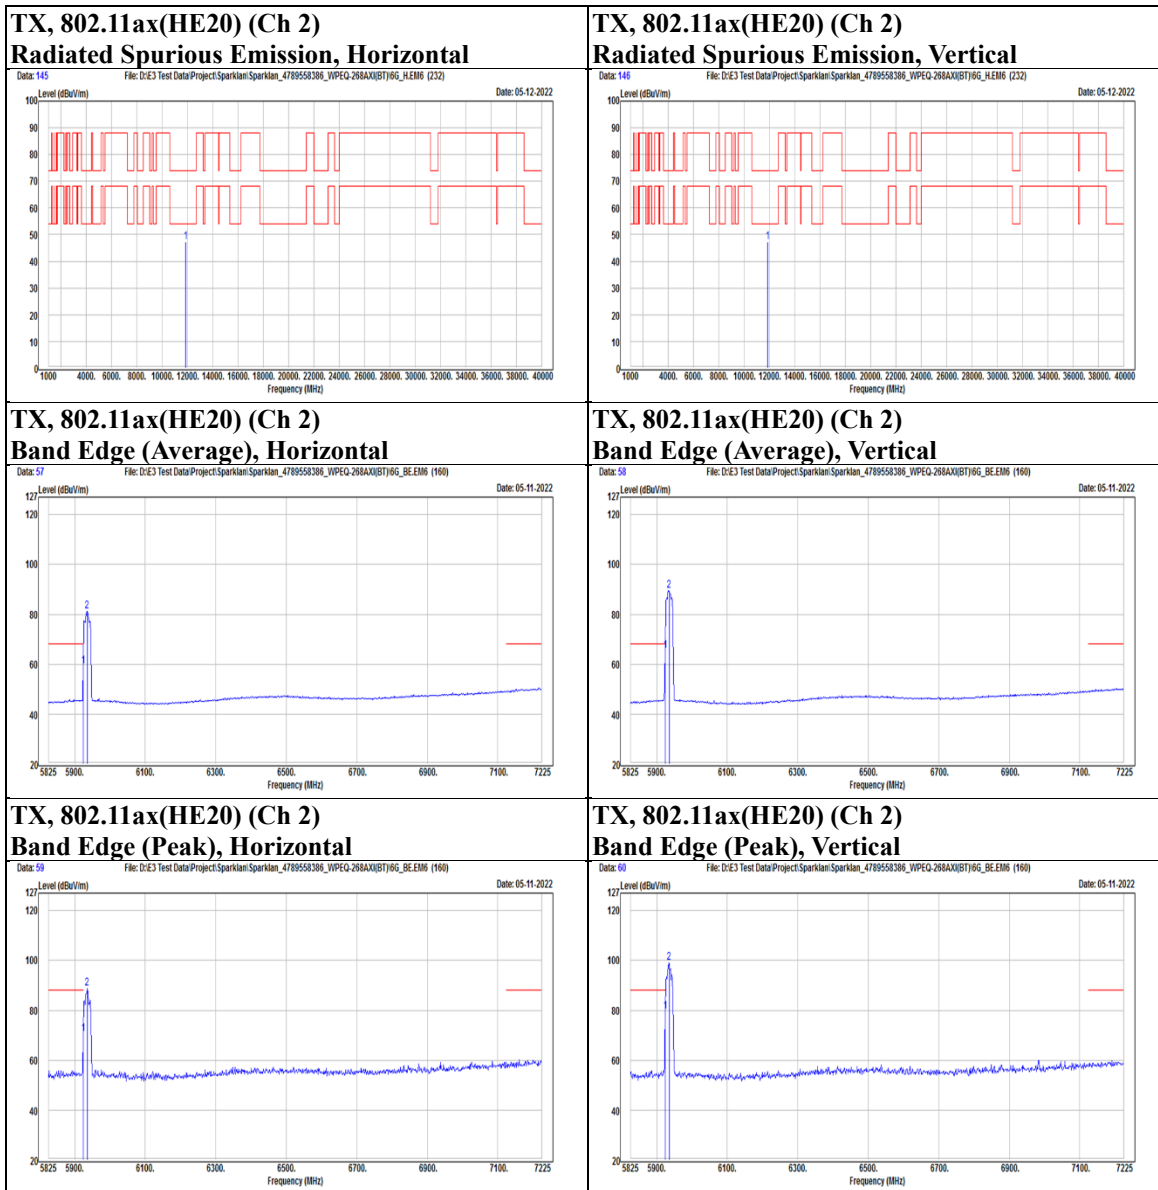



Test report No. : 4790371368-US-R2-V0
Page : 144 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	1
------	----------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5907.6	30.77	14.97	45.74	68.2	-22.46	AVG
		5910.4	41.5	14.97	56.47	88.2	-31.73	PK
	@	5955	72.14	14.95	87.09	N/A	N/A	PK
	@	5955	66.11	14.95	81.06	N/A	N/A	AVG
	*	11910	28.81	18.84	47.65	74	-26.35	PK
Vertical		5892.2	41.12	14.92	56.04	88.2	-32.16	PK
		5895	31.3	14.94	46.24	68.2	-21.96	AVG
	@	5955	83.28	14.95	98.23	N/A	N/A	PK
	@	5955	74.58	14.95	89.53	N/A	N/A	AVG
	*	11910	27.78	18.84	46.62	74	-27.38	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 145 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

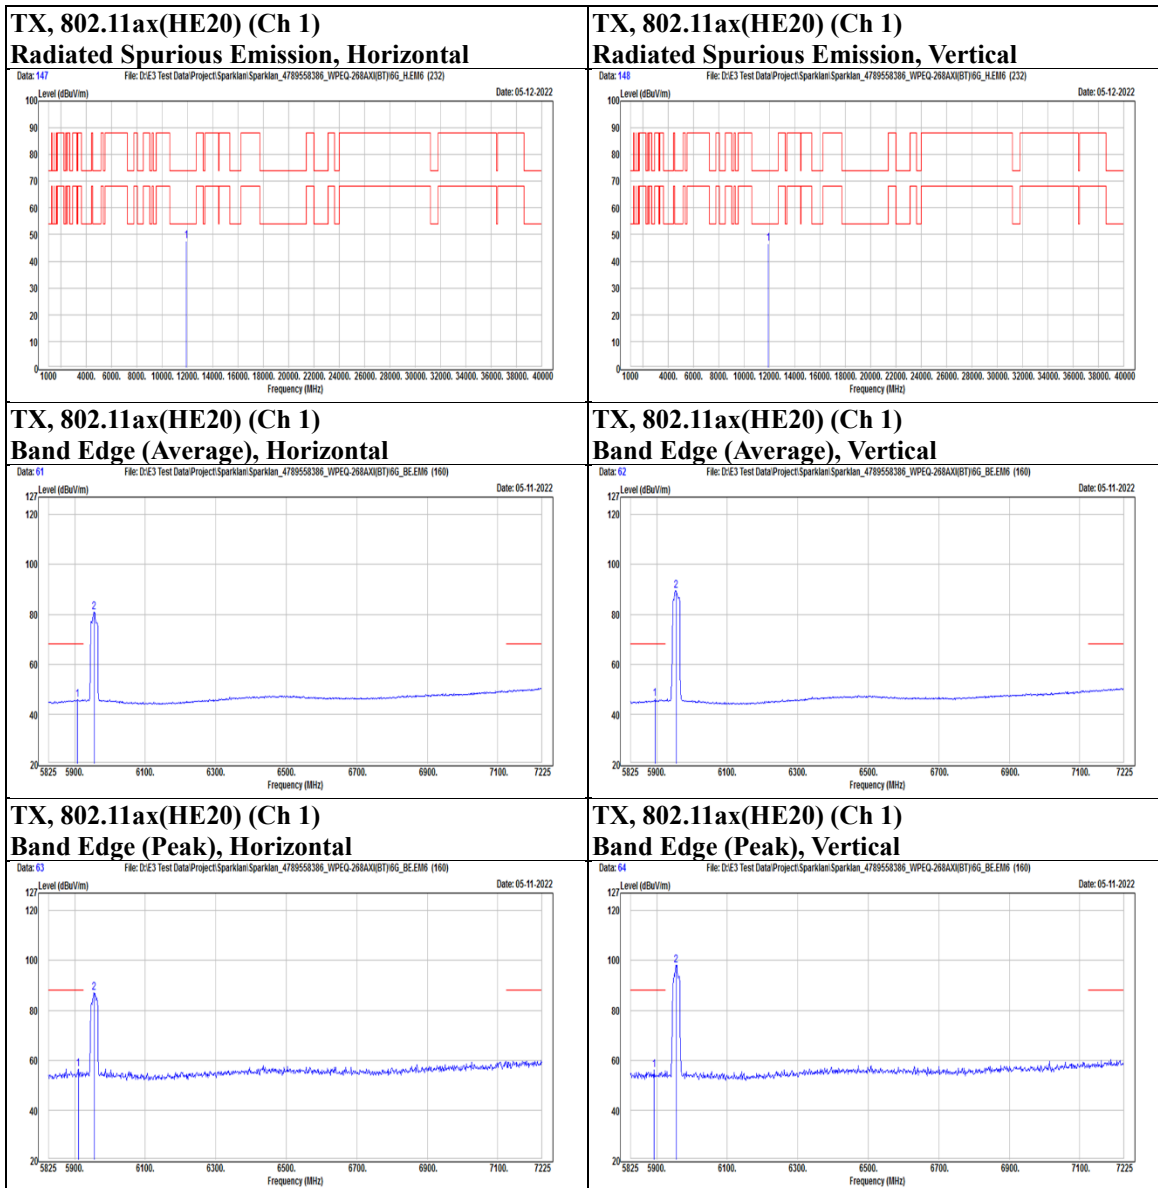

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 146 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	45
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5869.8	41.28	14.76	56.04	88.2	-32.16	PK
		5900.6	30.78	14.98	45.76	68.2	-22.44	AVG
	@	6175	64.44	15.52	79.96	N/A	N/A	PK
	@	6175	57.74	15.52	73.26	N/A	N/A	AVG
	*	12350	28.45	19.25	47.7	74	-26.3	PK
Vertical		5910.4	41.1	14.97	56.07	88.2	-32.13	PK
		5914.6	30.67	14.96	45.63	68.2	-22.57	AVG
	@	6175	82.65	15.52	98.17	N/A	N/A	PK
	@	6175	73.95	15.52	89.47	N/A	N/A	AVG
	*	12350	28.06	19.25	47.31	74	-26.69	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 147 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

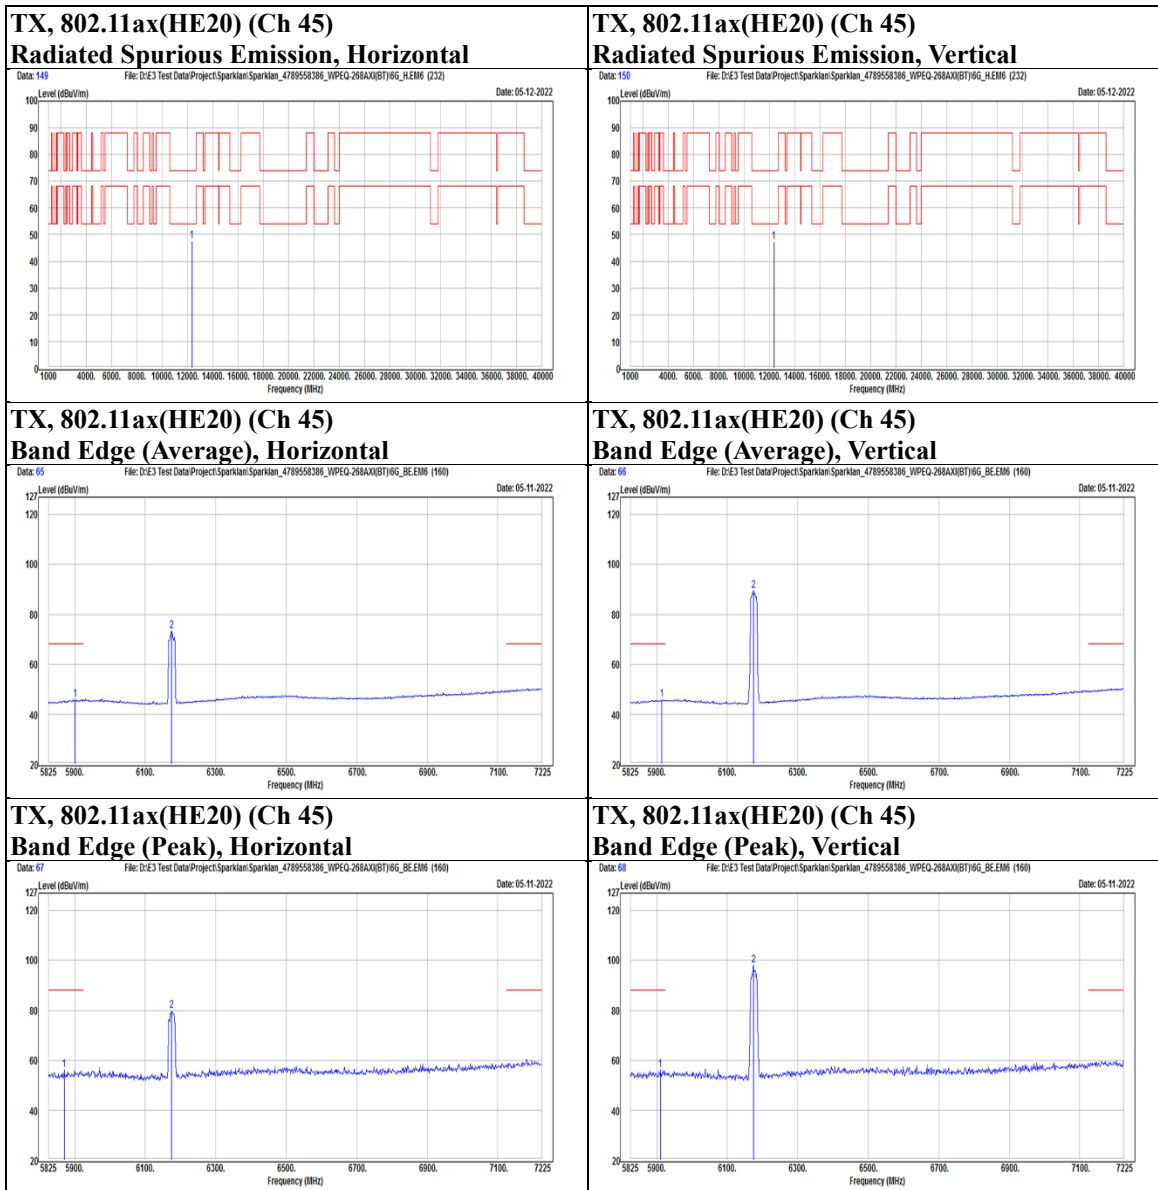

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 148 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	93
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5869.8	30.91	14.76	45.67	68.2	-22.53	AVG
		5911.8	41.45	14.97	56.42	88.2	-31.78	PK
	@	6415	67.06	16.72	83.78	N/A	N/A	PK
	@	6415	59.88	16.72	76.6	N/A	N/A	AVG
		7166.2	40.04	19.93	59.97	88.2	-28.23	PK
		7225	29.95	20.26	50.21	68.2	-17.99	AVG
	*	12830	28.29	20.62	48.91	88.2	-39.29	PK
Vertical		5840.4	41.03	14.6	55.63	88.2	-32.57	PK
		5923	31.09	14.96	46.05	68.2	-22.15	AVG
	@	6415	80.67	16.72	97.39	N/A	N/A	PK
	@	6415	72.63	16.72	89.35	N/A	N/A	AVG
		7138.2	41.17	19.78	60.95	88.2	-27.25	PK
		7222.2	30.24	20.25	50.49	68.2	-17.71	AVG
	*	12830	28.31	20.62	48.93	88.2	-39.27	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

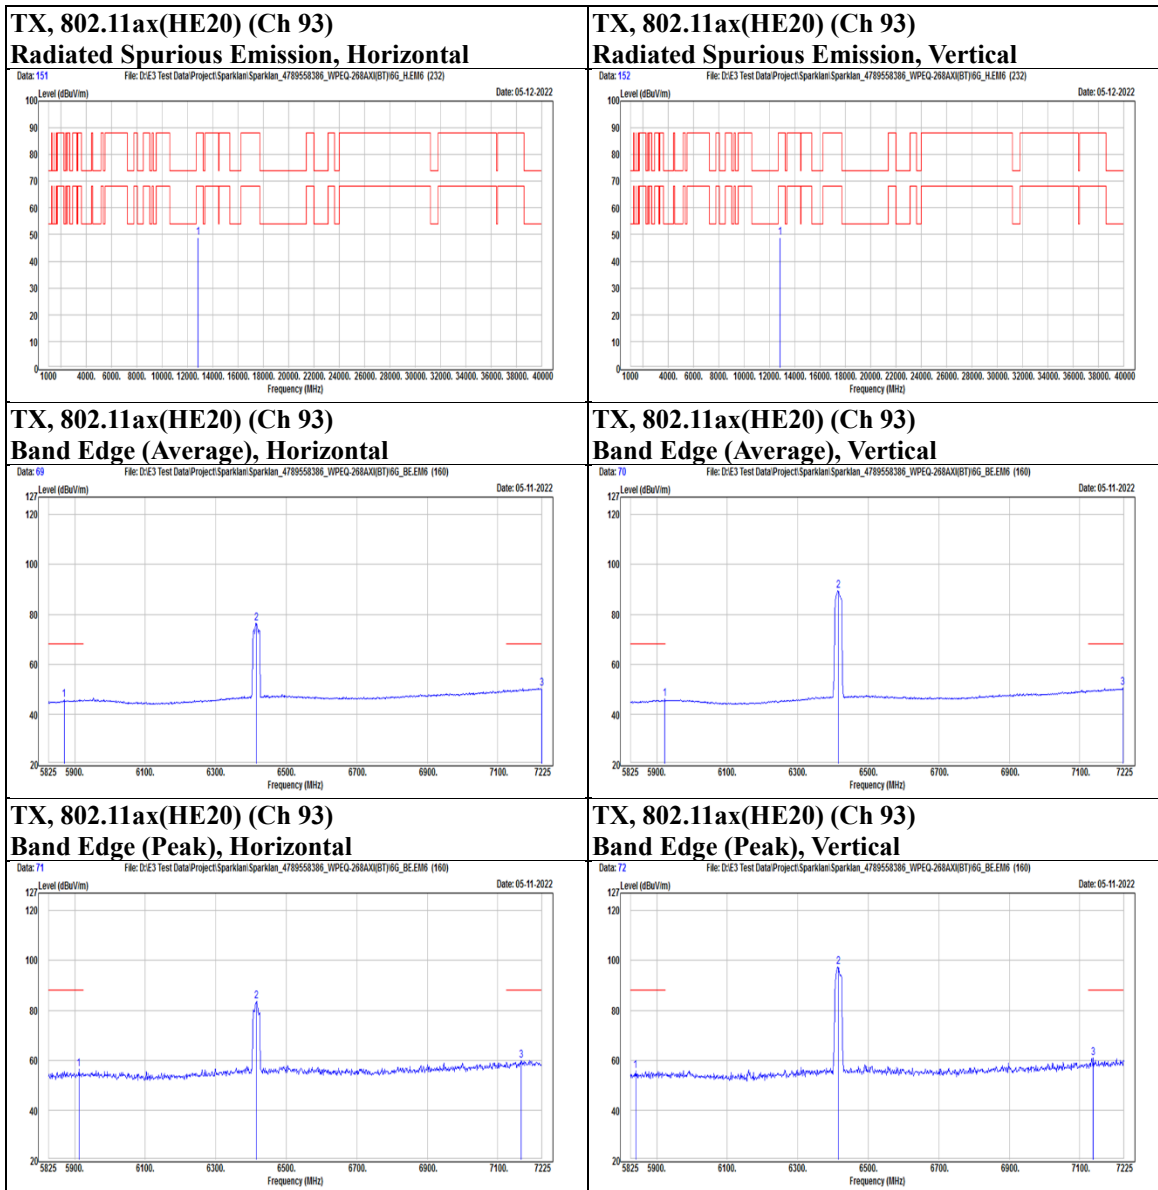



Test report No. : 4790371368-US-R2-V0
Page : 150 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	97
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5834.8	41.07	14.6	55.67	88.2	-32.53	PK
		5916	30.9	14.97	45.87	68.2	-22.33	AVG
	@	6435	67.19	16.78	83.97	N/A	N/A	PK
	@	6435	60.46	16.78	77.24	N/A	N/A	AVG
		7218	30.12	20.22	50.34	68.2	-17.86	AVG
		7223.6	39.87	20.25	60.12	88.2	-28.08	PK
	*	12870	27.5	20.73	48.23	88.2	-39.97	PK
Vertical		5888	30.81	14.9	45.71	68.2	-22.49	AVG
		5906.2	40.87	14.97	55.84	88.2	-32.36	PK
	@	6435	83.68	16.78	100.46	N/A	N/A	PK
	@	6435	73.27	16.78	90.05	N/A	N/A	AVG
		7180.2	41	20.02	61.02	88.2	-27.18	PK
		7223.6	30.2	20.25	50.45	68.2	-17.75	AVG
	*	12870	27.23	20.73	47.96	88.2	-40.24	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

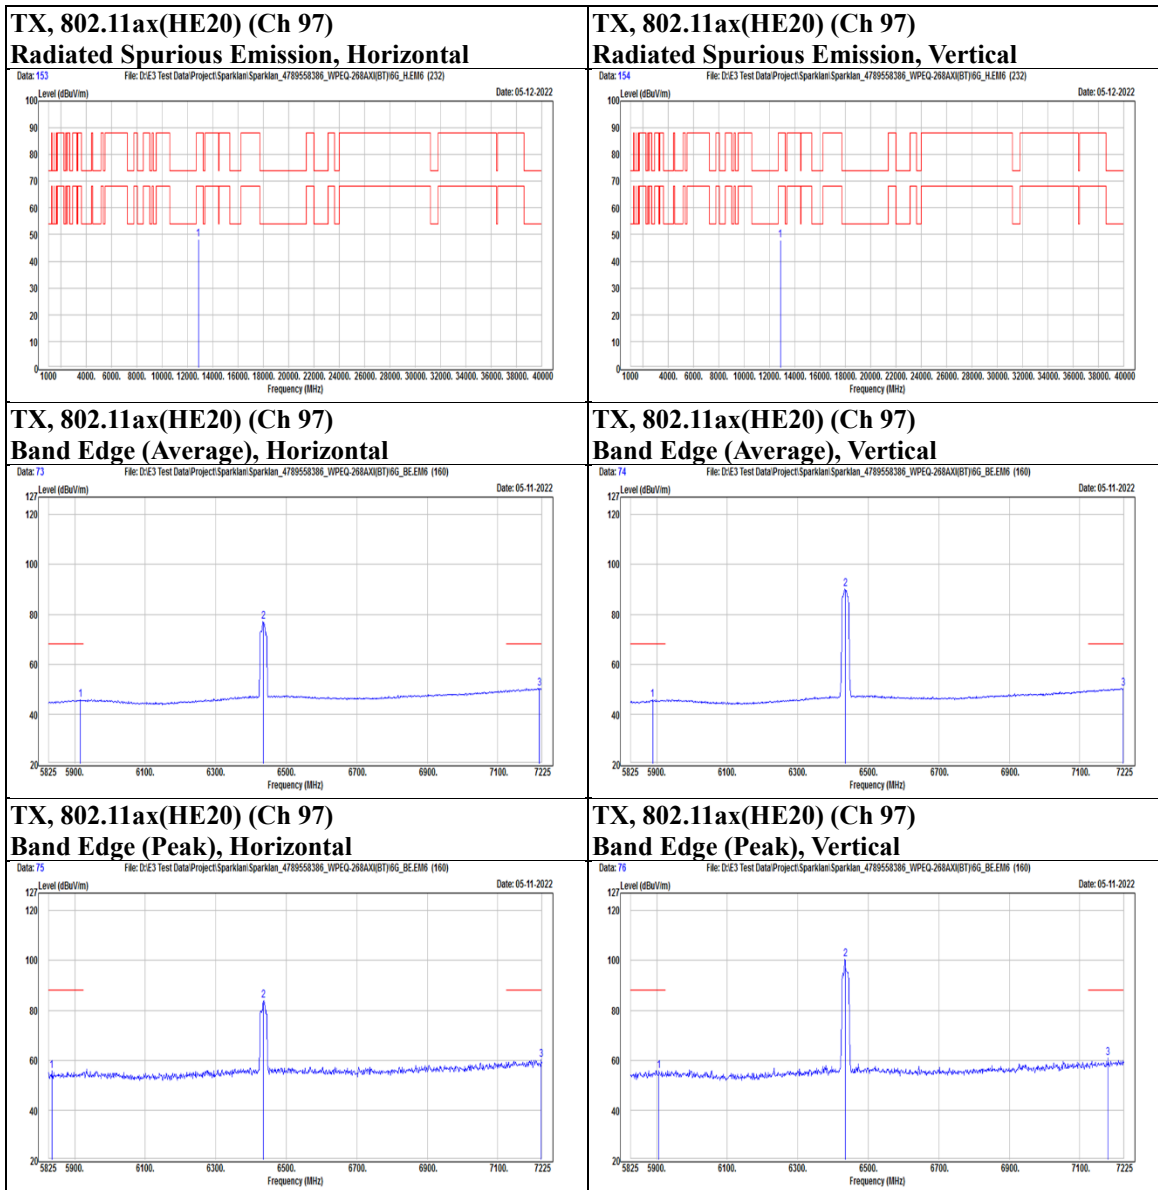



Test report No. : 4790371368-US-R2-V0
Page : 152 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	105
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5904.8	30.94	14.97	45.91	68.2	-22.29	AVG
		5923	40.88	14.96	55.84	88.2	-32.36	PK
	@	6475	64.08	17.06	81.14	N/A	N/A	PK
	@	6475	58.3	17.06	75.36	N/A	N/A	AVG
		7223.6	29.87	20.25	50.12	68.2	-18.08	AVG
		7225	40.01	20.26	60.27	88.2	-27.93	PK
	*	12950	27.18	20.86	48.04	88.2	-40.16	PK
Vertical		5916	40.72	14.97	55.69	88.2	-32.51	PK
		5924.4	30.82	14.96	45.78	68.2	-22.42	AVG
	@	6475	79.55	17.06	96.61	N/A	N/A	PK
	@	6475	72.34	17.06	89.4	N/A	N/A	AVG
		7218	40.28	20.22	60.5	88.2	-27.7	PK
		7220.8	30.05	20.23	50.28	68.2	-17.92	AVG
	*	12950	27.53	20.86	48.39	88.2	-39.81	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

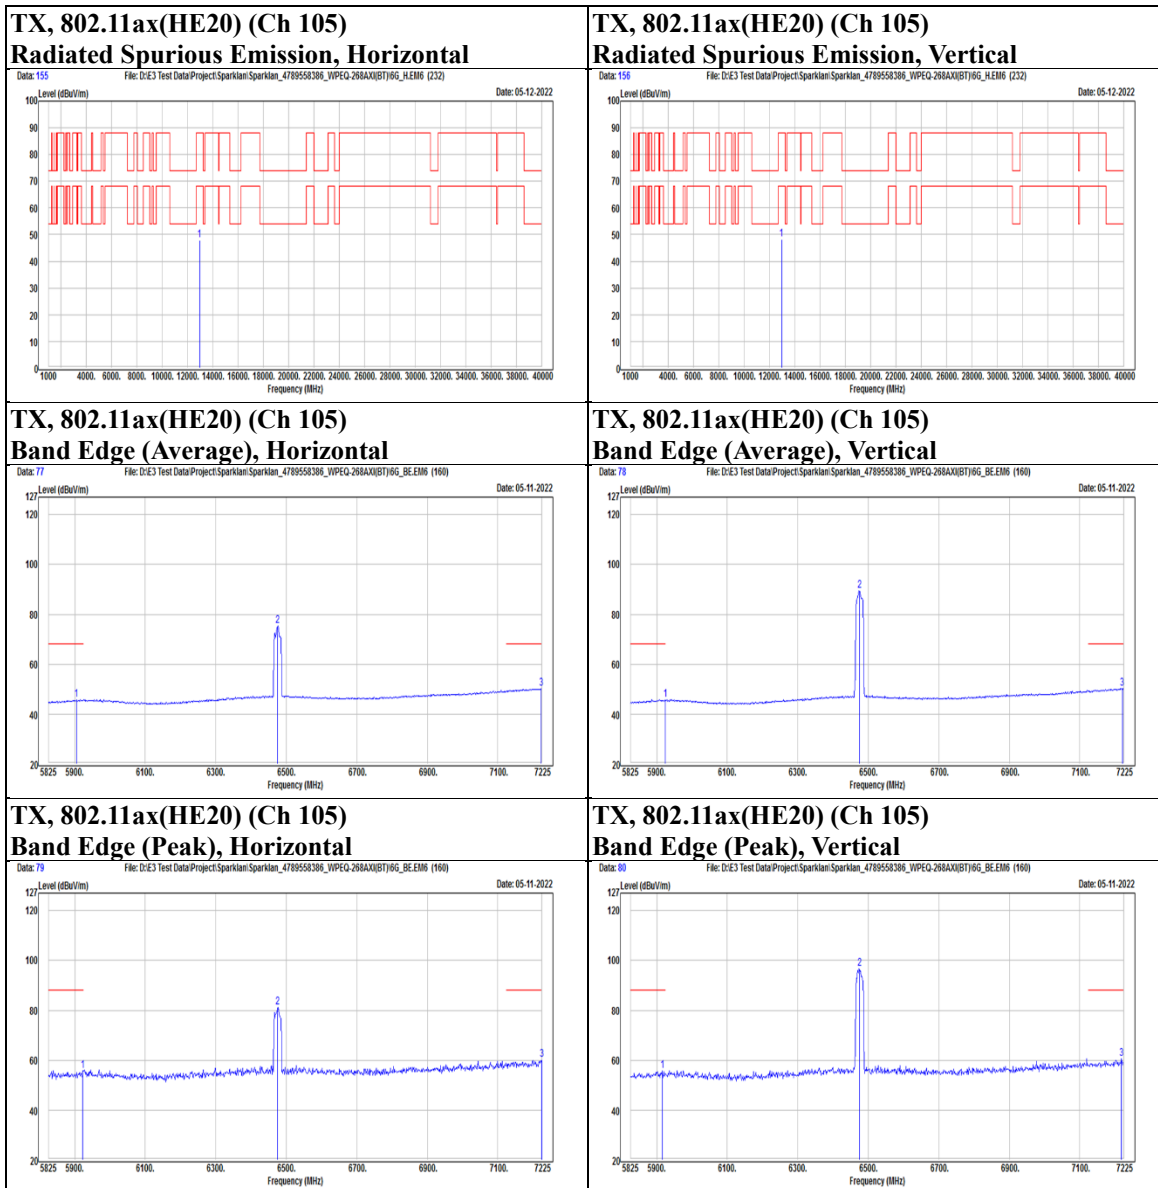



Test report No. : 4790371368-US-R2-V0
Page : 154 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	113
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5888	40.51	14.9	55.41	88.2	-32.79	PK
		5924.4	30.81	14.96	45.77	68.2	-22.43	AVG
	@	6515	66.1	17.31	83.41	N/A	N/A	PK
	@	6515	59.1	17.31	76.41	N/A	N/A	AVG
		7148	40.43	19.84	60.27	88.2	-27.93	PK
		7209.6	30.18	20.18	50.36	68.2	-17.84	AVG
	*	13030	28.24	20.95	49.19	88.2	-39.01	PK
Vertical		5910.4	40.69	14.97	55.66	88.2	-32.54	PK
		5921.6	30.7	14.96	45.66	68.2	-22.54	AVG
	@	6515	80.1	17.31	97.41	N/A	N/A	PK
	@	6515	72.12	17.31	89.43	N/A	N/A	AVG
		7199.8	39.35	20.12	59.47	88.2	-28.73	PK
		7209.6	30.31	20.18	50.49	68.2	-17.71	AVG
	*	13030	27.45	20.95	48.4	88.2	-39.8	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0




Test report No. : 4790371368-US-R2-V0
Page : 155 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB


TX, 802.11ax(HE20) (Ch 113)
Radiated Spurious Emission, Horizontal

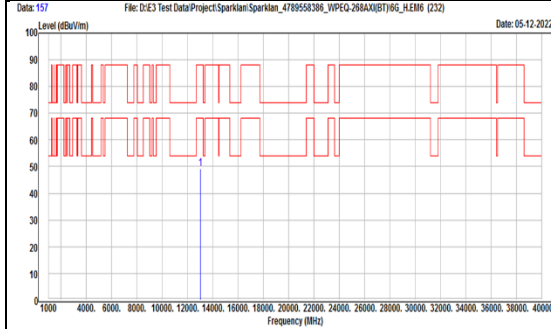


TX, 802.11ax(HE20) (Ch 113)
Radiated Spurious Emission, Vertical

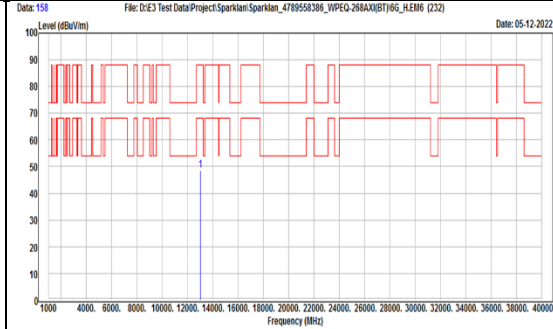


TX, 802.11ax(HE20) (Ch 113)
Band Edge (Average), Horizontal

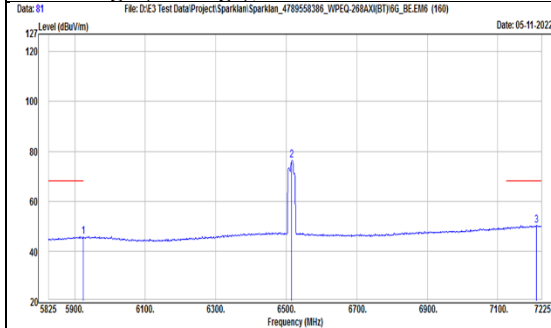


TX, 802.11ax(HE20) (Ch 113)
Band Edge (Average), Vertical

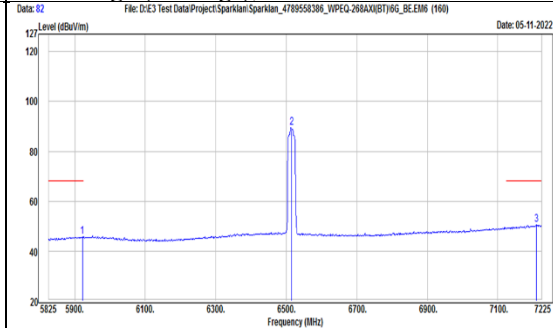

TX, 802.11ax(HE20) (Ch 113)
Band Edge (Peak), Horizontal

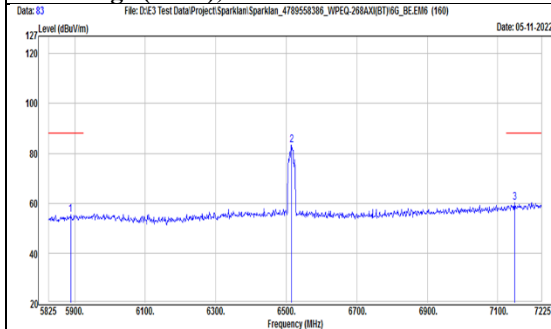

TX, 802.11ax(HE20) (Ch 113)
Band Edge (Peak), Vertical

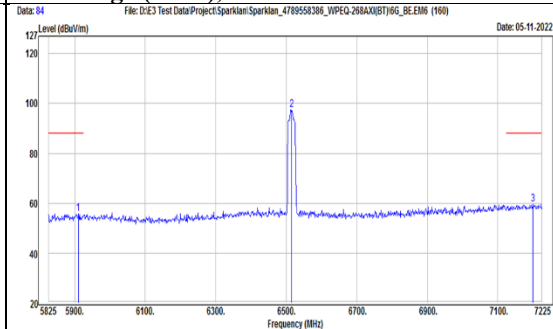

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 156 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	117
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5843.2	40.97	14.61	55.58	88.2	-32.62	PK
		5911.8	30.81	14.97	45.78	68.2	-22.42	AVG
	@	6535	65.71	17.33	83.04	N/A	N/A	PK
	@	6535	58.74	17.33	76.07	N/A	N/A	AVG
		7180.2	40.83	20.02	60.85	88.2	-27.35	PK
		7198.4	30.32	20.11	50.43	68.2	-17.77	AVG
	*	13070	27.72	21.01	48.73	88.2	-39.47	PK
Vertical		5871.2	41.53	14.78	56.31	88.2	-31.89	PK
		5917.4	30.62	14.97	45.59	68.2	-22.61	AVG
	@	6535	80.17	17.33	97.5	N/A	N/A	PK
	@	6535	72.14	17.33	89.47	N/A	N/A	AVG
		7212.4	39.79	20.19	59.98	88.2	-28.22	PK
		7216.6	30.39	20.22	50.61	68.2	-17.59	AVG
	*	13070	26.84	21.01	47.85	88.2	-40.35	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

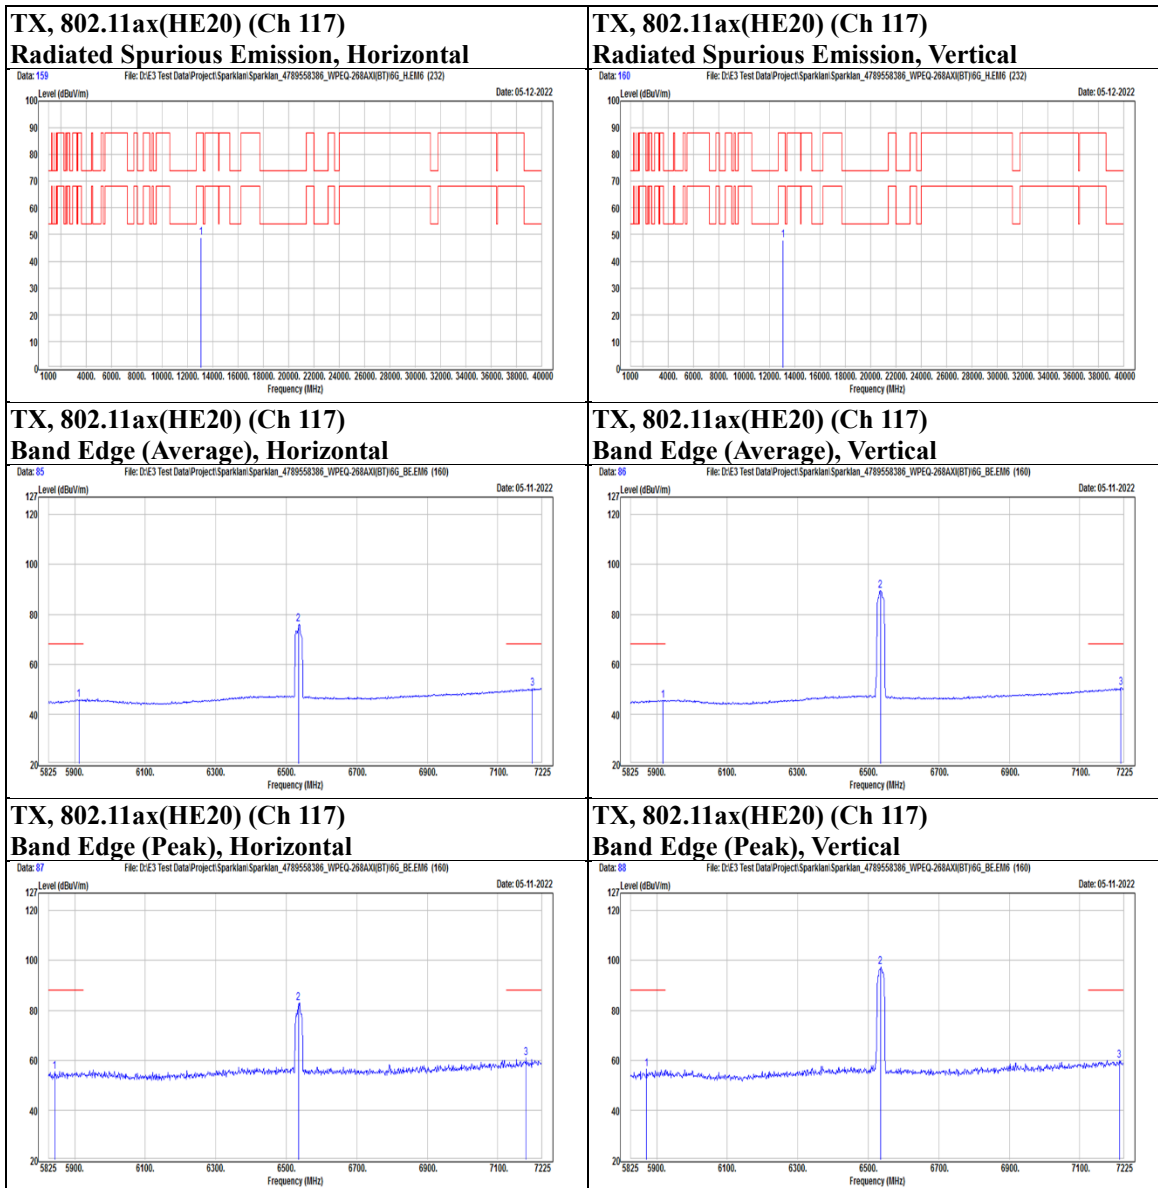



Test report No. : 4790371368-US-R2-V0
Page : 158 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	149
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5913.2	30.85	14.96	45.81	68.2	-22.39	AVG
		5917.4	40.97	14.97	55.94	88.2	-32.26	PK
	@	6695	69.94	17.5	87.44	N/A	N/A	PK
	@	6695	60.64	17.5	78.14	N/A	N/A	AVG
		7212.4	40.2	20.19	60.39	88.2	-27.81	PK
		7223.6	30.03	20.25	50.28	68.2	-17.92	AVG
	*	13390	27.47	22.07	49.54	74	-24.46	PK
Vertical		5900.6	41	14.98	55.98	88.2	-32.22	PK
		5917.4	30.97	14.97	45.94	68.2	-22.26	AVG
	@	6695	80.06	17.5	97.56	N/A	N/A	PK
	@	6695	72.25	17.5	89.75	N/A	N/A	AVG
		7150.8	40.79	19.85	60.64	88.2	-27.56	PK
		7201.2	30.1	20.13	50.23	68.2	-17.97	AVG
	*	13390	27.5	22.07	49.57	74	-24.43	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

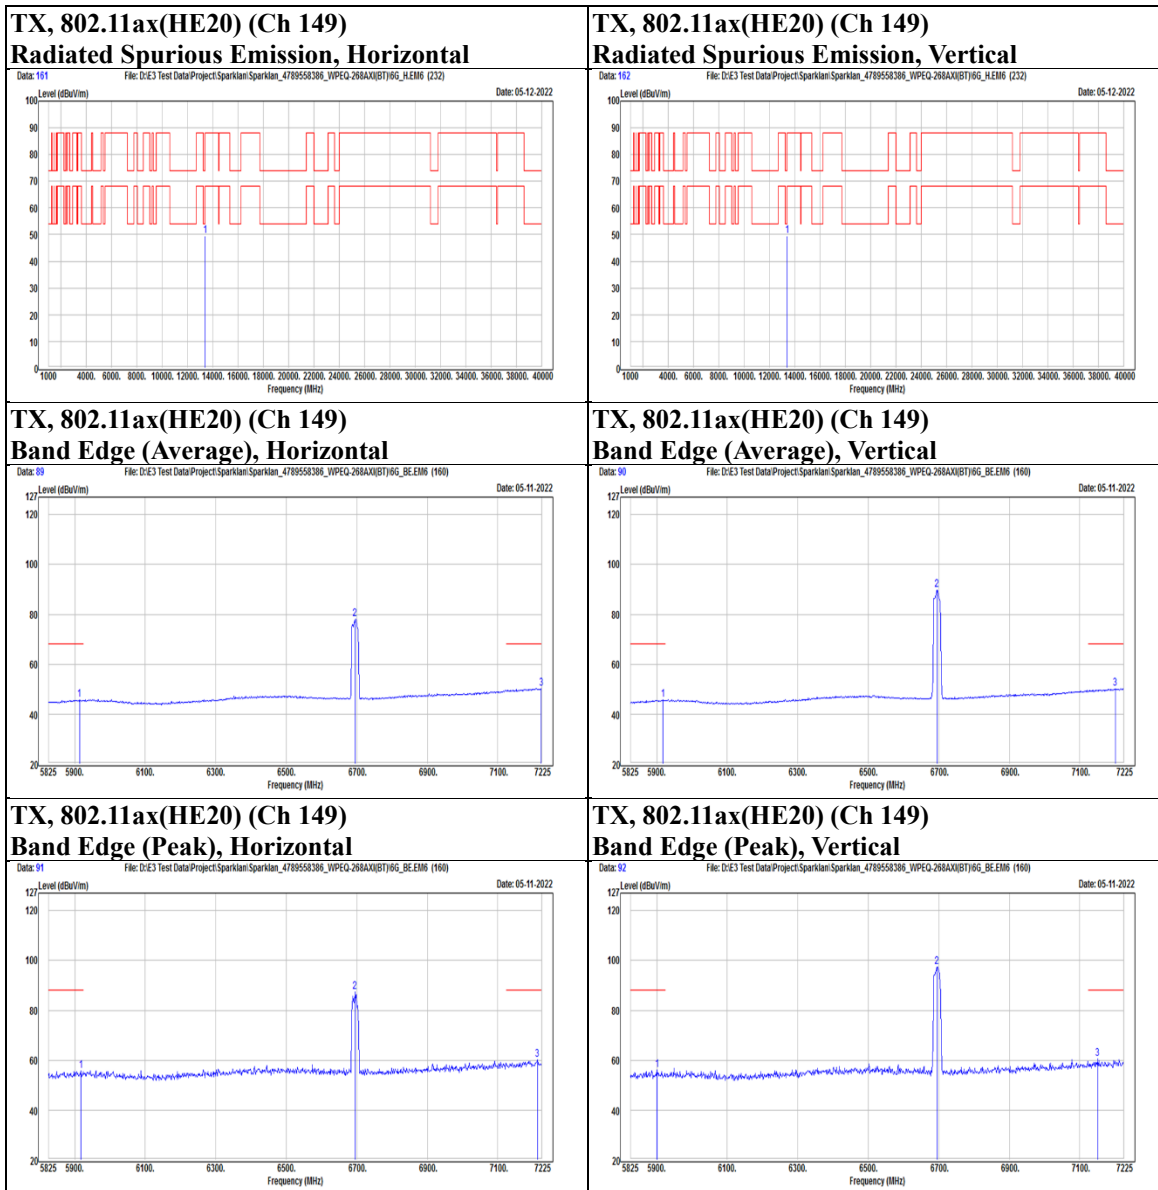



Test report No. : 4790371368-US-R2-V0
Page : 160 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	181
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5917.4	40.72	14.97	55.69	88.2	-32.51	PK
		5924.4	30.81	14.96	45.77	68.2	-22.43	AVG
	@	6855	67.71	18.28	85.99	N/A	N/A	PK
	@	6855	59.27	18.28	77.55	N/A	N/A	AVG
		7162	41.36	19.92	61.28	88.2	-26.92	PK
		7222.2	30.2	20.25	50.45	68.2	-17.75	AVG
	*	13710	27.92	22.78	50.7	88.2	-37.5	PK
Vertical		5918.8	40.74	14.96	55.7	88.2	-32.5	PK
		5918.8	31.2	14.96	46.16	68.2	-22.04	AVG
	@	6855	79	18.28	97.28	N/A	N/A	PK
	@	6855	71.32	18.28	89.6	N/A	N/A	AVG
		7176	39.63	19.99	59.62	88.2	-28.58	PK
		7204	30.41	20.15	50.56	68.2	-17.64	AVG
	*	13710	28.57	22.78	51.35	88.2	-36.85	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0