





PSD NVNT n40 5510MHz Ant1

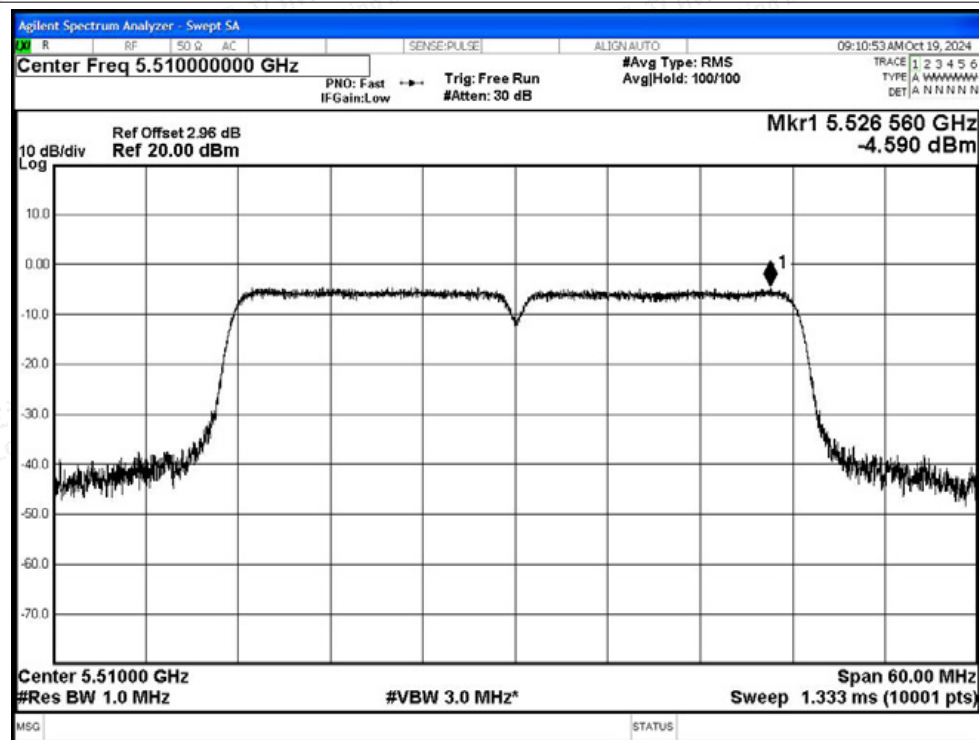


PSD NVNT n40 5550MHz Ant1

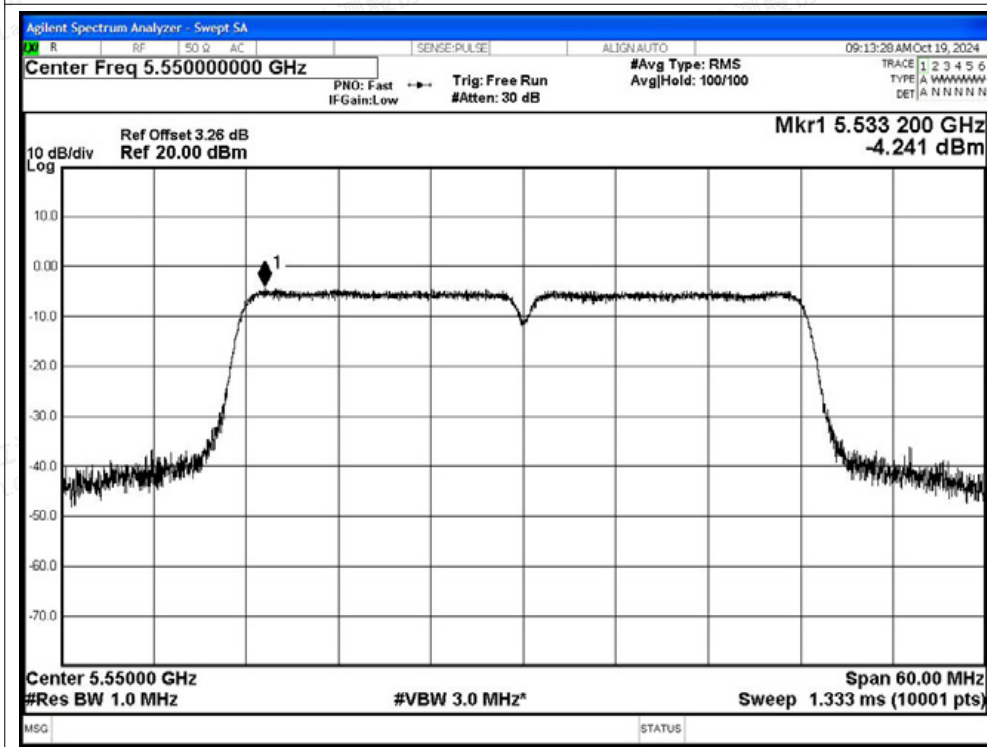




PSD NVNT n40 5670MHz Ant1

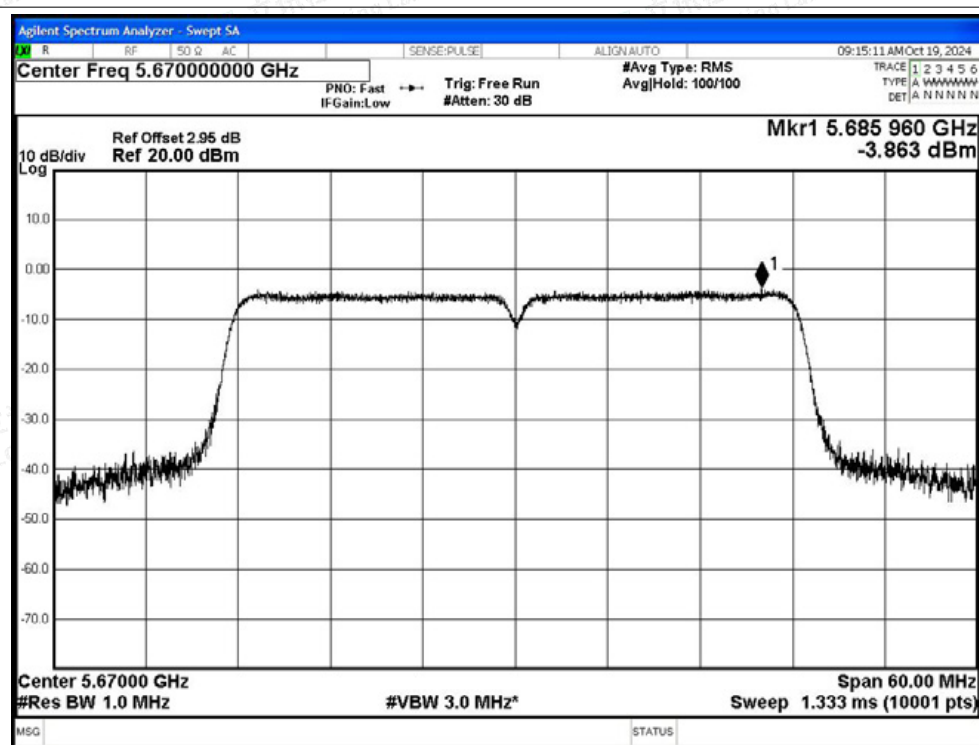


PSD NVNT ac20 5500MHz Ant1

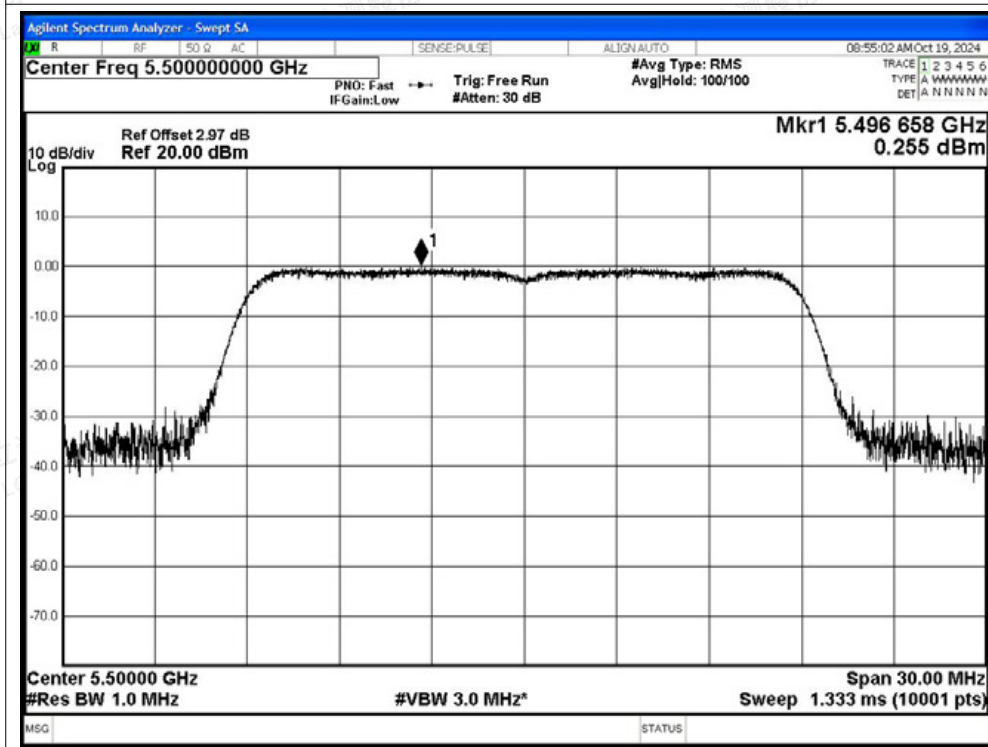




PSD NVNT ac20 5580MHz Ant1

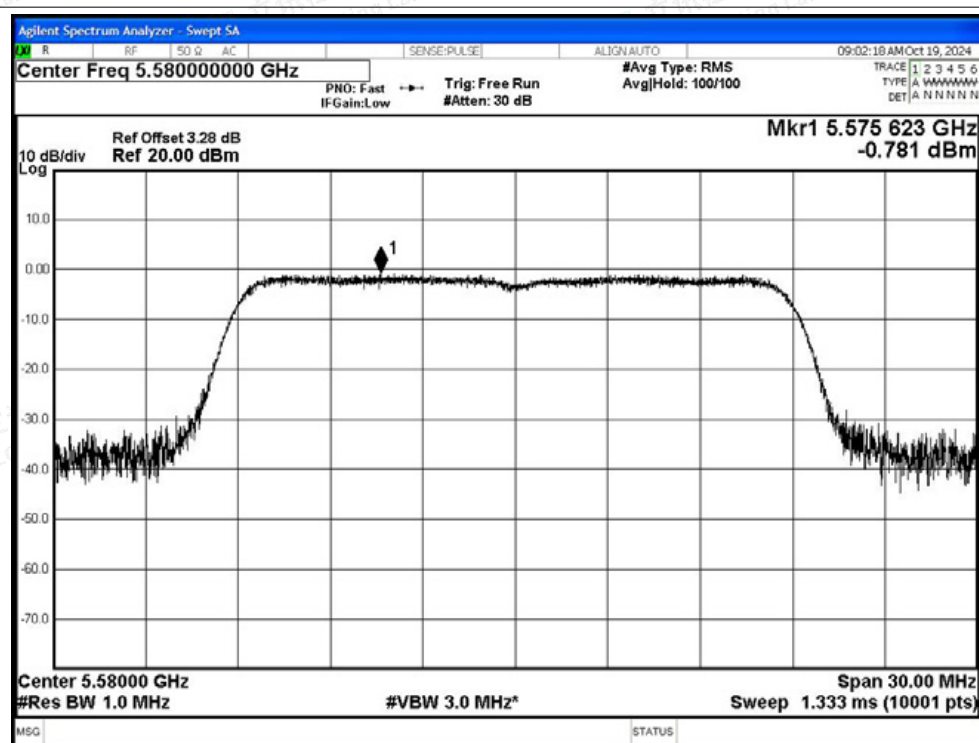


PSD NVNT ac20 5700MHz Ant1

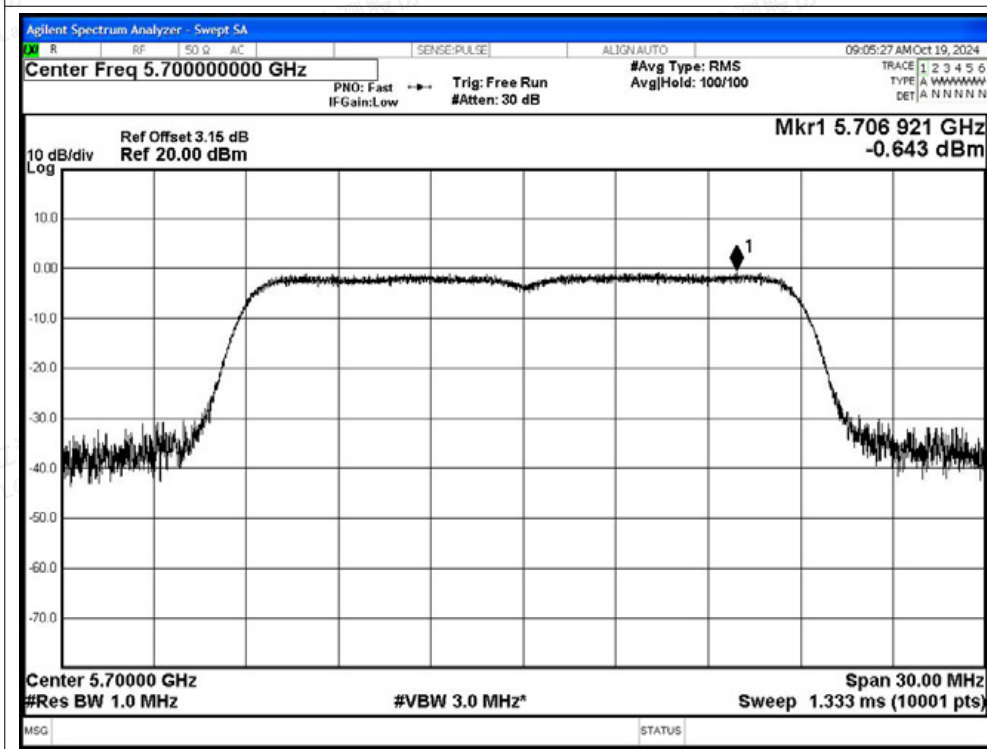






PSD NVNT ac40 5510MHz Ant1

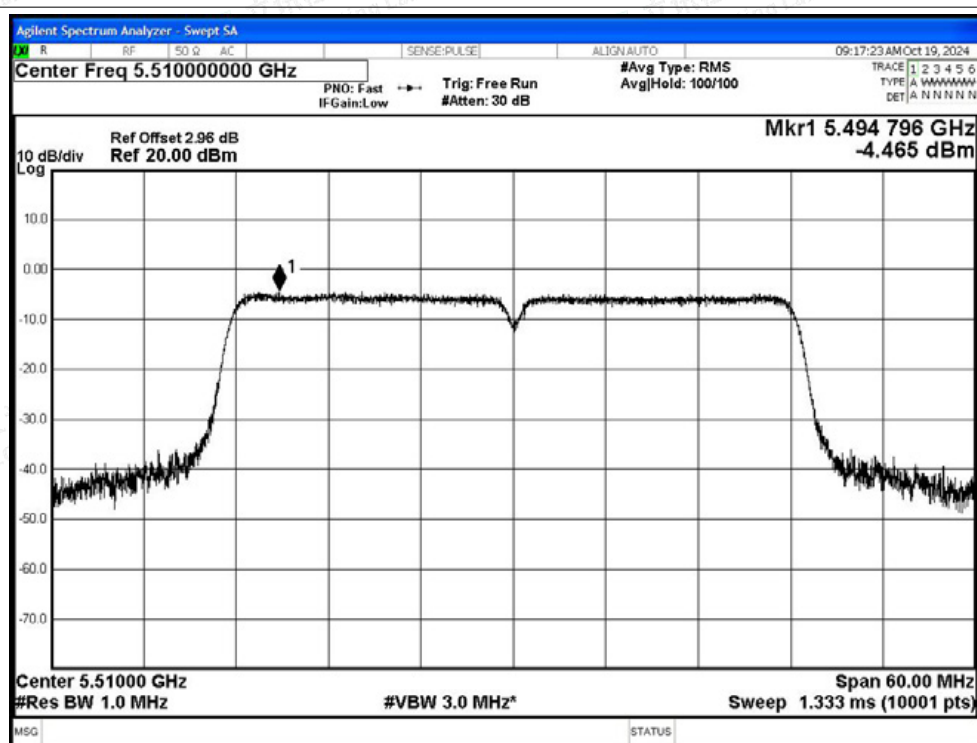

PSD NVNT ac40 5550MHz Ant1

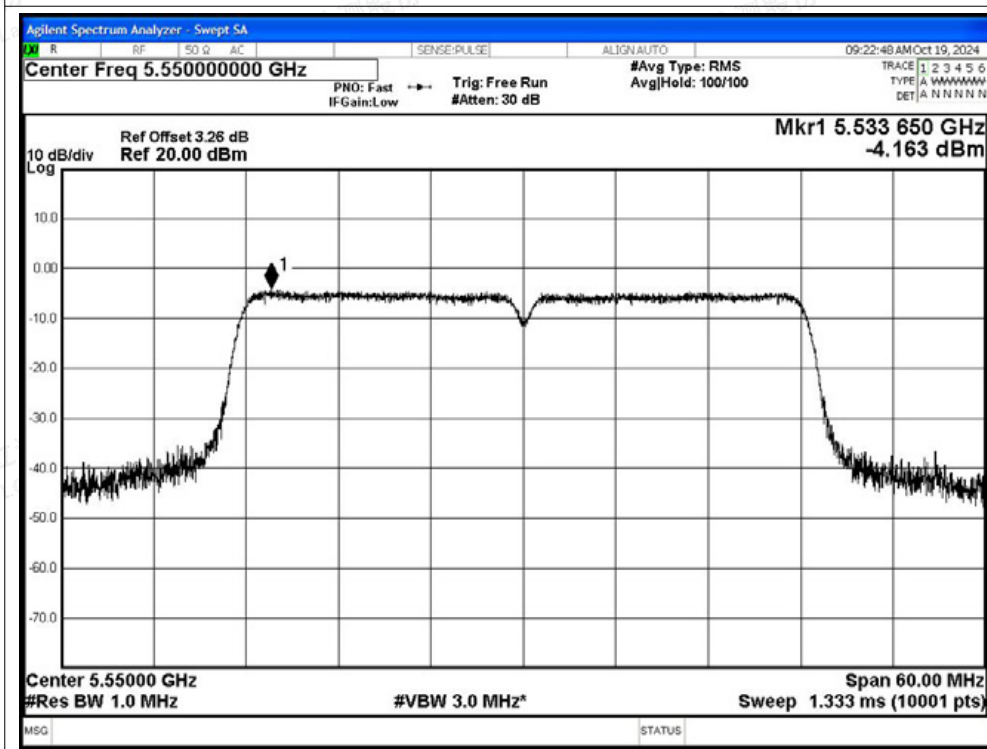


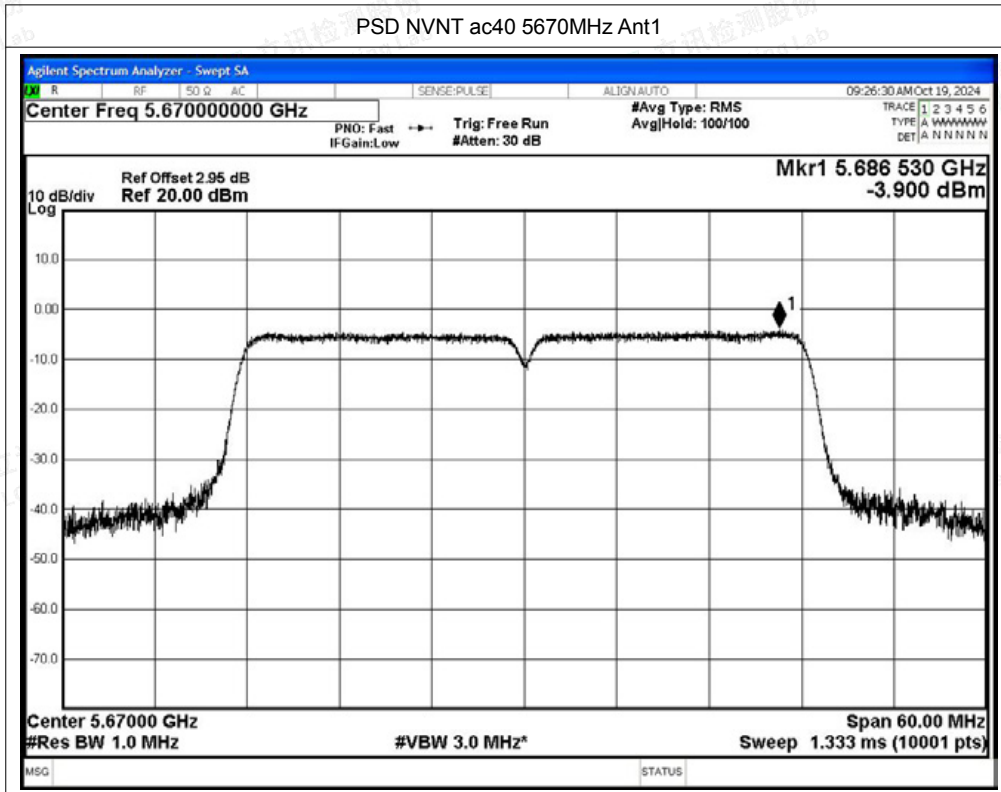

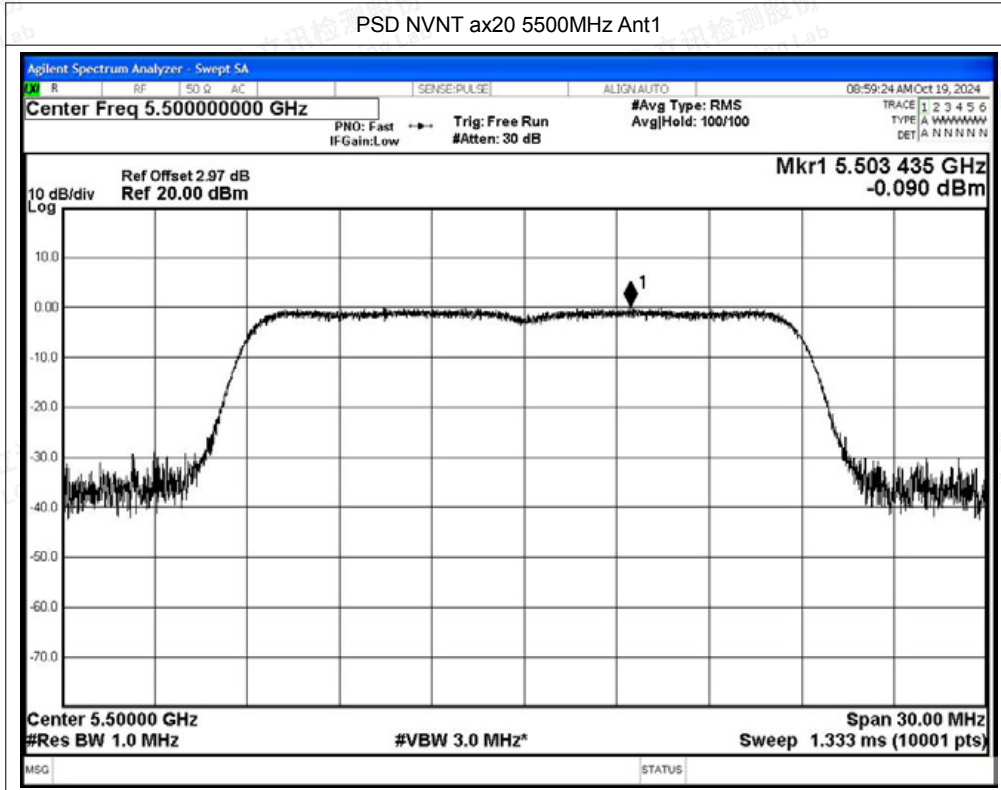




PSD NVNT ax20 5580MHz Ant1

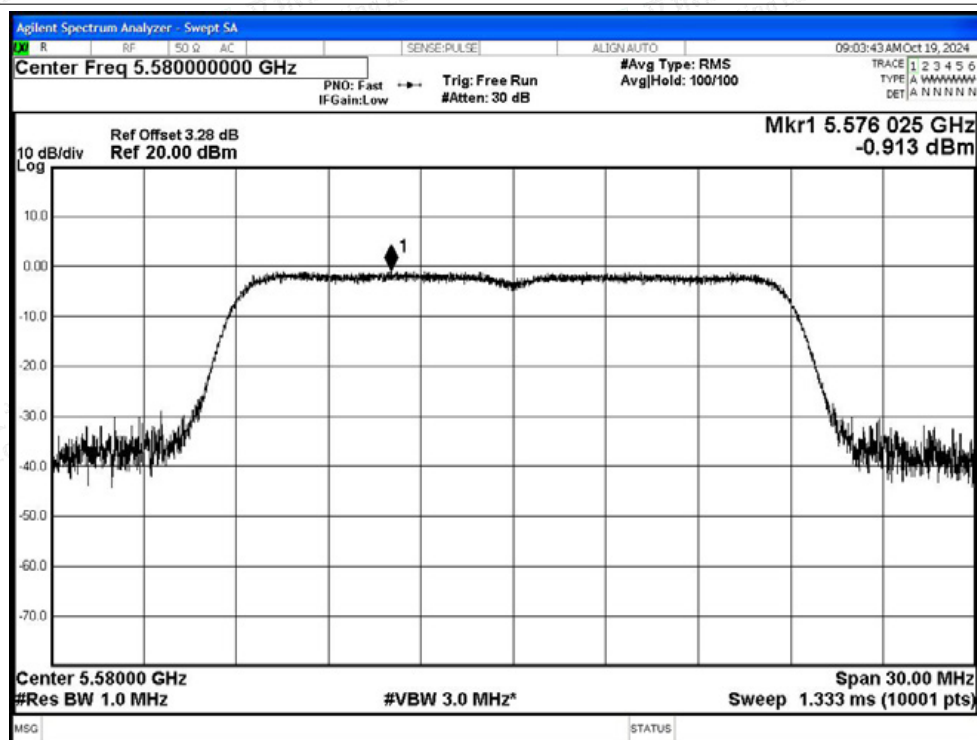


PSD NVNT ax20 5700MHz Ant1

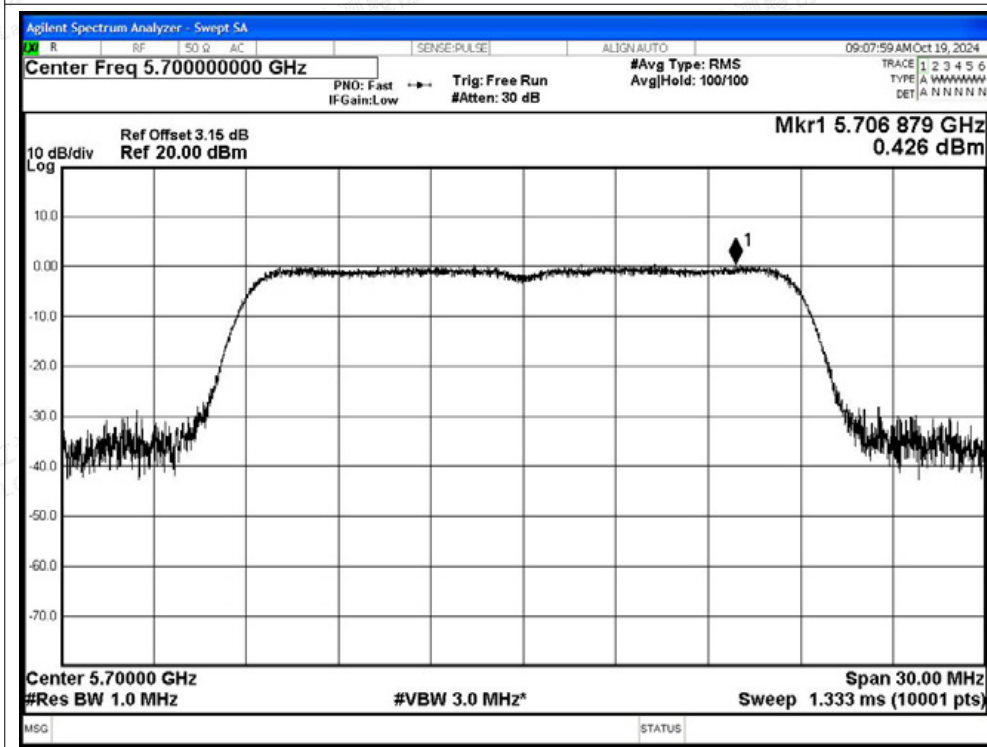





PSD NVNT ax40 5510MHz Ant1

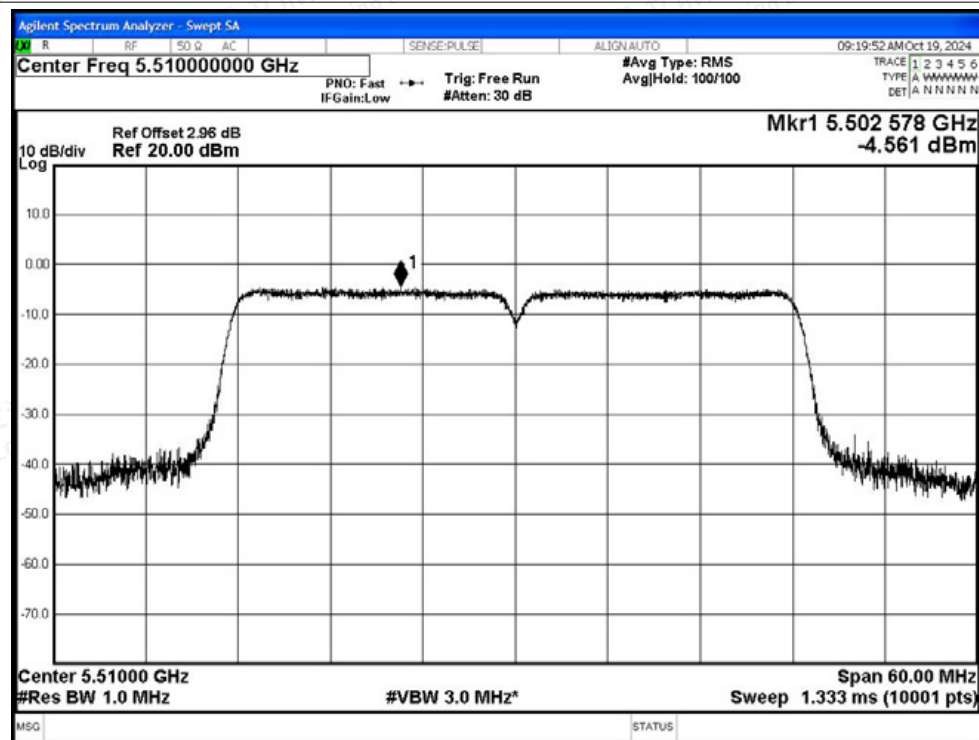

PSD NVNT ax40 5550MHz Ant1

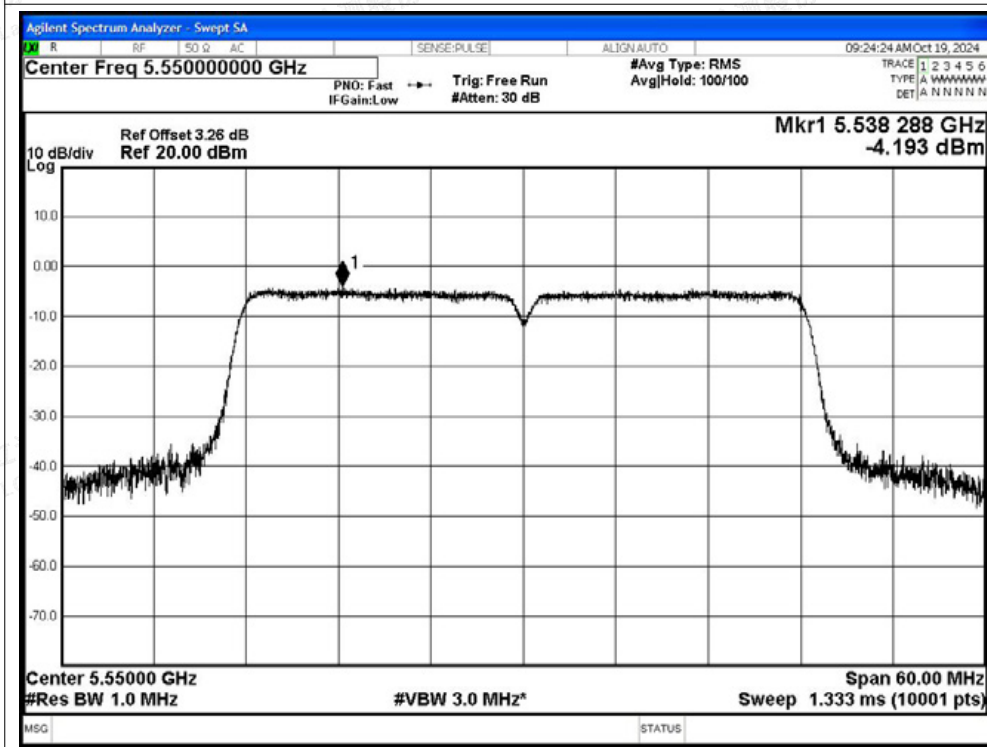

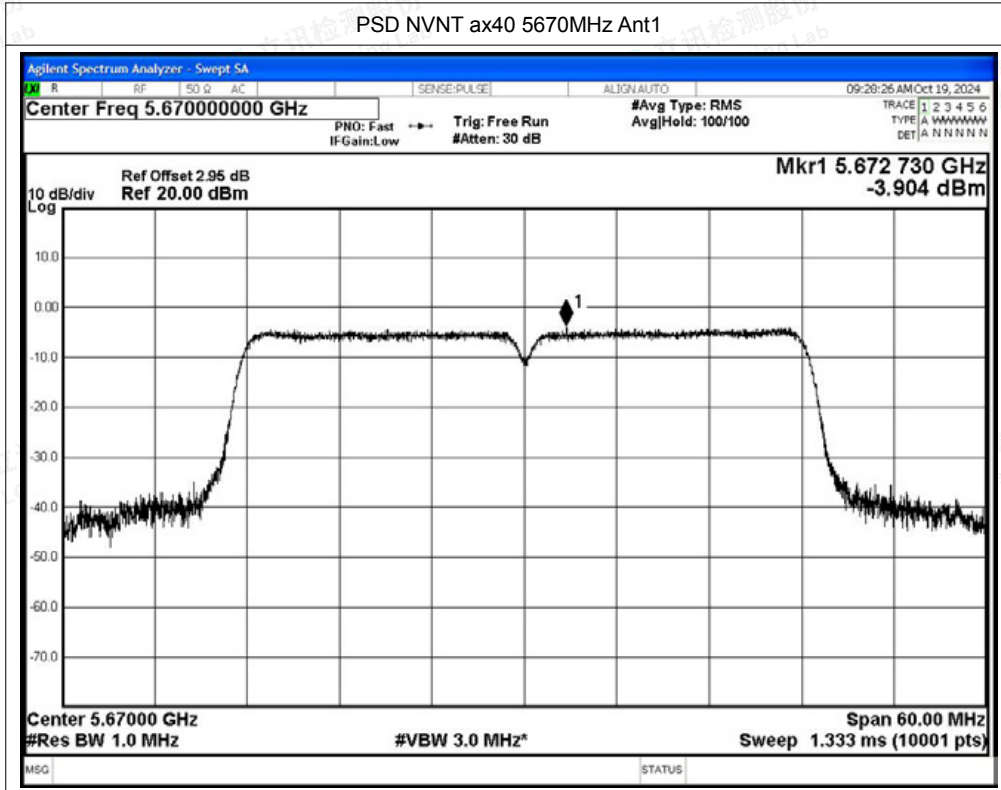



F.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant0	5460	-49.99	2.97	-	48.21	Peak	68.2	Pass
NVNT	a	5500	Ant0	5460	-57.87	2.97	0.24	40.57	Average	54	Pass
NVNT	a	5500	Ant0	5468.6	-41.8	2.97	-	56.40	Peak	68.2	Pass
NVNT	a	5500	Ant0	5469.6	-55.41	2.97	0.24	43.03	Average	54	Pass
NVNT	a	5500	Ant0	5470	-43.69	2.97	-	54.51	Peak	68.2	Pass
NVNT	a	5500	Ant0	5470	-55.65	2.97	0.24	42.79	Average	54	Pass
NVNT	a	5700	Ant0	5725	-40.42	2.97	-	57.78	Peak	68.2	Pass
NVNT	a	5700	Ant0	5725	-55.68	2.97	0.24	42.76	Average	54	Pass
NVNT	a	5700	Ant0	5726.2	-38.37	2.97	-	59.83	Peak	68.2	Pass
NVNT	a	5700	Ant0	5726.8	-52.86	2.97	0.24	45.58	Average	54	Pass
NVNT	a	5700	Ant0	5735	-46.26	2.97	-	51.94	Peak	68.2	Pass
NVNT	a	5700	Ant0	5735	-57.09	2.97	0.24	41.35	Average	54	Pass
NVNT	n20	5500	Ant0	5460	-48.83	2.97	-	49.37	Peak	68.2	Pass
NVNT	n20	5500	Ant0	5460	-56.45	2.97	0.12	41.87	Average	54	Pass
NVNT	n20	5500	Ant0	5469.6	-36.64	2.97	-	61.56	Peak	68.2	Pass
NVNT	n20	5500	Ant0	5469.8	-52.52	2.97	0.12	45.80	Average	54	Pass
NVNT	n20	5500	Ant0	5470	-42.63	2.97	-	55.57	Peak	68.2	Pass
NVNT	n20	5500	Ant0	5470	-53.45	2.97	0.12	44.87	Average	54	Pass
NVNT	n20	5700	Ant0	5725	-34.37	2.97	-	63.83	Peak	68.2	Pass
NVNT	n20	5700	Ant0	5725	-52.48	2.97	0.12	45.84	Average	54	Pass
NVNT	n20	5700	Ant0	5735	-48.65	2.97	-	49.55	Peak	68.2	Pass
NVNT	n20	5700	Ant0	5735	-57.69	2.97	0.12	40.63	Average	54	Pass
NVNT	n20	5700	Ant0	5725	-34.37	2.97	-	63.83	Peak	68.2	Pass
NVNT	n20	5700	Ant0	5725	-52.48	2.97	0.12	45.84	Average	54	Pass
NVNT	n40	5510	Ant0	5460	-49.73	2.97	-	48.47	Peak	68.2	Pass
NVNT	n40	5510	Ant0	5460	-57.23	2.97	0.12	41.09	Average	54	Pass
NVNT	n40	5510	Ant0	5468.2	-39.99	2.97	-	58.21	Peak	68.2	Pass
NVNT	n40	5510	Ant0	5470	-53.6	2.97	0.12	44.72	Average	54	Pass
NVNT	n40	5510	Ant0	5470	-45.17	2.97	-	53.03	Peak	68.2	Pass
NVNT	n40	5510	Ant0	5470	-53.6	2.97	0.12	44.72	Average	54	Pass
NVNT	n40	5670	Ant0	5725	-47.15	2.97	-	51.05	Peak	68.2	Pass
NVNT	n40	5670	Ant0	5725	-55.74	2.97	0.12	42.58	Average	54	Pass
NVNT	n40	5670	Ant0	5726.8	-45.24	2.97	-	52.96	Peak	68.2	Pass
NVNT	n40	5670	Ant0	5725.6	-54.57	2.97	0.12	43.75	Average	54	Pass
NVNT	n40	5670	Ant0	5735	-48.1	2.97	-	50.10	Peak	68.2	Pass
NVNT	n40	5670	Ant0	5735	-56.18	2.97	0.12	42.14	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac20	5500	Ant0	5460	-48.17	2.97	-	50.03	Peak	68.2	Pass
NVNT	ac20	5500	Ant0	5460	-56.71	2.97	0.12	41.61	Average	54	Pass
NVNT	ac20	5500	Ant0	5469.4	-31.82	2.97	-	66.38	Peak	68.2	Pass
NVNT	ac20	5500	Ant0	5468	-51.75	2.97	0.12	46.57	Average	54	Pass
NVNT	ac20	5500	Ant0	5470	-40.99	2.97	-	57.21	Peak	68.2	Pass
NVNT	ac20	5500	Ant0	5470	-53	2.97	0.12	45.32	Average	54	Pass
NVNT	ac20	5700	Ant0	5725	-39.05	2.97	-	59.15	Peak	68.2	Pass
NVNT	ac20	5700	Ant0	5725	-51.89	2.97	0.12	46.43	Average	54	Pass
NVNT	ac20	5700	Ant0	5725.8	-36.02	2.97	-	62.18	Peak	68.2	Pass
NVNT	ac20	5700	Ant0	5725.2	-51.63	2.97	0.12	46.69	Average	54	Pass
NVNT	ac20	5700	Ant0	5735	-46.3	2.97	-	51.90	Peak	68.2	Pass
NVNT	ac20	5700	Ant0	5735	-56.83	2.97	0.12	41.49	Average	54	Pass
NVNT	ac40	5510	Ant0	5460	-49.21	2.97	-	48.99	Peak	68.2	Pass
NVNT	ac40	5510	Ant0	5460	-57.3	2.97	0.12	41.02	Average	54	Pass
NVNT	ac40	5510	Ant0	5467	-37.86	2.97	-	60.34	Peak	68.2	Pass
NVNT	ac40	5510	Ant0	5470	-53.77	2.97	0.12	44.55	Average	54	Pass
NVNT	ac40	5510	Ant0	5470	-44.9	2.97	-	53.30	Peak	68.2	Pass
NVNT	ac40	5510	Ant0	5470	-53.77	2.97	0.12	44.55	Average	54	Pass
NVNT	ac40	5670	Ant0	5725	-45.73	2.97	-	52.47	Peak	68.2	Pass
NVNT	ac40	5670	Ant0	5725	-54.63	2.97	0.12	43.69	Average	54	Pass
NVNT	ac40	5670	Ant0	5731.2	-44.06	2.97	-	54.14	Peak	68.2	Pass
NVNT	ac40	5670	Ant0	5725	-54.63	2.97	0.12	43.69	Average	54	Pass
NVNT	ac40	5670	Ant0	5735	-48.51	2.97	-	49.69	Peak	68.2	Pass
NVNT	ac40	5670	Ant0	5735	-56.06	2.97	0.12	42.26	Average	54	Pass
NVNT	ax20	5500	Ant0	5460	-50.77	2.97	-	47.43	Peak	68.2	Pass
NVNT	ax20	5500	Ant0	5460	-58.15	2.97	0.12	40.17	Average	54	Pass
NVNT	ax20	5500	Ant0	5468	-44.02	2.97	-	54.18	Peak	68.2	Pass
NVNT	ax20	5500	Ant0	5469.2	-56.28	2.97	0.12	42.04	Average	54	Pass
NVNT	ax20	5500	Ant0	5470	-45.16	2.97	-	53.04	Peak	68.2	Pass
NVNT	ax20	5500	Ant0	5470	-56.52	2.97	0.12	41.80	Average	54	Pass
NVNT	ax20	5700	Ant0	5725	-39.02	2.97	-	59.18	Peak	68.2	Pass
NVNT	ax20	5700	Ant0	5725	-53.09	2.97	0.12	45.23	Average	54	Pass
NVNT	ax20	5700	Ant0	5728.8	-37.1	2.97	-	61.10	Peak	68.2	Pass
NVNT	ax20	5700	Ant0	5727.2	-52.96	2.97	0.12	45.36	Average	54	Pass
NVNT	ax20	5700	Ant0	5735	-48.43	2.97	-	49.77	Peak	68.2	Pass
NVNT	ax20	5700	Ant0	5735	-57.14	2.97	0.12	41.18	Average	54	Pass
NVNT	ax40	5510	Ant0	5460	-49.18	2.97	-	49.02	Peak	68.2	Pass
NVNT	ax40	5510	Ant0	5460	-57.39	2.97	0.12	40.93	Average	54	Pass
NVNT	ax40	5510	Ant0	5469.4	-35.15	2.97	-	63.05	Peak	68.2	Pass
NVNT	ax40	5510	Ant0	5469.8	-53.15	2.97	0.12	45.17	Average	54	Pass
NVNT	ax40	5510	Ant0	5470	-42.94	2.97	-	55.26	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5510	Ant0	5470	-53.73	2.97	0.12	44.59	Average	54	Pass
NVNT	ax40	5670	Ant0	5725	-46.88	2.97	-	51.32	Peak	68.2	Pass
NVNT	ax40	5670	Ant0	5725	-54.94	2.97	0.12	43.38	Average	54	Pass
NVNT	ax40	5670	Ant0	5732.8	-43.93	2.97	-	54.27	Peak	68.2	Pass
NVNT	ax40	5670	Ant0	5726.4	-54.62	2.97	0.12	43.70	Average	54	Pass
NVNT	ax40	5670	Ant0	5735	-48.88	2.97	-	49.32	Peak	68.2	Pass
NVNT	ax40	5670	Ant0	5735	-56.22	2.97	0.12	42.10	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5500MHz Ant0 Peak



Restrict Band NVNT a 5500MHz Ant0 Average

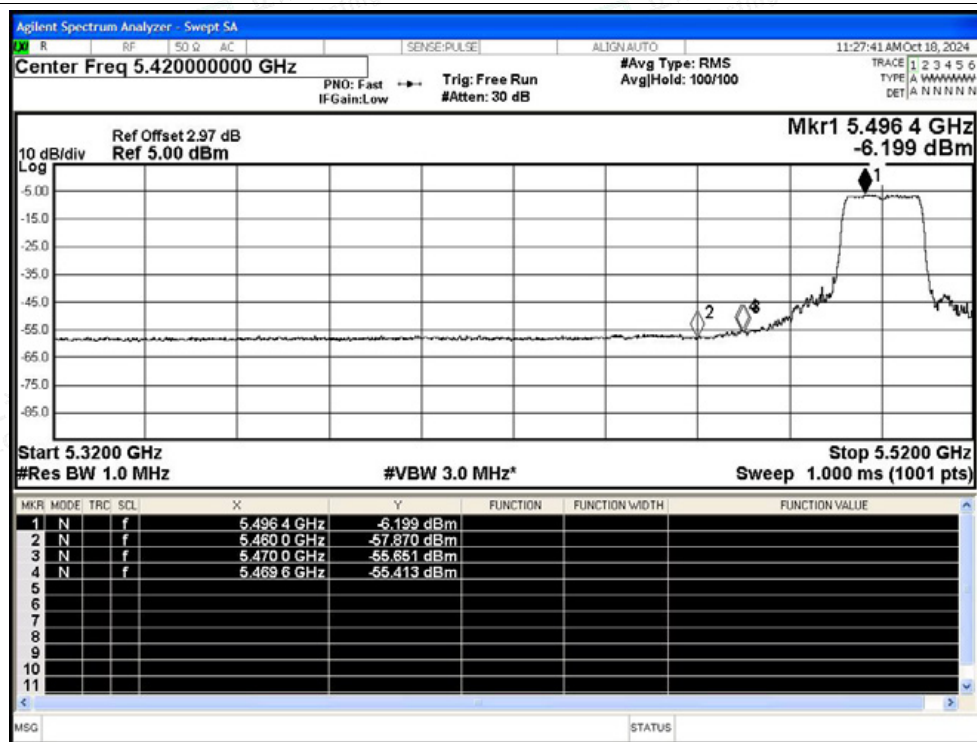

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant0 Peak

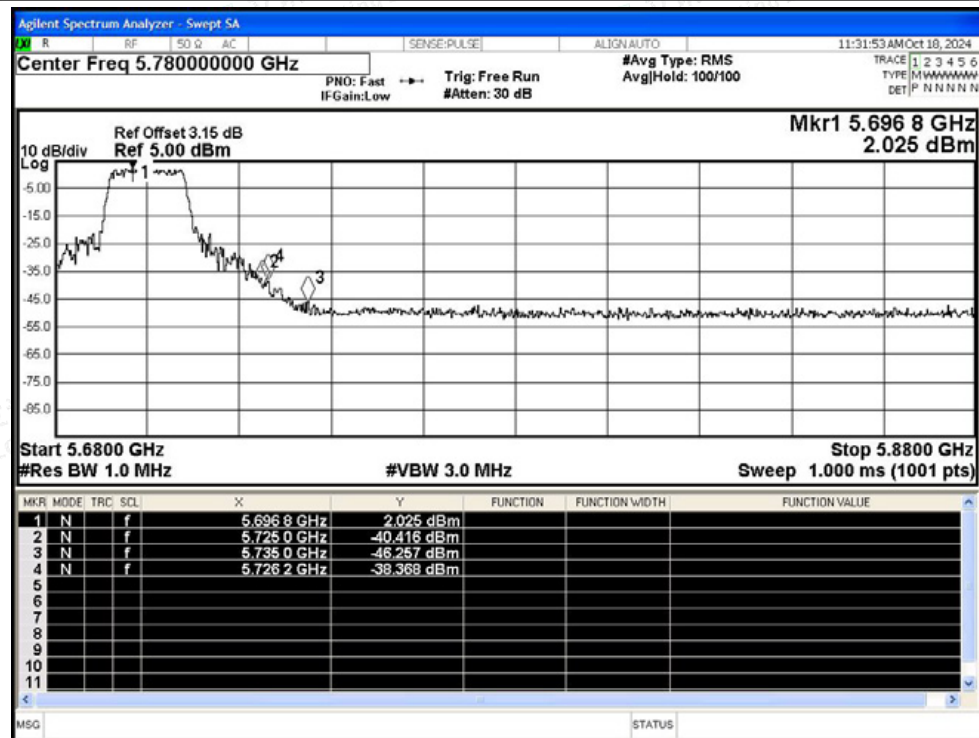


Restrict Band NVNT a 5700MHz Ant0 Average

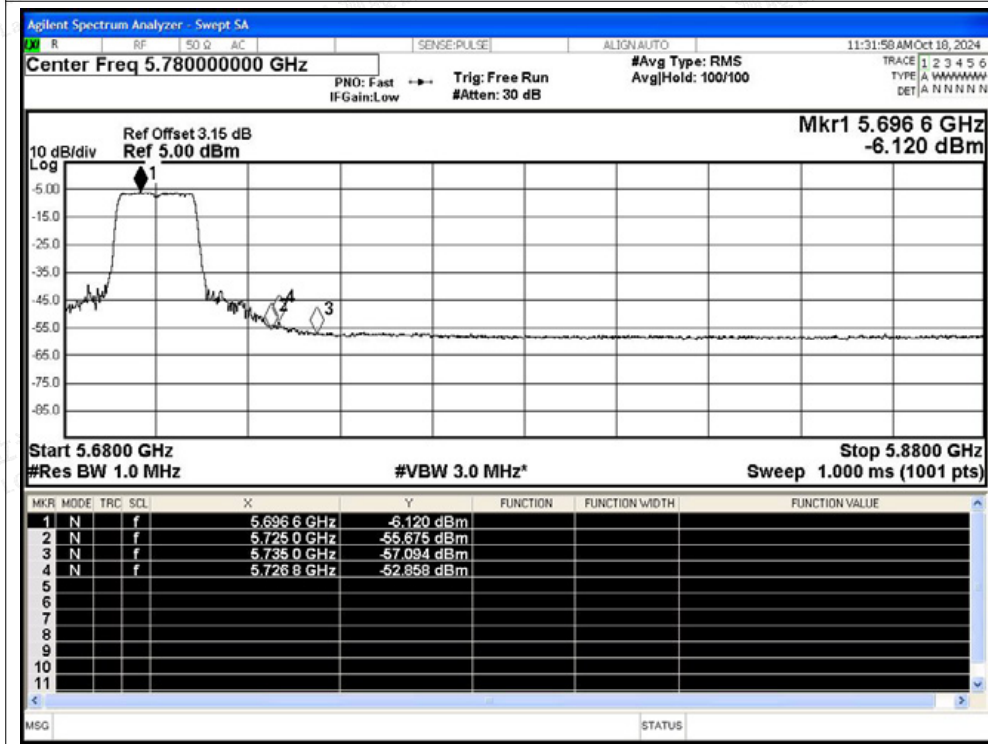




Restrict Band NVNT n20 5500MHz Ant0 Peak

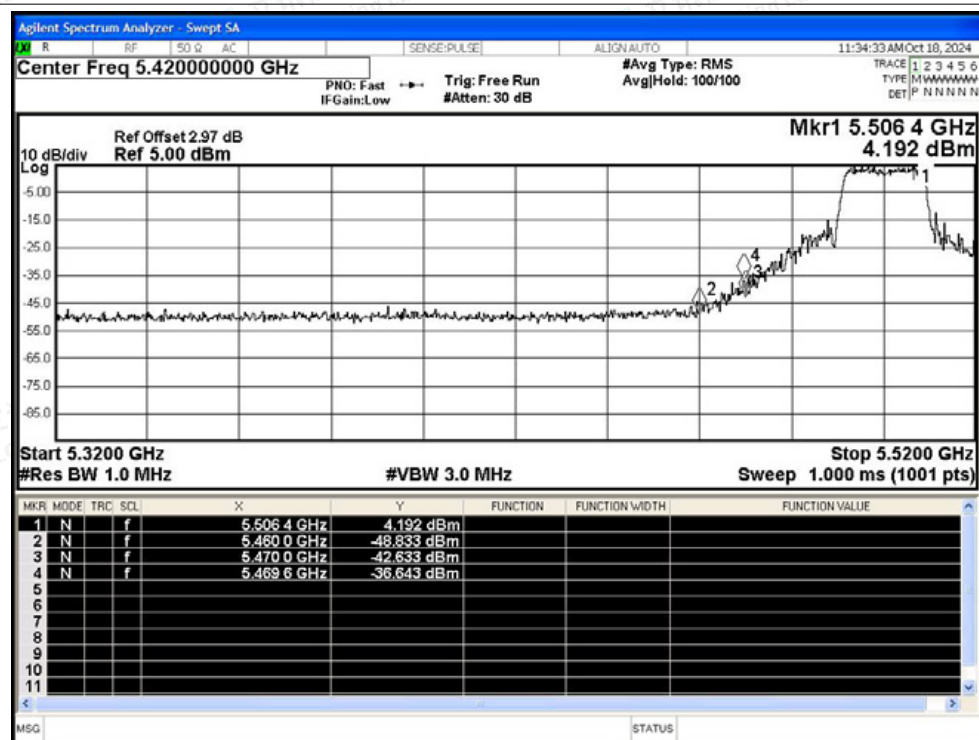

Restrict Band NVNT n20 5500MHz Ant0 Average

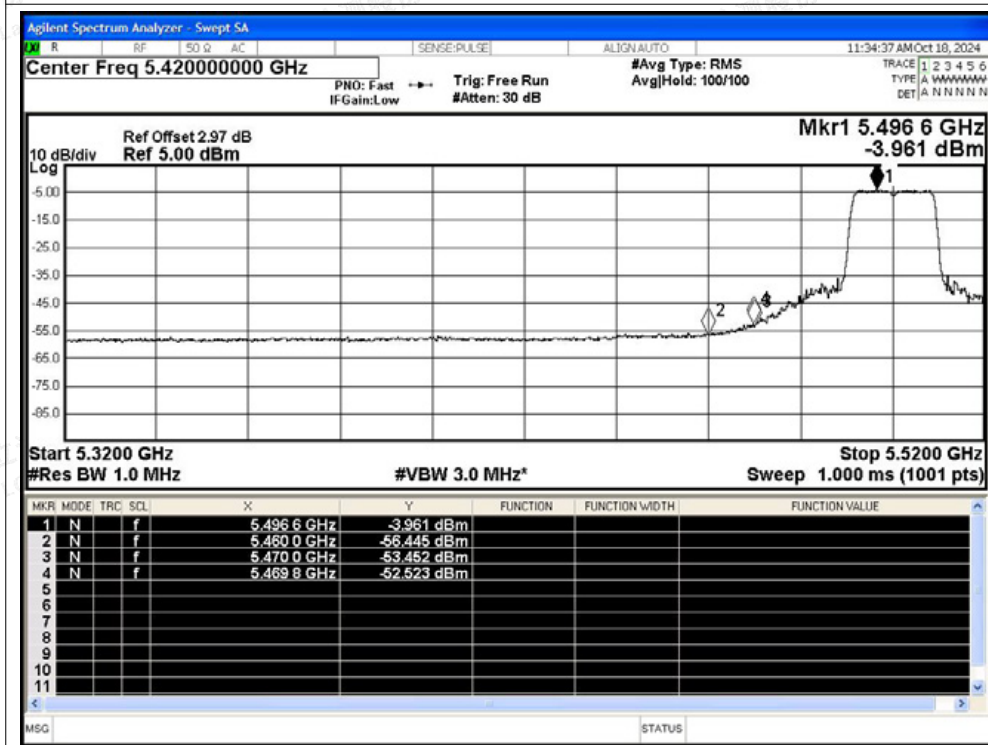

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant0 Peak

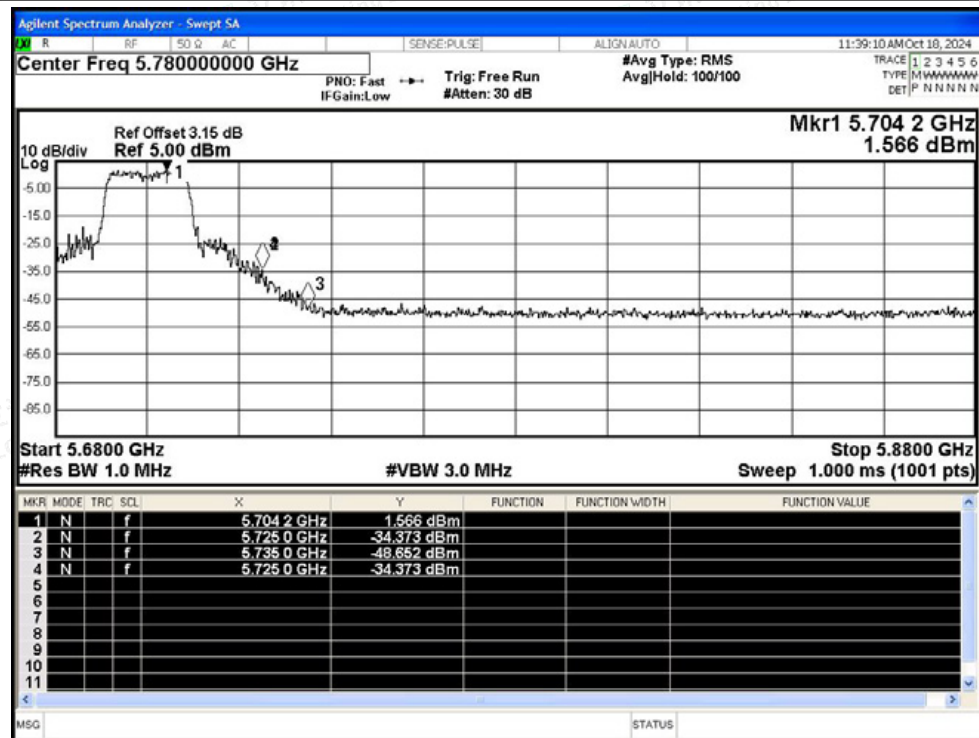


Restrict Band NVNT n20 5700MHz Ant0 Average

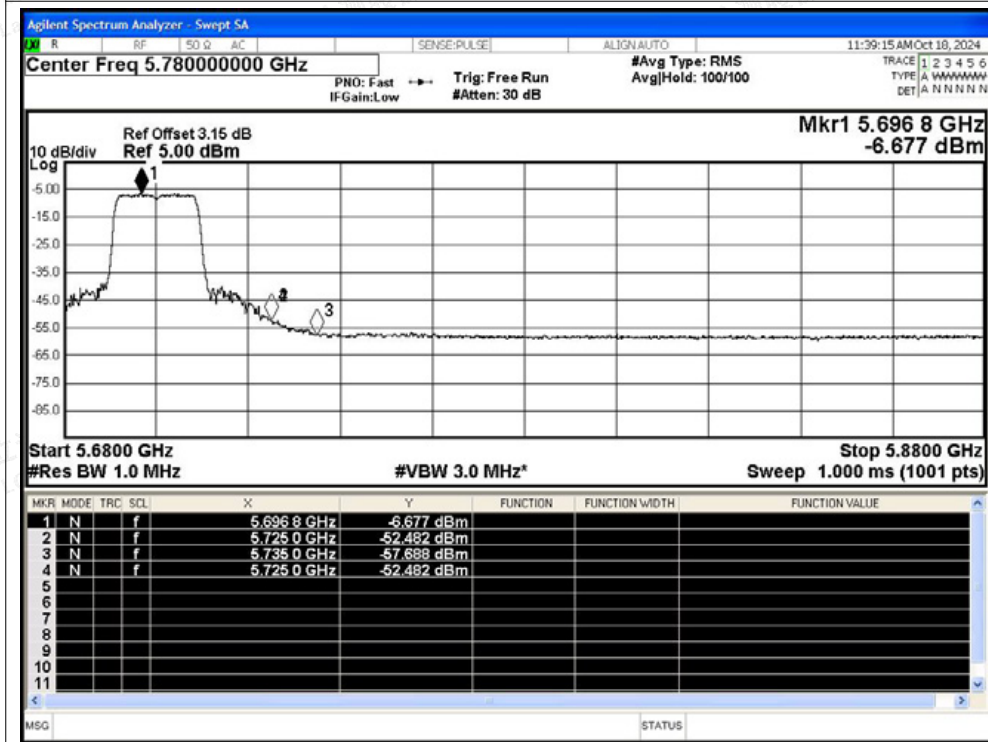




Restrict Band NVNT n40 5510MHz Ant0 Peak

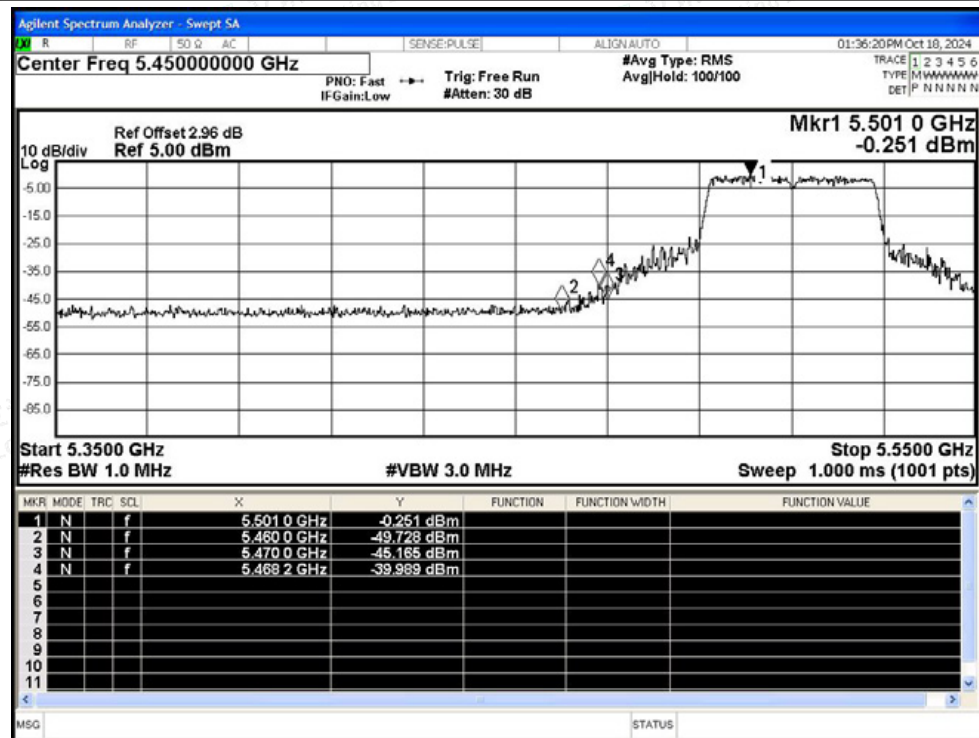


Restrict Band NVNT n40 5510MHz Ant0 Average

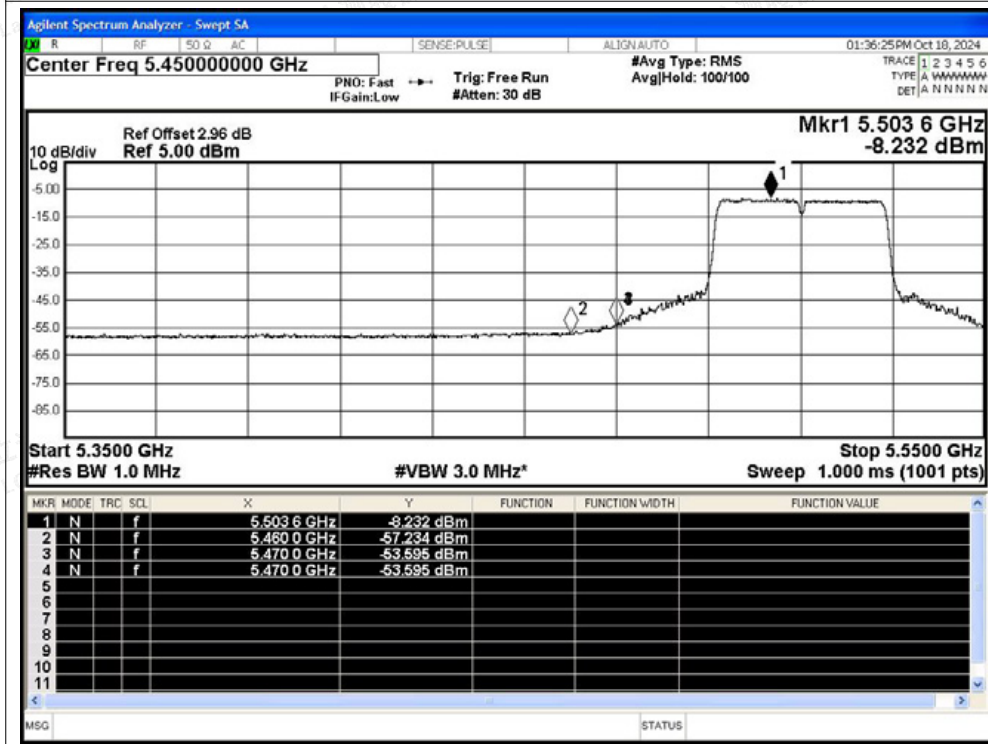




Restrict Band NVNT n40 5670MHz Ant0 Peak

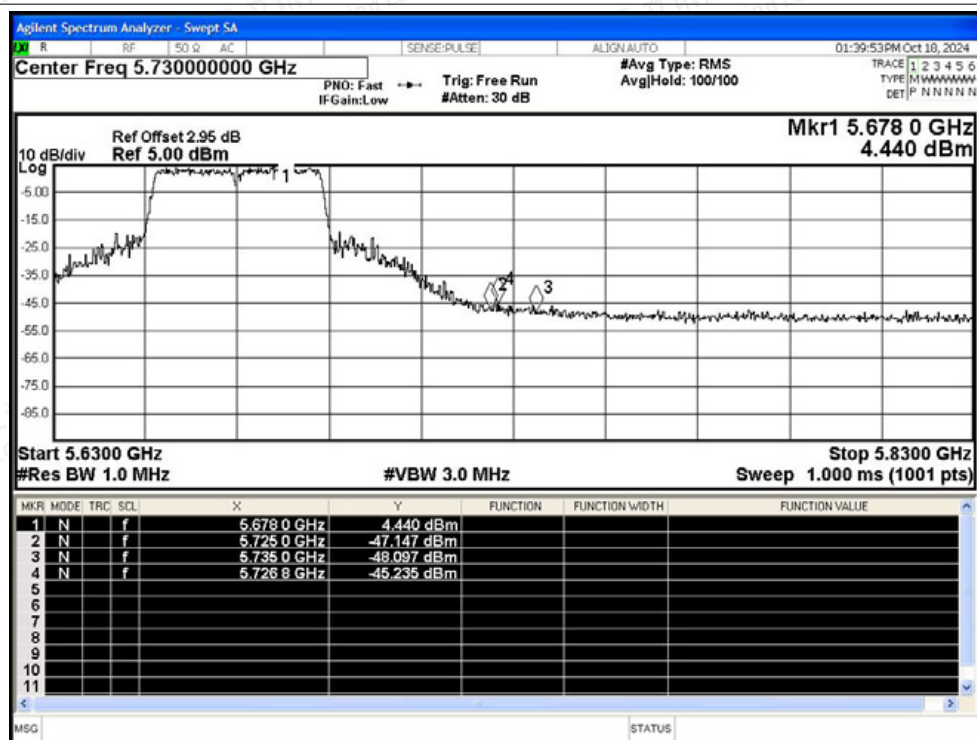

Restrict Band NVNT n40 5670MHz Ant0 Average

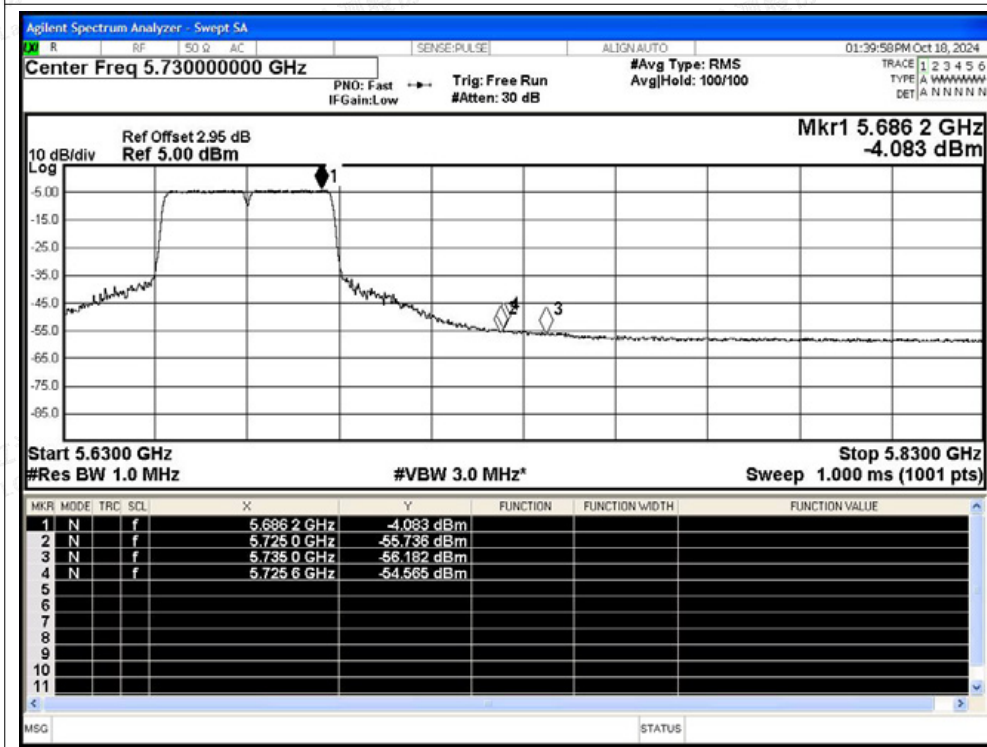

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant0 Peak

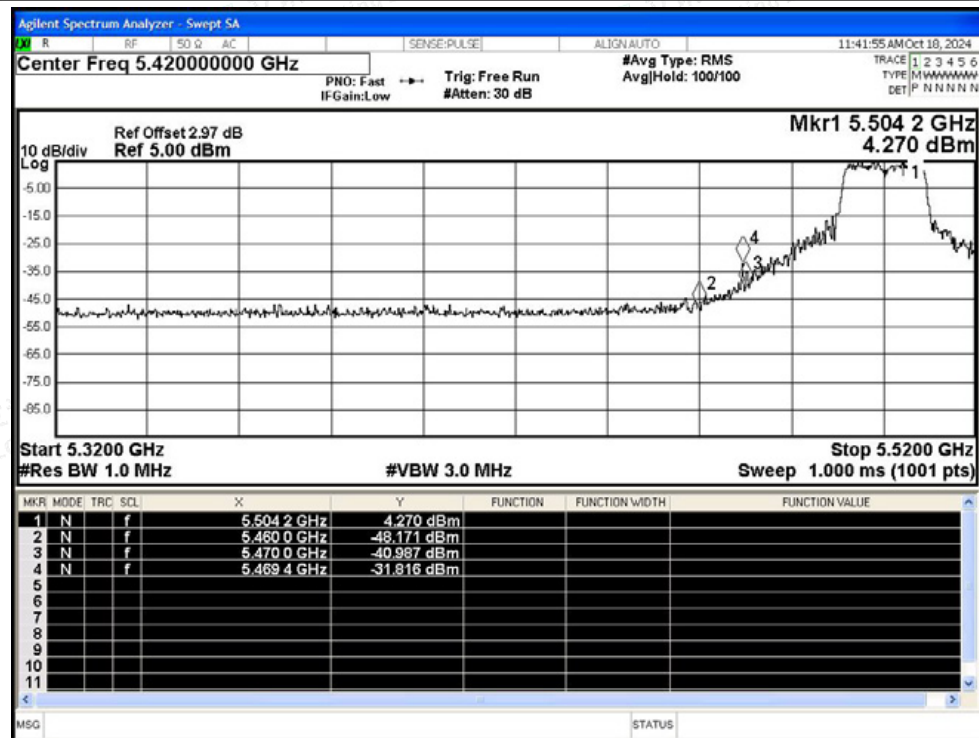


Restrict Band NVNT ac20 5500MHz Ant0 Average

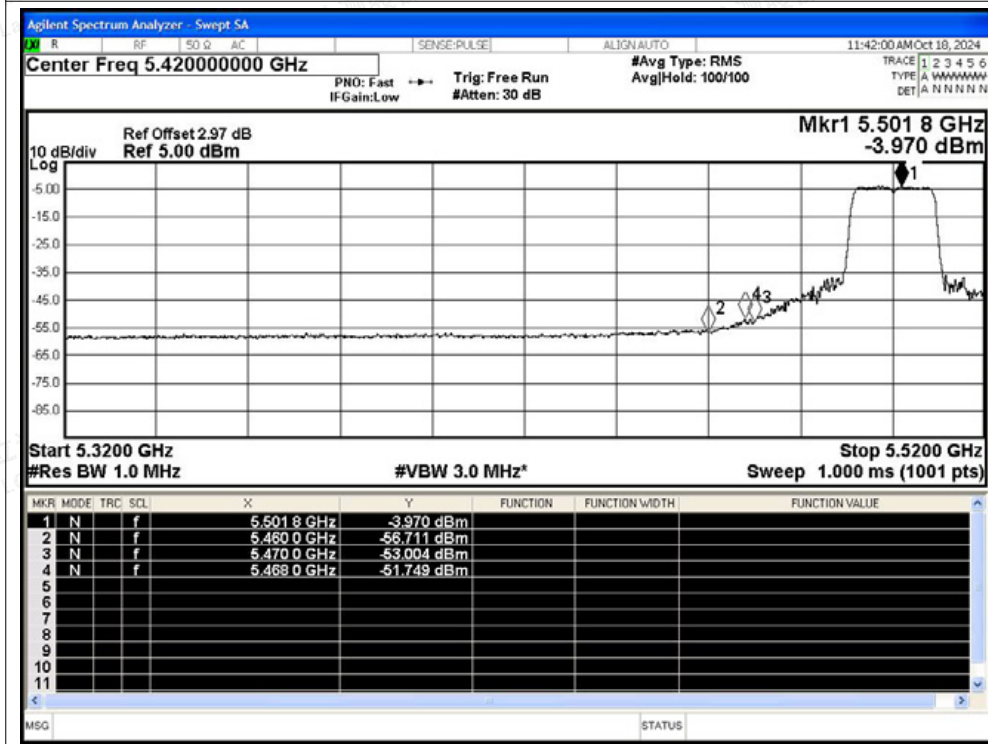




Restrict Band NVNT ac20 5700MHz Ant0 Peak

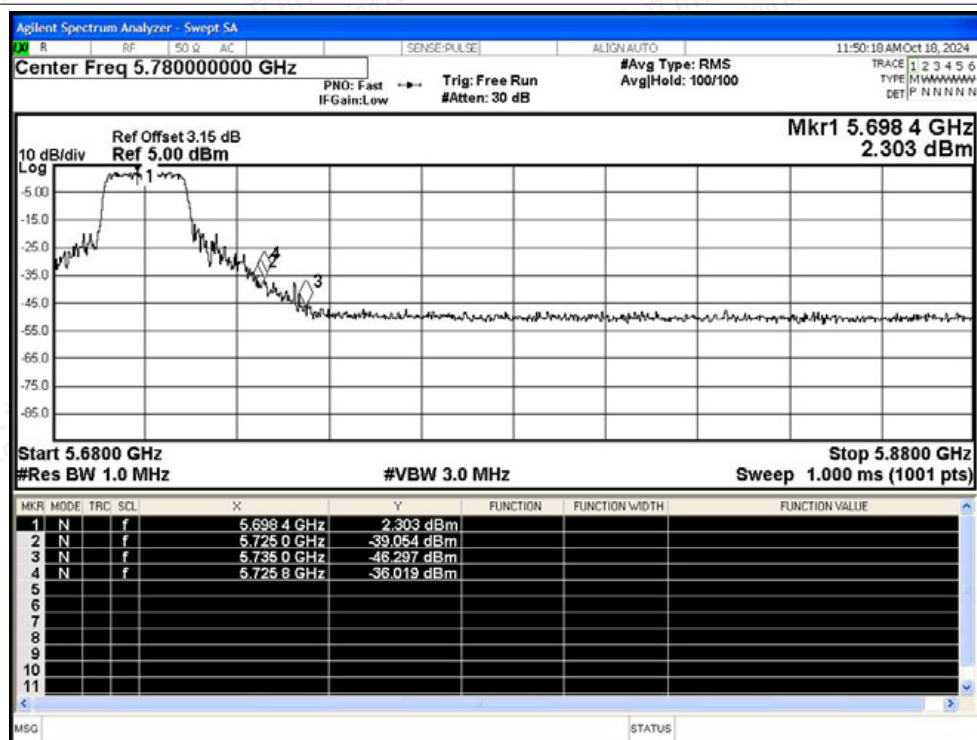

Restrict Band NVNT ac20 5700MHz Ant0 Average

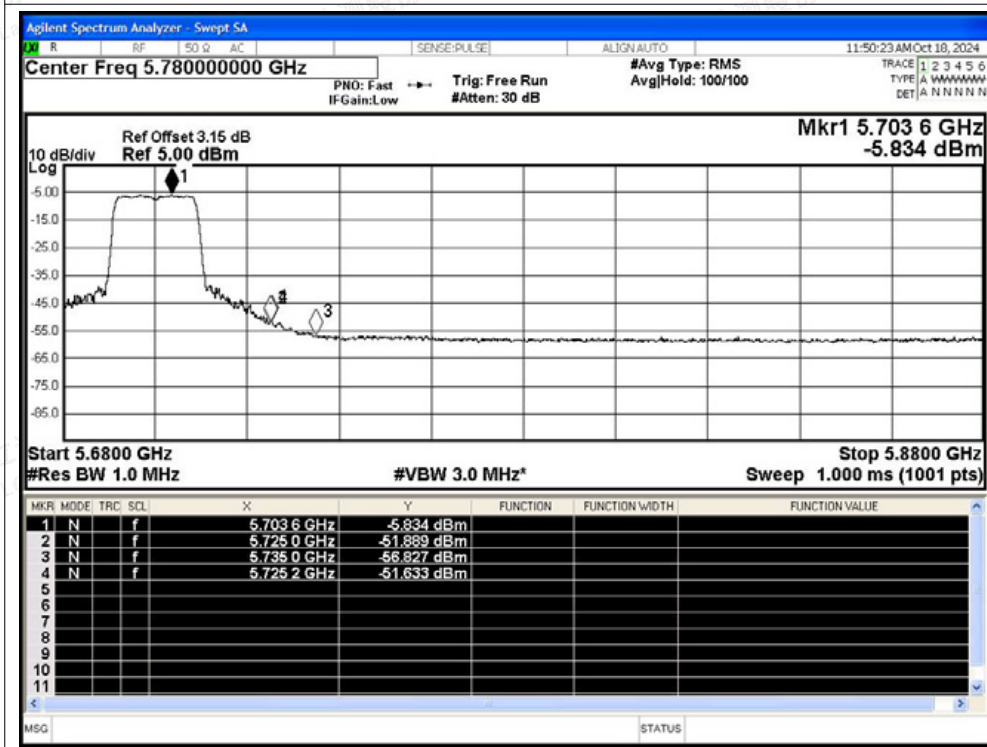

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant0 Peak

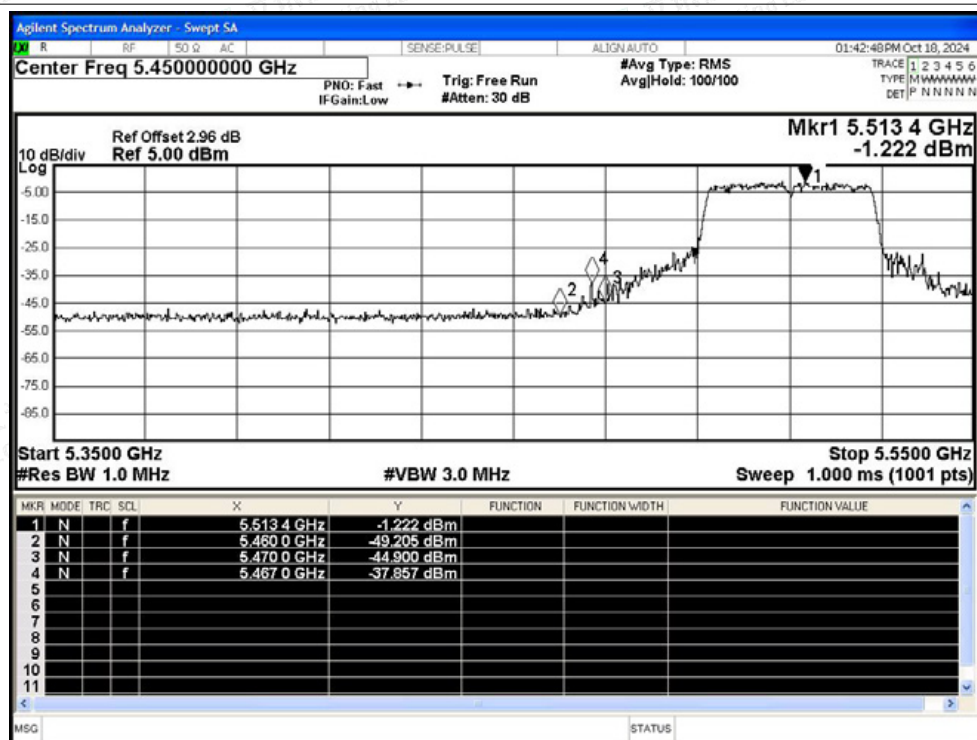

Restrict Band NVNT ac40 5510MHz Ant0 Average

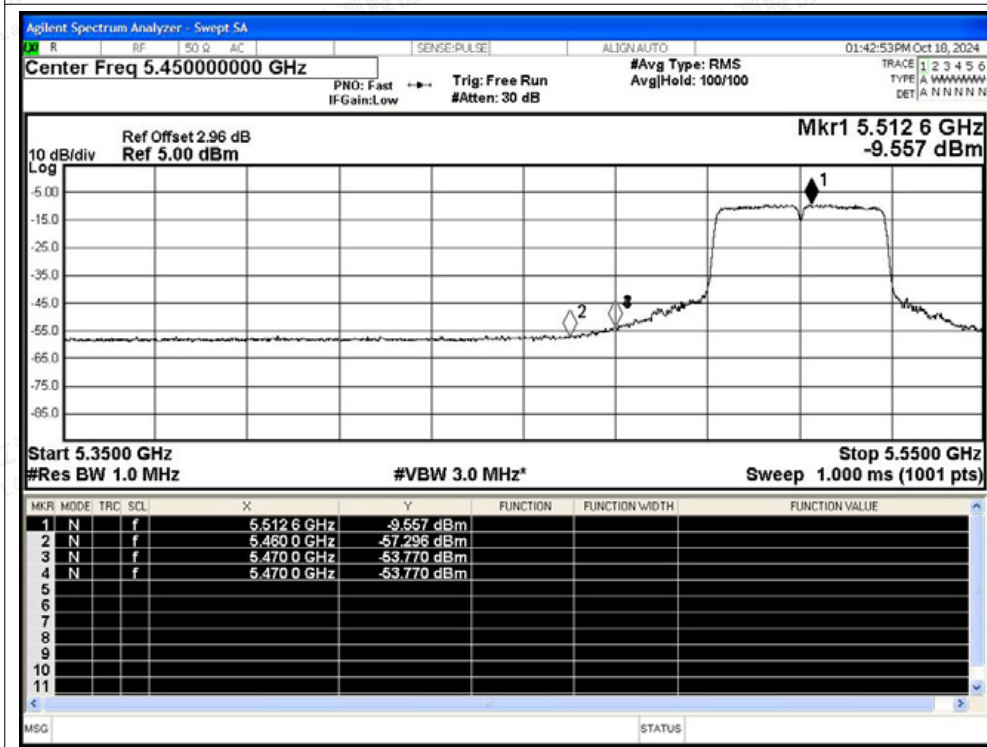

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant0 Peak

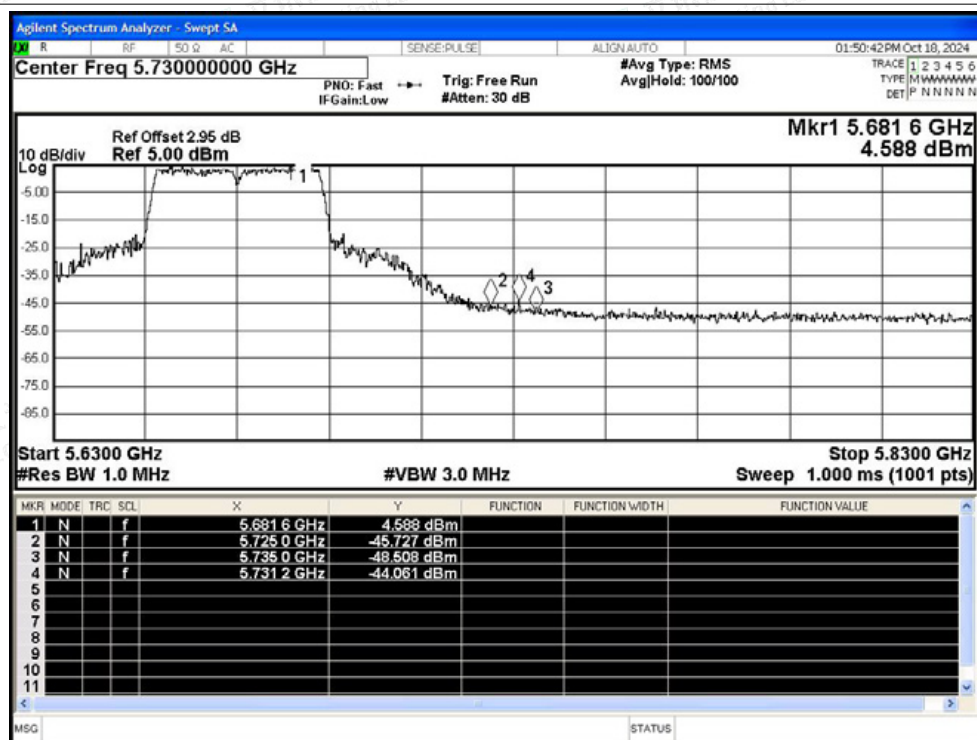

Restrict Band NVNT ac40 5670MHz Ant0 Average

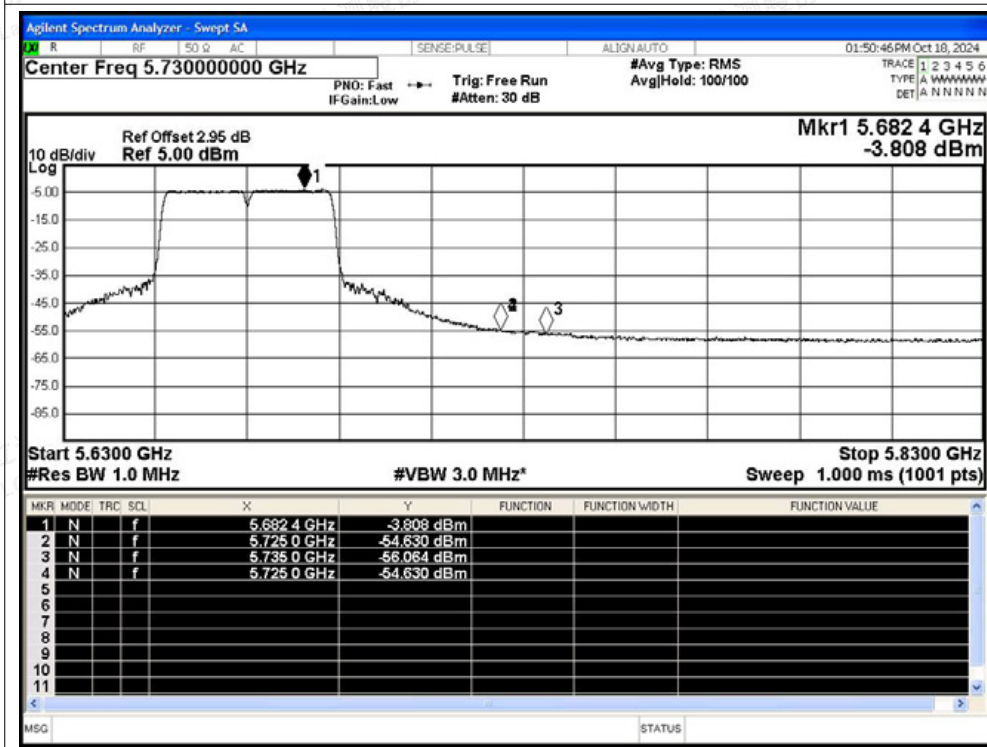

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Restrict Band NVNT ax20 5500MHz Ant0 Peak



Restrict Band NVNT ax20 5500MHz Ant0 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5700MHz Ant0 Peak

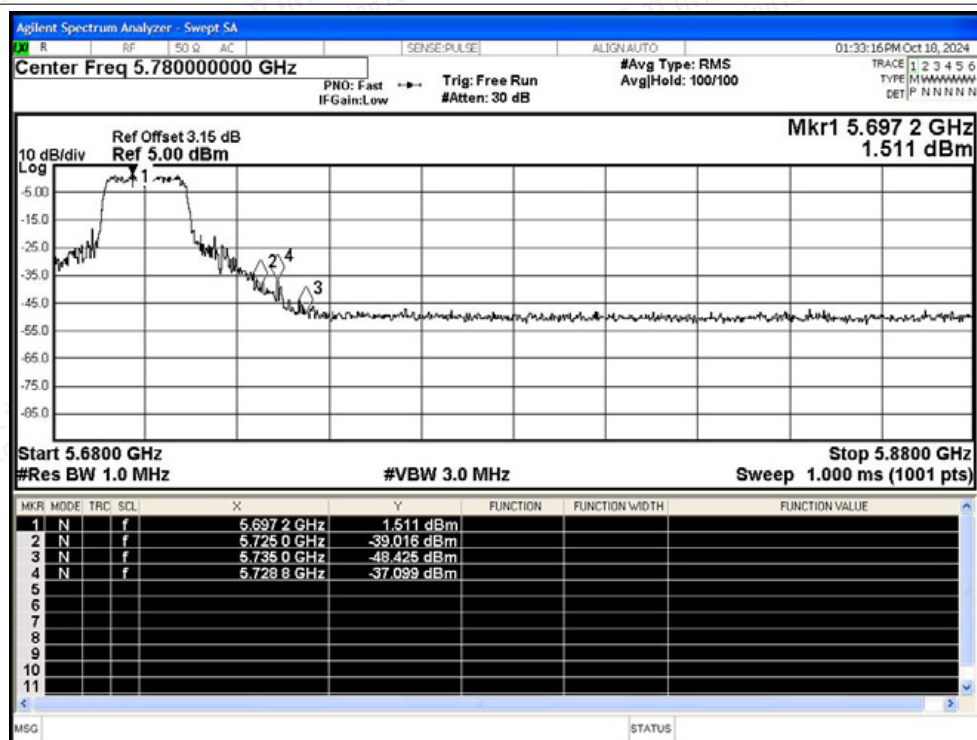

Restrict Band NVNT ax20 5700MHz Ant0 Average

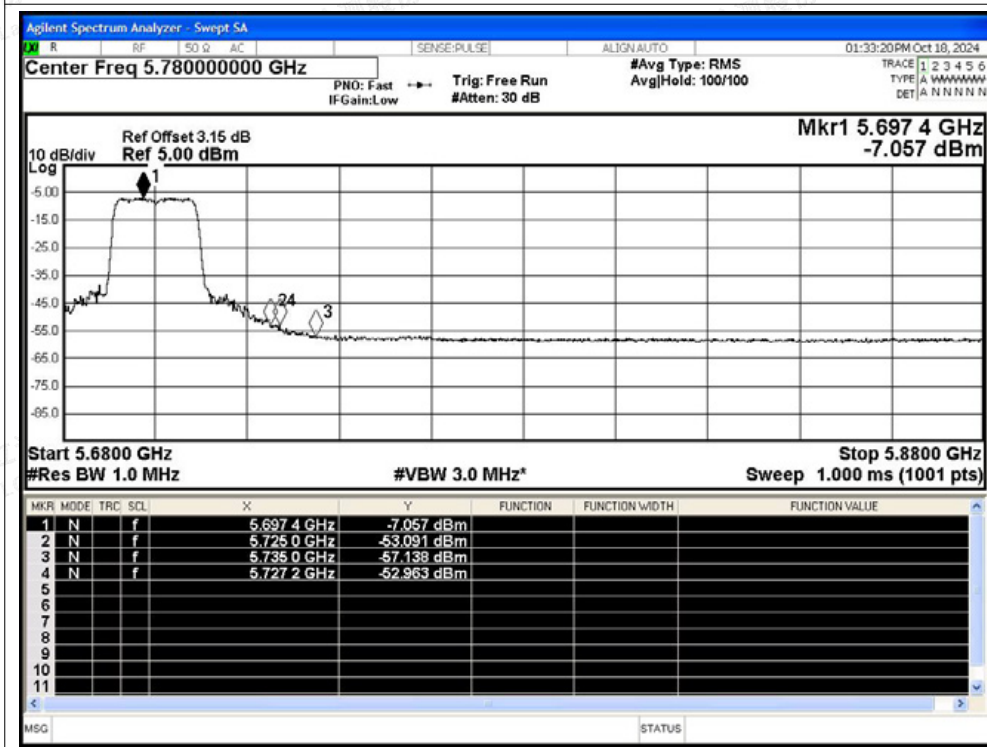

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5510MHz Ant0 Peak

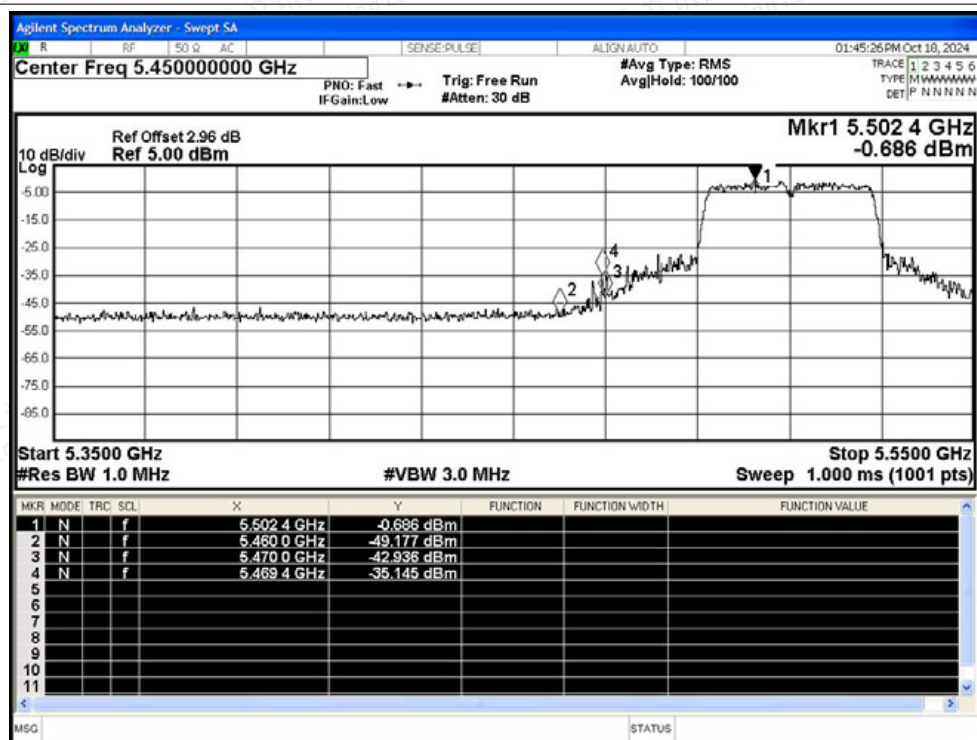

Restrict Band NVNT ax40 5510MHz Ant0 Average

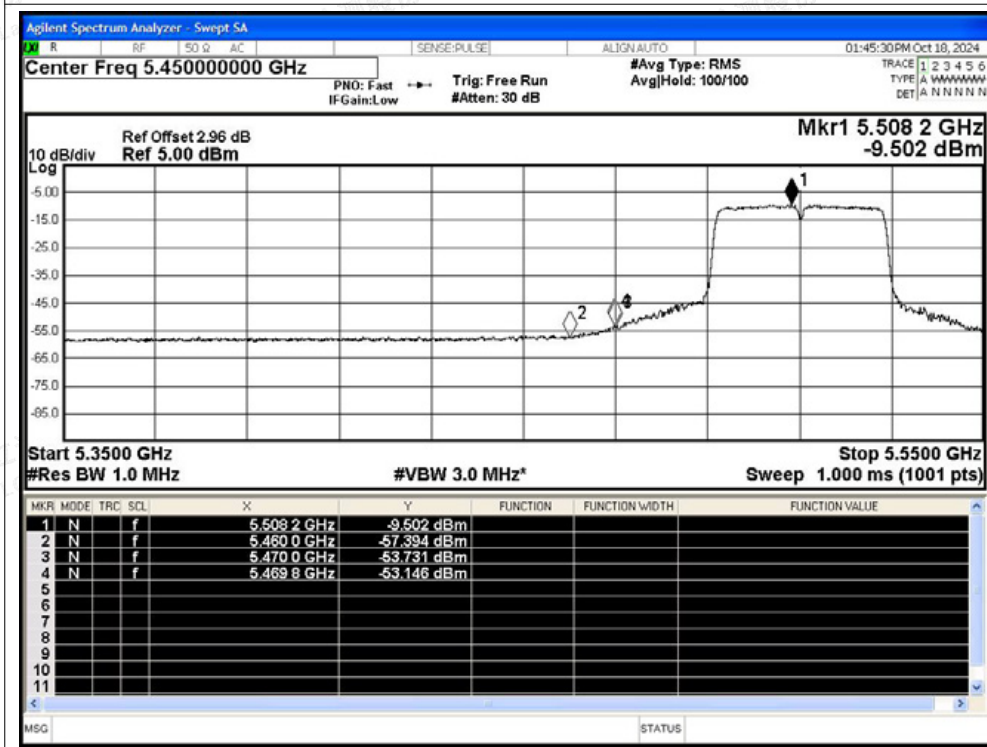

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5670MHz Ant0 Peak

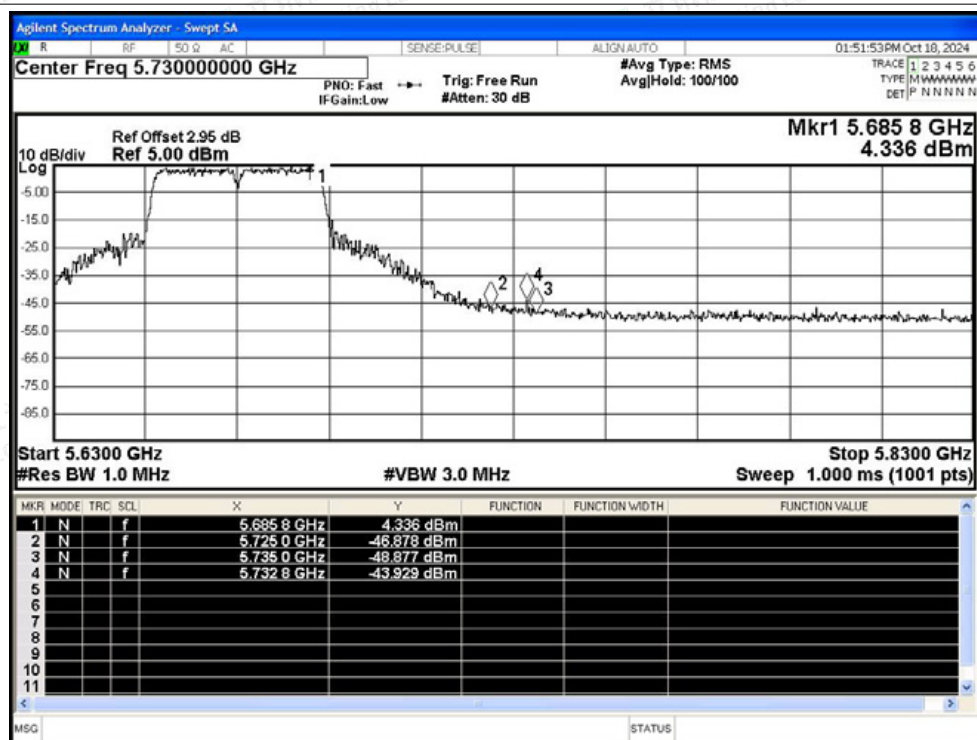

Restrict Band NVNT ax40 5670MHz Ant0 Average

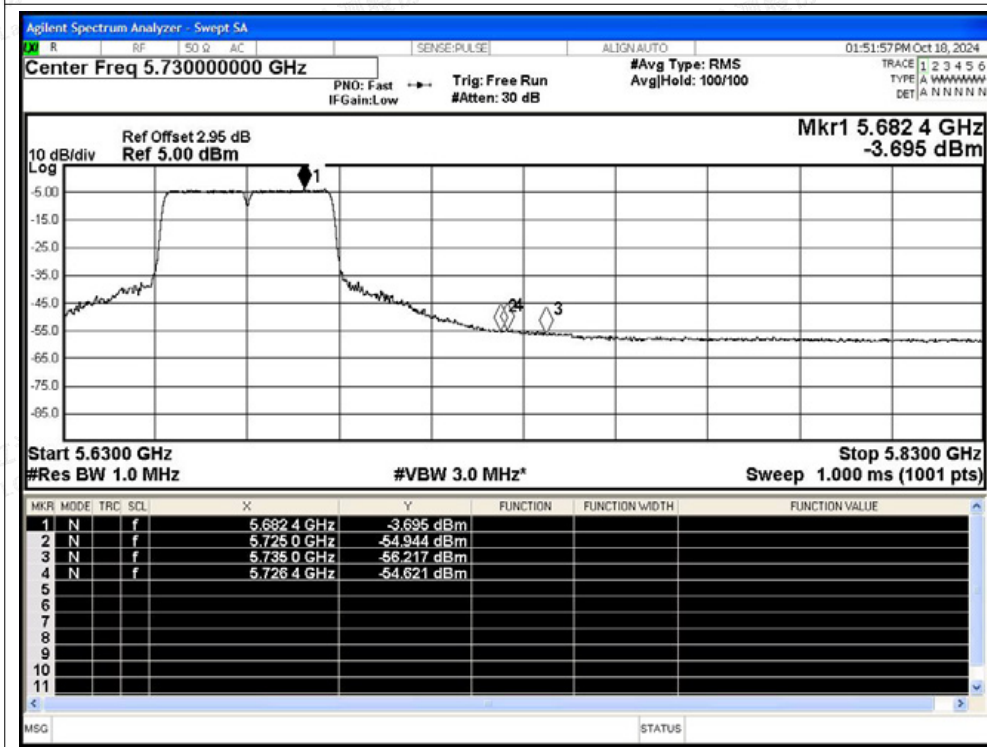

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant1	5460	-48.53	2.97	-	49.67	Peak	68.2	Pass
NVNT	a	5500	Ant1	5460	-57	2.97	0	41.20	Average	54	Pass
NVNT	a	5500	Ant1	5467.6	-38.07	2.97	-	60.13	Peak	68.2	Pass
NVNT	a	5500	Ant1	5469.8	-53.87	2.97	0	44.33	Average	54	Pass
NVNT	a	5500	Ant1	5470	-39.28	2.97	-	58.92	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-54.68	2.97	0	43.52	Average	54	Pass
NVNT	a	5700	Ant1	5725	-44.55	2.97	-	53.65	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-55.3	2.97	0.24	43.14	Average	54	Pass
NVNT	a	5700	Ant1	5725.4	-38.61	2.97	-	59.59	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725.6	-53.68	2.97	0.24	44.76	Average	54	Pass
NVNT	a	5700	Ant1	5735	-50.14	2.97	-	48.06	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-56.89	2.97	0.24	41.55	Average	54	Pass
NVNT	n20	5500	Ant1	5460	-48.15	2.97	-	50.05	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5460	-56.58	2.97	0.12	41.74	Average	54	Pass
NVNT	n20	5500	Ant1	5469.8	-39.82	2.97	-	58.38	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5469.4	-53.68	2.97	0.12	44.64	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-41.57	2.97	-	56.63	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-54.47	2.97	0.12	43.85	Average	54	Pass
NVNT	n20	5700	Ant1	5725	-39.72	2.97	-	58.48	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-54.45	2.97	0.12	43.87	Average	54	Pass
NVNT	n20	5700	Ant1	5728	-36.19	2.97	-	62.01	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725.8	-51.65	2.97	0.12	46.67	Average	54	Pass
NVNT	n20	5700	Ant1	5735	-48.23	2.97	-	49.97	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5735	-56.87	2.97	0.12	41.45	Average	54	Pass
NVNT	n40	5510	Ant1	5460	-48.04	2.97	-	50.16	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5460	-57.39	2.97	0.12	40.93	Average	54	Pass
NVNT	n40	5510	Ant1	5467.4	-39.8	2.97	-	58.40	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5469.8	-53.61	2.97	0.12	44.71	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-42.25	2.97	-	55.95	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-53.91	2.97	0.12	44.41	Average	54	Pass
NVNT	n40	5670	Ant1	5725	-47.82	2.97	-	50.38	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-55.91	2.97	0.12	42.41	Average	54	Pass
NVNT	n40	5670	Ant1	5728.6	-47.31	2.97	-	50.89	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5727.2	-55.72	2.97	0.12	42.60	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-47.58	2.97	-	50.62	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5735	-57.55	2.97	0.12	40.77	Average	54	Pass
NVNT	ac20	5500	Ant1	5460	-50.71	2.97	-	47.49	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant1	5460	-57.97	2.97	0.12	40.35	Average	54	Pass
NVNT	ac20	5500	Ant1	5468	-43.59	2.97	-	54.61	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-54.78	2.97	0.12	43.54	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-45.36	2.97	-	52.84	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-54.78	2.97	0.12	43.54	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-38.12	2.97	-	60.08	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-52.26	2.97	0.12	46.06	Average	54	Pass
NVNT	ac20	5700	Ant1	5726	-36.15	2.97	-	62.05	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5726.2	-51.83	2.97	0.12	46.49	Average	54	Pass
NVNT	ac20	5700	Ant1	5735	-46.86	2.97	-	51.34	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-57.3	2.97	0.12	41.02	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-47.56	2.97	-	50.64	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-57.09	2.97	0.12	41.23	Average	54	Pass
NVNT	ac40	5510	Ant1	5469.4	-40.31	2.97	-	57.89	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5469	-53.51	2.97	0.12	44.81	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-42.63	2.97	-	55.57	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-54.41	2.97	0.12	43.91	Average	54	Pass
NVNT	ac40	5670	Ant1	5725	-47.04	2.97	-	51.16	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-55.7	2.97	0.12	42.62	Average	54	Pass
NVNT	ac40	5670	Ant1	5725.4	-45.77	2.97	-	52.43	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5728	-55.51	2.97	0.12	42.81	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-50.02	2.97	-	48.18	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-57.26	2.97	0.12	41.06	Average	54	Pass
NVNT	ax20	5500	Ant1	5460	-49.1	2.97	-	49.10	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5460	-57.04	2.97	0.12	41.28	Average	54	Pass
NVNT	ax20	5500	Ant1	5468.8	-37.95	2.97	-	60.25	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5470	-51.66	2.97	0.12	46.66	Average	54	Pass
NVNT	ax20	5500	Ant1	5470	-39.98	2.97	-	58.22	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5470	-51.66	2.97	0.12	46.66	Average	54	Pass
NVNT	ax20	5700	Ant1	5725	-39.4	2.97	-	58.80	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725	-52.41	2.97	0.12	45.91	Average	54	Pass
NVNT	ax20	5700	Ant1	5725.4	-37.16	2.97	-	61.04	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725	-52.41	2.97	0.12	45.91	Average	54	Pass
NVNT	ax20	5700	Ant1	5735	-49.19	2.97	-	49.01	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5735	-57.35	2.97	0.12	40.97	Average	54	Pass
NVNT	ax40	5510	Ant1	5460	-48.61	2.97	-	49.59	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5460	-56.74	2.97	0.12	41.58	Average	54	Pass
NVNT	ax40	5510	Ant1	5470	-40.87	2.97	-	57.33	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5468.6	-53.68	2.97	0.12	44.64	Average	54	Pass
NVNT	ax40	5510	Ant1	5470	-40.87	2.97	-	57.33	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5470	-54.05	2.97	0.12	44.27	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax40	5670	Ant1	5725	-48.01	2.97	-	50.19	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5725	-56.25	2.97	0.12	42.07	Average	54	Pass
NVNT	ax40	5670	Ant1	5731.8	-46.08	2.97	-	52.12	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5727	-55.56	2.97	0.12	42.76	Average	54	Pass
NVNT	ax40	5670	Ant1	5735	-49.52	2.97	-	48.68	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5735	-57.18	2.97	0.12	41.14	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5500MHz Ant1 Peak

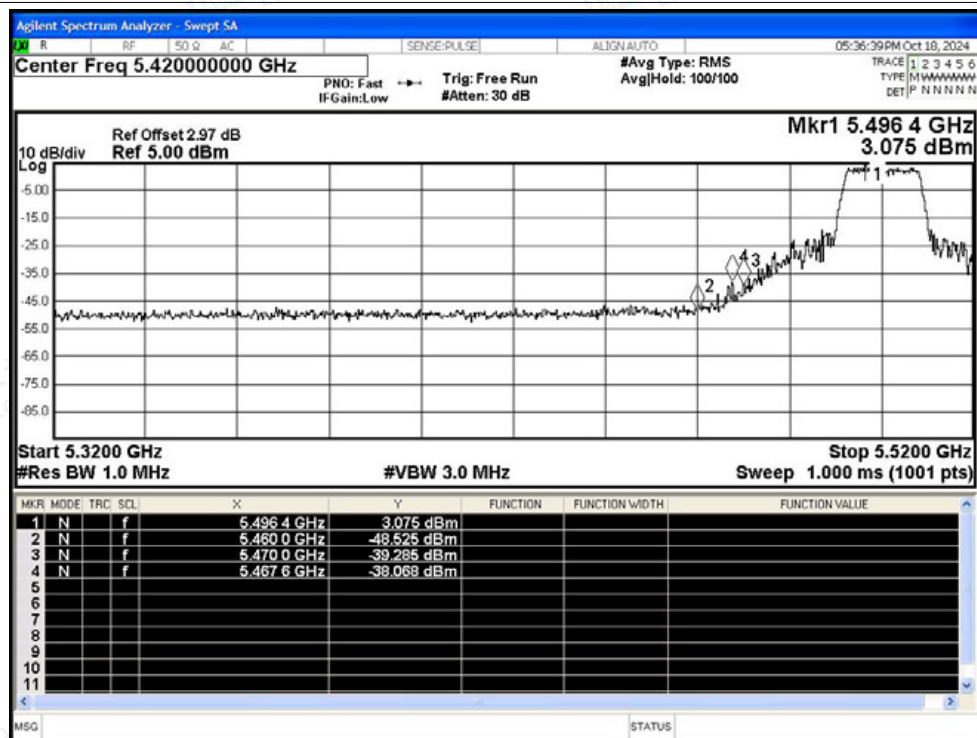

Restrict Band NVNT a 5500MHz Ant1 Average

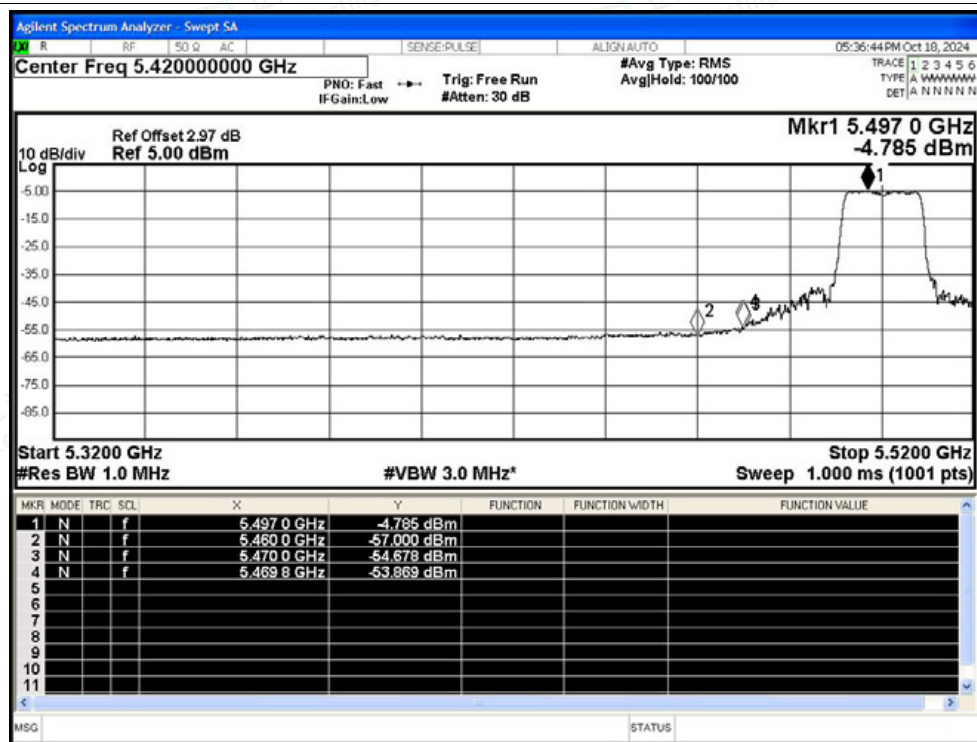

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant1 Peak

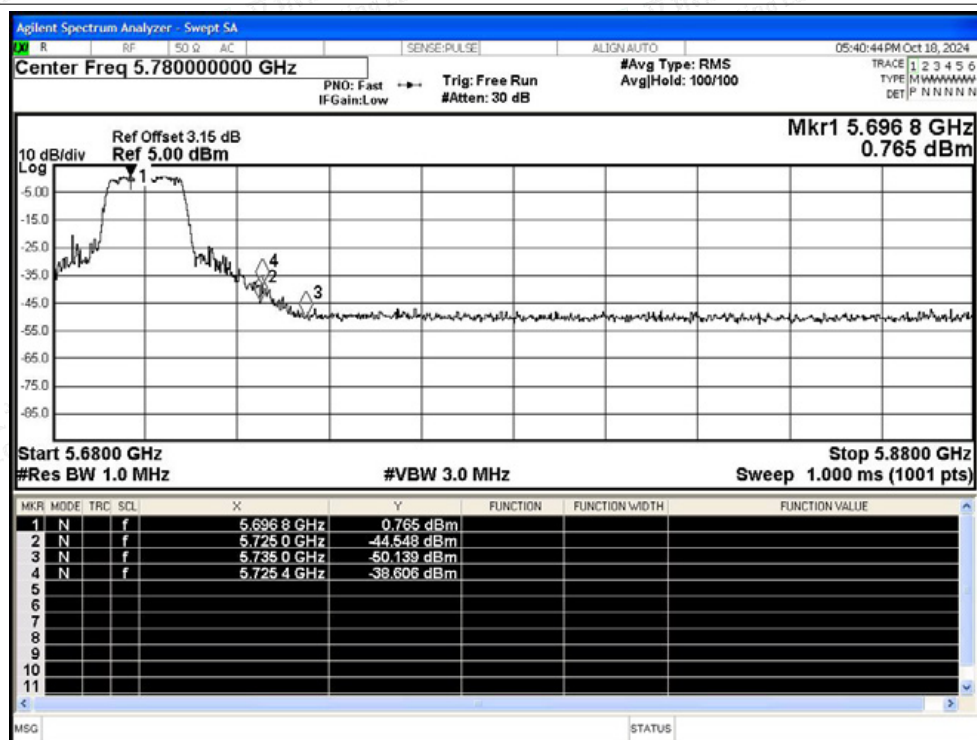

Restrict Band NVNT a 5700MHz Ant1 Average

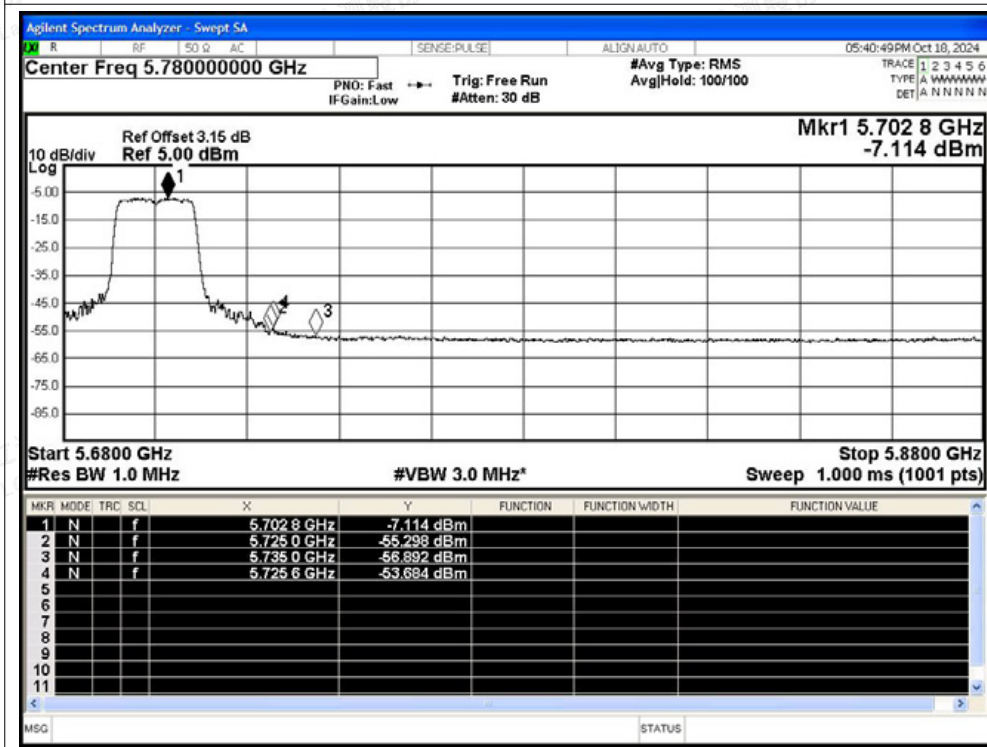

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant1 Peak



Restrict Band NVNT n20 5500MHz Ant1 Average

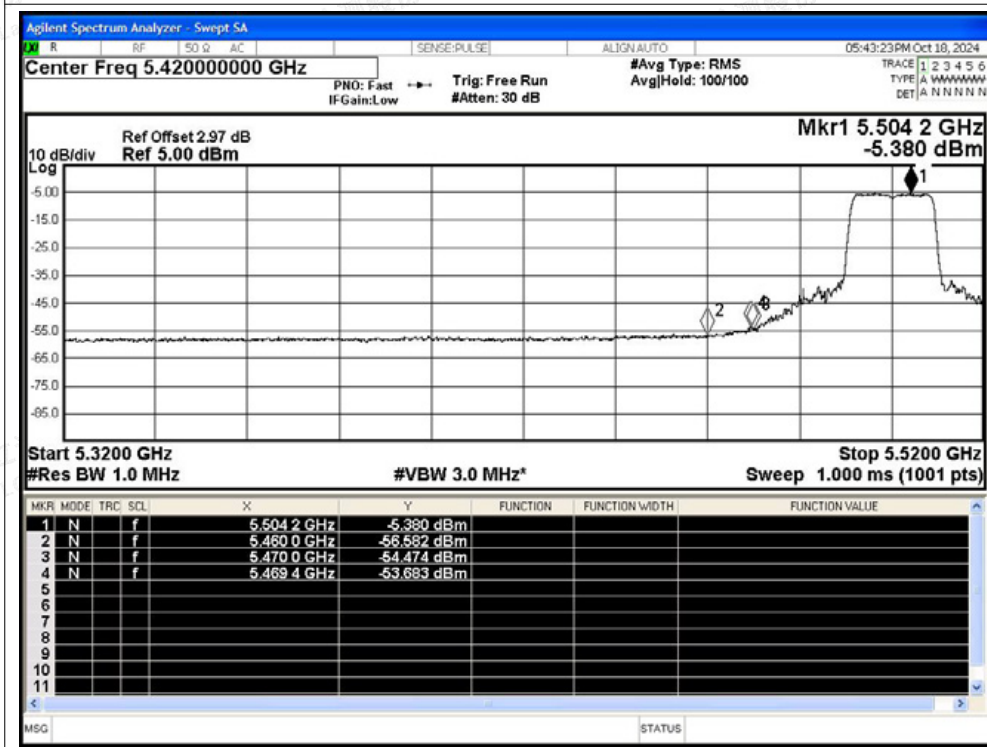

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant1 Peak

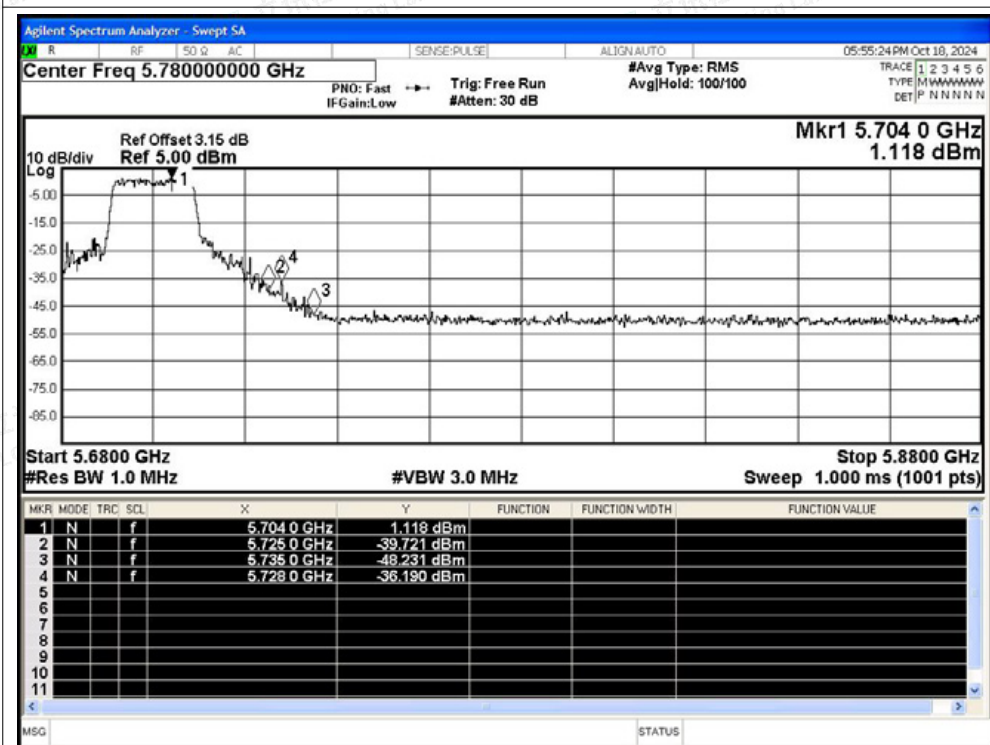

Restrict Band NVNT n20 5700MHz Ant1 Average

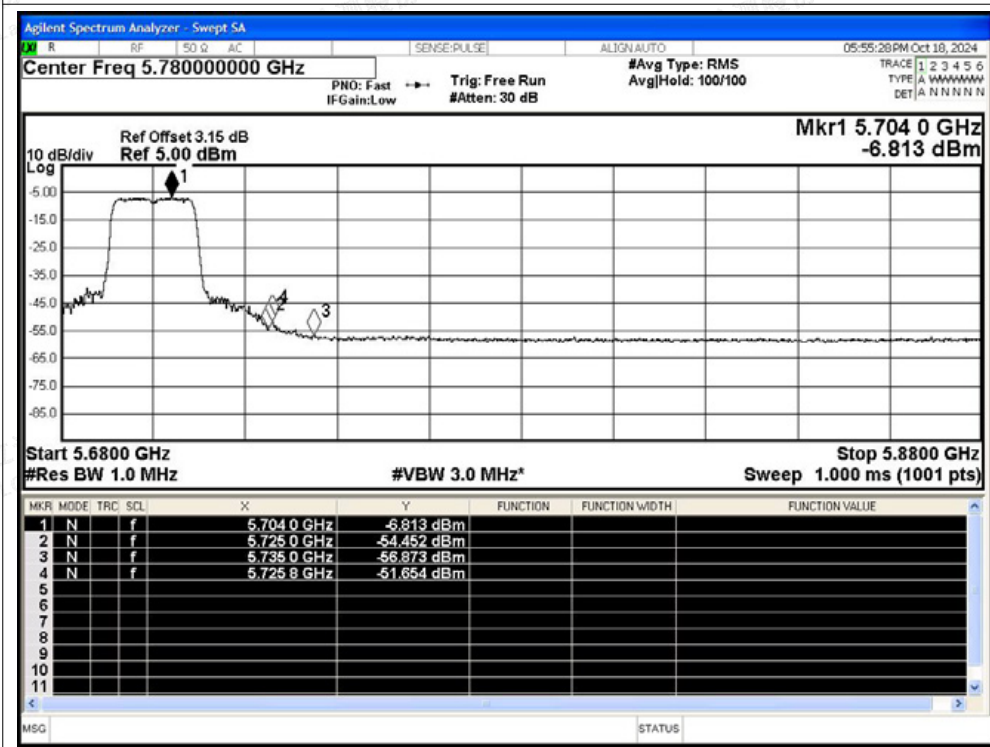

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant1 Peak

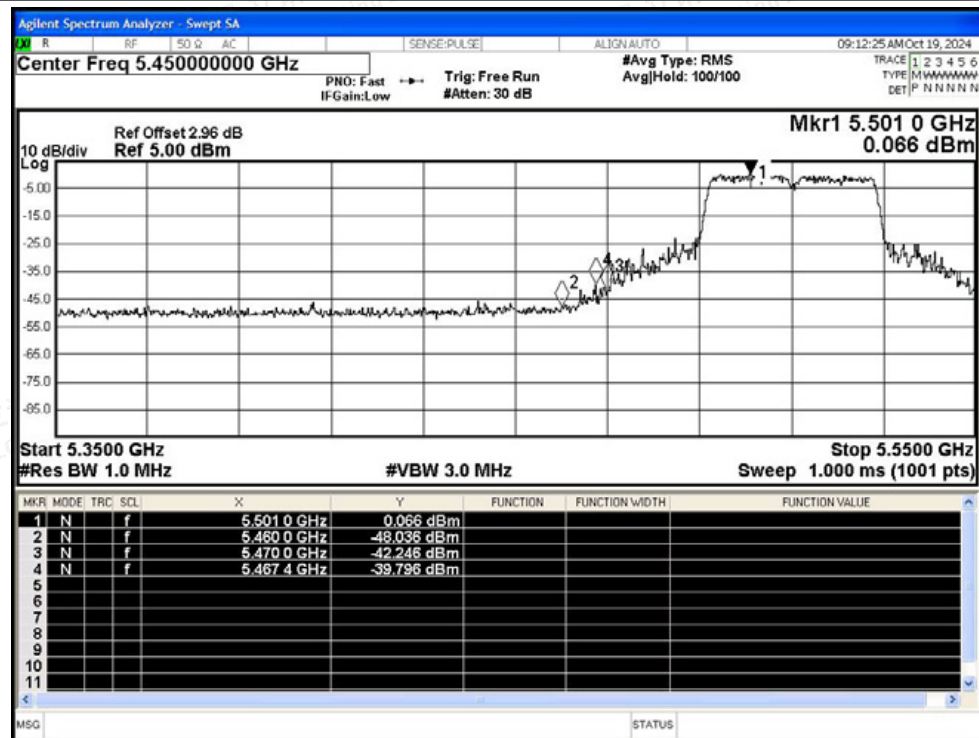


Restrict Band NVNT n40 5510MHz Ant1 Average

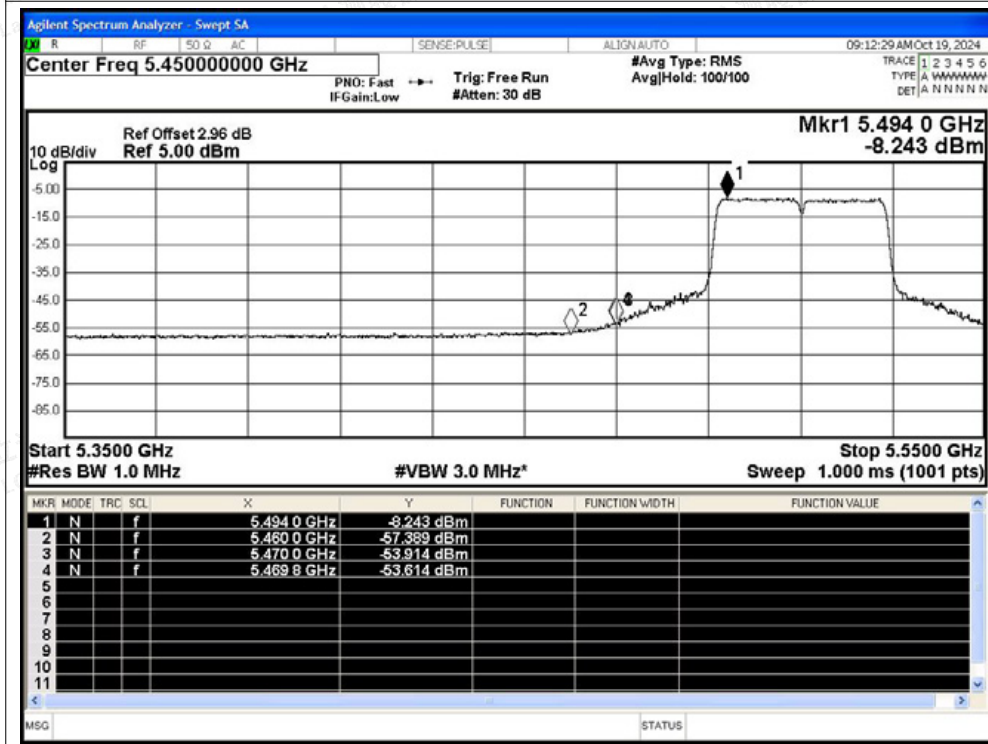




Restrict Band NVNT n40 5670MHz Ant1 Peak

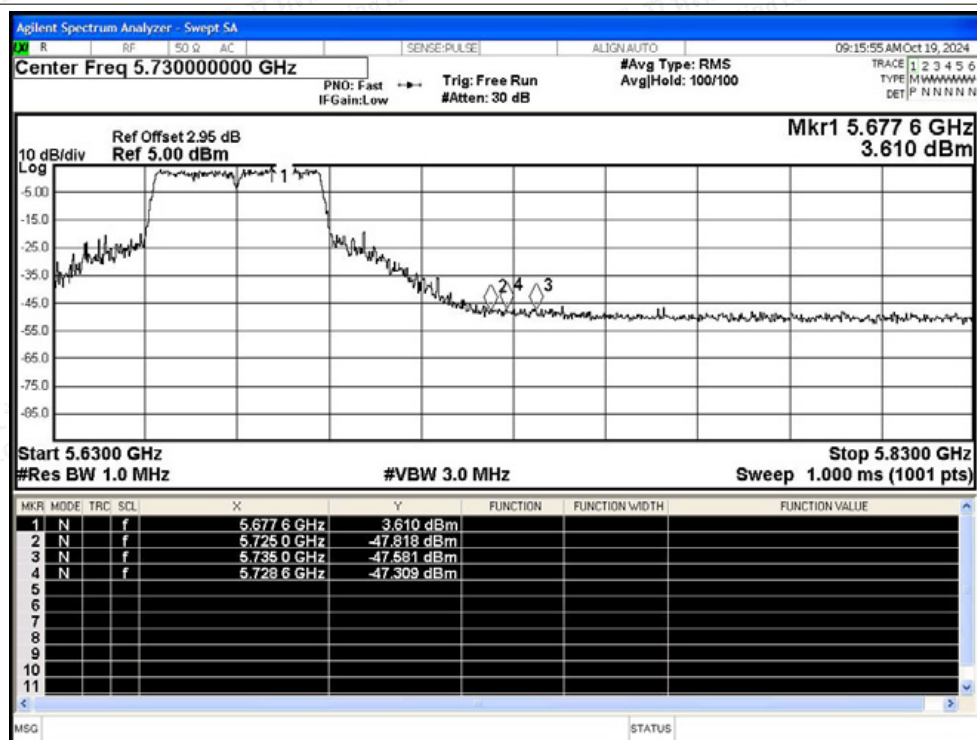

Restrict Band NVNT n40 5670MHz Ant1 Average

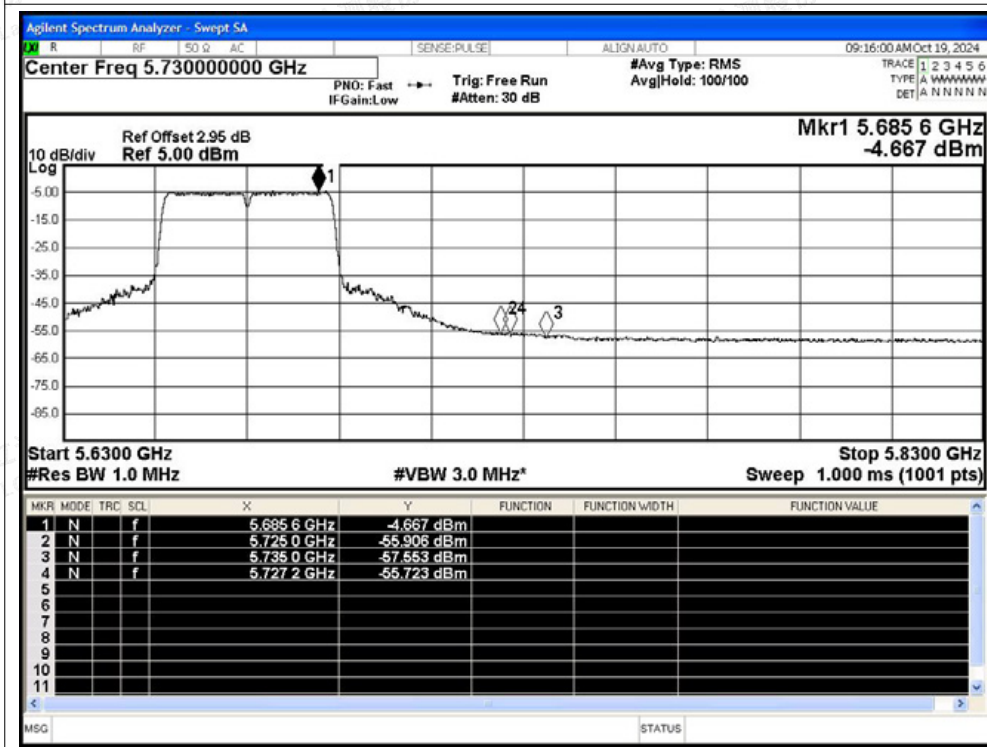

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant1 Peak

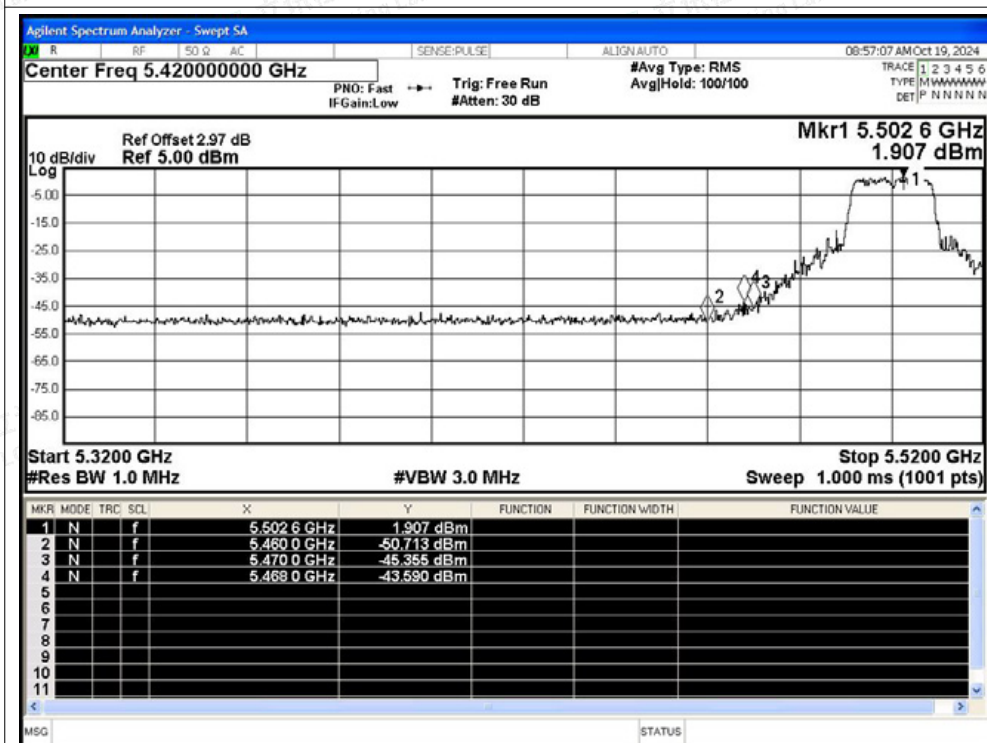

Restrict Band NVNT ac20 5500MHz Ant1 Average

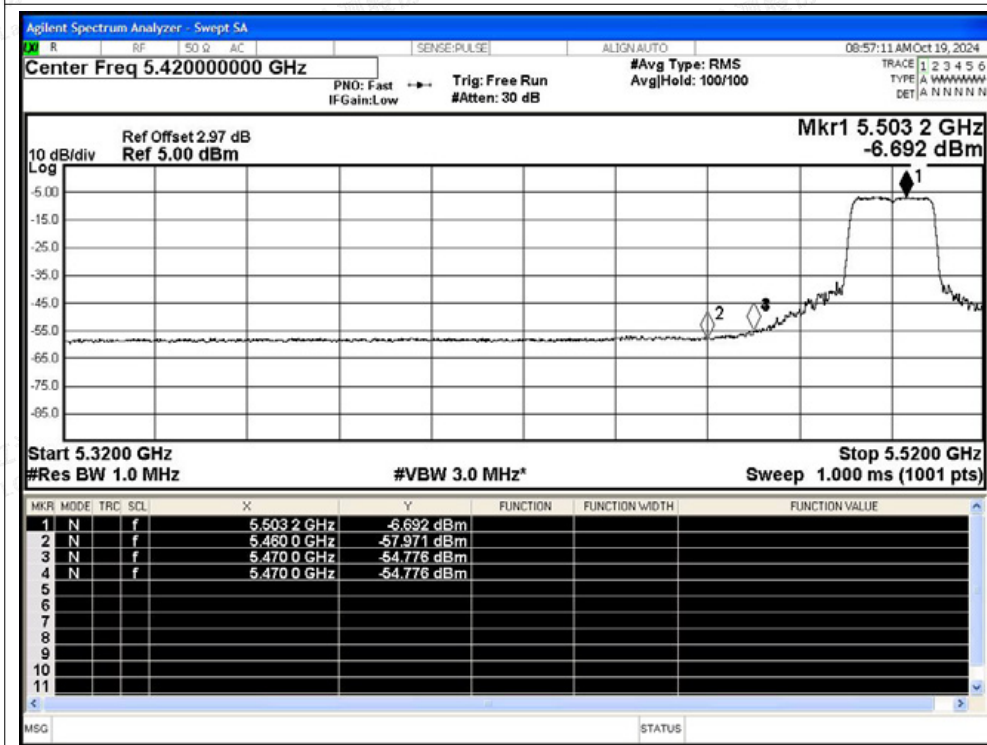

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant1 Peak

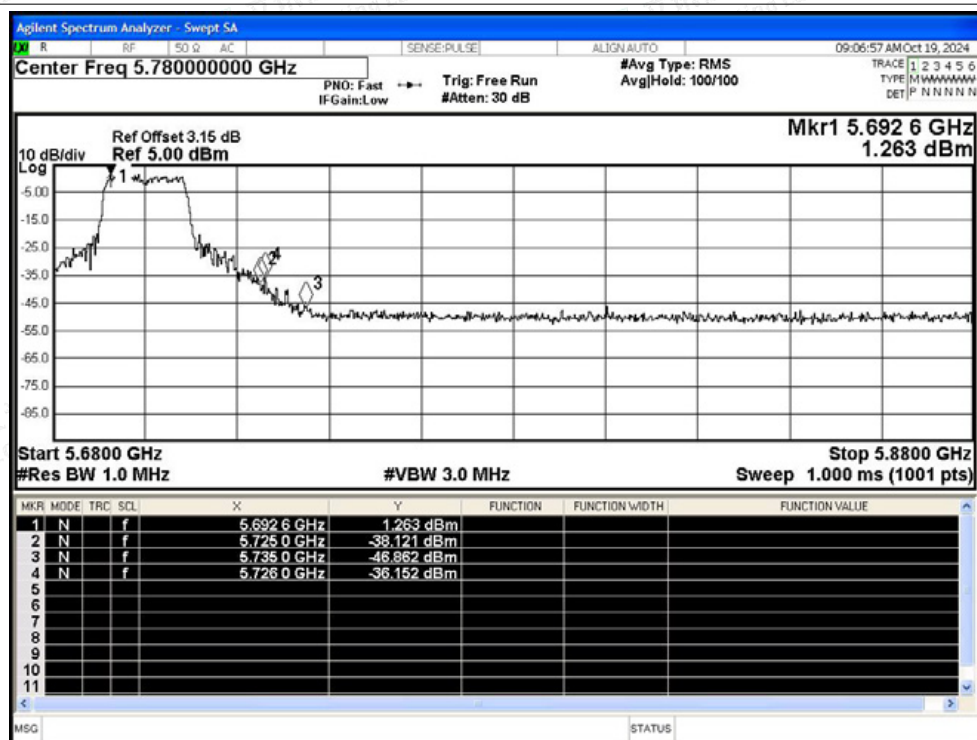

Restrict Band NVNT ac20 5700MHz Ant1 Average

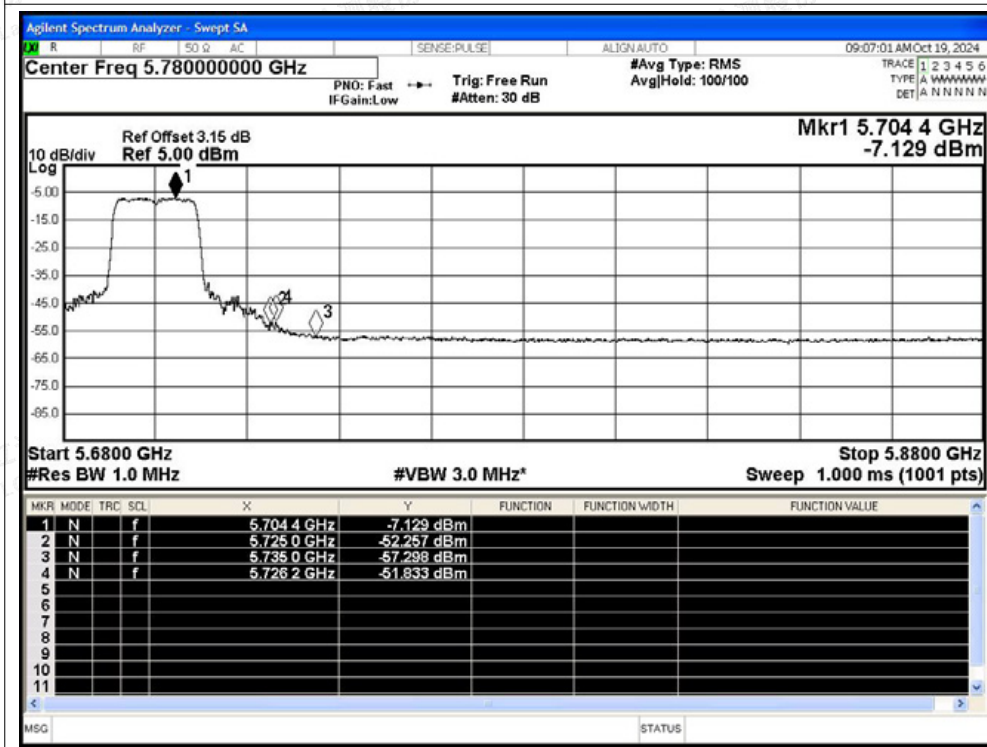

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant1 Peak

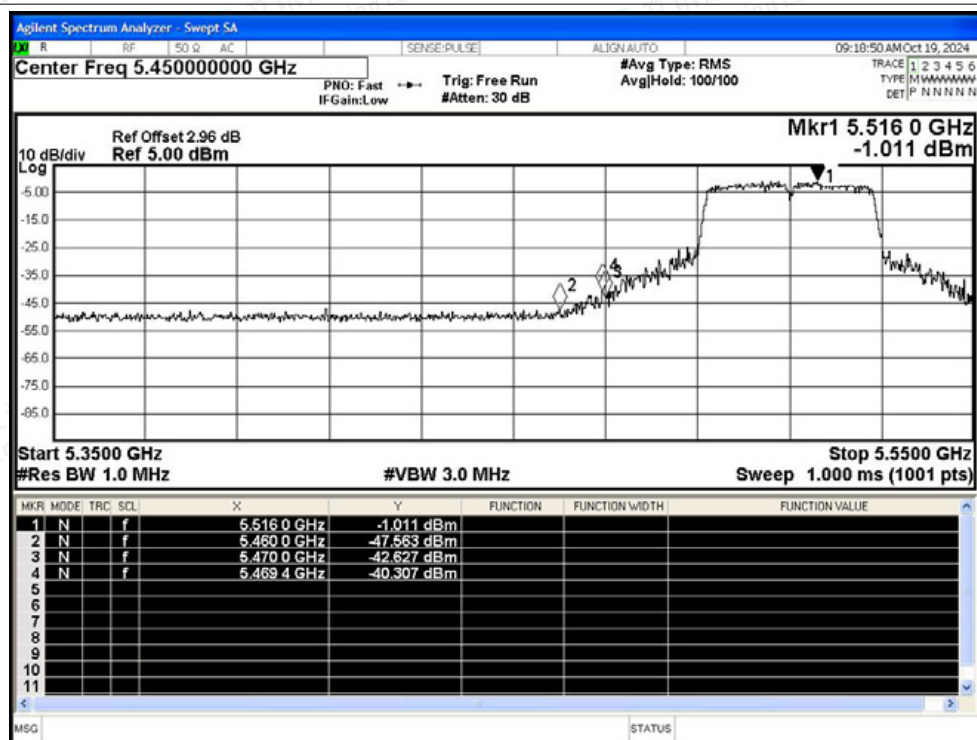

Restrict Band NVNT ac40 5510MHz Ant1 Average

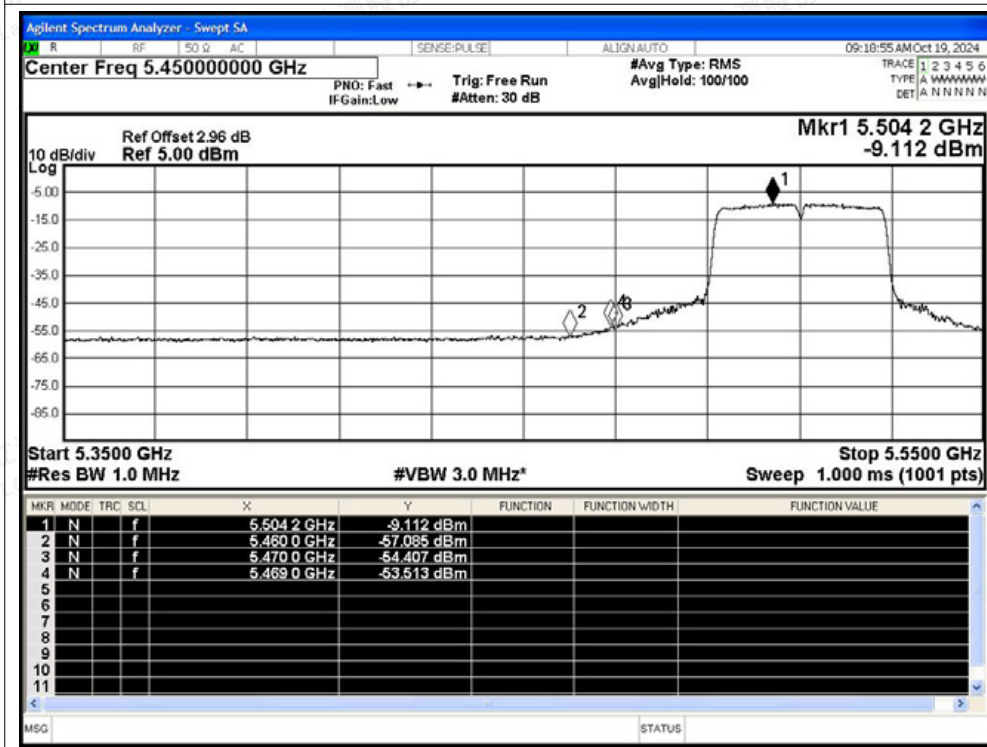

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity