




Band Edge(Hopping) NVNT 3-DH5 2402MHz Ant1 Hopping Ref



Band Edge(Hopping) NVNT 3-DH5 2402MHz Ant1 Hopping Emission

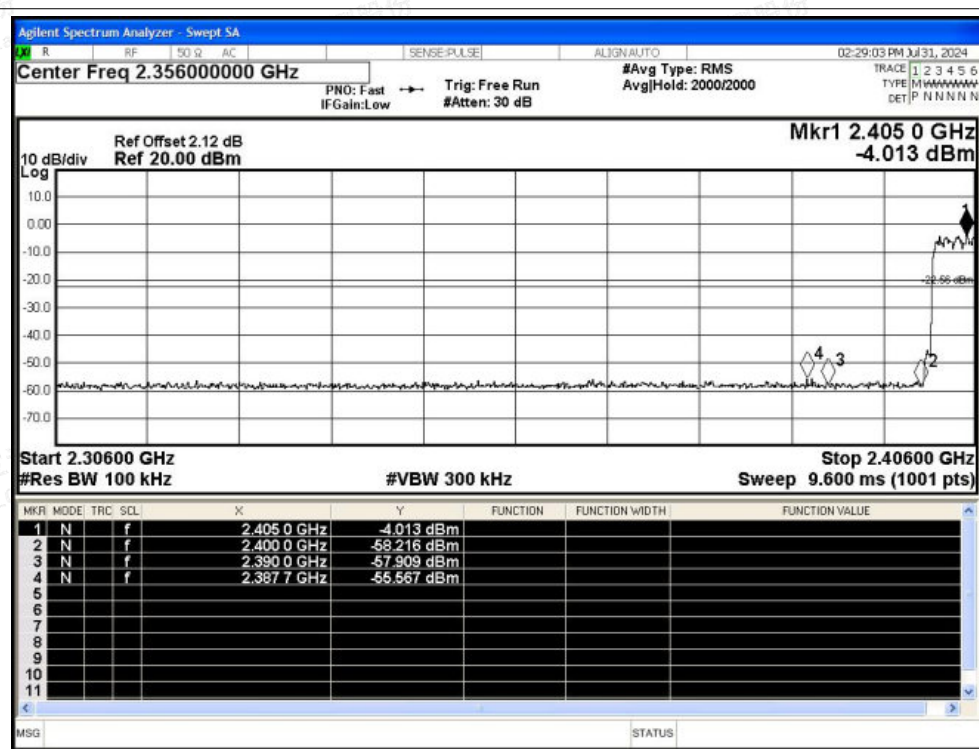

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Band Edge(Hopping) NVNT 3-DH5 2480MHz Ant1 Hopping Ref

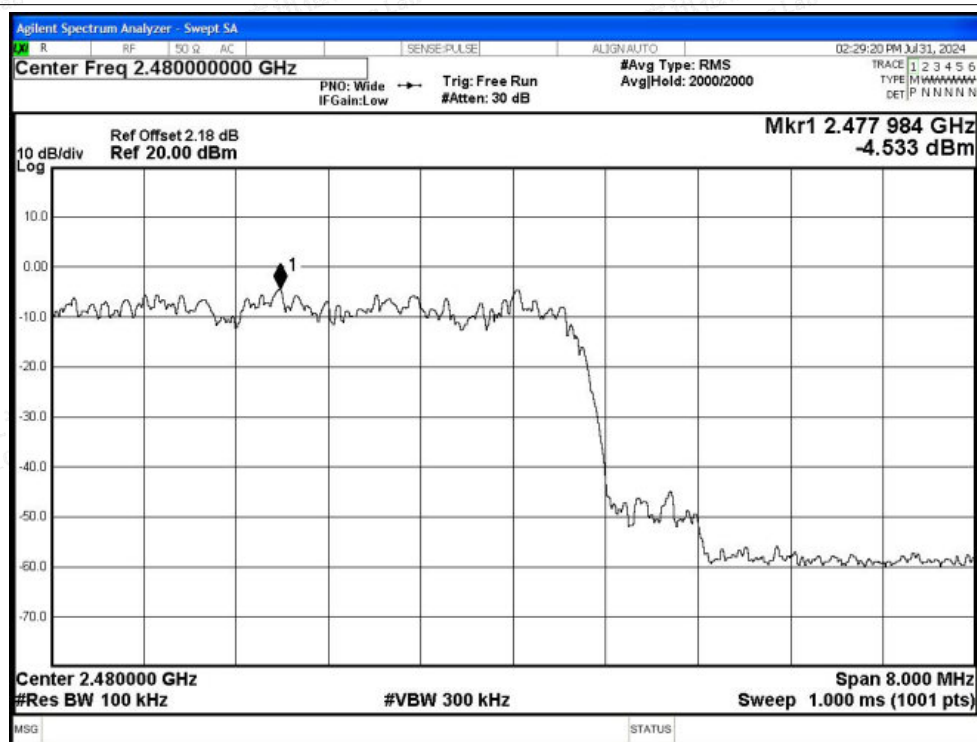

Band Edge(Hopping) NVNT 3-DH5 2480MHz Ant1 Hopping Emission

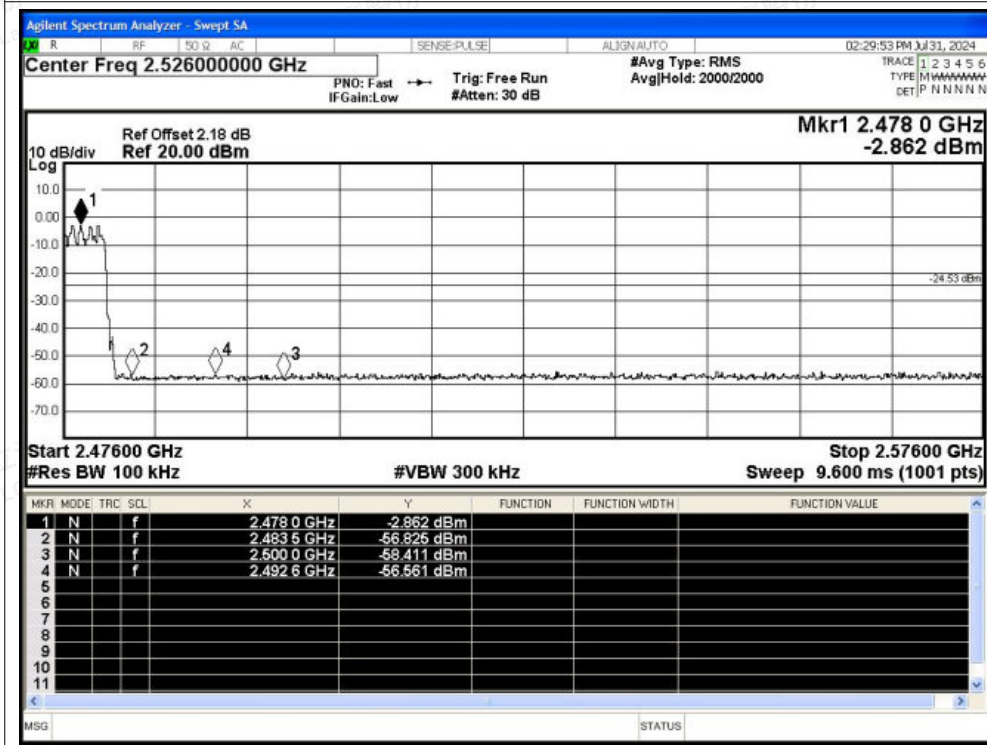

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.7 Conducted RF Spurious Emission

Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	1-DH5	2402	Ant1	-54.51	-20	Pass
NVNT	1-DH5	2441	Ant1	-54.49	-20	Pass
NVNT	1-DH5	2480	Ant1	-53.7	-20	Pass
NVNT	2-DH5	2402	Ant1	-52.42	-20	Pass
NVNT	2-DH5	2441	Ant1	-52.94	-20	Pass
NVNT	2-DH5	2480	Ant1	-47.64	-20	Pass
NVNT	3-DH5	2402	Ant1	-52.43	-20	Pass
NVNT	3-DH5	2441	Ant1	-53.51	-20	Pass
NVNT	3-DH5	2480	Ant1	-52.29	-20	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Tx. Spurious NVNT 1-DH5 2402MHz Ant1 Ref



Tx. Spurious NVNT 1-DH5 2402MHz Ant1 Emission

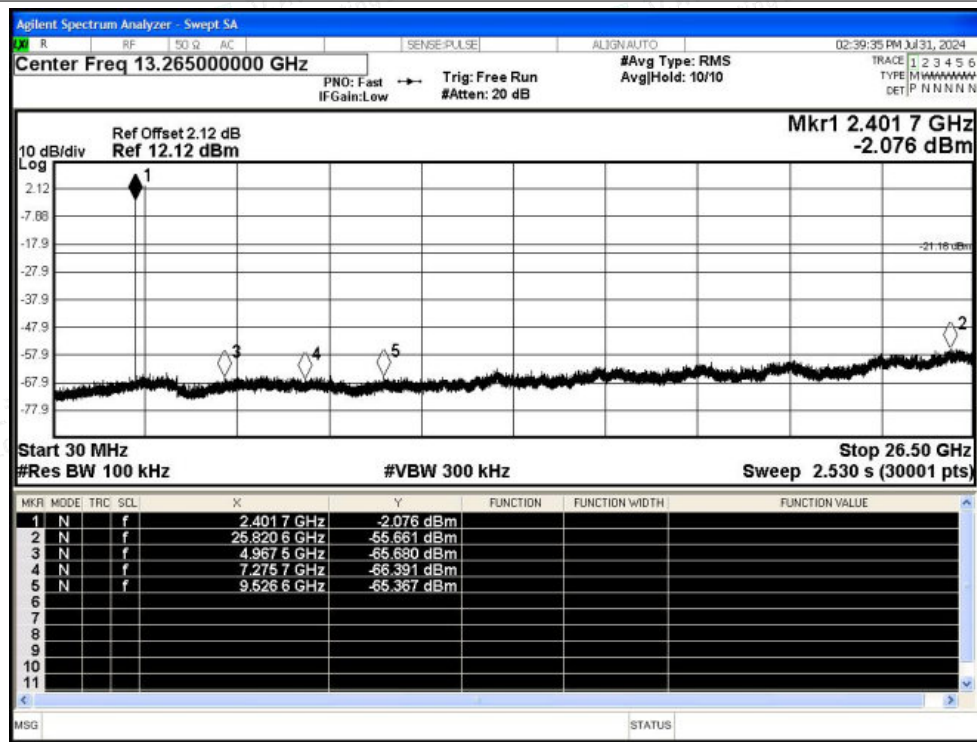

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 1-DH5 2441MHz Ant1 Ref

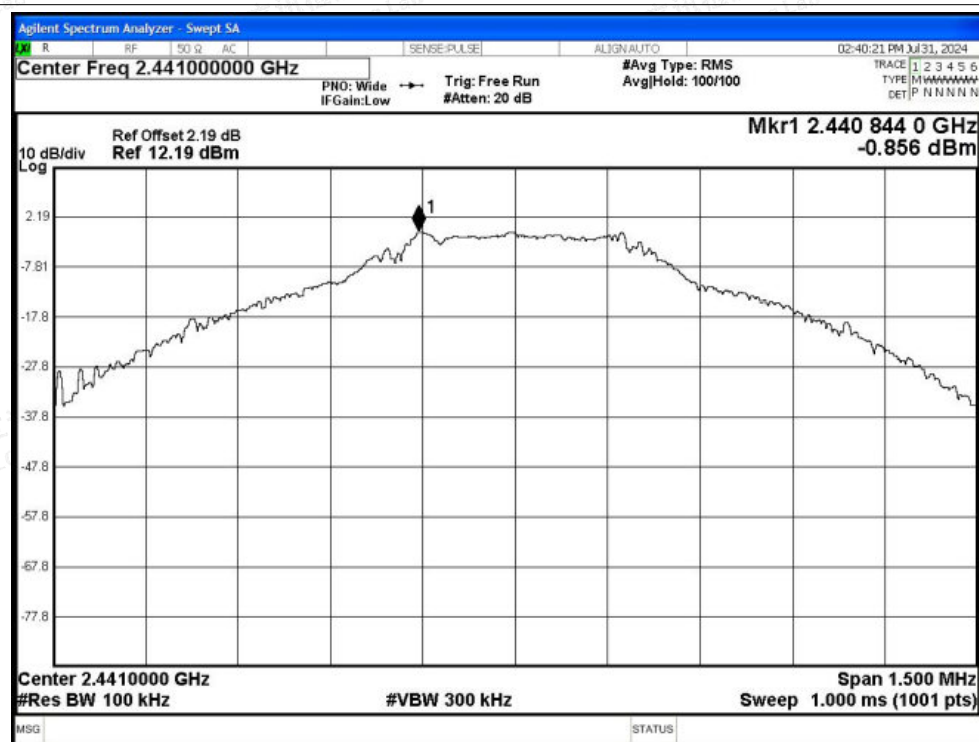

Tx. Spurious NVNT 1-DH5 2441MHz Ant1 Emission

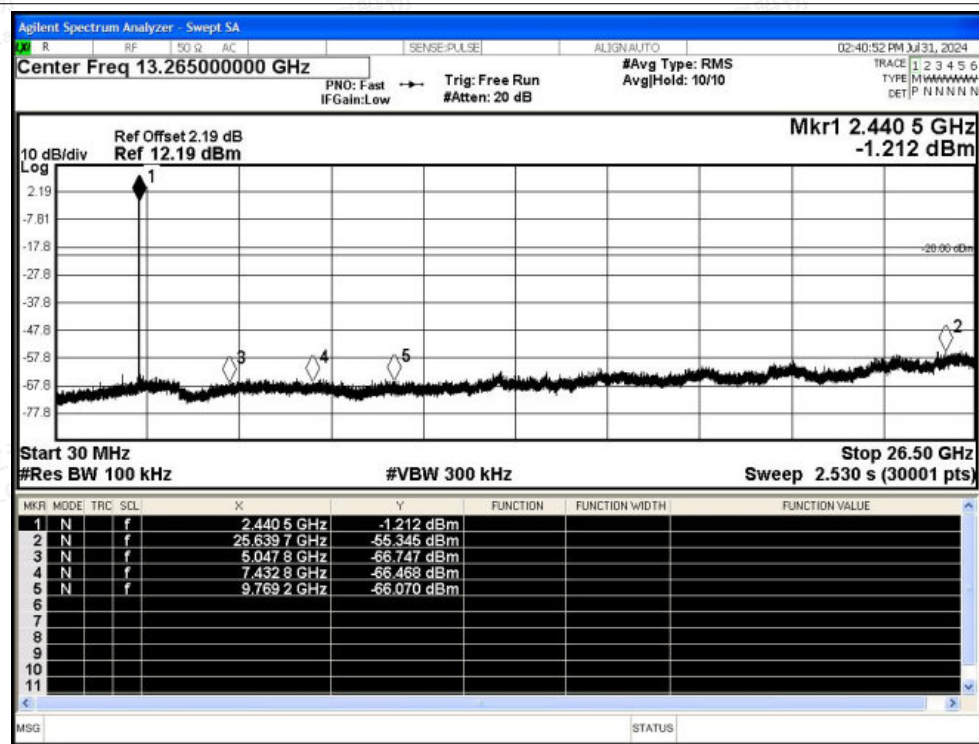

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 1-DH5 2480MHz Ant1 Ref

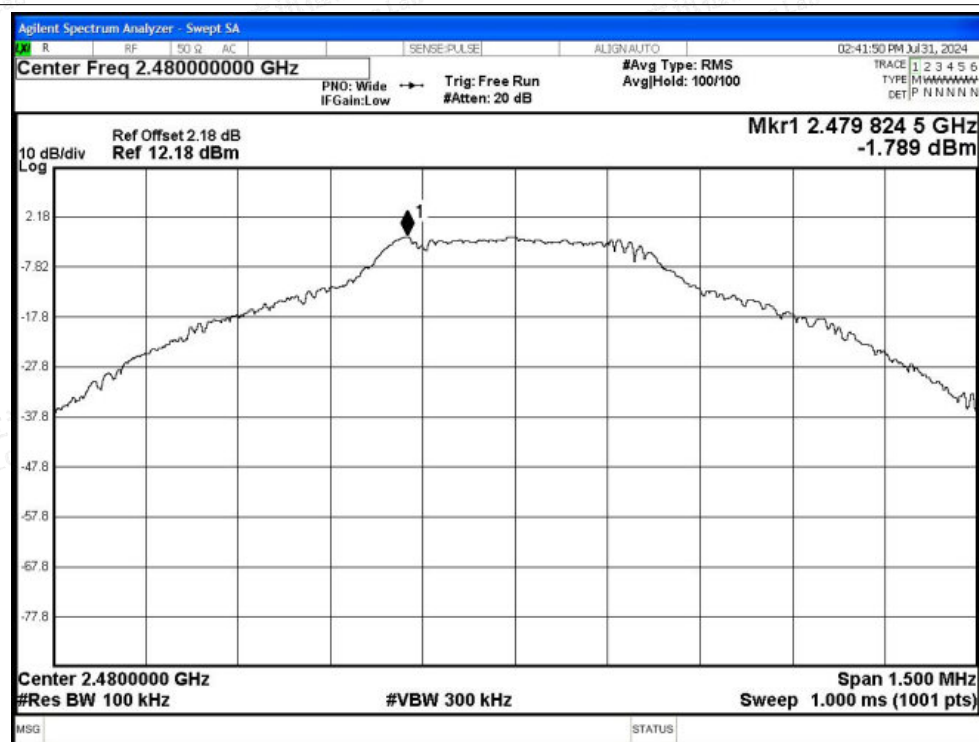

Tx. Spurious NVNT 1-DH5 2480MHz Ant1 Emission

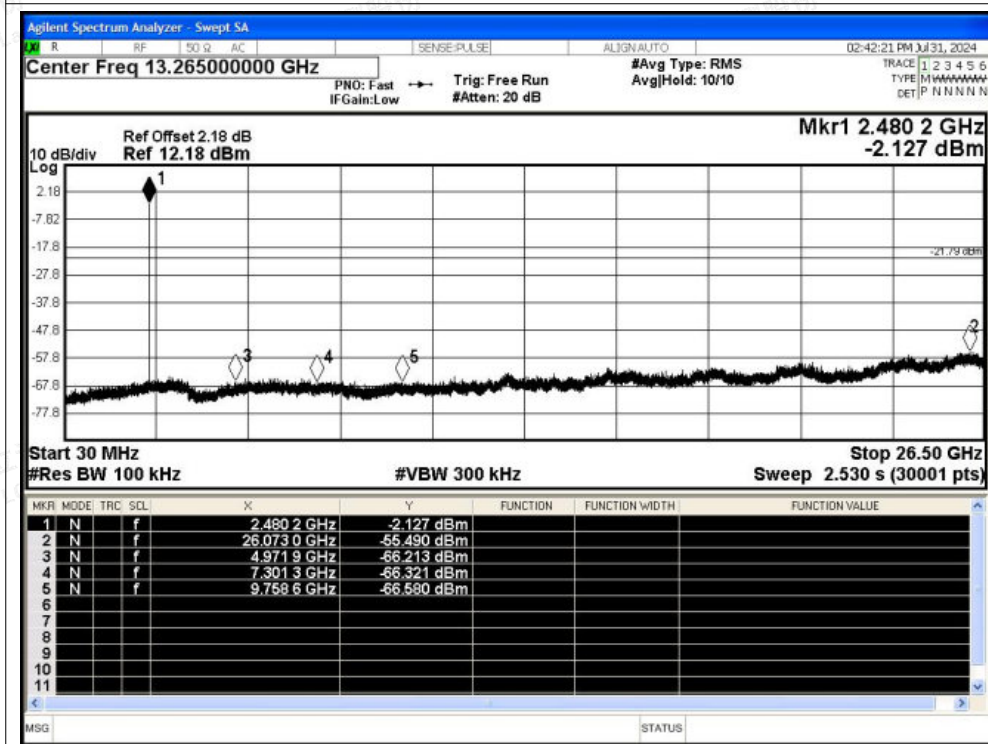

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Ref

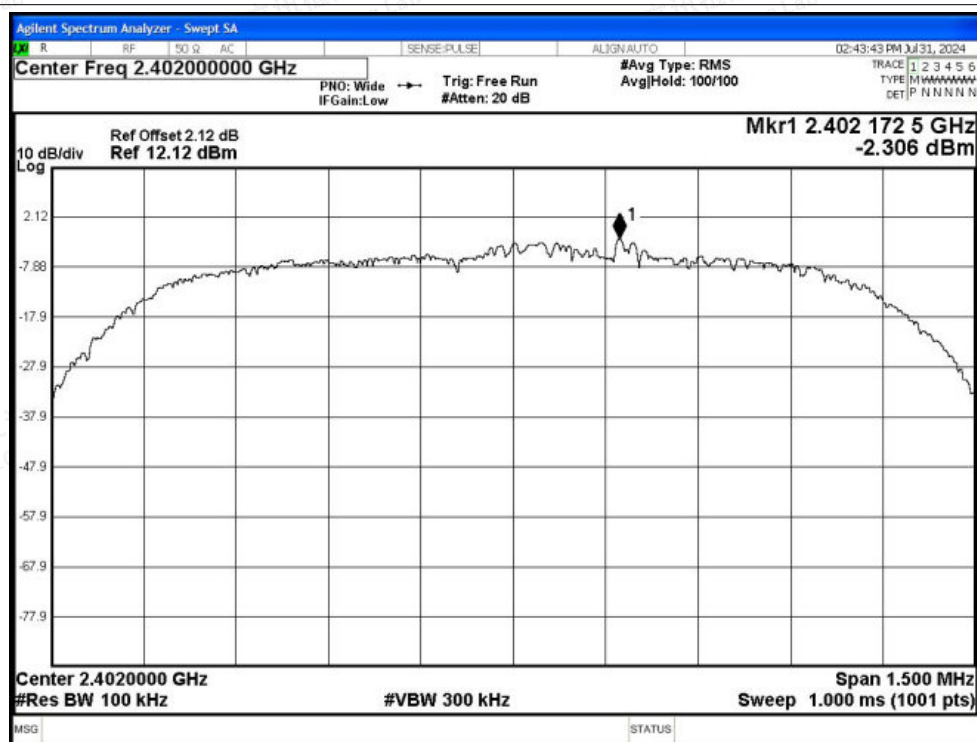

Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Emission

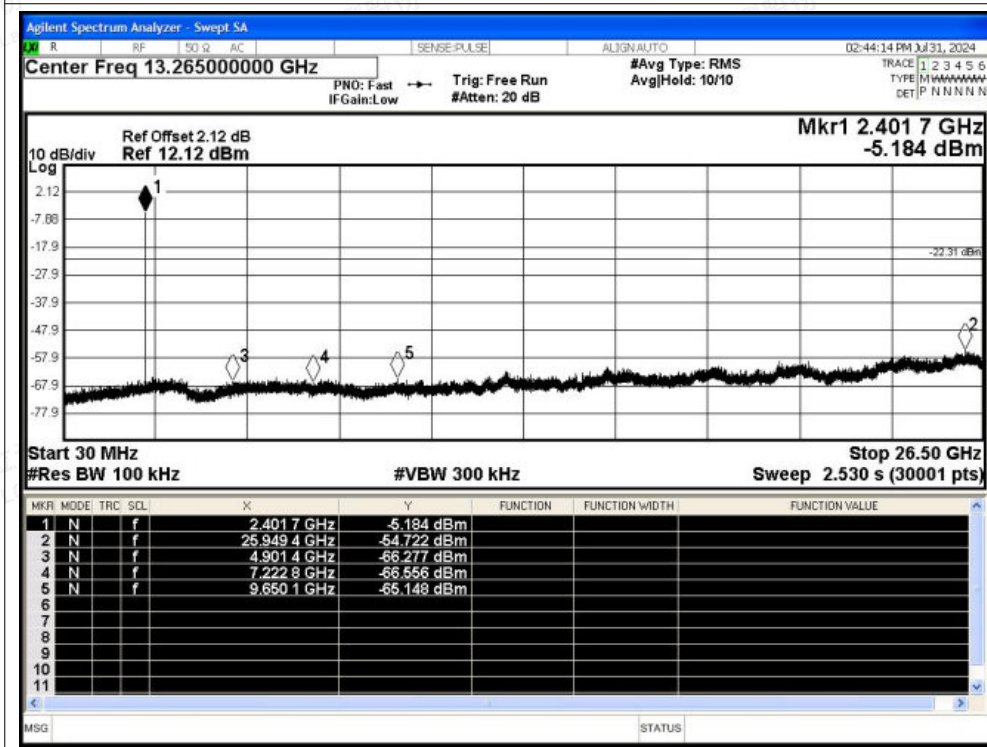

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Ref

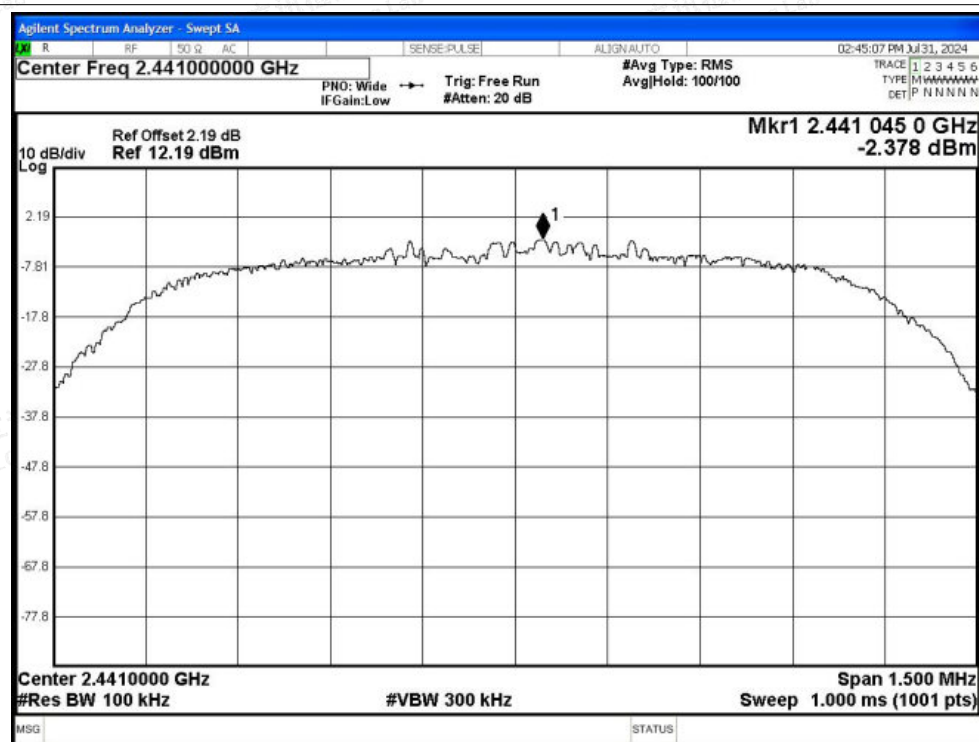

Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Emission

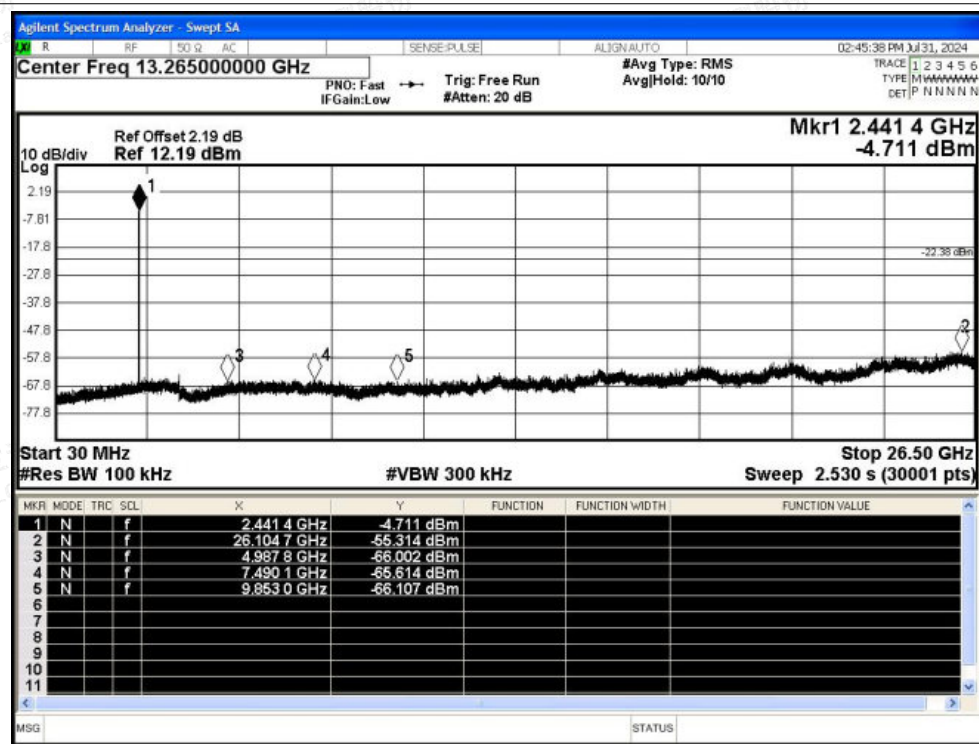

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Ref

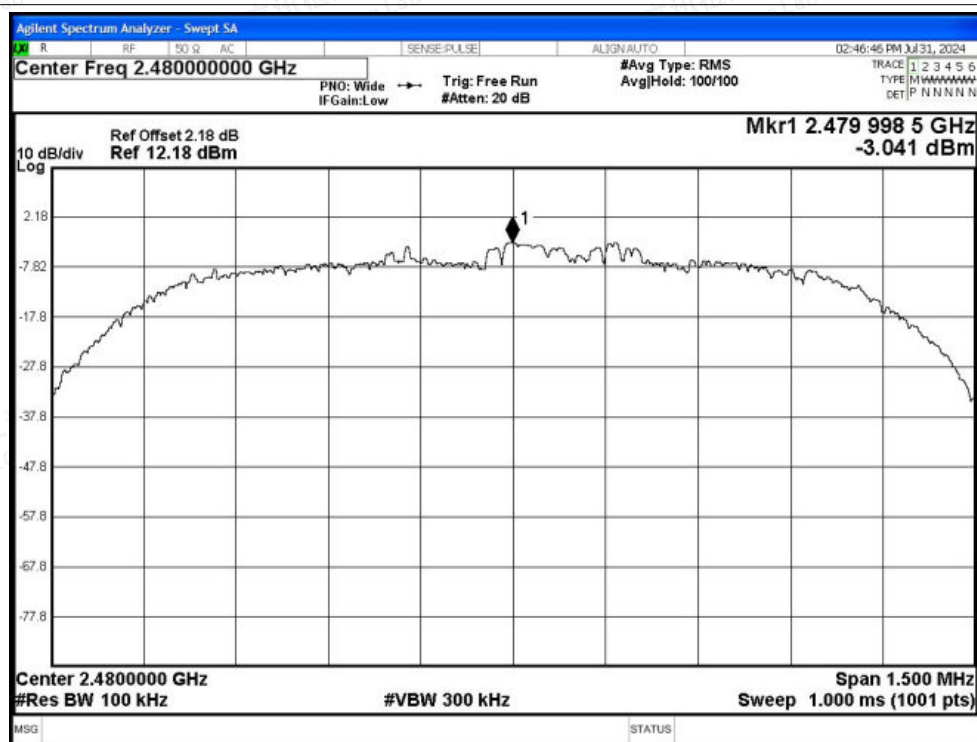

Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Emission

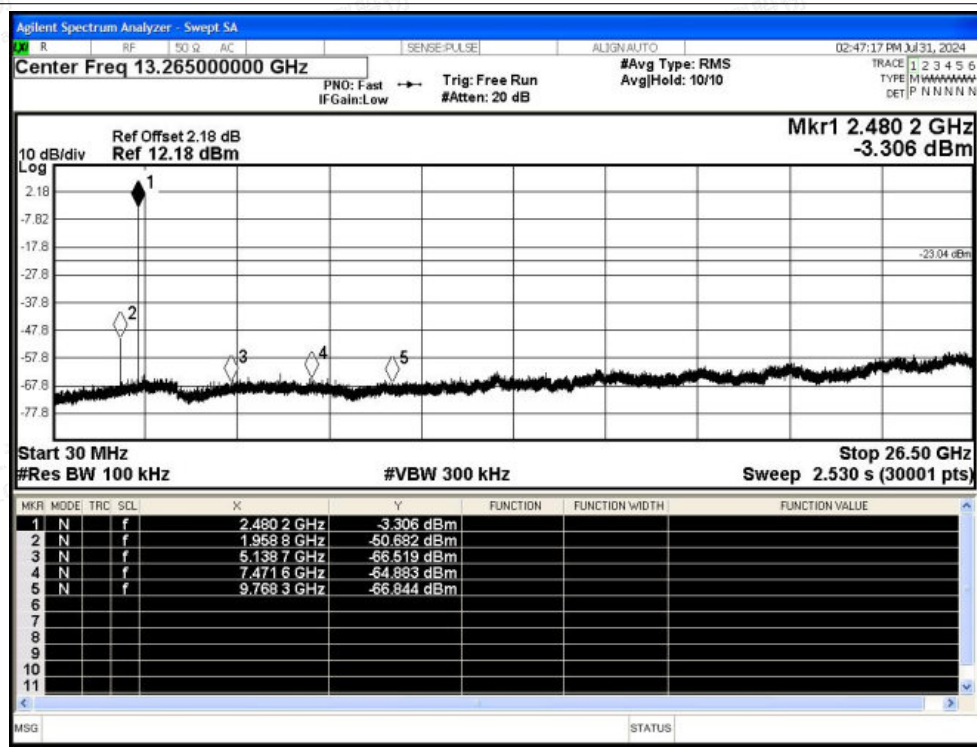

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Ref

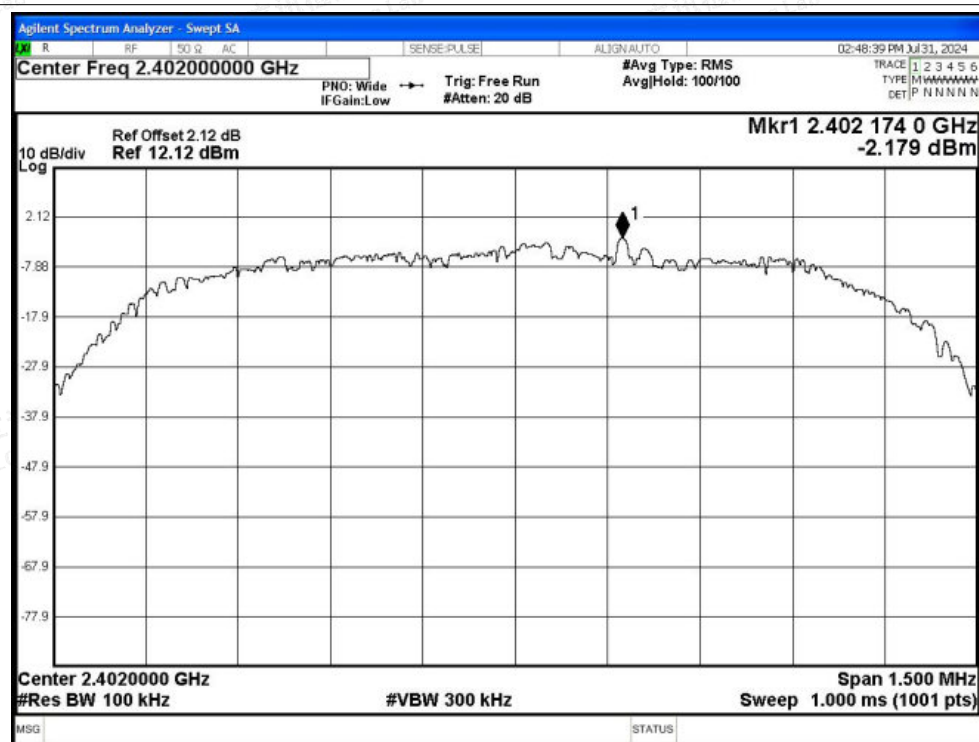

Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Emission

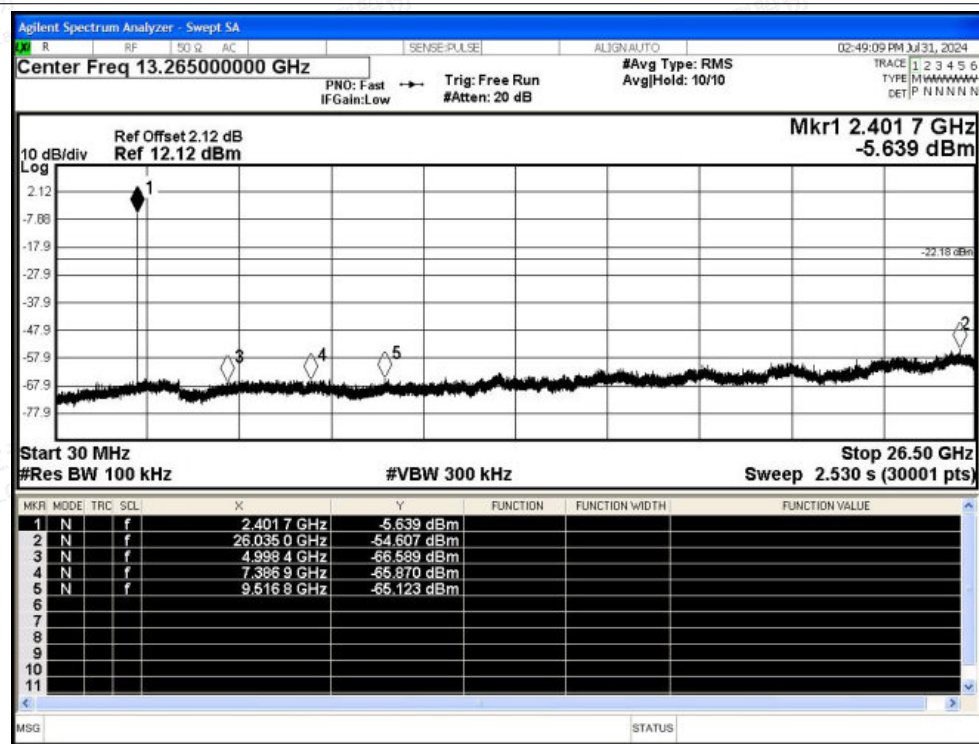

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Ref

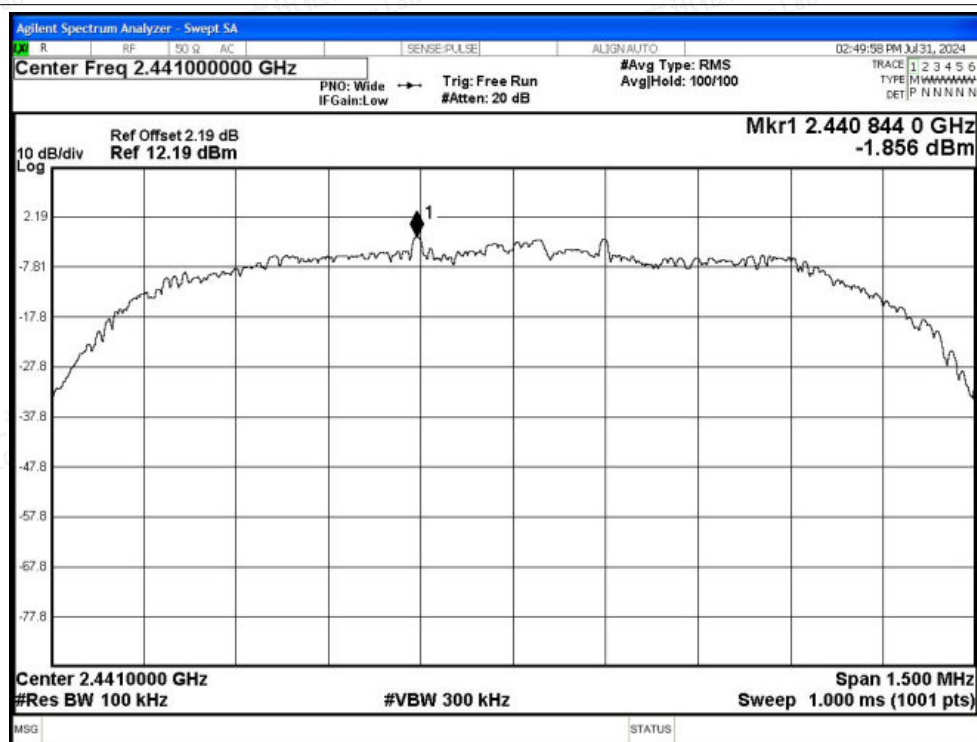

Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Emission

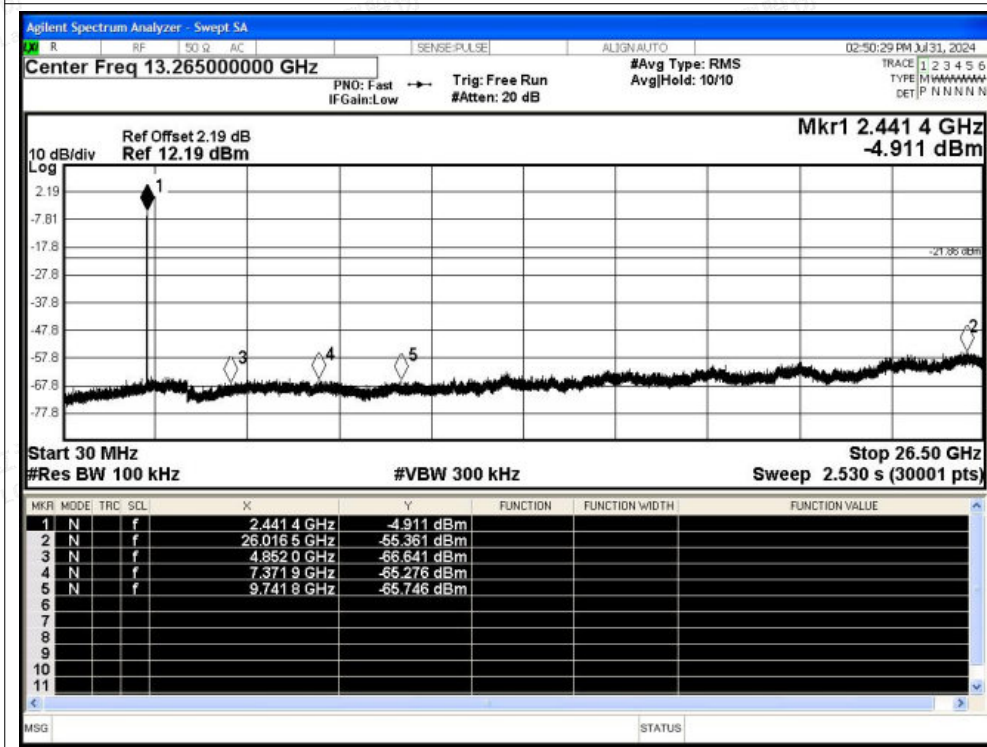

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Ref

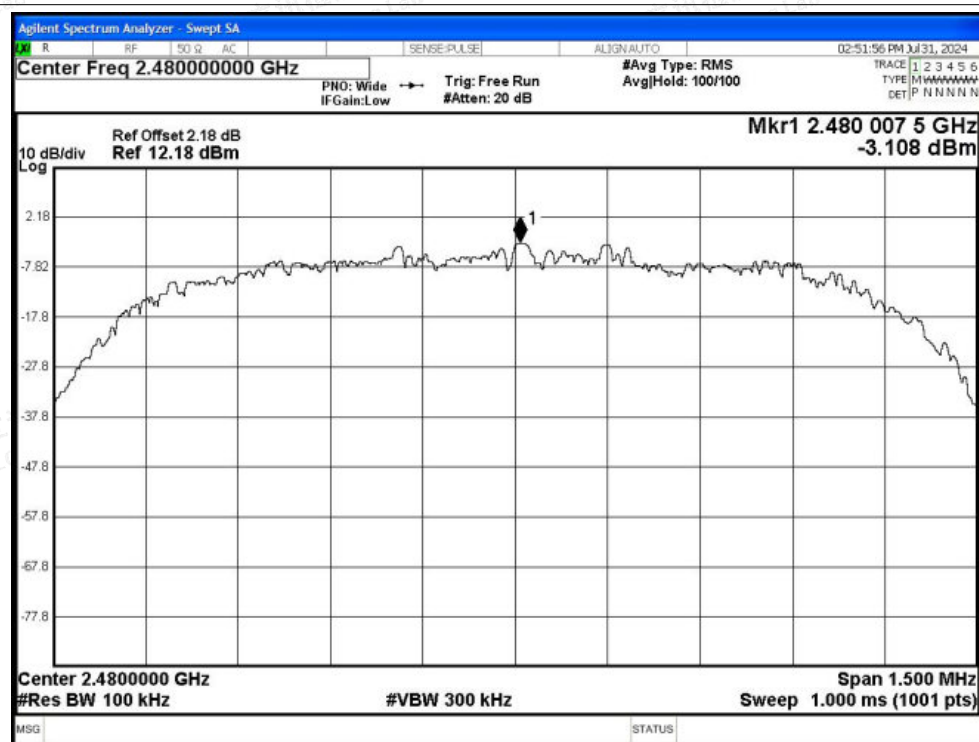

Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Emission

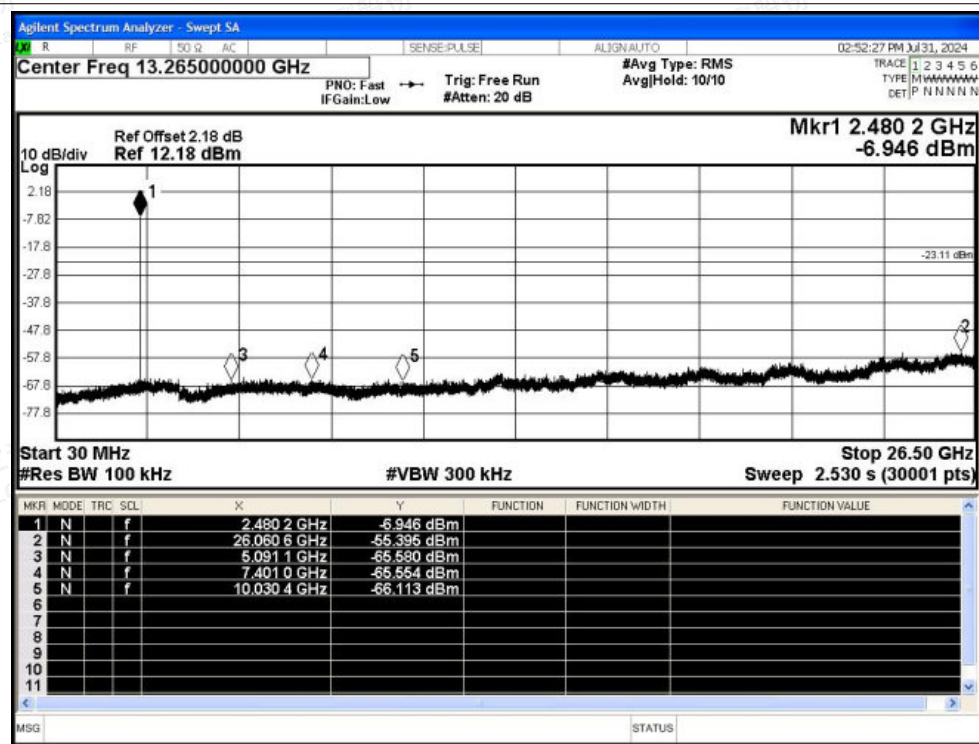

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.8 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	1-DH5	2402	Ant1	77.63	1.1	0.34
NVNT	1-DH5	2441	Ant1	77.6	1.1	0.34
NVNT	1-DH5	2480	Ant1	77.6	1.1	0.34
NVNT	2-DH5	2402	Ant1	76.43	1.17	0.36
NVNT	2-DH5	2441	Ant1	77.28	1.12	0.35
NVNT	2-DH5	2480	Ant1	77.28	1.12	0.35
NVNT	3-DH5	2402	Ant1	77.28	1.12	0.35
NVNT	3-DH5	2441	Ant1	77.33	1.12	0.34
NVNT	3-DH5	2480	Ant1	77.28	1.12	0.35






Test Graphs

Duty Cycle NVNT 1-DH5 2402MHz Ant1

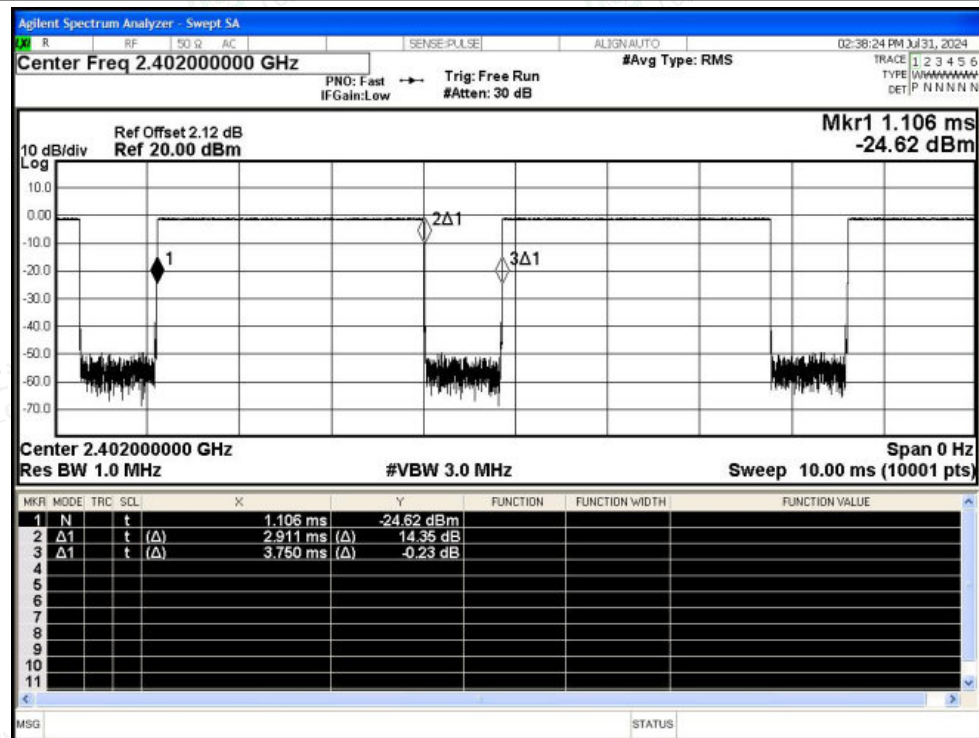

Duty Cycle NVNT 1-DH5 2441MHz Ant1

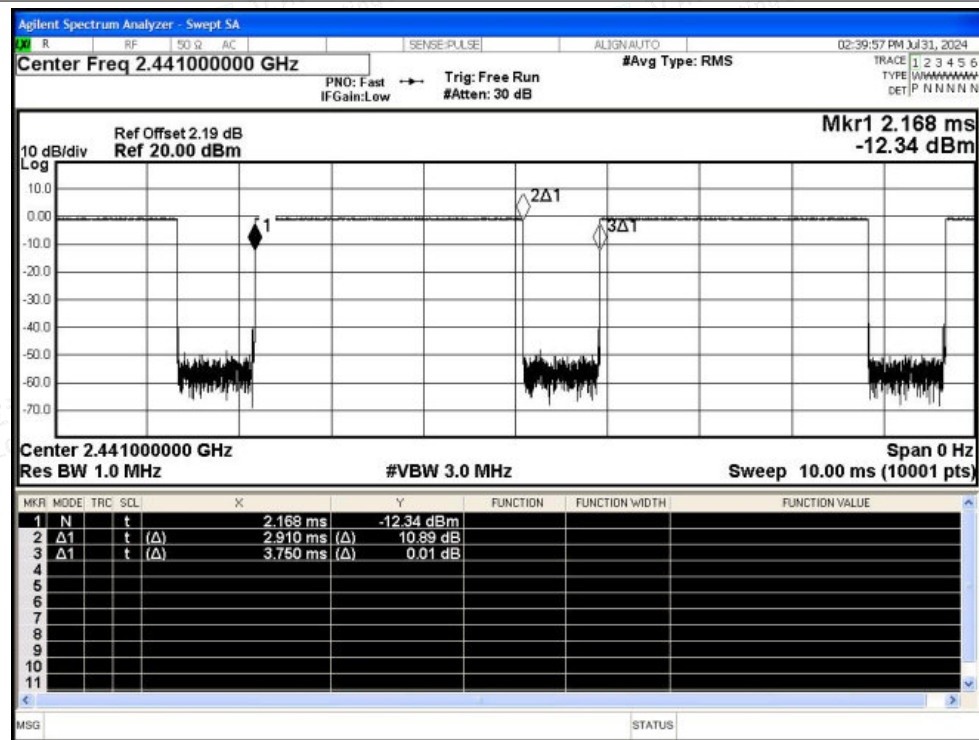

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 1-DH5 2480MHz Ant1

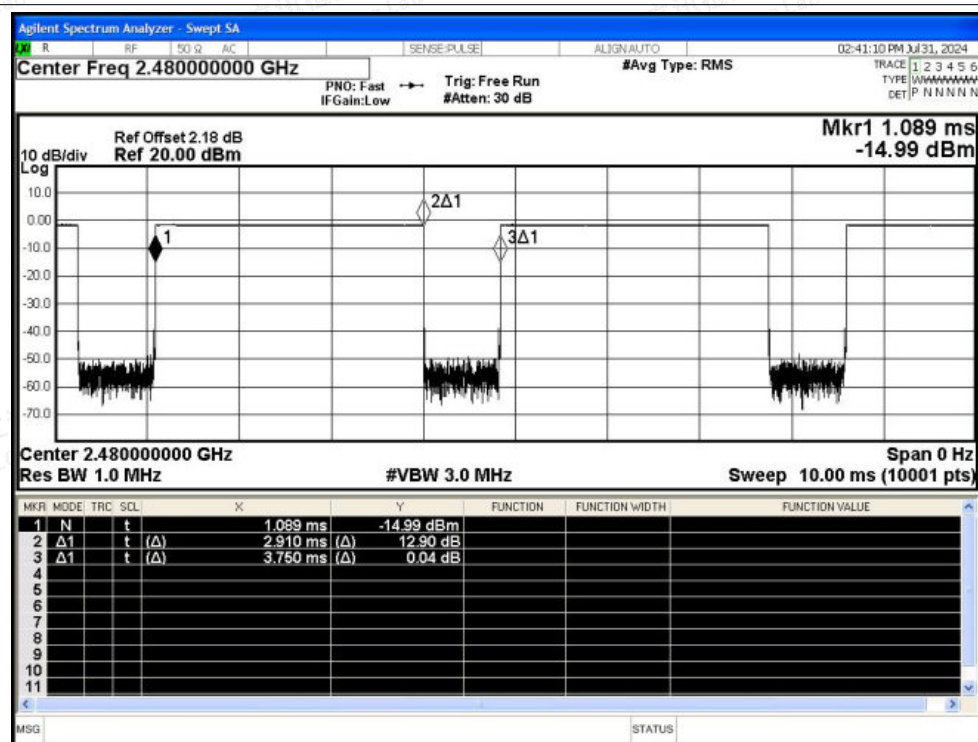

Duty Cycle NVNT 2-DH5 2402MHz Ant1

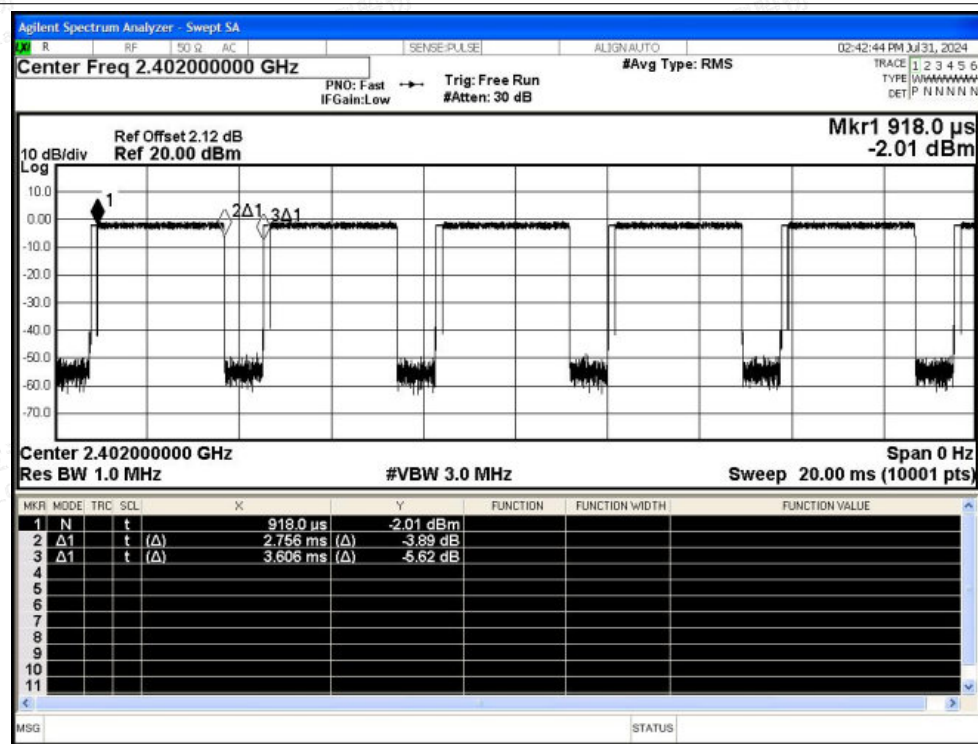

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 2-DH5 2441MHz Ant1

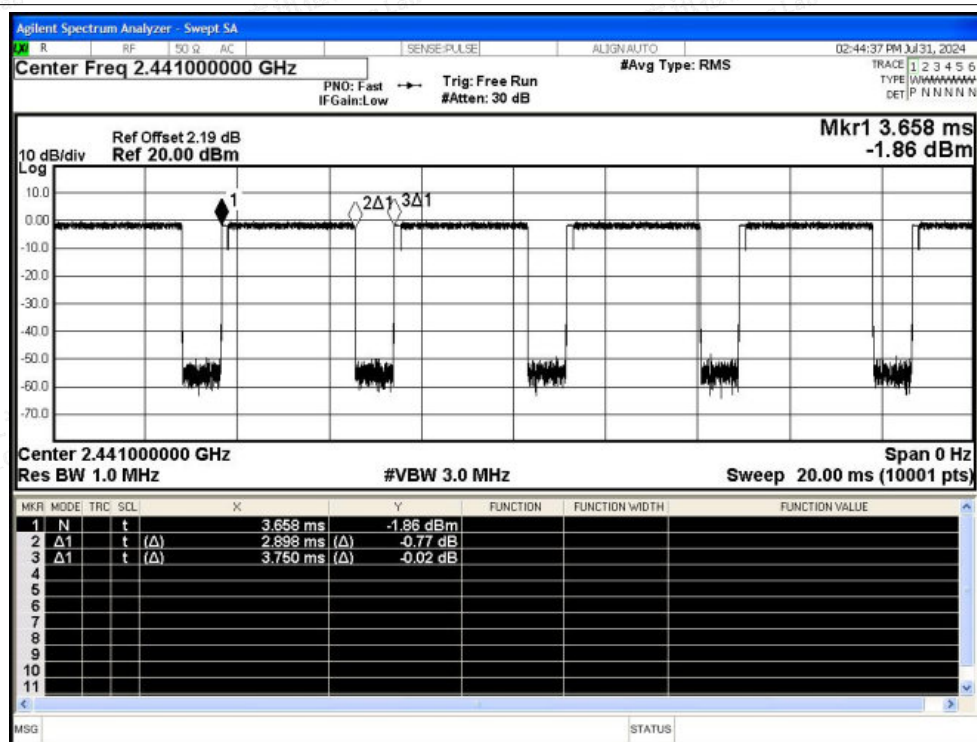

Duty Cycle NVNT 2-DH5 2480MHz Ant1

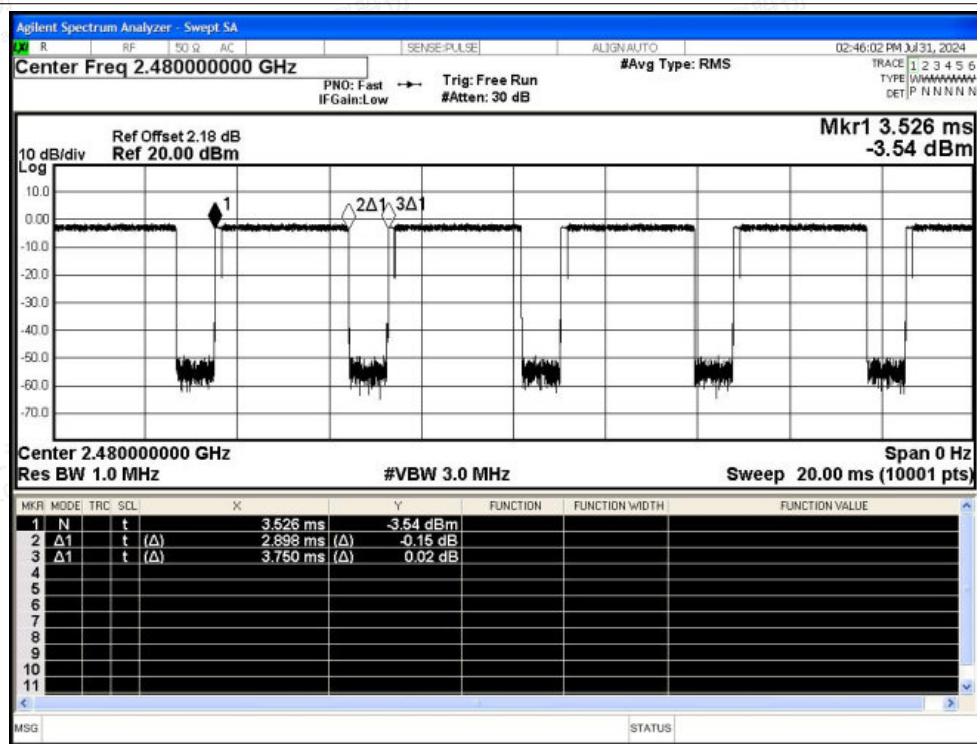

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 3-DH5 2402MHz Ant1

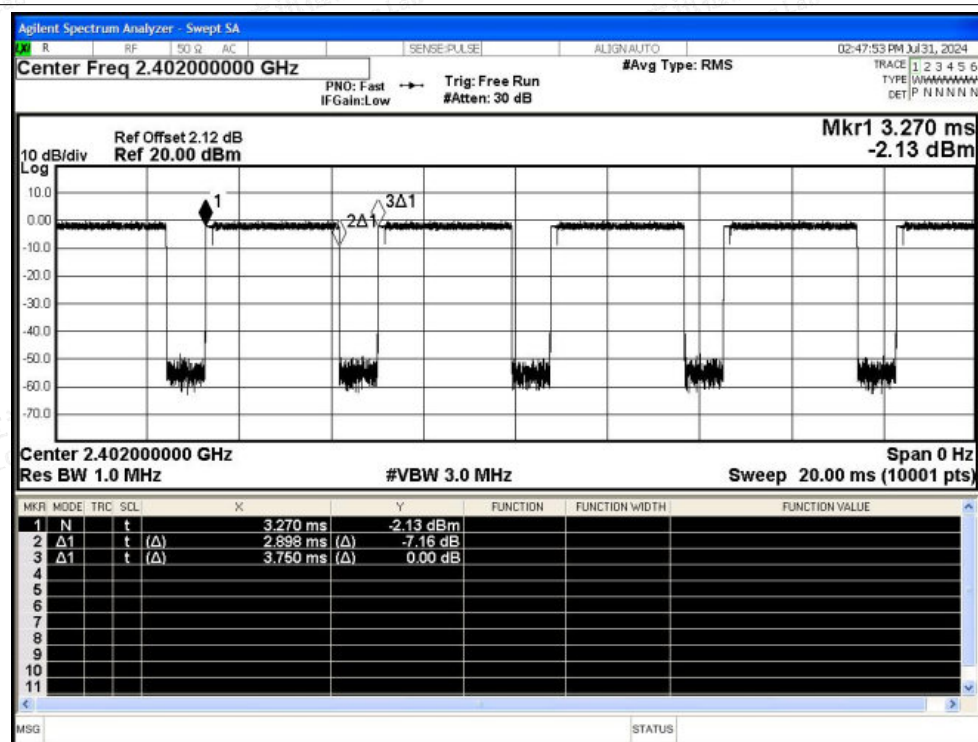

Duty Cycle NVNT 3-DH5 2441MHz Ant1

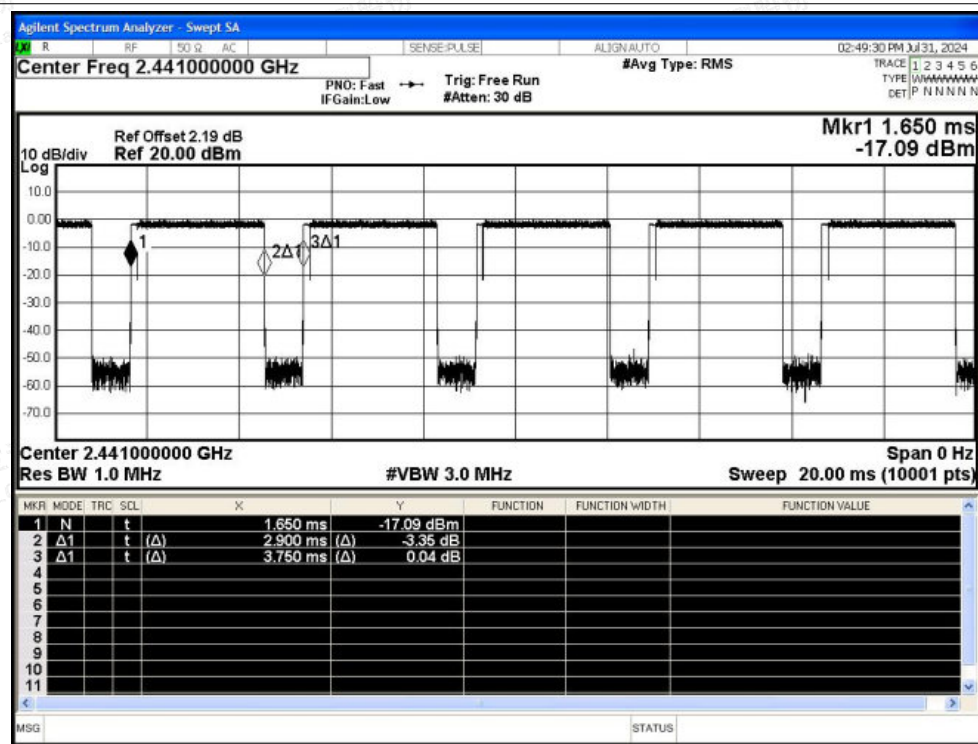

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Duty Cycle NVNT 3-DH5 2480MHz Ant1

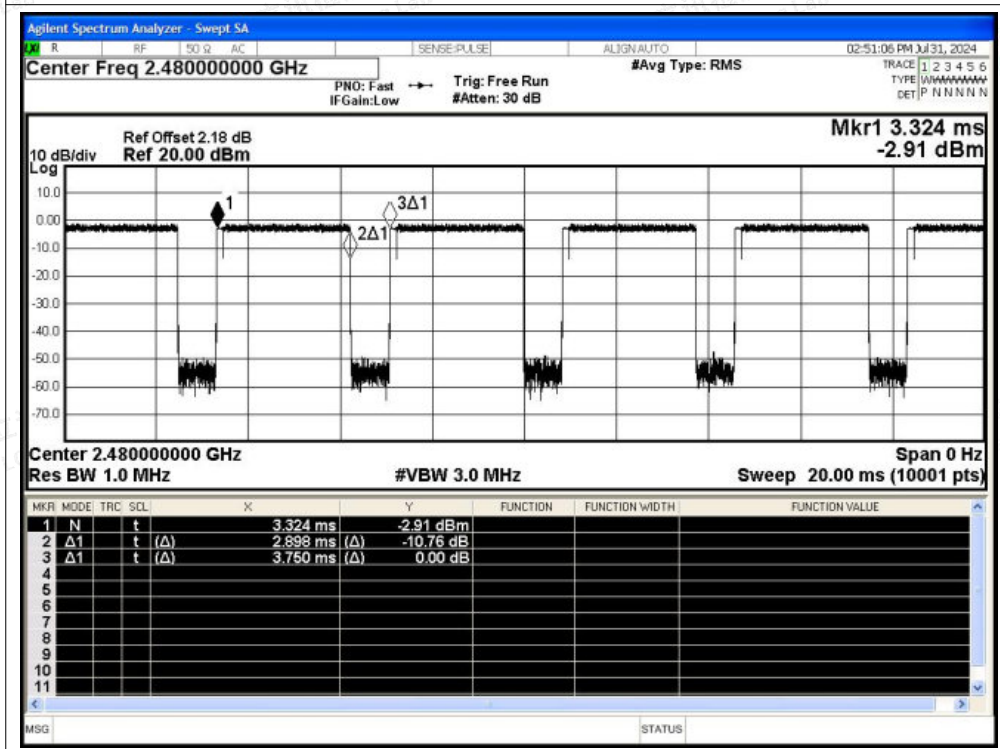

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.9 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-50.77	2	-	46.49	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-58.71	2	1.1	39.65	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2356.848	-47.38	2	-	49.88	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2389.104	-57.55	2	1.1	40.81	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-50.63	2	-	46.63	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-58.65	2	1.1	39.71	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-49.75	2	-	47.51	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-58.61	2	1.1	39.75	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2484.16	-46.29	2	-	50.97	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2495.296	-57.2	2	1.1	41.16	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-51.5	2	-	45.76	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-58.33	2	1.1	40.03	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-50.29	2	-	46.97	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-58.55	2	1.17	39.88	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2327.952	-47.42	2	-	49.84	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2389.488	-57.6	2	1.17	40.83	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-50.46	2	-	46.8	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-58.28	2	1.17	40.15	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-45.7	2	-	51.56	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-57.65	2	1.12	40.73	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.728	-45.15	2	-	52.11	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2493.592	-57.08	2	1.12	41.3	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-48.75	2	-	48.51	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-58.03	2	1.12	40.35	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-51.37	2	-	45.89	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-58.47	2	1.12	39.91	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2325.264	-47.09	2	-	50.17	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2387.76	-57.65	2	1.12	40.73	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-50.39	2	-	46.87	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-58.5	2	1.12	39.88	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-50.03	2	-	47.23	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-58.12	2	1.12	40.26	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2496.304	-47.17	2	-	50.09	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2496.88	-57.11	2	1.12	41.27	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-49.92	2	-	47.34	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-58.08	2	1.12	40.3	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Peak

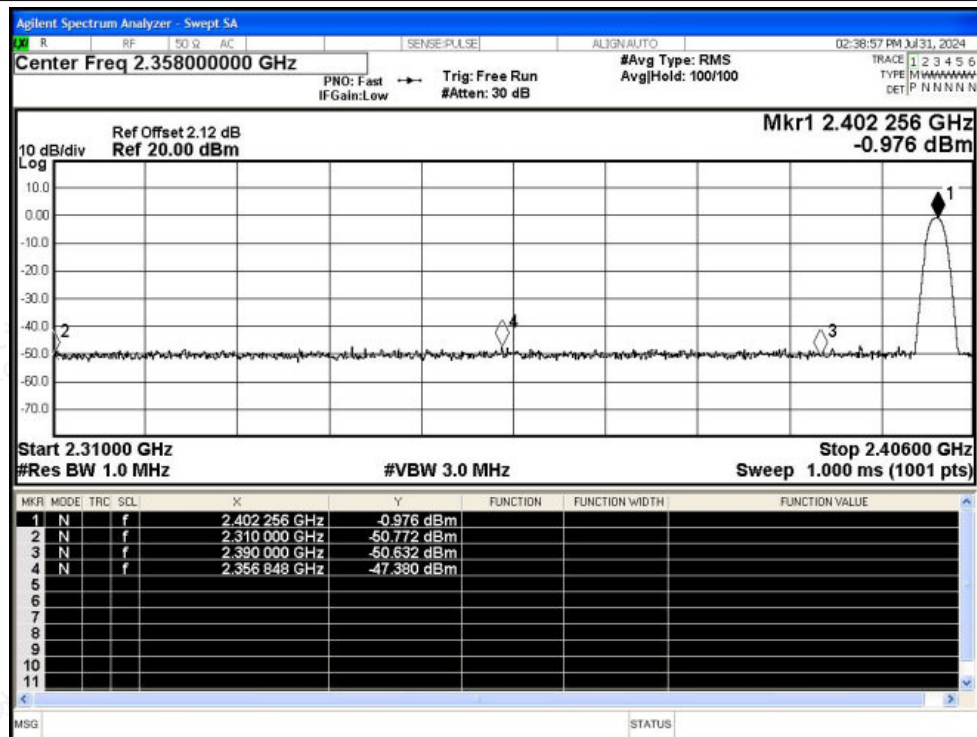

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Average

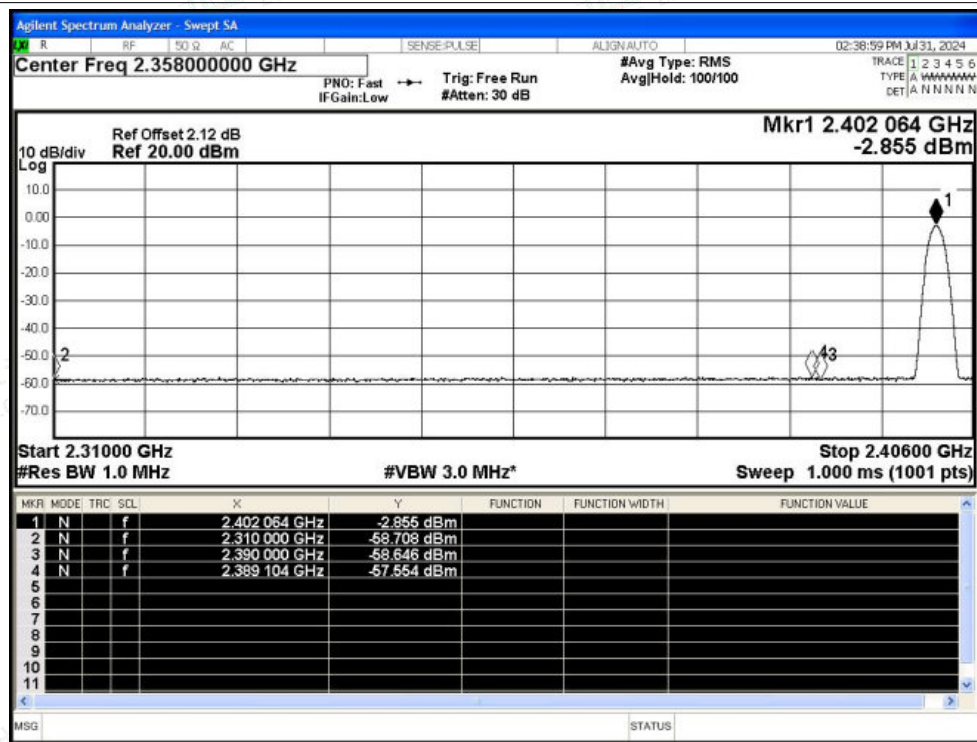

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Peak

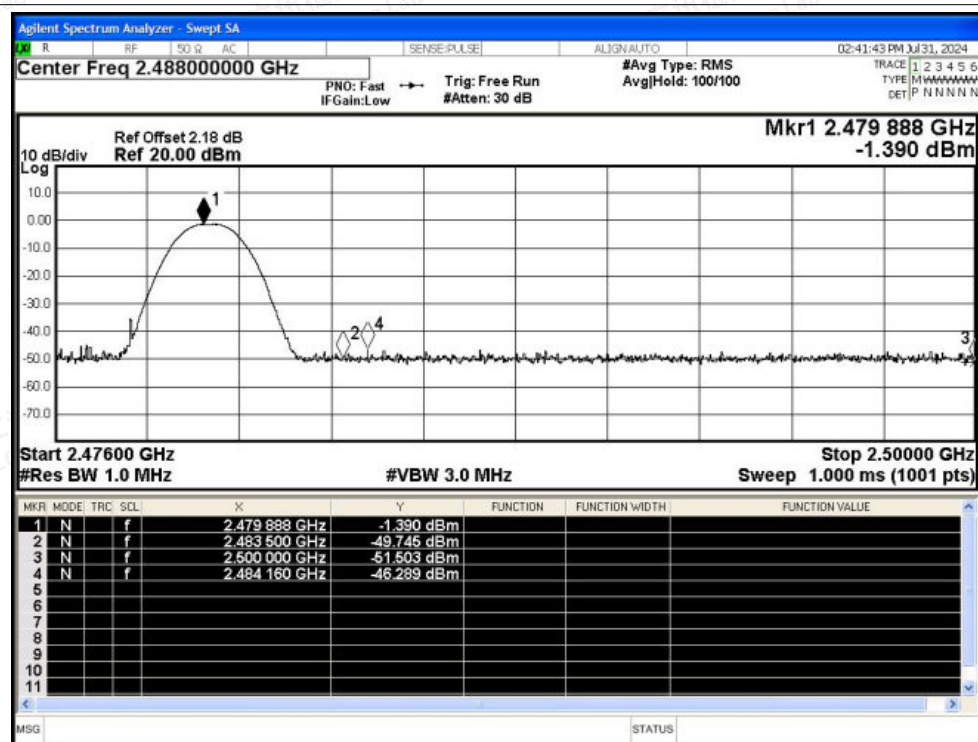

Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Average

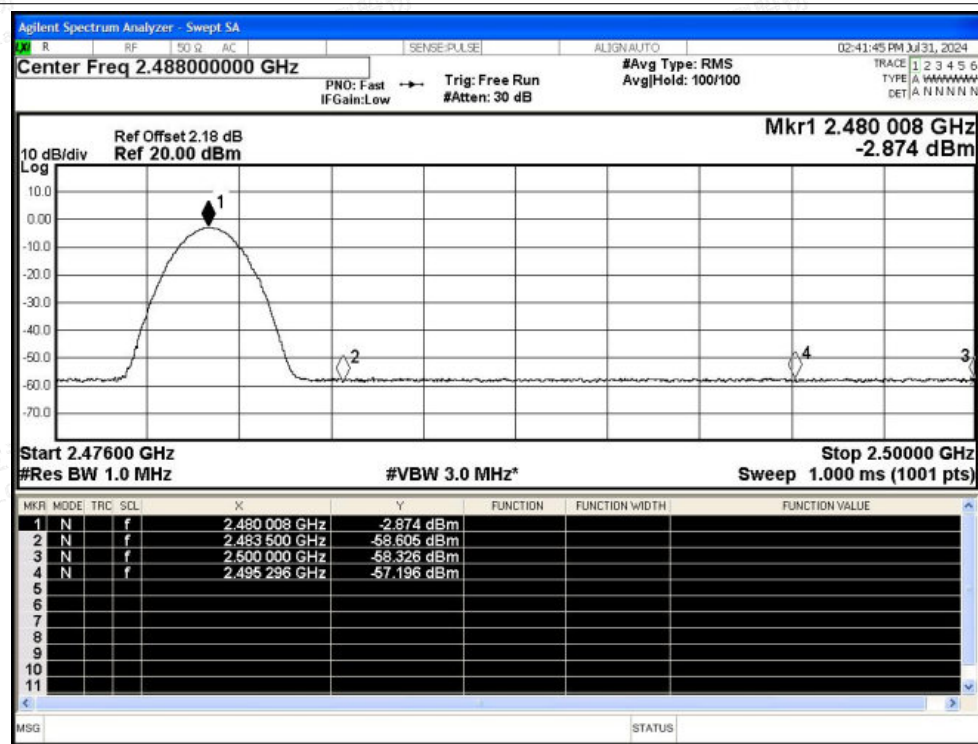

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Peak

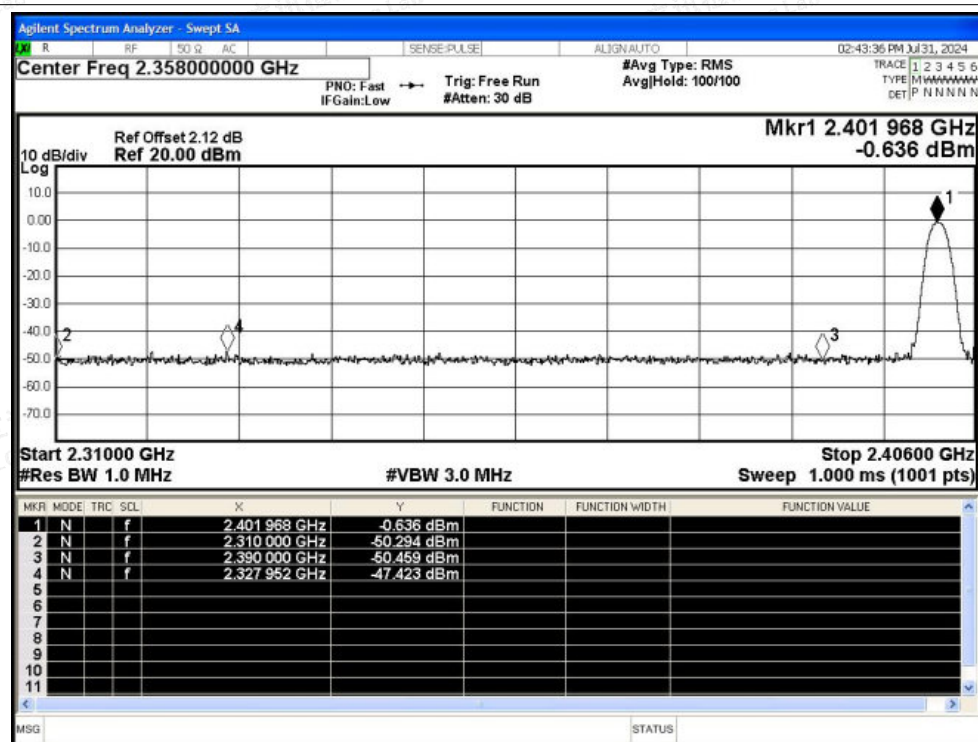

Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Average

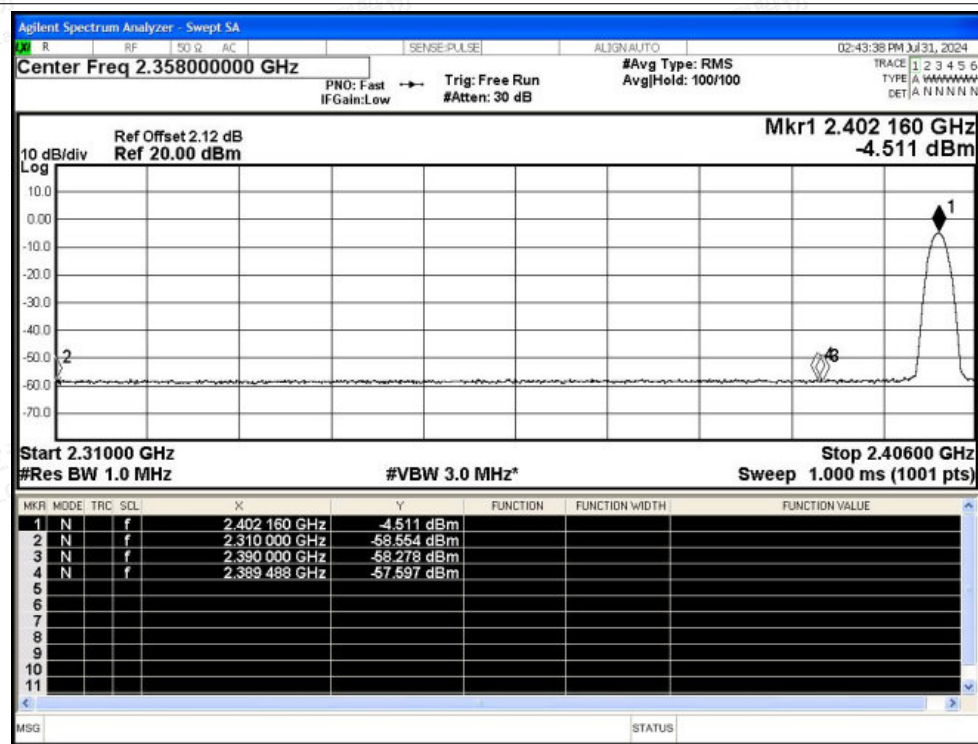

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Peak

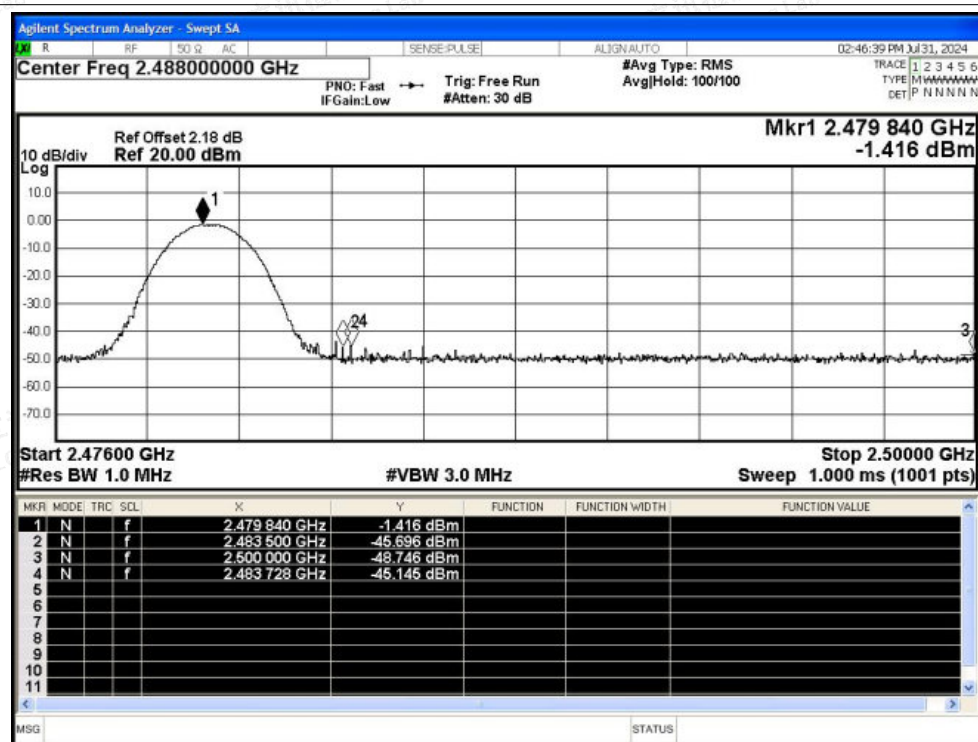

Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Average

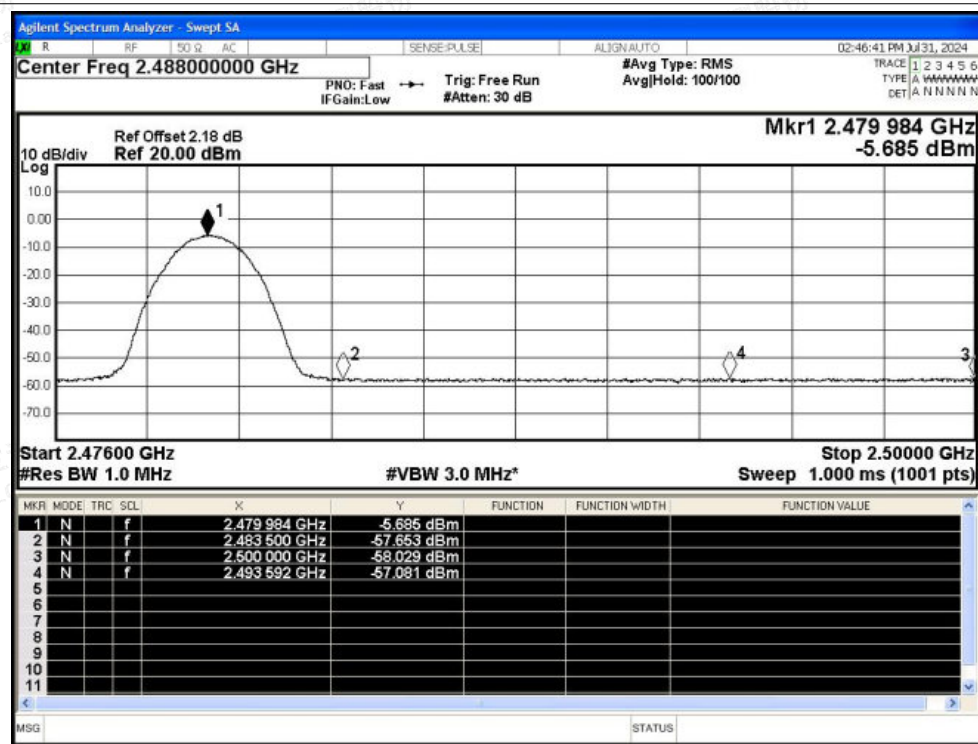

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Peak

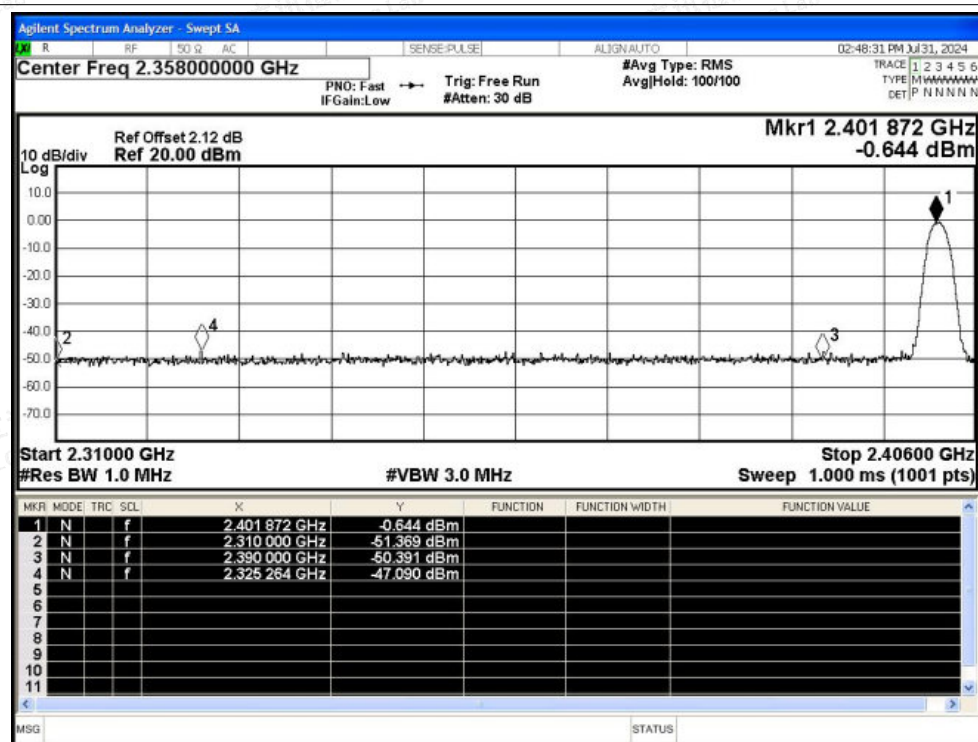

Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Average

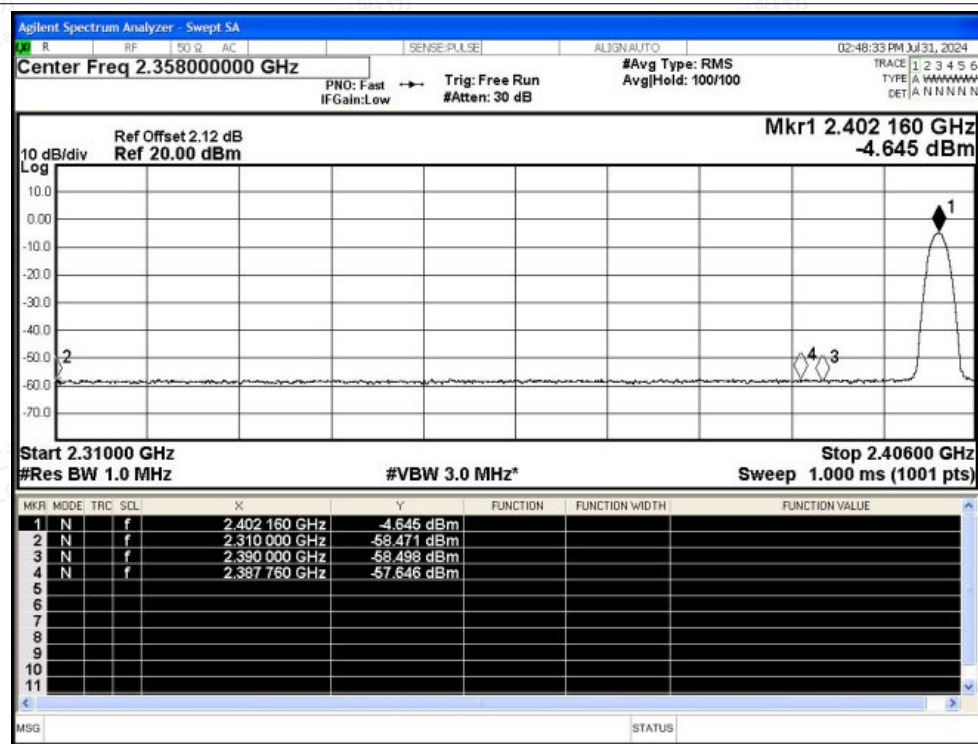

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Peak

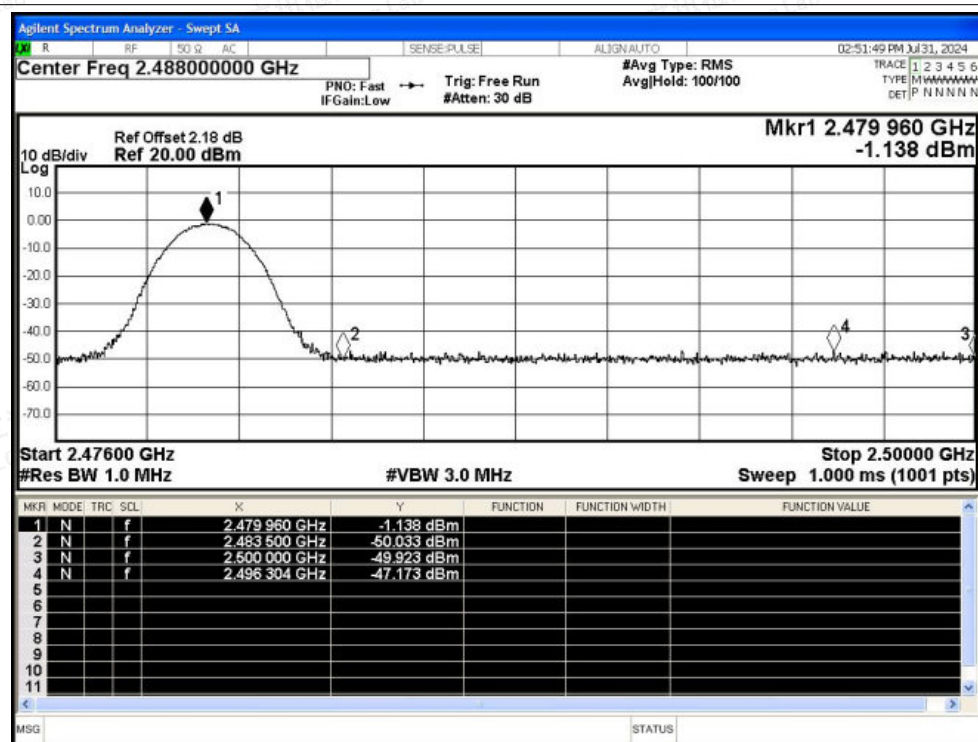

Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Average

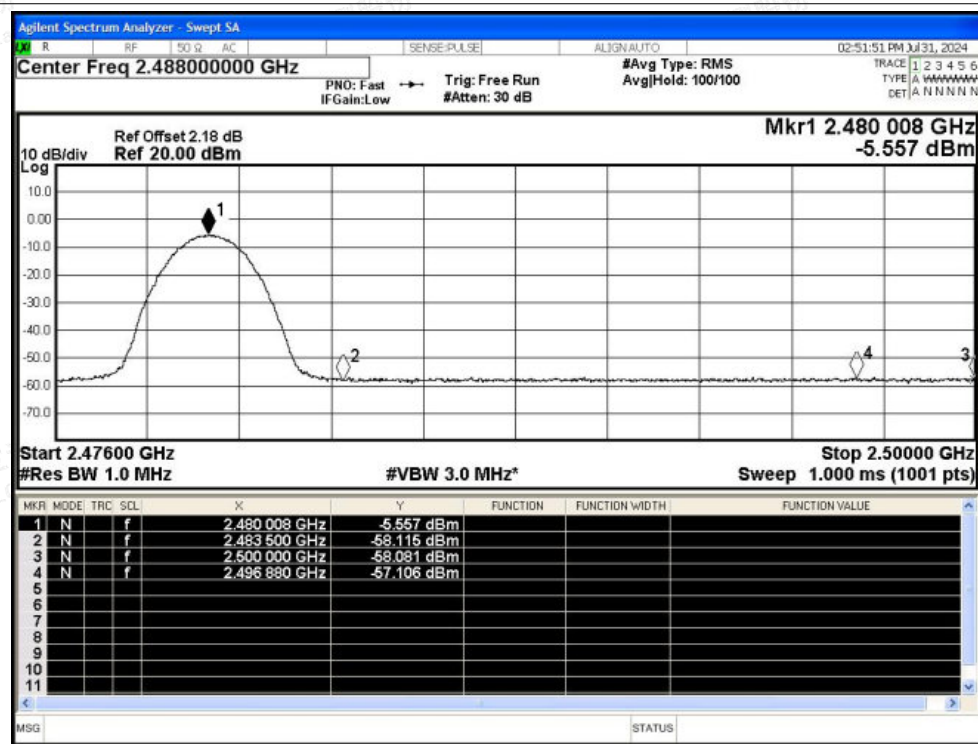

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity