






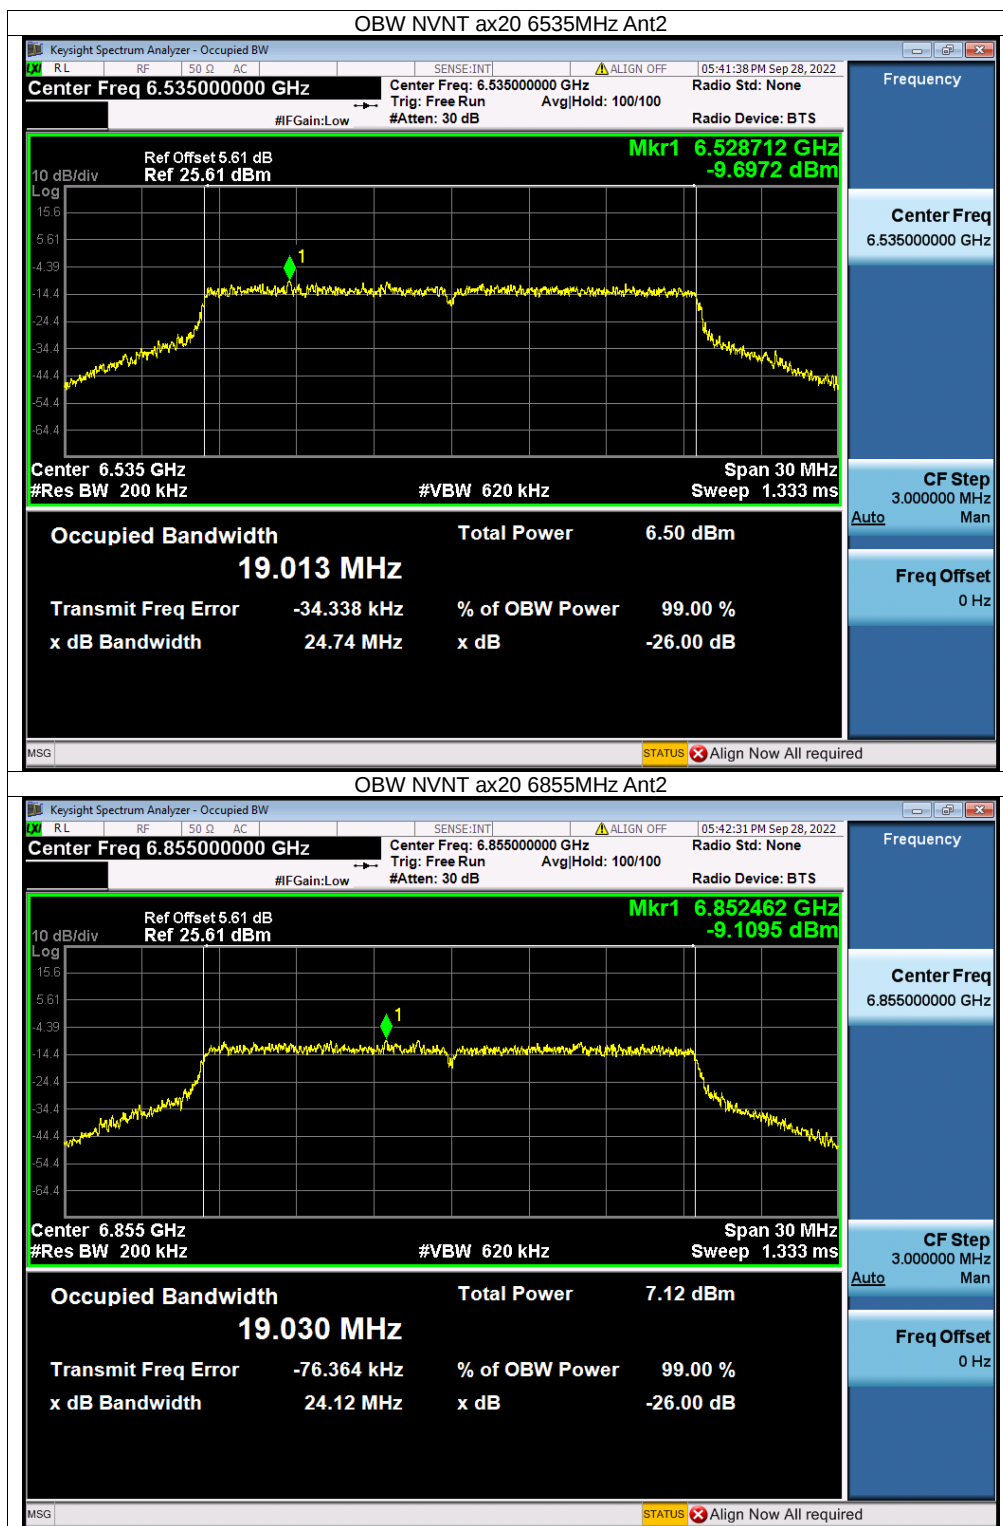


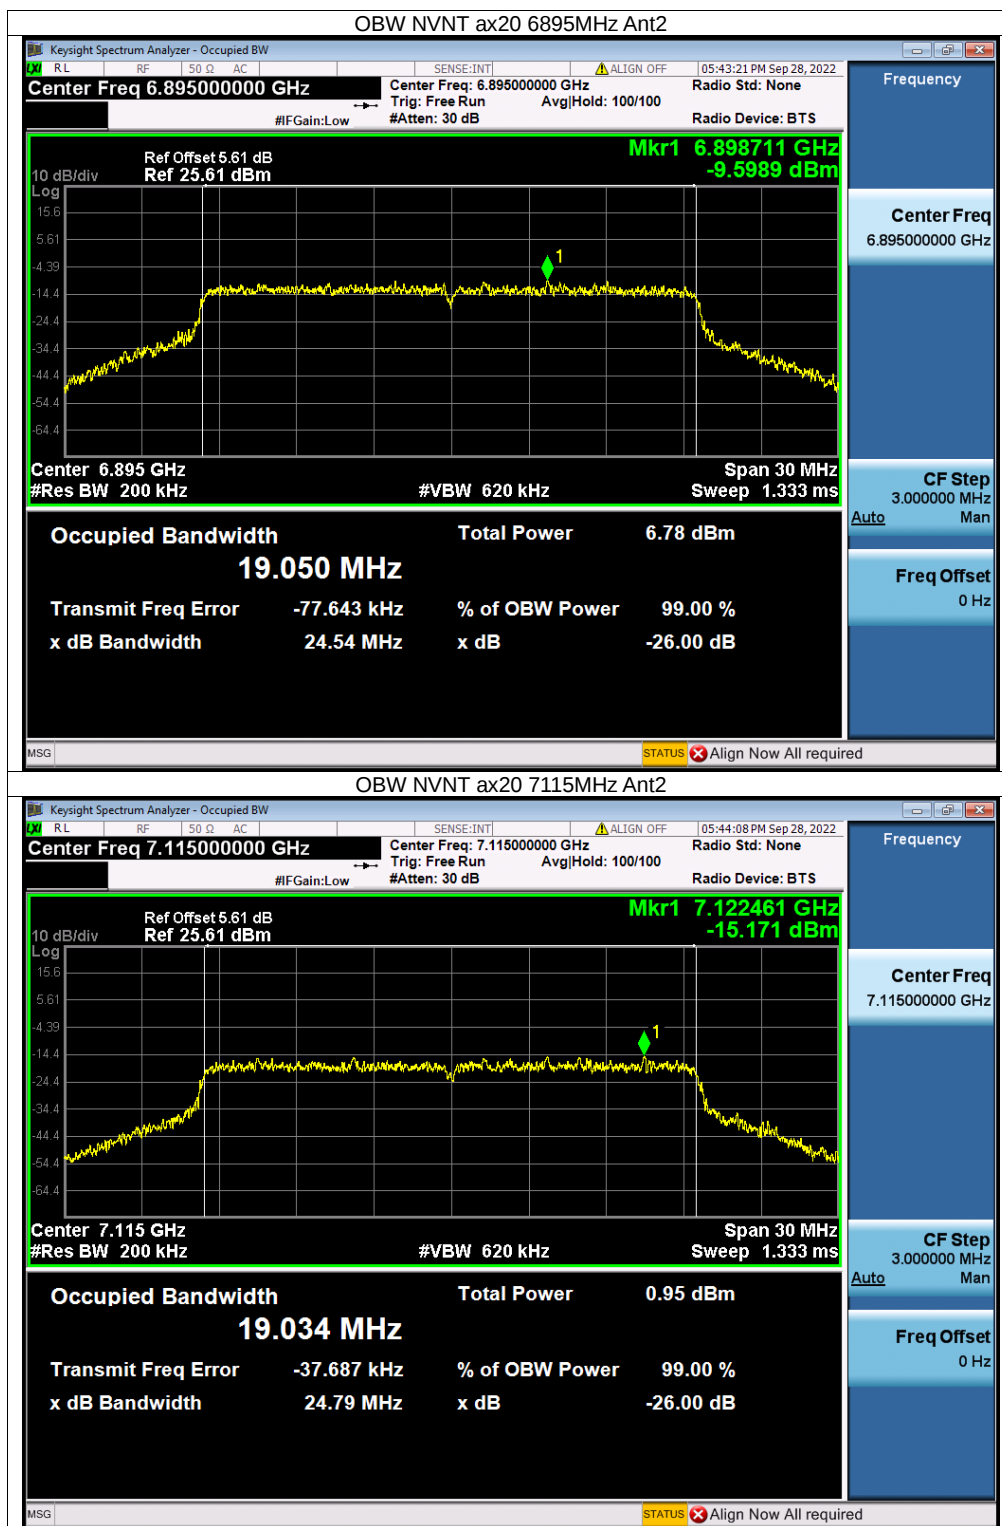


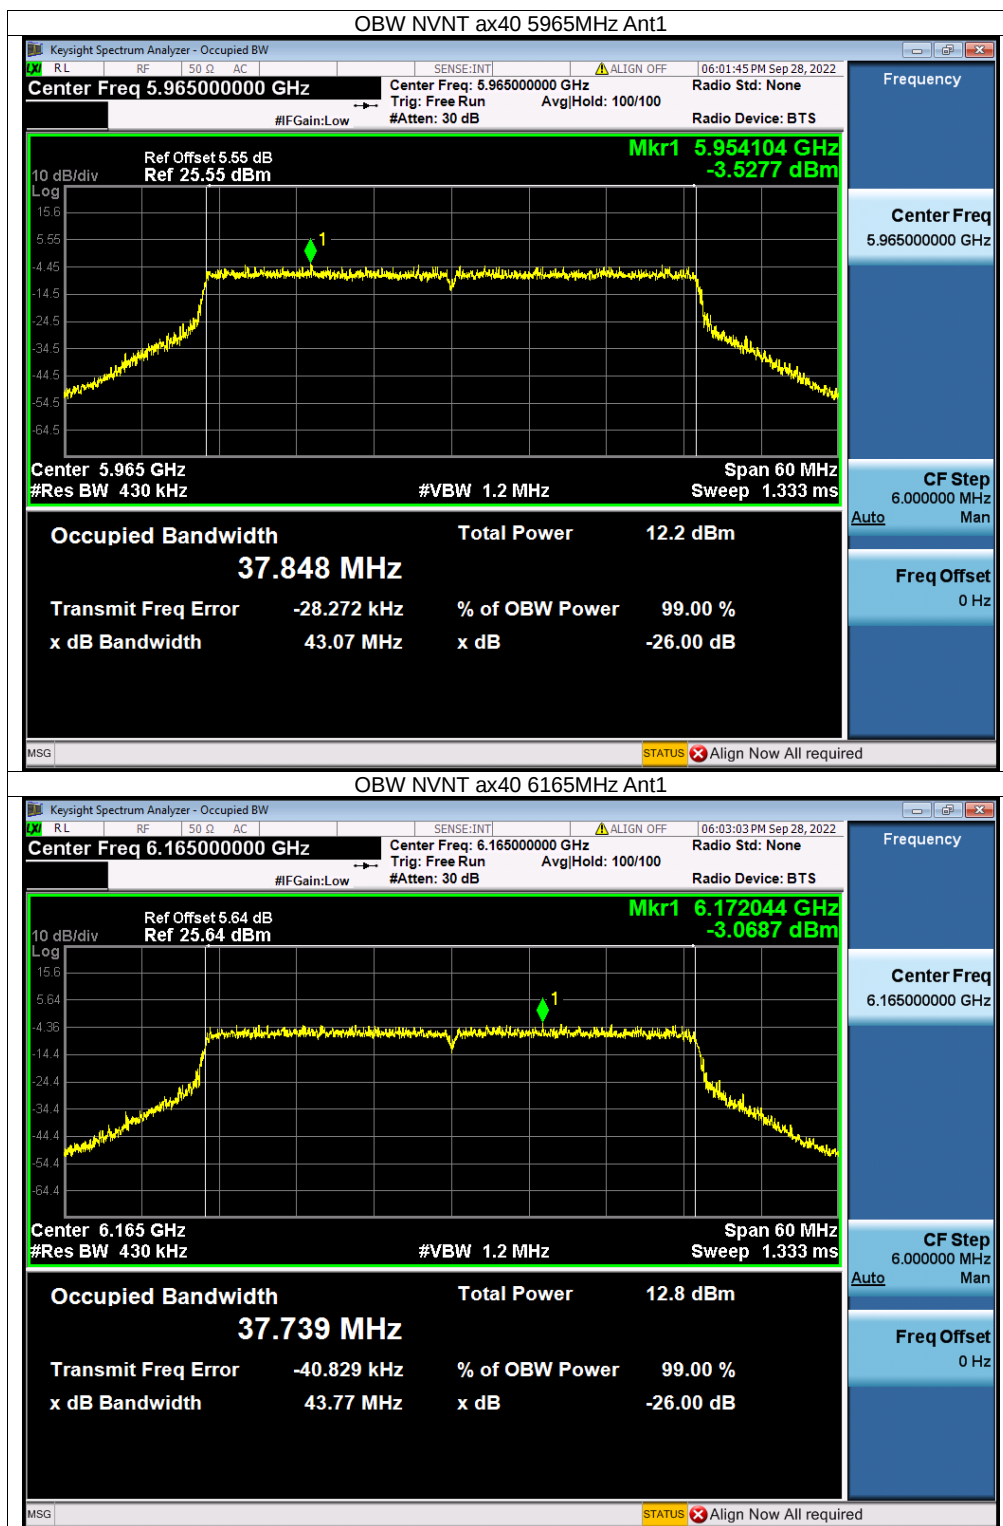


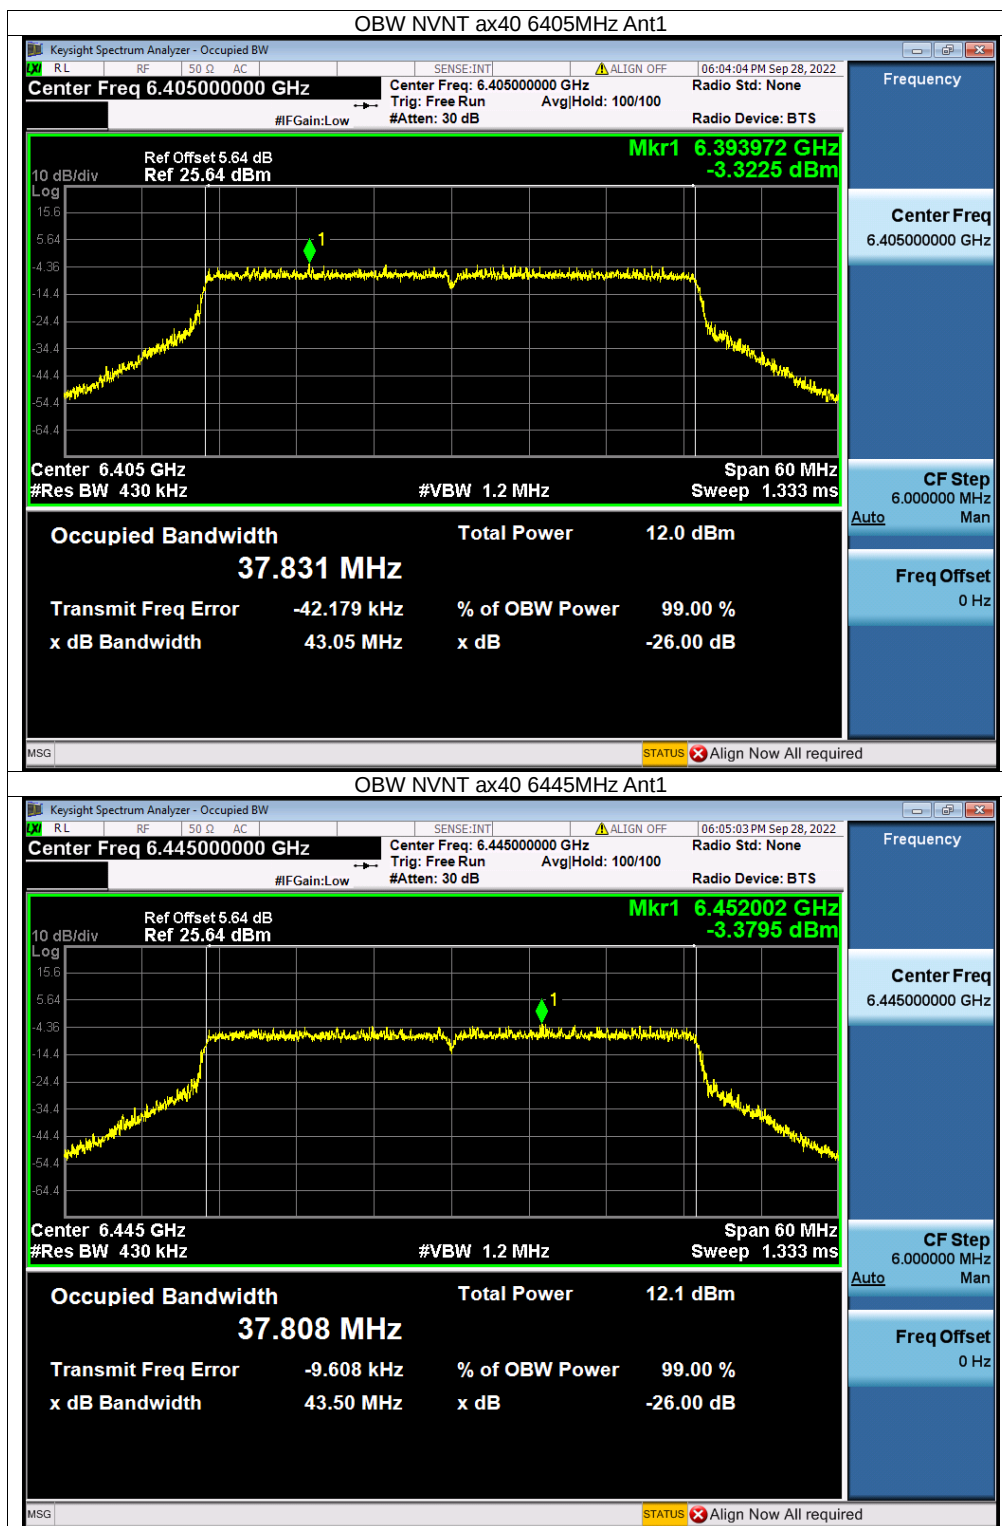


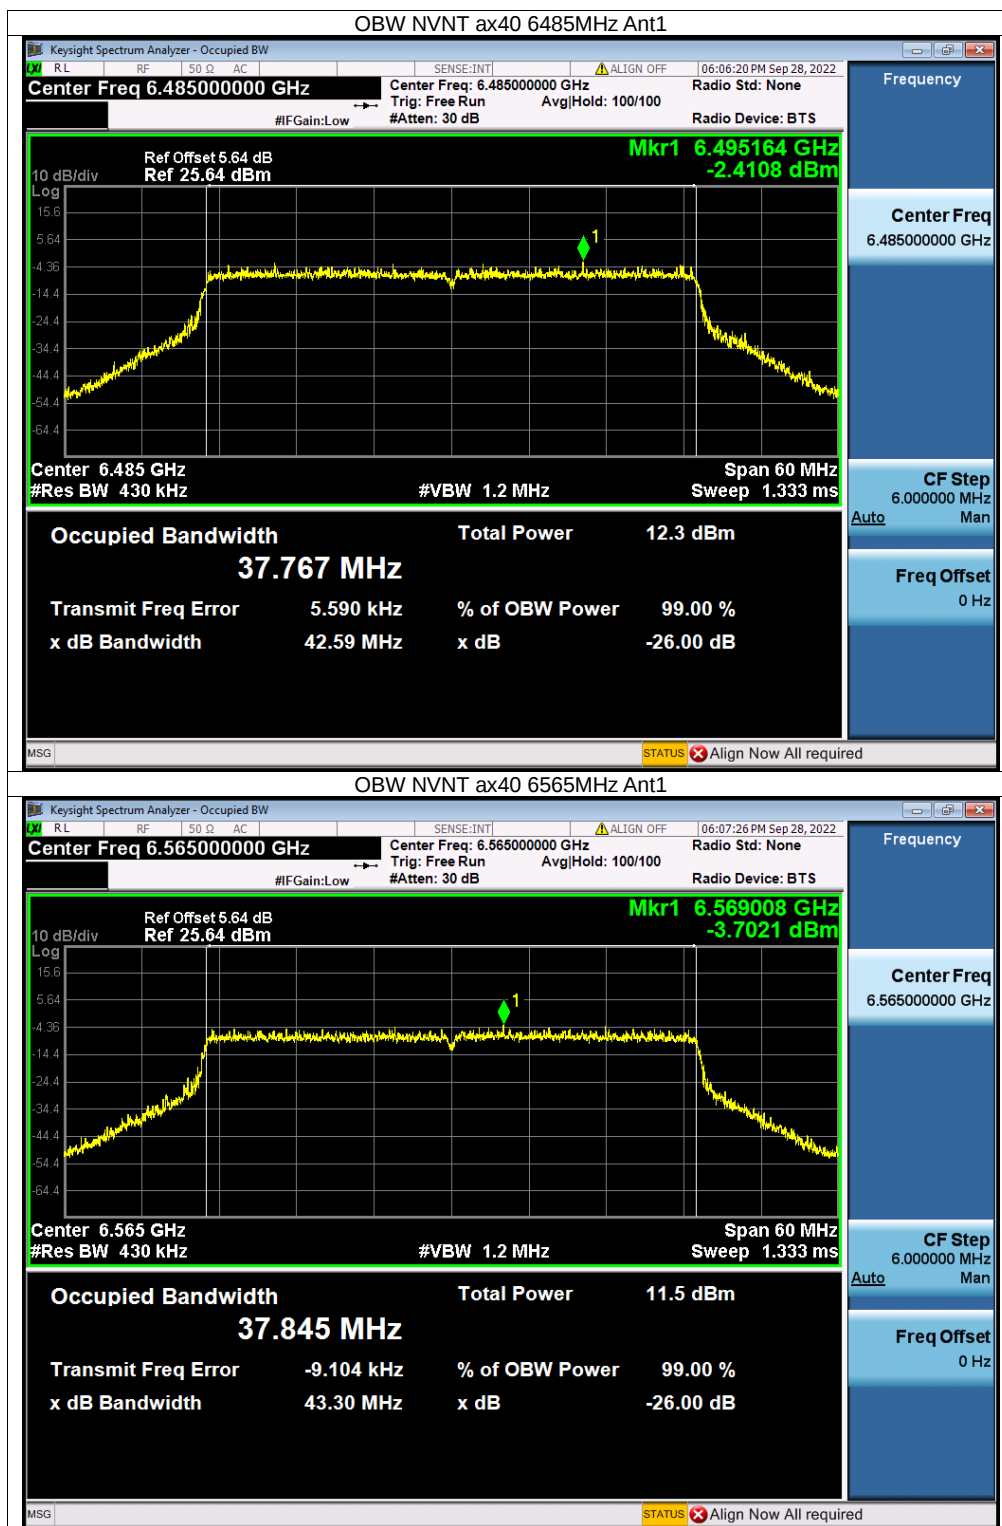


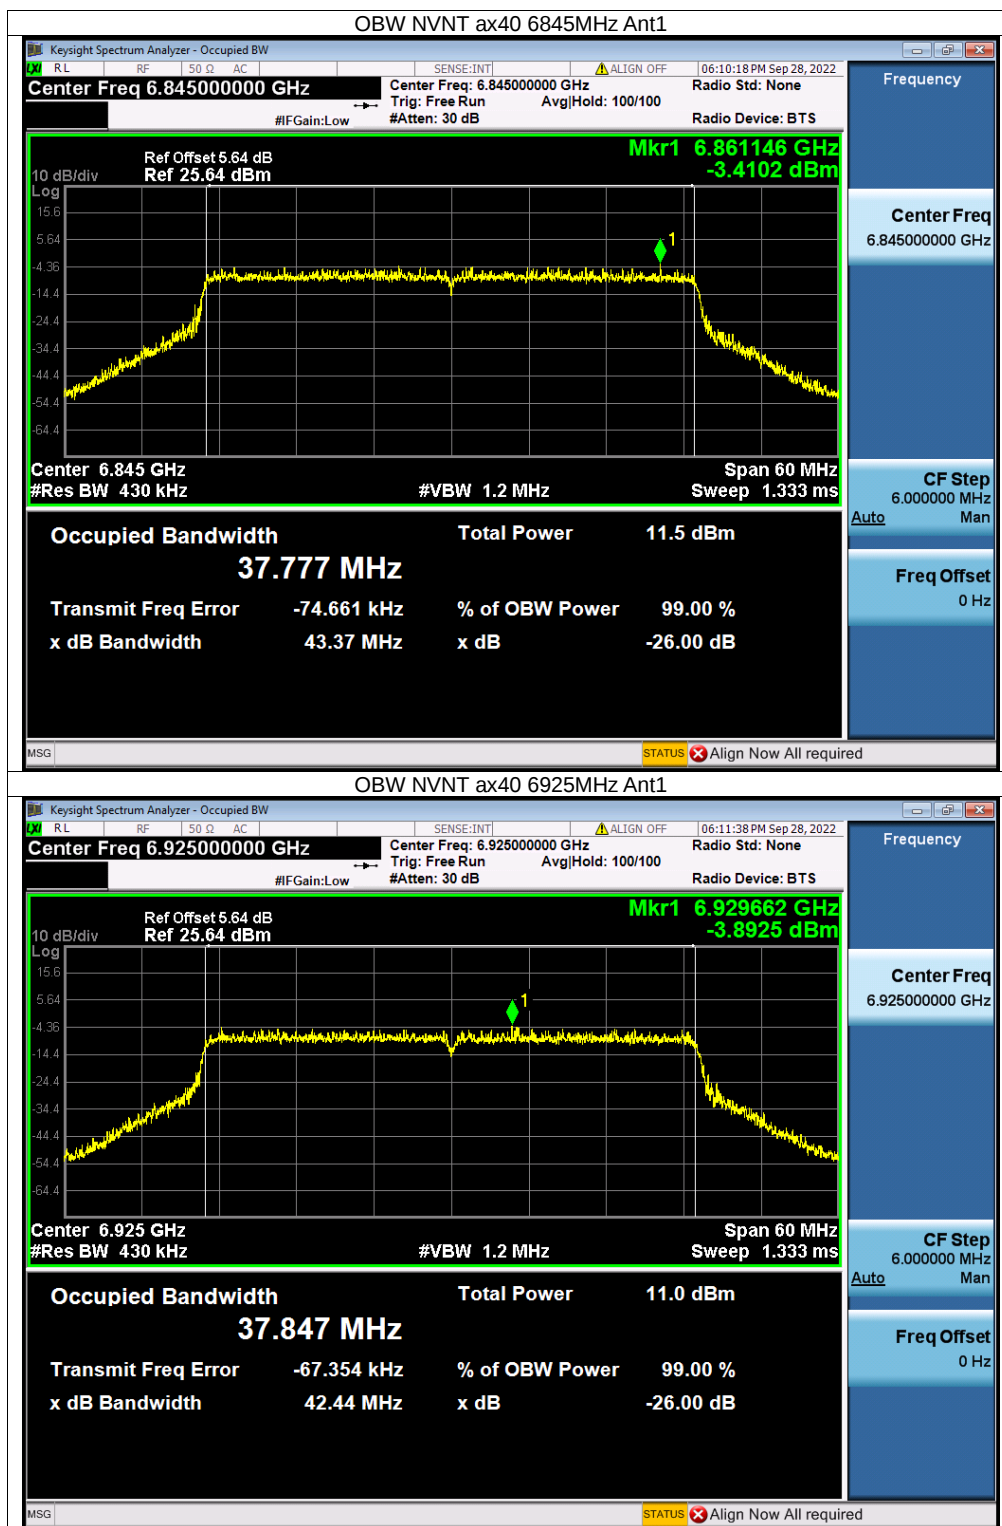


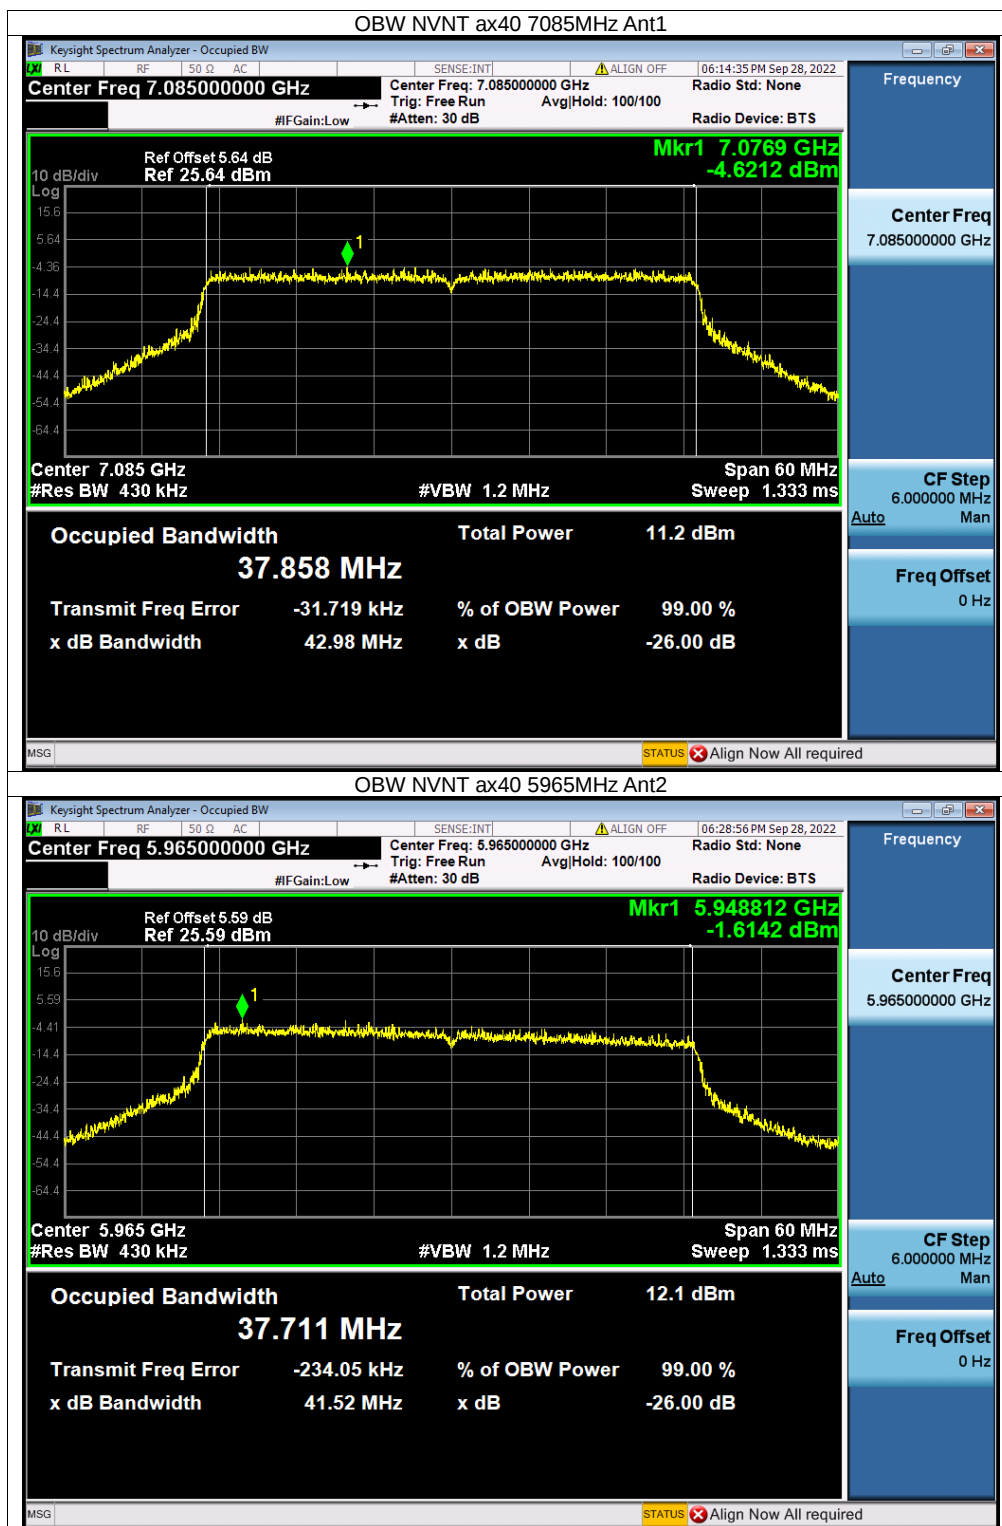


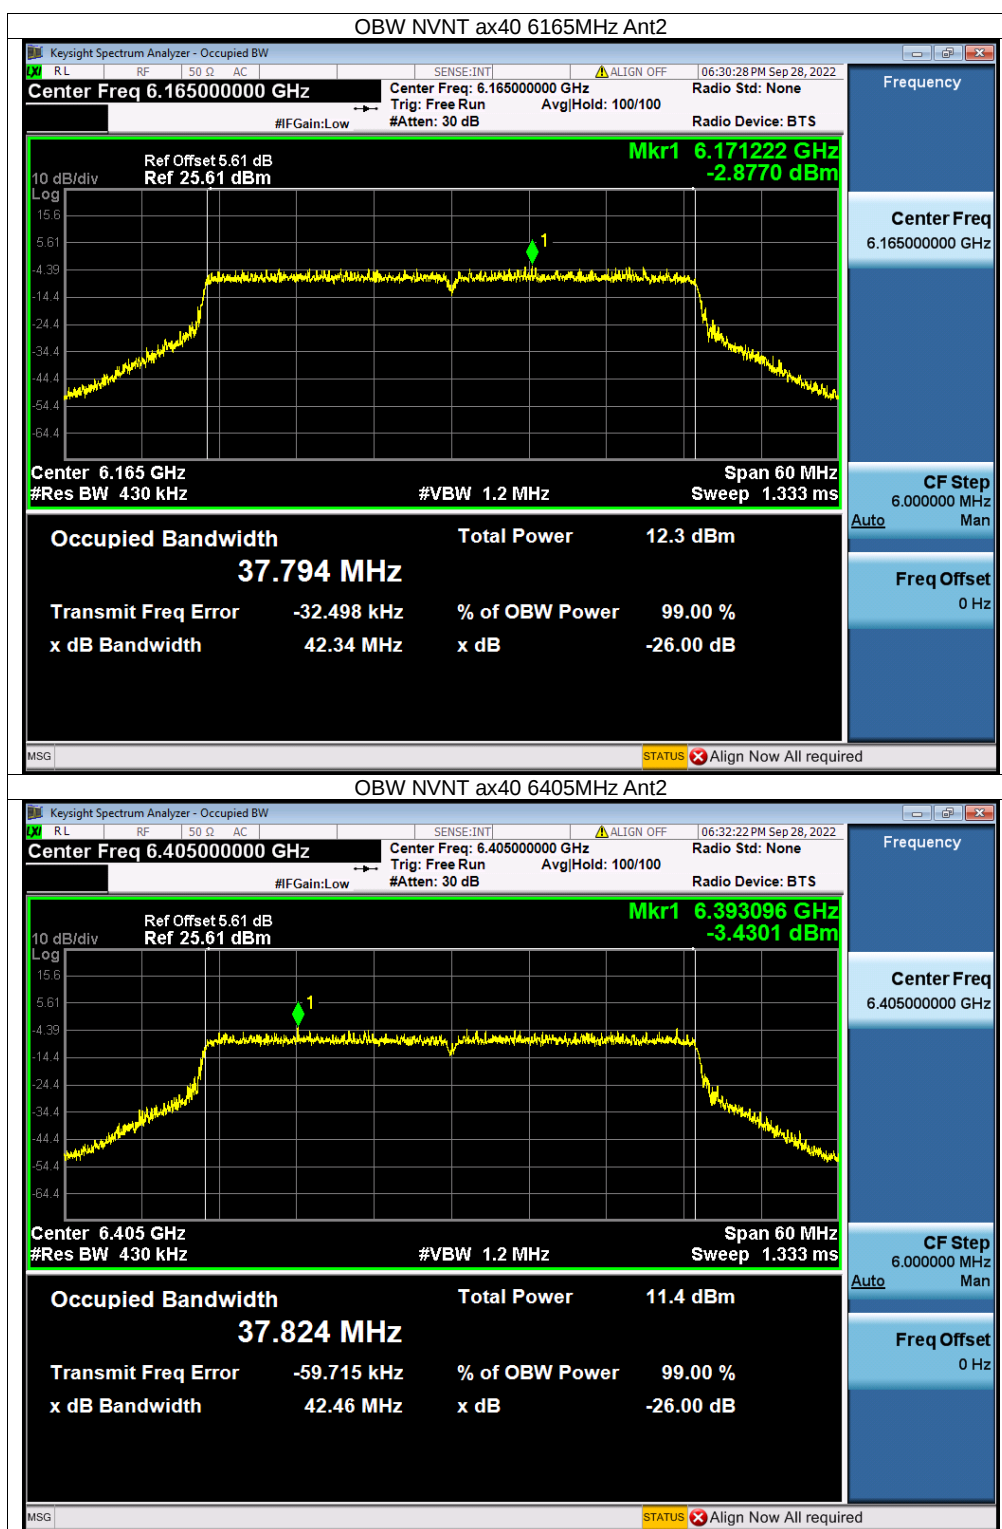


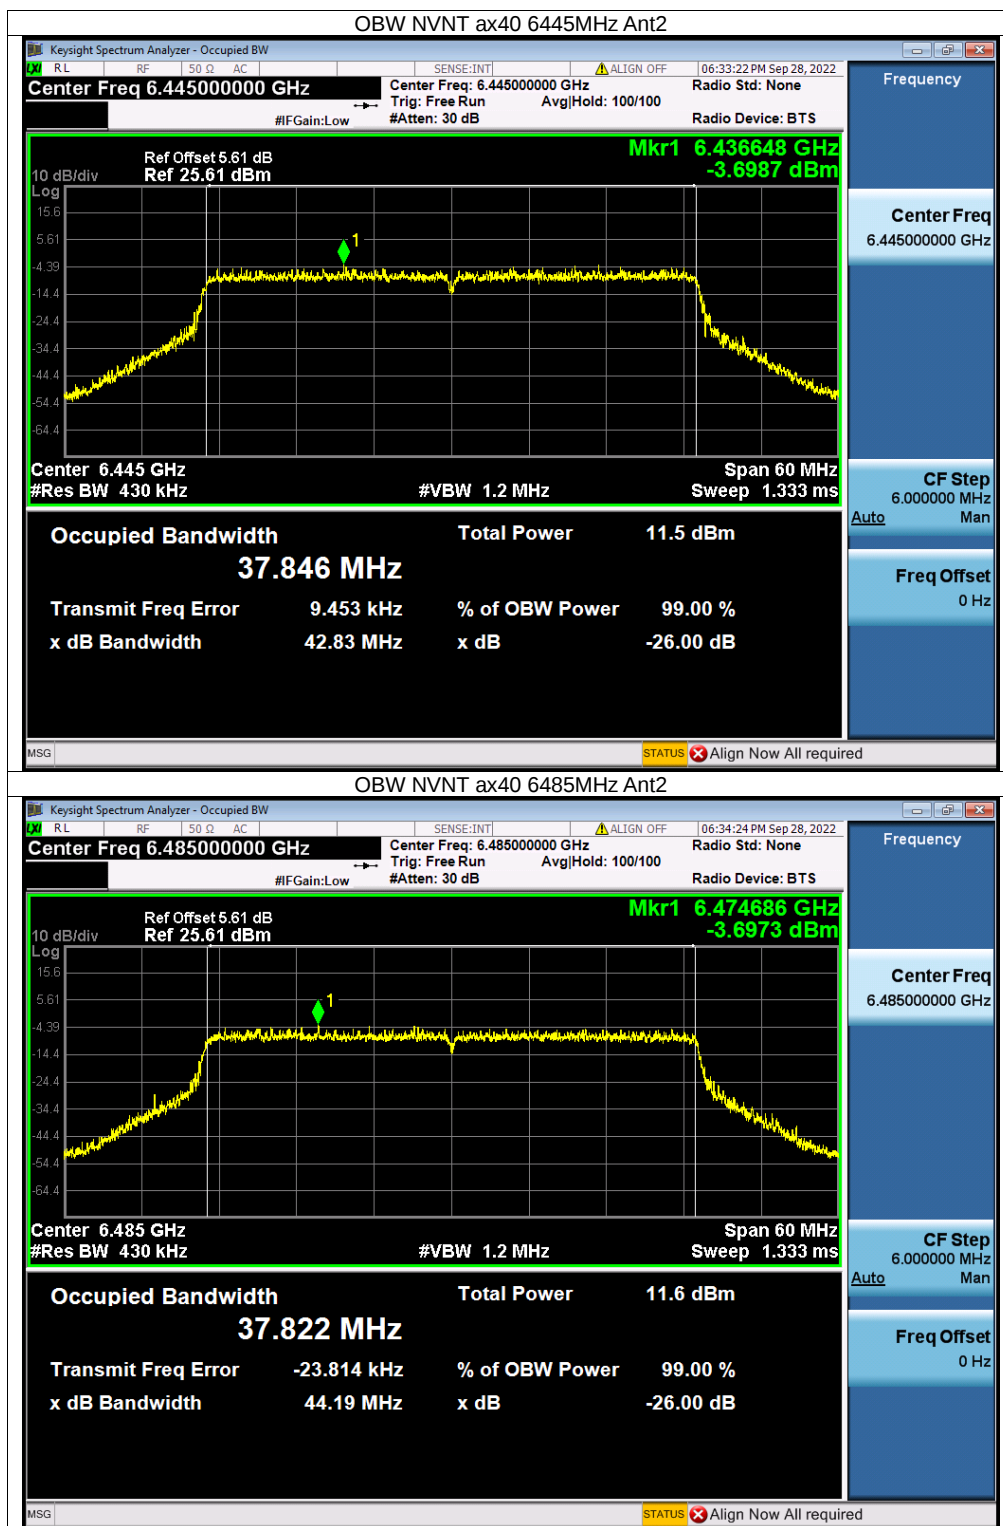


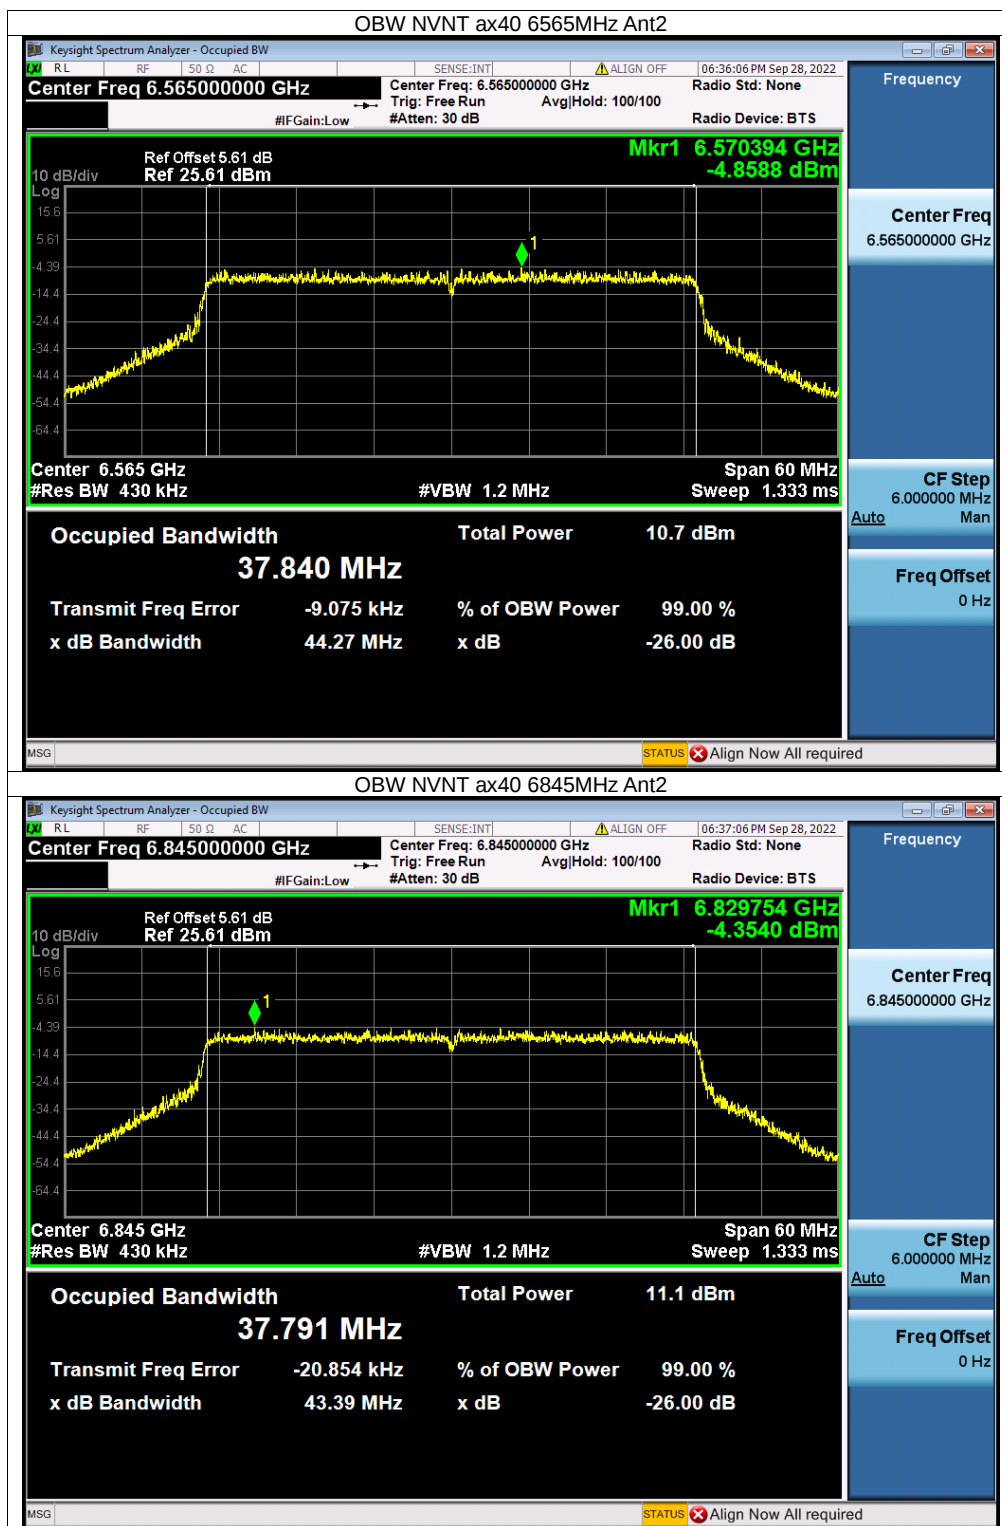


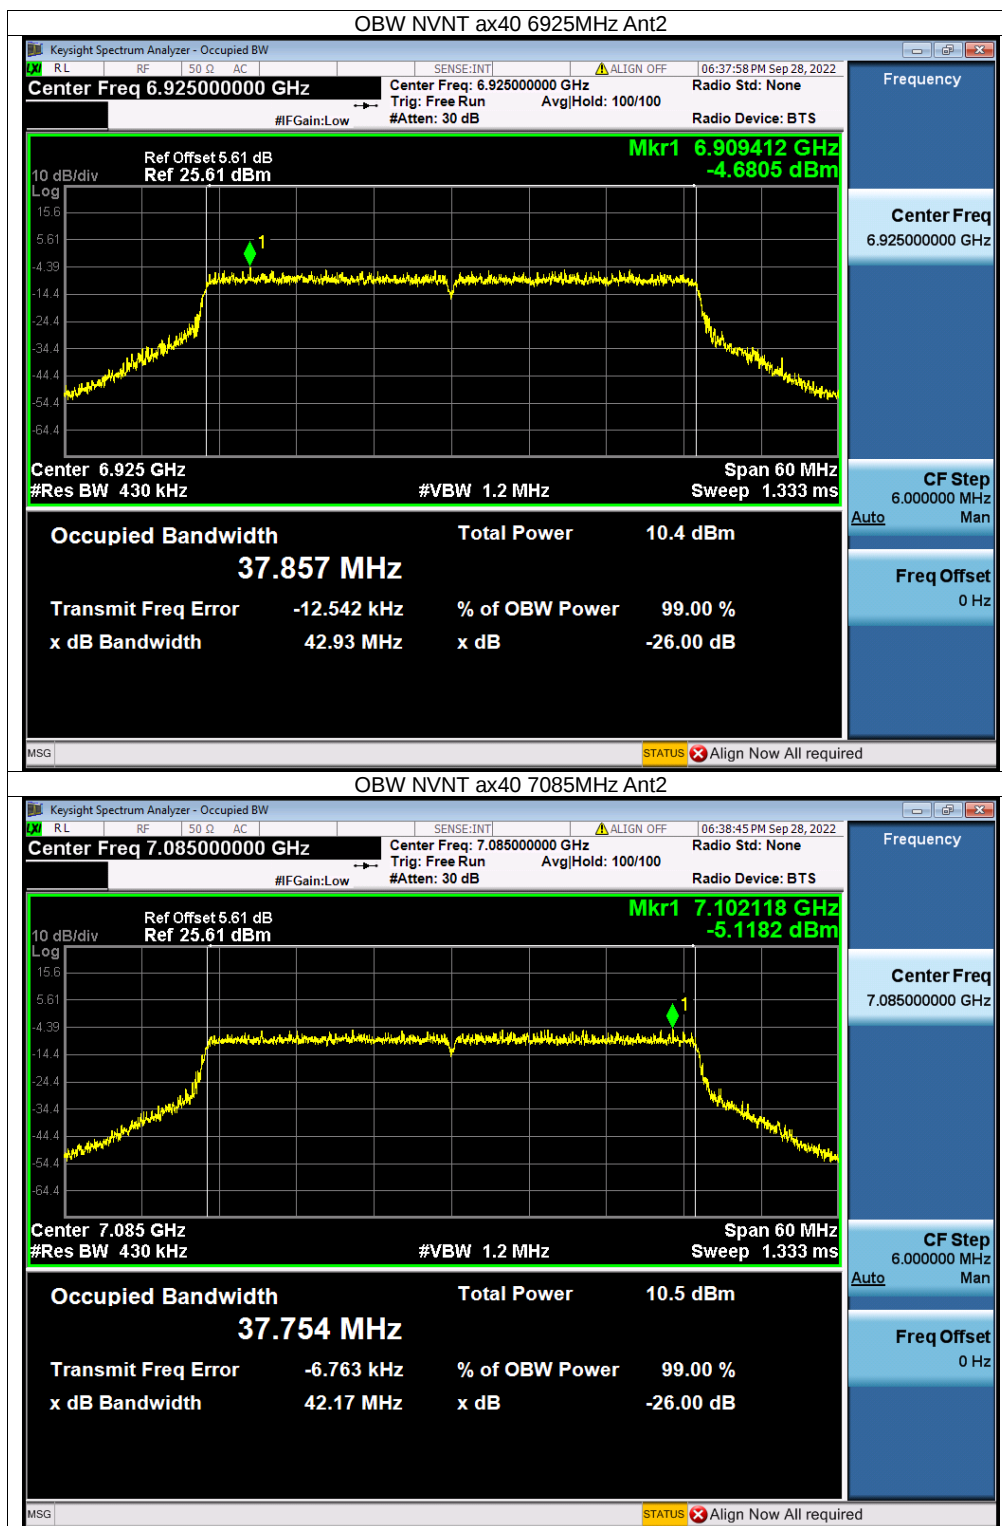


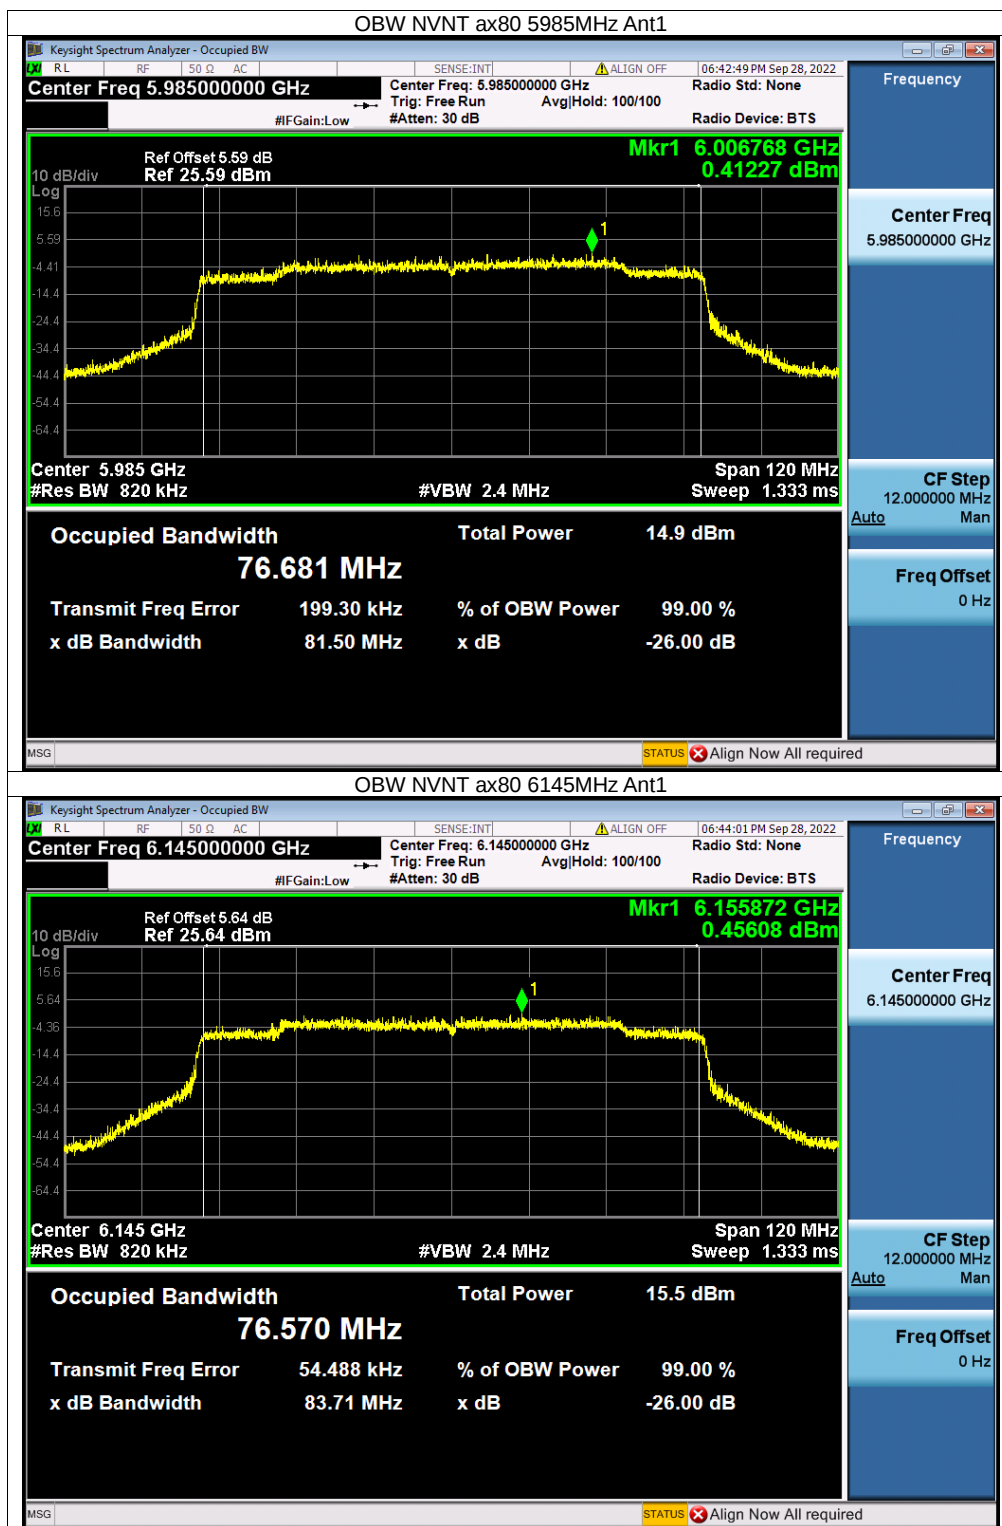


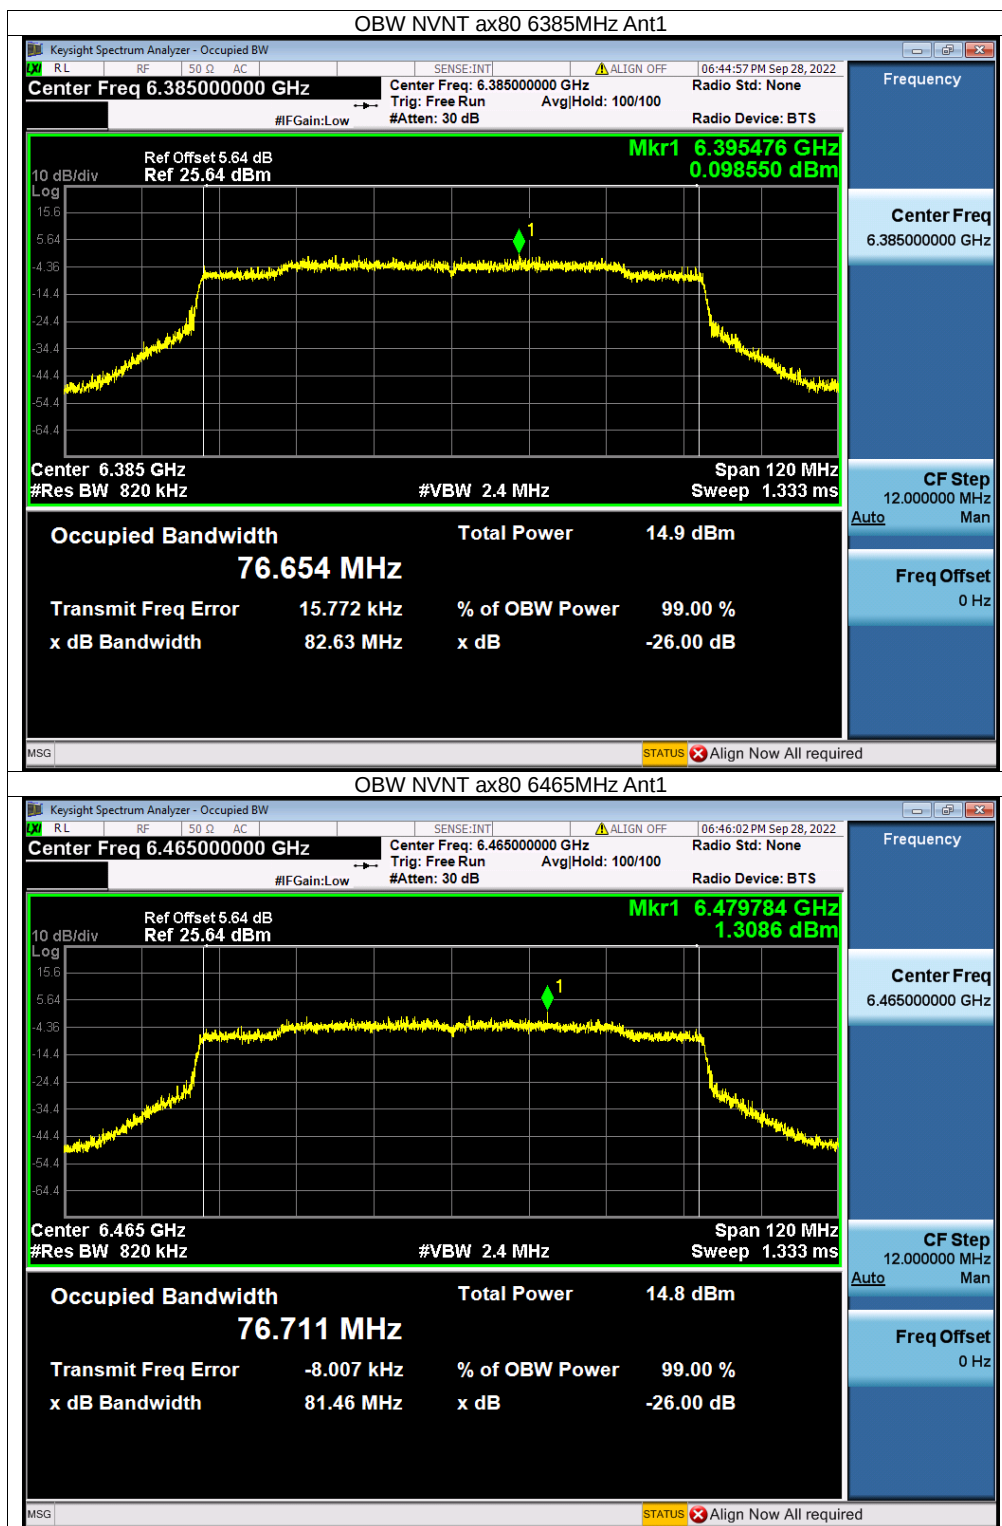


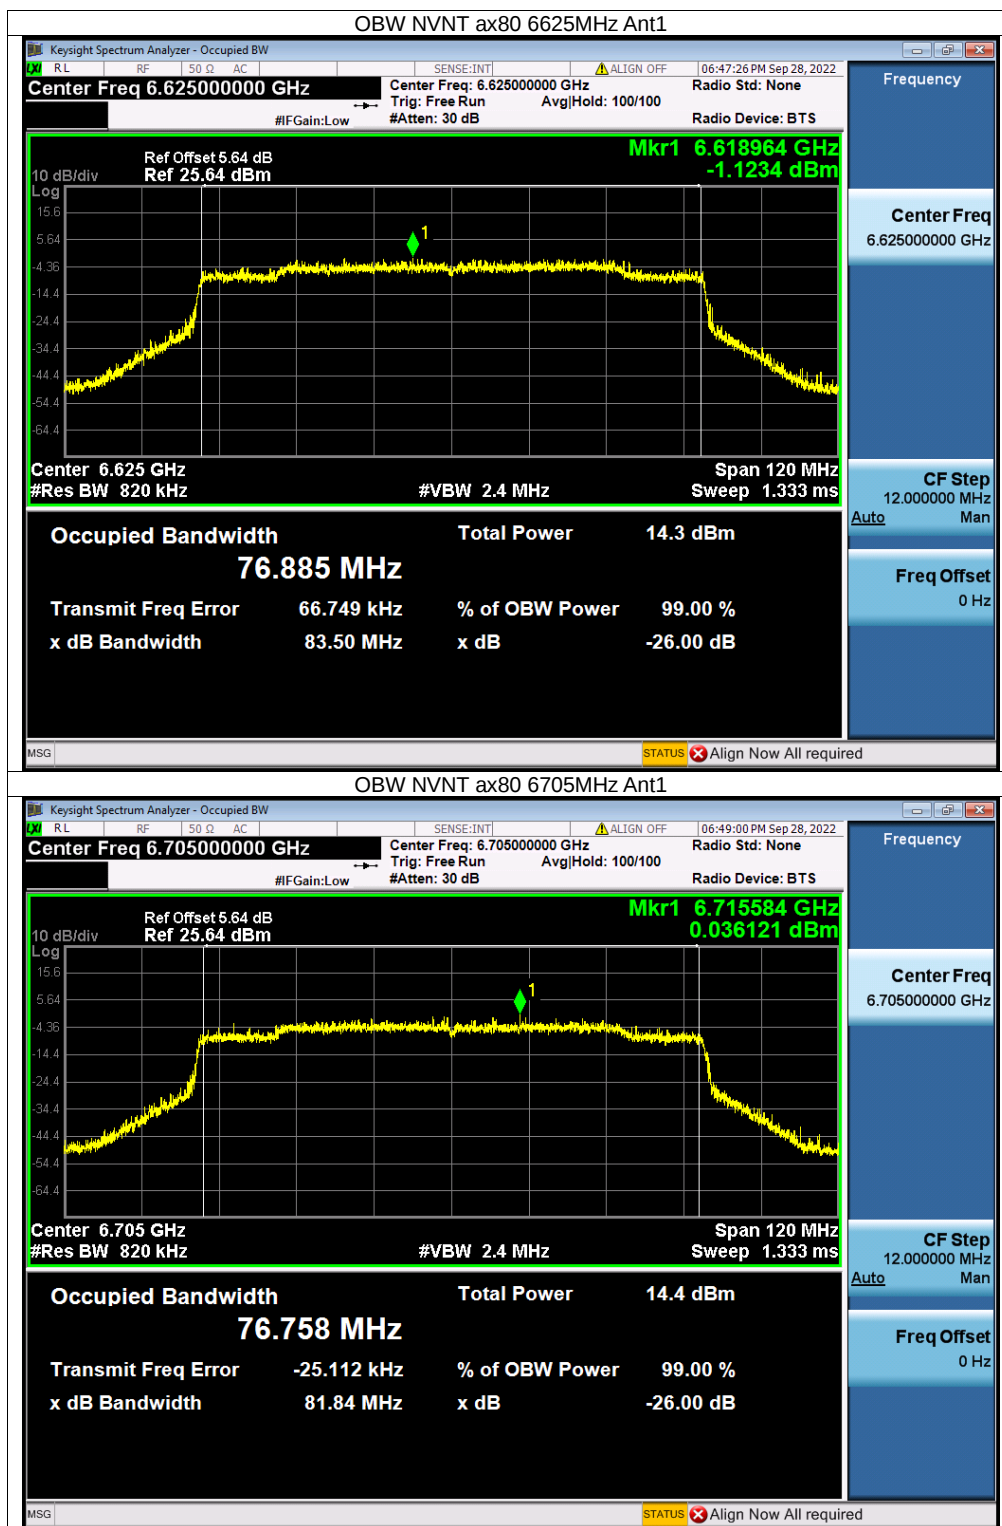


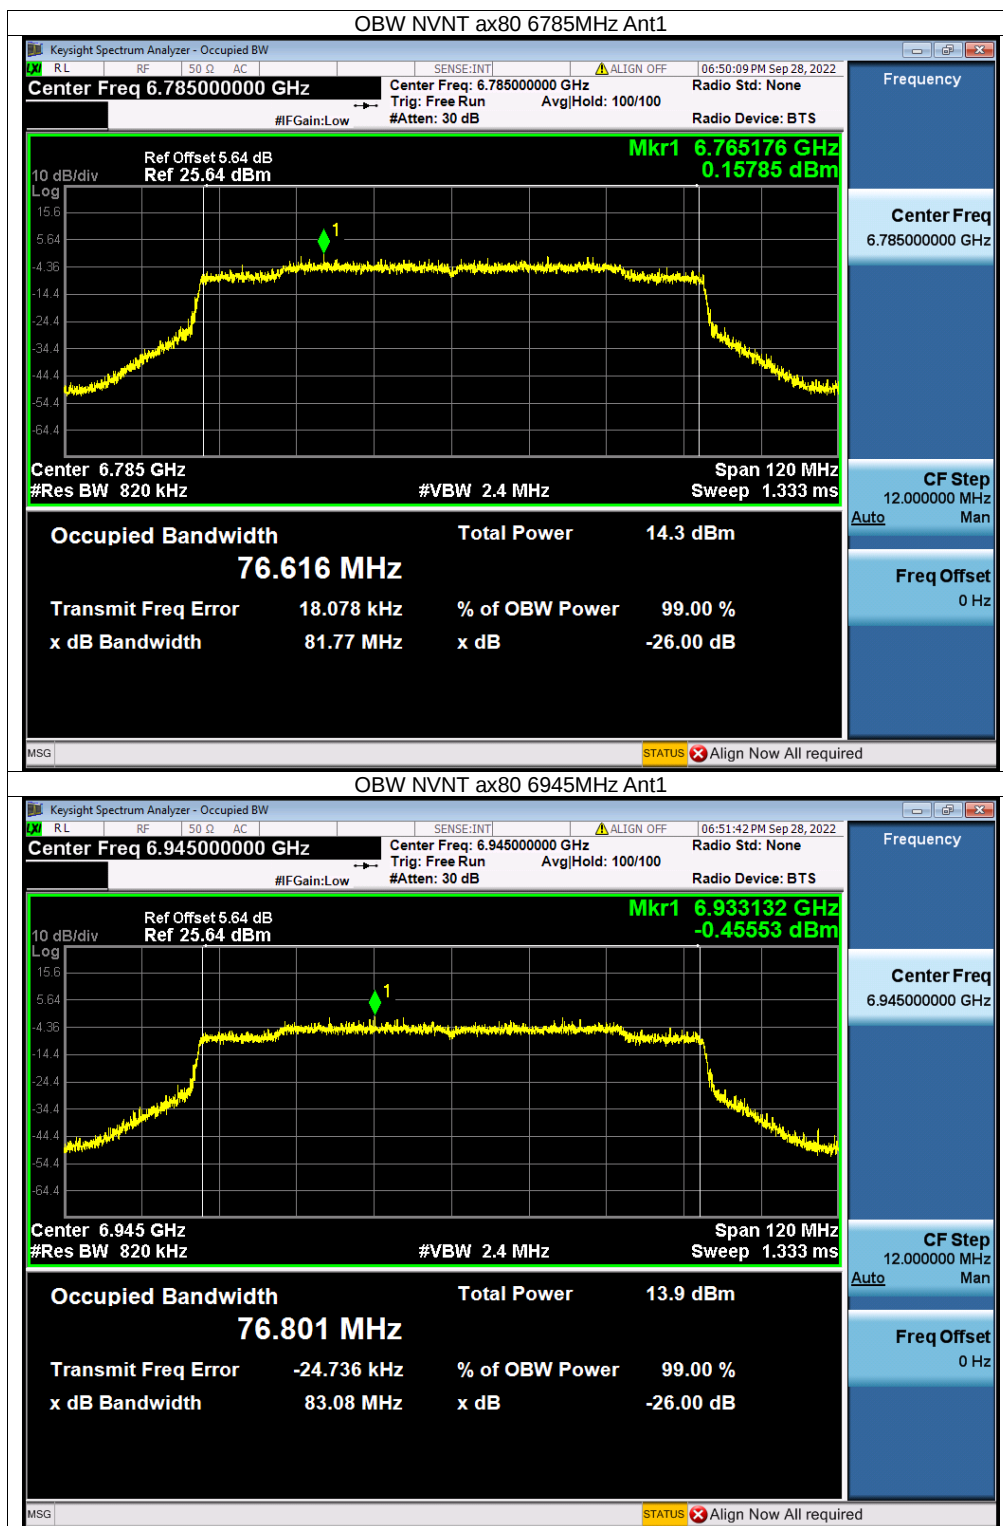


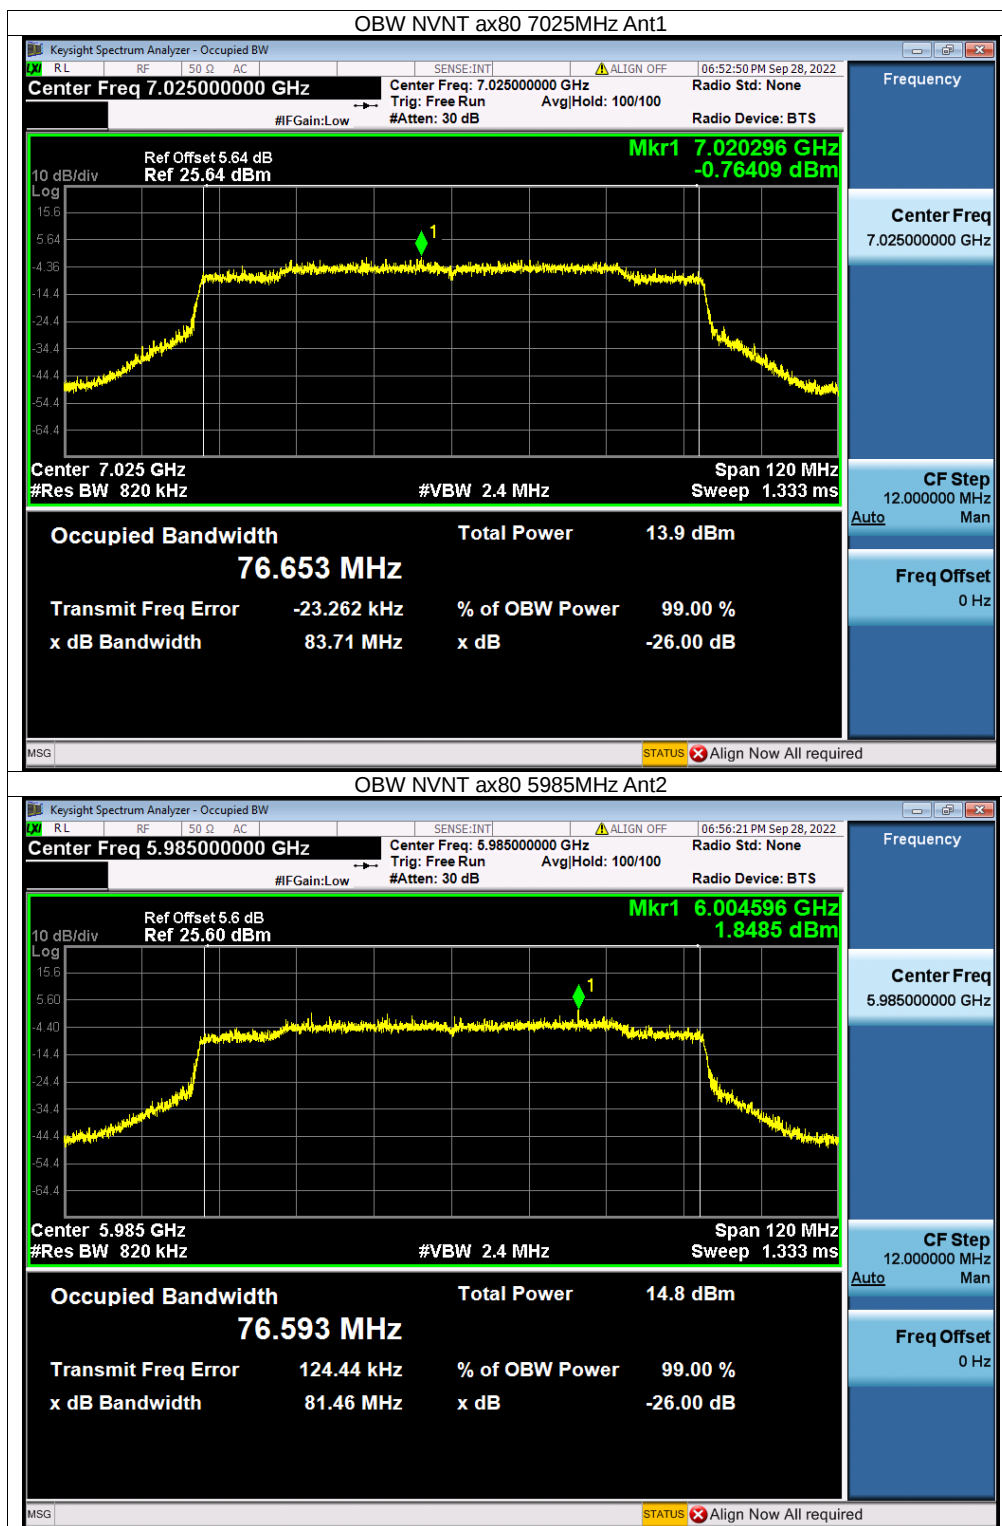

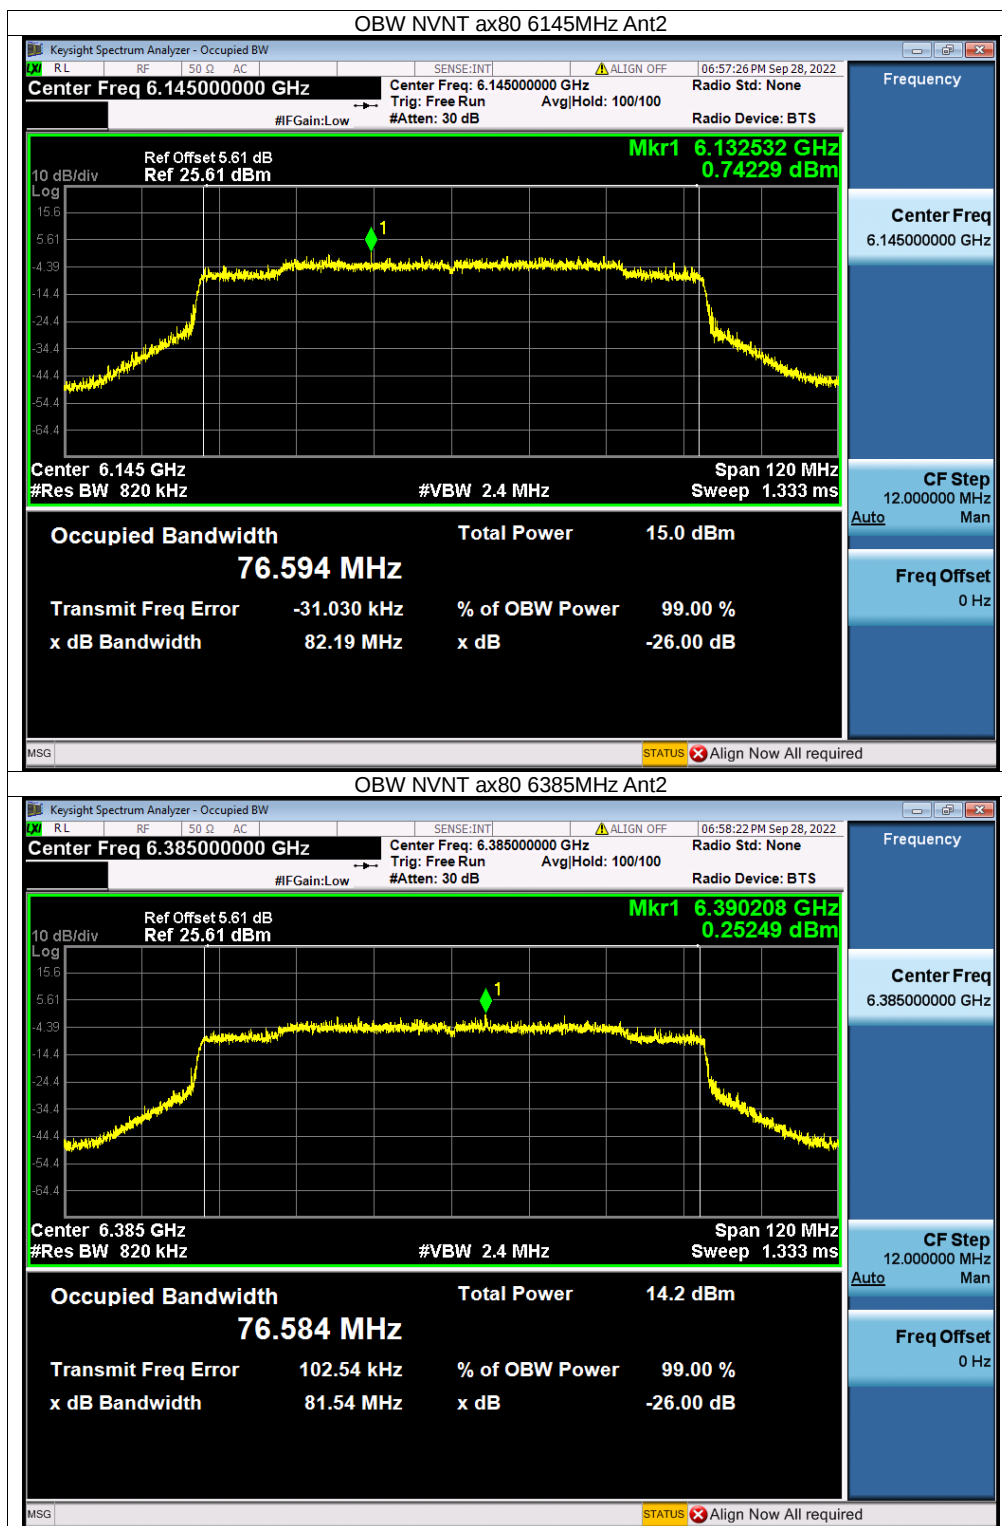

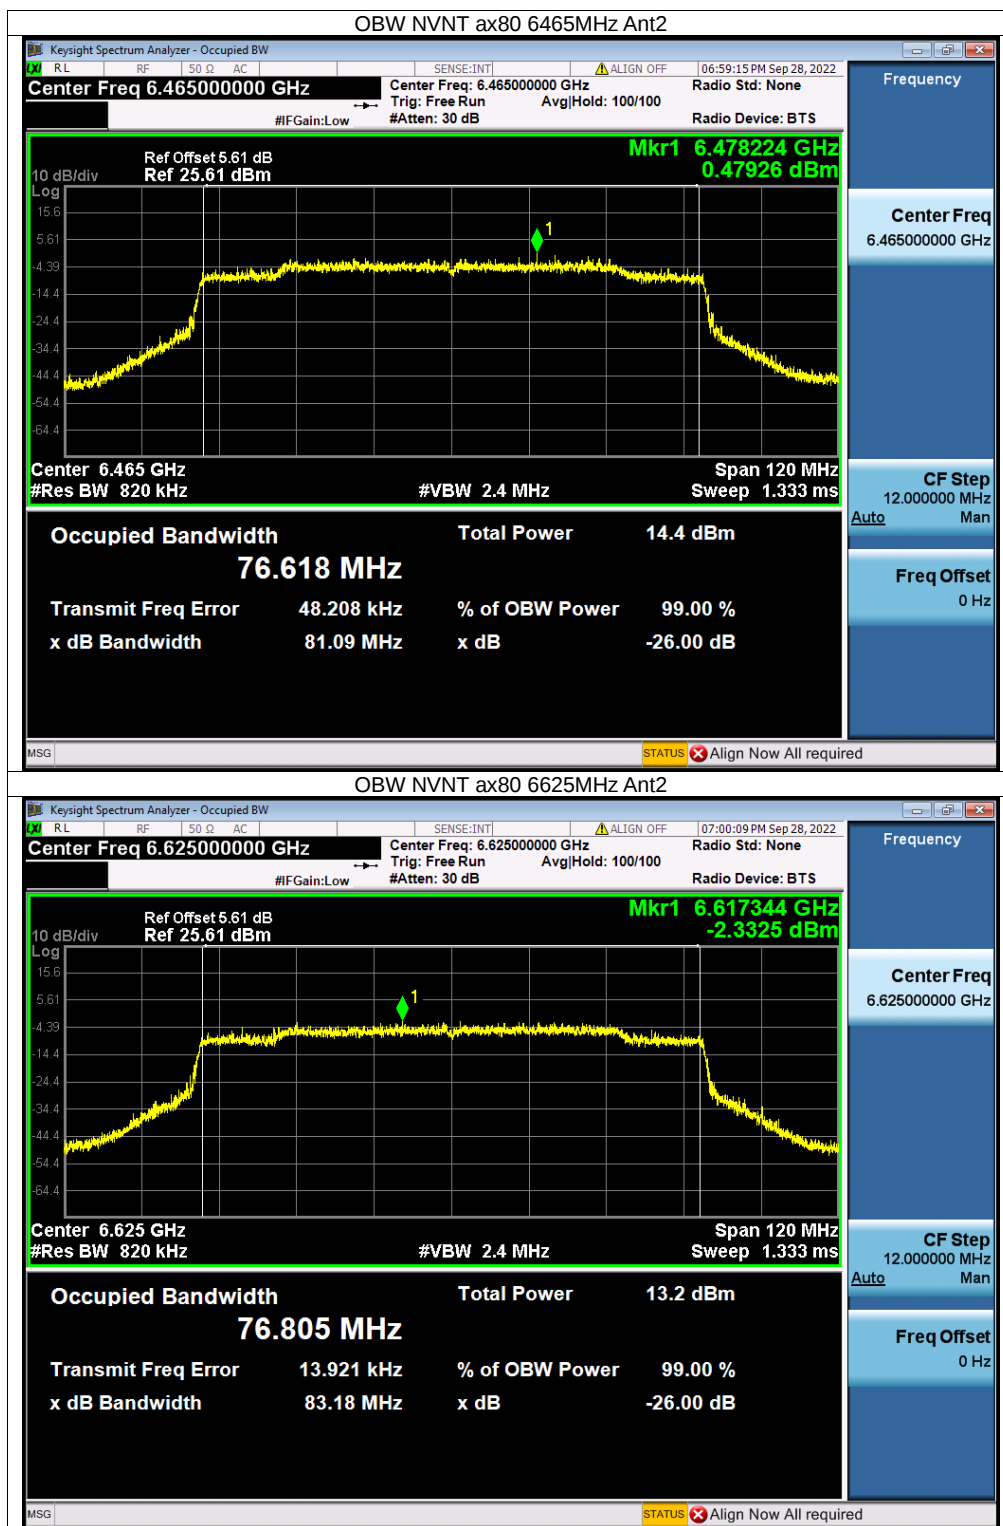

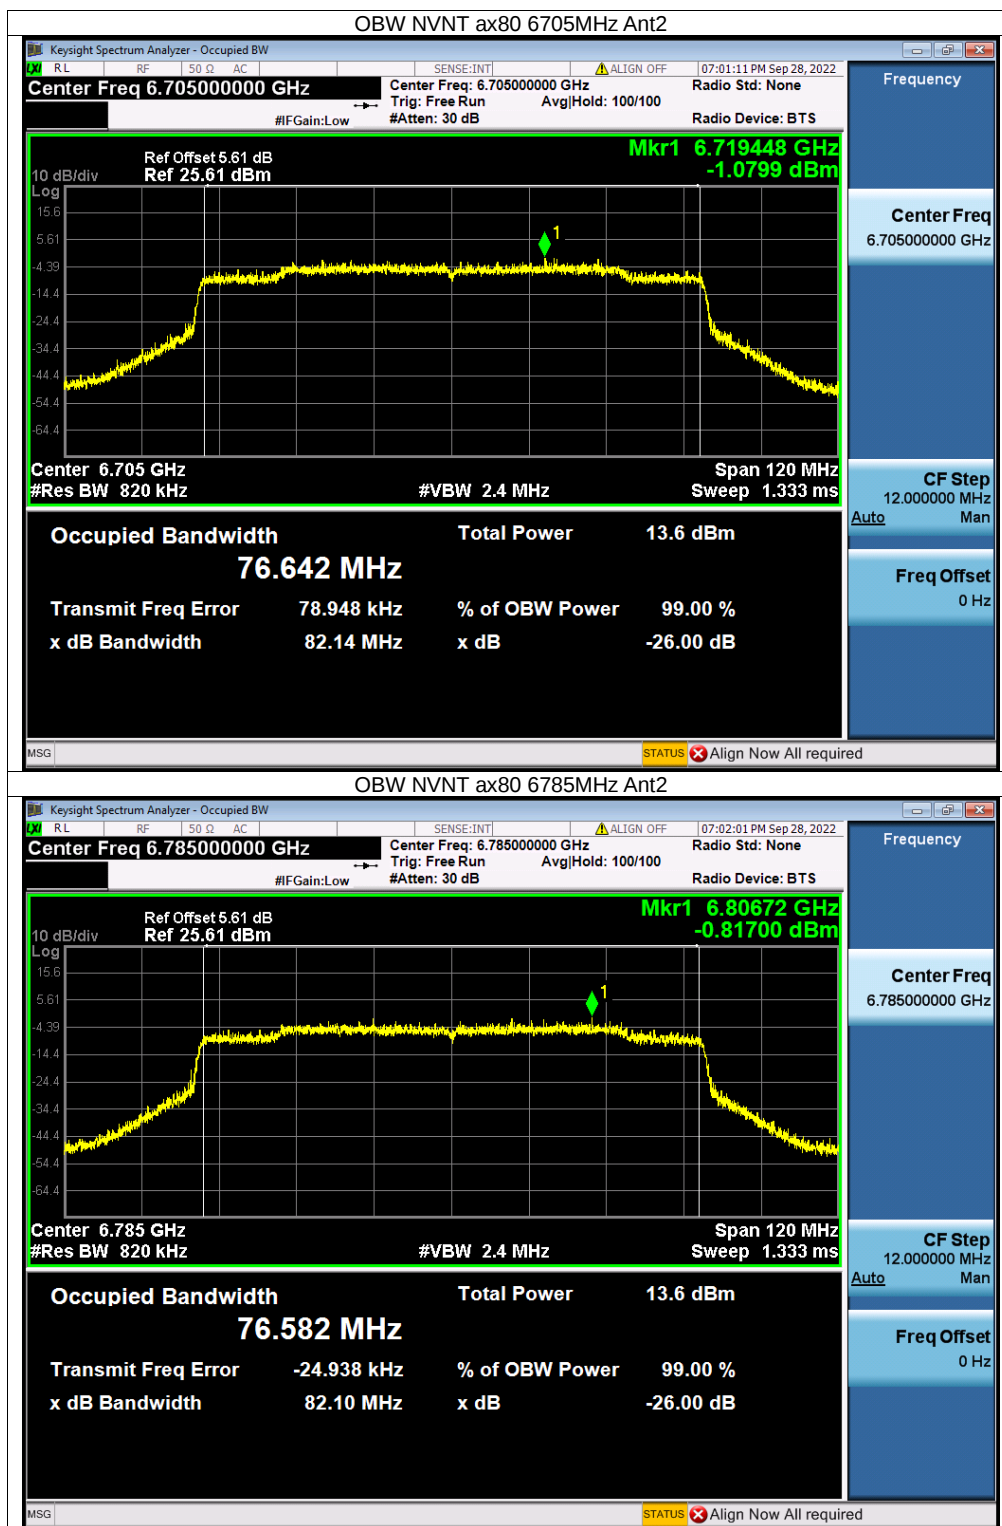

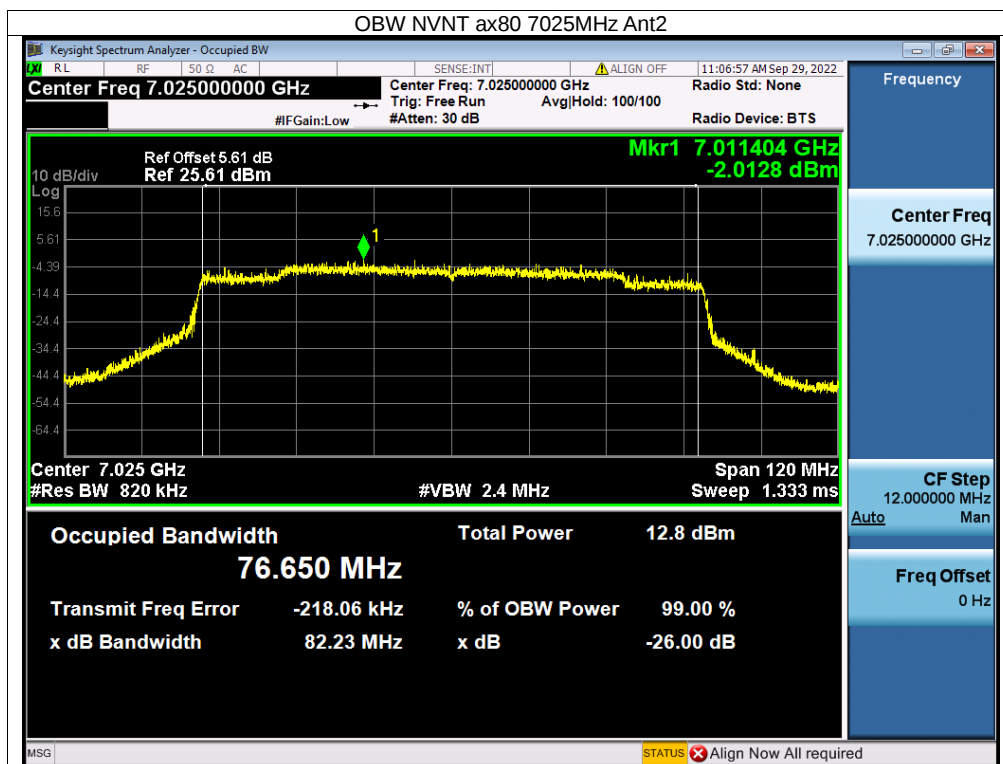



MAXIMUM POWER SPECTRAL DENSITY LEVEL

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Gain (dBi)	eirp PSD (dBm)	Limit (dBm)	Verdict
NVNT	ax160	6025	Ant1	-12.62	0	-12.62	2.22	-10.4	-1	Pass
NVNT	ax160	6025	Ant2	-12.04	0	-12.04	2.22	-9.82	-1	Pass
NVNT	ax160	6025	Sum					-7.09	-1	Pass
NVNT	ax160	6185	Ant1	-11.45	0	-11.45	2.22	-9.23	-1	Pass
NVNT	ax160	6185	Ant2	-11.34	0	-11.34	2.22	-9.12	-1	Pass
NVNT	ax160	6185	Sum					-6.16	-1	Pass
NVNT	ax160	6345	Ant1	-11.44	0	-11.44	2.22	-9.22	-1	Pass
NVNT	ax160	6345	Ant2	-11.91	0	-11.91	2.22	-9.69	-1	Pass
NVNT	ax160	6345	Sum					-6.44	-1	Pass
NVNT	ax160	6665	Ant1	-11.34	0	-11.34	2.22	-9.12	-1	Pass
NVNT	ax160	6665	Ant2	-12.45	0	-12.45	2.22	-10.23	-1	Pass
NVNT	ax160	6665	Sum					-6.63	-1	Pass
NVNT	ax160	6985	Ant1	-11.76	0	-11.76	2.22	-9.54	-1	Pass
NVNT	ax160	6985	Ant2	-12.06	0	-12.06	2.22	-9.84	-1	Pass
NVNT	ax160	6985	Sum					-6.68	-1	Pass
NVNT	ax20	5955	Ant1	-14.32	0	-14.32	2.22	-12.1	-1	Pass
NVNT	ax20	5955	Ant2	-12.79	0	-12.79	2.22	-10.57	-1	Pass
NVNT	ax20	5955	Sum					-8.26	-1	Pass
NVNT	ax20	6175	Ant1	-13.07	0	-13.07	2.22	-10.85	-1	Pass
NVNT	ax20	6175	Ant2	-12.68	0	-12.68	2.22	-10.46	-1	Pass
NVNT	ax20	6175	Sum					-7.64	-1	Pass
NVNT	ax20	6415	Ant1	-13	0	-13	2.22	-10.78	-1	Pass
NVNT	ax20	6415	Ant2	-13.38	0	-13.38	2.22	-11.16	-1	Pass
NVNT	ax20	6415	Sum					-7.96	-1	Pass
NVNT	ax20	6435	Ant1	-12.93	0	-12.93	2.22	-10.71	-1	Pass
NVNT	ax20	6435	Ant2	-13.38	0	-13.38	2.22	-11.16	-1	Pass
NVNT	ax20	6435	Sum					-7.92	-1	Pass
NVNT	ax20	6475	Ant1	-12.29	0	-12.29	2.22	-10.07	-1	Pass
NVNT	ax20	6475	Ant2	-13.24	0	-13.24	2.22	-11.02	-1	Pass
NVNT	ax20	6475	Sum					-7.51	-1	Pass
NVNT	ax20	6515	Ant1	-12.22	0	-12.22	2.22	-10	-1	Pass
NVNT	ax20	6515	Ant2	-13.25	0	-13.25	2.22	-11.03	-1	Pass
NVNT	ax20	6515	Sum					-7.47	-1	Pass
NVNT	ax20	6535	Ant1	-14.76	0	-14.76	2.22	-12.54	-1	Pass
NVNT	ax20	6535	Ant2	-14.74	0	-14.74	2.22	-12.52	-1	Pass
NVNT	ax20	6535	Sum					-9.52	-1	Pass
NVNT	ax20	6715	Ant1	-14.94	0	-14.94	2.22	-12.72	-1	Pass
NVNT	ax20	6715	Ant2	-16.37	0	-16.37	2.22	-14.15	-1	Pass
NVNT	ax20	6715	Sum					-10.37	-1	Pass
NVNT	ax20	6855	Ant1	-12.85	0	-12.85	2.22	-10.63	-1	Pass
NVNT	ax20	6855	Ant2	-14.58	0	-14.58	2.22	-12.36	-1	Pass
NVNT	ax20	6855	Sum					-8.4	-1	Pass
NVNT	ax20	6875	Ant1	-13.28	0	-13.28	2.22	-11.06	-1	Pass
NVNT	ax20	6875	Ant2	-15.64	0	-15.64	2.22	-13.42	-1	Pass
NVNT	ax20	6875	Sum					-9.07	-1	Pass
NVNT	ax20	6895	Ant1	-13.78	0	-13.78	2.22	-11.56	-1	Pass
NVNT	ax20	6895	Ant2	-16.05	0	-16.05	2.22	-13.83	-1	Pass
NVNT	ax20	6895	Sum					-9.54	-1	Pass
NVNT	ax20	7015	Ant1	-14.8	0	-14.8	2.22	-12.58	-1	Pass
NVNT	ax20	7015	Ant2	-16.27	0	-16.27	2.22	-14.05	-1	Pass
NVNT	ax20	7015	Sum					-10.24	-1	Pass
NVNT	ax20	7095	Ant1	-13.88	0	-13.88	2.22	-11.66	-1	Pass
NVNT	ax20	7095	Ant2	-14.38	0	-14.38	2.22	-12.16	-1	Pass
NVNT	ax20	7095	Sum					-8.89	-1	Pass
NVNT	ax20	7115	Ant1	-19.03	0	-19.03	2.22	-16.81	-1	Pass
NVNT	ax20	7115	Ant2	-19.5	0	-19.5	2.22	-17.28	-1	Pass
NVNT	ax20	7115	Sum					-14.03	-1	Pass
NVNT	ax40	5965	Ant1	-13.59	0	-13.59	2.22	-11.37	-1	Pass
NVNT	ax40	5965	Ant2	-12.69	0	-12.69	2.22	-10.47	-1	Pass
NVNT	ax40	5965	Sum					-7.89	-1	Pass
NVNT	ax40	6165	Ant1	-11.56	0	-11.56	2.22	-9.34	-1	Pass
NVNT	ax40	6165	Ant2	-12.21	0	-12.21	2.22	-9.99	-1	Pass
NVNT	ax40	6165	Sum					-6.64	-1	Pass
NVNT	ax40	6405	Ant1	-11.71	0	-11.71	2.22	-9.49	-1	Pass
NVNT	ax40	6405	Ant2	-12.94	0	-12.94	2.22	-10.72	-1	Pass
NVNT	ax40	6405	Sum					-7.05	-1	Pass
NVNT	ax40	6445	Ant1	-11.25	0	-11.25	2.22	-9.03	-1	Pass
NVNT	ax40	6445	Ant2	-12.74	0	-12.74	2.22	-10.52	-1	Pass
NVNT	ax40	6445	Sum					-6.7	-1	Pass
NVNT	ax40	6485	Ant1	-10.56	0	-10.56	2.22	-8.34	-1	Pass
NVNT	ax40	6485	Ant2	-12.34	0	-12.34	2.22	-10.12	-1	Pass
NVNT	ax40	6485	Sum					-6.13	-1	Pass
NVNT	ax40	6565	Ant1	-10.49	0	-10.49	2.22	-8.27	-1	Pass



NVNT	ax40	6565	Ant2	-13.4	0	-13.4	2.22	-11.18	-1	Pass
NVNT	ax40	6565	Sum					-6.48	-1	Pass
NVNT	ax40	6725	Ant1	-11.57	0	-11.57	2.22	-9.35	-1	Pass
NVNT	ax40	6725	Ant2	-12.86	0	-12.86	2.22	-10.64	-1	Pass
NVNT	ax40	6725	Sum					-6.94	-1	Pass
NVNT	ax40	6925	Ant1	-12.56	0	-12.56	2.22	-10.34	-1	Pass
NVNT	ax40	6925	Ant2	-13.7	0	-13.7	2.22	-11.48	-1	Pass
NVNT	ax40	6925	Sum					-7.86	-1	Pass
NVNT	ax40	7005	Ant1	-10.93	0	-10.93	2.22	-8.71	-1	Pass
NVNT	ax40	7005	Ant2	-13.57	0	-13.57	2.22	-11.35	-1	Pass
NVNT	ax40	7005	Sum					-6.82	-1	Pass
NVNT	ax40	7085	Ant1	-10.78	0	-10.78	2.22	-8.56	-1	Pass
NVNT	ax40	7085	Ant2	-13.17	0	-13.17	2.22	-10.95	-1	Pass
NVNT	ax40	7085	Sum					-6.58	-1	Pass
NVNT	ax80	5985	Ant1	-13.59	0	-13.59	2.22	-11.37	-1	Pass
NVNT	ax80	5985	Ant2	-12.79	0	-12.79	2.22	-10.57	-1	Pass
NVNT	ax80	5985	Sum					-7.94	-1	Pass
NVNT	ax80	6145	Ant1	-12.39	0	-12.39	2.22	-10.17	-1	Pass
NVNT	ax80	6145	Ant2	-11.73	0	-11.73	2.22	-9.51	-1	Pass
NVNT	ax80	6145	Sum					-6.81	-1	Pass
NVNT	ax80	6385	Ant1	-12.13	0	-12.13	2.22	-9.91	-1	Pass
NVNT	ax80	6385	Ant2	-12.76	0	-12.76	2.22	-10.54	-1	Pass
NVNT	ax80	6385	Sum					-7.2	-1	Pass
NVNT	ax80	6465	Ant1	-11.73	0	-11.73	2.22	-9.51	-1	Pass
NVNT	ax80	6465	Ant2	-12.17	0	-12.17	2.22	-9.95	-1	Pass
NVNT	ax80	6465	Sum					-6.71	-1	Pass
NVNT	ax80	6625	Ant1	-11.32	0	-11.32	2.22	-9.1	-1	Pass
NVNT	ax80	6625	Ant2	-12.96	0	-12.96	2.22	-10.74	-1	Pass
NVNT	ax80	6625	Sum					-6.83	-1	Pass
NVNT	ax80	6705	Ant1	-11.93	0	-11.93	2.22	-9.71	-1	Pass
NVNT	ax80	6705	Ant2	-12.91	0	-12.91	2.22	-10.69	-1	Pass
NVNT	ax80	6705	Sum					-7.16	-1	Pass
NVNT	ax80	6785	Ant1	-12.01	0	-12.01	2.22	-9.79	-1	Pass
NVNT	ax80	6785	Ant2	-12.34	0	-12.34	2.22	-10.12	-1	Pass
NVNT	ax80	6785	Sum					-6.94	-1	Pass
NVNT	ax80	6945	Ant1	-12.08	0	-12.08	2.22	-9.86	-1	Pass
NVNT	ax80	6945	Ant2	-13.51	0	-13.51	2.22	-11.29	-1	Pass
NVNT	ax80	6945	Sum					-7.51	-1	Pass
NVNT	ax80	7025	Ant1	-11.68	0	-11.68	2.22	-9.46	-1	Pass
NVNT	ax80	7025	Ant2	-13.26	0	-13.26	2.22	-11.04	-1	Pass
NVNT	ax80	7025	Sum					-7.17	-1	Pass

