



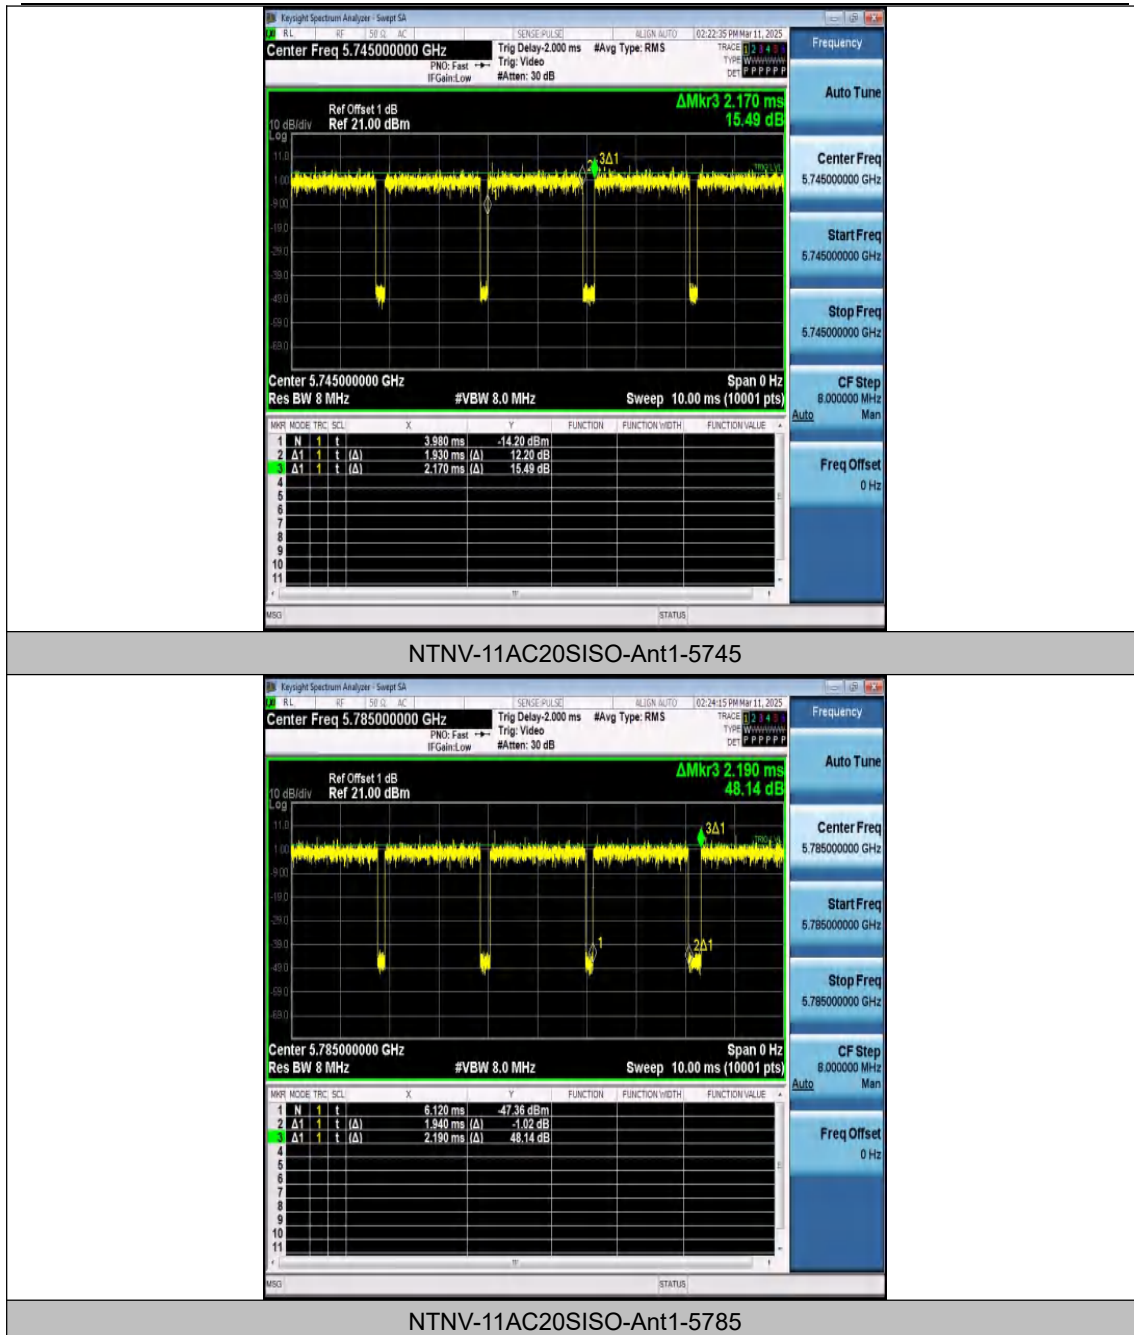


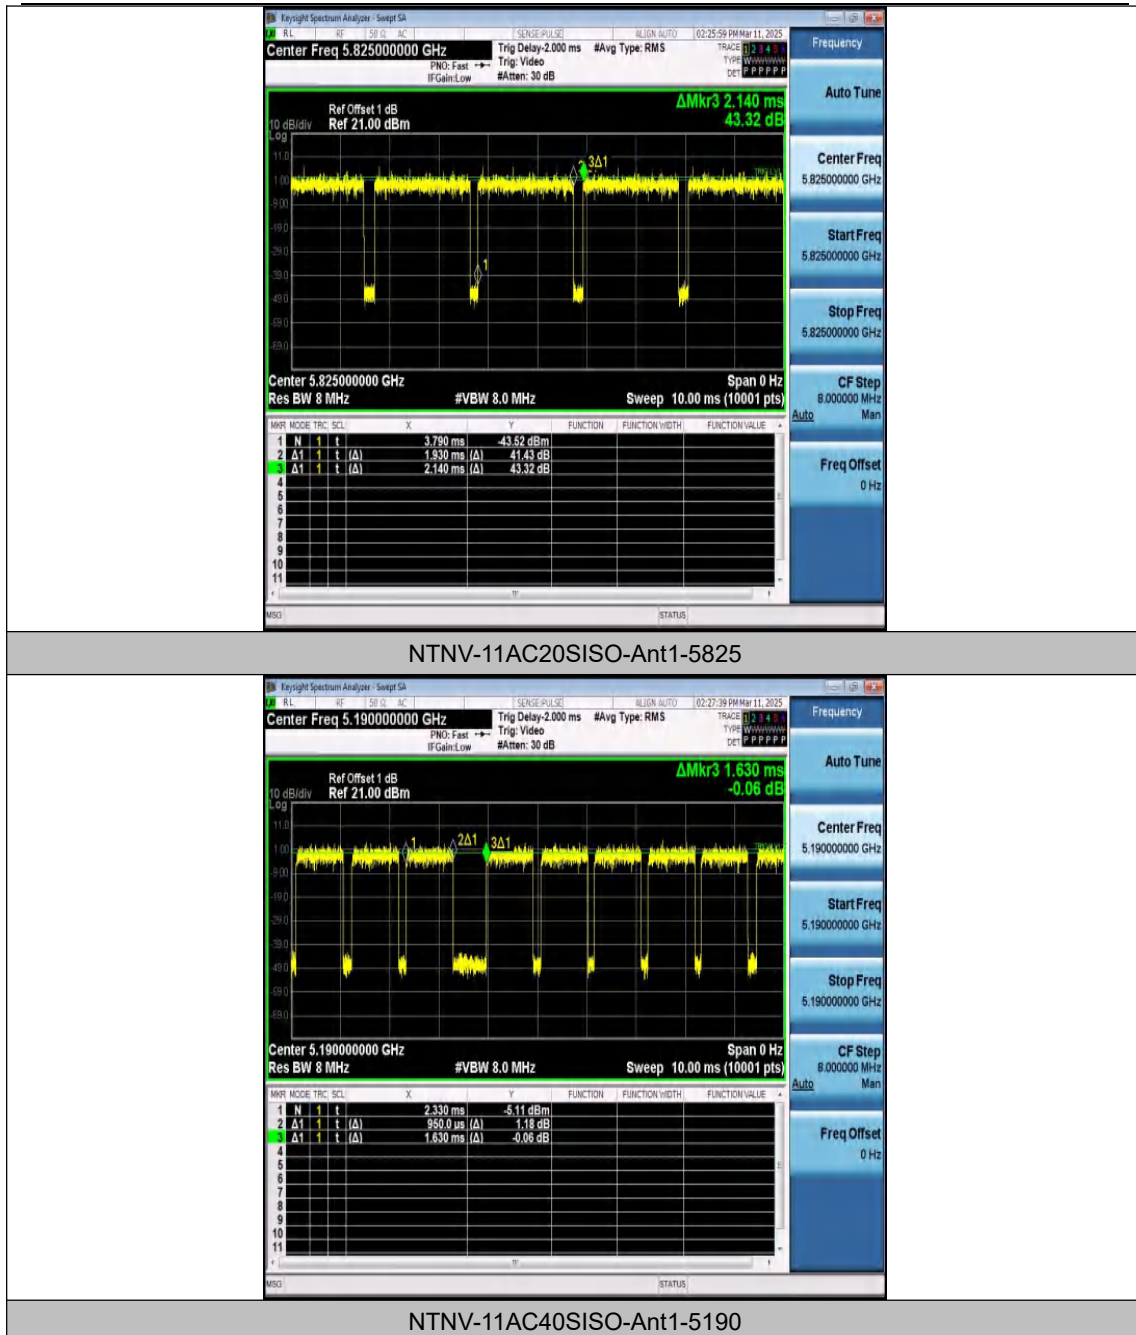



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

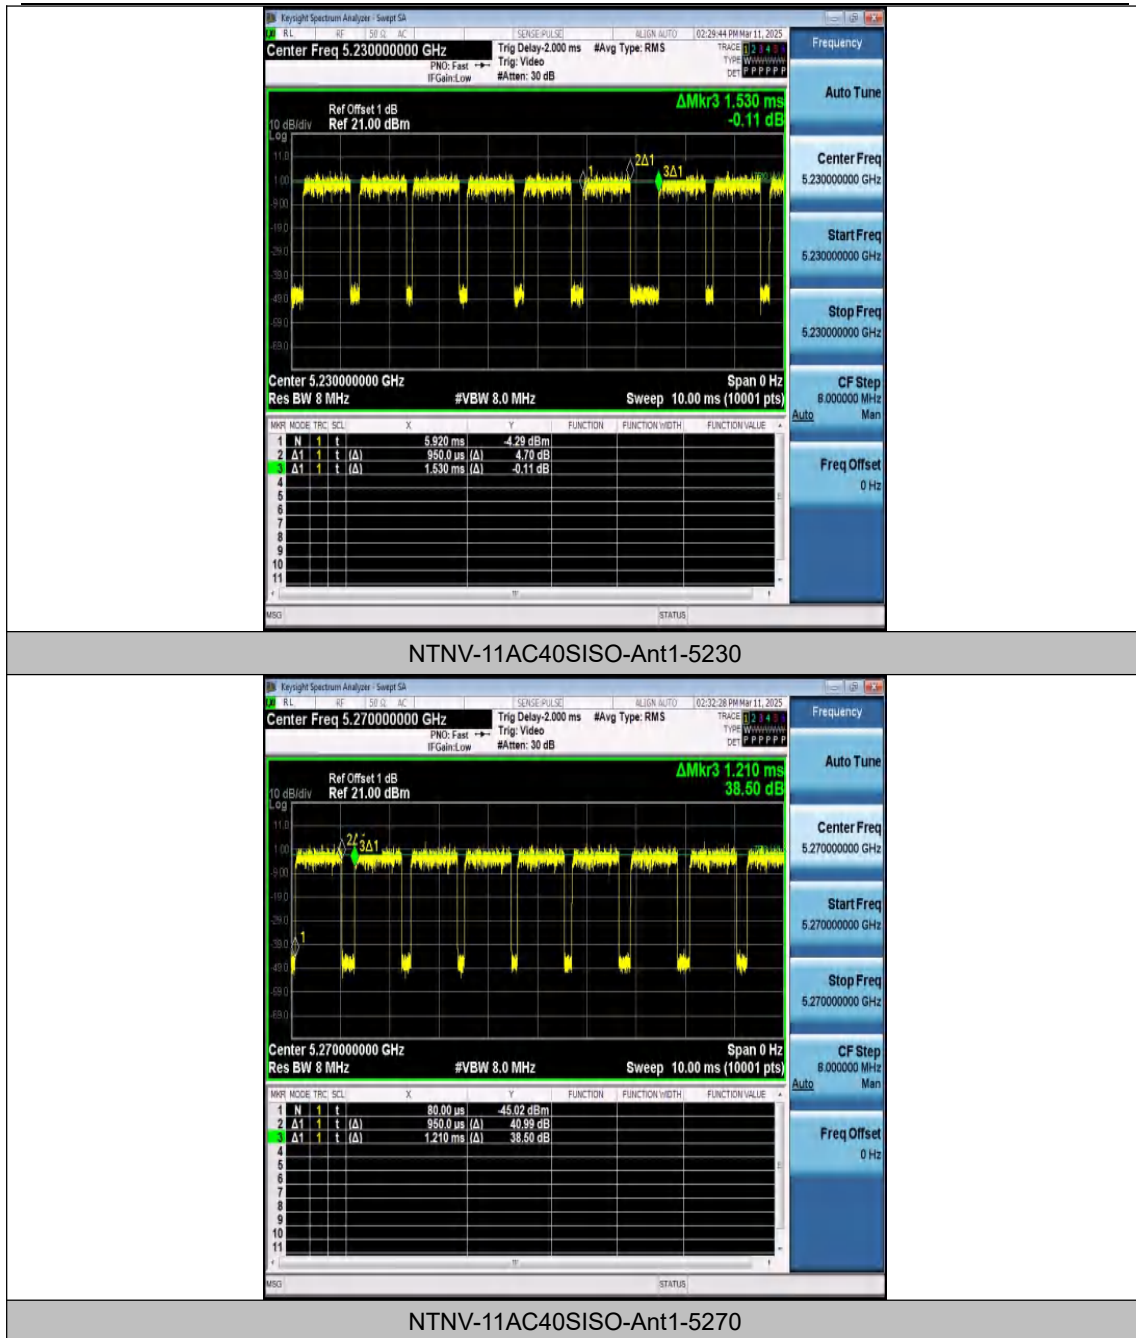


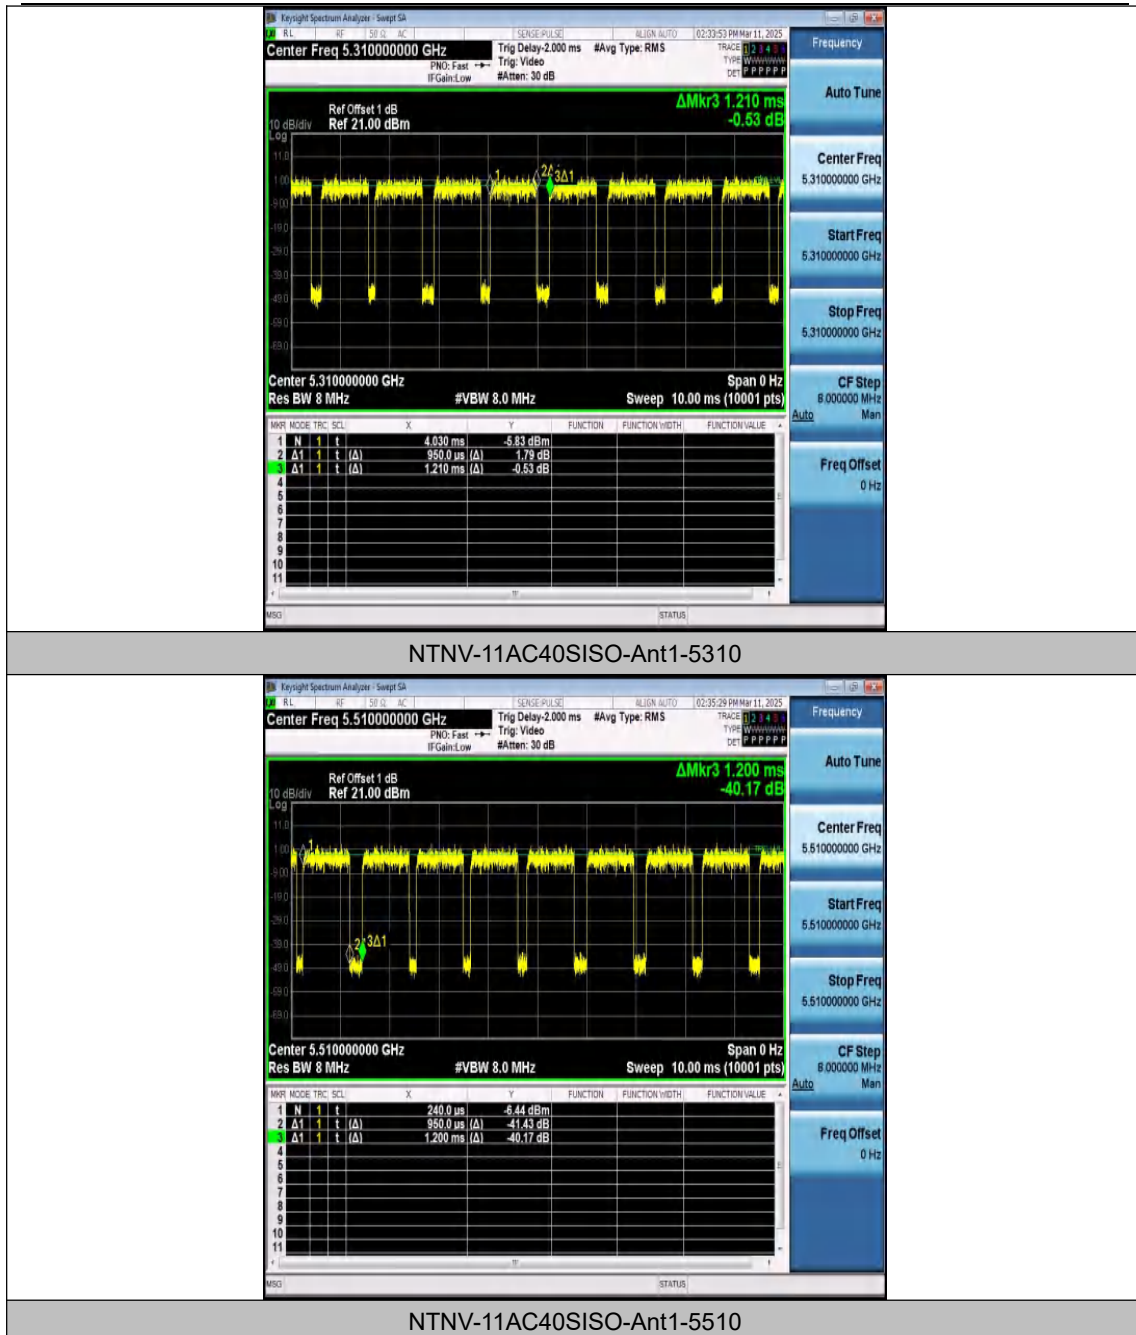


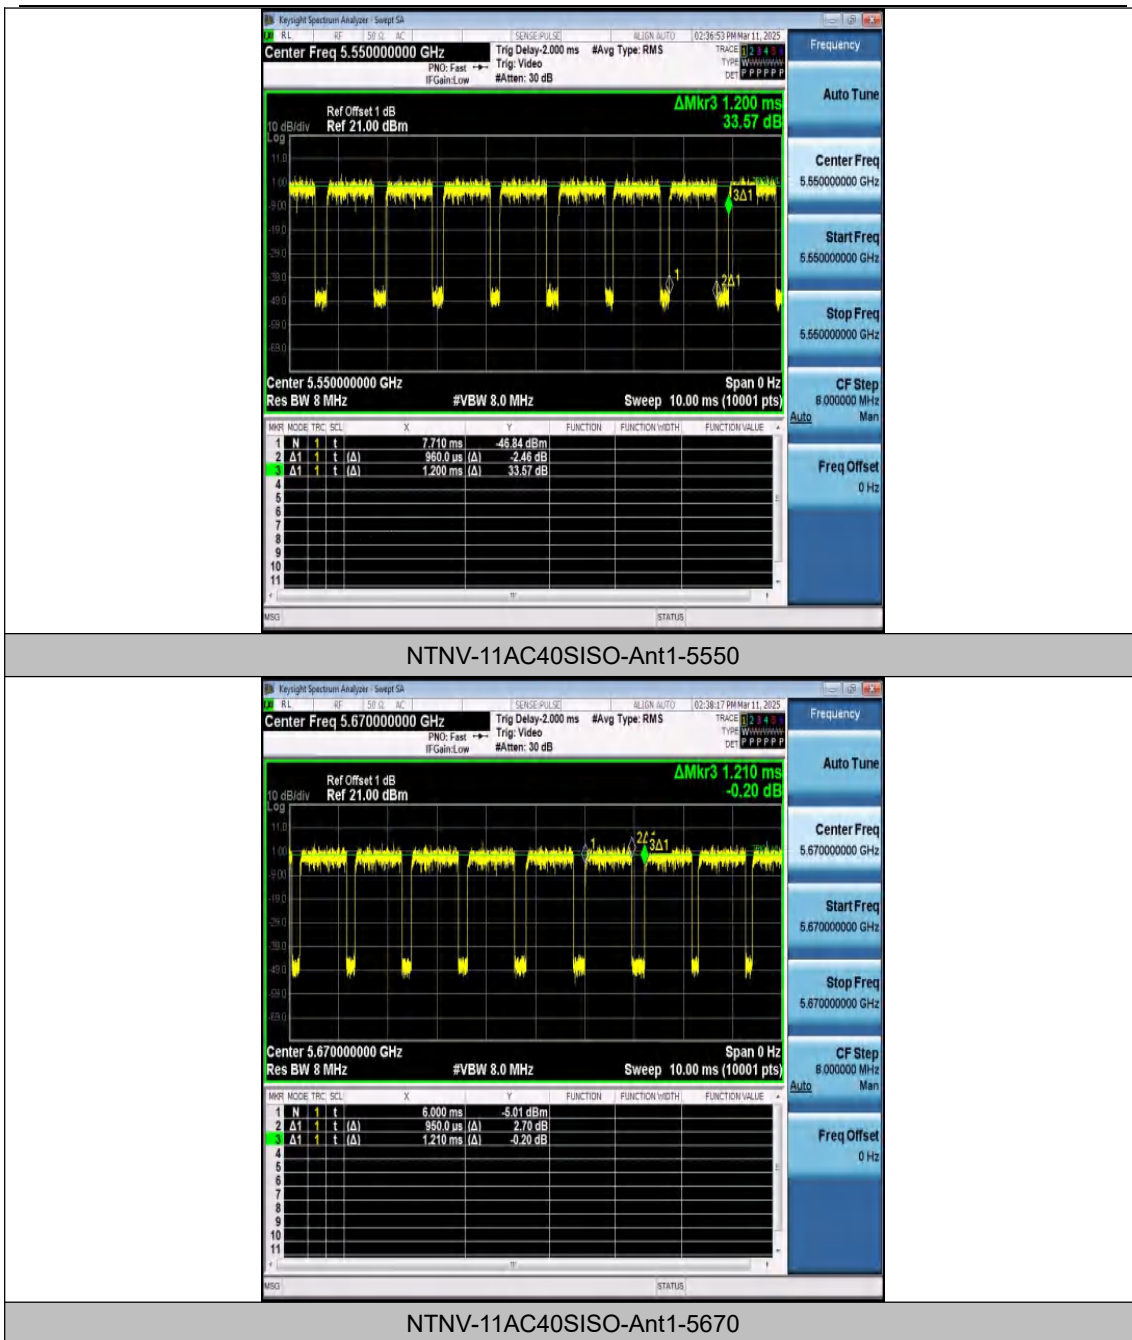

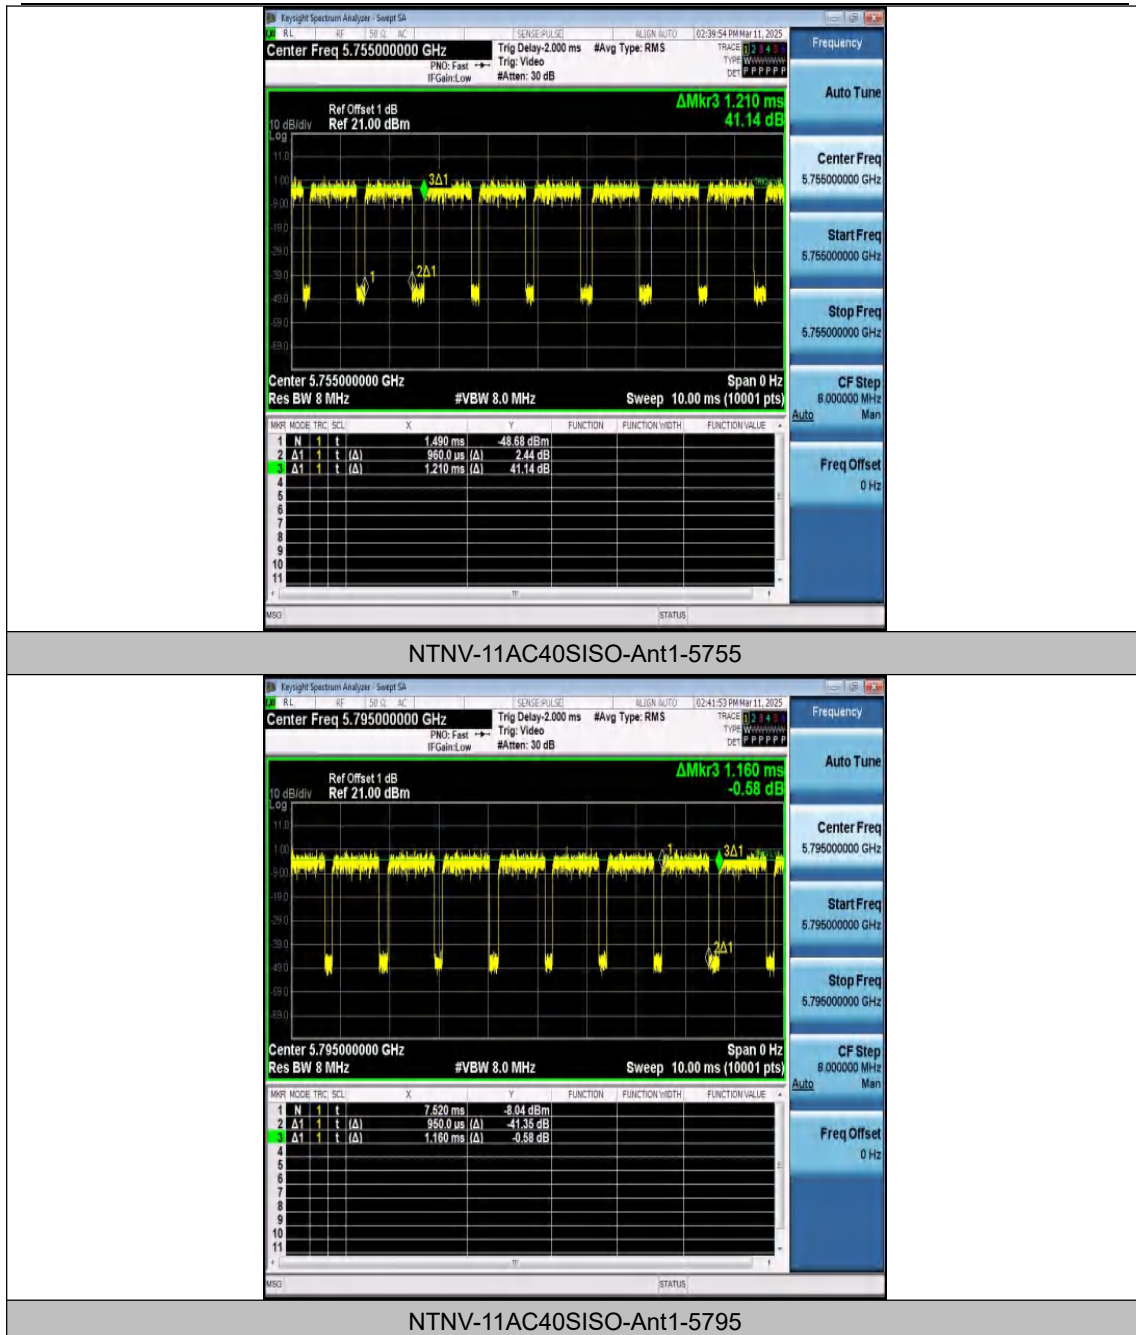

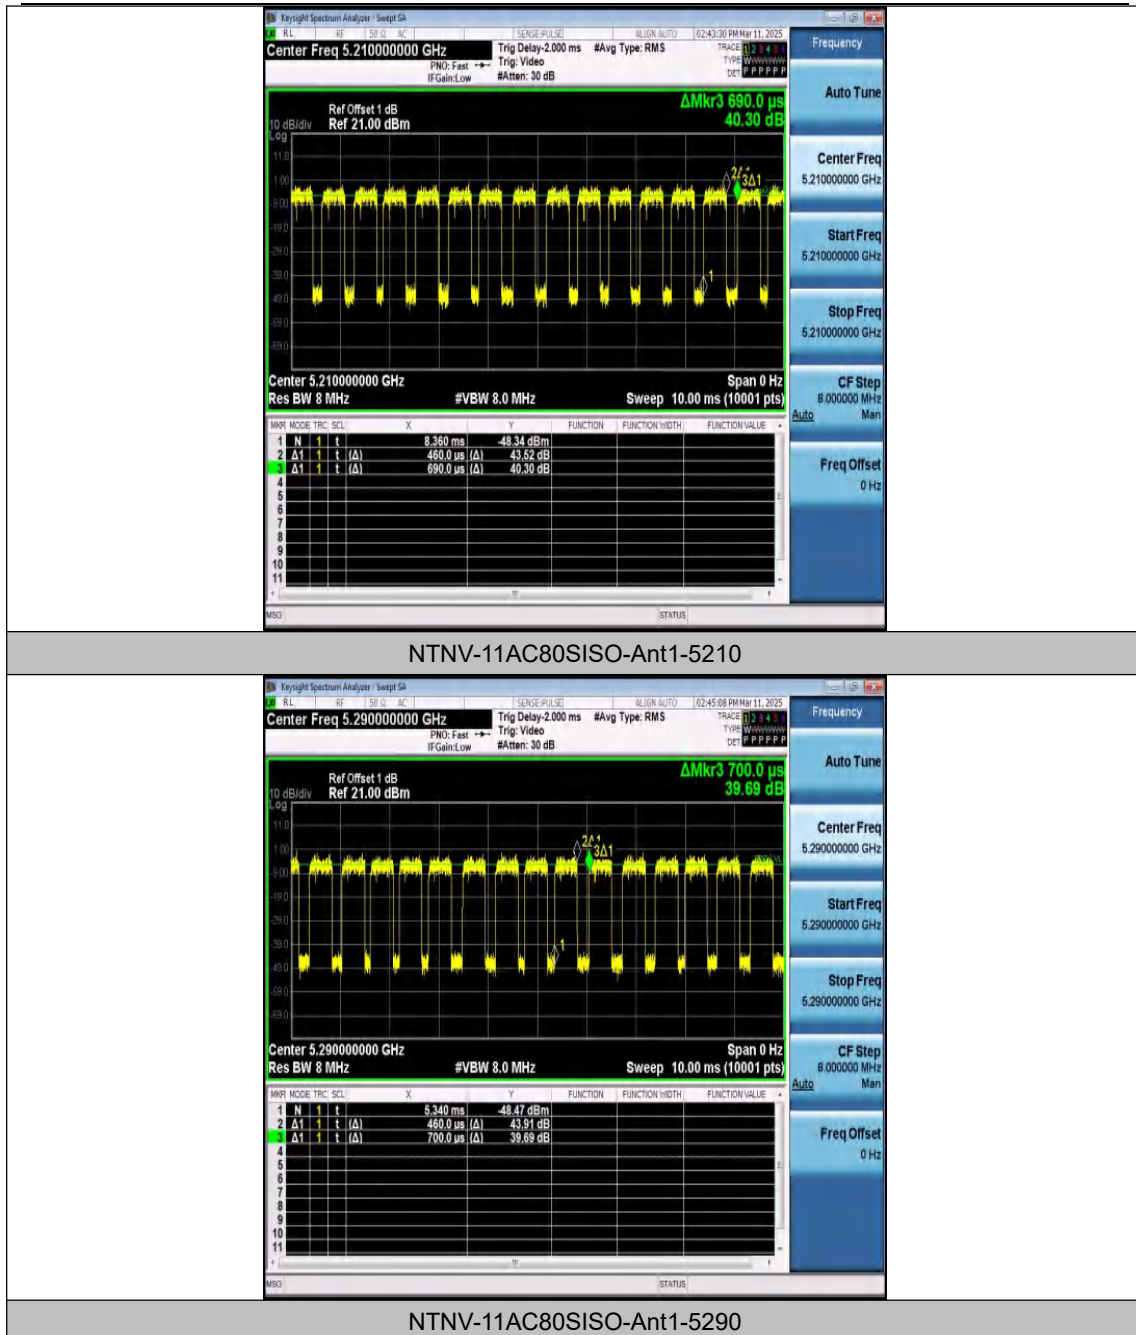

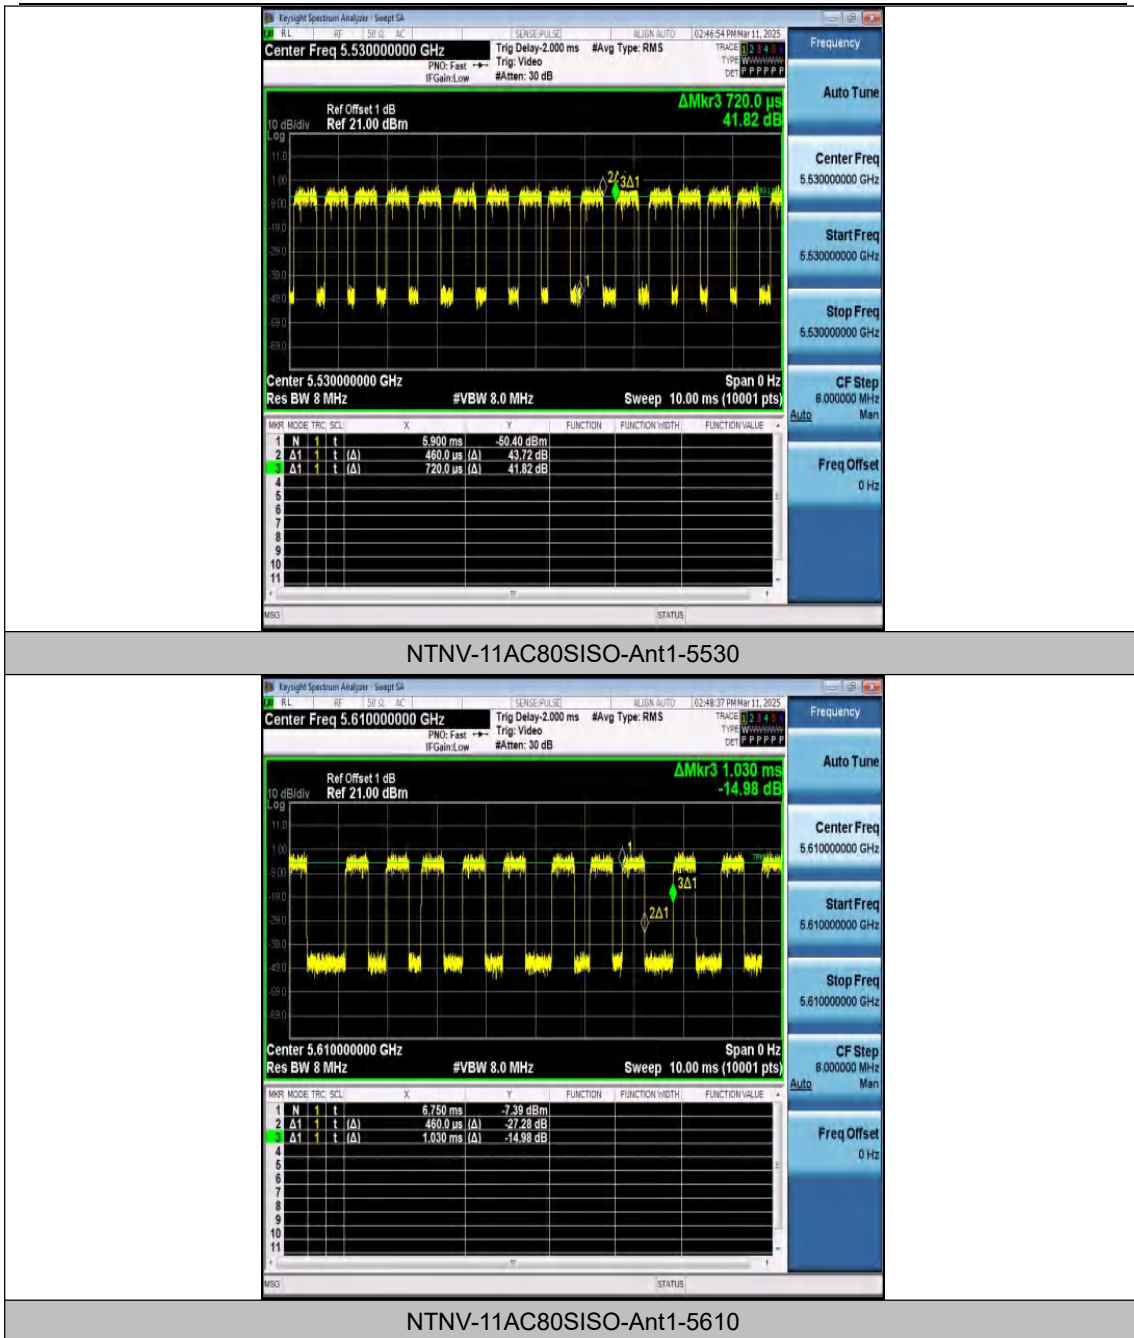

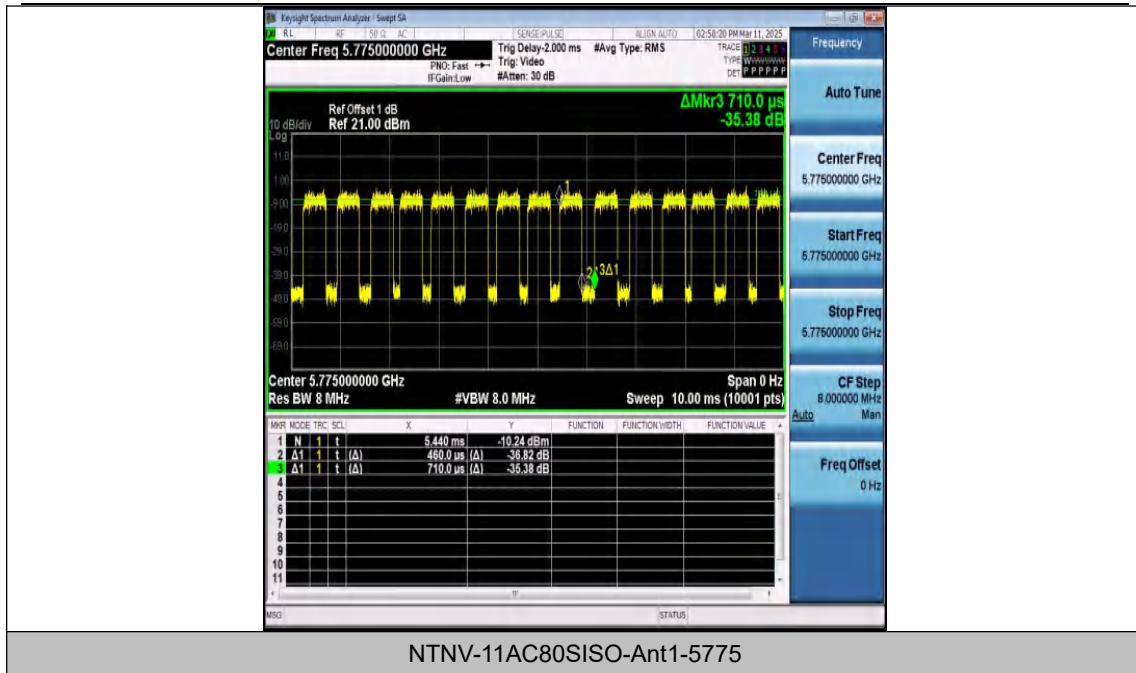

NTNV-11AC80SISO-Ant1-5775

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Appendix C: Maximum Conducted Output Power


Test Result Channel Power

Test Mode	Antenna	Frequency [MHz]	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	5.77	90.79	0.42	6.19	≤23.98	PASS
11A	Ant1	5220	6.65	90.00	0.46	7.11	≤23.98	PASS
11A	Ant1	5240	6.69	91.59	0.38	7.07	≤23.98	PASS
11A	Ant1	5260	5.23	90.39	0.44	5.67	≤23.69	PASS
11A	Ant1	5300	4.99	90.79	0.42	5.41	≤23.64	PASS
11A	Ant1	5320	4.67	89.96	0.46	5.13	≤23.69	PASS
11A	Ant1	5500	4.52	92.41	0.34	4.86	≤23.69	PASS
11A	Ant1	5580	6.17	90.39	0.44	6.61	≤23.70	PASS
11A	Ant1	5700	5.43	91.15	0.40	5.83	≤23.68	PASS
11A	Ant1	5745	4.31	90.00	0.46	4.77	≤30.00	PASS
11A	Ant1	5785	3.40	89.57	0.48	3.88	≤30.00	PASS
11A	Ant1	5825	2.98	91.56	0.38	3.36	≤30.00	PASS
11N20SISO	Ant1	5180	6.47	91.00	0.41	6.88	≤23.98	PASS
11N20SISO	Ant1	5220	6.62	90.14	0.45	7.07	≤23.98	PASS
11N20SISO	Ant1	5240	6.70	91.43	0.39	7.09	≤23.98	PASS
11N20SISO	Ant1	5260	5.73	89.30	0.49	6.22	≤23.86	PASS
11N20SISO	Ant1	5300	5.24	88.89	0.51	5.75	≤23.83	PASS
11N20SISO	Ant1	5320	4.90	89.72	0.47	5.37	≤23.87	PASS
11N20SISO	Ant1	5500	4.53	89.30	0.49	5.02	≤23.83	PASS
11N20SISO	Ant1	5580	6.22	89.72	0.47	6.69	≤23.89	PASS
11N20SISO	Ant1	5700	5.38	91.43	0.39	5.77	≤23.84	PASS
11N20SISO	Ant1	5745	4.23	91.87	0.37	4.60	≤30.00	PASS
11N20SISO	Ant1	5785	3.37	89.72	0.47	3.84	≤30.00	PASS
11N20SISO	Ant1	5825	3.47	90.14	0.45	3.92	≤30.00	PASS
11N40SISO	Ant1	5190	5.37	81.03	0.91	6.28	≤23.98	PASS
11N40SISO	Ant1	5230	6.01	80.34	0.95	6.96	≤23.98	PASS
11N40SISO	Ant1	5270	5.18	80.34	0.95	6.13	≤23.98	PASS
11N40SISO	Ant1	5310	4.76	81.74	0.88	5.64	≤23.98	PASS
11N40SISO	Ant1	5510	4.89	80.34	0.95	5.84	≤23.98	PASS
11N40SISO	Ant1	5550	5.57	81.20	0.90	6.47	≤23.98	PASS
11N40SISO	Ant1	5670	6.12	80.34	0.95	7.07	≤23.98	PASS
11N40SISO	Ant1	5755	4.17	80.51	0.94	5.11	≤30.00	PASS
11N40SISO	Ant1	5795	3.23	82.46	0.84	4.07	≤30.00	PASS
11AC20SISO	Ant1	5180	5.57	91.04	0.41	5.98	≤23.98	PASS
11AC20SISO	Ant1	5220	6.42	90.61	0.43	6.85	≤23.98	PASS
11AC20SISO	Ant1	5240	6.51	92.34	0.35	6.86	≤23.98	PASS

11AC20SISO	Ant1	5260	5.43	91.04	0.41	5.84	≤23.88	PASS
11AC20SISO	Ant1	5300	5.24	88.53	0.53	5.77	≤23.89	PASS
11AC20SISO	Ant1	5320	4.89	90.61	0.43	5.32	≤23.86	PASS
11AC20SISO	Ant1	5500	4.77	91.47	0.39	5.16	≤23.88	PASS
11AC20SISO	Ant1	5580	6.41	89.35	0.49	6.90	≤23.86	PASS
11AC20SISO	Ant1	5700	5.61	89.35	0.49	6.10	≤23.92	PASS
11AC20SISO	Ant1	5745	4.55	88.94	0.51	5.06	≤30.00	PASS
11AC20SISO	Ant1	5785	3.67	88.58	0.53	4.20	≤30.00	PASS
11AC20SISO	Ant1	5825	3.20	90.19	0.45	3.65	≤30.00	PASS
11AC40SISO	Ant1	5190	5.44	58.28	2.34	7.78	≤23.98	PASS
11AC40SISO	Ant1	5230	5.25	62.09	2.07	7.32	≤23.98	PASS
11AC40SISO	Ant1	5270	4.21	78.51	1.05	5.26	≤23.98	PASS
11AC40SISO	Ant1	5310	4.16	78.51	1.05	5.21	≤23.98	PASS
11AC40SISO	Ant1	5510	4.10	79.17	1.01	5.11	≤23.98	PASS
11AC40SISO	Ant1	5550	4.99	80.00	0.97	5.96	≤23.98	PASS
11AC40SISO	Ant1	5670	5.42	78.51	1.05	6.47	≤23.98	PASS
11AC40SISO	Ant1	5755	3.52	79.34	1.01	4.53	≤30.00	PASS
11AC40SISO	Ant1	5795	2.57	81.90	0.87	3.44	≤30.00	PASS
11AC80SISO	Ant1	5210	4.63	66.67	1.76	6.39	≤23.98	PASS
11AC80SISO	Ant1	5290	4.60	65.71	1.82	6.42	≤23.98	PASS
11AC80SISO	Ant1	5530	4.45	63.89	1.95	6.40	≤23.98	PASS
11AC80SISO	Ant1	5610	2.08	44.66	3.50	5.58	≤23.98	PASS
11AC80SISO	Ant1	5775	2.92	64.79	1.88	4.80	≤30.00	PASS

Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.


Test Graphs Channel Power

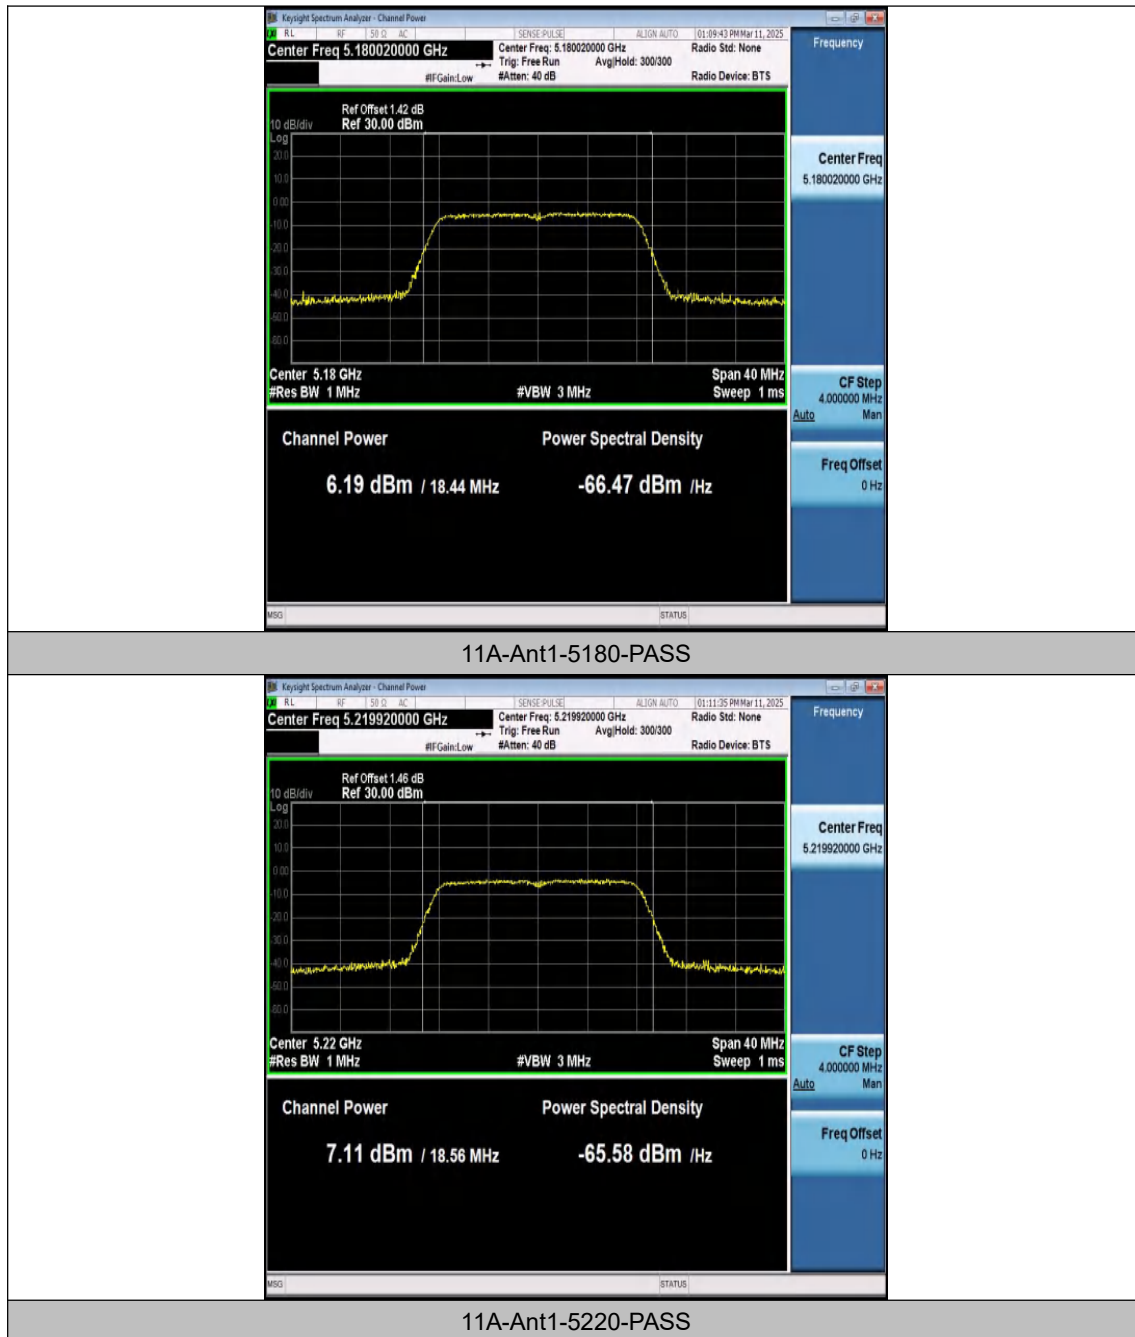



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86)0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

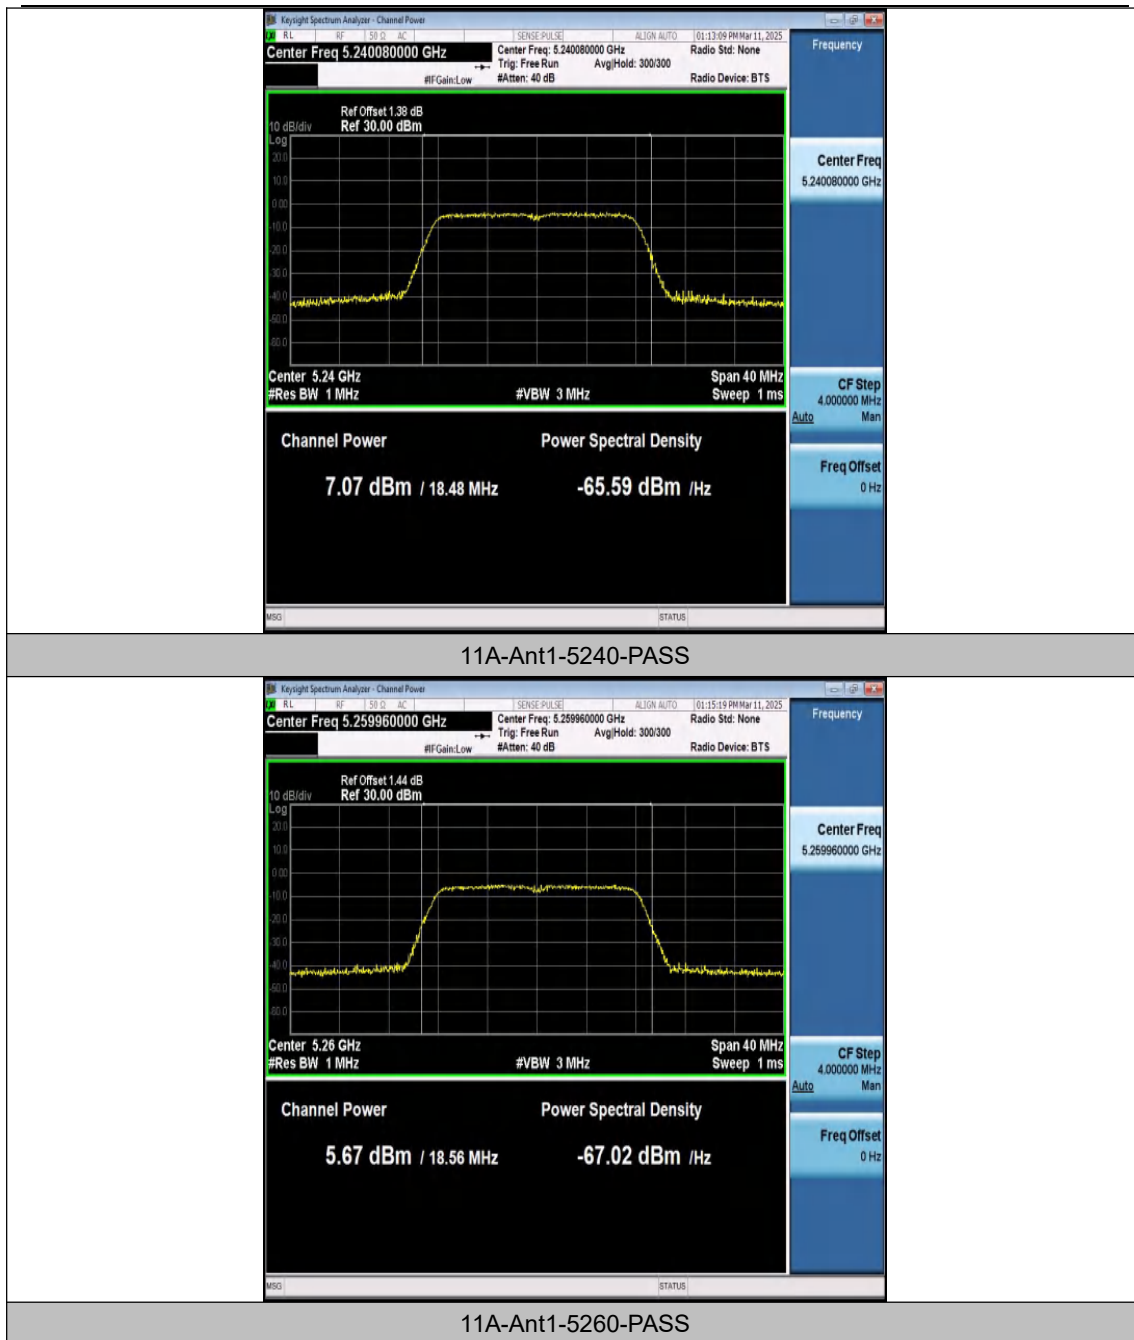


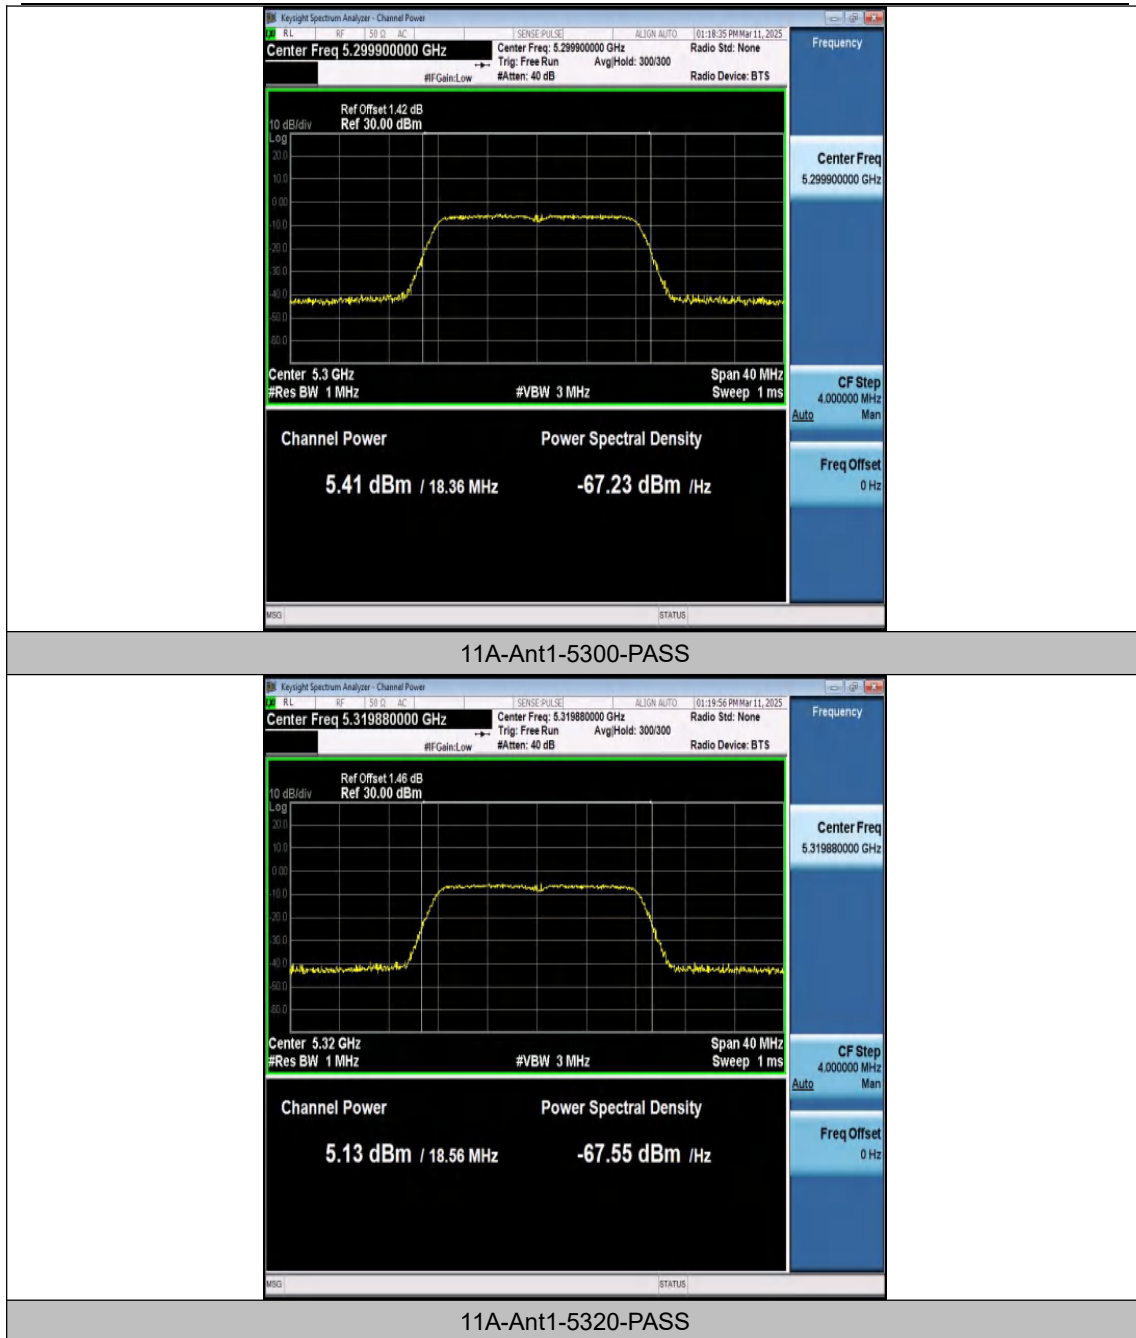

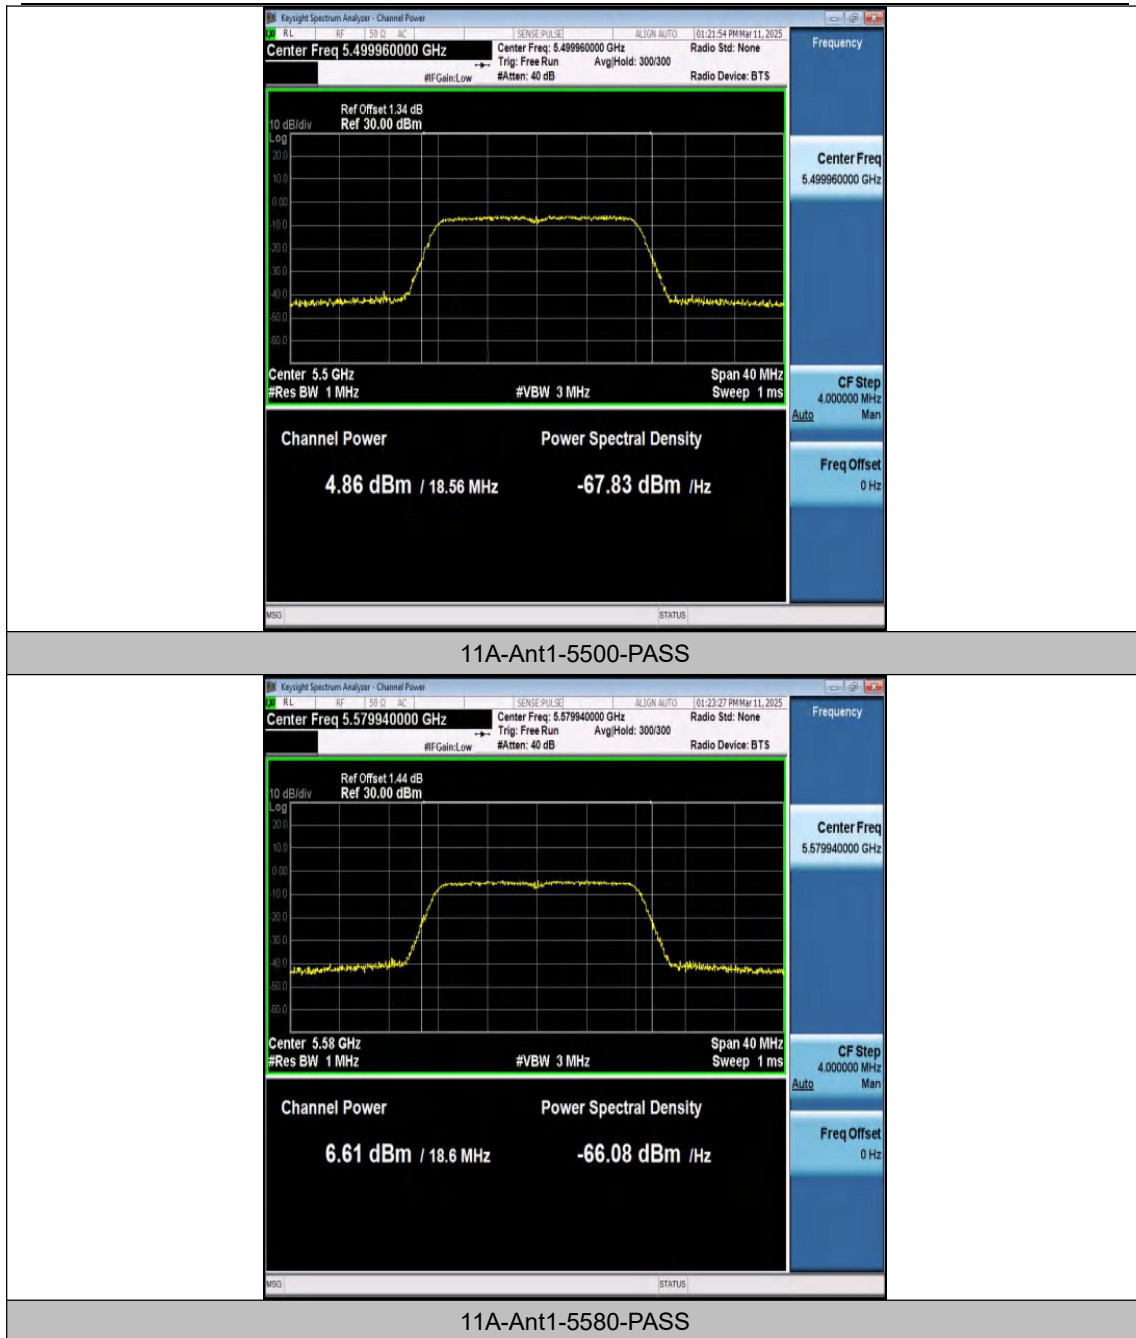

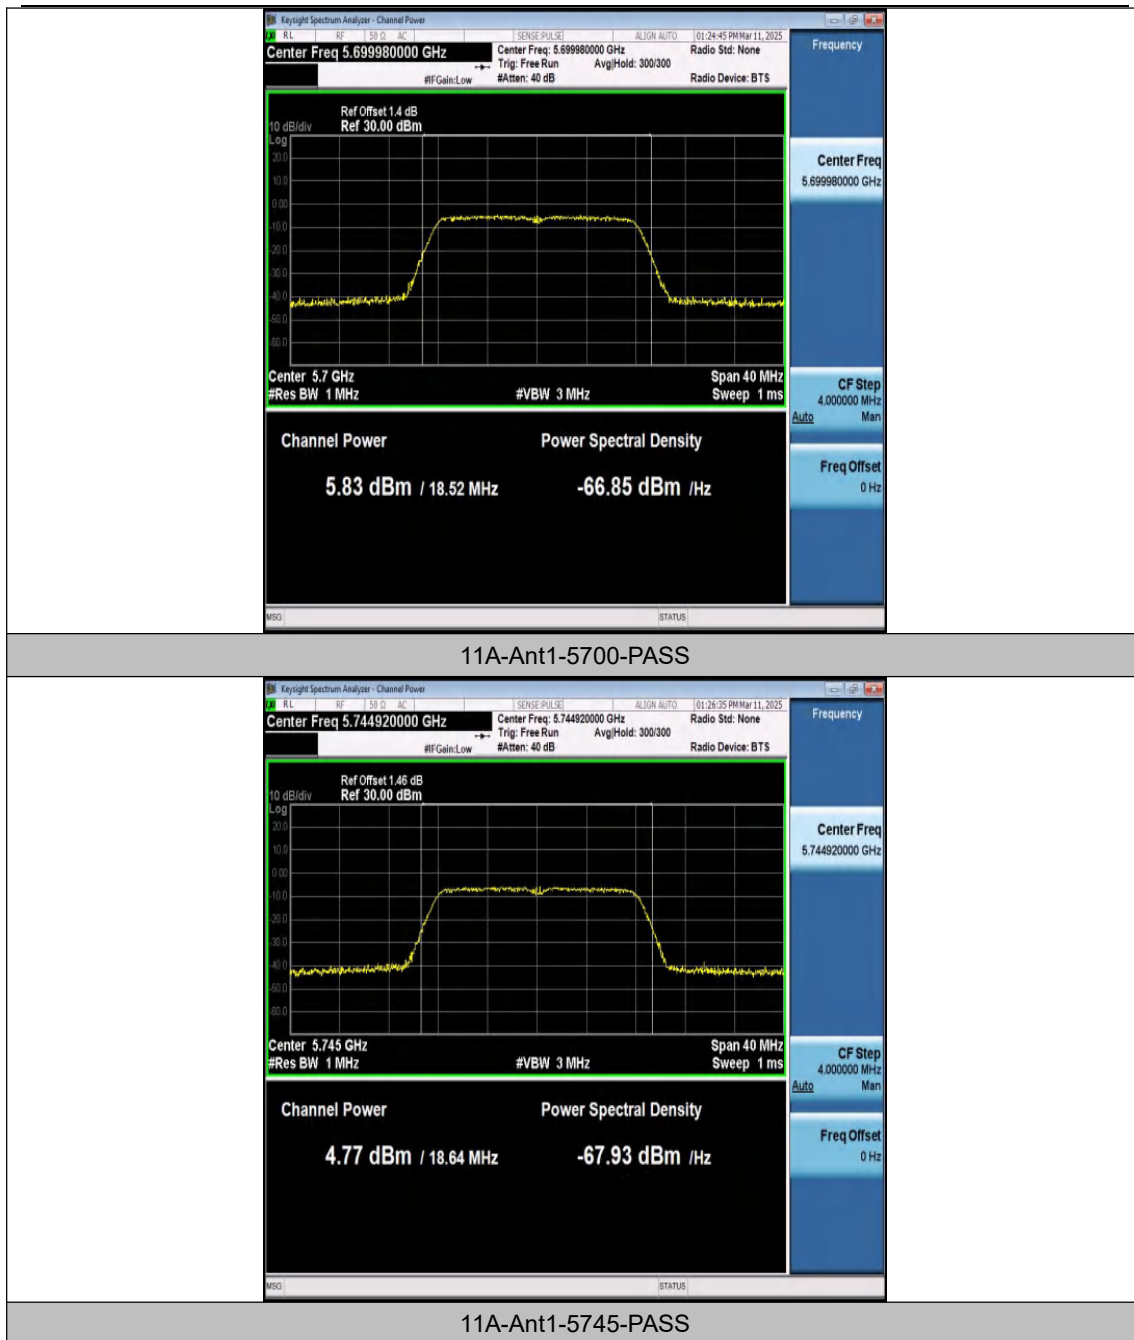

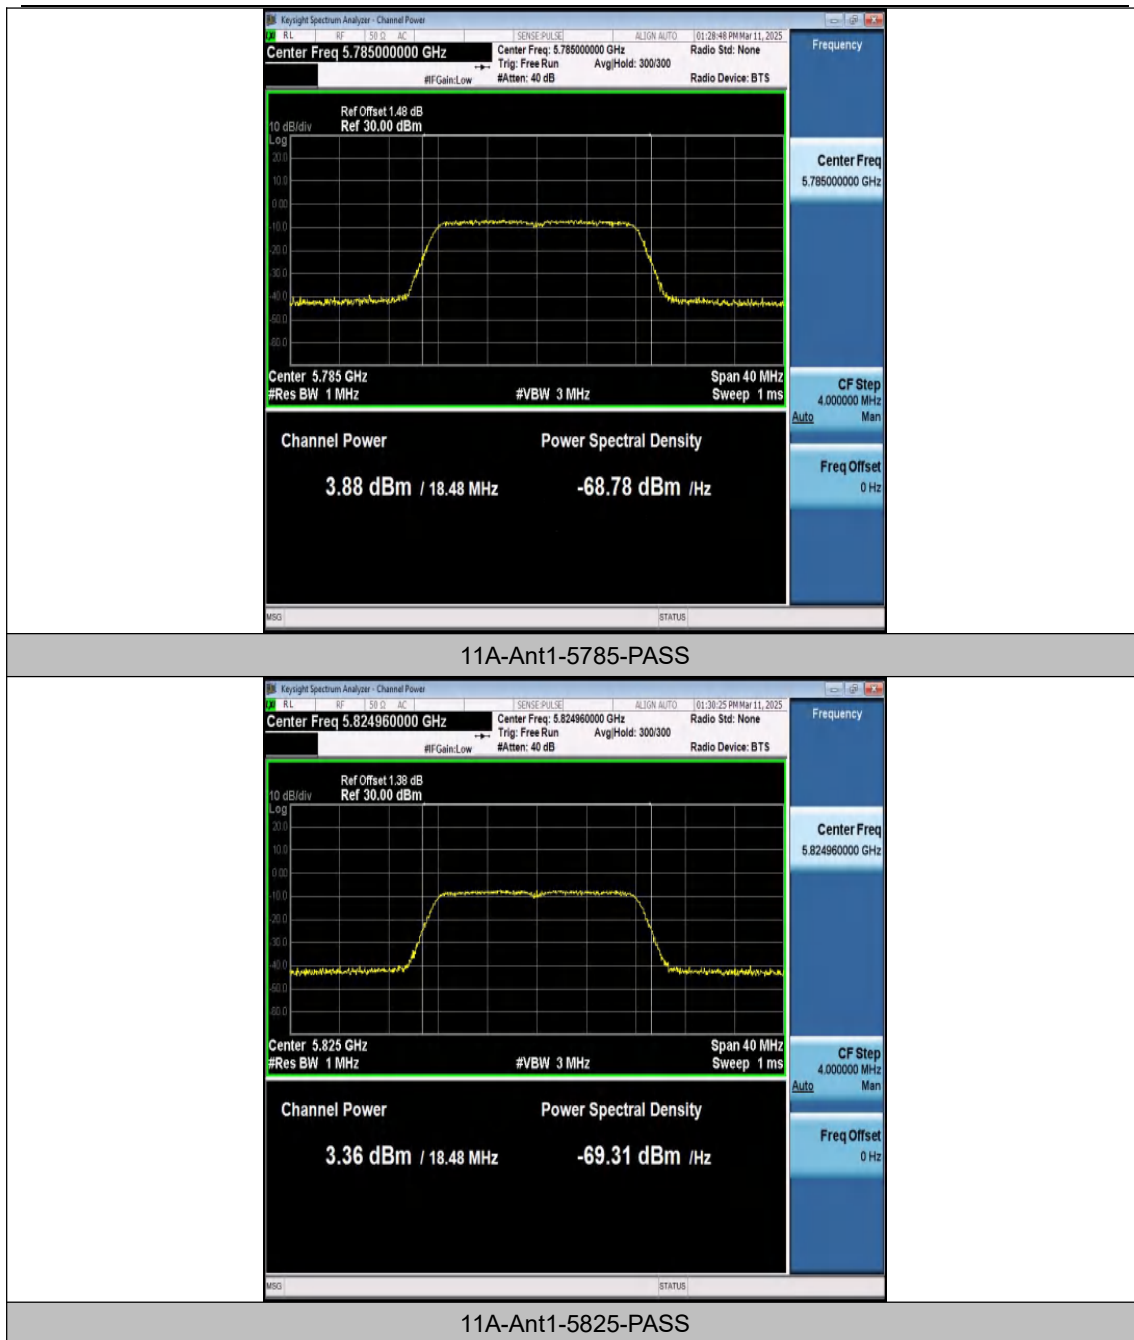


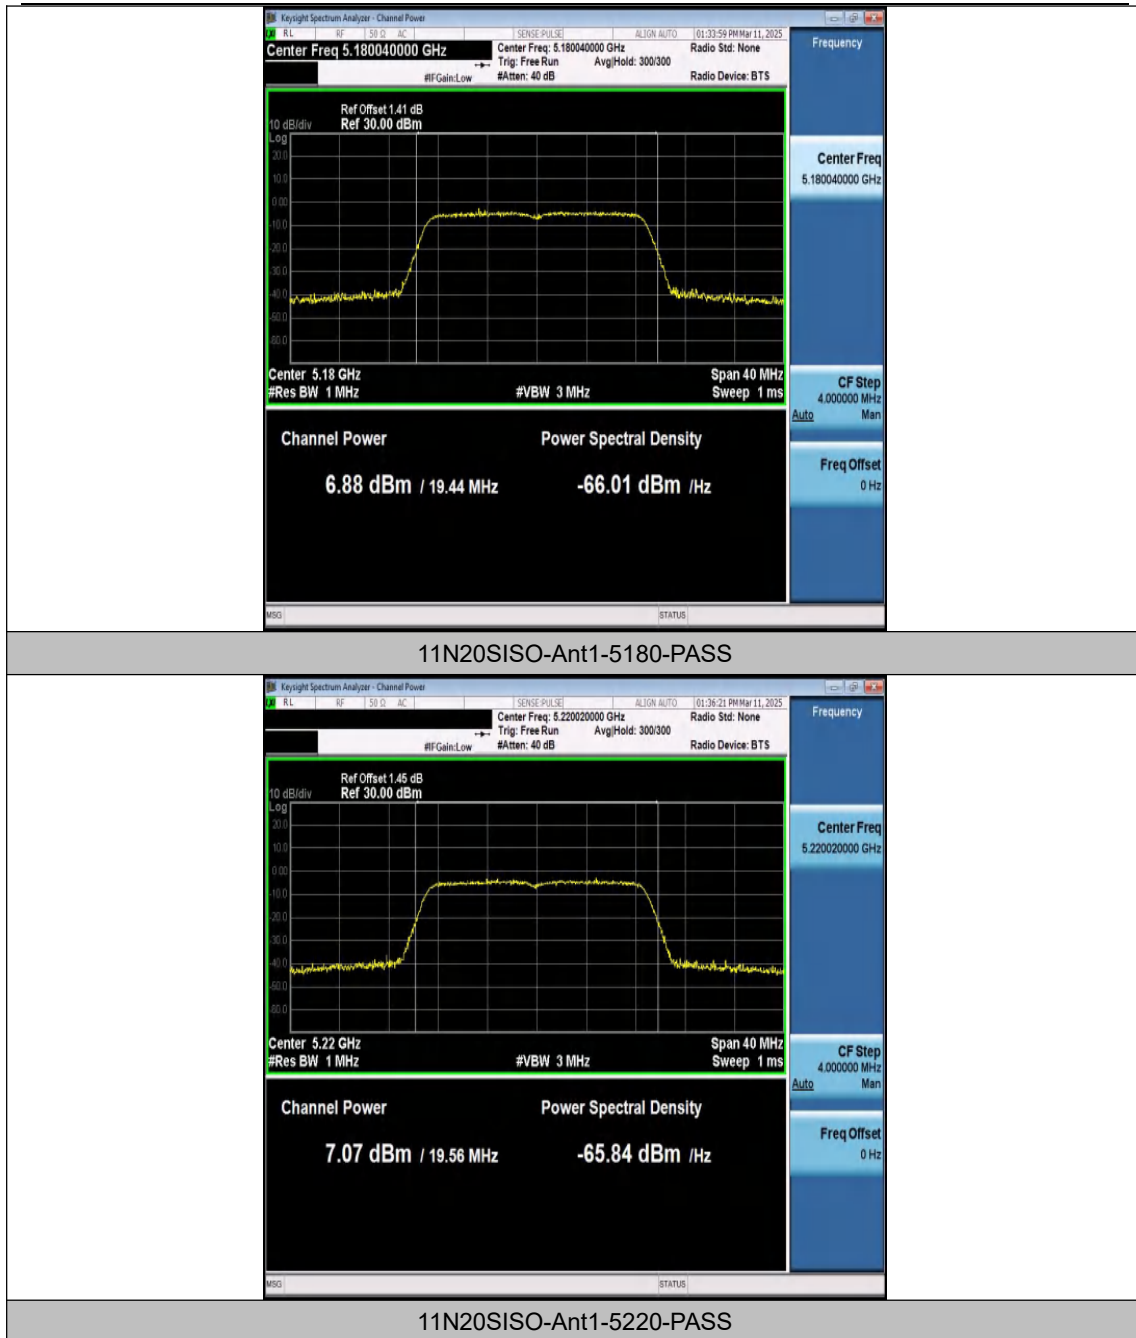

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

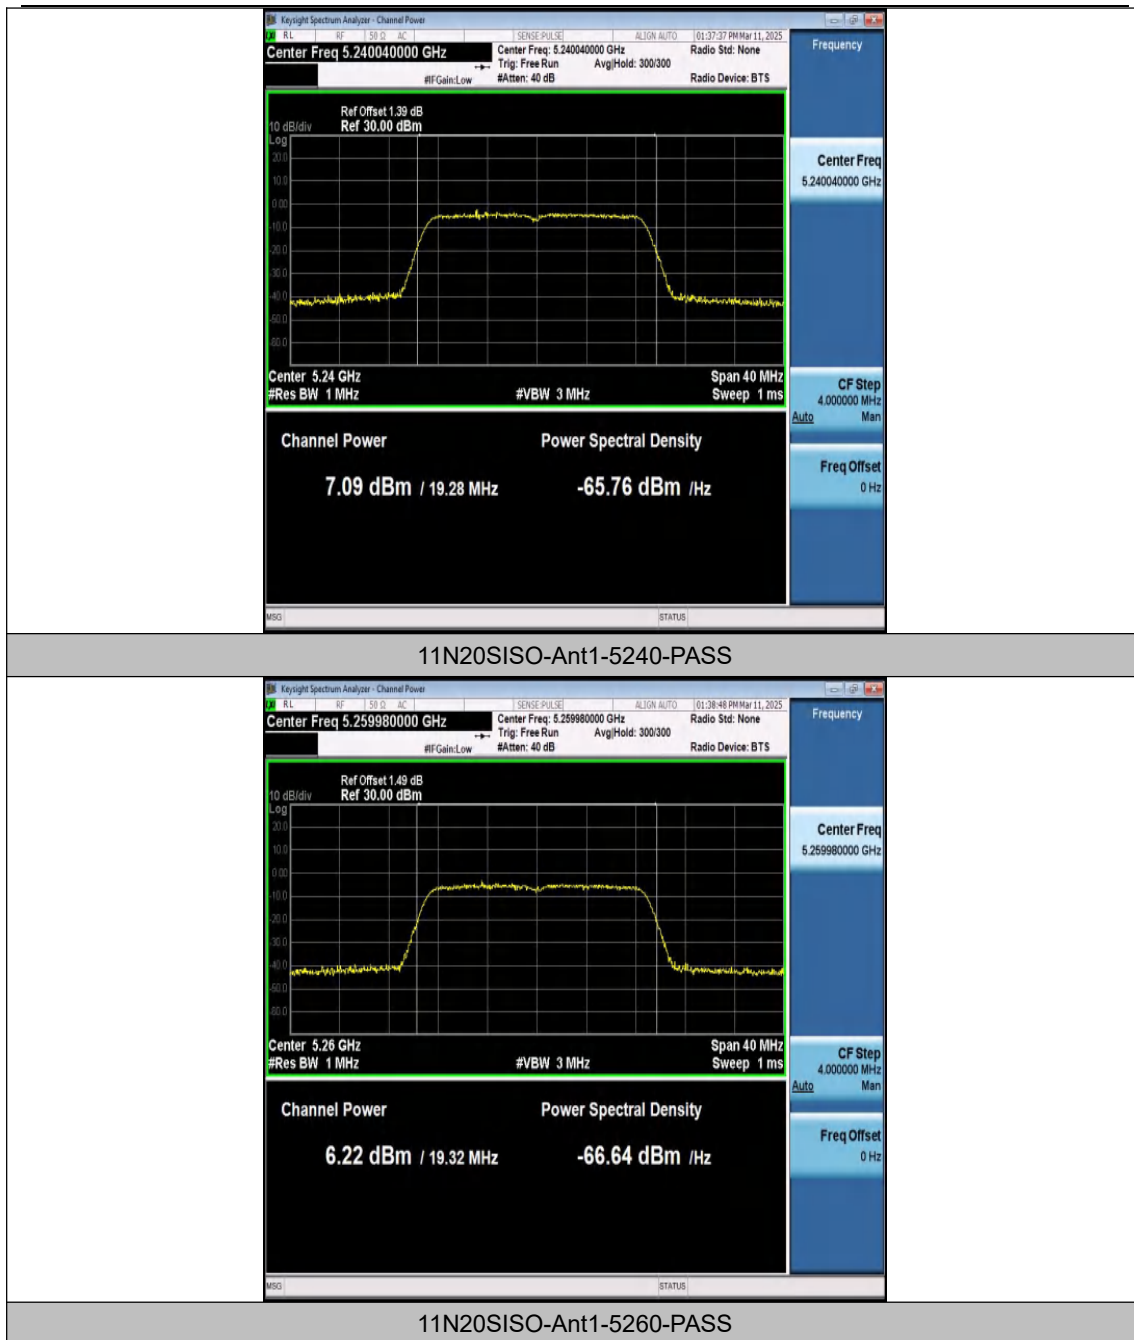



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com





Hotline
400-003-0500
www.anbotech.com

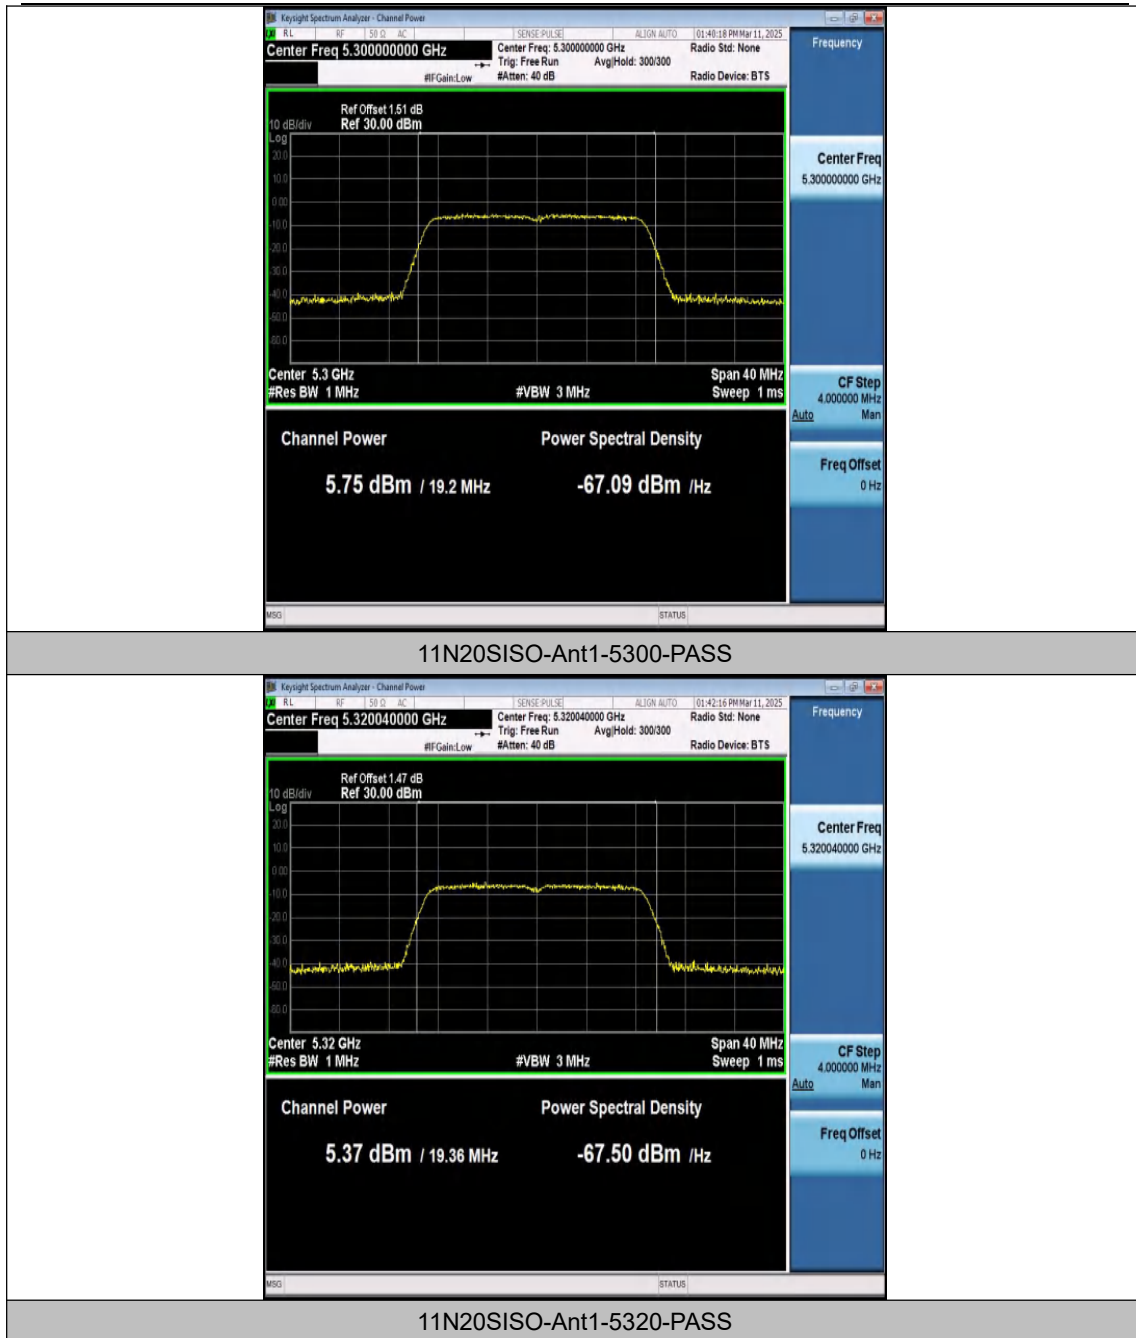

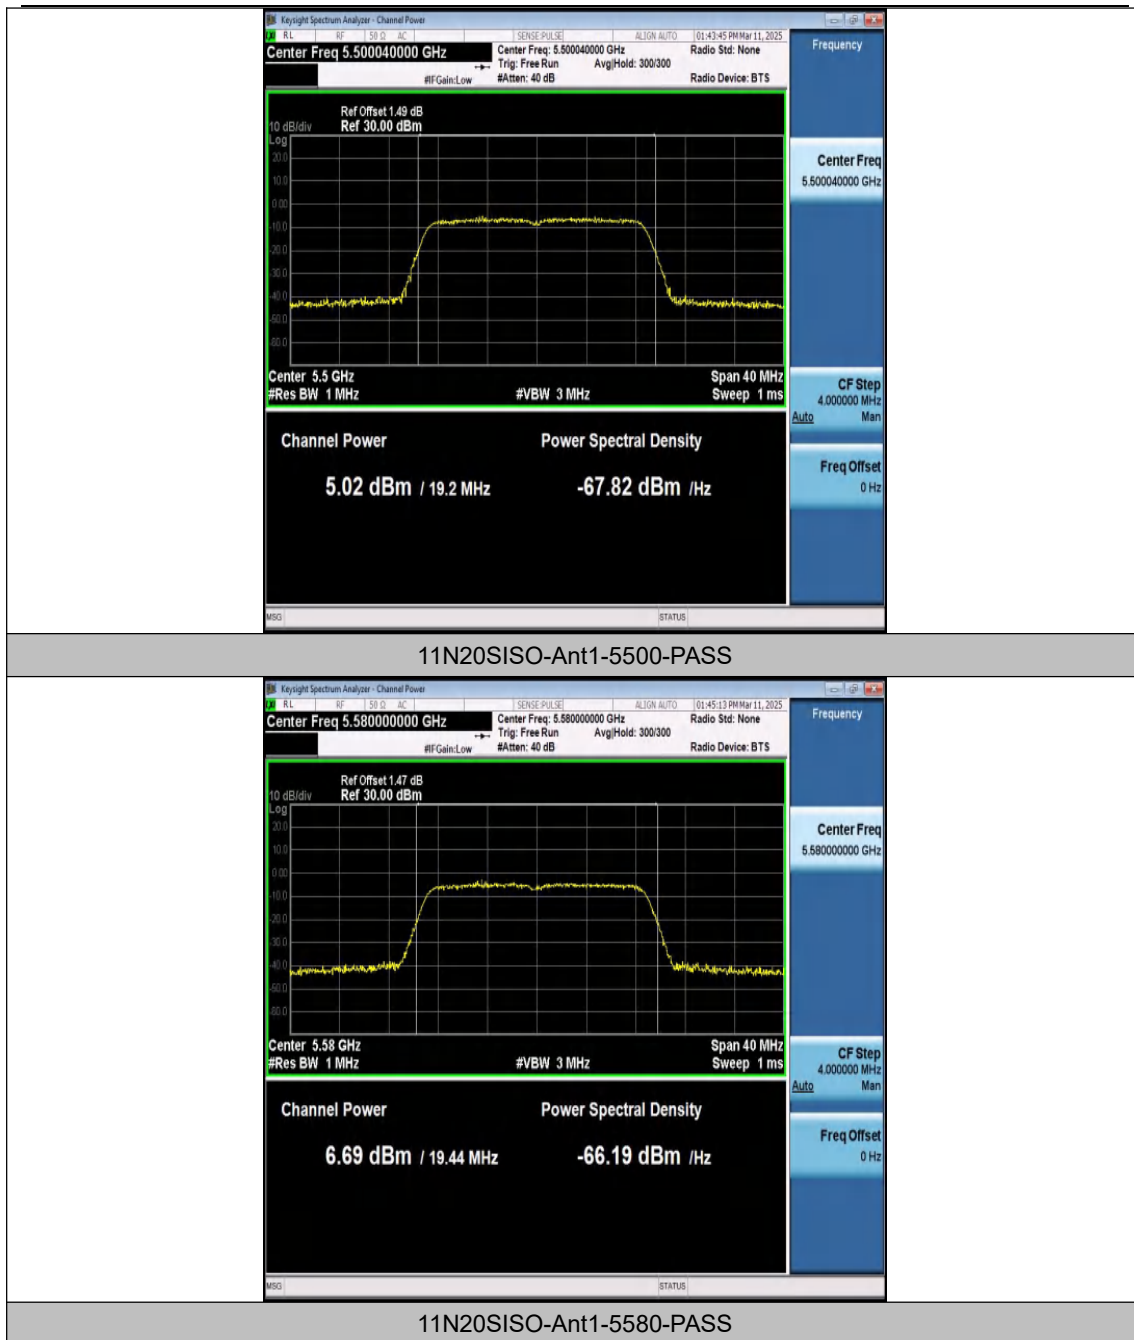

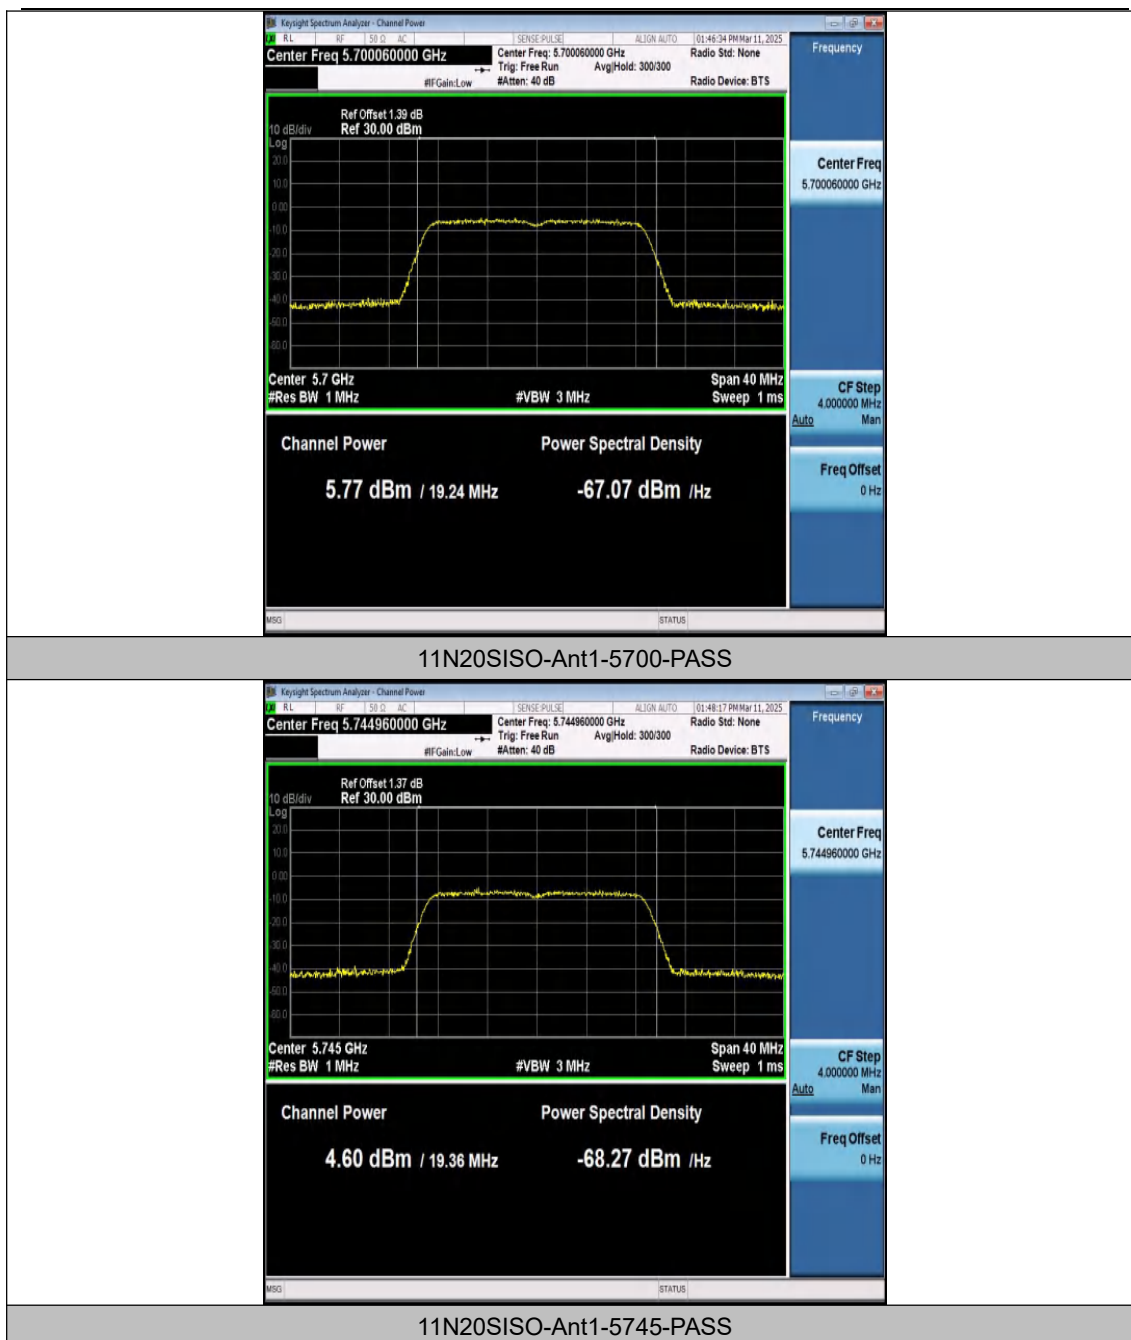

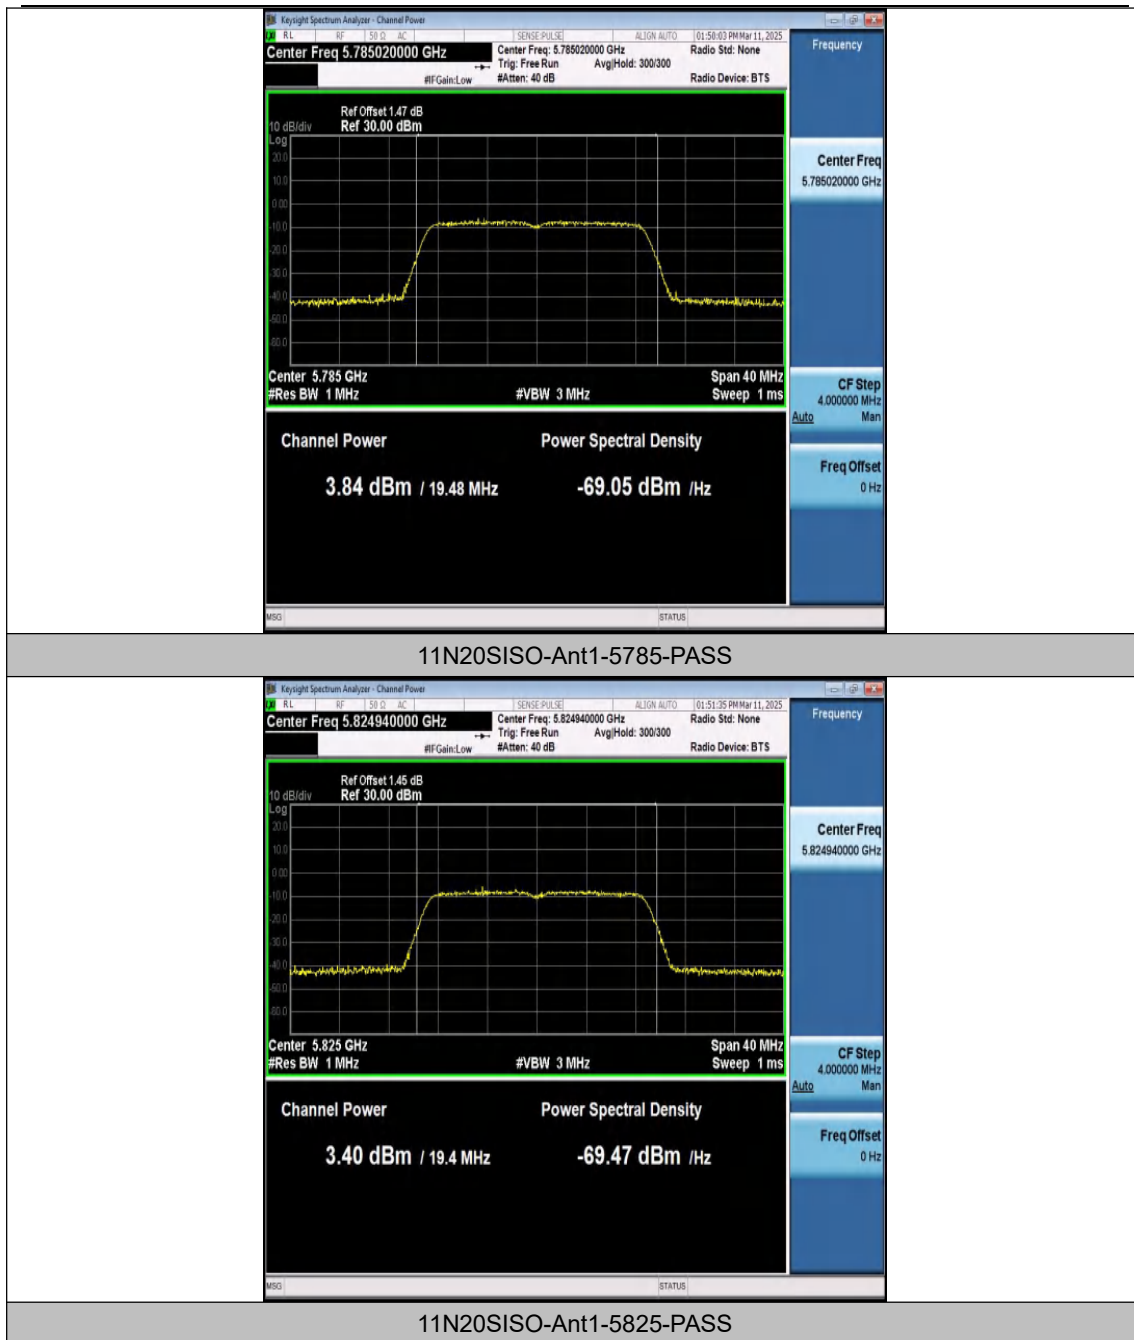


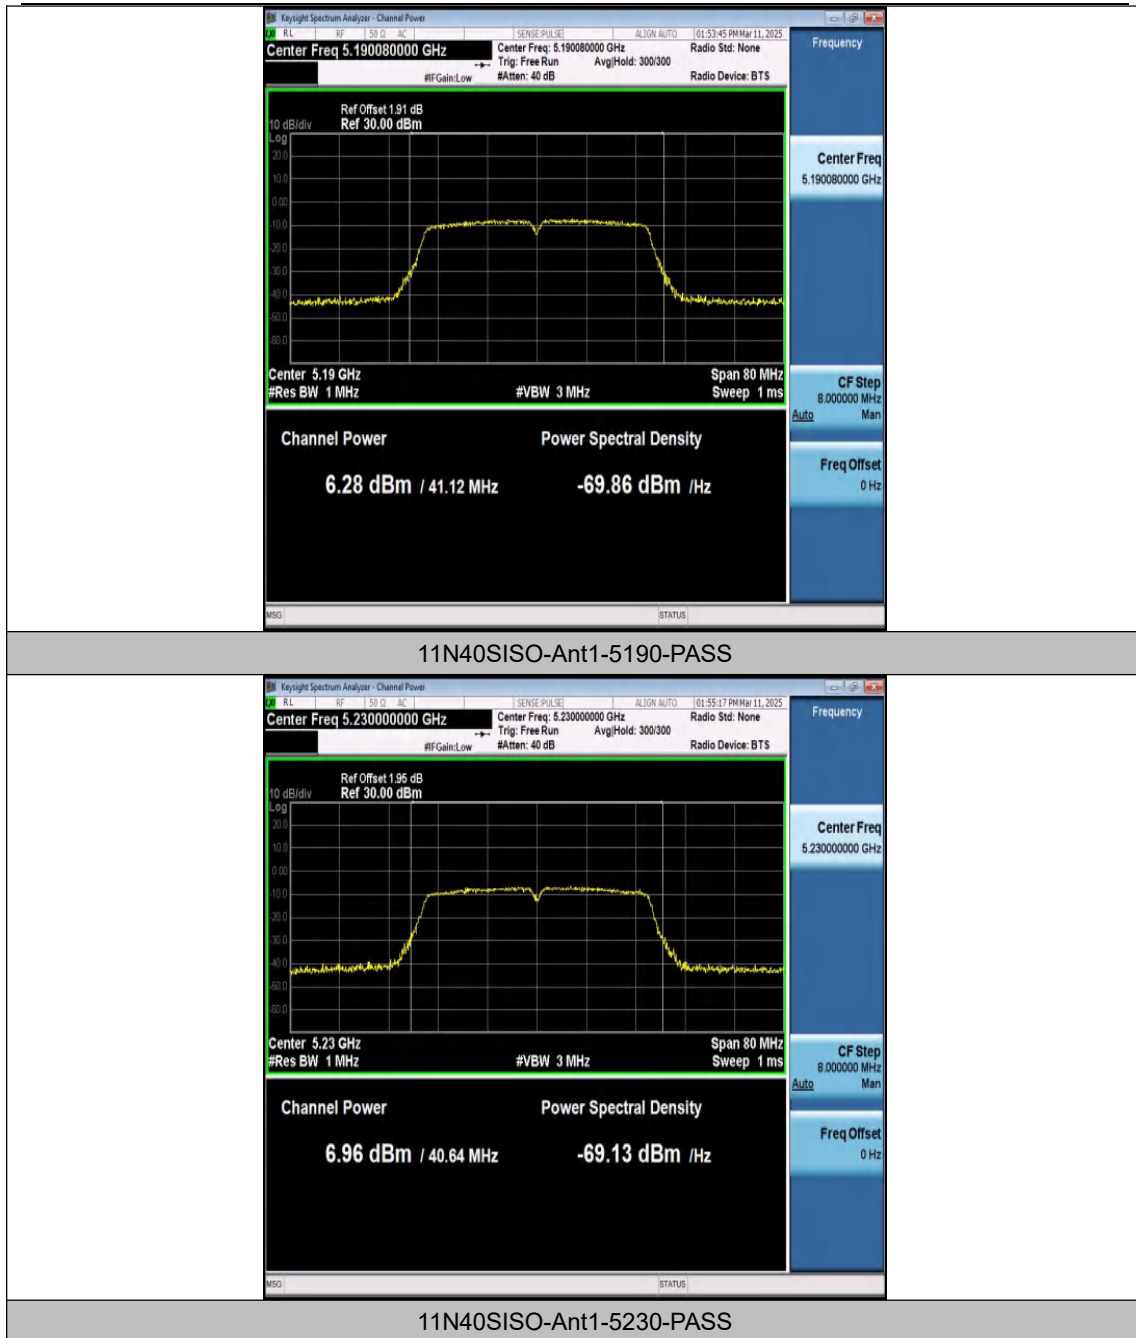


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

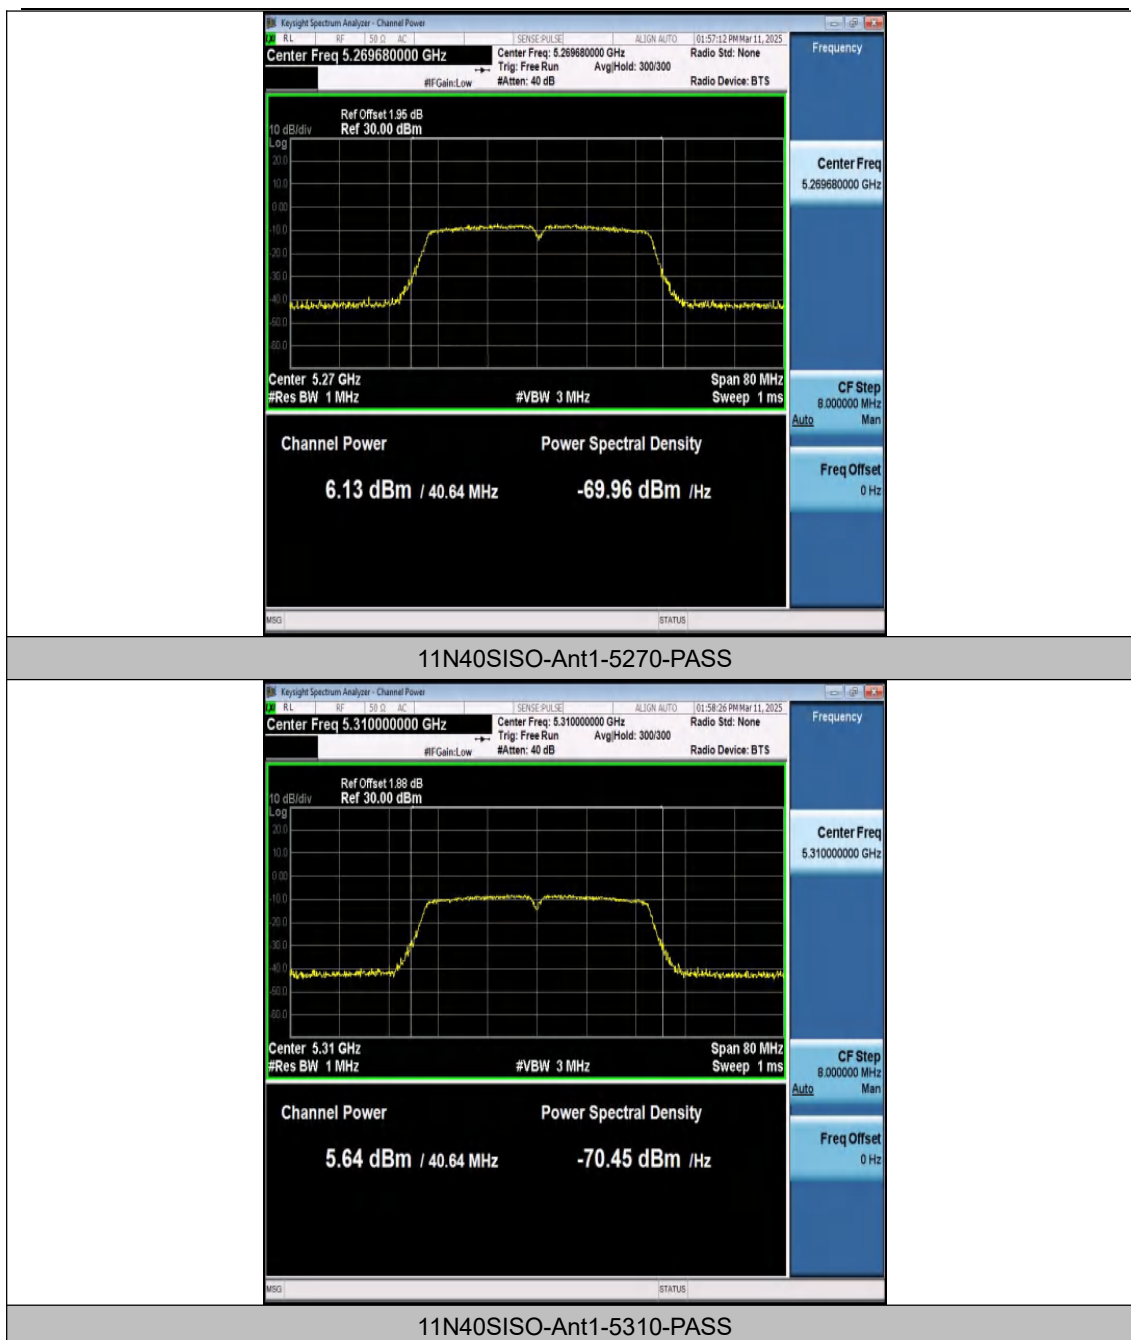


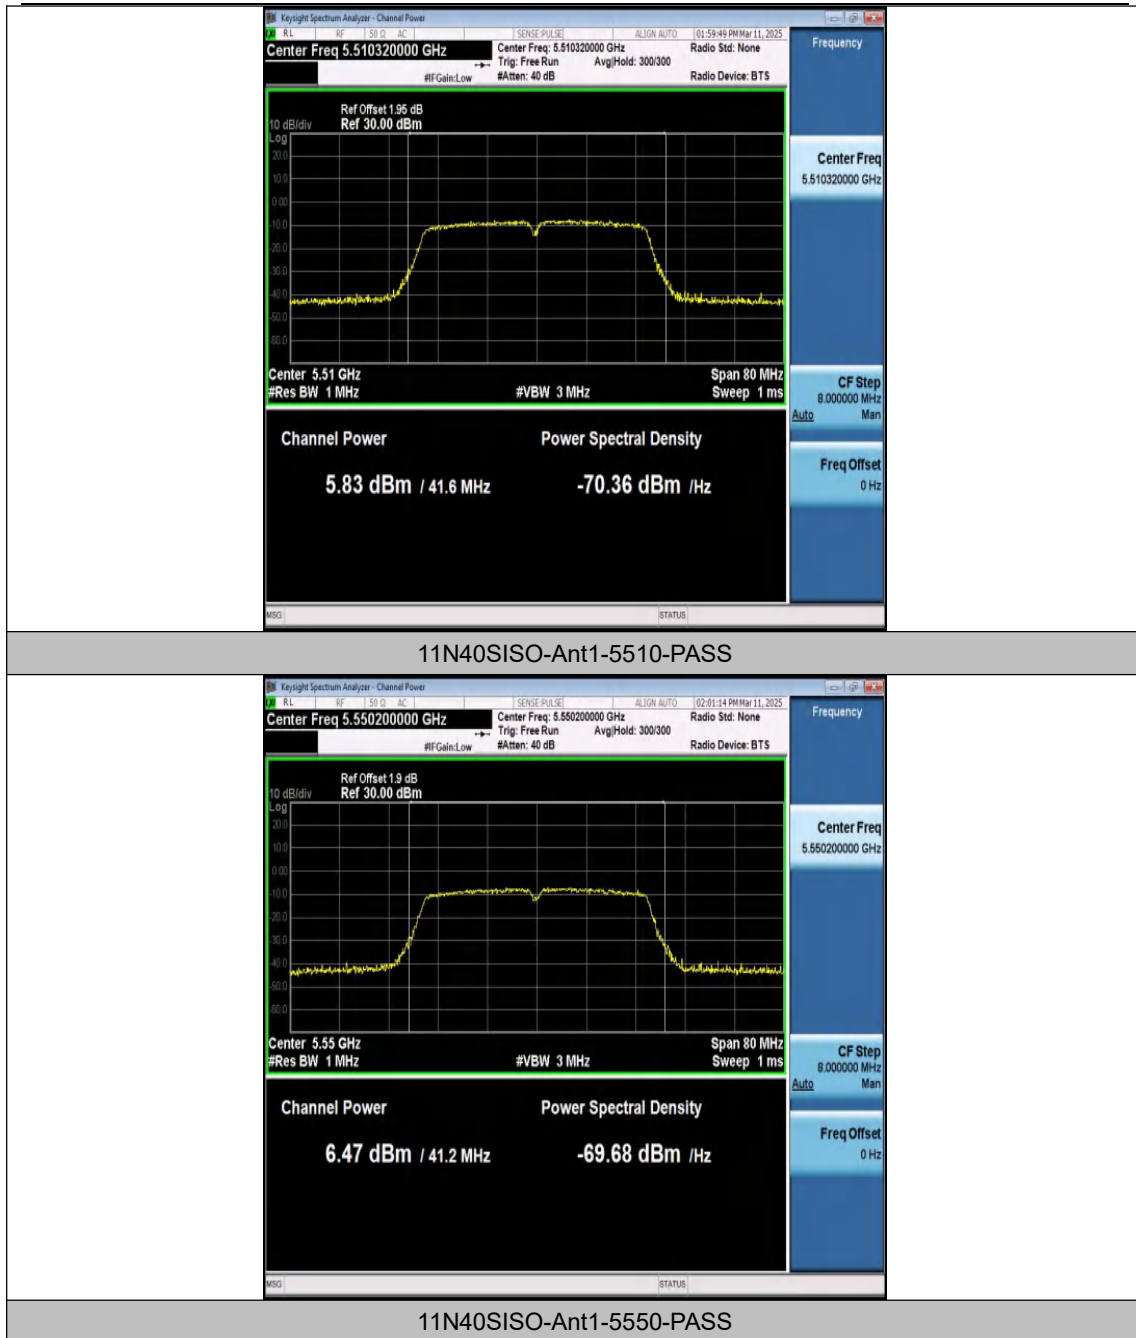



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

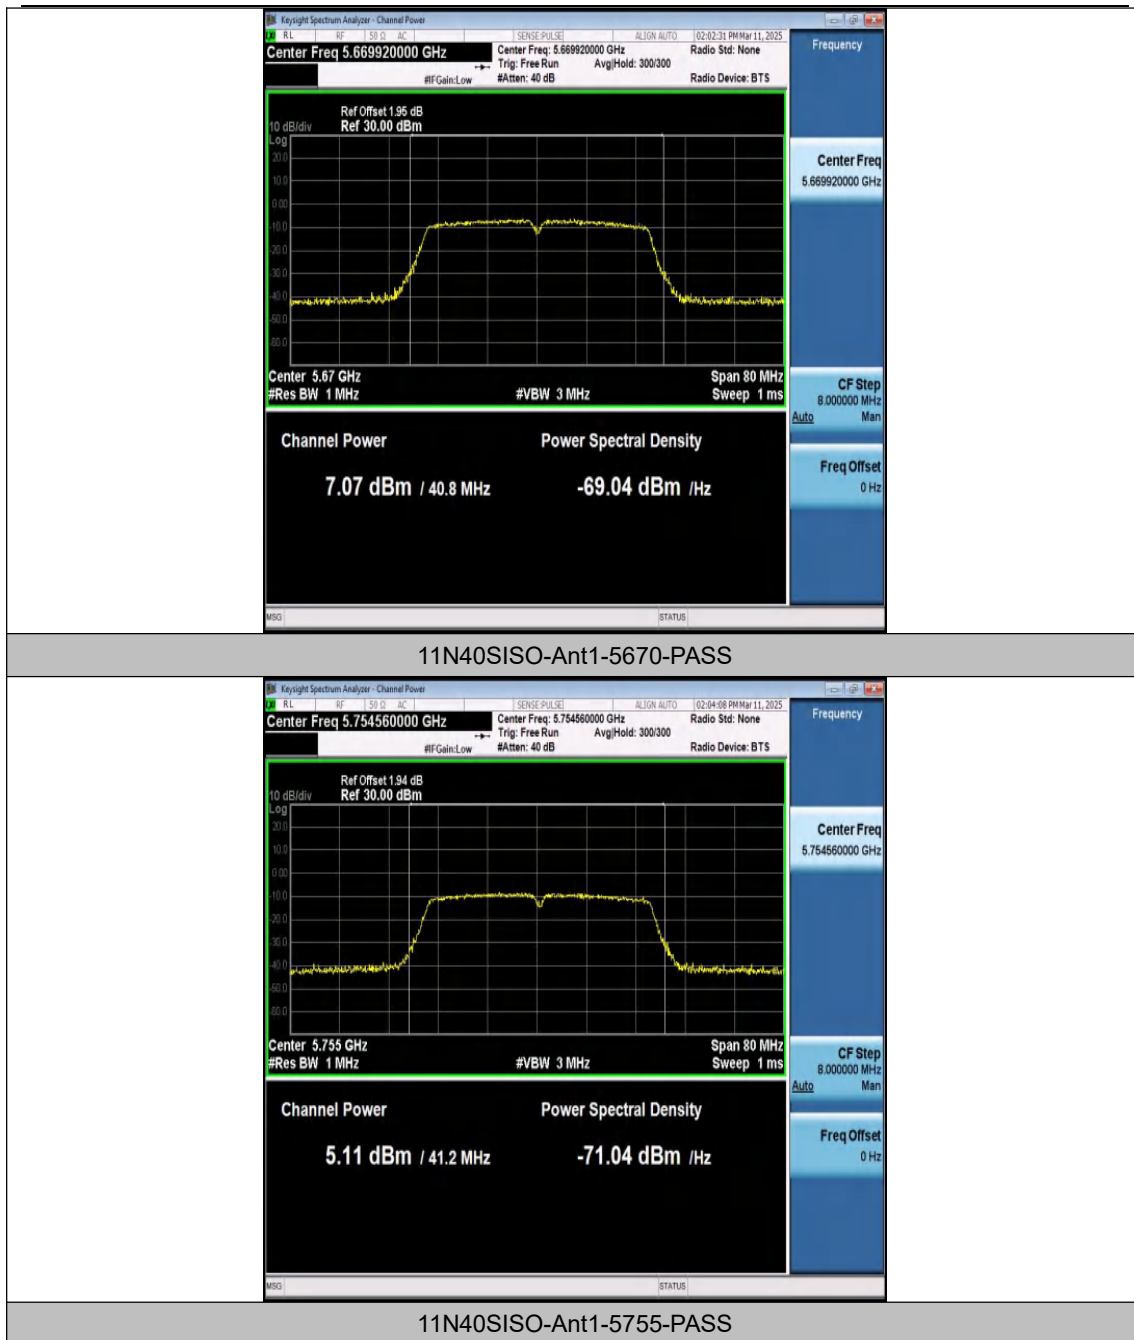

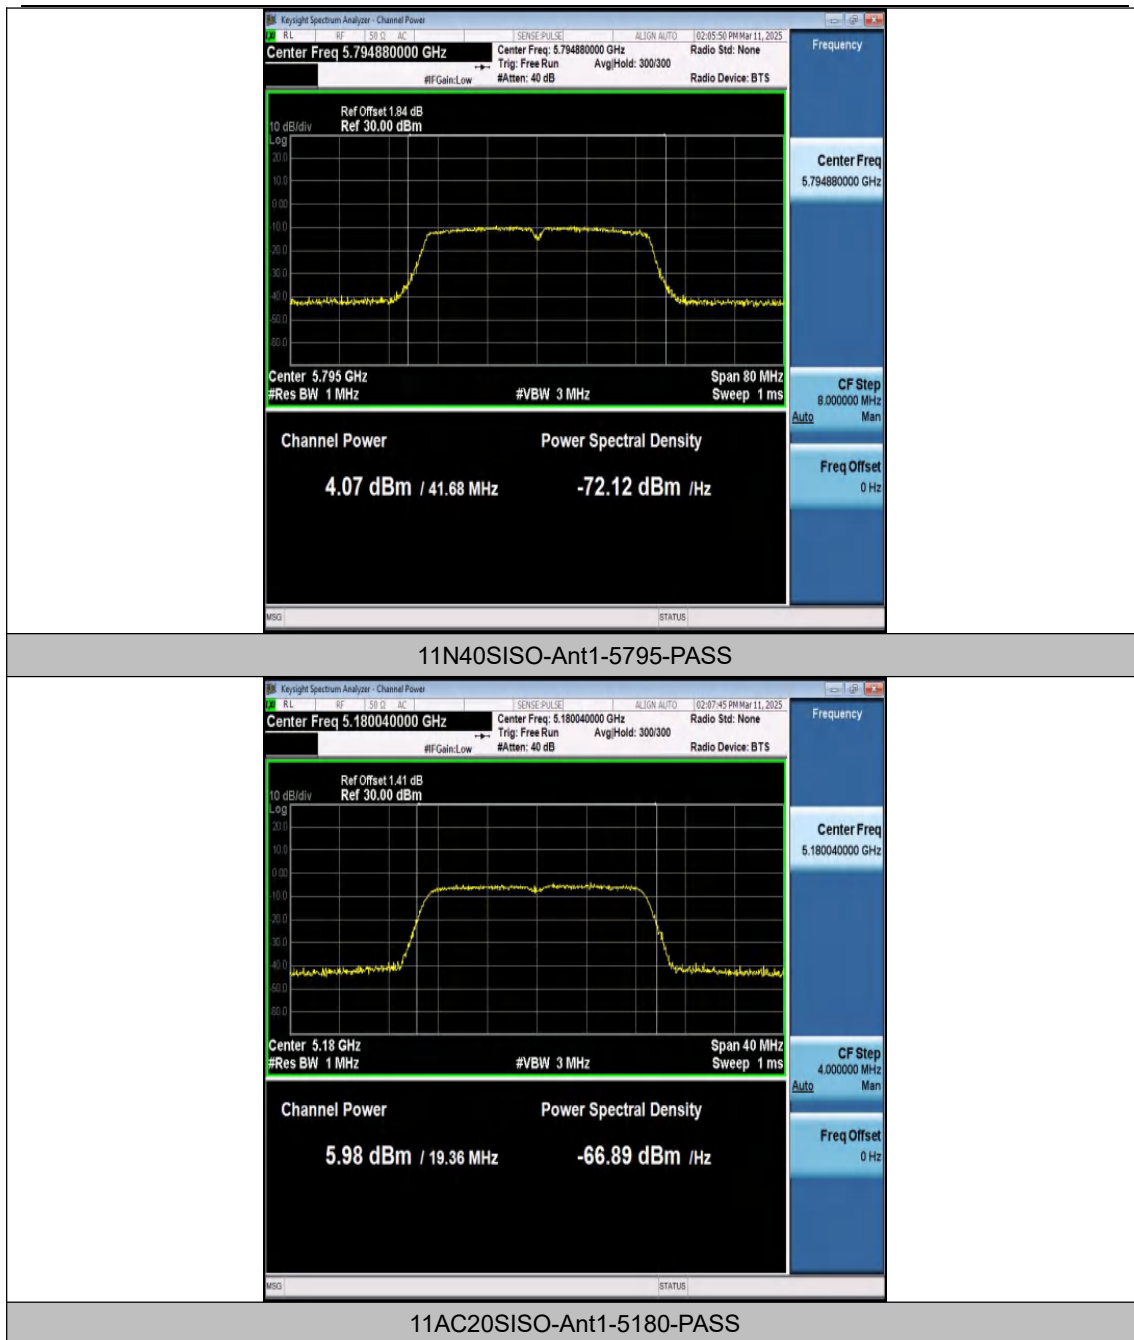

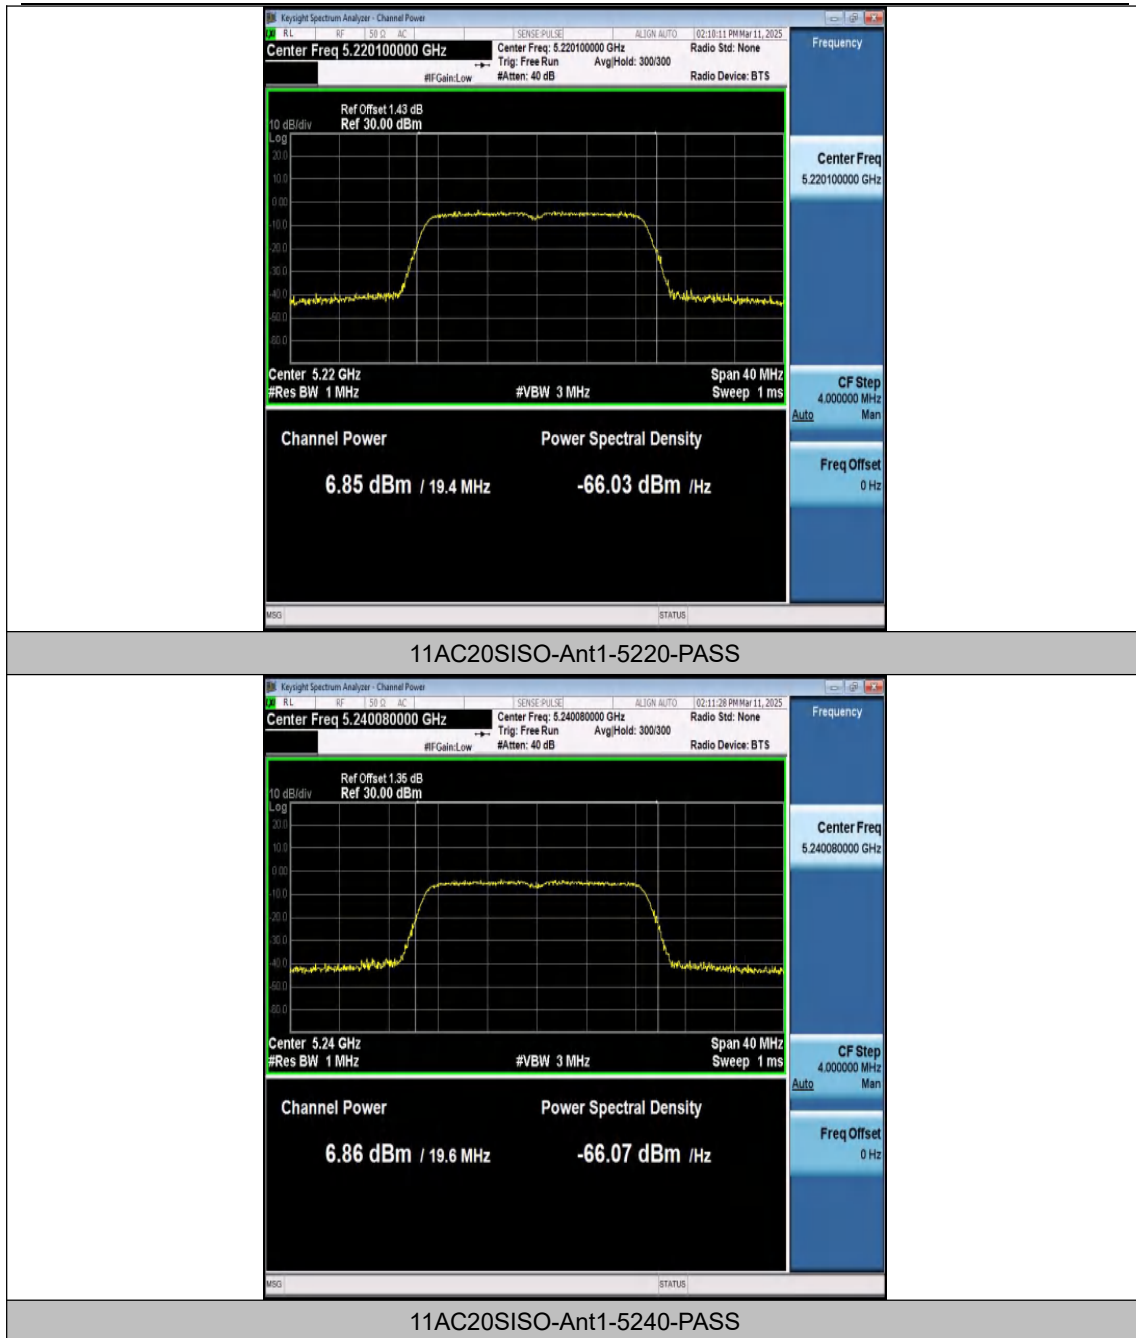

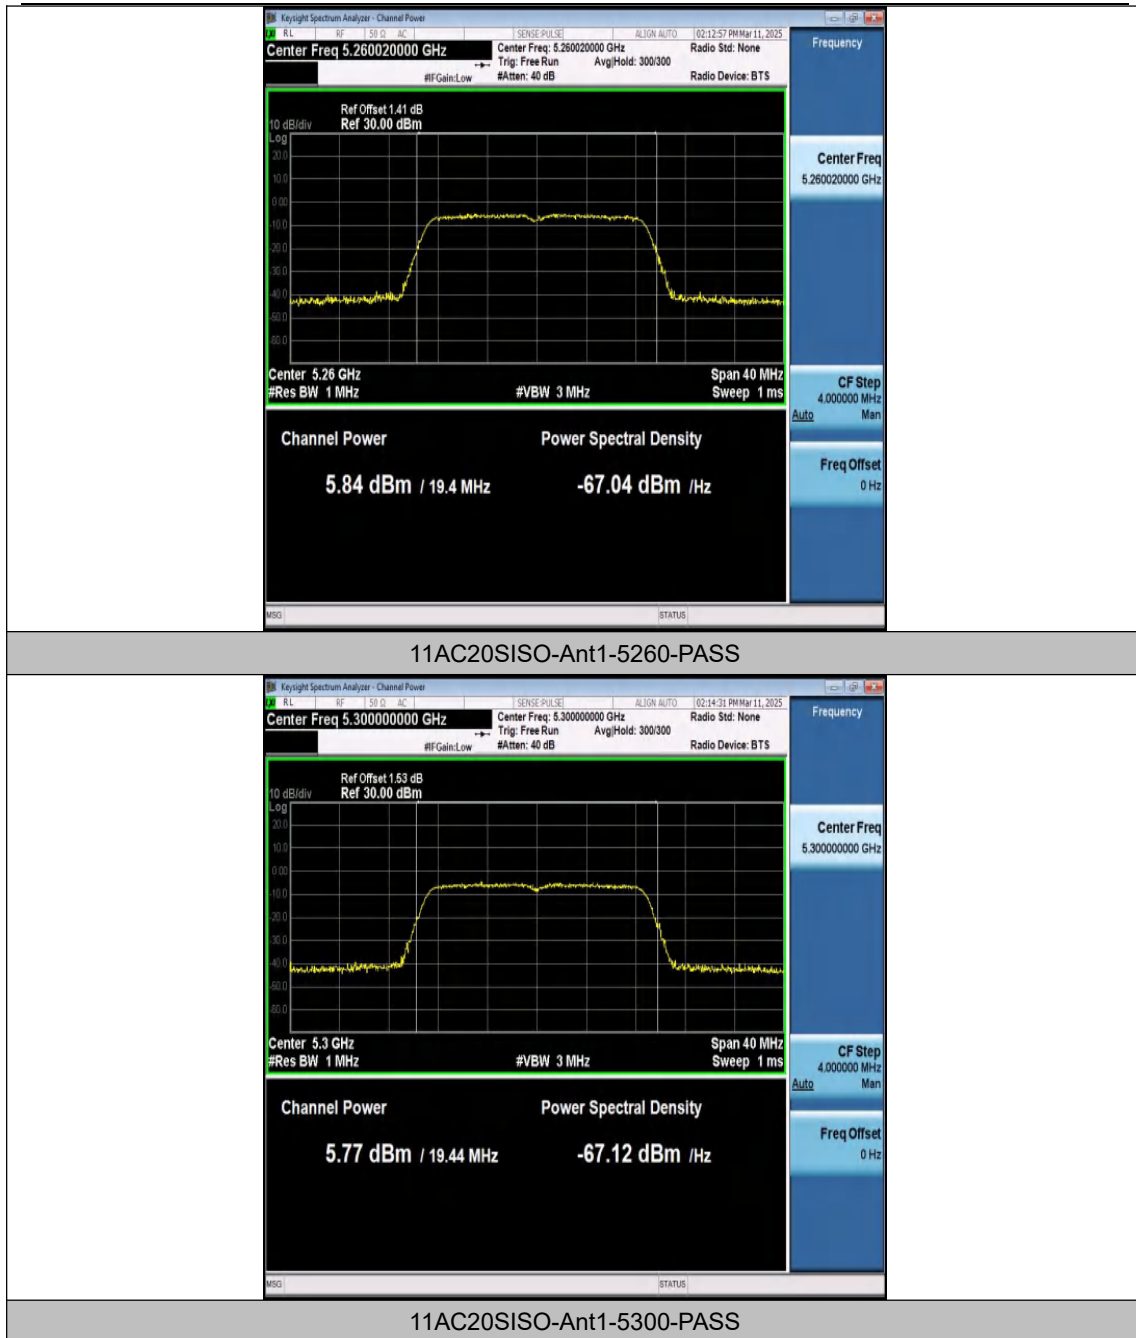


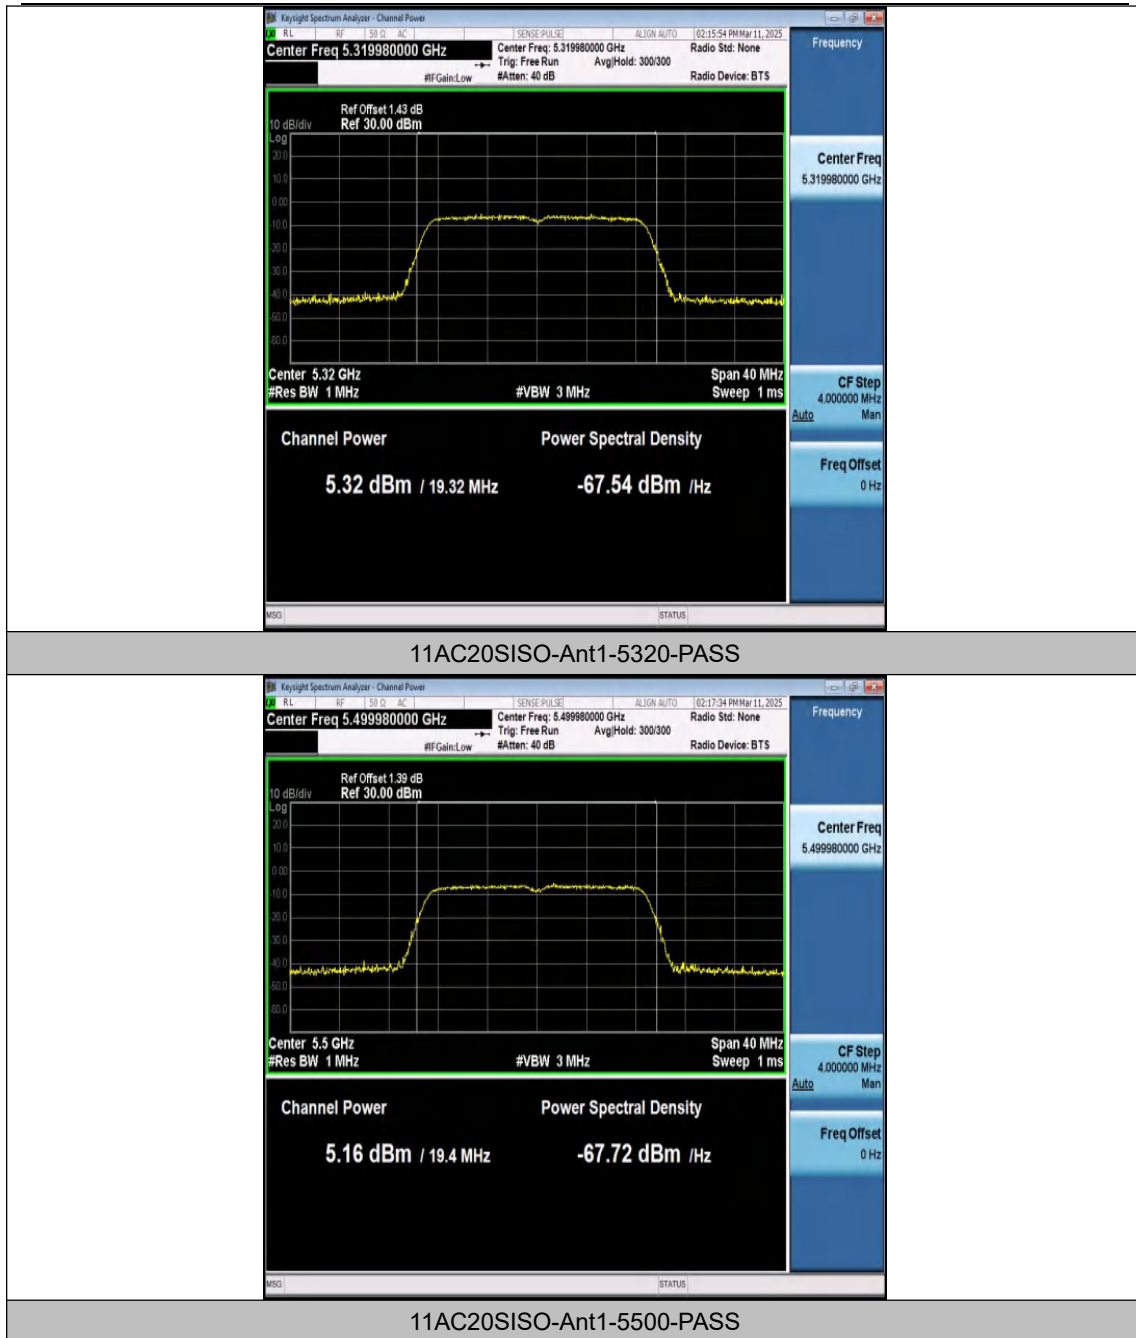



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

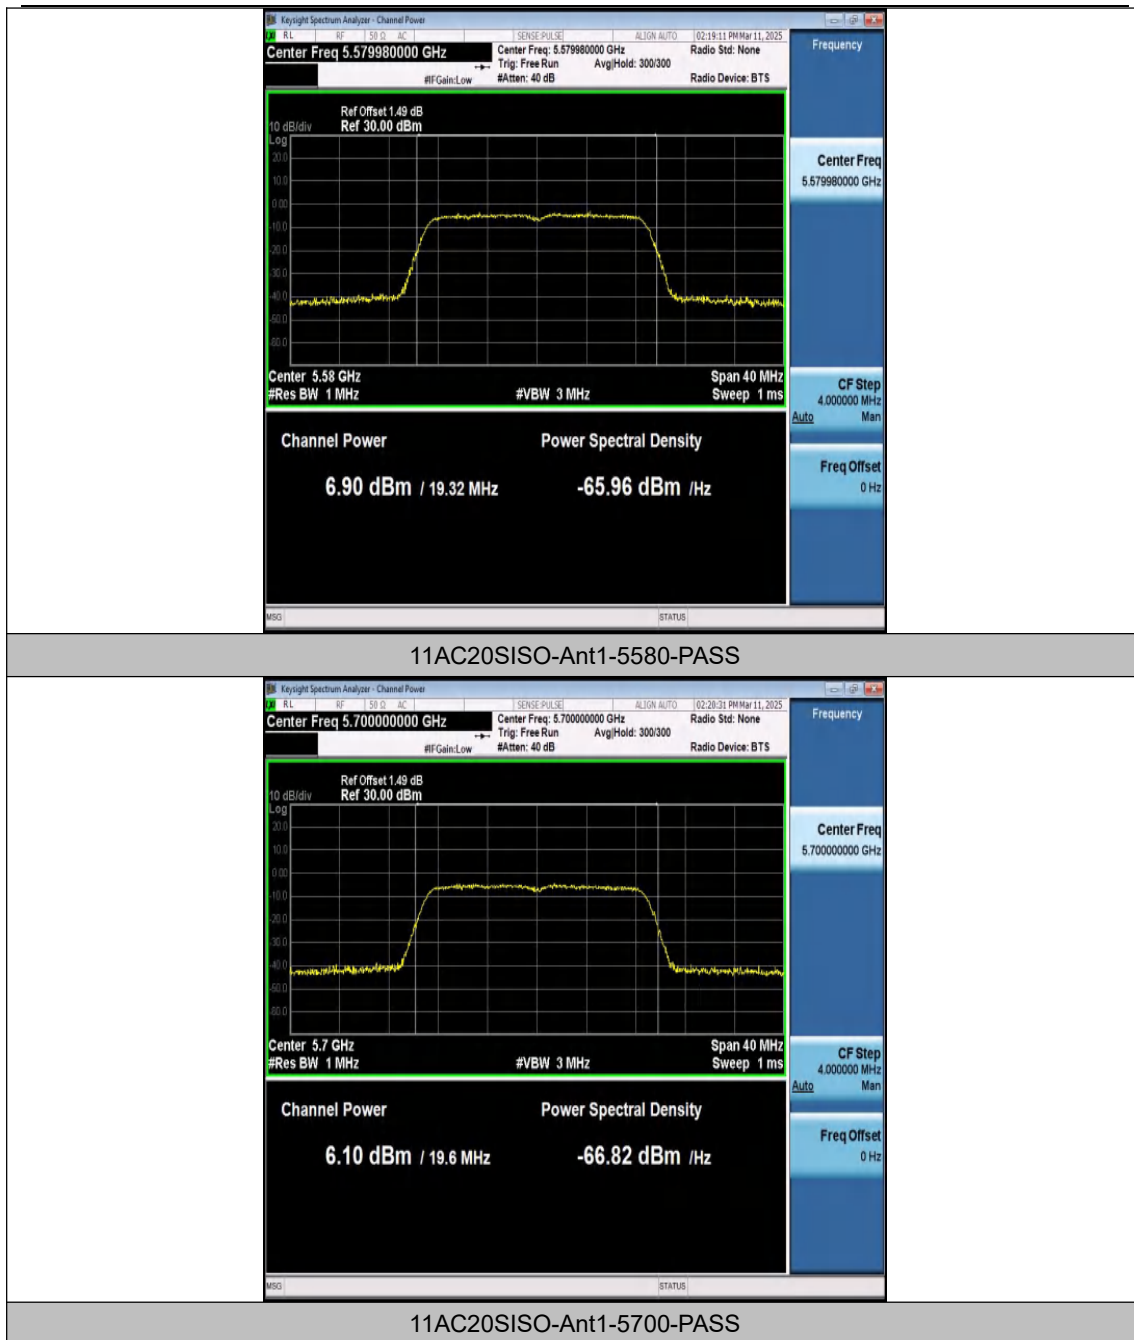

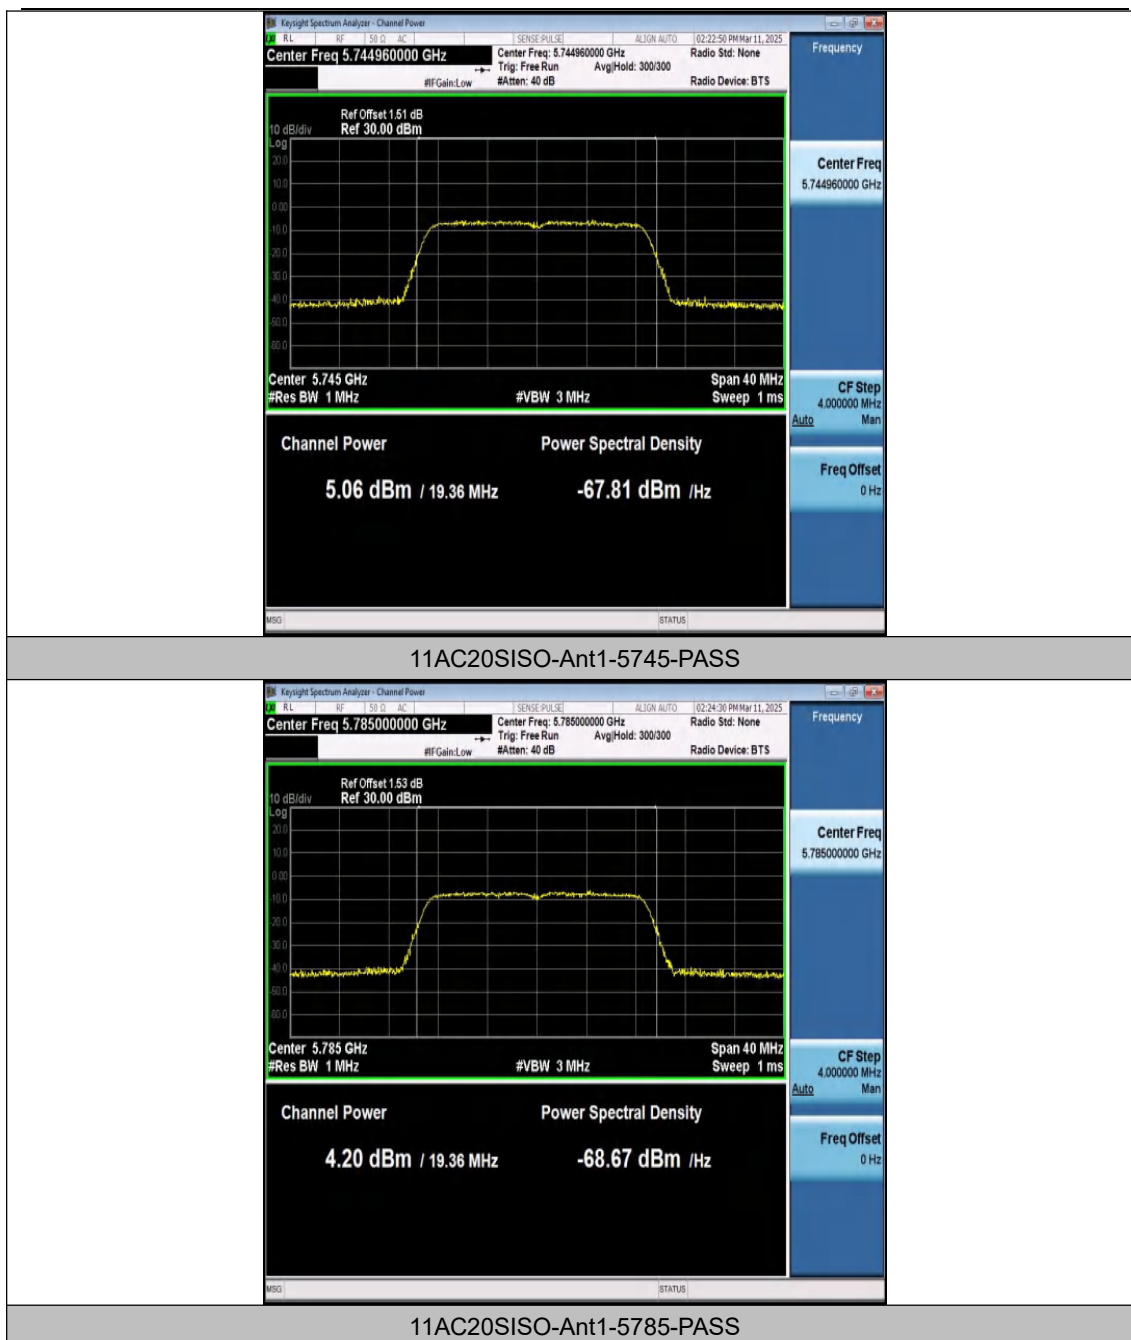

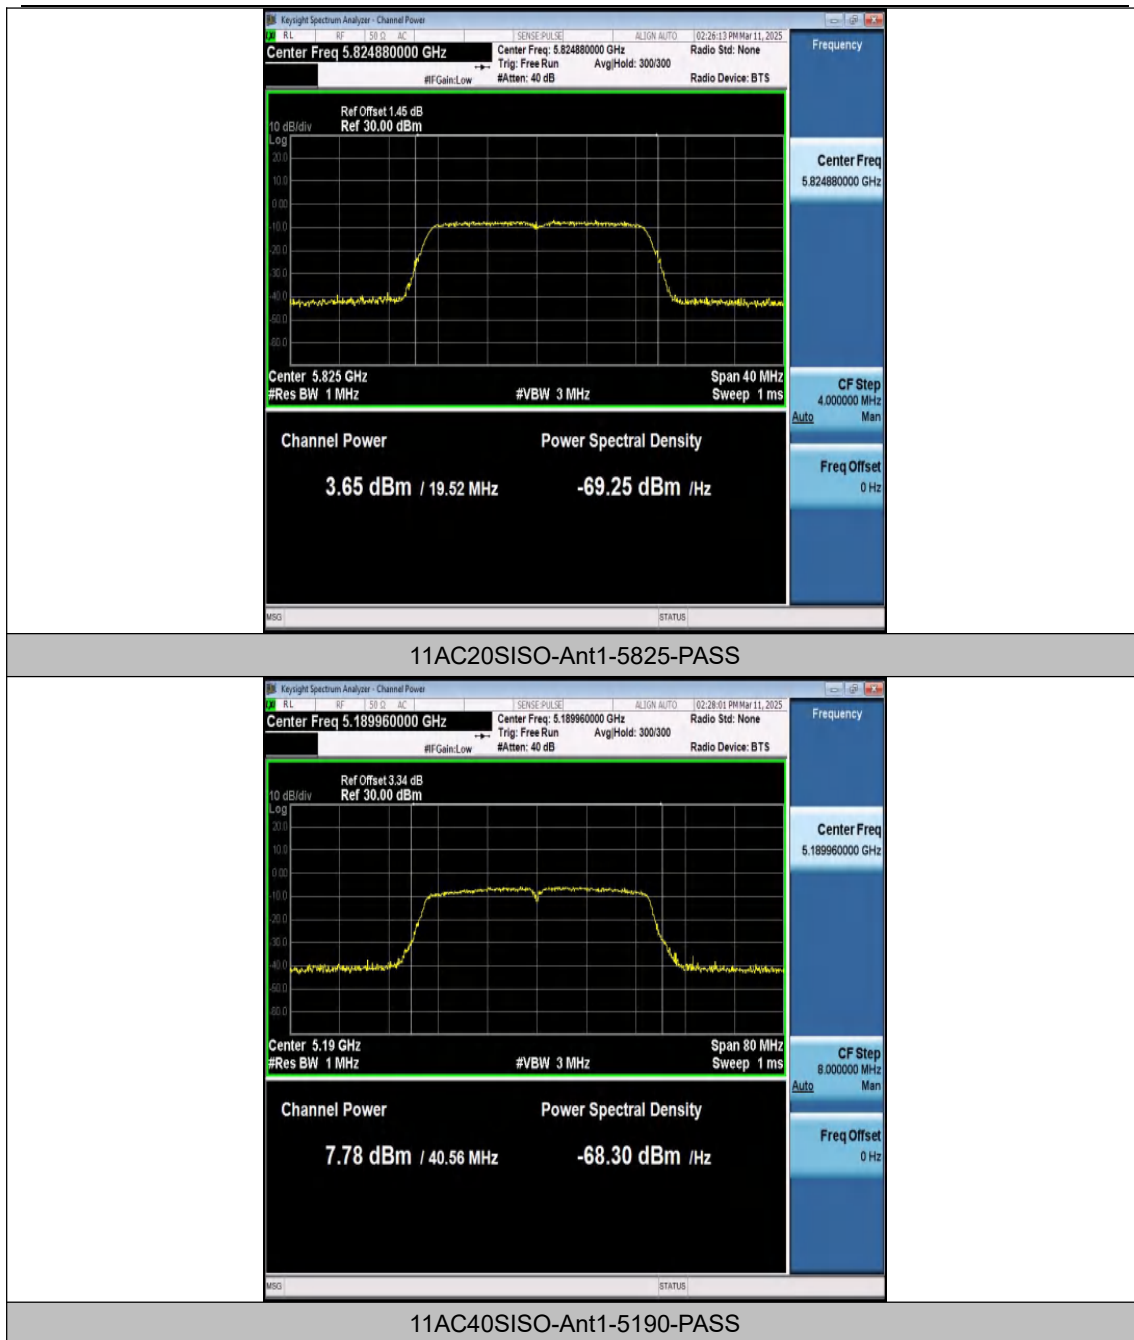


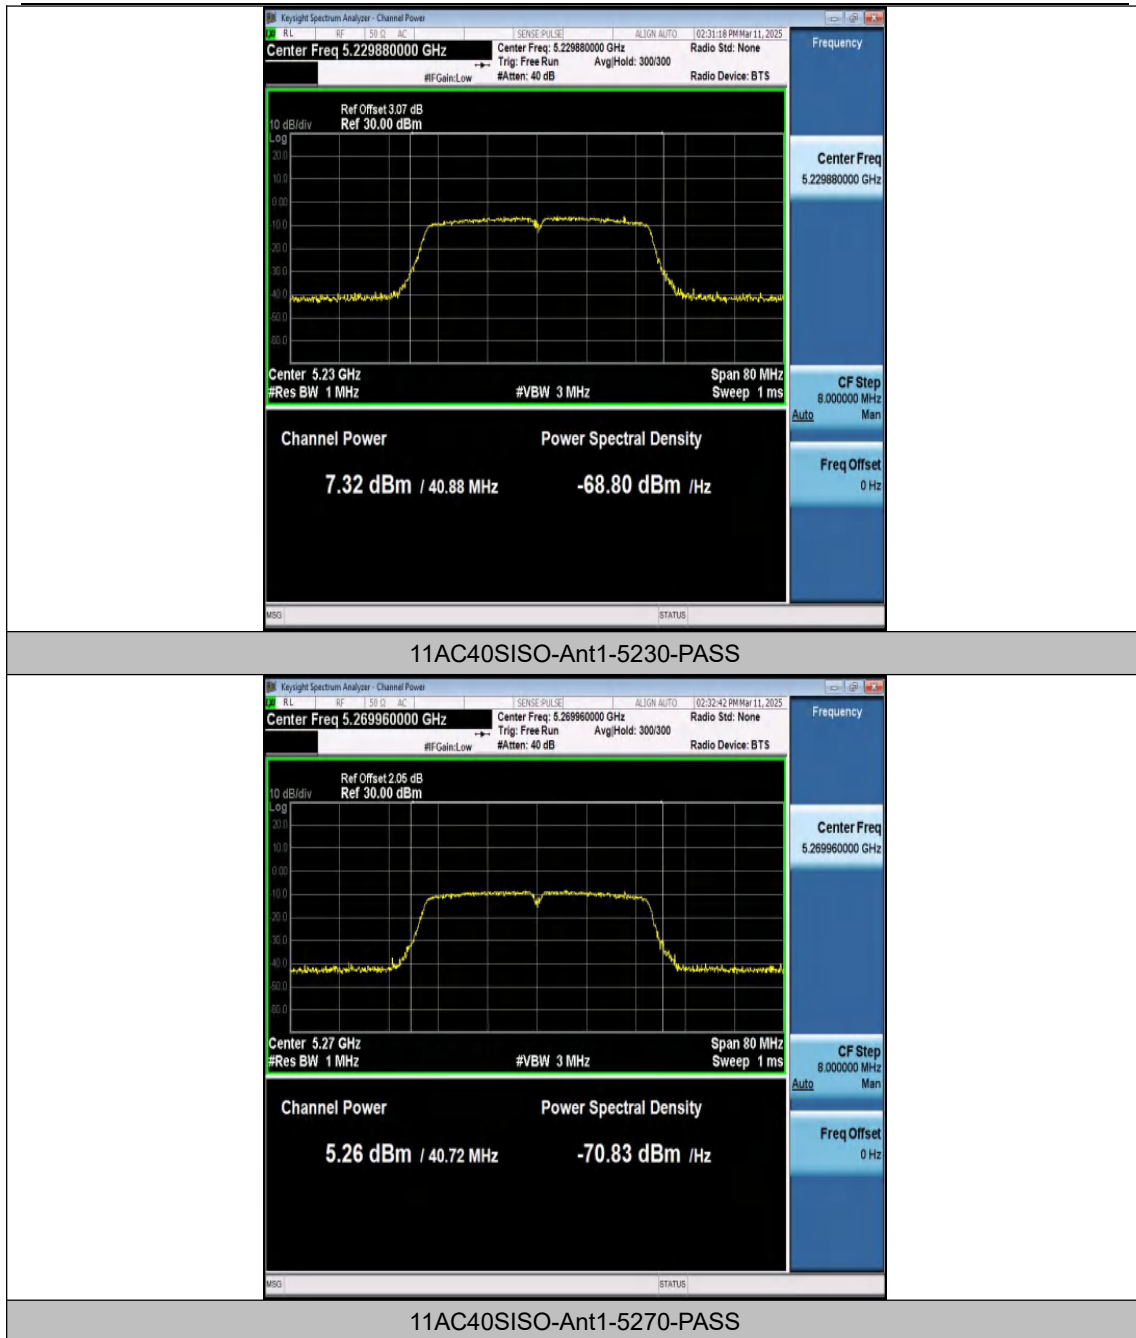



Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

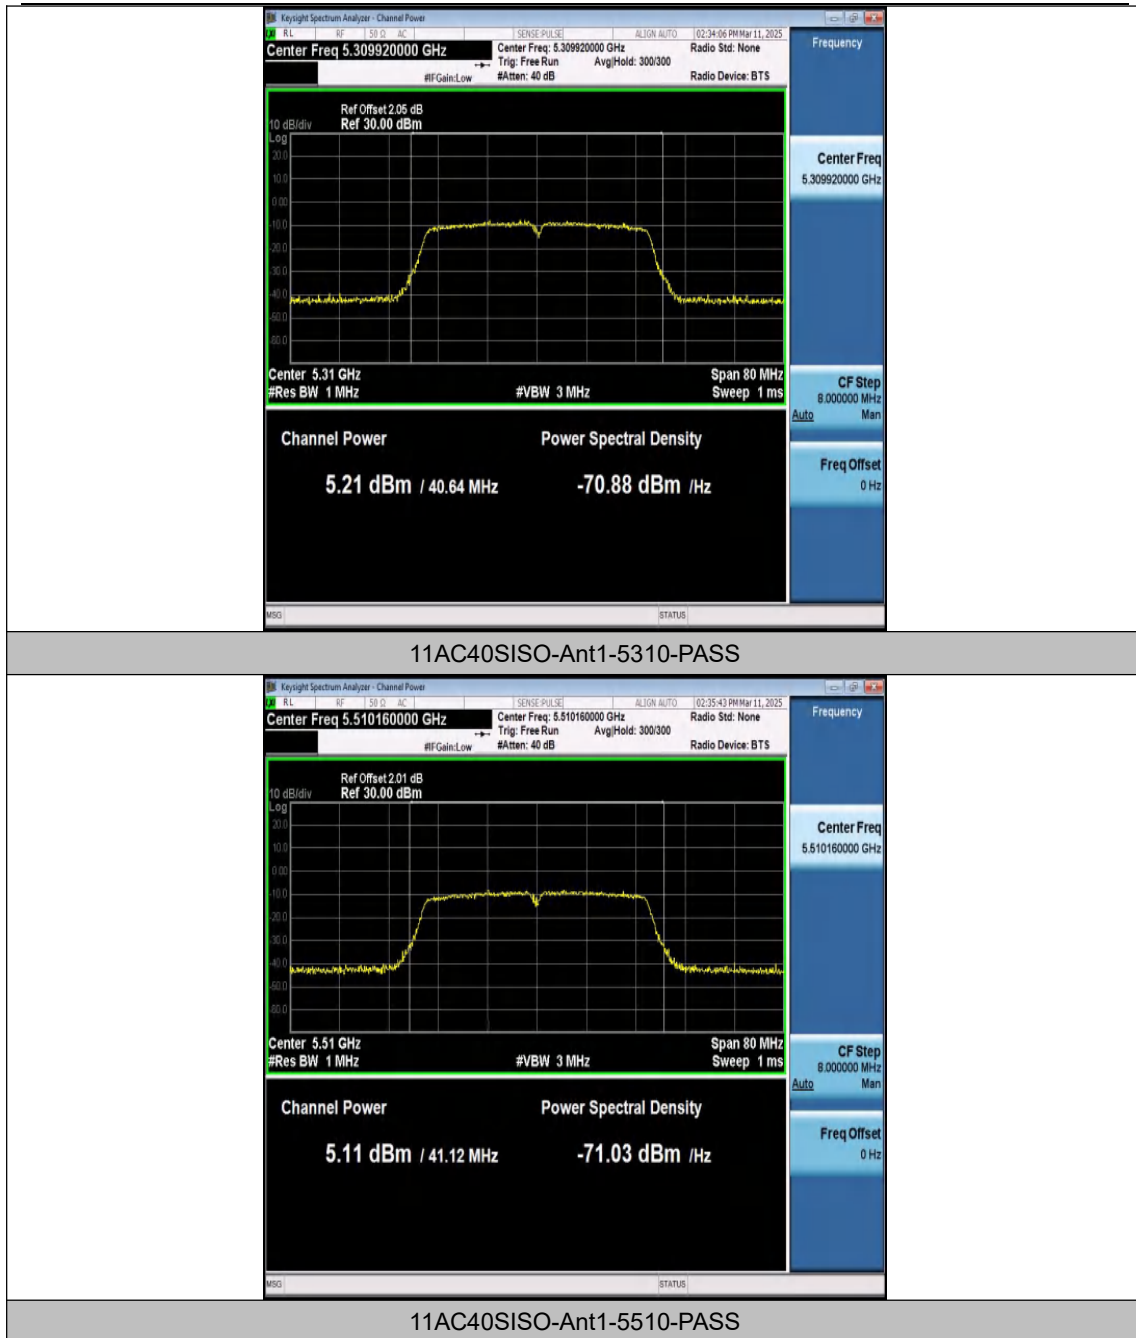

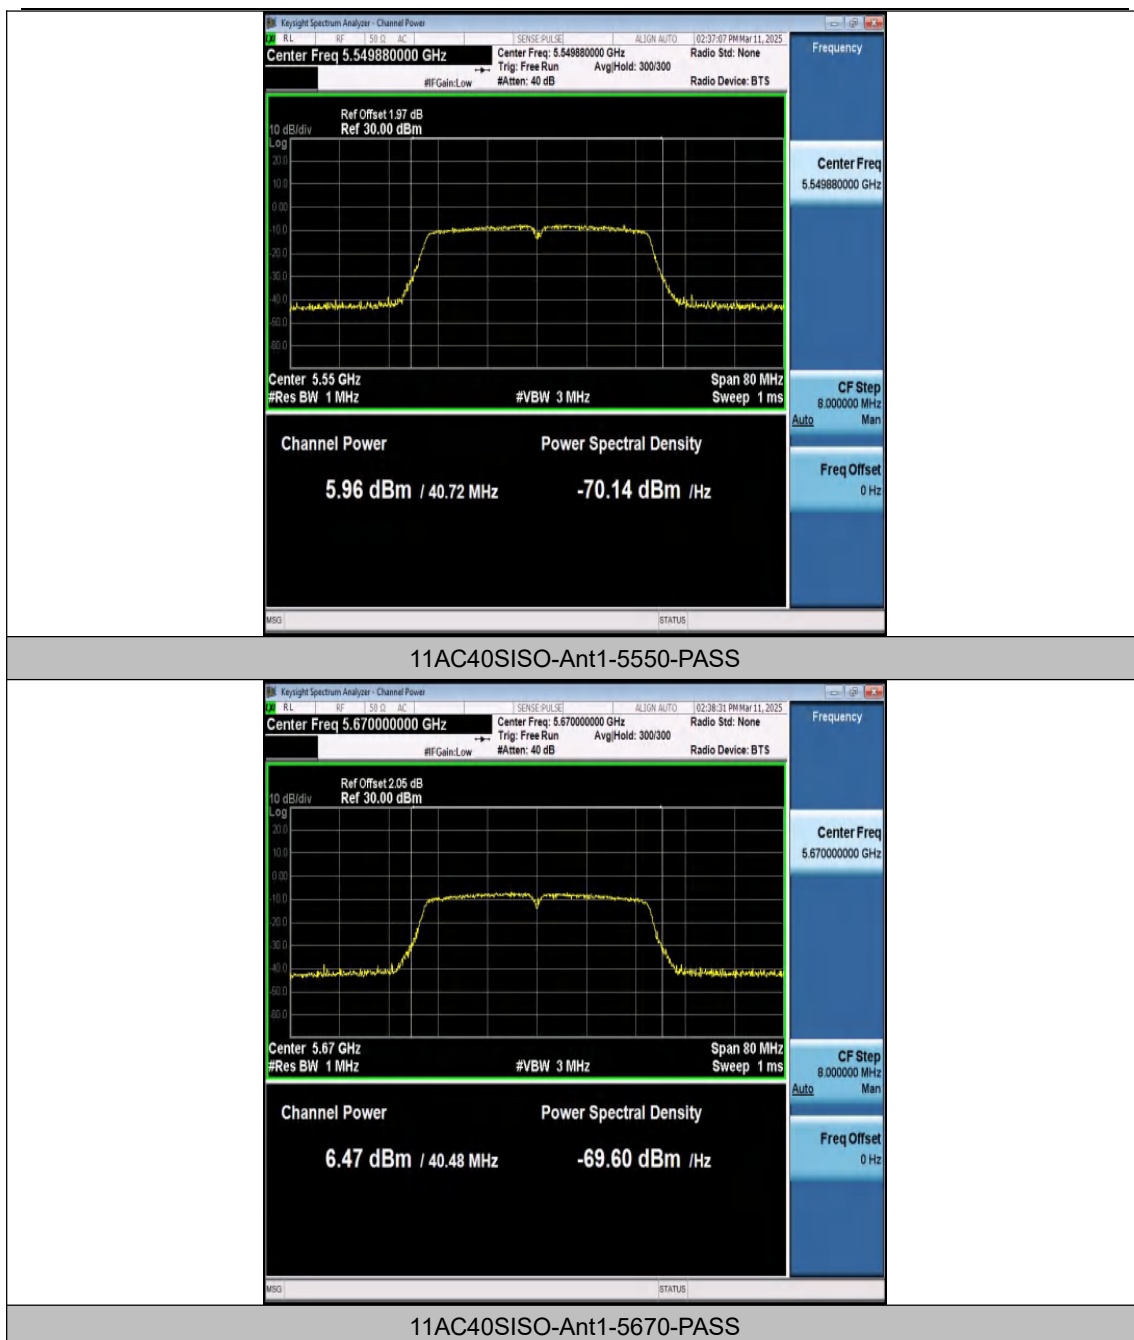


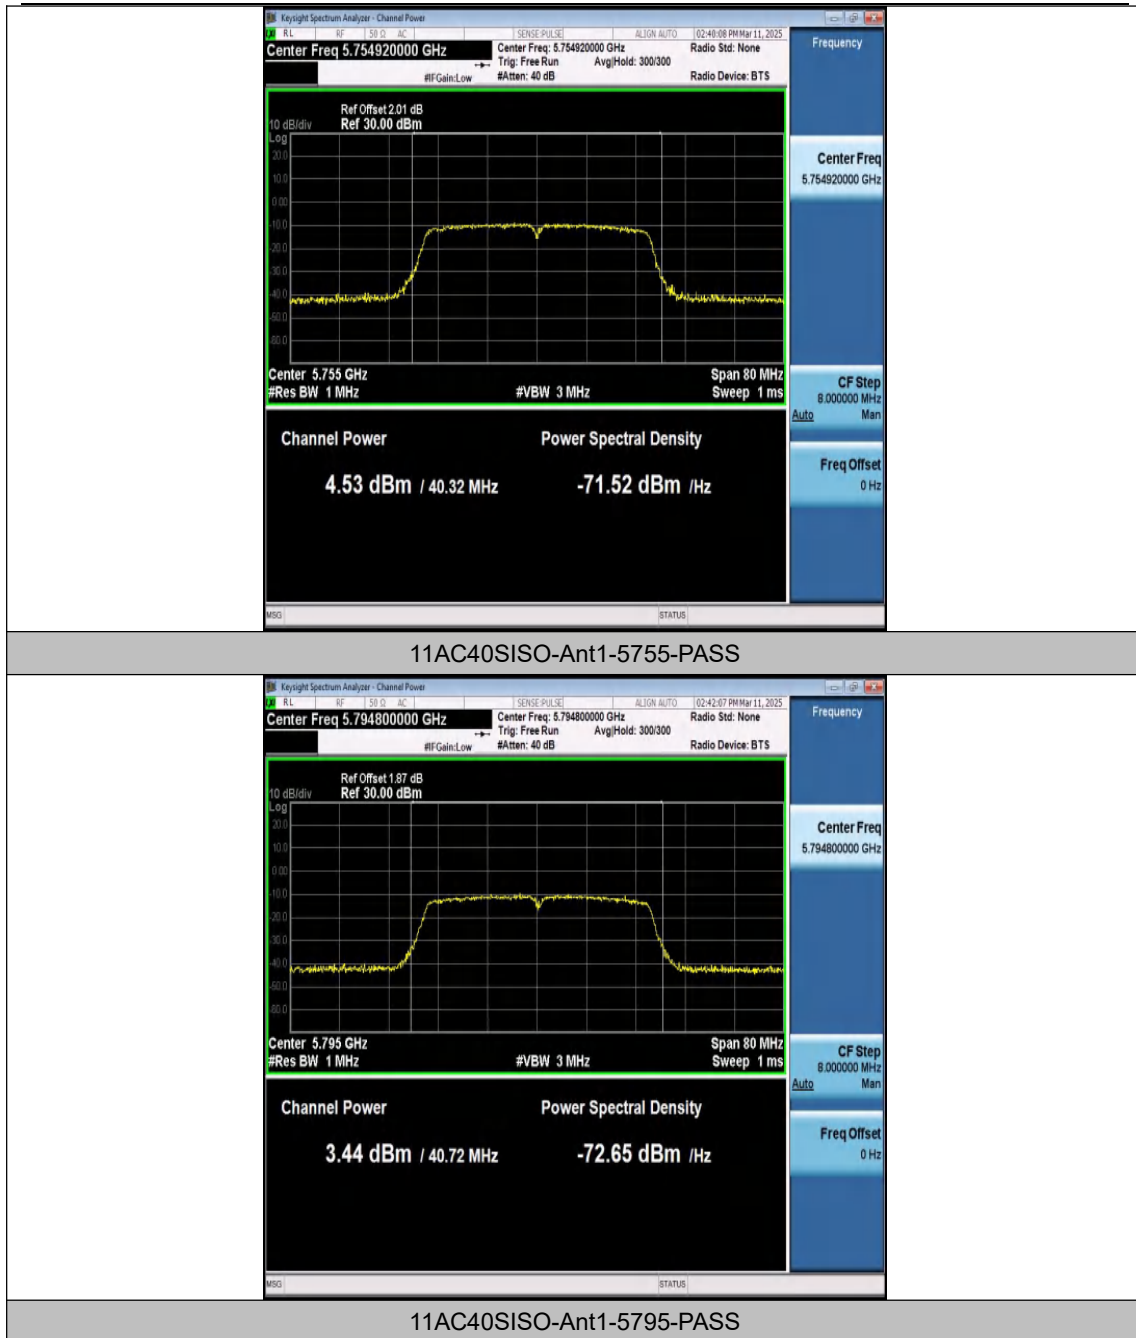

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

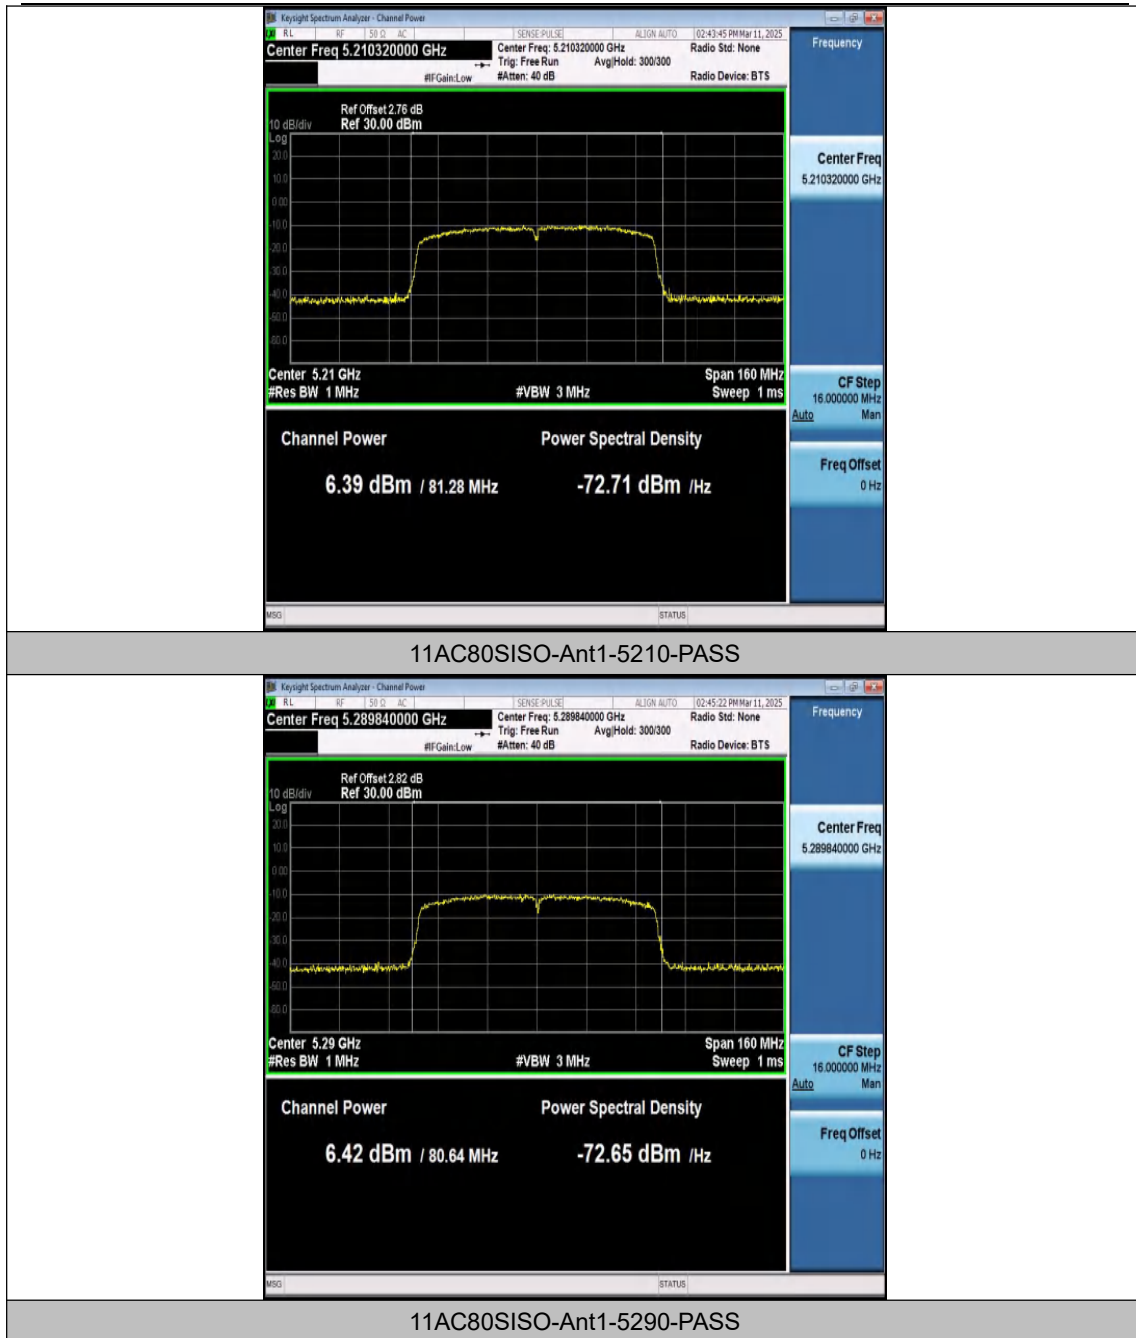


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

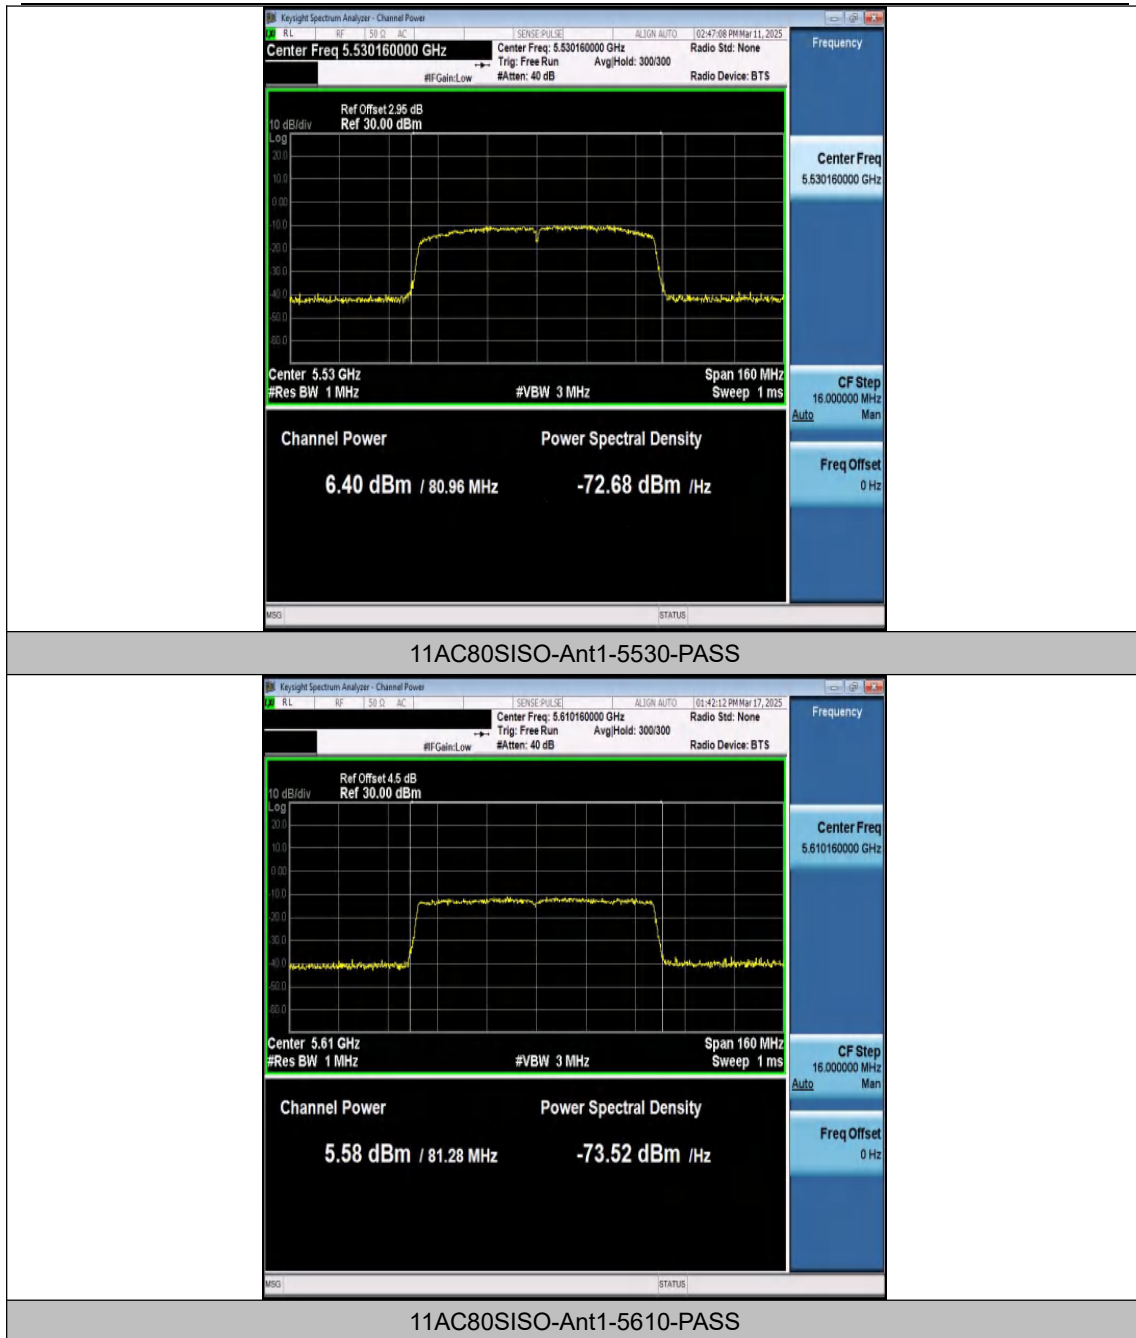

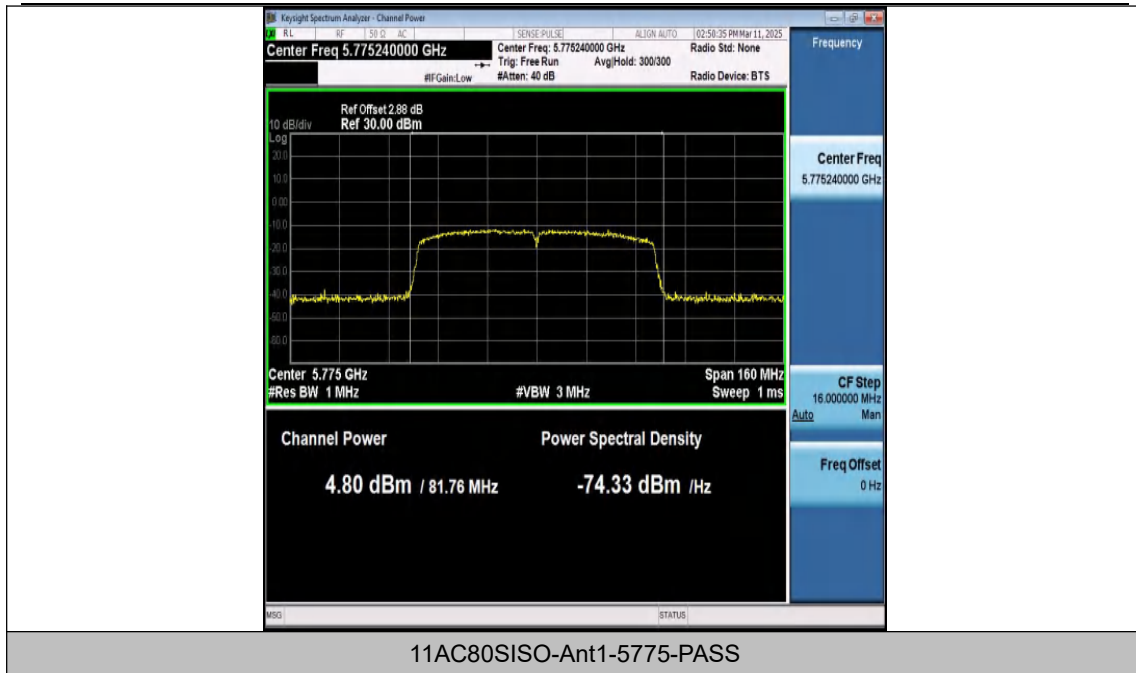

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

Appendix D: Maximum Power Spectral Density

Test Result B1/2/3

Test Mode	Antenna	Frequency [MHz]	Reading Result [dBm/MHz]	DC Factor [dBm]	Result [dBm/MHz]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-10.42	0.42	-10	≤11.00	PASS
11A	Ant1	5220	-9.78	0.46	-9.32	≤11.00	PASS
11A	Ant1	5240	-9.56	0.38	-9.18	≤11.00	PASS
11A	Ant1	5260	-10.87	0.44	-10.43	≤11.00	PASS
11A	Ant1	5300	-11.28	0.42	-10.86	≤11.00	PASS
11A	Ant1	5320	-11.38	0.46	-10.92	≤11.00	PASS
11A	Ant1	5500	-11.74	0.34	-11.4	≤11.00	PASS
11A	Ant1	5580	-9.79	0.44	-9.35	≤11.00	PASS
11A	Ant1	5700	-10.6	0.4	-10.2	≤11.00	PASS
11N20SISO	Ant1	5180	-10.08	0.41	-9.67	≤11.00	PASS
11N20SISO	Ant1	5220	-9.81	0.45	-9.36	≤11.00	PASS
11N20SISO	Ant1	5240	-9.93	0.39	-9.54	≤11.00	PASS
11N20SISO	Ant1	5260	-11.19	0.49	-10.7	≤11.00	PASS
11N20SISO	Ant1	5300	-11.84	0.51	-11.33	≤11.00	PASS
11N20SISO	Ant1	5320	-11.77	0.47	-11.3	≤11.00	PASS
11N20SISO	Ant1	5500	-11.75	0.49	-11.26	≤11.00	PASS
11N20SISO	Ant1	5580	-10.28	0.47	-9.81	≤11.00	PASS
11N20SISO	Ant1	5700	-11.01	0.39	-10.62	≤11.00	PASS
11N40SISO	Ant1	5190	-14.22	0.91	-13.31	≤11.00	PASS
11N40SISO	Ant1	5230	-13.48	0.95	-12.53	≤11.00	PASS
11N40SISO	Ant1	5270	-14.14	0.95	-13.19	≤11.00	PASS
11N40SISO	Ant1	5310	-14.82	0.88	-13.94	≤11.00	PASS
11N40SISO	Ant1	5510	-14.83	0.95	-13.88	≤11.00	PASS
11N40SISO	Ant1	5550	-13.67	0.9	-12.77	≤11.00	PASS
11N40SISO	Ant1	5670	-13.05	0.95	-12.1	≤11.00	PASS
11AC20SISO	Ant1	5180	-10.83	0.41	-10.42	≤11.00	PASS
11AC20SISO	Ant1	5220	-9.92	0.43	-9.49	≤11.00	PASS
11AC20SISO	Ant1	5240	-9.77	0.35	-9.42	≤11.00	PASS
11AC20SISO	Ant1	5260	-11.16	0.41	-10.75	≤11.00	PASS
11AC20SISO	Ant1	5300	-11.42	0.53	-10.89	≤11.00	PASS
11AC20SISO	Ant1	5320	-11.94	0.43	-11.51	≤11.00	PASS
11AC20SISO	Ant1	5500	-11.82	0.39	-11.43	≤11.00	PASS
11AC20SISO	Ant1	5580	-9.72	0.49	-9.23	≤11.00	PASS
11AC20SISO	Ant1	5700	-10.92	0.49	-10.43	≤11.00	PASS
11AC40SISO	Ant1	5190	-14.18	2.34	-11.84	≤11.00	PASS
11AC40SISO	Ant1	5230	-14.33	2.07	-12.26	≤11.00	PASS



11AC40SISO	Ant1	5270	-15.69	1.05	-14.64	≤11.00	PASS
11AC40SISO	Ant1	5310	-15.61	1.05	-14.56	≤11.00	PASS
11AC40SISO	Ant1	5510	-15.27	1.01	-14.26	≤11.00	PASS
11AC40SISO	Ant1	5550	-14.61	0.97	-13.64	≤11.00	PASS
11AC40SISO	Ant1	5670	-14.19	1.05	-13.14	≤11.00	PASS
11AC80SISO	Ant1	5210	-18.81	1.76	-17.05	≤11.00	PASS
11AC80SISO	Ant1	5290	-18.29	1.82	-16.47	≤11.00	PASS
11AC80SISO	Ant1	5530	-18.58	1.95	-16.63	≤11.00	PASS
11AC80SISO	Ant1	5610	-18.4	3.5	-14.9	≤11.00	PASS


Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.

Test Result B4

Test Mode	Antenna	Frequency [MHz]	Reading Result [dBm/MHz]	DC Factor [dBm]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-14.65	0.46	-14.28	≤30.00	PASS
11A	Ant1	5785	-15.53	0.48	-15.14	≤30.00	PASS
11A	Ant1	5825	-15.77	0.38	-15.48	≤30.00	PASS
11N20SISO	Ant1	5745	-15.11	0.37	-14.83	≤30.00	PASS
11N20SISO	Ant1	5785	-16.14	0.47	-15.76	≤30.00	PASS
11N20SISO	Ant1	5825	-15.48	0.45	-15.12	≤30.00	PASS
11N40SISO	Ant1	5755	-18.11	0.94	-17.26	≤30.00	PASS
11N40SISO	Ant1	5795	-19.39	0.84	-18.64	≤30.00	PASS
11AC20SISO	Ant1	5745	-14.81	0.51	-14.39	≤30.00	PASS
11AC20SISO	Ant1	5785	-15.55	0.53	-15.11	≤30.00	PASS
11AC20SISO	Ant1	5825	-16.02	0.45	-15.66	≤30.00	PASS
11AC40SISO	Ant1	5755	-19.07	1.01	-18.15	≤30.00	PASS
11AC40SISO	Ant1	5795	-20.18	0.87	-19.40	≤30.00	PASS
11AC80SISO	Ant1	5775	-22.99	1.88	-21.20	≤30.00	PASS

Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.


Test Graphs

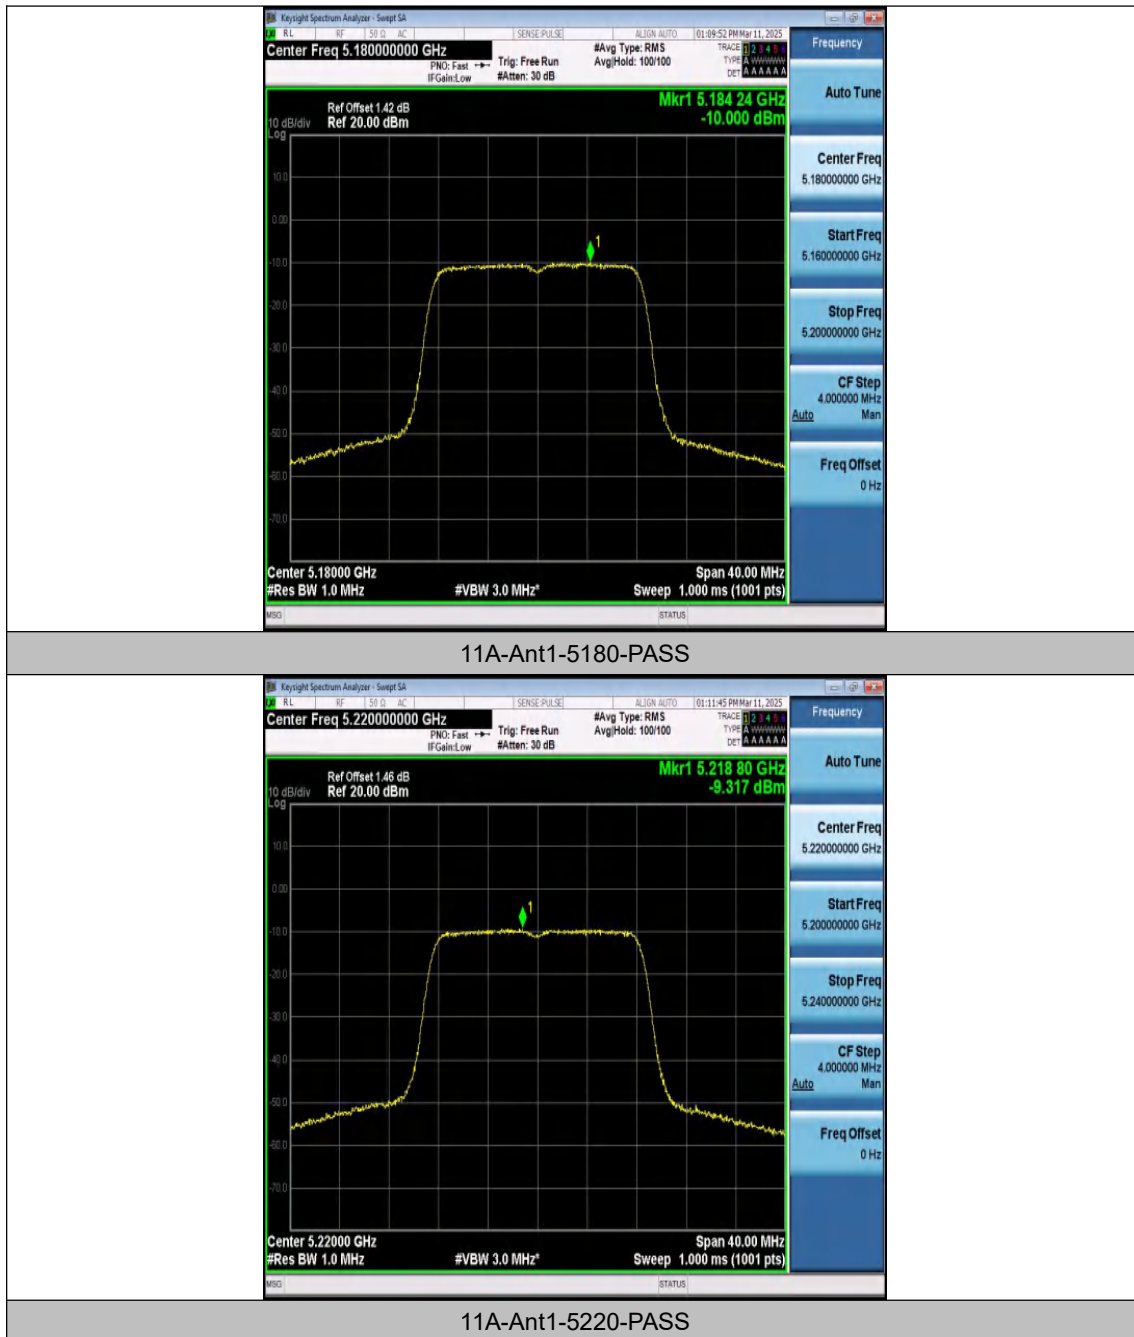

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

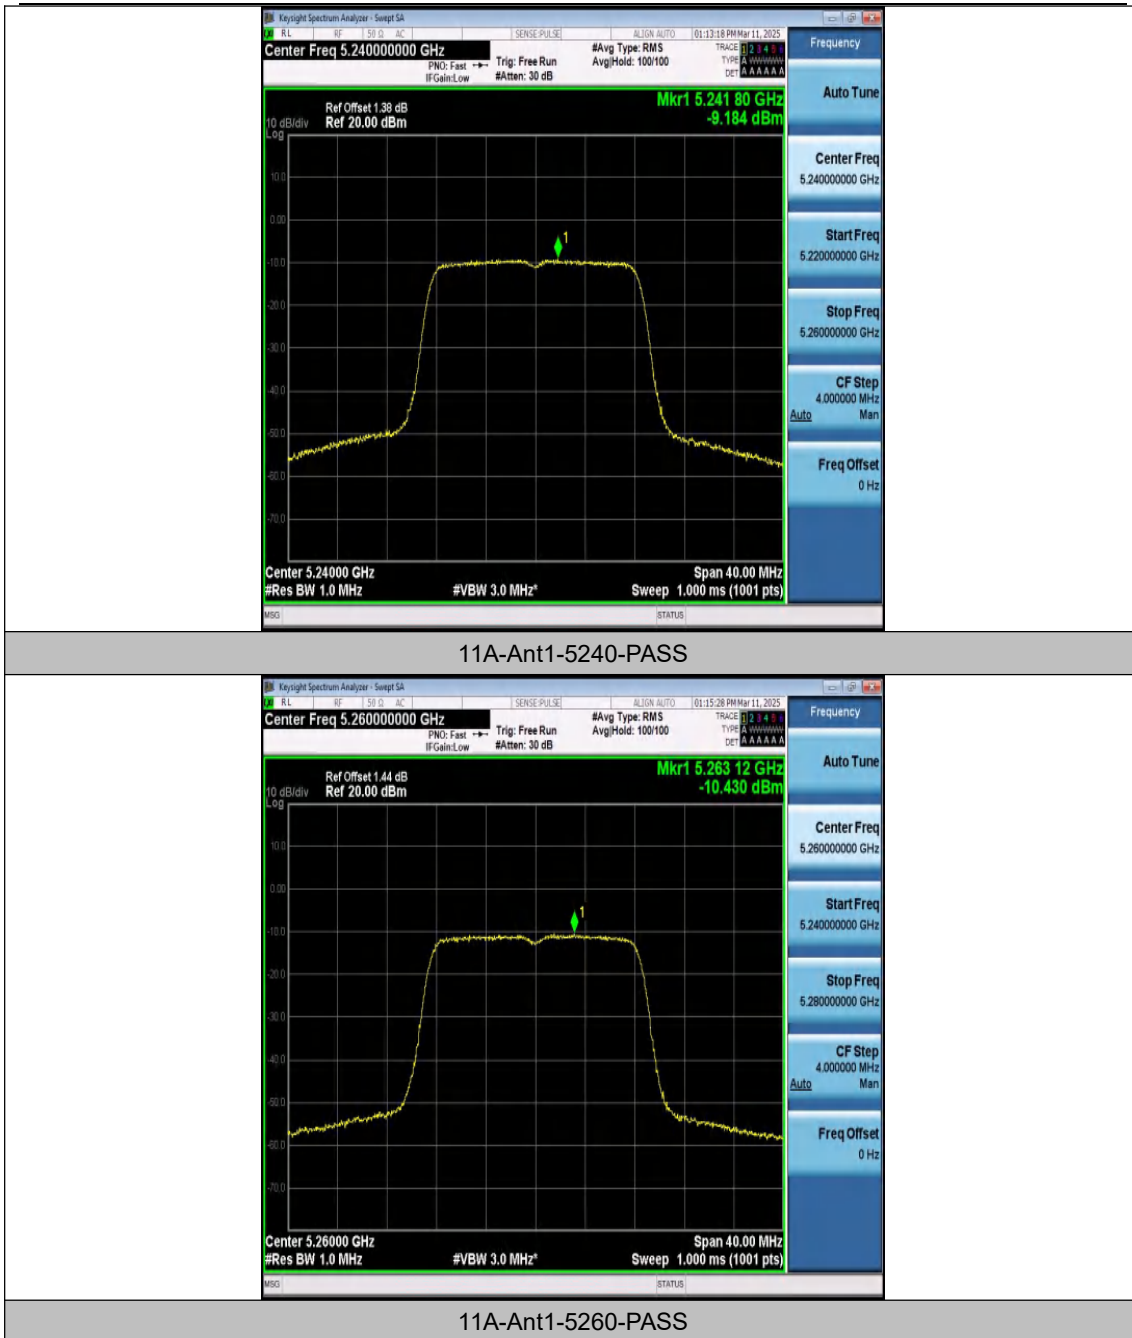



Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

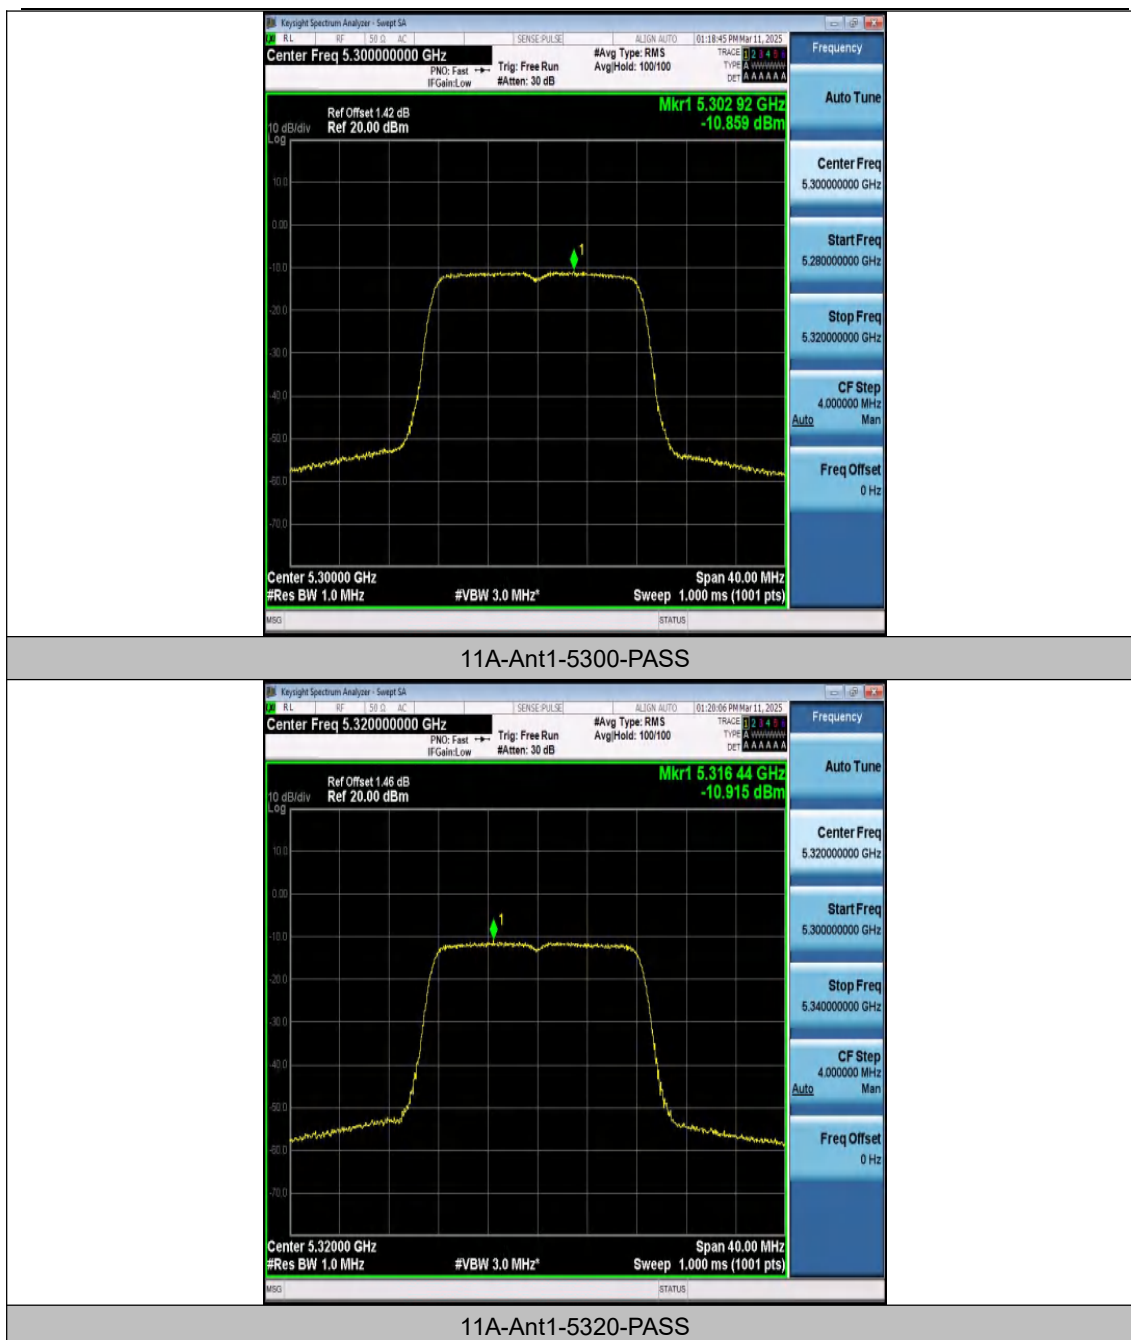


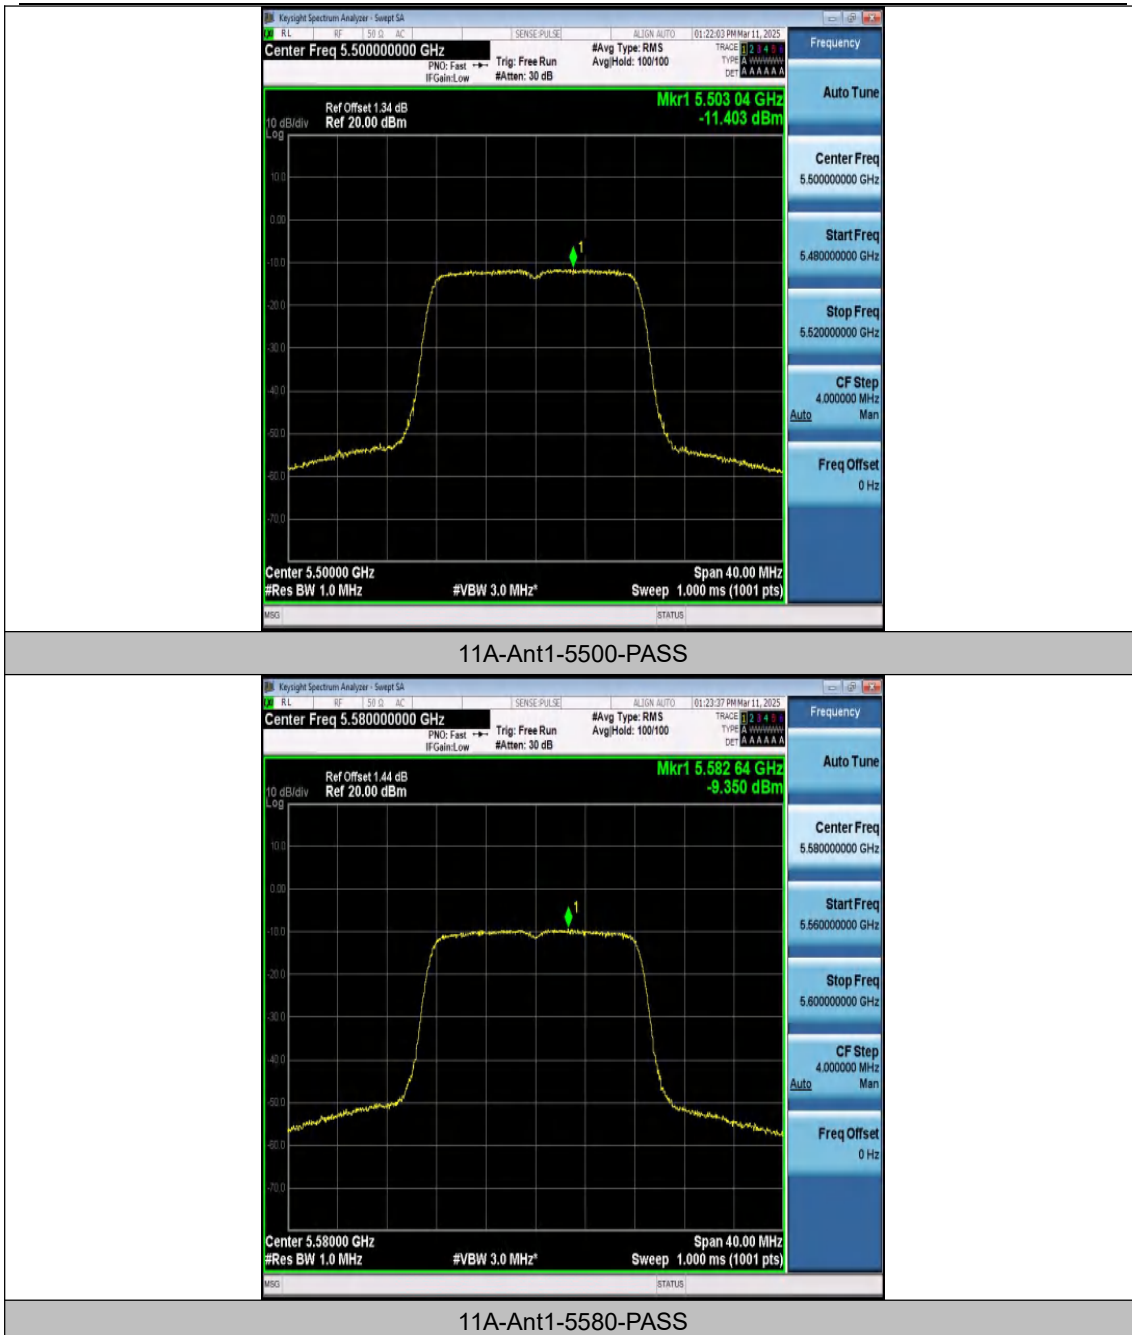


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

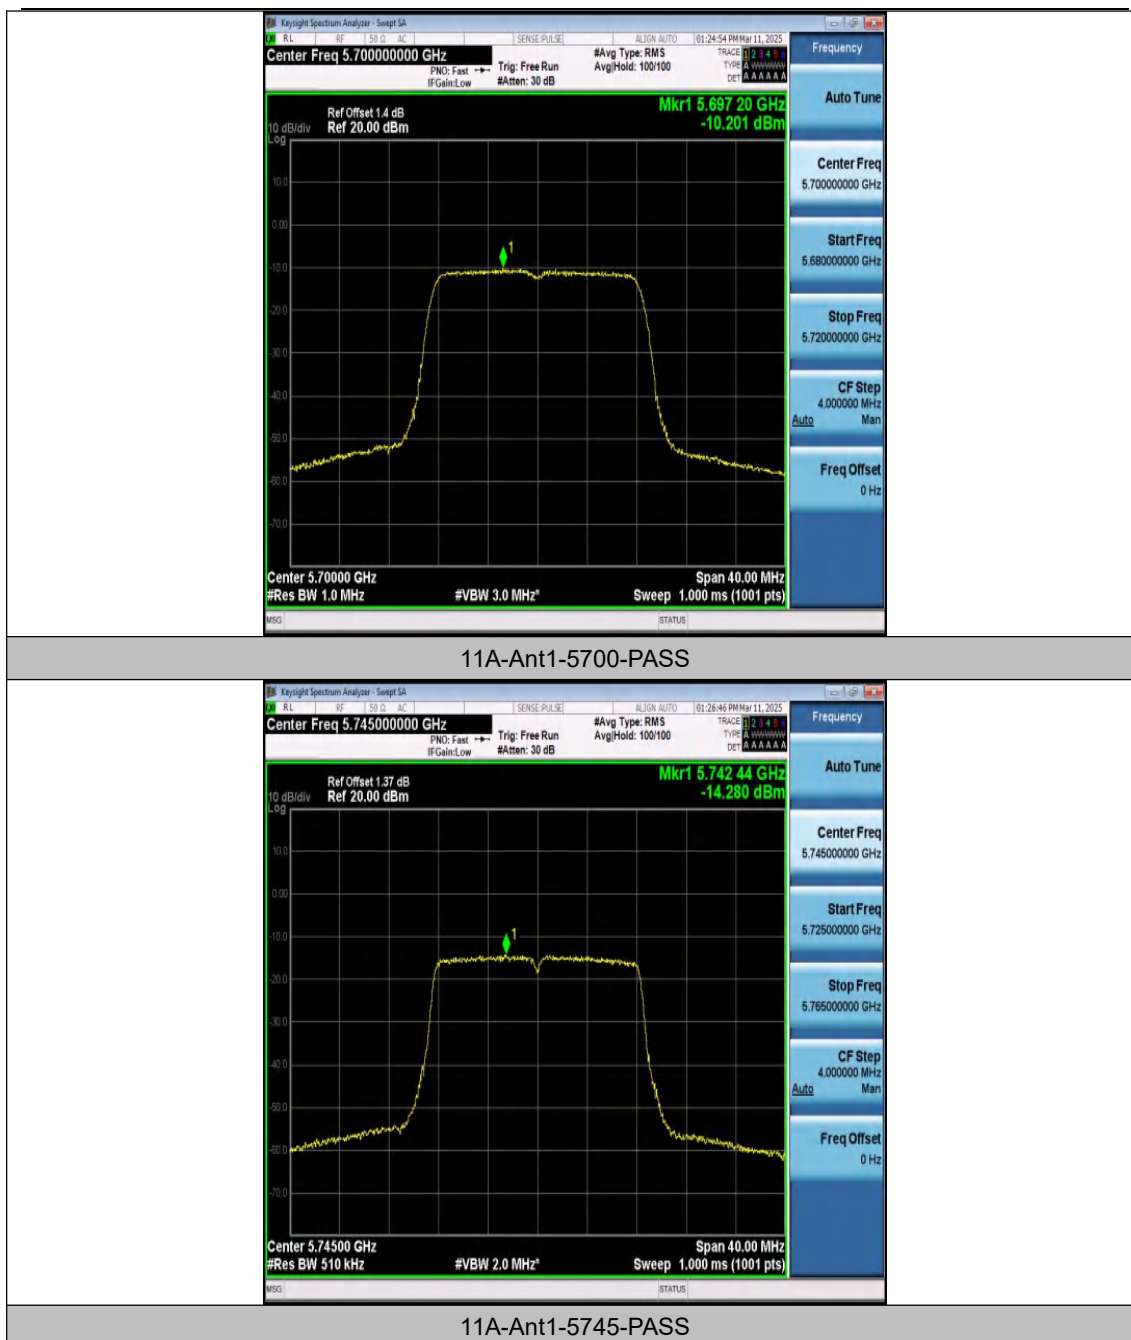


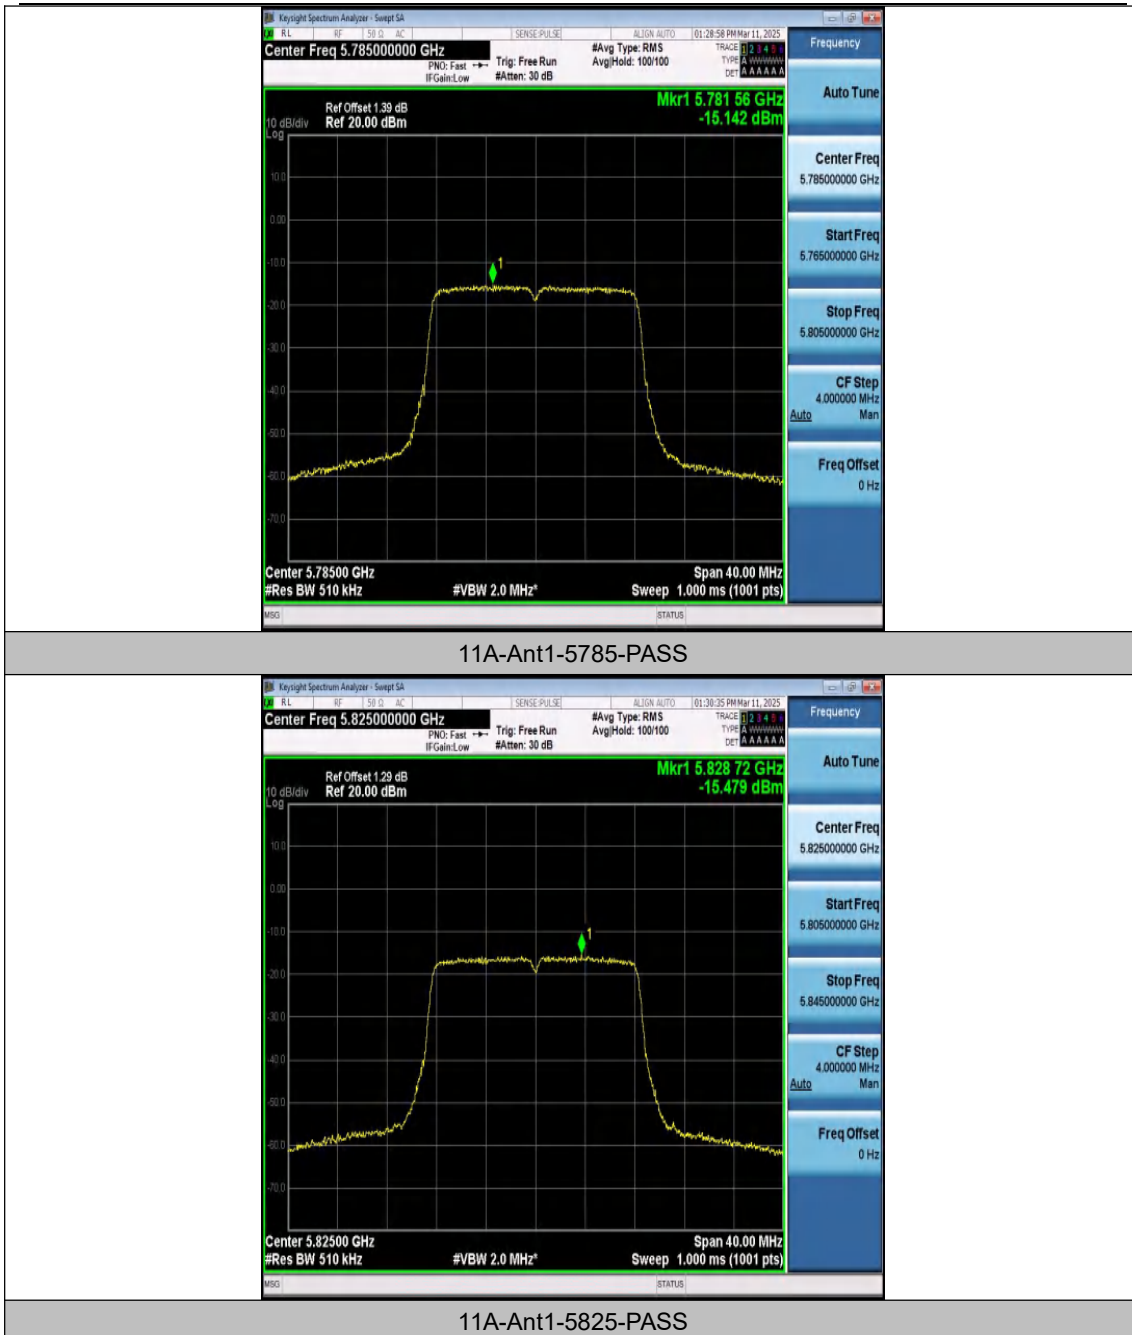

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

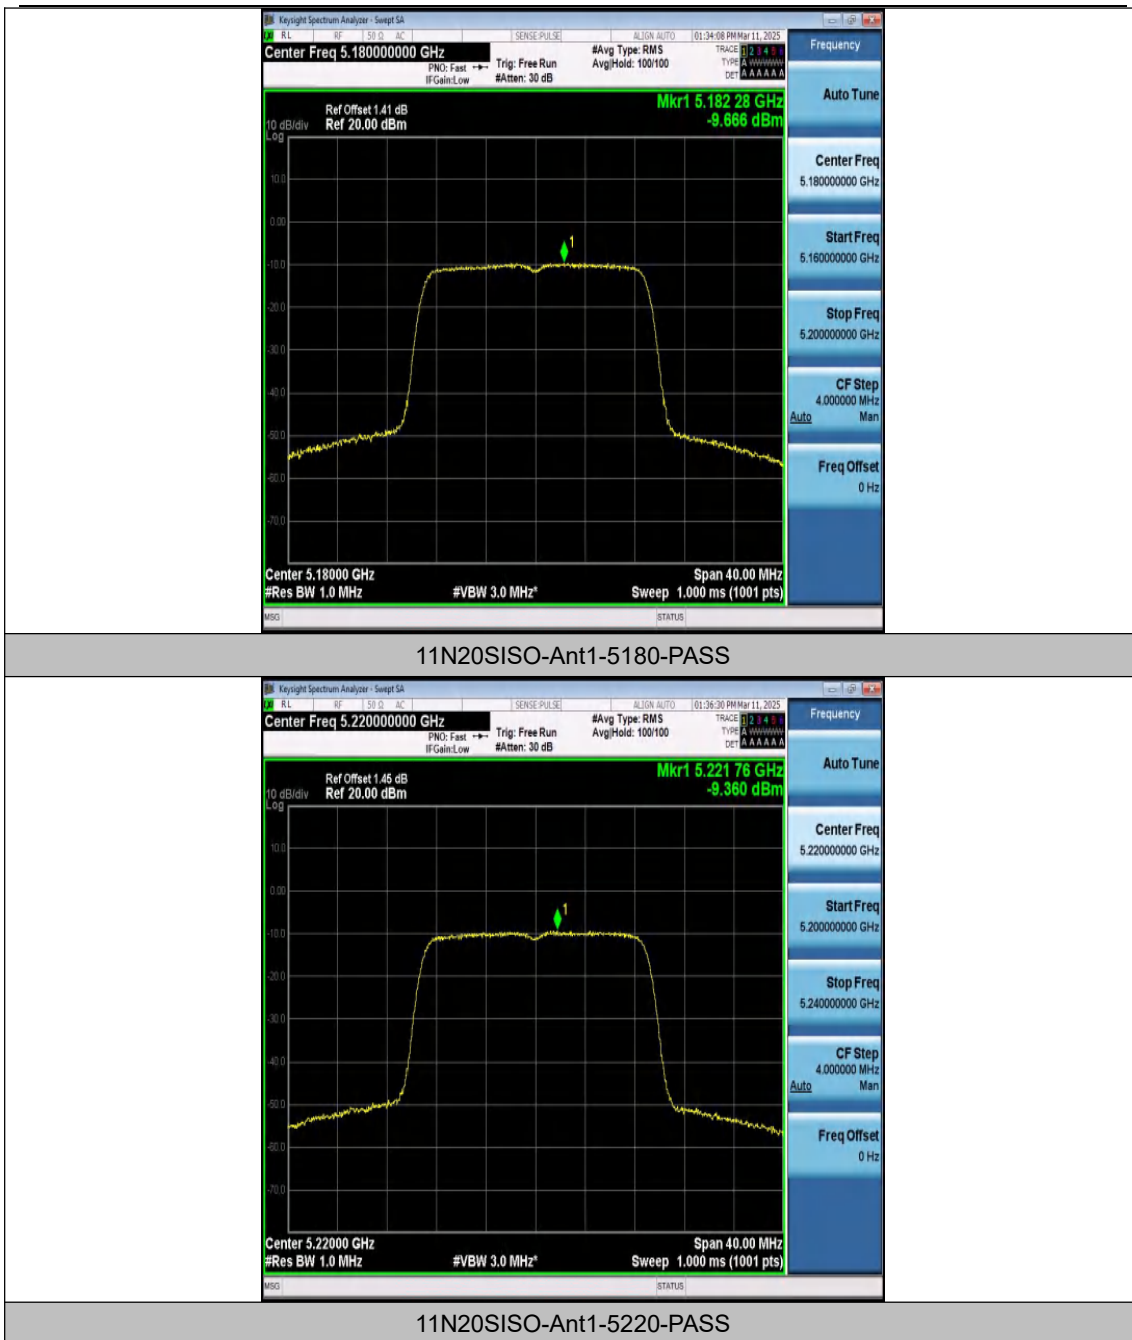


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com




Hotline
400-003-0500
www.anbotech.com

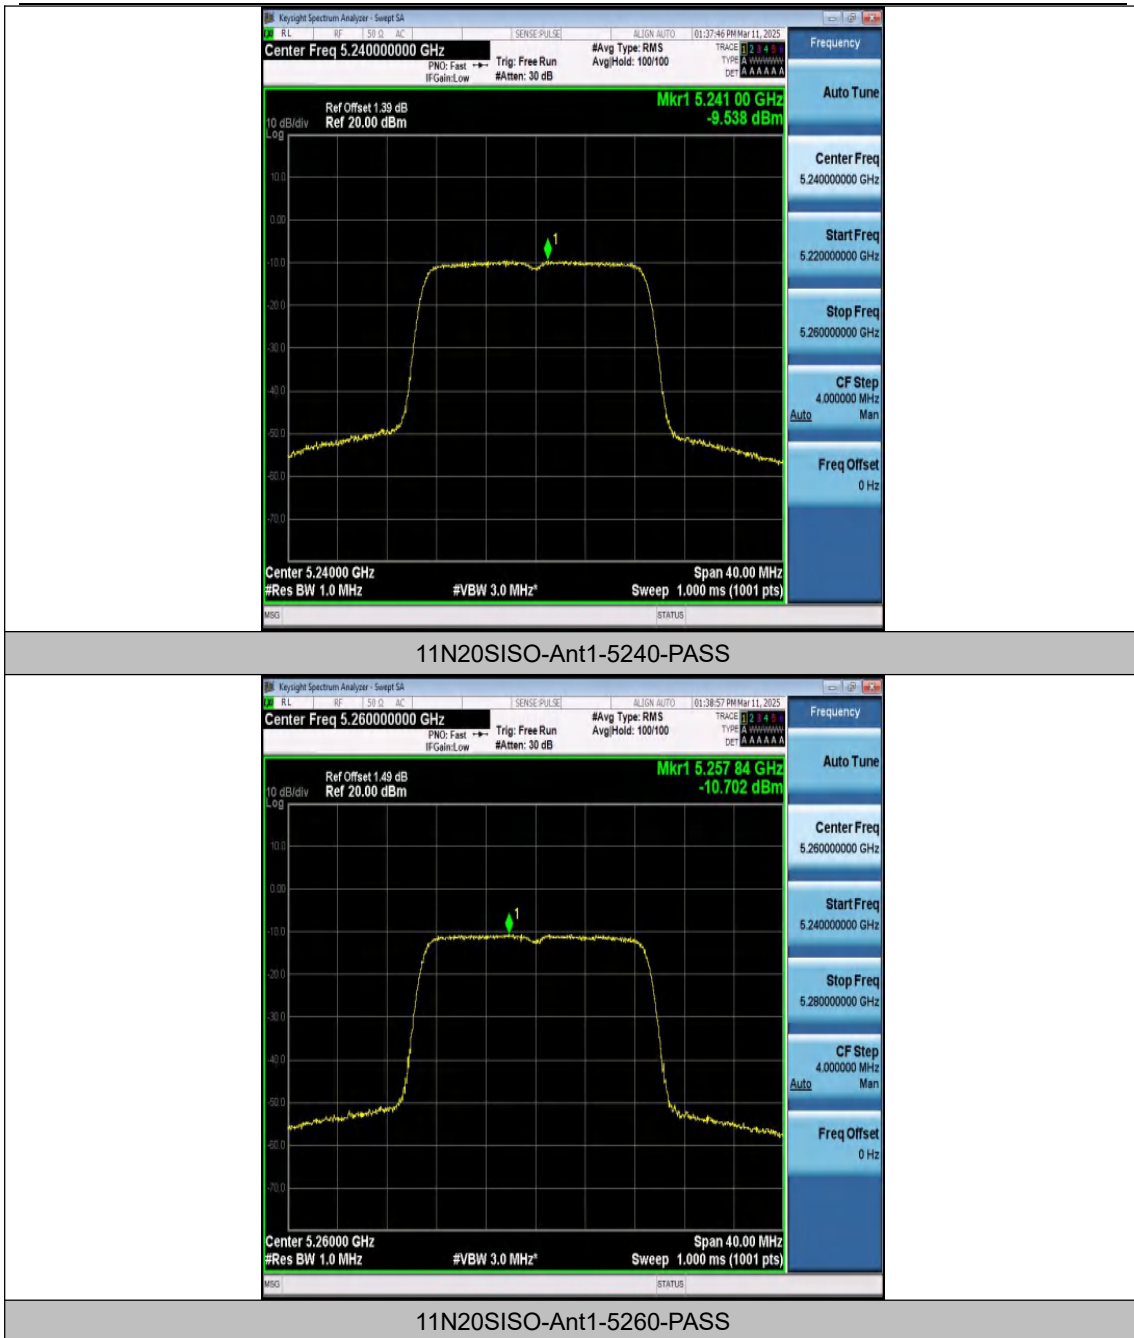

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

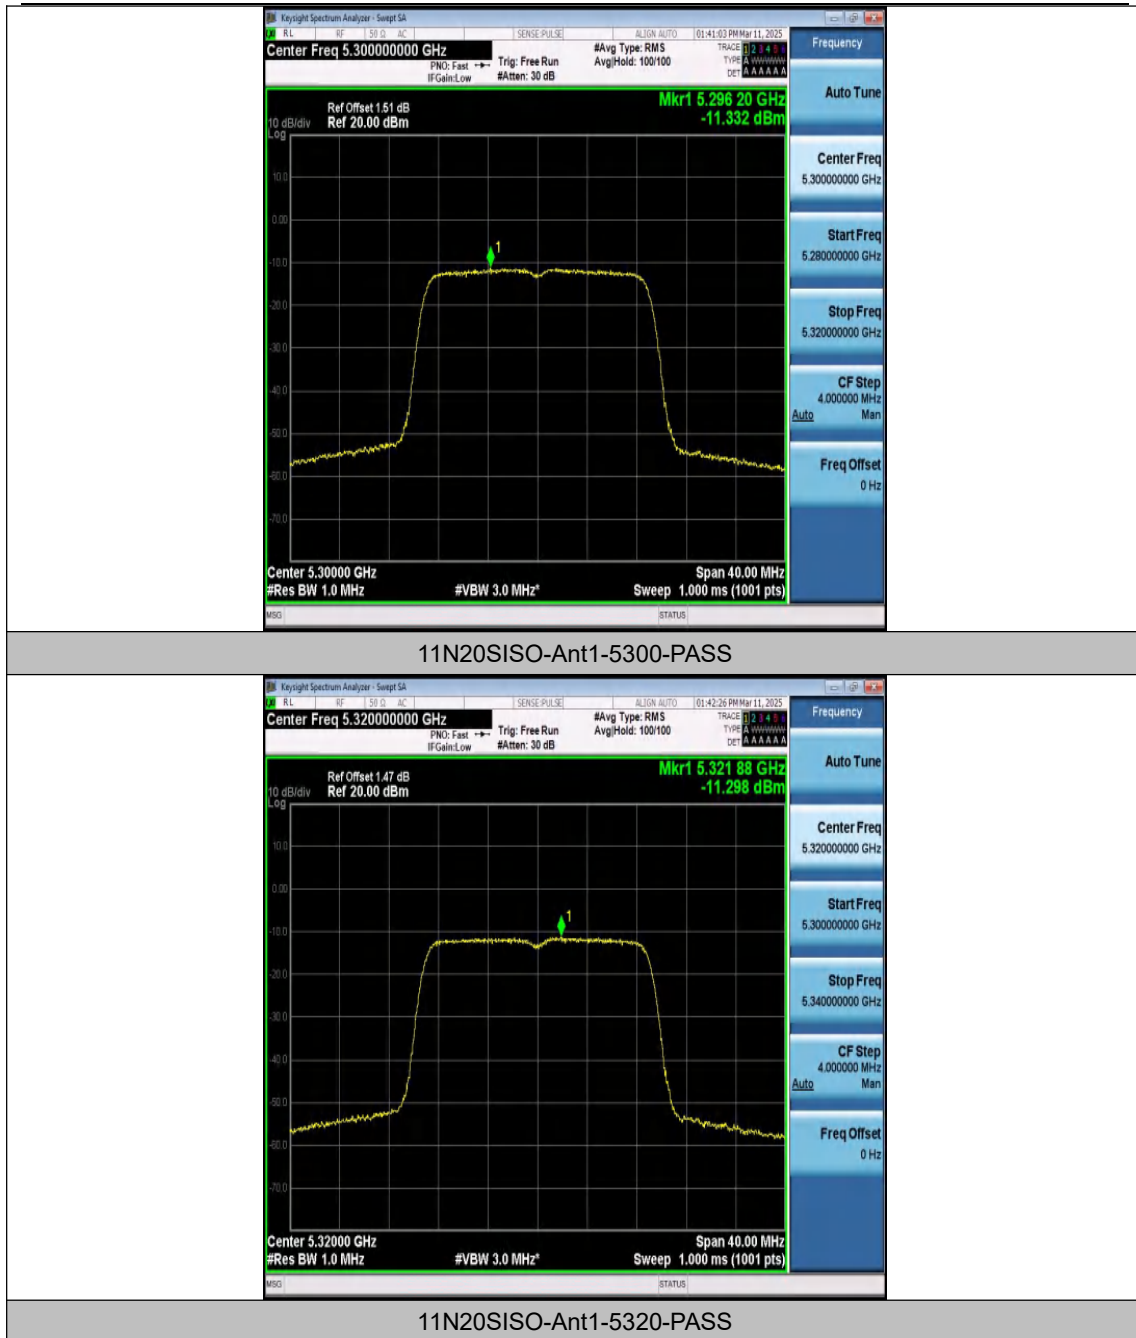


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com




Hotline
400-003-0500
www.anbotech.com

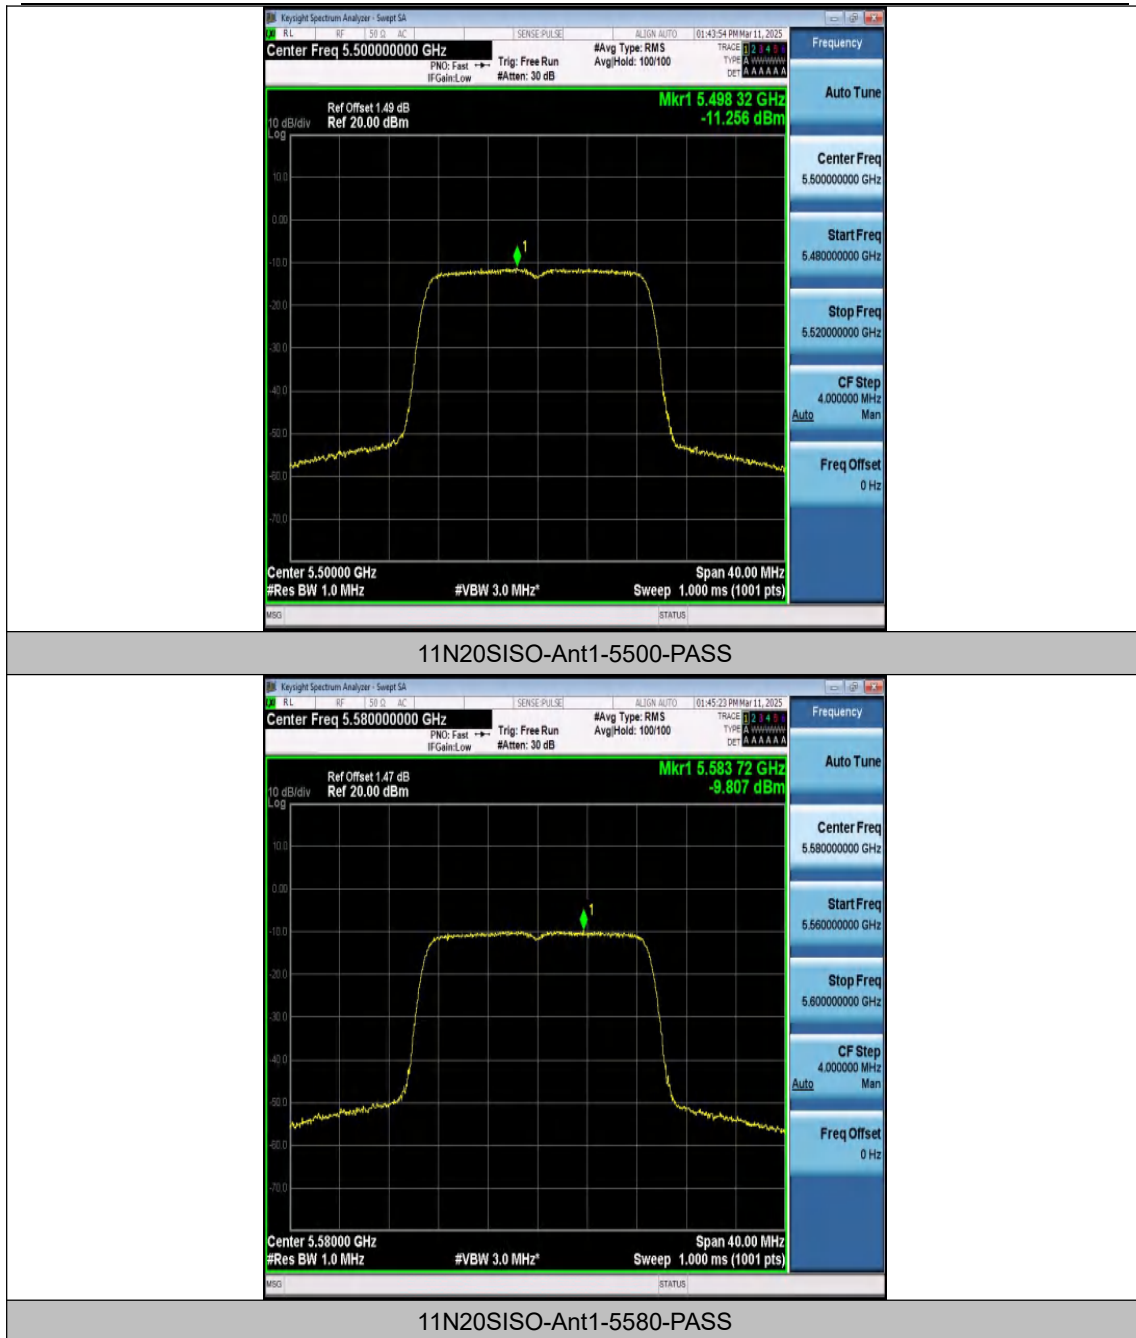

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

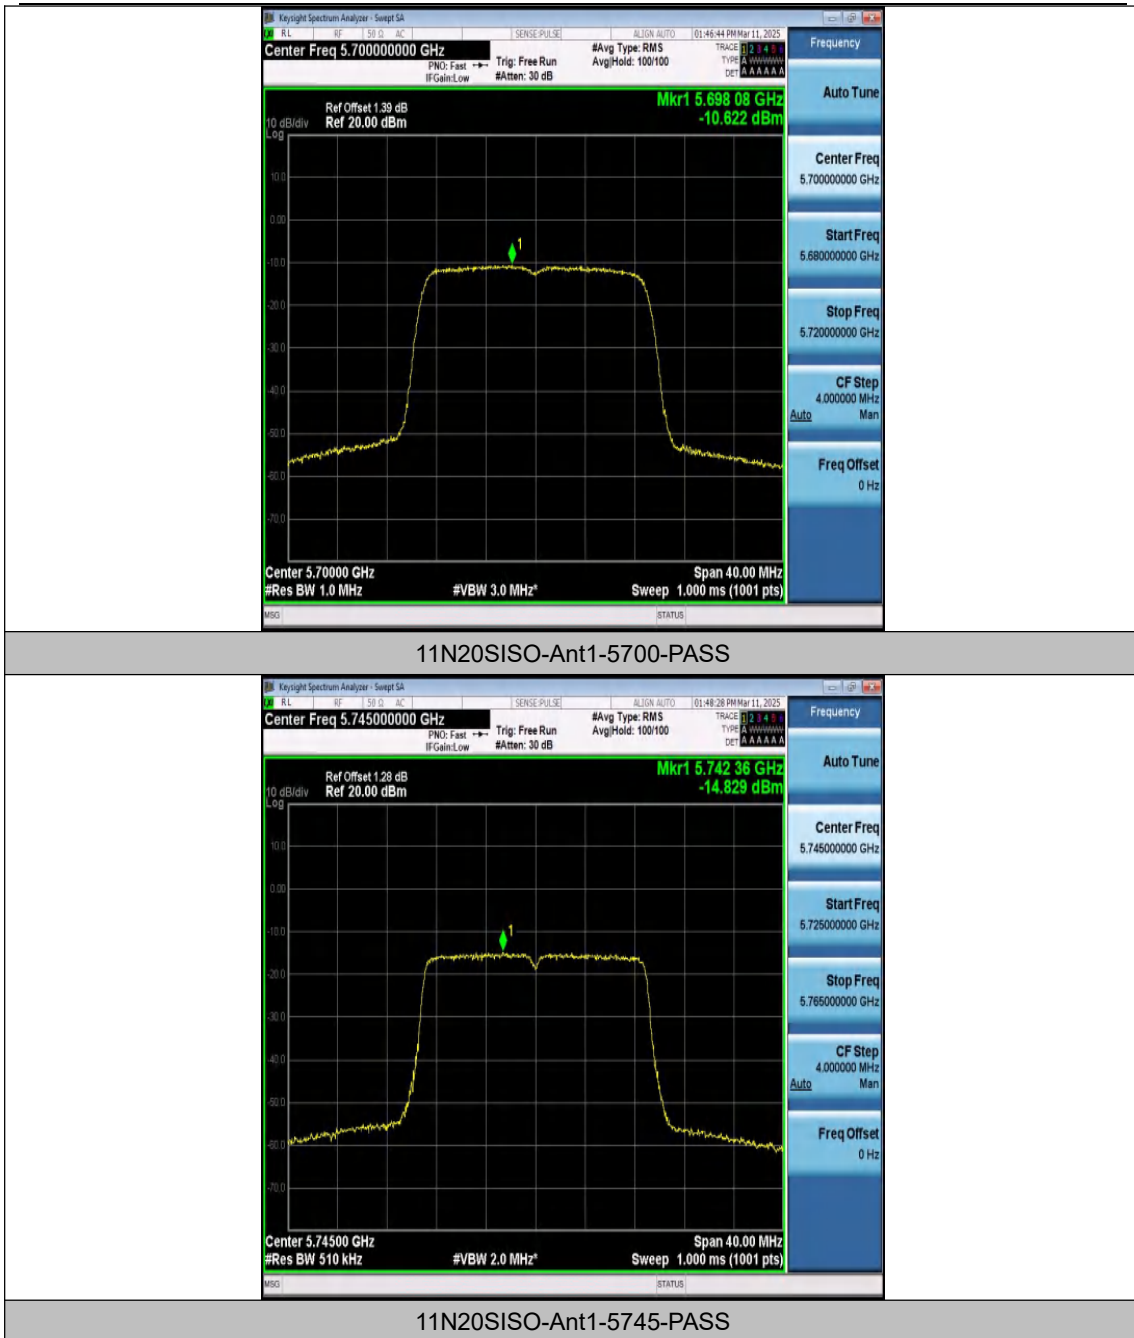

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

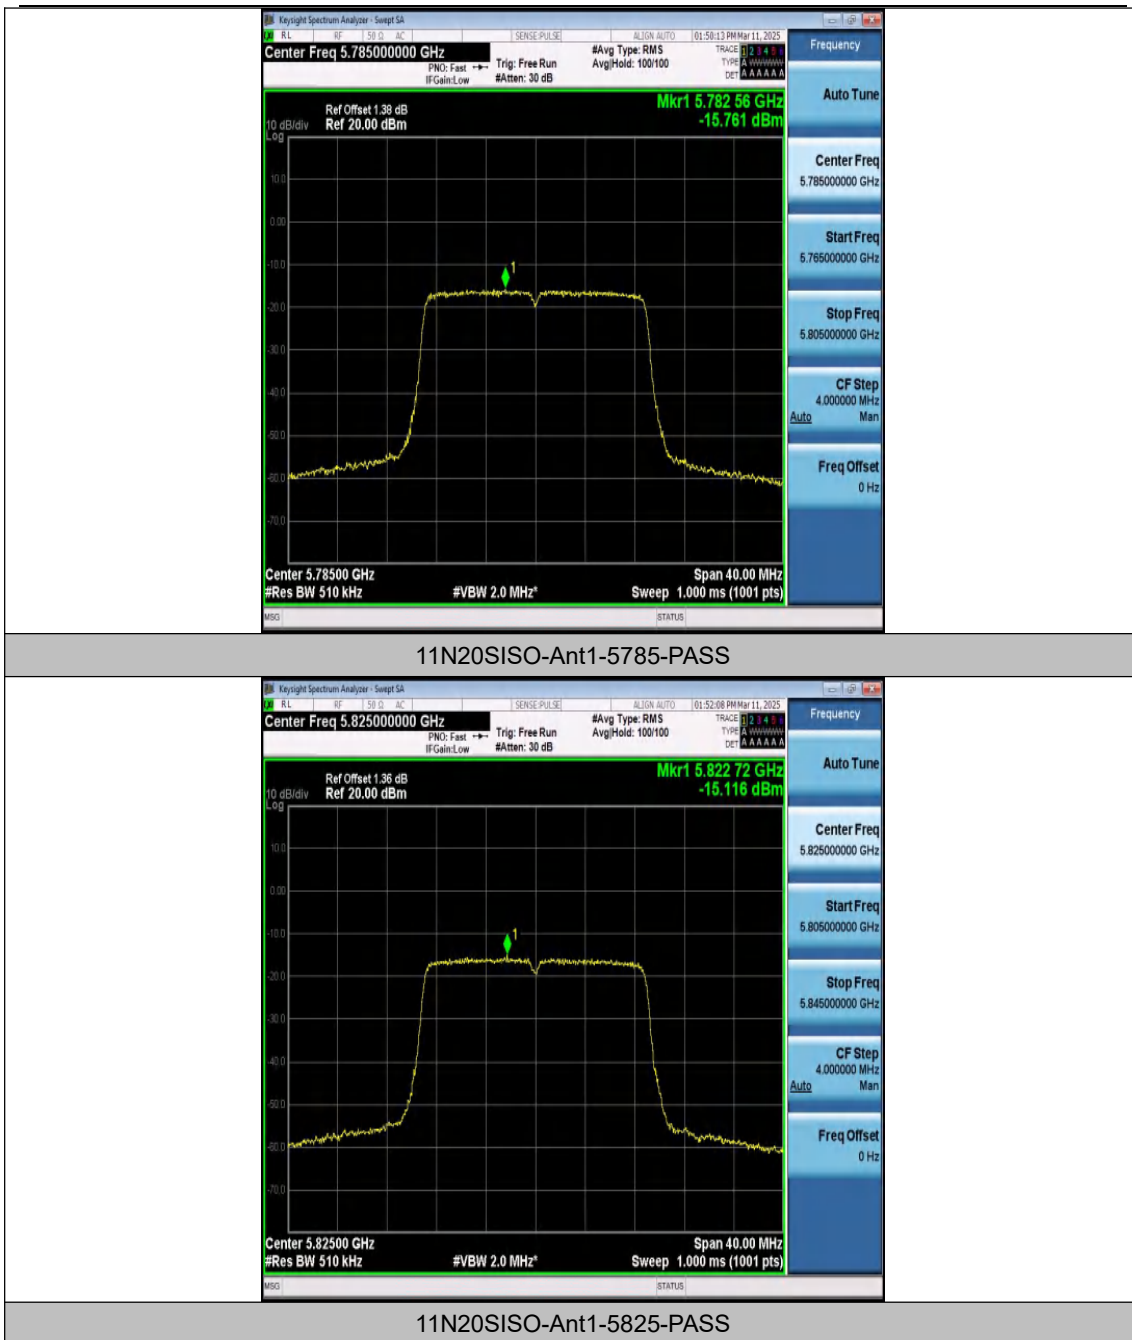


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

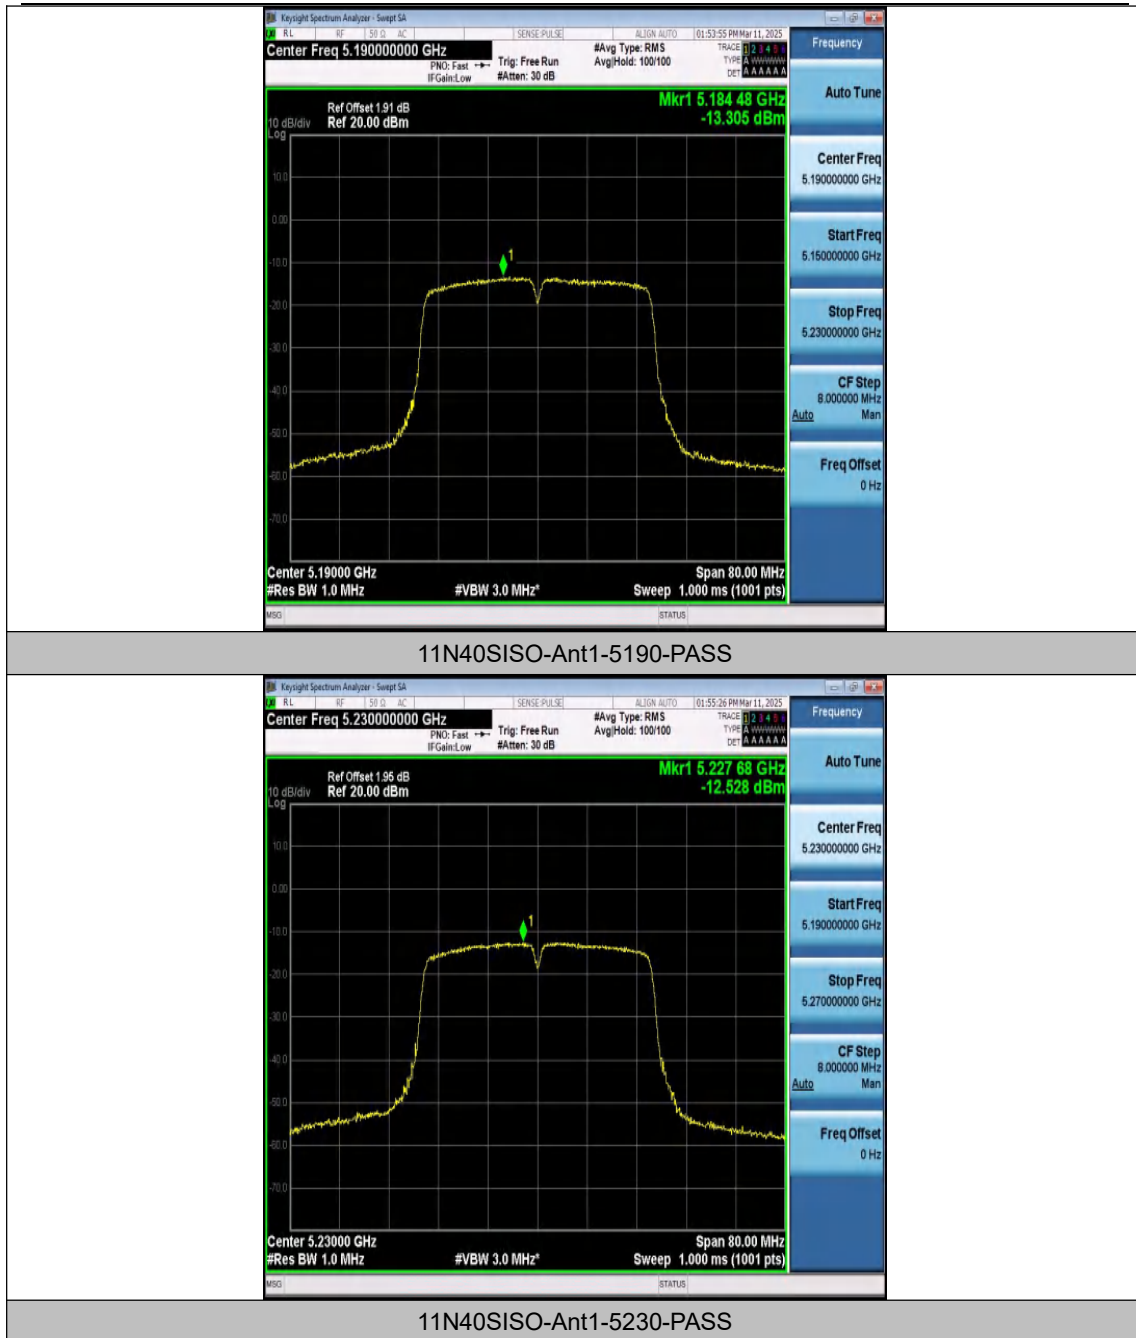


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com




Hotline
400-003-0500
www.anbotech.com

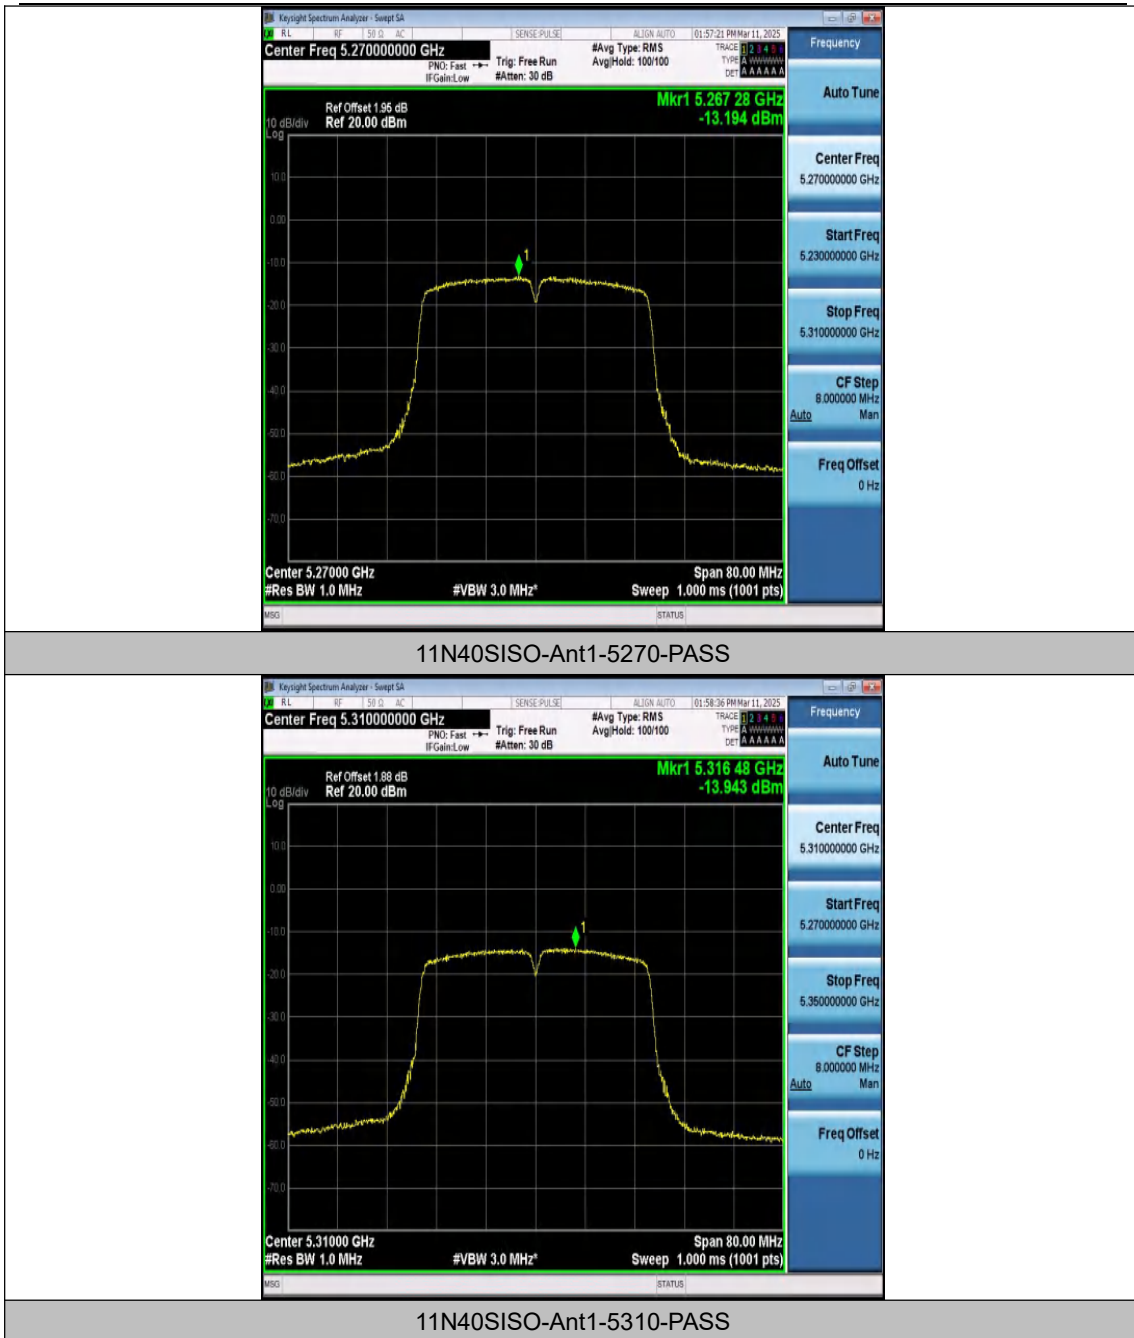

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

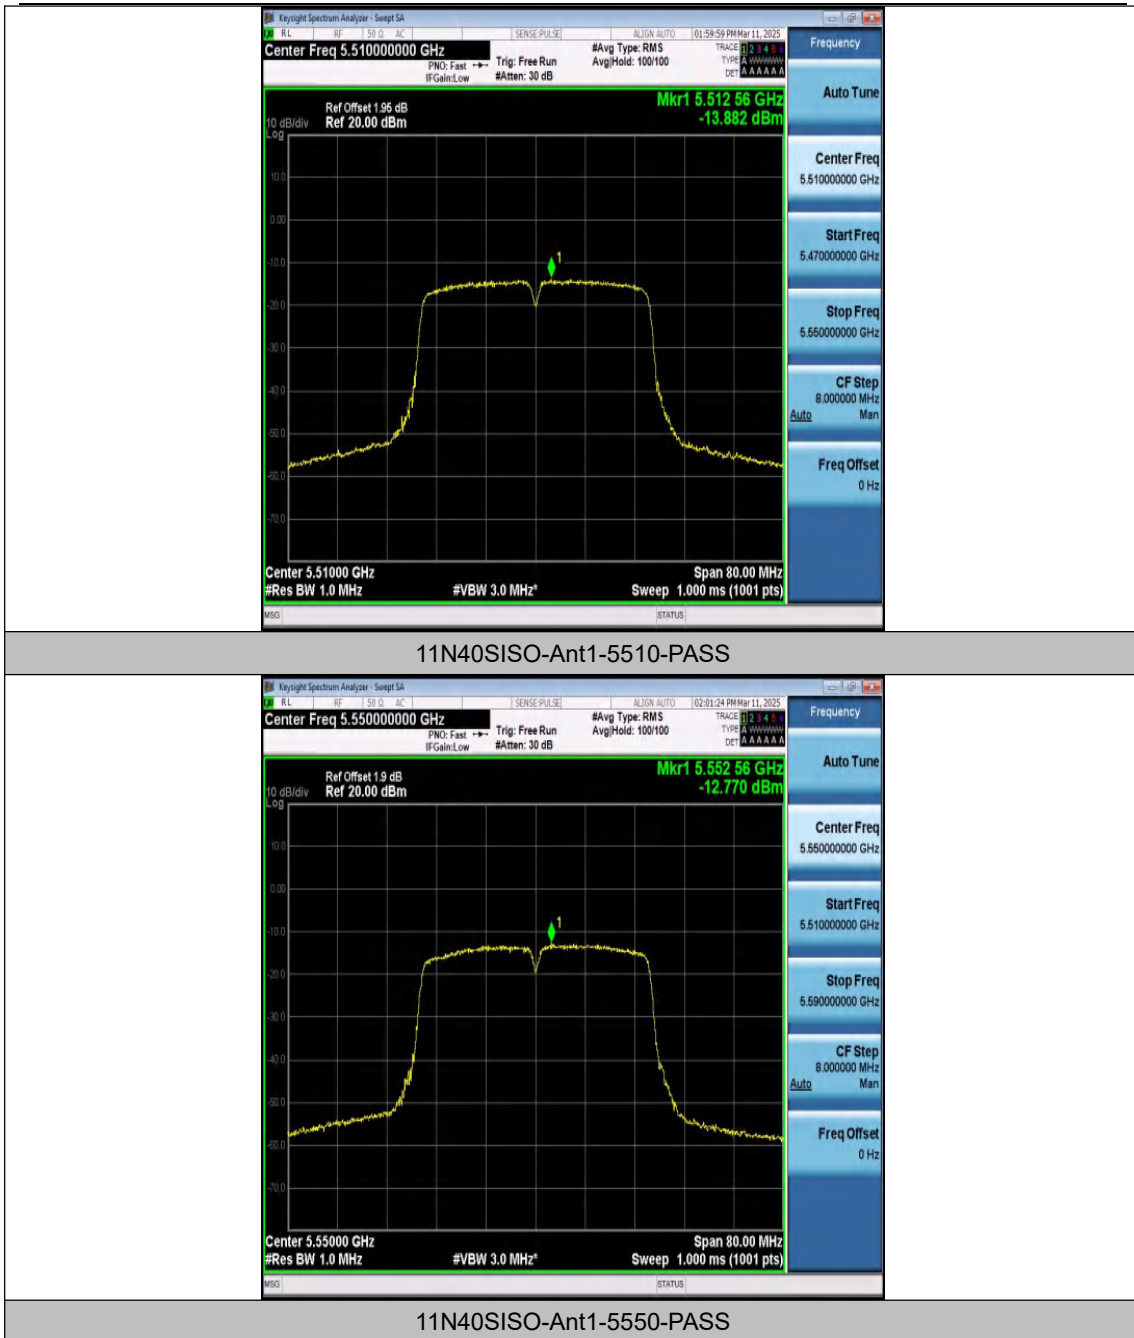

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

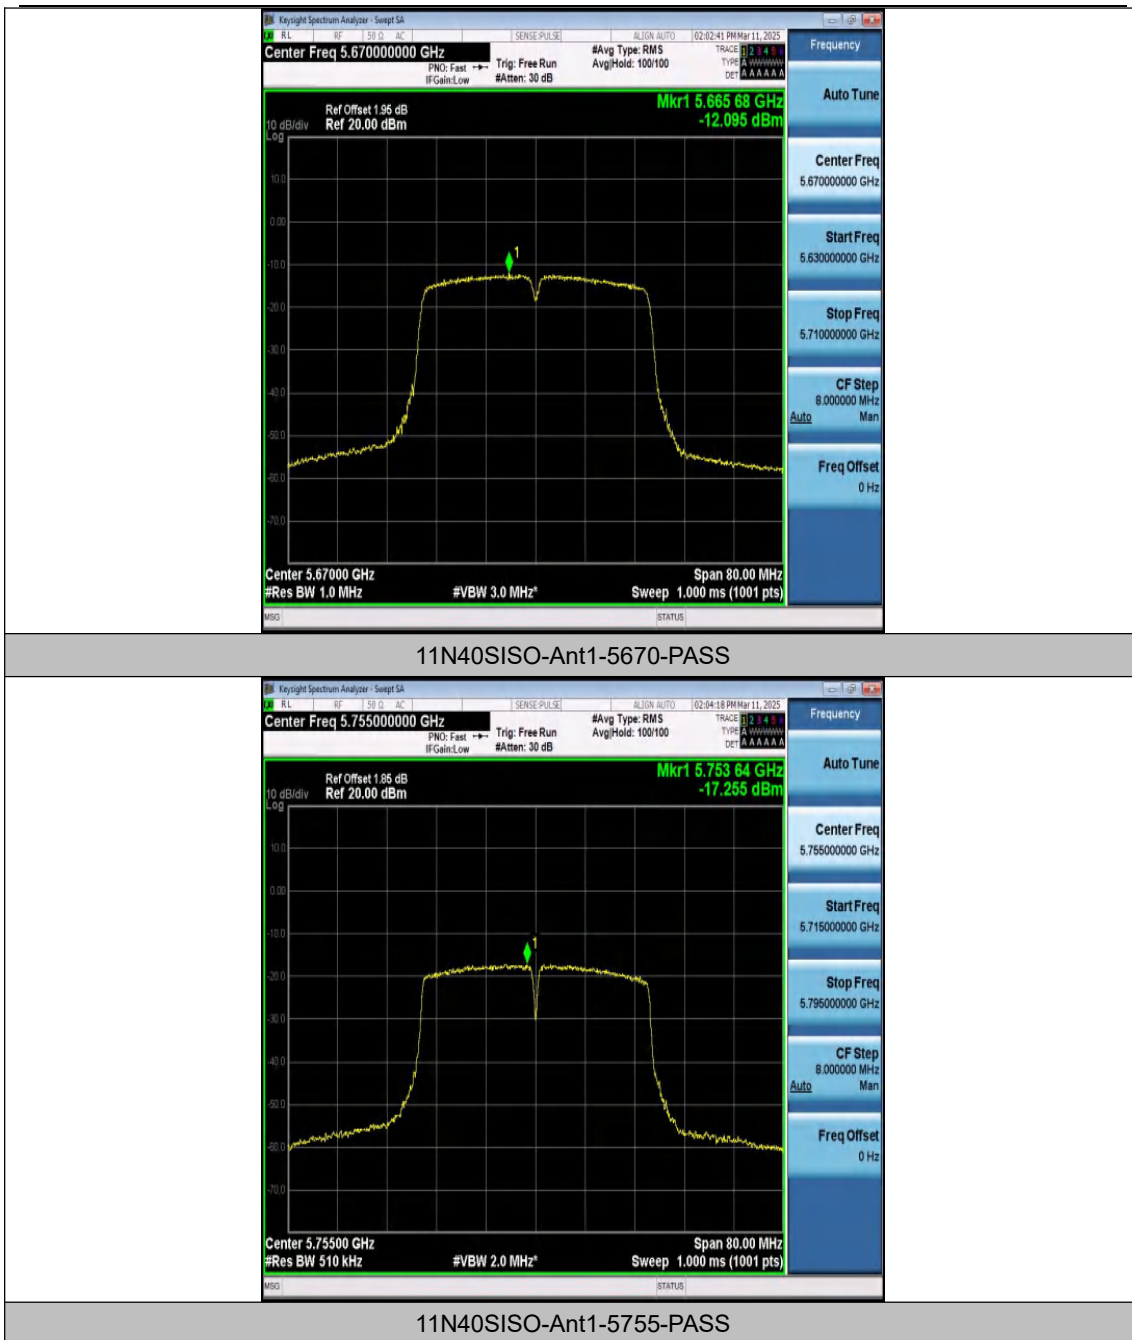


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com




Hotline
400-003-0500
www.anbotech.com

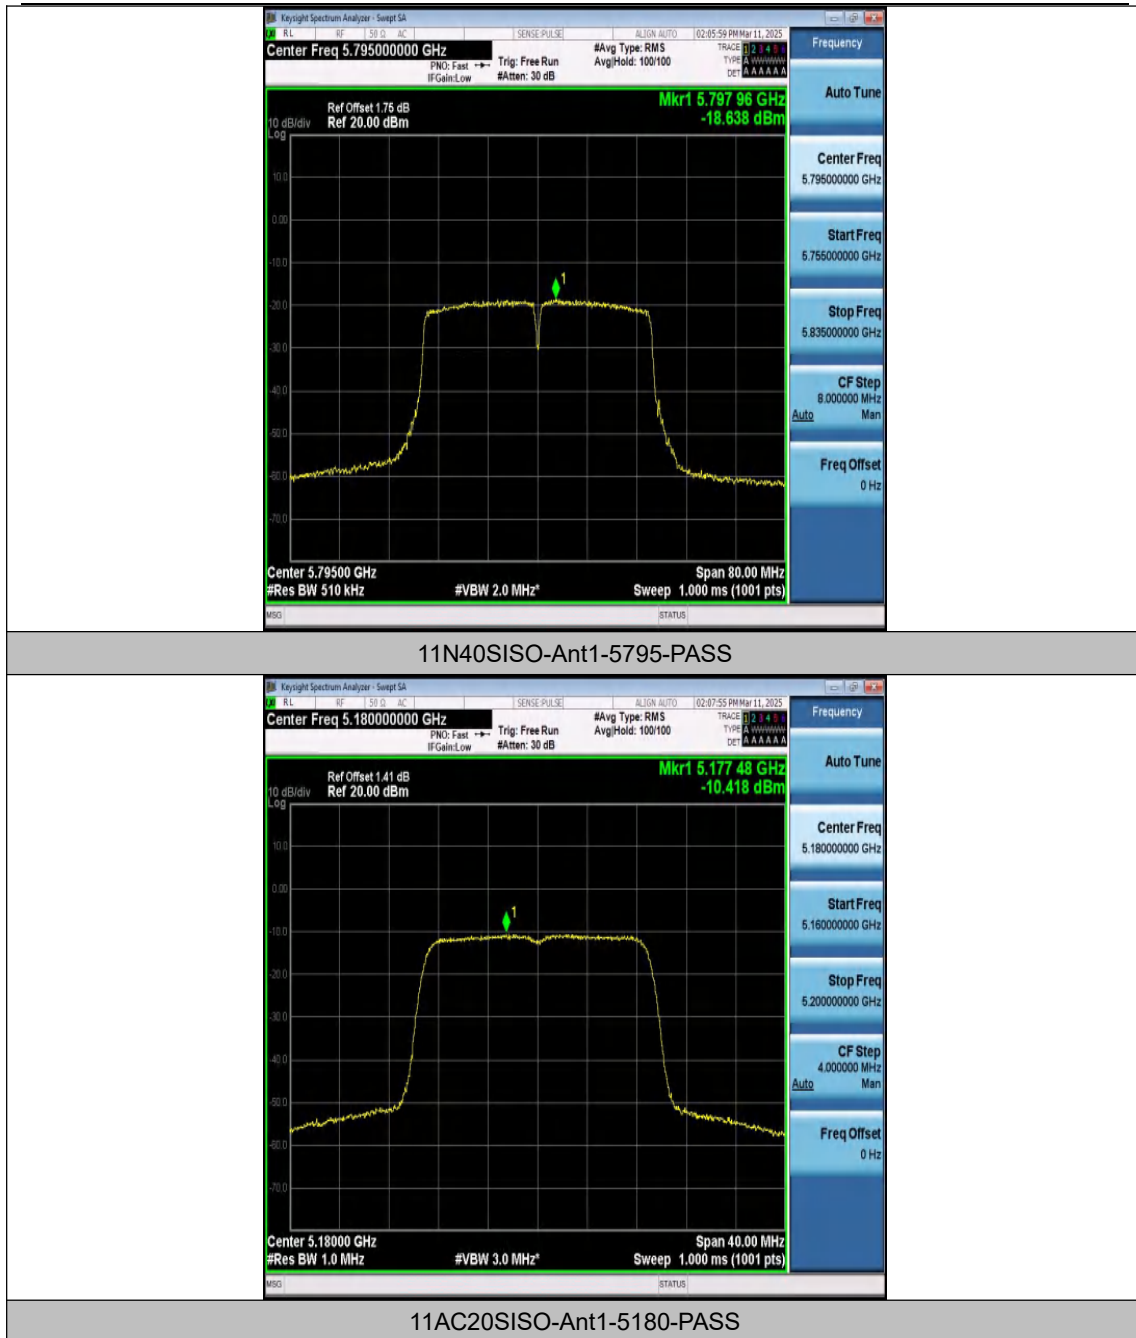

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

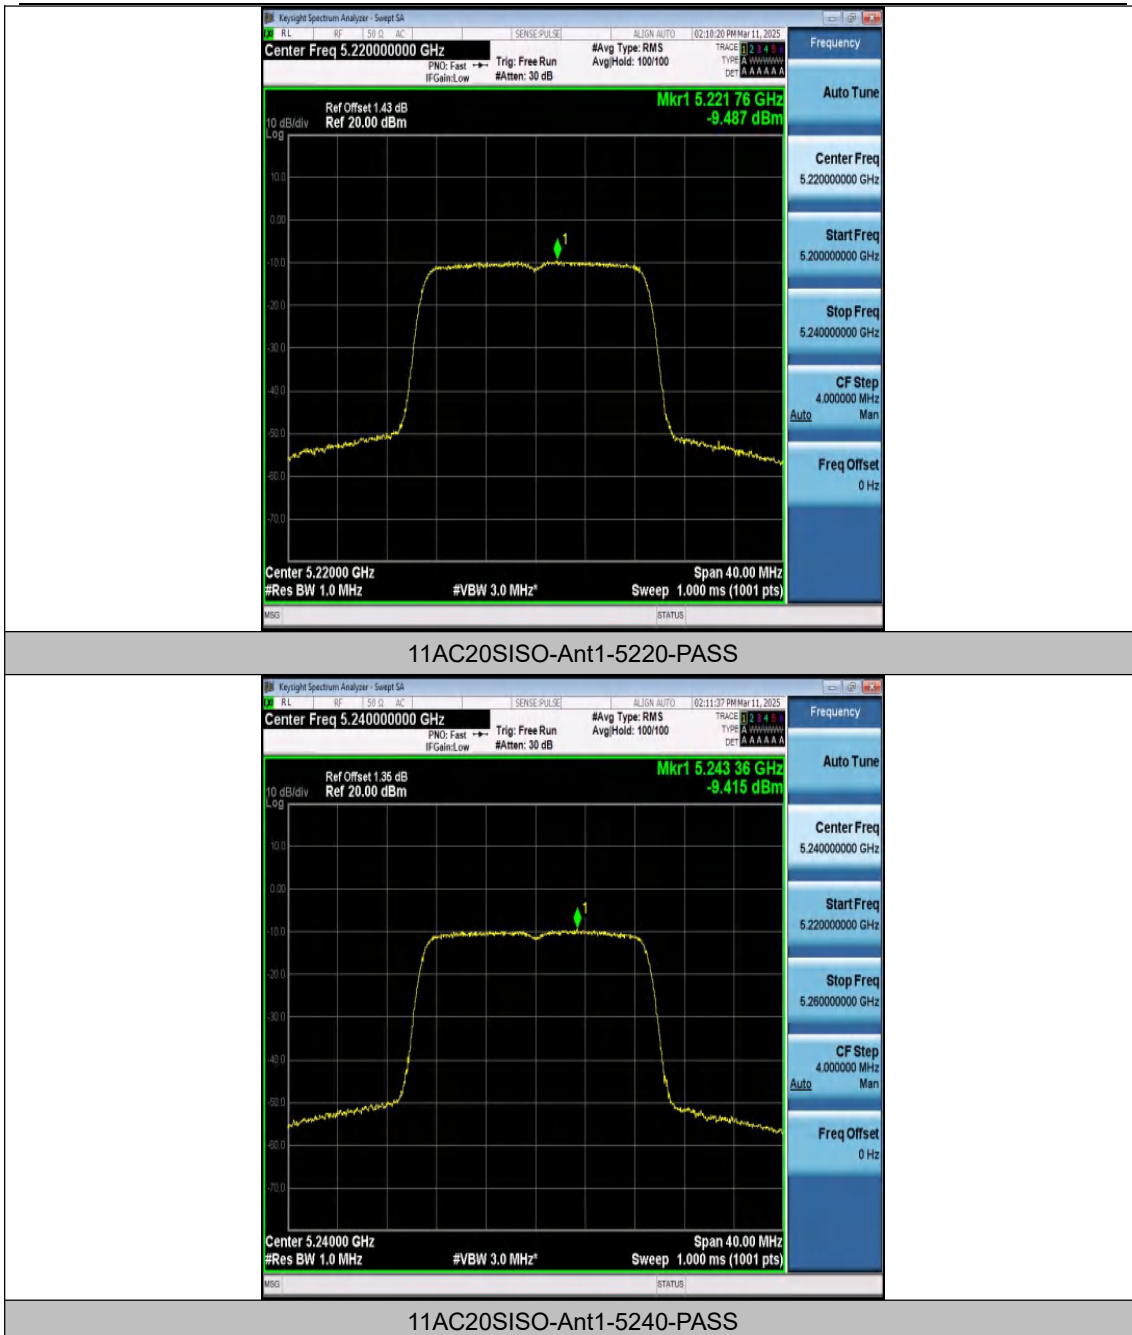

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

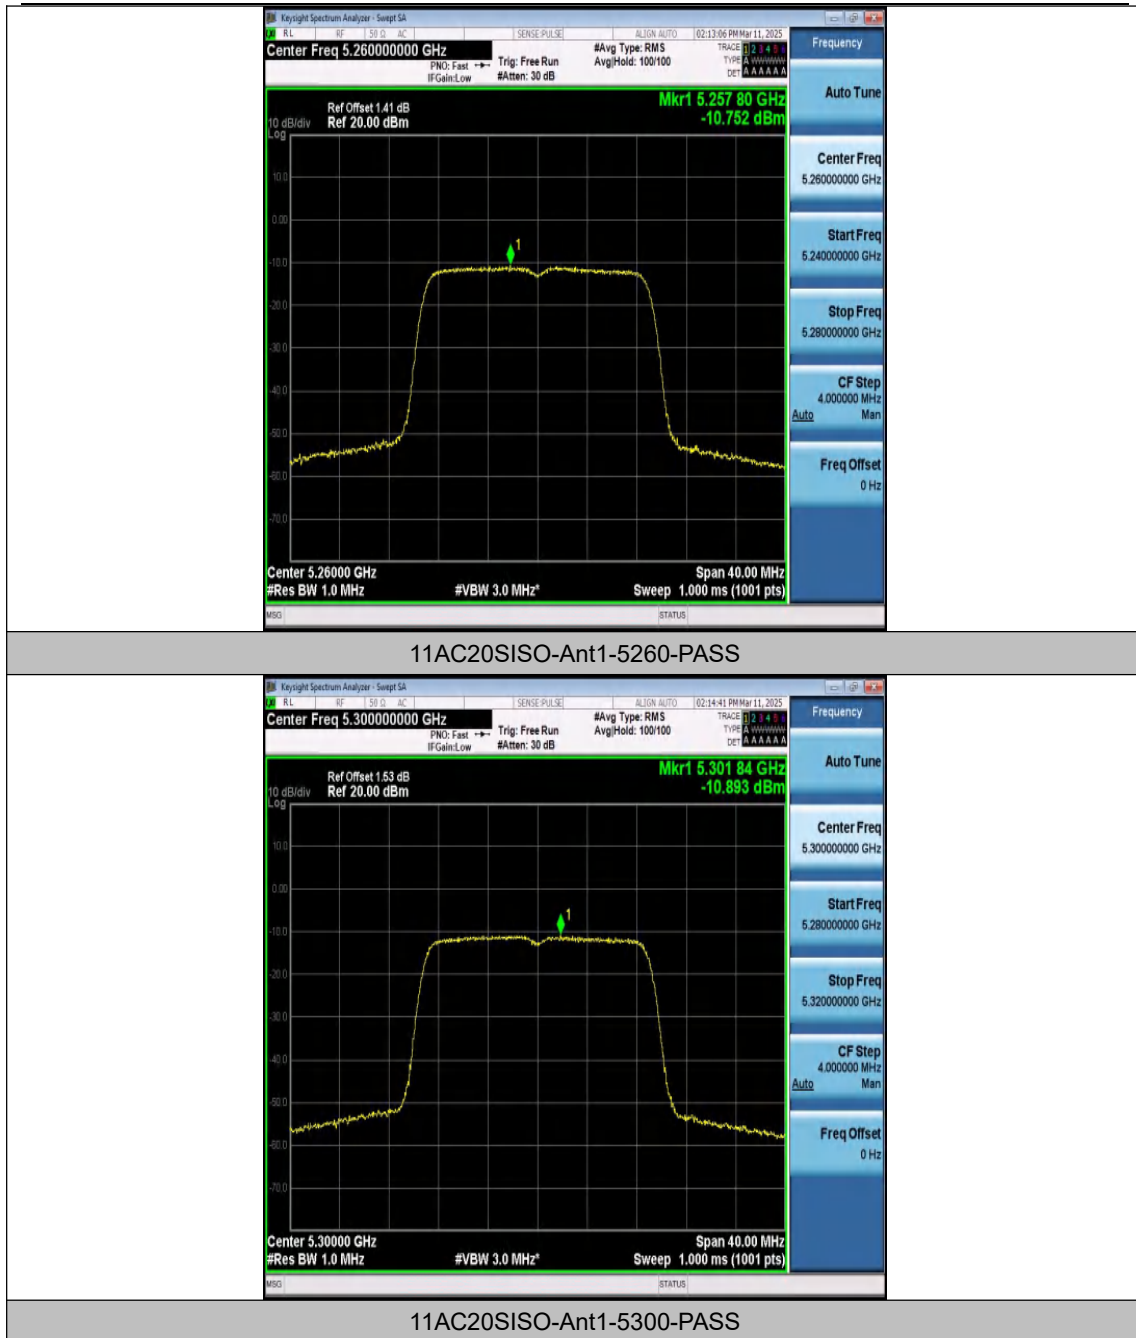

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

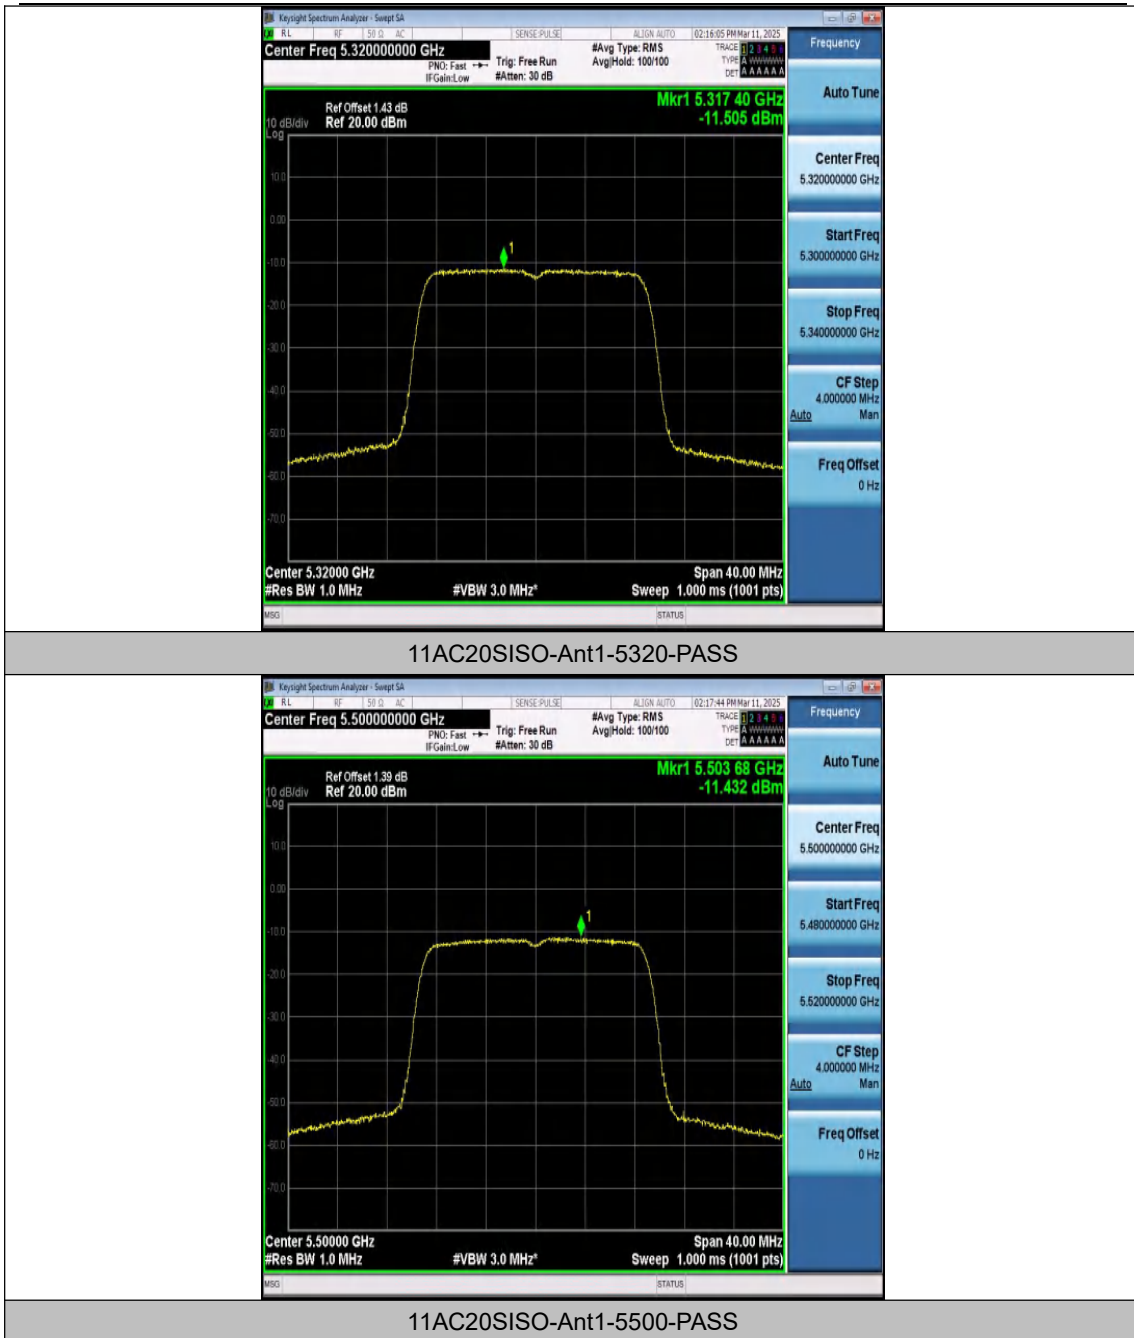

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

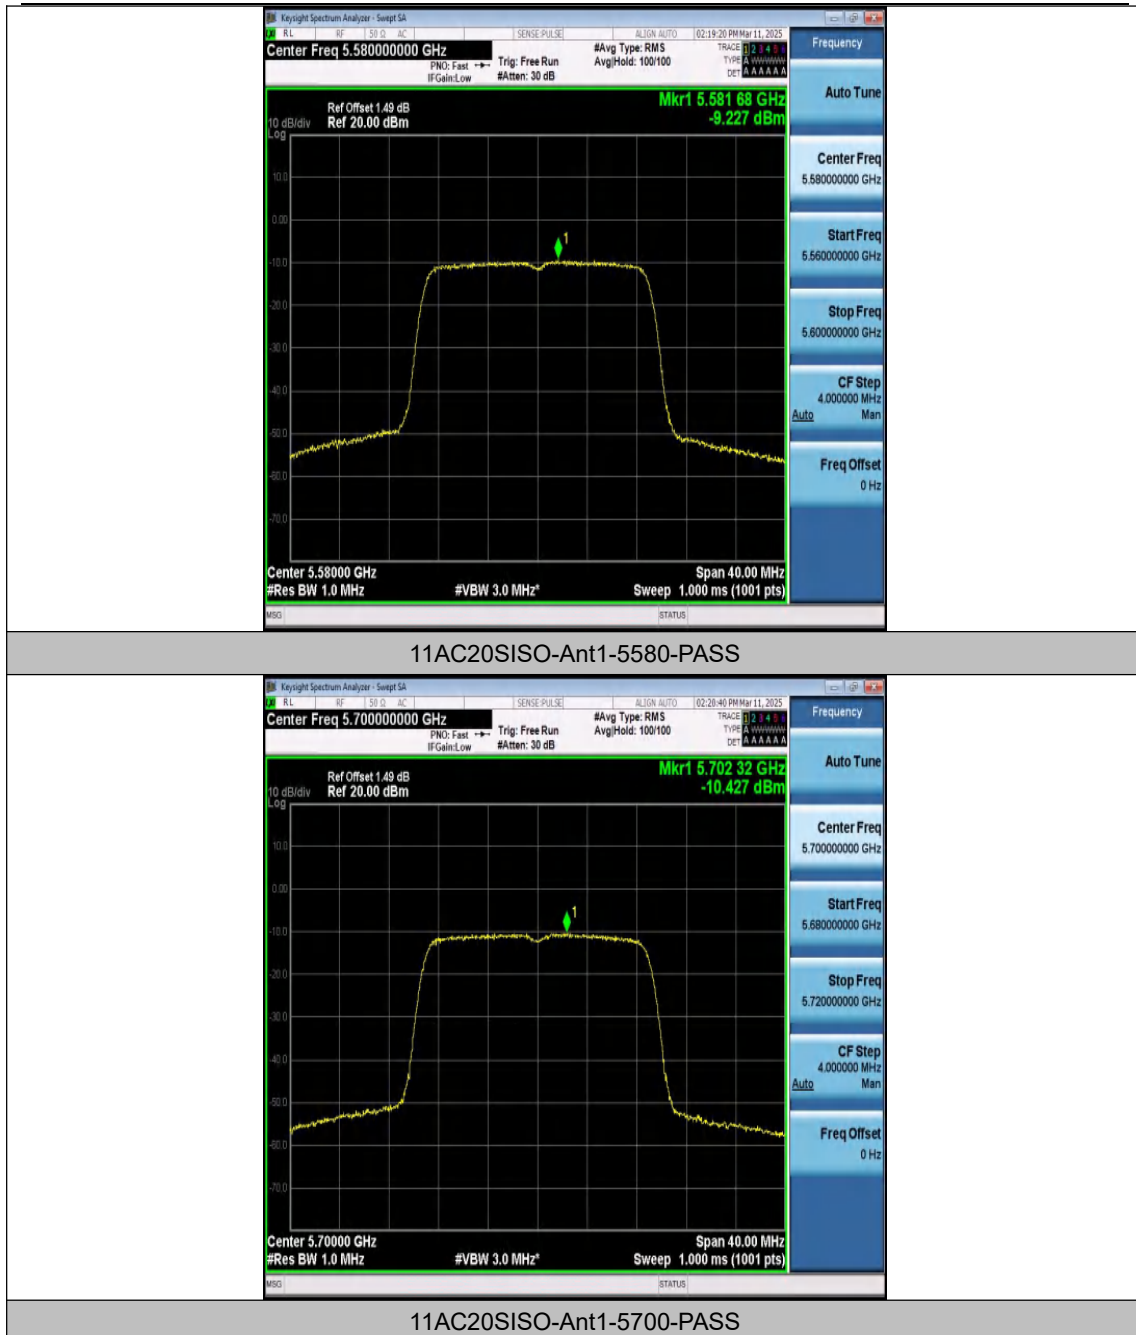


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

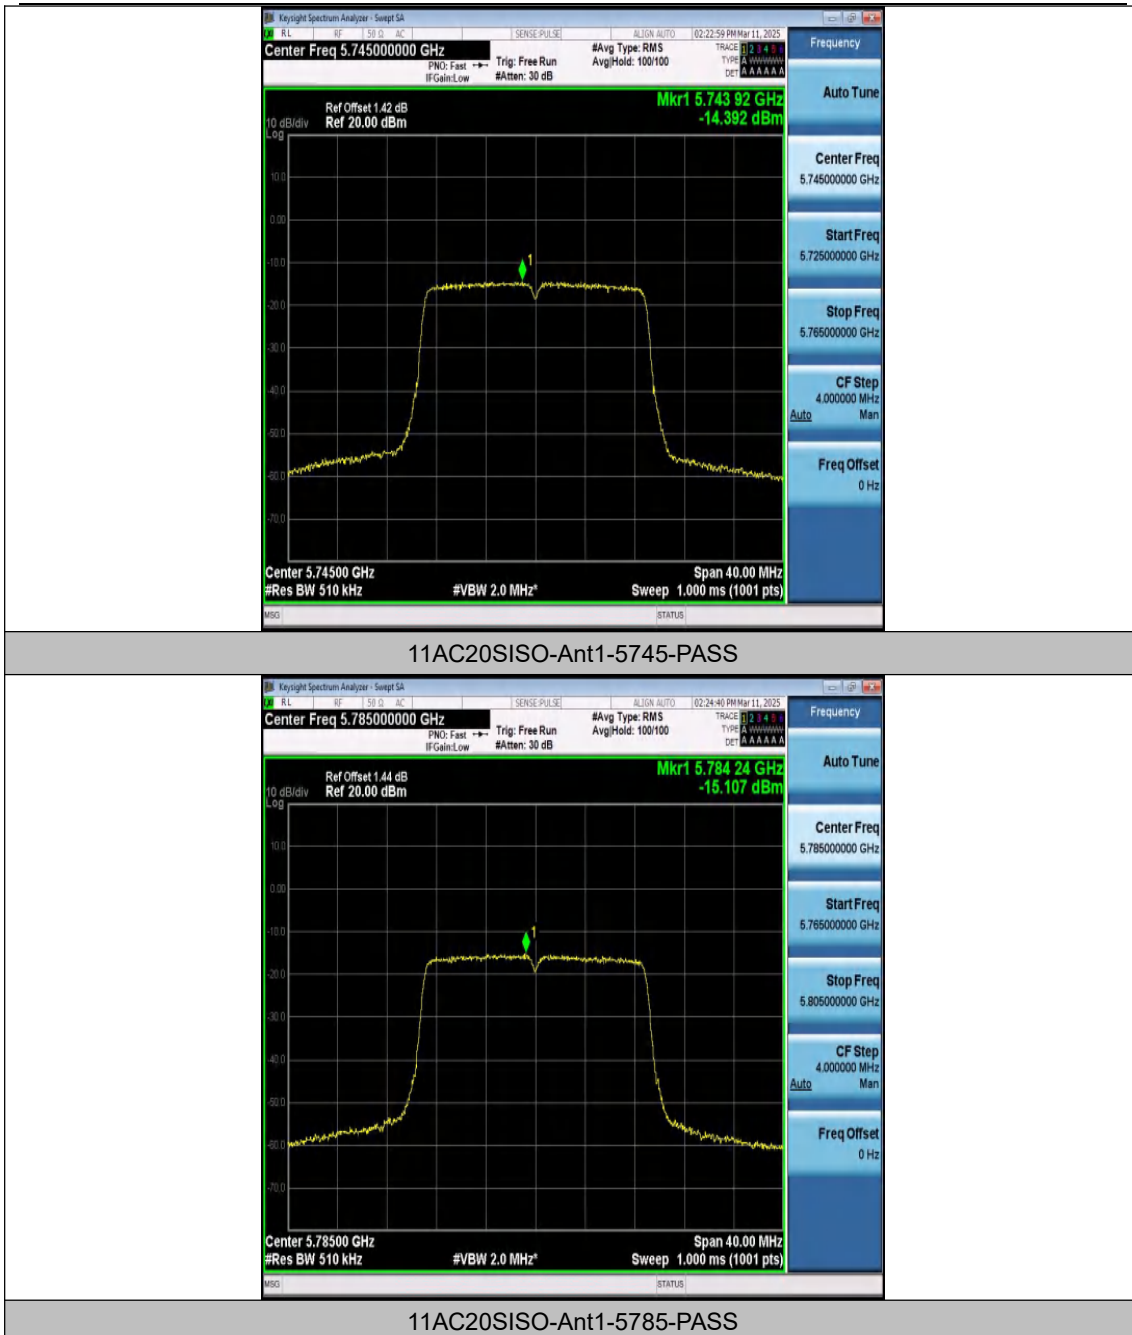

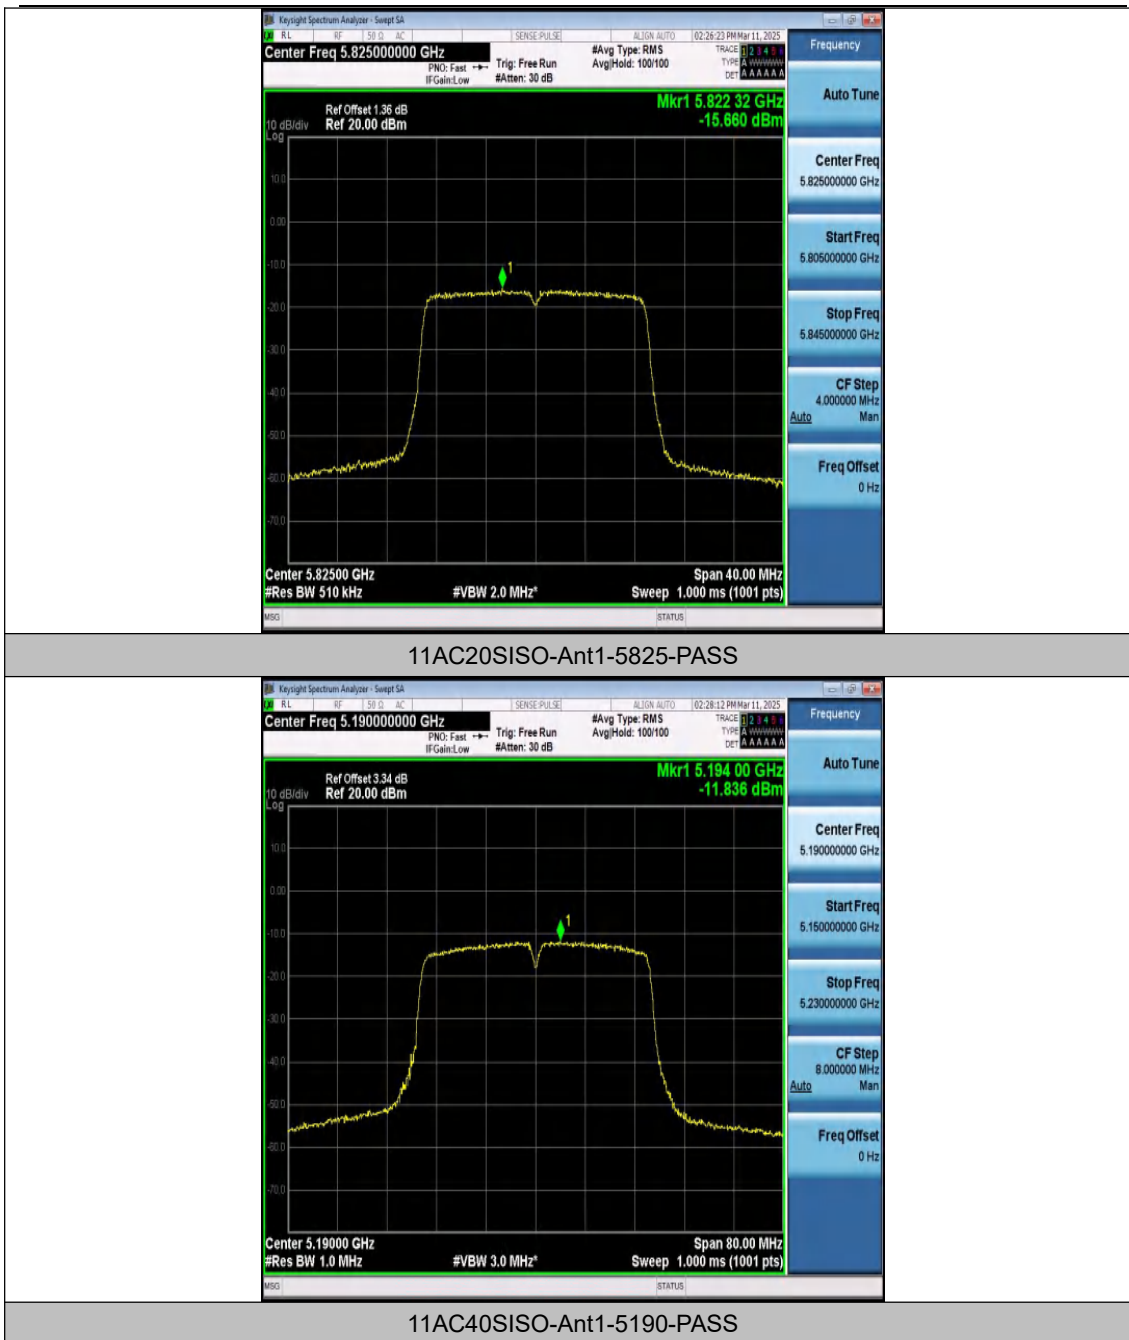


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com




Hotline
400-003-0500
www.anbotech.com

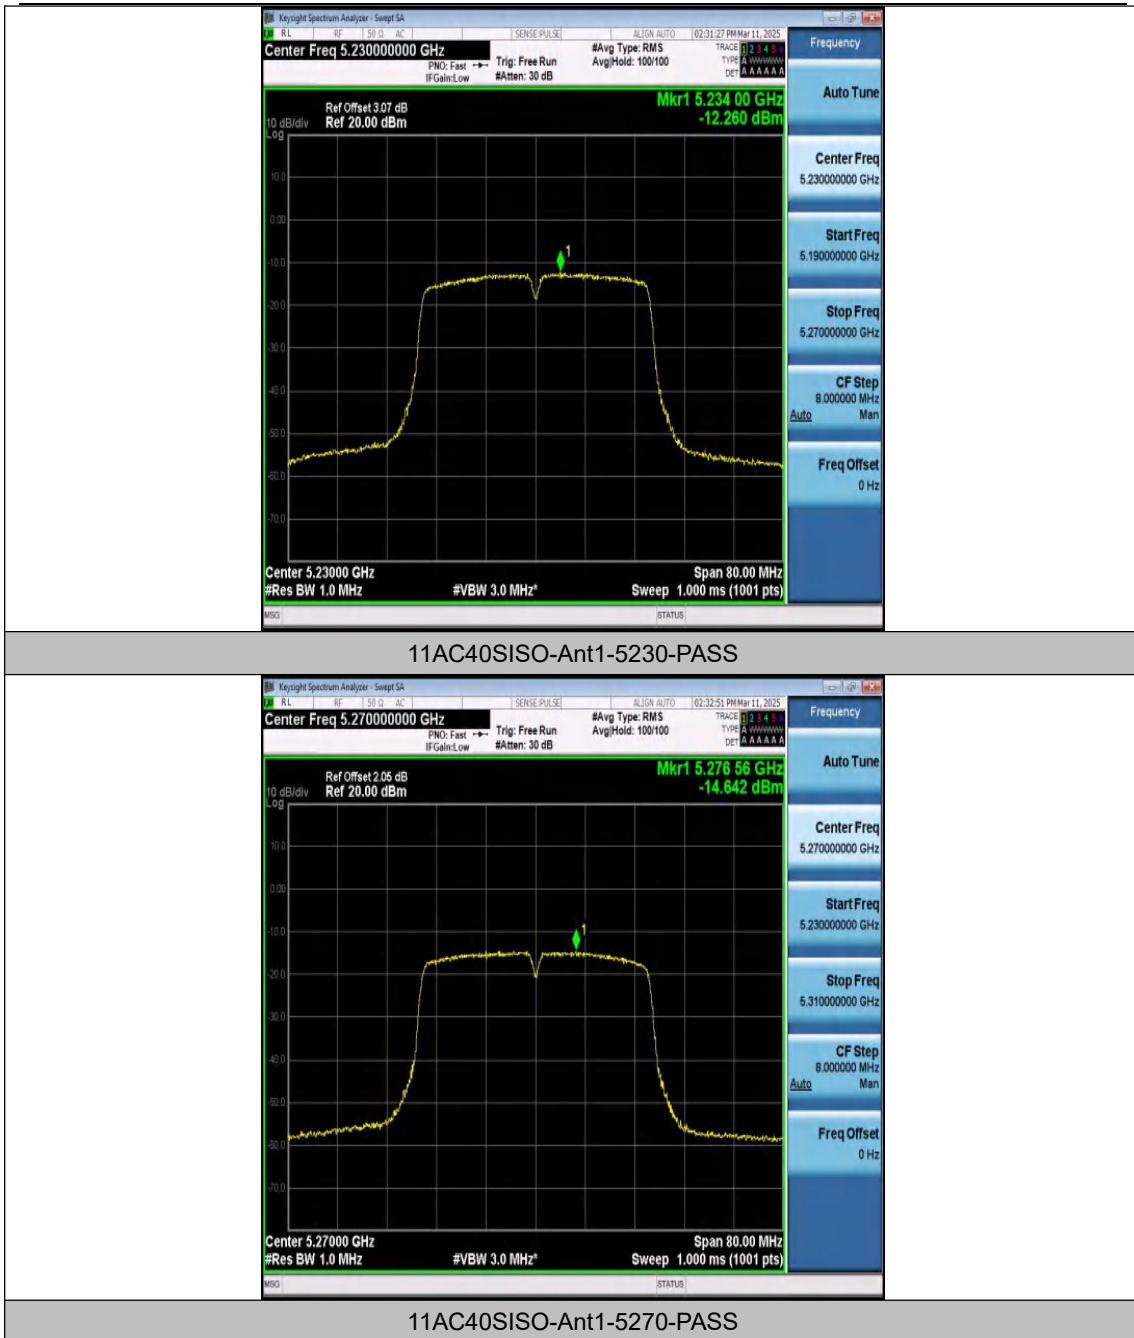

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

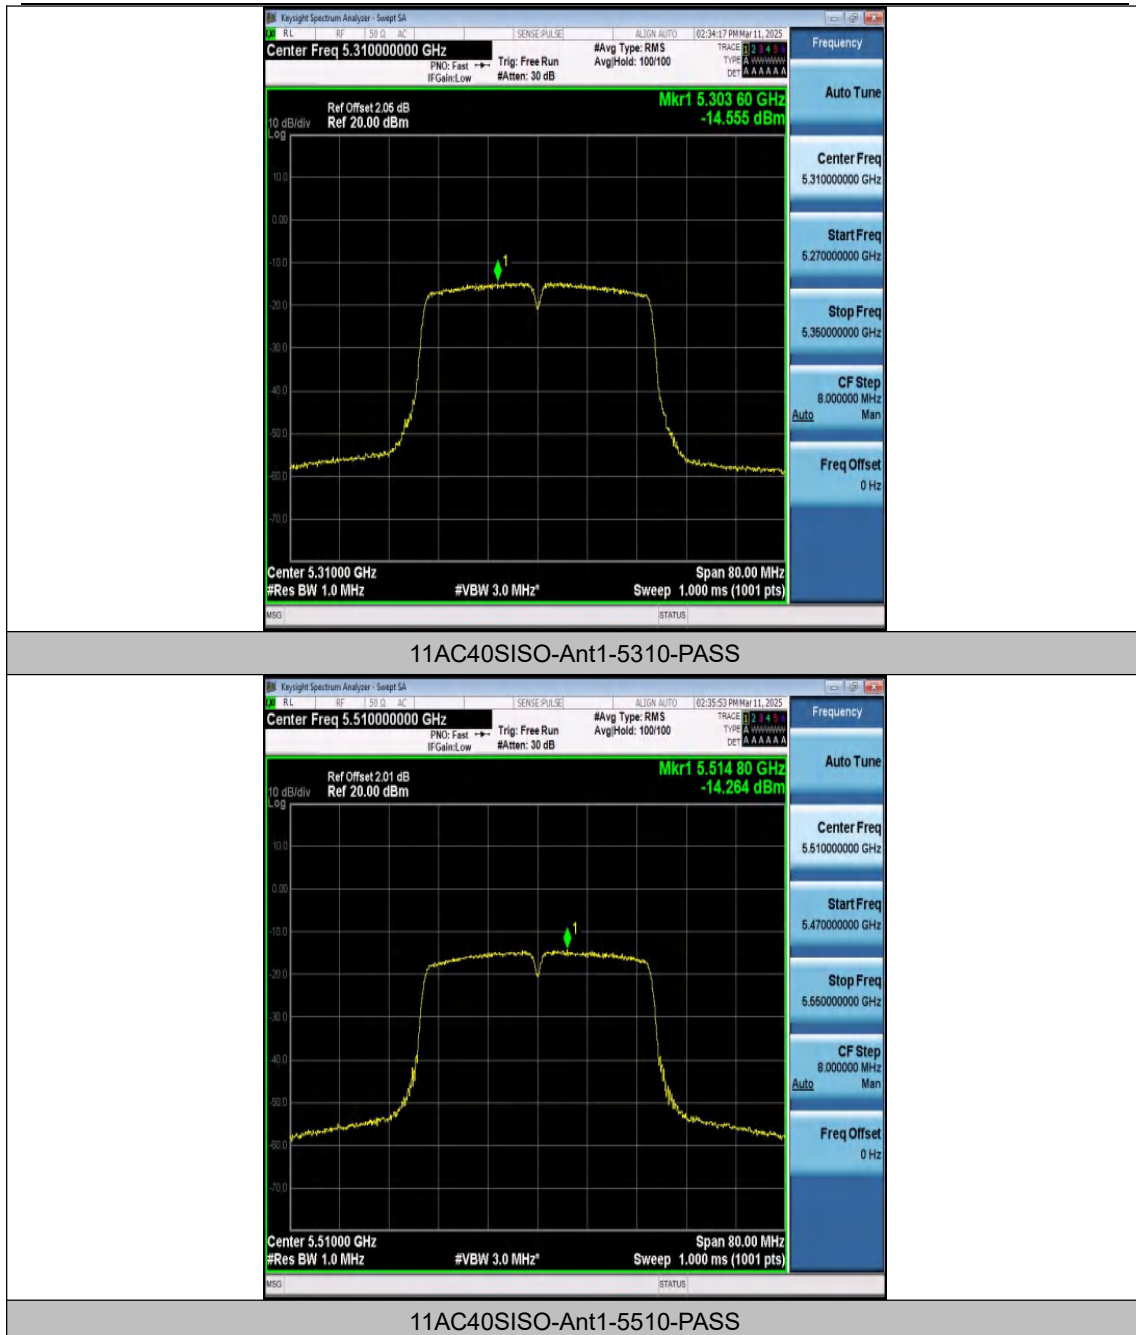

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

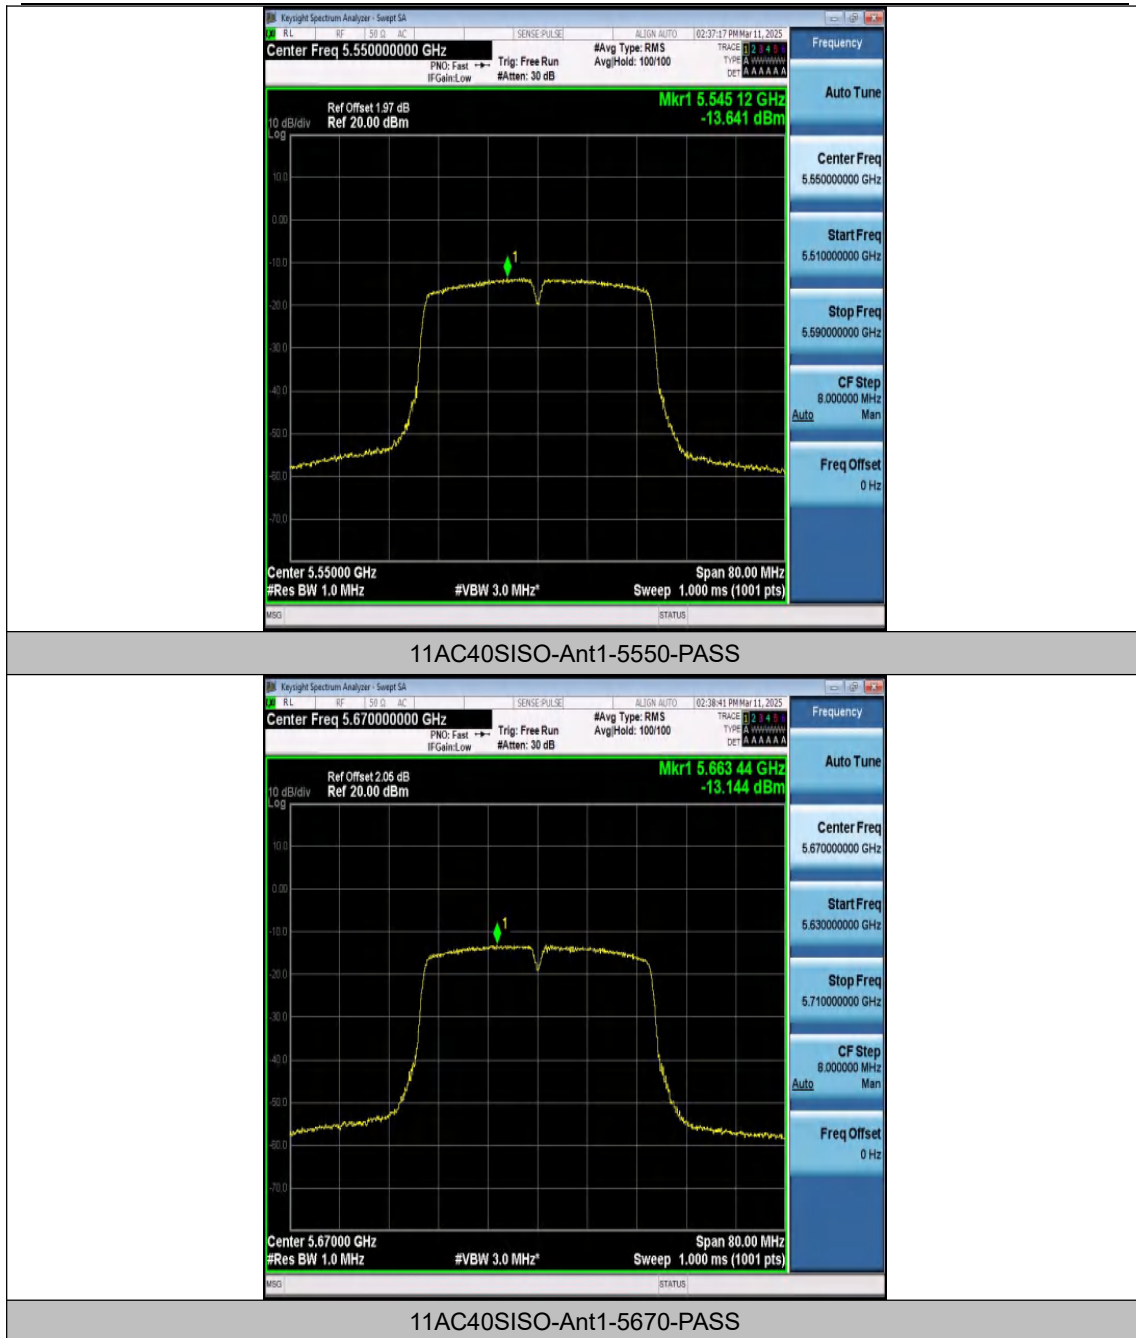

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

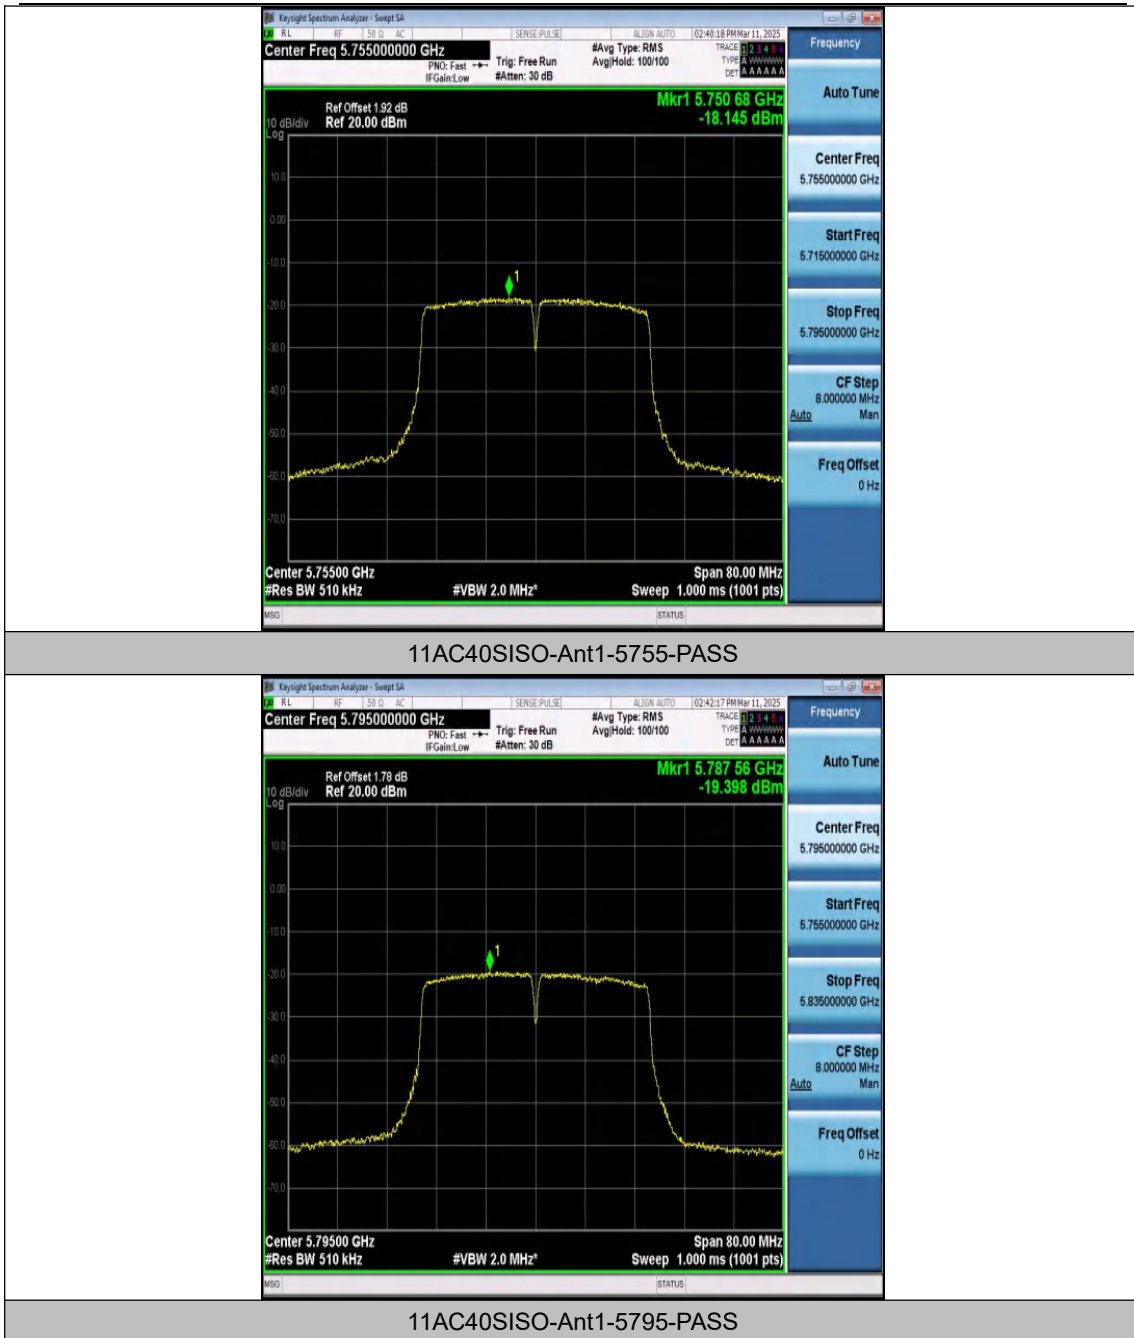


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

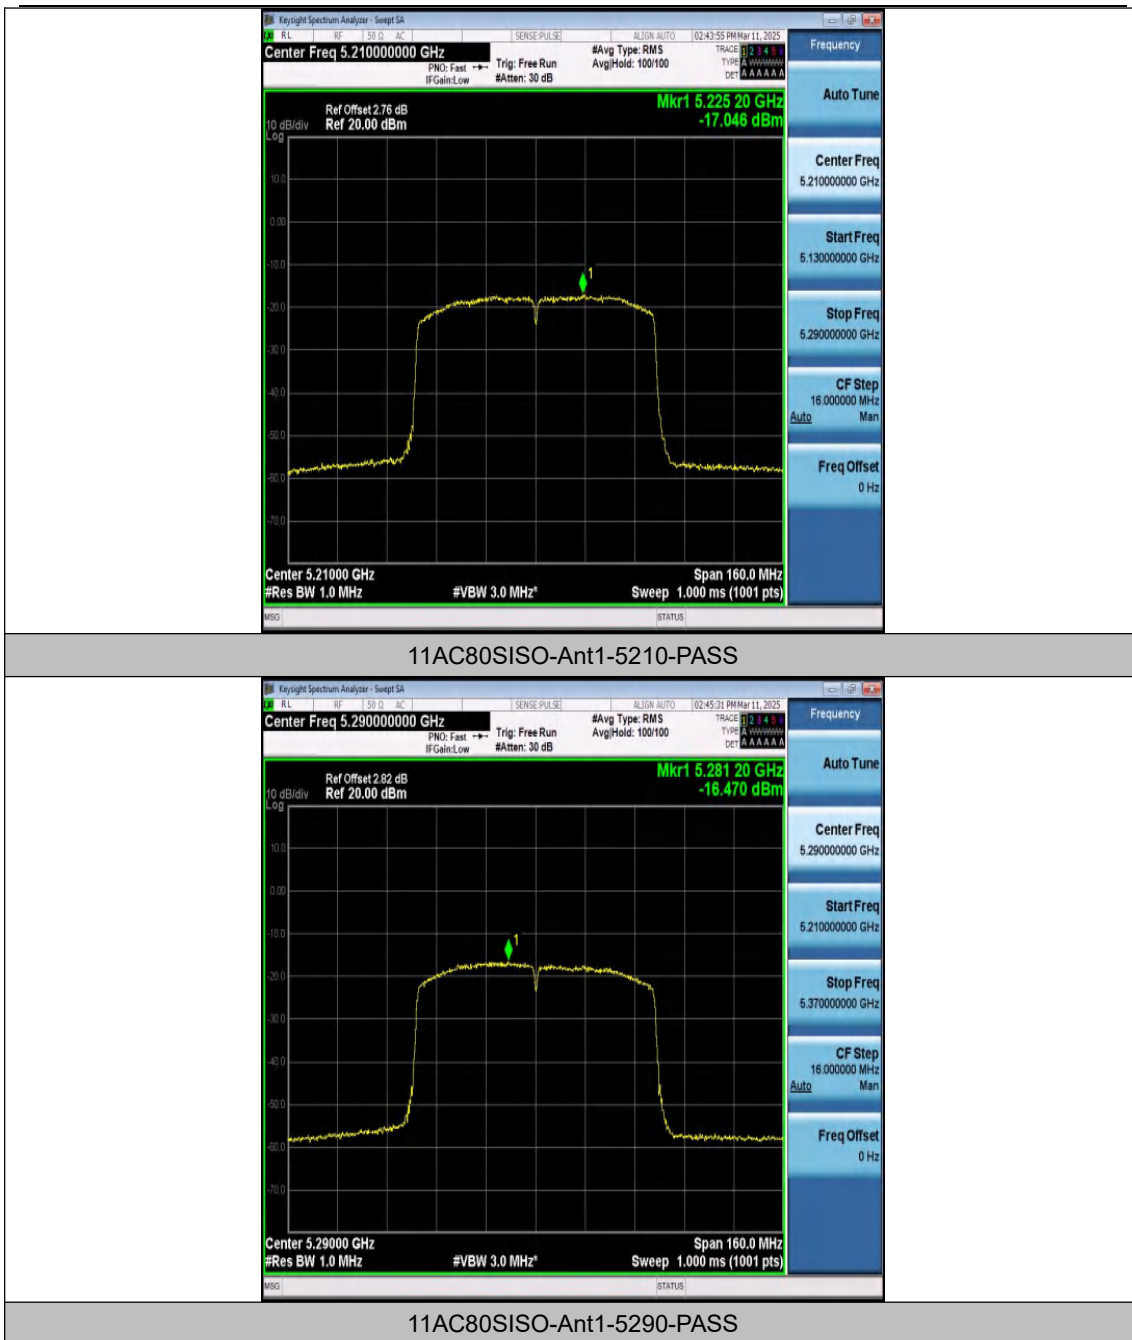

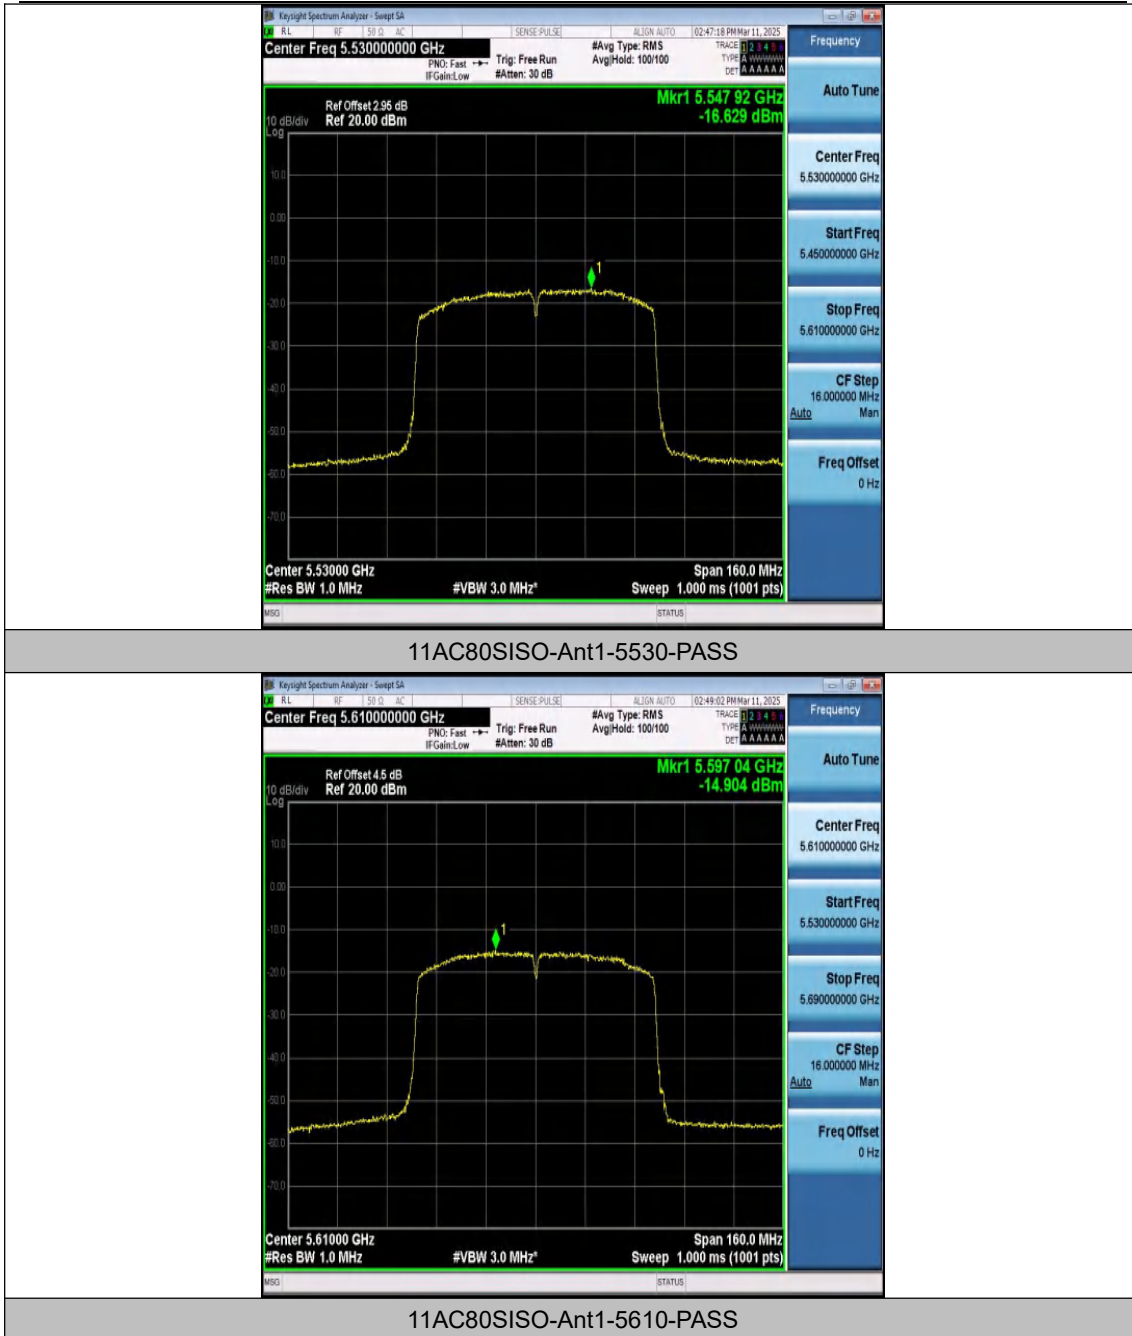

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

Appendix E: Band edge measurements

Test Result B1/2/3

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-47.49	≤-27	PASS
11A	Ant1	High	5320	-48.6	≤-27	PASS
11A	Ant1	Low	5500	-48.58	≤-27	PASS
11A	Ant1	High	5700	-48.7	≤-27	PASS
11N20SISO	Ant1	Low	5180	-48.51	≤-27	PASS
11N20SISO	Ant1	High	5320	-49.2	≤-27	PASS
11N20SISO	Ant1	Low	5500	-49.01	≤-27	PASS
11N20SISO	Ant1	High	5700	-48.24	≤-27	PASS
11N40SISO	Ant1	Low	5190	-47.86	≤-27	PASS
11N40SISO	Ant1	High	5310	-47.78	≤-27	PASS
11N40SISO	Ant1	Low	5510	-48.24	≤-27	PASS
11N40SISO	Ant1	High	5670	-48.17	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-48.38	≤-27	PASS
11AC20SISO	Ant1	High	5320	-48.3	≤-27	PASS
11AC20SISO	Ant1	Low	5500	-48.9	≤-27	PASS
11AC20SISO	Ant1	High	5700	-48.97	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-47.09	≤-27	PASS
11AC40SISO	Ant1	High	5310	-48.39	≤-27	PASS
11AC40SISO	Ant1	Low	5510	-48.43	≤-27	PASS
11AC40SISO	Ant1	High	5670	-47.66	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-45.68	≤-27	PASS
11AC80SISO	Ant1	High	5290	-48.38	≤-27	PASS
11AC80SISO	Ant1	Low	5530	-47.7	≤-27	PASS
11AC80SISO	Ant1	High	5610	-47.92	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency [MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-48.82	≤16.60	PASS
11A	Ant1	Low	5745	5700~5720	-48.68	≤11.38	PASS
11A	Ant1	Low	5745	5650~5700	-50.49	≤-26.87	PASS
11A	Ant1	Low	5745	5760~5650	-49.7	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-49.85	≤16.65	PASS
11A	Ant1	High	5825	5855~5875	-50.21	≤10.29	PASS
11A	Ant1	High	5825	5875~5925	-49.76	≤-26.81	PASS
11A	Ant1	High	5825	5925~5935	-48.98	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-43.21	≤22.63	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-48.73	≤10.09	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-49.56	≤-26.96	PASS
11N20SISO	Ant1	Low	5745	5760~5650	-48.81	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-50.64	≤16.34	PASS
11N20SISO	Ant1	High	5825	5855~5875	-50.21	≤10.02	PASS
11N20SISO	Ant1	High	5825	5875~5925	-50.65	≤-26.61	PASS
11N20SISO	Ant1	High	5825	5925~5935	-49.39	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-45.09	≤15.74	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-47.48	≤12.10	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-49.37	≤-26.80	PASS
11N40SISO	Ant1	Low	5755	5780~5650	-49.69	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-50.95	≤16.03	PASS
11N40SISO	Ant1	High	5795	5855~5875	-49.66	≤10.25	PASS
11N40SISO	Ant1	High	5795	5875~5925	-50.52	≤-26.46	PASS
11N40SISO	Ant1	High	5795	5925~5935	-48.94	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-50.31	≤15.82	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-48.47	≤10.06	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-49.56	≤-26.62	PASS
11AC20SISO	Ant1	Low	5745	5760~5650	-49.52	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-51.62	≤15.73	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-49.25	≤10.44	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-50.88	≤-26.51	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-49.81	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-44.45	≤16.04	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-48.78	≤10.74	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-50.04	≤-26.80	PASS
11AC40SISO	Ant1	Low	5755	5780~5650	-49.43	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-50.05	≤16.03	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-50.17	≤10.06	PASS
11AC40SISO	Ant1	High	5795	5875~5925	-49.88	≤-25.61	PASS


Shenzhen Anbotech Compliance Laboratory Limited





11AC40SISO	Ant1	High	5795	5925~5935	-47.56	≤-27	PASS
11AC80SISO	Ant1	Low	5775	5720~5725	-46.58	≤15.65	PASS
11AC80SISO	Ant1	Low	5775	5700~5720	-46.56	≤10.79	PASS
11AC80SISO	Ant1	Low	5775	5650~5700	-49.98	≤-26.80	PASS
11AC80SISO	Ant1	Low	5775	5800~5650	-49.6	≤-27	PASS
11AC80SISO	Ant1	High	5775	5850~5855	-50.54	≤15.84	PASS
11AC80SISO	Ant1	High	5775	5855~5875	-49.69	≤10.19	PASS
11AC80SISO	Ant1	High	5775	5875~5925	-49.48	≤-25.78	PASS
11AC80SISO	Ant1	High	5775	5925~5935	-49.46	≤-27	PASS


Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1/2/3

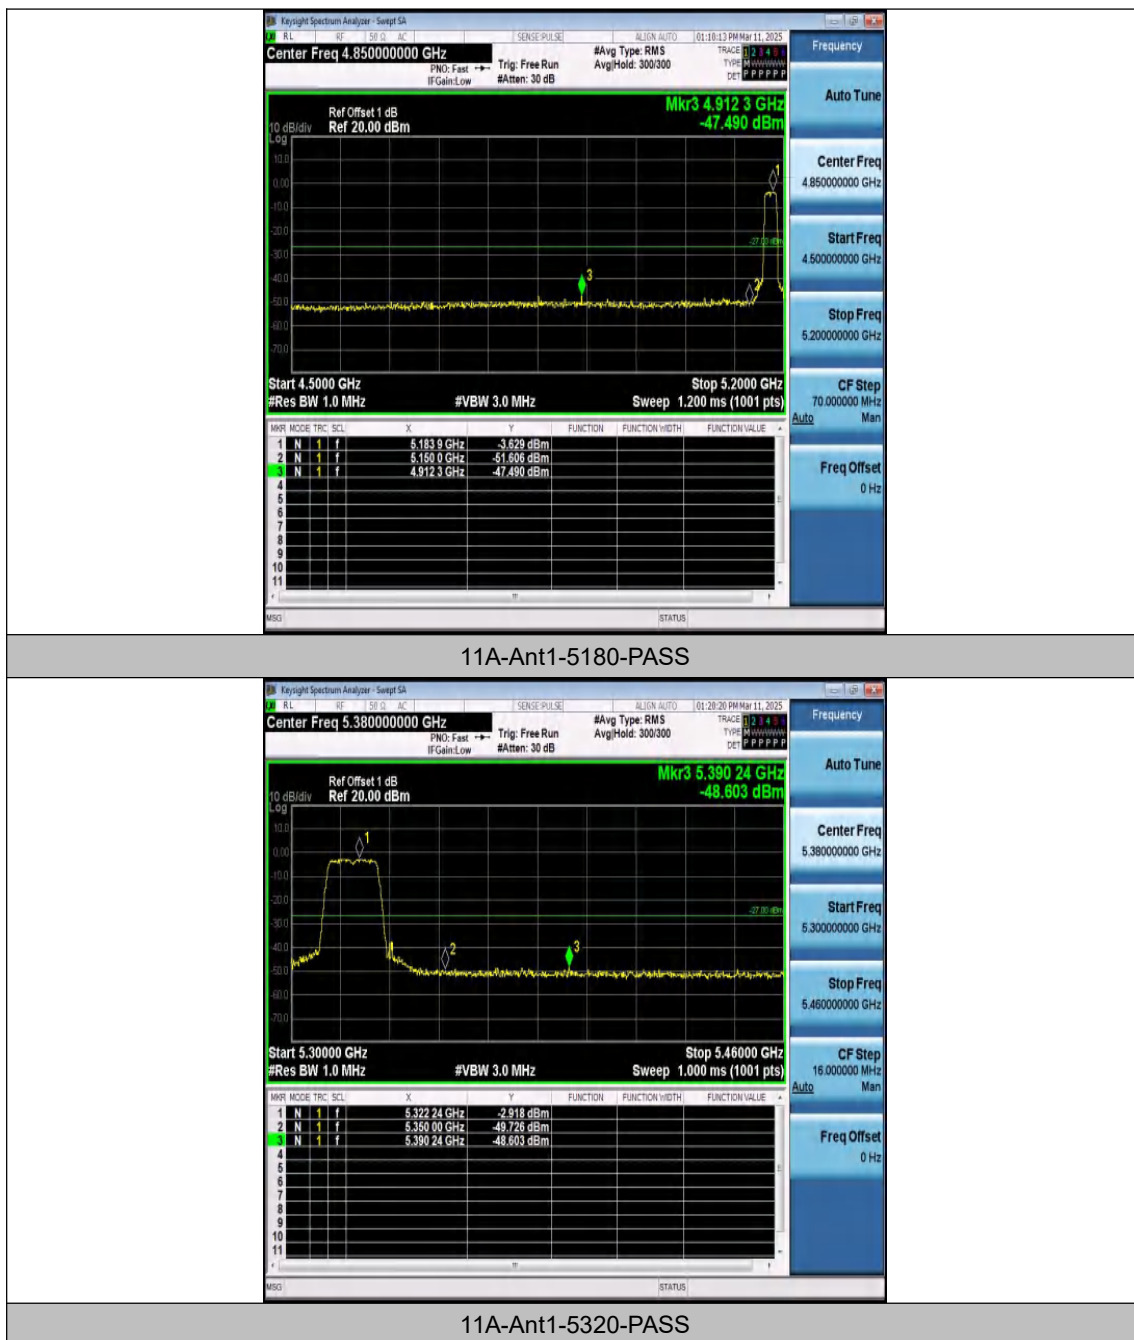


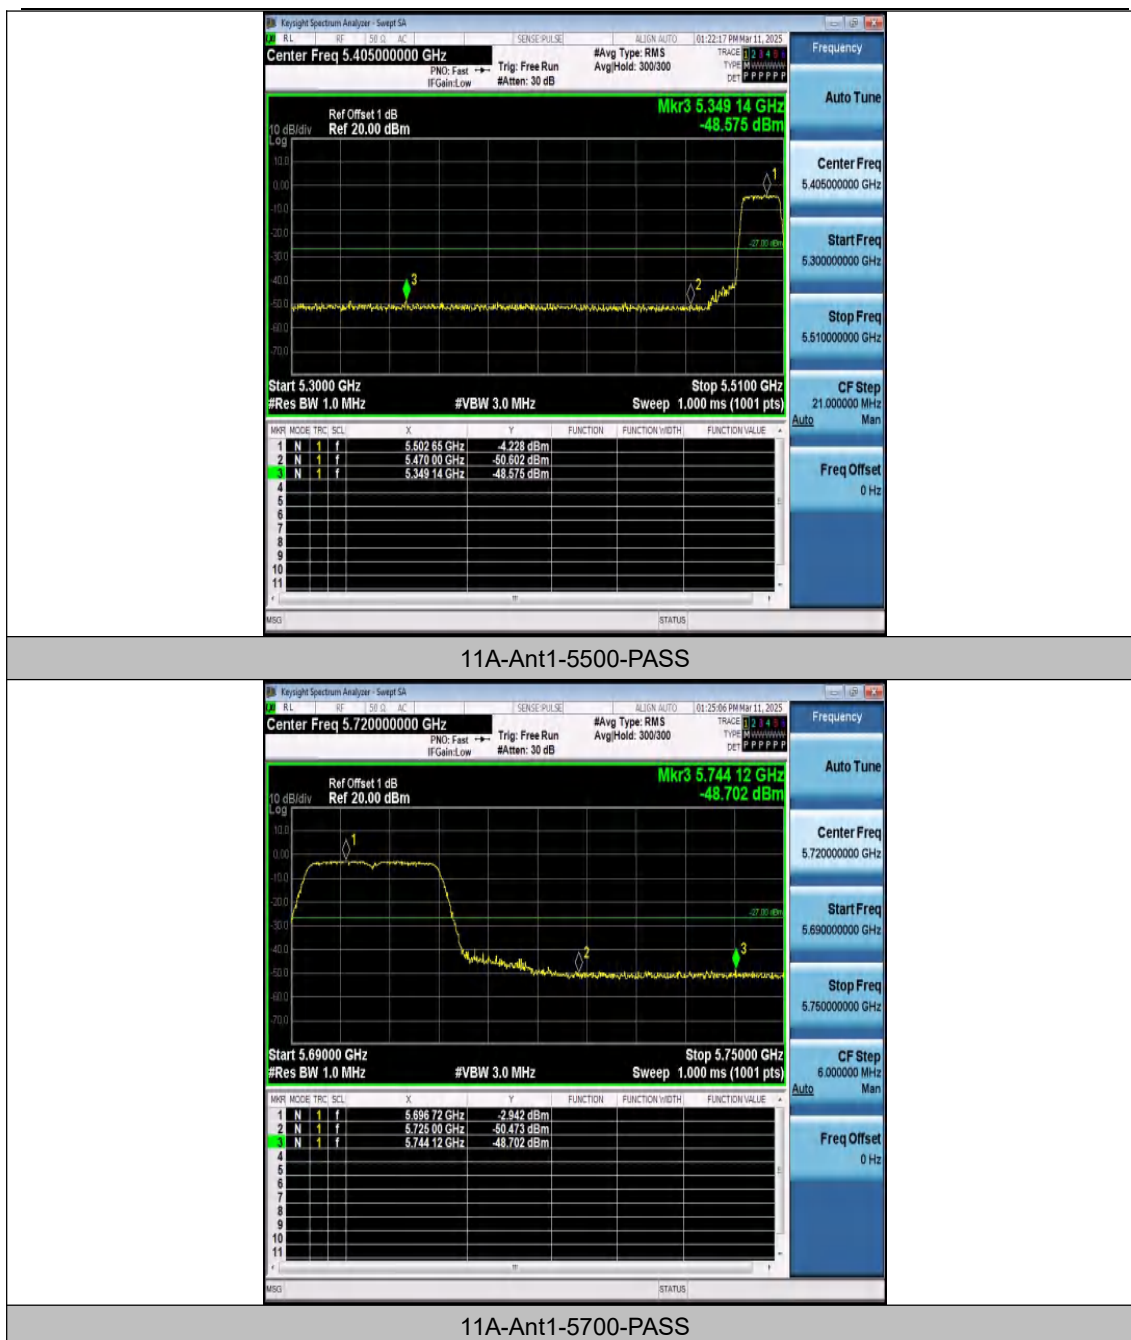

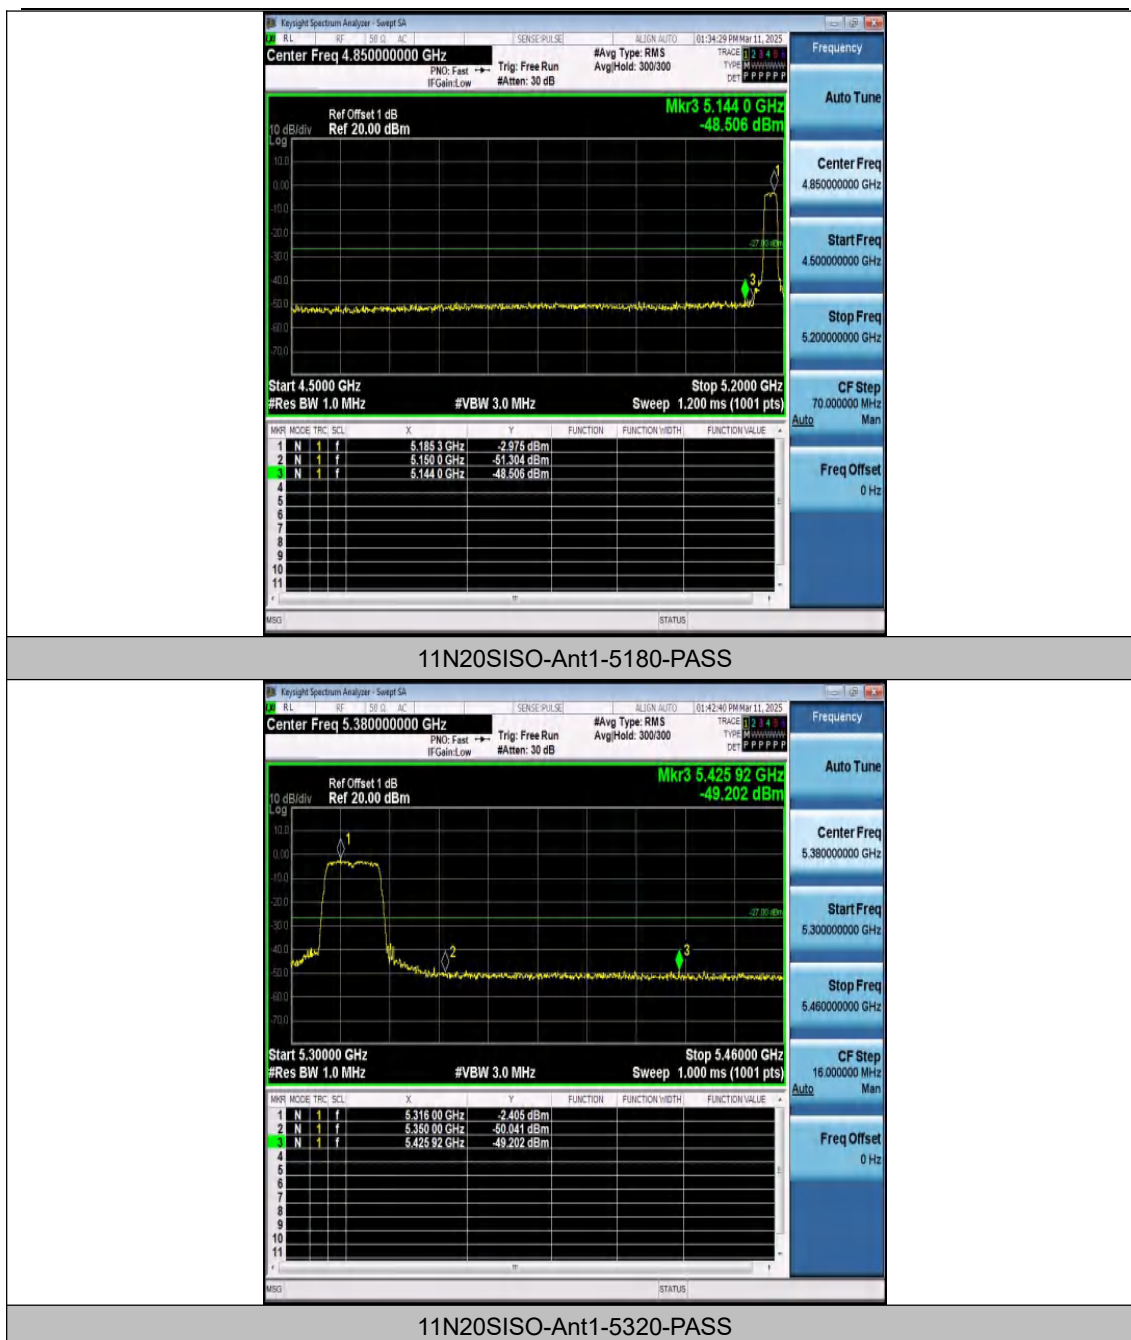


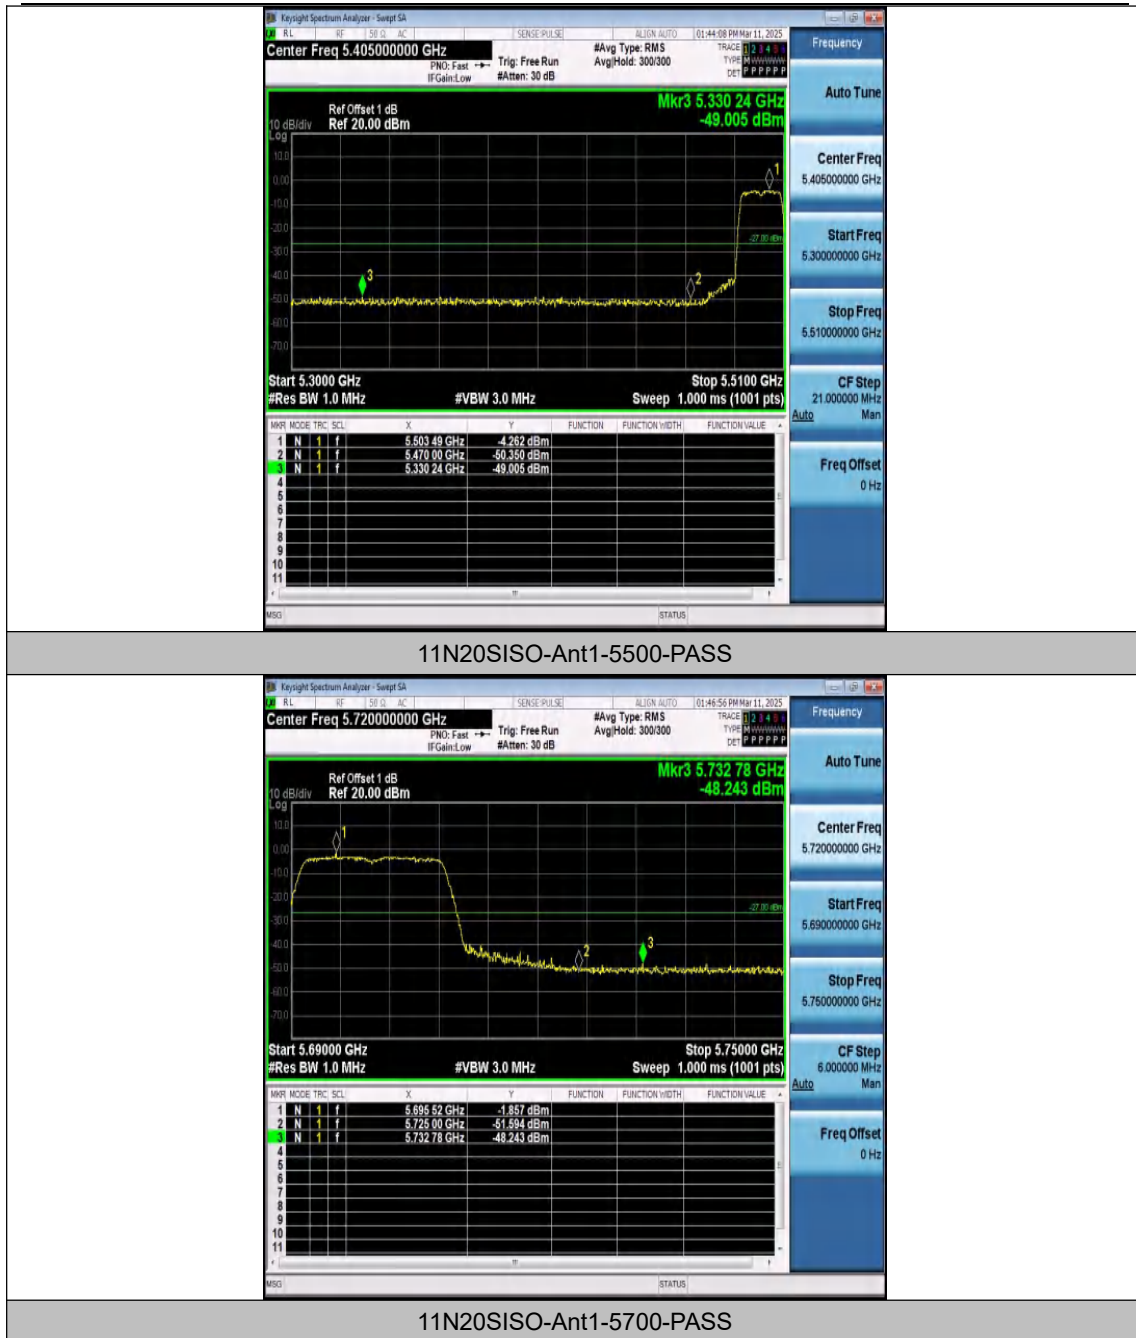

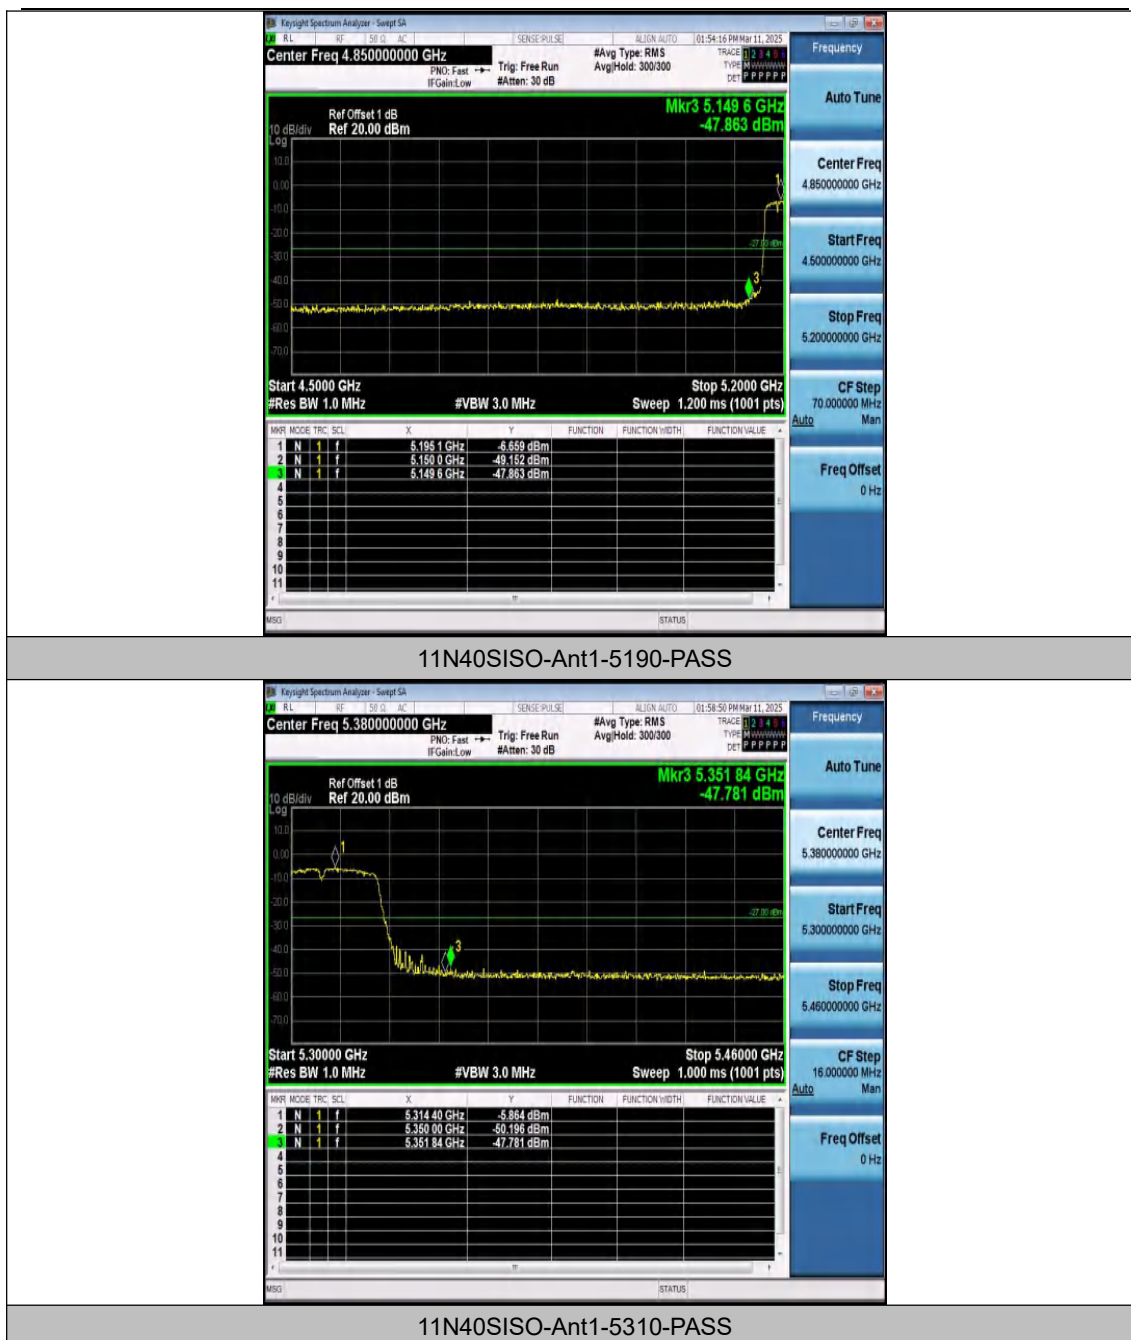


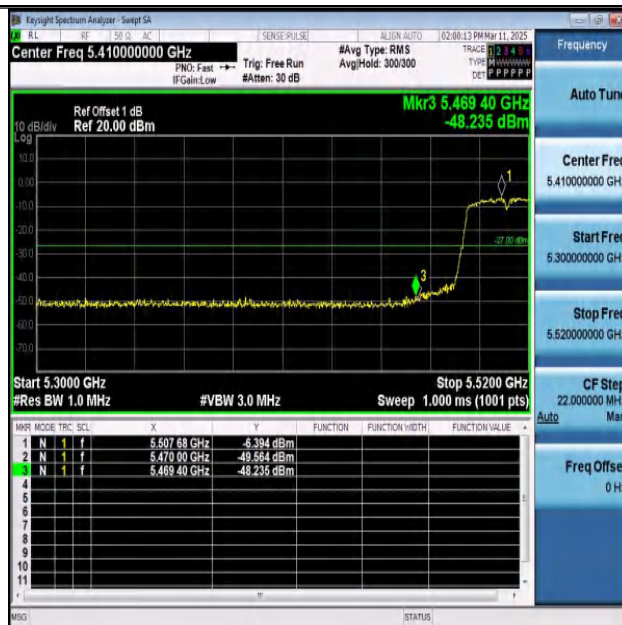



11N40SISO-Ant1-5510-PASS

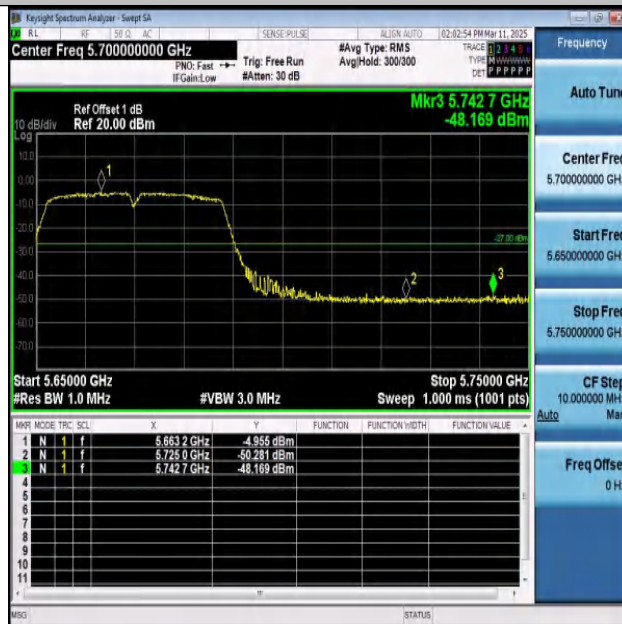



11N40SISO-Ant1-5670-PASS

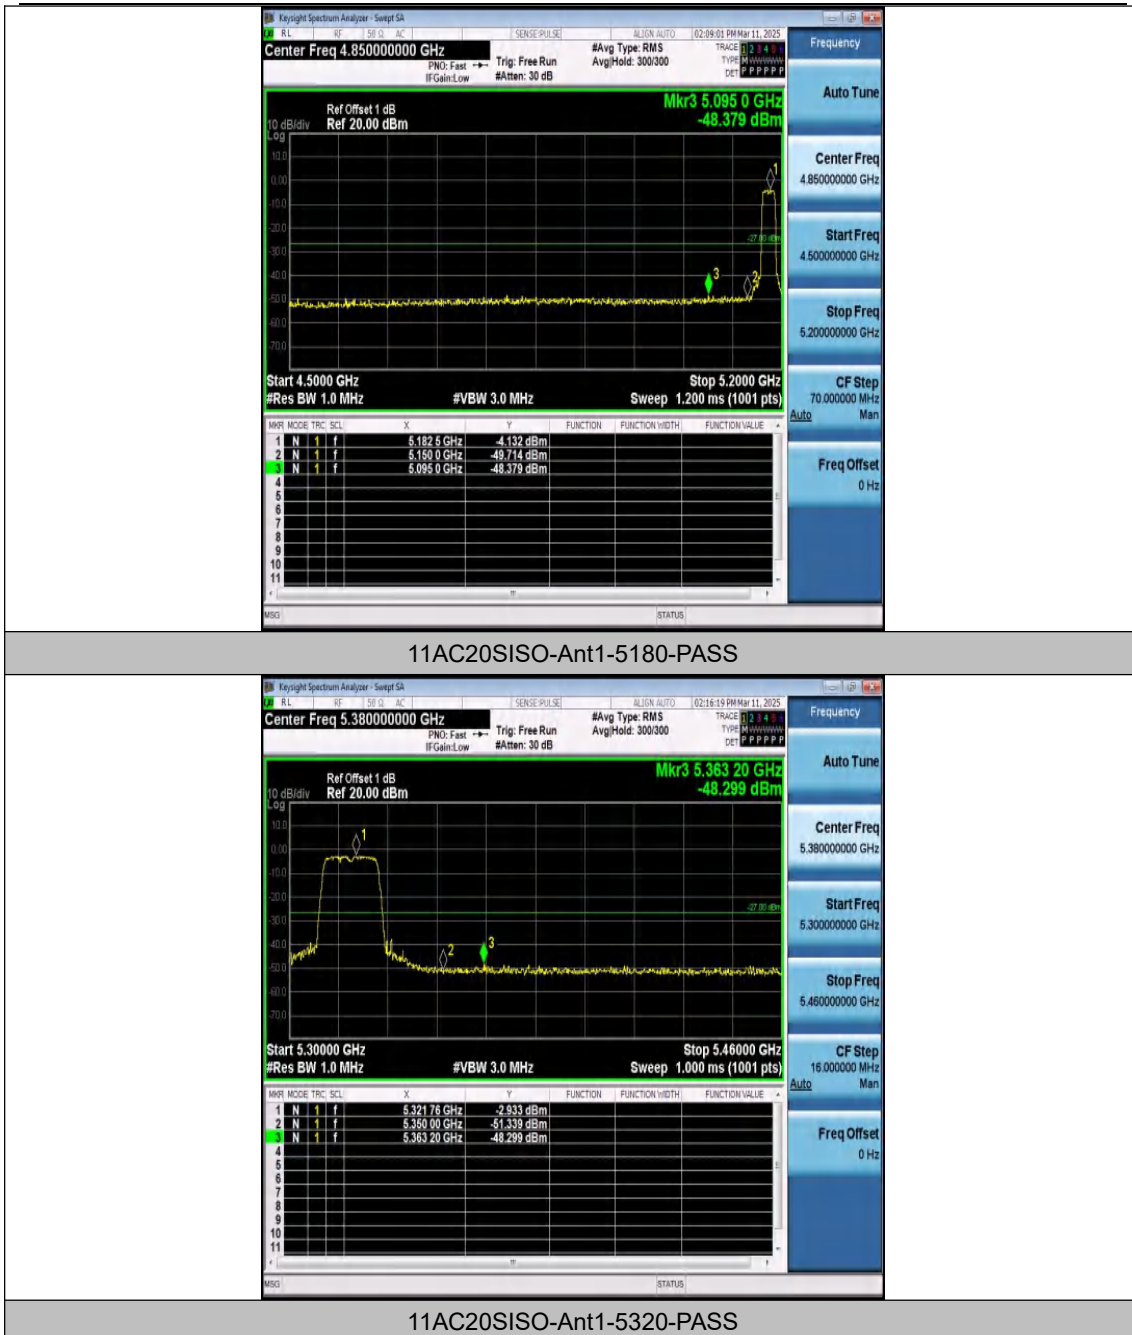


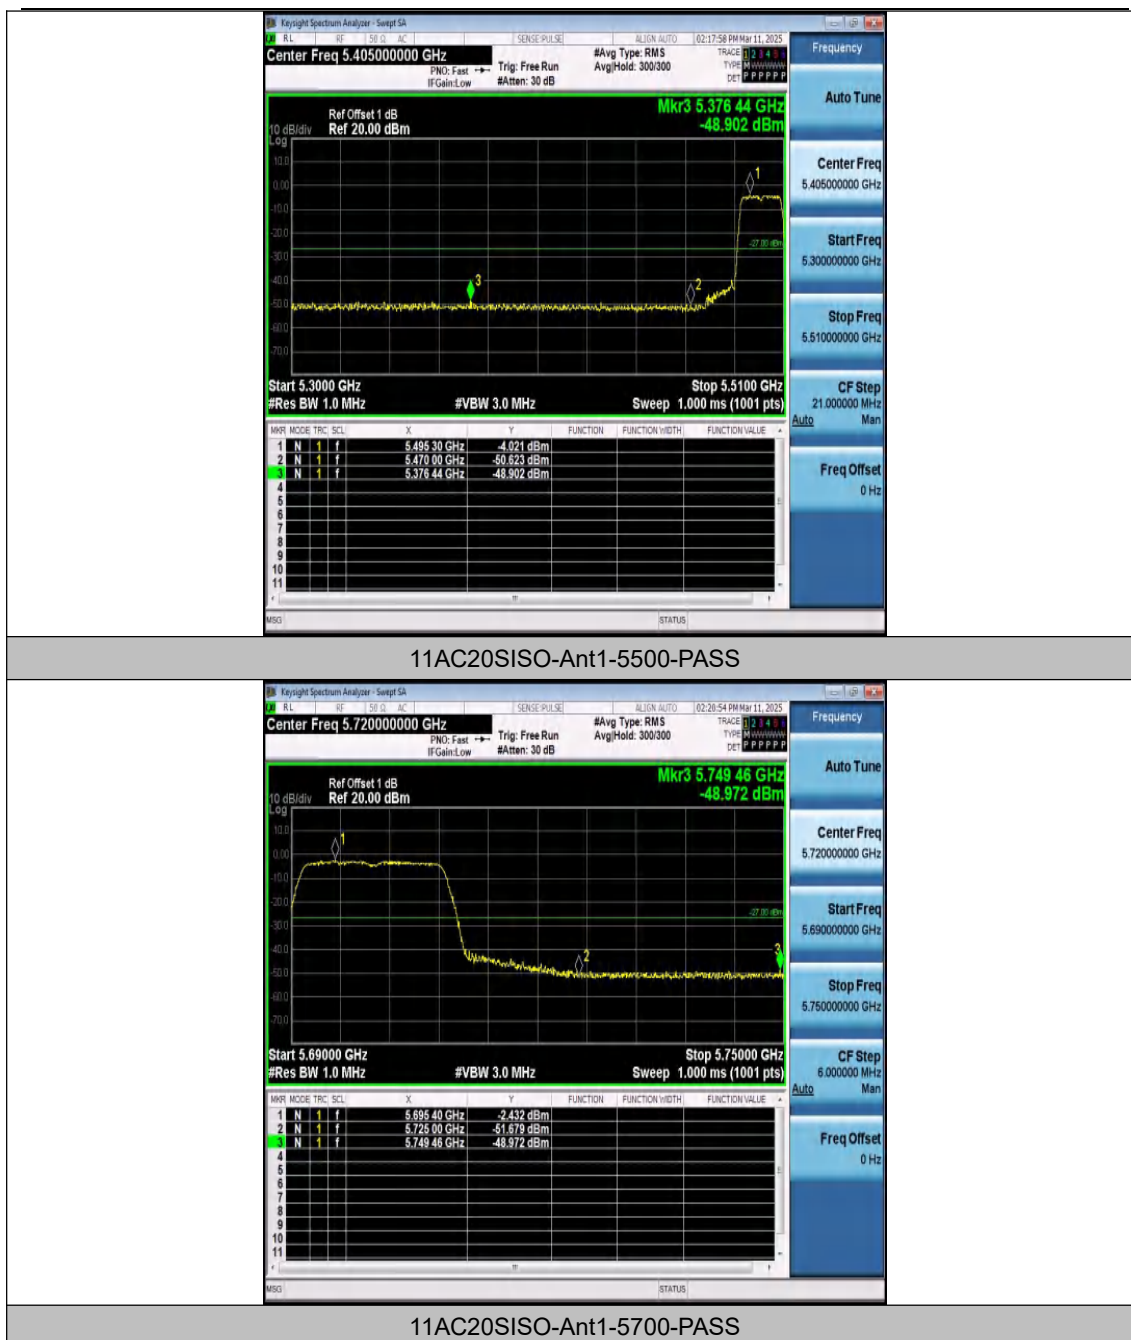

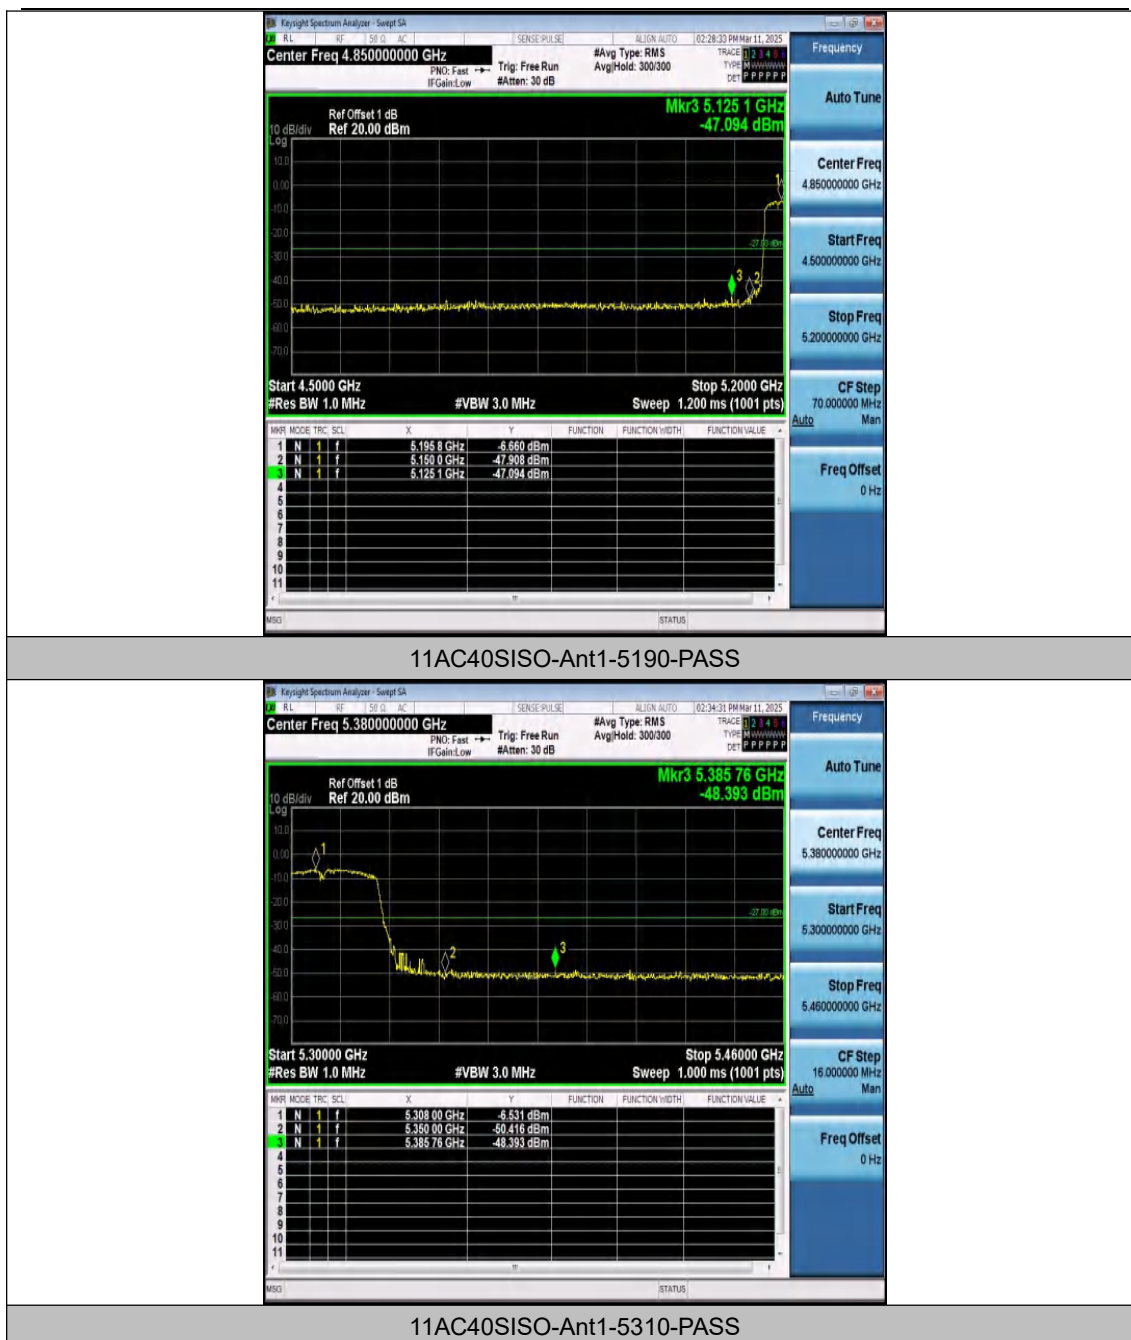


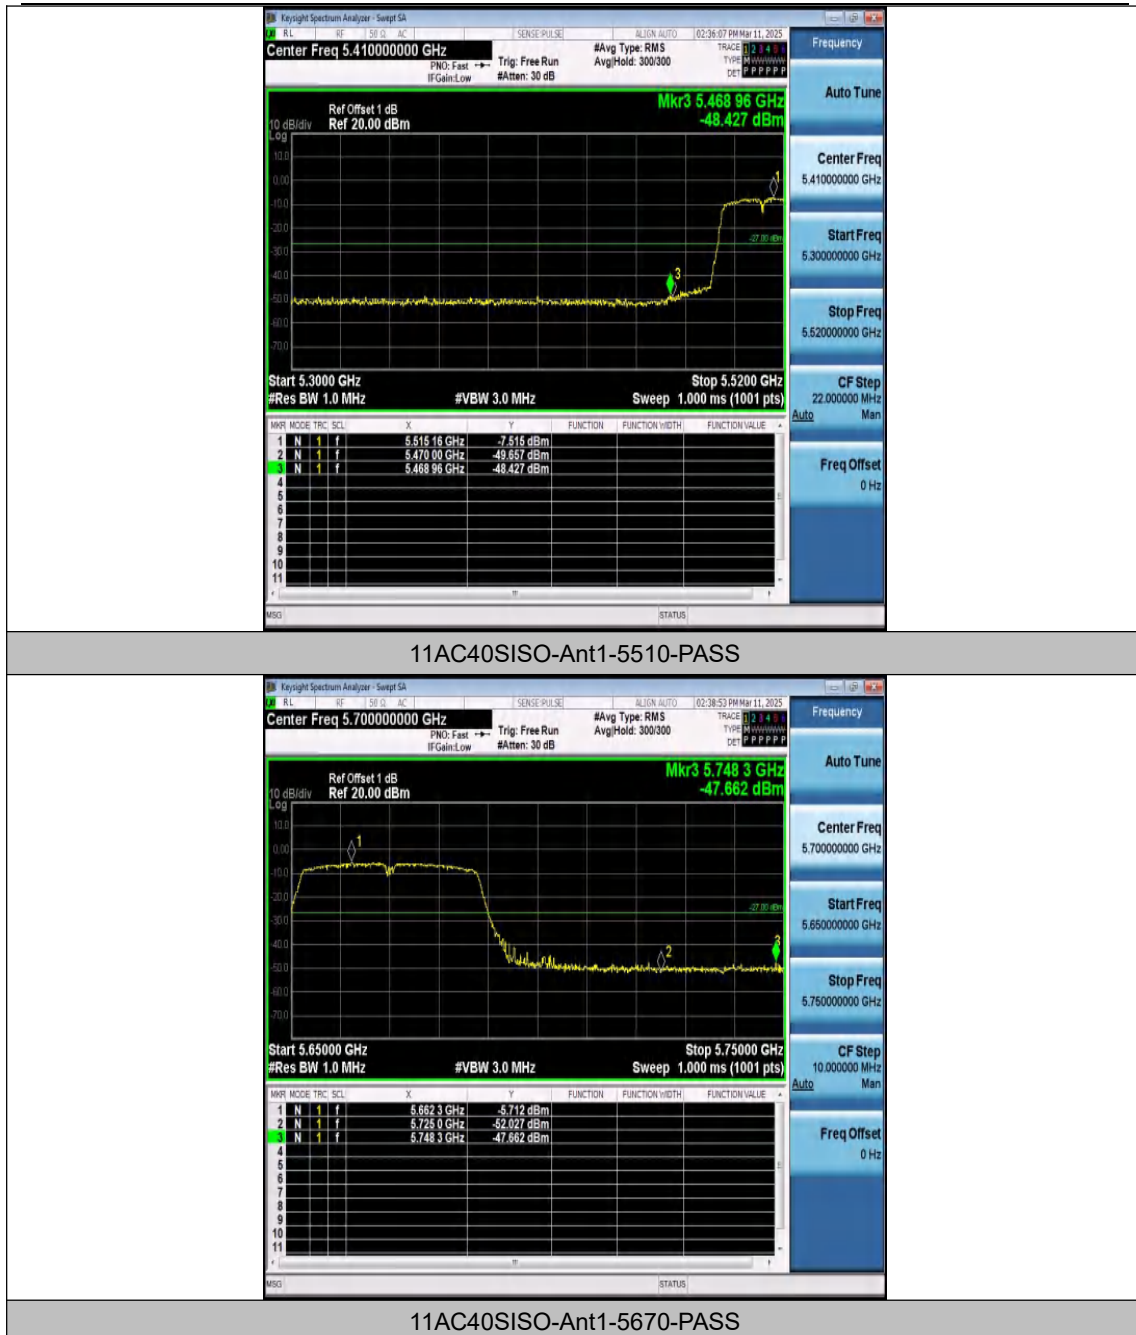


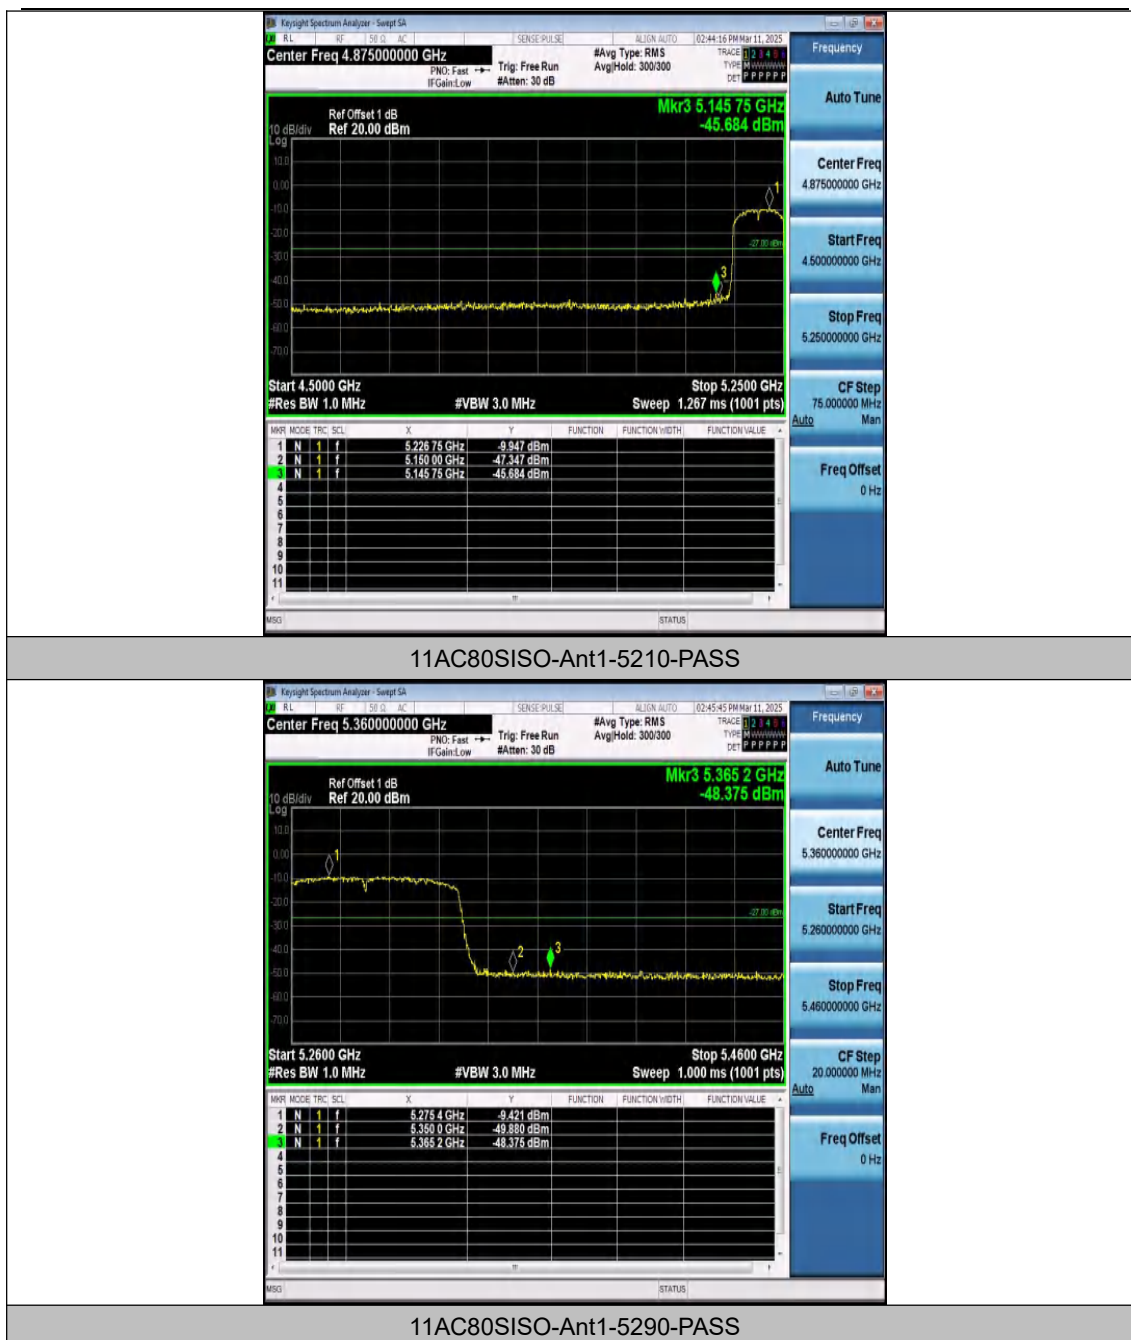


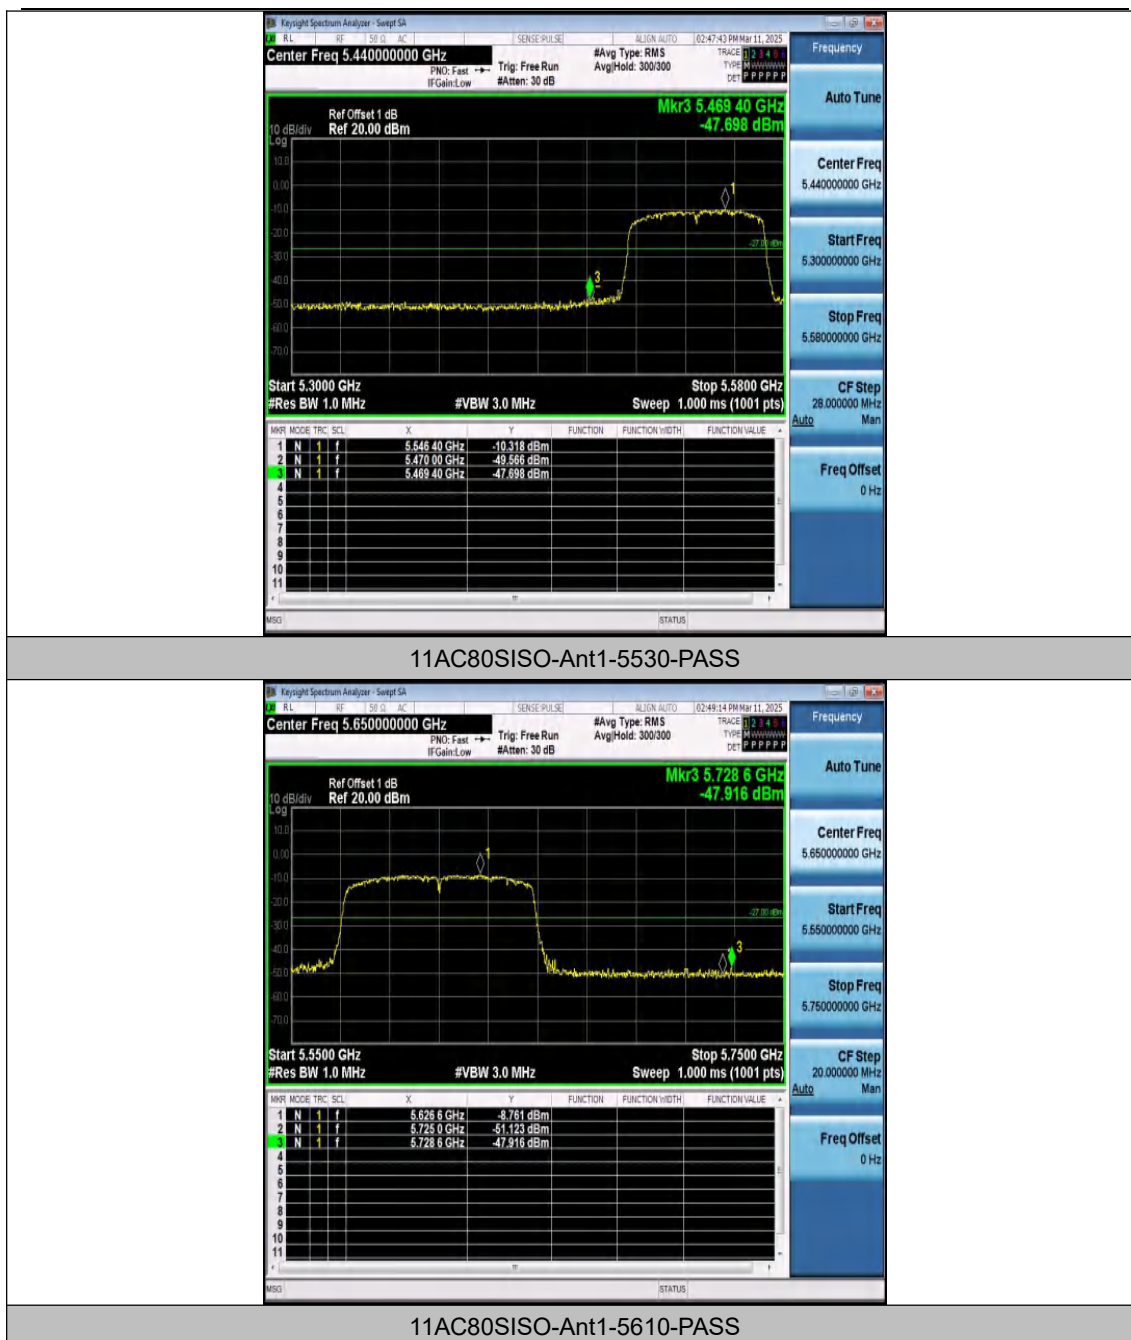



Test Graphs B4

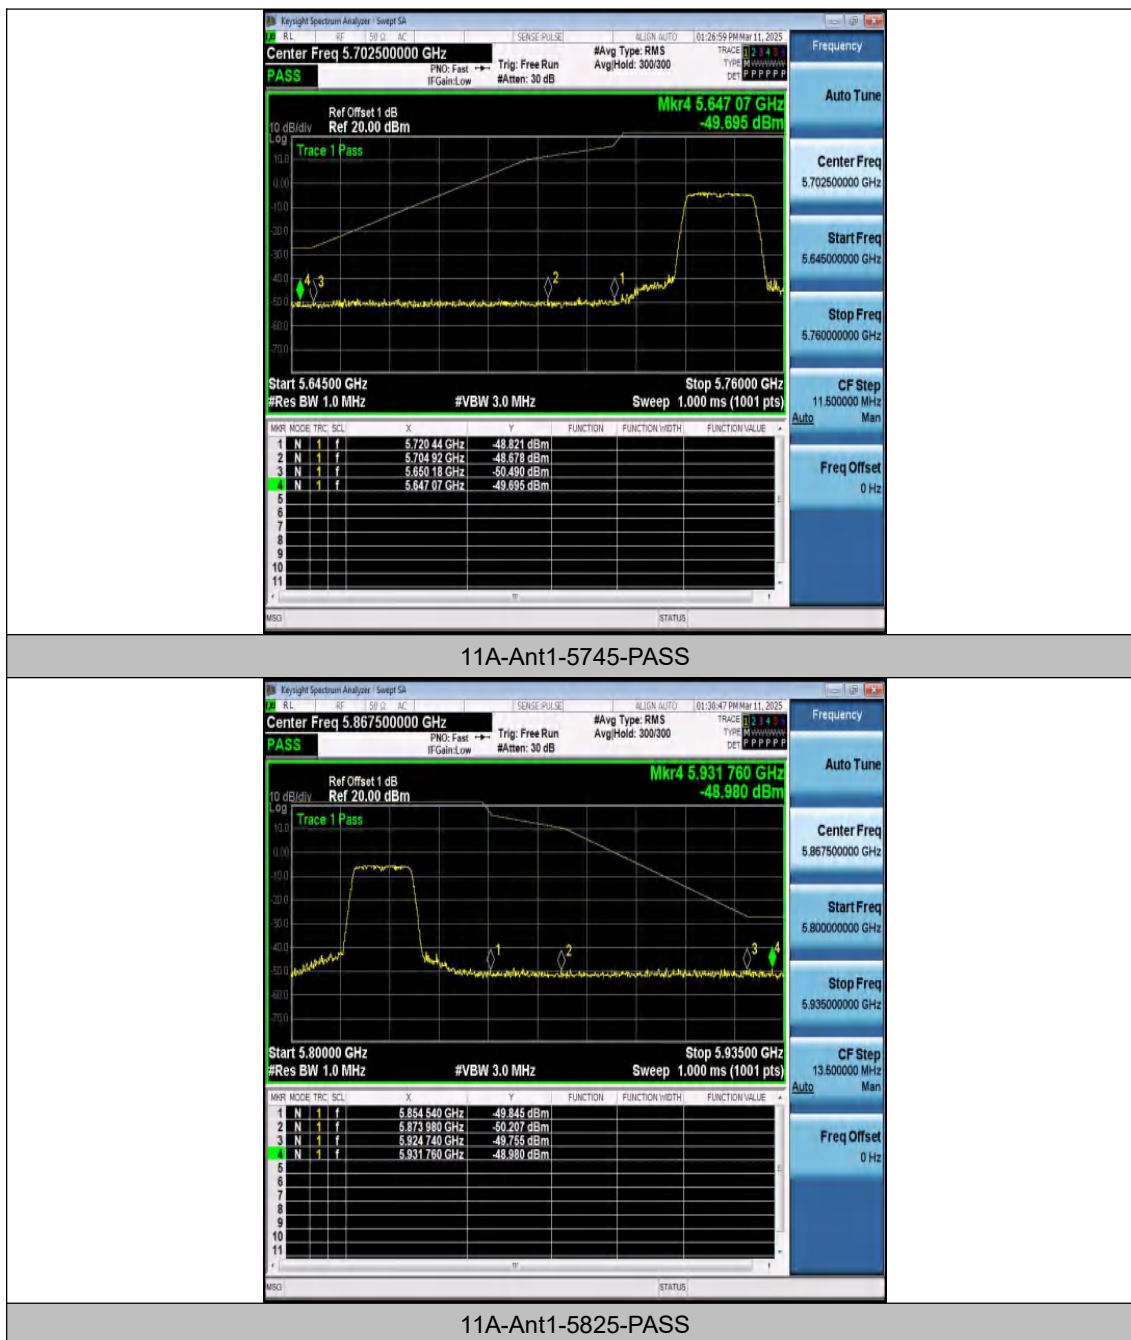


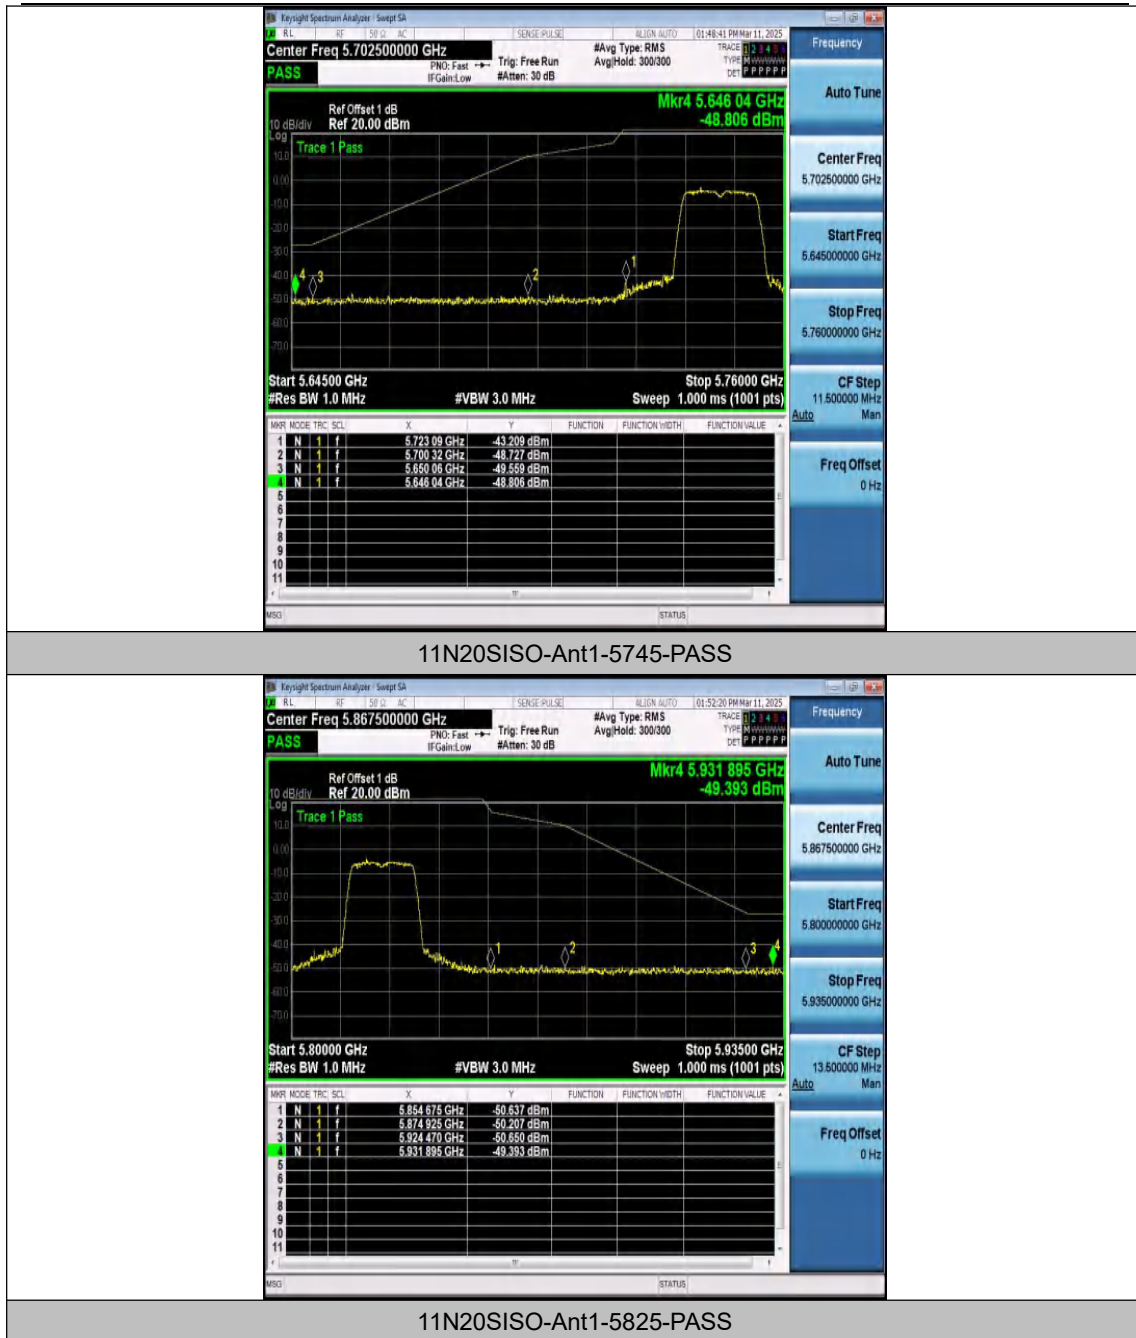

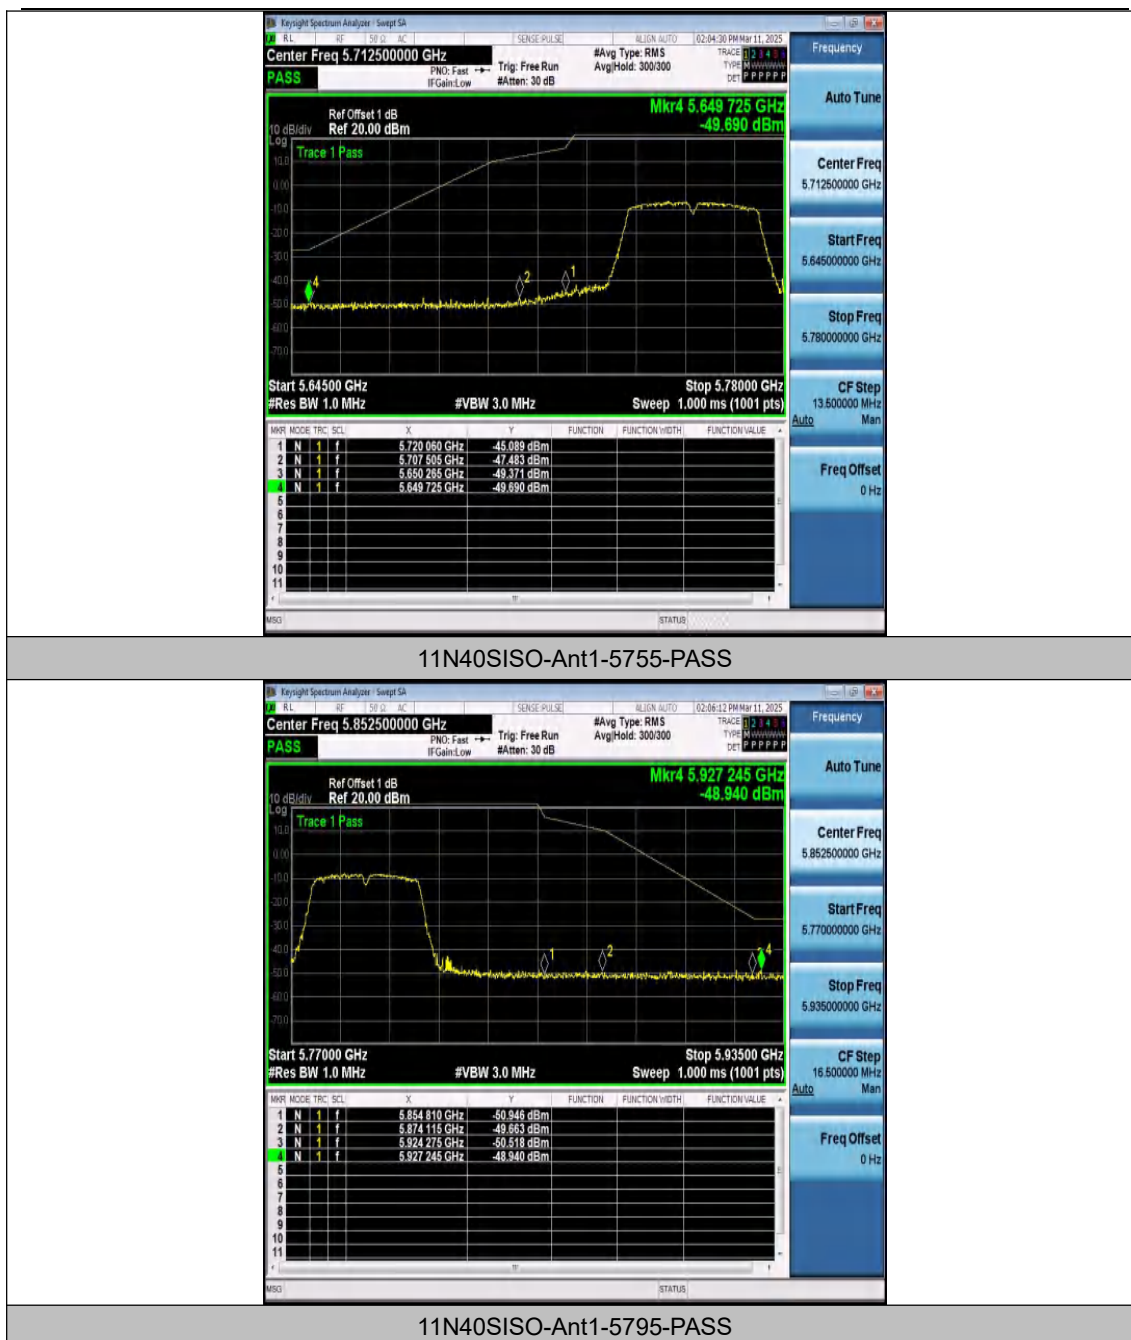

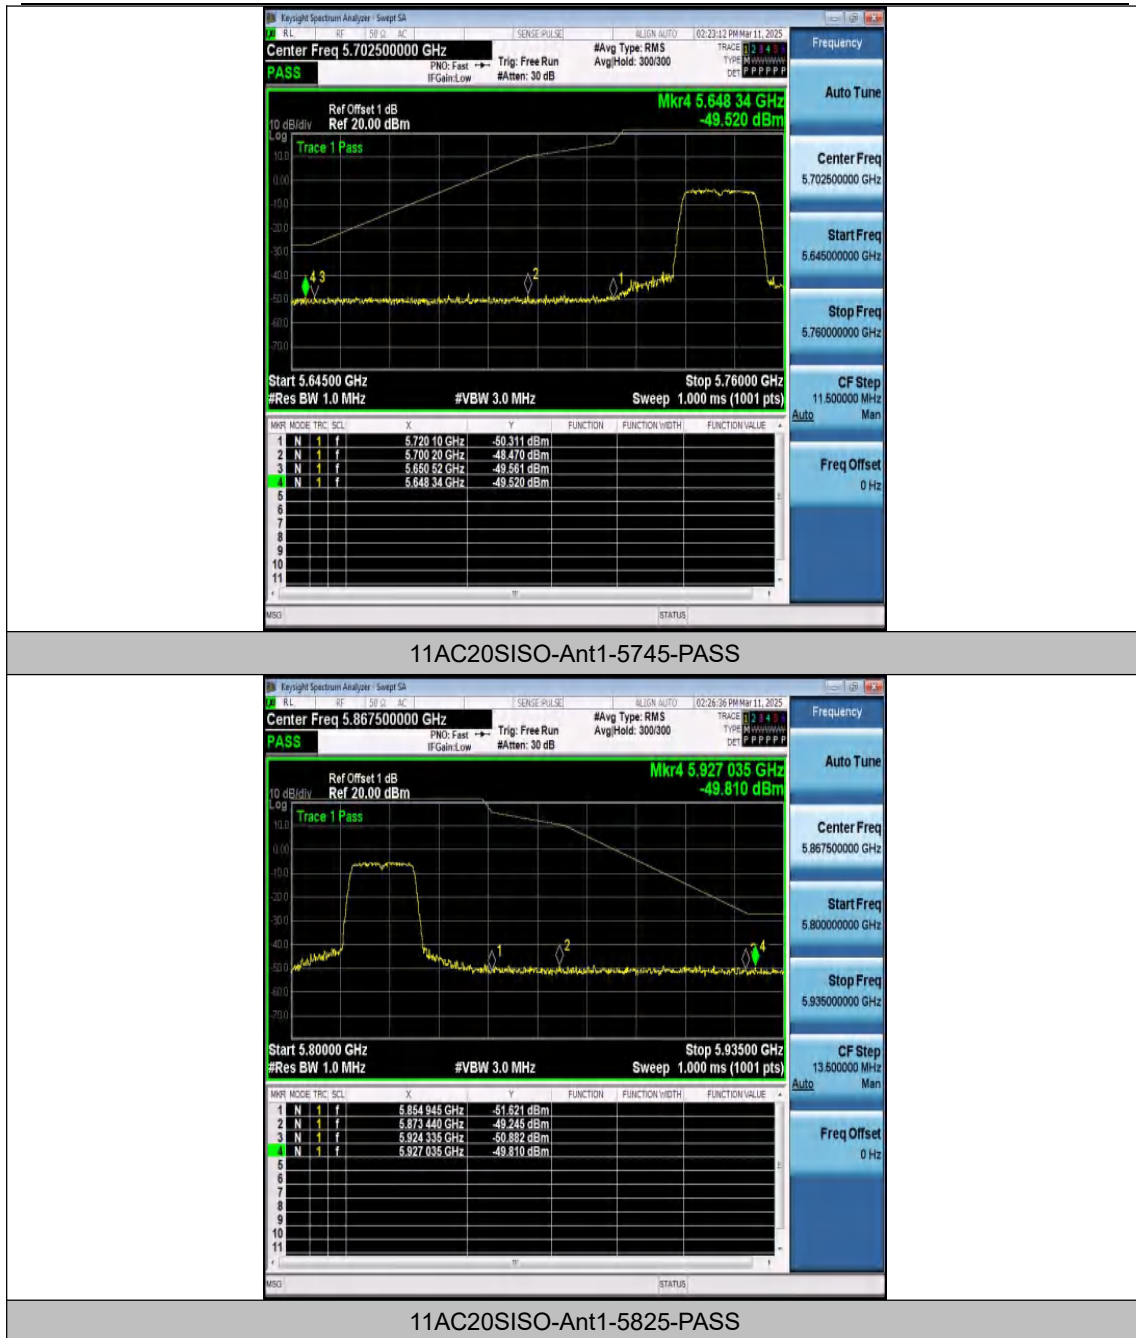

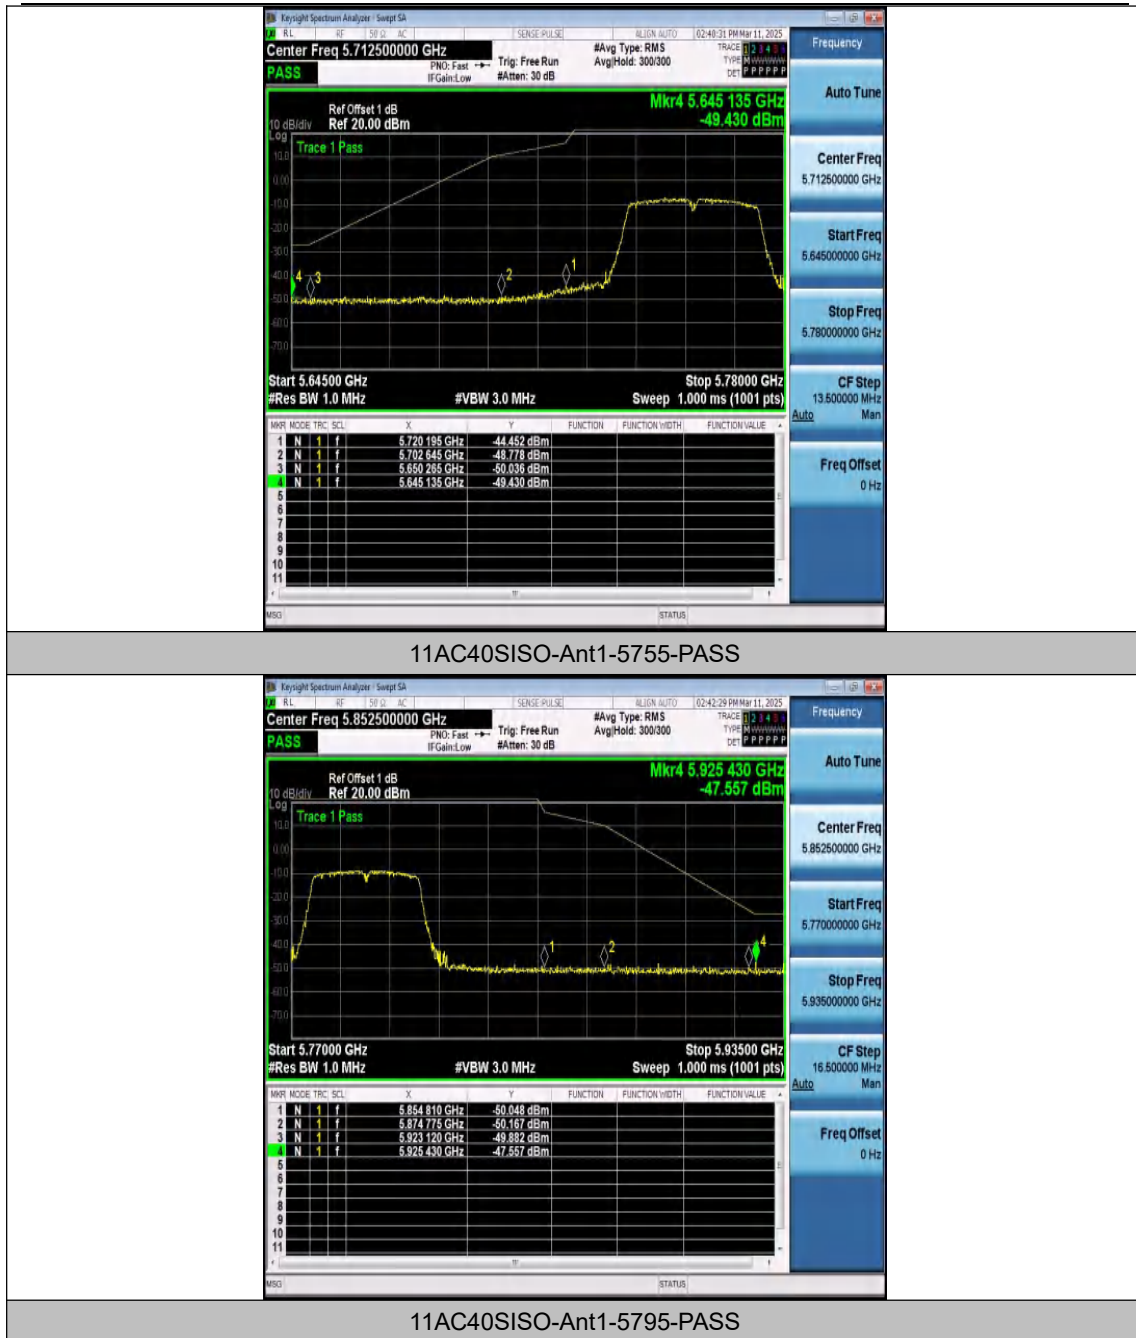

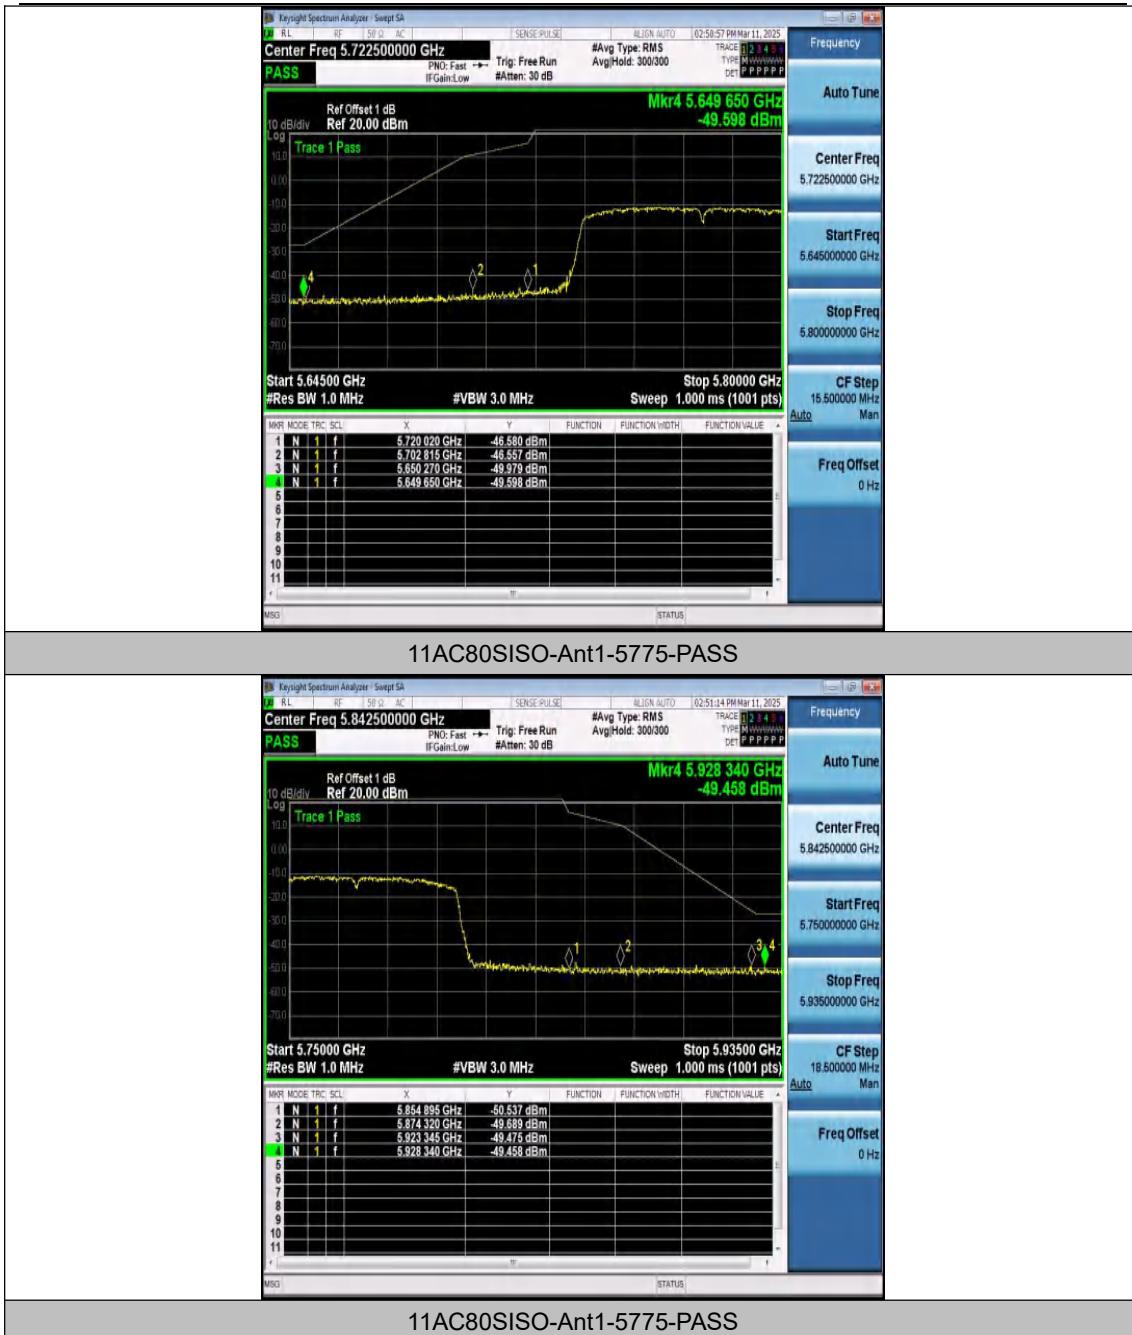


Appendix F: DFS Detection Thresholds

Test Result

TestMode	Frequency[MHz]	Radar Type	Result[dBm]	Limit[dBm]	Verdict
11AC80SISO	5290	Type0	-62.12	-62.00	PASS
	5610	Type0	-62.04	-62.00	PASS

Test Graphs

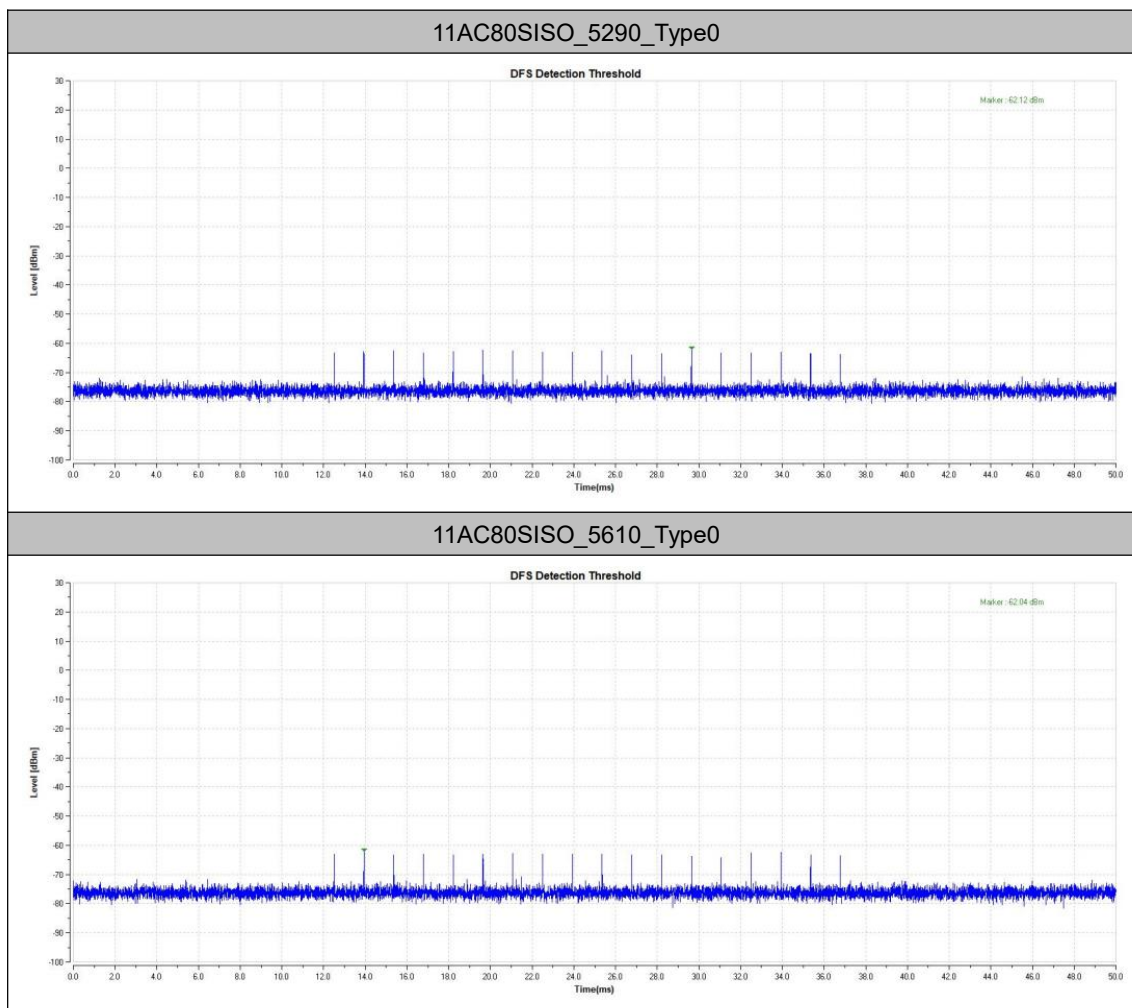


Appendix G: Channel Move Time and Channel Closing

Transmission Time

Test Result

TestMode	Frequency[MHz]	CCT[ms]	Limit[ms]	CMT[ms]	Limit[ms]	Verdict
11AC80SISO	5290	200+3.9	200+60	456.0	10000	PASS
11AC80SISO	5610	200+6.5	200+60	476.8	10000	PASS

Test Graphs

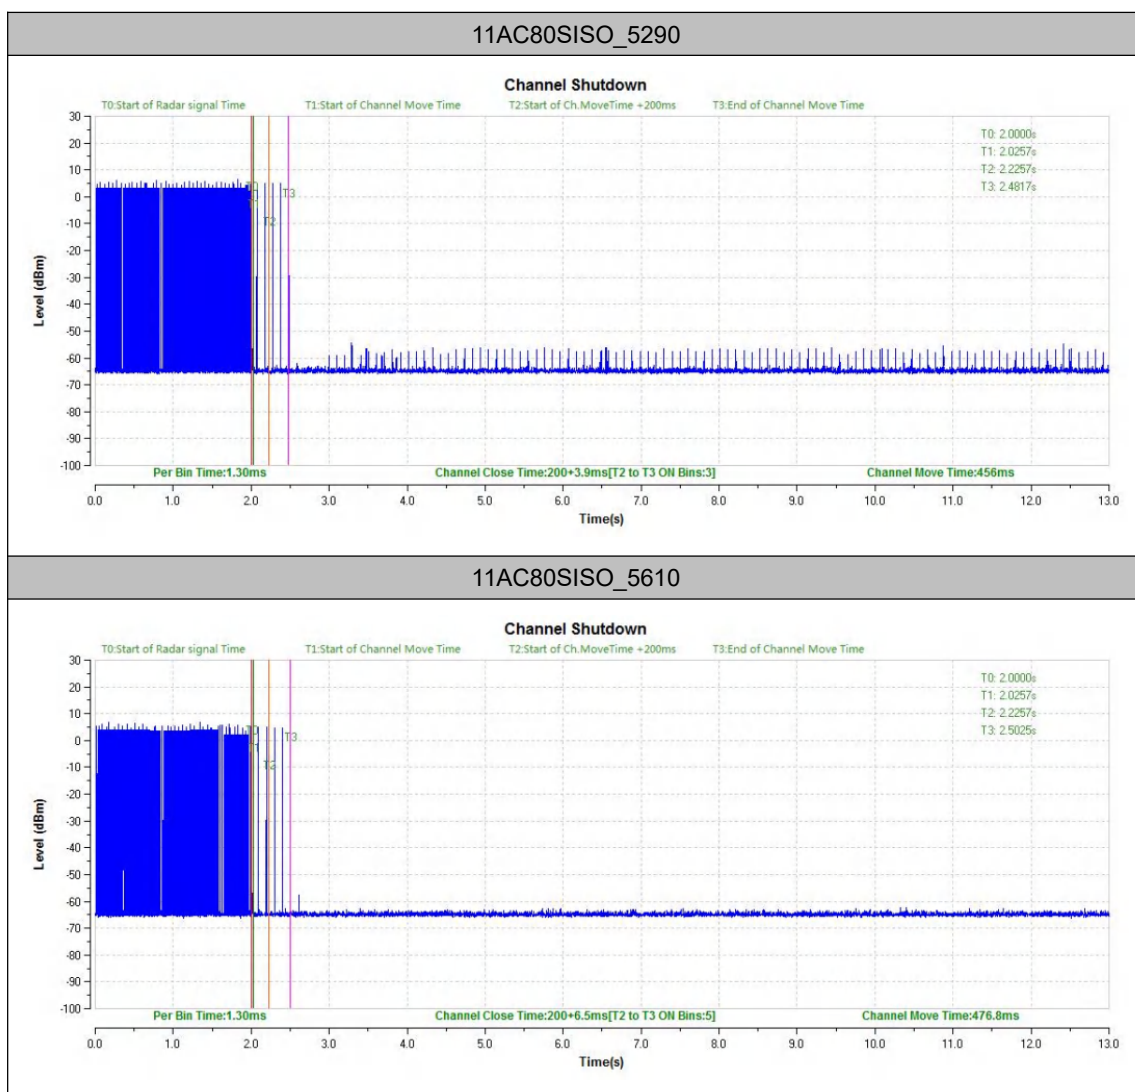

---End---