




Test report No. : 4790042400-US-R1-V0
Page : 170 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

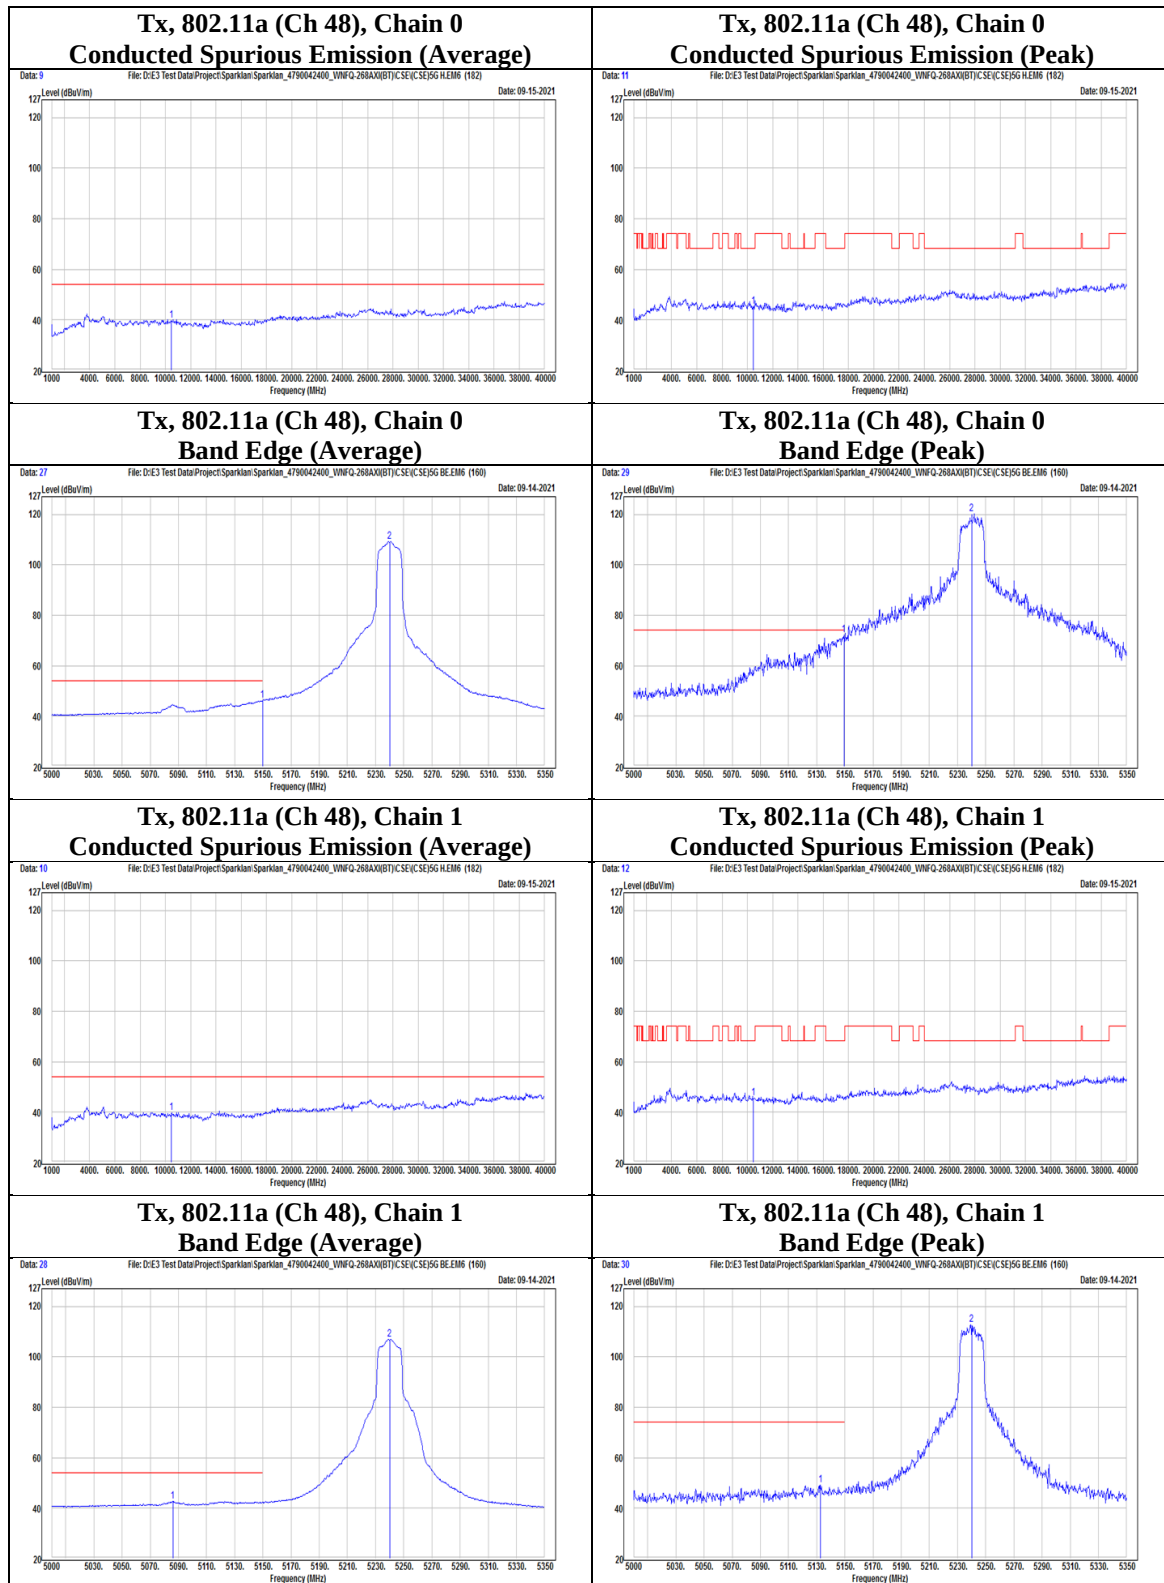

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 171 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11a	Channel	52
------	---------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	5260	130.46	-11.74	118.72	N/A	N/A	PK
	@	5260	121.24	-11.74	109.5	N/A	N/A	AVG
		5363.4	64.33	-11.74	52.59	74	-21.41	PK
		5379	54.28	-11.74	42.54	54	-11.46	AVG
		10520	57.99	-11.74	46.25	68.2	-21.95	PK
		10520	50.86	-11.74	39.12	54	-14.88	AVG
Chain 1	@	5260	129.44	-11.74	117.7	N/A	N/A	PK
	@	5260	119.59	-11.74	107.85	N/A	N/A	AVG
		5350.2	56.14	-11.74	44.4	54	-9.6	AVG
		5351.1	77.12	-11.74	65.38	74	-8.62	PK
		10520	57.62	-11.74	45.88	68.2	-22.32	PK
		10520	50.79	-11.74	39.05	54	-14.95	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 172 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

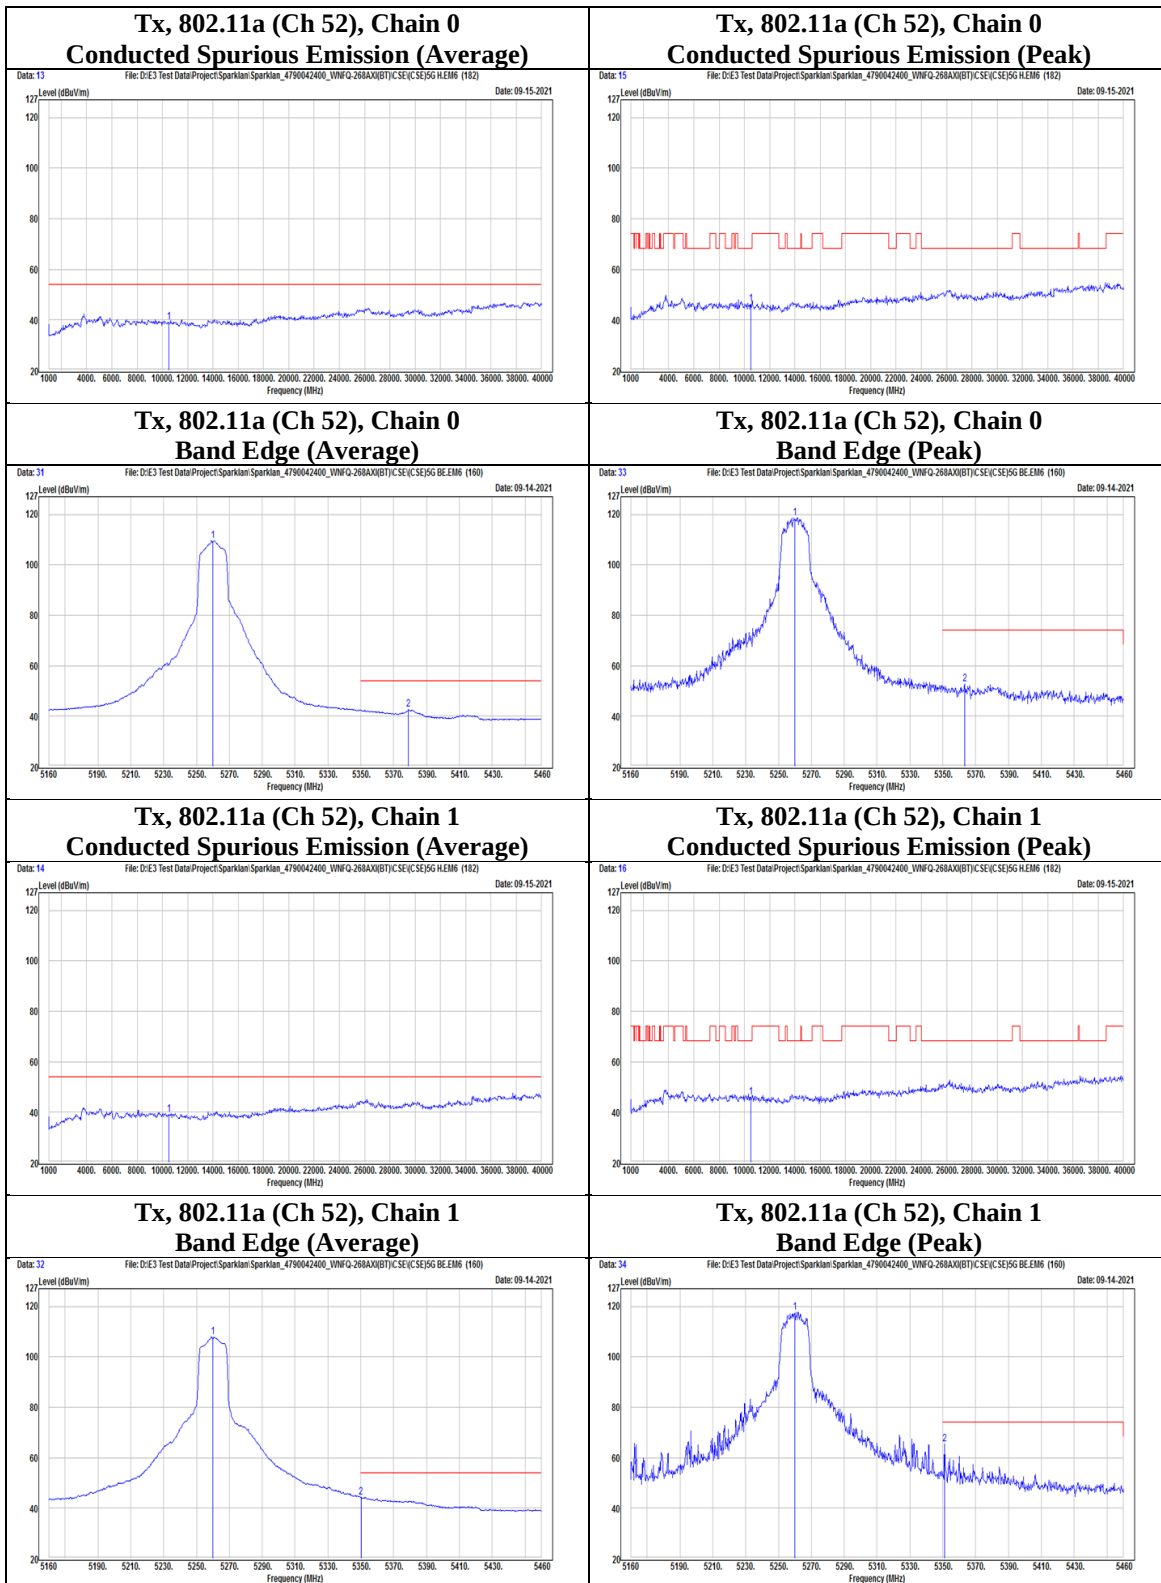

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 173 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11a	Channel	60
------	---------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	5300	130.01	-11.74	118.27	N/A	N/A	PK
	@	5300	119.5	-11.74	107.76	N/A	N/A	AVG
		5350.2	64.67	-11.74	52.93	54	-1.07	AVG
		5362.8	77.76	-11.74	66.02	74	-7.98	PK
		10600	57.27	-11.74	45.53	68.2	-22.67	PK
		10600	50.45	-11.74	38.71	54	-15.29	AVG
Chain 1	@	5300	129.12	-11.74	117.38	N/A	N/A	PK
	@	5300	119.89	-11.74	108.15	N/A	N/A	AVG
		5350.2	64.69	-11.74	52.95	54	-1.05	AVG
		5352.3	78.28	-11.74	66.54	74	-7.46	PK
		10600	57.82	-11.74	46.08	68.2	-22.12	PK
		10600	50.92	-11.74	39.18	54	-14.82	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 174 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

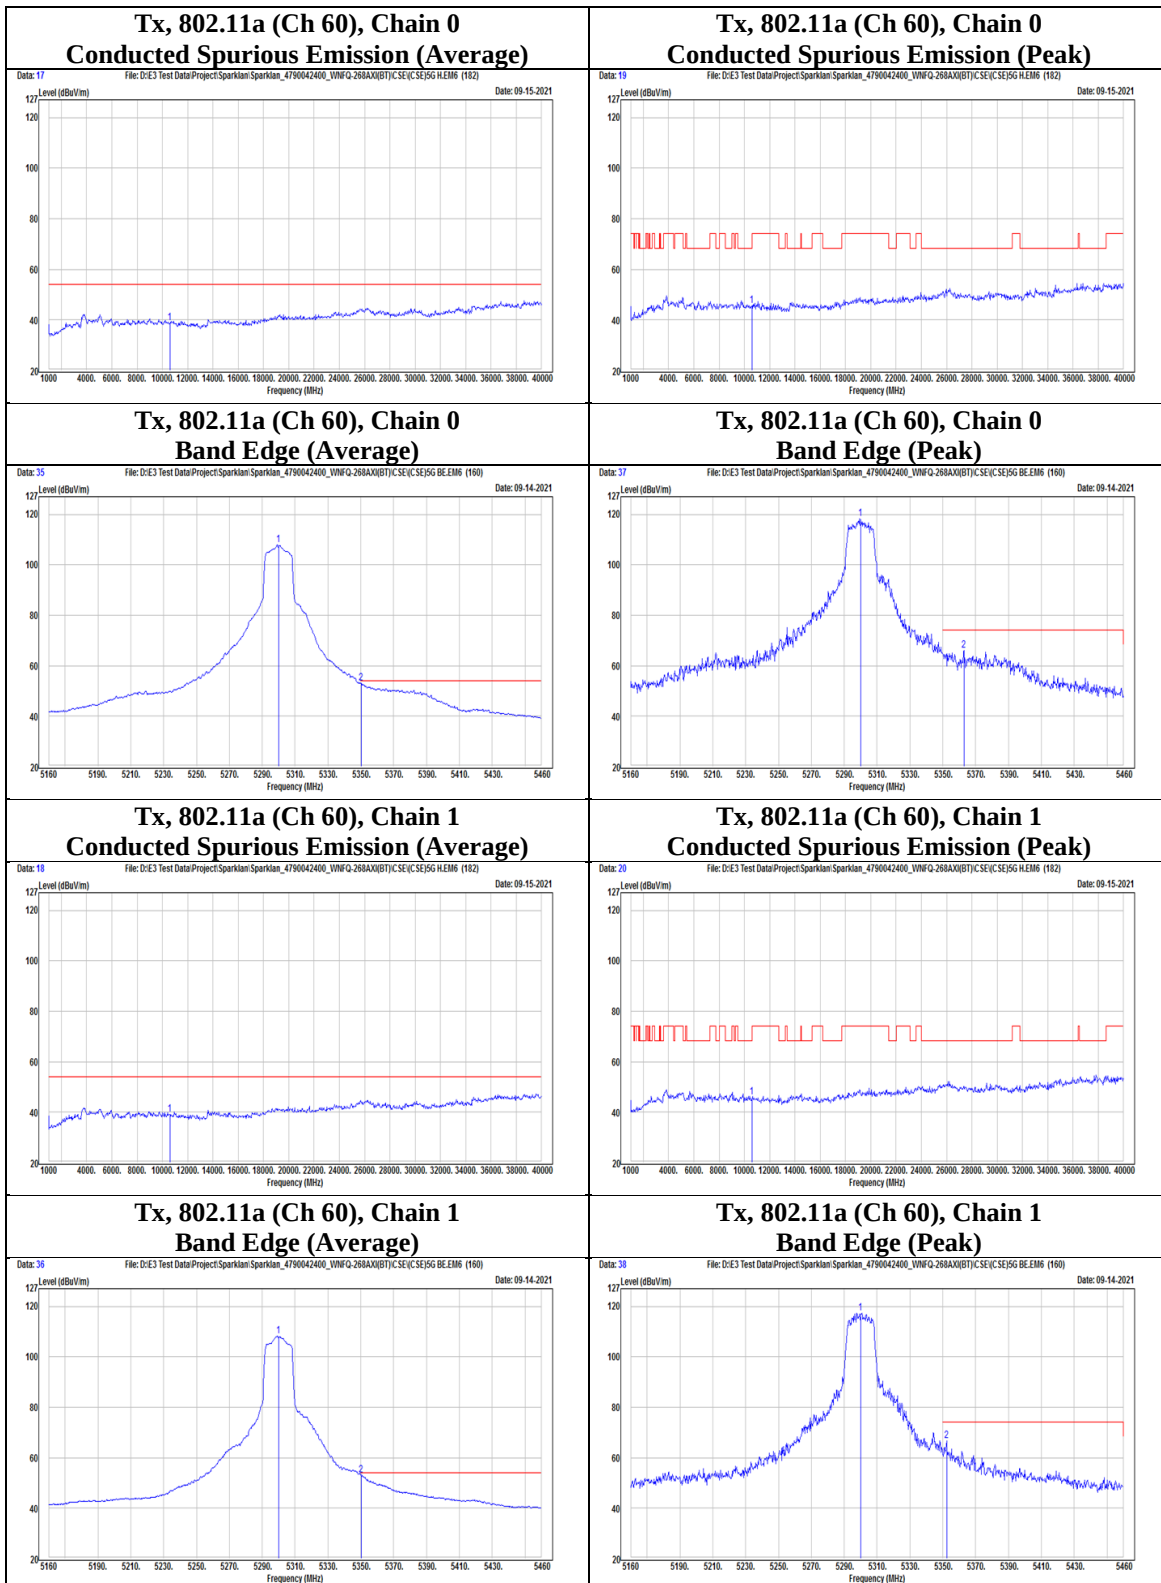

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 175 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11a	Channel	64
------	---------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	5320	127.35	-11.74	115.61	N/A	N/A	PK
	@	5320	118.29	-11.74	106.55	N/A	N/A	AVG
		5351.1	61.66	-11.74	49.92	54	-4.08	AVG
		5352.3	73.14	-11.74	61.4	74	-12.6	PK
		10640	57.63	-11.74	45.89	74	-28.11	PK
		10640	50.63	-11.74	38.89	54	-15.11	AVG
Chain 1	@	5320	127.52	-11.74	115.78	N/A	N/A	PK
	@	5320	118.14	-11.74	106.4	N/A	N/A	AVG
		5350.2	75.08	-11.74	63.34	74	-10.66	PK
		5350.2	64.54	-11.74	52.8	54	-1.2	AVG
		10640	59.2	-11.74	47.46	74	-26.54	PK
		10640	51.05	-11.74	39.31	54	-14.69	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 176 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

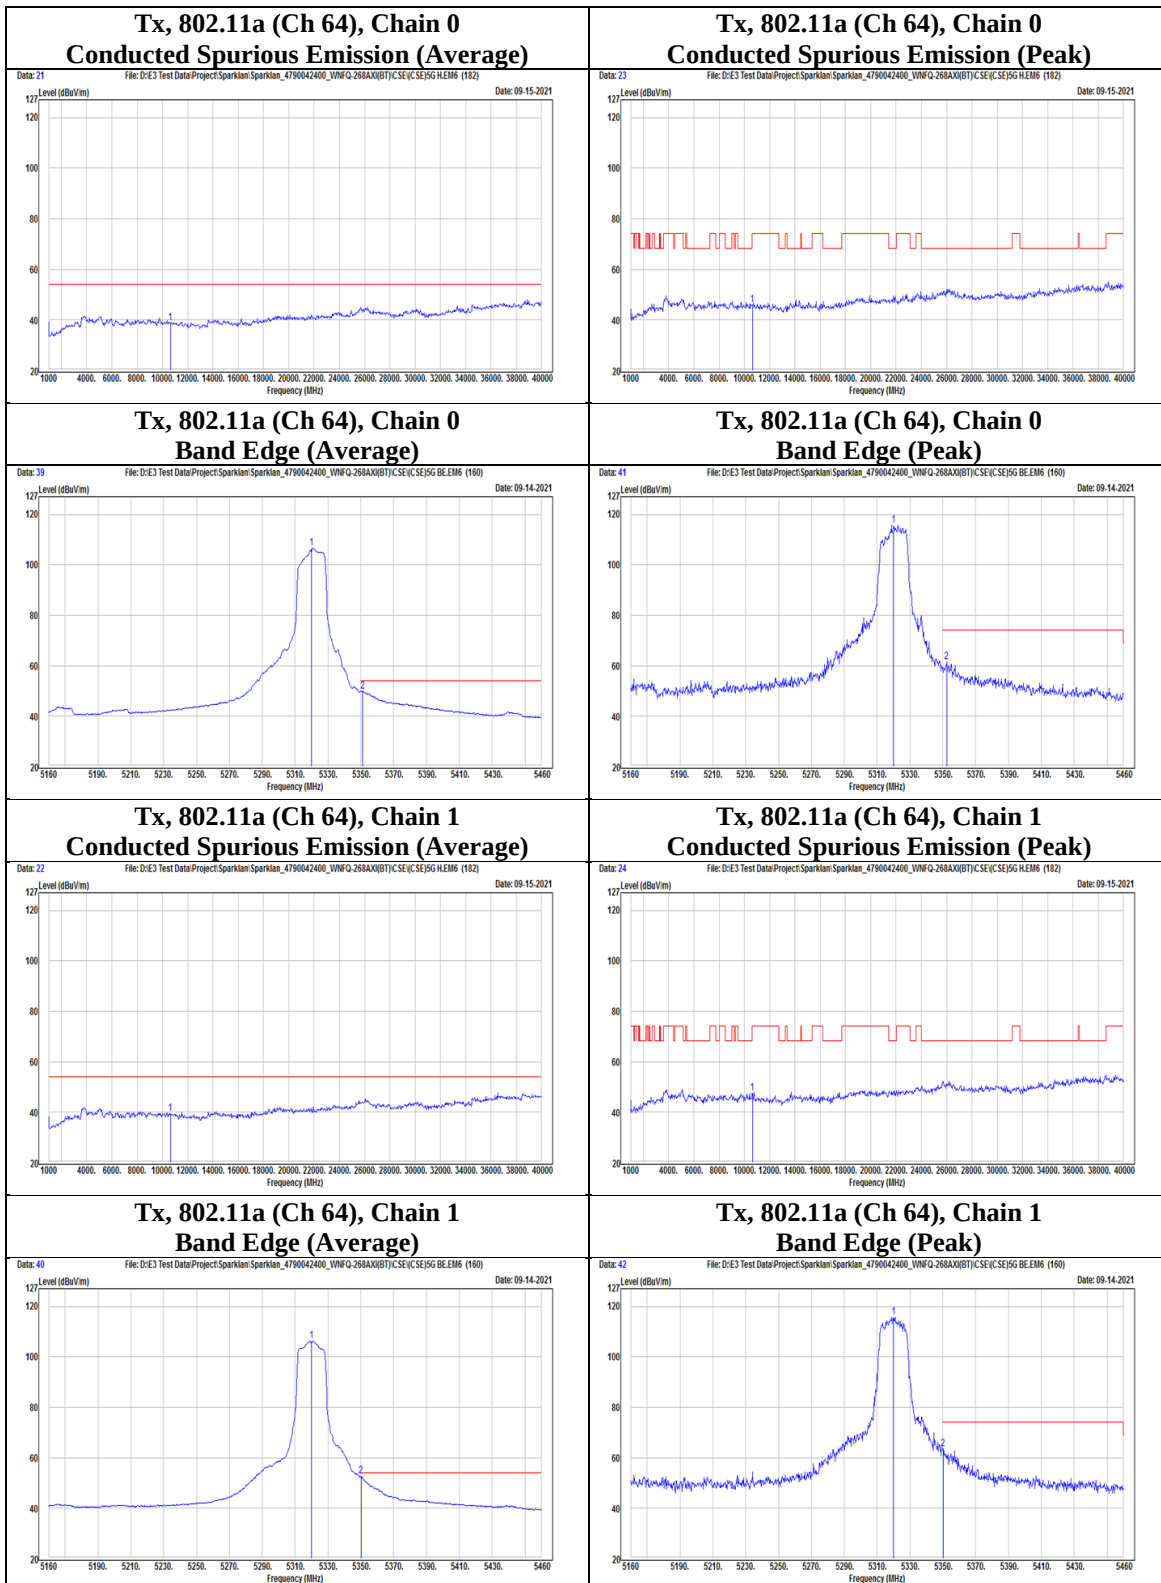

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 177 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11a	Channel	100
------	---------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5456.35	72.09	-11.74	60.35	74	-13.65	PK
		5456.35	61.59	-11.74	49.85	54	-4.15	AVG
		5468.25	78.25	-11.74	66.51	68.2	-1.69	PK
	@	5500	126.97	-11.74	115.23	N/A	N/A	PK
	@	5500	118.53	-11.74	106.79	N/A	N/A	AVG
		11000	58.89	-11.74	47.15	74	-26.85	PK
		11000	50.41	-11.74	38.67	54	-15.33	AVG
Chain 1		5455.65	70.62	-11.74	58.88	74	-15.12	PK
		5456.35	58.98	-11.74	47.24	54	-6.76	AVG
		5469.65	78.64	-11.74	66.9	68.2	-1.3	PK
	@	5500	127.23	-11.74	115.49	N/A	N/A	PK
	@	5500	118.92	-11.74	107.18	N/A	N/A	AVG
		11000	57.81	-11.74	46.07	74	-27.93	PK
		11000	51.01	-11.74	39.27	54	-14.73	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 178 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

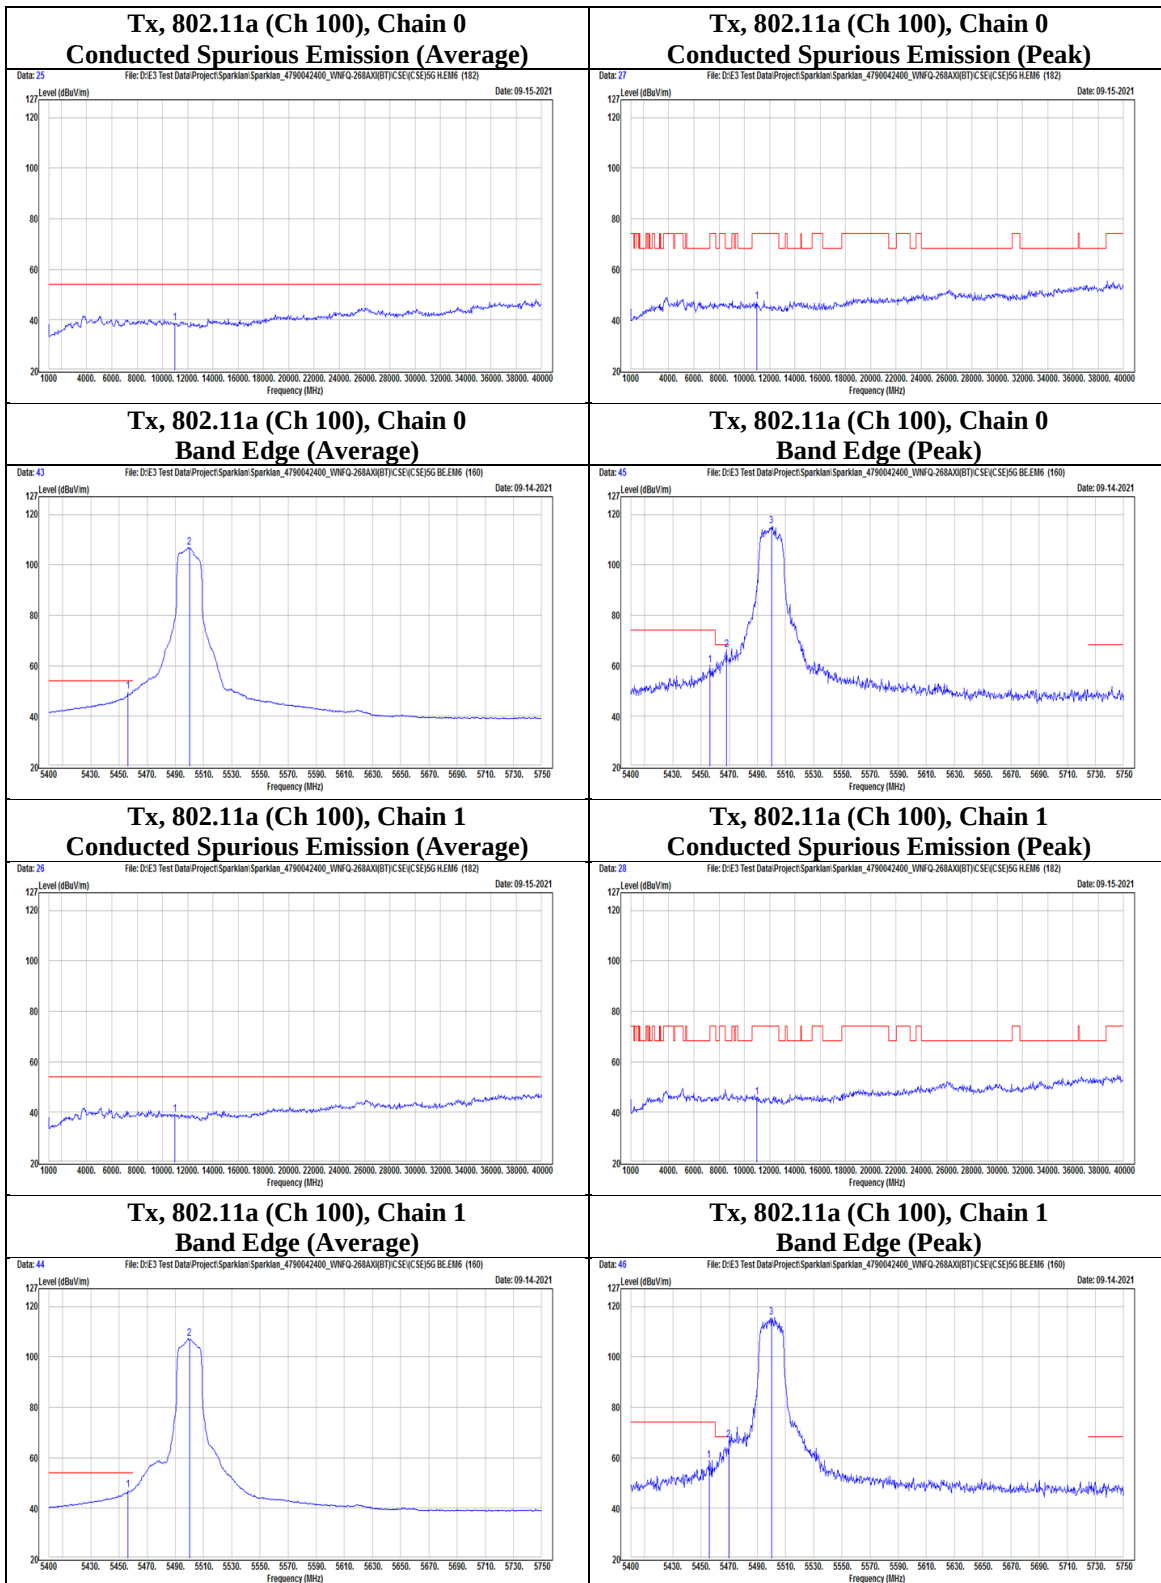

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 179 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11a	Channel	116
------	---------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5440.6	57.48	-11.74	45.74	54	-8.26	AVG
		5451.8	74.32	-11.74	62.58	74	-11.42	PK
		5463.35	75.87	-11.74	64.13	68.2	-4.07	PK
	@	5580	130.87	-11.74	119.13	N/A	N/A	PK
	@	5580	122.78	-11.74	111.04	N/A	N/A	AVG
		5730.4	74.95	-11.74	63.21	68.2	-4.99	PK
		11160	56.48	-11.74	44.74	74	-29.26	PK
		11160	50.5	-11.74	38.76	54	-15.24	AVG
		5440.6	70.52	-11.74	58.78	74	-15.22	PK
Chain 1		5440.6	57.98	-11.74	46.24	54	-7.76	AVG
		5470	72.83	-11.74	61.09	68.2	-7.11	PK
	@	5580	129.73	-11.74	117.99	N/A	N/A	PK
	@	5580	121.88	-11.74	110.14	N/A	N/A	AVG
		5725	69.79	-11.74	58.05	68.2	-10.15	PK
		11160	56.23	-11.74	44.49	74	-29.51	PK
		11160	50.41	-11.74	38.67	54	-15.33	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 180 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

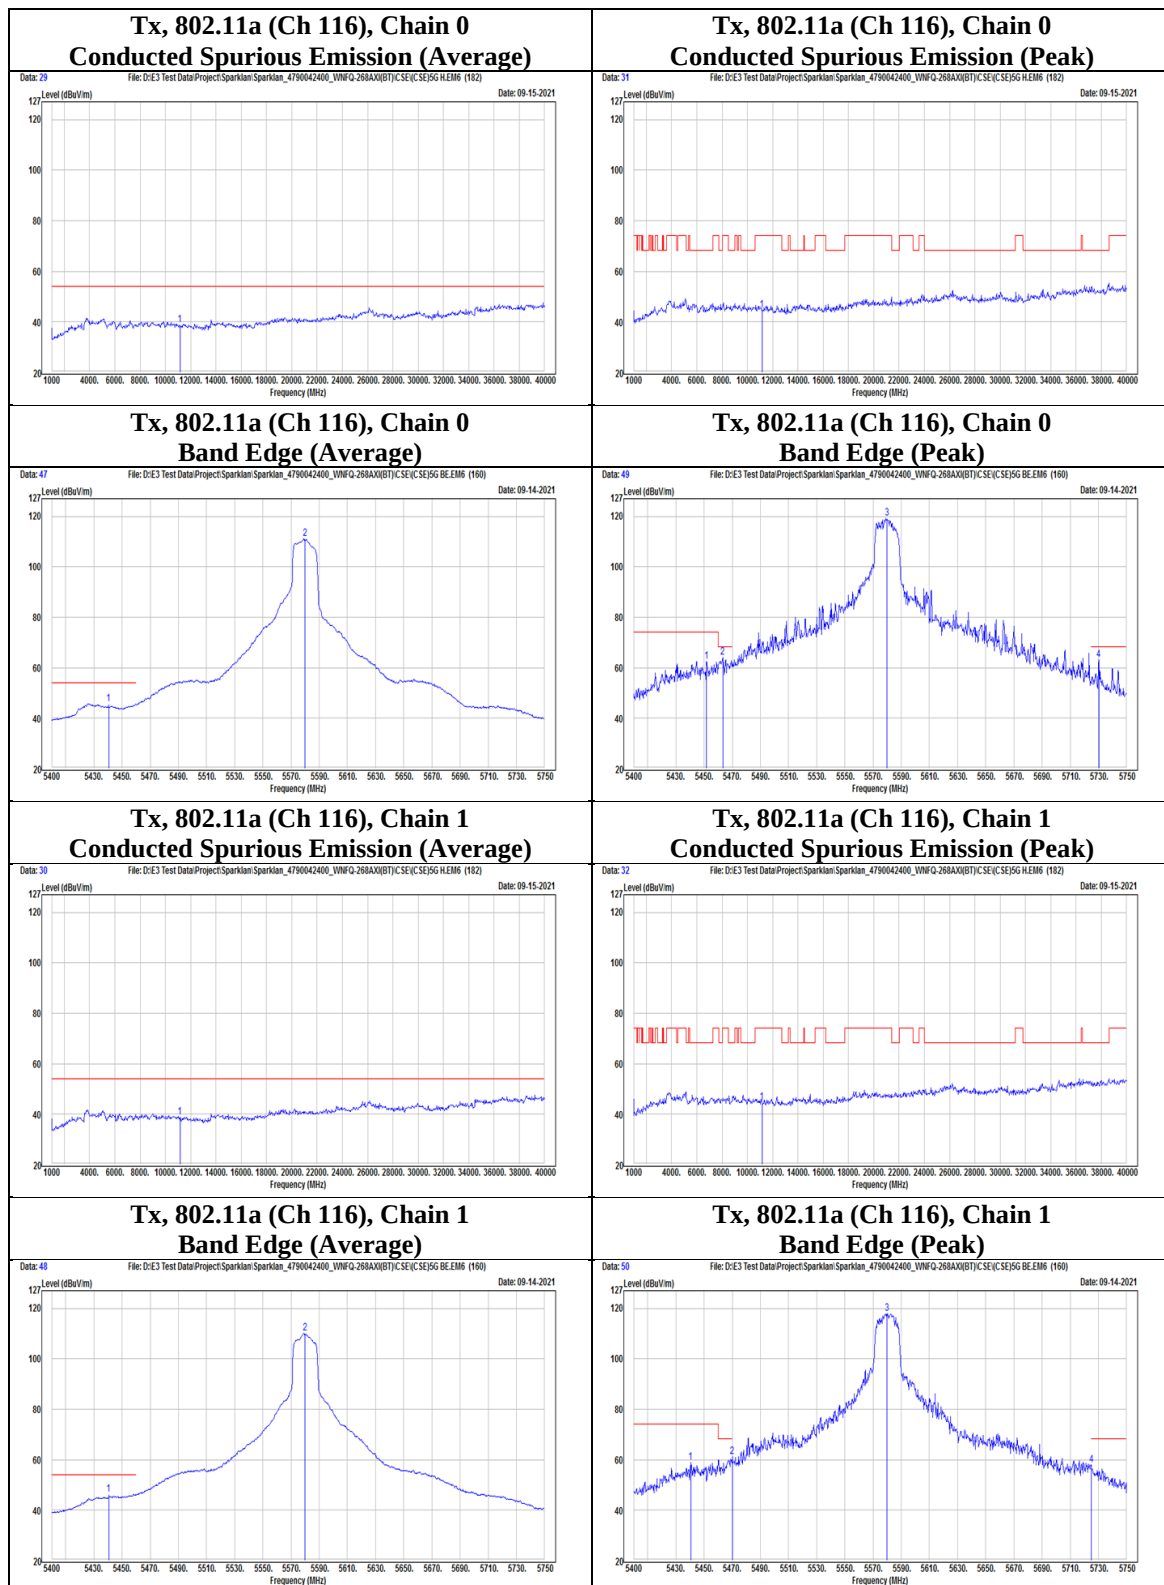

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 181 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11a	Channel	140
------	---------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5453.2	62	-11.74	50.26	74	-23.74	PK
		5453.2	51.24	-11.74	39.5	54	-14.5	AVG
		5464.05	63.84	-11.74	52.1	68.2	-16.1	PK
	@	5700	126.74	-11.74	115	N/A	N/A	PK
	@	5700	118.54	-11.74	106.8	N/A	N/A	AVG
		5726.55	69.37	-11.74	57.63	68.2	-10.57	PK
		11400	57.11	-11.74	45.37	74	-28.63	PK
		11400	49.94	-11.74	38.2	54	-15.8	AVG
Chain 1		5440.6	61.51	-11.74	49.77	74	-24.23	PK
		5453.2	51.23	-11.74	39.49	54	-14.51	AVG
		5464.4	60.55	-11.74	48.81	68.2	-19.39	PK
	@	5700	127.35	-11.74	115.61	N/A	N/A	PK
	@	5700	118.52	-11.74	106.78	N/A	N/A	AVG
		5730.05	79.01	-11.74	67.27	68.2	-0.93	PK
		11400	57.3	-11.74	45.56	74	-28.44	PK
		11400	50.67	-11.74	38.93	54	-15.07	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 182 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

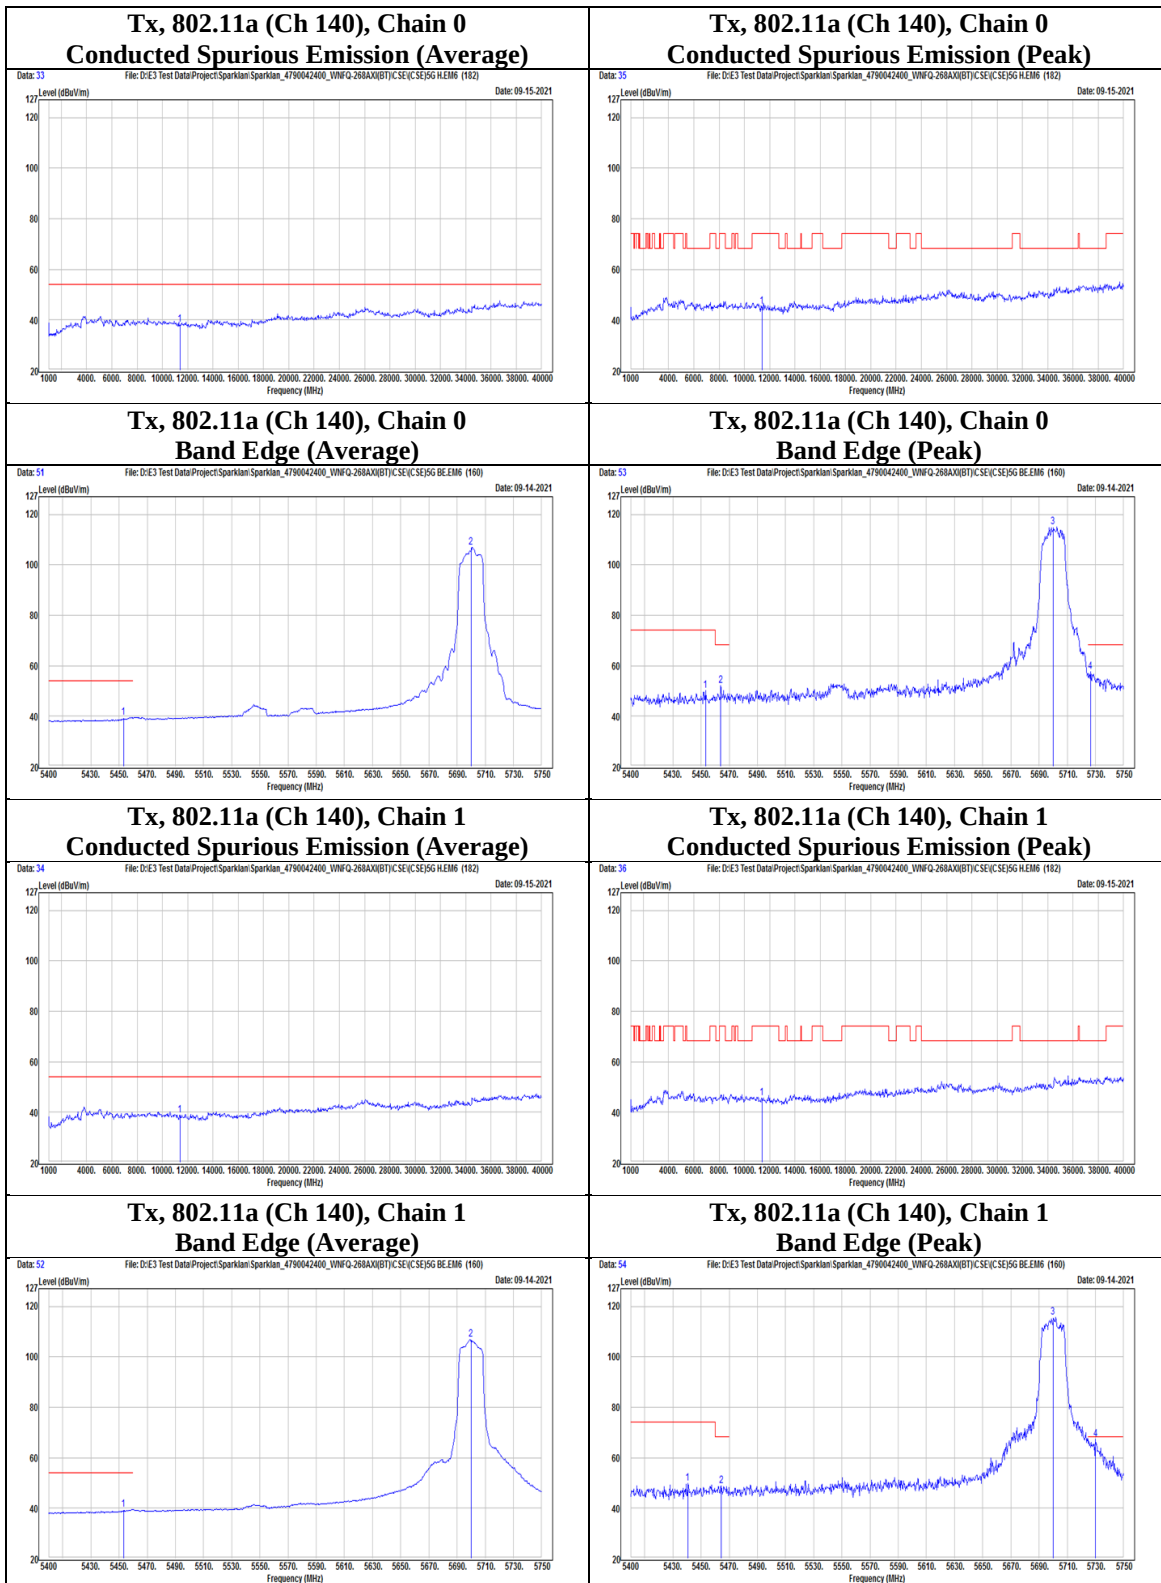

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 183 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXBT

Mode	802.11a	Channel	144
------	---------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		11440	57.61	-11.74	45.87	74	-28.13	PK
		11440	50.52	-11.74	38.78	54	-15.22	AVG
Chain 1		11440	56.47	-11.74	44.73	74	-29.27	PK
		11440	50.14	-11.74	38.4	54	-15.6	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 184 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXBT

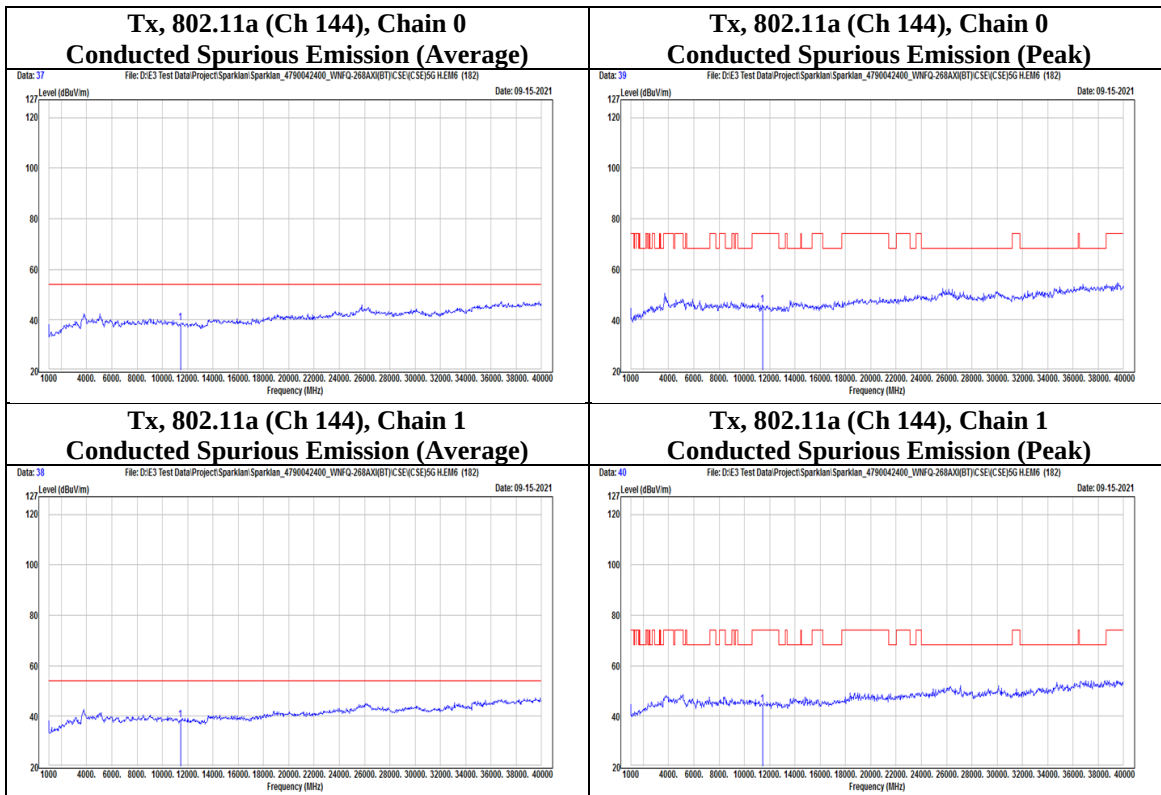

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 185 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11a	Channel	149
------	---------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5637	73.91	-11.74	62.17	68.2	-6.03	PK
		5687	84.21	-11.74	72.47	95.61	-23.14	PK
	@	5745	131.12	-11.74	119.38	N/A	N/A	PK
		11490	57.8	-11.74	46.06	74	-27.94	PK
		11490	51.75	-11.74	40.01	54	-13.99	AVG
Chain 1		5632	78.71	-11.74	66.97	68.2	-1.23	PK
		5699.5	91.63	-11.74	79.89	104.83	-24.94	PK
	@	5745	130.96	-11.74	119.22	N/A	N/A	PK
		11490	58	-11.74	46.26	74	-27.74	PK
		11490	51.61	-11.74	39.87	54	-14.13	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 186 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

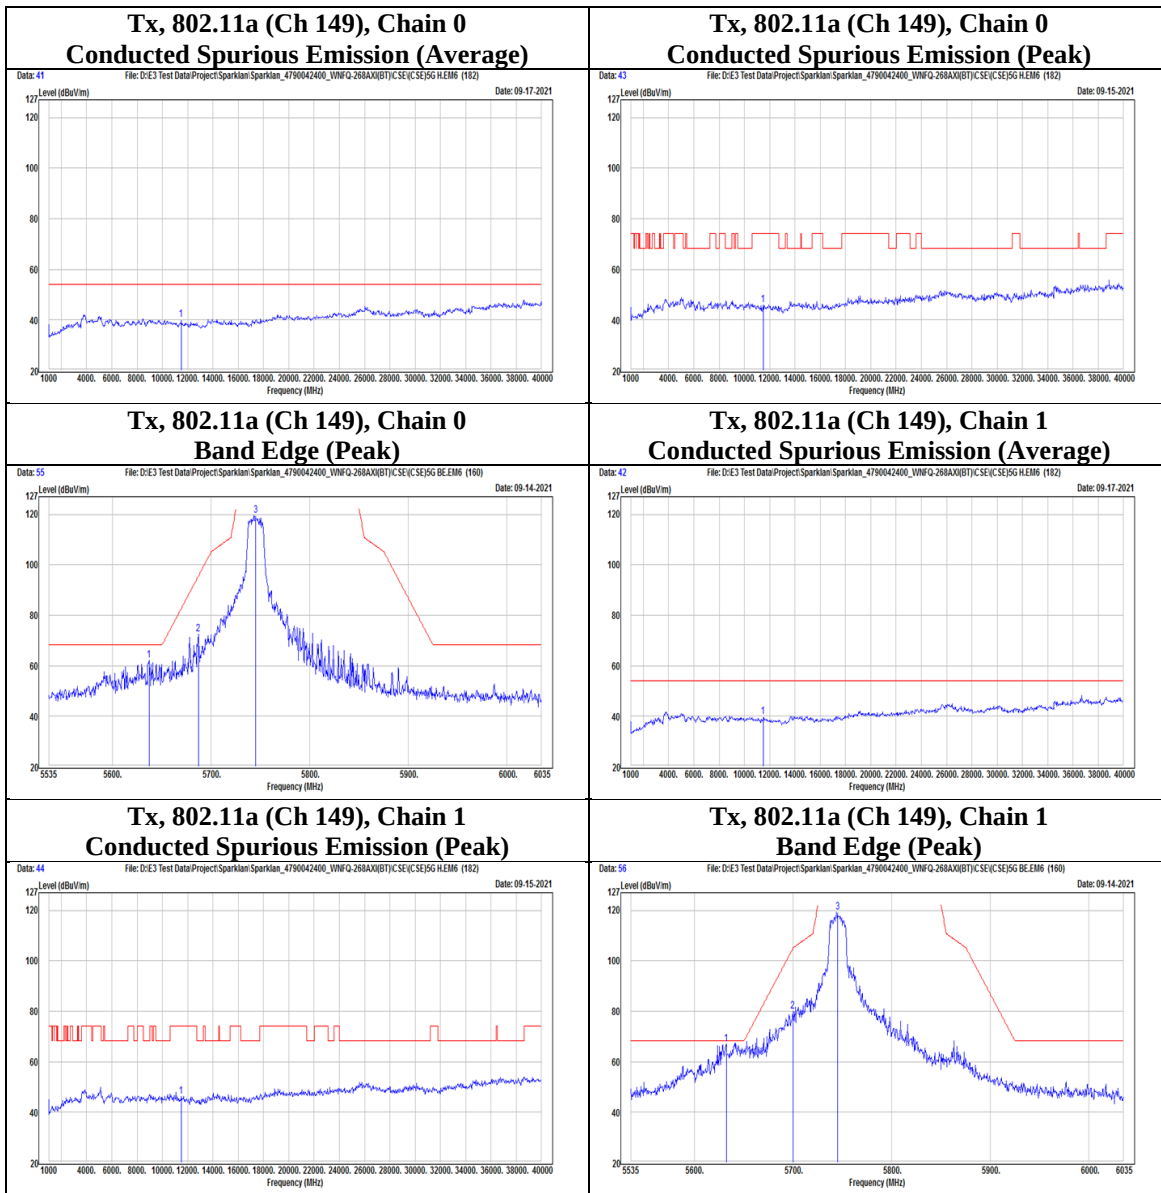

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 187 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11a	Channel	157
------	---------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5633.5	67.62	-11.74	55.88	68.2	-12.32	PK
		5698	68.12	-11.74	56.38	103.73	-47.35	PK
	@	5785	131.46	-11.74	119.72	N/A	N/A	PK
		5910.5	65.67	-11.74	53.93	78.9	-24.97	PK
		5992.5	64.39	-11.74	52.65	68.2	-15.55	PK
		11570	57.52	-11.74	45.78	74	-28.22	PK
		11570	50.43	-11.74	38.69	54	-15.31	AVG
Chain 1		5633.5	63.49	-11.74	51.75	68.2	-16.45	PK
		5664	66.03	-11.74	54.29	78.59	-24.3	PK
	@	5785	130.88	-11.74	119.14	N/A	N/A	PK
		5884	64.3	-11.74	52.56	98.52	-45.96	PK
		5949	63.83	-11.74	52.09	68.2	-16.11	PK
		11570	58.23	-11.74	46.49	74	-27.51	PK
		11570	50.15	-11.74	38.41	54	-15.59	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 188 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

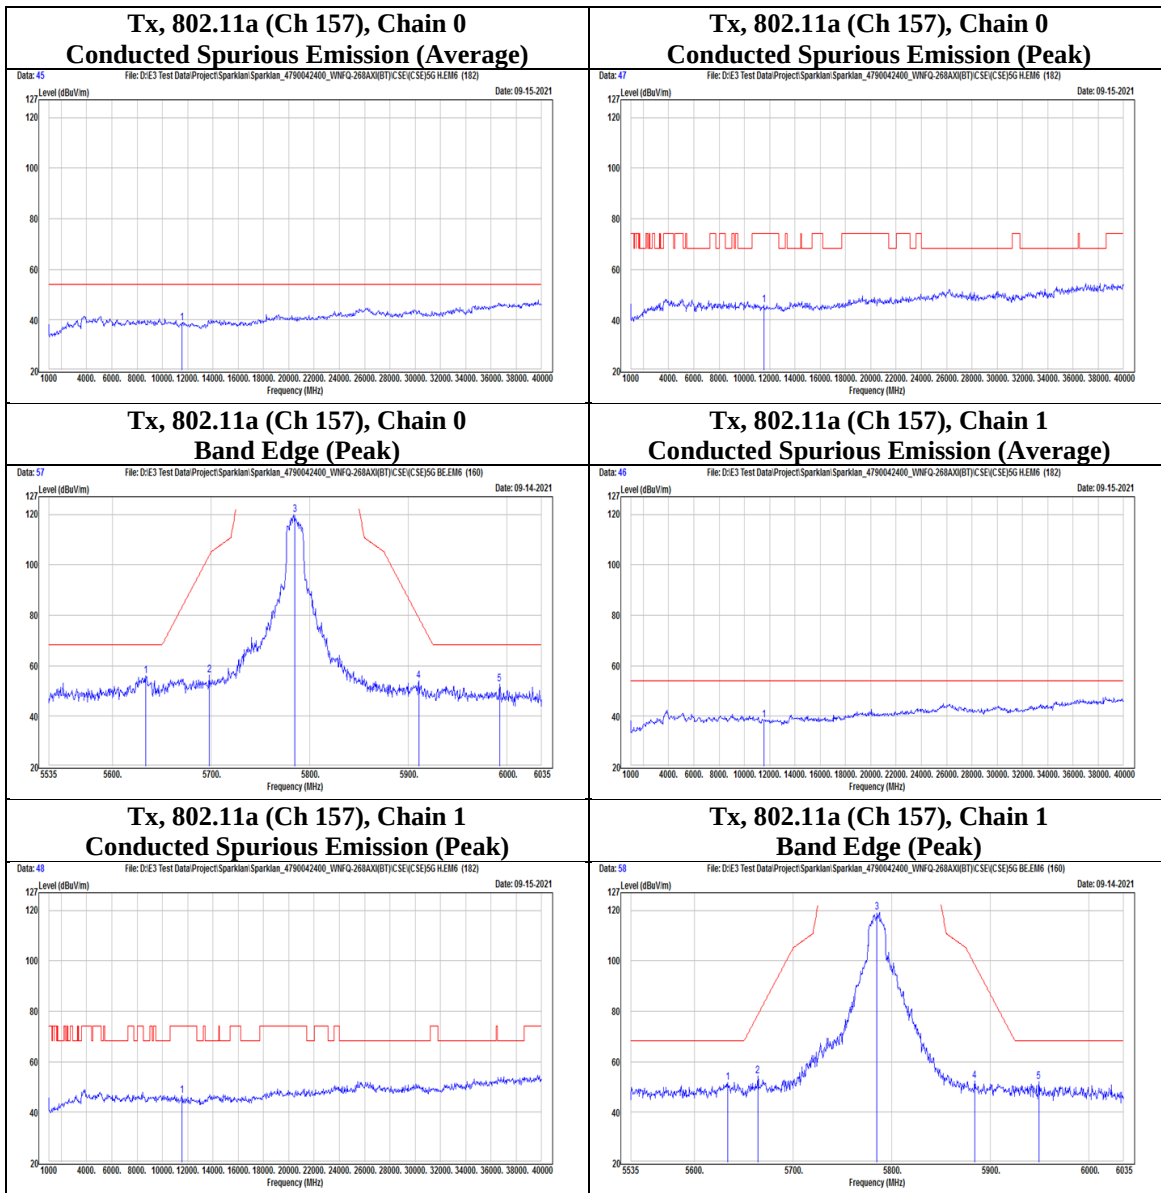

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 189 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11a	Channel	165
------	---------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	5825	129.45	-11.74	117.71	N/A	N/A	PK
		5883.5	68.56	-11.74	56.82	98.89	-42.07	PK
		5979	65.66	-11.74	53.92	68.2	-14.28	PK
		11650	56.41	-11.74	44.67	74	-29.33	PK
		11650	50.29	-11.74	38.55	54	-15.45	AVG
Chain 1	@	5825	130.09	-11.74	118.35	N/A	N/A	PK
		5876	87.07	-11.74	75.33	104.46	-29.13	PK
		5926	78.61	-11.74	66.87	68.2	-1.33	PK
		11650	56.91	-11.74	45.17	74	-28.83	PK
		11650	50.15	-11.74	38.41	54	-15.59	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 190 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

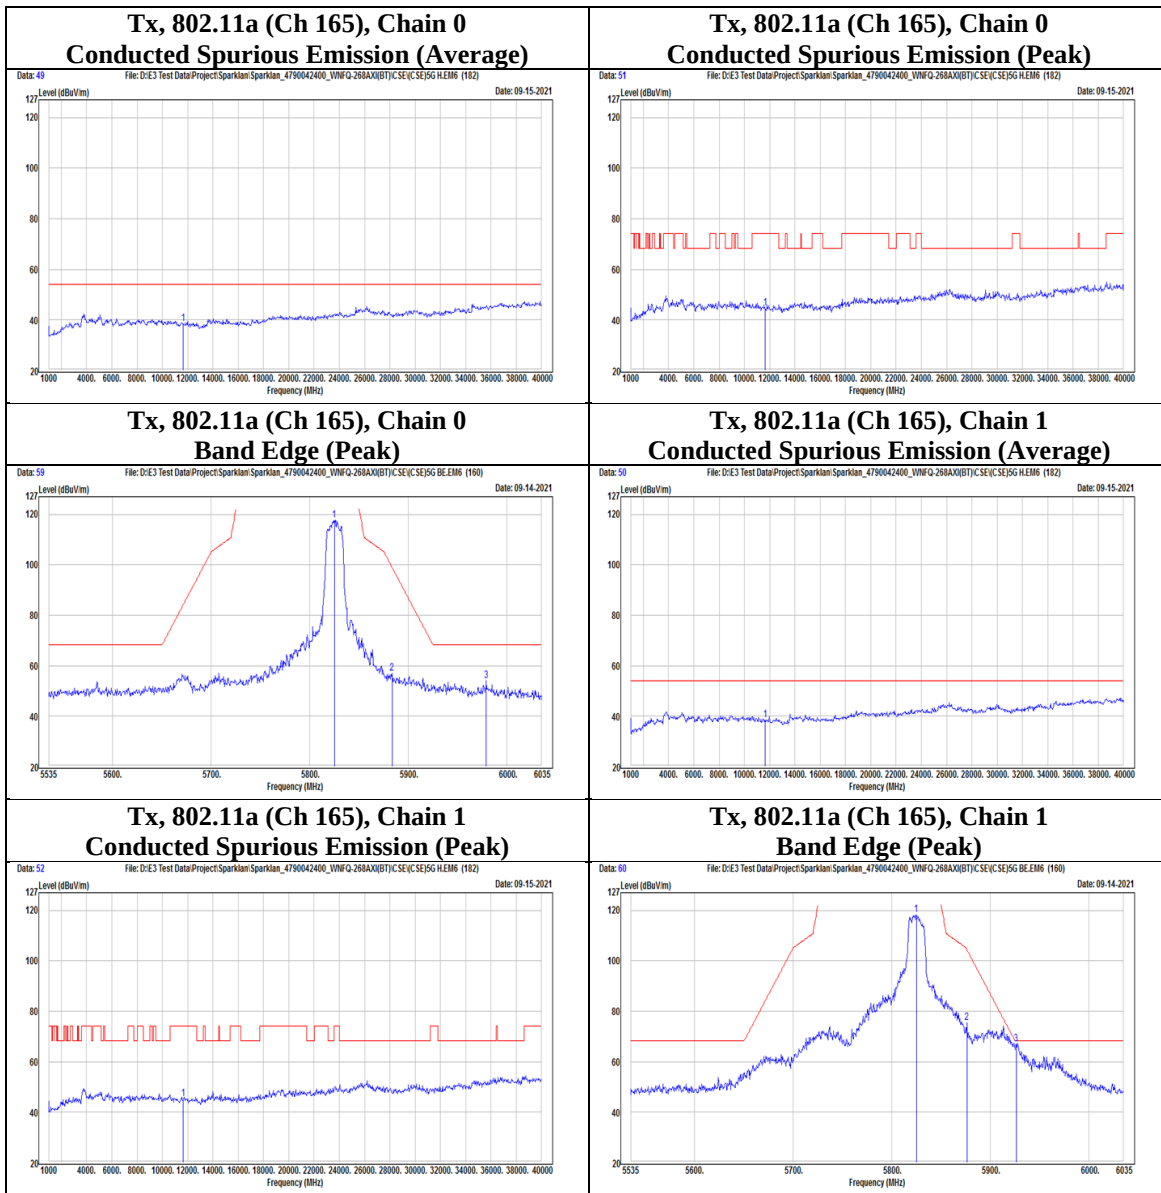

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 191 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax20	Channel	36
------	------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5149.45	75.89	-11.74	64.15	74	-9.85	PK
		5149.8	64.22	-11.74	52.48	54	-1.52	AVG
	@	5180	126.23	-11.74	114.49	N/A	N/A	PK
	@	5180	115.23	-11.74	103.49	N/A	N/A	AVG
		10360	57.48	-11.74	45.74	68.2	-22.46	PK
		10360	50.68	-11.74	38.94	54	-15.06	AVG
		5145.6	68.75	-11.74	57.01	74	-16.99	PK
Chain 1		5149.8	64.48	-11.74	52.74	54	-1.26	AVG
	@	5180	122.85	-11.74	111.11	N/A	N/A	PK
	@	5180	117.26	-11.74	105.52	N/A	N/A	AVG
		10360	57.4	-11.74	45.66	68.2	-22.54	PK
		10360	51.37	-11.74	39.63	54	-14.37	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 192 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

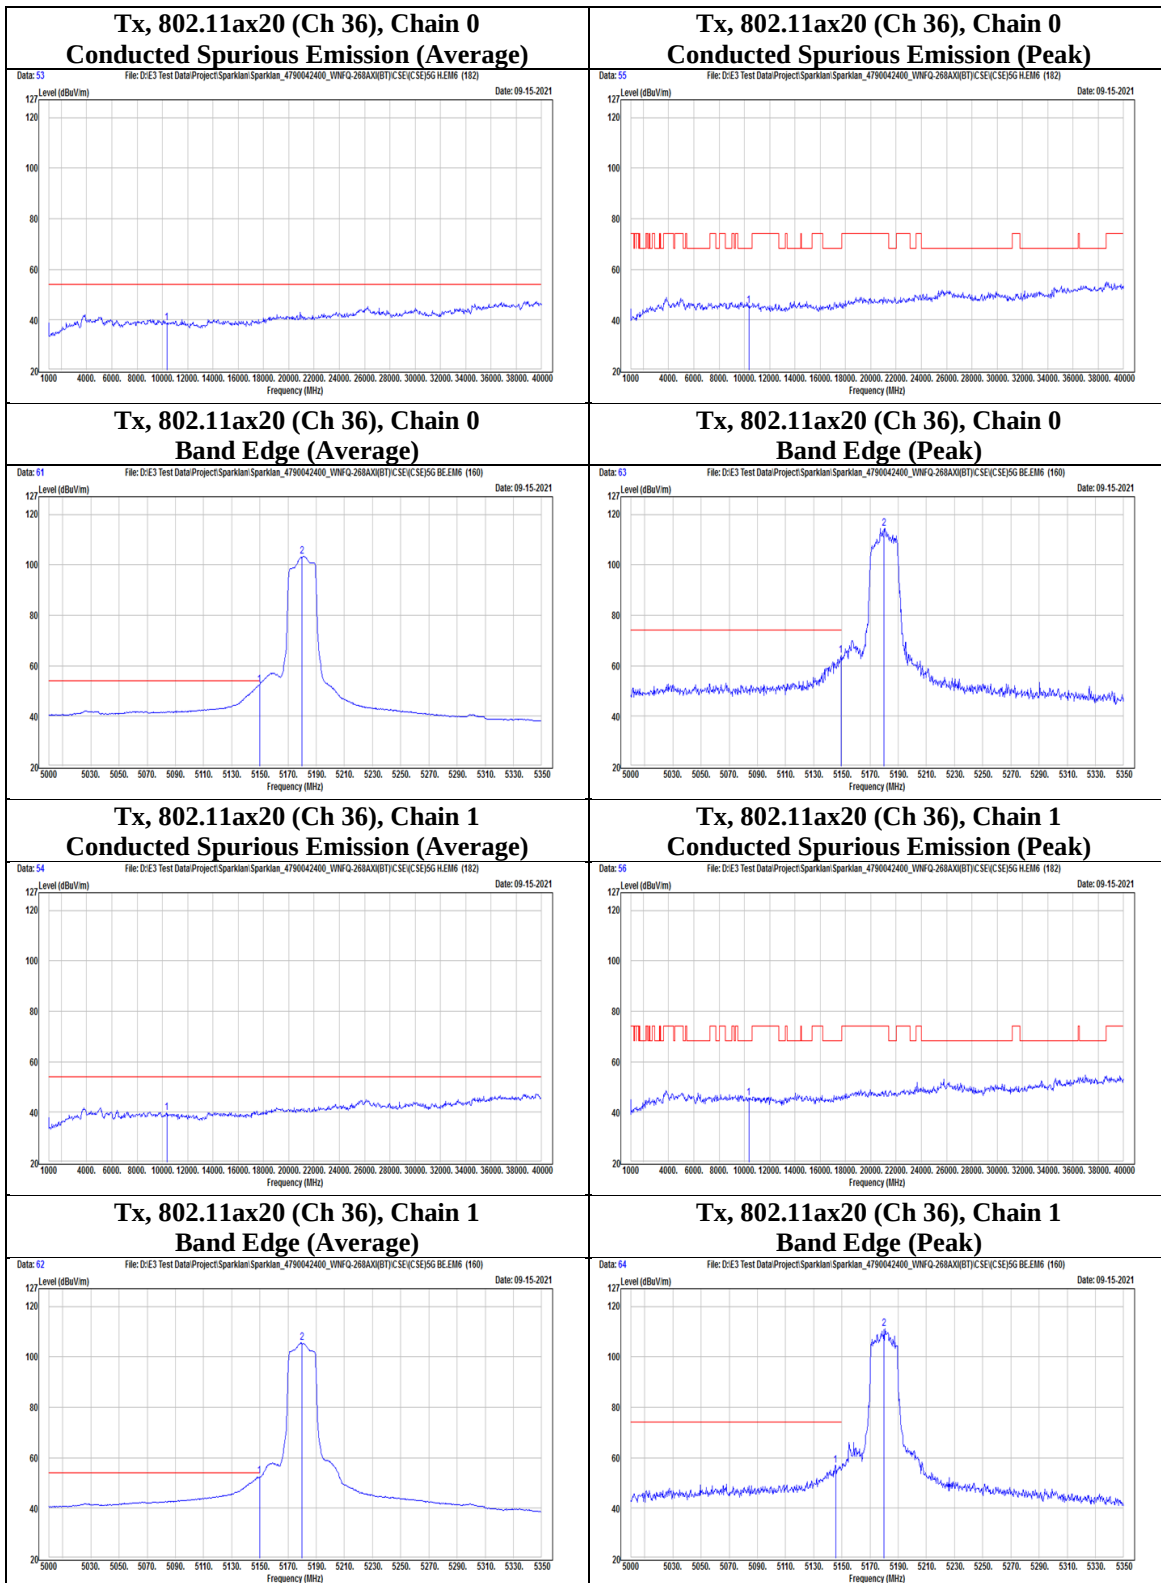

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 193 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax20	Channel	44
------	------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5147	72.38	-11.74	60.64	74	-13.36	PK
		5149.45	59.72	-11.74	47.98	54	-6.02	AVG
	@	5220	130.24	-11.74	118.5	N/A	N/A	PK
	@	5220	120.38	-11.74	108.64	N/A	N/A	AVG
		10440	57.71	-11.74	45.97	68.2	-22.23	PK
		10440	50.56	-11.74	38.82	54	-15.18	AVG
Chain 1		5144.9	64.89	-11.74	53.15	74	-20.85	PK
		5149.45	58.07	-11.74	46.33	54	-7.67	AVG
	@	5220	126.41	-11.74	114.67	N/A	N/A	PK
	@	5220	121.66	-11.74	109.92	N/A	N/A	AVG
		10440	56.91	-11.74	45.17	68.2	-23.03	PK
		10440	50.69	-11.74	38.95	54	-15.05	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 194 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

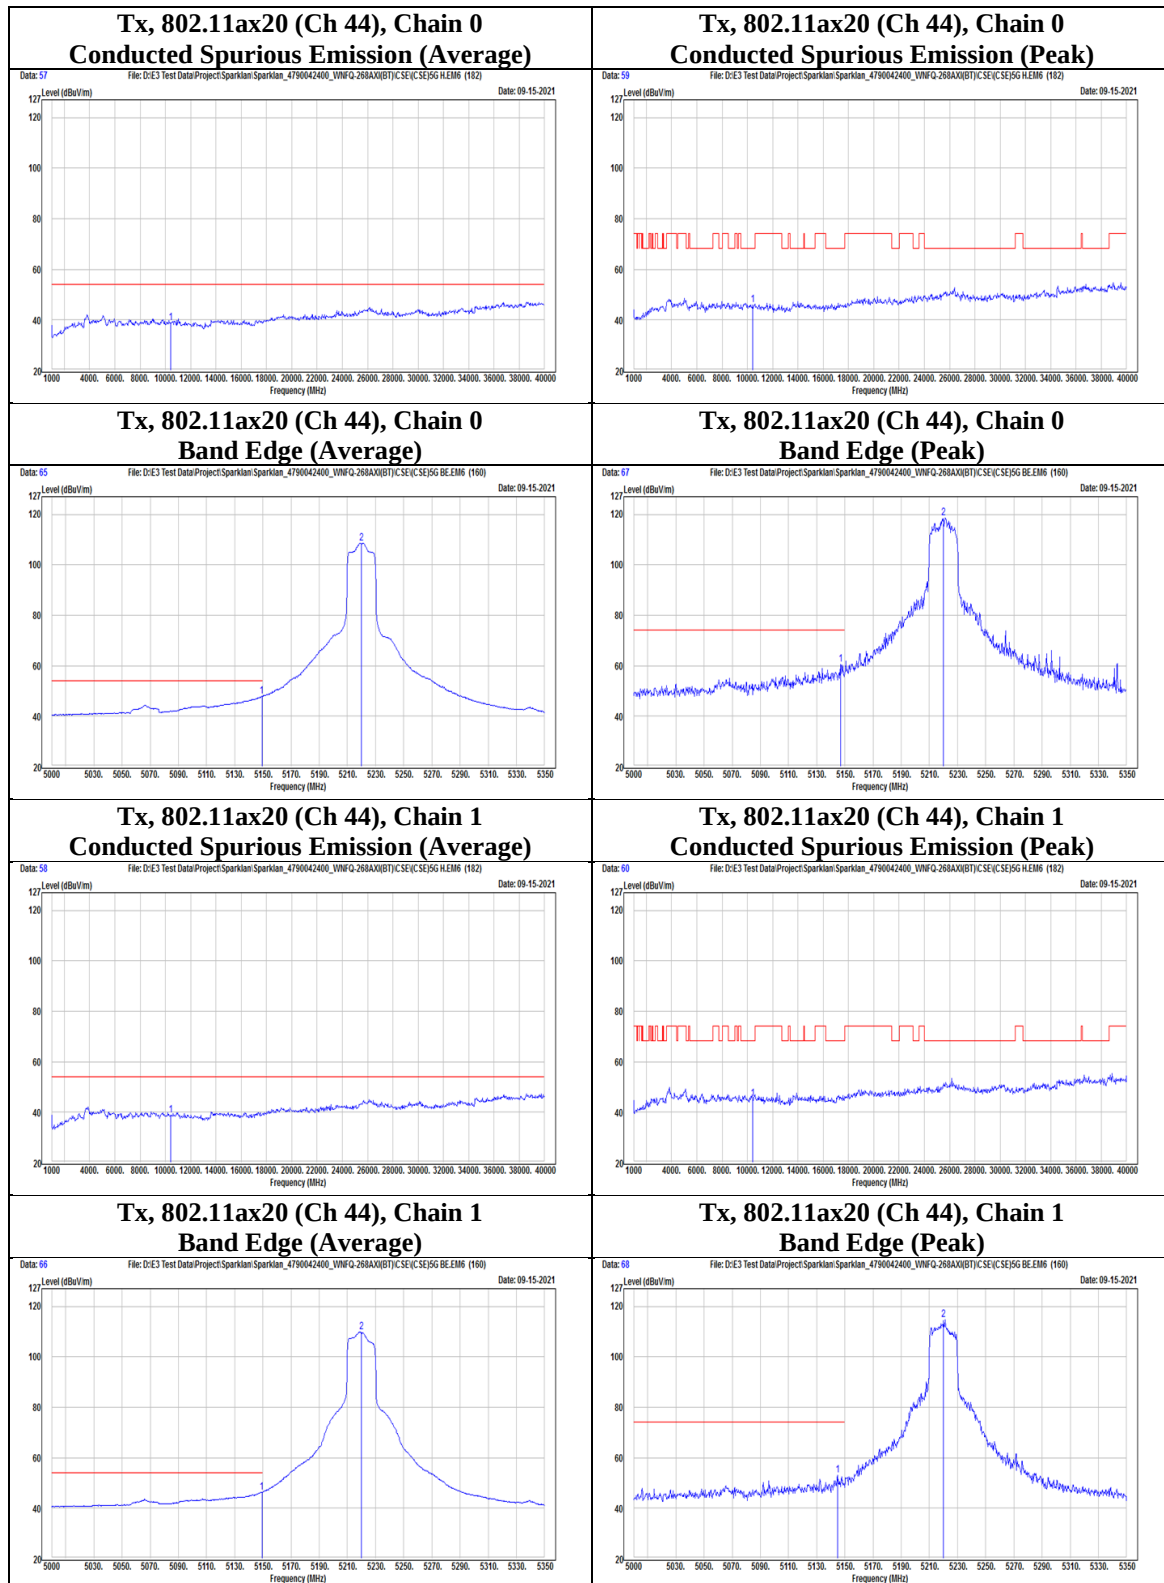

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0