




NVNT	ax20	5240	Ant1	5350	-48.13	6.3	-	53.40	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5350	-56.94	6.3	0.12	44.71	Average	54	Pass
NVNT	ax20	5240	Ant1	5454.96	-45.51	6.3	-	56.02	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5419.44	-56.37	6.3	0.12	45.28	Average	54	Pass
NVNT	ax20	5240	Ant1	5460	-50.21	6.3	-	51.32	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5460	-56.78	6.3	0.12	44.87	Average	54	Pass
NVNT	ax40	5190	Ant1	4500	-48.34	6.3	-	53.19	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	4500	-57.45	6.3	0.24	44.32	Average	54	Pass
NVNT	ax40	5190	Ant1	5146.78	-41.5	6.3	-	60.03	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5149.7	-53.86	6.3	0.24	47.91	Average	54	Pass
NVNT	ax40	5190	Ant1	5150	-42.84	6.3	-	58.69	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5150	-53.85	6.3	0.24	47.92	Average	54	Pass
NVNT	ax40	5230	Ant1	5350	-49.68	6.3	-	51.85	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5350	-57.25	6.3	0.24	44.52	Average	54	Pass
NVNT	ax40	5230	Ant1	5393.04	-45.5	6.3	-	56.03	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5398.98	-56.29	6.3	0.24	45.48	Average	54	Pass
NVNT	ax40	5230	Ant1	5460	-48.34	6.3	-	53.19	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5460	-57.21	6.3	0.24	44.56	Average	54	Pass
NVNT	ax80	5210	Ant1	4500	-47.75	6.3	-	53.78	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	4500	-57.38	6.3	0.47	44.62	Average	54	Pass
NVNT	ax80	5210	Ant1	5149.38	-40.59	6.3	-	60.94	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5149.38	-53.44	6.3	0.47	48.56	Average	54	Pass
NVNT	ax80	5210	Ant1	5150	-40.1	6.3	-	61.43	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5150	-53.17	6.3	0.47	48.83	Average	54	Pass
NVNT	ax80	5210	Ant1	5350	-48.12	6.3	-	53.41	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5350	-56.32	6.3	0.47	45.68	Average	54	Pass
NVNT	ax80	5210	Ant1	5439.87	-45.62	6.3	-	55.91	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5356.05	-55.68	6.3	0.47	46.32	Average	54	Pass
NVNT	ax80	5210	Ant1	5460	-47.14	6.3	-	54.39	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5460	-56.68	6.3	0.47	45.32	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant1 Peak

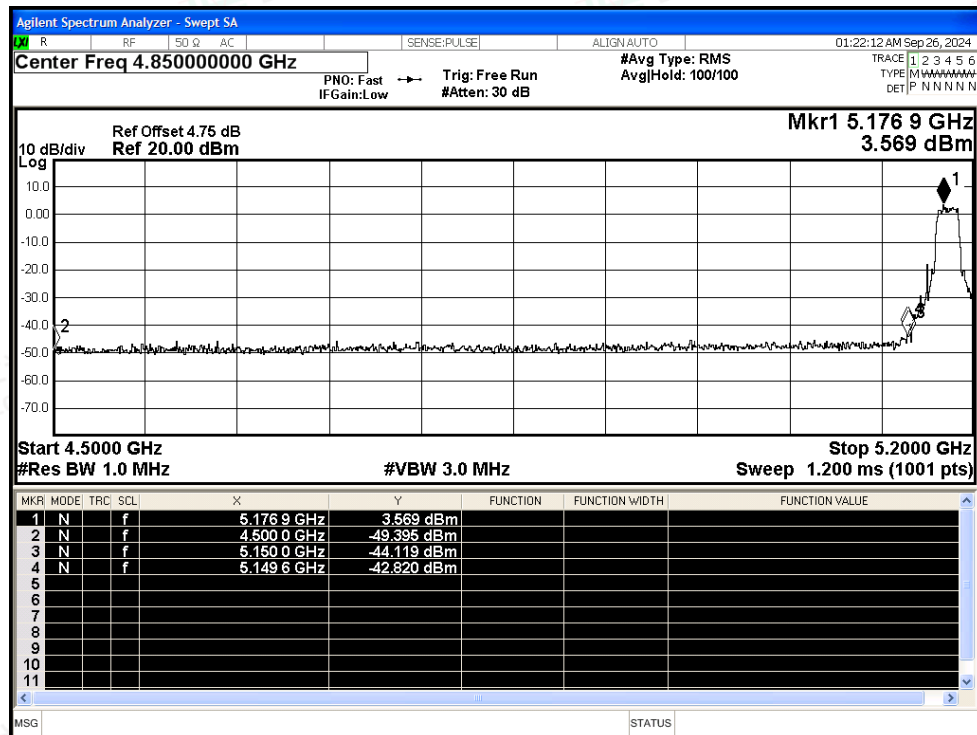

Restrict Band NVNT a 5180MHz Ant1 Average

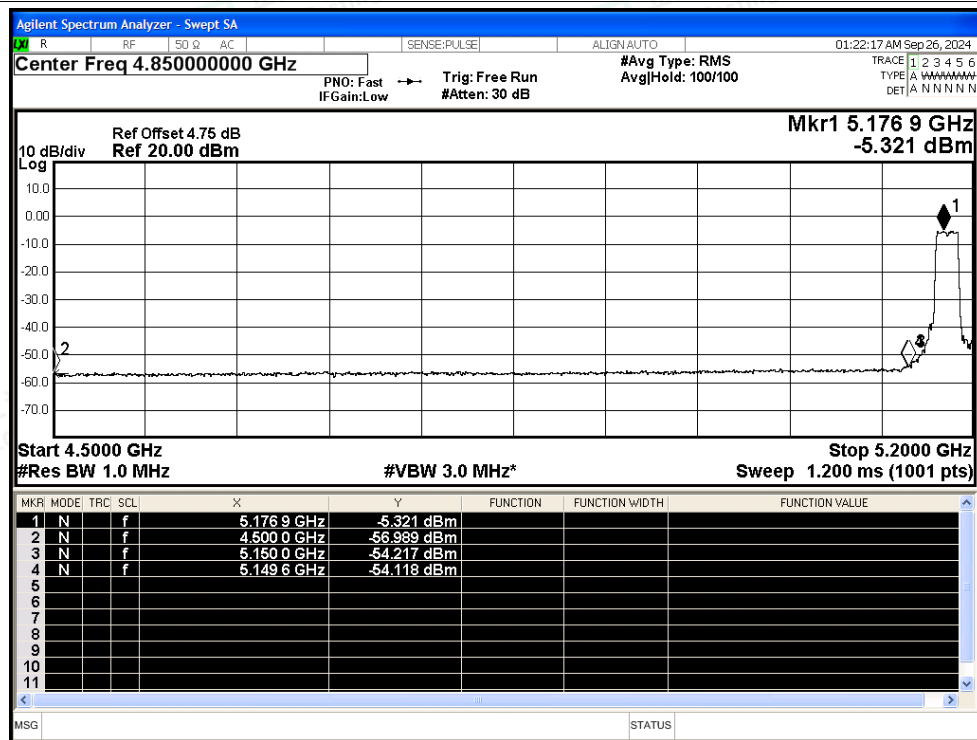

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant1 Peak

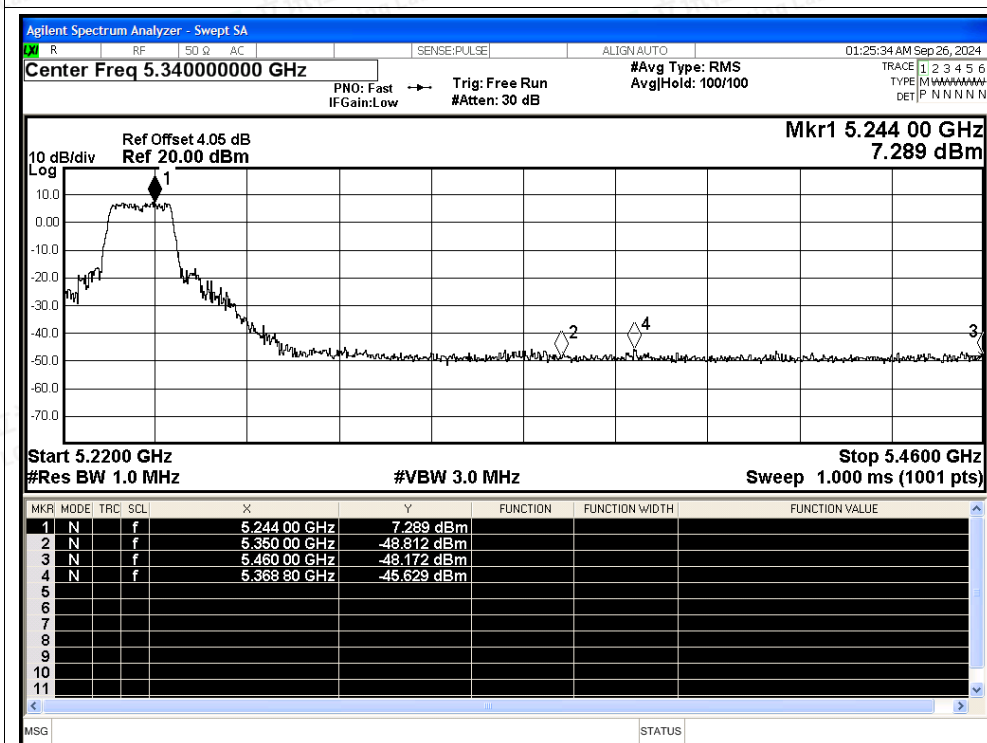

Restrict Band NVNT a 5240MHz Ant1 Average

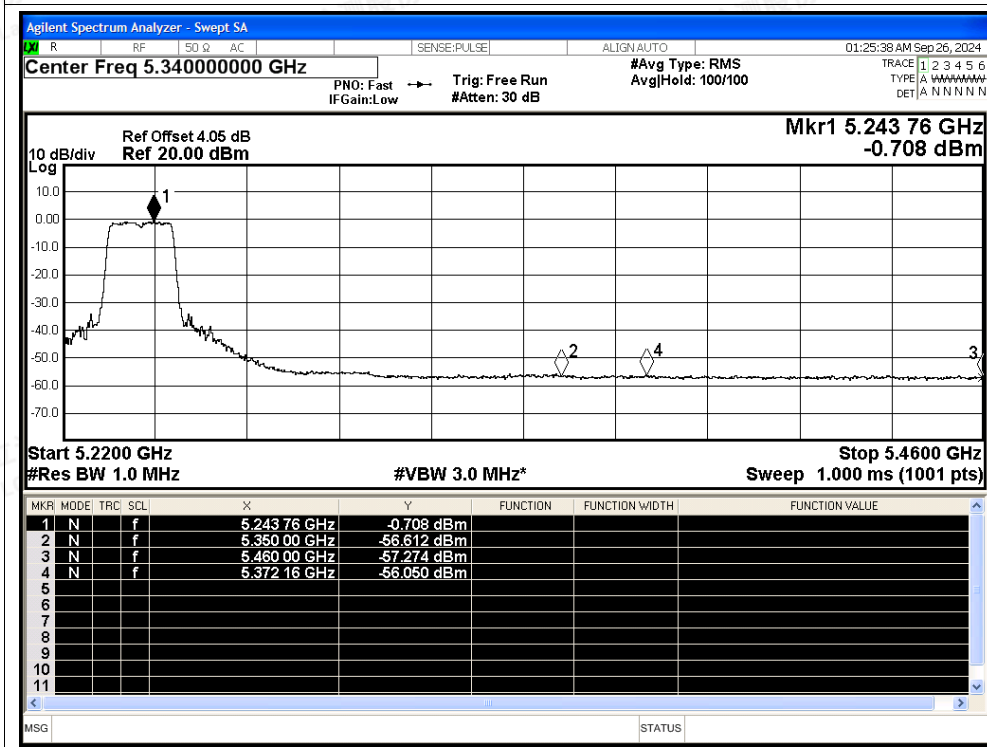

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant1 Peak

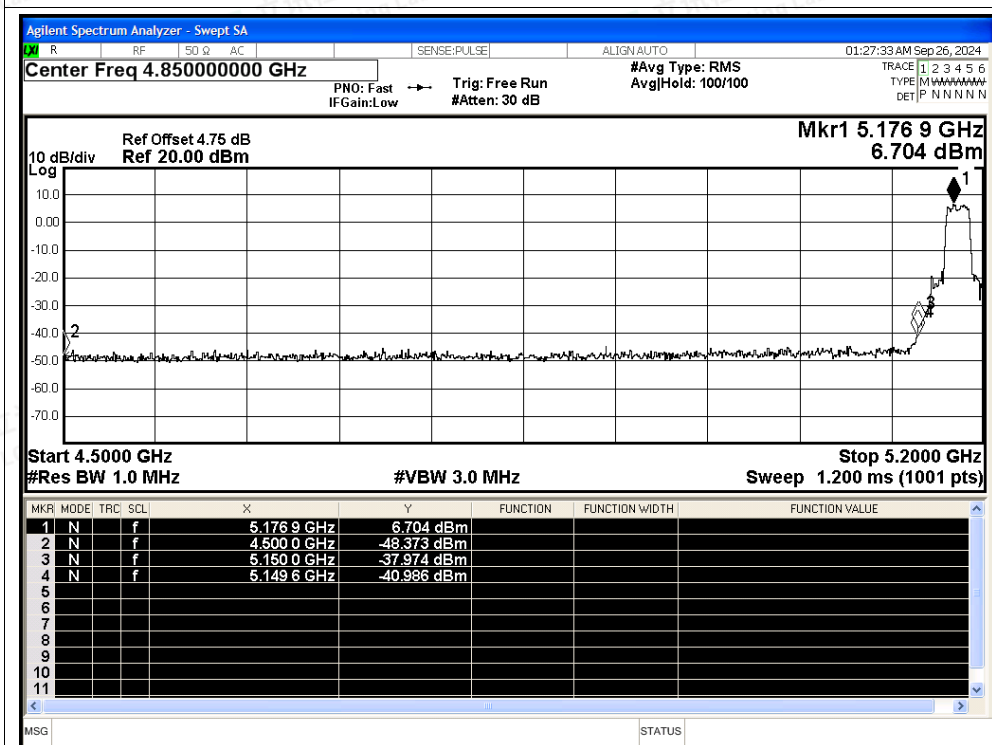

Restrict Band NVNT n20 5180MHz Ant1 Average

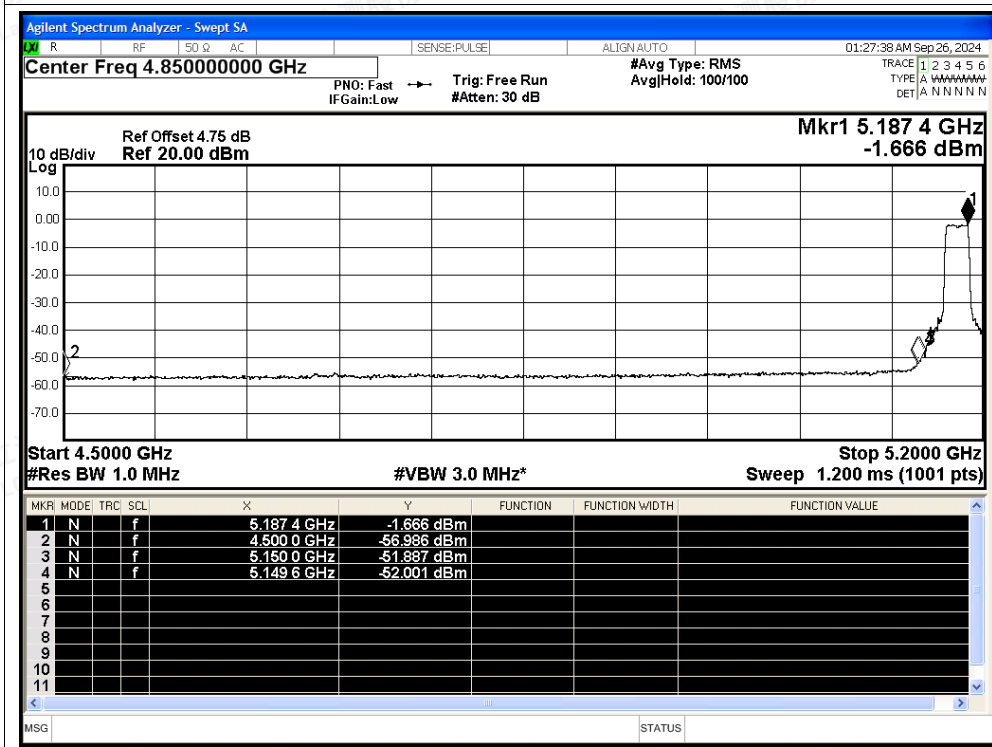

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant1 Peak

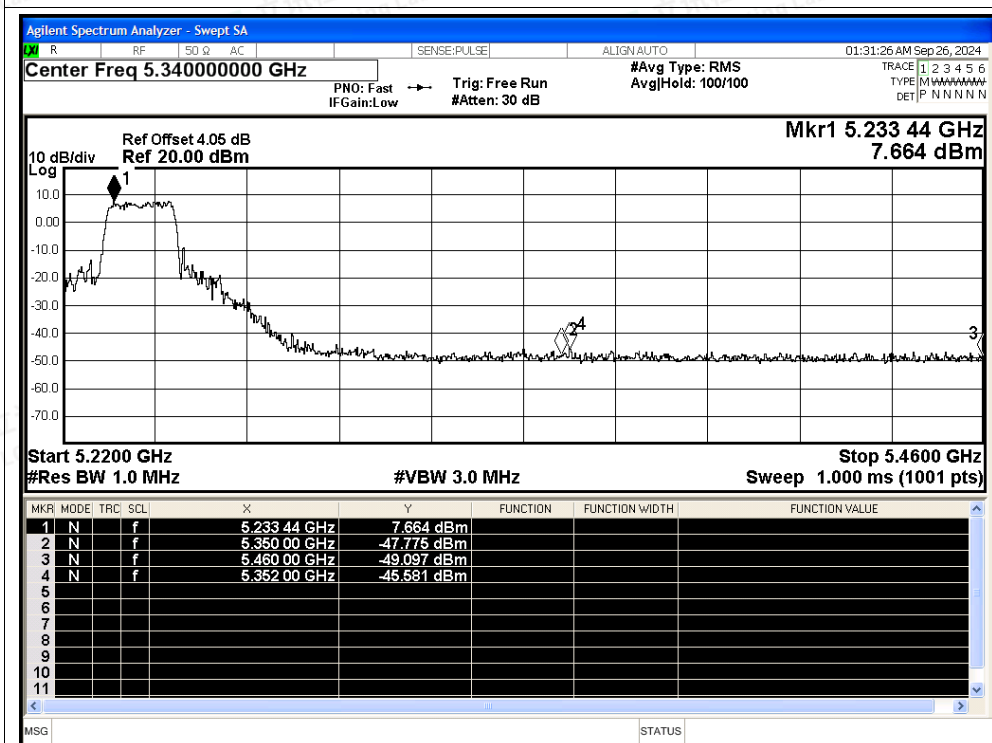

Restrict Band NVNT n20 5240MHz Ant1 Average

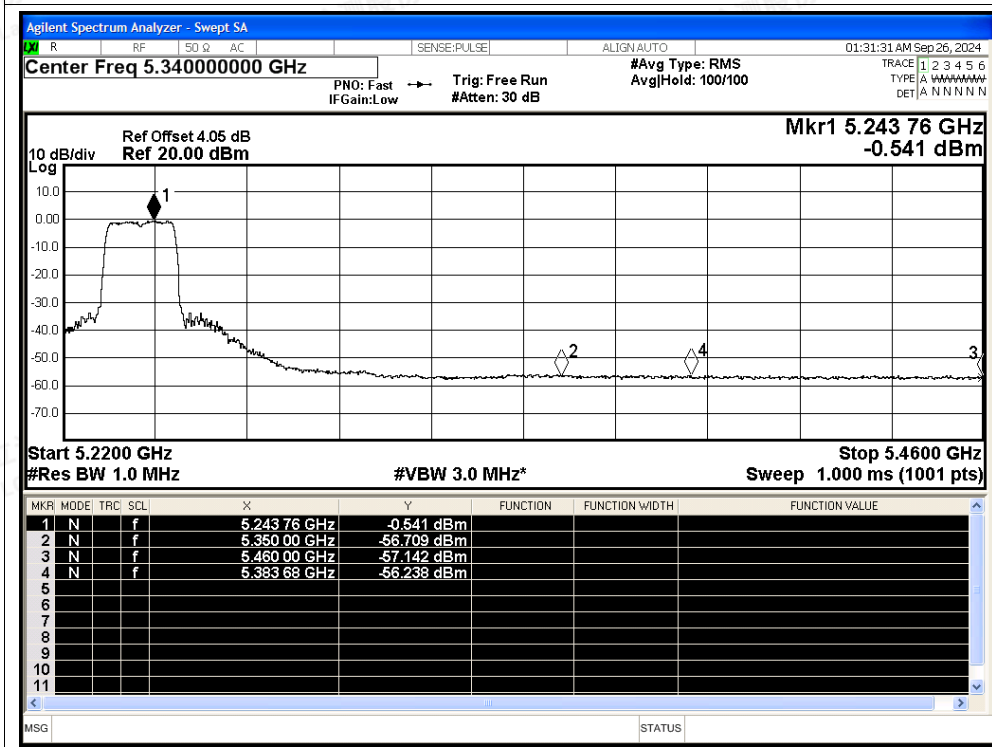

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant1 Peak

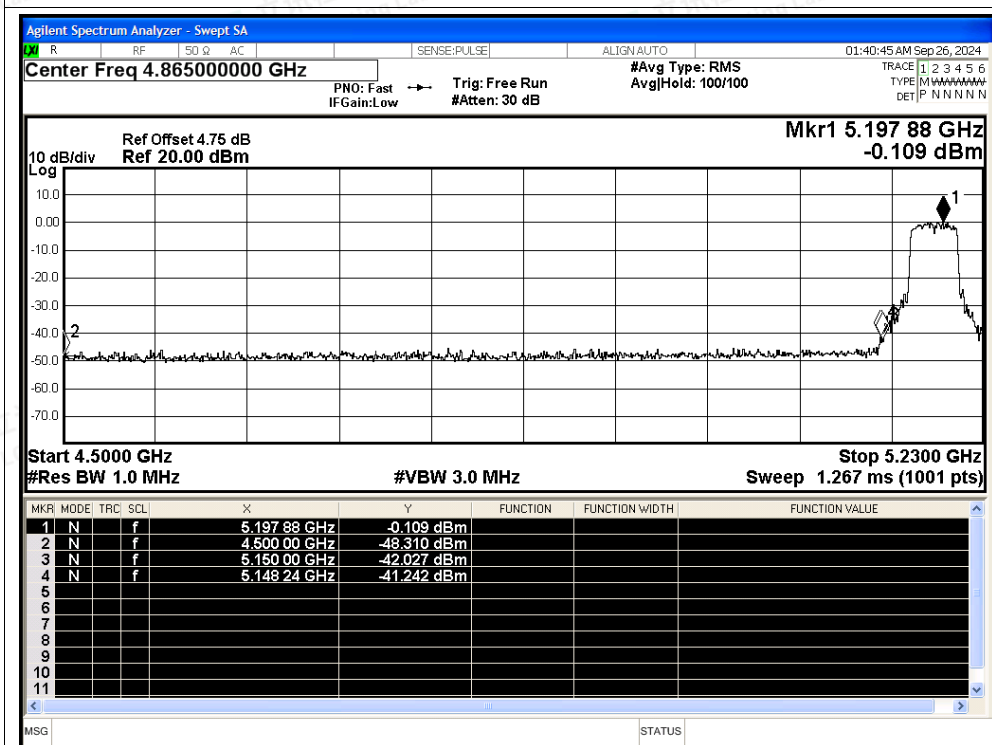

Restrict Band NVNT n40 5190MHz Ant1 Average

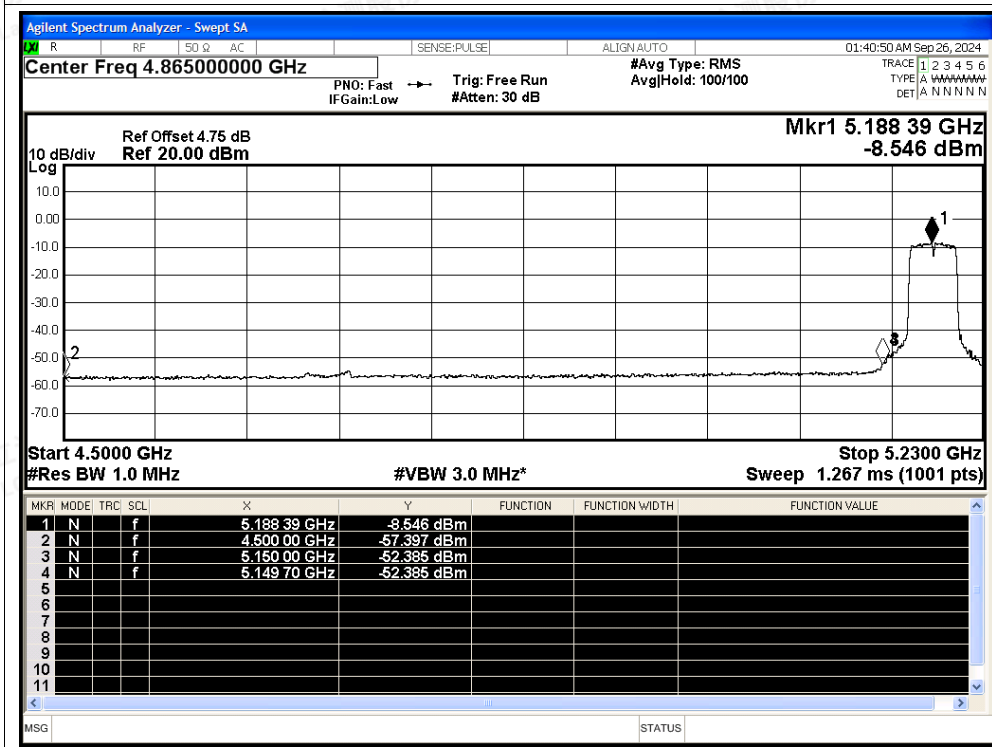

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant1 Peak

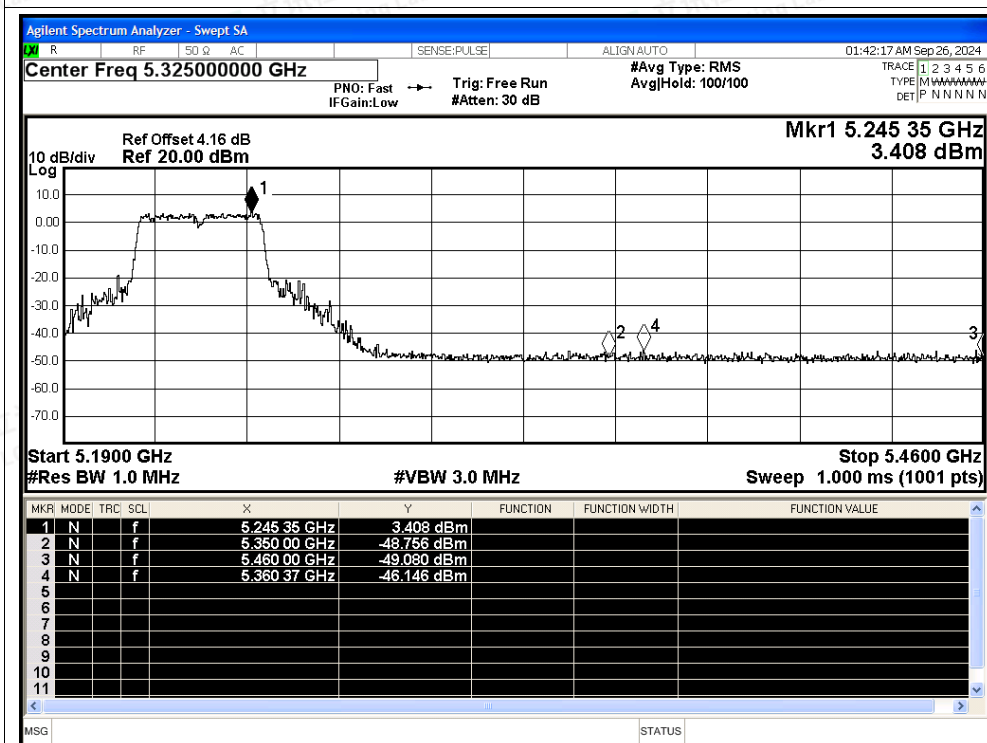

Restrict Band NVNT n40 5230MHz Ant1 Average

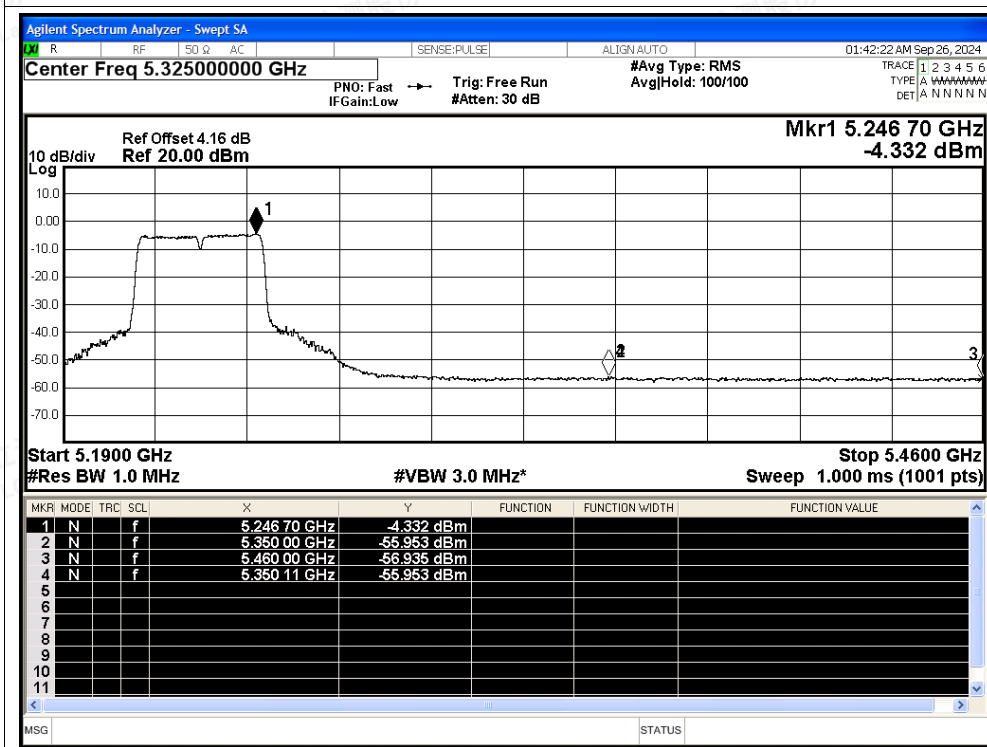

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant1 Peak

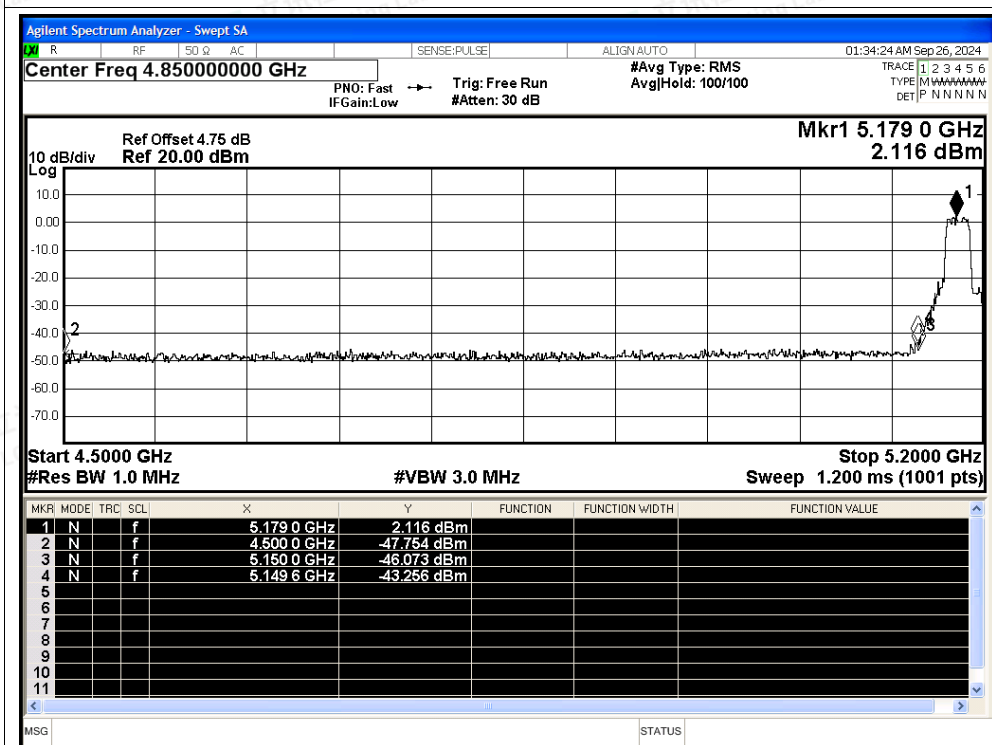

Restrict Band NVNT ac20 5180MHz Ant1 Average

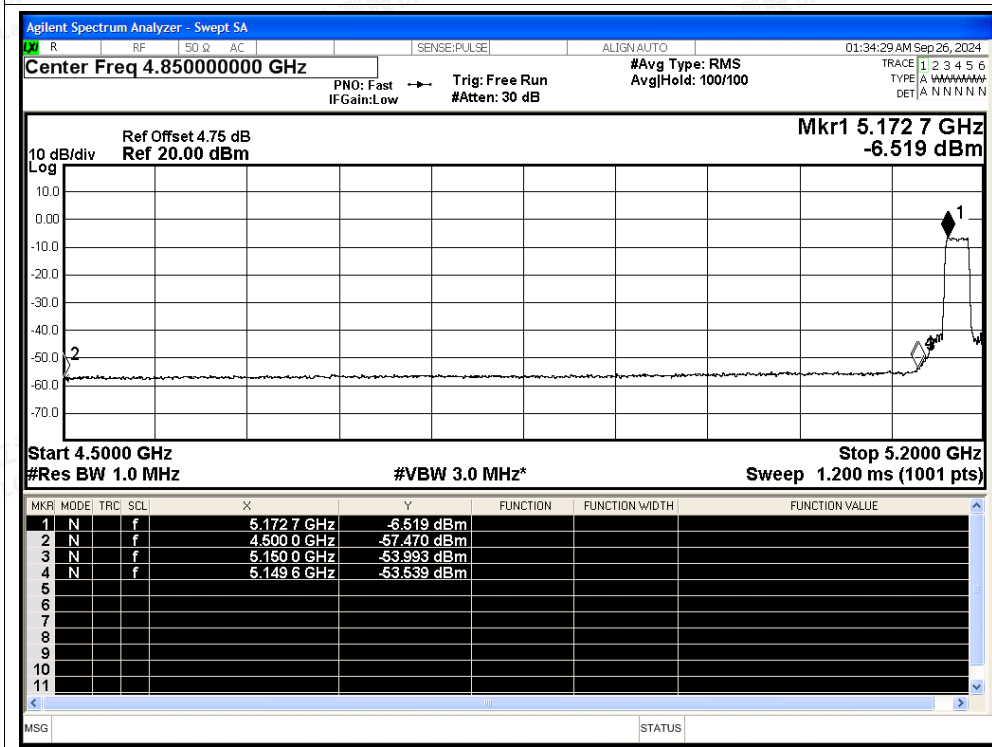

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant1 Peak

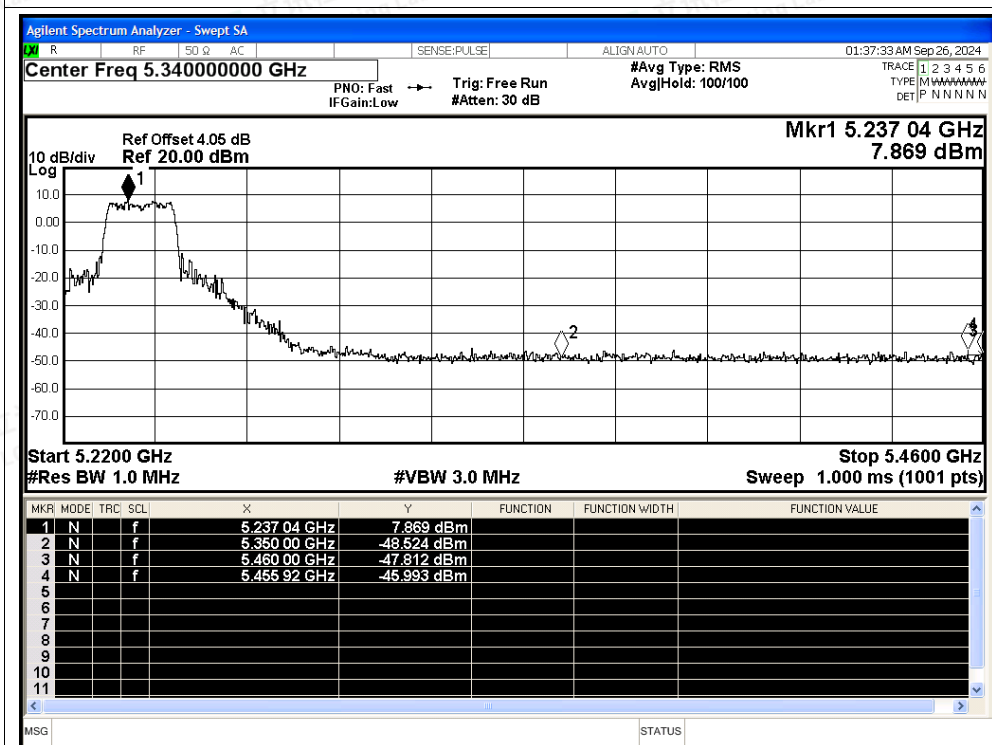

Restrict Band NVNT ac20 5240MHz Ant1 Average

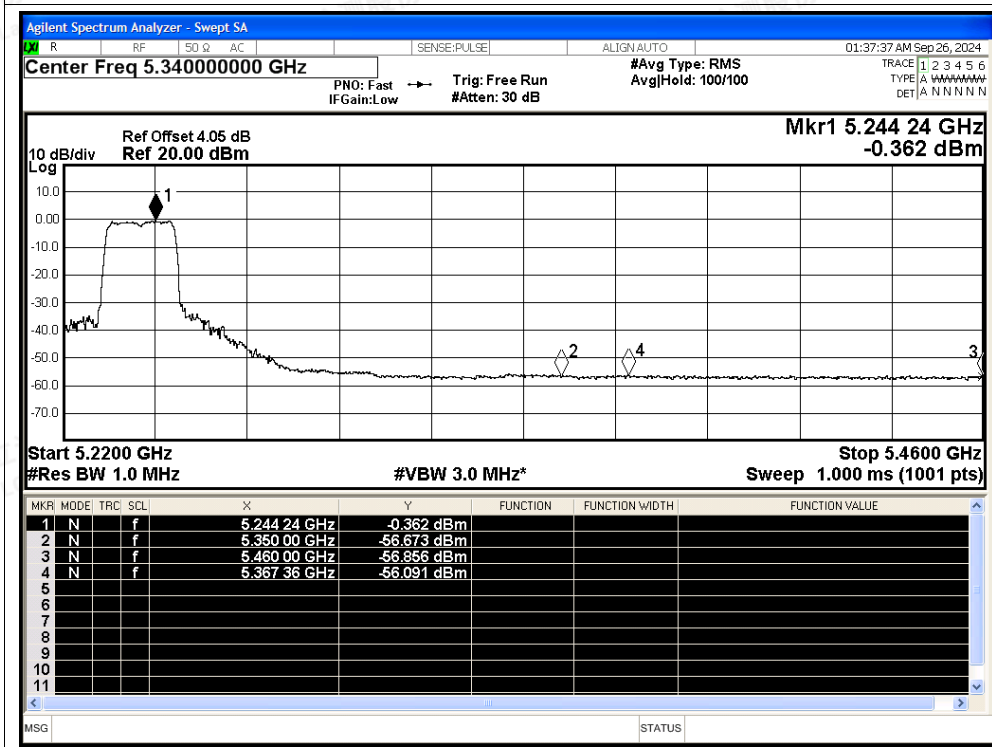

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

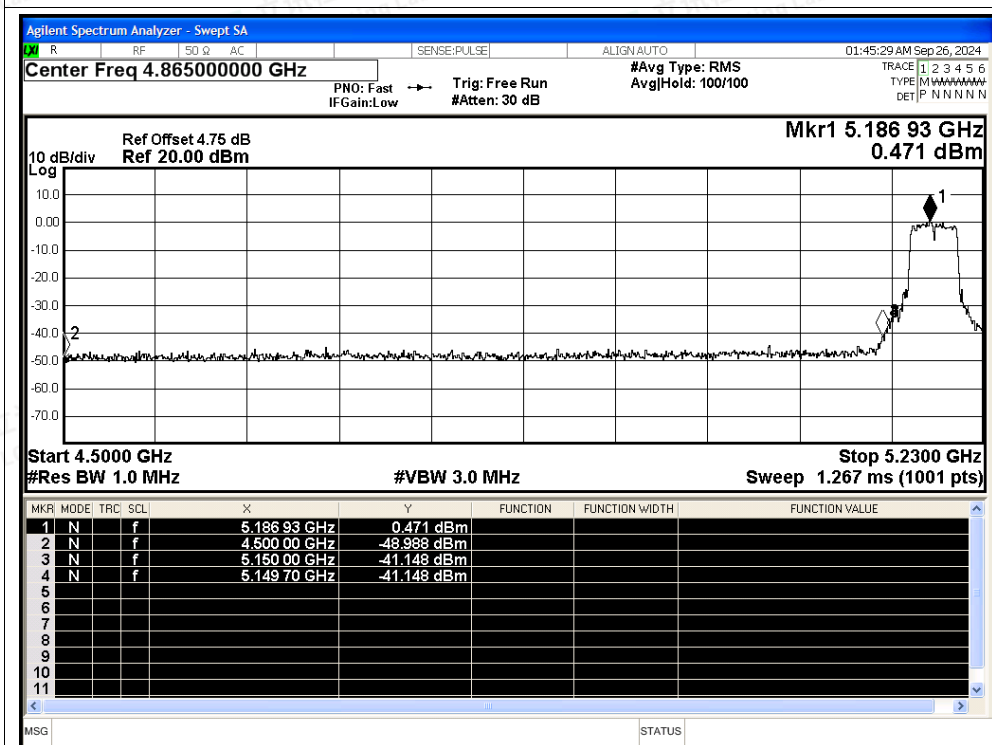

Restrict Band NVNT ac40 5190MHz Ant1 Average

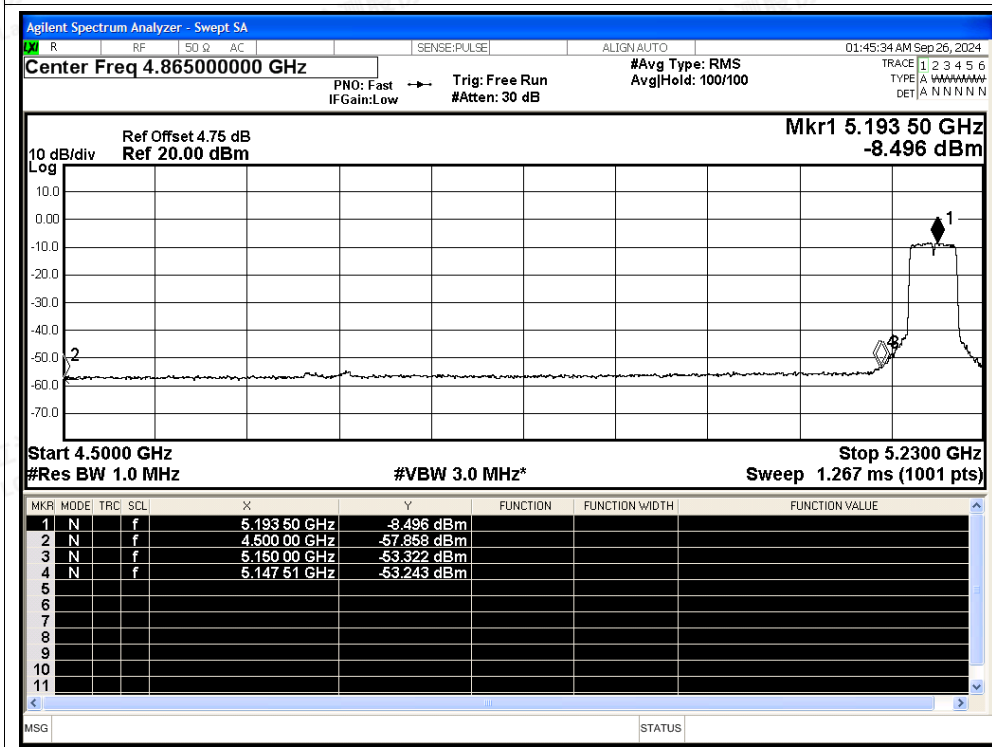

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant1 Peak

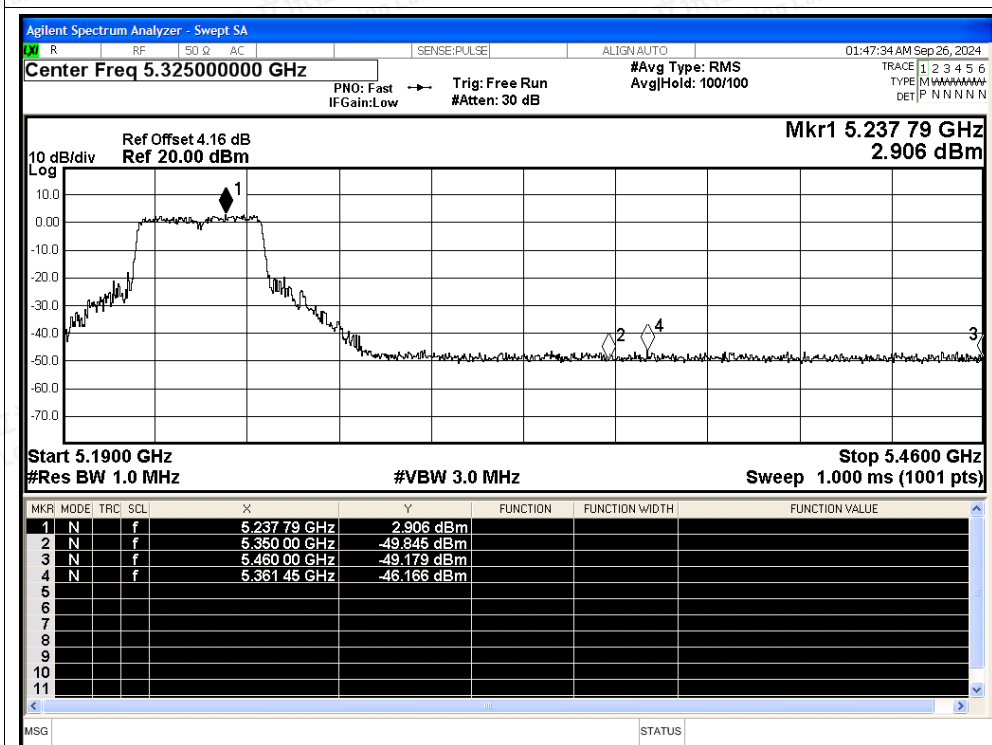

Restrict Band NVNT ac40 5230MHz Ant1 Average

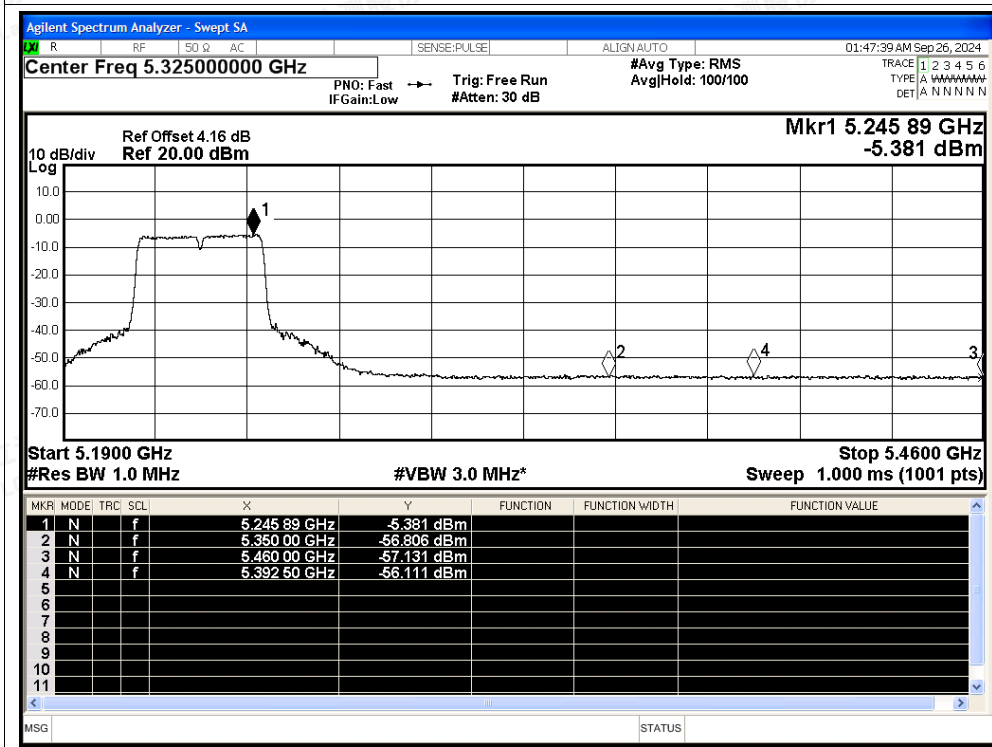

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

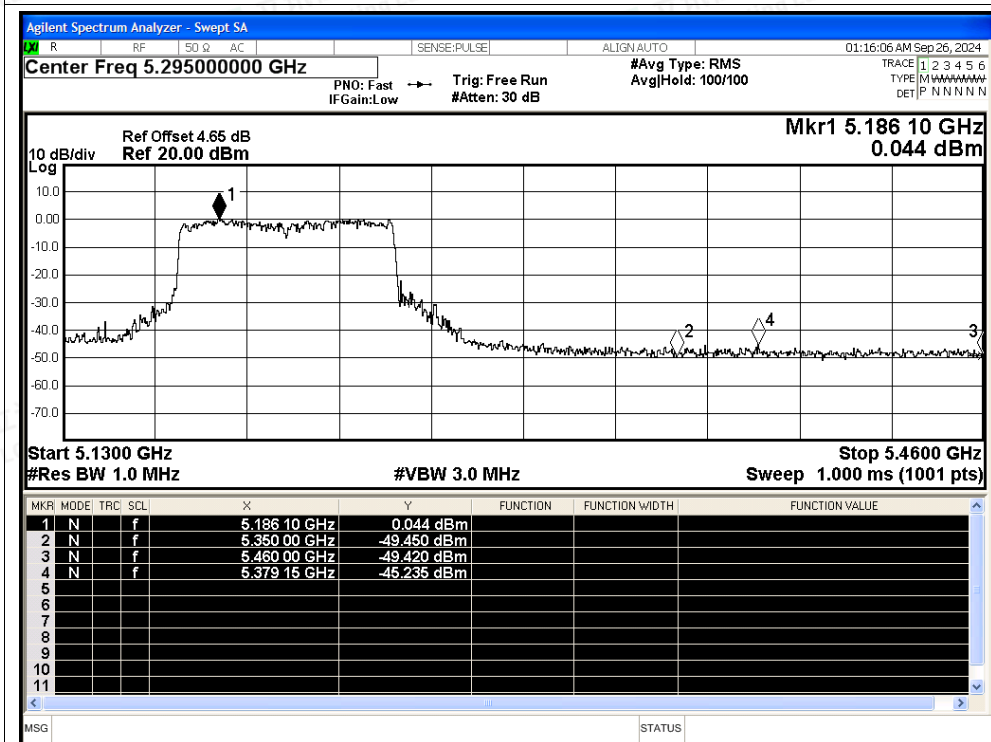


Restrict Band NVNT ac80 5210MHz Ant1 Average

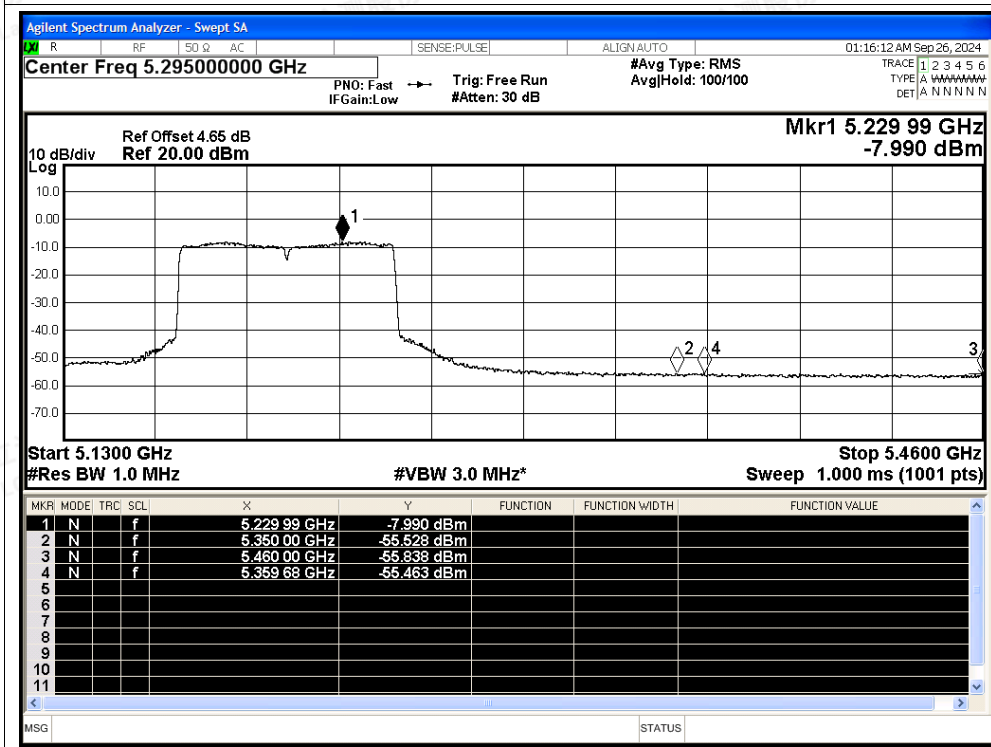




Restrict Band NVNT ac80 5210MHz Ant1 Peak

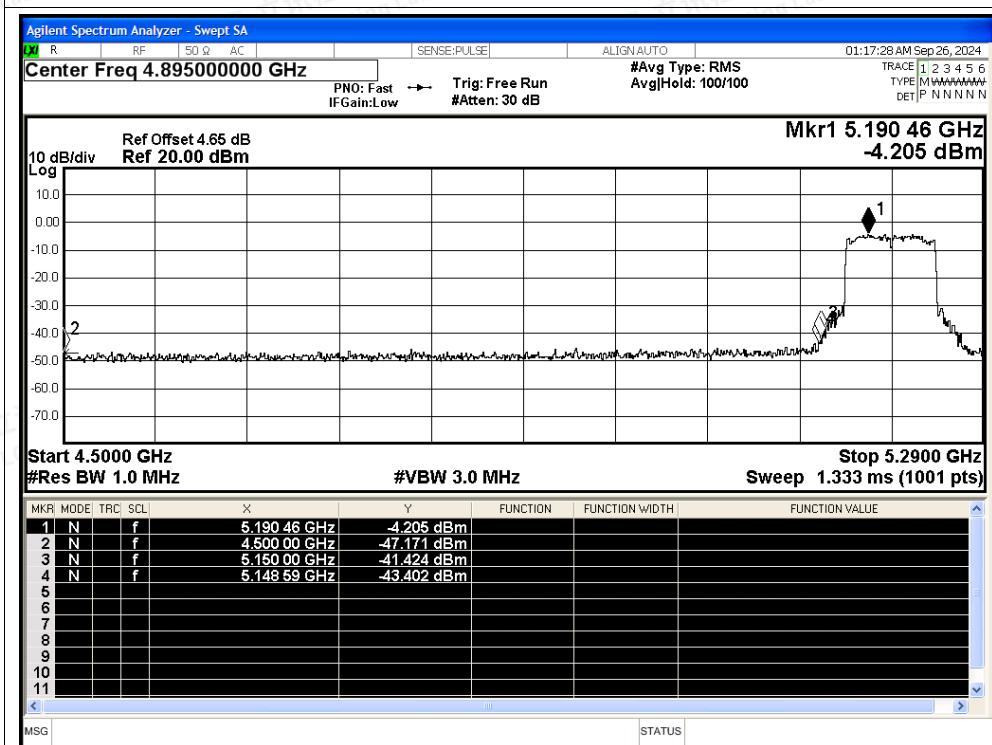

Restrict Band NVNT ac80 5210MHz Ant1 Average

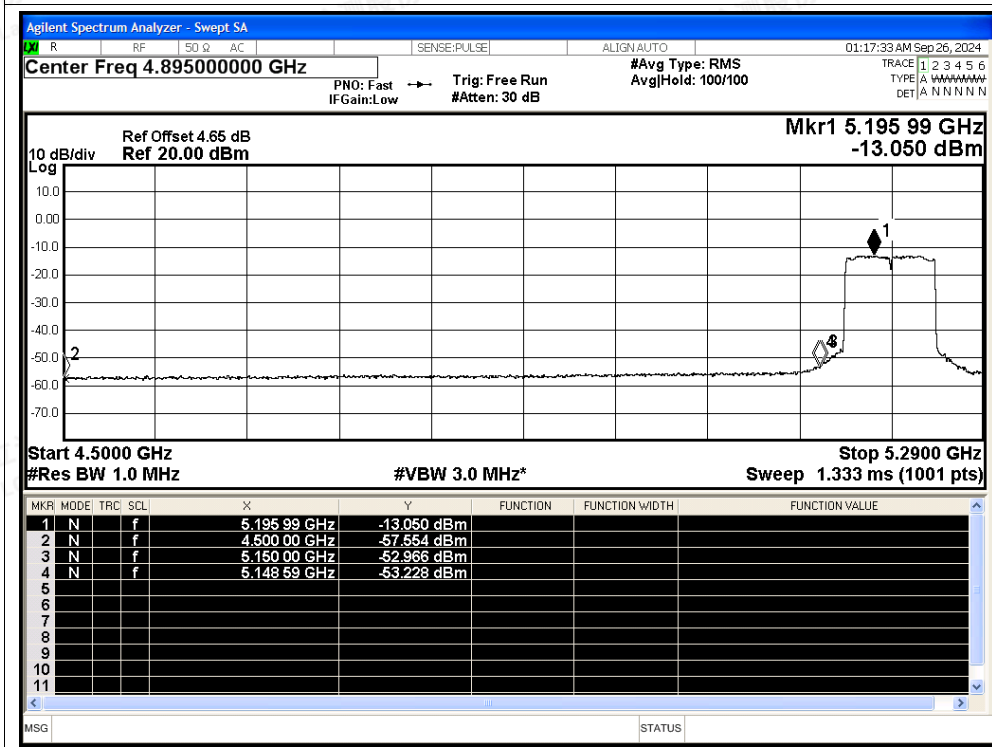

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant1 Peak

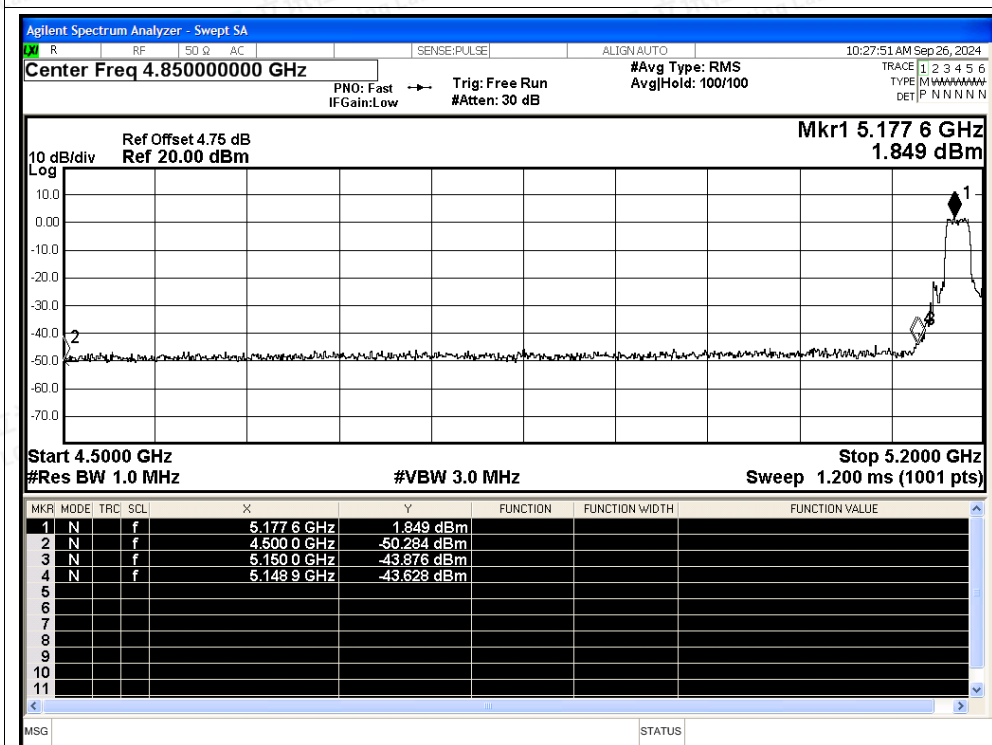

Restrict Band NVNT ax20 5180MHz Ant1 Average

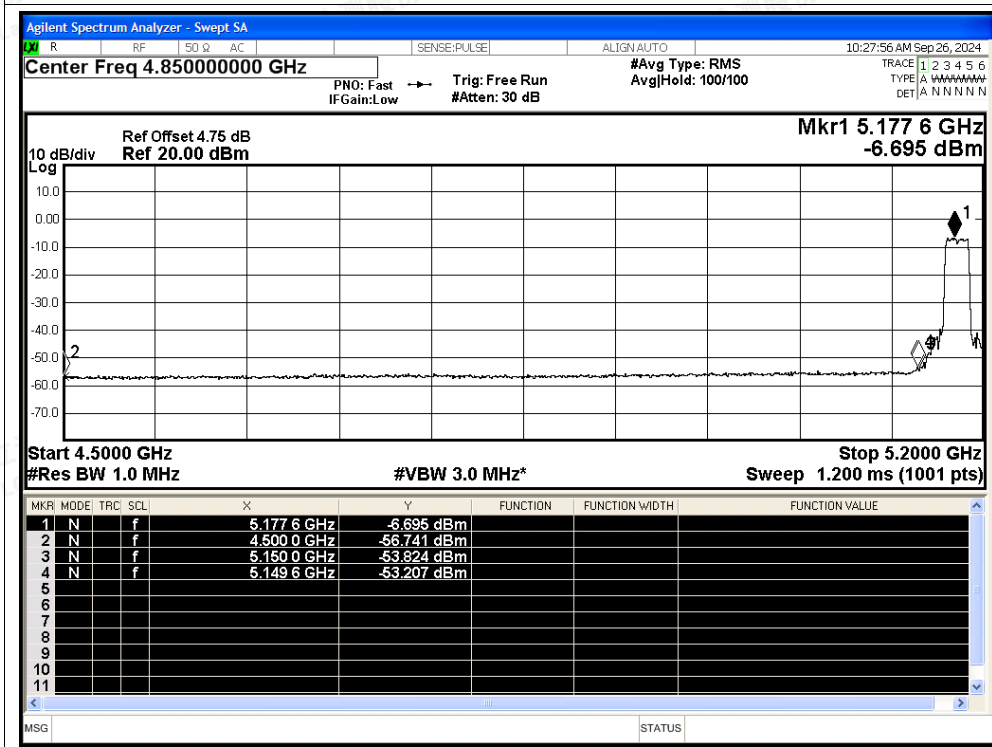

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant1 Peak

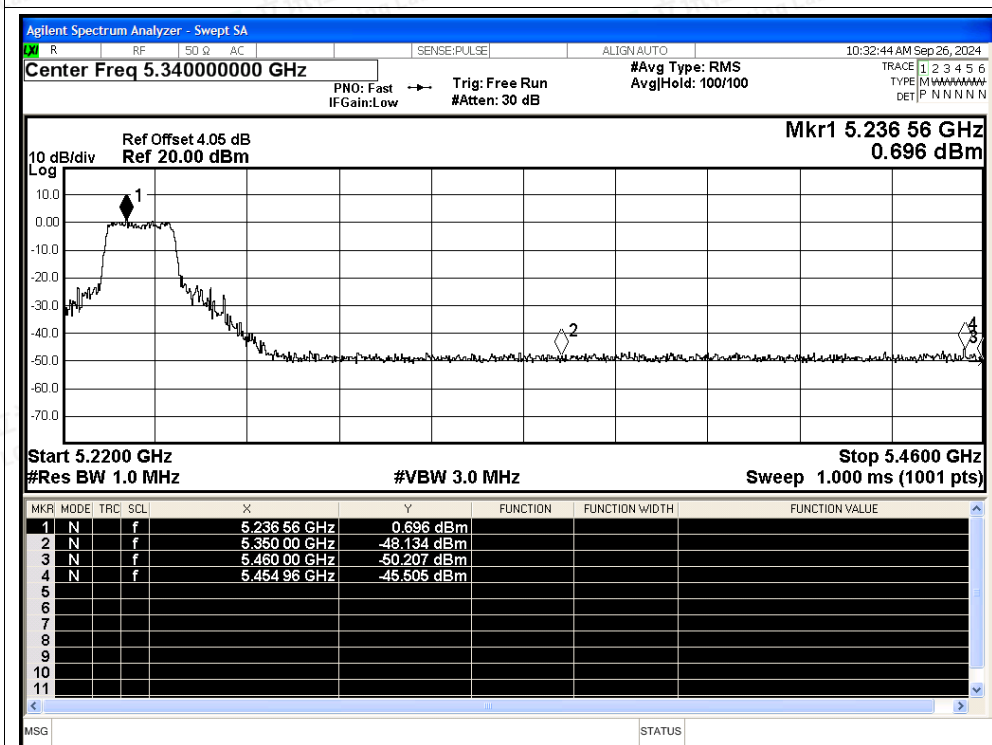

Restrict Band NVNT ax20 5240MHz Ant1 Average

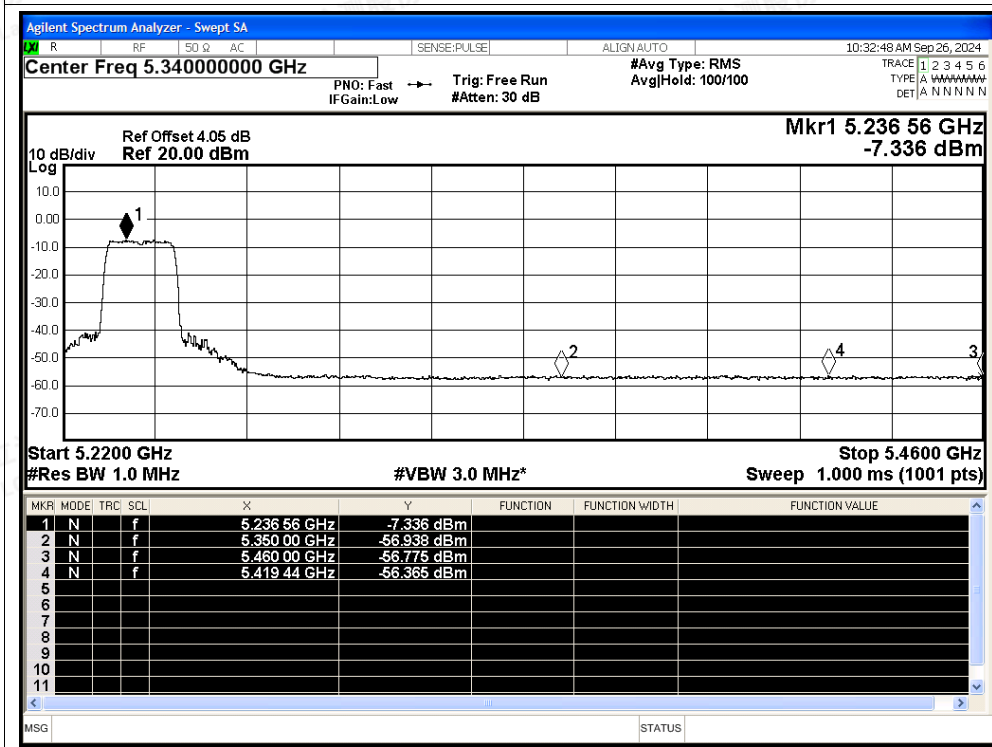

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant1 Peak

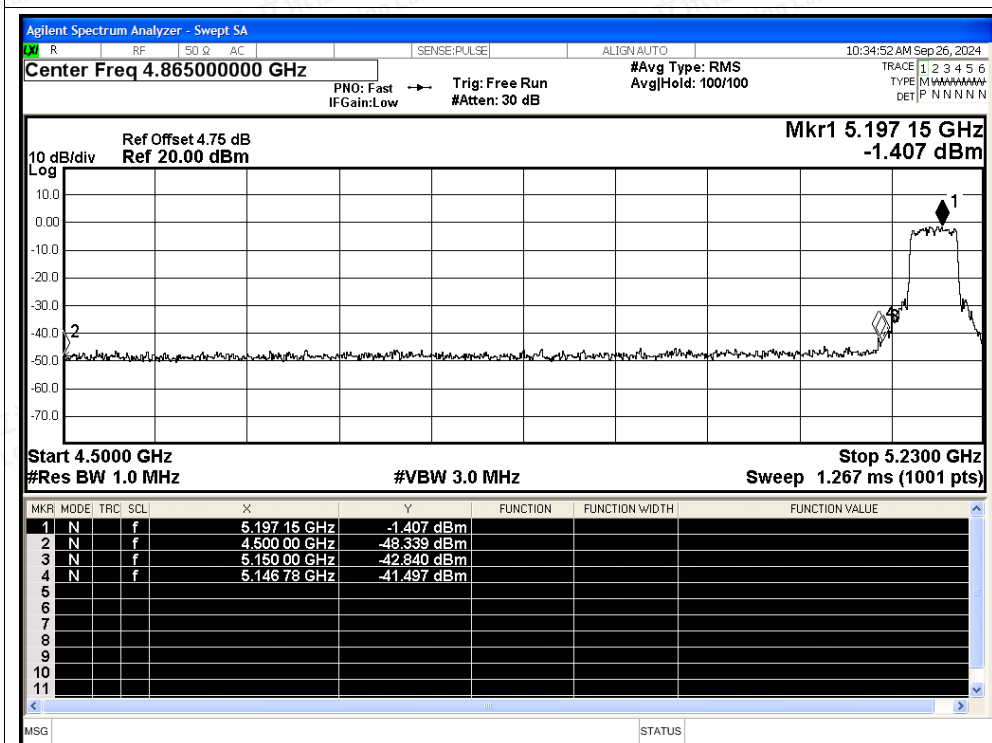

Restrict Band NVNT ax40 5190MHz Ant1 Average

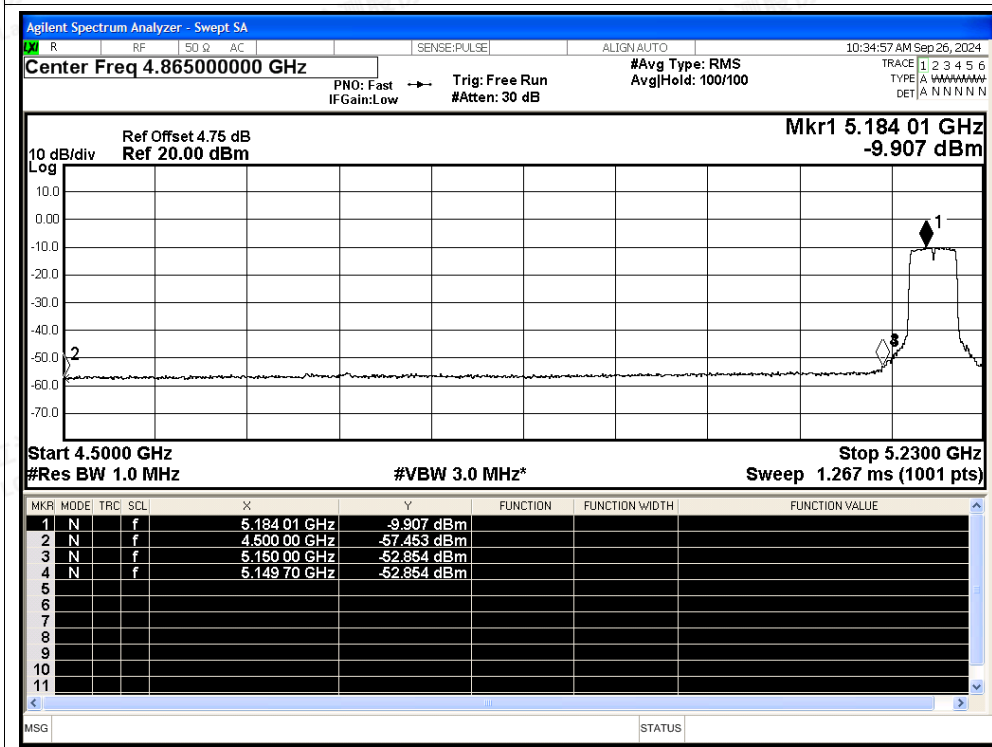

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant1 Peak

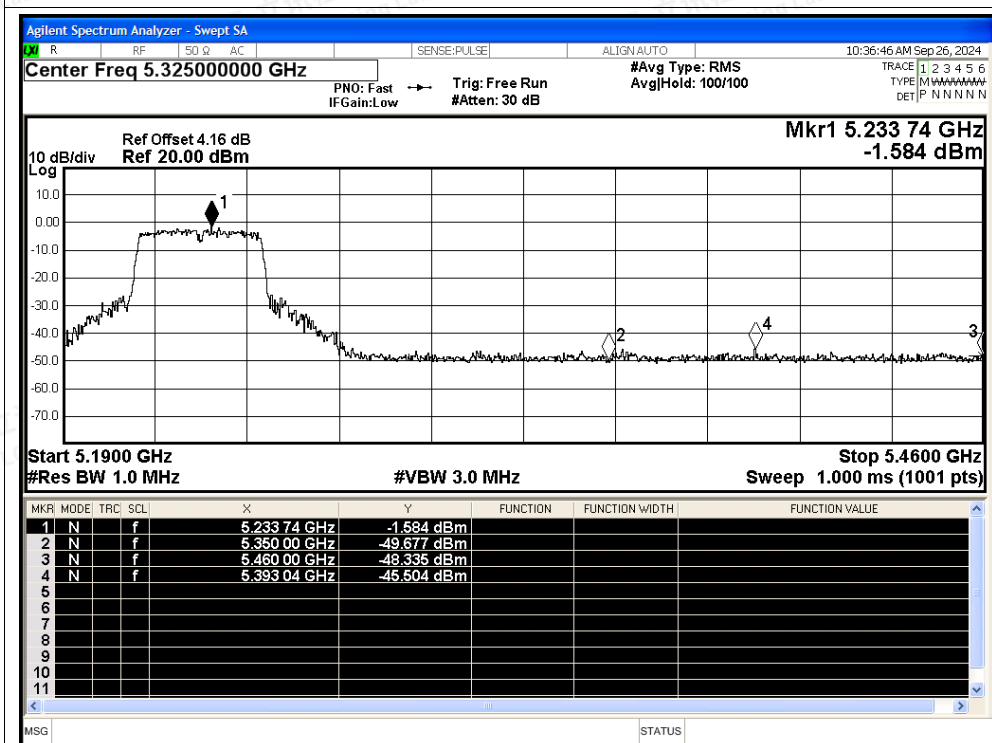

Restrict Band NVNT ax40 5230MHz Ant1 Average

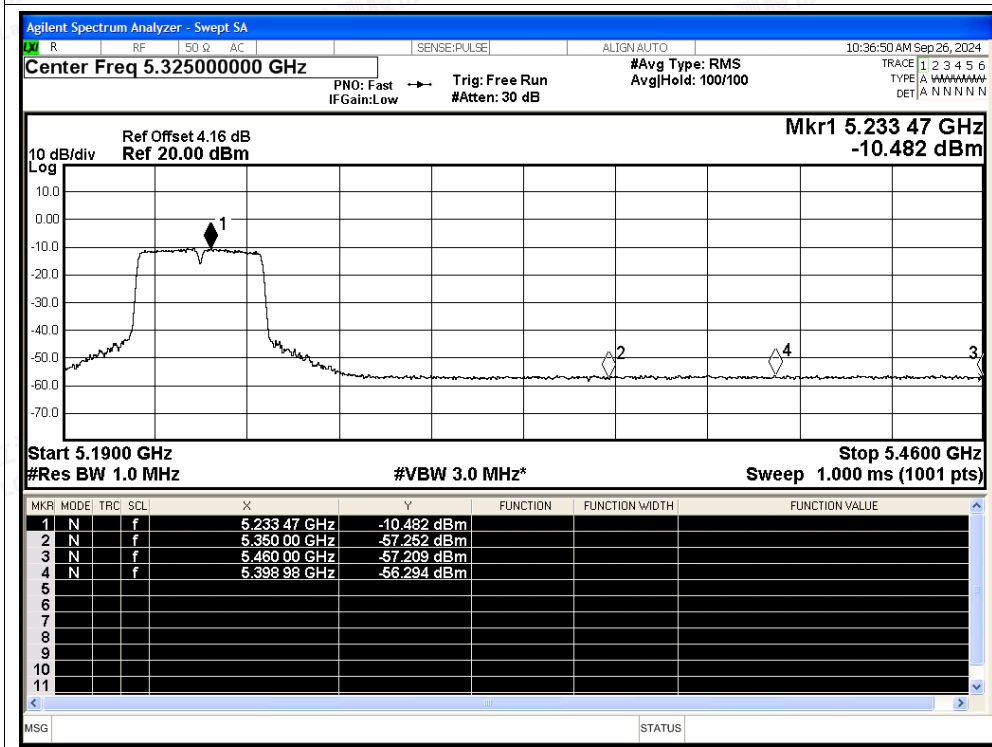

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

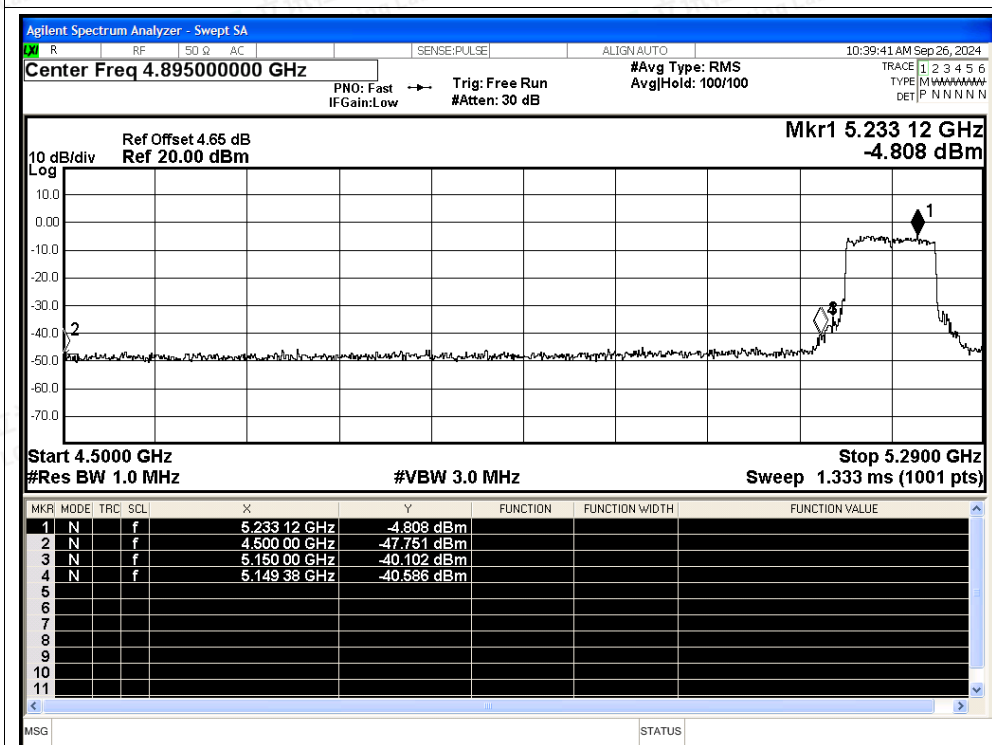

Restrict Band NVNT ax80 5210MHz Ant1 Average

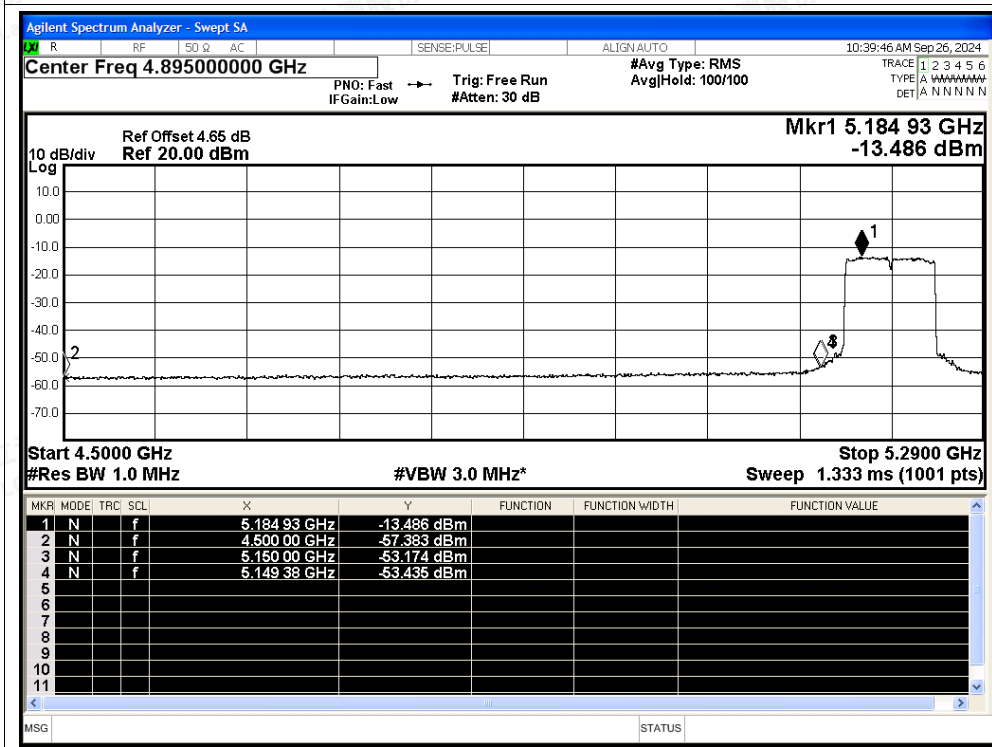

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

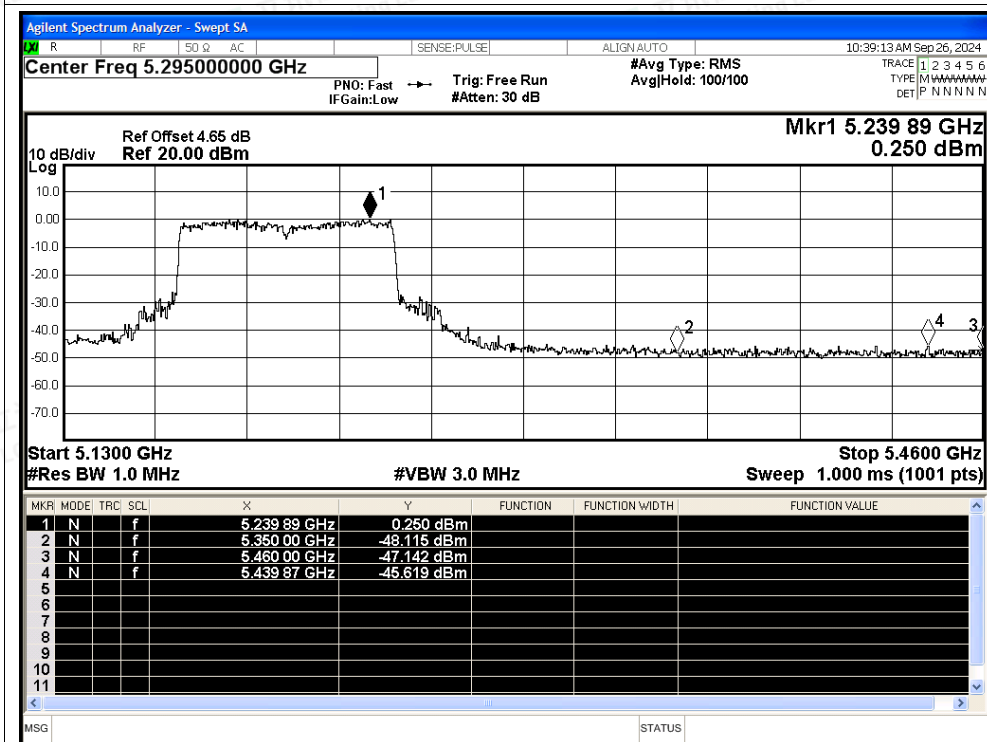

Restrict Band NVNT ax80 5210MHz Ant1 Average

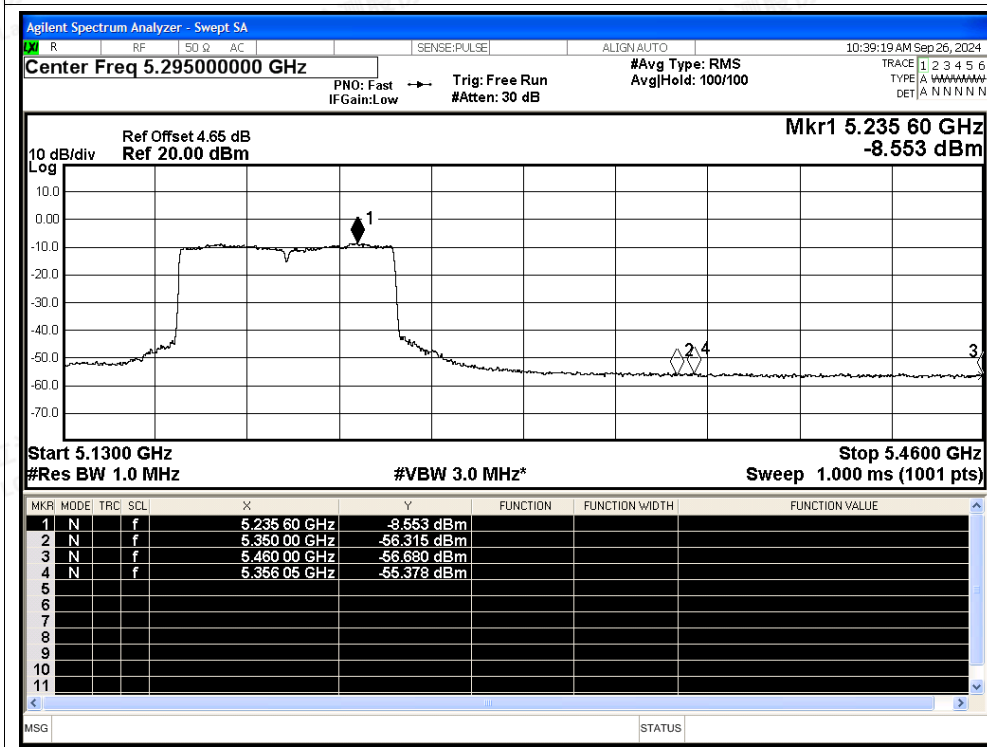

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant0 Power (dBm)	Ant1 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	4500	-48.89	-48.37	9.31	58.93	Peak	68.2	Pass
NVNT	n20	5180	4500	-57.6	-56.99	9.31	50.26	Average	54	Pass
NVNT	n20	5180	5148.9	-40.86	-40.99	9.31	66.62	Peak	68.2	Pass
NVNT	n20	5180	5149.6	-52.4	-55.2	9.31	53.97	Average	54	Pass
NVNT	n20	5180	5150	-39.09	-39.65	9.31	68.19	Peak	68.2	Pass
NVNT	n20	5180	5150	-53.76	-53.89	9.31	53.72	Average	54	Pass
NVNT	n20	5240	5350	-47.57	-47.78	9.31	59.87	Peak	68.2	Pass
NVNT	n20	5240	5350	-55.96	-56.71	9.31	51.23	Average	54	Pass
NVNT	n20	5240	5351.04	-45.48	-45.58	9.31	62.02	Peak	68.2	Pass
NVNT	n20	5240	5366.16	-55.6	-56.24	9.31	51.64	Average	54	Pass
NVNT	n20	5240	5460	-49.87	-49.1	9.31	58.08	Peak	68.2	Pass
NVNT	n20	5240	5460	-57.17	-57.14	9.31	50.39	Average	54	Pass
NVNT	n40	5190	4500	-48.65	-48.31	9.31	59.07	Peak	68.2	Pass
NVNT	n40	5190	4500	-57.17	-57.4	9.31	50.26	Average	54	Pass
NVNT	n40	5190	5147.51	-41.42	-41.24	9.31	66.22	Peak	68.2	Pass
NVNT	n40	5190	5149.7	-53.62	-53.89	9.31	53.79	Average	54	Pass
NVNT	n40	5190	5150	-41.77	-42.03	9.31	65.65	Peak	68.2	Pass
NVNT	n40	5190	5150	-53.98	-53.99	9.31	53.56	Average	54	Pass
NVNT	n40	5230	5350	-47.57	-48.76	9.31	59.42	Peak	68.2	Pass
NVNT	n40	5230	5350	-56.56	-55.95	9.31	51.30	Average	54	Pass
NVNT	n40	5230	5379.54	-46.22	-46.15	9.31	61.36	Peak	68.2	Pass
NVNT	n40	5230	5359.29	-56.1	-55.95	9.31	51.52	Average	54	Pass
NVNT	n40	5230	5460	-48.79	-49.08	9.31	58.62	Peak	68.2	Pass
NVNT	n40	5230	5460	-57.01	-56.94	9.31	50.57	Average	54	Pass
NVNT	ac20	5180	4500	-48.91	-47.75	9.31	59.26	Peak	68.2	Pass
NVNT	ac20	5180	4500	-57.49	-57.47	9.31	50.07	Average	54	Pass
NVNT	ac20	5180	5148.9	-42.46	-43.26	9.31	64.71	Peak	68.2	Pass
NVNT	ac20	5180	5149.6	-53.65	-53.54	9.31	53.95	Average	54	Pass
NVNT	ac20	5180	5150	-44.35	-46.07	9.31	62.42	Peak	68.2	Pass
NVNT	ac20	5180	5150	-53.41	-53.99	9.31	53.86	Average	54	Pass
NVNT	ac20	5240	5350	-49.72	-48.52	9.31	58.47	Peak	68.2	Pass
NVNT	ac20	5240	5350	-56.15	-56.67	9.31	51.15	Average	54	Pass
NVNT	ac20	5240	5392.08	-46.19	-45.99	9.31	61.46	Peak	68.2	Pass
NVNT	ac20	5240	5371.68	-55.78	-56.09	9.31	51.62	Average	54	Pass
NVNT	ac20	5240	5460	-49.23	-47.81	9.31	59.09	Peak	68.2	Pass
NVNT	ac20	5240	5460	-56.5	-56.86	9.31	50.87	Average	54	Pass
NVNT	ac40	5190	4500	-49.7	-48.99	9.31	58.22	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	4500	-57.57	-57.86	9.31	49.84	Average	54	Pass
NVNT	ac40	5190	5148.97	-41.38	-41.15	9.31	66.28	Peak	68.2	Pass
NVNT	ac40	5190	5147.51	-53.96	-53.24	9.31	53.96	Average	54	Pass
NVNT	ac40	5190	5150	-42.52	-41.15	9.31	65.77	Peak	68.2	Pass
NVNT	ac40	5190	5150	-54.15	-53.32	9.31	53.83	Average	54	Pass
NVNT	ac40	5230	5350	-48.42	-49.85	9.31	58.47	Peak	68.2	Pass
NVNT	ac40	5230	5350	-56.89	-56.81	9.31	50.70	Average	54	Pass
NVNT	ac40	5230	5351.19	-45.38	-46.17	9.31	61.79	Peak	68.2	Pass
NVNT	ac40	5230	5387.37	-56.08	-56.11	9.31	51.45	Average	54	Pass
NVNT	ac40	5230	5460	-50.22	-49.18	9.31	57.88	Peak	68.2	Pass
NVNT	ac40	5230	5460	-56.74	-57.13	9.31	50.62	Average	54	Pass
NVNT	ac80	5210	5350	-47.94	-49.45	9.31	58.92	Peak	68.2	Pass
NVNT	ac80	5210	5350	-56.49	-55.53	9.31	51.56	Average	54	Pass
NVNT	ac80	5210	5355.39	-45.9	-45.24	9.31	61.99	Peak	68.2	Pass
NVNT	ac80	5210	5351.43	-55.4	-55.46	9.31	52.12	Average	54	Pass
NVNT	ac80	5210	5460	-48.54	-49.42	9.31	58.59	Peak	68.2	Pass
NVNT	ac80	5210	5460	-56.46	-55.84	9.31	51.41	Average	54	Pass
NVNT	ac80	5210	4500	-49.2	-47.17	9.31	59.48	Peak	68.2	Pass
NVNT	ac80	5210	4500	-57.51	-57.55	9.31	50.02	Average	54	Pass
NVNT	ac80	5210	5147.8	-40.59	-43.4	9.31	65.78	Peak	68.2	Pass
NVNT	ac80	5210	5149.38	-53.97	-53.93	9.31	53.60	Average	54	Pass
NVNT	ac80	5210	5150	-39.84	-41.42	9.31	66.99	Peak	68.2	Pass
NVNT	ac80	5210	5150	-53.68	-53.97	9.31	53.73	Average	54	Pass
NVNT	ax20	5180	4500	-49.04	-50.28	9.31	57.93	Peak	68.2	Pass
NVNT	ax20	5180	4500	-57.03	-56.74	9.31	50.67	Average	54	Pass
NVNT	ax20	5180	5148.9	-43.74	-43.63	9.31	63.86	Peak	68.2	Pass
NVNT	ax20	5180	5149.6	-53.97	-53.98	9.31	53.57	Average	54	Pass
NVNT	ax20	5180	5150	-44.62	-43.88	9.31	63.31	Peak	68.2	Pass
NVNT	ax20	5180	5150	-54.11	-53.82	9.31	53.59	Average	54	Pass
NVNT	ax20	5240	5350	-48.4	-48.13	9.31	59.28	Peak	68.2	Pass
NVNT	ax20	5240	5350	-57.7	-56.94	9.31	50.24	Average	54	Pass
NVNT	ax20	5240	5436.48	-46.32	-45.51	9.31	61.65	Peak	68.2	Pass
NVNT	ax20	5240	5451.84	-56.22	-56.37	9.31	51.25	Average	54	Pass
NVNT	ax20	5240	5460	-50.71	-50.21	9.31	57.10	Peak	68.2	Pass
NVNT	ax20	5240	5460	-56.52	-56.78	9.31	50.90	Average	54	Pass
NVNT	ax40	5190	4500	-48.8	-48.34	9.31	58.98	Peak	68.2	Pass
NVNT	ax40	5190	4500	-56.94	-57.45	9.31	50.36	Average	54	Pass
NVNT	ax40	5190	5148.24	-40.65	-41.5	9.31	66.49	Peak	68.2	Pass
NVNT	ax40	5190	5149.7	-53.39	-53.86	9.31	53.93	Average	54	Pass
NVNT	ax40	5190	5150	-44.11	-42.84	9.31	64.12	Peak	68.2	Pass
NVNT	ax40	5190	5150	-53.79	-53.85	9.31	53.73	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	5350	-49.66	-49.68	9.31	57.88	Peak	68.2	Pass
NVNT	ax40	5230	5350	-57.03	-57.25	9.31	50.41	Average	54	Pass
NVNT	ax40	5230	5396.55	-45.68	-45.5	9.31	61.96	Peak	68.2	Pass
NVNT	ax40	5230	5406.81	-56.15	-56.29	9.31	51.33	Average	54	Pass
NVNT	ax40	5230	5460	-48.42	-48.34	9.31	59.17	Peak	68.2	Pass
NVNT	ax40	5230	5460	-56.71	-57.21	9.31	50.60	Average	54	Pass
NVNT	ax80	5210	5350	-47.23	-47.75	9.31	60.07	Peak	68.2	Pass
NVNT	ax80	5210	5350	-56.33	-57.38	9.31	50.72	Average	54	Pass
NVNT	ax80	5210	5431.95	-45.35	-40.59	9.31	65.20	Peak	68.2	Pass
NVNT	ax80	5210	5407.86	-55.4	-53.44	9.31	53.24	Average	54	Pass
NVNT	ax80	5210	5460	-50.2	-40.1	9.31	64.84	Peak	68.2	Pass
NVNT	ax80	5210	5460	-55.94	-53.17	9.31	53.21	Average	54	Pass
NVNT	ax80	5210	4500	-49.97	-48.12	9.31	58.60	Peak	68.2	Pass
NVNT	ax80	5210	4500	-56.76	-56.32	9.31	51.01	Average	54	Pass
NVNT	ax80	5210	5148.59	-41.87	-45.62	9.31	64.20	Peak	68.2	Pass
NVNT	ax80	5210	5146.22	-52.21	-55.68	9.31	53.94	Average	54	Pass
NVNT	ax80	5210	5150	-41.5	-47.14	9.31	64.09	Peak	68.2	Pass
NVNT	ax80	5210	5150	-52.62	-56.68	9.31	53.36	Average	54	Pass





D.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant0	5180	0	0	25	Pass
NVNT	a	5200	Ant0	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant0	5240	0	0	25	Pass
NVNT	n20	5180	Ant0	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant0	5200	0	0	25	Pass
NVNT	n20	5240	Ant0	5240.02	20000	3.82	25	Pass
NVNT	n40	5190	Ant0	5190	0	0	25	Pass
NVNT	n40	5230	Ant0	5230	0	0	25	Pass
NVNT	ac20	5180	Ant0	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant0	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant0	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant0	5190	0	0	25	Pass
NVNT	ac40	5230	Ant0	5230	0	0	25	Pass
NVNT	ac80	5210	Ant0	5210	0	0	25	Pass
NVNT	ax20	5180	Ant0	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant0	5199.96	-40000	-7.69	25	Pass
NVNT	ax20	5240	Ant0	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant0	5190	0	0	25	Pass
NVNT	ax40	5230	Ant0	5230	0	0	25	Pass
NVNT	ax80	5210	Ant0	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant0

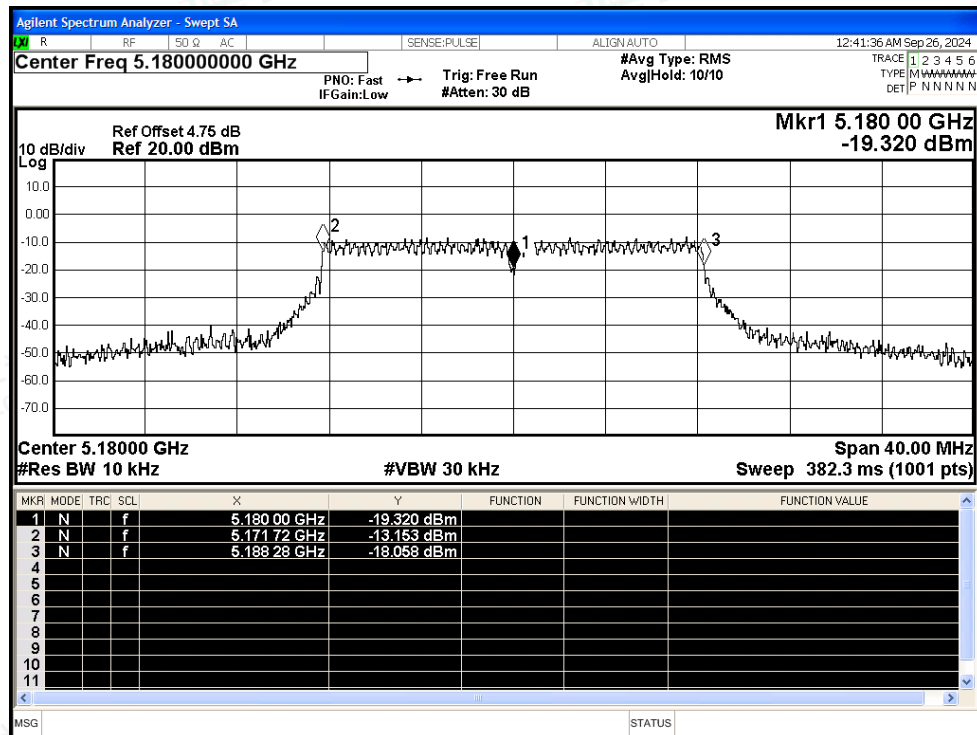

Freq. Stability NVNT a 5200MHz Ant0

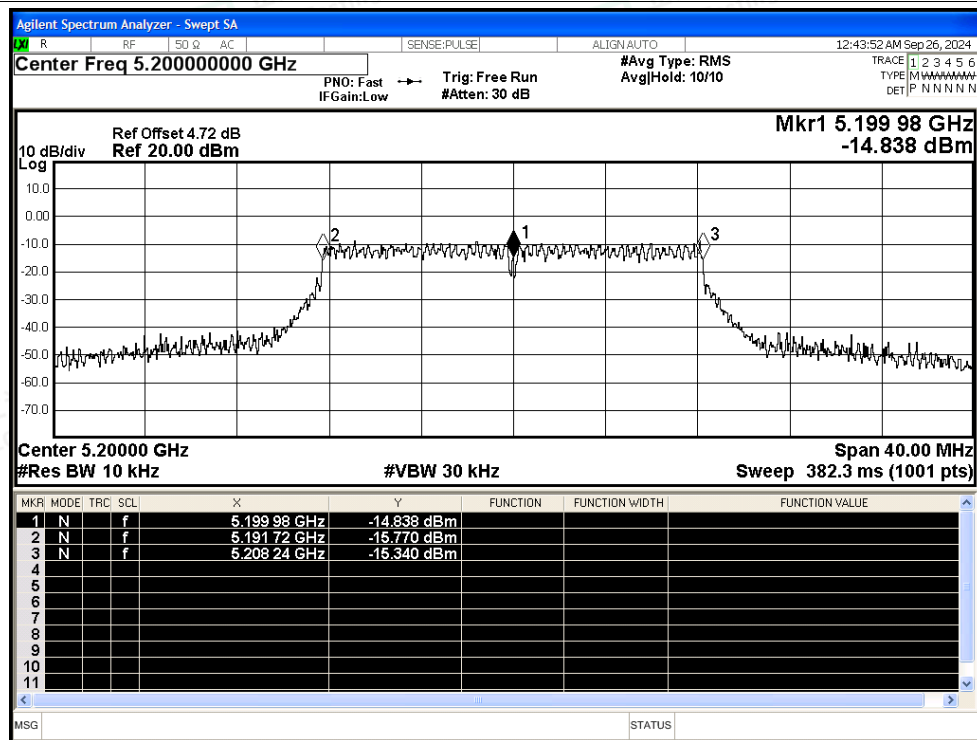

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant0

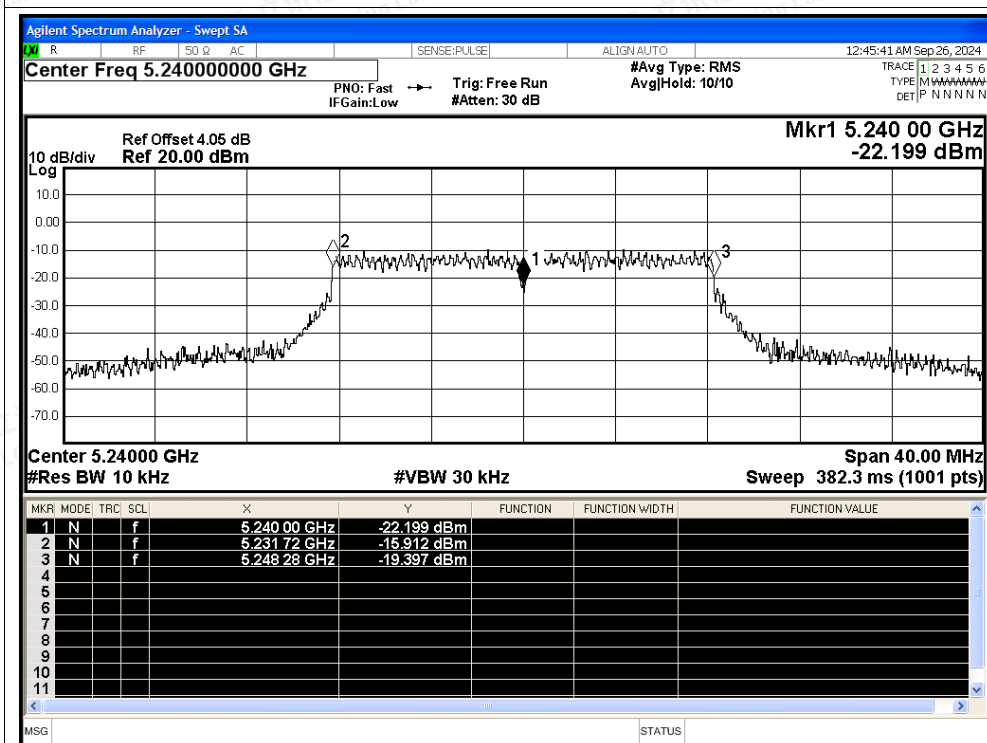

Freq. Stability NVNT n20 5180MHz Ant0

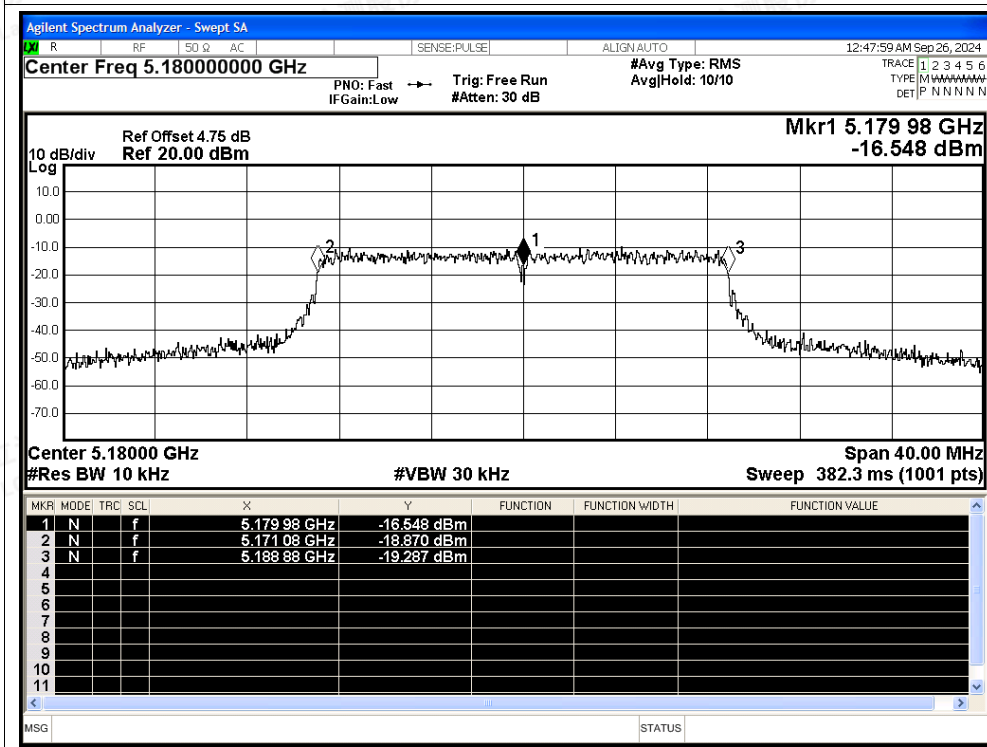

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant0

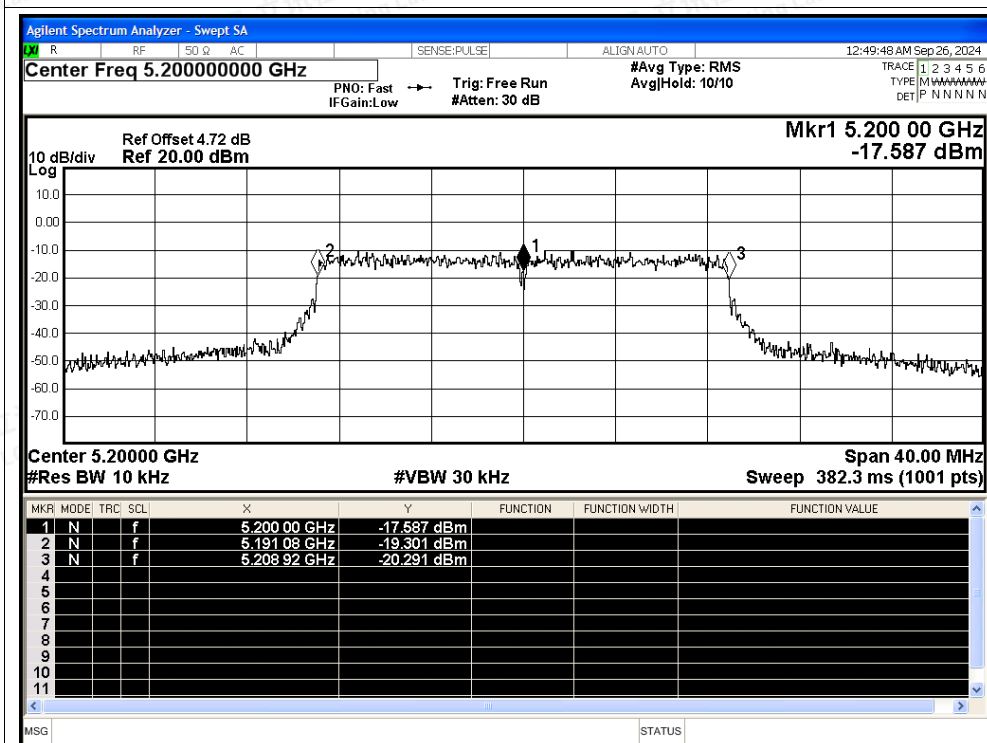

Freq. Stability NVNT n20 5240MHz Ant0

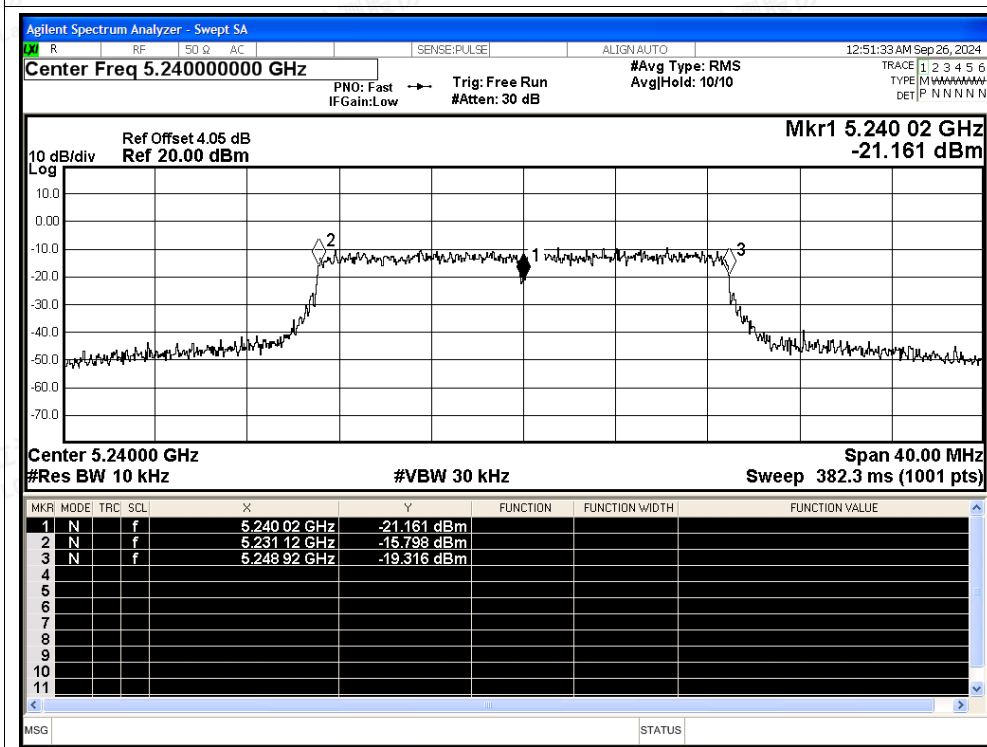

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant0

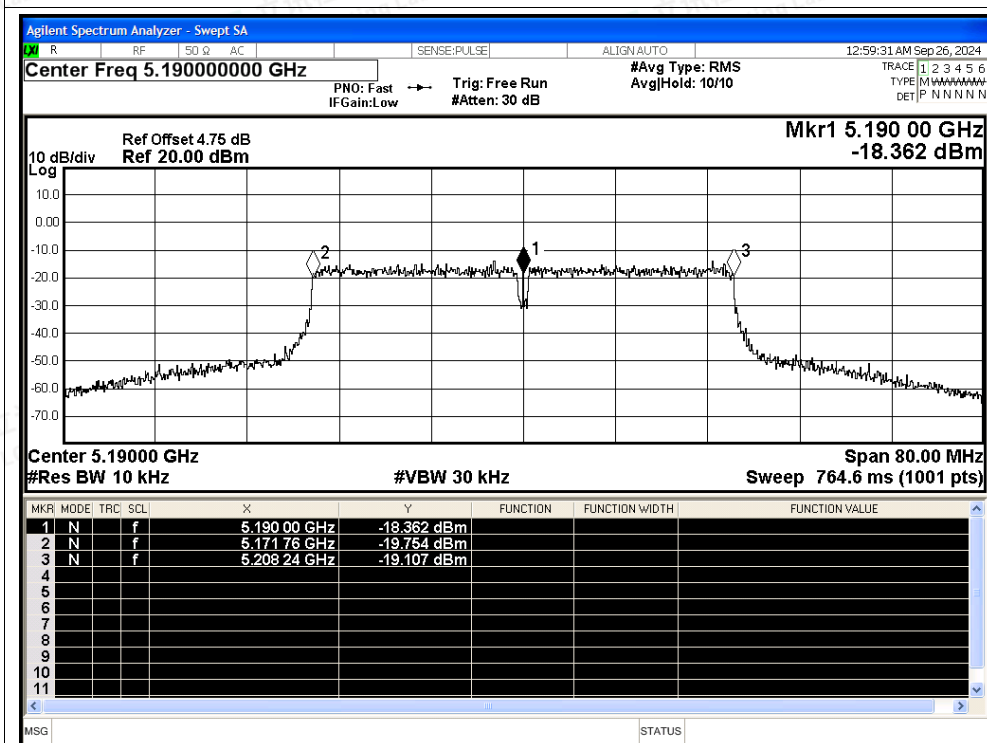

Freq. Stability NVNT n40 5230MHz Ant0

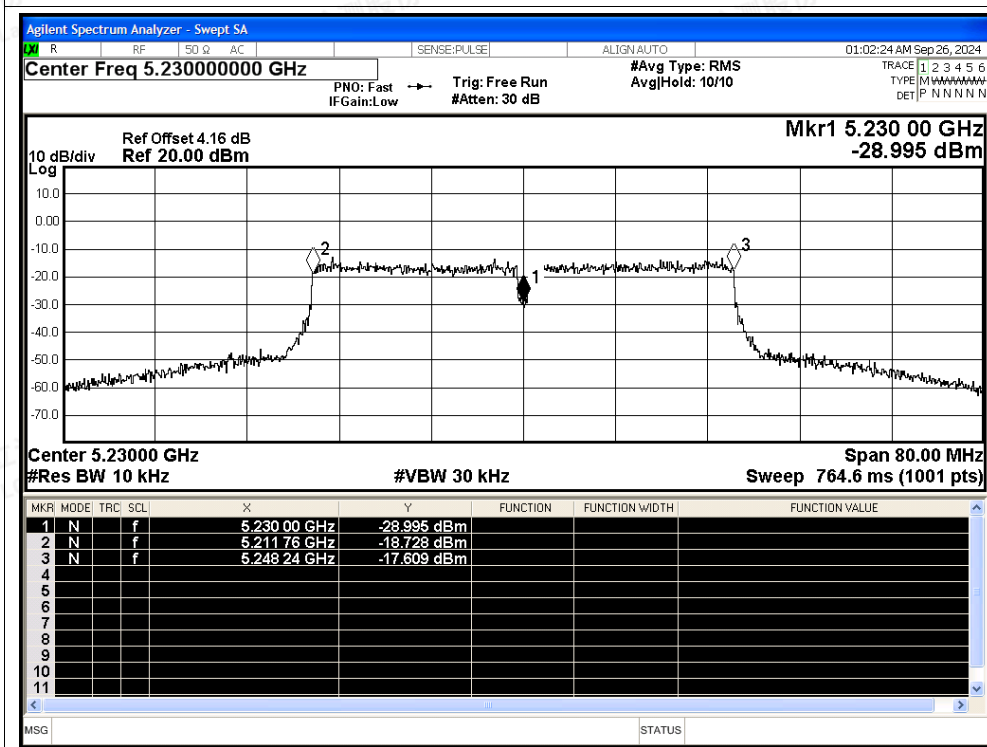


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

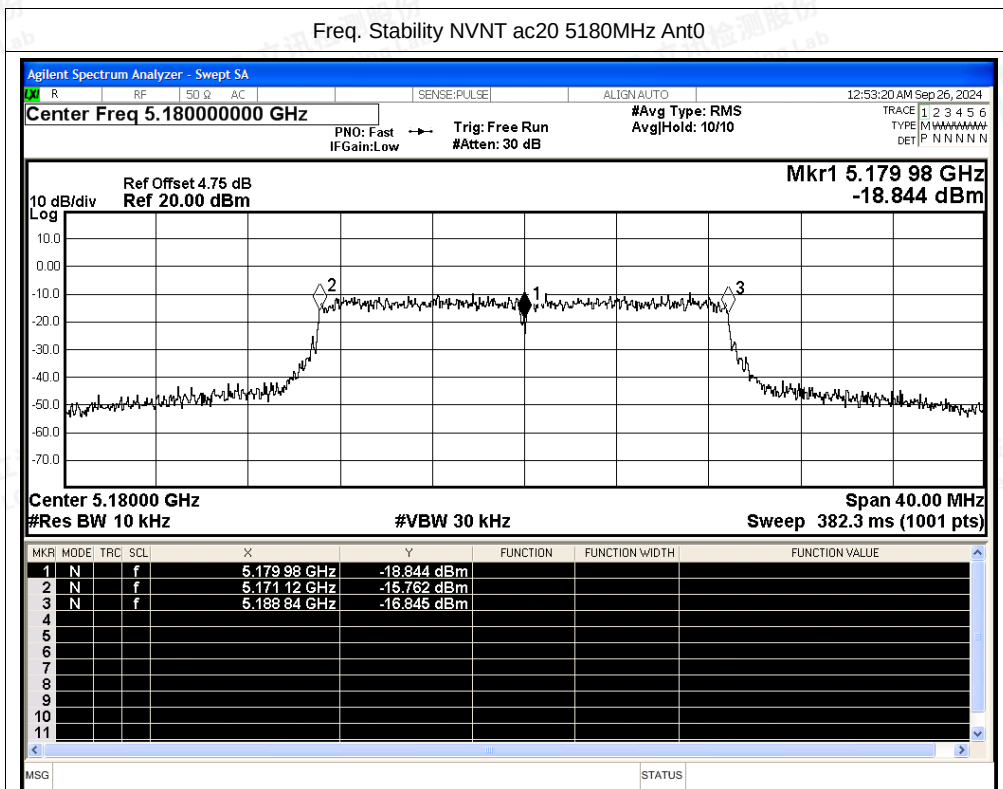

Freq. Stability NVNT ac20 5200MHz Ant0


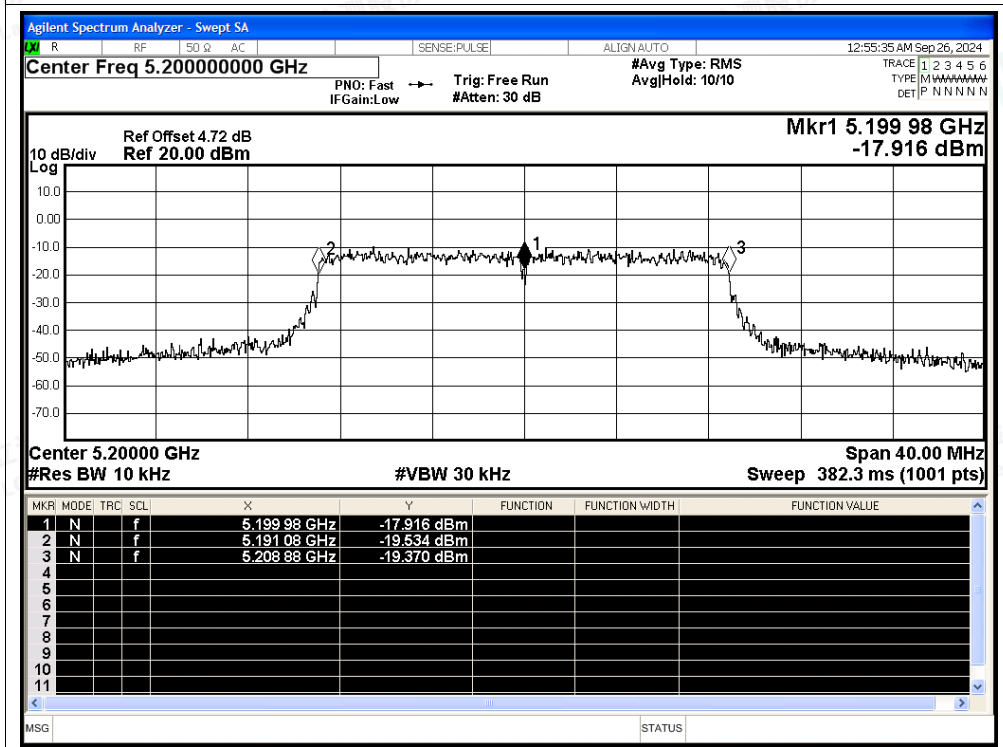


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

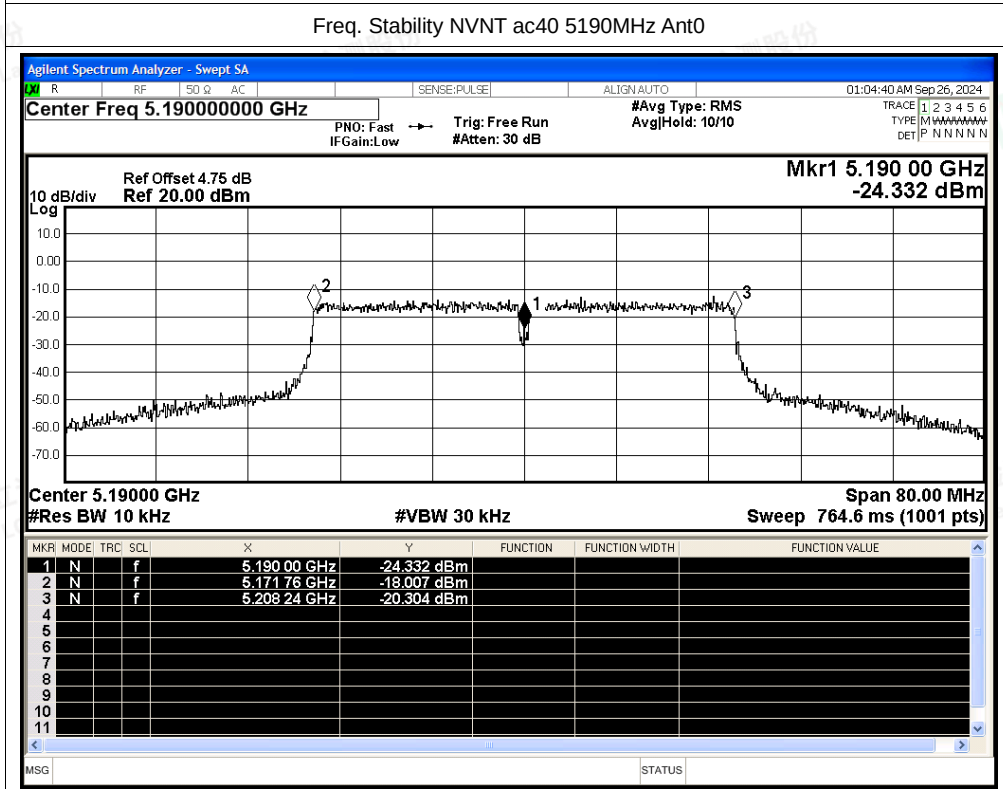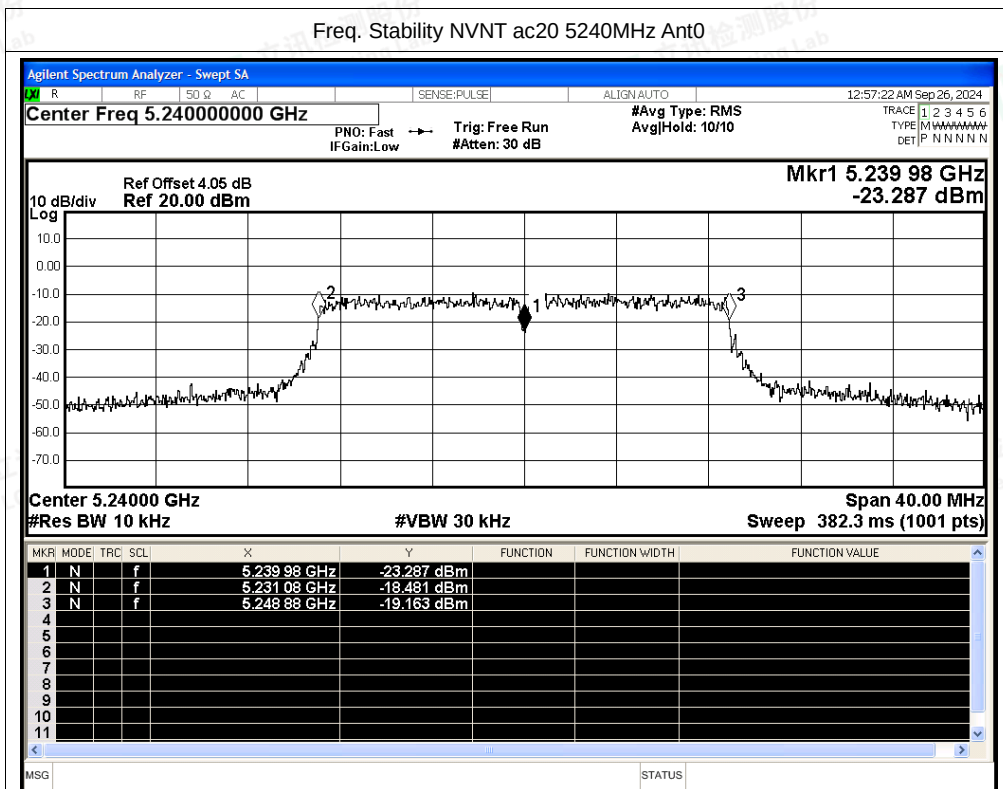

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant0

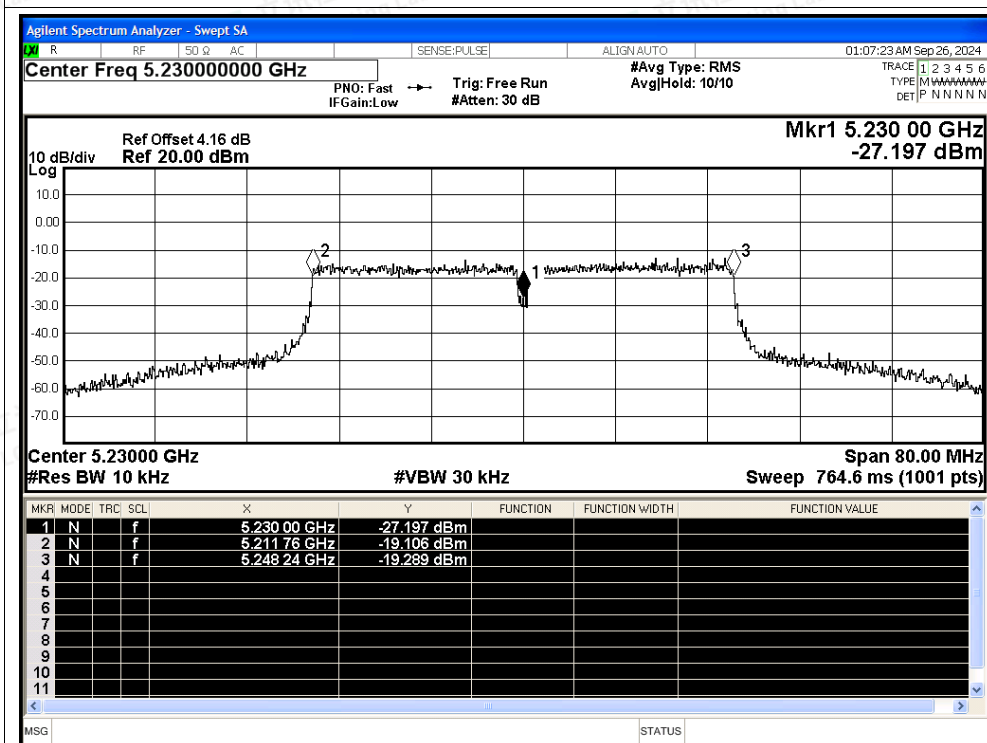

Freq. Stability NVNT ac80 5210MHz Ant0

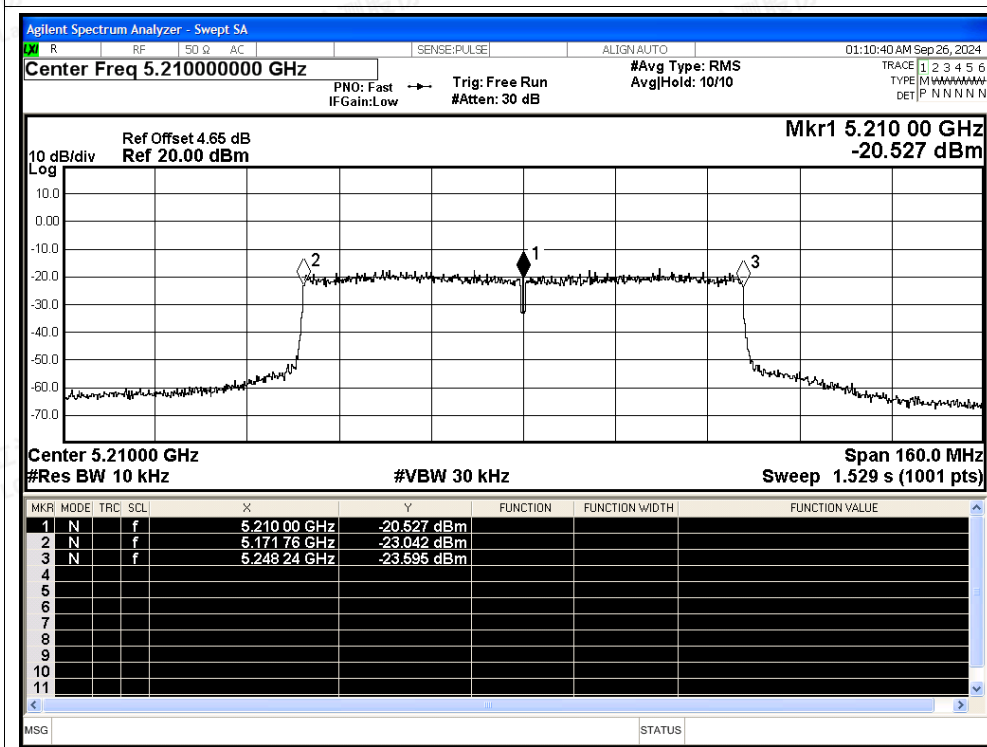

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac80 5210MHz Ant0

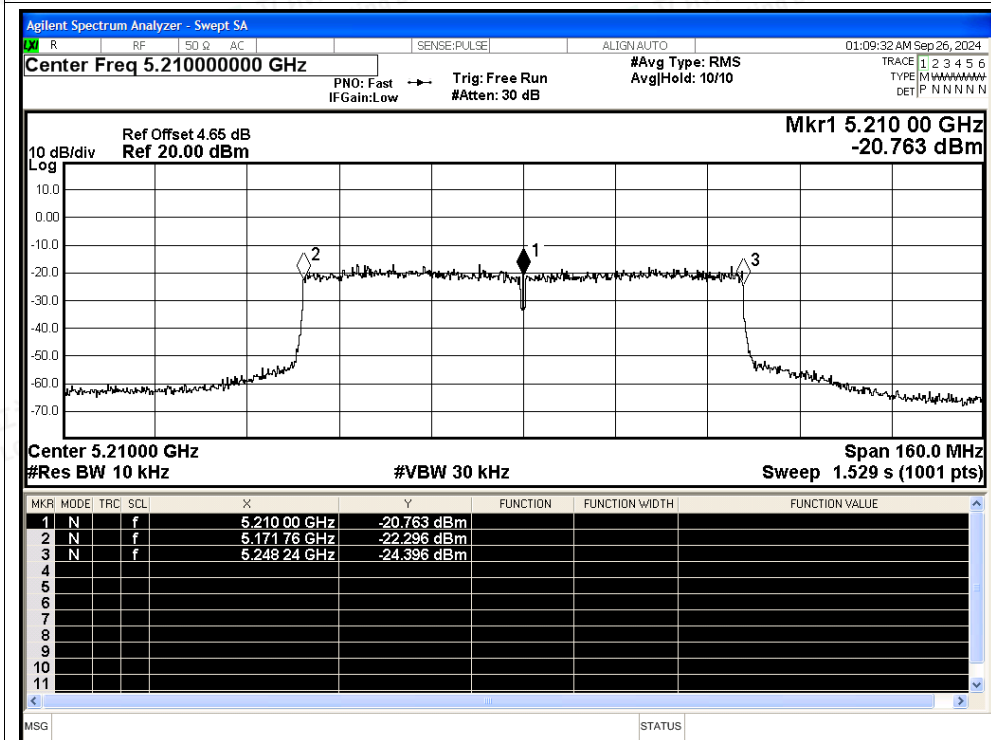

Freq. Stability NVNT ax20 5180MHz Ant0


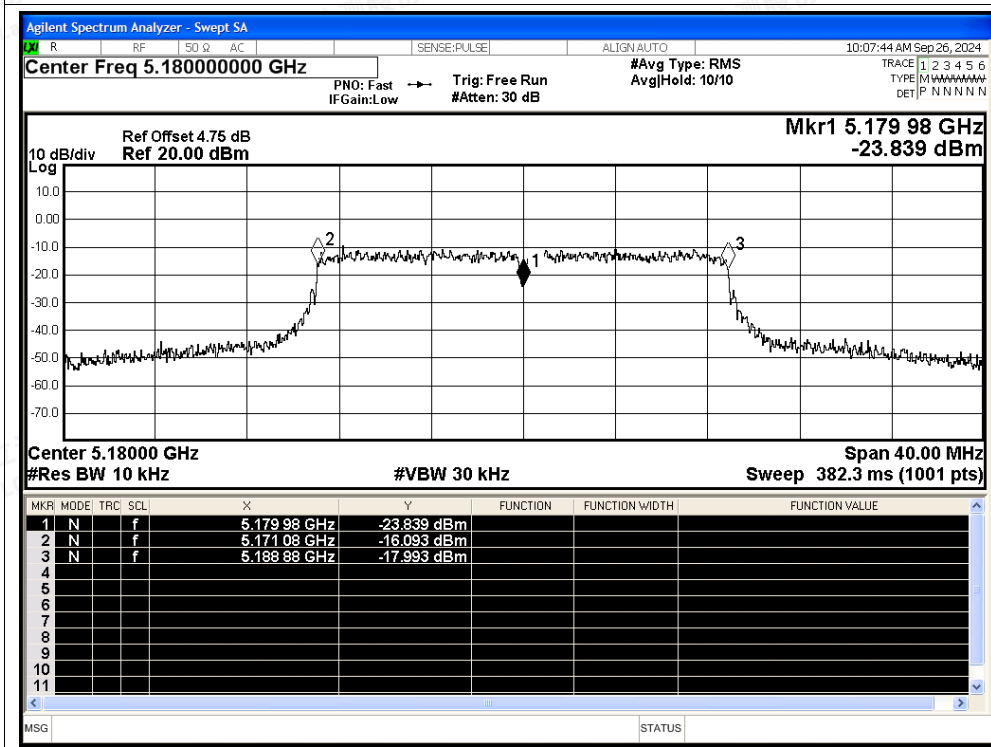


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

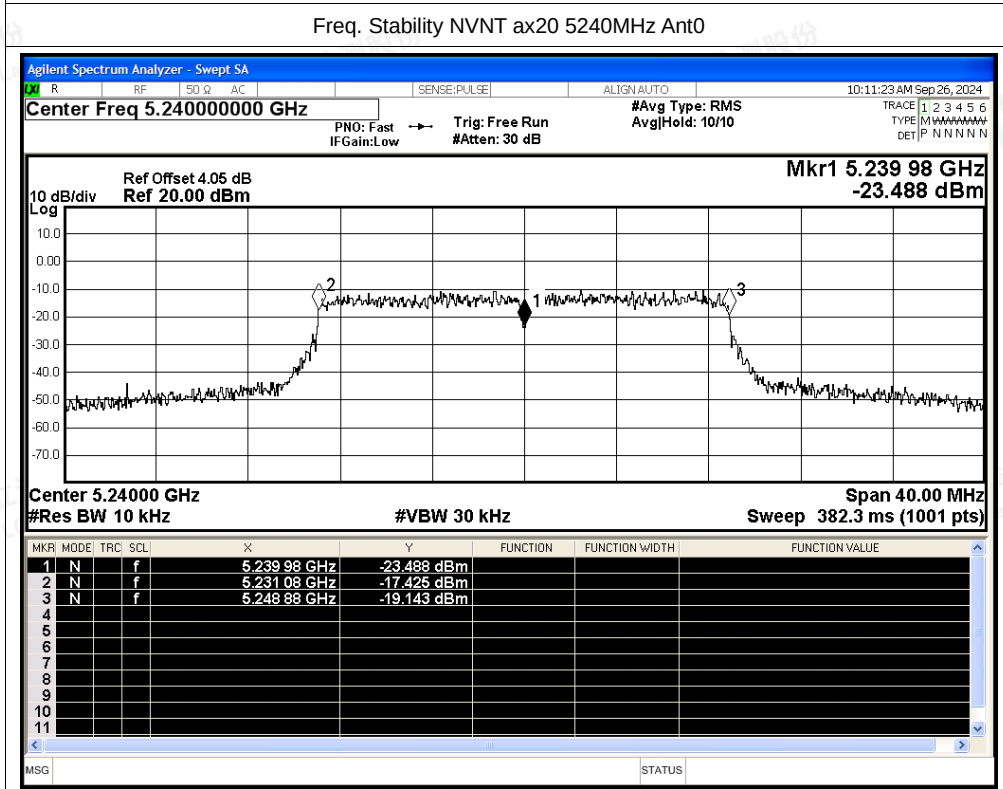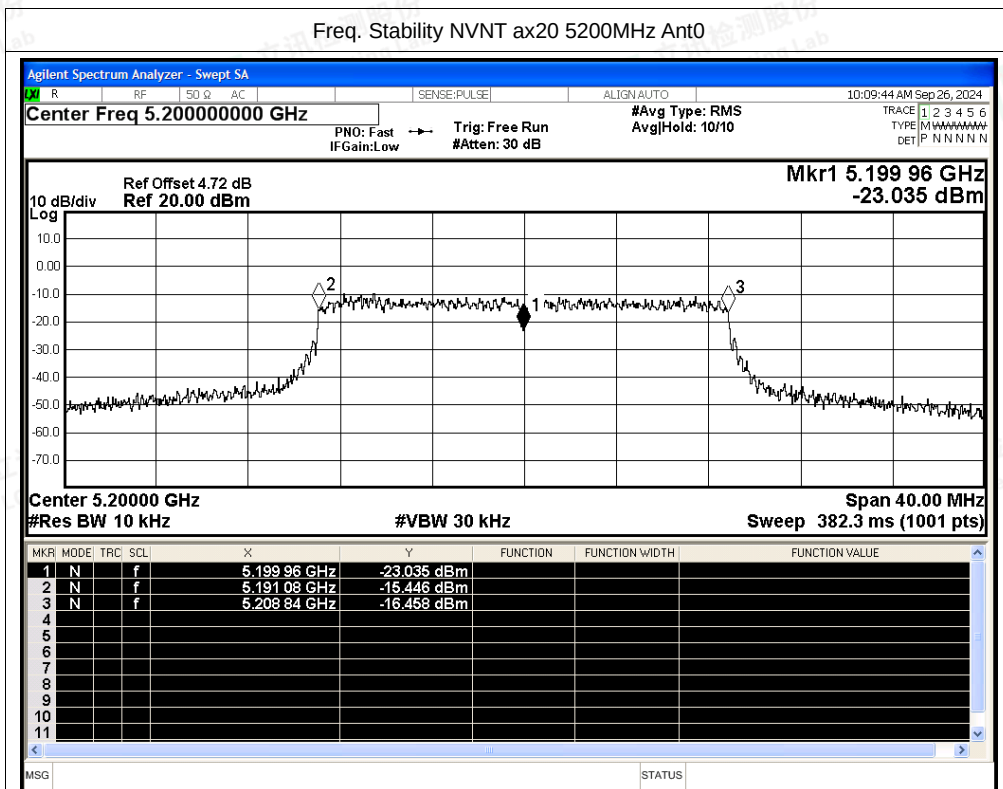

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5190MHz Ant0

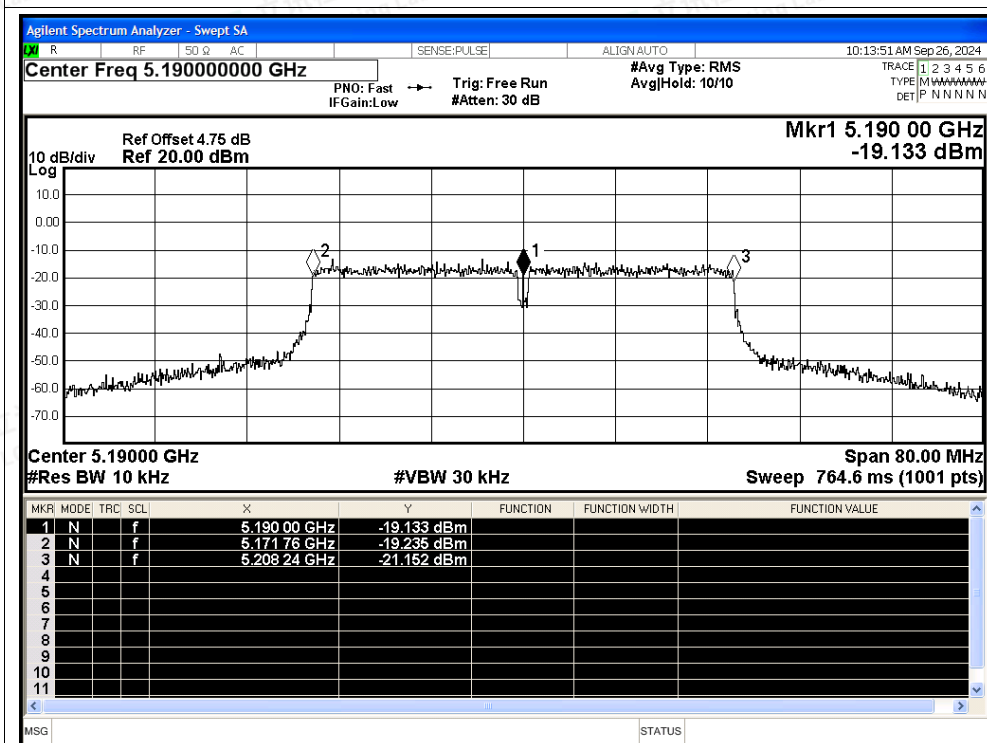

Freq. Stability NVNT ax40 5230MHz Ant0

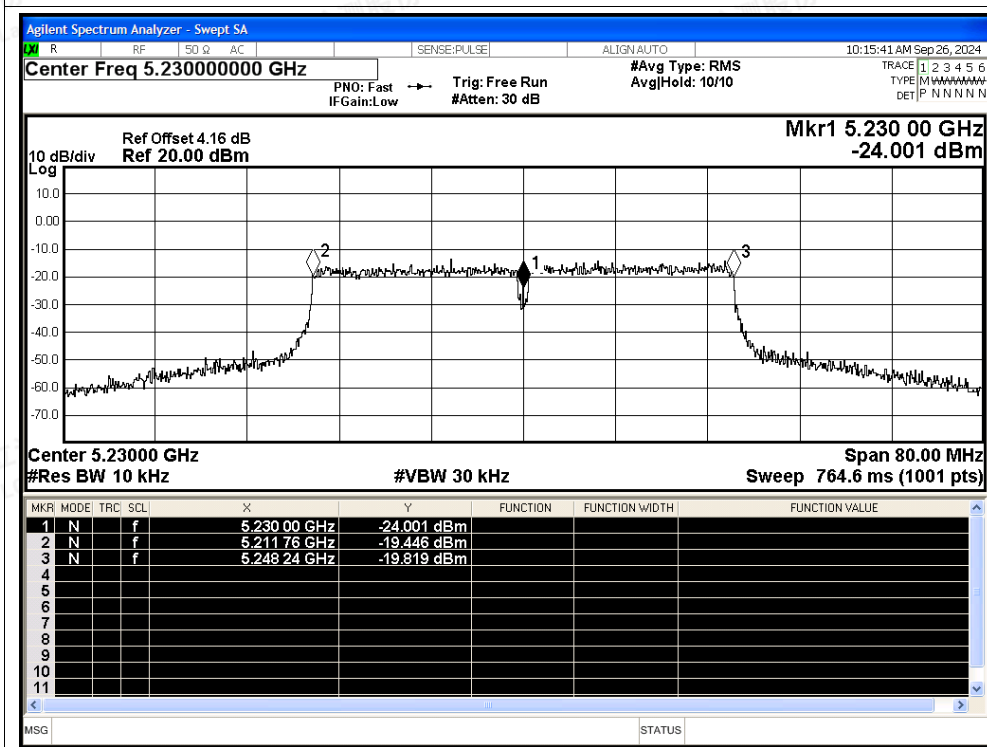


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

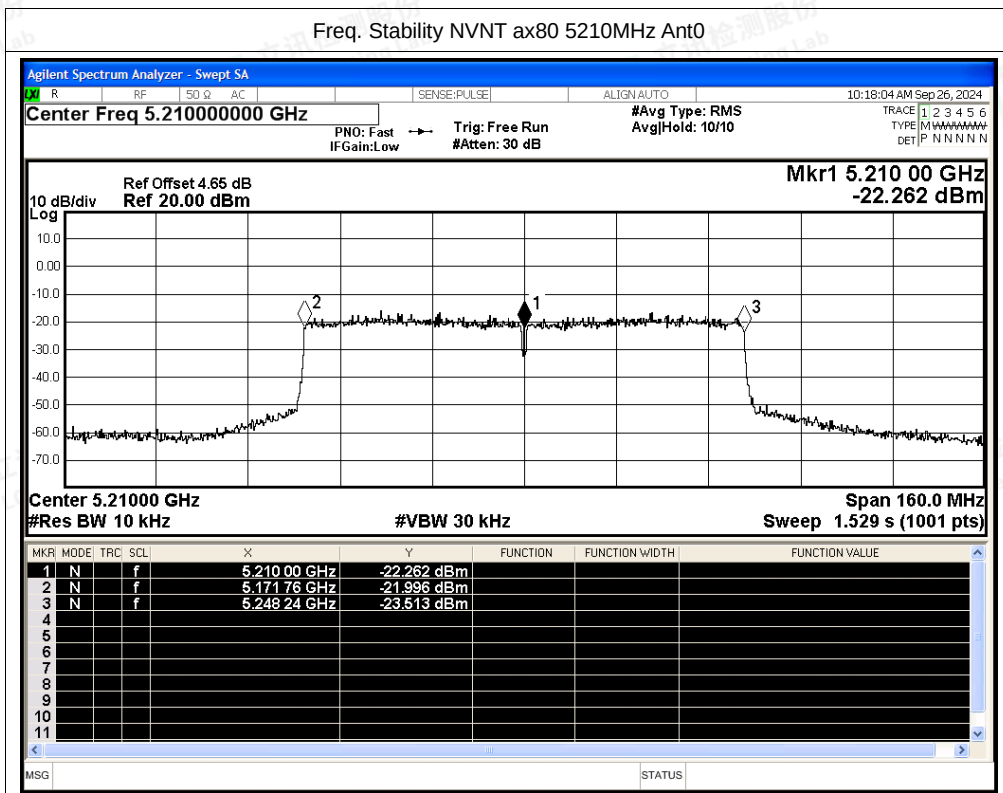




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant1	5200	0	0	25	Pass
NVNT	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant1	5240	0	0	25	Pass
NVNT	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass
NVNT	ax20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant1	5190	0	0	25	Pass
NVNT	ax40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ax80	5210	Ant1	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant1

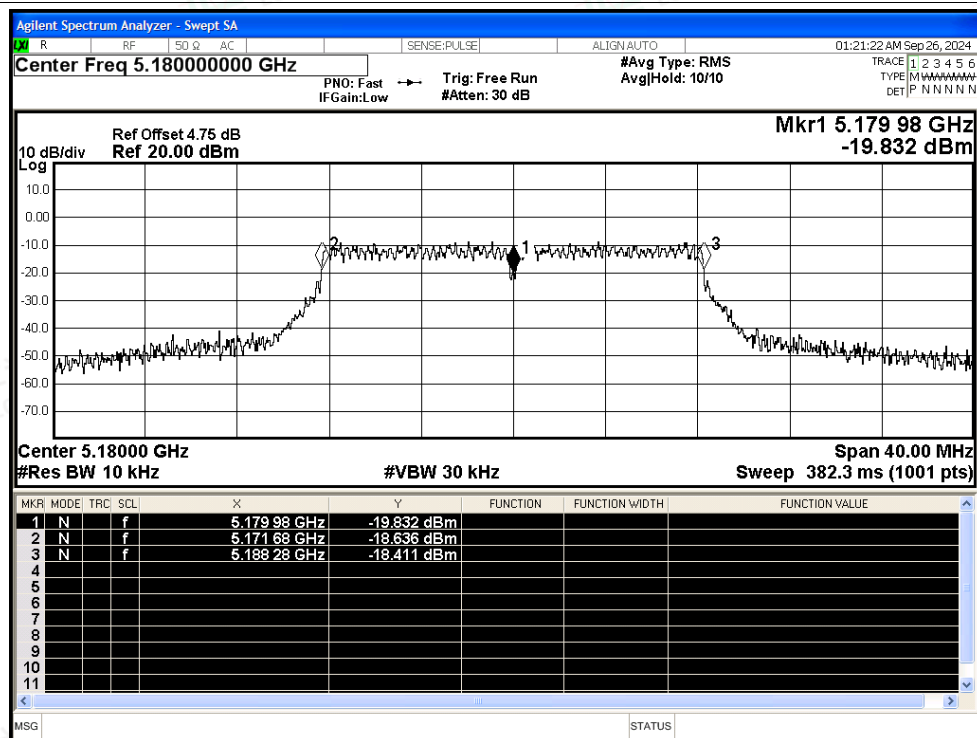

Freq. Stability NVNT a 5200MHz Ant1

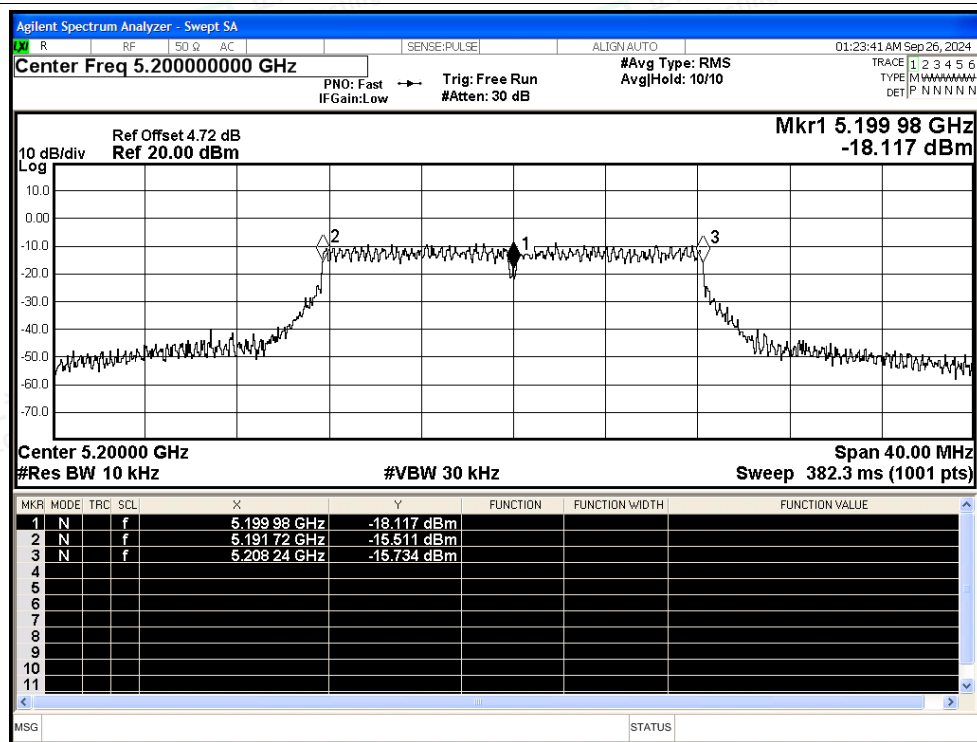

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant1

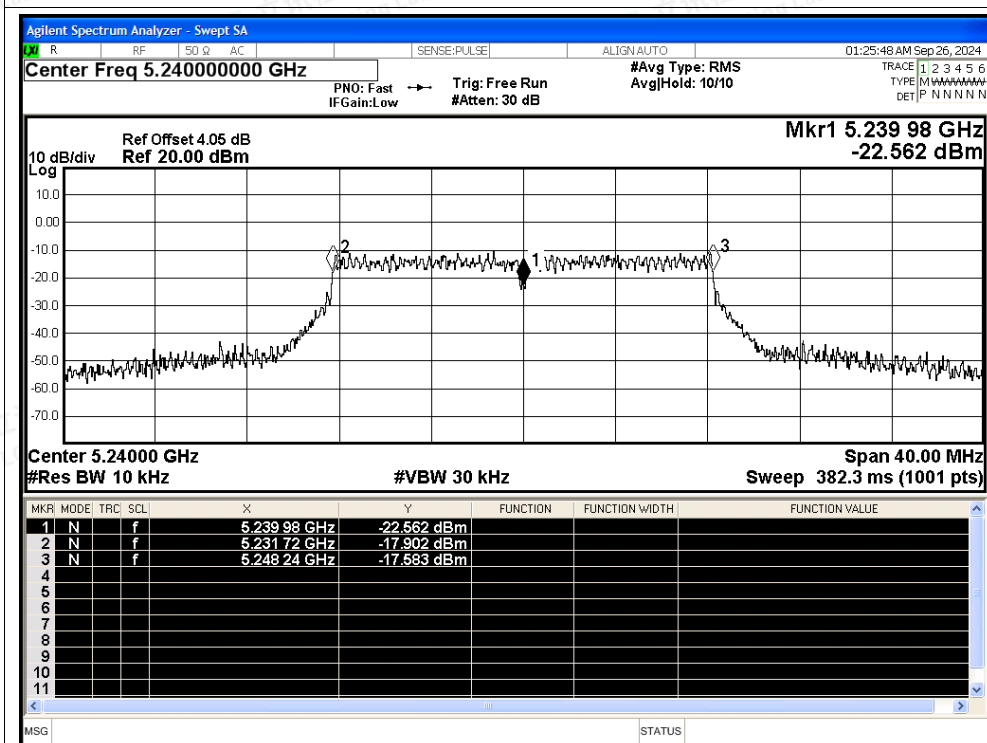


Freq. Stability NVNT n20 5180MHz Ant1

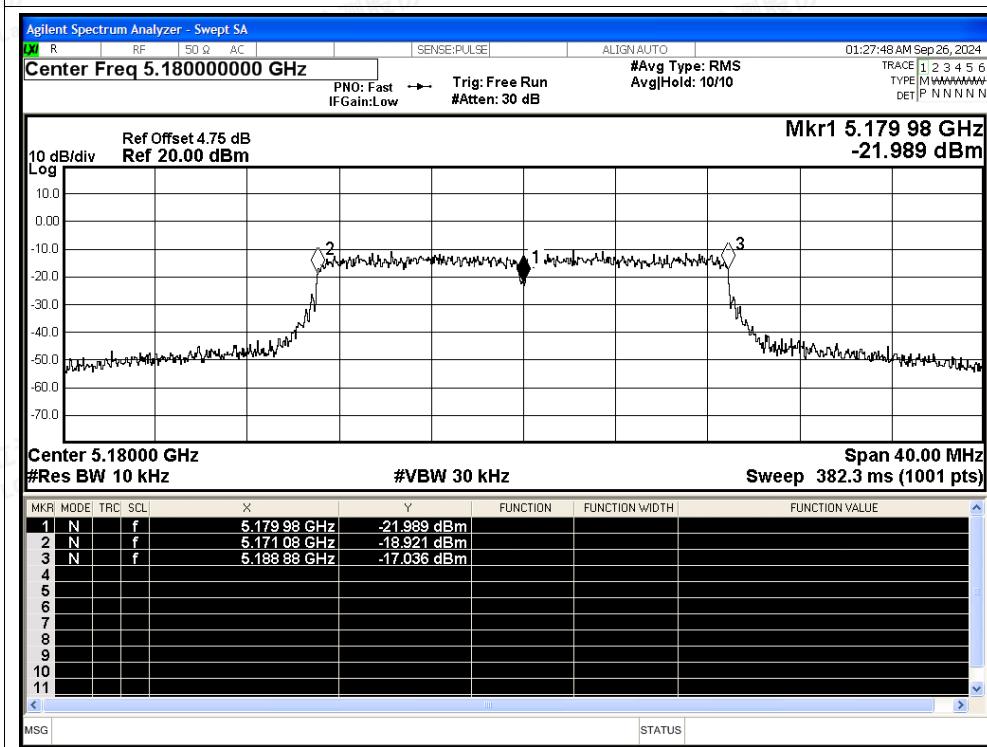




Freq. Stability NVNT n20 5200MHz Ant1

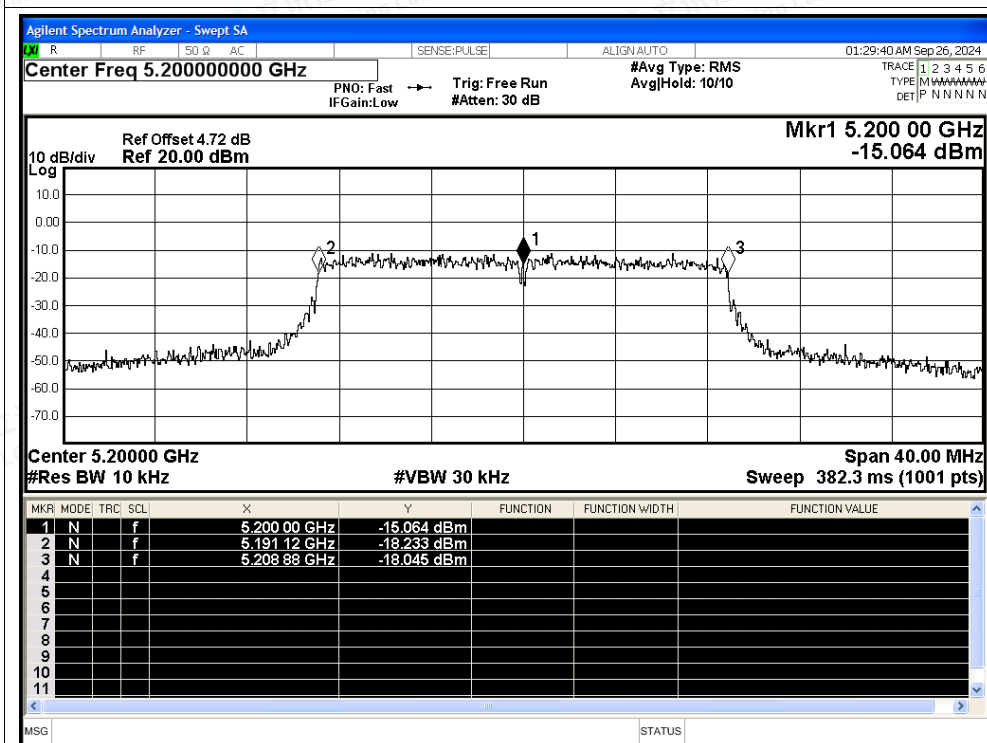

Freq. Stability NVNT n20 5240MHz Ant1

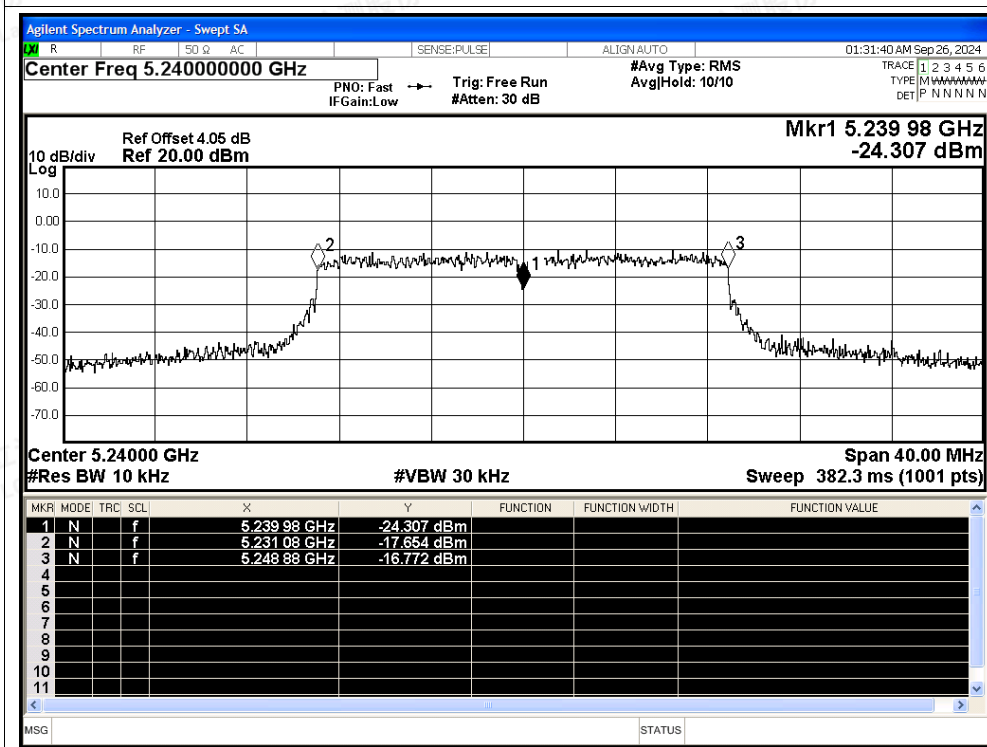

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant1

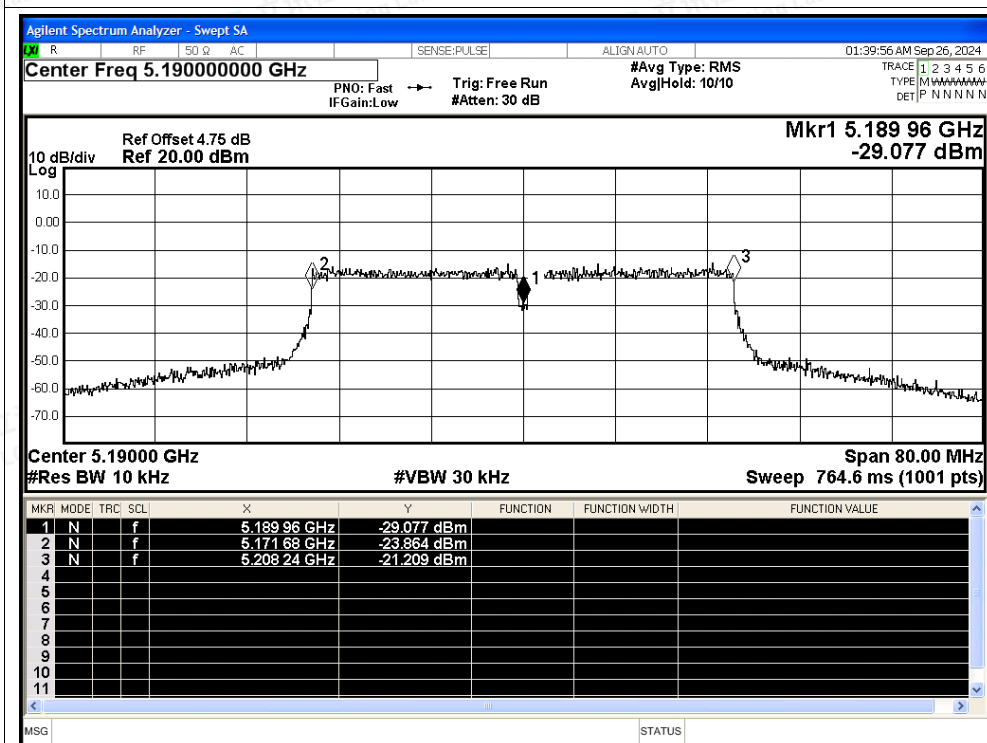

Freq. Stability NVNT n40 5230MHz Ant1

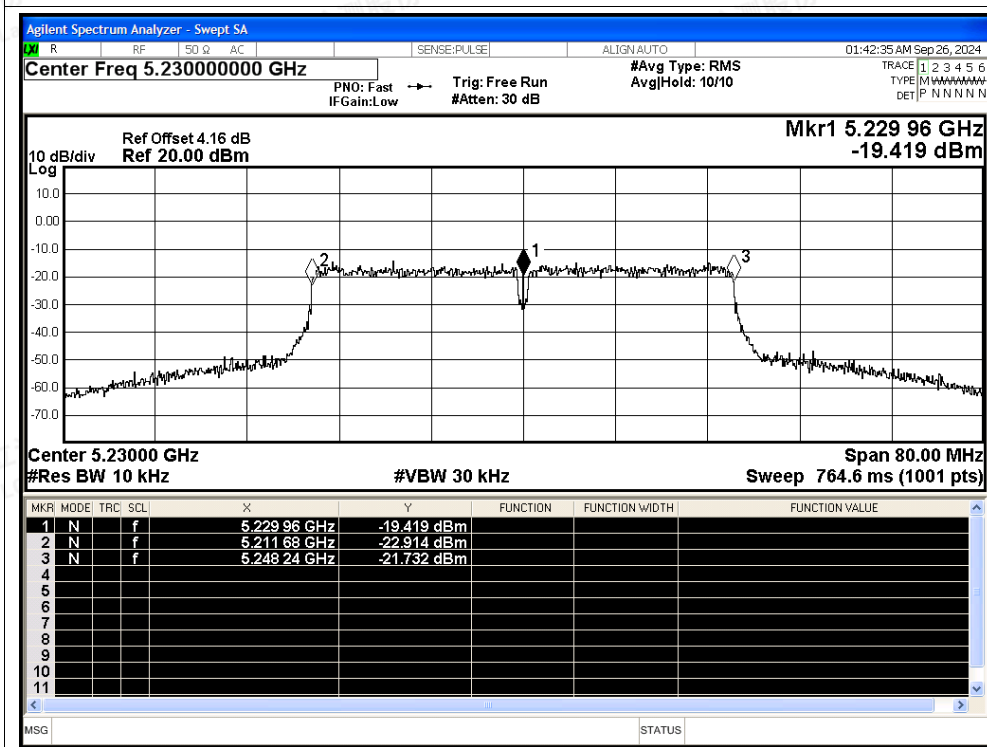

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant1

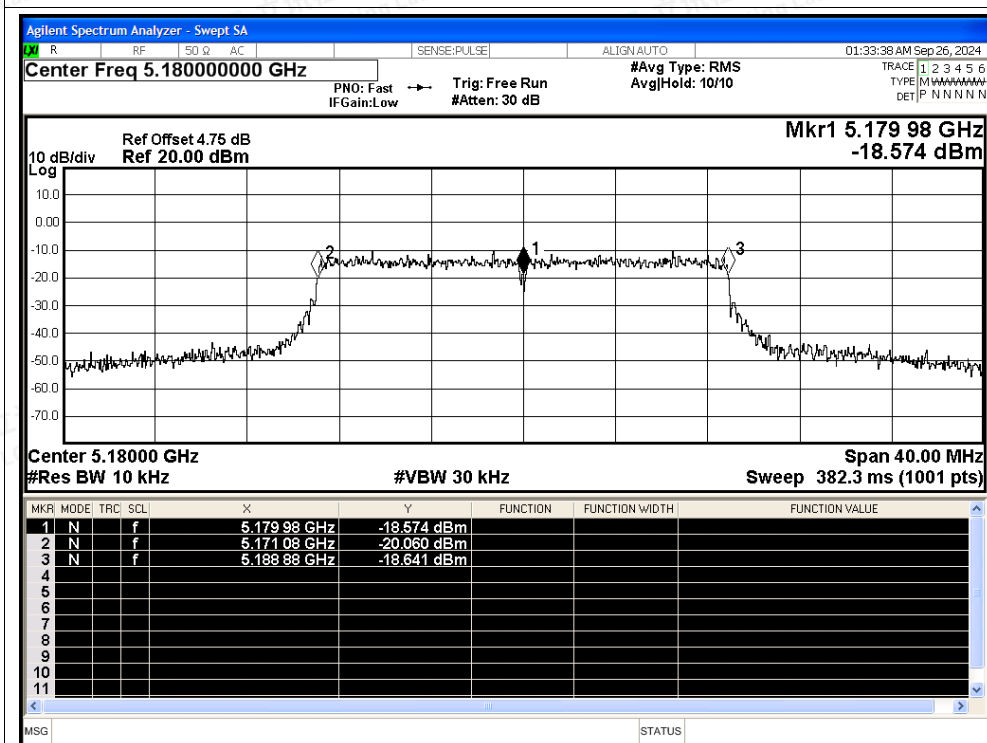


Freq. Stability NVNT ac20 5200MHz Ant1

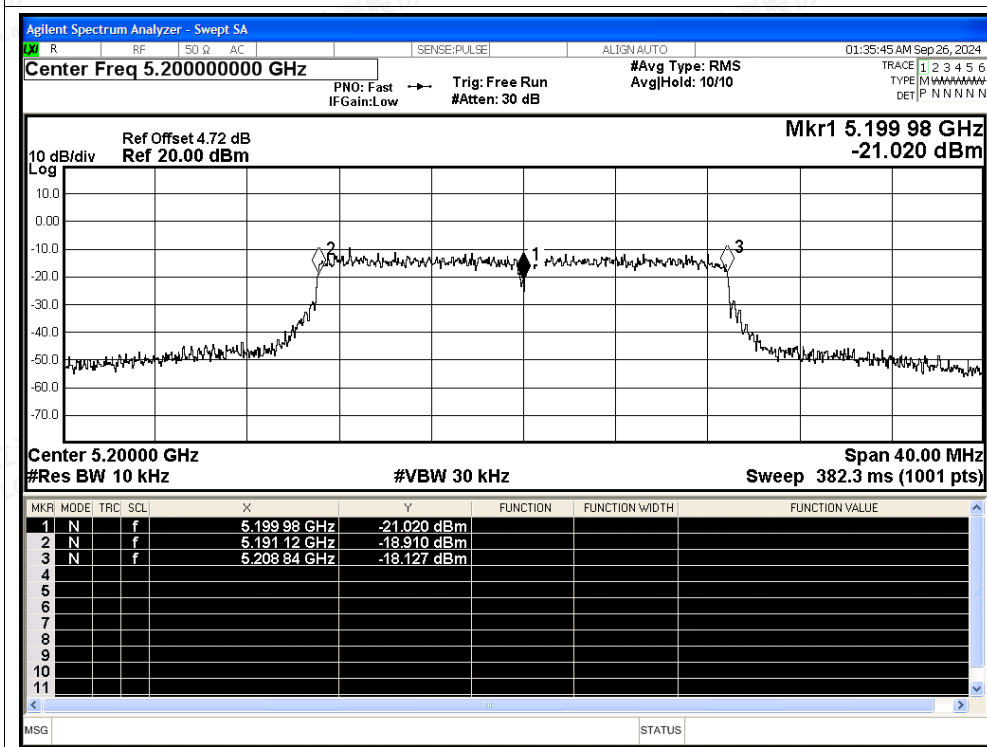





Freq. Stability NVNT ac20 5240MHz Ant1

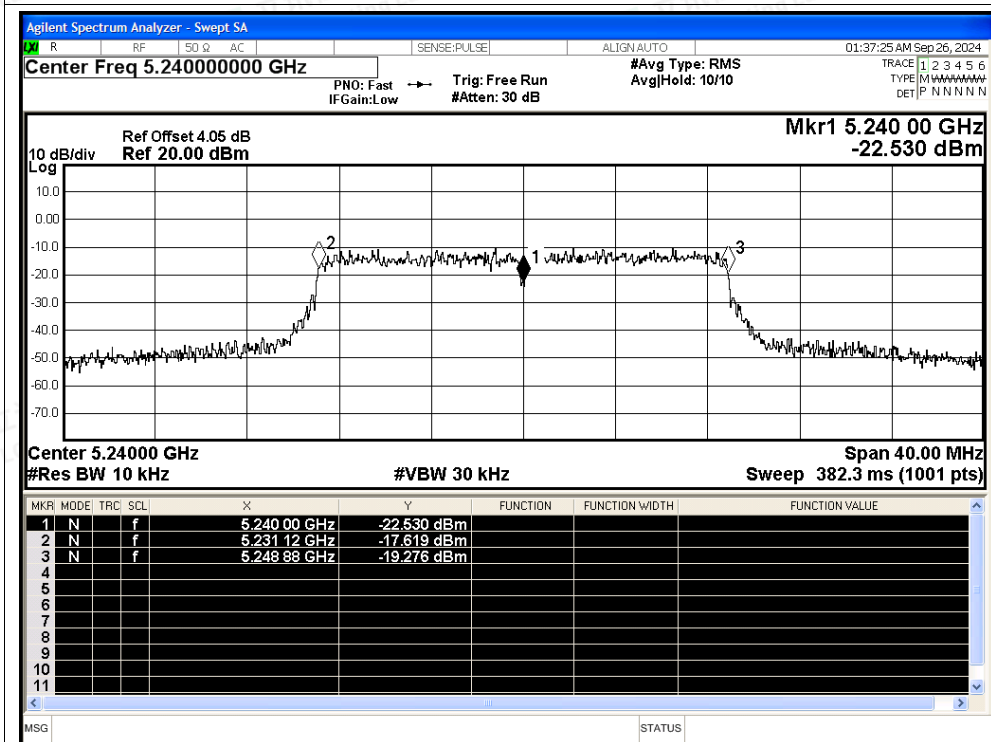


Freq. Stability NVNT ac40 5190MHz Ant1

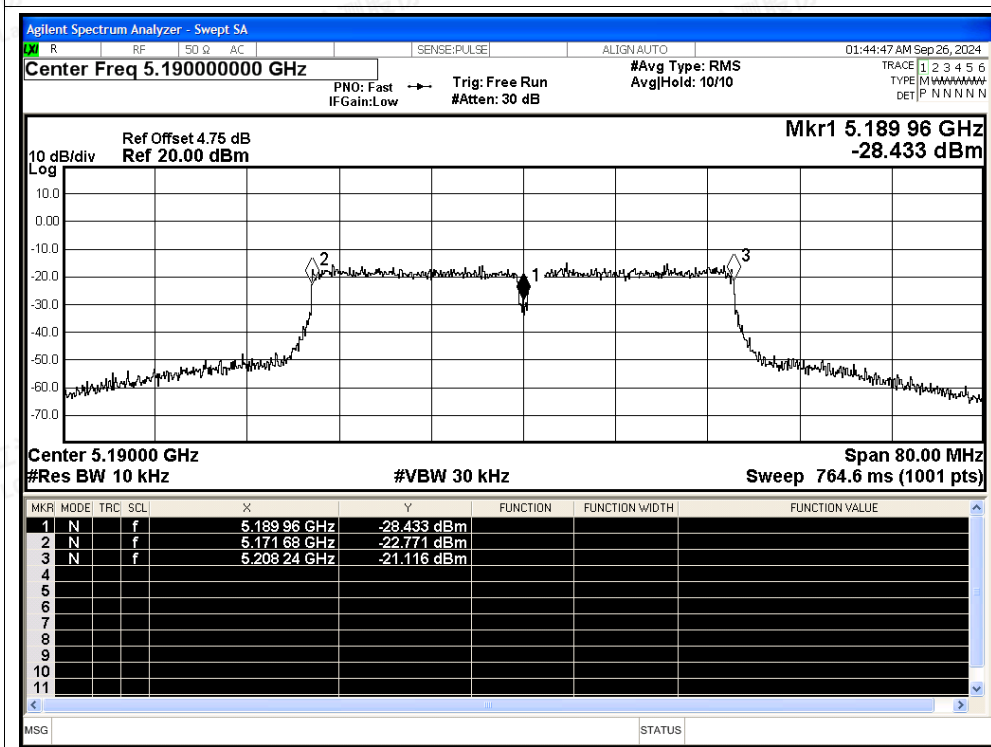

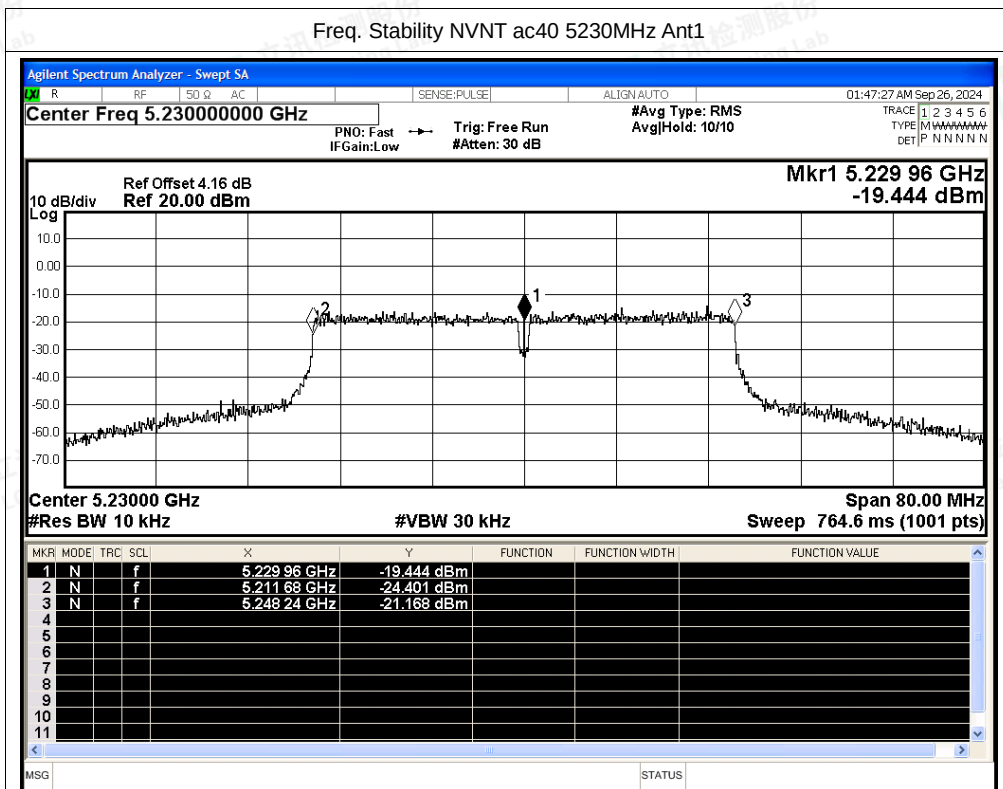

Freq. Stability NVNT ac80 5210MHz Ant1

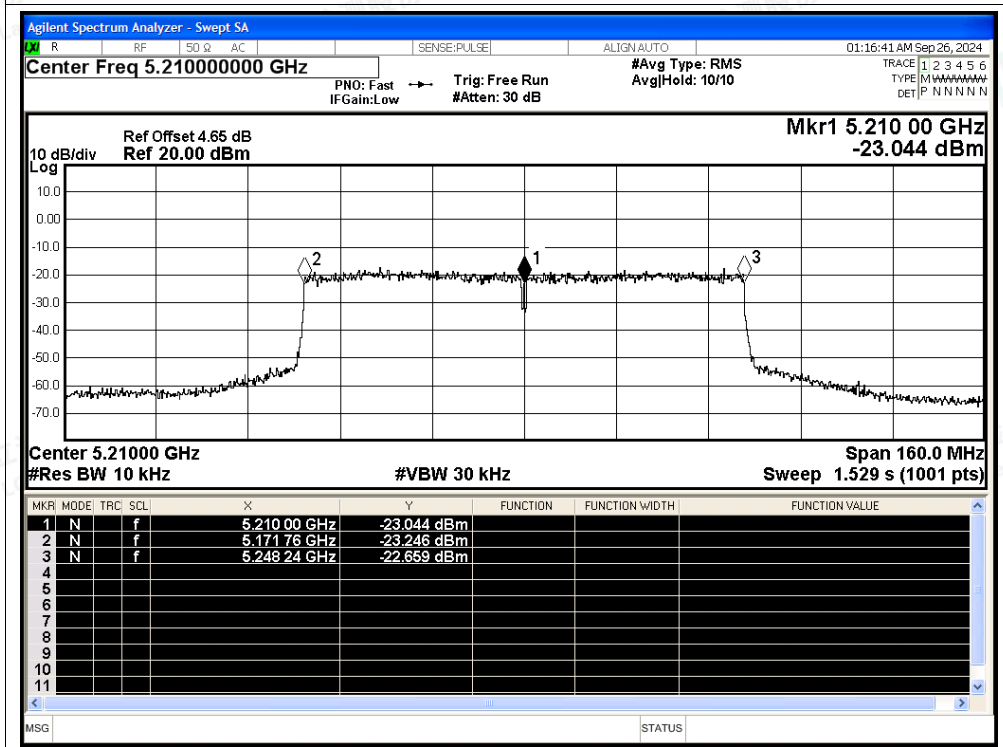

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac80 5210MHz Ant1

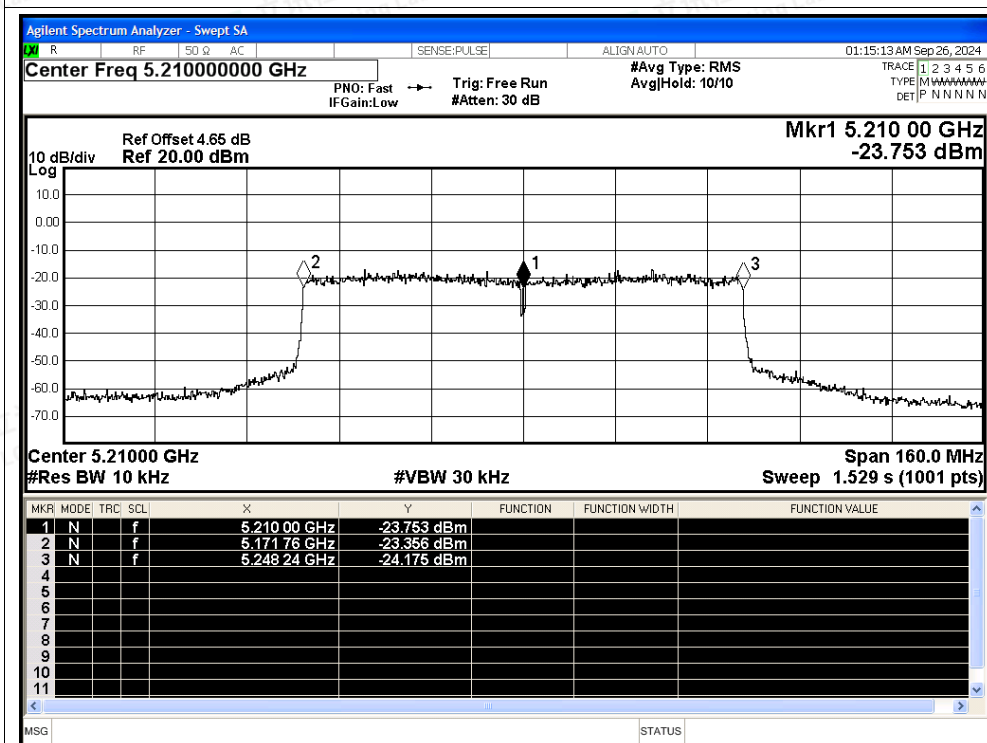

Freq. Stability NVNT ax20 5180MHz Ant1

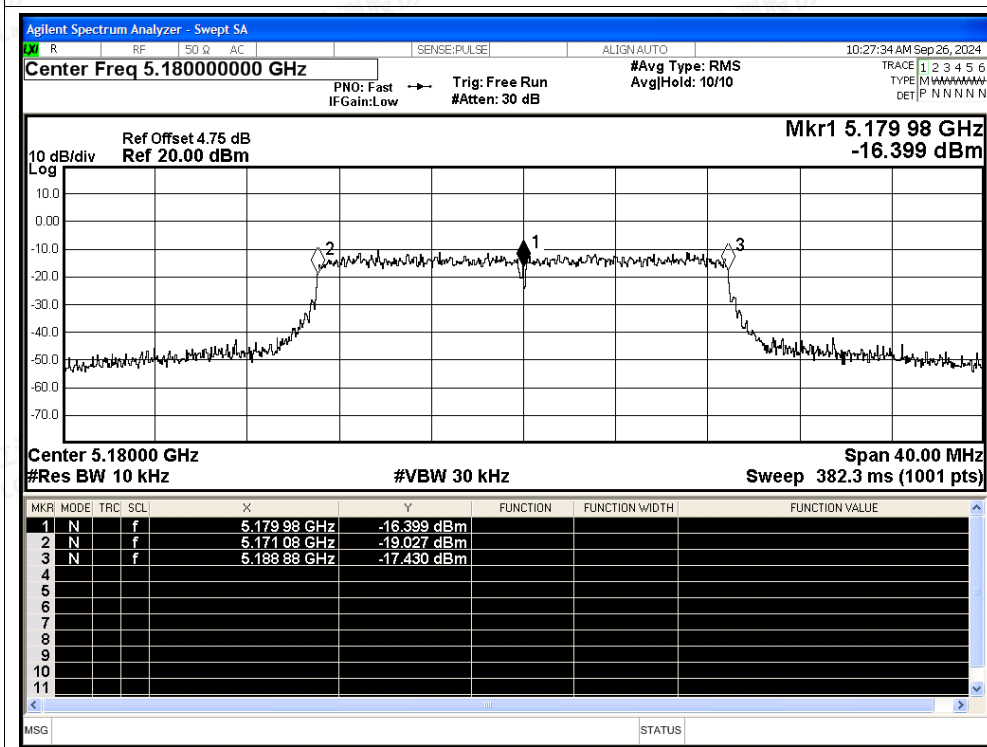

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5200MHz Ant1

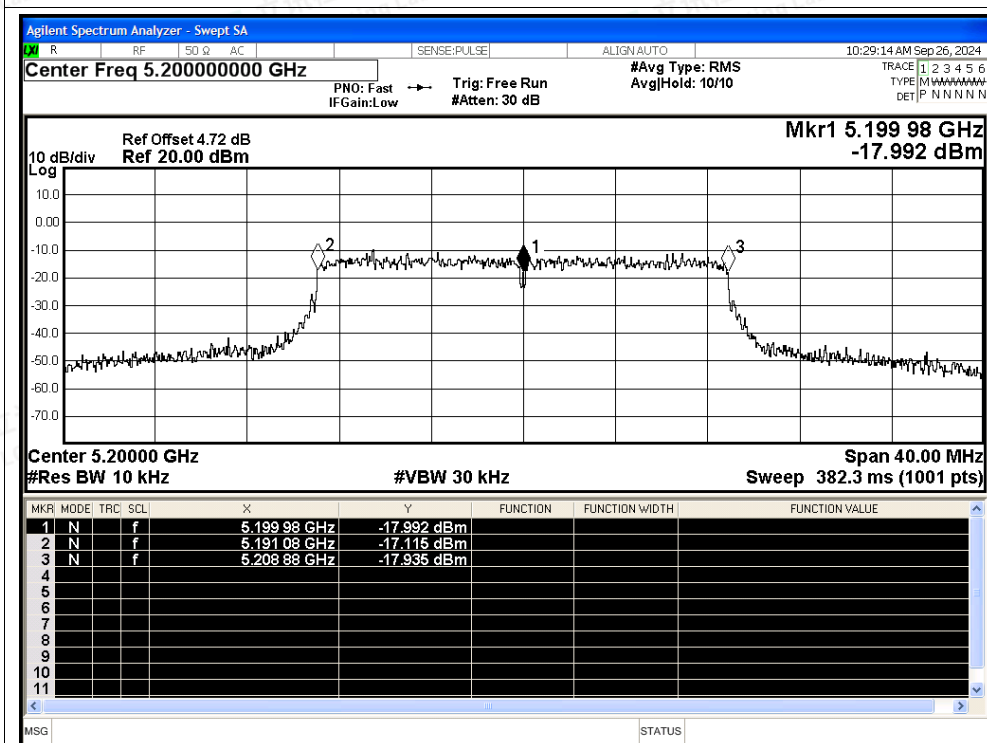

Freq. Stability NVNT ax20 5240MHz Ant1

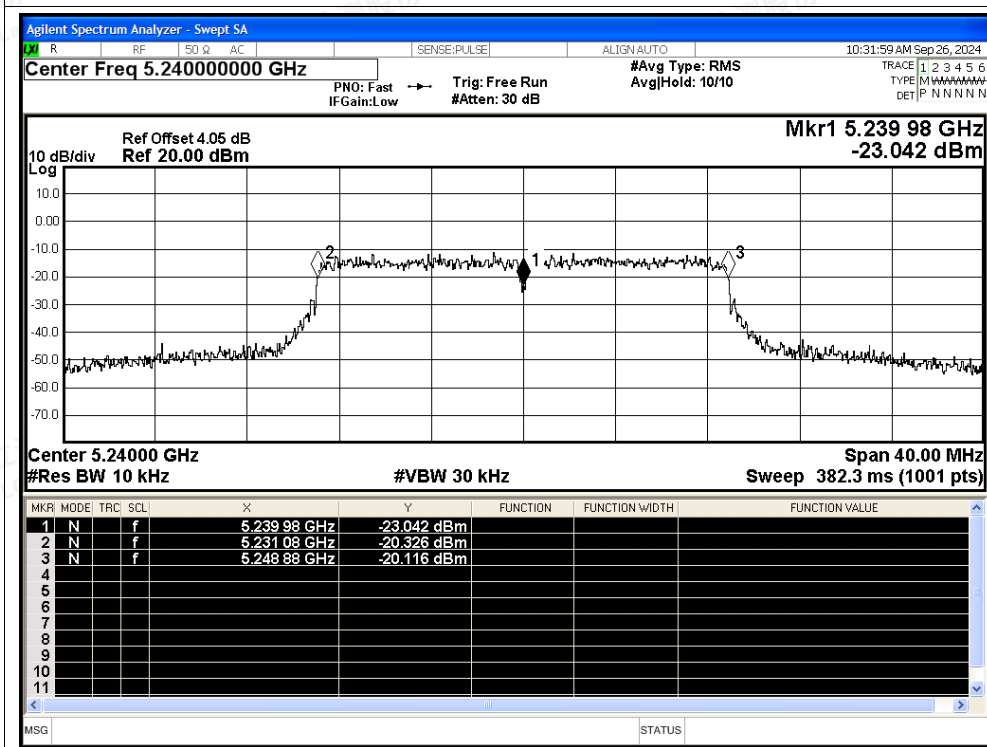

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5190MHz Ant1

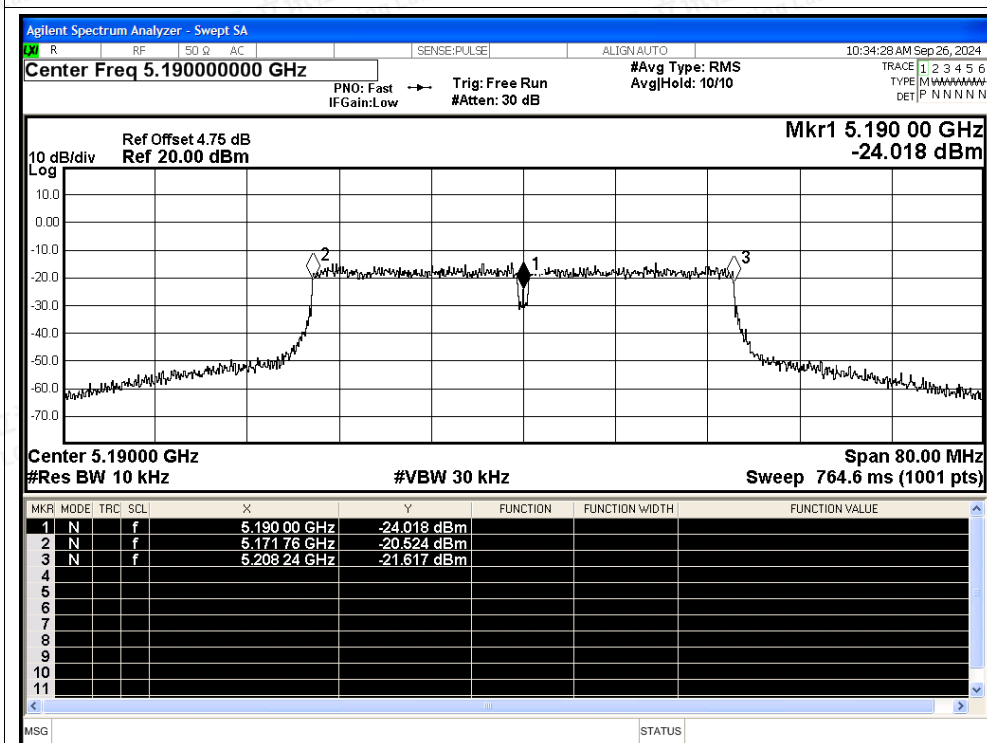

Freq. Stability NVNT ax40 5230MHz Ant1

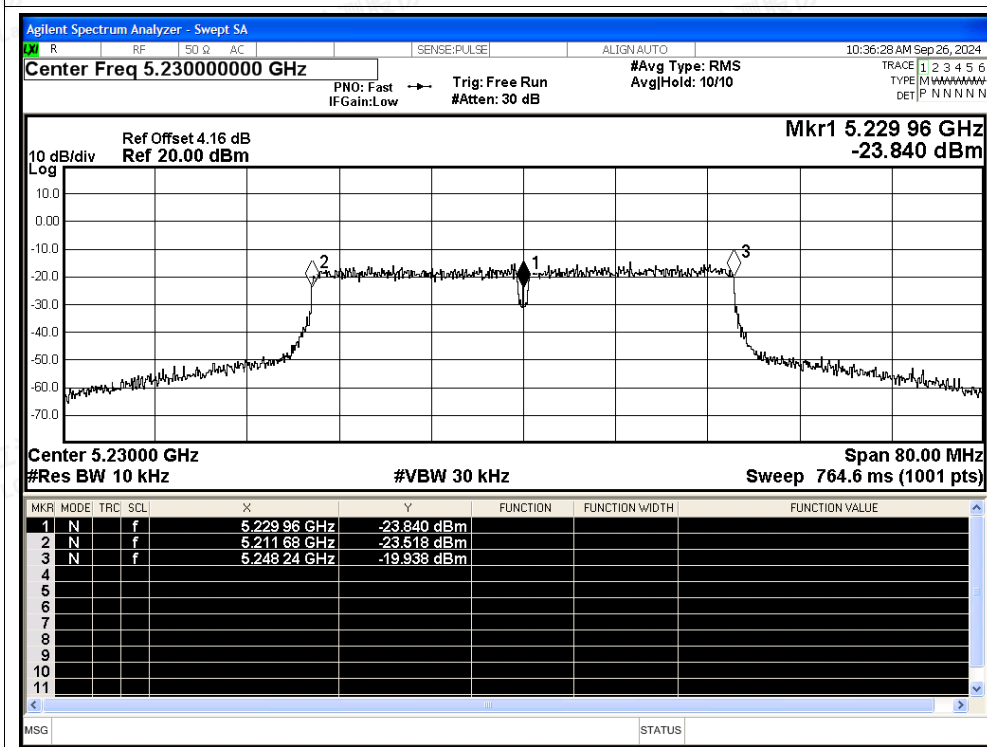


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

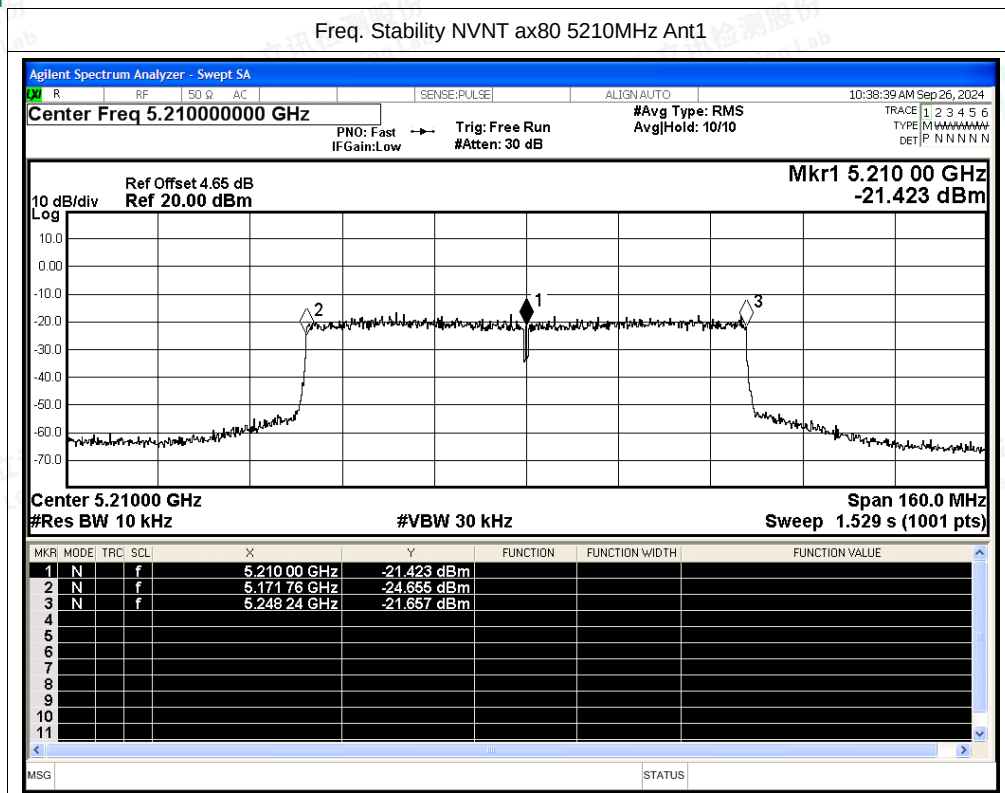

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant0	94.65	0.24	0.91
NVNT	a	5200	Ant0	94.56	0.24	0.91
NVNT	a	5240	Ant0	94.56	0.24	0.91
NVNT	n20	5180	Ant0	97.29	0.12	0.44
NVNT	n20	5200	Ant0	97.29	0.12	0.44
NVNT	n20	5240	Ant0	97.29	0.12	0.44
NVNT	n40	5190	Ant0	97.23	0.12	0.46
NVNT	n40	5230	Ant0	97.23	0.12	0.46
NVNT	ac20	5180	Ant0	97.35	0.12	0.44
NVNT	ac20	5200	Ant0	97.34	0.12	0.44
NVNT	ac20	5240	Ant0	97.3	0.12	0.44
NVNT	ac40	5190	Ant0	97.24	0.12	0.46
NVNT	ac40	5230	Ant0	97.19	0.12	0.46
NVNT	ac80	5210	Ant0	94.32	0.25	0.97
NVNT	ax20	5180	Ant0	97.3	0.12	0.44
NVNT	ax20	5200	Ant0	97.34	0.12	0.44
NVNT	ax20	5240	Ant0	97.34	0.12	0.44
NVNT	ax40	5190	Ant0	97.19	0.12	0.46
NVNT	ax40	5230	Ant0	97.19	0.12	0.46
NVNT	ax80	5210	Ant0	94.41	0.25	0.97






Test Graphs

Duty Cycle NVNT a 5180MHz Ant0

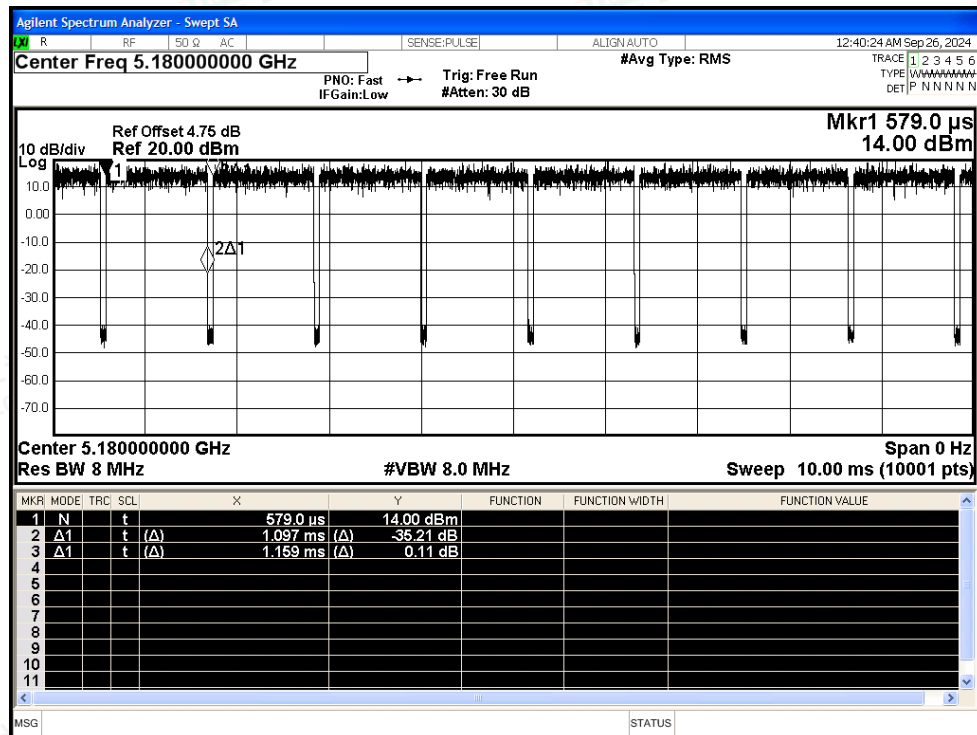

Duty Cycle NVNT a 5200MHz Ant0

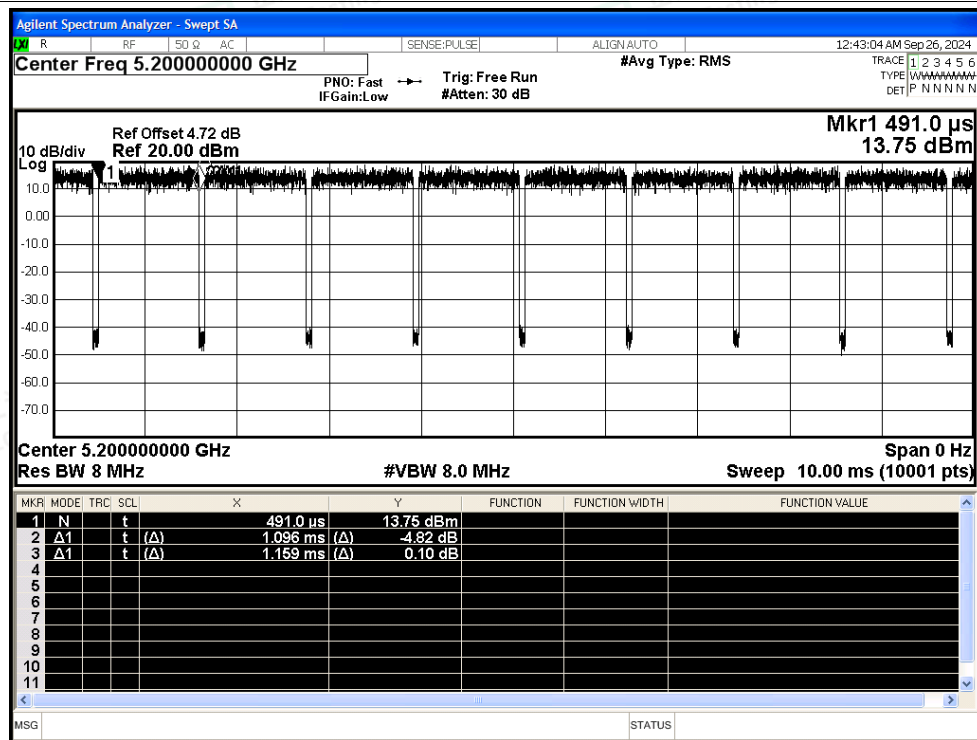

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant0

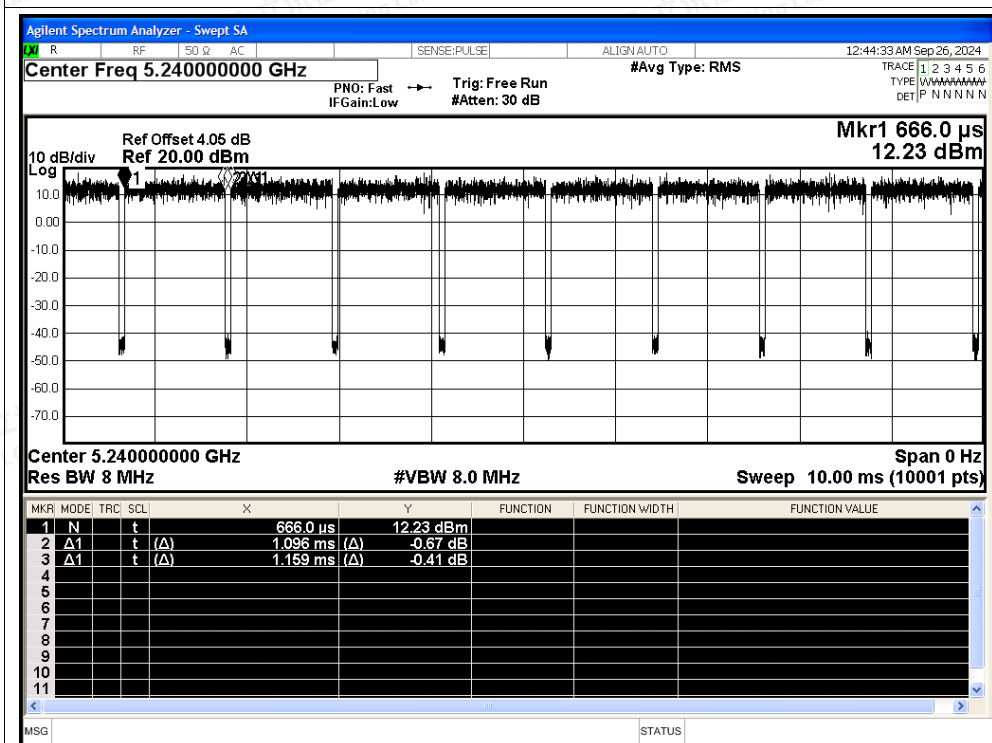


Duty Cycle NVNT n20 5180MHz Ant0

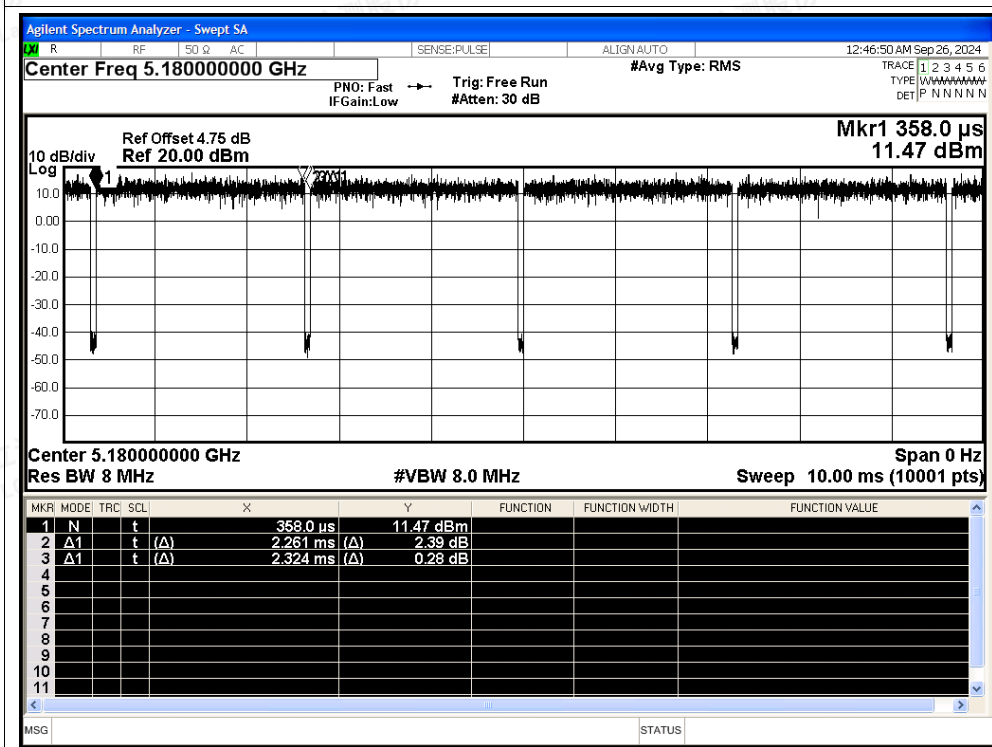




Duty Cycle NVNT n20 5200MHz Ant0

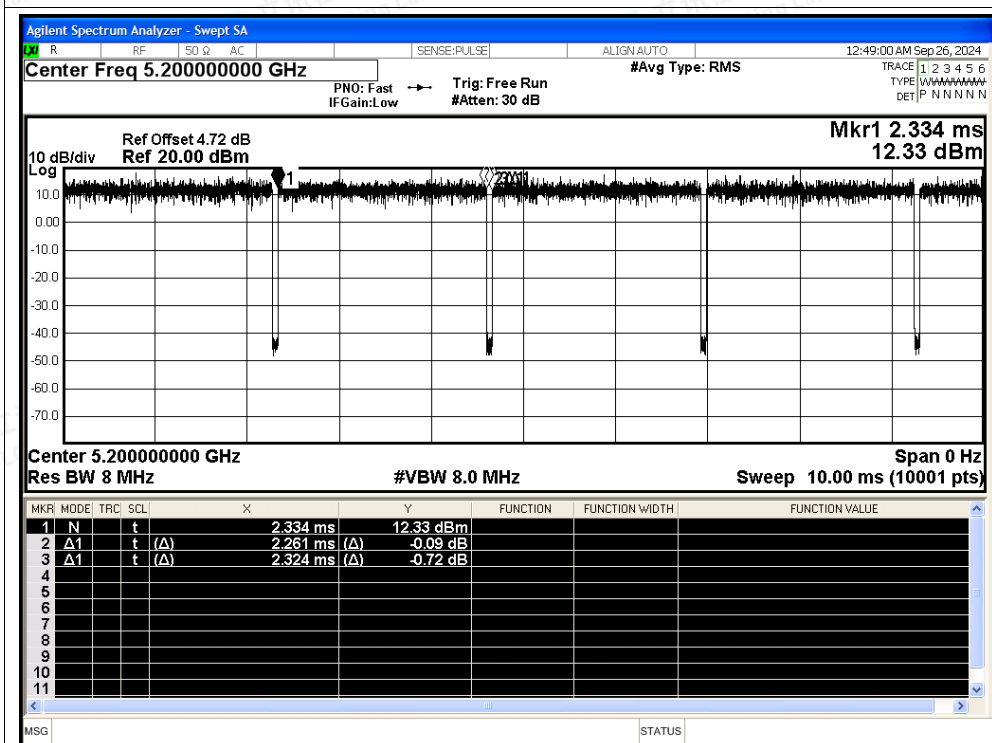

Duty Cycle NVNT n20 5240MHz Ant0

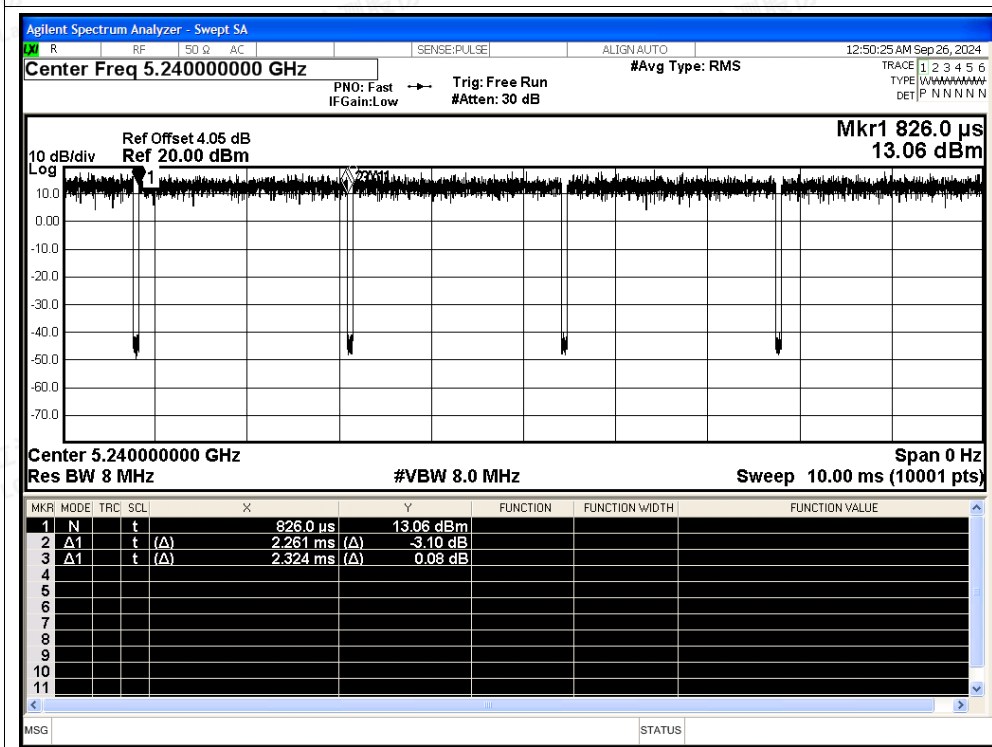

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant0

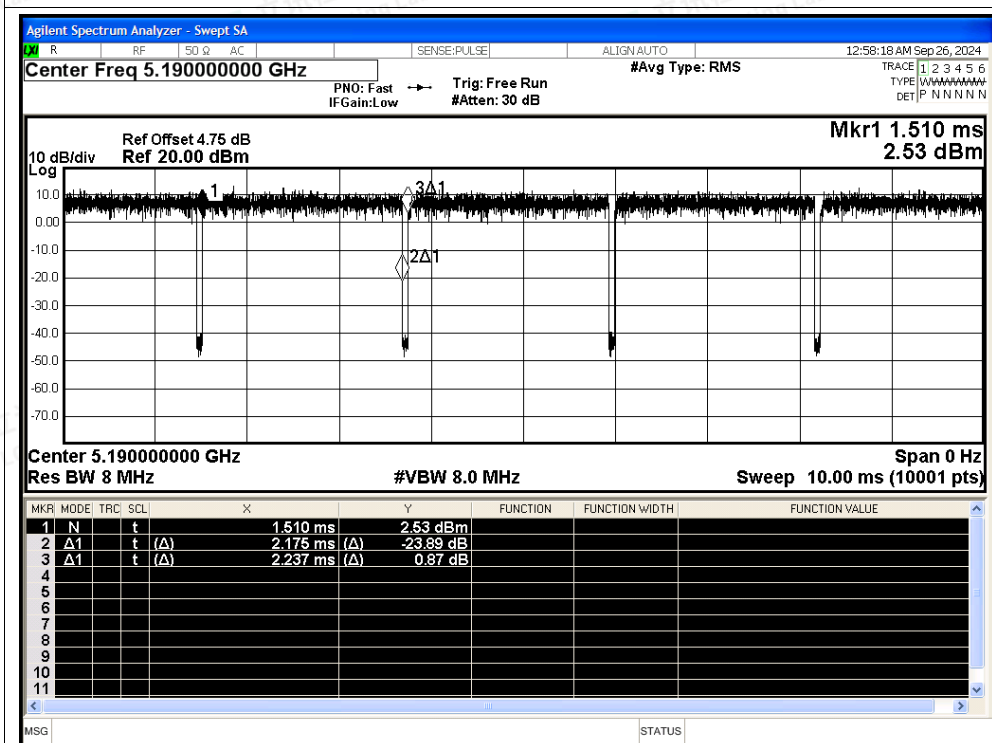

Duty Cycle NVNT n40 5230MHz Ant0


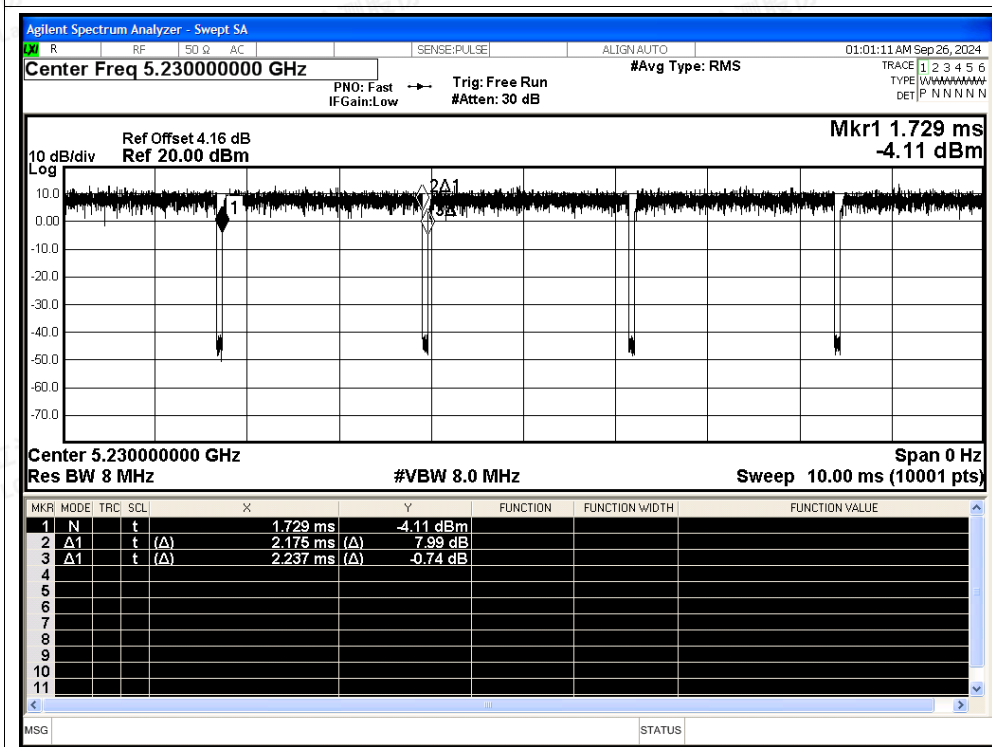


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

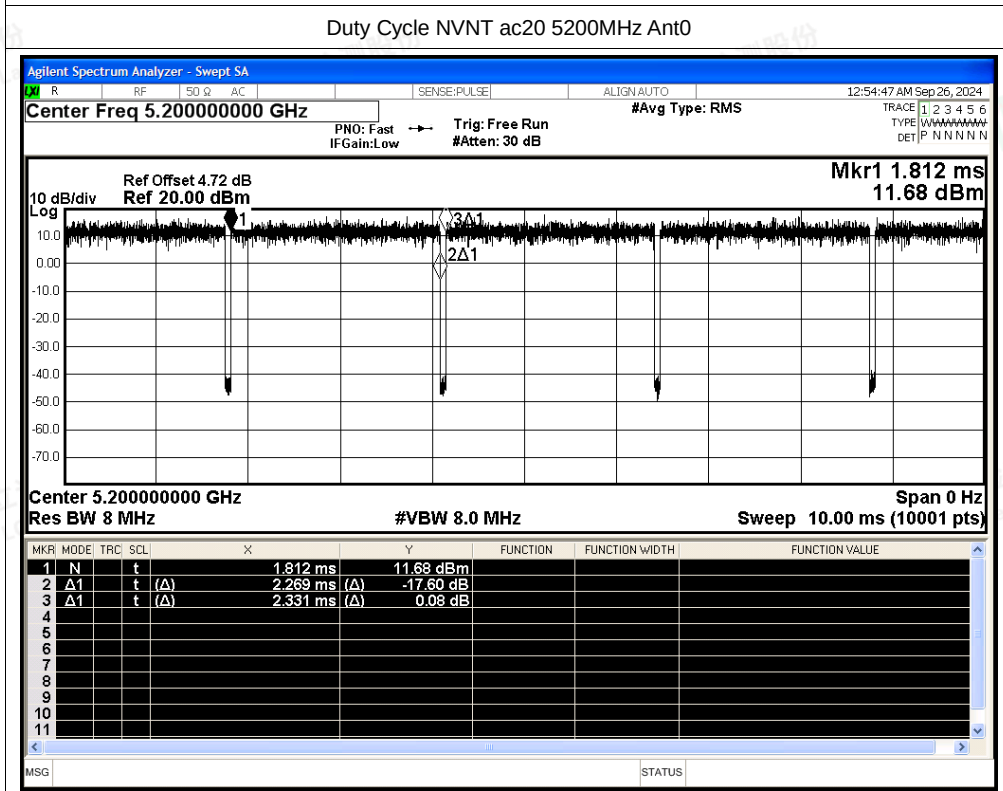
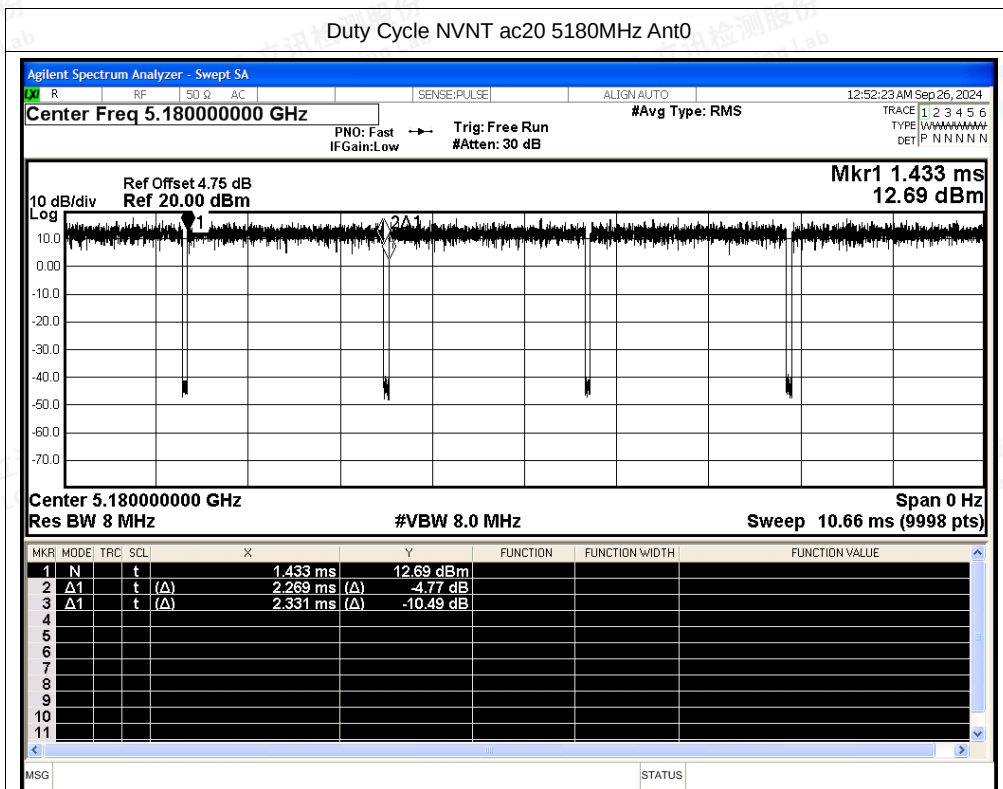


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

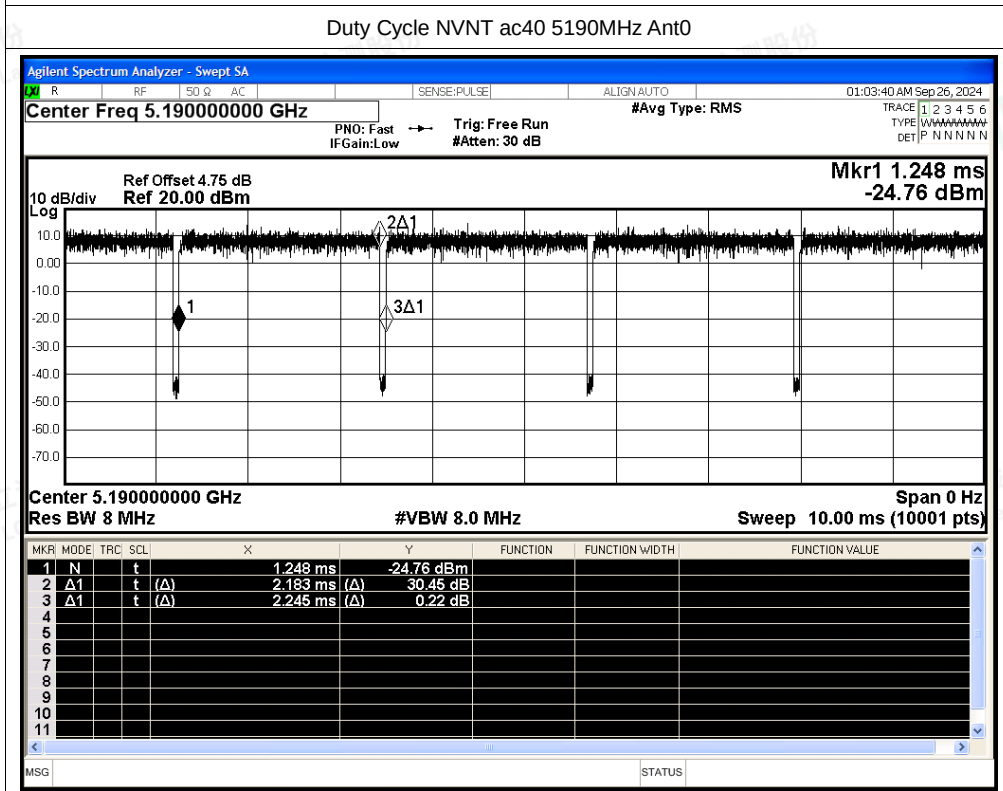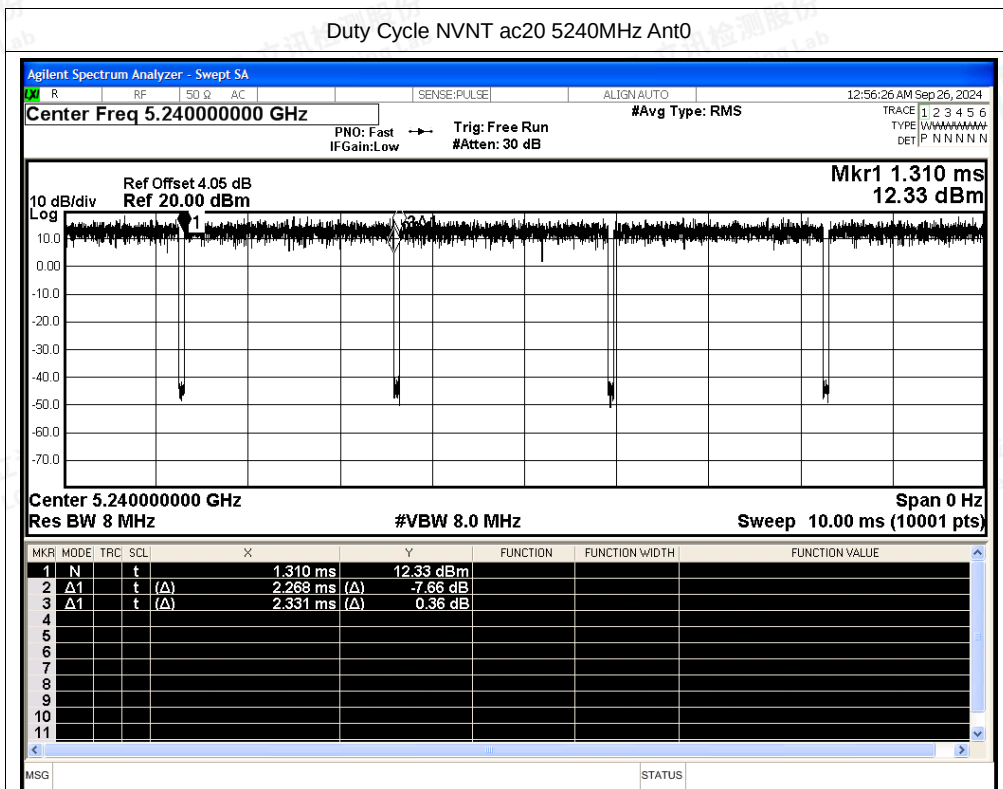

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5230MHz Ant0

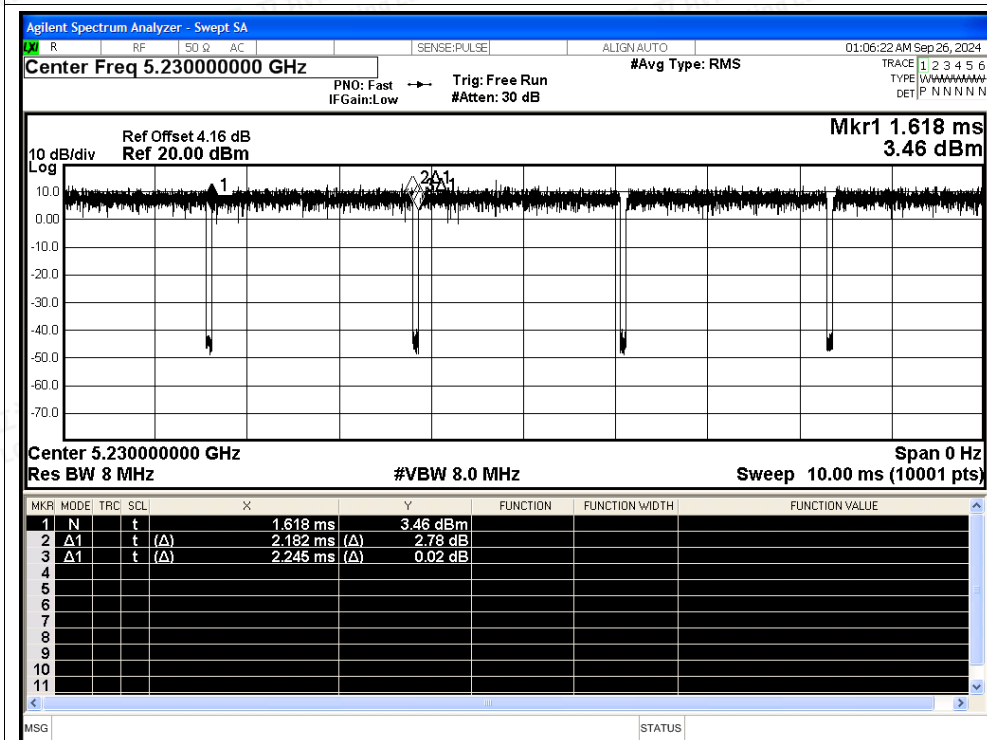

Duty Cycle NVNT ac80 5210MHz Ant0

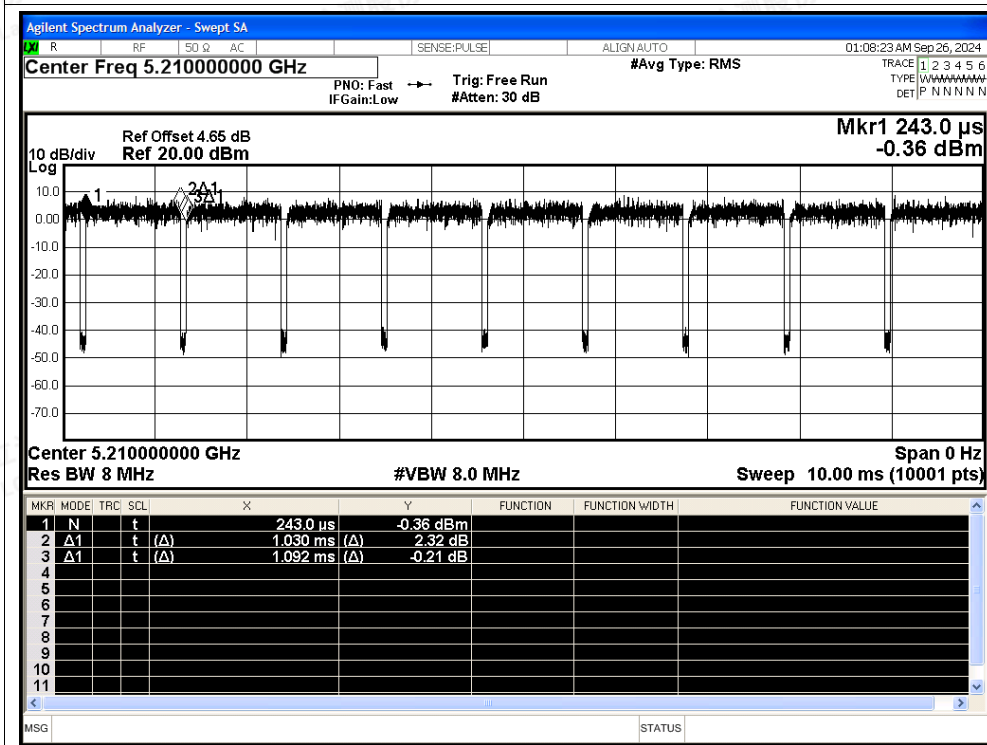

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5180MHz Ant0

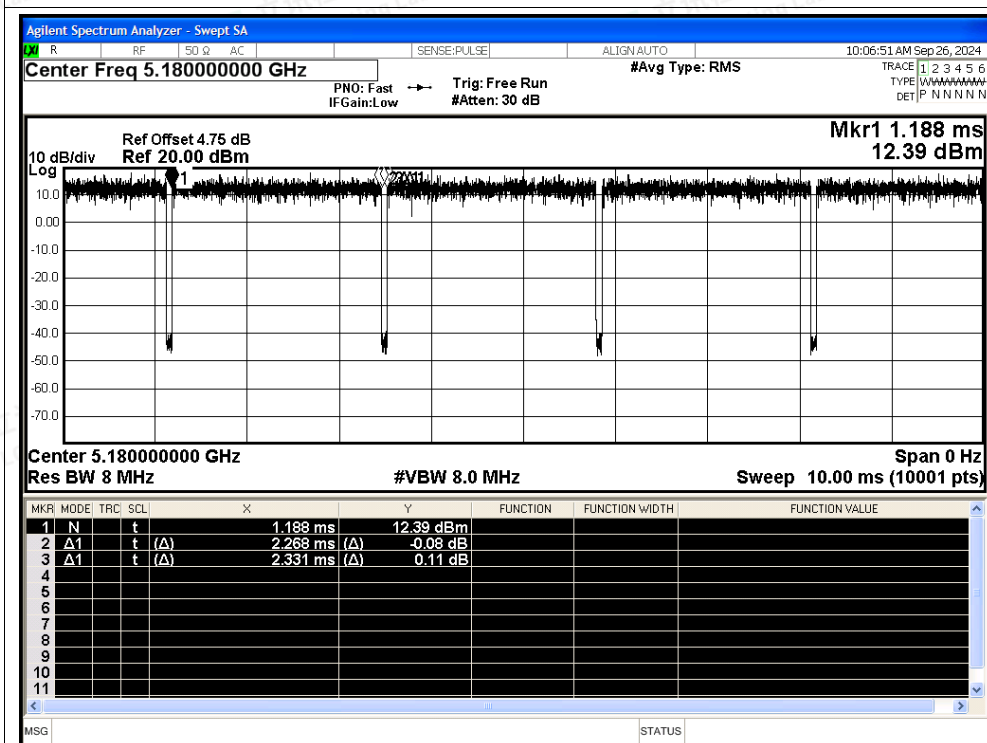

Duty Cycle NVNT ax20 5200MHz Ant0


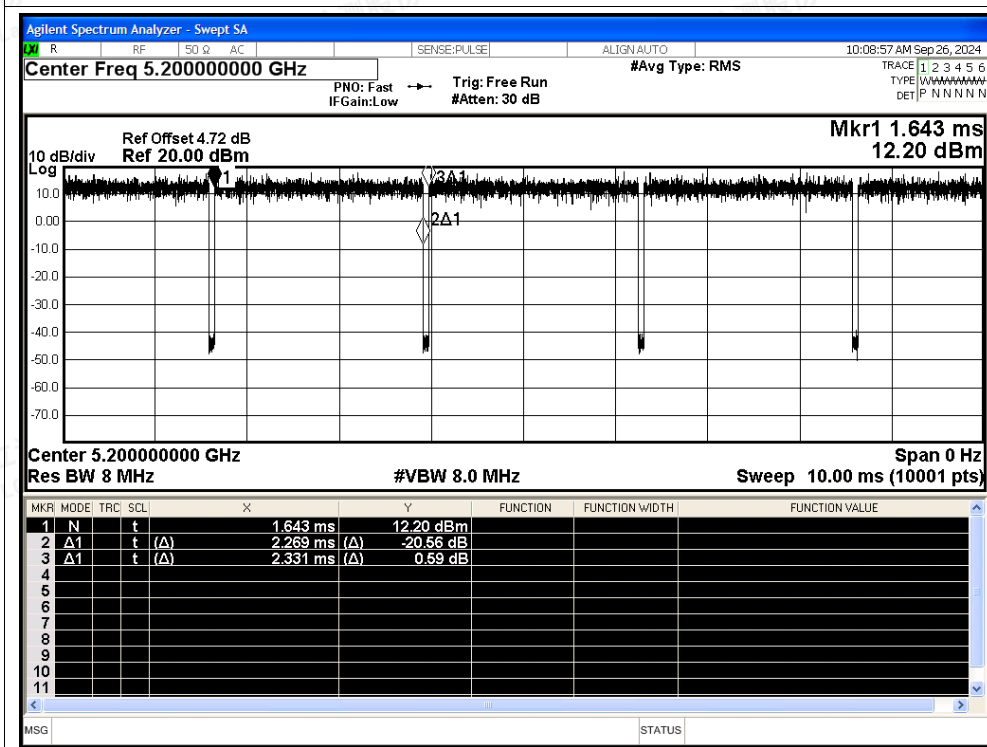


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

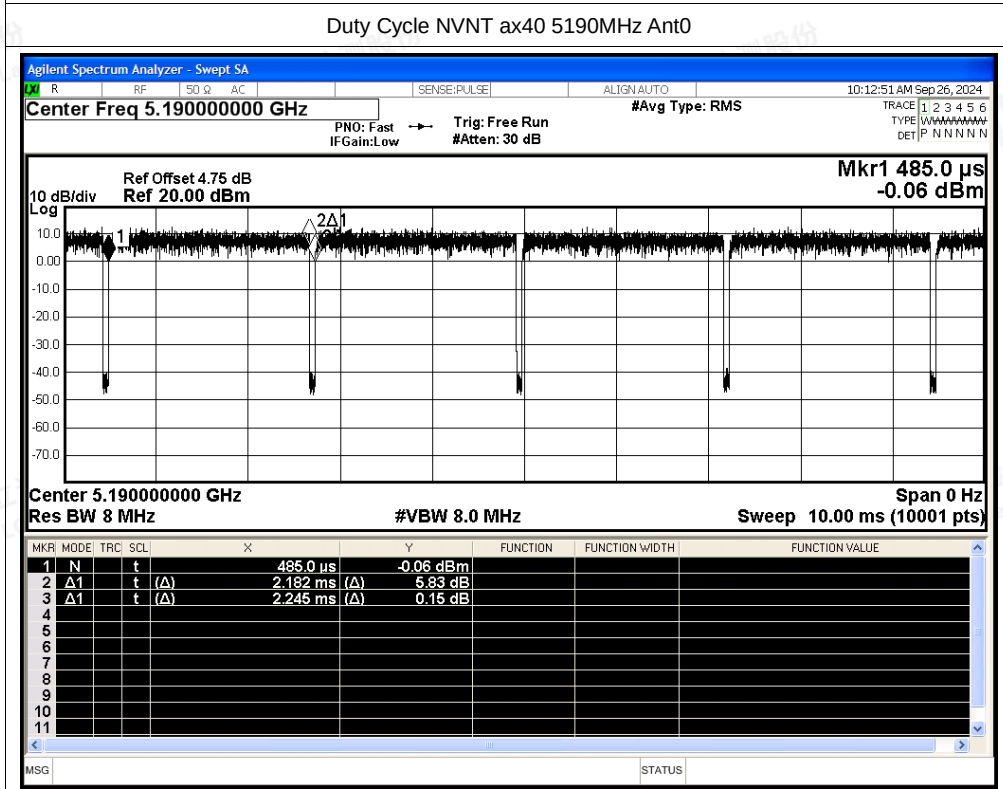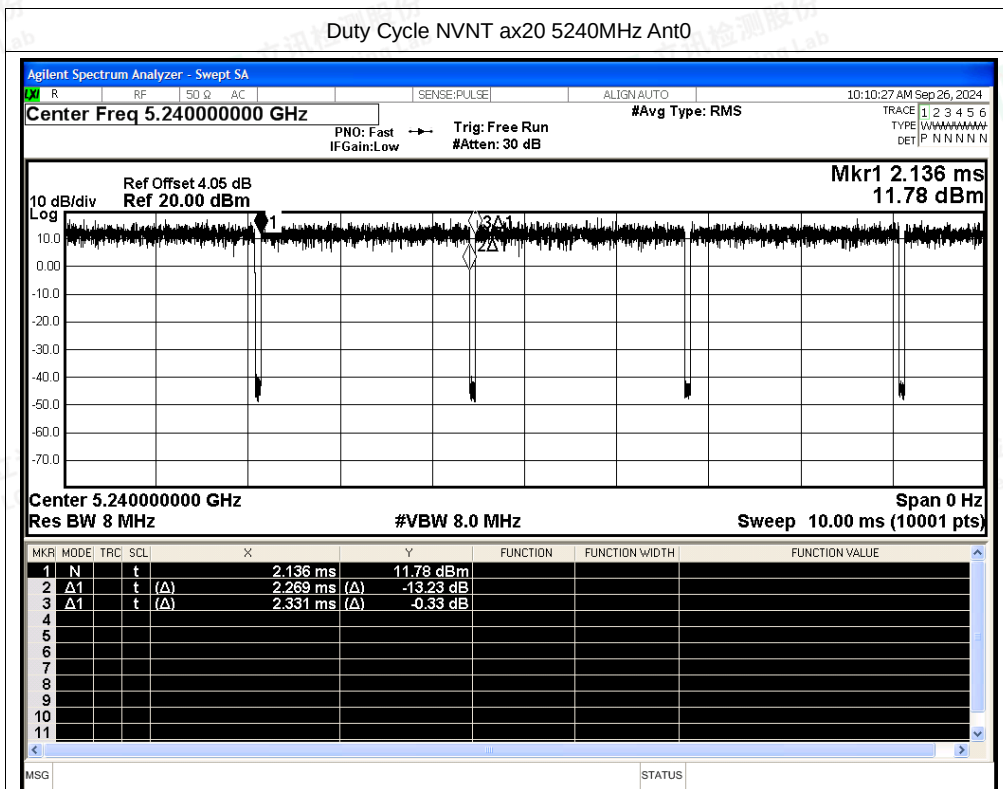

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5230MHz Ant0

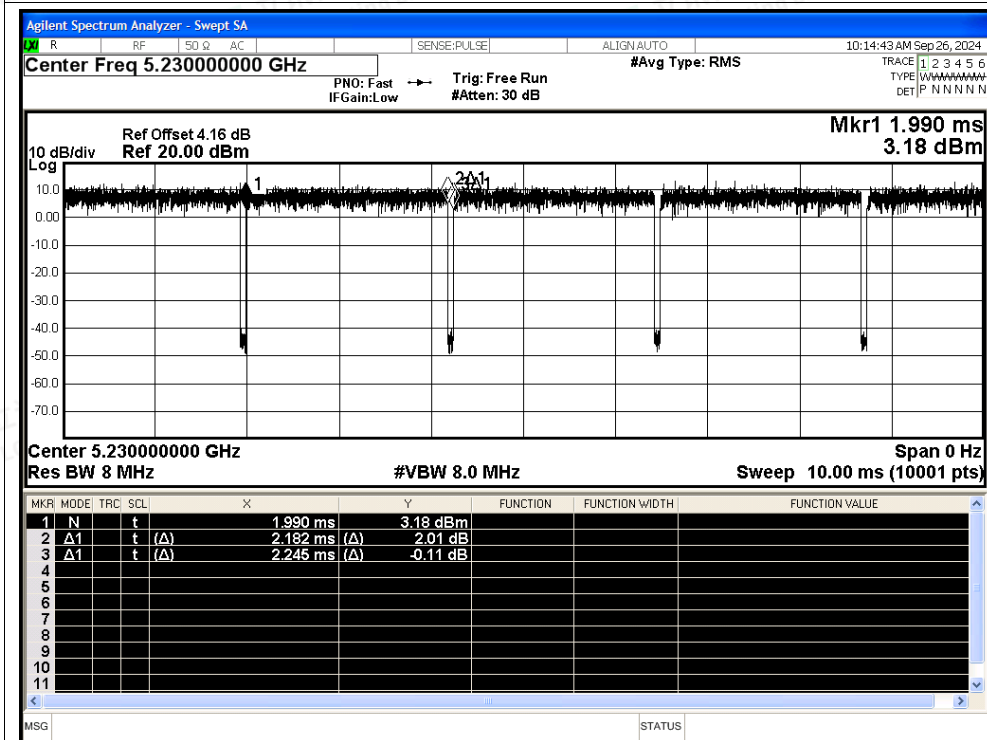

Duty Cycle NVNT ax80 5210MHz Ant0

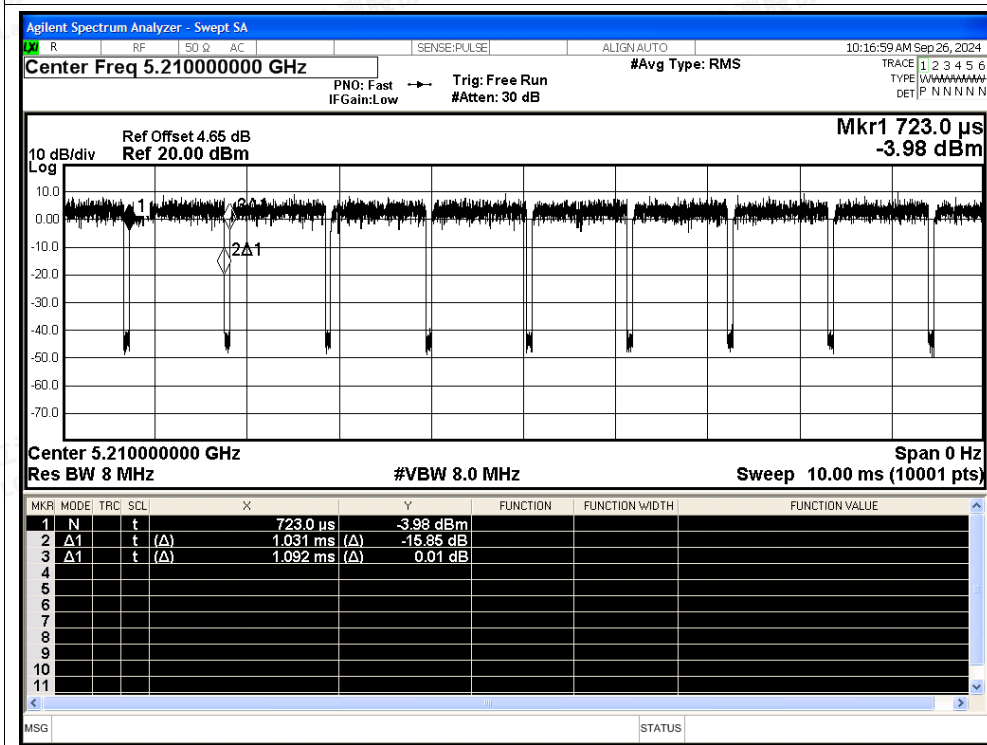

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	94.56	0.24	0.91
NVNT	a	5200	Ant1	94.65	0.24	0.91
NVNT	a	5240	Ant1	94.56	0.24	0.91
NVNT	n20	5180	Ant1	97.29	0.12	0.44
NVNT	n20	5200	Ant1	97.29	0.12	0.44
NVNT	n20	5240	Ant1	97.29	0.12	0.44
NVNT	n40	5190	Ant1	97.23	0.12	0.46
NVNT	n40	5230	Ant1	97.23	0.12	0.46
NVNT	ac20	5180	Ant1	97.35	0.12	0.44
NVNT	ac20	5200	Ant1	97.34	0.12	0.44
NVNT	ac20	5240	Ant1	97.3	0.12	0.44
NVNT	ac40	5190	Ant1	97.24	0.12	0.46
NVNT	ac40	5230	Ant1	97.24	0.12	0.46
NVNT	ac80	5210	Ant1	94.41	0.25	0.97
NVNT	ax20	5180	Ant1	97.34	0.12	0.44
NVNT	ax20	5200	Ant1	97.34	0.12	0.44
NVNT	ax20	5240	Ant1	97.3	0.12	0.44
NVNT	ax40	5190	Ant1	94.72	0.24	0.9
NVNT	ax40	5230	Ant1	94.72	0.24	0.9
NVNT	ax80	5210	Ant1	89.65	0.47	1.86






Test Graphs

Duty Cycle NVNT a 5180MHz Ant1

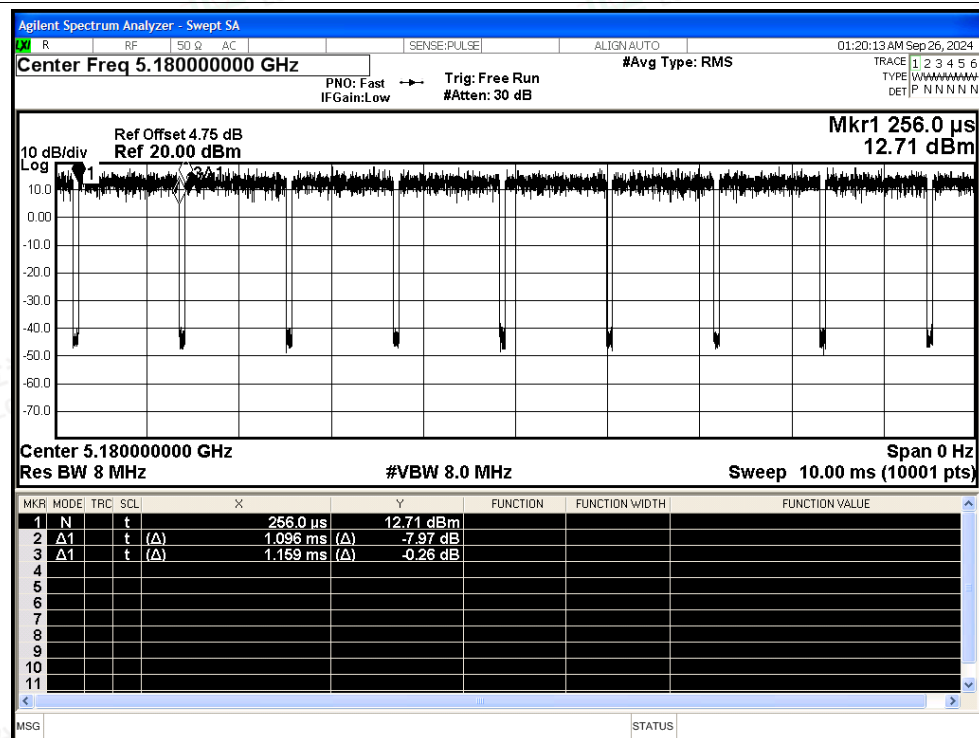

Duty Cycle NVNT a 5200MHz Ant1

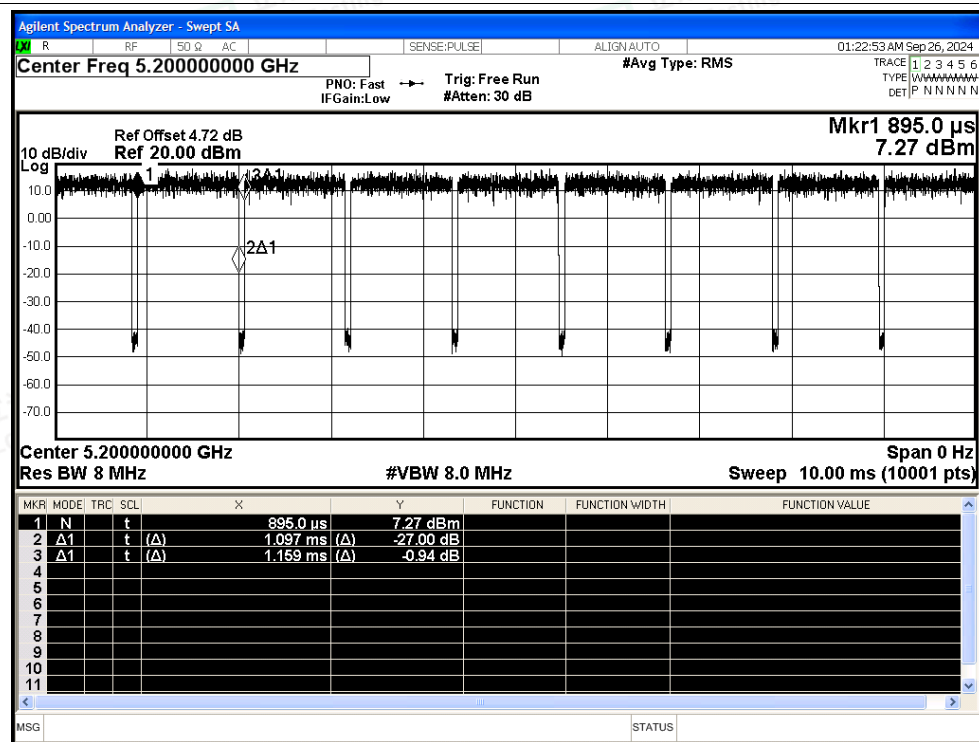

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant1

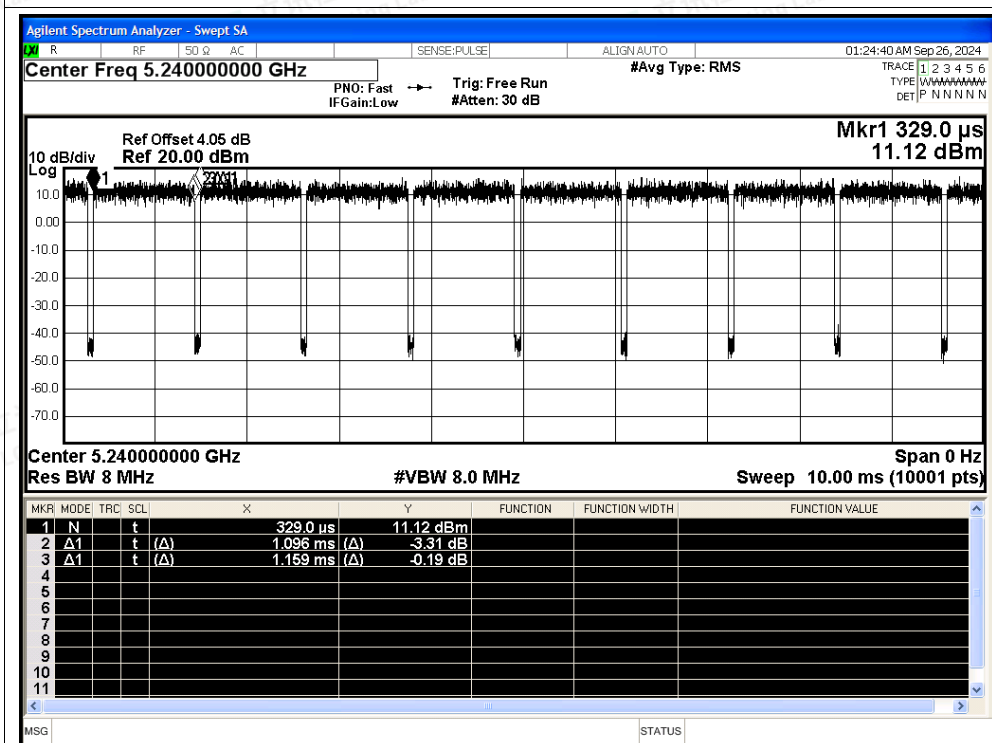

Duty Cycle NVNT n20 5180MHz Ant1

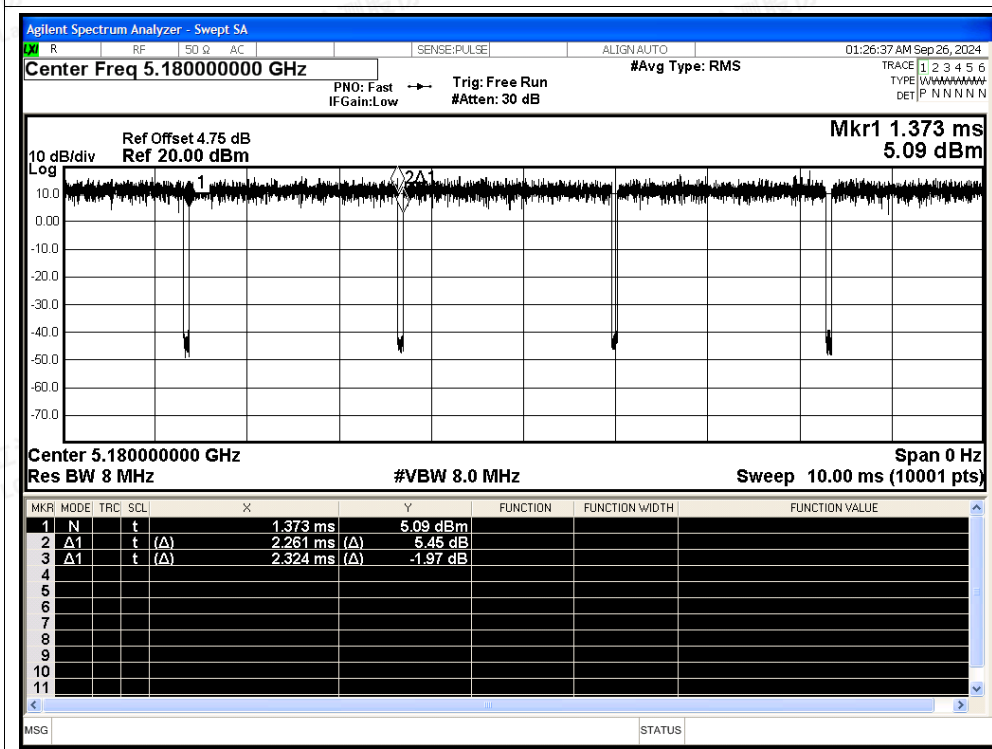

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant1

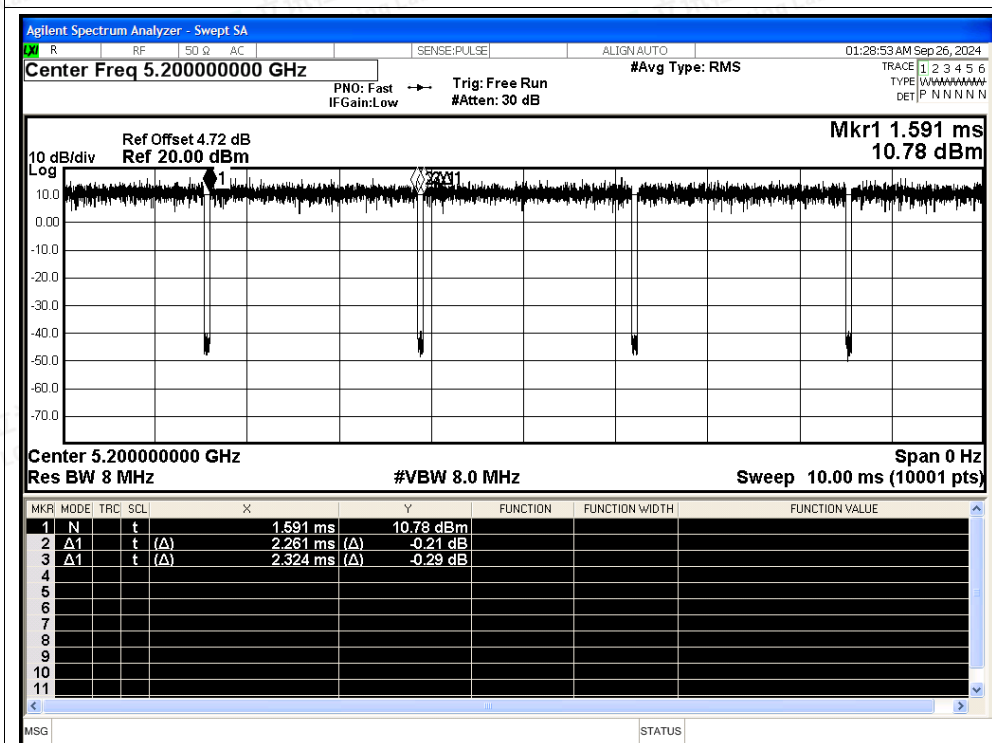

Duty Cycle NVNT n20 5240MHz Ant1

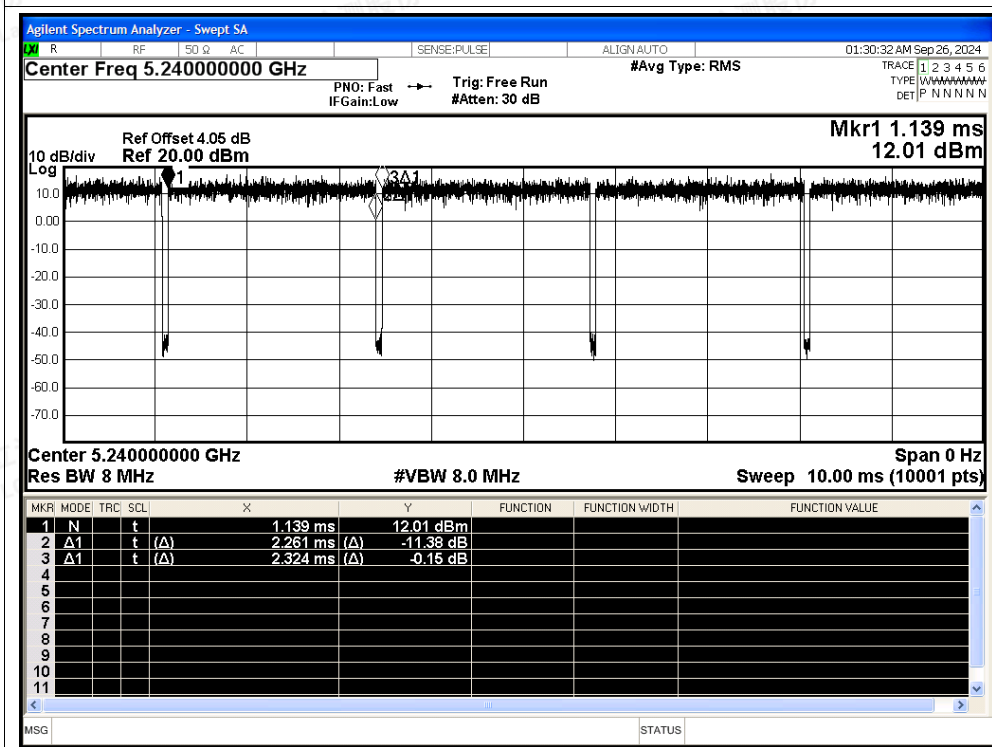

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant1

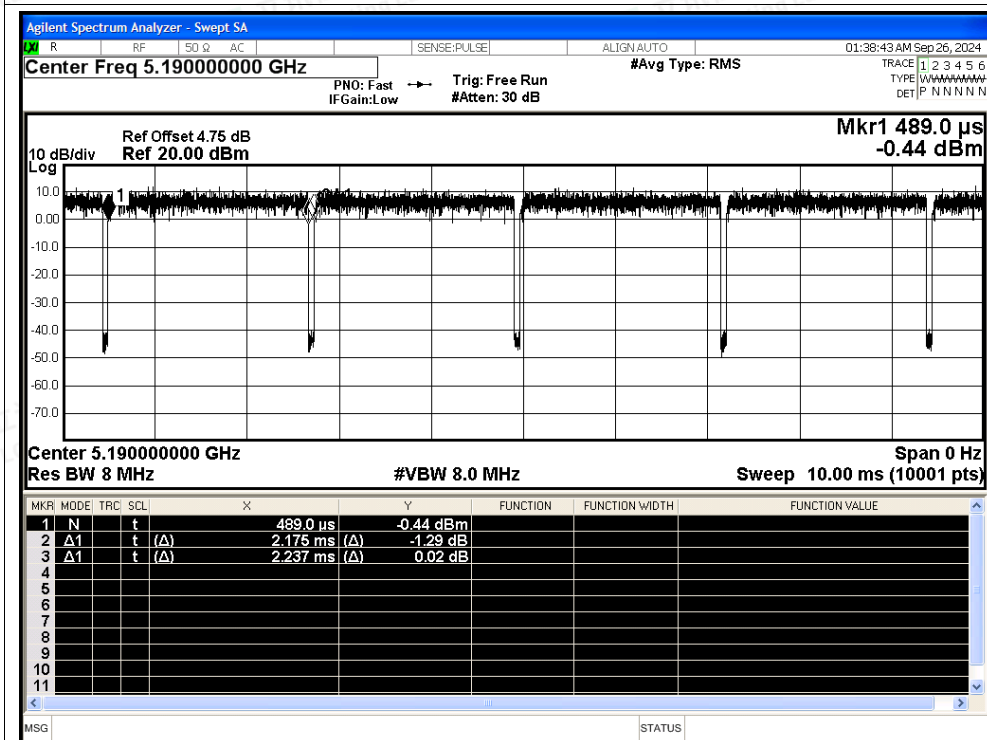

Duty Cycle NVNT n40 5230MHz Ant1


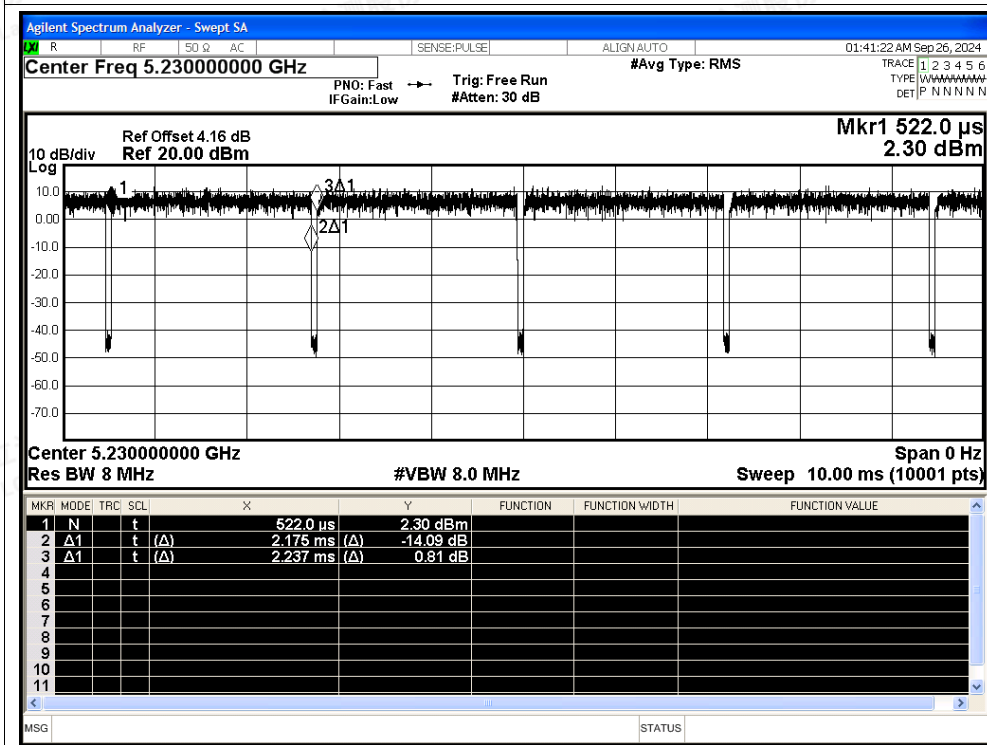


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

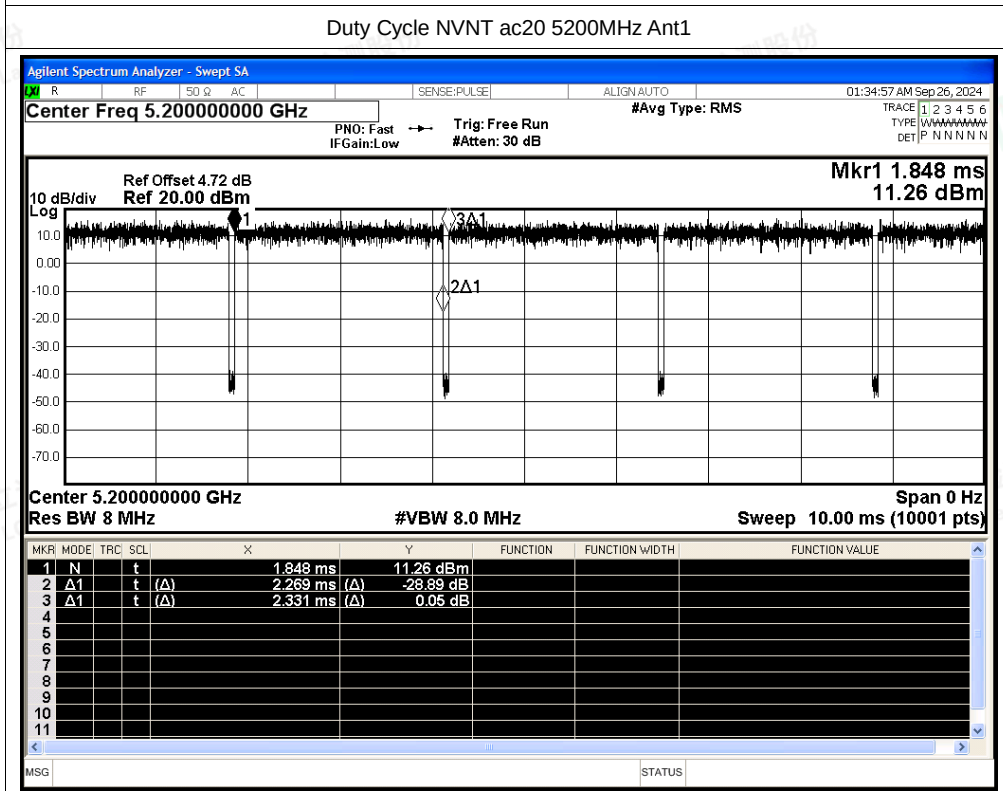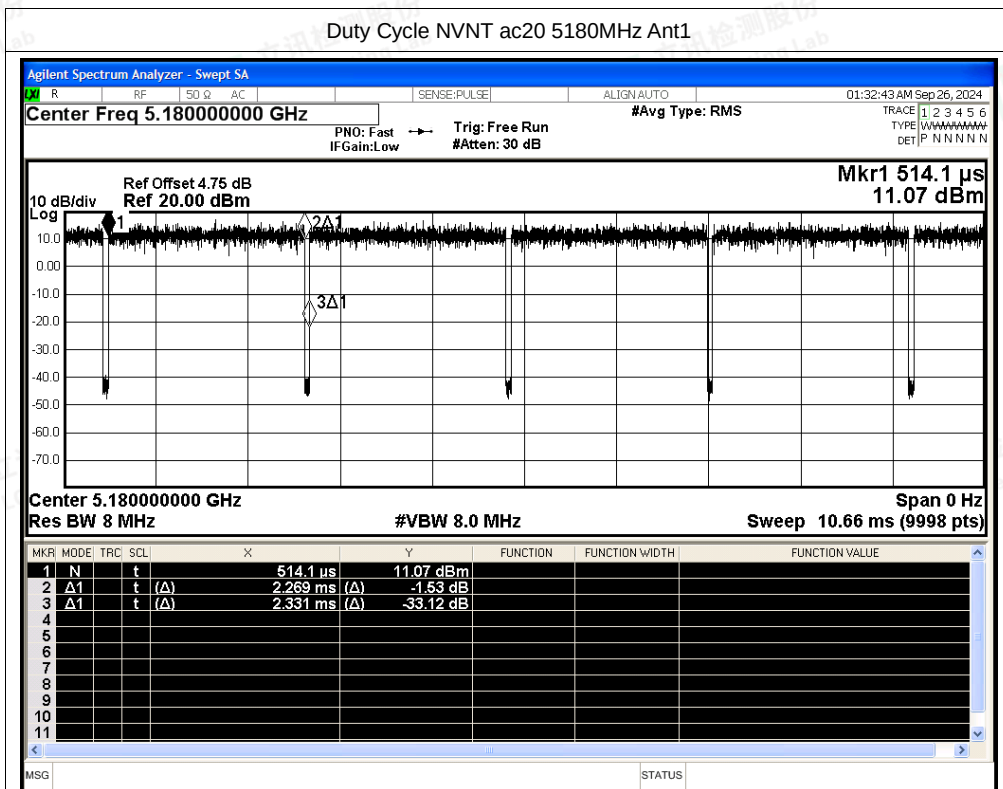

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant1

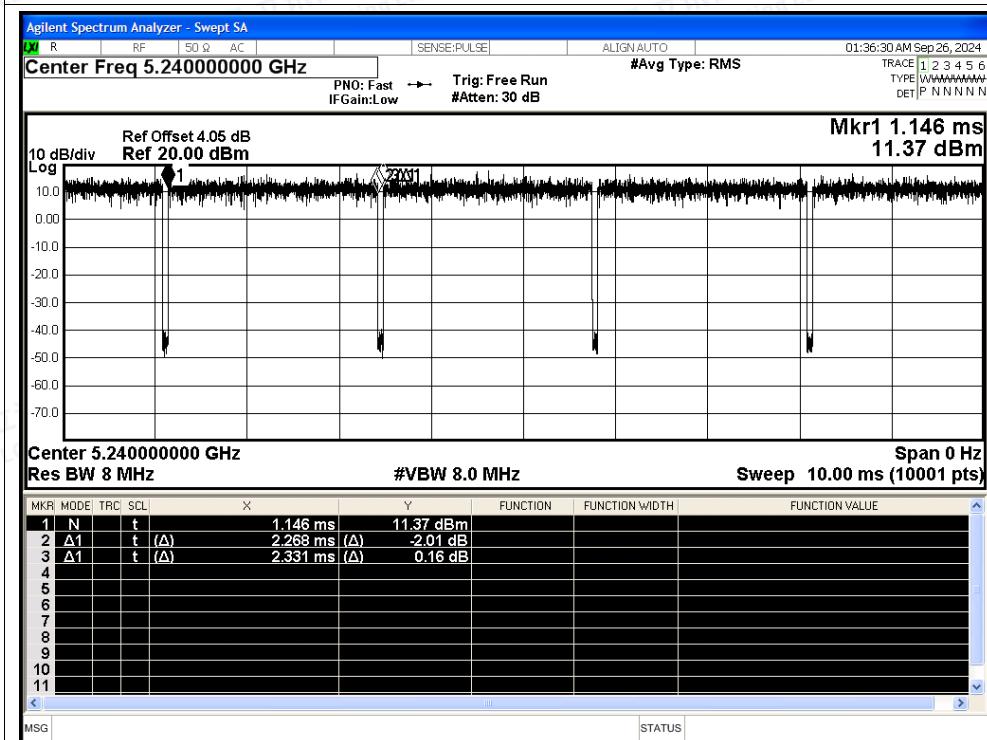

Duty Cycle NVNT ac40 5190MHz Ant1

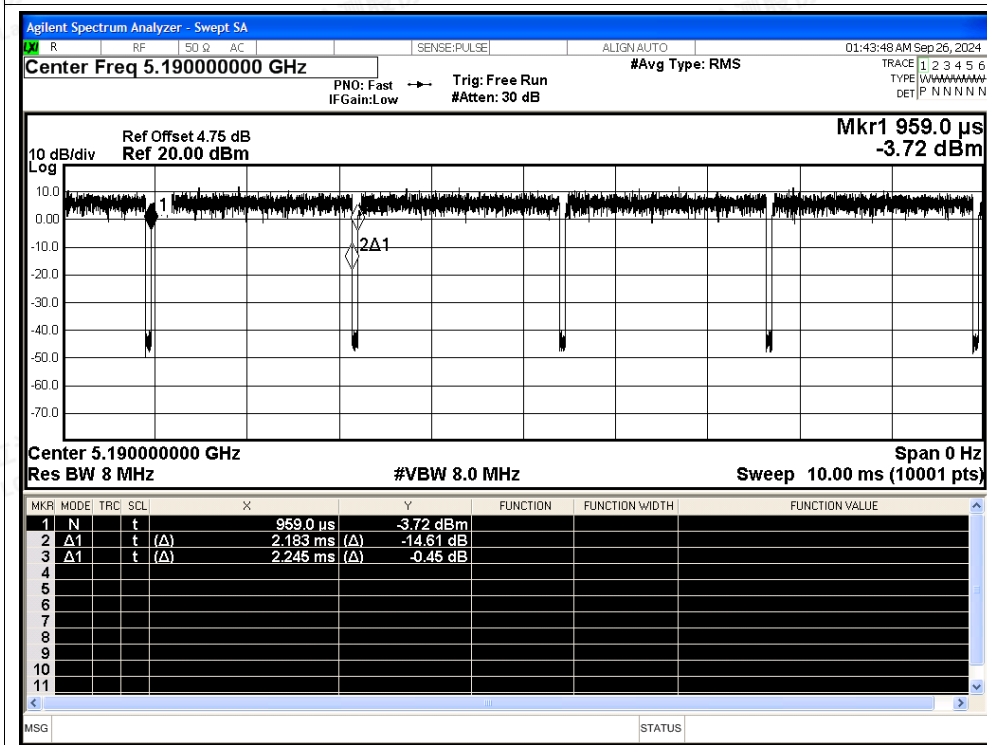

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5230MHz Ant1

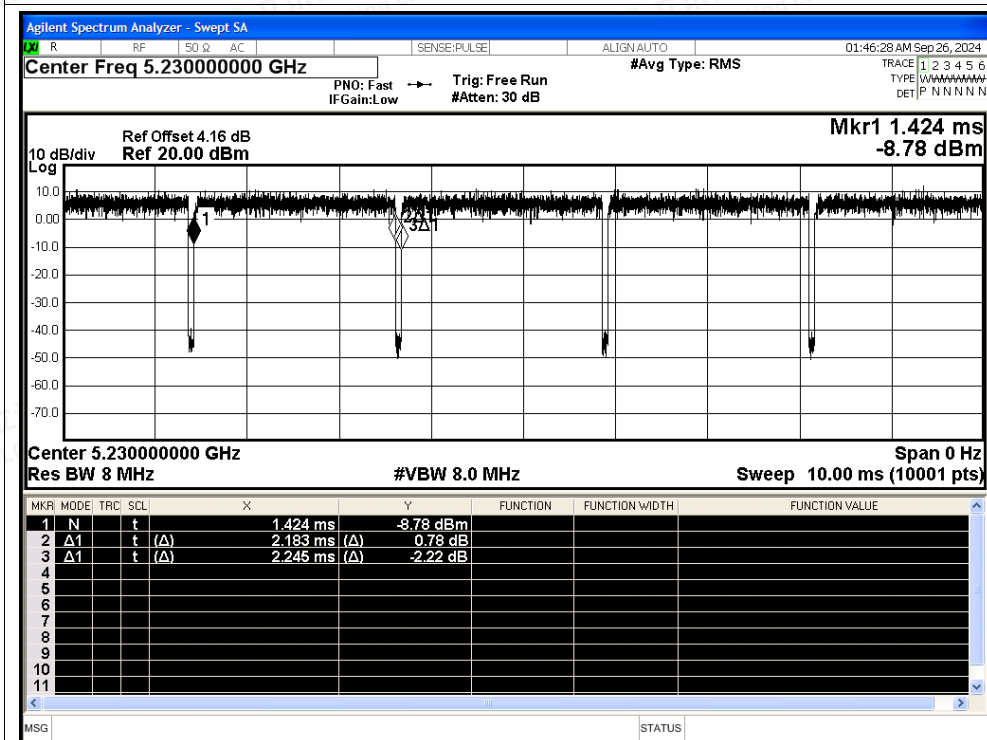

Duty Cycle NVNT ac80 5210MHz Ant1


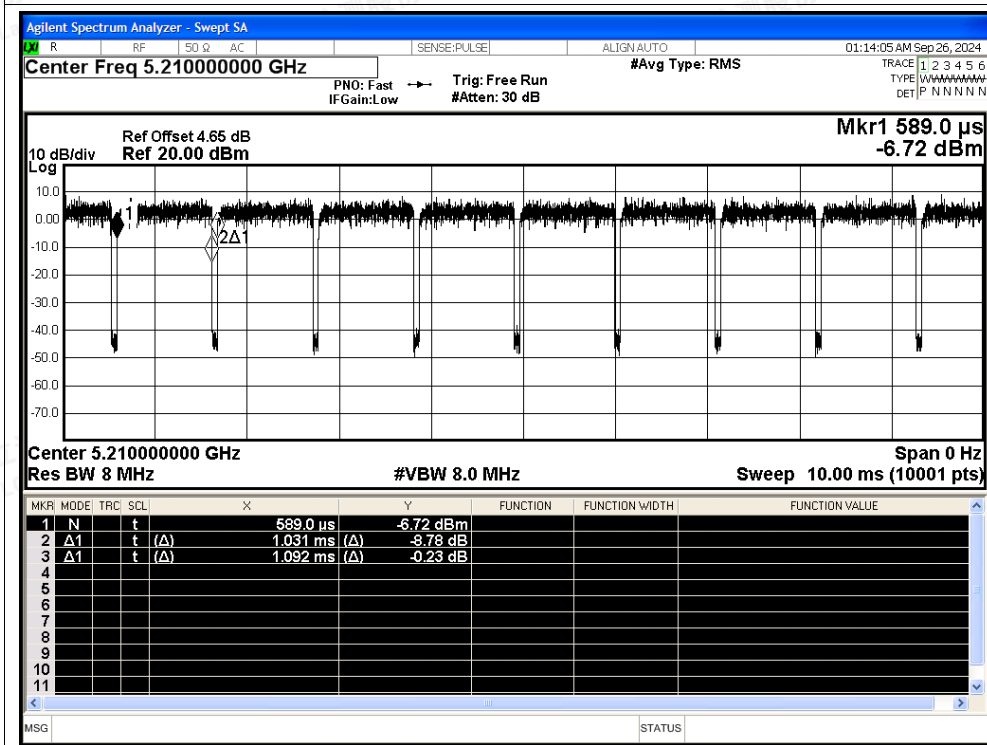


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

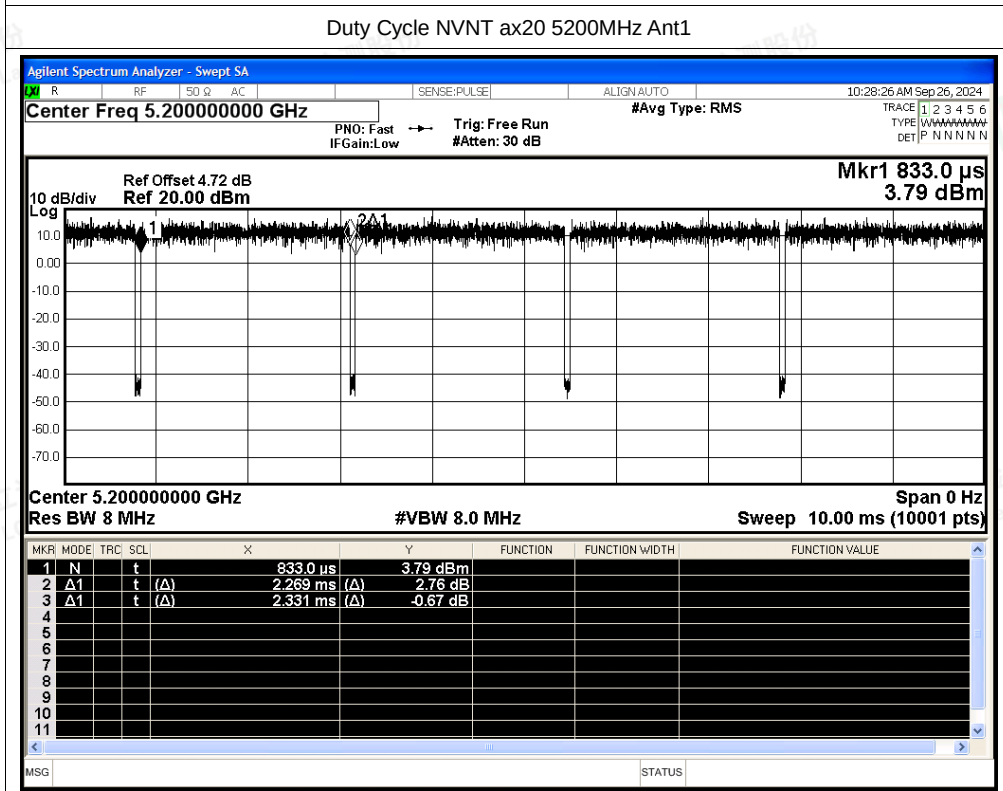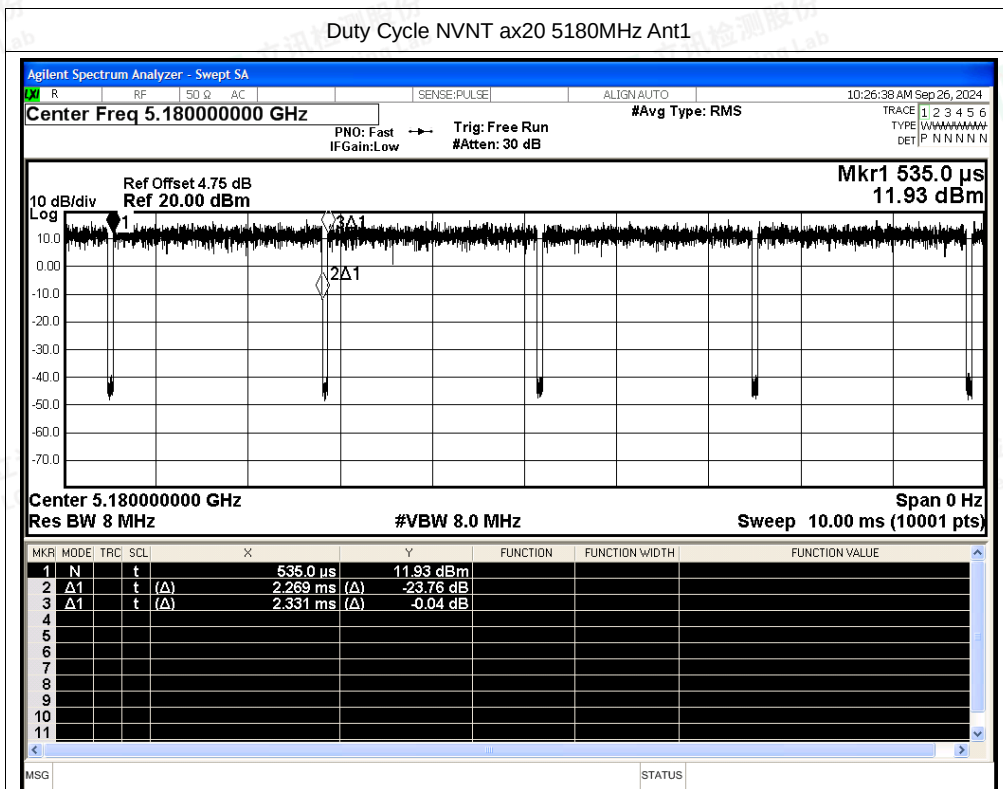

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5240MHz Ant1

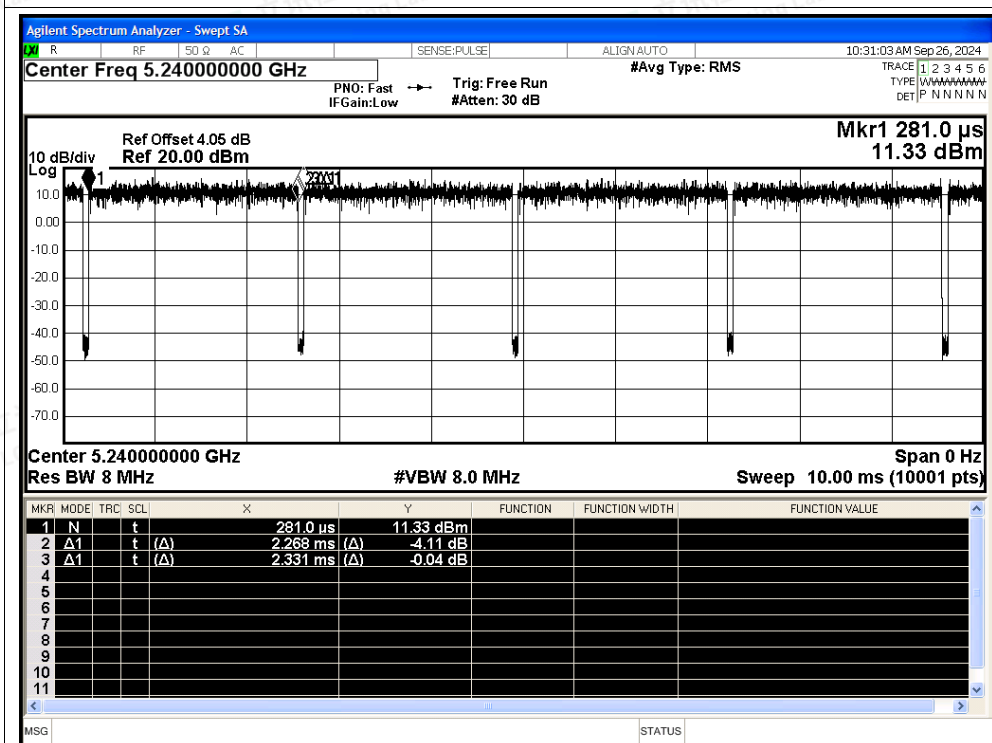

Duty Cycle NVNT ax40 5190MHz Ant1

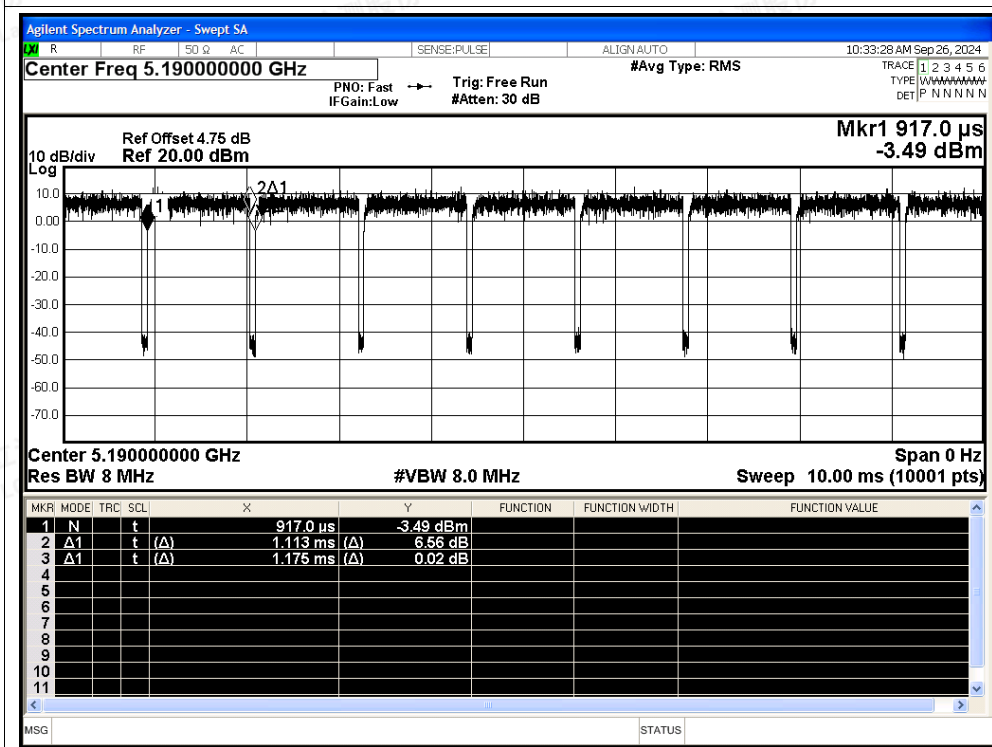

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5230MHz Ant1

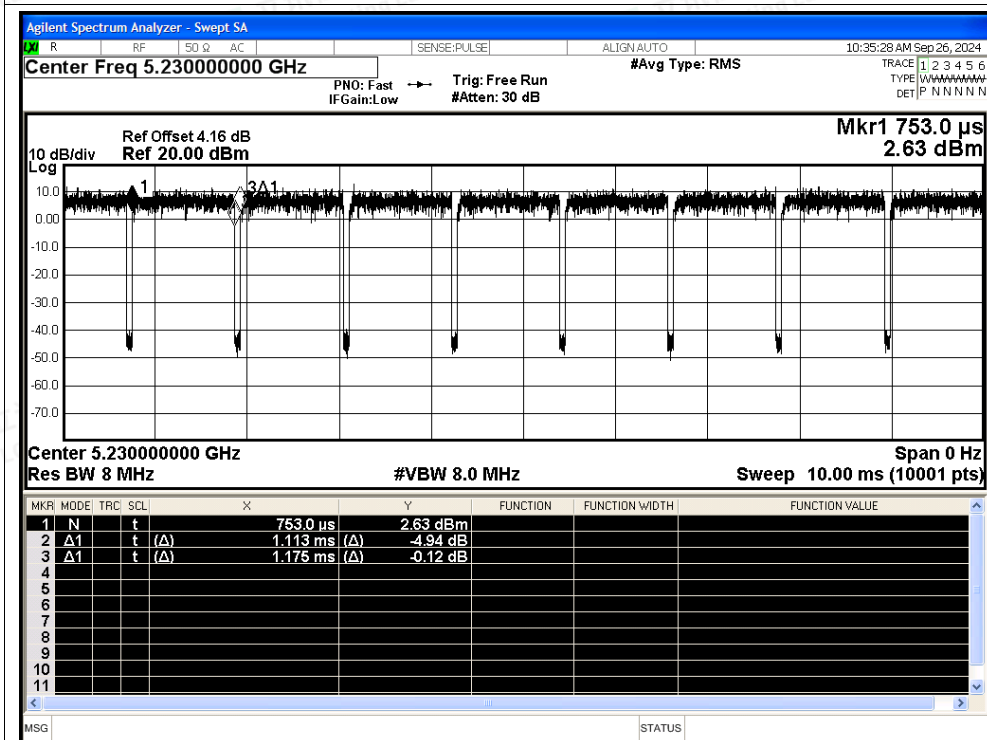

Duty Cycle NVNT ax80 5210MHz Ant1

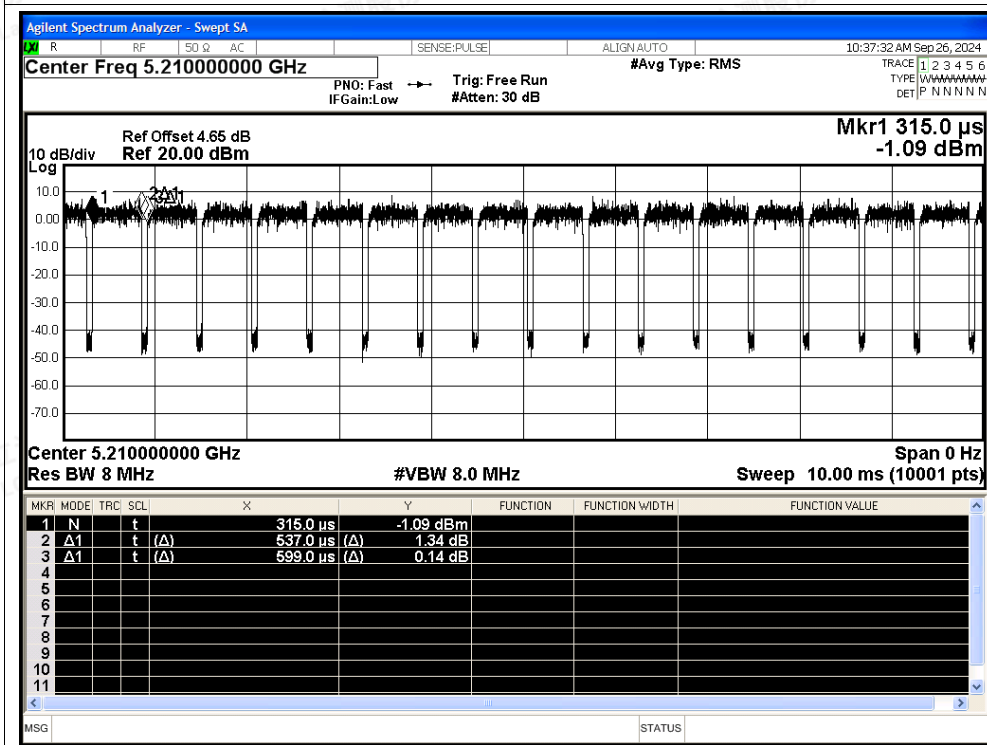

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity