



An IIA Company

# Test Report – UL-FCC Part 90 Booster Class A (B9A)

## Applicant: Fiplex Communications Inc.

Approved for Release By:

Signature: Bruno Clavier

Name & Title: Bruno Clavier, General Manager

Date of Signature 3/7/2023

This test report shall not be reproduced except in full without the written and signed permission of Timco Engineering Inc. (IIA). This test report relates only to the items tested as identified and is not valid for any subsequent changes or modifications made to the equipment under test.



## Table of Contents

|                                                                |           |
|----------------------------------------------------------------|-----------|
| <b>1. CUSTOMER INFORMATION.....</b>                            | <b>6</b>  |
| 1.1 TEST RESULT SUMMARY .....                                  | 6         |
| <b>2. LOCATION OF TESTING .....</b>                            | <b>9</b>  |
| 2.1 TEST LABORATORY.....                                       | 9         |
| 2.2 TESTING WAS PERFORMED, REVIEWED BY .....                   | 9         |
| <b>3. TEST SAMPLE(S) (EUT/DUT) .....</b>                       | <b>10</b> |
| 3.1 DEFINITIONS .....                                          | 10        |
| 3.2 DESCRIPTION OF THE EUT .....                               | 11        |
| 3.3 CONFIGURATION OF EUT .....                                 | 12        |
| 3.4 TEST SETUP OF EUT .....                                    | 12        |
| <b>4. TEST METHODS &amp; APPLICABLE REGULATORY LIMITS.....</b> | <b>13</b> |
| 4.1 TEST METHODS/STANDARDS/GUIDANCE:.....                      | 13        |
| 4.2 APPLIED LIMITS AND REGULATORY LIMITS:.....                 | 13        |
| <b>5. MEASUREMENT UNCERTAINTY.....</b>                         | <b>13</b> |
| <b>6. ENVIRONMENTAL CONDITIONS .....</b>                       | <b>13</b> |
| 6.1 TEMPERATURE & HUMIDITY .....                               | 13        |
| <b>7. LIST OF TEST EQUIPMENT AND TEST FACILITY.....</b>        | <b>14</b> |
| 7.1 LIST OF TEST EQUIPMENT .....                               | 14        |
| <b>8. TEST RESULTS .....</b>                                   | <b>15</b> |
| 8.1 POWER AT THE FINAL AMPLIFIER.....                          | 16        |
| 8.2 RF OUTPUT POWER & GAIN.....                                | 17        |
| 8.3 OUT-OF-BAND REJECTION.....                                 | 19        |
| 8.3.1 700 Band, Uplink.....                                    | 20        |
| 8.3.2 800 Band Uplink.....                                     | 21        |
| 8.4 BANDWIDTH & EMISSION .....                                 | 22        |
| 8.5 INPUT VS OUTPUT SIGNAL COMPARISON .....                    | 23        |
| 8.5.1 6.25 kHz FM, Input Signal .....                          | 26        |
| 8.5.2 12.5 kHz FM, Input Signal.....                           | 27        |
| 8.5.3 25 kHz FM, Input Signal.....                             | 28        |
| 8.5.4 C4FM, Input Signal.....                                  | 29        |
| 8.5.5 H-CPM, Input Signal .....                                | 30        |
| 8.5.6 H-DQPSK, Input Signal.....                               | 31        |
| 8.5.7 6.25 kHz, FM, UL Mask C, AGC, 788.0125 MHz .....         | 32        |
| 8.5.8 6.25 kHz, FM, UL Mask C, AGC +3, 788.0125 MHz .....      | 33        |
| 8.5.9 12.5 kHz, FM, UL Mask C, AGC, 788.0125 MHz.....          | 34        |
| 8.5.10 12.5 kHz, FM, UL Mask C, AGC+3, 788.0125 MHz.....       | 35        |
| 8.5.11 25 kHz FM, UL Mask C, AGC, 788.0125 MHz.....            | 36        |
| 8.5.12 25 kHz FM, UL Mask C, AGC+3, 788.0125 MHz.....          | 37        |



|        |                                                   |    |
|--------|---------------------------------------------------|----|
| 8.5.13 | C4FM, UL Mask C, AGC, 788.0125 MHz.....           | 38 |
| 8.5.14 | C4FM, UL Mask C, AGC+3, 788.0125 MHz.....         | 39 |
| 8.5.15 | H-CPM, UL Mask C, AGC, 788.0125 MHz.....          | 40 |
| 8.5.16 | H-CPM, UL Mask C, AGC+3, 788.0125 MHz.....        | 41 |
| 8.5.17 | H-DQPSK, UL Mask C, AGC, 788.0125 MHz.....        | 42 |
| 8.5.18 | H-DQPSK, UL Mask C, AGC+3, 788.0125 MHz.....      | 43 |
| 8.5.19 | 6.25 kHz, FM, UL Mask C, AGC, 796 MHz.....        | 44 |
| 8.5.20 | 6.25 kHz, FM, UL Mask C, AGC+3, 796 MHz.....      | 45 |
| 8.5.21 | 12.5 kHz, FM, UL Mask C, AGC, 796 MHz.....        | 46 |
| 8.5.22 | 12.5 kHz, FM, UL Mask C, AGC+3, 796 MHz.....      | 47 |
| 8.5.23 | 25 kHz FM, UL Mask C, AGC, 796 MHz.....           | 48 |
| 8.5.24 | 25 kHz FM, UL Mask C, AGC+3, 796 MHz.....         | 49 |
| 8.5.25 | C4FM, UL Mask C, AGC, 796 MHz.....                | 50 |
| 8.5.26 | C4FM, UL Mask C, AGC+3, 796 MHz.....              | 51 |
| 8.5.27 | H-CPM, UL Mask C, AGC, 796 MHz.....               | 52 |
| 8.5.28 | H-CPM, UL Mask C, AGC+3, 796 MHz.....             | 53 |
| 8.5.29 | H-DQPSK, UL Mask C, AGC, 796 MHz.....             | 54 |
| 8.5.30 | H-DQPSK, UL Mask C, AGC+3, 796 MHz.....           | 55 |
| 8.5.31 | 6.25 kHz, FM, UL Mask C, AGC, 804.9875 MHz.....   | 56 |
| 8.5.32 | 6.25 kHz, FM, UL Mask C, AGC+3, 804.9875 MHz..... | 57 |
| 8.5.33 | 12.5 kHz, FM, UL Mask C, AGC, 804.9875 MHz.....   | 58 |
| 8.5.34 | 12.5 kHz, FM, UL Mask C, AGC+3, 804.9875 MHz..... | 59 |
| 8.5.35 | 25 kHz FM, UL Mask C, AGC, 804.9875 MHz.....      | 60 |
| 8.5.36 | 25 kHz FM, UL Mask C, AGC+3, 804.9875 MHz.....    | 61 |
| 8.5.37 | C4FM, UL Mask C, AGC, 804.9875 MHz.....           | 62 |
| 8.5.38 | C4FM, UL Mask C, AGC+3, 804.9875 MHz.....         | 63 |
| 8.5.39 | H-CPM, UL Mask C, AGC, 804.9875 MHz.....          | 64 |
| 8.5.40 | H-CPM, UL Mask C, AGC+3, 804.9875 MHz.....        | 65 |
| 8.5.41 | H-DQPSK, UL Mask C, AGC, 804.9875 MHz.....        | 66 |
| 8.5.42 | H-DQPSK, UL Mask C, AGC+3, 804.9875 MHz.....      | 67 |
| 8.5.43 | 6.25 kHz, FM, UL Mask H, AGC, 806.0125 MHz.....   | 68 |
| 8.5.44 | 6.25 kHz, FM, UL Mask H, AGC+3, 806.0125 MHz..... | 69 |
| 8.5.45 | 12.5 kHz, FM, UL Mask H, AGC, 806.0125 MHz.....   | 70 |
| 8.5.46 | 12.5 kHz, FM, UL Mask H, AGC+3, 806.0125 MHz..... | 71 |
| 8.5.47 | 25 kHz FM, UL Mask H, AGC, 806.0125 MHz.....      | 72 |
| 8.5.48 | 25 kHz FM, UL Mask H, AGC+3, 806.0125 MHz.....    | 73 |
| 8.5.49 | C4FM, UL Mask H, AGC, 806.0125 MHz.....           | 74 |
| 8.5.50 | C4FM, UL Mask H, AGC+3, 806.0125 MHz.....         | 75 |
| 8.5.51 | H-CPM, UL Mask H, AGC, 806.0125 MHz.....          | 76 |
| 8.5.52 | H-CPM, UL Mask H, AGC+3, 806.0125 MHz.....        | 77 |
| 8.5.53 | H-DQPSK, UL Mask H, AGC, 806.0125 MHz.....        | 78 |
| 8.5.54 | H-DQPSK, UL Mask H, AGC+3, 806.0125 MHz.....      | 79 |
| 8.5.55 | 6.25 kHz, FM, UL Mask E, AGC, 812 MHz.....        | 80 |
| 8.5.56 | 6.25 kHz, FM, UL Mask E, AGC+3, 812 MHz.....      | 81 |
| 8.5.57 | 12.5 kHz, FM, UL Mask D, AGC, 812 MHz.....        | 82 |
| 8.5.58 | 12.5 kHz, FM, UL Mask D, AGC+3, 812 MHz.....      | 83 |



|        |                                                                    |     |
|--------|--------------------------------------------------------------------|-----|
| 8.5.59 | 25 kHz FM, UL Mask G, AGC, 812 MHz.....                            | 84  |
| 8.5.60 | 25 kHz FM, UL Mask G, AGC+3, 812 MHz.....                          | 85  |
| 8.5.61 | C4FM, UL Mask D, AGC, 812 MHz.....                                 | 86  |
| 8.5.62 | C4FM, UL Mask D, AGC+3, 812 MHz.....                               | 87  |
| 8.5.63 | H-CPM, UL Mask D, AGC, 812 MHz.....                                | 88  |
| 8.5.64 | H-CPM, UL Mask D, AGC+3, 812 MHz.....                              | 89  |
| 8.5.65 | H-DQPSK, UL Mask D, AGC, 812 MHz.....                              | 90  |
| 8.5.66 | H-DQPSK, UL Mask D, AGC+3, 812 MHz.....                            | 91  |
| 8.5.67 | 6.25 kHz, FM, UL Mask E, AGC, 823.9875 MHz.....                    | 92  |
| 8.5.68 | 6.25 kHz, FM, UL Mask E, AGC+3, 823.9875 MHz.....                  | 93  |
| 8.5.69 | 12.5 kHz, FM, UL Mask D, AGC, 823.9875 MHz.....                    | 94  |
| 8.5.70 | 12.5 kHz, FM, UL Mask D, AGC+3, 823.9875 MHz.....                  | 95  |
| 8.5.71 | 25 kHz FM, UL Mask G, AGC, 823.9875 MHz.....                       | 96  |
| 8.5.72 | 25 kHz FM, UL Mask G, AGC+3, 823.9875 MHz.....                     | 97  |
| 8.5.73 | C4FM, UL Mask D, AGC, 823.9875 MHz.....                            | 98  |
| 8.5.74 | C4FM, UL Mask D, AGC+3, 823.9875 MHz.....                          | 99  |
| 8.5.75 | H-CPM, UL Mask D, AGC, 823.9875 MHz.....                           | 100 |
| 8.5.76 | H-CPM, UL Mask D, AGC+3, 823.9875 MHz.....                         | 101 |
| 8.5.77 | H-DQPSK, UL Mask D, AGC, 823.9875 MHz.....                         | 102 |
| 8.5.78 | H-DQPSK, UL Mask D, AGC+3, 823.9875 MHz.....                       | 103 |
| 8.6    | NOISE FIGURE.....                                                  | 104 |
| 8.7    | OUT-OF-BAND/OUT-OF-BLOCK EMISSIONS (INTERMODULATION PRODUCTS)..... | 105 |
| 8.7.1  | 6.25 kHz Signal, Uplink, AGC, 788.0125 MHz.....                    | 106 |
| 8.7.2  | 6.25 kHz Signal, Uplink, AGC+3dB, 788.0125 MHz.....                | 107 |
| 8.7.3  | 12.5 kHz Signal, Uplink, AGC, 788.0125 MHz.....                    | 108 |
| 8.7.4  | 12.5 kHz Signal, Uplink, AGC+3dB, 788.0125 MHz.....                | 109 |
| 8.7.5  | 25 kHz Signal, Uplink, AGC, 788.0125 MHz.....                      | 110 |
| 8.7.6  | 25 kHz Signal, Uplink, AGC+3dB, 788.0125 MHz.....                  | 111 |
| 8.7.7  | 6.25 kHz Signal, Uplink, AGC, 796 MHz.....                         | 112 |
| 8.7.8  | 6.25 kHz Signal, Uplink, AGC+3dB, 796 MHz.....                     | 113 |
| 8.7.9  | 12.5 kHz Signal, Uplink, AGC, 796 MHz.....                         | 114 |
| 8.7.10 | 12.5 kHz Signal, Uplink, AGC+3dB, 796 MHz.....                     | 115 |
| 8.7.11 | 25 kHz Signal, Uplink, AGC, 796 MHz.....                           | 116 |
| 8.7.12 | 25 kHz Signal, Uplink, AGC+3dB, 796 MHz.....                       | 117 |
| 8.7.13 | 6.25 kHz Signal, Uplink, AGC, 804.9875 MHz.....                    | 118 |
| 8.7.14 | 6.25 kHz Signal, Uplink, AGC+3dB, 804.9875 MHz.....                | 119 |
| 8.7.15 | 12.5 kHz Signal, Uplink, AGC, 804.9875 MHz.....                    | 120 |
| 8.7.16 | 12.5 kHz Signal, Uplink, AGC+3dB, 804.9875 MHz.....                | 121 |
| 8.7.17 | 25 kHz Signal, Uplink, AGC, 804.9875 MHz.....                      | 122 |
| 8.7.18 | 25 kHz Signal, Uplink, AGC+3dB, 804.9875 MHz.....                  | 123 |
| 8.7.19 | 6.25 kHz Signal, Uplink, AGC, 806.0125 MHz.....                    | 124 |
| 8.7.20 | 6.25 kHz Signal, Uplink, AGC+3dB, 806.0125 MHz.....                | 125 |
| 8.7.21 | 12.5 kHz Signal, Uplink, AGC, 806.0125 MHz.....                    | 126 |
| 8.7.22 | 12.5 kHz Signal, Uplink, AGC+3dB, 806.0125 MHz.....                | 127 |
| 8.7.23 | 25 kHz Signal, Uplink, AGC, 806.0125 MHz.....                      | 128 |
| 8.7.24 | 25 kHz Signal, Uplink, AGC+3dB, 806.0125 MHz.....                  | 129 |



|        |                                                        |     |
|--------|--------------------------------------------------------|-----|
| 8.7.25 | 6.25 kHz Signal, Uplink, AGC, 812 MHz .....            | 130 |
| 8.7.26 | 6.25 kHz Signal, Uplink, AGC+3dB, 812 MHz .....        | 131 |
| 8.7.27 | 12.5 kHz Signal, Uplink, AGC, 812 MHz .....            | 132 |
| 8.7.28 | 12.5 kHz Signal, Uplink, AGC+3dB, 812 MHz .....        | 133 |
| 8.7.29 | 25 kHz Signal, Uplink, AGC, 812 MHz .....              | 134 |
| 8.7.30 | 25 kHz Signal, Uplink, AGC+3dB, 812 MHz .....          | 135 |
| 8.7.31 | 6.25 kHz Signal, Uplink, AGC, 823.9875 MHz .....       | 136 |
| 8.7.32 | 6.25 kHz Signal, Uplink, AGC+3dB, 823.9875 MHz .....   | 137 |
| 8.7.33 | 12.5 kHz Signal, Uplink, AGC, 823.9875 MHz .....       | 138 |
| 8.7.34 | 12.5 kHz Signal, Uplink, AGC+3dB, 823.9875 MHz .....   | 139 |
| 8.7.35 | 25 kHz Signal, Uplink, AGC, 823.9875 MHz .....         | 140 |
| 8.7.36 | 25 kHz Signal, Uplink, AGC+3dB, 823.9875 MHz .....     | 141 |
| 8.8    | EMISSION MASK, OUT-OF-BAND .....                       | 142 |
| 8.8.1  | 30 MHz to 1 GHz, 788.0125 MHz .....                    | 143 |
| 8.8.2  | 1 GHz to 10 <sup>th</sup> Harmonic, 788.0125 MHz ..... | 144 |
| 8.8.3  | 30 MHz to 1 GHz, 796 MHz .....                         | 145 |
| 8.8.4  | 1 GHz to 10 <sup>th</sup> Harmonic, 796 MHz .....      | 146 |
| 8.8.5  | 30 MHz to 1 GHz, 804.9875 MHz .....                    | 147 |
| 8.8.6  | 1 GHz to 10 <sup>th</sup> Harmonic, 804.9875 MHz ..... | 148 |
| 8.8.7  | 30 MHz to 1 GHz, 806.0125 MHz .....                    | 149 |
| 8.8.8  | 1 GHz to 10 <sup>th</sup> Harmonic, 806.0125 MHz ..... | 150 |
| 8.8.9  | 30 MHz to 1 GHz, 812 MHz .....                         | 151 |
| 8.8.10 | 1 GHz to 10 <sup>th</sup> Harmonic, 812 MHz .....      | 152 |
| 8.8.11 | 30 MHz to 1 GHz, 823.9875 MHz .....                    | 153 |
| 8.8.12 | 1 GHz to 10 <sup>th</sup> Harmonic, 823.9875 MHz ..... | 154 |
| 8.9    | SPURIOUS RADIATED EMISSIONS .....                      | 155 |
| 8.9.1  | Uplink, 788.0125 MHz .....                             | 156 |
| 8.9.2  | Uplink, 796 MHz .....                                  | 157 |
| 8.9.3  | Uplink, 804.9875 MHz .....                             | 158 |
| 8.9.4  | Uplink, 806.0125 MHz .....                             | 159 |
| 8.9.5  | Uplink, 812 MHz .....                                  | 160 |
| 8.9.6  | Uplink, 823.9875 MHz .....                             | 161 |
| 8.10   | MODULATION CHARACTERISTICS .....                       | 162 |
| 8.11   | FREQUENCY STABILITY .....                              | 163 |
| 8.12   | TRANSIENT FREQUENCY BEHAVIOR .....                     | 164 |
| 8.13   | ADJACENT CHANNEL POWER LIMITS .....                    | 165 |
| 9.     | ANNEX-A - PHOTOGRAPHS OF THE EUT .....                 | 166 |
| 10.    | ANNEX-B – TEST SETUP PHOTOGRAPHS .....                 | 166 |
| 11.    | HISTORY OF TEST REPORT CHANGES .....                   | 166 |



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

## 1. Customer Information

**Applicant:** Fiplex Communications Inc.  
**Address:** 2101 NW 79th Avenue,  
Miami, Florida, 33122, United States

### 1.1 Test Result Summary

The following test procedure and guidance were used for measuring FCC PART 90 (PRIVATE LAND MOBILE RADIO SERVICES) known as Licensed Land Mobile; ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters. Full test results are available in this report.

No additions to the test methods were needed. There were no deviations, or exclusions from the test methods. No test results are from external providers or from the customer. The test results relate only to the items tested. Timco does not offer opinions and interpretations, only a pass/fail statement.

| Applicable Clauses from Part 2 |                                         |                           |
|--------------------------------|-----------------------------------------|---------------------------|
| FCC Part 2 Clauses             | Description of the requirements         | Result: (Pass, Fail, N/A) |
| 2.202                          | Bandwidth & Emission                    | Pass                      |
| 2.1033 (c)(8)                  | Power at the Final Amplifier            | Pass                      |
| 2.1046 (a)                     | RF Output Power                         | Pass                      |
| 2.1047                         | Modulation characteristics              | n/a                       |
| 2.1049                         | Occupied Bandwidth                      | Pass                      |
| 2.1051                         | Spurious emissions at antenna terminals | Pass                      |
| 2.1053                         | Field strength of spurious radiation    | Pass                      |
| 2.1055                         | Frequency stability                     | n/a                       |



| Applicable Clauses from Part 90 Subpart I |                                                          |                              |
|-------------------------------------------|----------------------------------------------------------|------------------------------|
| FCC Part 90 Clauses                       | Description of the requirements                          | Result:<br>(Pass, Fail, N/A) |
| 90.205                                    | Transmitter Power                                        | Pass                         |
| 90.207                                    | Types of Emissions                                       | Pass                         |
| 90.209                                    | Bandwidth limitations                                    | Pass                         |
| 90.210                                    | Emission masks, In-band                                  | Pass                         |
| 90.210                                    | Emission masks, Out-of-band                              | Pass                         |
| 90.213                                    | Frequency stability                                      | n/a                          |
| 90.214                                    | Transient Frequency Behavior                             | n/a                          |
| 90.219 (d)(6)(i)                          | ERP of intermodulation products                          | n/a <sup>1</sup>             |
| 90.219 (d)(6)(ii)                         | ERP of noise within the passband                         | n/a <sup>1</sup>             |
| 90.219 (d)(6)(iii)                        | ERP of noise on spectrum < 1 MHz outside of the passband | n/a <sup>1</sup>             |
| 90.219 (d)(3)(i), (e)(1)                  | ERP of Radiated Power                                    | n/a <sup>1</sup>             |
| 90.219 (e)(2)                             | Noise figure                                             | Pass                         |
| 90.219 (e)(3)                             | Spurious emissions                                       | Pass                         |
| 90.219 (e)(4)(i)(ii)(iii)                 | Retransmitted Signals                                    | n/a                          |
| 90.221                                    | Adjacent channel power limits                            | n/a                          |

**Note 1:** Requirements in Part 90.219 (d) apply at deployment of this EUT, therefore are not applicable at certification.

| KDB 935210 D05 v01r04      |                                                                         |                              |
|----------------------------|-------------------------------------------------------------------------|------------------------------|
| FCC KDB 935210 D05 Clauses | Description of the requirements                                         | Result:<br>(Pass, Fail, N/A) |
| 4.1                        | Test Signals for PLMRS (Input Signals)                                  | Pass                         |
| 4.2                        | AGC Threshold                                                           | Reported                     |
| 4.3                        | Out-of-Band Rejection                                                   | Reported                     |
| 4.4                        | Input-versus-Output Signal Comparison                                   | Pass                         |
| 4.5                        | Output Power                                                            | Pass                         |
| 4.5                        | Amplifier/Booster Gain (optional)                                       | Reported                     |
| 4.6                        | Noise Figure                                                            | Pass                         |
| 4.7.2                      | Out-of-band/Out-of-block Conducted Emissions (Intermodulation Products) | Pass                         |
| 4.7.3                      | EUT Spurious Conducted Emissions                                        | Pass                         |
| 4.8                        | Frequency Stability                                                     | n/a                          |
| 4.9                        | Spurious Radiated Emissions                                             | Pass                         |



| KDB 484596 D01 v01            |                                 |                                 |
|-------------------------------|---------------------------------|---------------------------------|
| FCC KDB 935210<br>D05 Clauses | Description of the requirements | Result:<br>(Pass, Fail,<br>N/A) |
| 3 a                           | Introduction                    | Reported                        |
| 3 b                           | Explain the Differences         | Reported                        |
| 3 c                           | Spot-check Verification Data    | Pass                            |
| 3 d                           | Reference Section               | Reported                        |

### Introduction

Equipment classes B9A and B9B are not allowed to be filed under the same FCC ID. However, FCC ID P3TDH7S-8A is electrically identical to FCC ID P3TDH7S-8B. The EUT uses software to limit the passband, converting the EUT from a Class B Industrial Signal Booster into a Class A Industrial Signal Booster. The test data is valid to be re-used due to the Class B operation of the EUT being worst-case in all aspects. The Class A operation represented in this filing was equal or more compliant with FCC Part 90 in all respects. Therefore all testing is to be considered identical, and has been re-used following the guidelines of KDB 484596.

### Explain the Differences

FCC ID P3TDH17S-8A is electrically identical to FCC ID P3TDH7S-8B and has no difference in hardware. The EUT uses software to limit the passband from widths equal to or greater than 75 kHz to widths less than 75 kHz.

### Spot-Check Verification Data

Please see sections Out-of-Band Rejection and Spurious Radiated Emissions in this report for Spot-Check data.

### Reference Section

All original test data is from FCC ID P3TDH7S-8B, test report *"TR\_6057-23\_UL\_FCC 90\_Booster Class B\_1.docx"*.



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

## 2. Location of Testing

### 2.1 Test Laboratory

Timco Engineering Inc. is a subsidiary of Industrial Inspection & Analysis, Inc. ("IIA").

Testing was performed at Timco's permanent laboratory located at 849 NW State Road 45, Newberry, Florida 32669

FCC test firm # 578780

FCC Designation # US1070

FCC site registration is under A2LA certificate # 0955.01

ISED Canada test site registration # 2056A

EU Notified Body # 1177

For all designations see A2LA scope # 0955.01

### 2.2 Testing was performed, reviewed by

Dates of Testing: 1/25/23 – 2/3/23

Signature:

Sr. EMC Engineer  
EMC-003838-NE



Name & Title:

Tim Royer, EMC Engineer

Date of Signature

3/7/2023

Signature:

Name & Title:

Kristoffer Costa, EMC Technician

Date of Signature

3/7/2023



### 3. Test Sample(s) (EUT/DUT)

The test sample was received: 1/9/2023

#### 3.1 Definitions

***Signal booster:*** A device or system that automatically receives, amplifies, and retransmits signals from wireless stations into and out of building interiors, tunnels, shielded outdoor areas and other locations where these signals would otherwise be too weak for reliable communications. Signal booster systems may contain both Class A and Class B signal boosters as components.

***Class A signal booster:*** A signal booster designed to retransmit signals on one or more specific channels. A signal booster is deemed to be a Class A signal booster if none of its passbands exceed 75 kHz.

***Class B signal booster:*** A signal booster designed to retransmit any signals within a wide frequency band. A signal booster is deemed to be a Class B signal booster if it has a passband that exceeds 75 kHz.



### 3.2 Description of the EUT

A description as well as unambiguous identification of the EUT(s) tested. Where more than one sample is required for technical reasons (such as the use of connected units for the purpose of conducted output power testing where the product units will have integral antennas), each specific test shall identify which unit was tested.

| Identification    |                                       |
|-------------------|---------------------------------------|
| FCC ID:           | P3TDH7S-8A                            |
| Brief Description | BDA All In One Digital Signal Booster |
| Model(s) #        | HONBDA-A                              |
| Firmware version  | N/A                                   |
| Software version  | N/A                                   |
| Serial Number     | N/A                                   |

| Technical Characteristics    |                                                                                 |
|------------------------------|---------------------------------------------------------------------------------|
| Frequency Range              | Uplink: 788 MHz- 805 MHz & 806 MHz- 824 MHz                                     |
| RF O/P Power (Max.)          | 23.76 dBm/ 0.239 W                                                              |
| Modulation                   | FM                                                                              |
| Bandwidth & Emission Class   | 12K3F3E, 7K85F3E, 4K02F3E, 8K18F1D, 8K18F1E, 7K96F1W, 9K60F1D, 9K60F1E, 9K60D7W |
| Duty Cycle                   | 100%                                                                            |
| Antenna Connector            | N Type                                                                          |
| Voltage Rating (AC or Batt.) | 110VAC, 24VDC Battery (Internal)                                                |

| Antenna Characteristics |                 |           |              |
|-------------------------|-----------------|-----------|--------------|
| Antenna                 | Frequency Range | Mode / BW | Antenna Gain |
| 1                       | n/a             | n/a       | 0 dBi        |

- Note: Information such as antenna gain, firmware/software numbers are provided by manufacturer and cannot be validated by the test lab.



### 3.3 Configuration of EUT

| Test Modes |                |                        |
|------------|----------------|------------------------|
| Band (MHz) | Link Direction | Test Frequencies (MHz) |
| 700 MHz    | Uplink         | 788.0125 MHz           |
|            |                | 796 MHz                |
|            |                | 804.9875 MHz           |
| 800 MHz    | Uplink         | 806.0125 MHz           |
|            |                | 812 MHz                |
|            |                | 824.9875 MHz           |

#### Operating conditions during Testing:

No other modifications of the device under test (including firmware, specific software settings, and input/output signal levels to the EUT) were made.

#### Peripherals used during Testing:

A laptop was used to program the EUT.

### 3.4 Test Setup of EUT

Equipment, antenna, and cable arrangement. The setup of the equipment and cable or wire placement on the test site that produces the highest radiated and the highest ac power line conducted emissions shall be shown clearly and described. Information on the orientation of portable equipment during testing shall be included. Drawings or photographs may be used for this purpose.

Test Setups are included in the test report.



#### 4. Test methods & Applicable Regulatory Limits

##### 4.1 Test methods/Standards/Guidance:

Test procedures and guidance for measuring Licensed Part 90 Licensed device:

- 1) ANSI C63.26-2015
- 2) FCC KDB 935210 D05 v01r04 Industrial Signal Boosters

##### 4.2 Applied Limits and Regulatory Limits:

- 1) FCC CFR 47 Part 90 Subpart I, 90.219

#### 5. Measurement Uncertainty

| Parameter                                                                                                                                                                   | Uncertainty (dB) |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------|
| Conducted Emissions                                                                                                                                                         | $\pm 3.14$ dB    |
| Radiated Emissions (9kHz – 30 MHz)                                                                                                                                          | $\pm 3.08$ dB    |
| Radiated Emissions (30 – 200 MHz)                                                                                                                                           | $\pm 2.16$ dB    |
| Radiated Emissions (200 – 1000 MHz)                                                                                                                                         | $\pm 2.15$ dB    |
| Radiated Emissions (1 GHz – 18 GHz)                                                                                                                                         | $\pm 2.14$ dB    |
| Radiated Emissions (18 GHz – 40 GHz)                                                                                                                                        | $\pm 2.31$ dB    |
| <b>Note:</b> The uncertainties provided in this table represent an expanded uncertainty expressed at approximately the 95% confidence level using a coverage factor of K=2. |                  |

#### 6. Environmental Conditions

##### 6.1 Temperature & Humidity

Measurements performed at the test site did not exceed the following:

| Parameter                                                                                                                       | Measurement |
|---------------------------------------------------------------------------------------------------------------------------------|-------------|
| Temperature                                                                                                                     | 23 C +/- 5% |
| Humidity                                                                                                                        | 55% +/- 5%  |
| Barometric Pressure                                                                                                             | 30.05 in Hg |
| <b>Note:</b> Specific environmental conditions that are applicable to a specific test are available in the test result section. |             |



## 7. List of Test Equipment and Test Facility

The test equipment used identified by type, manufacturer, serial number, or other identification and the date on which the next calibration or service check is due.

Description of the firmware or software used to operate EUT for testing purposes.

A complete list of all test equipment used shall be included with the test report. The manufacturer's model and serial numbers, and date of last calibration, and calibration interval shall be included. Measurement cable loss, measuring instrument bandwidth and detector function, video bandwidth, if appropriate, and antenna factors shall also be included where applicable.

### 7.1 List of Test Equipment

| Test Equipment     |                               |                 |             |             |             |            |
|--------------------|-------------------------------|-----------------|-------------|-------------|-------------|------------|
| Type               | Device                        | Manufacturer    | Model       | SN#         | Current Cal | Cal Due    |
| Antenna            | Double-Ridged Horn/ETS Horn 1 | ETS-Lindgren    | 3117        | 00035923    | 2/25/20     | 2/24/2023  |
| CHAMBER            | CHAMBER                       | Panashield      | 3M          | N/A         | 3/12/19     | 12/21/2023 |
| Pre-amp            | Pre-amp                       | RF-LAMBDA       | RLNA00M45GA | NA          | 2/27/19     | 7/26/2025  |
| Receiver           | EMI Test Receiver R&S ESU 40  | Rohde & Schwarz | ESU 40      | 100320      | 5/27/21     | 5/26/2024  |
| Receiver           | EMI Test Receiver R&S ESW44   | Rohde & Schwarz | ESW44       | 103049      | 10/13/21    | 10/12/2024 |
| Function Generator | Function Generator            | Standford       | DS340       | 25200       | 1/13/21     | 1/13/2024  |
| Signal Generator   | Signal Generator HP 8648C     | HP              | 8648C       | 35537A01679 | 3/29/19     | 8/03/2025  |

| Software       |                 |                          |               |
|----------------|-----------------|--------------------------|---------------|
| Software       | Author          | Version                  | Validation on |
| ESU Firmware   | Rohde & Schwarz | 4.43 SP3; BIOS v5.1-24-3 | 2018          |
| RSCCommander   | Rohde & Schwarz | 1.6.4                    | 2014          |
| ScopeExplorer  | LeCroy          | v2.25.0.0                | 2009          |
| Field Strength | Timco           | v4.10.7.0                | 2016          |



## 8. Test Results

The results of the test are usually indicated in the form of tables, spectrum analyzer plots, charts, sample calculations, as appropriate for each test procedure.

A description and/or a block diagram of the test setup is usually provided.

The measurement results, along with the appropriate limits for comparison, may be presented in tabular or graphical form. In addition, any variation in the measurement environment may be reported if applicable (e.g., a significant change of temperature that could affect the cable loss and amplifier response).

Unless noted otherwise in the referenced standard, the measurements of **ac power-line conducted emissions and conducted power output** will be reported in units of dB $\mu$ V. Unless noted otherwise in the referenced standard, the measurements of **radiated emissions** will be reported in units of decibels, referenced to one microvolt per meter (dB $\mu$ V/m) for electric fields, or to one ampere per meter (dBA/m) for magnetic fields, at the distance specified in the appropriate standards or requirements. The measurements of antenna-conducted power for receivers may be reported in units of dB $\mu$ V if the impedance of the measuring instrument is also reported. Otherwise, antenna-conducted power will be reported in units of decibels referenced to one milliwatt (dBm). All formulas for data conversions and conversion factors, if used, will be included in this measurement report.

### Example:

|            |               |              |          |                          |
|------------|---------------|--------------|----------|--------------------------|
| Freq (MHz) | Meter Reading | + ACF        | +CL      | = FS                     |
| 33         | 20 dB $\mu$ V | + 10.36 dB/m | +0.40 dB | =30.36 dB $\mu$ V/m @ 3m |

$EIRP = P_{cond} \text{ (dBm)} + dBi$



## 8.1 Power at the Final Amplifier

*Referenced from test report "TR\_6057-23\_UL\_FCC 90\_Booster Class B\_1.docx".*

Limits from FCC Part 2.1033 (c)(8)

No method of measurement is specified. The result has been calculated based on all available information.


| Test Results              |                 |                                  |
|---------------------------|-----------------|----------------------------------|
| EUT Operating Voltage (V) | EUT Current (A) | Power at the Final Amplifier (W) |
| 24                        | 3.33            | 79.92                            |



## 8.2 RF Output Power & Gain

Referenced from test report "TR\_6057-23\_UL\_FCC 90\_Booster Class B\_1.docx".

Limits from FCC Parts 2.1046(a), and 90.205 and test procedure from ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

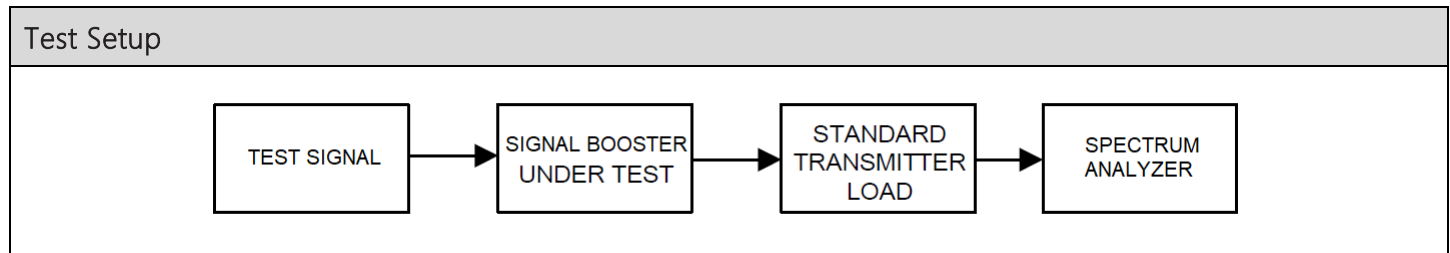

| Test Results, Power Output |                        |                      |
|----------------------------|------------------------|----------------------|
| Link Direction             | Max Power Output (dBm) | Max Power Output (W) |
| Uplink                     | 23.76                  | 0.239                |




| Test Results, Gain |                       |             |                   |                    |           |
|--------------------|-----------------------|-------------|-------------------|--------------------|-----------|
| Link Direction     | Tuned Frequency (MHz) | Input Level | Power Input (dBm) | Power Output (dBm) | Gain (dB) |
| Uplink<br>700 MHz  | 788.0125              | AGC         | -50               | 23.28              | 73.28     |
|                    |                       | AGC+3       | -47               | 23.29              | 70.29     |
|                    | 796                   | AGC         | -49               | 23.21              | 72.21     |
|                    |                       | AGC+3       | -46               | 26.13              | 72.13     |
|                    | 804.9875              | AGC         | -50.5             | 23.56              | 73.98     |
|                    |                       | AGC+3       | -47.5             | 26.35              | 73.85     |
| Uplink<br>800 MHz  | 806.0125              | AGC         | -50.5             | 23.48              | 73.98     |
|                    |                       | AGC+3       | -47.5             | 25.13              | 72.63     |
|                    | 812                   | AGC         | -50               | 23.30              | 73.30     |
|                    |                       | AGC+3       | -47               | 23.44              | 70.44     |
|                    | 823.9875              | AGC         | -50.5             | 23.76              | 74.26     |
|                    |                       | AGC+3       | -47.5             | 26.00              | 73.50     |



### 8.3 Out-of-band Rejection

Limits and test method from FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

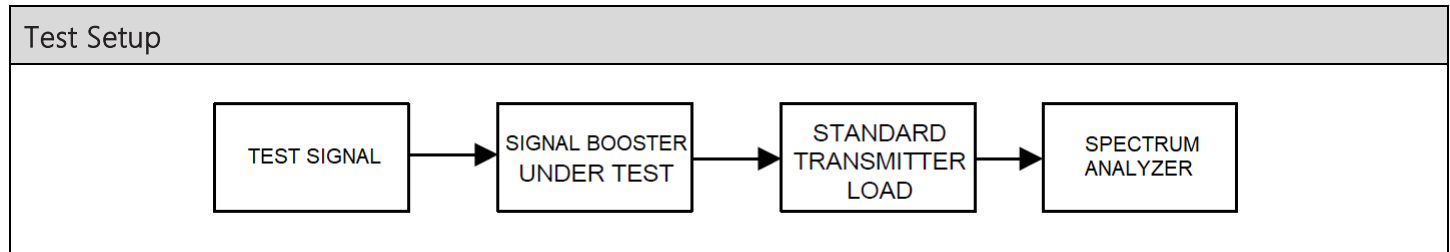


| Test Results, Out-of-band Rejection and Class of Operation |                |                |                    |
|------------------------------------------------------------|----------------|----------------|--------------------|
| Operating Band (MHz)                                       | Link Direction | Passband (kHz) | Class of Operation |
| 700- 805 MHz                                               | Uplink         | < 75 kHz       | Class A            |
| 806- 824 MHz                                               | Uplink         | < 75 kHz       | Class A            |



## Out-of-band Rejection, Spectrum Plots


### 8.3.1 700 Band, Uplink

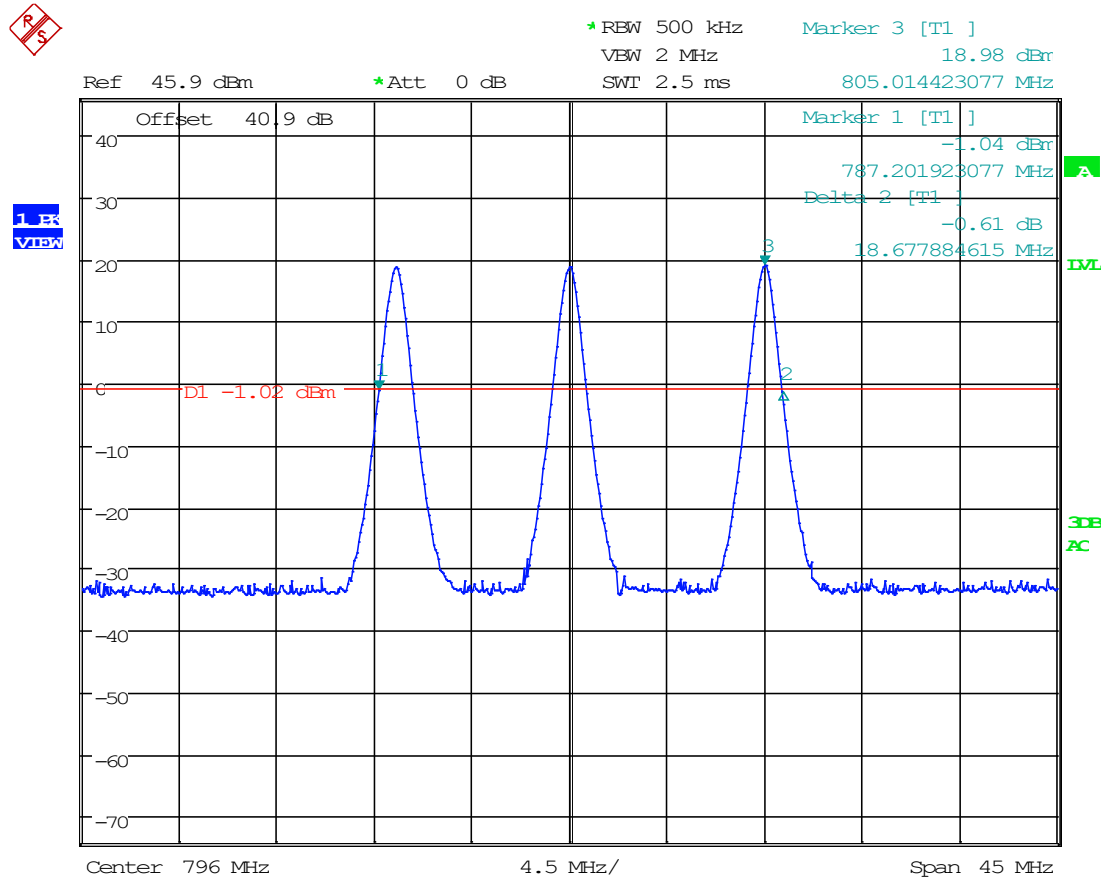

Date: 1.FEB.2023 15:52:17



### 8.3.2 800 Band Uplink

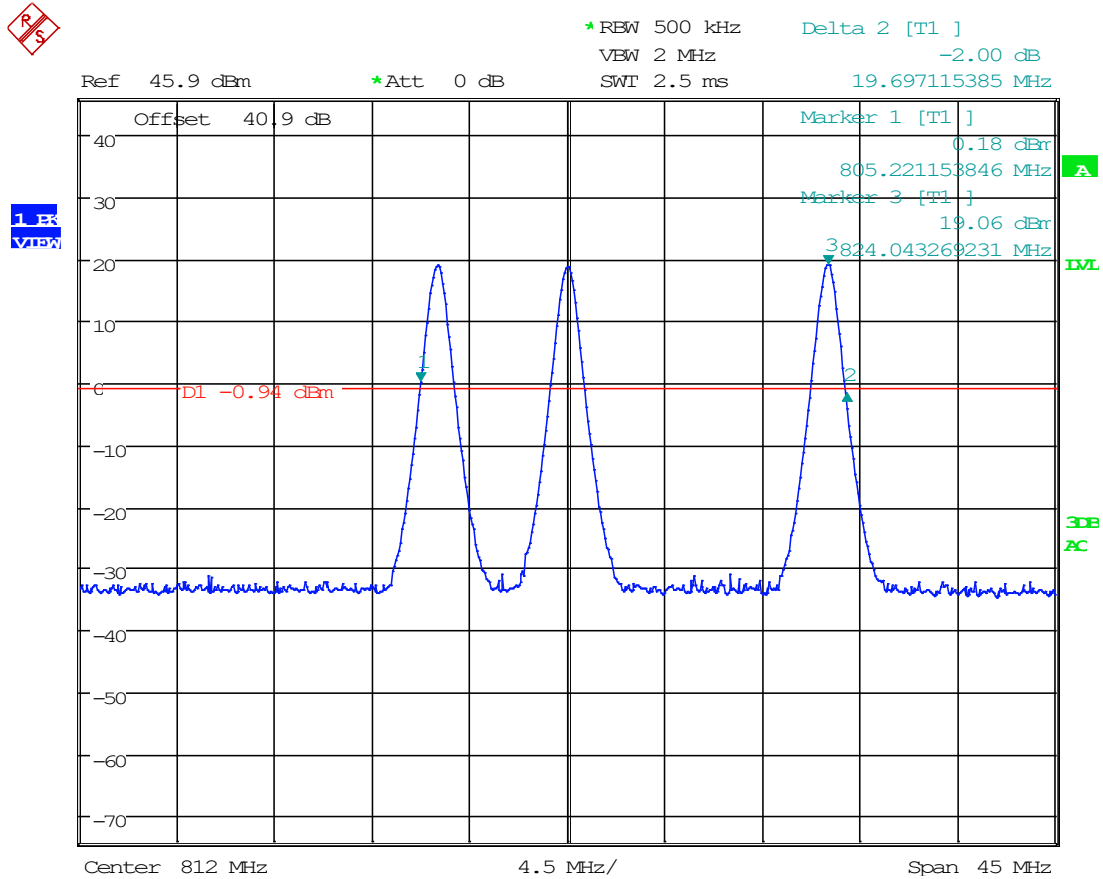

Date: 1.FEB.2023 15:55:38



## 8.4 Bandwidth & Emission

Referenced from test report "TR\_6057-23\_UL\_FCC 90\_Booster Class B\_1.docx".

Limits from FCC Parts 2.202, 90.209 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

| Authorized Bandwidth |                       |                            |
|----------------------|-----------------------|----------------------------|
| Rule Part            | Operating Range (MHz) | Authorized Bandwidth (kHz) |
| Part 90              | 788- 805 MHz          | Unspecified                |
| Part 90              | 806- 824 MHz          | 11.25/20                   |


| Applicable Input Signals |                          |                                       |
|--------------------------|--------------------------|---------------------------------------|
| Signal                   | Occupied Bandwidth (MHz) | Representative Emission Designator(s) |
| CW                       | N/A                      | N/A                                   |
| 25 kHz FM                | 12.36                    | 12K3F3E                               |
| 12.5 kHz FM              | 7.85                     | 7K85F3E                               |
| 6.25 kHz FM              | 4.02                     | 4K02F3E                               |
| C4FM (P25 Phase I)       | 8.18                     | 8K18F1D, 8K18F1E                      |
| HCPM (P25 Phase II SU)   | 7.96                     | 7K96F1W                               |
| HDQPSK (P25 Phase II BS) | 9.6                      | 9K60F1D, 9K60F1E, 9K60D7W             |



## 8.5 Input VS Output Signal Comparison

*Referenced from test report "TR\_6057-23\_UL\_FCC 90\_Booster Class B\_1.docx".*

Limits from FCC Parts 90.210 and test procedure from ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

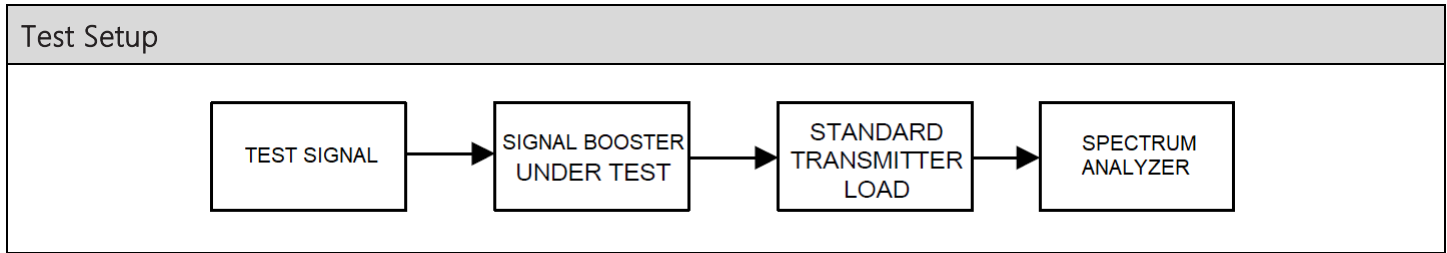



## 700 Band Input VS Output Comparison

| Test Results, Input VS Output Comparison |                       |              |            |                        |                         |            |
|------------------------------------------|-----------------------|--------------|------------|------------------------|-------------------------|------------|
| Link Direction                           | Tuned Frequency (MHz) | Input Signal | AGC Level  | 99% OBW of Input (MHz) | 99% OBW of Output (MHz) | Change (%) |
| Uplink                                   | 796                   | 6.25 kHz FM  | @ AGC      | 4.038                  | 4.16                    | 0.122      |
|                                          |                       |              | @ AGC+3 dB | 4.038                  | 4.16                    | 0.122      |
|                                          |                       | 12.5 kHz FM  | @ AGC      | 6.21                   | 7.69                    | 1.48       |
|                                          |                       |              | @ AGC+3 dB | 6.21                   | 7.69                    | 1.48       |
|                                          |                       | 25 kHz FM    | @ AGC      | 10.21                  | 12.17                   | 1.96       |
|                                          |                       |              | @ AGC+3 dB | 10.21                  | 12.5                    | 2.29       |
|                                          |                       | C4FM         | @ AGC      | 7.71                   | 8.01                    | 0.3        |
|                                          |                       |              | @ AGC+3 dB | 7.71                   | 8.49                    | 0.78       |
|                                          |                       | HCPM         | @ AGC      | 7.71                   | 8.17                    | 0.46       |
|                                          |                       |              | @ AGC+3 dB | 7.71                   | 8.01                    | 0.3        |
|                                          |                       | HDQPSK       | @ AGC      | 9.91                   | 9.93                    | 0.02       |
|                                          |                       |              | @ AGC+3 dB | 9.91                   | 10.09                   | 0.18       |




## 800 Band Input VS Output Comparison

| Test Results, Input VS Output Comparison |                       |              |            |                        |                         |            |
|------------------------------------------|-----------------------|--------------|------------|------------------------|-------------------------|------------|
| Link Direction                           | Tuned Frequency (MHz) | Input Signal | AGC Level  | 99% OBW of Input (MHz) | 99% OBW of Output (MHz) | Change (%) |
| Uplink                                   | 812                   | 6.25 kHz FM  | @ AGC      | 4.03                   | 4.03                    | 0          |
|                                          |                       |              | @ AGC+3 dB | 4.03                   | 4.03                    | 0          |
|                                          |                       | 12.5 kHz FM  | @ AGC      | 6.21                   | 7.89                    | 1.68       |
|                                          |                       |              | @ AGC+3 dB | 6.21                   | 7.89                    | 1.68       |
|                                          |                       | 25 kHz FM    | @ AGC      | 10.21                  | 12.33                   | 2.12       |
|                                          |                       |              | @ AGC+3 dB | 10.21                  | 12.33                   | 2.12       |
|                                          |                       | C4FM         | @ AGC      | 7.71                   | 8.13                    | 0.42       |
|                                          |                       |              | @ AGC+3 dB | 7.71                   | 7.93                    | 0.22       |
|                                          |                       | HCPM         | @ AGC      | 7.71                   | 7.93                    | 0.22       |
|                                          |                       |              | @ AGC+3 dB | 7.71                   | 8.13                    | 0.42       |
|                                          |                       | HDQPSK       | @ AGC      | 9.91                   | 9.69                    | 0.22       |
|                                          |                       |              | @ AGC+3 dB | 9.91                   | 9.65                    | 0.26       |




## Input VS Output, Input Spectrum Plots

### 8.5.1 6.25 kHz FM, Input Signal

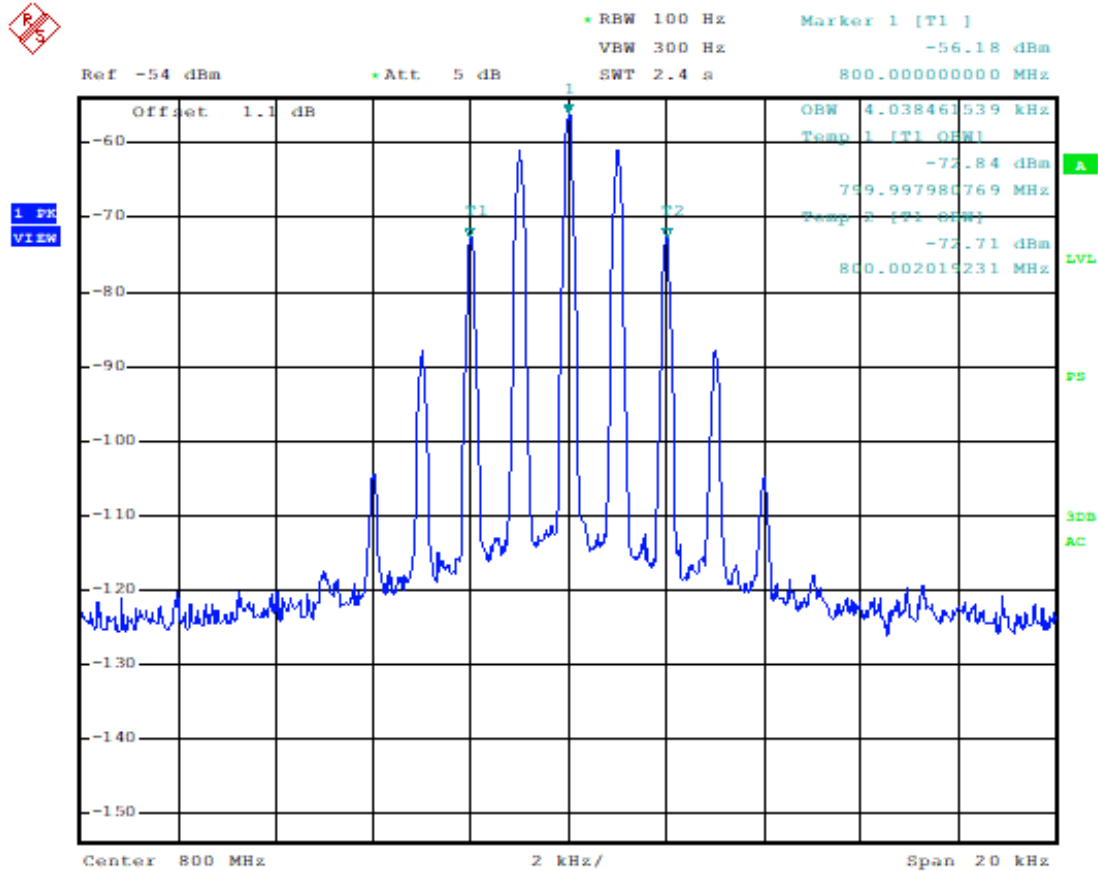

Date: 30.JAN.2019 13:10:11


## 8.5.2 12.5 kHz FM, Input Signal

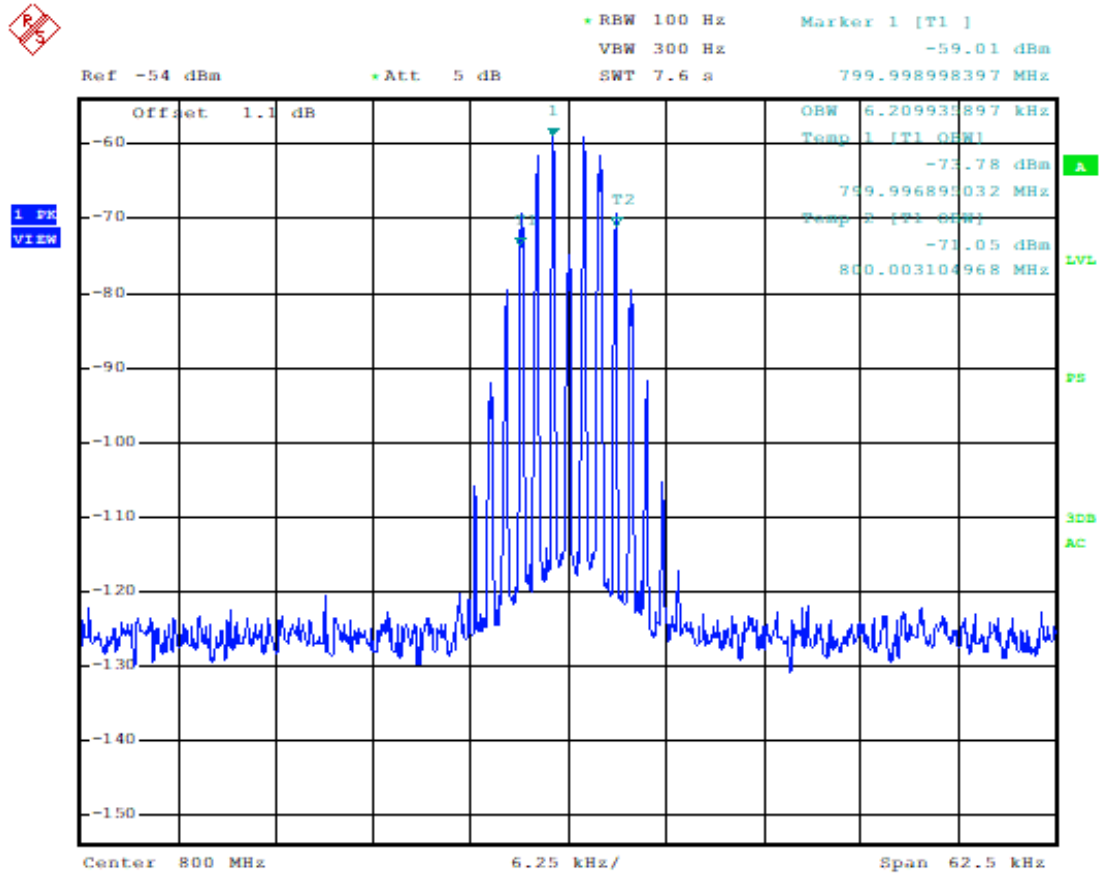

Date: 30.JAN.2019 14:19:45




### 8.5.3 25 kHz FM, Input Signal

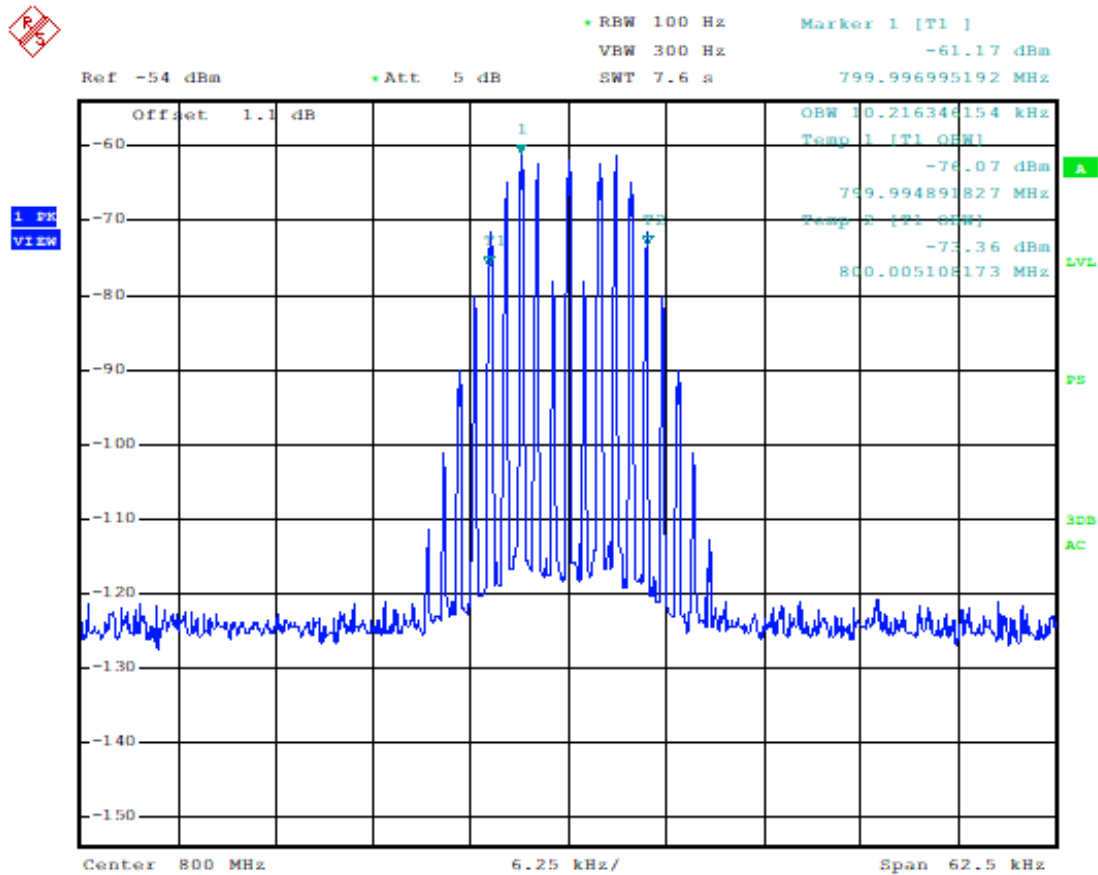


Date: 30.JAN.2019 14:23:14

## 8.5.4 C4FM, Input Signal

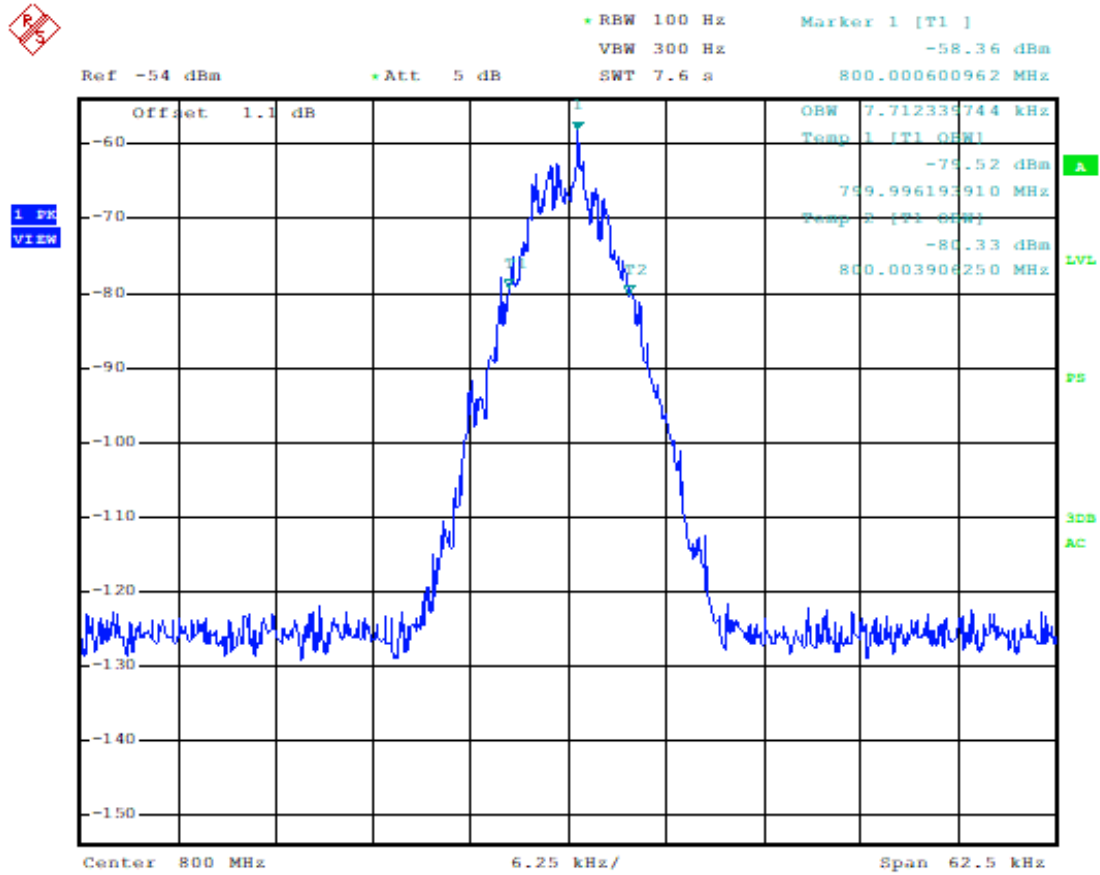

Date: 30.JAN.2019 14:28:58


### 8.5.5 H-CPM, Input Signal

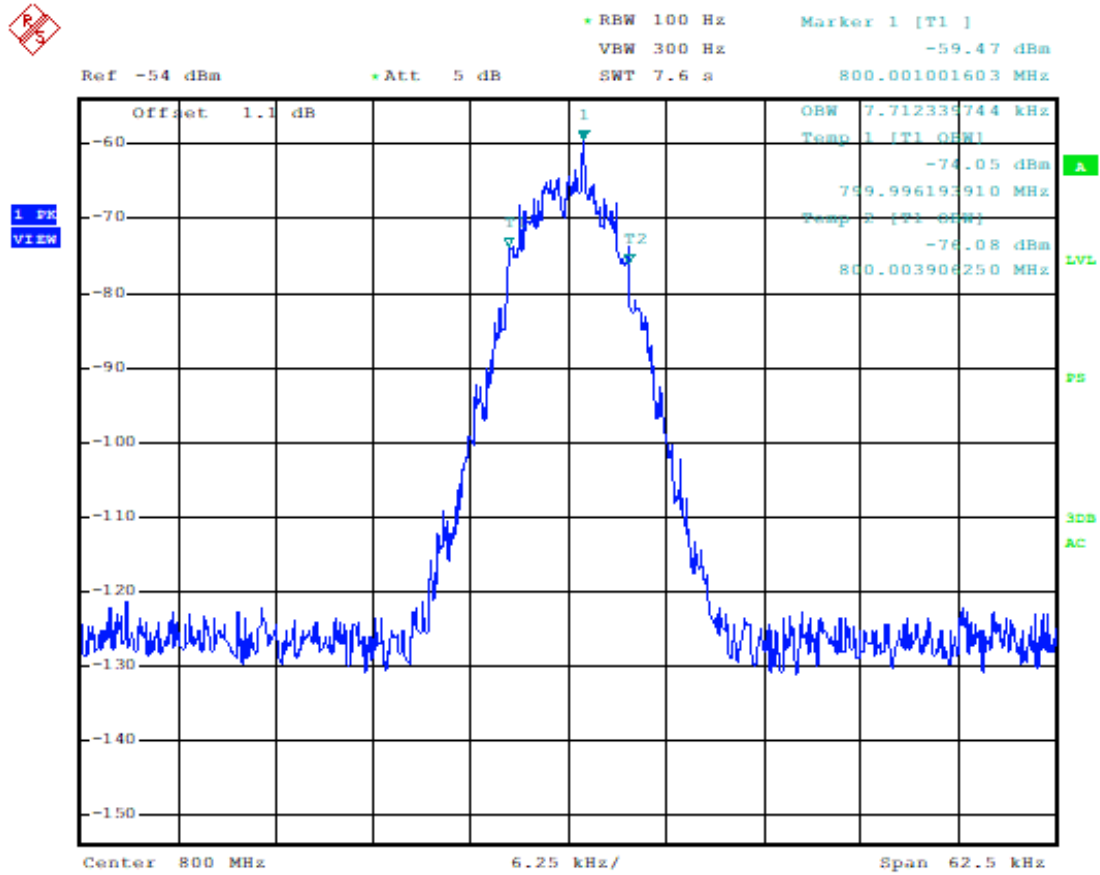

Date: 30.JAN.2019 14:30:47




## 8.5.6 H-DQPSK, Input Signal

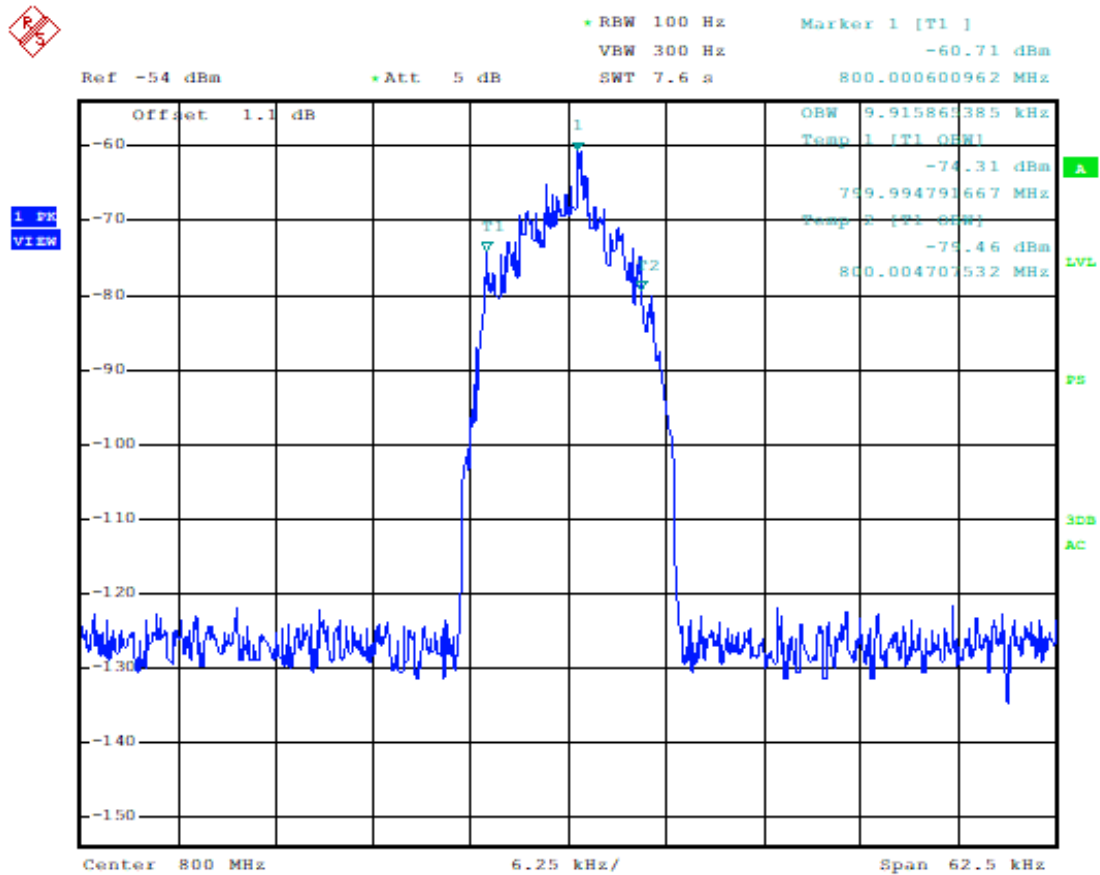

Date: 30.JAN.2019 14:32:35


### 8.5.7 6.25 kHz, FM, UL Mask C, AGC, 788.0125 MHz

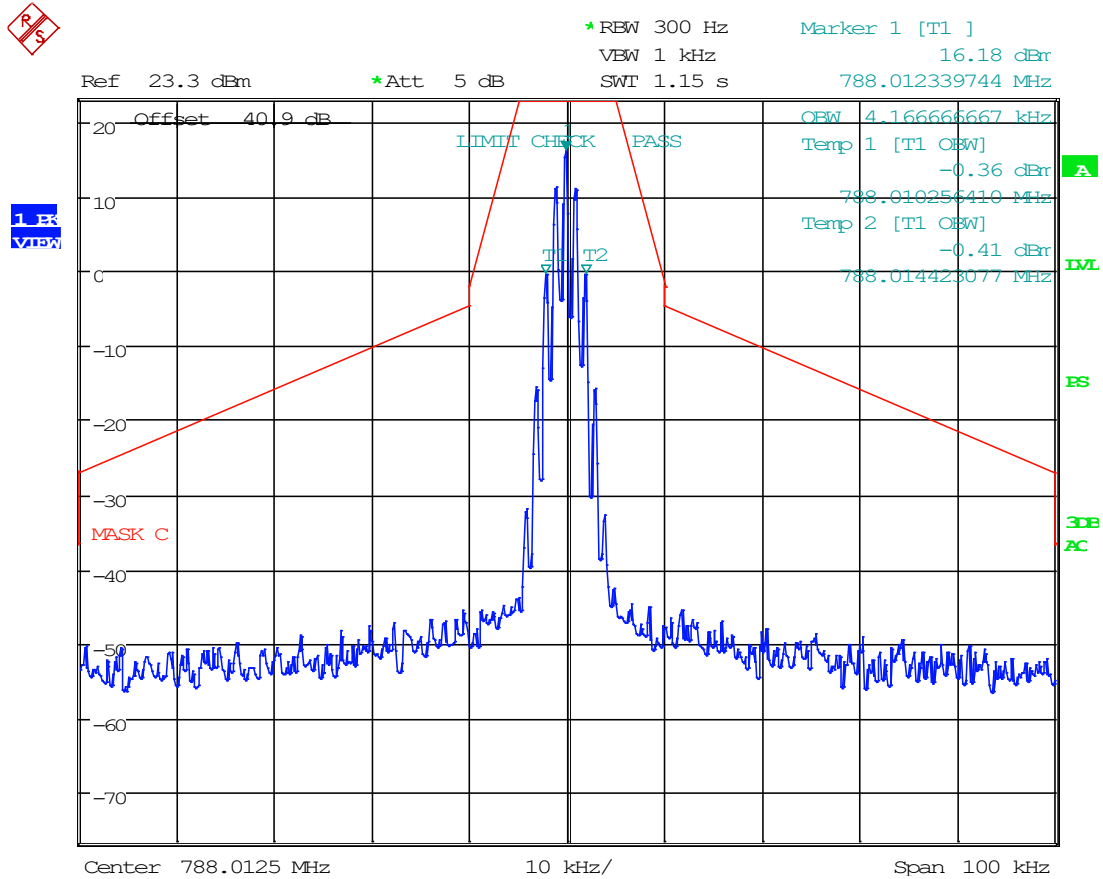

Date: 2.FEB.2023 09:50:25



### 8.5.8 6.25 kHz, FM, UL Mask C, AGC +3, 788.0125 MHz

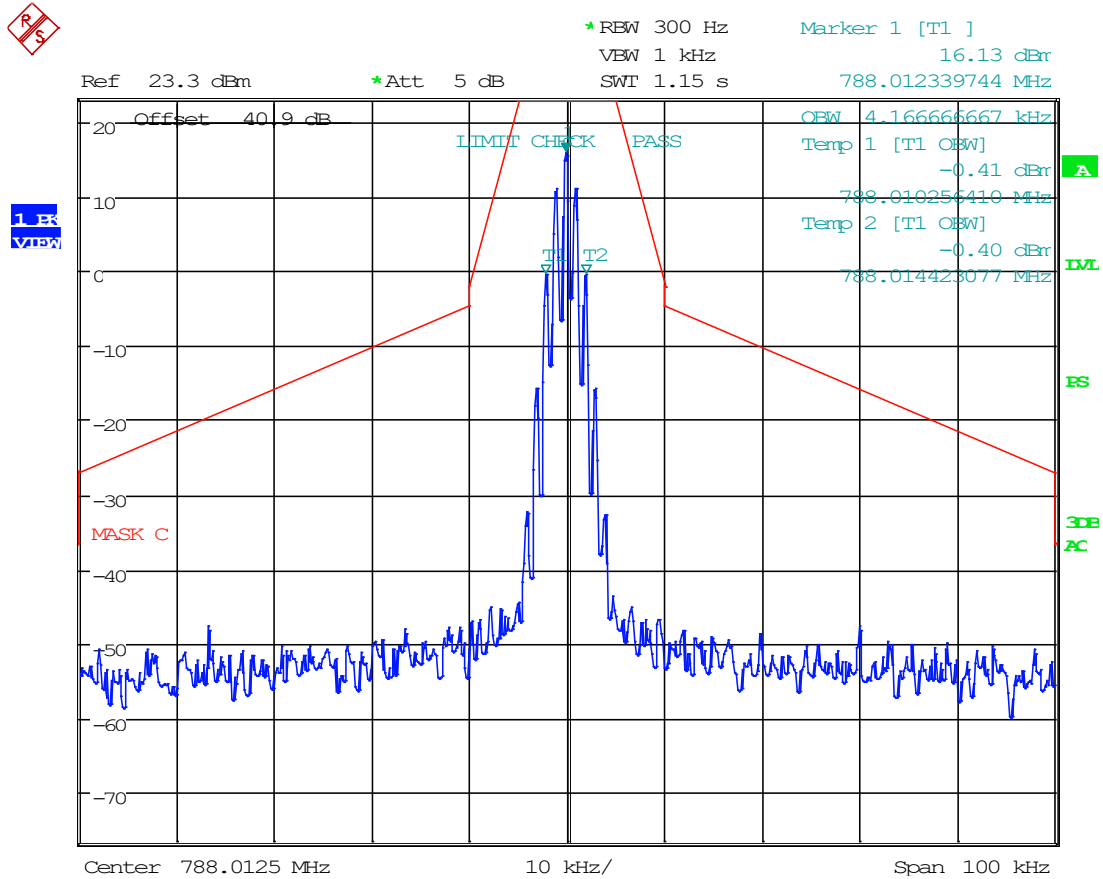


Date: 2.FEB.2023 11:26:22



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.5.9 12.5 kHz, FM, UL Mask C, AGC, 788.0125 MHz

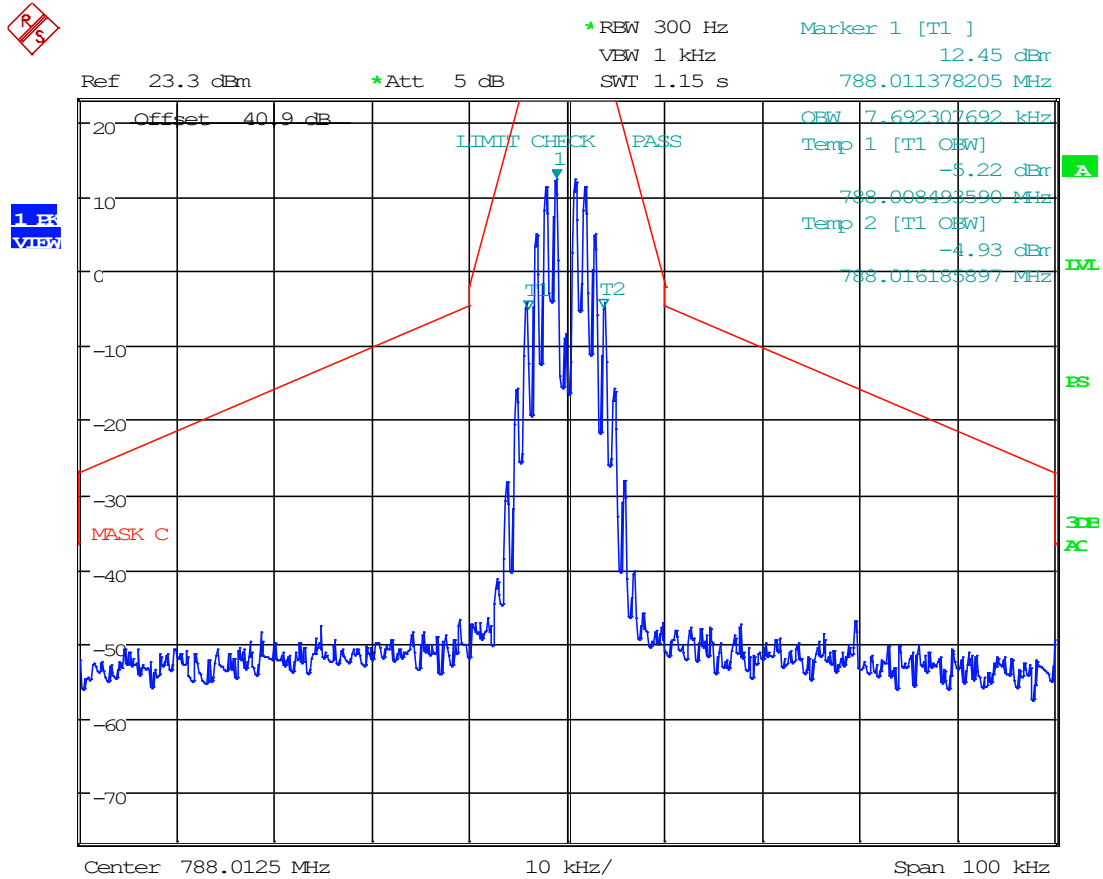

Date: 2.FEB.2023 09:56:38




8.5.10 12.5 kHz, FM, UL Mask C, AGC+3, 788.0125 MHz

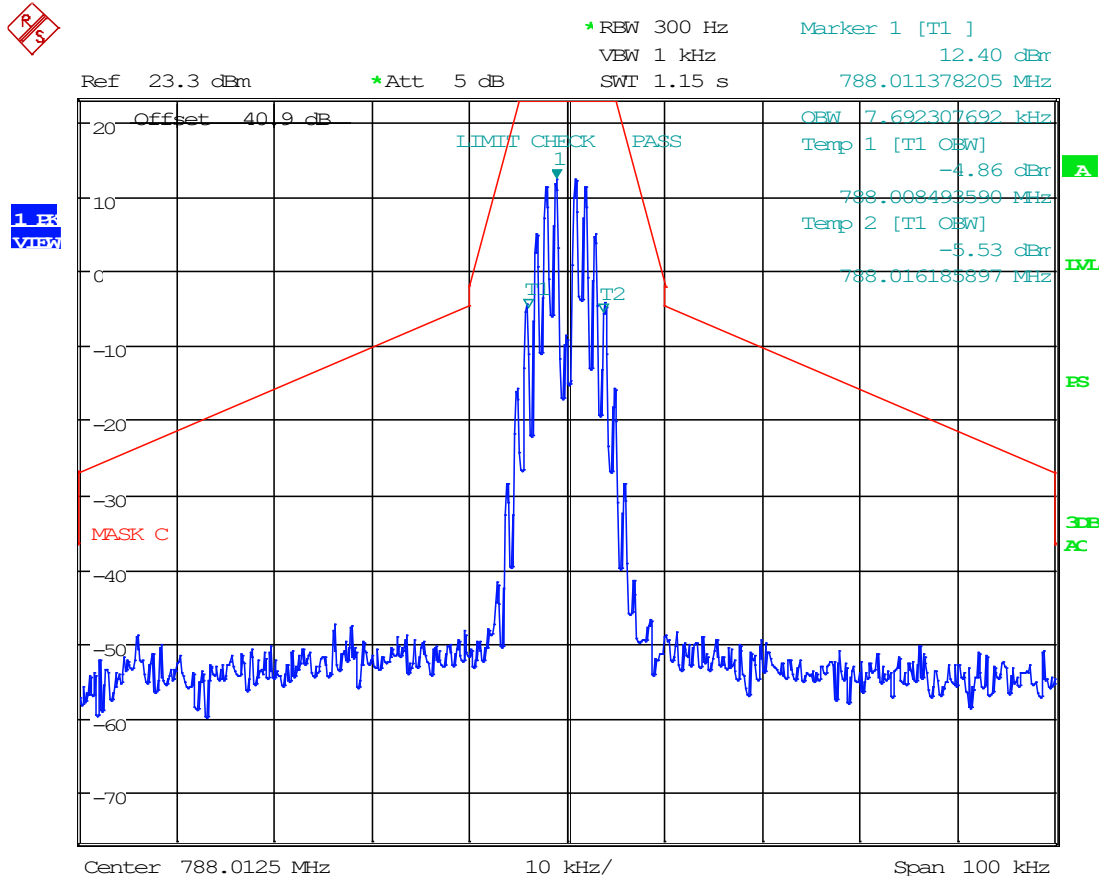

Date: 2.FEB.2023 11:28:31



### 8.5.11 25 kHz FM, UL Mask C, AGC, 788.0125 MHz

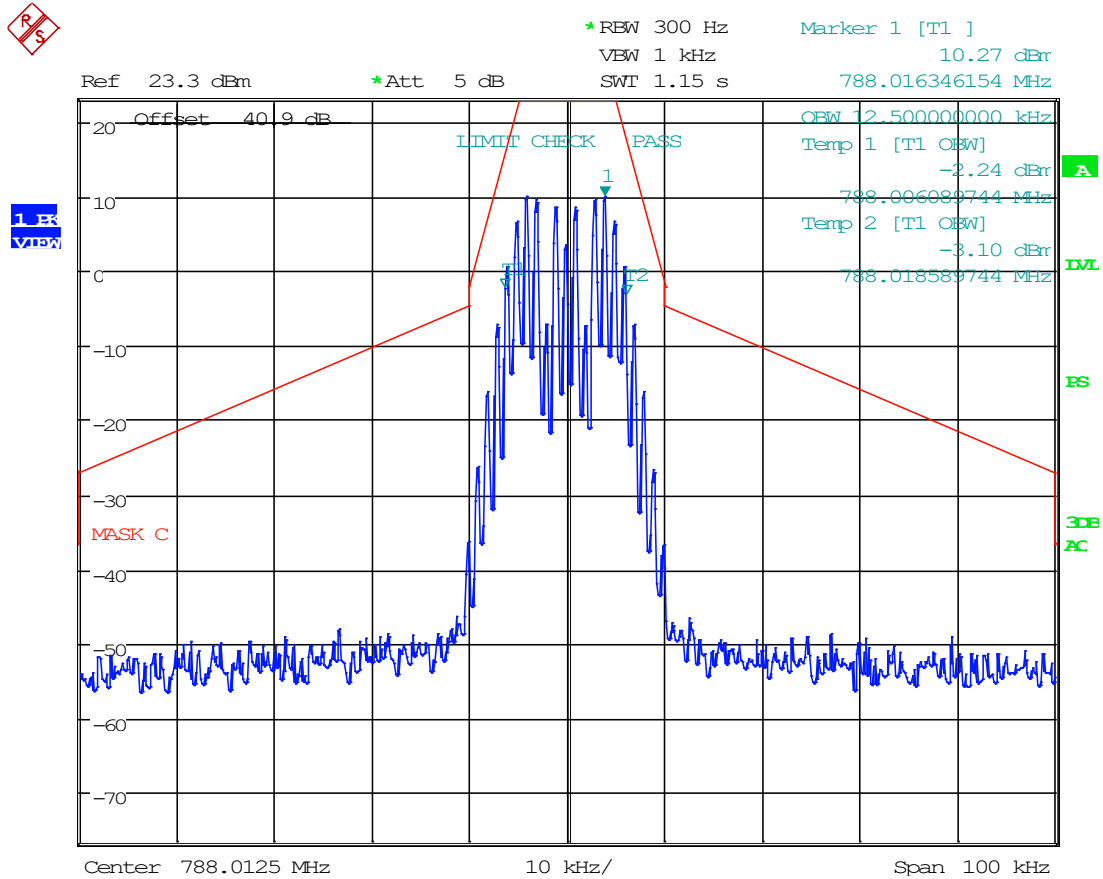


Date: 2.FEB.2023 09:57:54




Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.5.12 25 kHz FM, UL Mask C, AGC+3, 788.0125 MHz

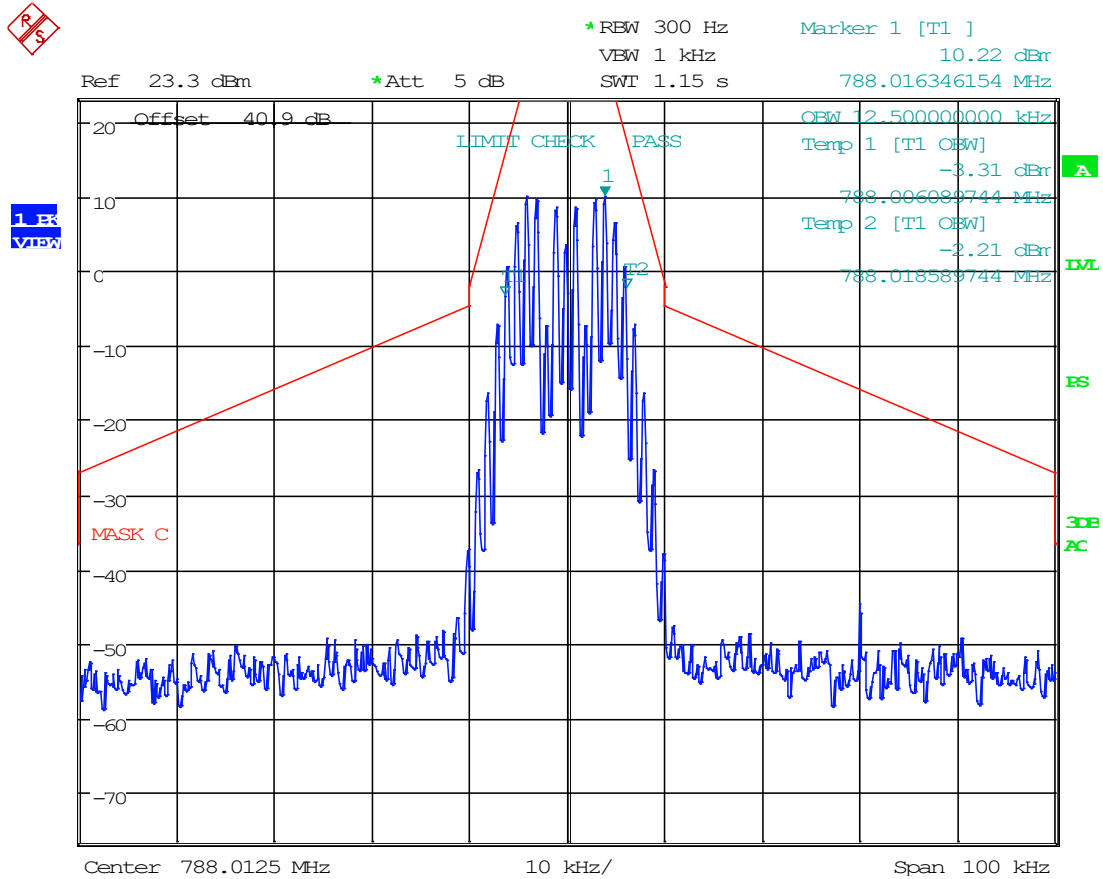


Date: 2.FEB.2023 11:29:57

### 8.5.13 C4FM, UL Mask C, AGC, 788.0125 MHz

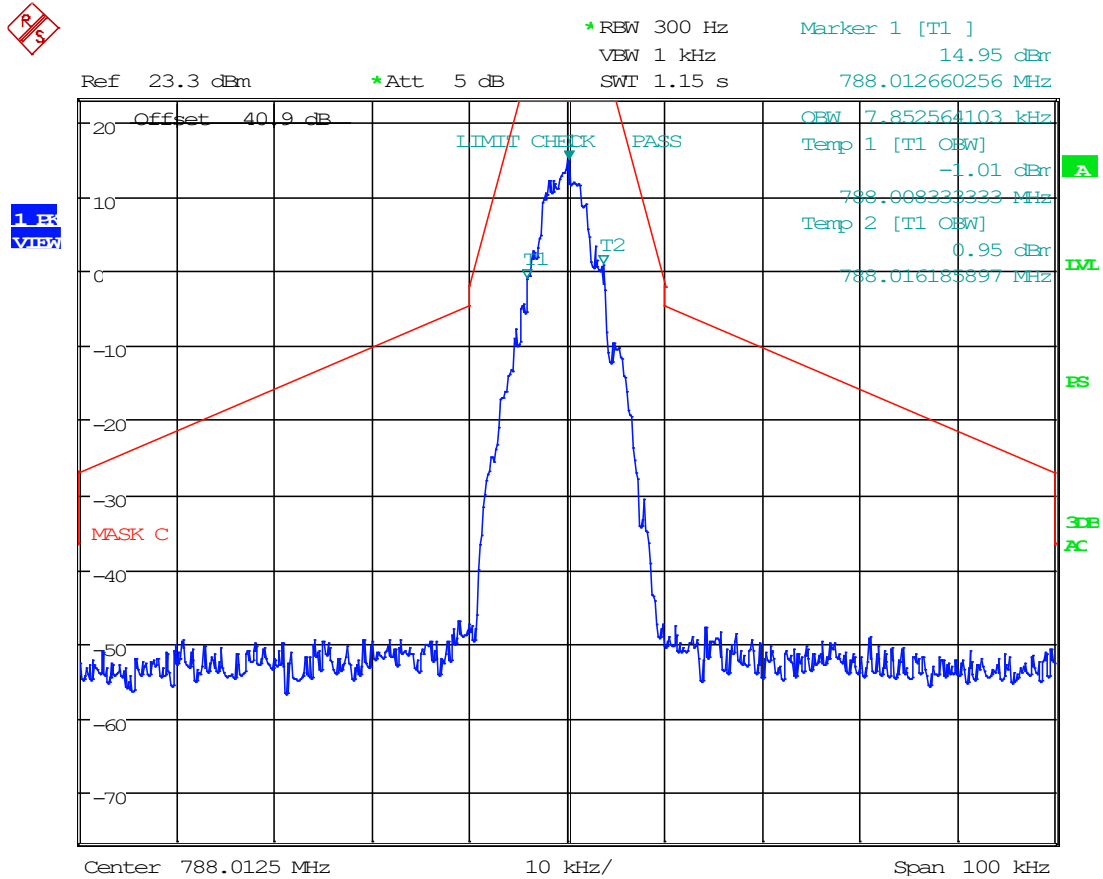

Date: 2.FEB.2023 10:09:39


### 8.5.14 C4FM, UL Mask C, AGC+3, 788.0125 MHz

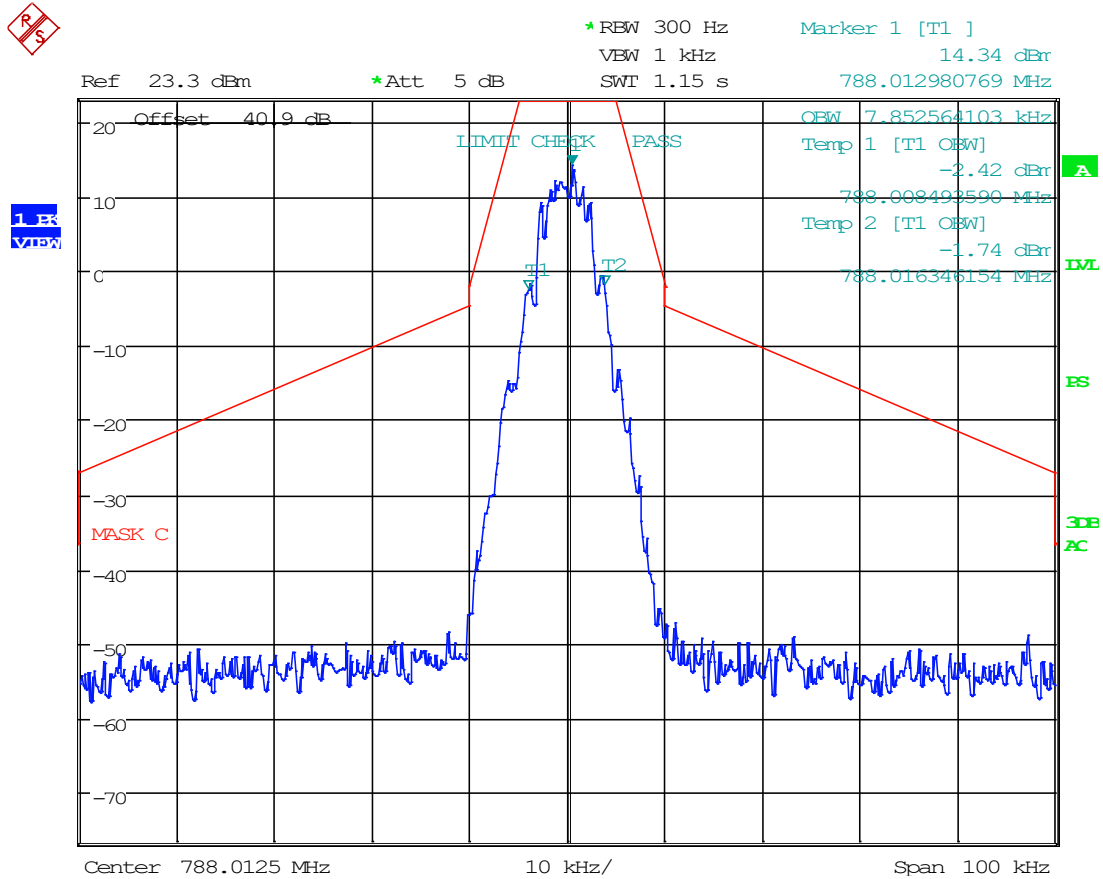

Date: 2.FEB.2023 11:32:45




### 8.5.15 H-CPM, UL Mask C, AGC, 788.0125 MHz

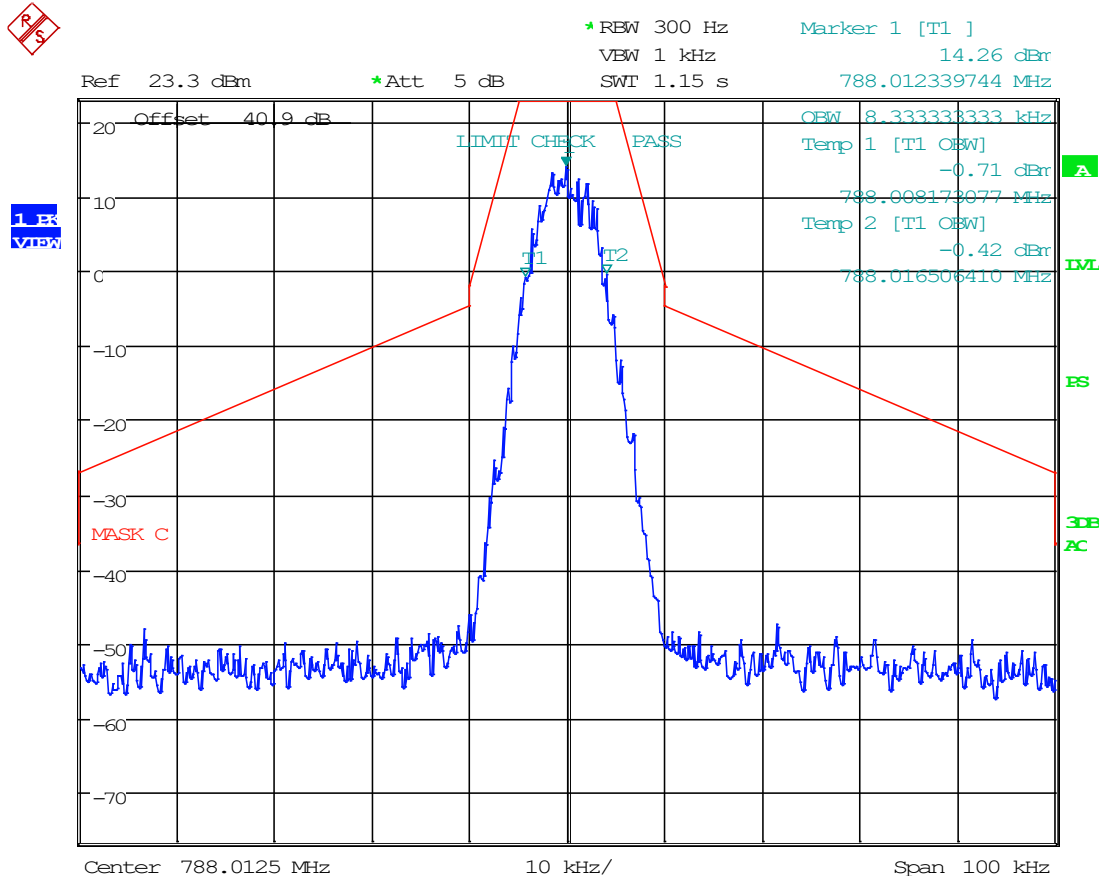


Date: 2.FEB.2023 10:10:36

### 8.5.16 H-CPM, UL Mask C, AGC+3, 788.0125 MHz

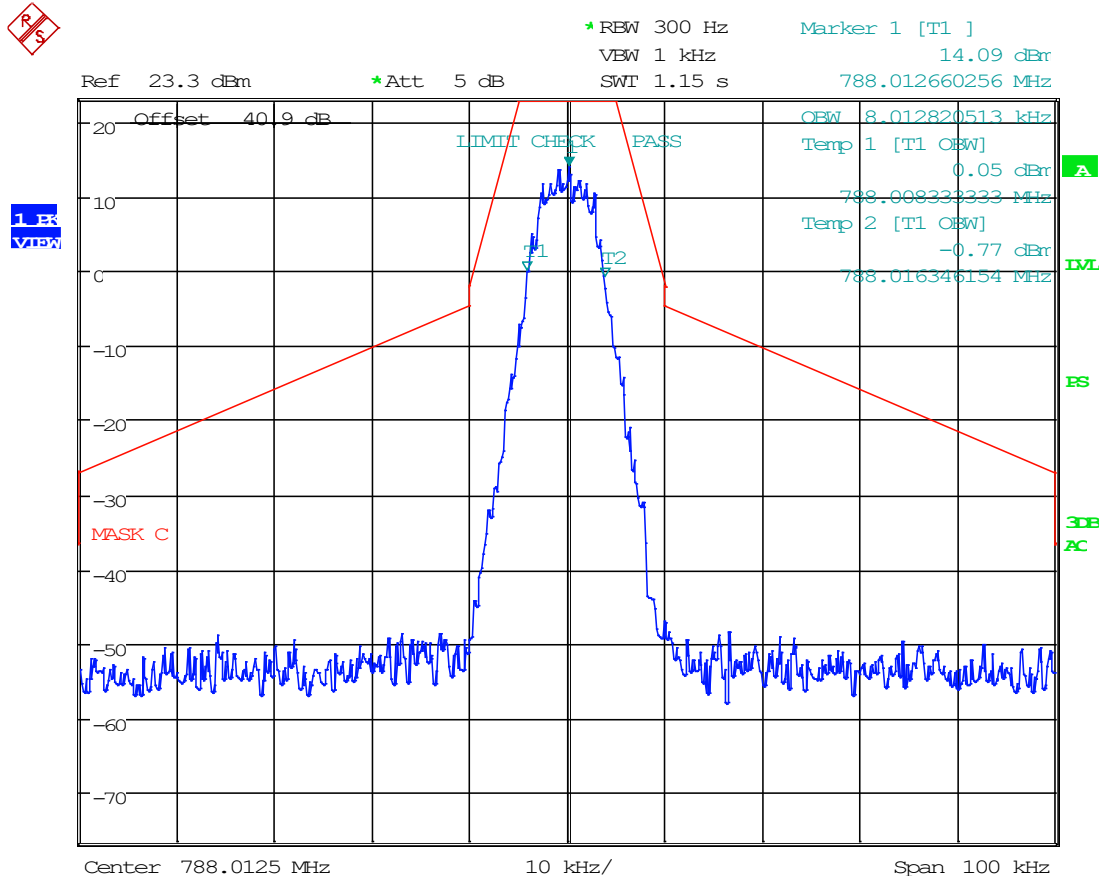


Date: 2.FEB.2023 11:33:58

### 8.5.17 H-DQPSK, UL Mask C, AGC, 788.0125 MHz

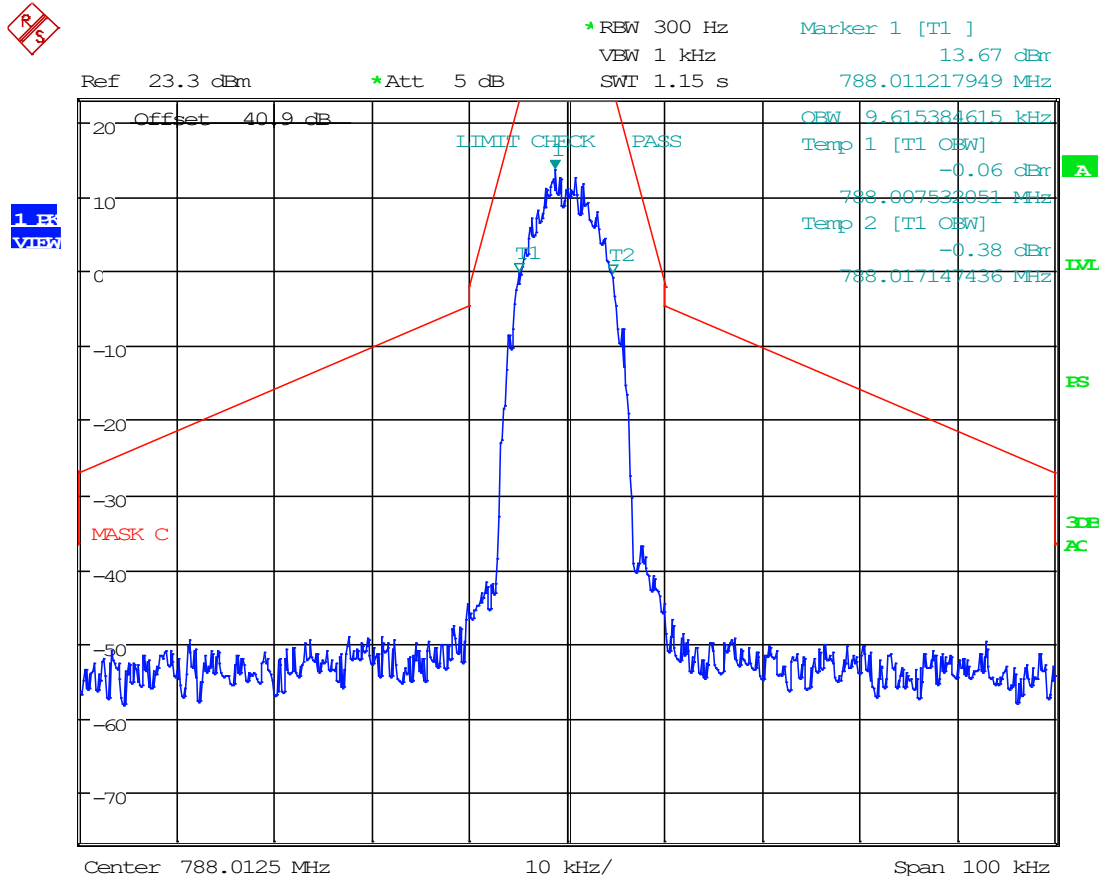

Date: 2.FEB.2023 10:11:27


### 8.5.18 H-DQPSK, UL Mask C, AGC+3, 788.0125 MHz

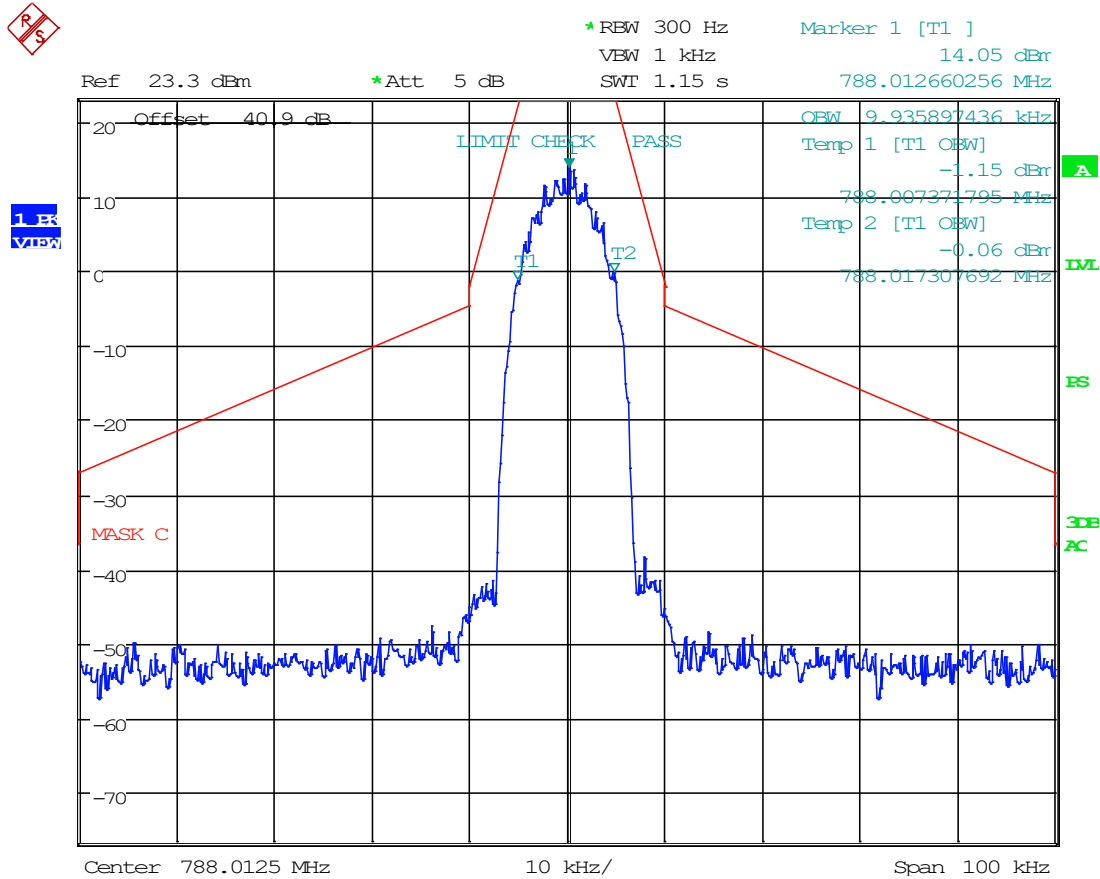

Date: 2.FEB.2023 11:34:50




### 8.5.19 6.25 kHz, FM, UL Mask C, AGC, 796 MHz

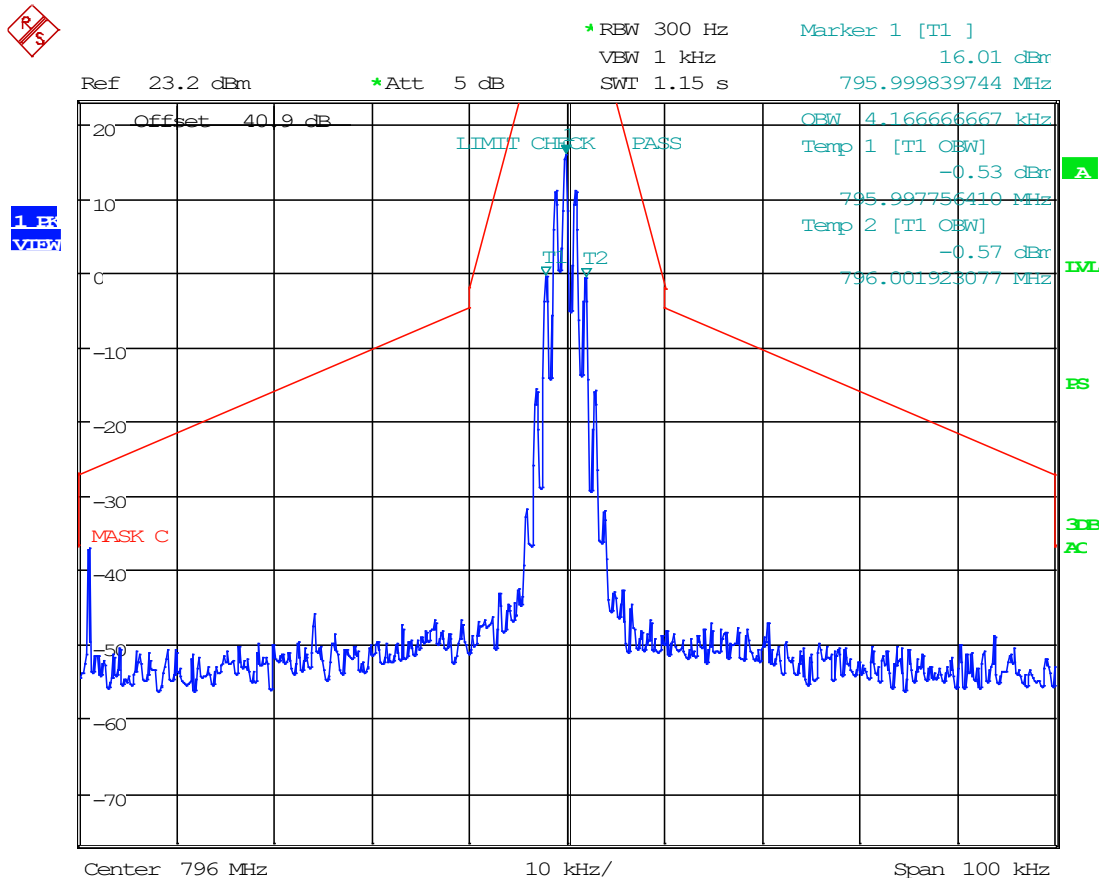

Date: 2.FEB.2023 10:19:57



### 8.5.20 6.25 kHz, FM, UL Mask C, AGC+3, 796 MHz

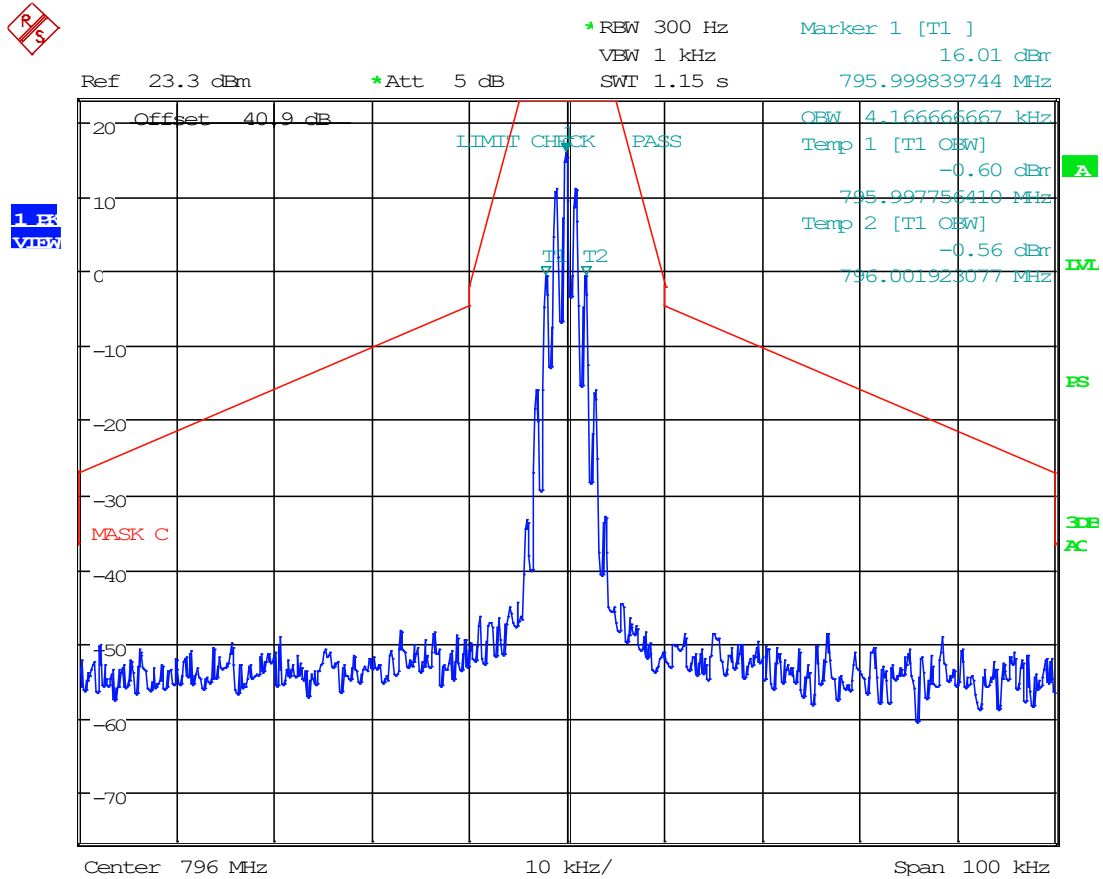


Date: 2.FEB.2023 11:35:52



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.5.21 12.5 kHz, FM, UL Mask C, AGC, 796 MHz

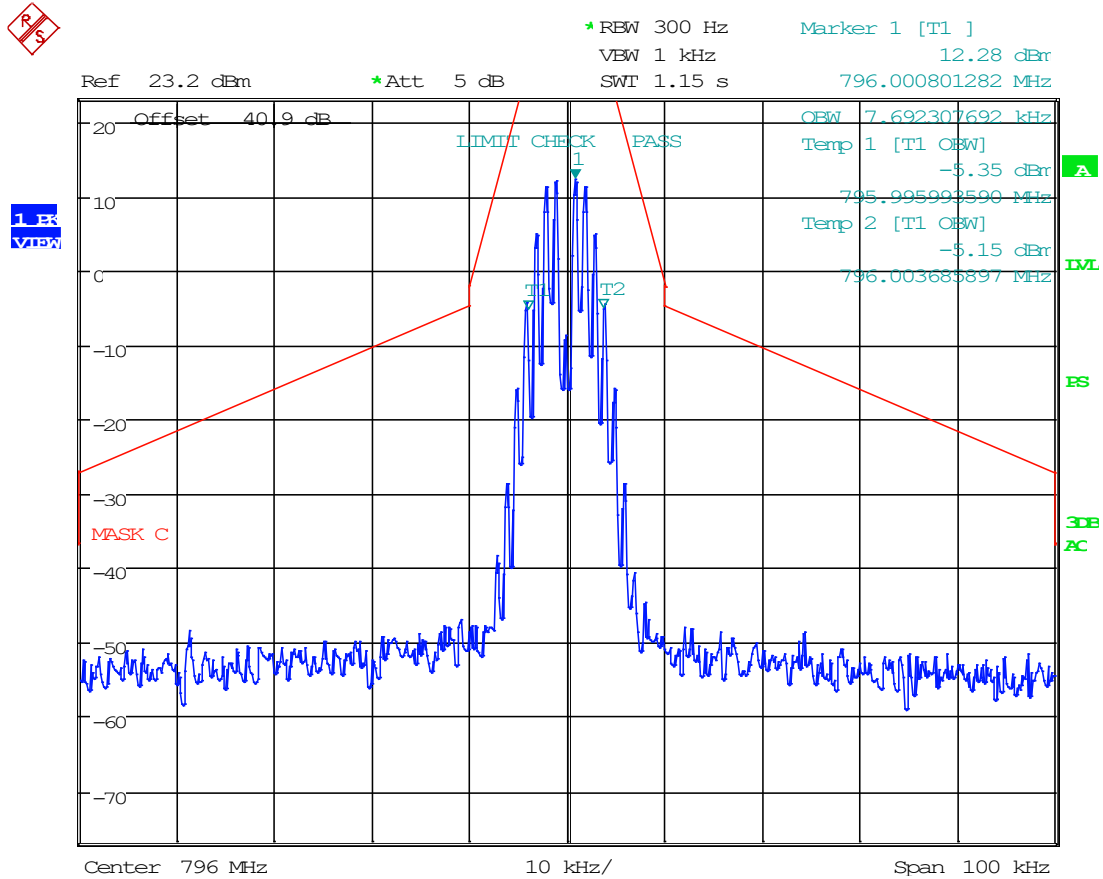


Date: 2.FEB.2023 10:20:52



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.5.22 12.5 kHz, FM, UL Mask C, AGC+3, 796 MHz

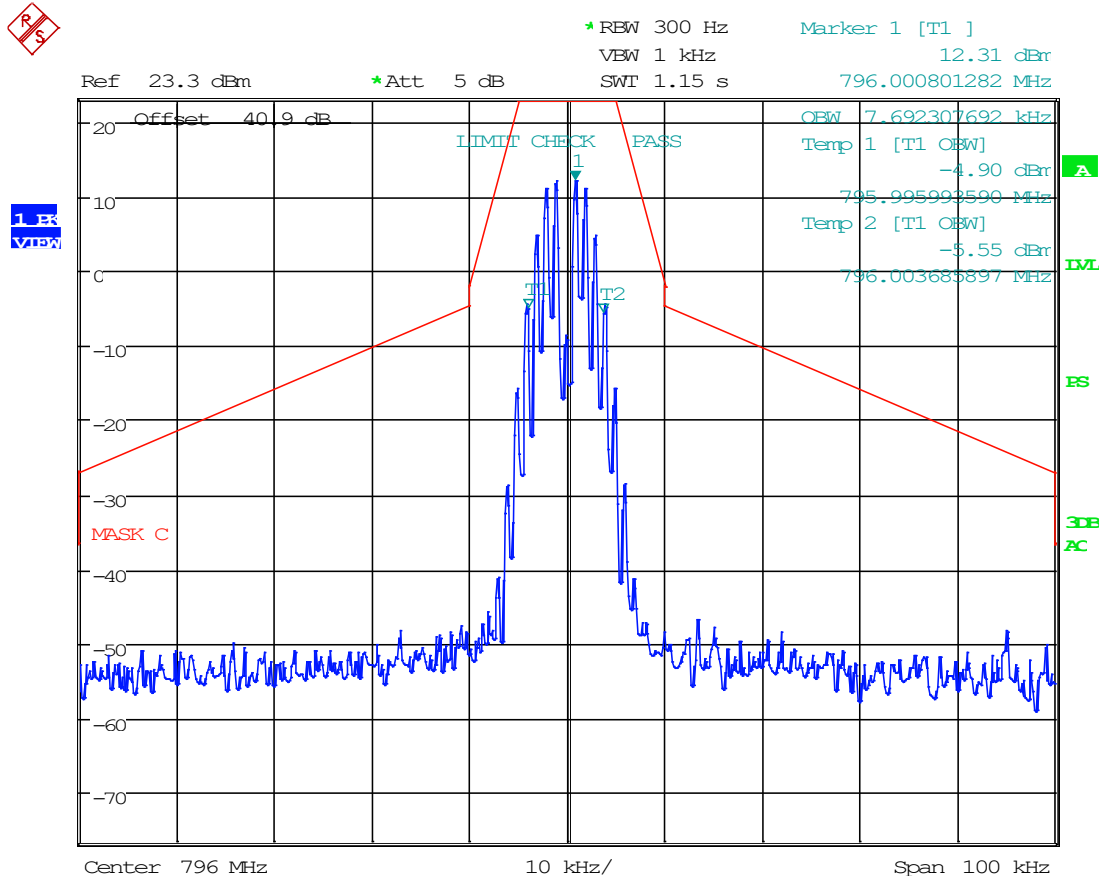


Date: 2.FEB.2023 11:37:58




Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.5.23 25 kHz FM, UL Mask C, AGC, 796 MHz

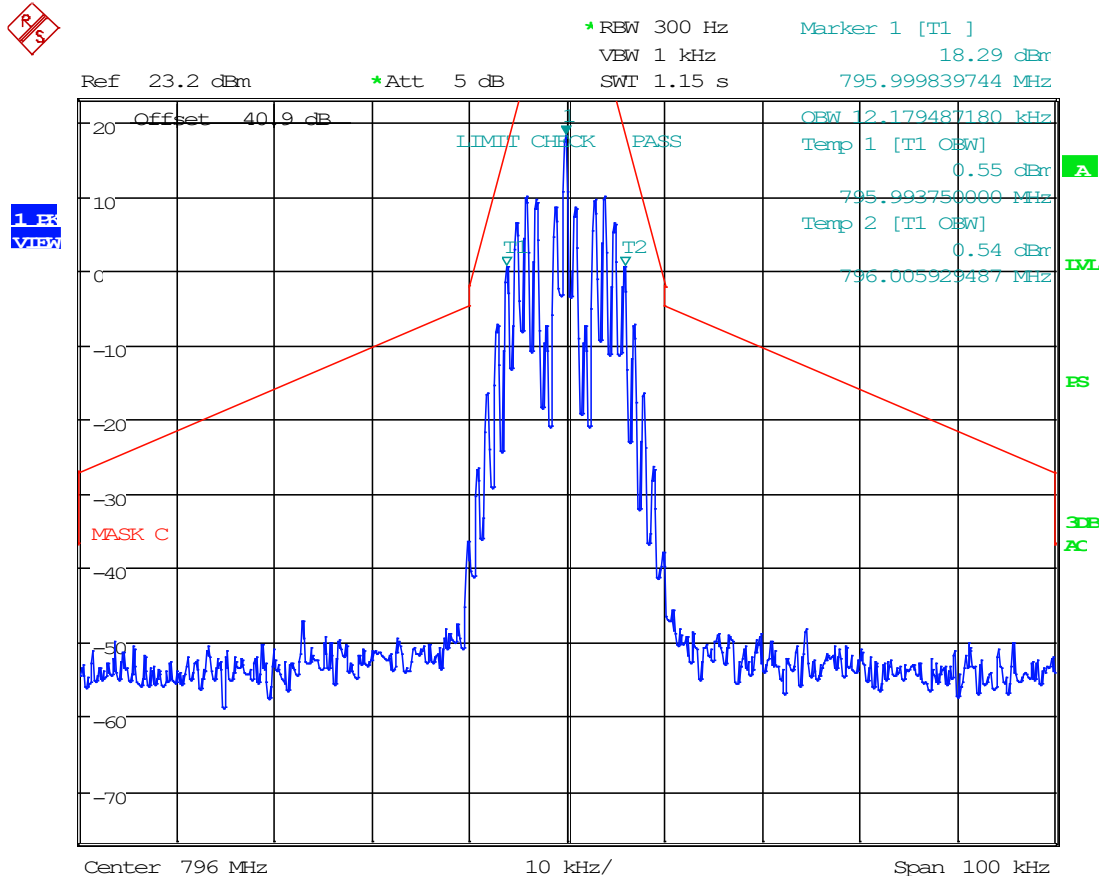


Date: 2.FEB.2023 10:21:39

### 8.5.24 25 kHz FM, UL Mask C, AGC+3, 796 MHz

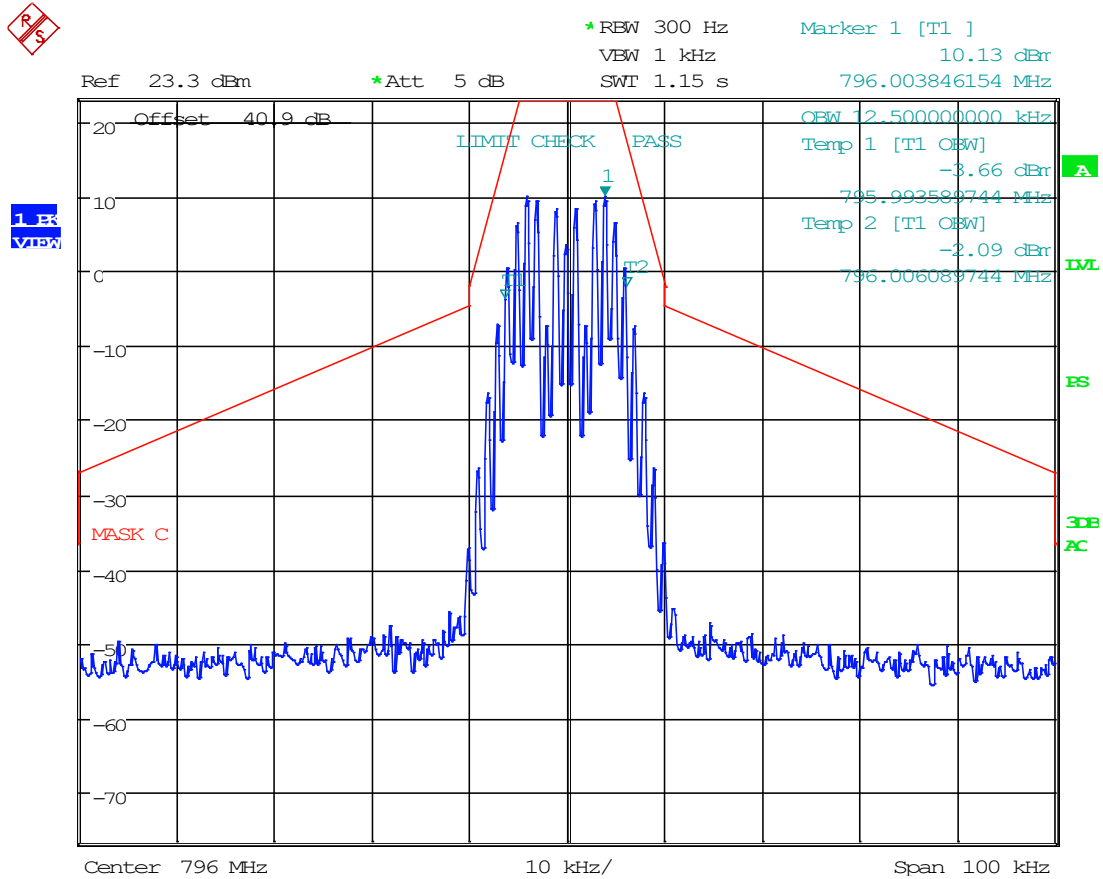


Date: 2.FEB.2023 11:40:15

### 8.5.25 C4FM, UL Mask C, AGC, 796 MHz

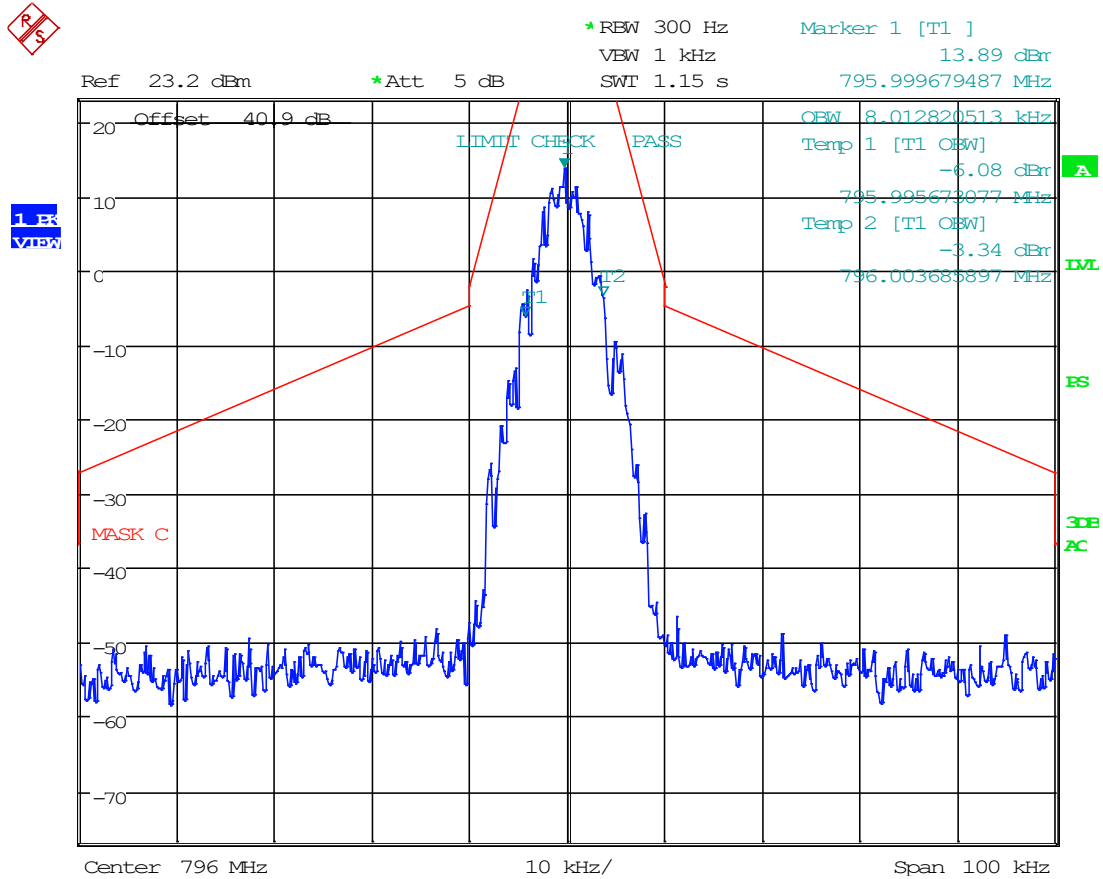


Date: 2.FEB.2023 10:24:01

### 8.5.26 C4FM, UL Mask C, AGC+3, 796 MHz

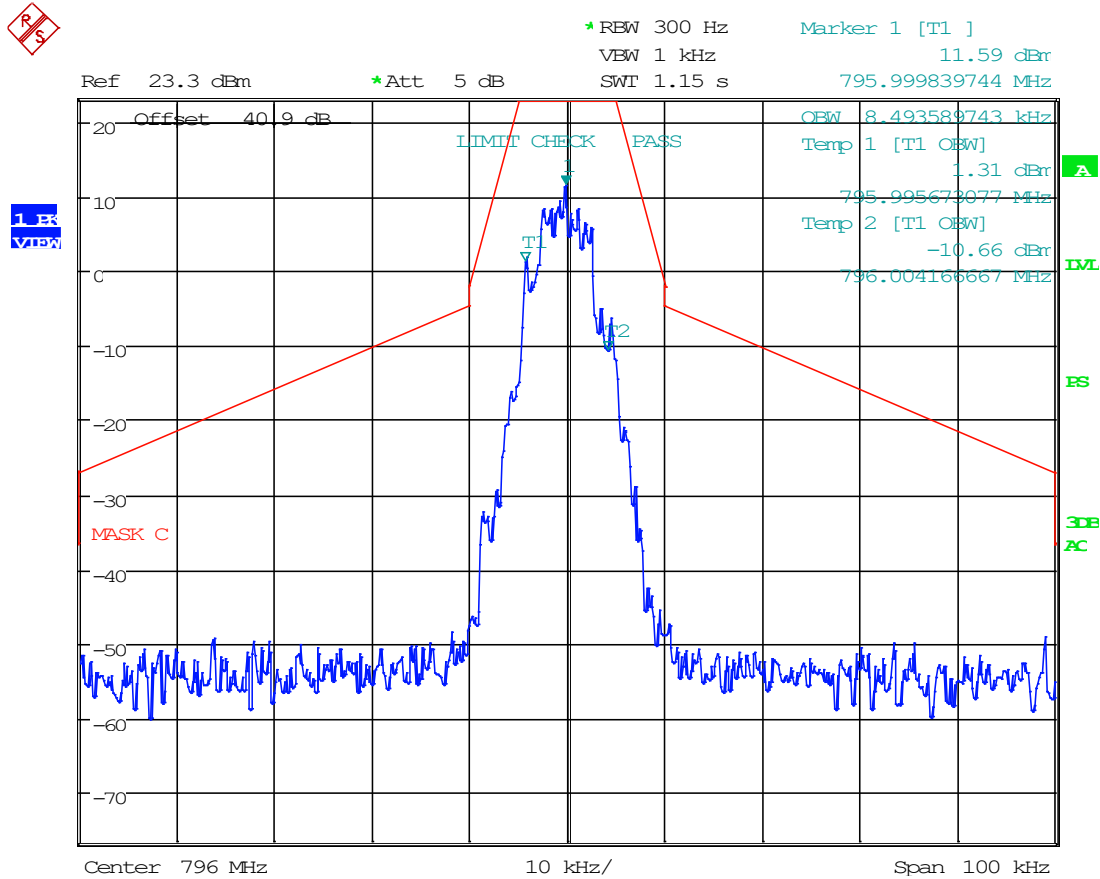


Date: 2.FEB.2023 11:41:53

### 8.5.27 H-CPM, UL Mask C, AGC, 796 MHz

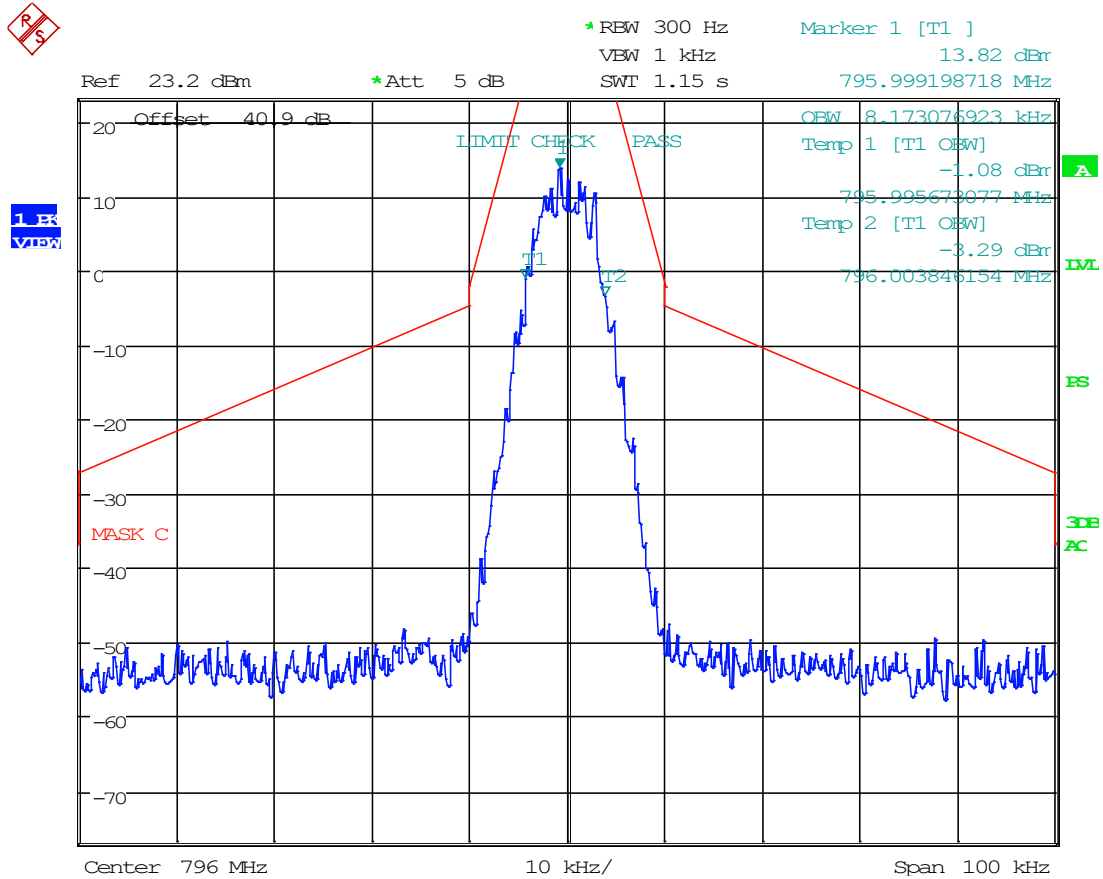


Date: 2.FEB.2023 10:25:04

### 8.5.28 H-CPM, UL Mask C, AGC+3, 796 MHz

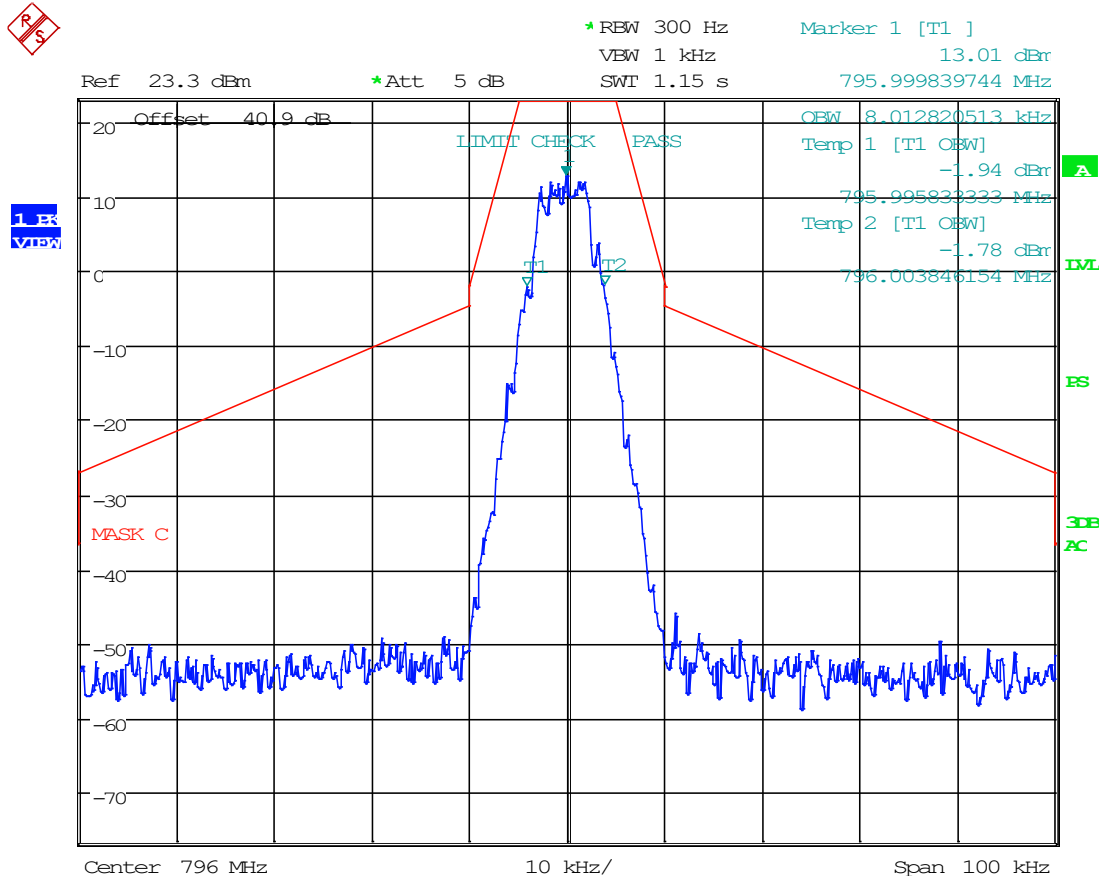

Date: 2.FEB.2023 11:42:58

### 8.5.29 H-DQPSK, UL Mask C, AGC, 796 MHz

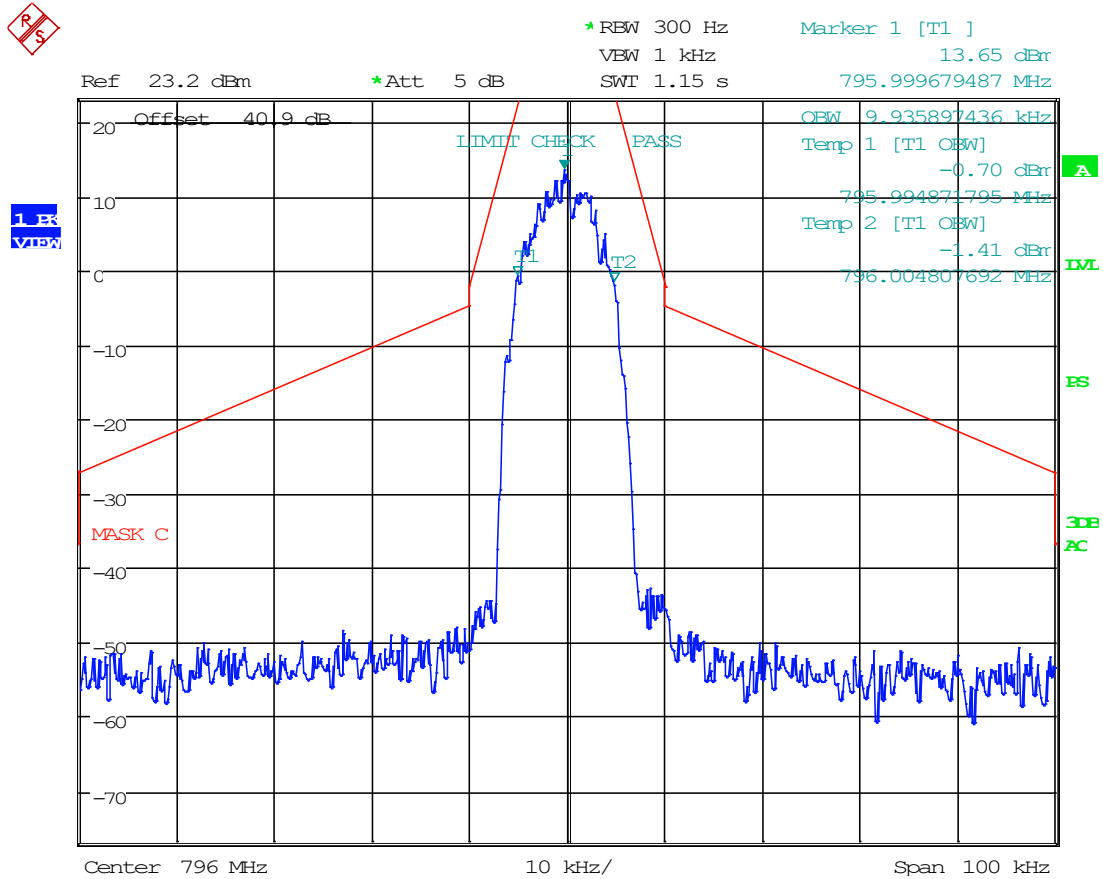


Date: 2.FEB.2023 10:25:54



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.5.30 H-DQPSK, UL Mask C, AGC+3, 796 MHz

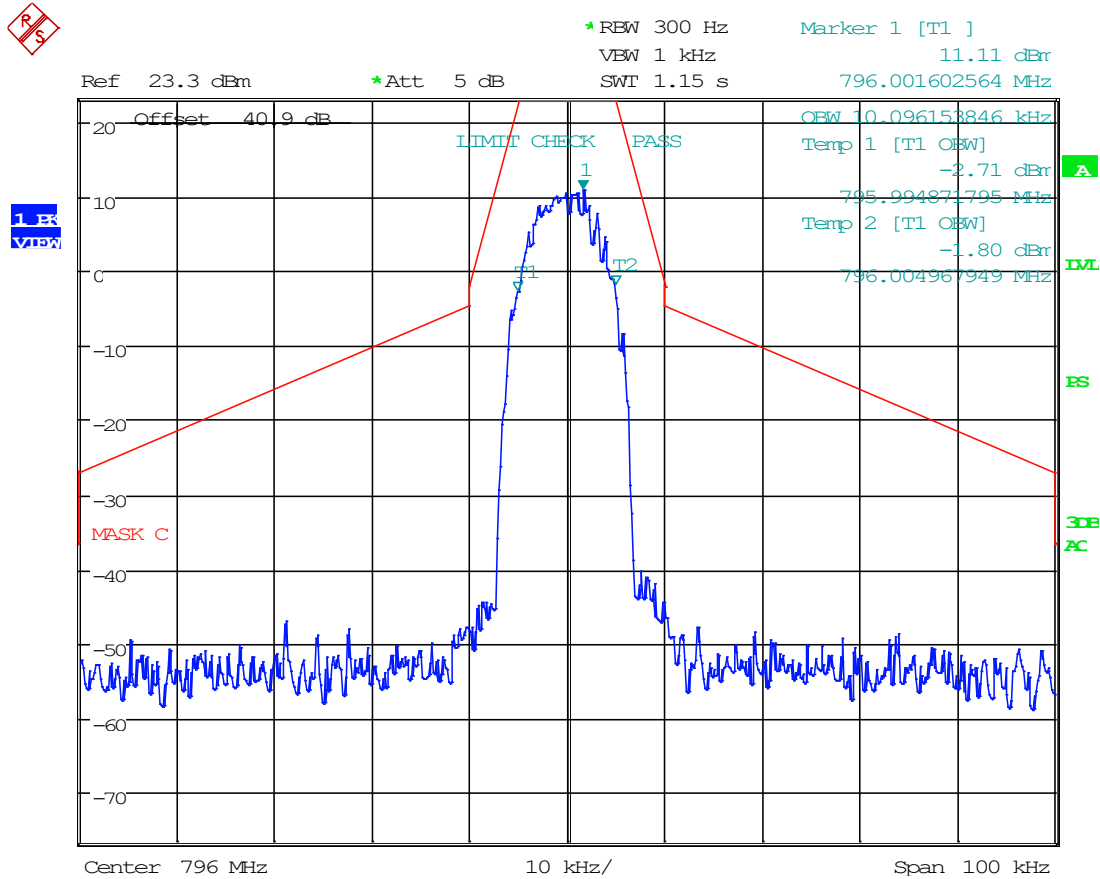

Date: 2.FEB.2023 11:43:51



8.5.31 6.25 kHz, FM, UL Mask C, AGC, 804.9875 MHz

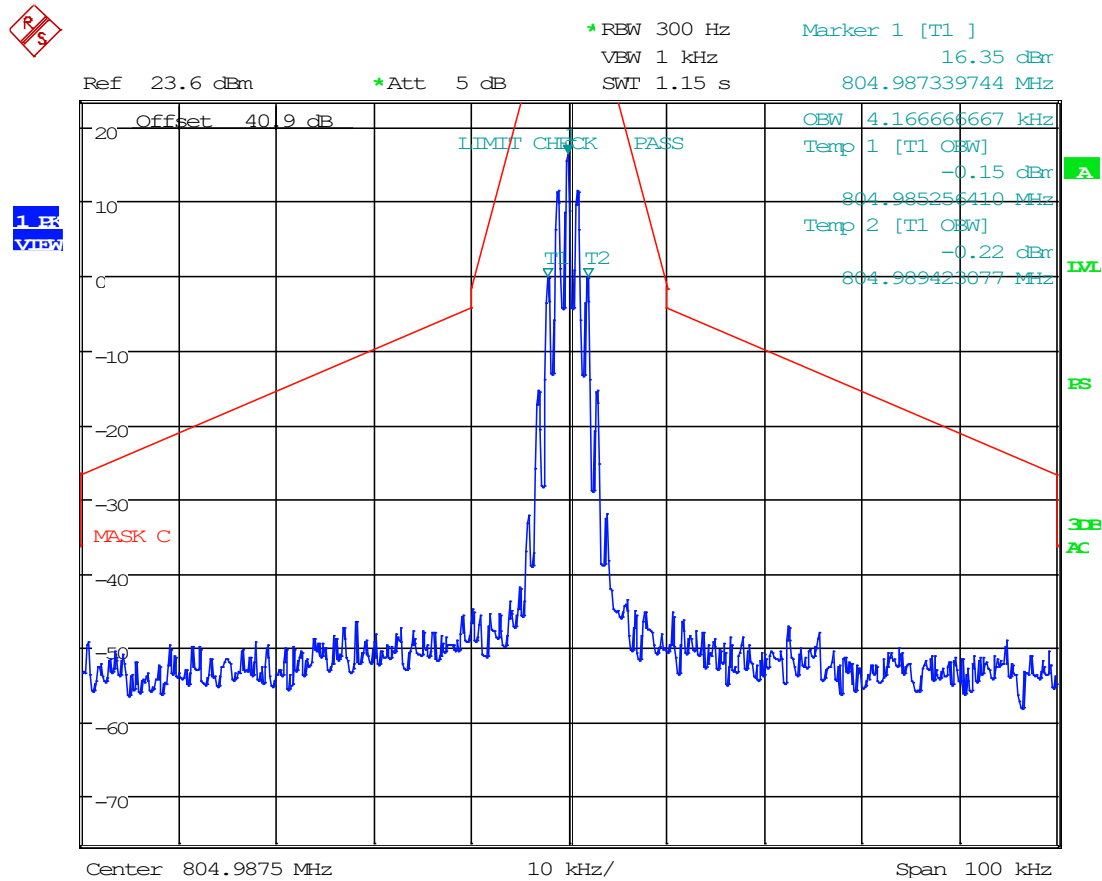


Date: 2.FEB.2023 10:27:52



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

8.5.32 6.25 kHz, FM, UL Mask C, AGC+3, 804.9875 MHz

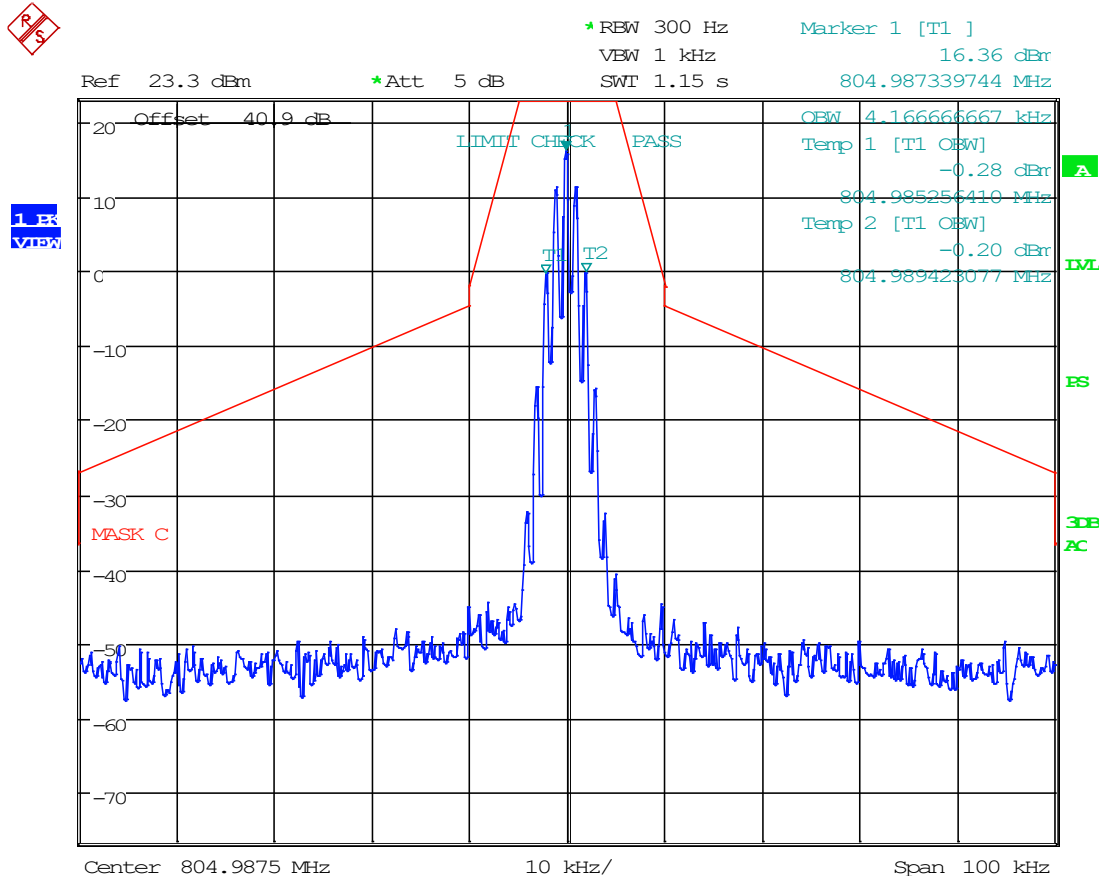


Date: 2.FEB.2023 11:45:13



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.5.33 12.5 kHz, FM, UL Mask C, AGC, 804.9875 MHz

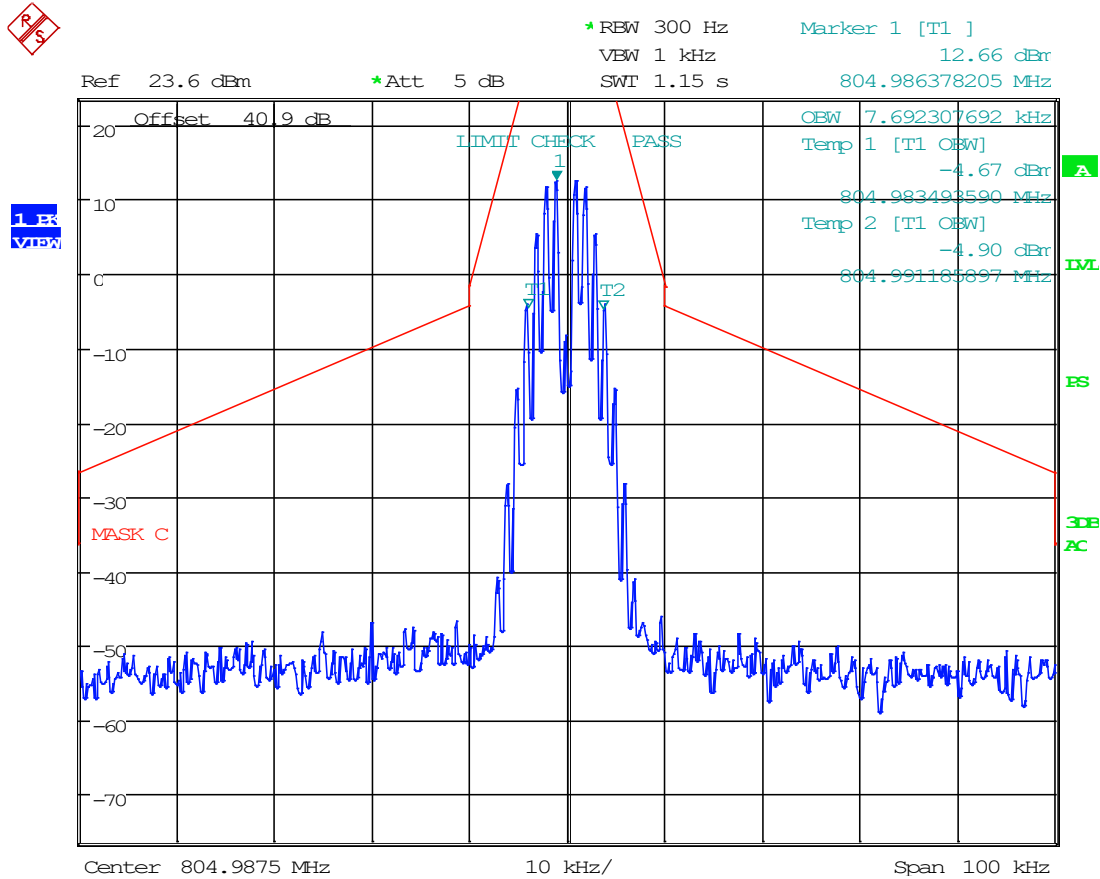


Date: 2.FEB.2023 10:28:48



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.5.34 12.5 kHz, FM, UL Mask C, AGC+3, 804.9875 MHz

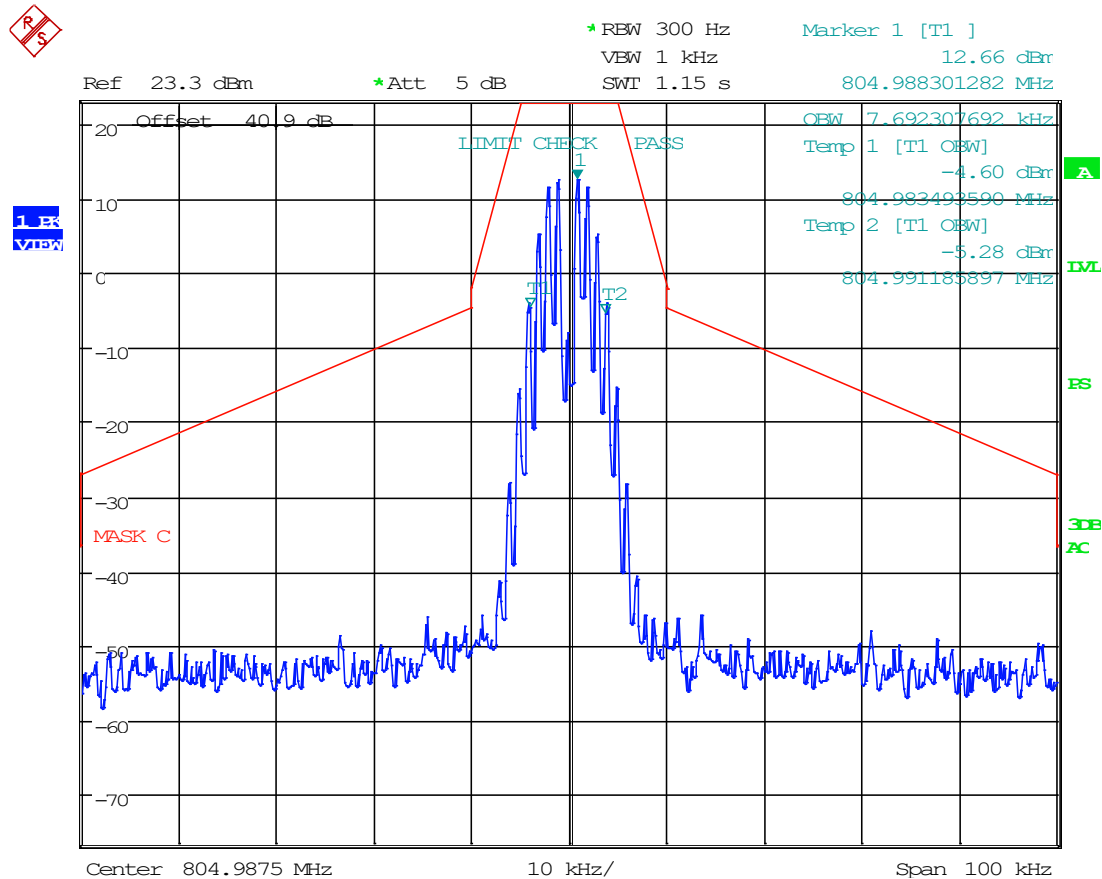

Date: 2.FEB.2023 11:46:12



8.5.35 25 kHz FM, UL Mask C, AGC, 804.9875 MHz

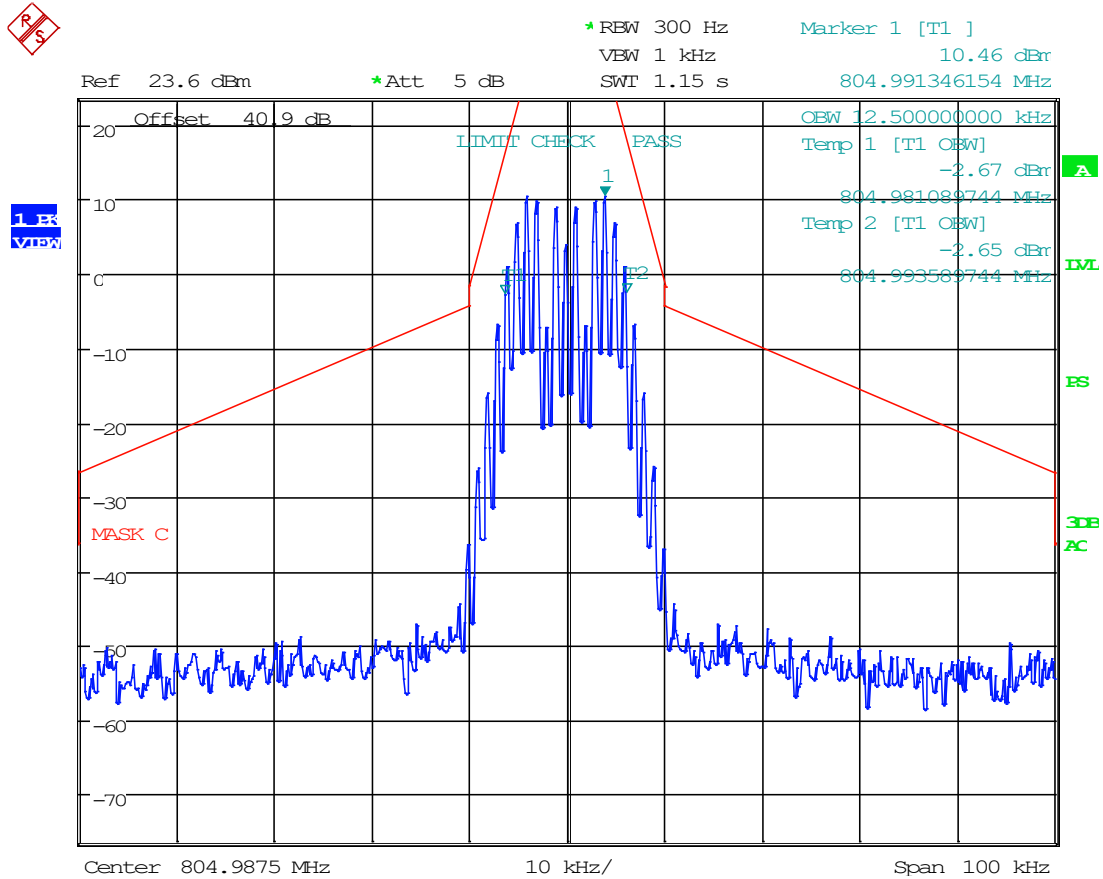


Date: 2.FEB.2023 10:29:55



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.5.36 25 kHz FM, UL Mask C, AGC+3, 804.9875 MHz

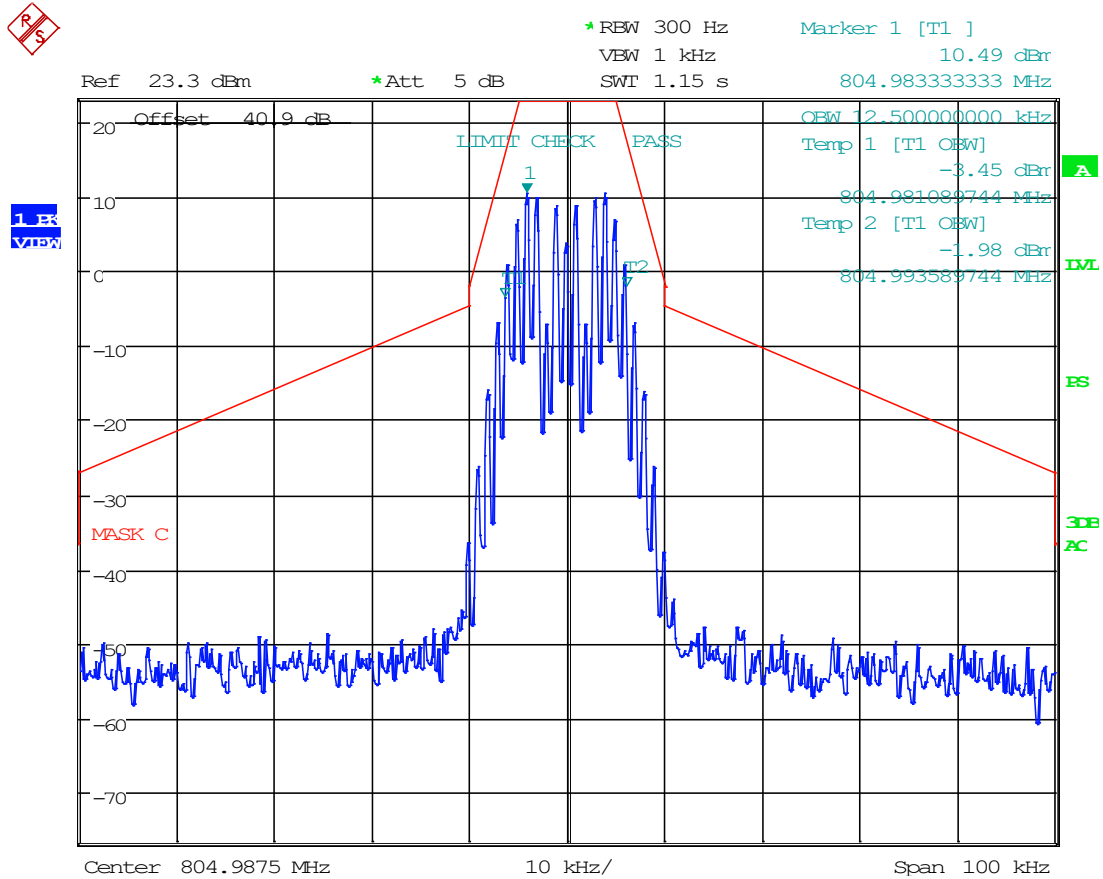

Date: 2.FEB.2023 11:46:58




### 8.5.37 C4FM, UL Mask C, AGC, 804.9875 MHz

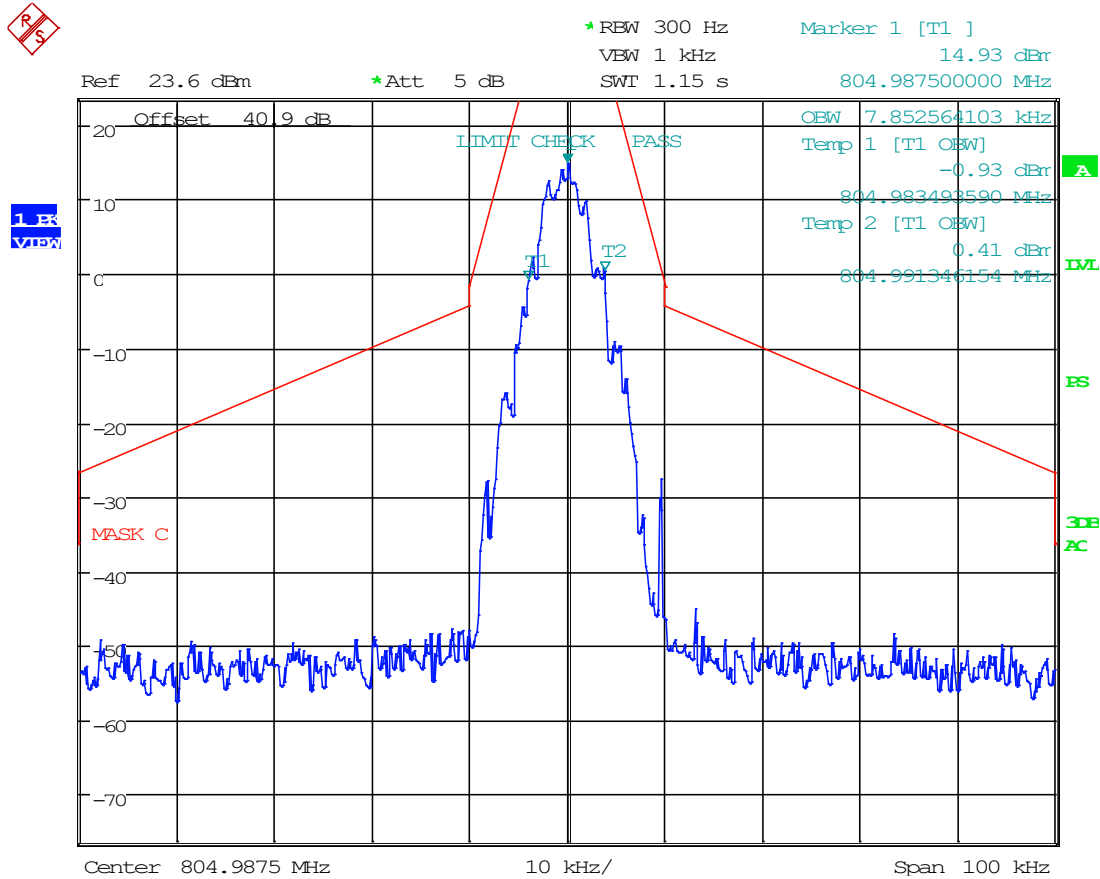

Date: 2.FEB.2023 10:30:51




### 8.5.38 C4FM, UL Mask C, AGC+3, 804.9875 MHz

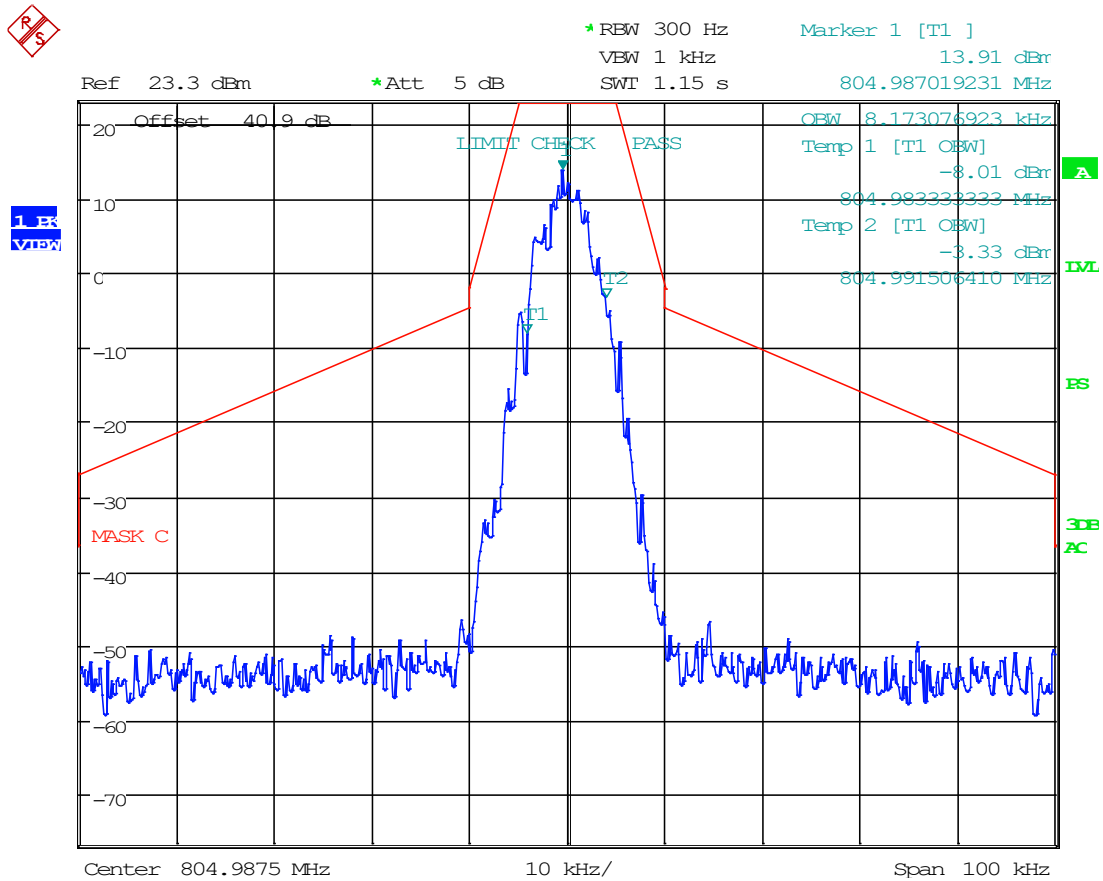

Date: 2.FEB.2023 11:49:33




### 8.5.39 H-CPM, UL Mask C, AGC, 804.9875 MHz

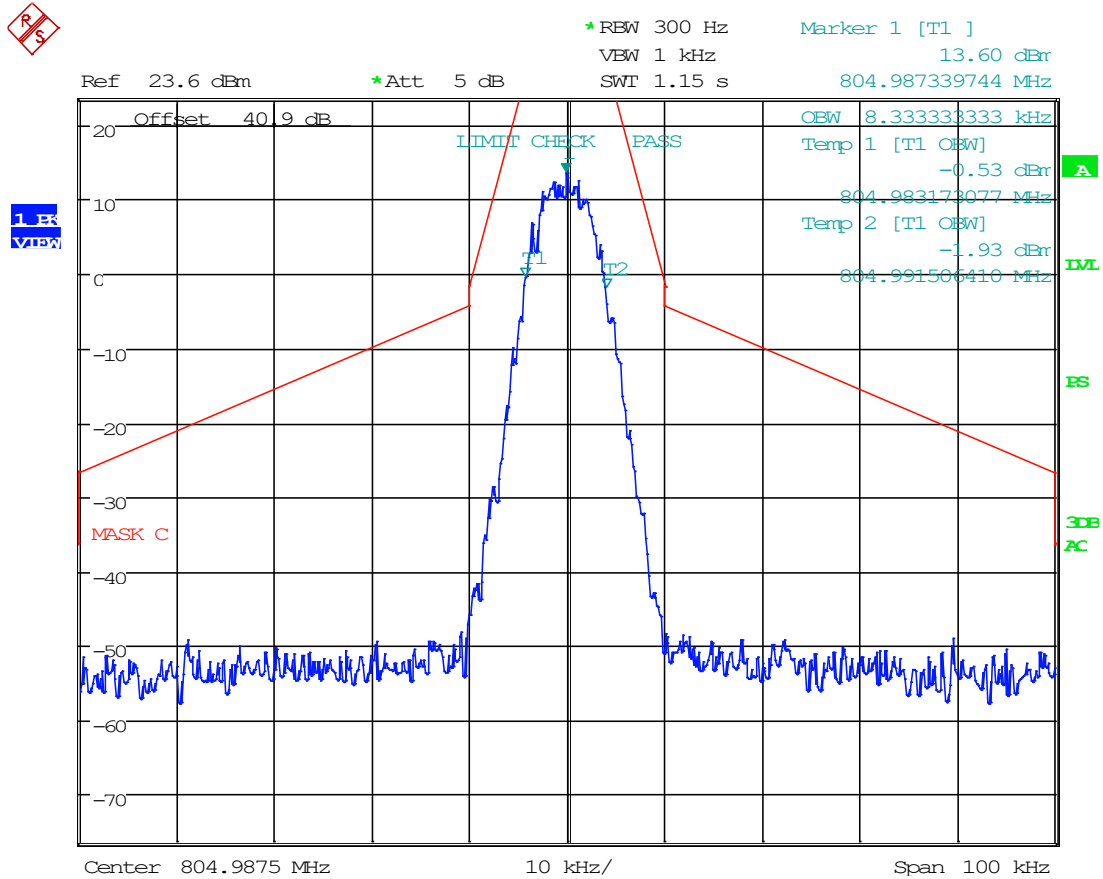

Date: 2.FEB.2023 10:32:00




### 8.5.40 H-CPM, UL Mask C, AGC+3, 804.9875 MHz

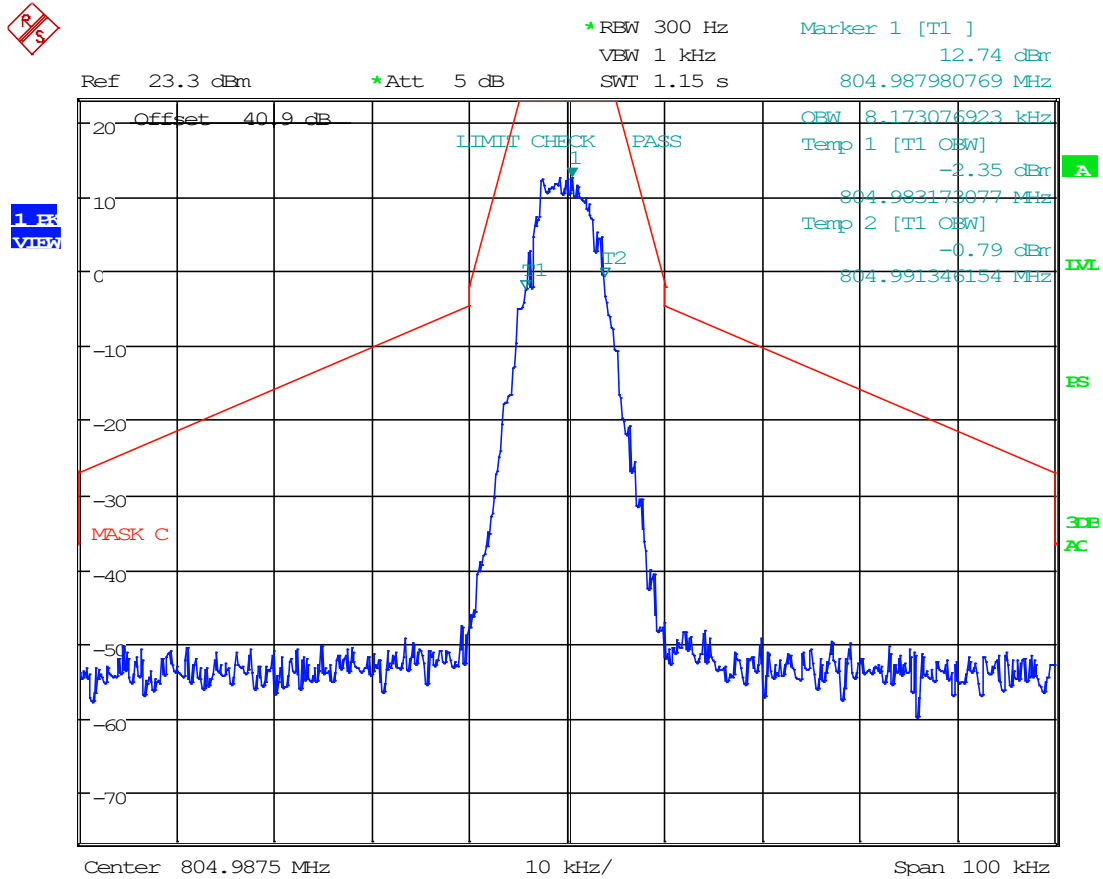


Date: 2.FEB.2023 11:50:30

### 8.5.41 H-DQPSK, UL Mask C, AGC, 804.9875 MHz

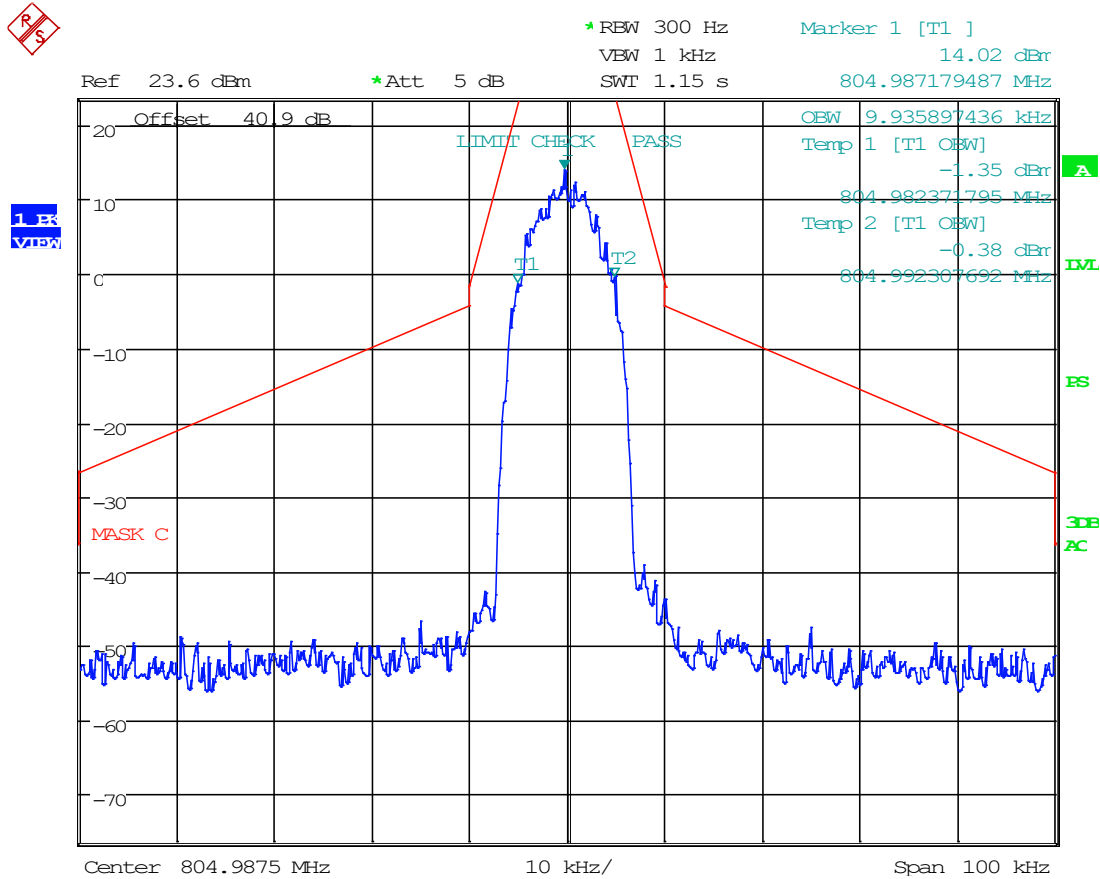

Date: 2.FEB.2023 10:32:58

### 8.5.42 H-DQPSK, UL Mask C, AGC+3, 804.9875 MHz

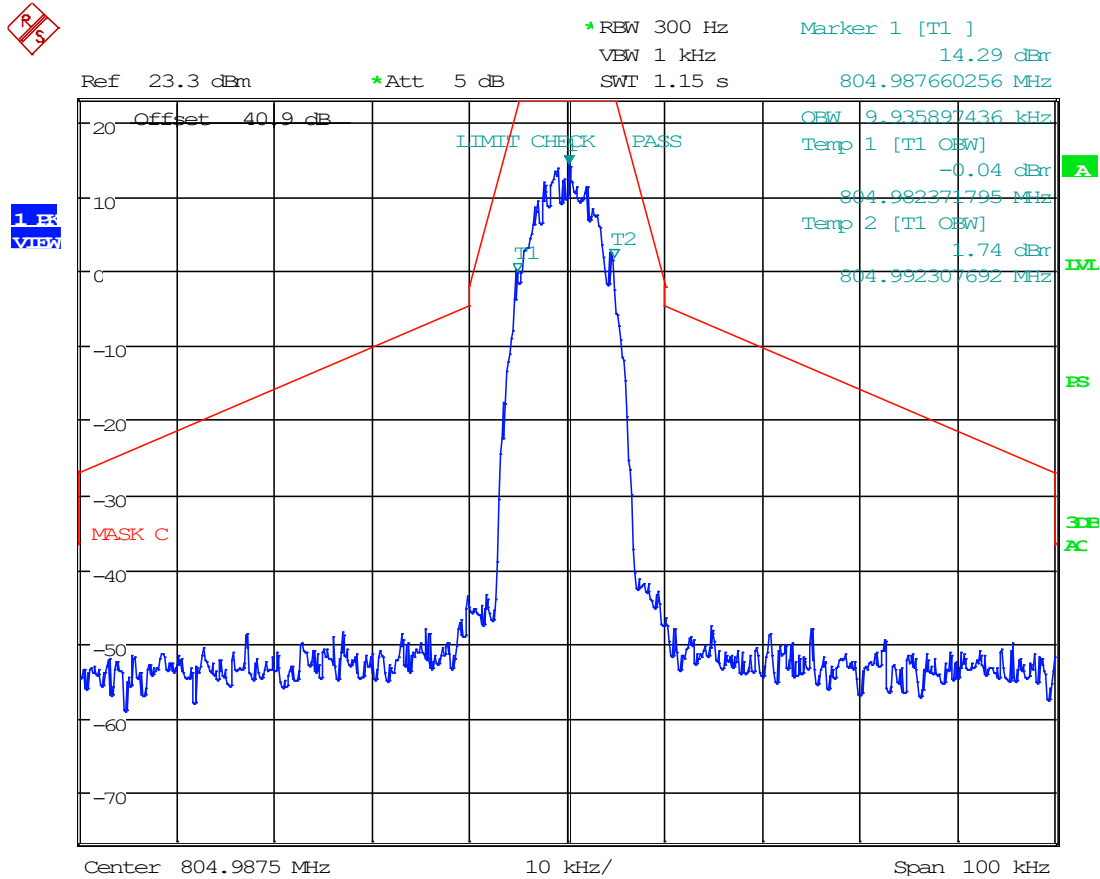


Date: 2.FEB.2023 11:51:14



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.5.43 6.25 kHz, FM, UL Mask H, AGC, 806.0125 MHz

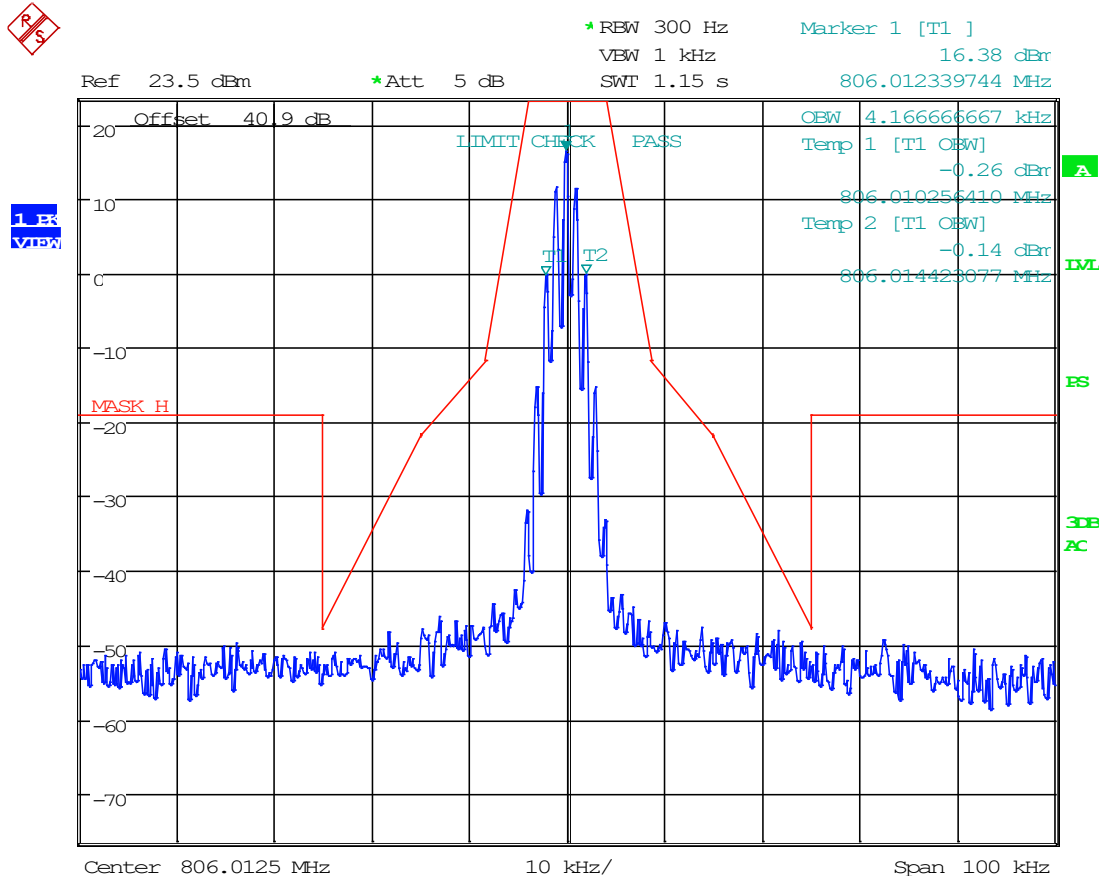

Date: 2.FEB.2023 14:27:04



### 8.5.44 6.25 kHz, FM, UL Mask H, AGC+3, 806.0125 MHz

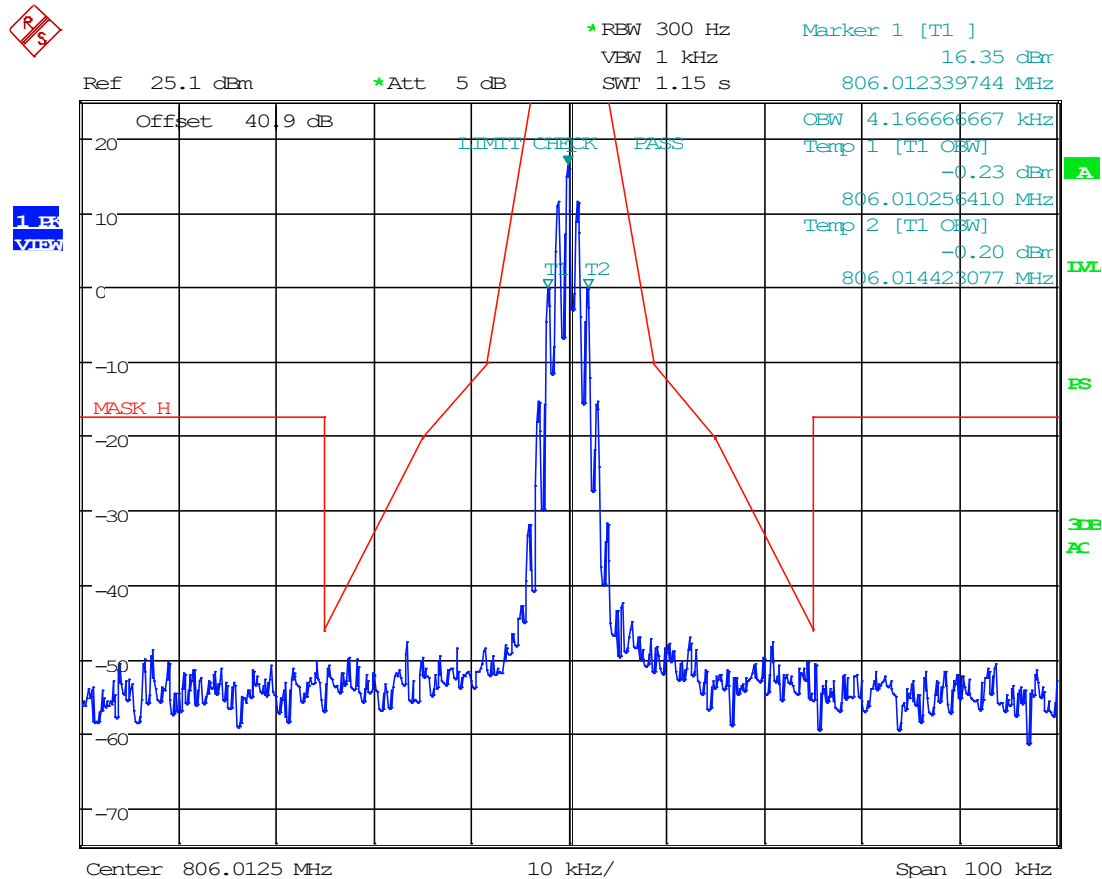


Date: 2.FEB.2023 14:34:06



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

8.5.45 12.5 kHz, FM, UL Mask H, AGC, 806.0125 MHz

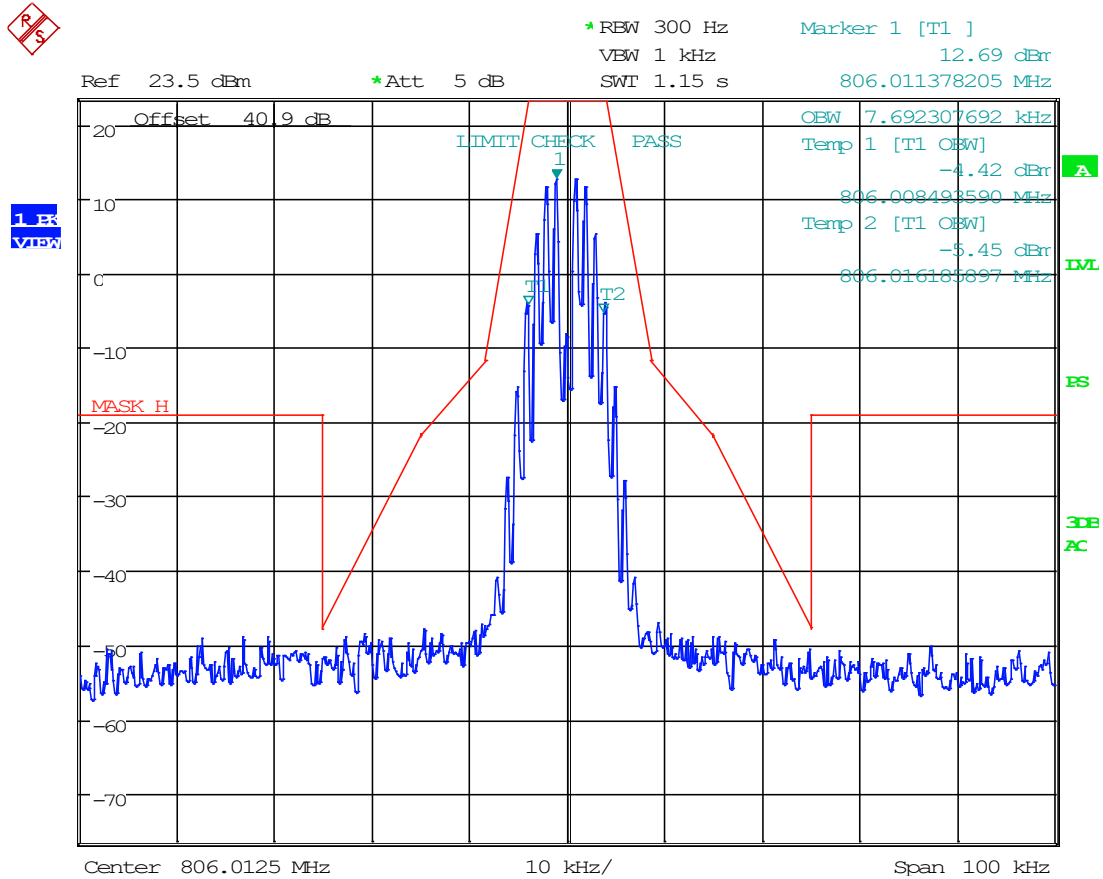


Date: 2.FEB.2023 14:27:51



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.5.46 12.5 kHz, FM, UL Mask H, AGC+3, 806.0125 MHz

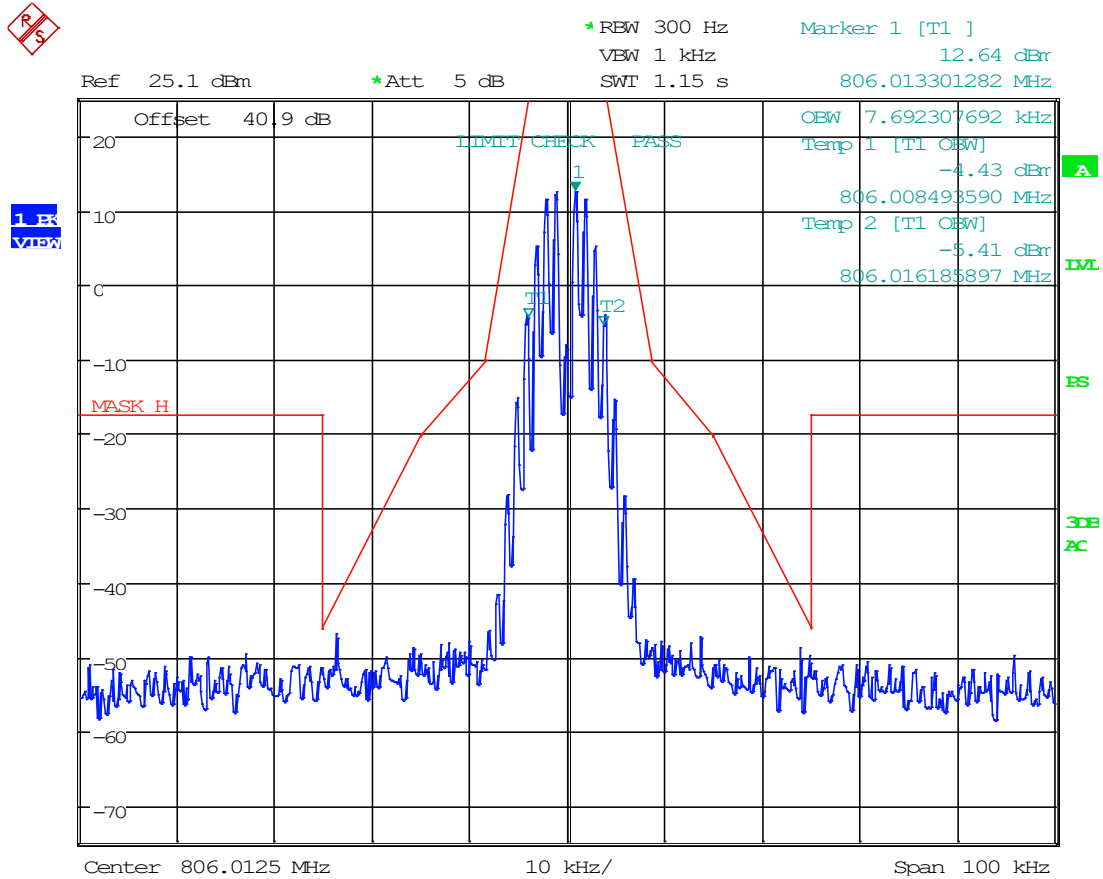

Date: 2.FEB.2023 14:35:39




### 8.5.47 25 kHz FM, UL Mask H, AGC, 806.0125 MHz

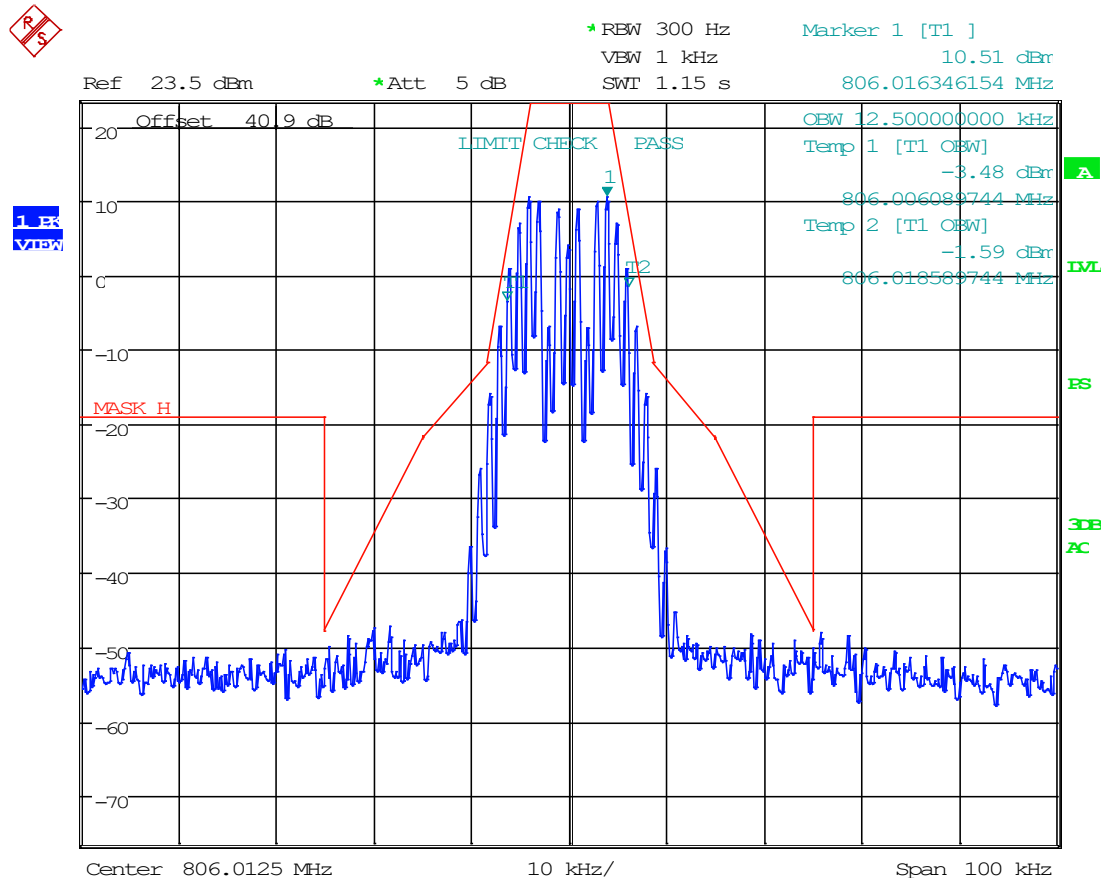

Date: 2.FEB.2023 14:28:42




8.5.48 25 kHz FM, UL Mask H, AGC+3, 806.0125 MHz

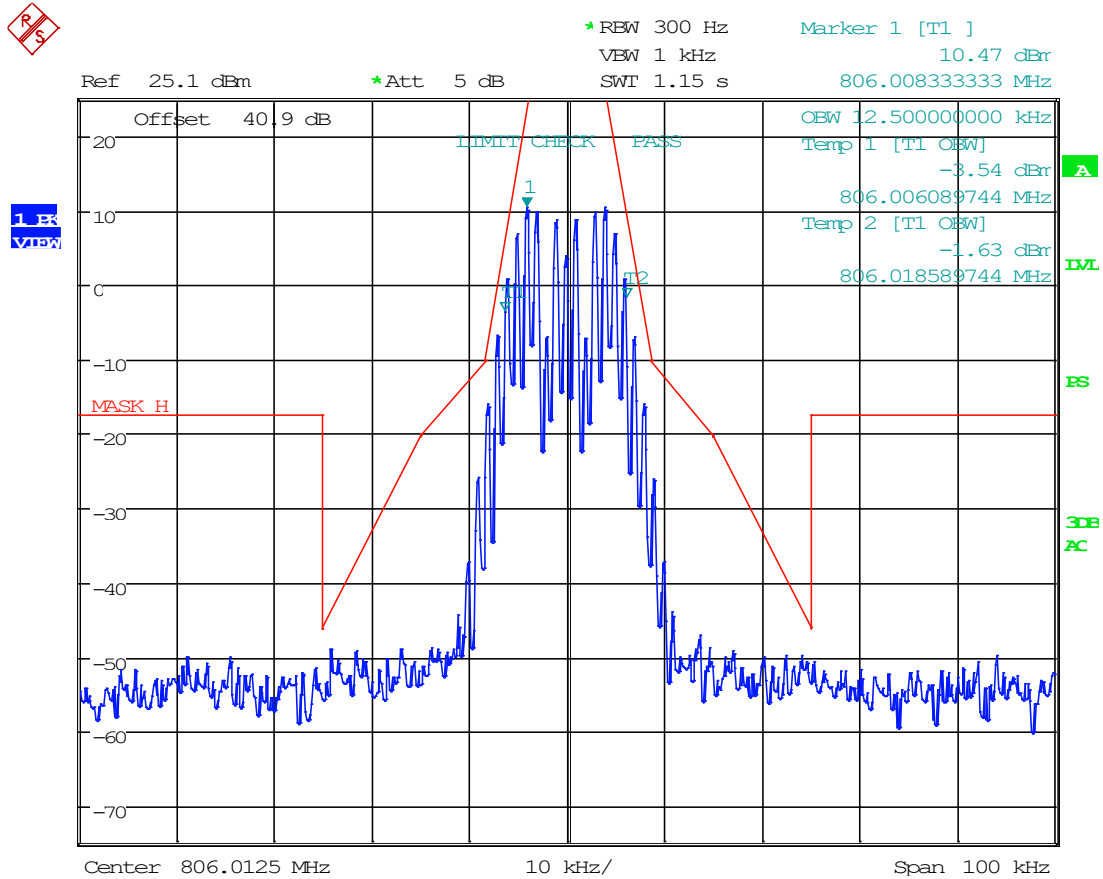

Date: 2.FEB.2023 14:36:19




### 8.5.49 C4FM, UL Mask H, AGC, 806.0125 MHz

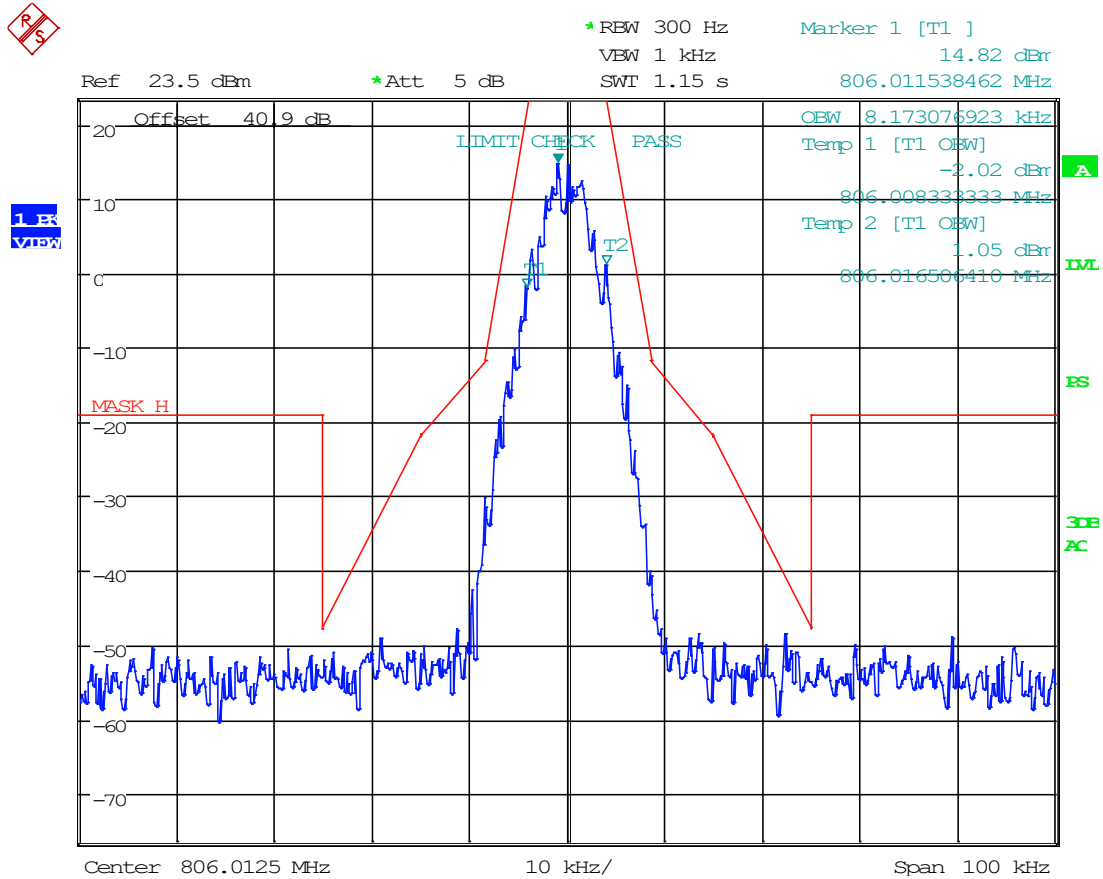

Date: 2.FEB.2023 14:29:41




### 8.5.50 C4FM, UL Mask H, AGC+3, 806.0125 MHz

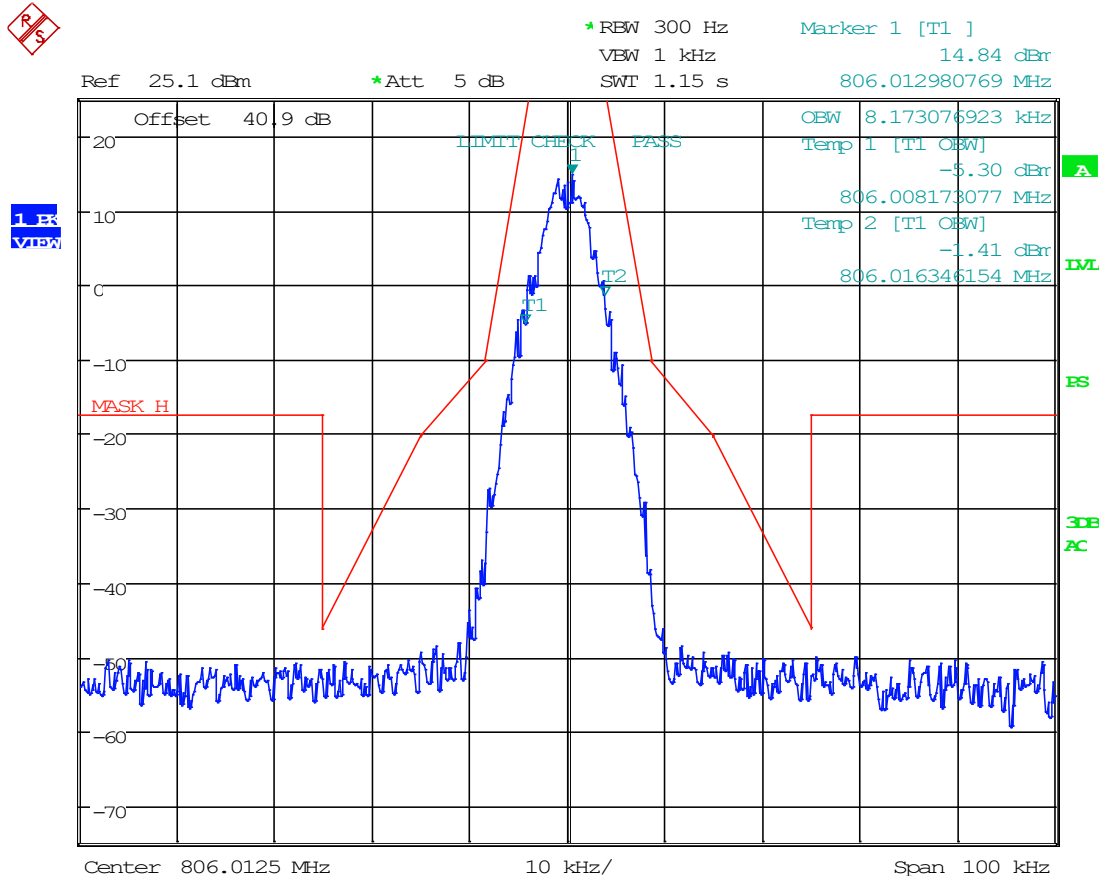

Date: 2.FEB.2023 14:37:22




### 8.5.51 H-CPM, UL Mask H, AGC, 806.0125 MHz

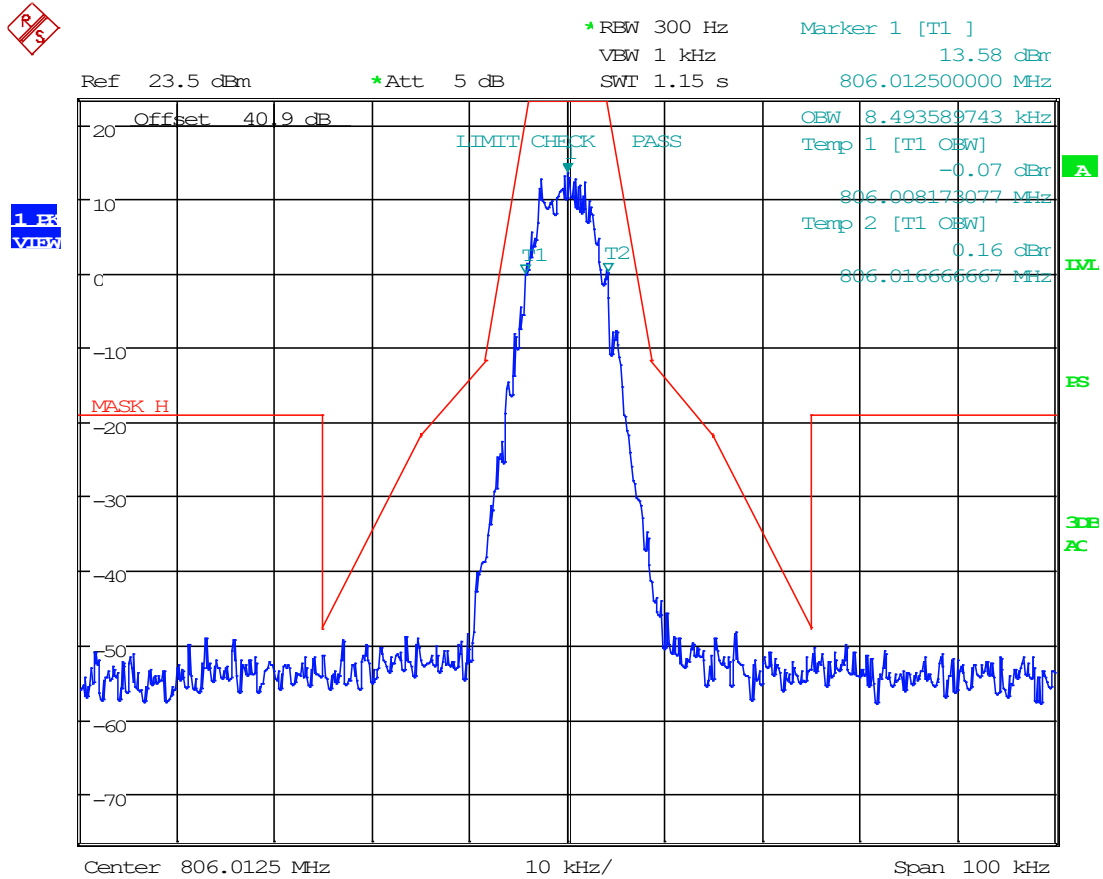

Date: 2.FEB.2023 14:30:43




### 8.5.52 H-CPM, UL Mask H, AGC+3, 806.0125 MHz

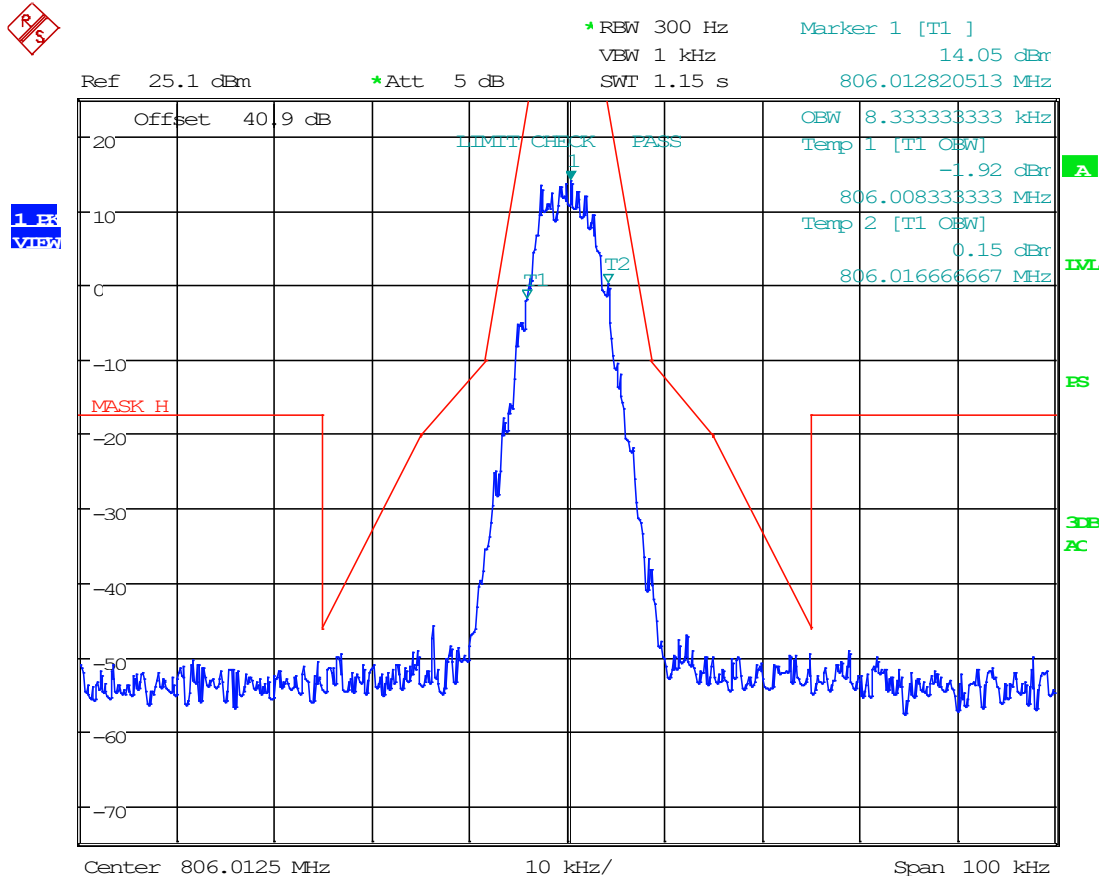

Date: 2.FEB.2023 14:38:04


### 8.5.53 H-DQPSK, UL Mask H, AGC, 806.0125 MHz

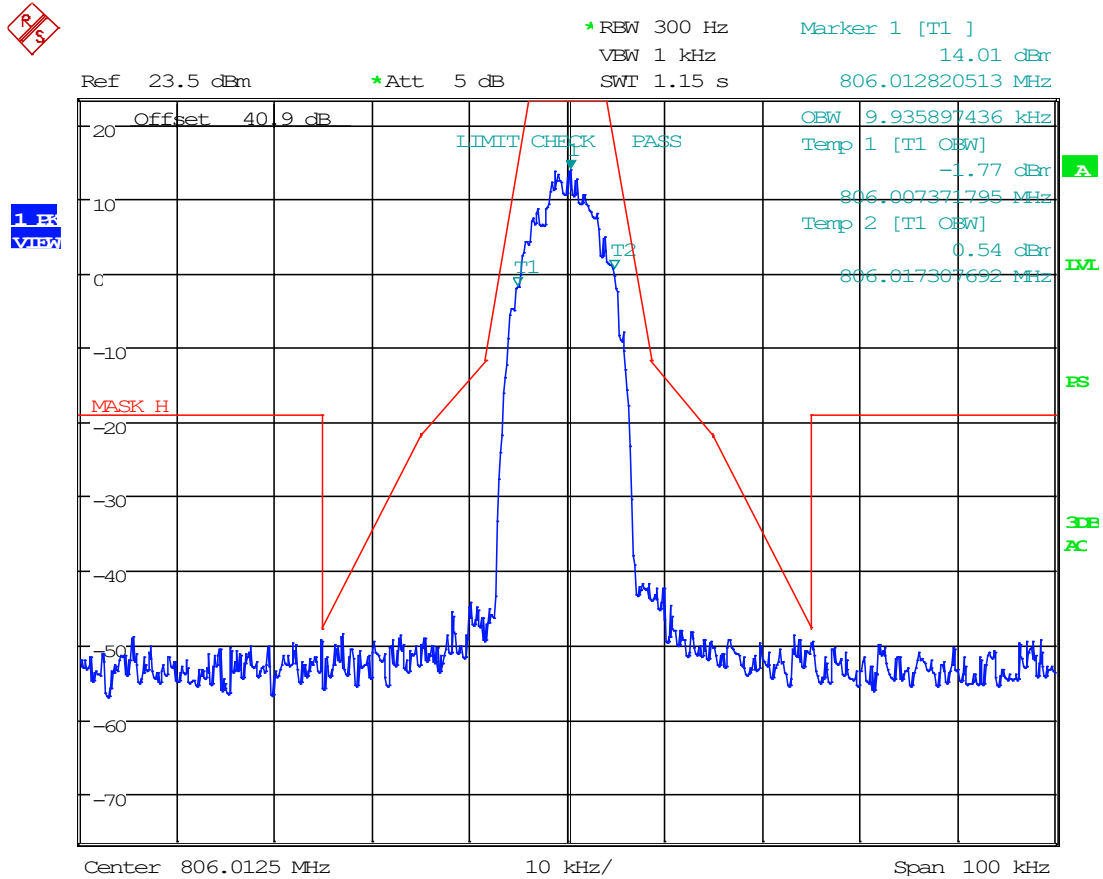

Date: 2.FEB.2023 14:31:29



### 8.5.54 H-DQPSK, UL Mask H, AGC+3, 806.0125 MHz

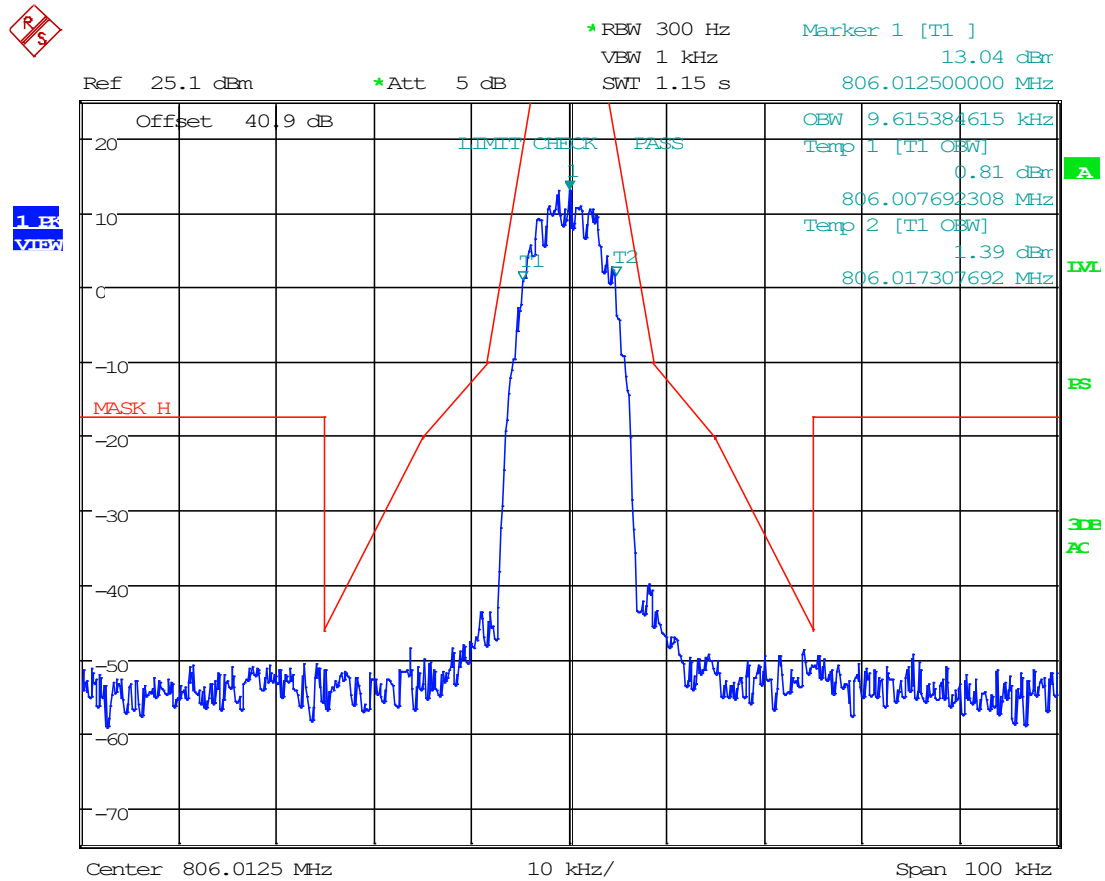


Date: 2.FEB.2023 14:39:06



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.5.55 6.25 kHz, FM, UL Mask E, AGC, 812 MHz

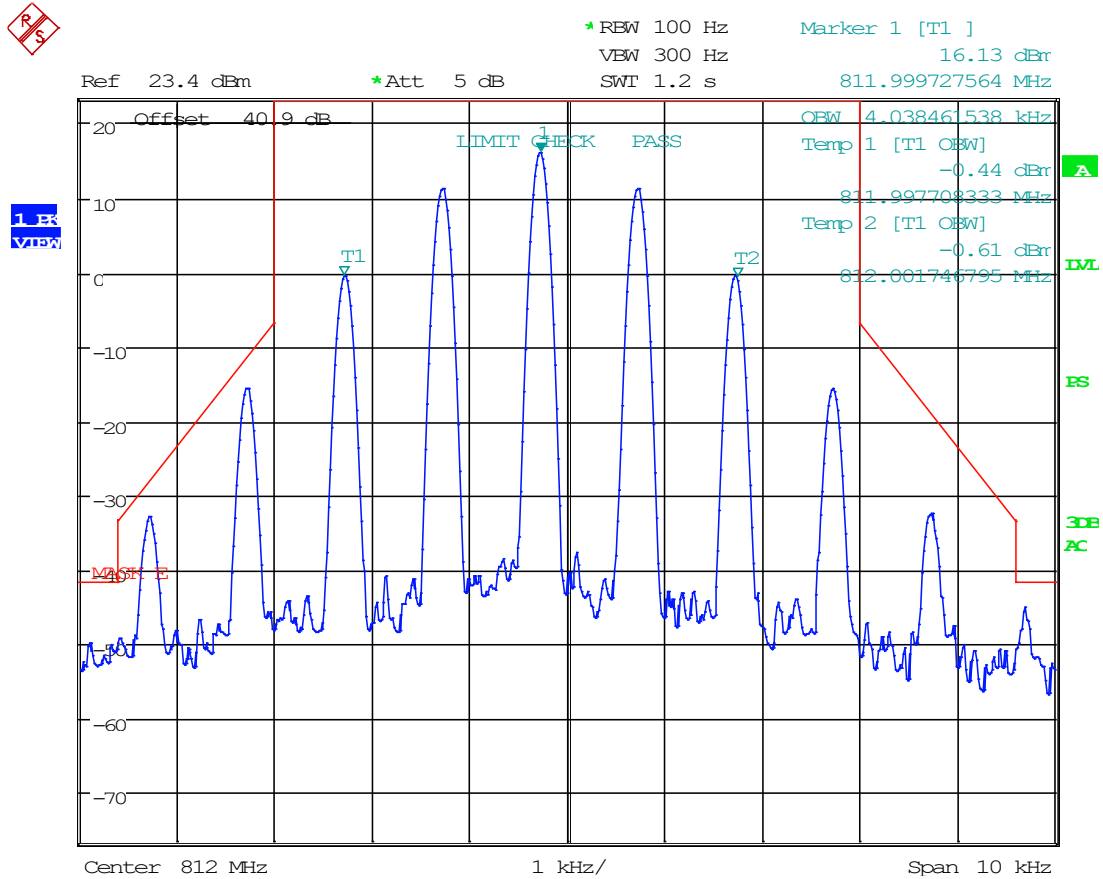


Date: 3.FEB.2023 08:41:39



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.5.56 6.25 kHz, FM, UL Mask E, AGC+3, 812 MHz

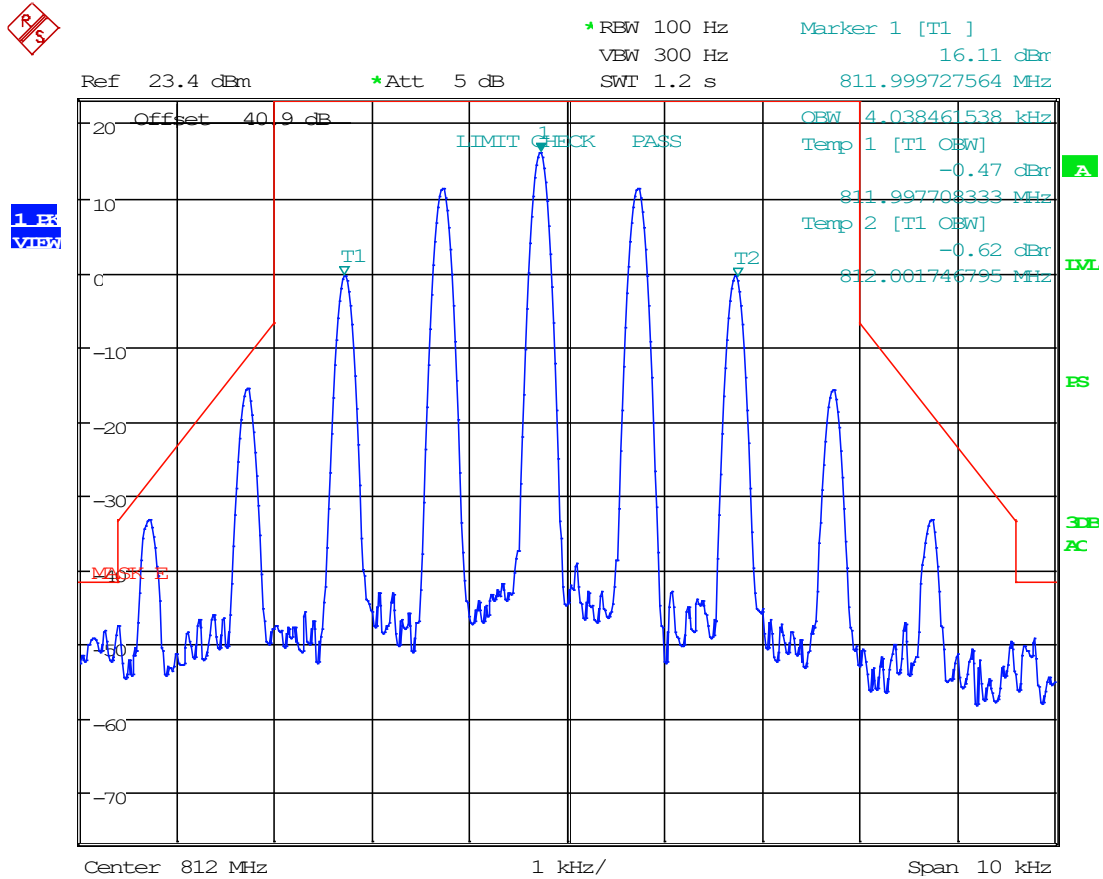

Date: 3.FEB.2023 08:43:42



8.5.57 12.5 kHz, FM, UL Mask D, AGC, 812 MHz

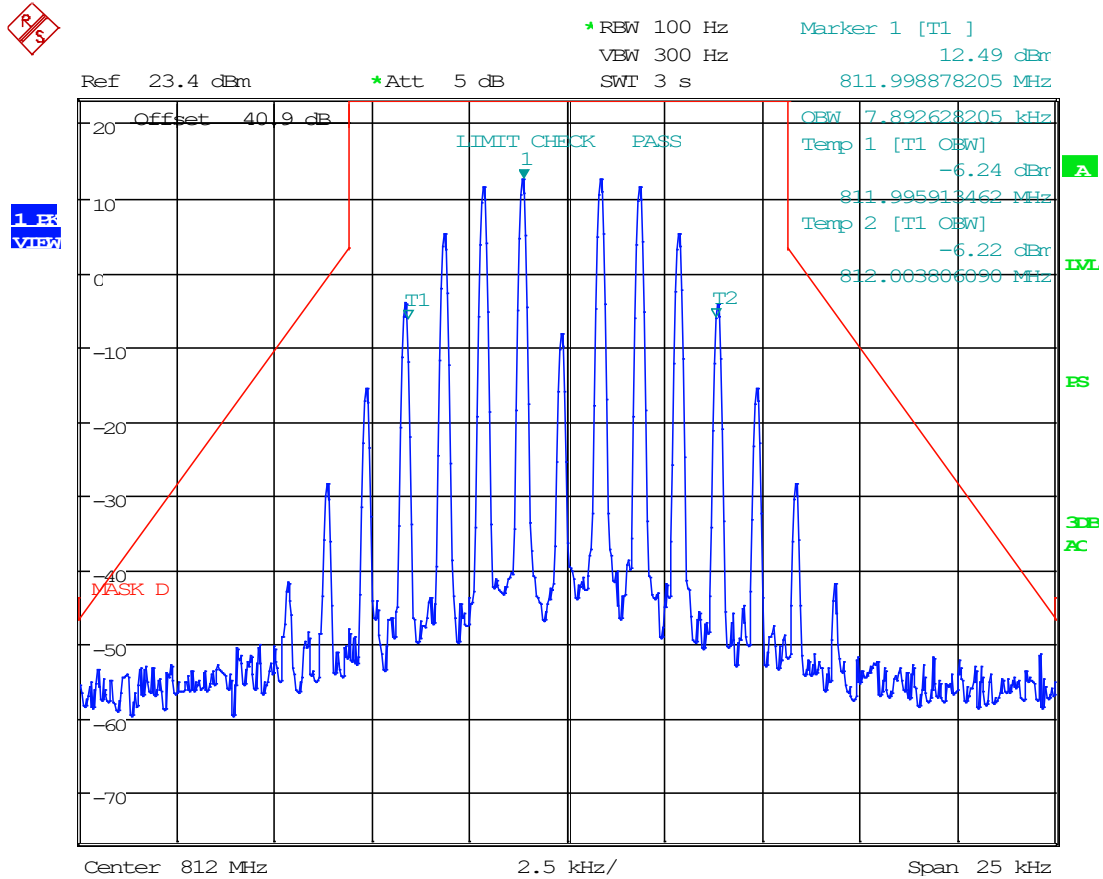


Date: 2.FEB.2023 15:08:13



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


8.5.58 12.5 kHz, FM, UL Mask D, AGC+3, 812 MHz

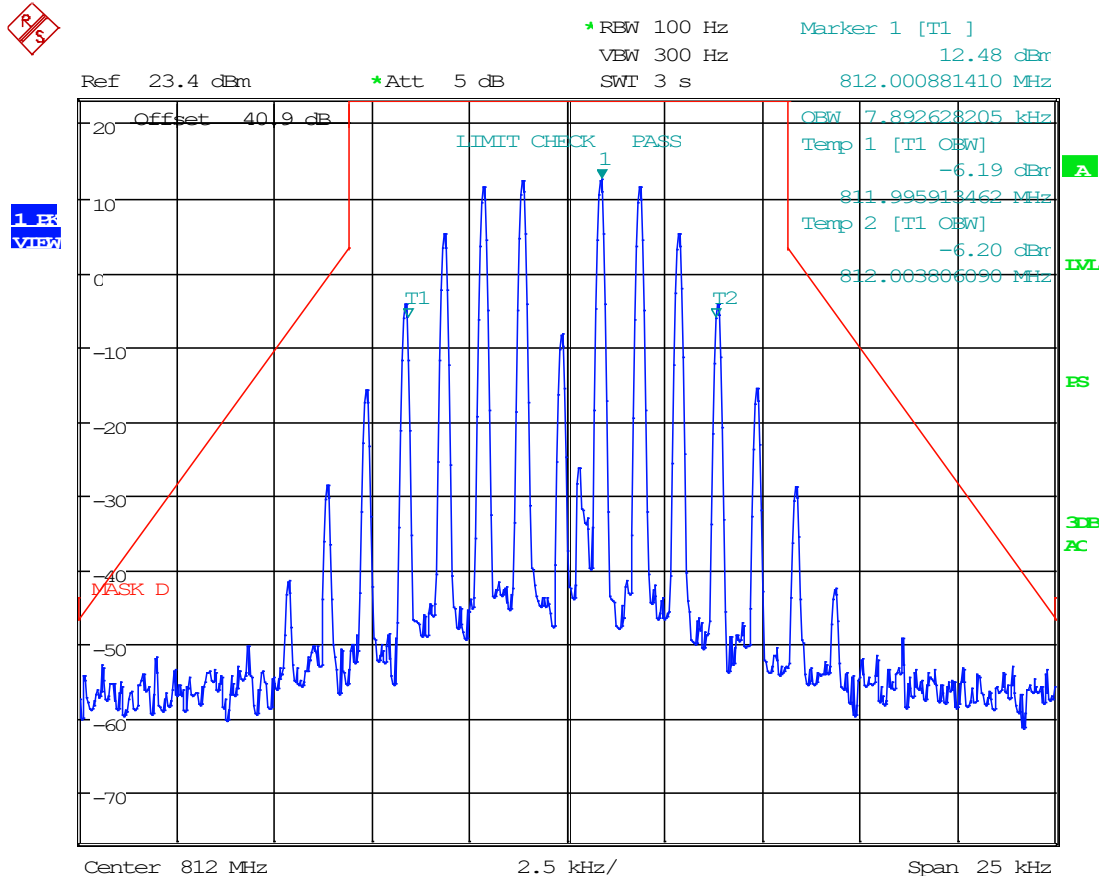

Date: 2.FEB.2023 15:10:18




### 8.5.59 25 kHz FM, UL Mask G, AGC, 812 MHz

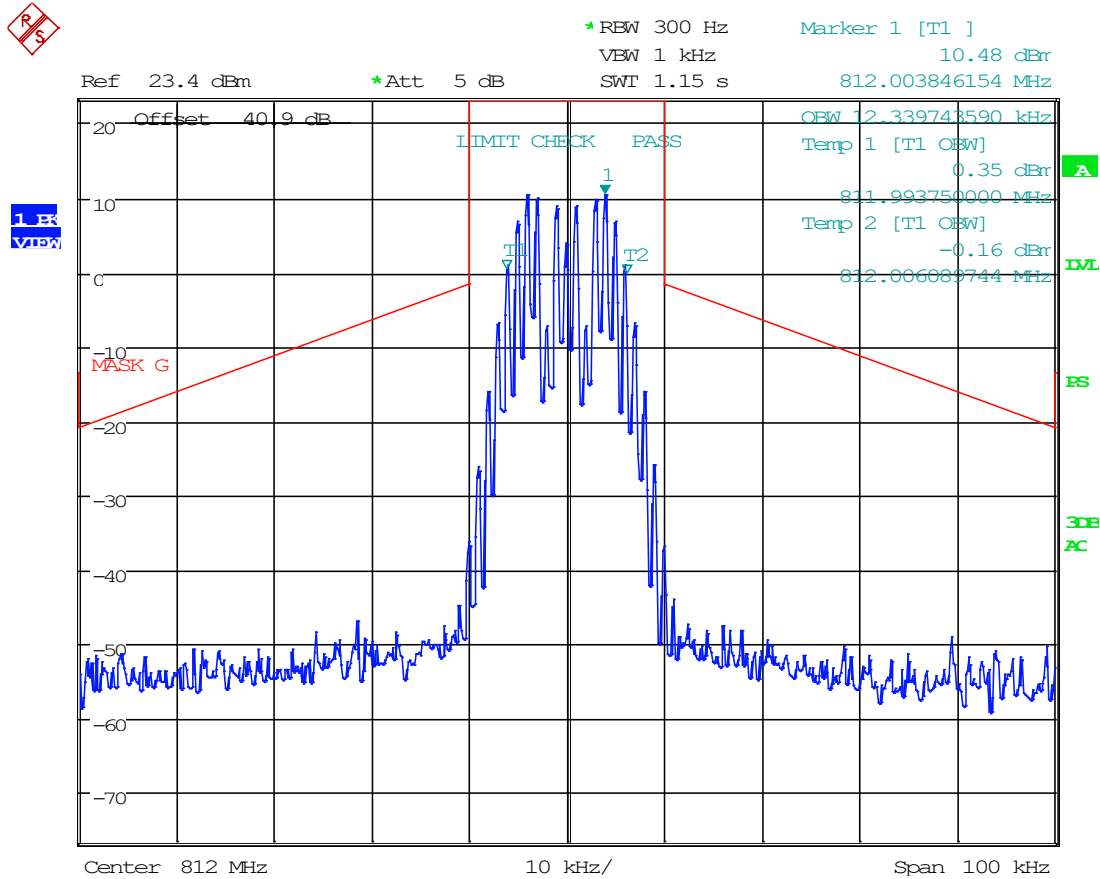

Date: 2.FEB.2023 17:04:45




### 8.5.60 25 kHz FM, UL Mask G, AGC+3, 812 MHz

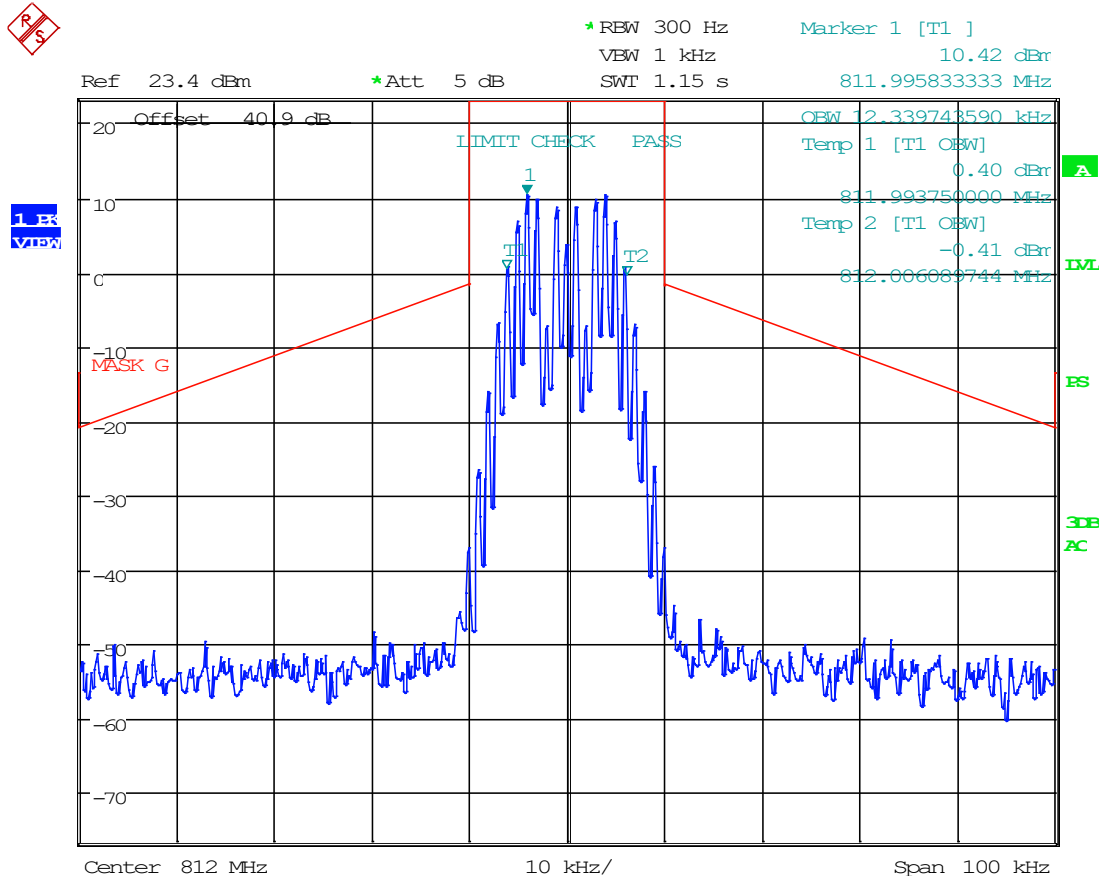

Date: 2.FEB.2023 17:07:48


### 8.5.61 C4FM, UL Mask D, AGC, 812 MHz

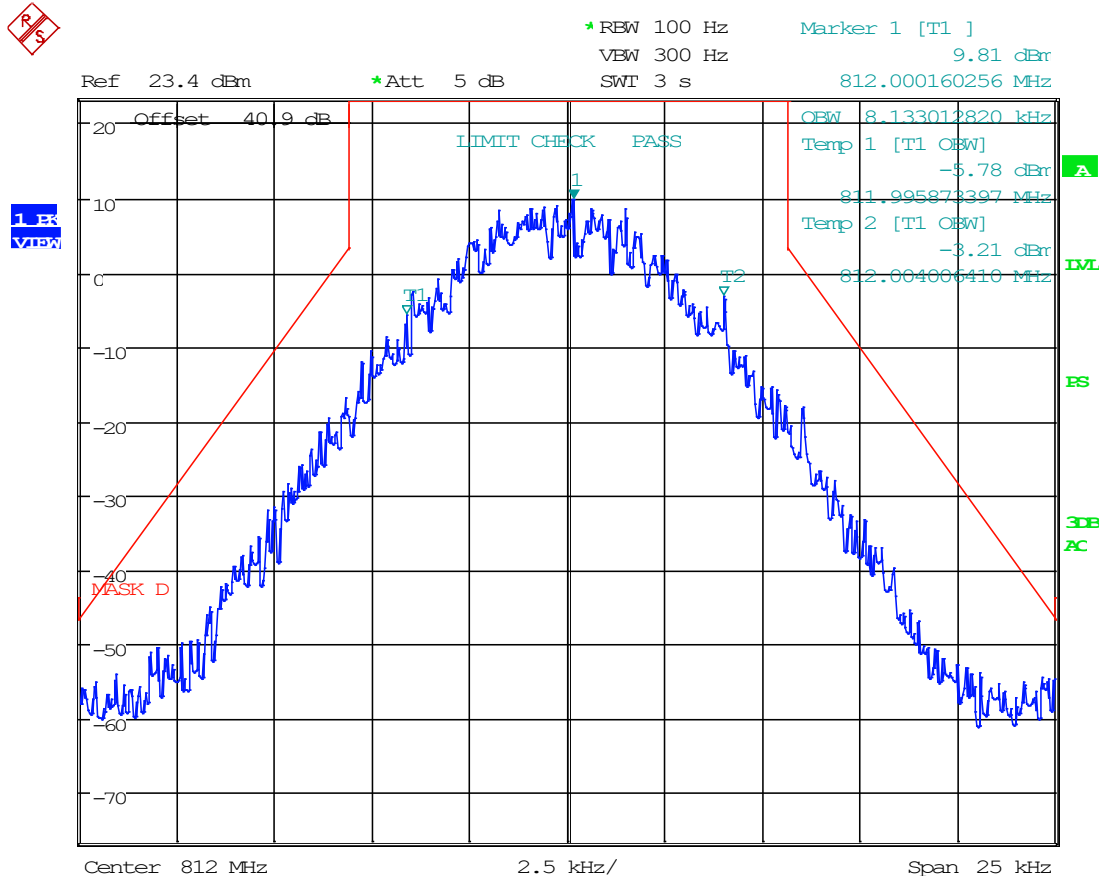

Date: 2.FEB.2023 15:29:03




### 8.5.62 C4FM, UL Mask D, AGC+3, 812 MHz

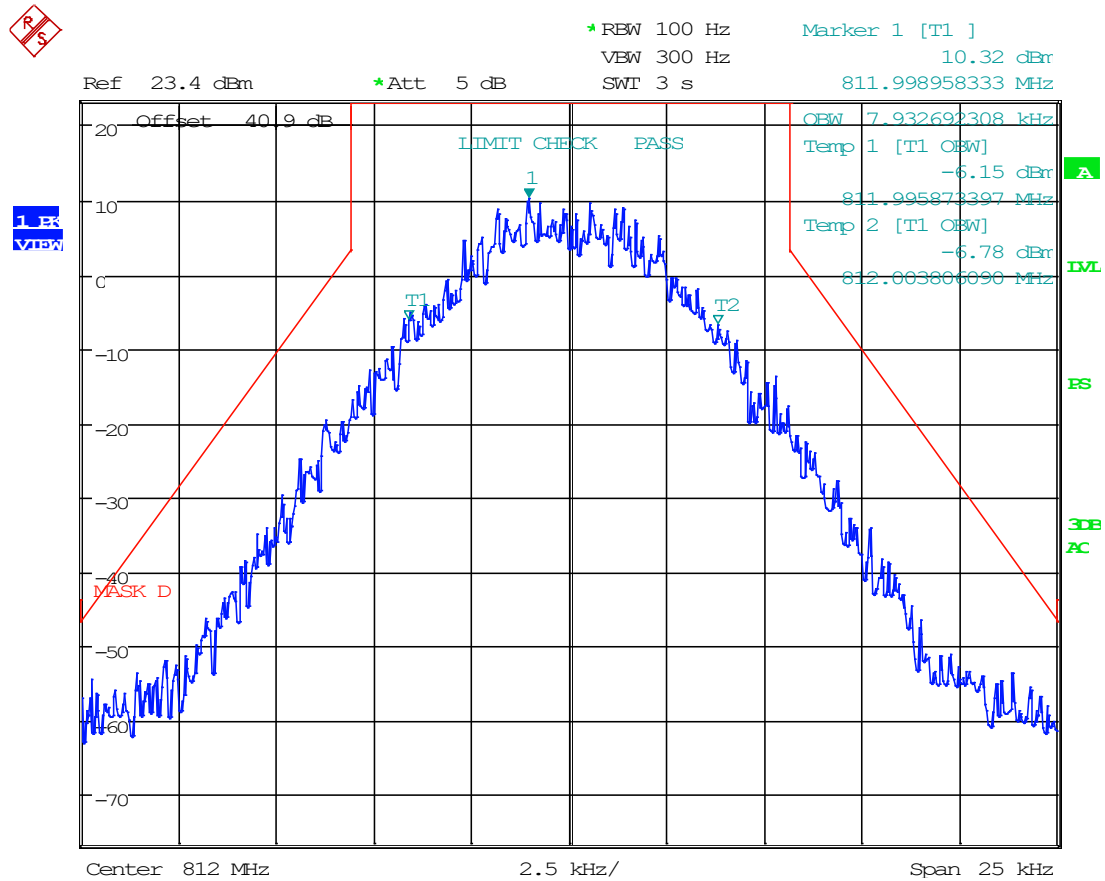

Date: 2.FEB.2023 15:32:57




### 8.5.63 H-CPM, UL Mask D, AGC, 812 MHz

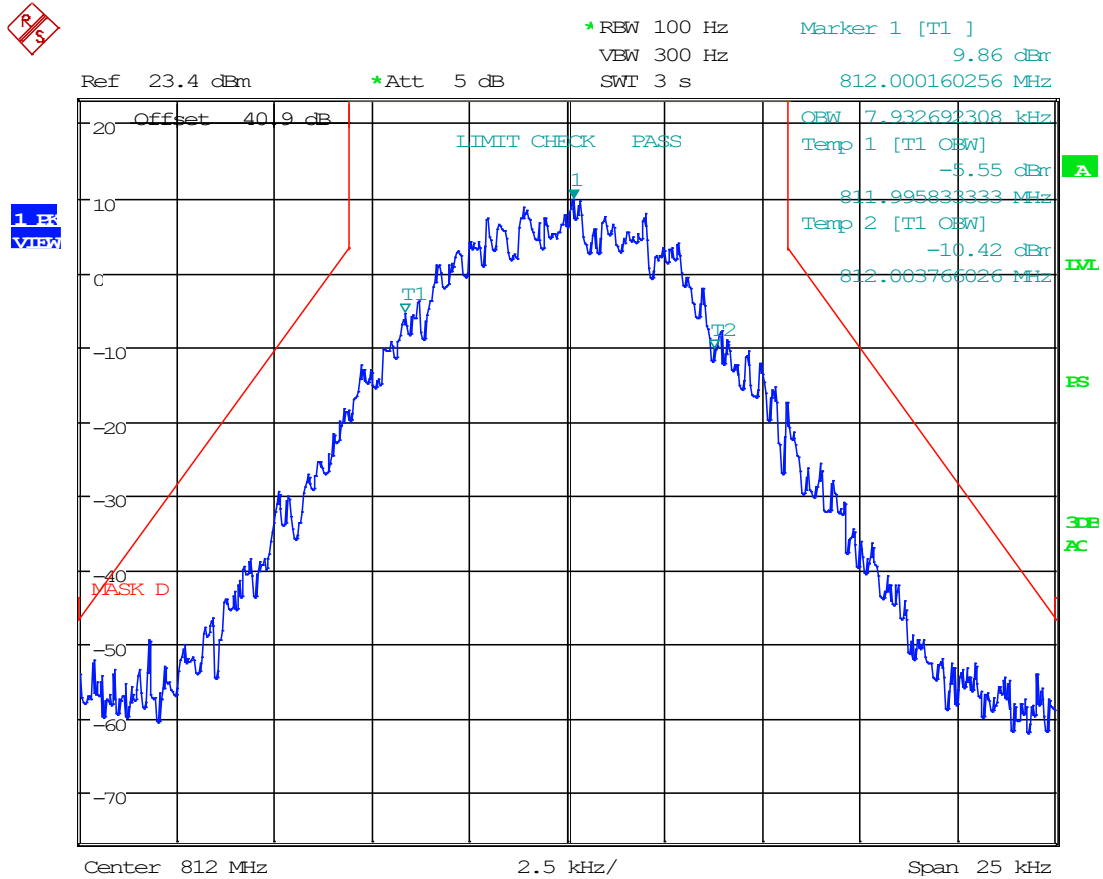

Date: 2.FEB.2023 15:31:12




### 8.5.64 H-CPM, UL Mask D, AGC+3, 812 MHz

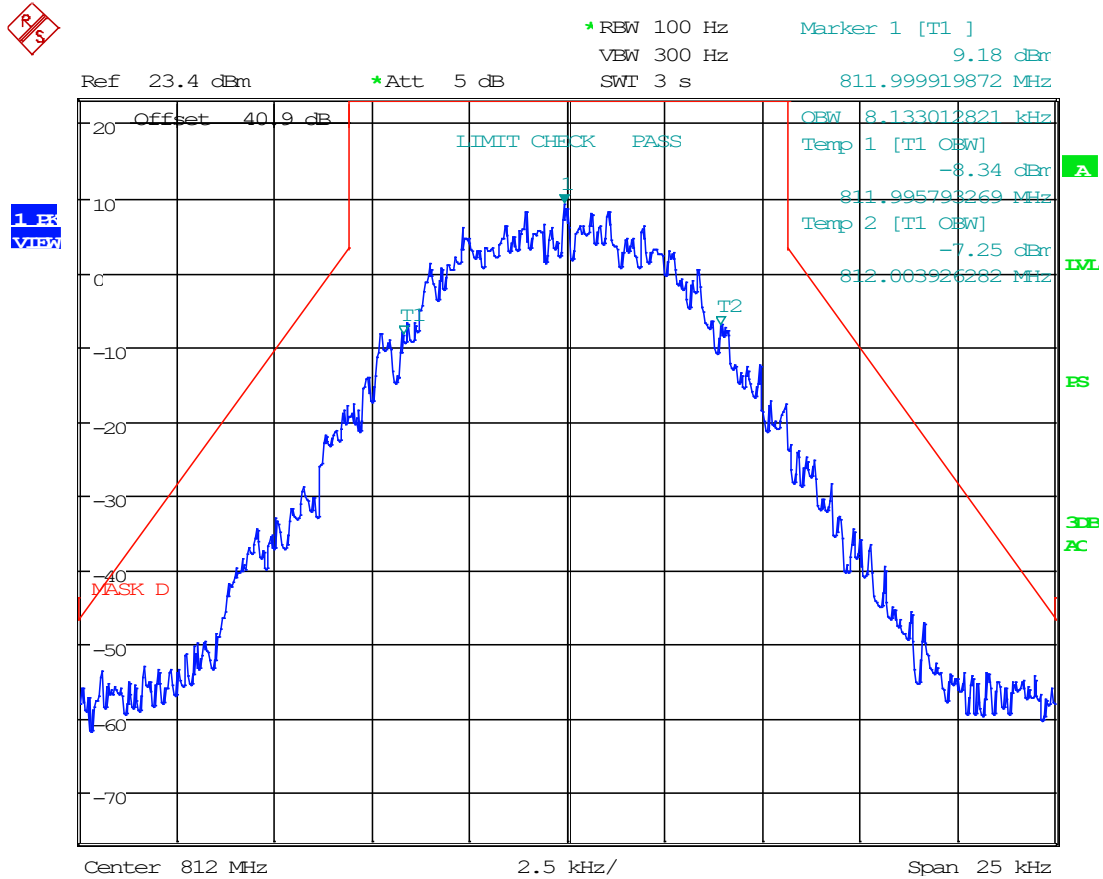

Date: 2.FEB.2023 15:33:51



### 8.5.65 H-DQPSK, UL Mask D, AGC, 812 MHz

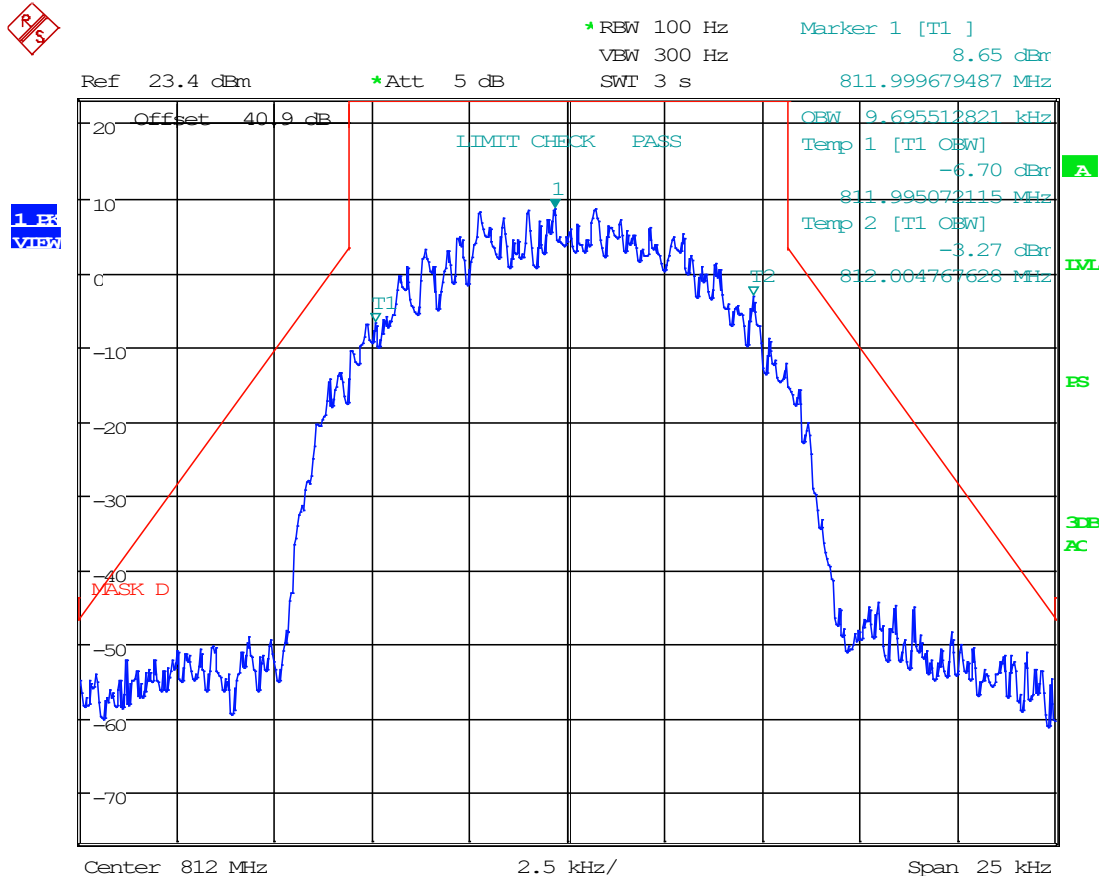


Date: 2.FEB.2023 15:32:03



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.5.66 H-DQPSK, UL Mask D, AGC+3, 812 MHz

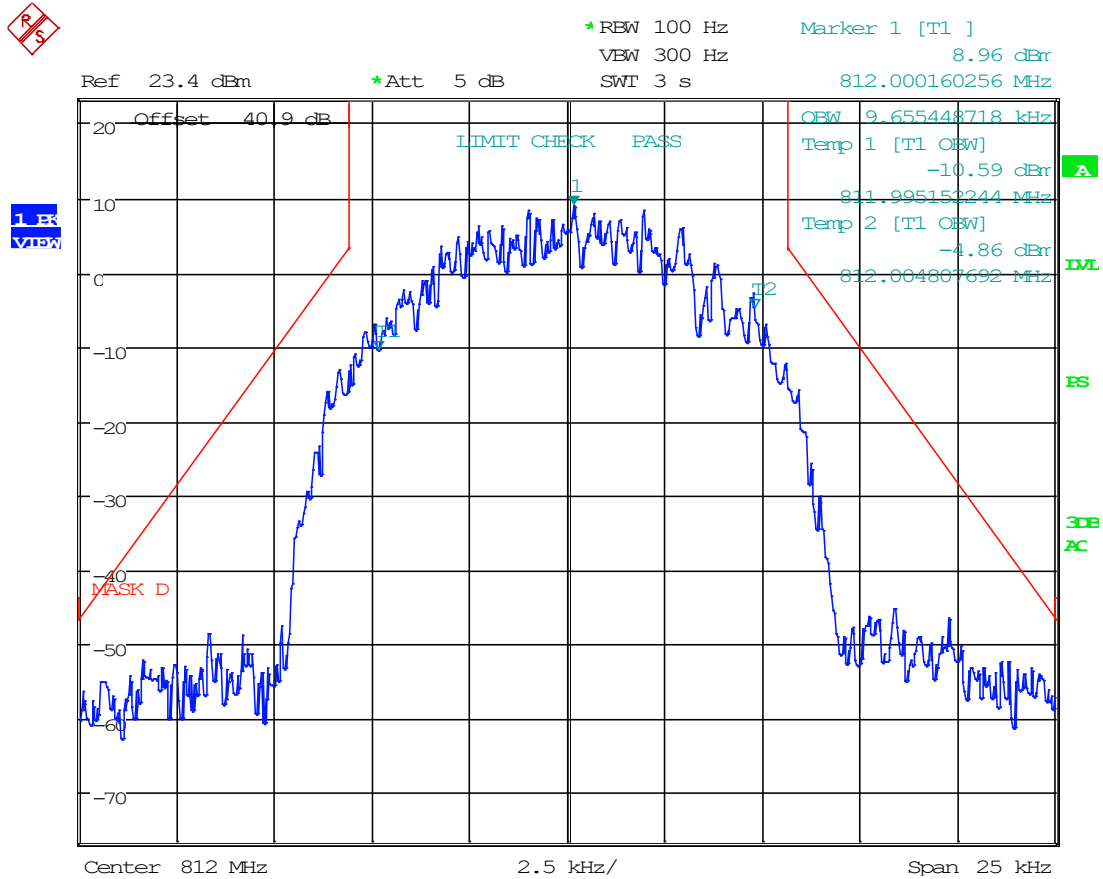


Date: 2.FEB.2023 15:34:35



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.5.67 6.25 kHz, FM, UL Mask E, AGC, 823.9875 MHz

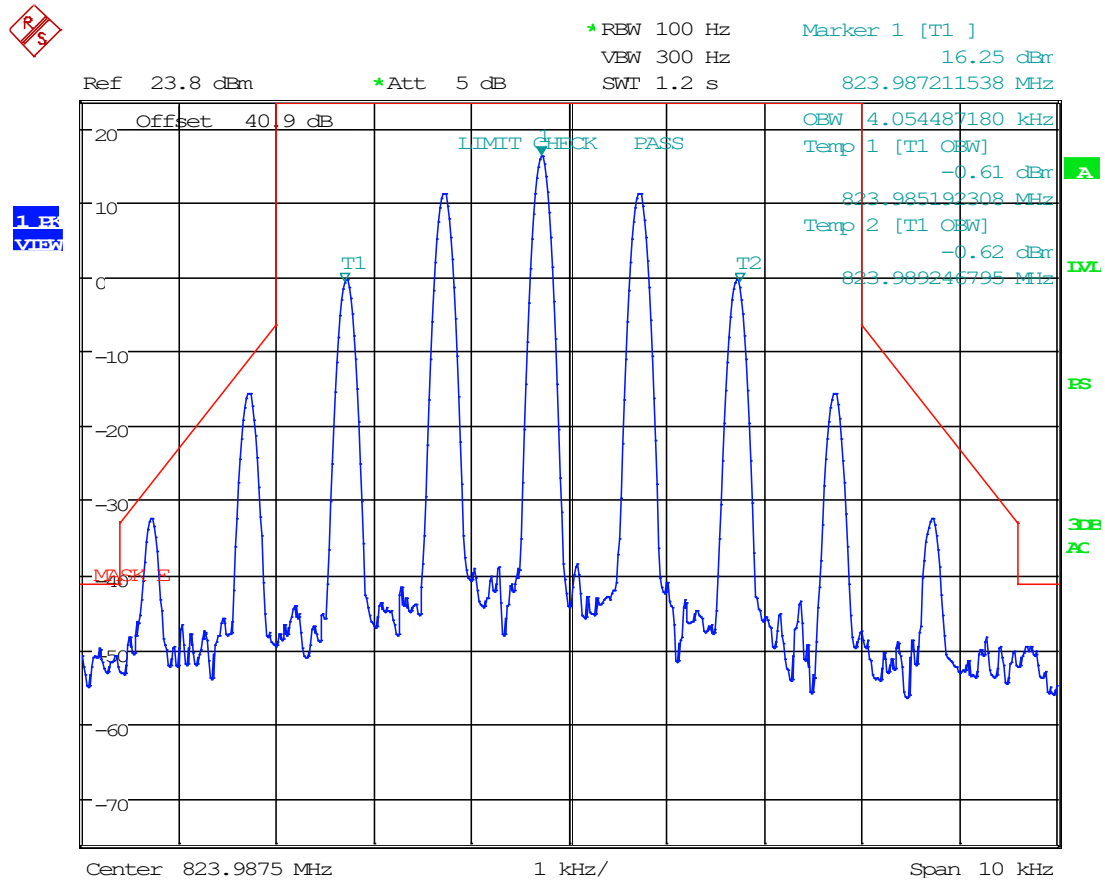


Date: 3.FEB.2023 08:45:21



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

8.5.68 6.25 kHz, FM, UL Mask E, AGC+3, 823.9875 MHz

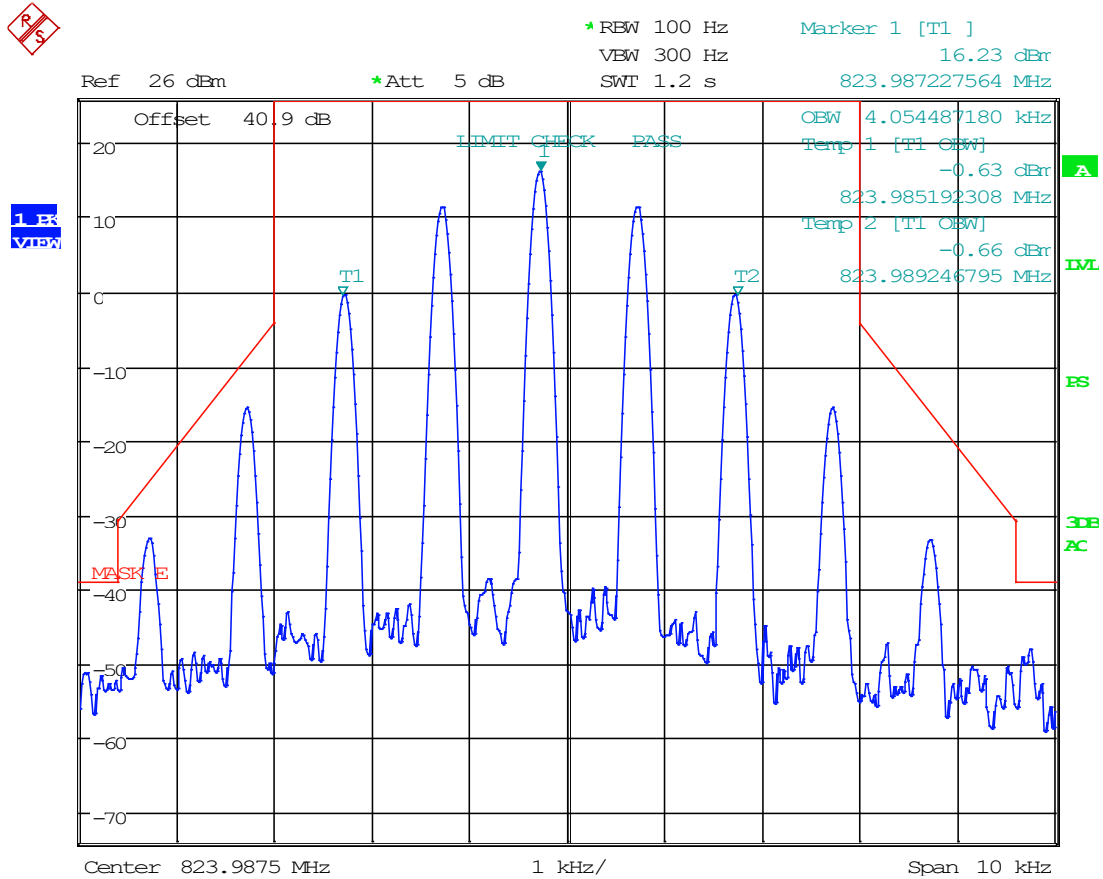


Date: 3.FEB.2023 08:46:43



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.5.69 12.5 kHz, FM, UL Mask D, AGC, 823.9875 MHz

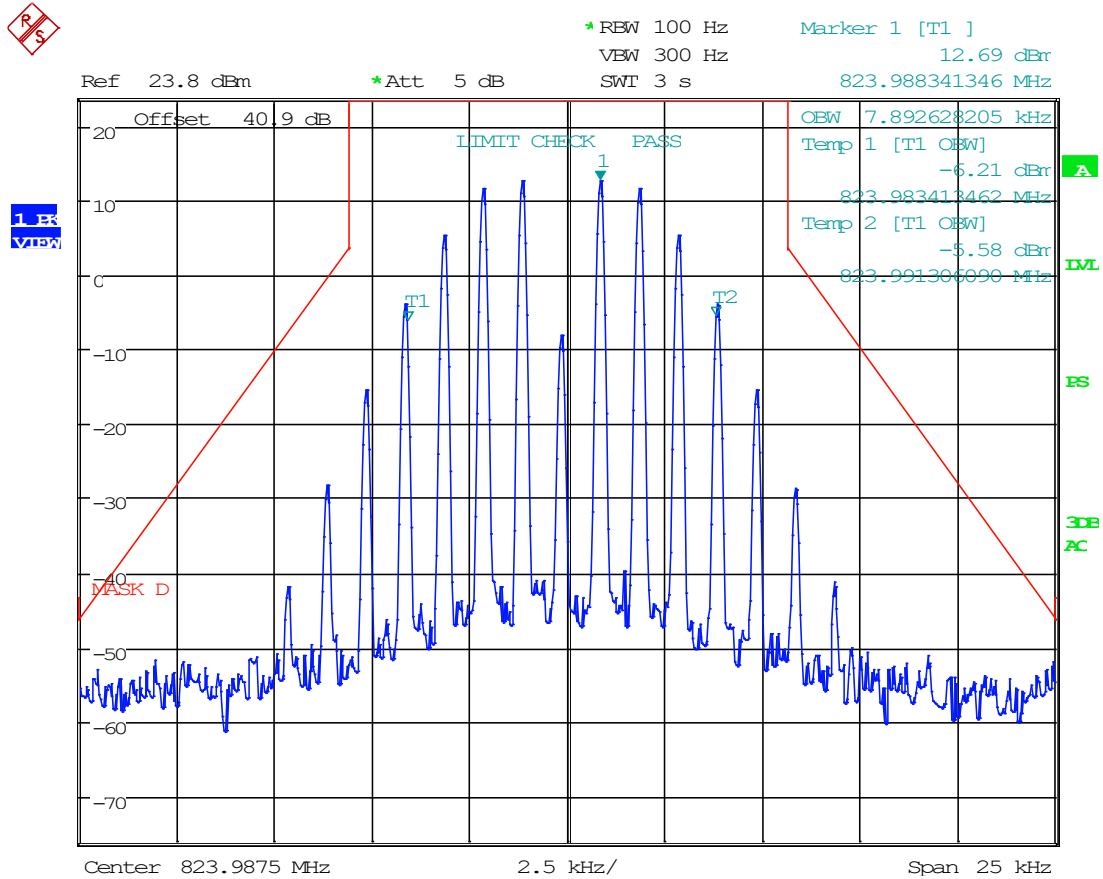


Date: 2.FEB.2023 15:15:06



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


8.5.70 12.5 kHz, FM, UL Mask D, AGC+3, 823.9875 MHz

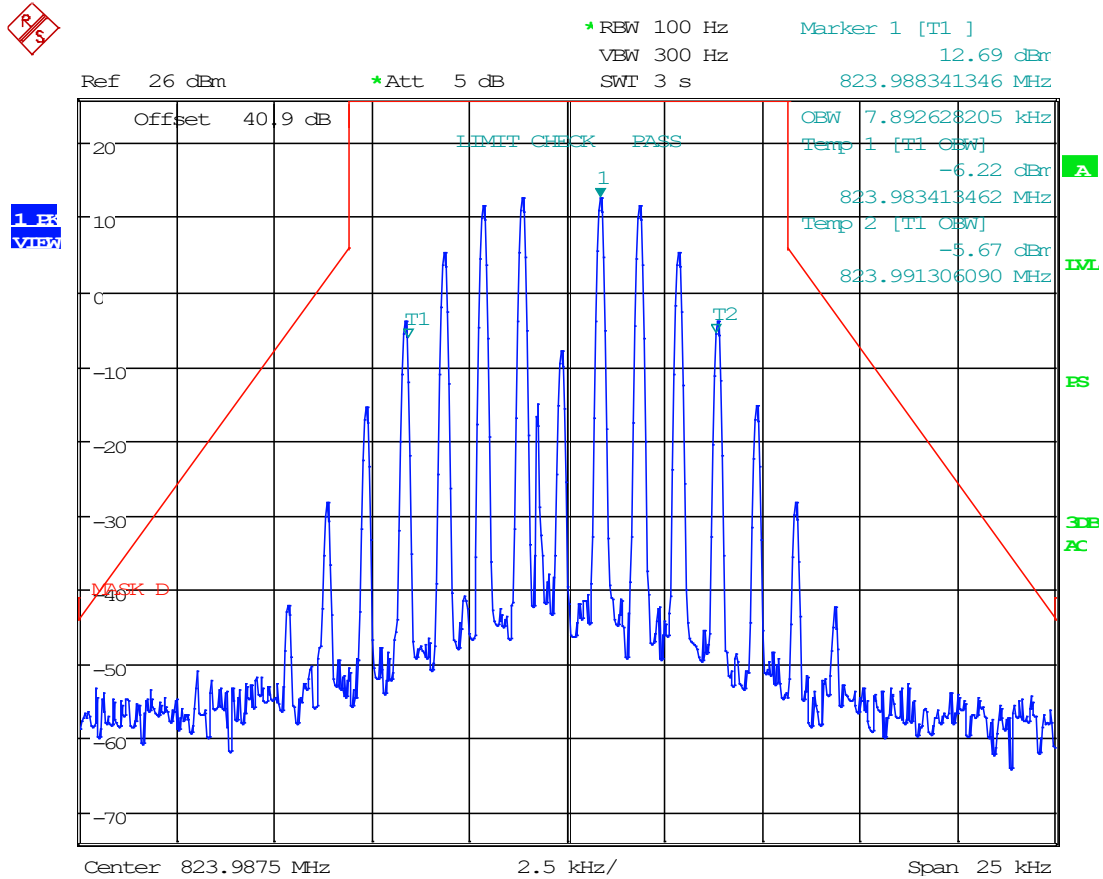

Date: 2.FEB.2023 15:16:30



8.5.71 25 kHz FM, UL Mask G, AGC, 823.9875 MHz

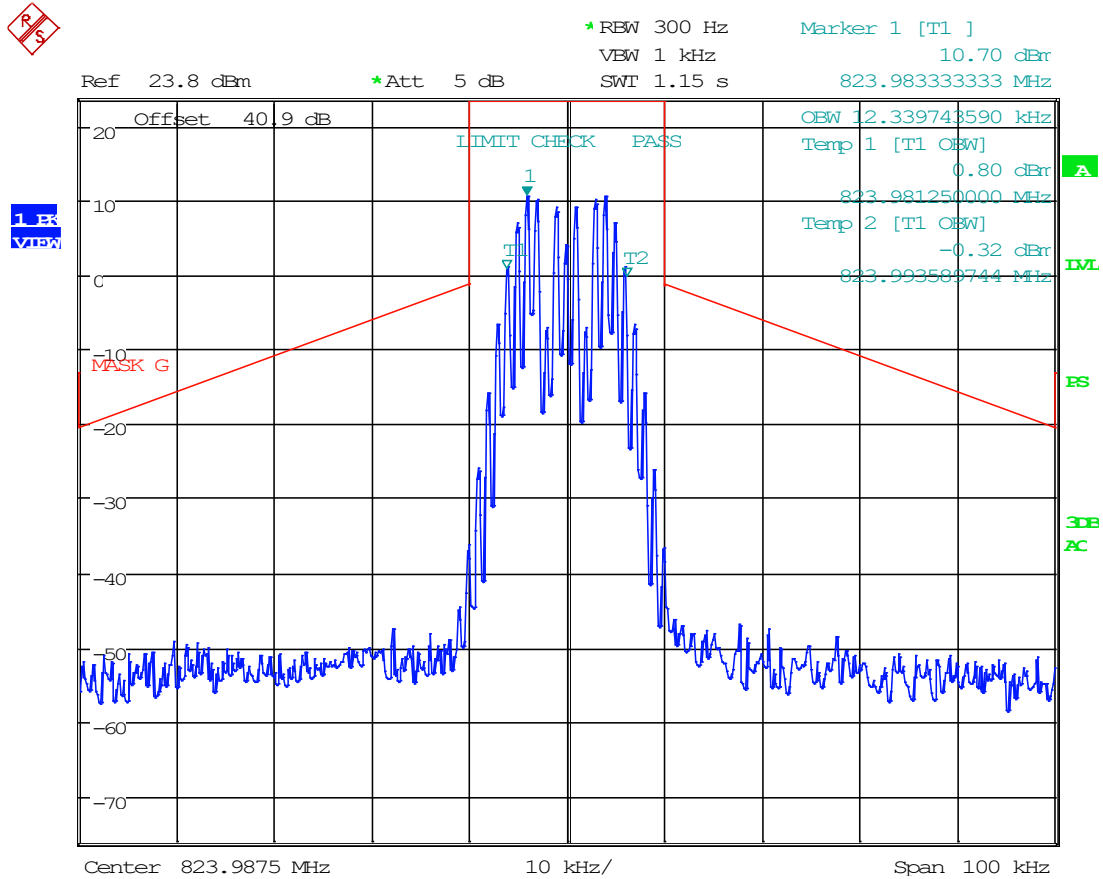


Date: 2.FEB.2023 17:10:18



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.5.72 25 kHz FM, UL Mask G, AGC+3, 823.9875 MHz

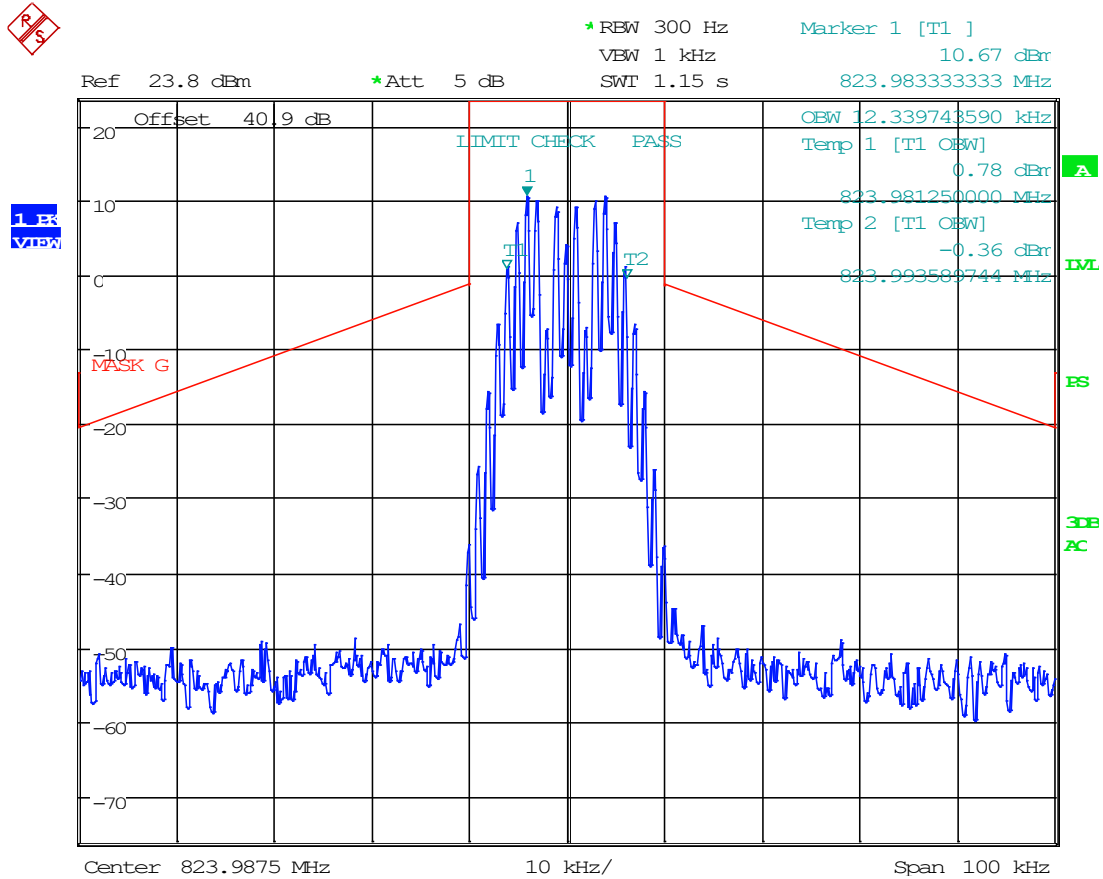

Date: 2.FEB.2023 17:11:28



### 8.5.73 C4FM, UL Mask D, AGC, 823.9875 MHz

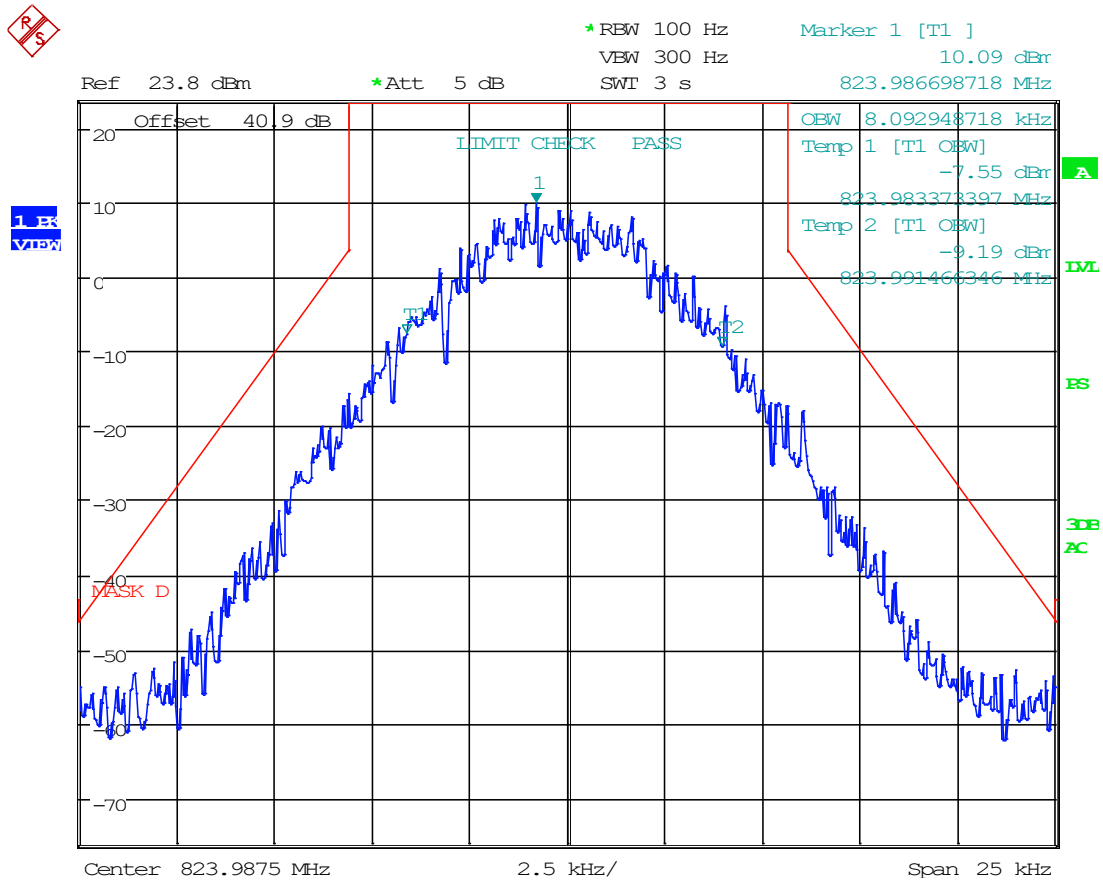


Date: 2.FEB.2023 15:41:59



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.5.74 C4FM, UL Mask D, AGC+3, 823.9875 MHz

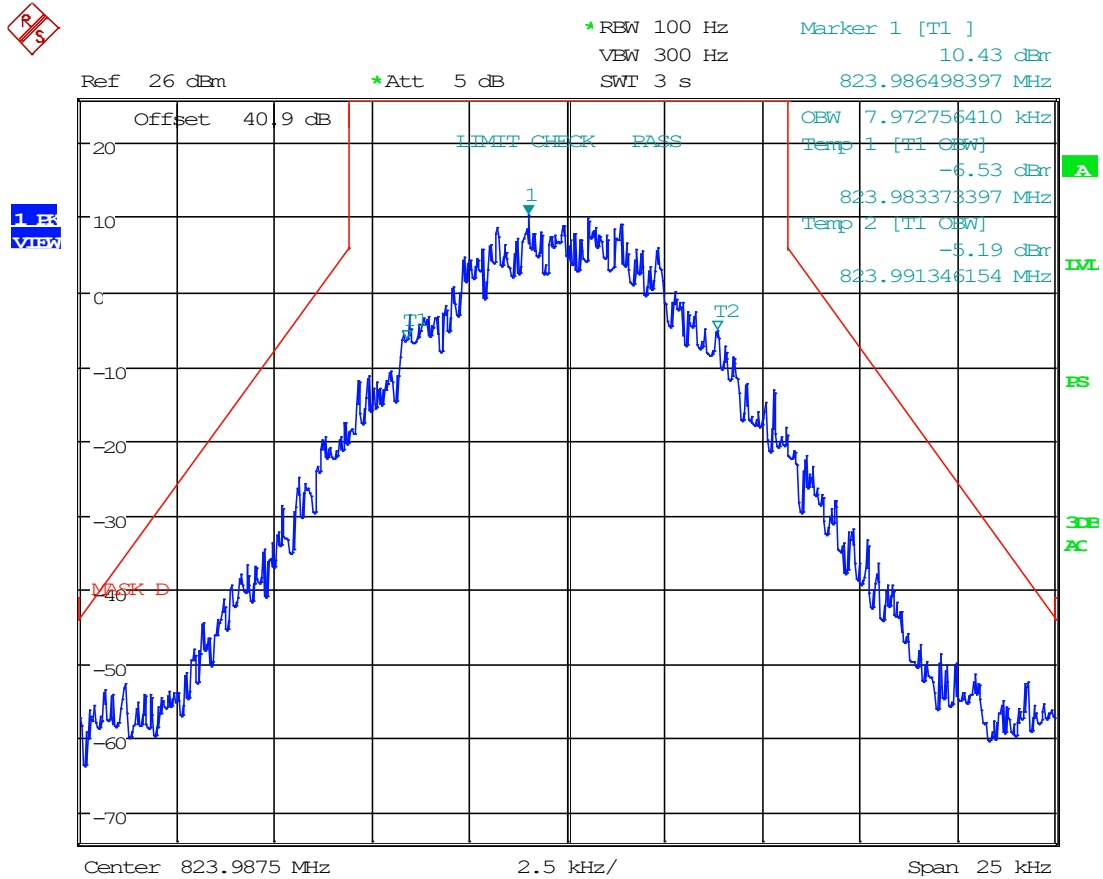

Date: 2.FEB.2023 15:45:33



### 8.5.75 H-CPM, UL Mask D, AGC, 823.9875 MHz

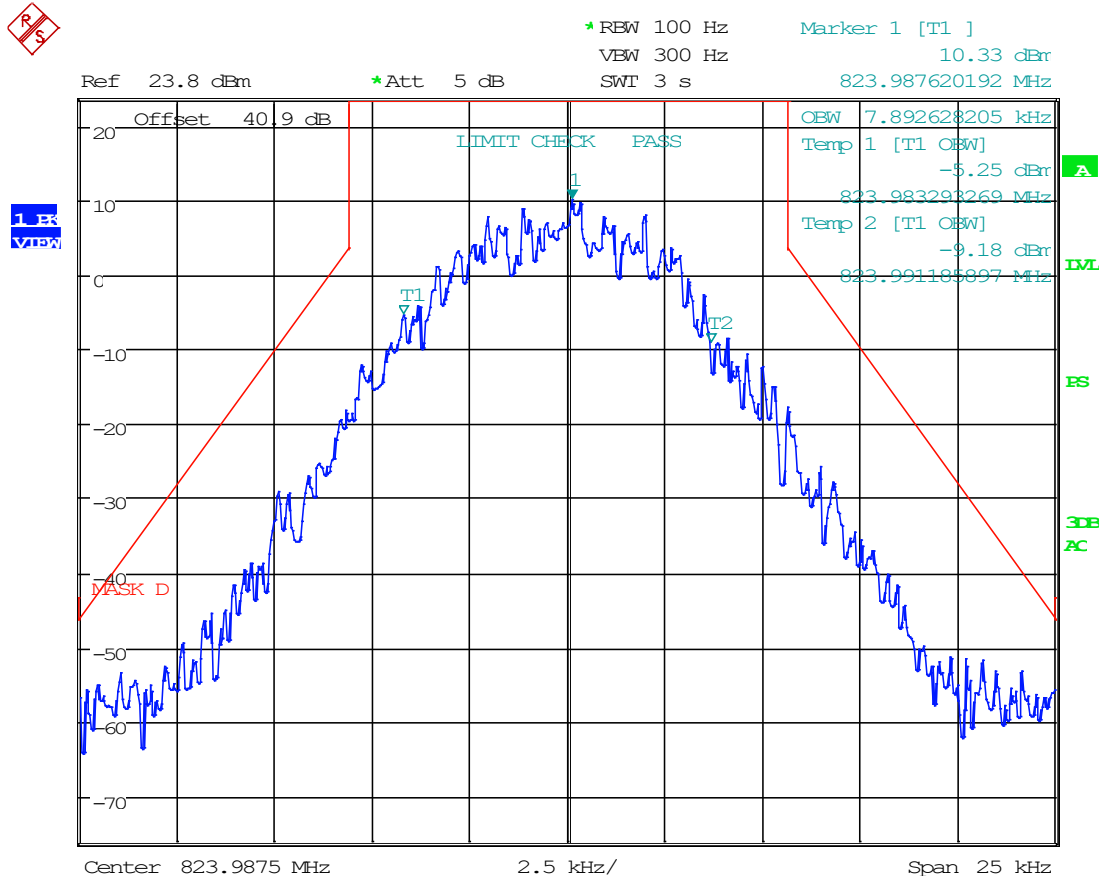


Date: 2.FEB.2023 15:43:17



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.5.76 H-CPM, UL Mask D, AGC+3, 823.9875 MHz

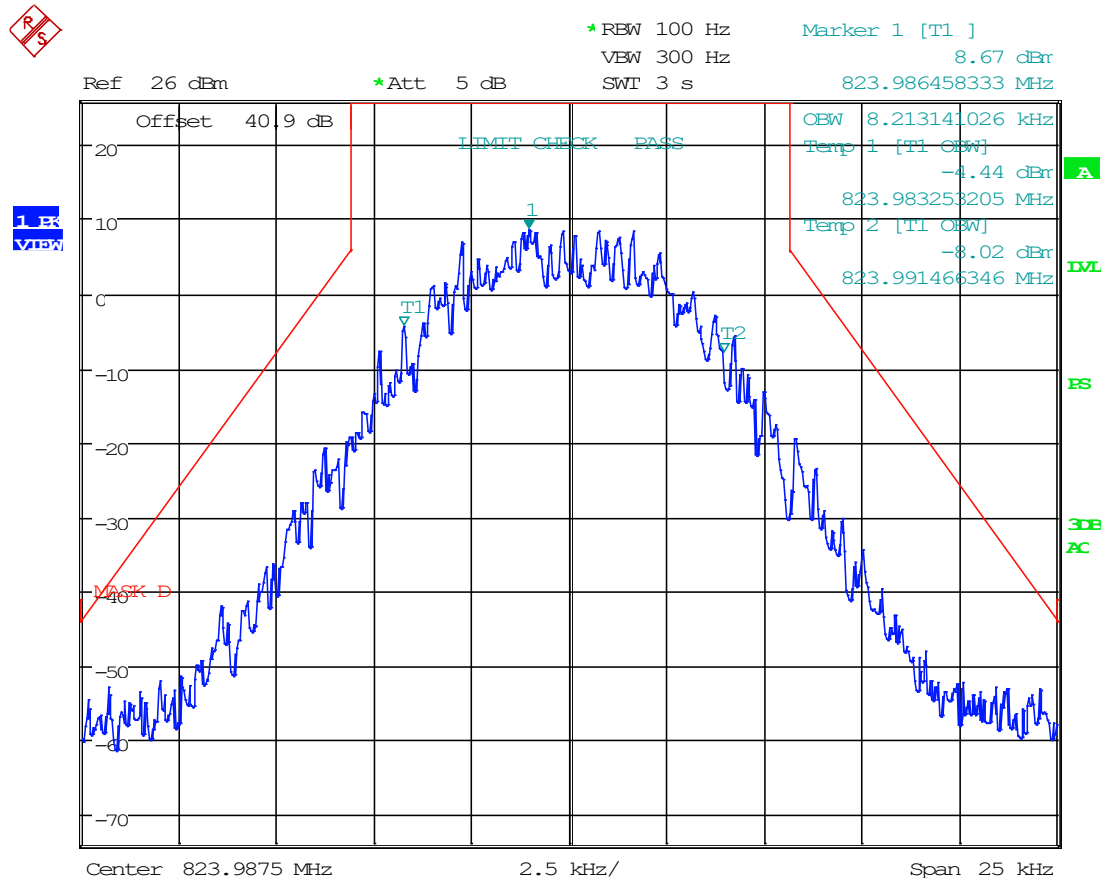

Date: 2.FEB.2023 15:47:08




### 8.5.77 H-DQPSK, UL Mask D, AGC, 823.9875 MHz

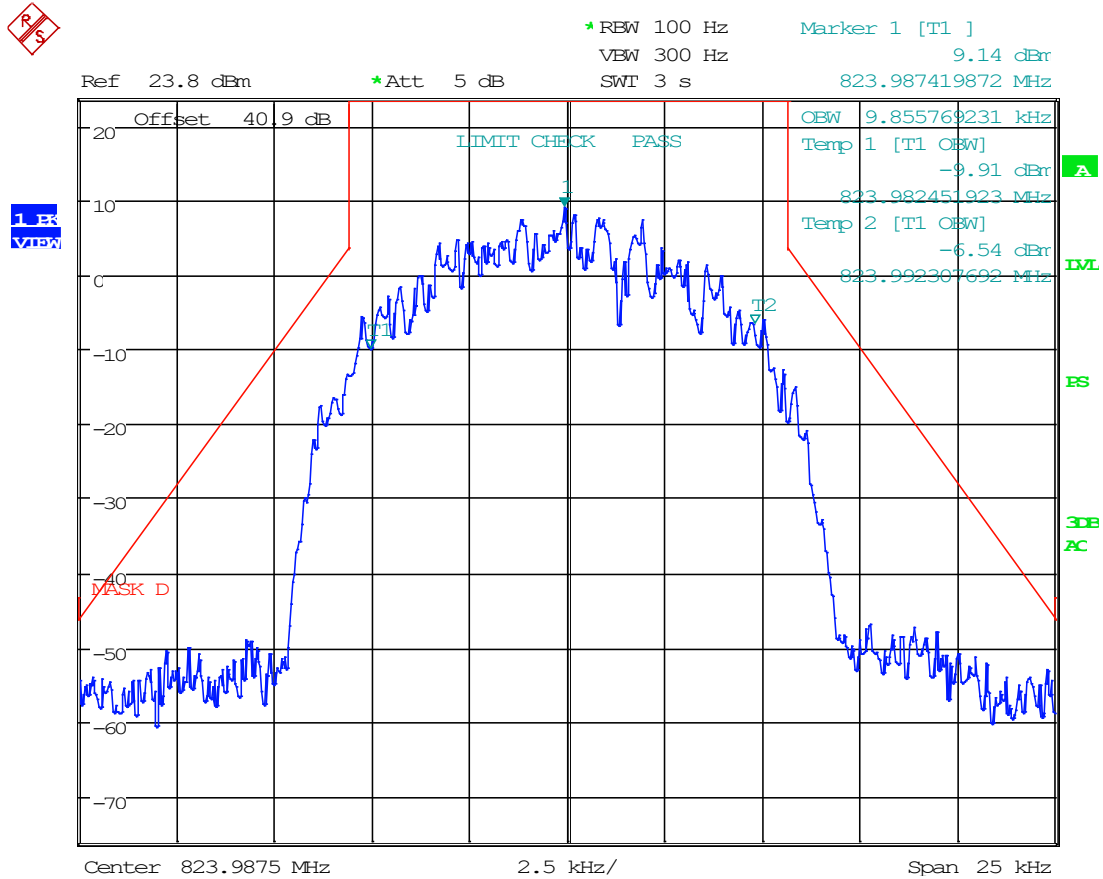

Date: 2.FEB.2023 15:44:05



### 8.5.78 H-DQPSK, UL Mask D, AGC+3, 823.9875 MHz

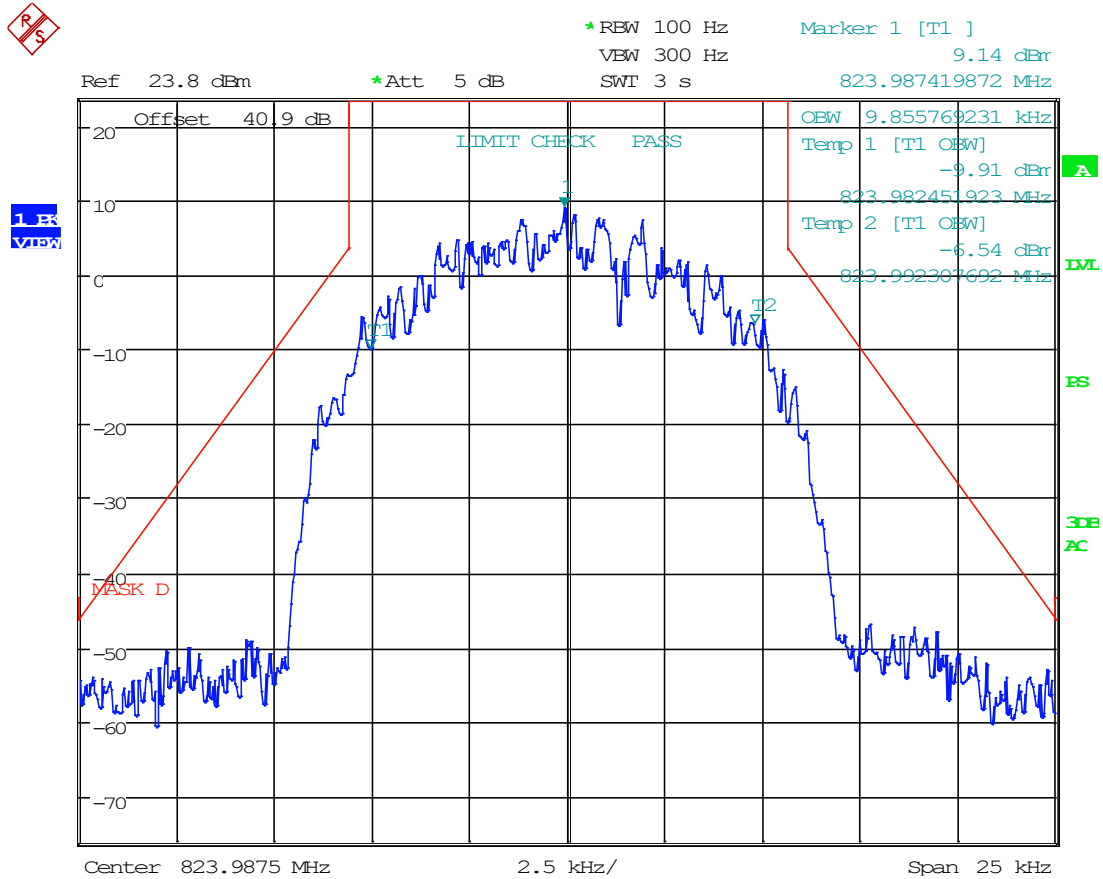


Date: 2.FEB.2023 15:44:05



## 8.6 Noise Figure

Referenced from test report "TR\_6057-23\_UL\_FCC 90\_Booster Class B\_1.docx".

Limits from FCC KDB 935210 D05 v01r04 Industrial Signal Boosters. Test method from "Noise Figure Measurement Accuracy: The Y-Factor Method" by Keysight Technologies.

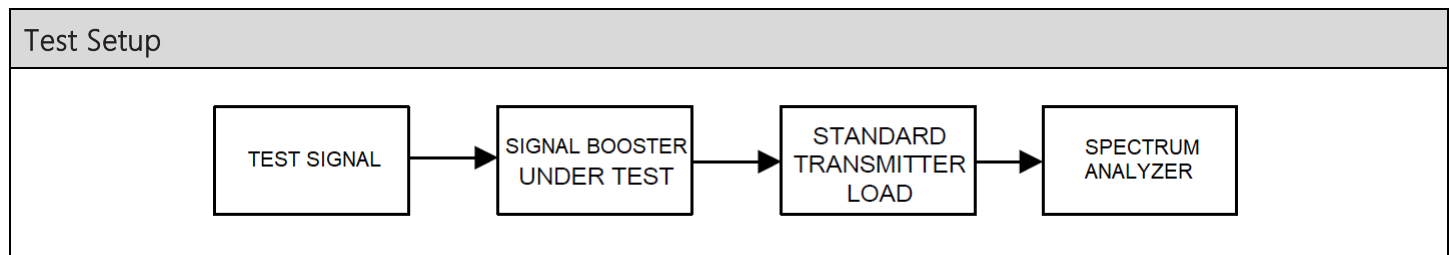


| Test Results, Out-of-band Rejection and Class of Operation |                |                   |            |
|------------------------------------------------------------|----------------|-------------------|------------|
| Operating Band (MHz)                                       | Link Direction | Noise Figure (dB) | Limit (dB) |
| 788- 805 MHz                                               | Uplink         | 8.83              | < 9 dB     |
| 806- 824 MHz                                               | Uplink         | 0.67              | < 9 dB     |



## 8.7 Out-of-Band/Out-of-Block Emissions (Intermodulation Products)

*Referenced from test report "TR\_6057-23\_UL\_FCC 90\_Booster Class B\_1.docx".*


Limits from FCC Parts 2.1051, FCC Pt. 90.219(d)(6)(i), FCC Pt. 90.219(e)(3) and test procedure from ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

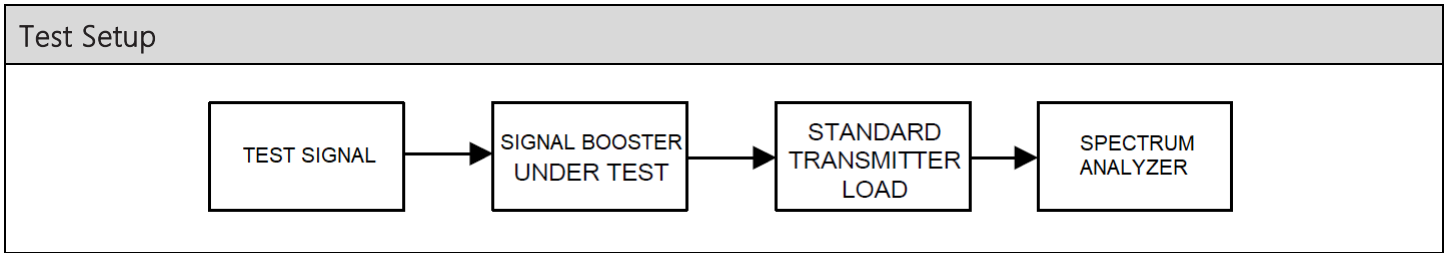



## Intermodulation Products Spectrum Plots


### 8.7.1 6.25 kHz Signal, Uplink, AGC, 788.0125 MHz

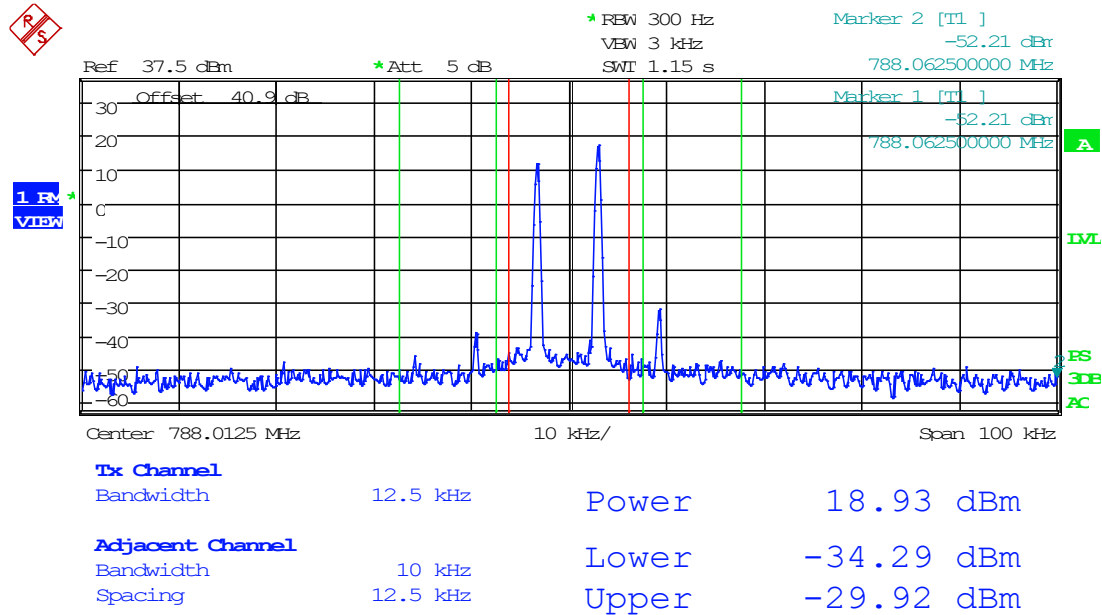

Date: 31.JAN.2023 15:17:24



### 8.7.2 6.25 kHz Signal, Uplink, AGC+3dB, 788.0125 MHz

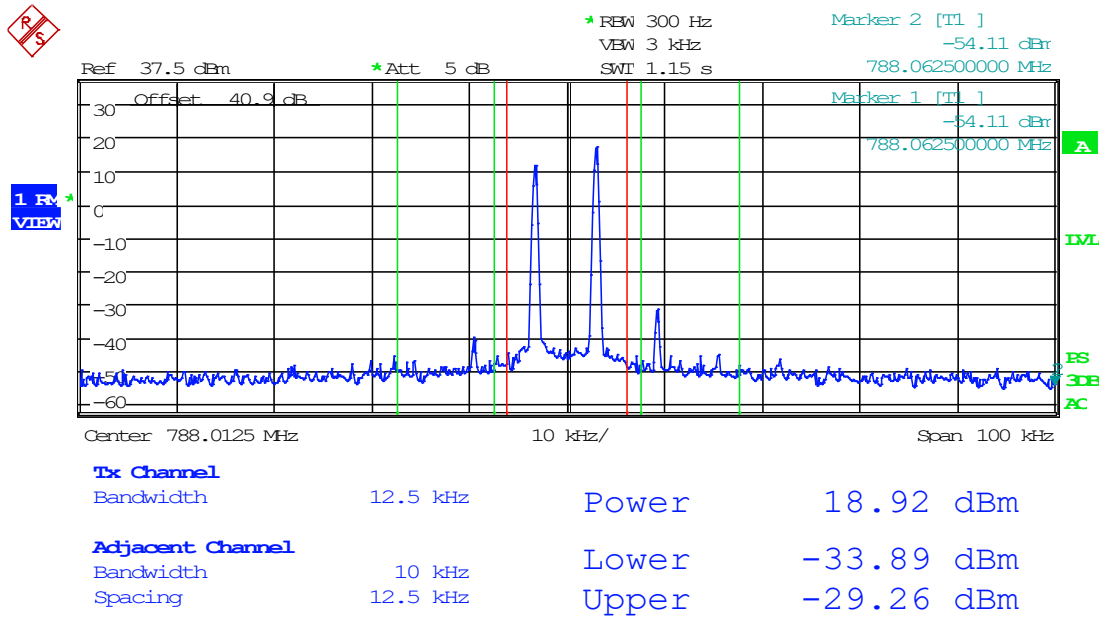


Date: 31.JAN.2023 15:19:24



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.7.3 12.5 kHz Signal, Uplink, AGC, 788.0125 MHz

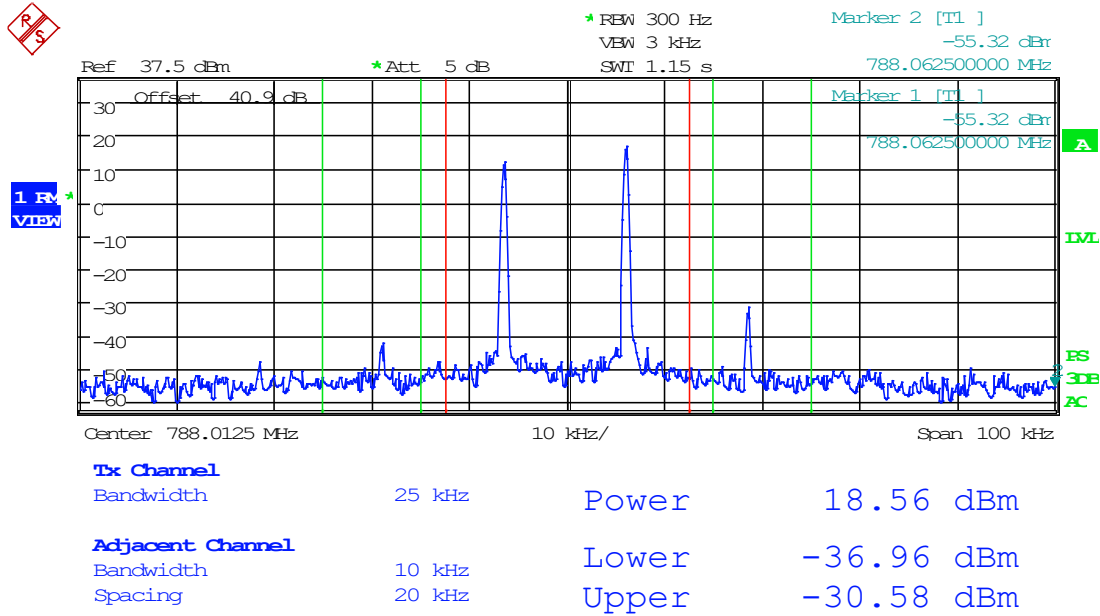

Date: 1.FEB.2023 07:47:46



#### 8.7.4 12.5 kHz Signal, Uplink, AGC+3dB, 788.0125 MHz

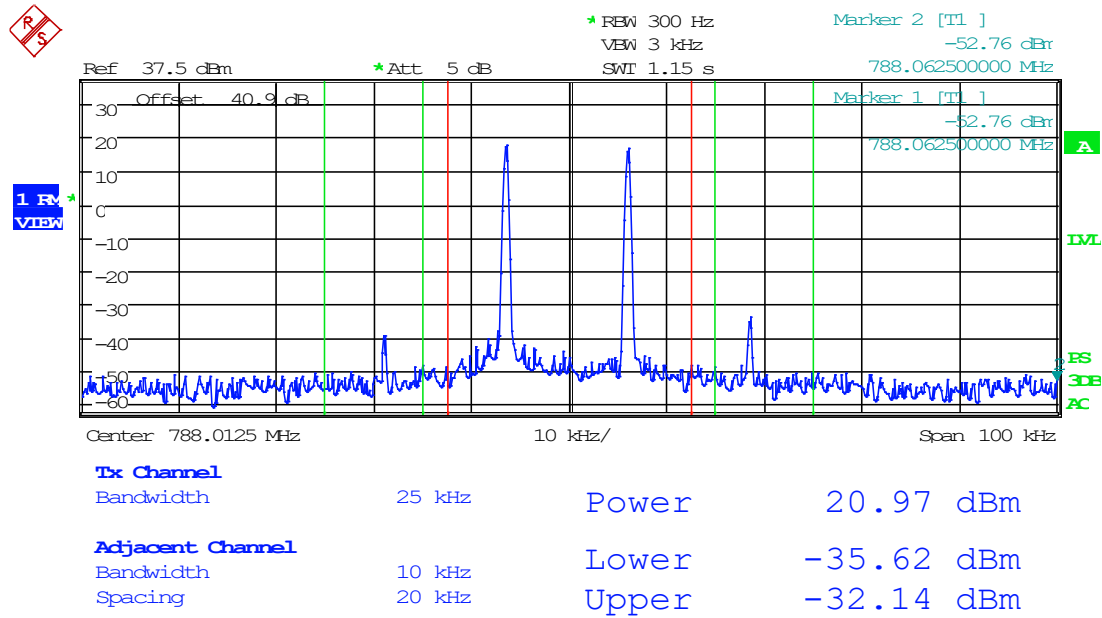

Date: 1.FEB.2023 07:51:32



Ref 37.5 dBm \*Att 5 dB SWI 1.15 s 788.062500000 MHz

Offset 40.9 dB Marker 1 [T1] -53.84 dBm 788.062500000 MHz

1 RM VIEW

Center 788.0125 MHz 10 kHz/ Span 100 kHz


**Tx Channel**  
 Bandwidth 50 kHz Power 20.83 dBm

**Adjacent Channel**  
 Bandwidth 10 kHz Lower -36.41 dBm  
 Spacing 40 kHz Upper -32.25 dBm

Page 110 of 167




### 8.7.6 25 kHz Signal, Uplink, AGC+3dB, 788.0125 MHz

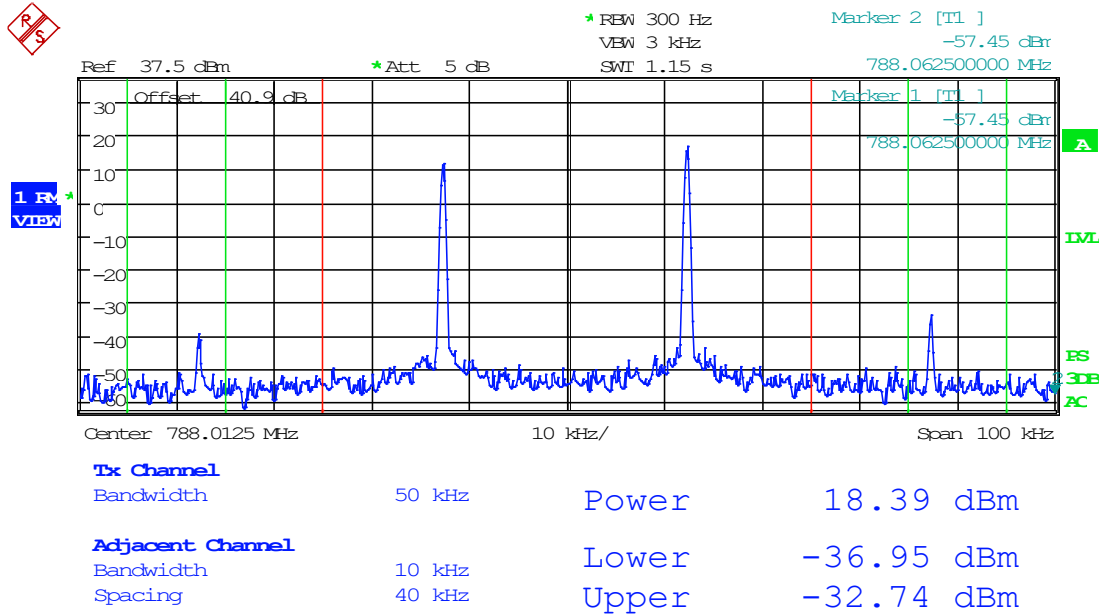

Date: 1.FEB.2023 08:33:38




### 8.7.7 6.25 kHz Signal, Uplink, AGC, 796 MHz

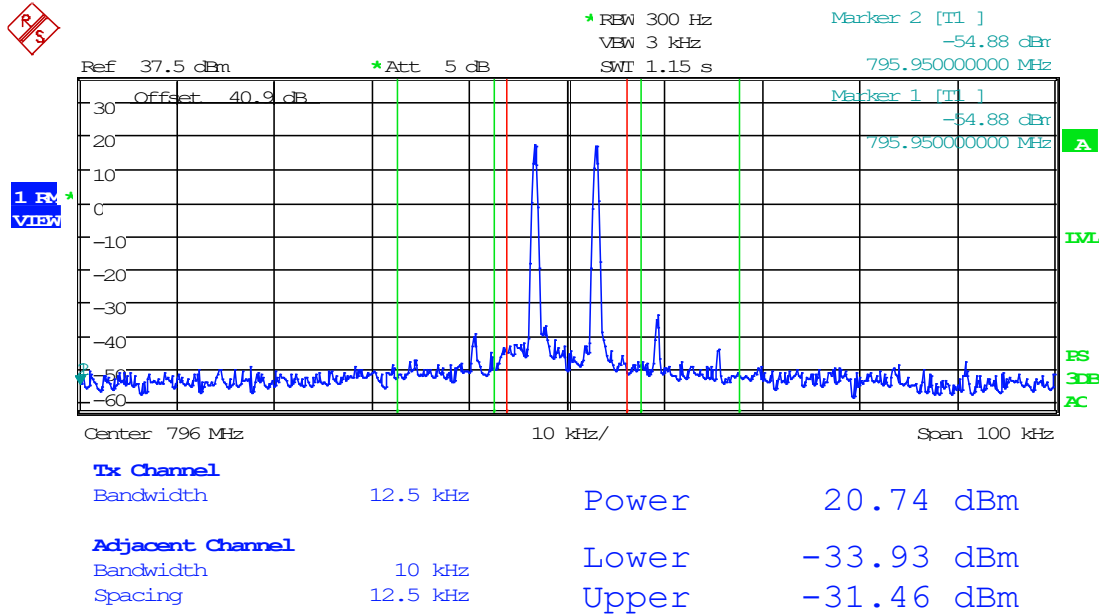

Date: 31.JAN.2023 15:40:24



### 8.7.8 6.25 kHz Signal, Uplink, AGC+3dB, 796 MHz

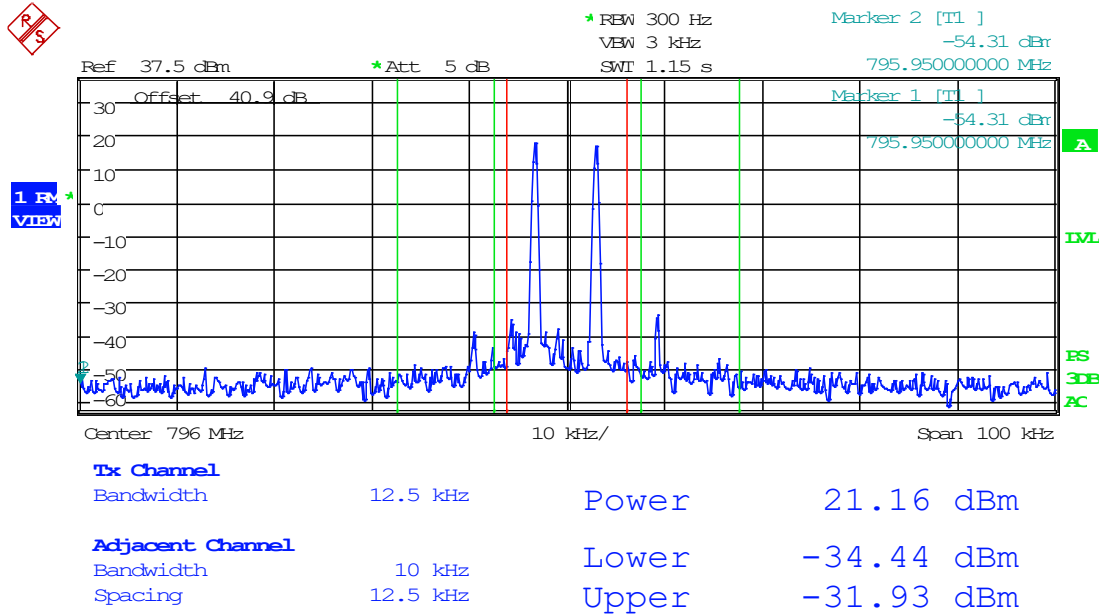


Date: 31.JAN.2023 15:43:01



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.7.9 12.5 kHz Signal, Uplink, AGC, 796 MHz

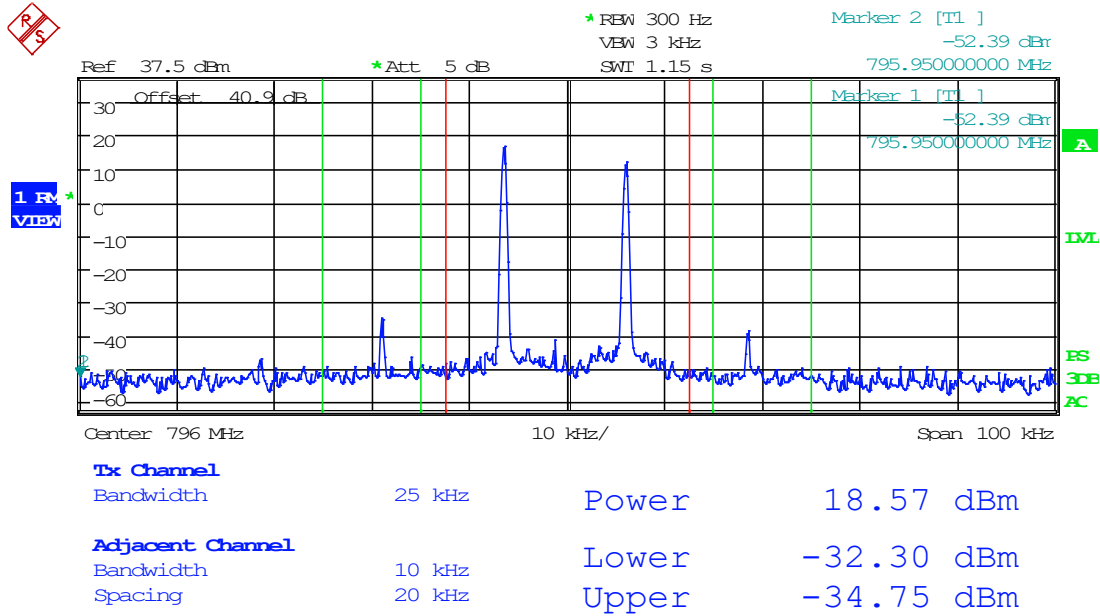

Date: 1.FEB.2023 07:53:35




### 8.7.10 12.5 kHz Signal, Uplink, AGC+3dB, 796 MHz

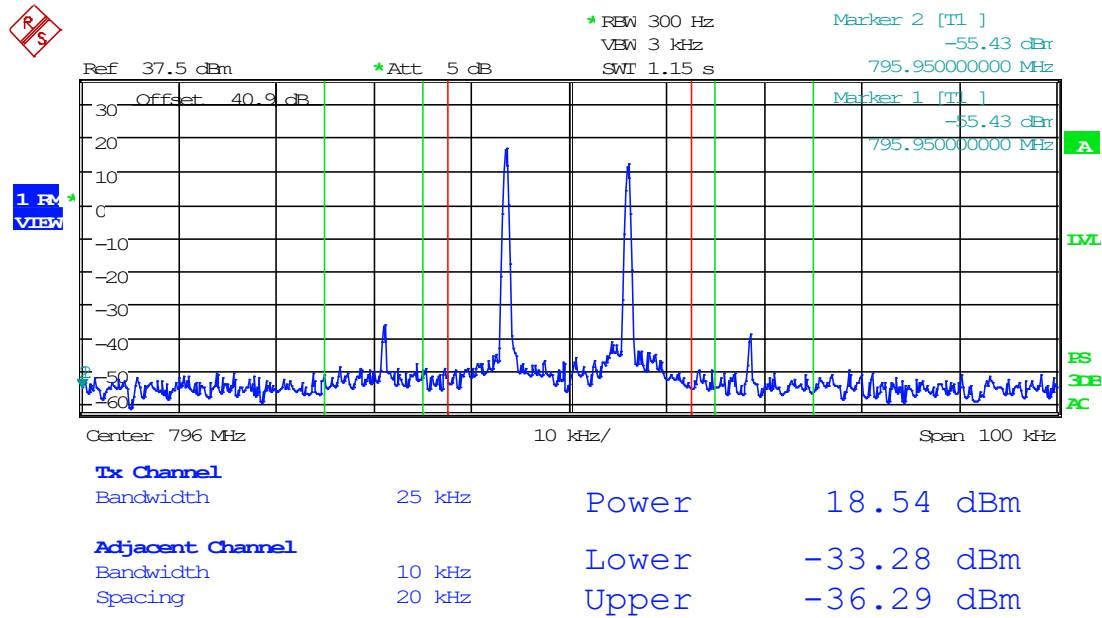

Date: 1.FEB.2023 07:55:39




### 8.7.11 25 kHz Signal, Uplink, AGC, 796 MHz

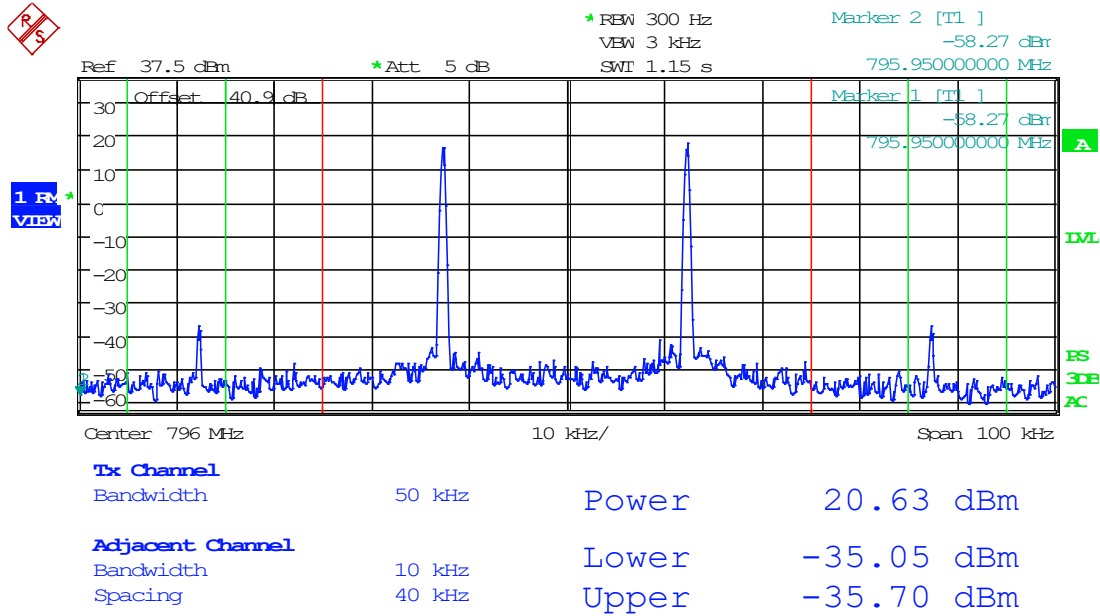

Date: 1.FEB.2023 08:35:03




### 8.7.12 25 kHz Signal, Uplink, AGC+3dB, 796 MHz

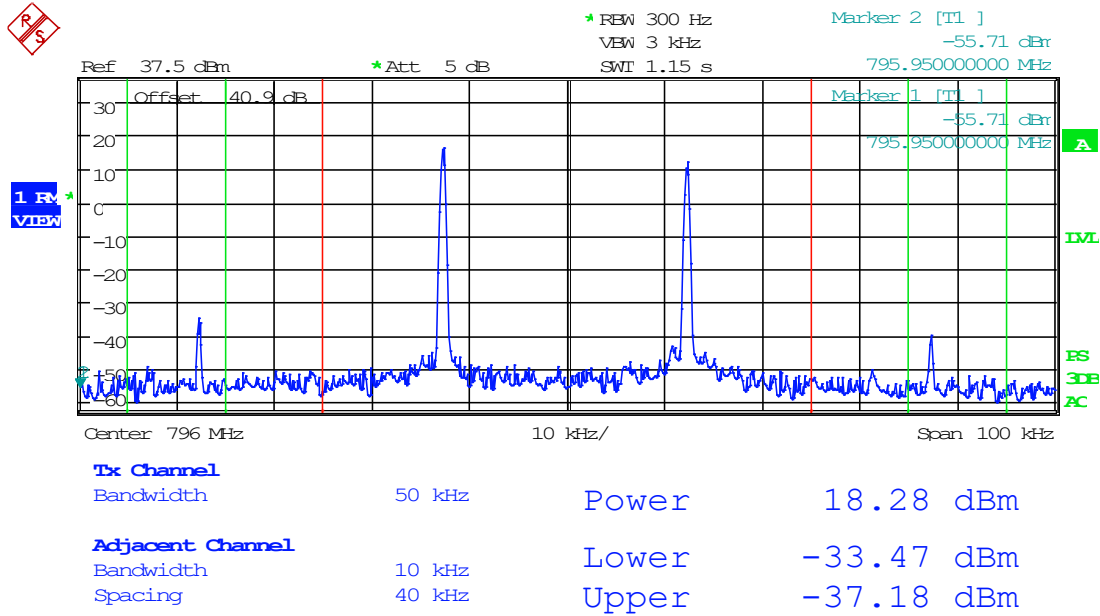

Date: 1.FEB.2023 08:35:44



### 8.7.13 6.25 kHz Signal, Uplink, AGC, 804.9875 MHz

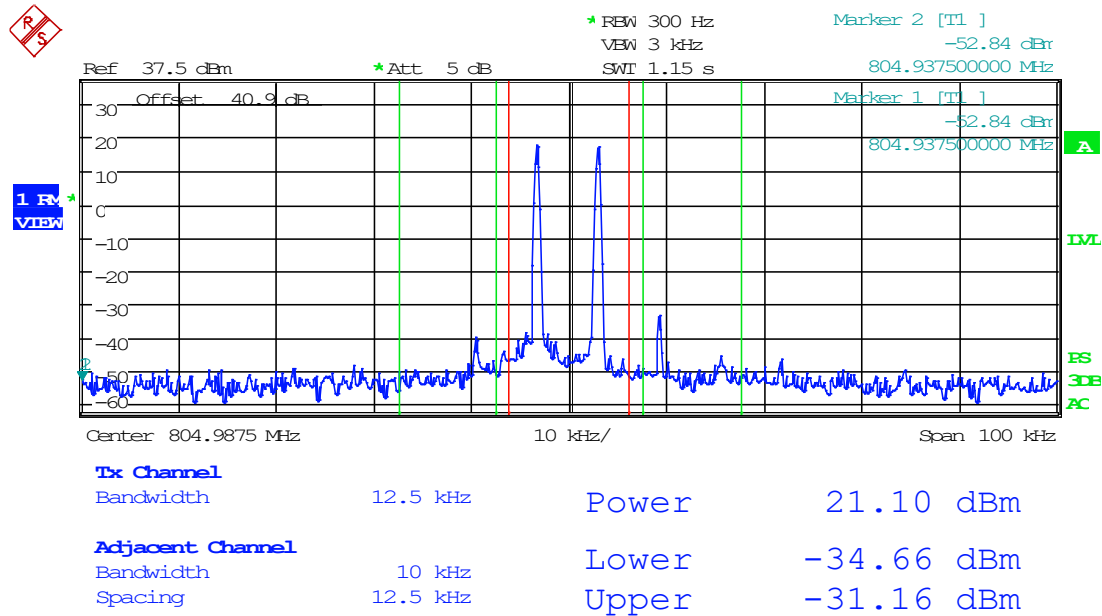


Date: 31.JAN.2023 15:46:42



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.7.14 6.25 kHz Signal, Uplink, AGC+3dB, 804.9875 MHz

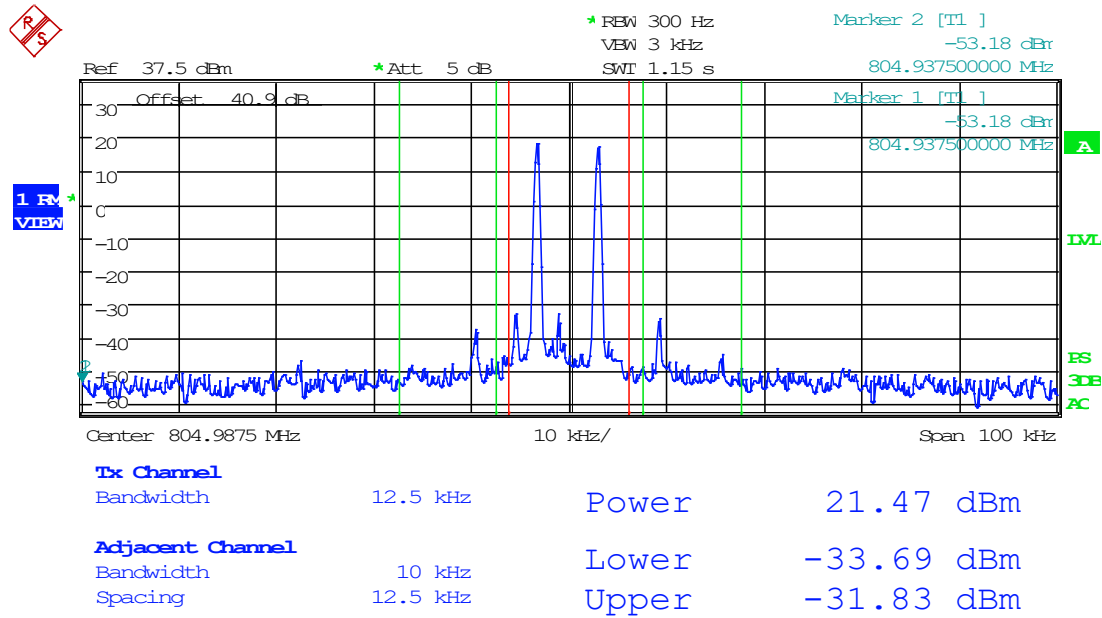


Date: 31.JAN.2023 15:49:47



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.7.15 12.5 kHz Signal, Uplink, AGC, 804.9875 MHz

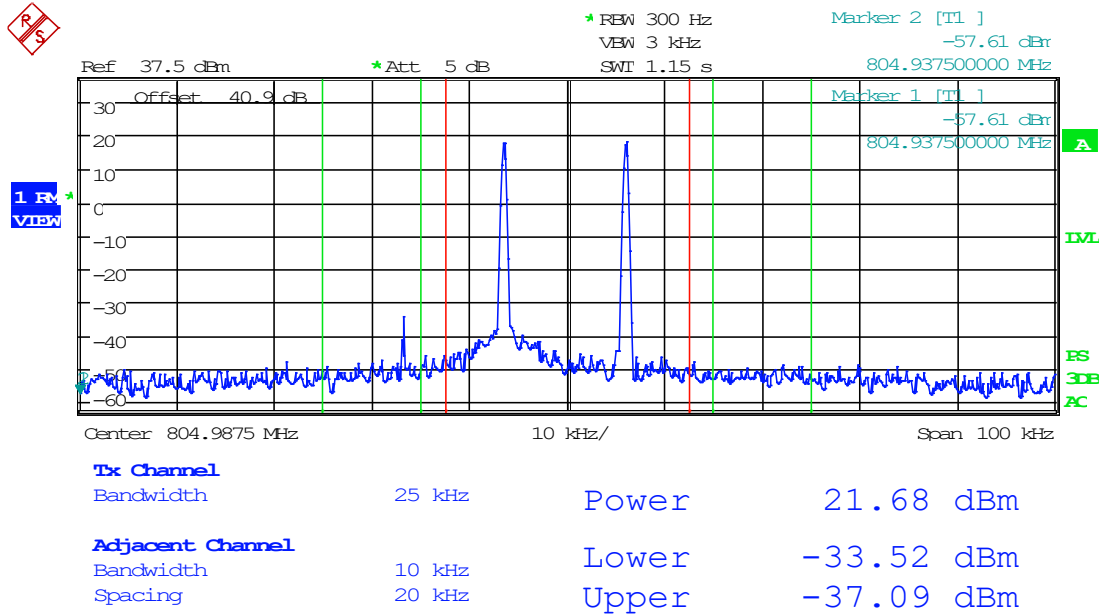


Date: 1.FEB.2023 08:00:16



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.7.16 12.5 kHz Signal, Uplink, AGC+3dB, 804.9875 MHz

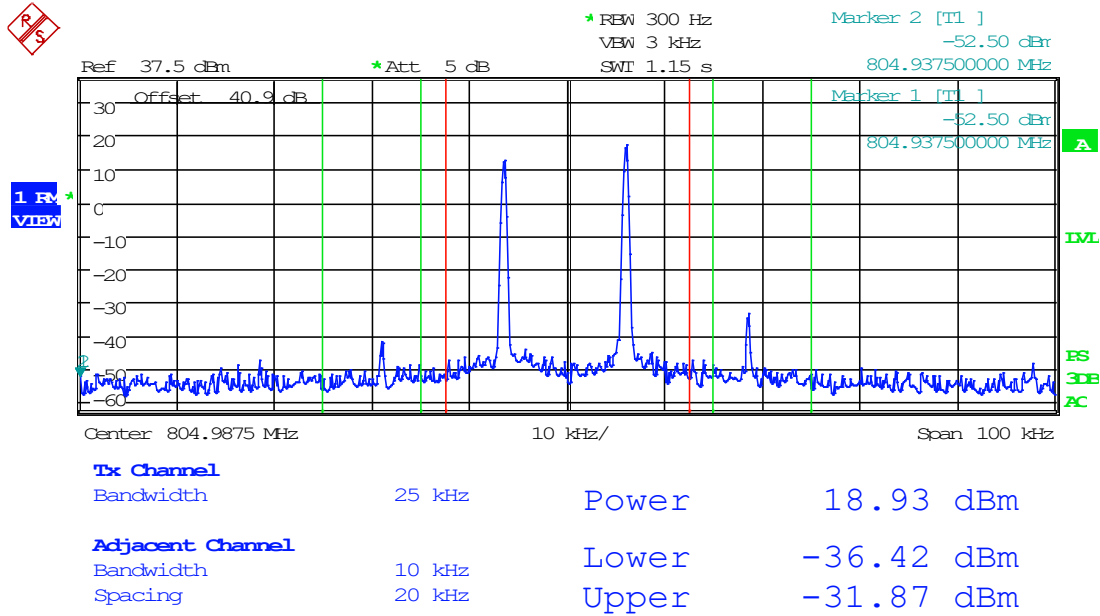

Date: 1.FEB.2023 08:01:13




### 8.7.17 25 kHz Signal, Uplink, AGC, 804.9875 MHz

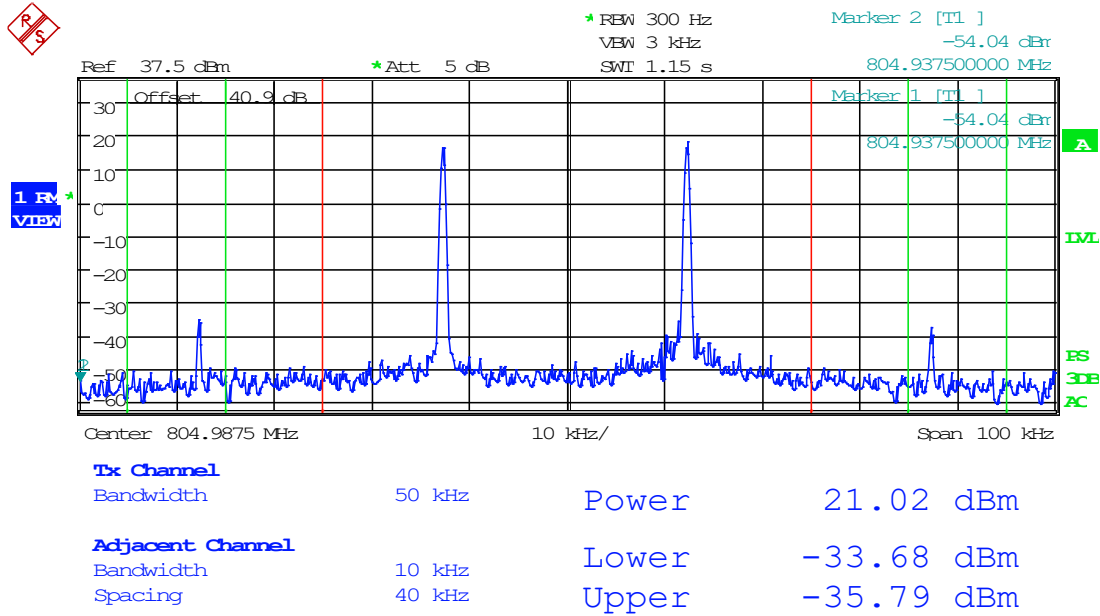

Date: 1.FEB.2023 08:37:20




### 8.7.18 25 kHz Signal, Uplink, AGC+3dB, 804.9875 MHz

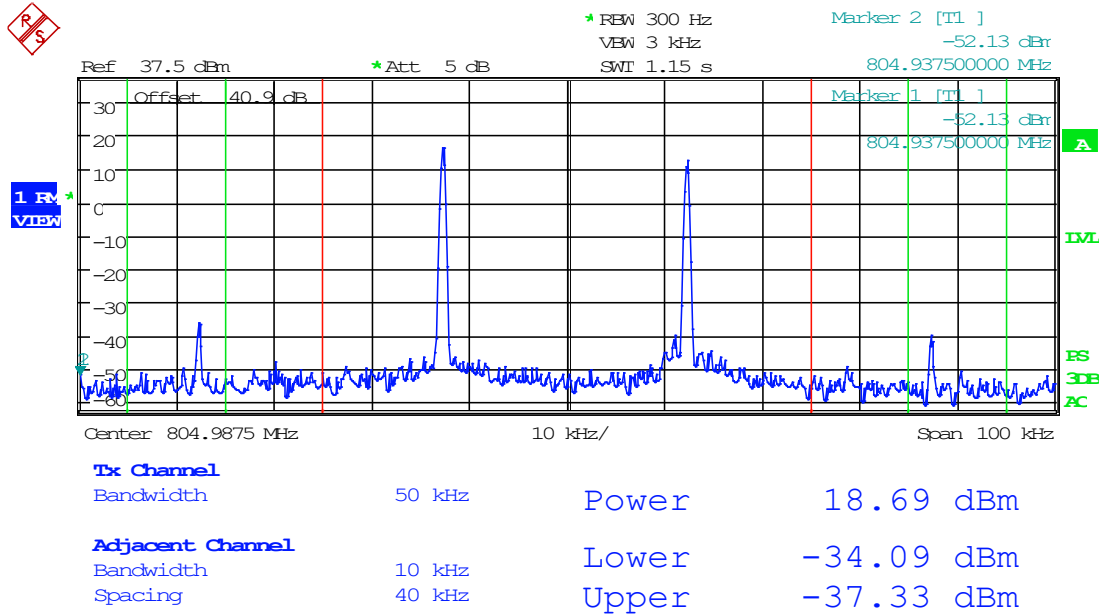

Date: 1.FEB.2023 08:37:59




### 8.7.19 6.25 kHz Signal, Uplink, AGC, 806.0125 MHz

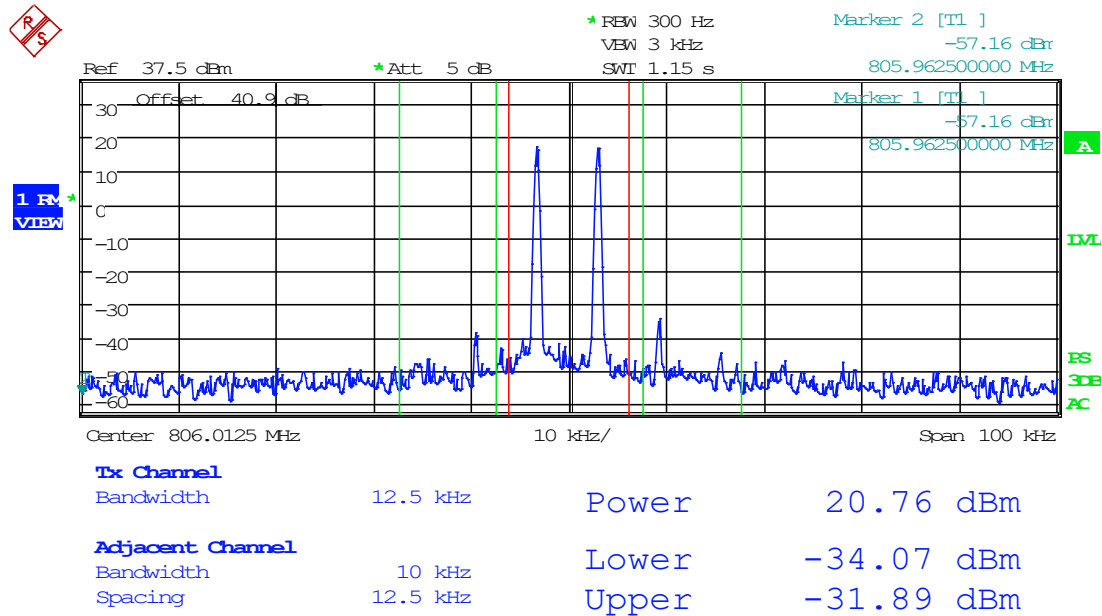

Date: 31.JAN.2023 15:51:48



### 8.7.20 6.25 kHz Signal, Uplink, AGC+3dB, 806.0125 MHz

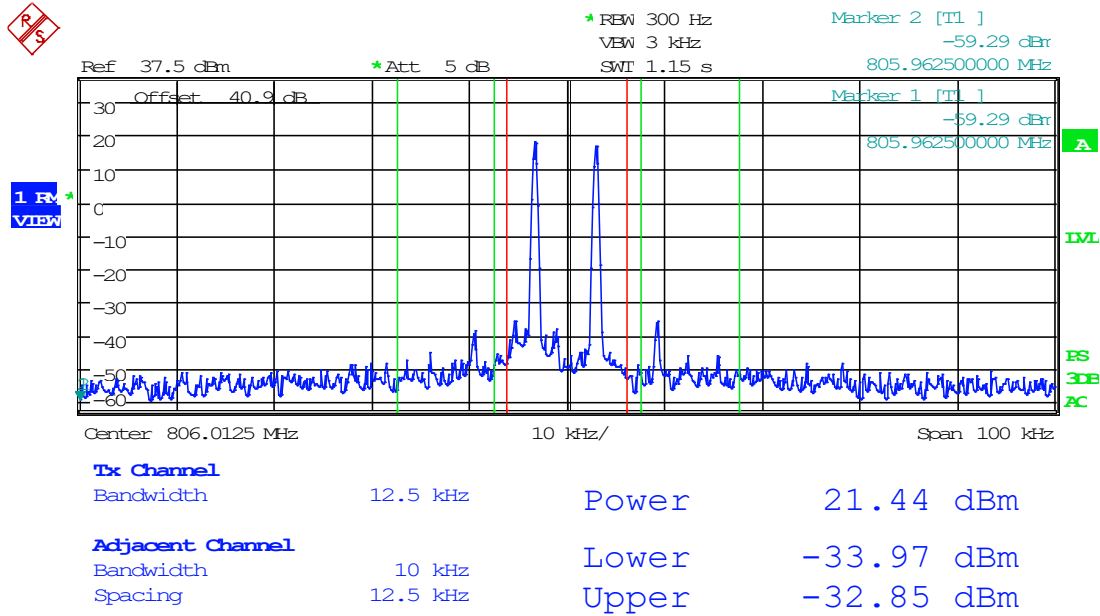


Date: 31.JAN.2023 15:52:53



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.7.21 12.5 kHz Signal, Uplink, AGC, 806.0125 MHz

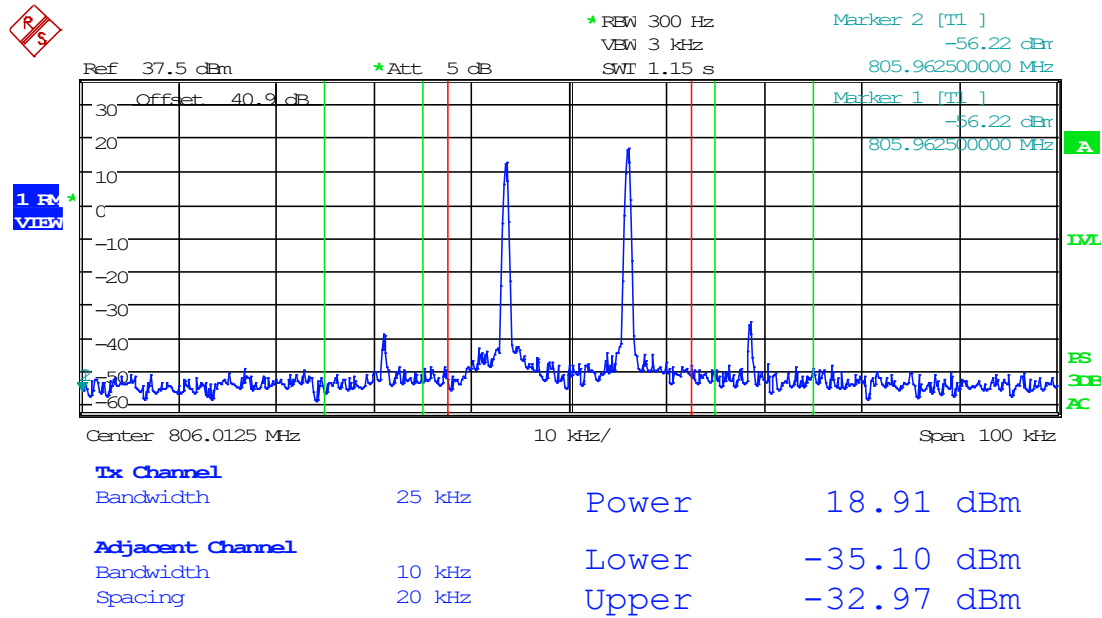

Date: 1.FEB.2023 08:02:48



### 8.7.22 12.5 kHz Signal, Uplink, AGC+3dB, 806.0125 MHz

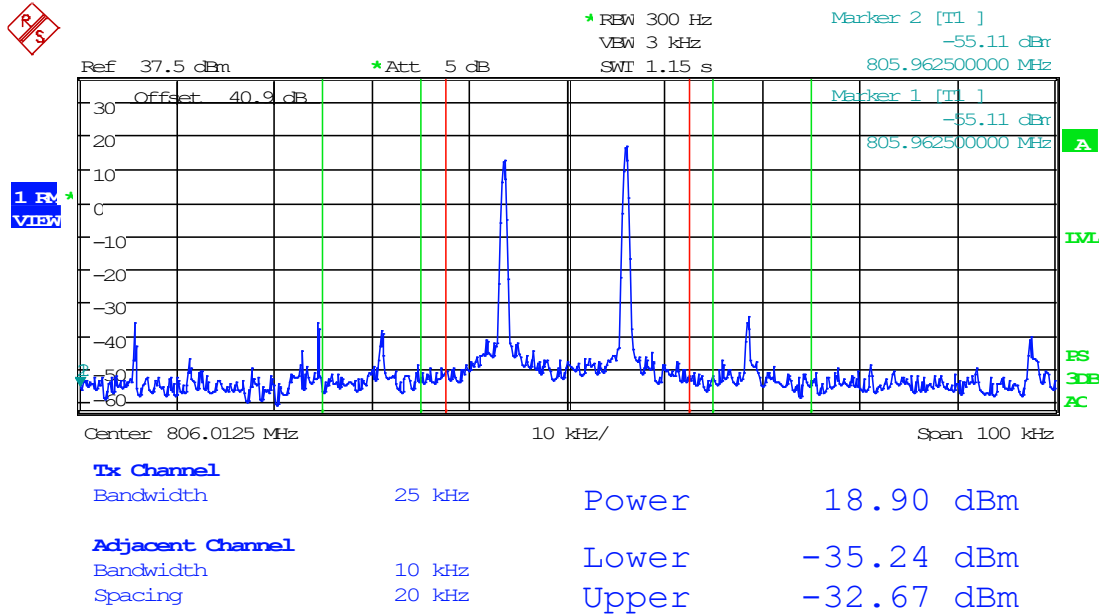


Date: 1.FEB.2023 08:03:45



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.7.23 25 kHz Signal, Uplink, AGC, 806.0125 MHz

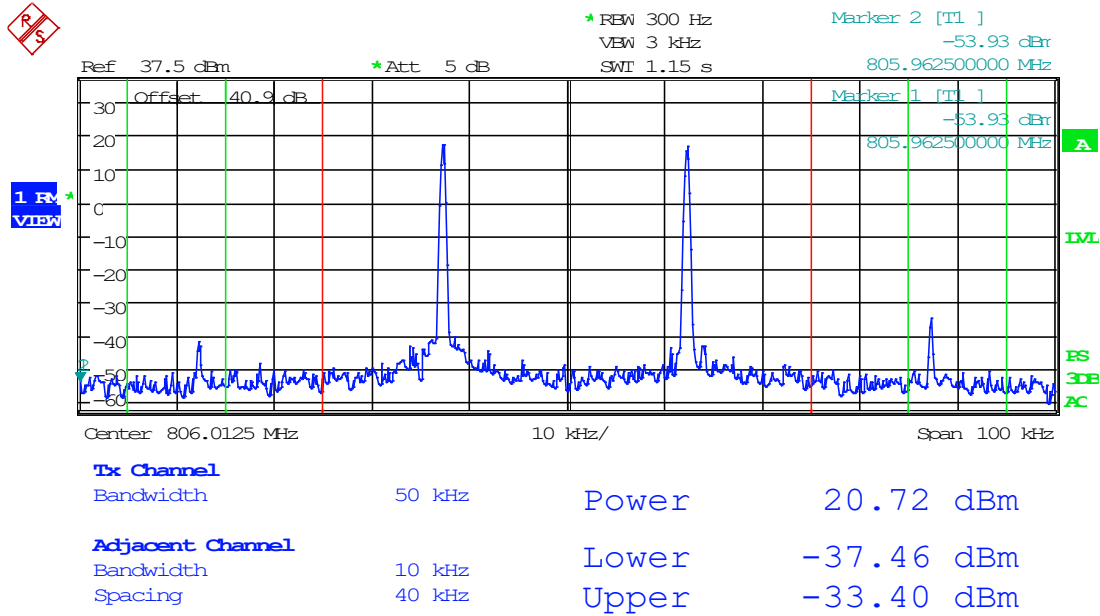


Date: 1.FEB.2023 08:39:20



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.7.24 25 kHz Signal, Uplink, AGC+3dB, 806.0125 MHz

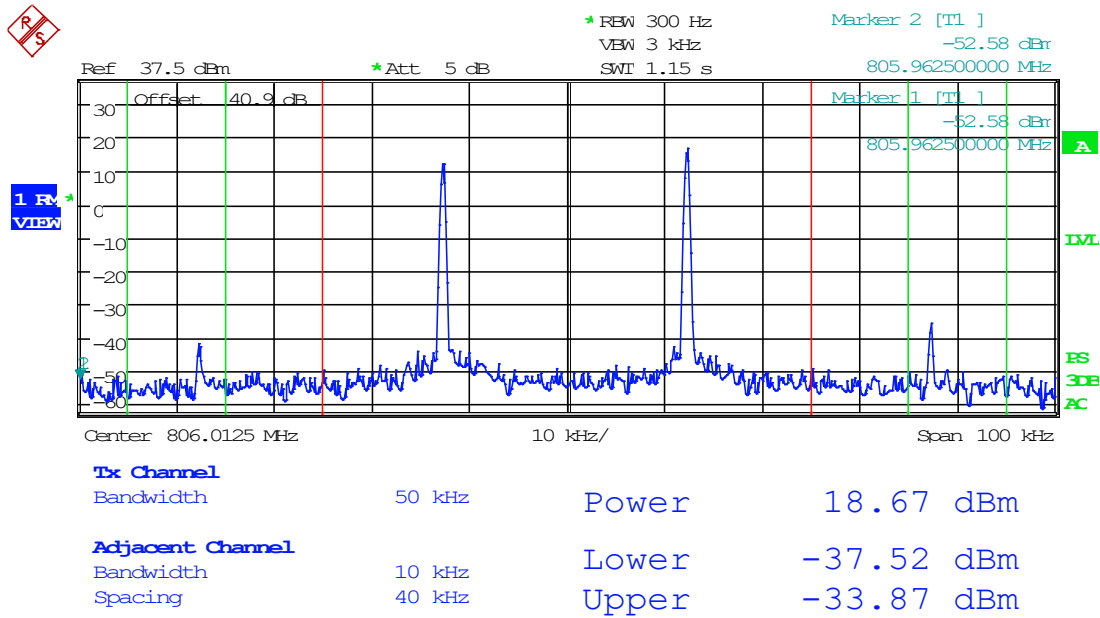

Date: 1.FEB.2023 08:39:59




### 8.7.25 6.25 kHz Signal, Uplink, AGC, 812 MHz

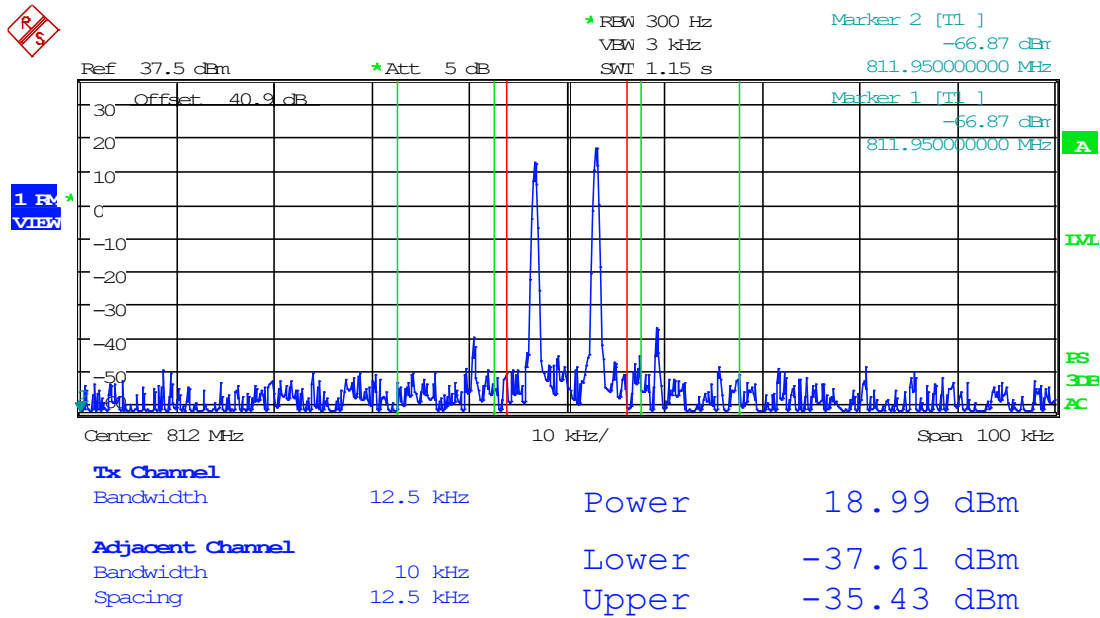

Date: 31.JAN.2023 15:55:07



### 8.7.26 6.25 kHz Signal, Uplink, AGC+3dB, 812 MHz

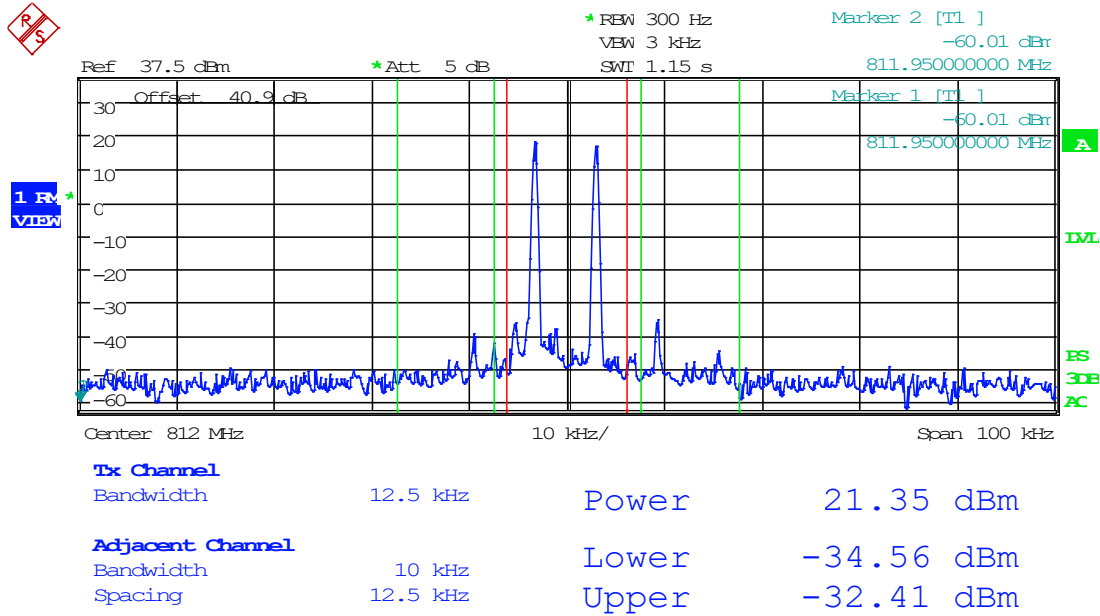


Date: 31.JAN.2023 15:55:56



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.7.27 12.5 kHz Signal, Uplink, AGC, 812 MHz

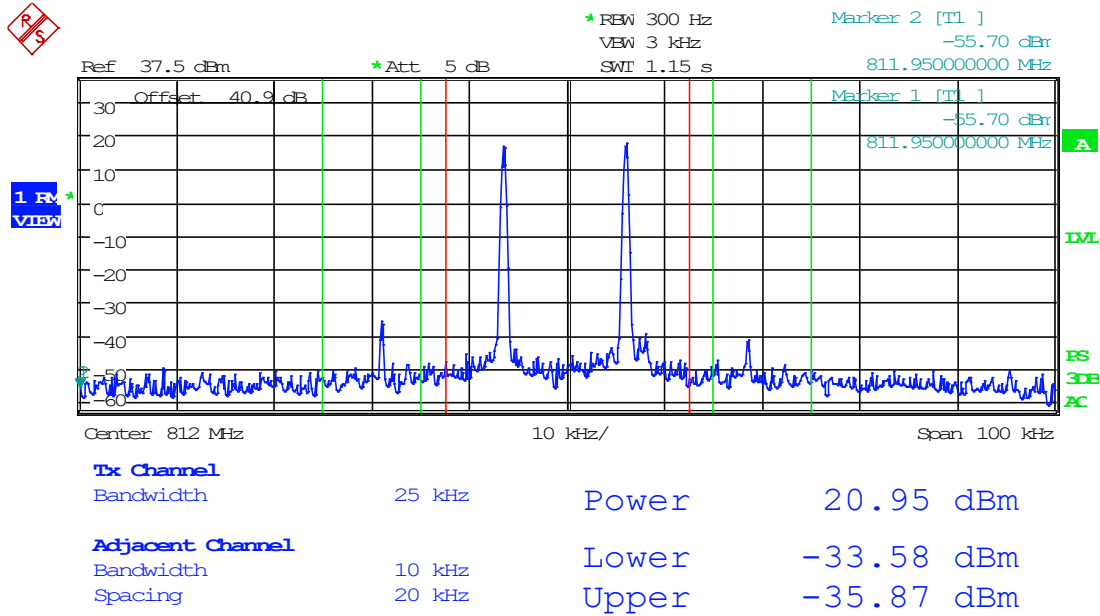

Date: 1.FEB.2023 08:05:26




### 8.7.28 12.5 kHz Signal, Uplink, AGC+3dB, 812 MHz

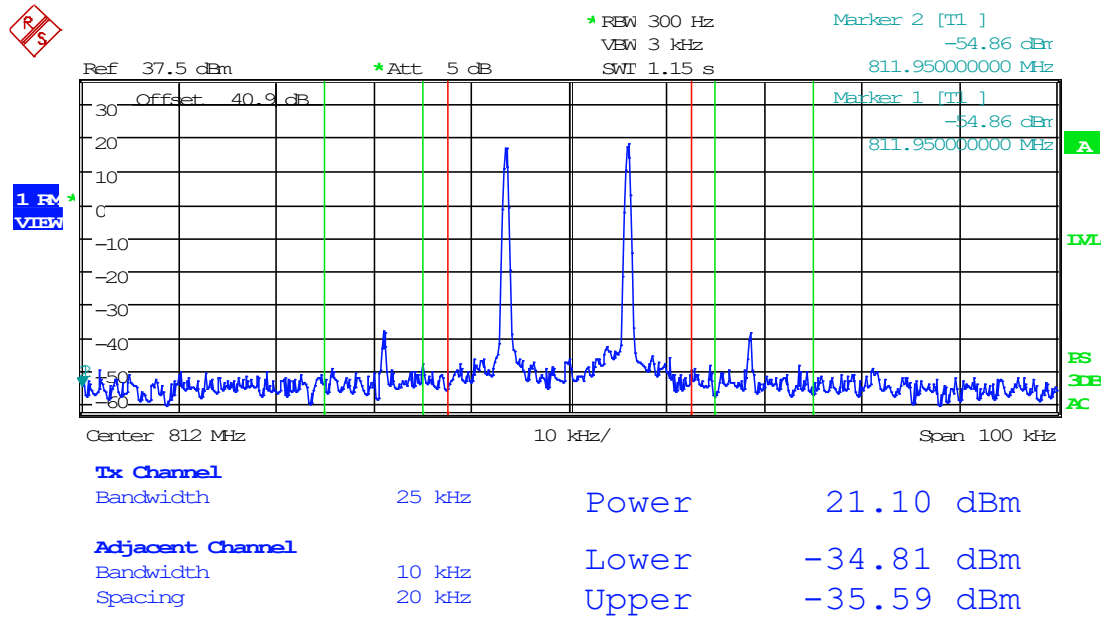

Date: 1.FEB.2023 08:06:11

### 8.7.29 25 kHz Signal, Uplink, AGC, 812 MHz

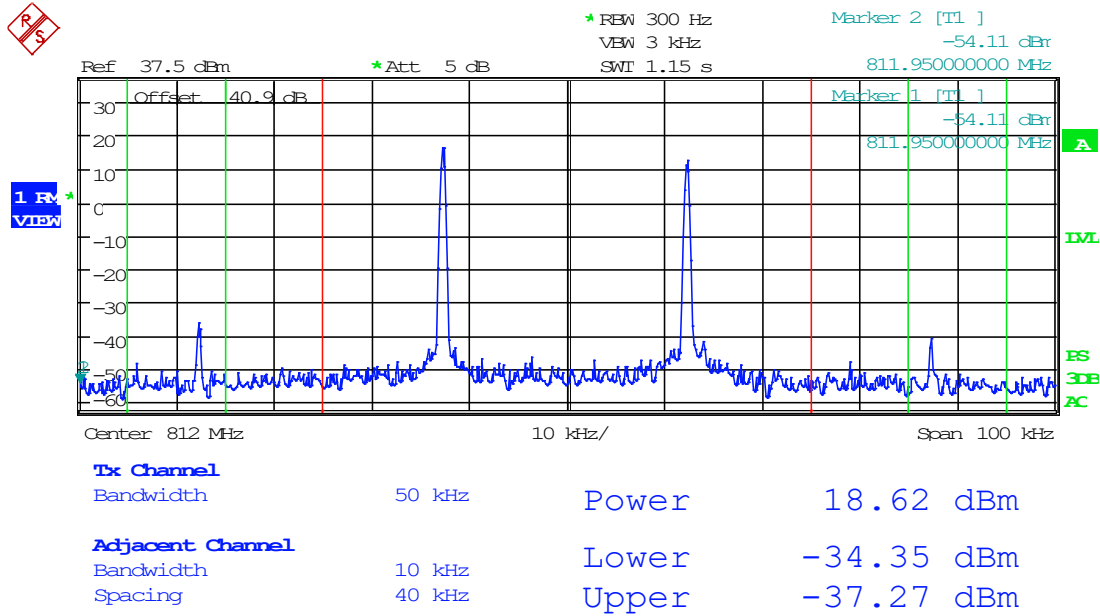


Date: 1.FEB.2023 08:41:21



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.7.30 25 kHz Signal, Uplink, AGC+3dB, 812 MHz

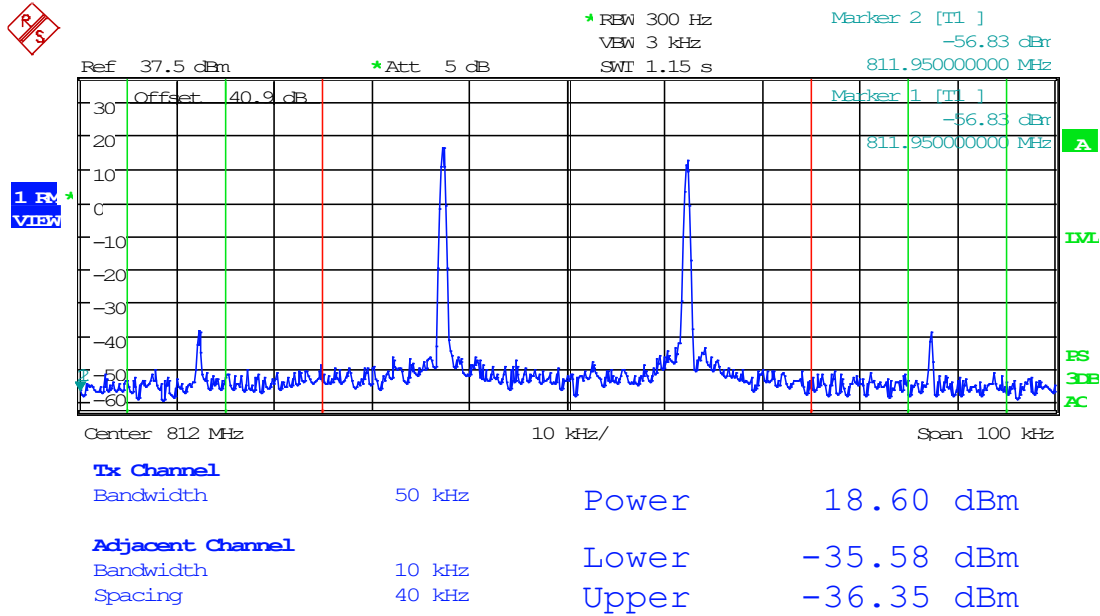


Date: 1.FEB.2023 08:42:01



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.7.31 6.25 kHz Signal, Uplink, AGC, 823.9875 MHz

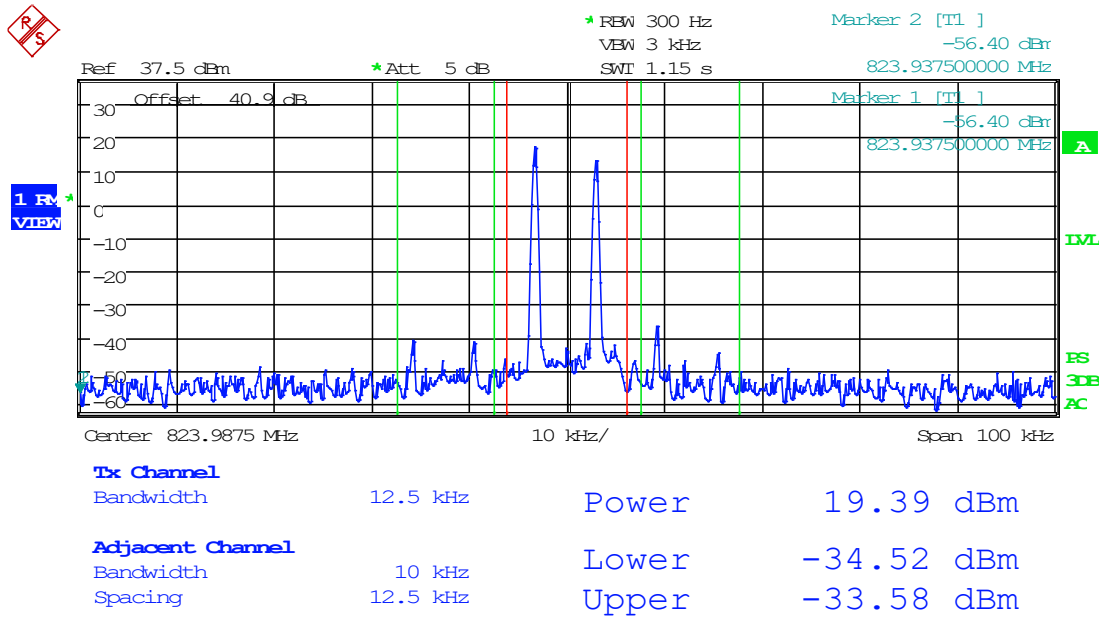


Date: 31.JAN.2023 15:59:56



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.7.32 6.25 kHz Signal, Uplink, AGC+3dB, 823.9875 MHz

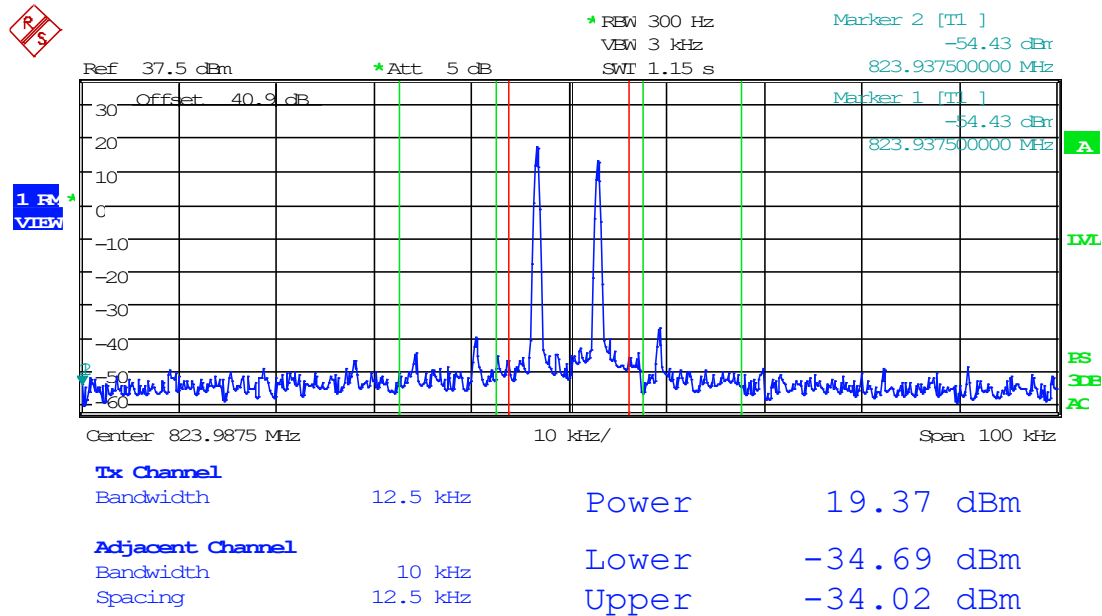


Date: 31.JAN.2023 15:58:29



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.7.33 12.5 kHz Signal, Uplink, AGC, 823.9875 MHz

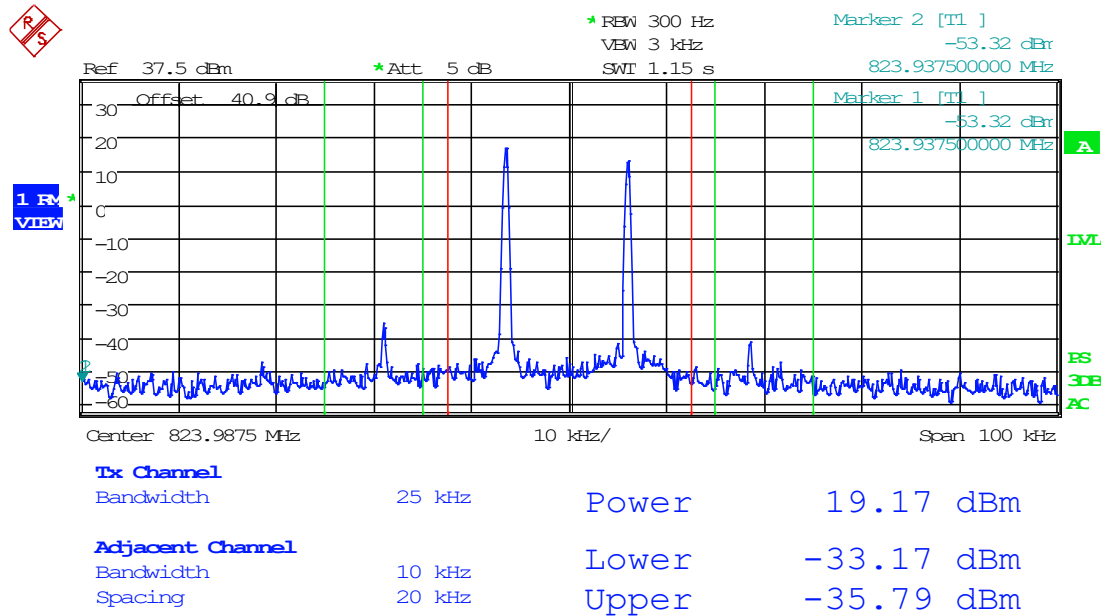


Date: 1.FEB.2023 08:07:46




Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.7.34 12.5 kHz Signal, Uplink, AGC+3dB, 823.9875 MHz

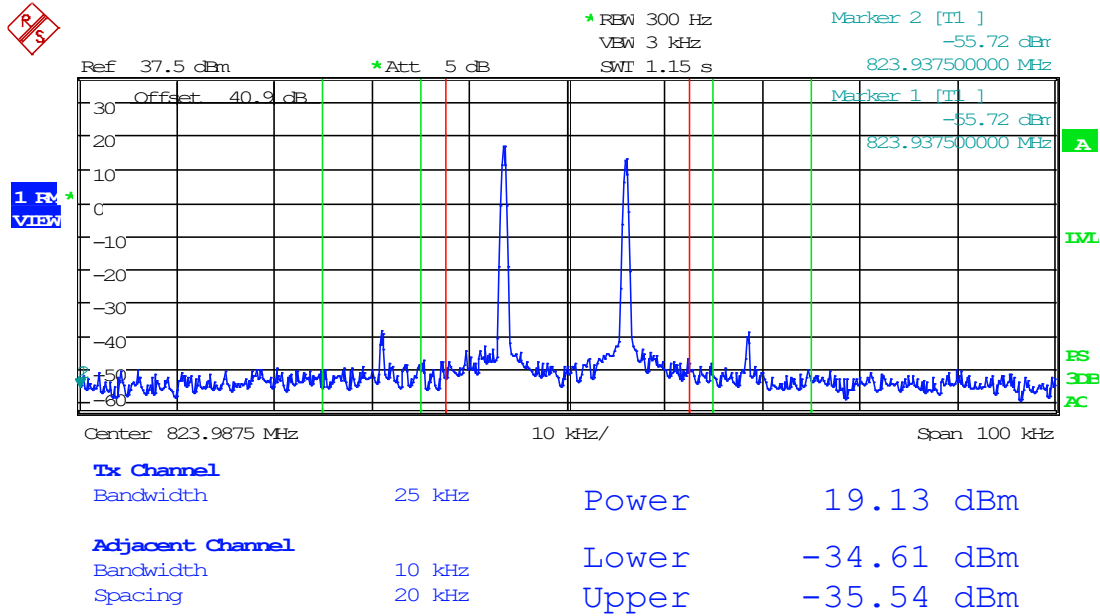

Date: 1.FEB.2023 08:08:35

### 8.7.35 25 kHz Signal, Uplink, AGC, 823.9875 MHz

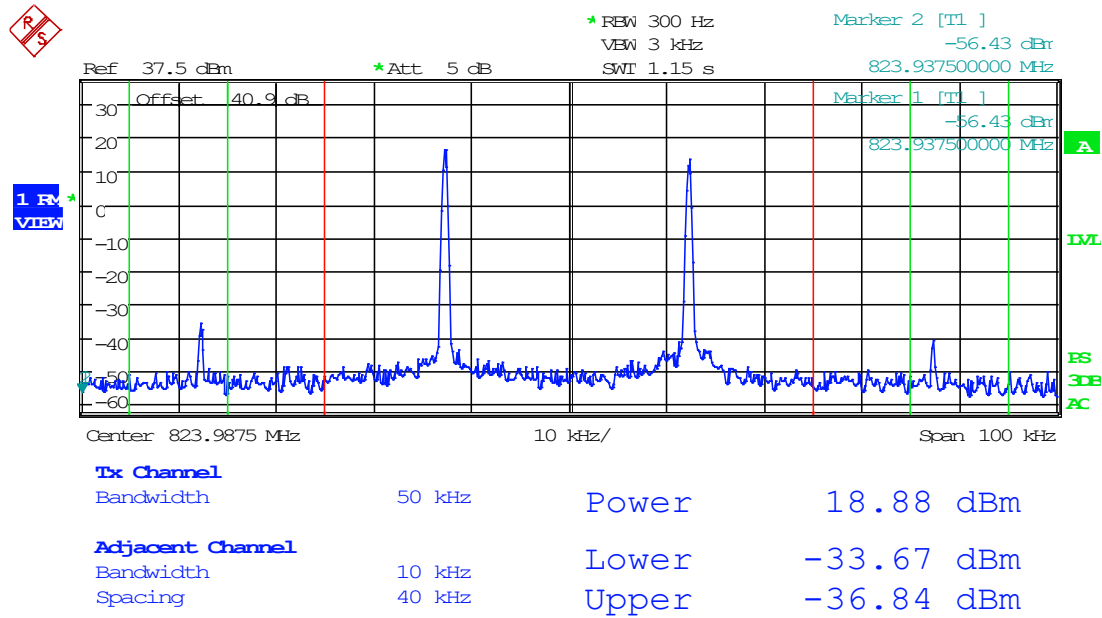


Date: 1.FEB.2023 08:44:15



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.7.36 25 kHz Signal, Uplink, AGC+3dB, 823.9875 MHz

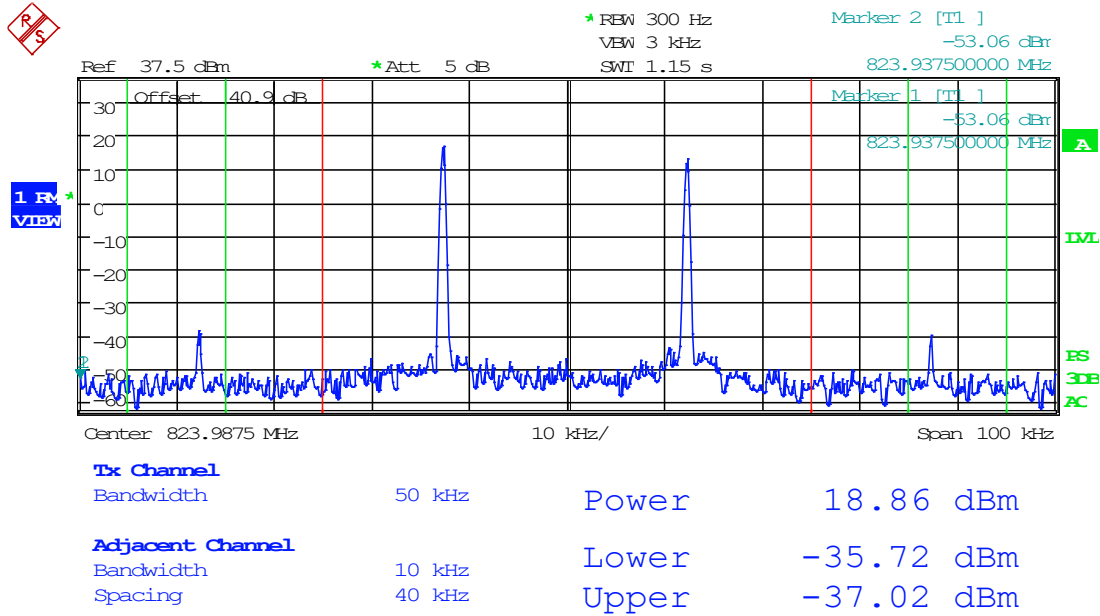


Date: 1.FEB.2023 08:45:04



## 8.8 Emission Mask, Out-of-Band

*Referenced from test report "TR\_6057-23\_UL\_FCC 90\_Booster Class B\_1.docx".*

Limits from FCC Parts 2.1051, 90.210 and test procedure from ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

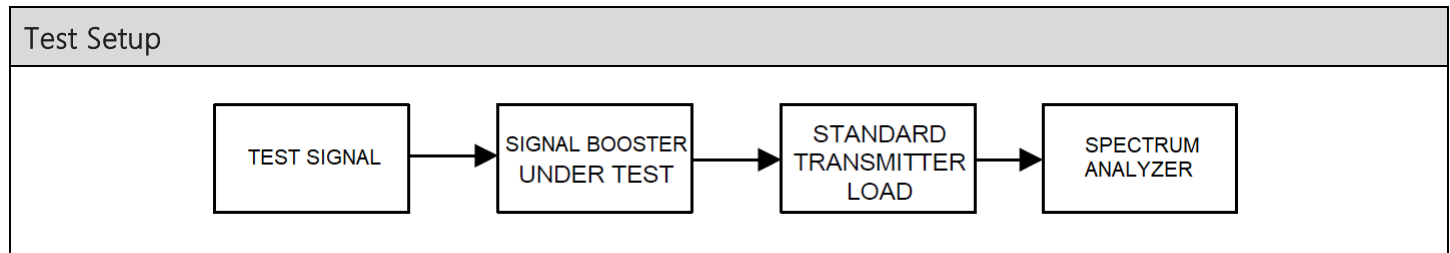


**Note:** Testing was done simultaneously on all combinations of Uplinks and Downlinks to address co-location of signals.



## Conducted Emissions Spectrum Plots


### 8.8.1 30 MHz to 1 GHz, 788.0125 MHz

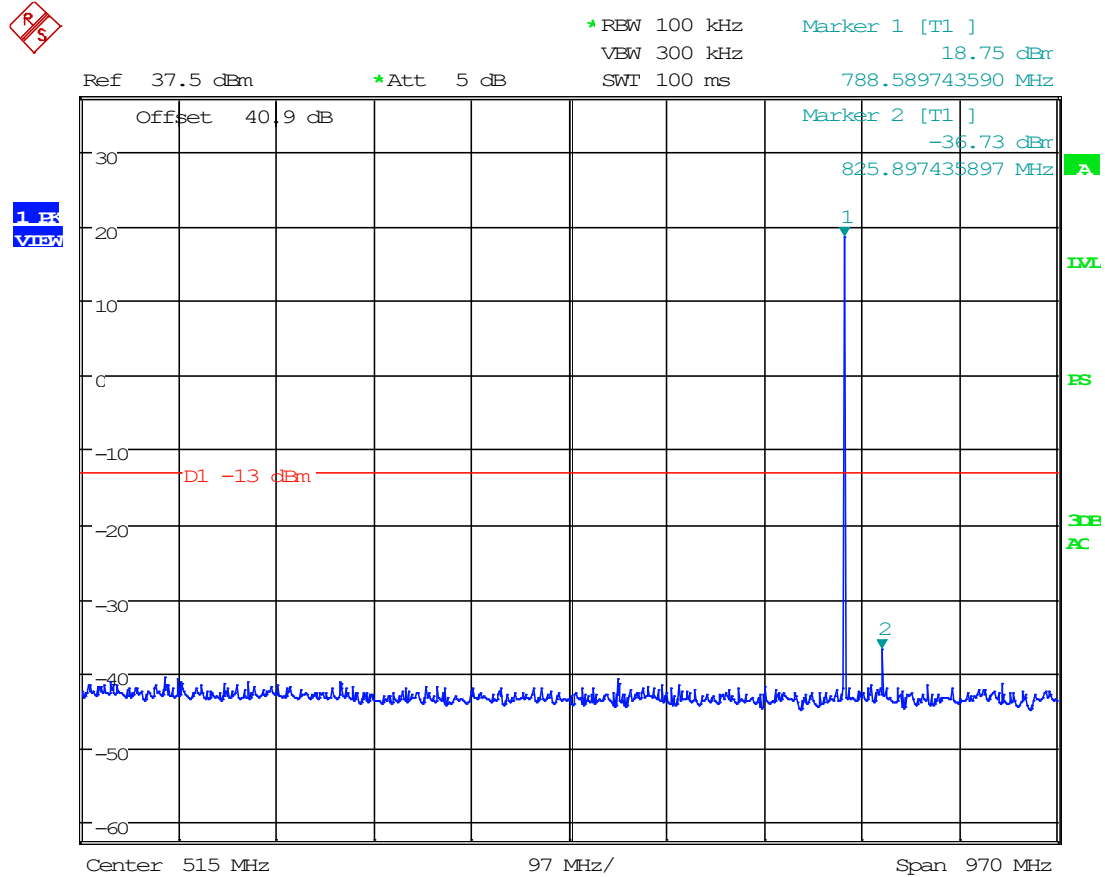

Date: 30.JAN.2023 16:31:10




## 8.8.2 1 GHz to 10<sup>th</sup> Harmonic, 788.0125 MHz

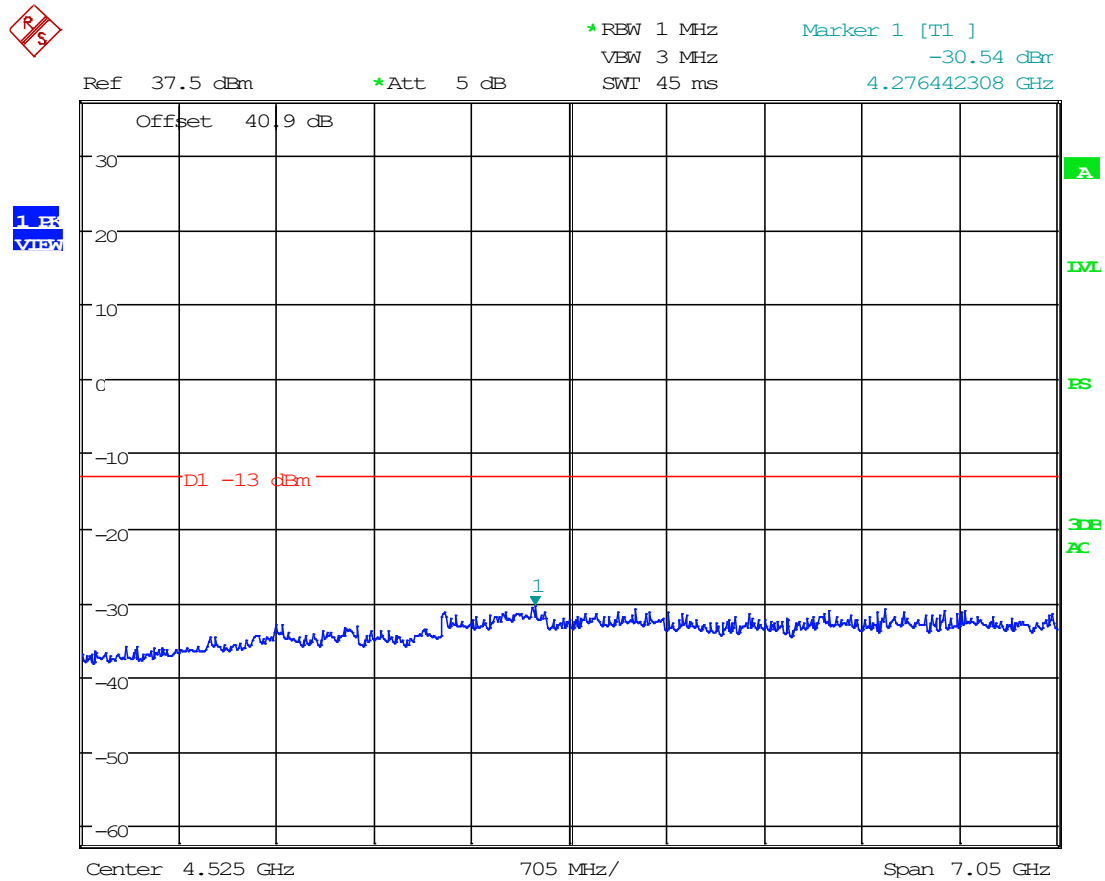

Date: 30.JAN.2023 17:05:05




### 8.8.3 30 MHz to 1 GHz, 796 MHz

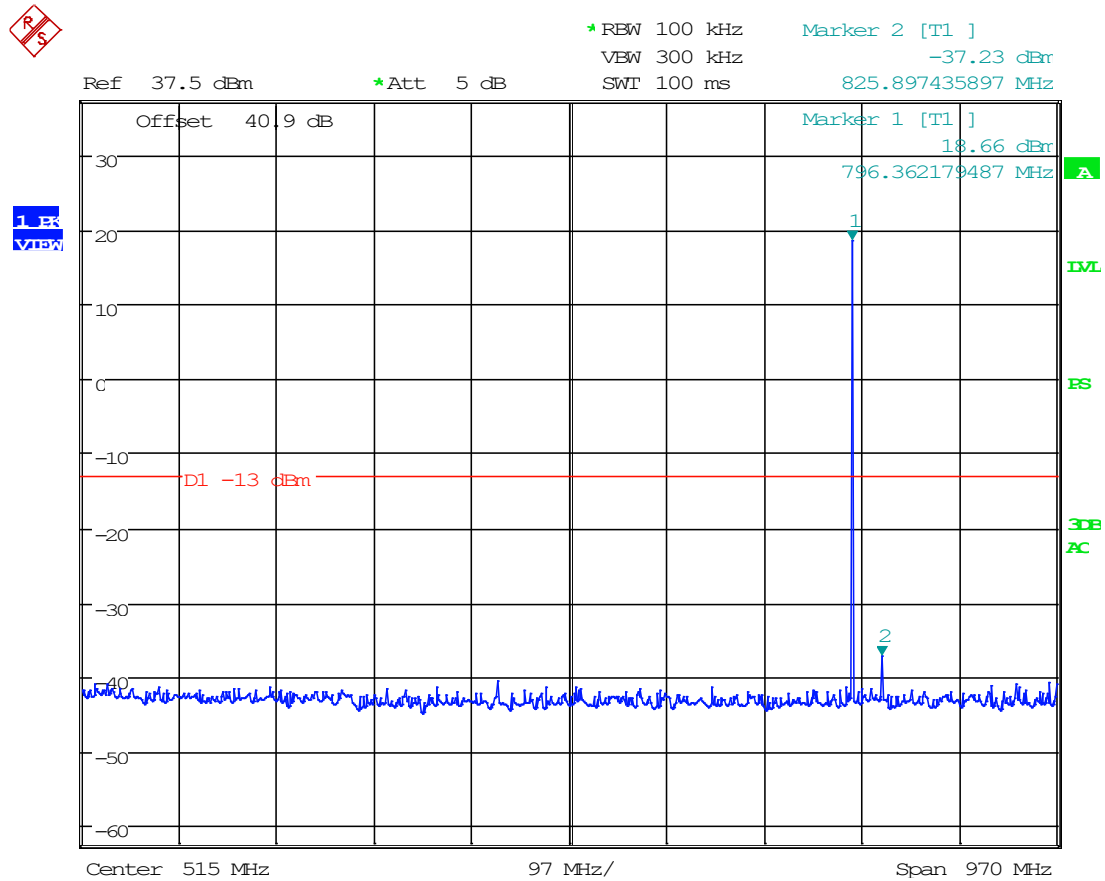

Date: 30.JAN.2023 16:46:04




#### 8.8.4 1 GHz to 10<sup>th</sup> Harmonic, 796 MHz

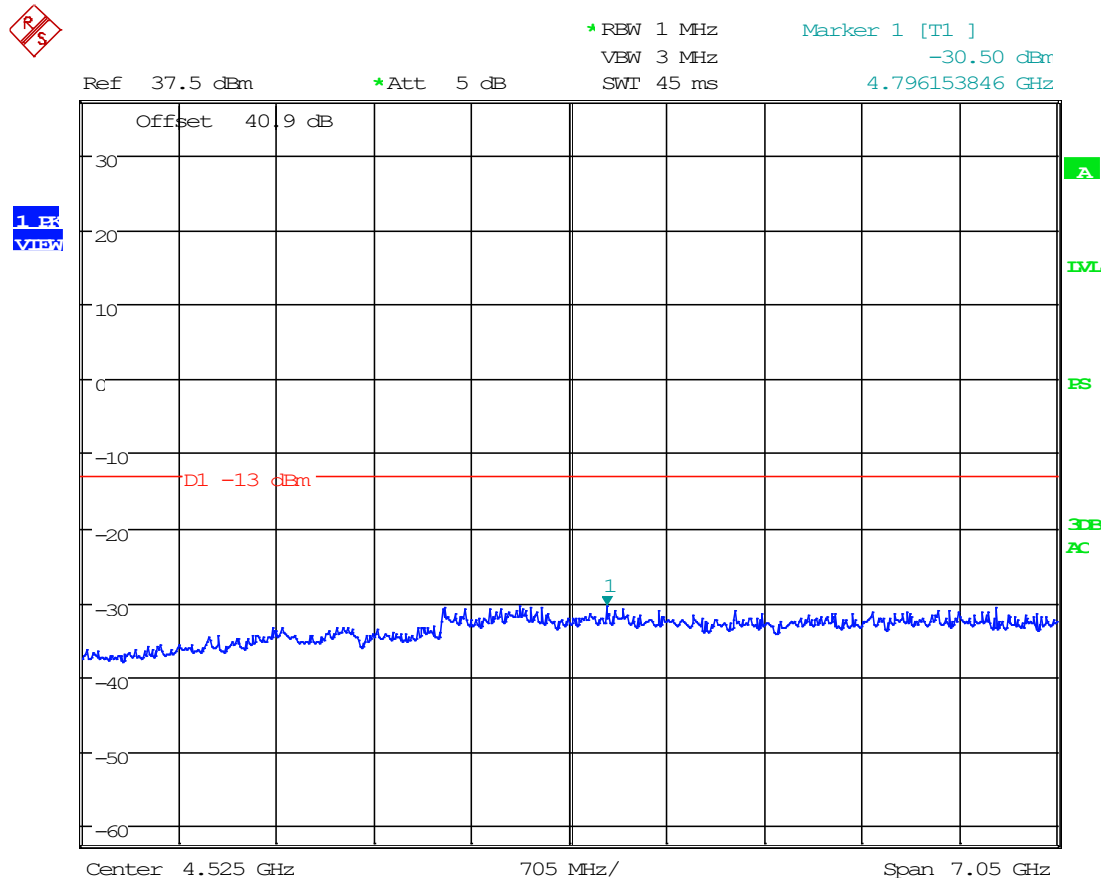

Date: 30.JAN.2023 17:05:58



### 8.8.5 30 MHz to 1 GHz, 804.9875 MHz

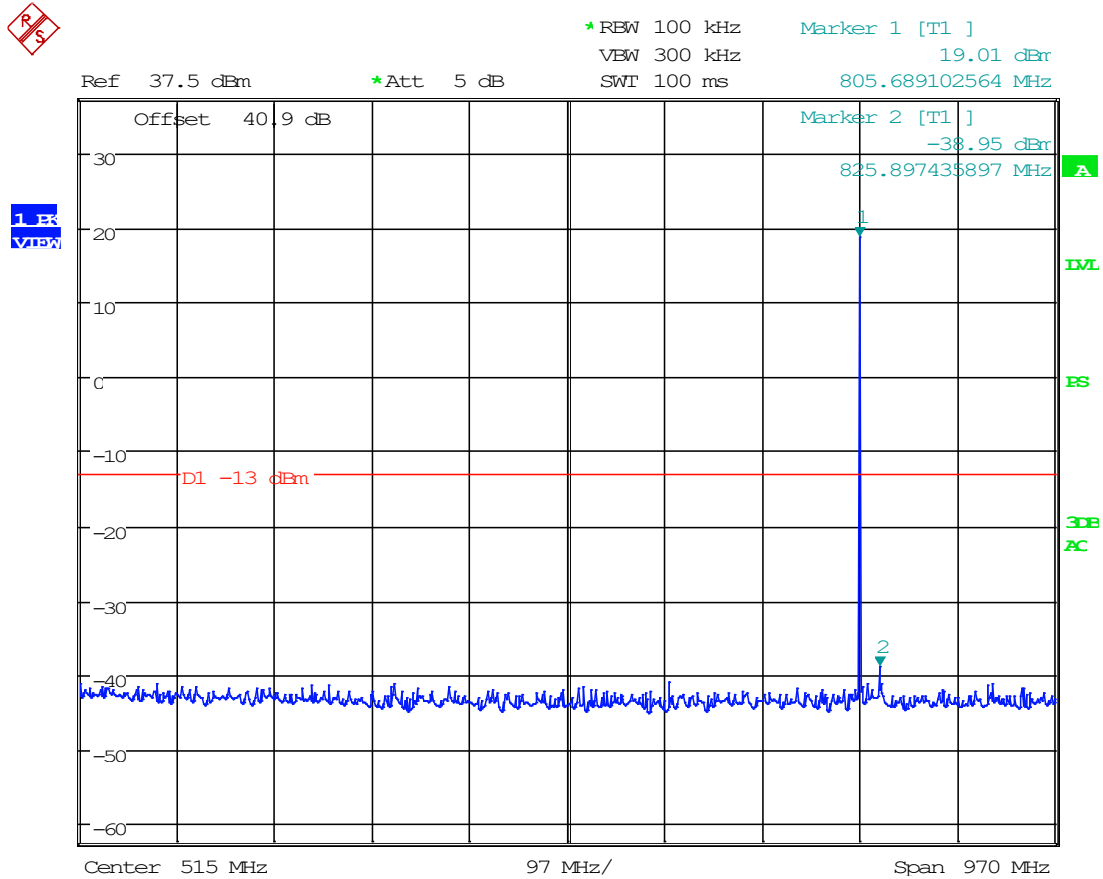


Date: 30.JAN.2023 16:47:02



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.8.6 1 GHz to 10<sup>th</sup> Harmonic, 804.9875 MHz

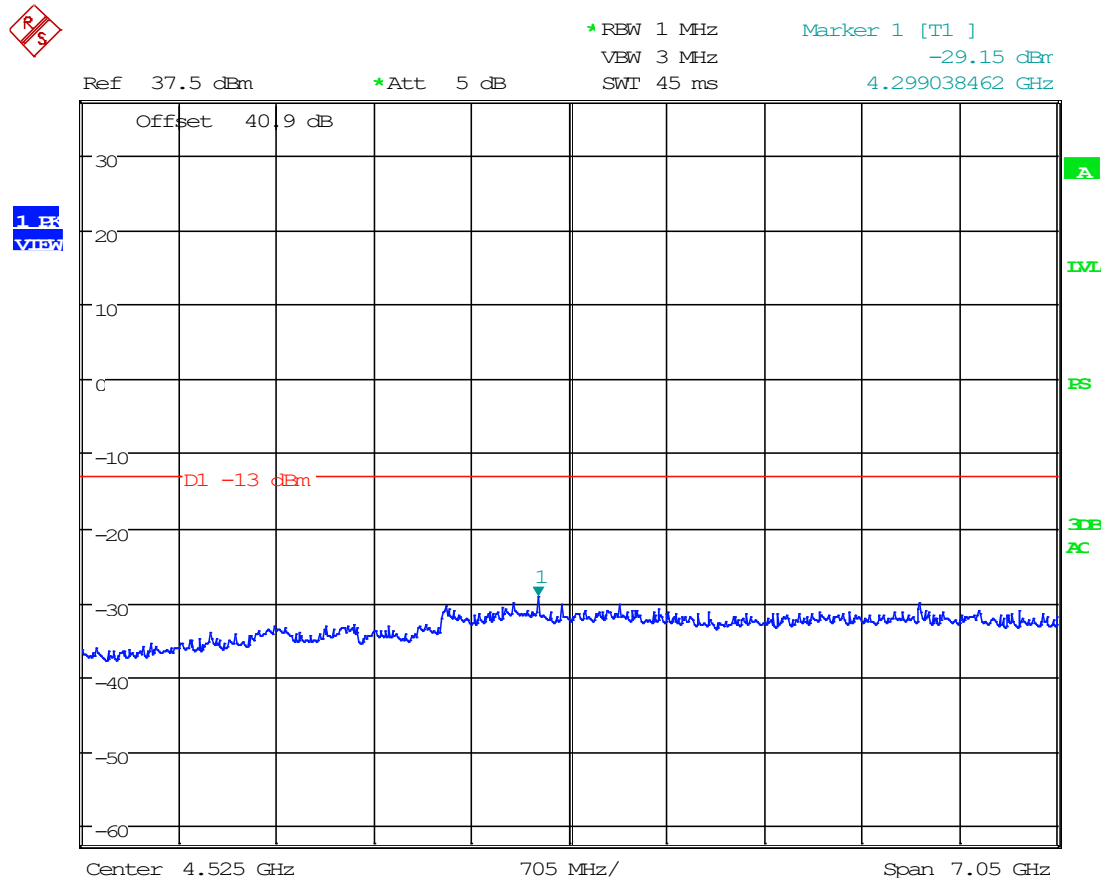

Date: 30.JAN.2023 17:07:14



### 8.8.7 30 MHz to 1 GHz, 806.0125 MHz

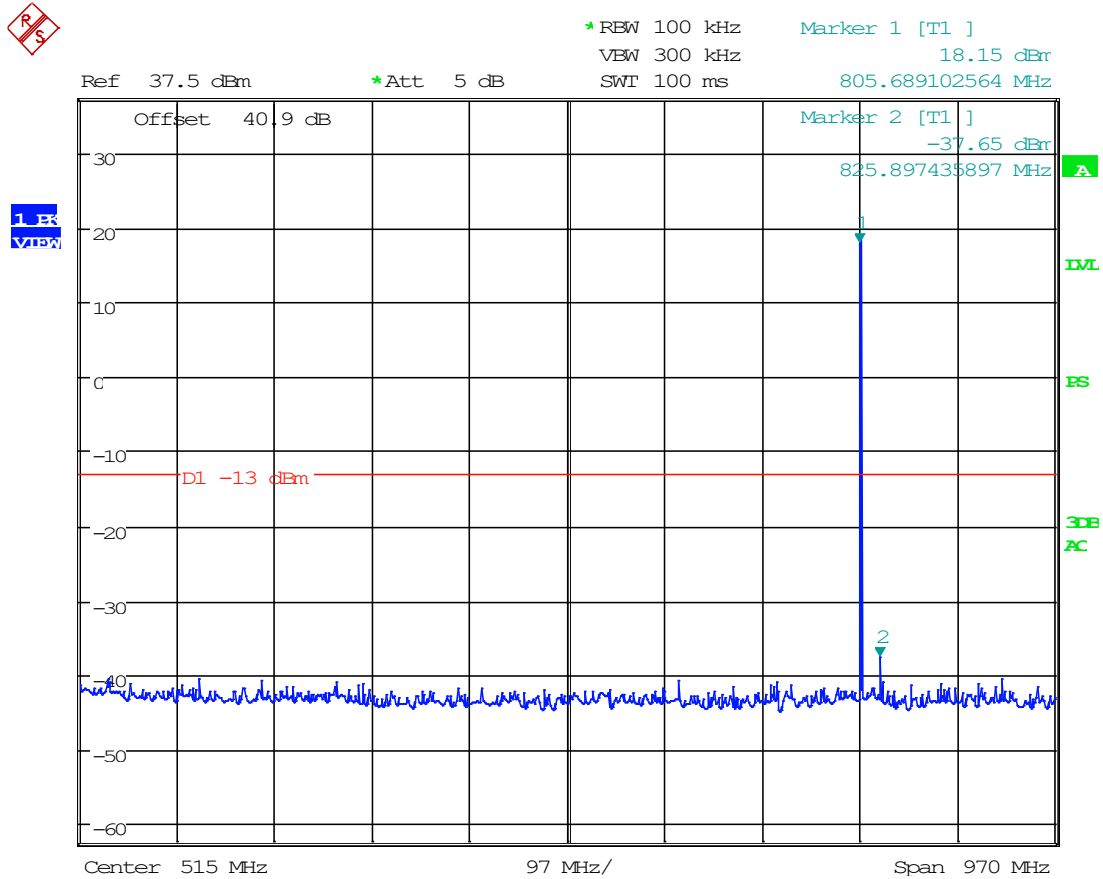


Date: 30.JAN.2023 16:47:50



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.8.8 1 GHz to 10<sup>th</sup> Harmonic, 806.0125 MHz

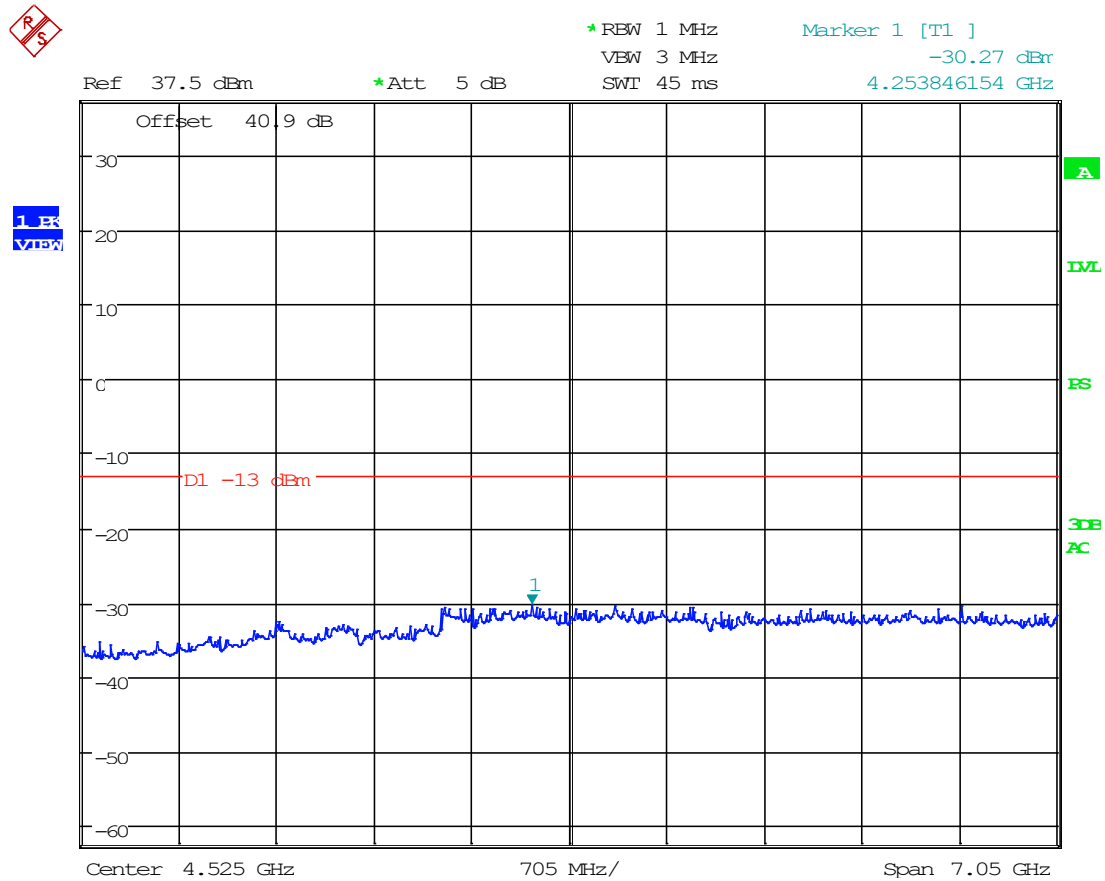

Date: 30.JAN.2023 17:08:04



### 8.8.9 30 MHz to 1 GHz, 812 MHz

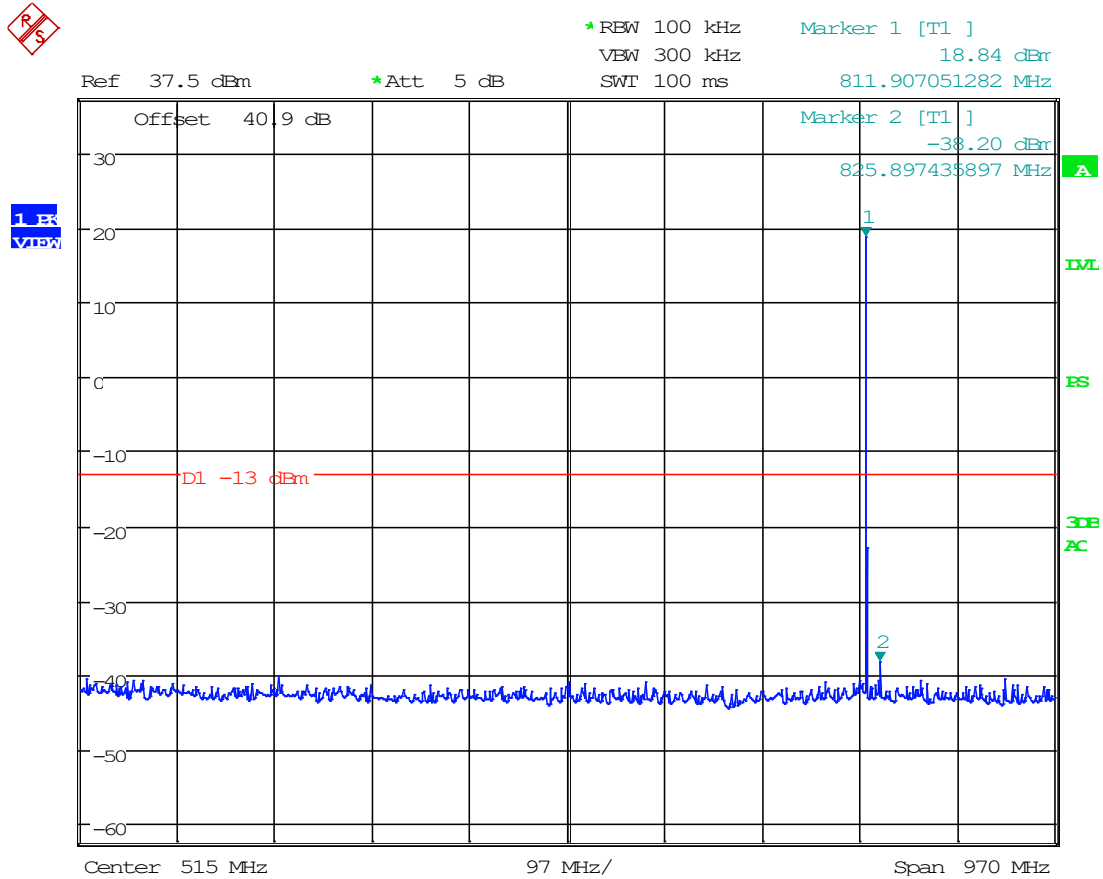


Date: 30.JAN.2023 16:48:36



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)


### 8.8.10 1 GHz to 10<sup>th</sup> Harmonic, 812 MHz

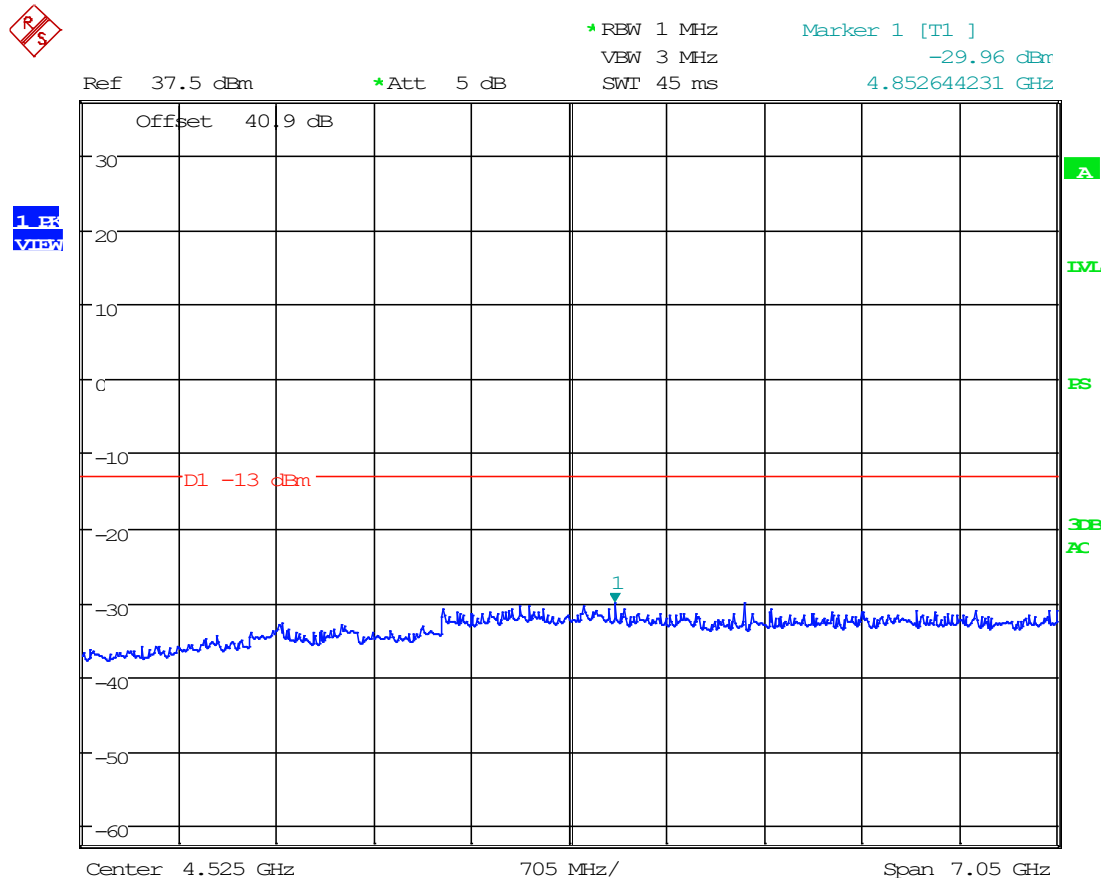

Date: 30.JAN.2023 17:08:47



### 8.8.11 30 MHz to 1 GHz, 823.9875 MHz

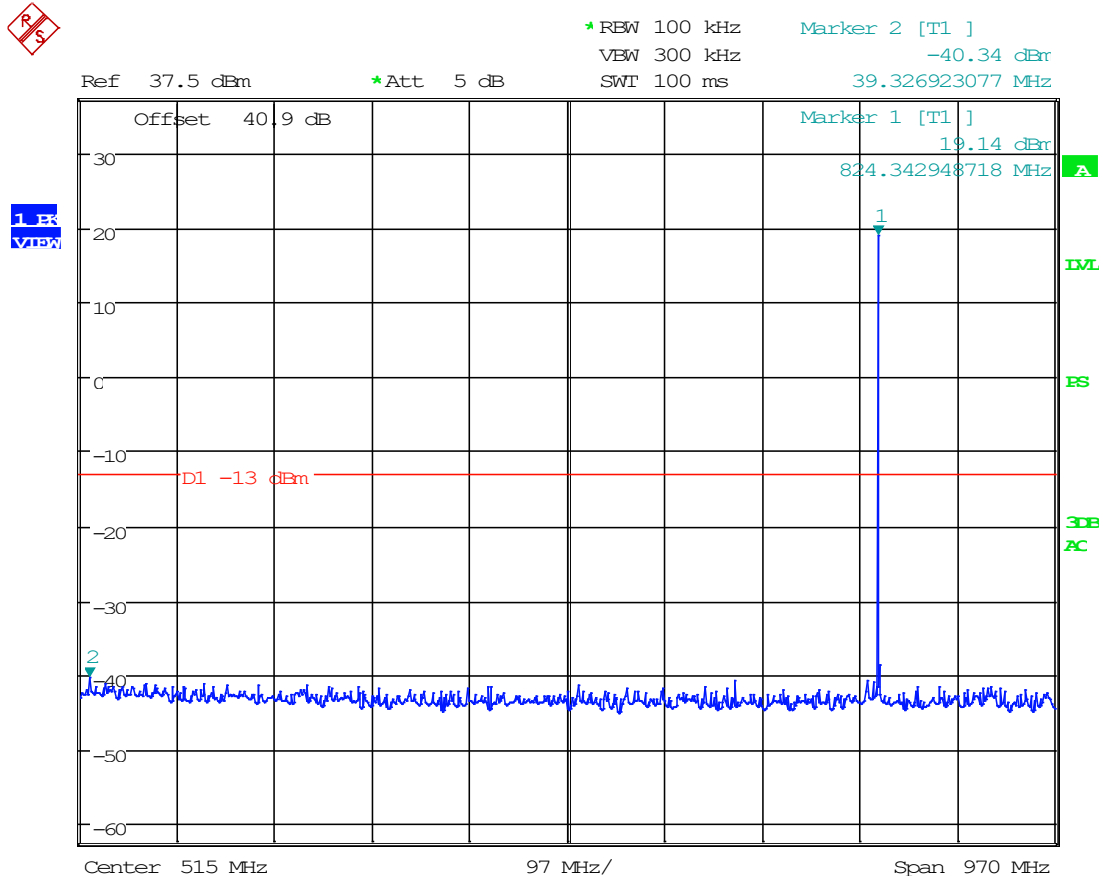


Date: 30.JAN.2023 16:49:32



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.8.12 1 GHz to 10<sup>th</sup> Harmonic, 823.9875 MHz

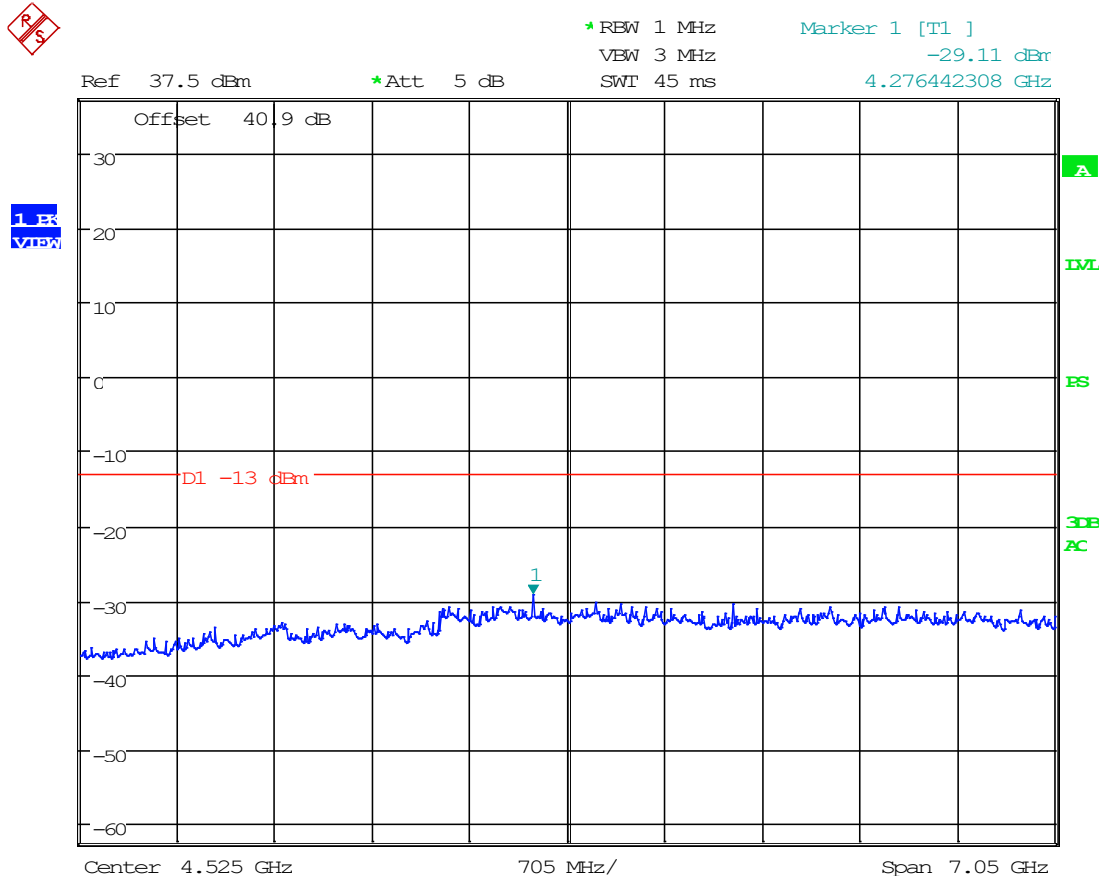


Date: 30.JAN.2023 17:09:32


## 8.9 Spurious Radiated Emissions

Limits from FCC Parts 2.1053, 90.210 and test procedure from ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

### Radiated Test Setup, 30 – 1000 MHz

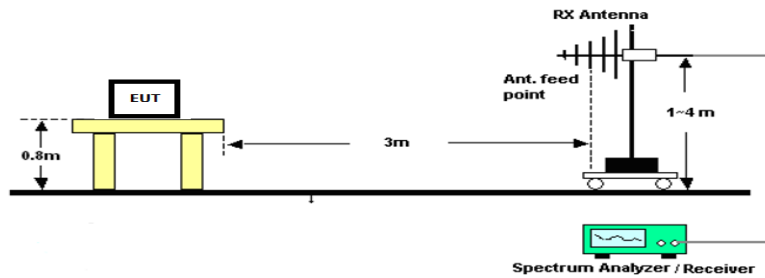

### Radiated Test Setup, Above 1000 MHz

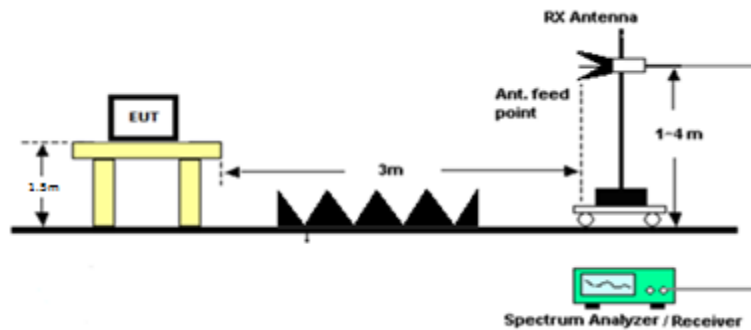



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

## Radiated Emissions, Tabular Data

### 8.9.1 Uplink, 788.0125 MHz

| Tuned Frequency (MHz) | Emission Frequency (MHz) | Detector | Meter Reading (dBuV) | Antenna Polarity | Coax Loss (dB) | Antenna Correction Factor (dB/m) | Distance (m) | Field Strength (dBuV/m) | ERP (dBm) | Spurious Limit (dBm) | Margin (dB) |
|-----------------------|--------------------------|----------|----------------------|------------------|----------------|----------------------------------|--------------|-------------------------|-----------|----------------------|-------------|
| 788.0125              | 1576.0250                | PK       | 10.60                | H                | 4.61           | 27.92                            | 3.00         | 43.13                   | -54.25    | -13.00               | 41.25       |
| 788.0125              | 1576.0250                | PK       | 10.30                | V                | 4.61           | 27.92                            | 3.00         | 42.83                   | -54.55    | -13.00               | 41.55       |
| 788.0125              | 2364.0375                | PK       | 12.10                | H                | 5.60           | 31.91                            | 3.00         | 49.61                   | -47.76    | -13.00               | 34.76       |
| 788.0125              | 2364.0375                | PK       | 12.20                | V                | 5.60           | 31.91                            | 3.00         | 49.71                   | -47.66    | -13.00               | 34.66       |
| 788.0125              | 3152.0500                | PK       | 13.30                | H                | 6.53           | 32.77                            | 3.00         | 52.60                   | -44.77    | -13.00               | 31.77       |
| 788.0125              | 3152.0500                | PK       | 13.70                | V                | 6.53           | 32.77                            | 3.00         | 53.00                   | -44.37    | -13.00               | 31.37       |
| 788.0125              | 3940.0625                | PK       | 16.70                | H                | 7.27           | 33.34                            | 3.00         | 57.31                   | -40.07    | -13.00               | 27.07       |
| 788.0125              | 3940.0625                | PK       | 16.60                | V                | 7.27           | 33.34                            | 3.00         | 57.21                   | -40.17    | -13.00               | 27.17       |
| 788.0125              | 4728.0750                | PK       | 13.90                | H                | 7.05           | 33.89                            | 3.00         | 54.85                   | -42.53    | -13.00               | 29.53       |
| 788.0125              | 4728.0750                | PK       | 14.40                | V                | 7.05           | 33.89                            | 3.00         | 55.35                   | -42.03    | -13.00               | 29.03       |
| 788.0125              | 5516.0875                | PK       | 14.60                | H                | 8.06           | 34.45                            | 3.00         | 57.11                   | -40.27    | -13.00               | 27.27       |
| 788.0125              | 5516.0875                | PK       | 14.10                | V                | 8.06           | 34.45                            | 3.00         | 56.61                   | -40.77    | -13.00               | 27.77       |
| 788.0125              | 6304.1000                | PK       | 14.90                | H                | 8.59           | 35.39                            | 3.00         | 58.87                   | -38.50    | -13.00               | 25.50       |
| 788.0125              | 6304.1000                | PK       | 14.80                | V                | 8.59           | 35.39                            | 3.00         | 58.77                   | -38.60    | -13.00               | 25.60       |
| 788.0125              | 7092.1125                | PK       | 14.20                | H                | 9.44           | 36.31                            | 3.00         | 59.95                   | -37.42    | -13.00               | 24.42       |
| 788.0125              | 7092.1125                | PK       | 13.90                | V                | 9.44           | 36.31                            | 3.00         | 59.65                   | -37.72    | -13.00               | 24.72       |
| 788.0125              | 7880.1250                | PK       | 14.50                | H                | 10.16          | 35.86                            | 3.00         | 60.51                   | -36.86    | -13.00               | 23.86       |
| 788.0125              | 7880.1250                | PK       | 13.80                | V                | 10.16          | 35.86                            | 3.00         | 59.81                   | -37.56    | -13.00               | 24.56       |



Timco Engineering, Inc., an IIA Company  
 849 NW State Road 45, Newberry, Florida 32669  
 (352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

## 8.9.2 Uplink, 796 MHz

| Tuned Frequency (MHz) | Emission Frequency (MHz) | Detector | Meter Reading (dBuV) | Antenna Polarity | Coax Loss (dB) | Antenna Correction Factor (dB/m) | Distance (m) | Field Strength (dBuV/m) | ERP (dBm) | Spurious Limit (dBm) | Margin (dB) |
|-----------------------|--------------------------|----------|----------------------|------------------|----------------|----------------------------------|--------------|-------------------------|-----------|----------------------|-------------|
| 796.0000              | 1592.00                  | PK       | 10.20                | H                | 4.64           | 28.02                            | 3.00         | 42.86                   | -54.52    | -13.00               | 41.52       |
| 796.0000              | 1592.00                  | PK       | 10.40                | V                | 4.64           | 28.02                            | 3.00         | 43.06                   | -54.32    | -13.00               | 41.32       |
| 796.0000              | 2388.00                  | PK       | 11.50                | H                | 5.62           | 31.89                            | 3.00         | 49.01                   | -48.37    | -13.00               | 35.37       |
| 796.0000              | 2388.00                  | PK       | 11.60                | V                | 5.62           | 31.89                            | 3.00         | 49.11                   | -48.27    | -13.00               | 35.27       |
| 796.0000              | 3184.00                  | PK       | 14.00                | H                | 6.61           | 32.71                            | 3.00         | 53.32                   | -44.06    | -13.00               | 31.06       |
| 796.0000              | 3184.00                  | PK       | 13.40                | V                | 6.61           | 32.71                            | 3.00         | 52.72                   | -44.66    | -13.00               | 31.66       |
| 796.0000              | 3980.00                  | PK       | 16.60                | H                | 7.26           | 33.39                            | 3.00         | 57.25                   | -40.13    | -13.00               | 27.13       |
| 796.0000              | 3980.00                  | PK       | 16.80                | V                | 7.26           | 33.39                            | 3.00         | 57.45                   | -39.93    | -13.00               | 26.93       |
| 796.0000              | 4776.00                  | PK       | 13.80                | H                | 7.01           | 33.92                            | 3.00         | 54.73                   | -42.64    | -13.00               | 29.64       |
| 796.0000              | 4776.00                  | PK       | 14.20                | V                | 7.01           | 33.92                            | 3.00         | 55.13                   | -42.24    | -13.00               | 29.24       |
| 796.0000              | 5572.00                  | PK       | 15.50                | H                | 8.09           | 34.42                            | 3.00         | 58.01                   | -39.37    | -13.00               | 26.37       |
| 796.0000              | 5572.00                  | PK       | 14.70                | V                | 8.09           | 34.42                            | 3.00         | 57.21                   | -40.17    | -13.00               | 27.17       |
| 796.0000              | 6368.00                  | PK       | 15.10                | H                | 8.91           | 35.42                            | 3.00         | 59.43                   | -37.95    | -13.00               | 24.95       |
| 796.0000              | 6368.00                  | PK       | 14.30                | V                | 8.91           | 35.42                            | 3.00         | 58.63                   | -38.75    | -13.00               | 25.75       |
| 796.0000              | 7164.00                  | PK       | 14.40                | H                | 9.50           | 36.38                            | 3.00         | 60.28                   | -37.10    | -13.00               | 24.10       |
| 796.0000              | 7164.00                  | PK       | 14.20                | V                | 9.50           | 36.38                            | 3.00         | 60.08                   | -37.30    | -13.00               | 24.30       |
| 796.0000              | 7960.00                  | PK       | 13.90                | H                | 9.82           | 35.72                            | 3.00         | 59.44                   | -37.93    | -13.00               | 24.93       |
| 796.0000              | 7960.00                  | PK       | 13.90                | V                | 9.82           | 35.72                            | 3.00         | 59.44                   | -37.93    | -13.00               | 24.93       |



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.9.3 Uplink, 804.9875 MHz

| Tuned Frequency (MHz) | Emission Frequency (MHz) | Detector | Meter Reading (dBuV) | Antenna Polarity | Coax Loss (dB) | Antenna Correction Factor (dB/m) | Distance (m) | Field Strength (dBuV/m) | ERP (dBm) | Spurious Limit (dBm) | Margin (dB) |
|-----------------------|--------------------------|----------|----------------------|------------------|----------------|----------------------------------|--------------|-------------------------|-----------|----------------------|-------------|
| 804.9875              | 1609.9750                | PK       | 10.60                | H                | 4.67           | 28.18                            | 3.00         | 43.45                   | -53.93    | -13.00               | 40.93       |
| 804.9875              | 1609.9750                | PK       | 12.00                | V                | 4.67           | 28.18                            | 3.00         | 44.85                   | -52.53    | -13.00               | 39.53       |
| 804.9875              | 2414.9625                | PK       | 11.60                | H                | 5.61           | 31.87                            | 3.00         | 49.08                   | -48.30    | -13.00               | 35.30       |
| 804.9875              | 2414.9625                | PK       | 11.90                | V                | 5.61           | 31.87                            | 3.00         | 49.38                   | -48.00    | -13.00               | 35.00       |
| 804.9875              | 3219.9500                | PK       | 13.80                | H                | 6.63           | 32.68                            | 3.00         | 53.11                   | -44.27    | -13.00               | 31.27       |
| 804.9875              | 3219.9500                | PK       | 13.30                | V                | 6.63           | 32.68                            | 3.00         | 52.61                   | -44.77    | -13.00               | 31.77       |
| 804.9875              | 4024.9375                | PK       | 13.90                | H                | 7.23           | 33.39                            | 3.00         | 54.51                   | -42.86    | -13.00               | 29.86       |
| 804.9875              | 4024.9375                | PK       | 13.80                | V                | 7.23           | 33.39                            | 3.00         | 54.41                   | -42.96    | -13.00               | 29.96       |
| 804.9875              | 4829.9250                | PK       | 13.70                | H                | 7.17           | 33.94                            | 3.00         | 54.81                   | -42.57    | -13.00               | 29.57       |
| 804.9875              | 4829.9250                | PK       | 13.80                | V                | 7.17           | 33.94                            | 3.00         | 54.91                   | -42.47    | -13.00               | 29.47       |
| 804.9875              | 5634.9125                | PK       | 14.40                | H                | 8.20           | 34.51                            | 3.00         | 57.11                   | -40.26    | -13.00               | 27.26       |
| 804.9875              | 5634.9125                | PK       | 15.20                | V                | 8.20           | 34.51                            | 3.00         | 57.91                   | -39.46    | -13.00               | 26.46       |
| 804.9875              | 6439.9000                | PK       | 14.30                | H                | 8.96           | 35.51                            | 3.00         | 58.76                   | -38.61    | -13.00               | 25.61       |
| 804.9875              | 6439.9000                | PK       | 14.00                | V                | 8.96           | 35.51                            | 3.00         | 58.46                   | -38.91    | -13.00               | 25.91       |
| 804.9875              | 7244.8875                | PK       | 15.50                | H                | 9.51           | 36.32                            | 3.00         | 61.33                   | -36.04    | -13.00               | 23.04       |
| 804.9875              | 7244.8875                | PK       | 14.20                | V                | 9.51           | 36.32                            | 3.00         | 60.03                   | -37.34    | -13.00               | 24.34       |
| 804.9875              | 8049.8750                | PK       | 14.40                | H                | 9.89           | 35.77                            | 3.00         | 60.06                   | -37.31    | -13.00               | 24.31       |
| 804.9875              | 8049.8750                | PK       | 14.70                | V                | 9.89           | 35.77                            | 3.00         | 60.36                   | -37.01    | -13.00               | 24.01       |



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

#### 8.9.4 Uplink, 806.0125 MHz

| Tuned Frequency (MHz) | Emission Frequency (MHz) | Detector | Meter Reading (dBuV) | Antenna Polarity | Coax Loss (dB) | Antenna Correction Factor (dB/m) | Distance (m) | Field Strength (dBuV/m) | ERP (dBm) | Spurious Limit (dBm) | Margin (dB) |
|-----------------------|--------------------------|----------|----------------------|------------------|----------------|----------------------------------|--------------|-------------------------|-----------|----------------------|-------------|
| 806.0125              | 1612.0250                | PK       | 10.70                | H                | 4.68           | 28.20                            | 3.00         | 43.58                   | -53.80    | -13.00               | 40.80       |
| 806.0125              | 1612.0250                | PK       | 10.80                | V                | 4.68           | 28.20                            | 3.00         | 43.68                   | -53.70    | -13.00               | 40.70       |
| 806.0125              | 2418.0375                | PK       | 12.20                | H                | 5.61           | 31.86                            | 3.00         | 49.68                   | -47.70    | -13.00               | 34.70       |
| 806.0125              | 2418.0375                | PK       | 11.80                | V                | 5.61           | 31.86                            | 3.00         | 49.28                   | -48.10    | -13.00               | 35.10       |
| 806.0125              | 3224.0500                | PK       | 14.70                | H                | 6.64           | 32.68                            | 3.00         | 54.01                   | -43.36    | -13.00               | 30.36       |
| 806.0125              | 3224.0500                | PK       | 13.80                | V                | 6.64           | 32.68                            | 3.00         | 53.11                   | -44.26    | -13.00               | 31.26       |
| 806.0125              | 4030.0625                | PK       | 14.10                | H                | 7.22           | 33.39                            | 3.00         | 54.70                   | -42.67    | -13.00               | 29.67       |
| 806.0125              | 4030.0625                | PK       | 14.40                | V                | 7.22           | 33.39                            | 3.00         | 55.00                   | -42.37    | -13.00               | 29.37       |
| 806.0125              | 4836.0750                | PK       | 13.90                | H                | 7.18           | 33.94                            | 3.00         | 55.03                   | -42.35    | -13.00               | 29.35       |
| 806.0125              | 4836.0750                | PK       | 14.00                | V                | 7.18           | 33.94                            | 3.00         | 55.13                   | -42.25    | -13.00               | 29.25       |
| 806.0125              | 5642.0875                | PK       | 14.60                | H                | 8.18           | 34.52                            | 3.00         | 57.30                   | -40.07    | -13.00               | 27.07       |
| 806.0125              | 5642.0875                | PK       | 14.20                | V                | 8.18           | 34.52                            | 3.00         | 56.90                   | -40.47    | -13.00               | 27.47       |
| 806.0125              | 6448.1000                | PK       | 14.00                | H                | 8.97           | 35.52                            | 3.00         | 58.49                   | -38.88    | -13.00               | 25.88       |
| 806.0125              | 6448.1000                | PK       | 14.00                | V                | 8.97           | 35.52                            | 3.00         | 58.49                   | -38.88    | -13.00               | 25.88       |
| 806.0125              | 7254.1125                | PK       | 15.50                | H                | 9.51           | 36.31                            | 3.00         | 61.33                   | -36.05    | -13.00               | 23.05       |
| 806.0125              | 7254.1125                | PK       | 14.60                | V                | 9.51           | 36.31                            | 3.00         | 60.43                   | -36.95    | -13.00               | 23.95       |
| 806.0125              | 8060.1250                | PK       | 14.40                | H                | 9.88           | 35.78                            | 3.00         | 60.05                   | -37.32    | -13.00               | 24.32       |
| 806.0125              | 8060.1250                | PK       | 14.10                | V                | 9.88           | 35.78                            | 3.00         | 59.75                   | -37.62    | -13.00               | 24.62       |



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.9.5 Uplink, 812 MHz

| Tuned Frequency (MHz) | Emission Frequency (MHz) | Detector | Meter Reading (dBuV) | Antenna Polarity | Coax Loss (dB) | Antenna Correction Factor (dB/m) | Distance (m) | Field Strength (dBuV/m) | ERP (dBm) | Spurious Limit (dBm) | Margin (dB) |
|-----------------------|--------------------------|----------|----------------------|------------------|----------------|----------------------------------|--------------|-------------------------|-----------|----------------------|-------------|
| 812.00                | 1624.00                  | PK       | 10.50                | H                | 4.70           | 28.33                            | 3.00         | 43.53                   | -53.85    | -13.00               | 40.85       |
| 812.00                | 1624.00                  | PK       | 10.50                | V                | 4.70           | 28.33                            | 3.00         | 43.53                   | -53.85    | -13.00               | 40.85       |
| 812.00                | 2436.00                  | PK       | 12.60                | H                | 5.61           | 31.85                            | 3.00         | 50.06                   | -47.32    | -13.00               | 34.32       |
| 812.00                | 2436.00                  | PK       | 12.20                | V                | 5.61           | 31.85                            | 3.00         | 49.66                   | -47.72    | -13.00               | 34.72       |
| 812.00                | 3248.00                  | PK       | 13.50                | H                | 6.65           | 32.68                            | 3.00         | 52.83                   | -44.55    | -13.00               | 31.55       |
| 812.00                | 3248.00                  | PK       | 13.90                | V                | 6.65           | 32.68                            | 3.00         | 53.23                   | -44.15    | -13.00               | 31.15       |
| 812.00                | 4060.00                  | PK       | 13.80                | H                | 7.17           | 33.38                            | 3.00         | 54.35                   | -43.02    | -13.00               | 30.02       |
| 812.00                | 4060.00                  | PK       | 14.90                | V                | 7.17           | 33.38                            | 3.00         | 55.45                   | -41.92    | -13.00               | 28.92       |
| 812.00                | 4872.00                  | PK       | 13.90                | H                | 7.28           | 33.93                            | 3.00         | 55.11                   | -42.26    | -13.00               | 29.26       |
| 812.00                | 4872.00                  | PK       | 14.20                | V                | 7.28           | 33.93                            | 3.00         | 55.41                   | -41.96    | -13.00               | 28.96       |
| 812.00                | 5684.00                  | PK       | 14.10                | H                | 8.04           | 34.58                            | 3.00         | 56.73                   | -40.65    | -13.00               | 27.65       |
| 812.00                | 5684.00                  | PK       | 14.30                | V                | 8.04           | 34.58                            | 3.00         | 56.93                   | -40.45    | -13.00               | 27.45       |
| 812.00                | 6496.00                  | PK       | 14.40                | H                | 9.08           | 35.53                            | 3.00         | 59.01                   | -38.36    | -13.00               | 25.36       |
| 812.00                | 6496.00                  | PK       | 14.40                | V                | 9.08           | 35.53                            | 3.00         | 59.01                   | -38.36    | -13.00               | 25.36       |
| 812.00                | 7308.00                  | PK       | 14.50                | H                | 9.62           | 36.27                            | 3.00         | 60.39                   | -36.99    | -13.00               | 23.99       |
| 812.00                | 7308.00                  | PK       | 14.10                | V                | 9.62           | 36.27                            | 3.00         | 59.99                   | -37.39    | -13.00               | 24.39       |
| 812.00                | 8120.00                  | PK       | 13.70                | H                | 9.96           | 35.80                            | 3.00         | 59.46                   | -37.92    | -13.00               | 24.92       |
| 812.00                | 8120.00                  | PK       | 13.50                | V                | 9.96           | 35.80                            | 3.00         | 59.26                   | -38.12    | -13.00               | 25.12       |



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.9.6 Uplink, 823.9875 MHz


| Tuned Frequency (MHz) | Emission Frequency (MHz) | Detector | Meter Reading (dBuV) | Antenna Polarity | Coax Loss (dB) | Antenna Correction Factor (dB/m) | Distance (m) | Field Strength (dBuV/m) | ERP (dBm) | Spurious Limit (dBm) | Margin (dB) |
|-----------------------|--------------------------|----------|----------------------|------------------|----------------|----------------------------------|--------------|-------------------------|-----------|----------------------|-------------|
| 823.9875              | 1647.9750                | PK       | 10.20                | H                | 4.72           | 28.58                            | 3.00         | 43.51                   | -53.87    | -13.00               | 40.87       |
| 823.9875              | 1647.9750                | PK       | 11.20                | V                | 4.72           | 28.58                            | 3.00         | 44.51                   | -52.87    | -13.00               | 39.87       |
| 823.9875              | 2471.9625                | PK       | 12.20                | H                | 5.62           | 32.03                            | 3.00         | 49.85                   | -47.53    | -13.00               | 34.53       |
| 823.9875              | 2471.9625                | PK       | 12.00                | V                | 5.62           | 32.03                            | 3.00         | 49.65                   | -47.73    | -13.00               | 34.73       |
| 823.9875              | 3295.9500                | PK       | 13.20                | H                | 6.70           | 32.63                            | 3.00         | 52.53                   | -44.85    | -13.00               | 31.85       |
| 823.9875              | 3295.9500                | PK       | 13.30                | V                | 6.70           | 32.63                            | 3.00         | 52.63                   | -44.75    | -13.00               | 31.75       |
| 823.9875              | 4119.9375                | PK       | 13.70                | H                | 7.09           | 33.41                            | 3.00         | 54.20                   | -43.18    | -13.00               | 30.18       |
| 823.9875              | 4119.9375                | PK       | 13.90                | V                | 7.09           | 33.41                            | 3.00         | 54.40                   | -42.98    | -13.00               | 29.98       |
| 823.9875              | 4943.9250                | PK       | 13.90                | H                | 7.77           | 33.94                            | 3.00         | 55.61                   | -41.77    | -13.00               | 28.77       |
| 823.9875              | 4943.9250                | PK       | 14.90                | V                | 7.77           | 33.94                            | 3.00         | 56.61                   | -40.77    | -13.00               | 27.77       |
| 823.9875              | 5767.9125                | PK       | 13.60                | H                | 8.23           | 34.70                            | 3.00         | 56.53                   | -40.85    | -13.00               | 27.85       |
| 823.9875              | 5767.9125                | PK       | 14.40                | V                | 8.23           | 34.70                            | 3.00         | 57.33                   | -40.05    | -13.00               | 27.05       |
| 823.9875              | 6591.9000                | PK       | 14.40                | H                | 9.20           | 35.65                            | 3.00         | 59.25                   | -38.13    | -13.00               | 25.13       |
| 823.9875              | 6591.9000                | PK       | 14.20                | V                | 9.20           | 35.65                            | 3.00         | 59.05                   | -38.33    | -13.00               | 25.33       |
| 823.9875              | 7415.8875                | PK       | 14.00                | H                | 9.52           | 36.04                            | 3.00         | 59.56                   | -37.82    | -13.00               | 24.82       |
| 823.9875              | 7415.8875                | PK       | 13.80                | V                | 9.52           | 36.04                            | 3.00         | 59.36                   | -38.02    | -13.00               | 25.02       |
| 823.9875              | 8239.8750                | PK       | 14.10                | H                | 10.02          | 35.80                            | 3.00         | 59.91                   | -37.46    | -13.00               | 24.46       |
| 823.9875              | 8239.8750                | PK       | 14.00                | V                | 10.02          | 35.80                            | 3.00         | 59.81                   | -37.56    | -13.00               | 24.56       |



## 8.10 Modulation Characteristics

*Referenced from test report "TR\_6057-23\_UL\_FCC 90\_Booster Class B\_1.docx".*

Limits from FCC Parts 2.1047, and test procedure from ANSI C63.26-2015.

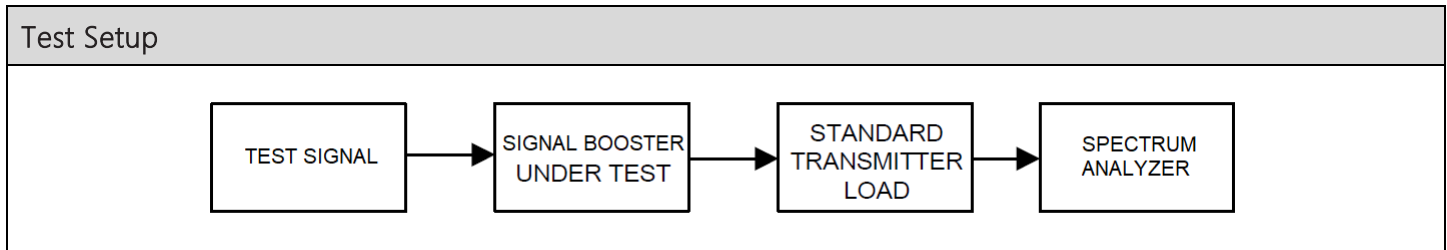


N/A. The EUT does not have any means to modulate the incoming signal.



## 8.11 Frequency Stability

Referenced from test report "TR\_6057-23\_UL\_FCC 90\_Booster Class B\_1.docx".

Limits from FCC Parts 2.1055, 90.213 (a); and test procedure from ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

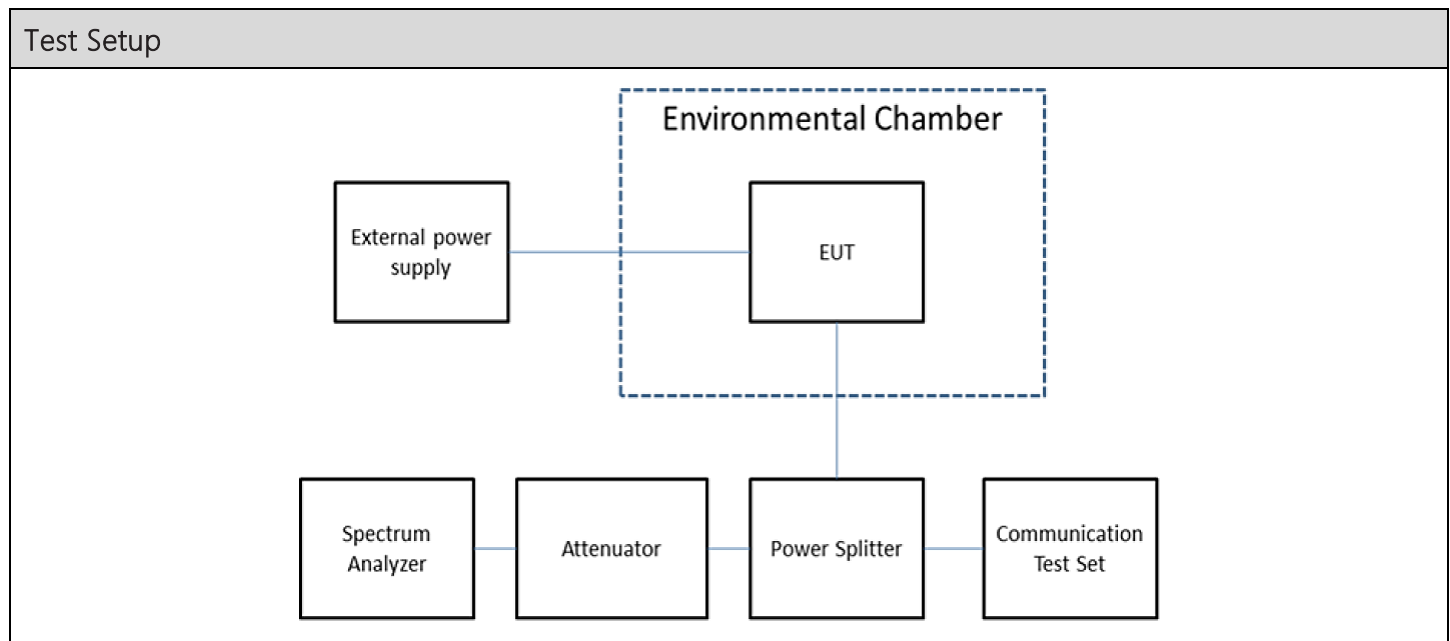

| Test Results, Mode 1  |                     |             |
|-----------------------|---------------------|-------------|
| Tuned Frequency (MHz) | Max Deviation (kHz) | Limit (ppm) |
| n/a                   | n/a                 | n/a         |

N/A. The EUT does not alter the input signal in any way.



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

## 8.12 Transient Frequency Behavior

*Referenced from test report "TR\_6057-23\_UL\_FCC 90\_Booster Class B\_1.docx".*

Limits from FCC Part 90.214; and test procedure from ANSI C63.26-2015.

N/A. The EUT does not "key-on" or "key off", and instead transmits indefinitely.



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

### 8.13 Adjacent channel power limits

*Referenced from test report "TR\_6057-23\_UL\_FCC 90\_Booster Class B\_1.docx".*

Limits from FCC Part 90.221, and test procedure from ANSI C63.26-2015.

N/A. Device does not operate in a band requiring ACP measurement.



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

## 9. ANNEX-A - Photographs of the EUT

Photographs of the EUT and any manufacturer supplied accessories to be used with the EUT are in separate supplementary documents labelled EXTERNAL PHOTOS and INTERNAL PHOTOS.

## 10. ANNEX-B – Test Setup Photographs

Test setup photographs are located in a separate supplementary ANNEX-B document.

## 11. History of Test Report Changes

| Test Report #                         | Revision # | Description     | Date of Issue |
|---------------------------------------|------------|-----------------|---------------|
| TR_6061-23_UL_FCC 90_Booster Class A_ | 1          | Initial release | 2/7/2023      |
|                                       |            |                 |               |
|                                       |            |                 |               |



Timco Engineering, Inc., an IIA Company  
849 NW State Road 45, Newberry, Florida 32669  
(352) 472-5500 / [testing@timcoengr.com](mailto:testing@timcoengr.com)

---

END OF TEST REPORT

---