





Band4-1.4MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

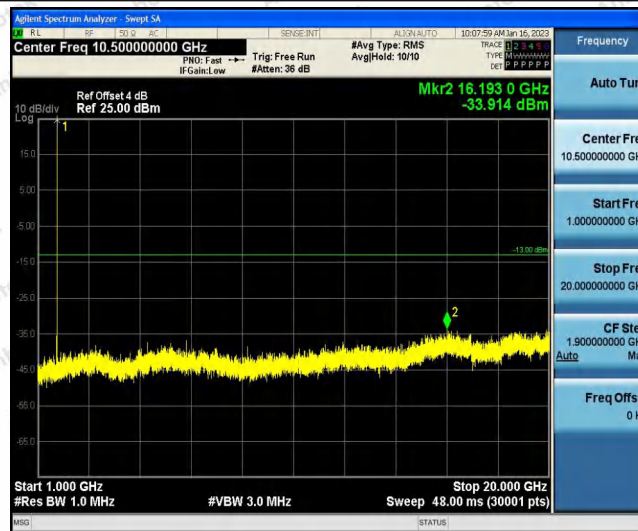


Band4-1.4MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

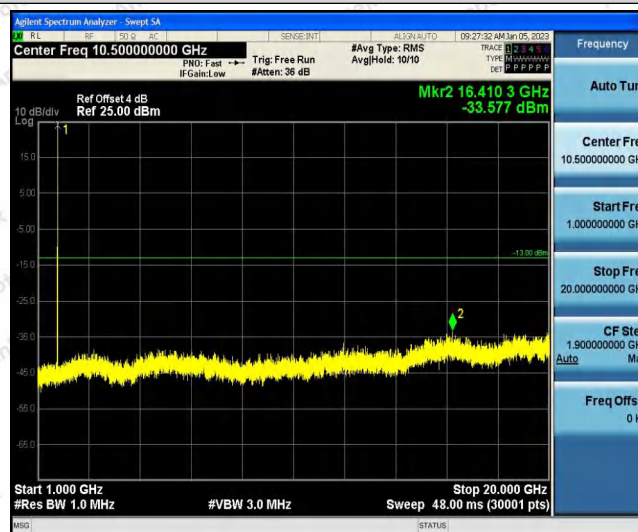


Band4-1.4MHz-QPSK-20393-1RB#0-Range1:30~1000MHz




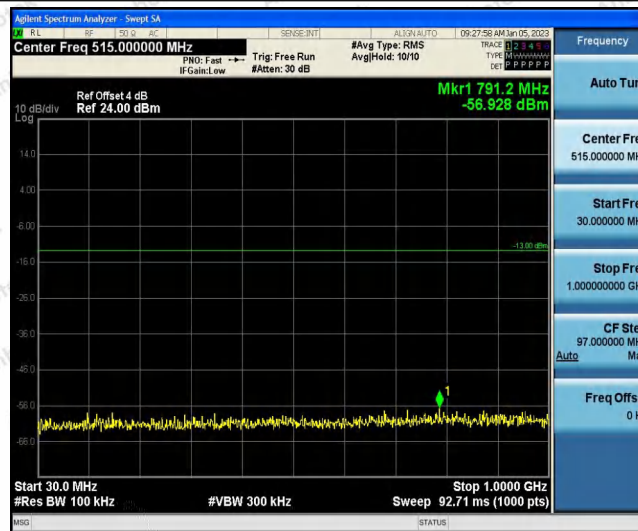

Band4-1.4MHz-QPSK-20393-1RB#0-Range2:1000~20000MHz

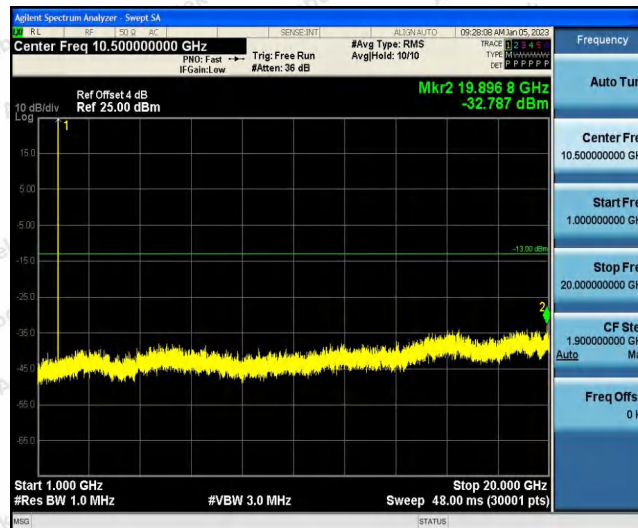

Band4-1.4MHz-16QAM-19957-1RB#0-Range1:30~1000MHz

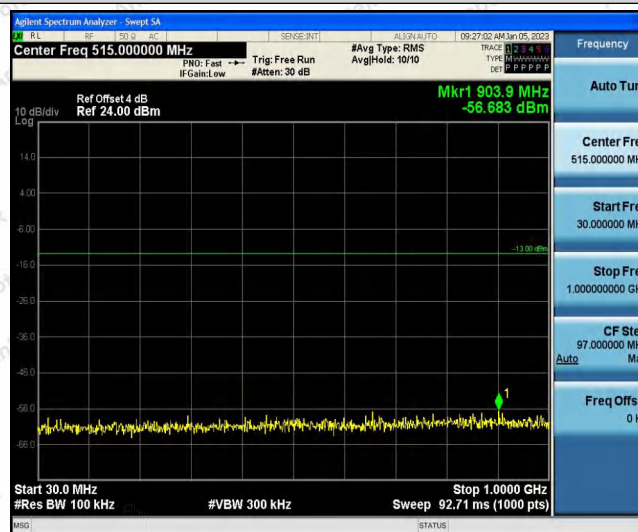

Band4-1.4MHz-16QAM-19957-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




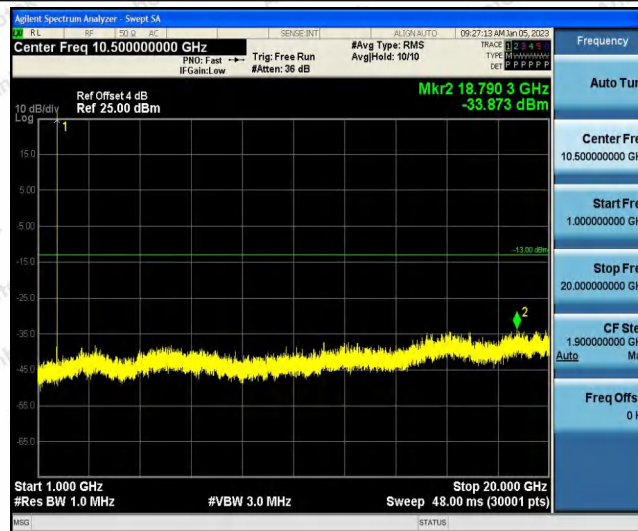

Band4-1.4MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

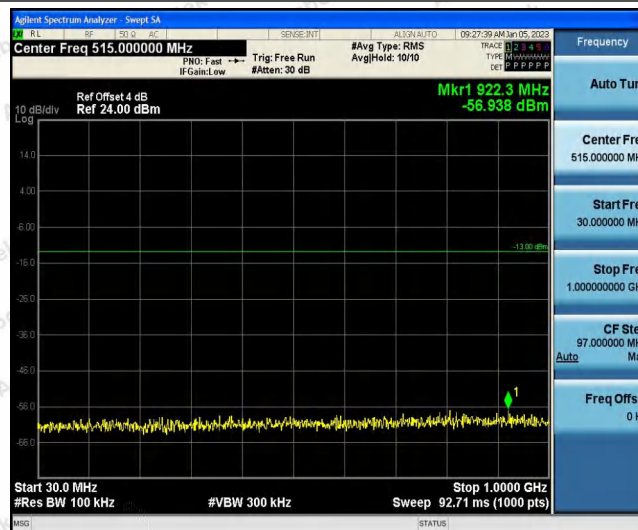

Band4-1.4MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

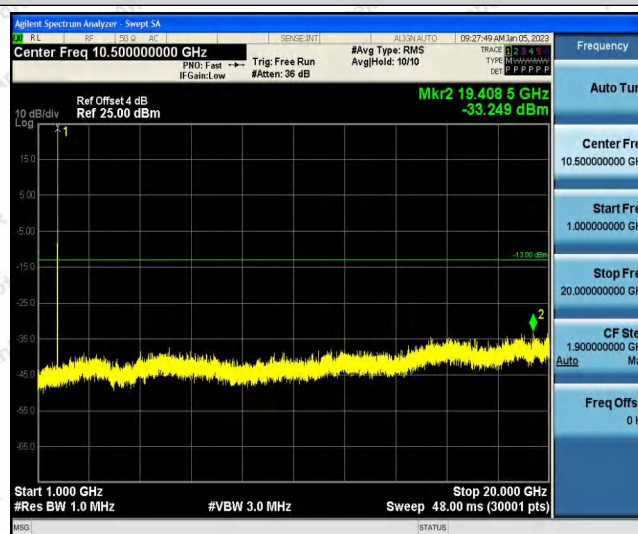


Band4-1.4MHz-16QAM-20393-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com.cn




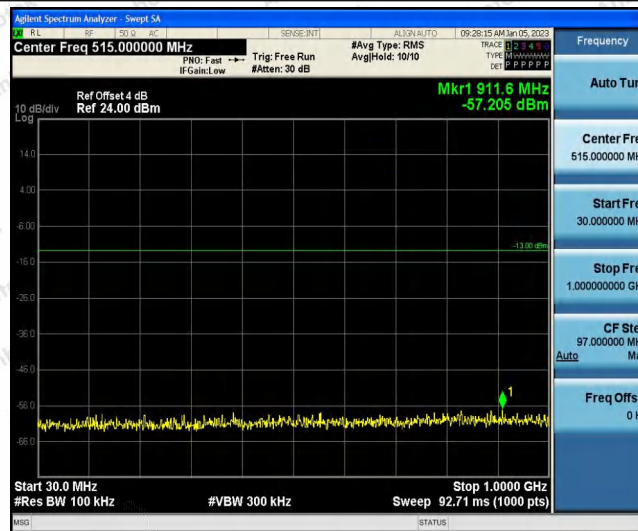

Band4-1.4MHz-16QAM-20393-1RB#0-Range2:1000~20000MHz

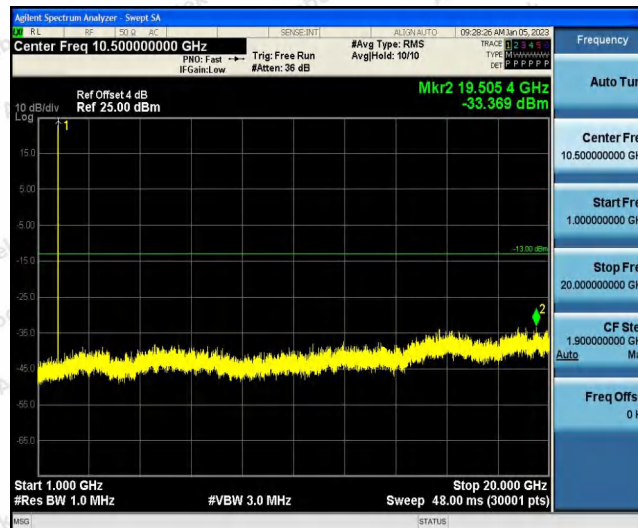

Band4-3MHz-QPSK-19965-1RB#0-Range1:30~1000MHz

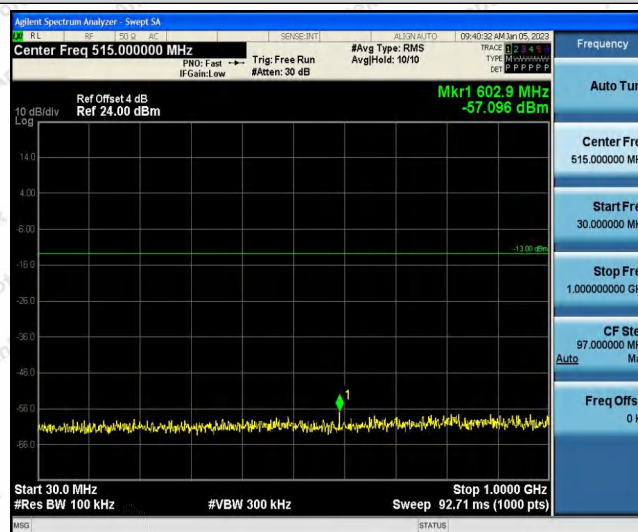

Band4-3MHz-QPSK-19965-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band4-3MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

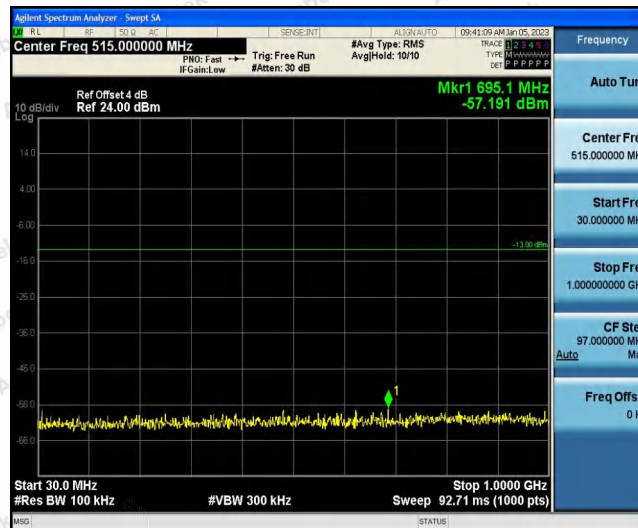

Band4-3MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

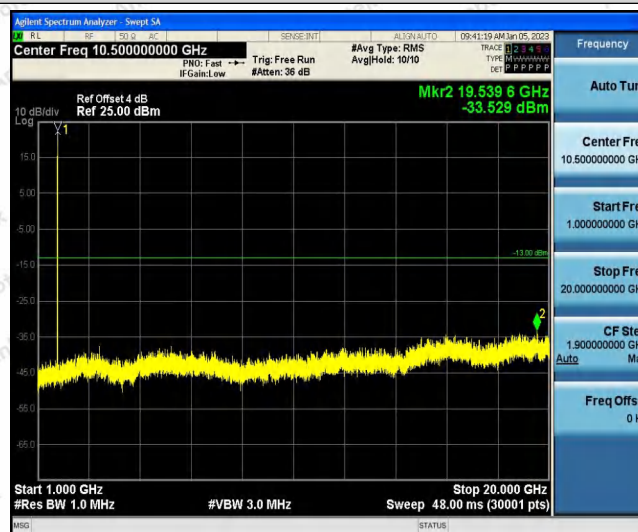


Band4-3MHz-QPSK-20385-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
www.anbotek.com.cn




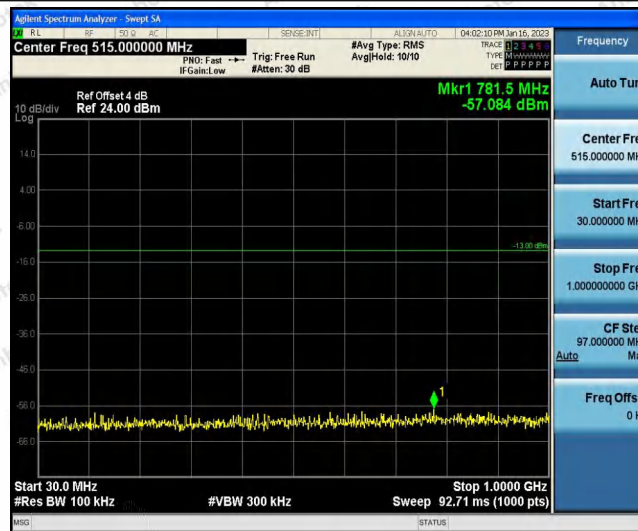

Band4-3MHz-QPSK-20385-1RB#0-Range2:1000~20000MHz

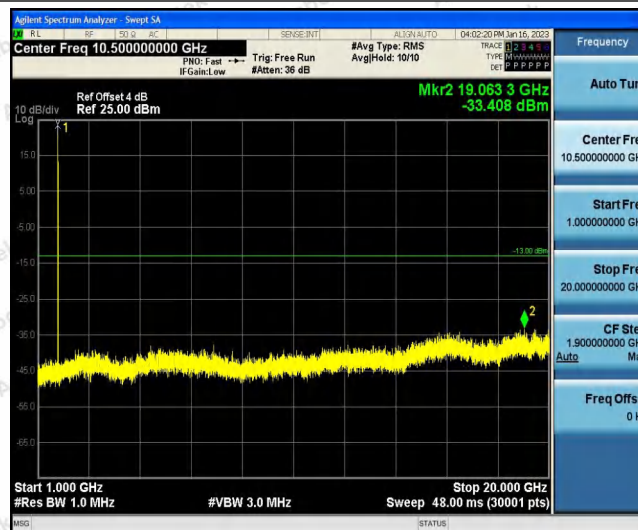

Band4-3MHz-16QAM-19965-1RB#0-Range1:30~1000MHz

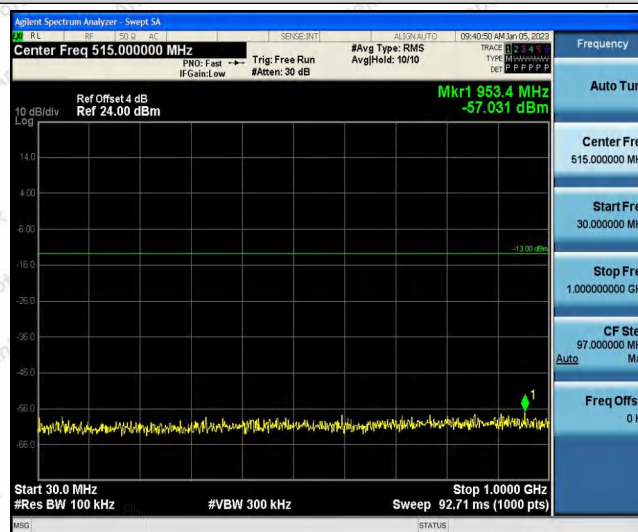

Band4-3MHz-16QAM-19965-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




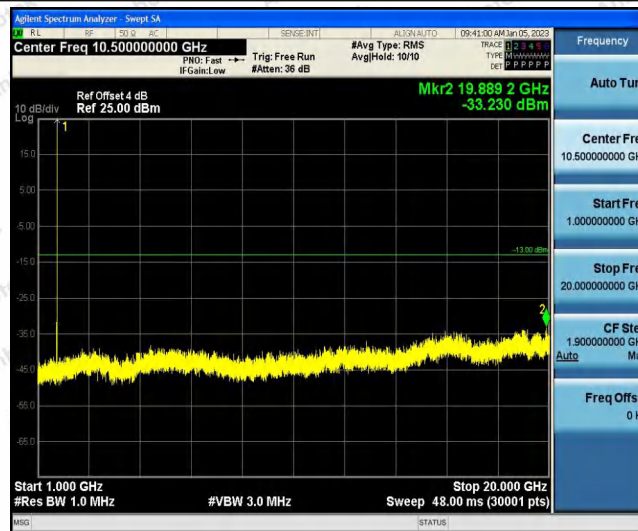

Band4-3MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

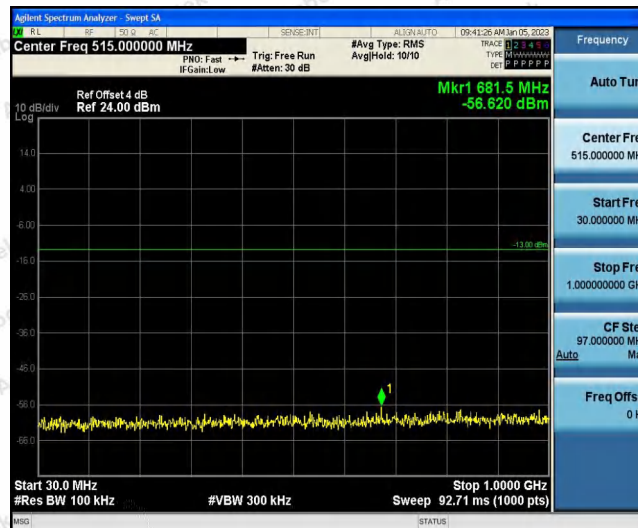

Band4-3MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

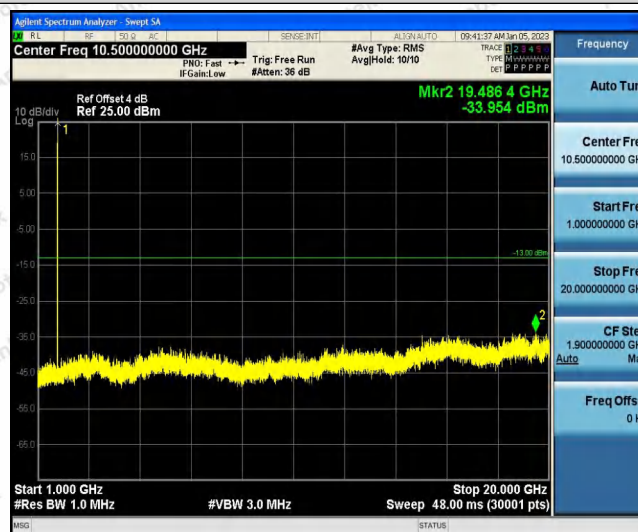

Band4-3MHz-16QAM-20385-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




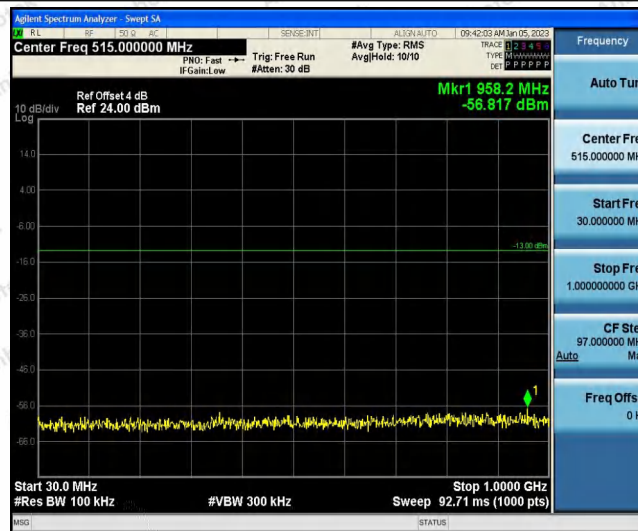

Band4-3MHz-16QAM-20385-1RB#0-Range2:1000~20000MHz

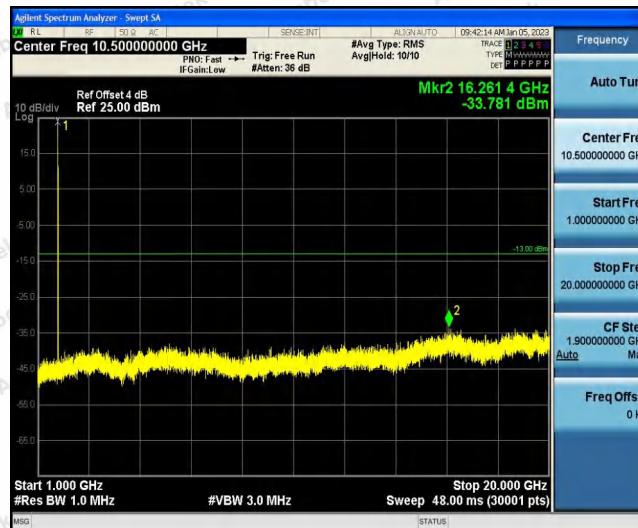

Band4-5MHz-QPSK-19975-1RB#0-Range1:30~1000MHz

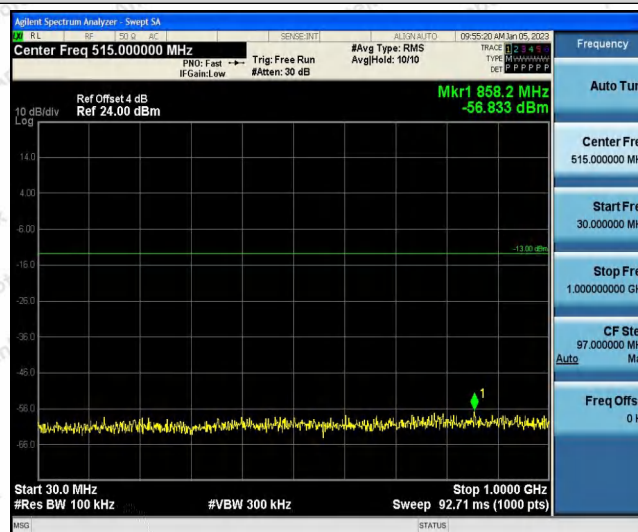

Band4-5MHz-QPSK-19975-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




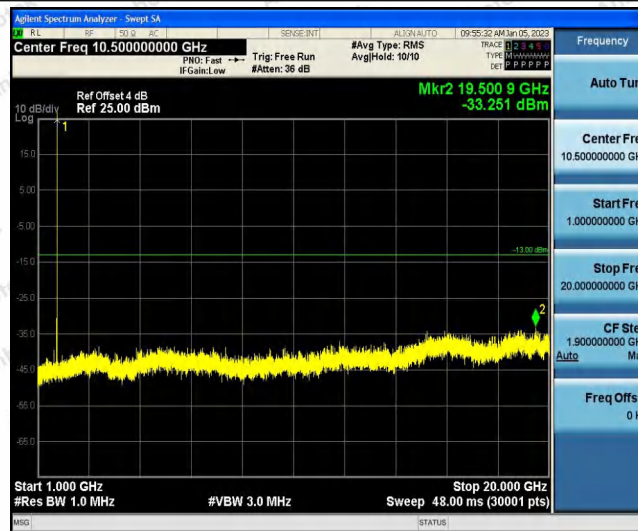

Band4-5MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

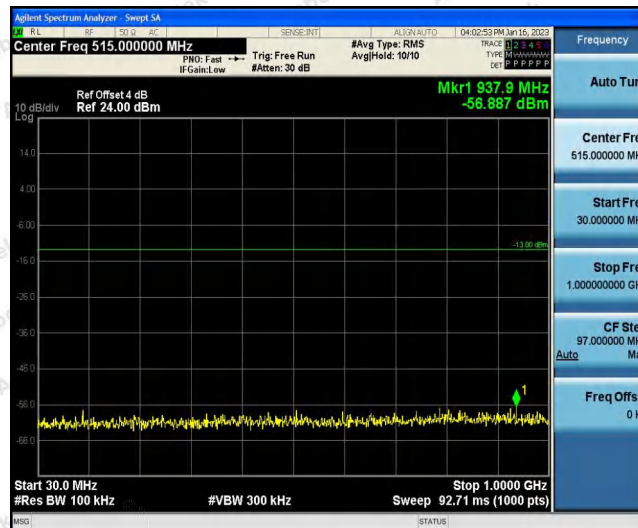

Band4-5MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

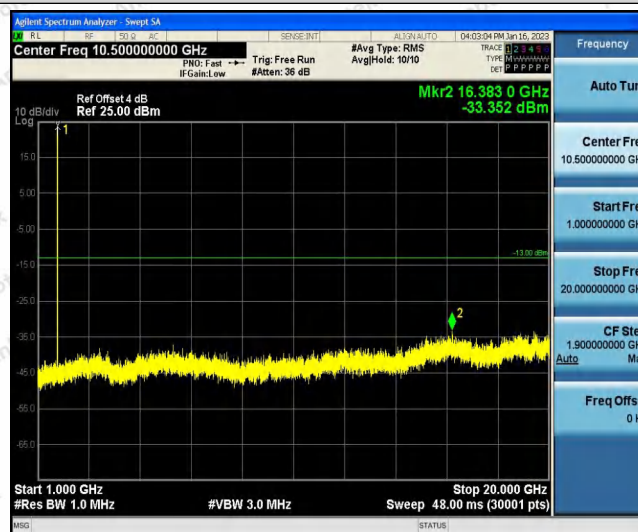

Band4-5MHz-QPSK-20375-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




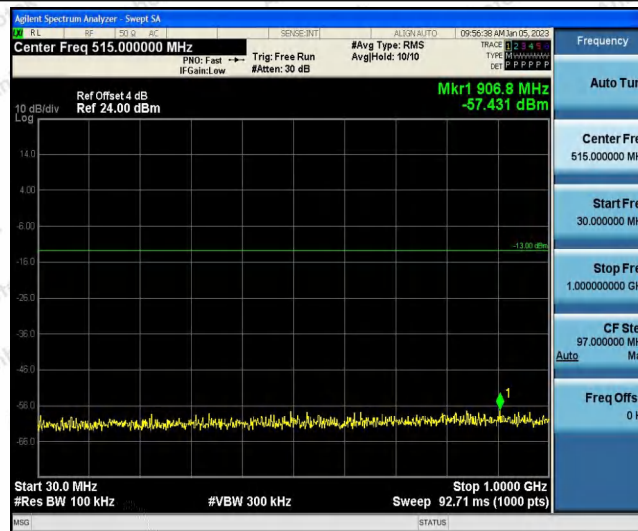

Band4-5MHz-QPSK-20375-1RB#0-Range2:1000~20000MHz

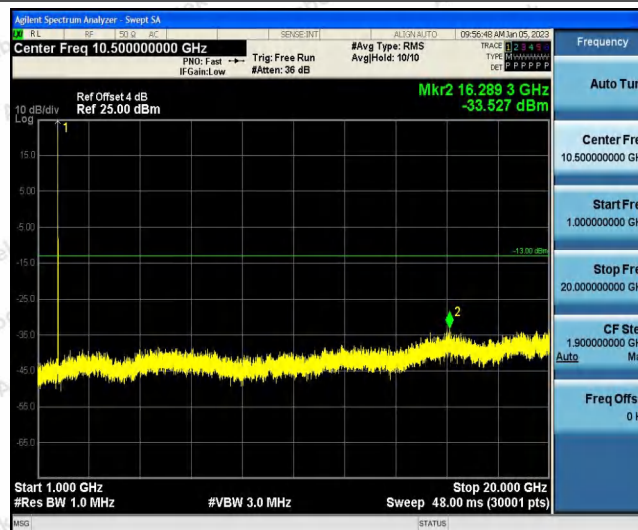

Band4-5MHz-16QAM-19975-1RB#0-Range1:30~1000MHz

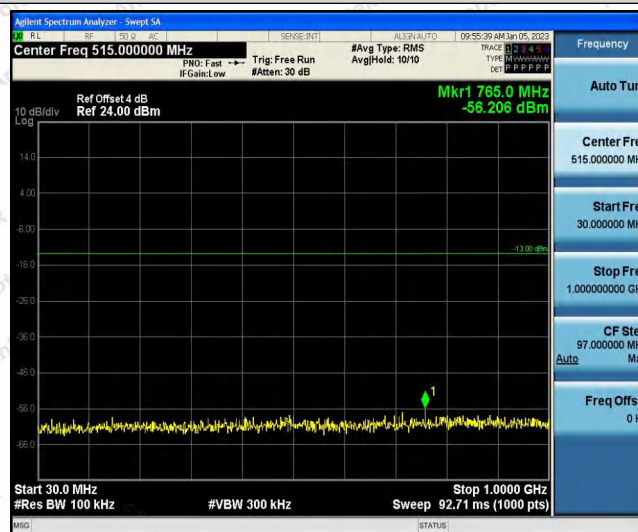

Band4-5MHz-16QAM-19975-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




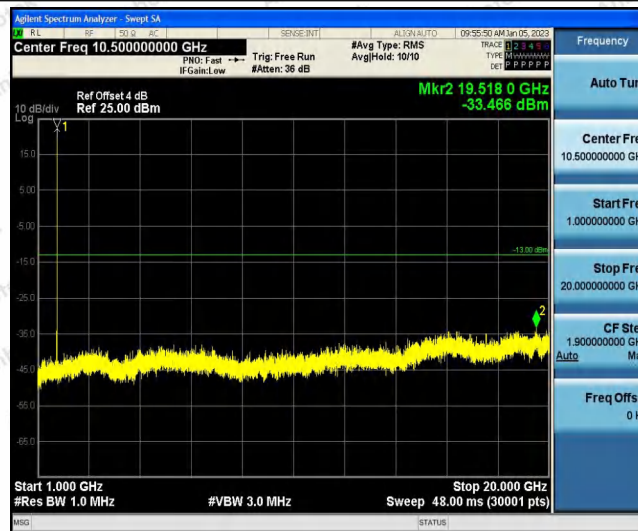

Band4-5MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

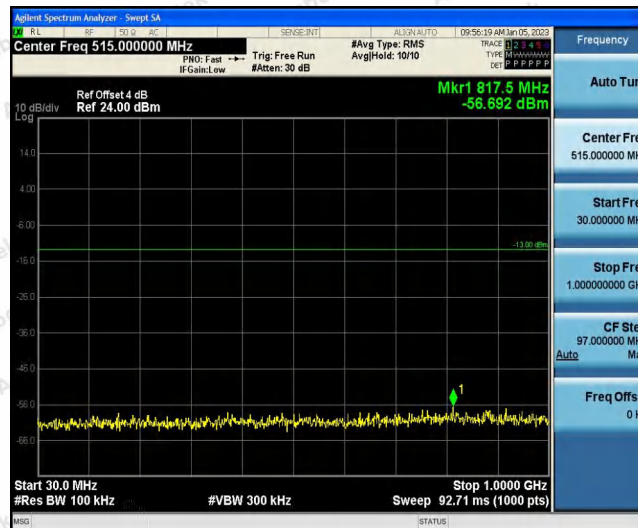

Band4-5MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

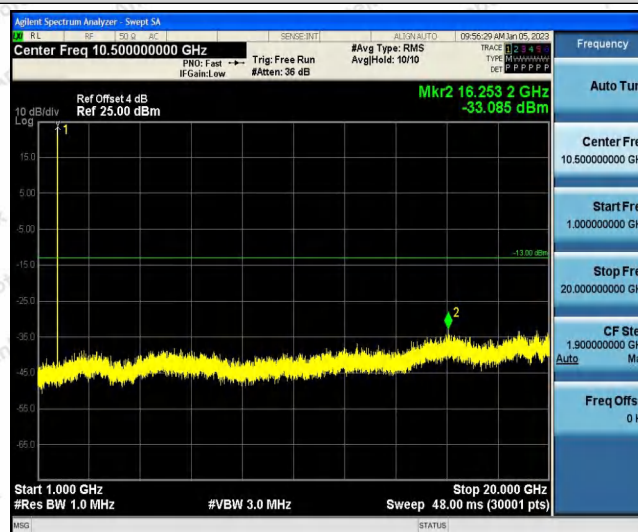

Band4-5MHz-16QAM-20375-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




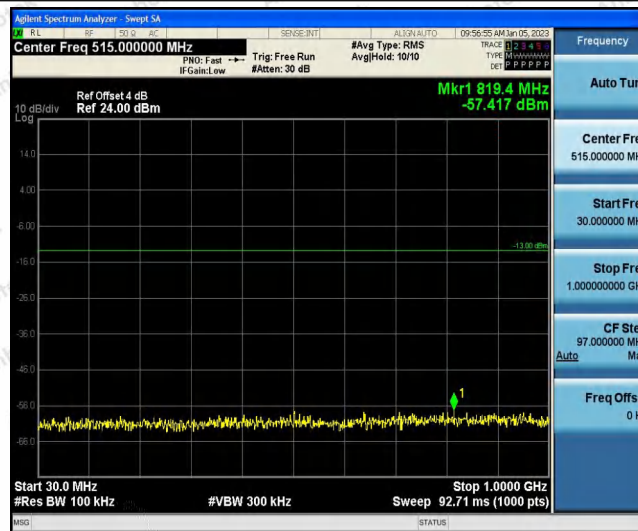

Band4-5MHz-16QAM-20375-1RB#0-Range2:1000~20000MHz

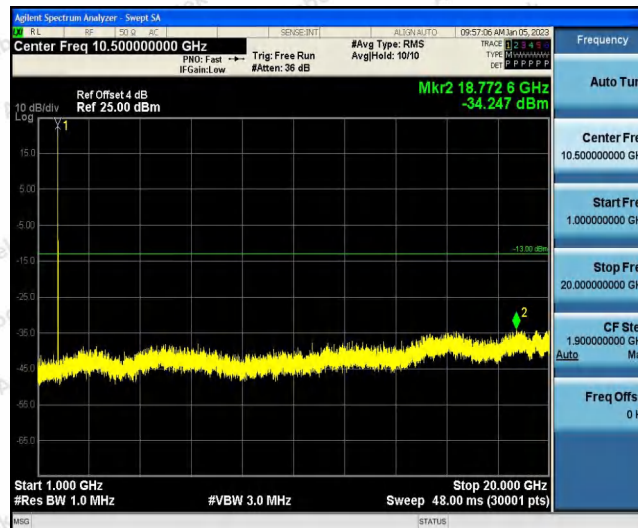

Band4-10MHz-QPSK-20000-1RB#0-Range1:30~1000MHz

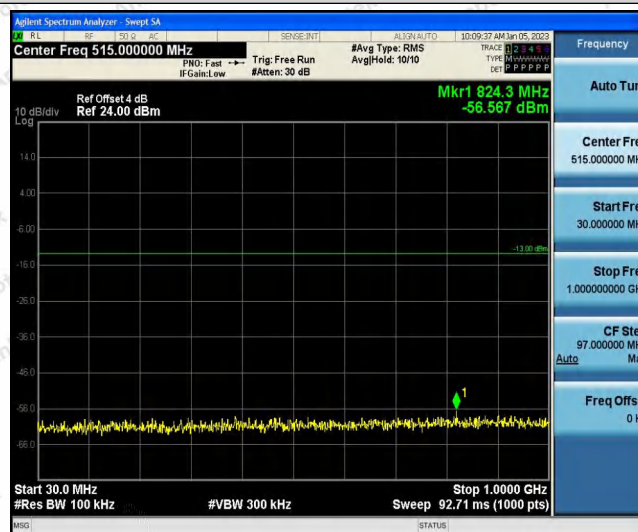

Band4-10MHz-QPSK-20000-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




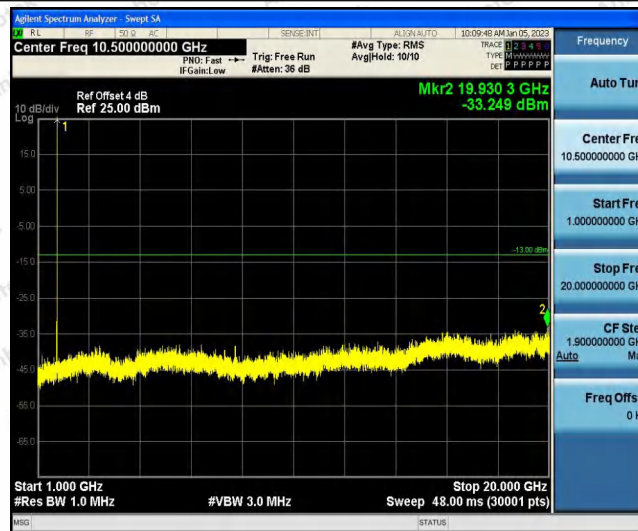

Band4-10MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

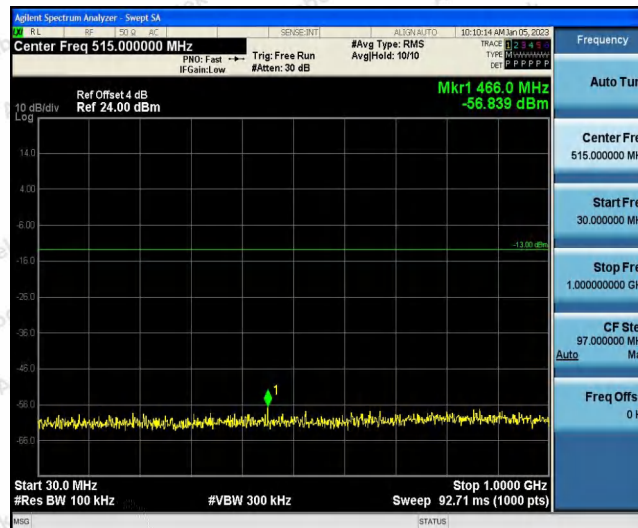

Band4-10MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

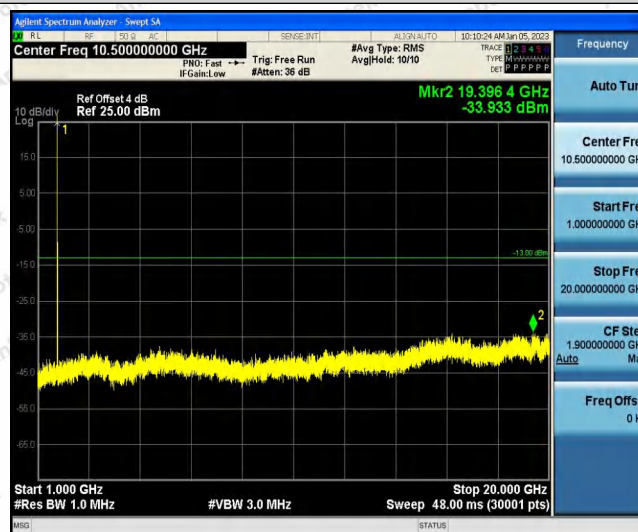

Band4-10MHz-QPSK-20350-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




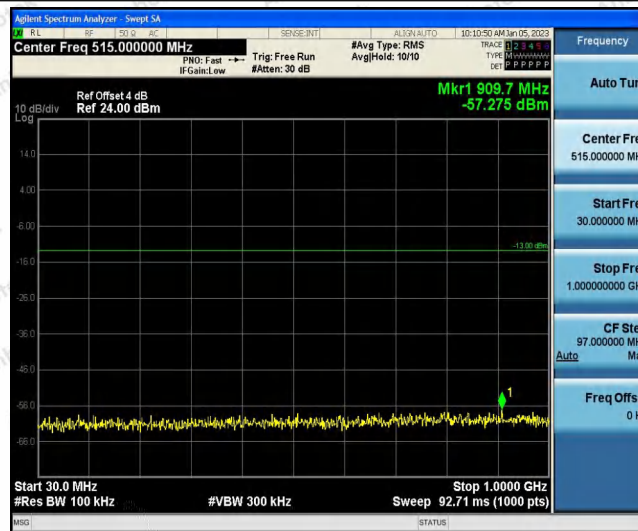

Band4-10MHz-QPSK-20350-1RB#0-Range2:1000~20000MHz

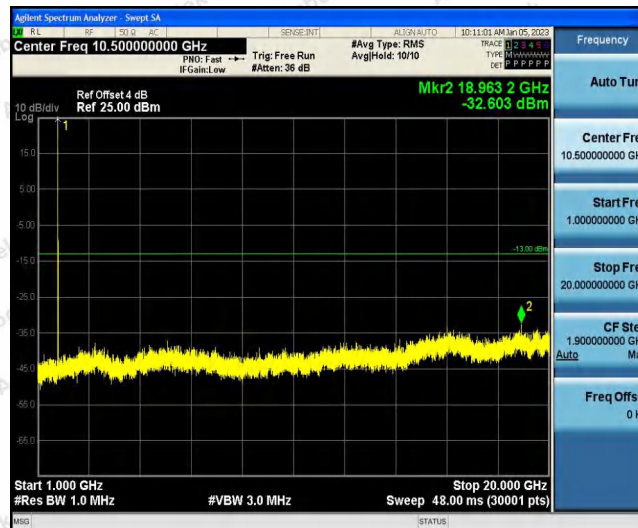

Band4-10MHz-16QAM-20000-1RB#0-Range1:30~1000MHz

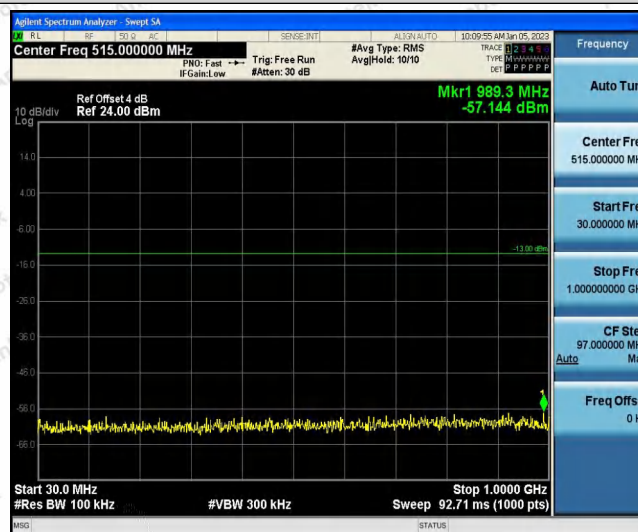

Band4-10MHz-16QAM-20000-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




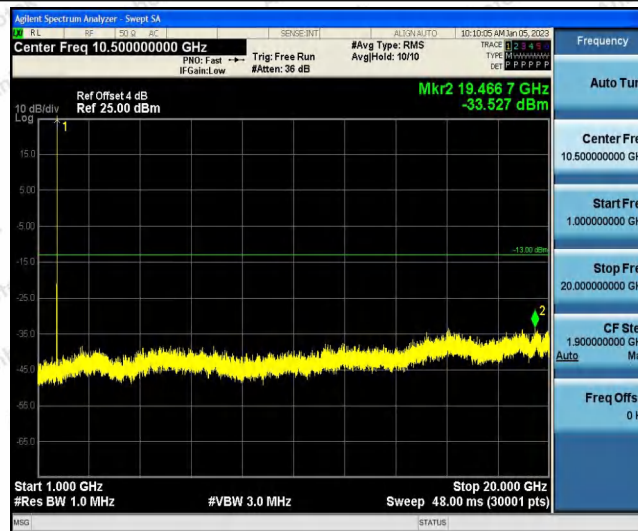

Band4-10MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

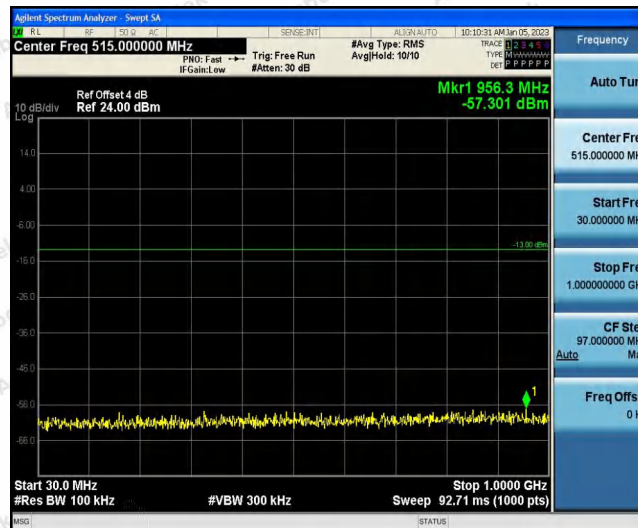

Band4-10MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

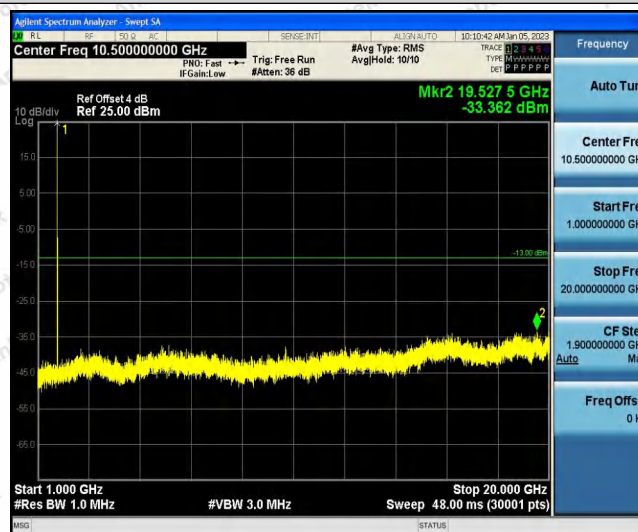

Band4-10MHz-16QAM-20350-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




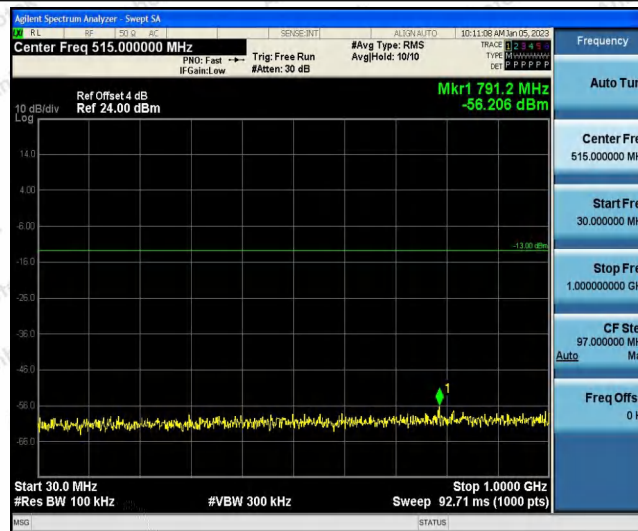

Band4-10MHz-16QAM-20350-1RB#0-Range2:1000~20000MHz

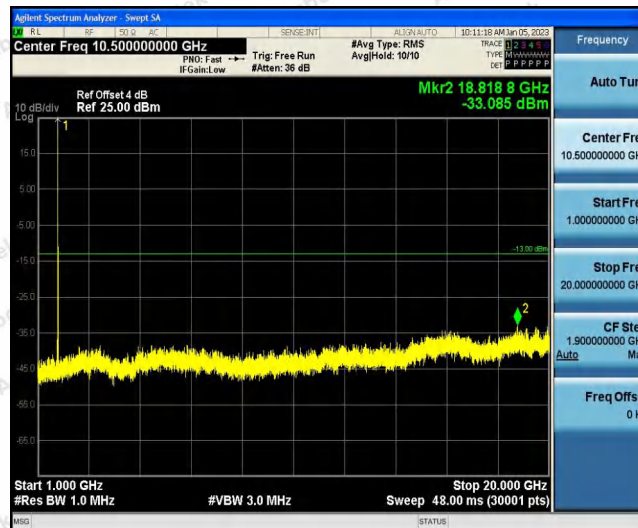

Band4-15MHz-QPSK-20025-1RB#0-Range1:30~1000MHz

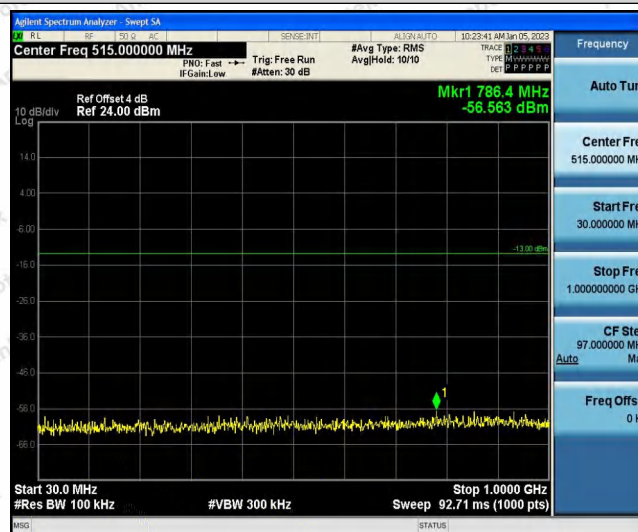

Band4-15MHz-QPSK-20025-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




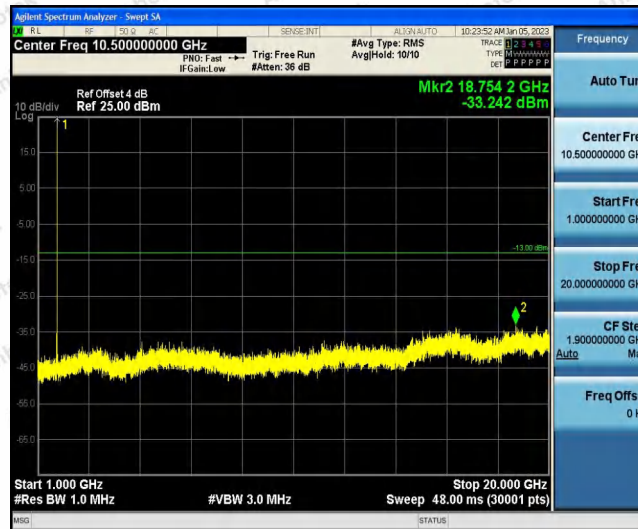

Band4-15MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

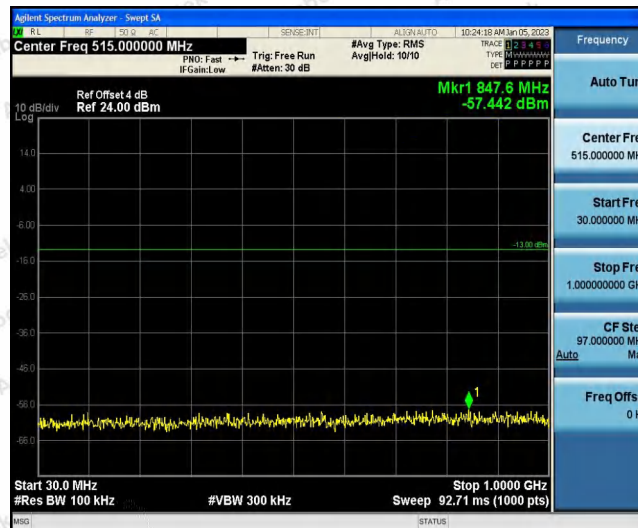


Band4-15MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

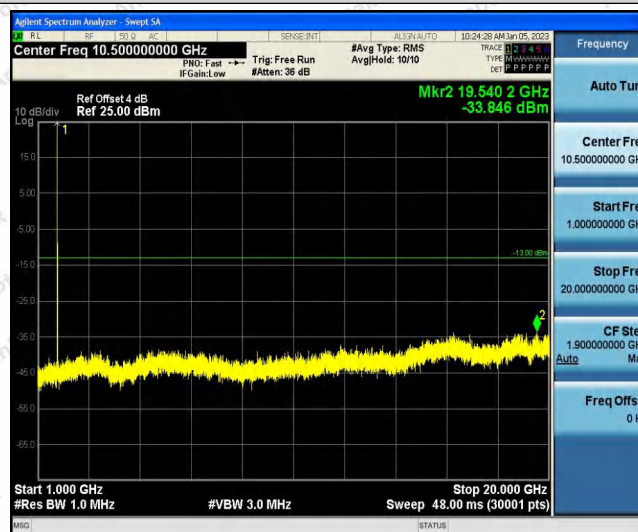


Band4-15MHz-QPSK-20325-1RB#0-Range1:30~1000MHz




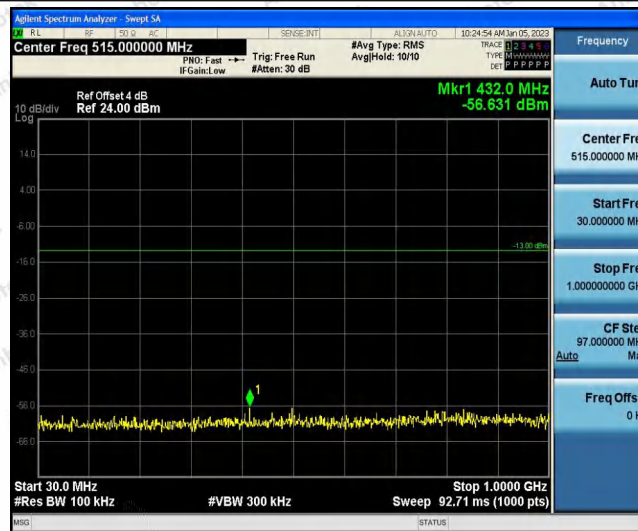

Band4-15MHz-QPSK-20325-1RB#0-Range2:1000~20000MHz

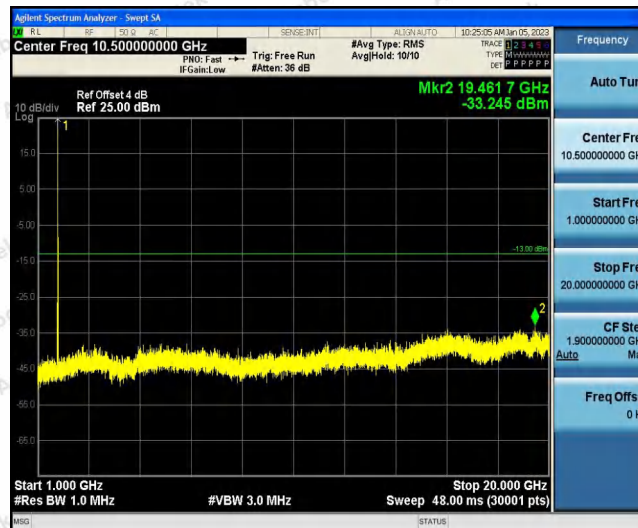

Band4-15MHz-16QAM-20025-1RB#0-Range1:30~1000MHz

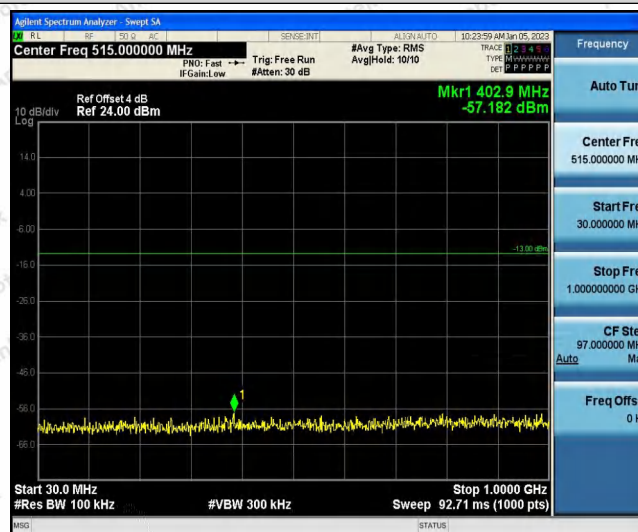

Band4-15MHz-16QAM-20025-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band4-15MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

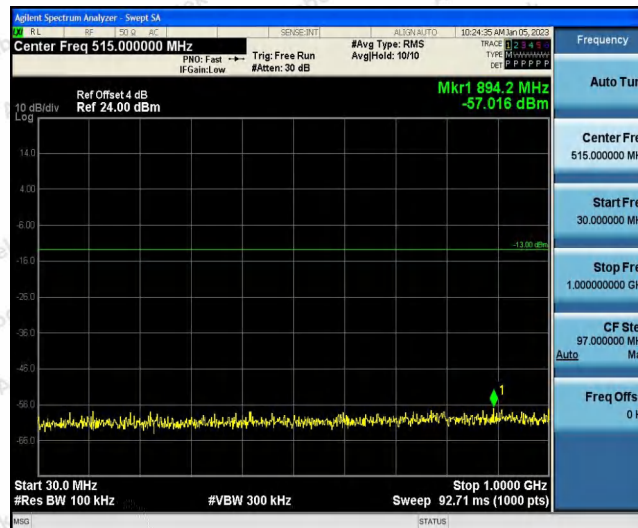


Band4-15MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

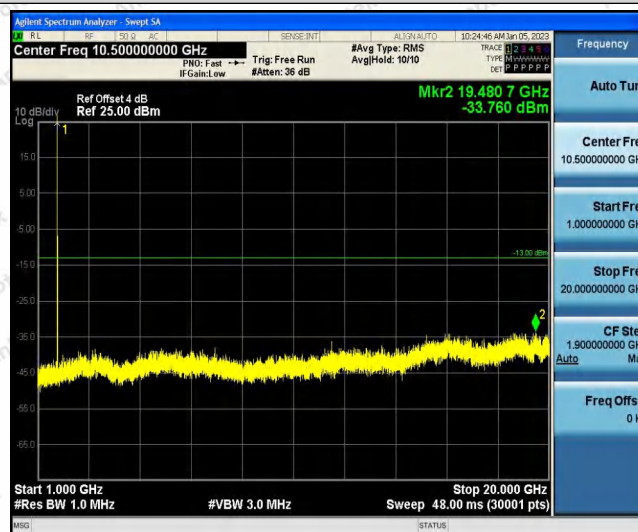


Band4-15MHz-16QAM-20325-1RB#0-Range1:30~1000MHz




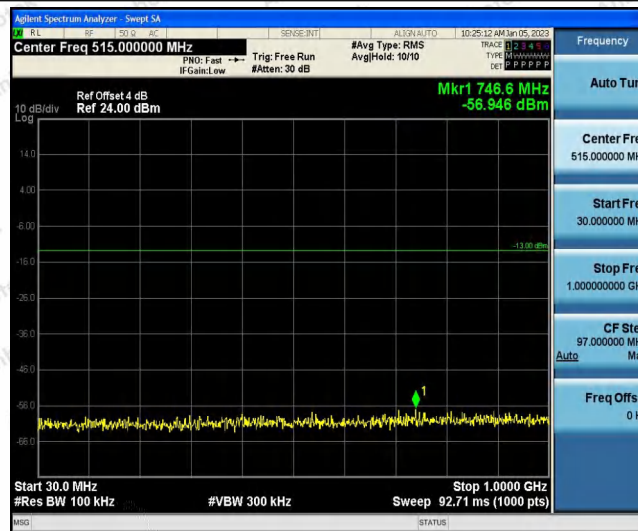

Band4-15MHz-16QAM-20325-1RB#0-Range2:1000~20000MHz

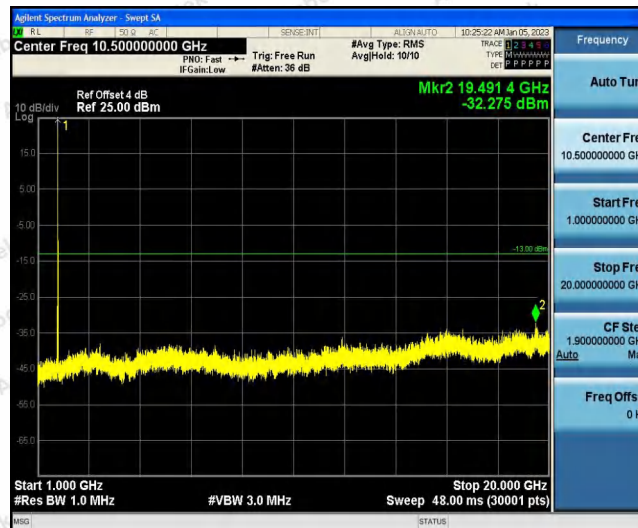

Band4-20MHz-QPSK-20050-1RB#0-Range1:30~1000MHz

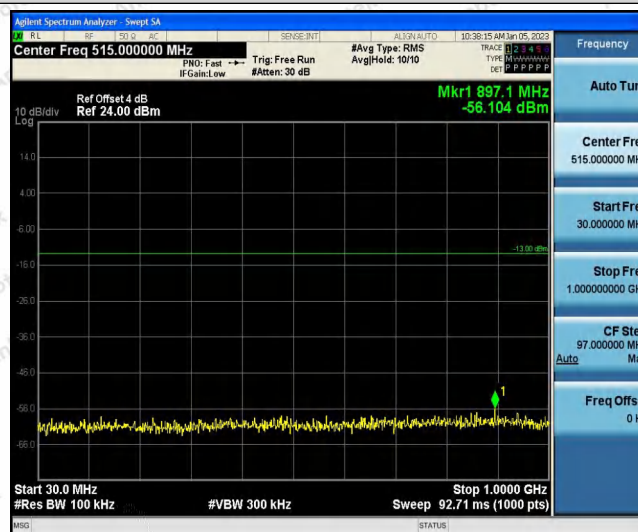

Band4-20MHz-QPSK-20050-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




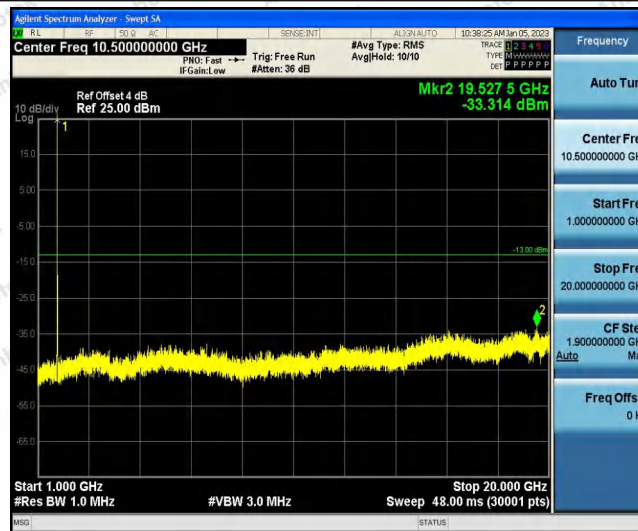

Band4-20MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

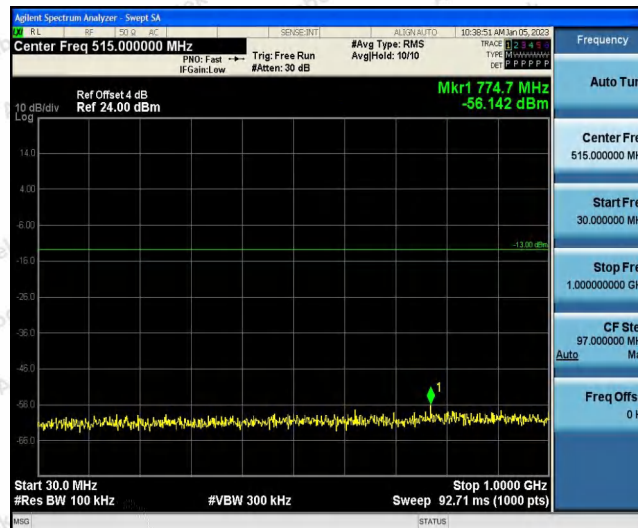

Band4-20MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

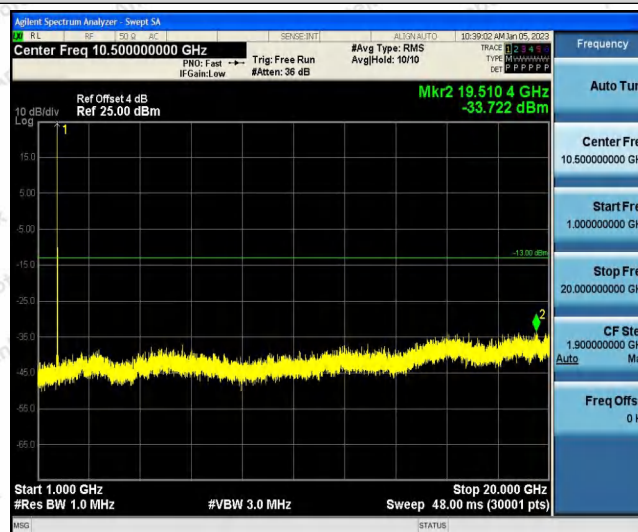

Band4-20MHz-QPSK-20300-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




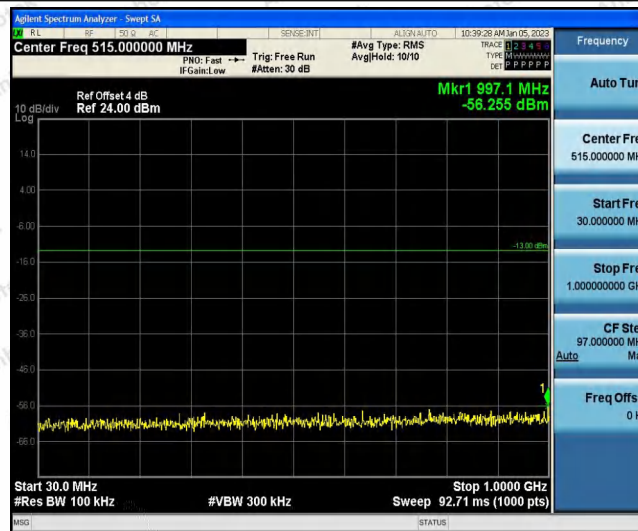

Band4-20MHz-QPSK-20300-1RB#0-Range2:1000~20000MHz

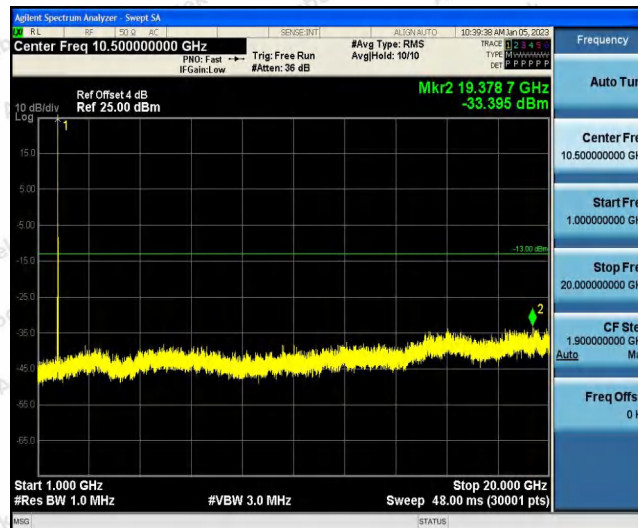

Band4-20MHz-16QAM-20050-1RB#0-Range1:30~1000MHz

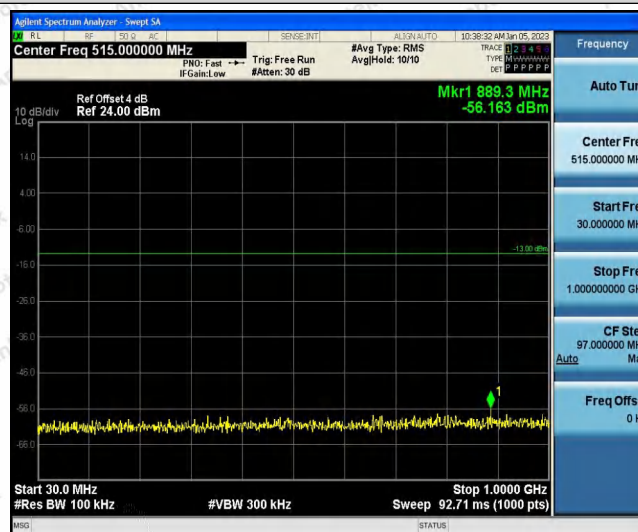

Band4-20MHz-16QAM-20050-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




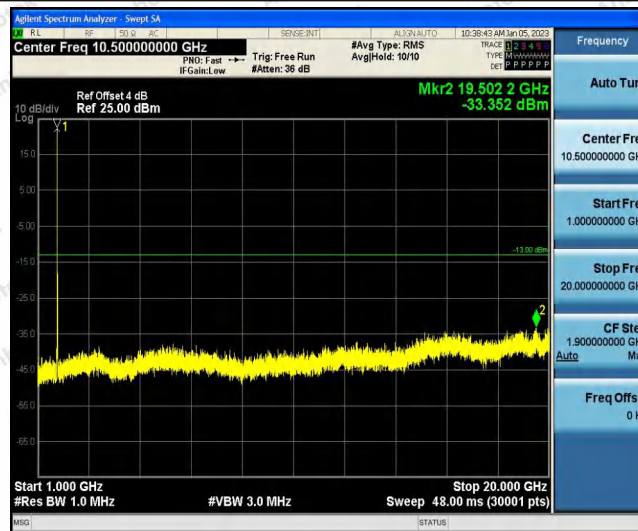

Band4-20MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

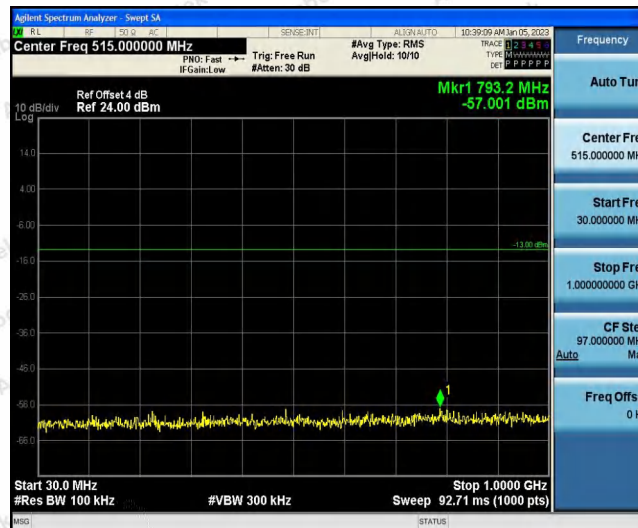

Band4-20MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

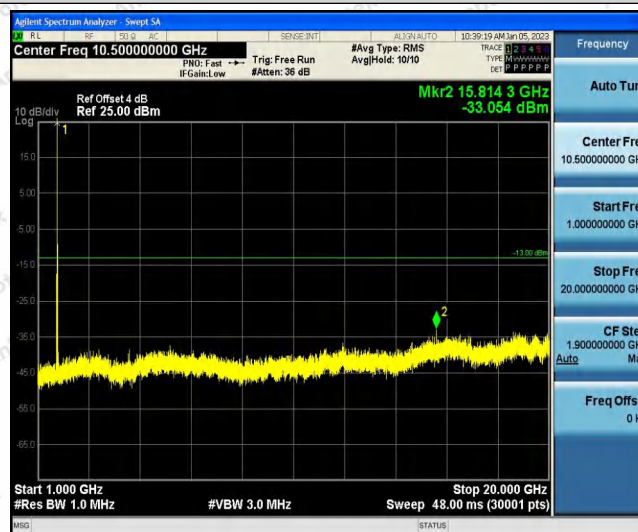

Band4-20MHz-16QAM-20300-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



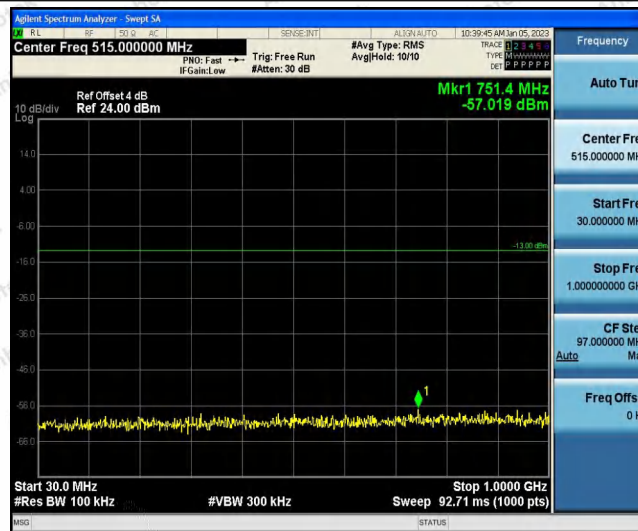

Band4-20MHz-16QAM-20300-1RB#0-Range2:1000~20000MHz

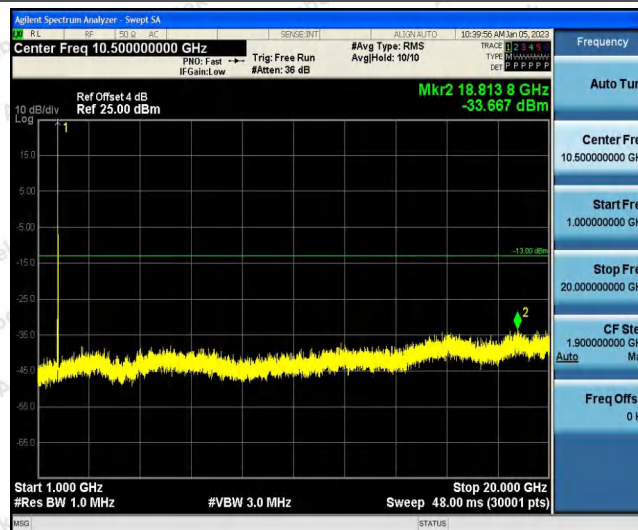

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band4	1.4MHz	QPSK	19957	6RB#0	VL	NT	6.92	0.004045	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VN	NT	10.24	0.005986	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VH	NT	5.94	0.003472	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VL	NT	8.27	0.004773	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VN	NT	9.34	0.005391	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VH	NT	12.40	0.007157	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VL	NT	-12.96	-0.007388	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VN	NT	-14.78	-0.008425	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VH	NT	-12.56	-0.007160	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VL	NT	4.05	0.002367	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VN	NT	2.66	0.001555	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VH	NT	4.96	0.002899	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VL	NT	15.58	0.008993	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VN	NT	18.42	0.010632	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VH	NT	14.55	0.008398	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VL	NT	-13.29	-0.007576	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VN	NT	-15.16	-0.008642	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VH	NT	-13.63	-0.007769	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VL	NT	4.45	0.002600	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VN	NT	6.31	0.003687	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VH	NT	5.21	0.003044	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VL	NT	4.25	0.002453	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VN	NT	4.71	0.002719	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VH	NT	3.89	0.002245	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VL	NT	4.58	0.002612	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VN	NT	4.78	0.002726	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VH	NT	3.89	0.002218	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VL	NT	5.56	0.003249	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VN	NT	5.62	0.003284	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VH	NT	6.68	0.003903	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VL	NT	6.35	0.003665	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VN	NT	4.61	0.002661	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VH	NT	4.36	0.002517	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VL	NT	5.14	0.002931	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band4	3MHz	16QAM	20385	15RB#0	VN	NT	4.81	0.002743	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VH	NT	4.23	0.002412	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VL	NT	8.71	0.005086	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VN	NT	7.51	0.004385	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VH	NT	7.41	0.004327	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VL	NT	5.95	0.003434	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VN	NT	5.68	0.003278	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VH	NT	5.65	0.003261	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VL	NT	-3.49	-0.001991	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VN	NT	-5.87	-0.003350	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VH	NT	-3.05	-0.001740	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VL	NT	3.72	0.002172	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VN	NT	5.59	0.003264	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VH	NT	5.18	0.003025	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VL	NT	5.11	0.002949	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VN	NT	5.31	0.003065	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VH	NT	5.36	0.003094	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VL	NT	4.29	0.002448	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VN	NT	-3.71	-0.002117	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VH	NT	-4.38	-0.002499	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VL	NT	-5.79	-0.003376	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VN	NT	-4.13	-0.002408	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VH	NT	-3.22	-0.001878	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VL	NT	5.29	0.003053	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VN	NT	4.31	0.002488	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VH	NT	5.56	0.003209	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VL	NT	5.36	0.003063	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VN	NT	5.72	0.003269	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VH	NT	6.42	0.003669	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VL	NT	-4.71	-0.002746	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VN	NT	-4.89	-0.002851	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VH	NT	-4.76	-0.002776	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VL	NT	4.98	0.002874	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VN	NT	2.70	0.001558	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VH	NT	4.91	0.002834	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VL	NT	3.26	0.001863	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VN	NT	5.21	0.002977	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VH	NT	7.32	0.004183	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VL	NT	3.92	0.002282	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VN	NT	3.53	0.002055	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VH	NT	4.03	0.002346	±2.5	PASS



Band4	15MHz	QPSK	20175	75RB#0	VL	NT	2.89	0.001668	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VN	NT	5.11	0.002949	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VH	NT	3.83	0.002211	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VL	NT	4.73	0.002707	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VN	NT	6.68	0.003823	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VH	NT	3.52	0.002014	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VL	NT	2.12	0.001234	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VN	NT	-3.38	-0.001968	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VH	NT	4.18	0.002434	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VL	NT	2.07	0.001195	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VN	NT	2.72	0.001570	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VH	NT	4.61	0.002661	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VL	NT	-3.20	-0.001831	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VN	NT	4.18	0.002392	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VH	NT	4.59	0.002627	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VL	NT	3.82	0.002221	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VN	NT	6.74	0.003919	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VH	NT	3.50	0.002035	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VL	NT	3.56	0.002055	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VN	NT	-3.22	-0.001859	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VH	NT	4.13	0.002384	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VL	NT	-5.15	-0.002951	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VN	NT	-7.22	-0.004138	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VH	NT	-4.69	-0.002688	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VL	NT	3.65	0.002122	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VN	NT	3.56	0.002070	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VH	NT	5.99	0.003483	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VL	NT	-2.68	-0.001547	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VN	NT	3.49	0.002014	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VH	NT	-3.56	-0.002055	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VL	NT	-3.38	-0.001937	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VN	NT	-4.23	-0.002424	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VH	NT	-3.66	-0.002097	±2.5	PASS



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-30	7.04	0.004115	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-20	7.97	0.004659	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	0	5.25	0.003069	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	10	5.14	0.003005	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	20	-3.03	-0.001771	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-30	13.82	0.007977	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-20	14.92	0.008612	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	0	15.31	0.008837	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	10	15.39	0.008883	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	20	15.18	0.008762	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-30	-13.59	-0.007747	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-20	-15.23	-0.008682	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	0	-16.67	-0.009502	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	10	-14.96	-0.008528	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	20	-17.60	-0.010032	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-30	-4.86	-0.002841	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-20	-3.96	-0.002315	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	0	-4.25	-0.002484	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	10	-3.35	-0.001958	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	20	-4.85	-0.002835	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-30	14.06	0.008115	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-20	12.00	0.006926	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	0	9.48	0.005472	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	10	7.97	0.004600	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	20	7.35	0.004242	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-30	-12.03	-0.006857	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-20	-12.52	-0.007137	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	0	-10.50	-0.005985	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	10	-9.70	-0.005529	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	20	-10.01	-0.005706	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-30	6.27	0.003663	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-20	5.71	0.003336	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	0	5.54	0.003237	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	10	5.71	0.003336	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	20	5.54	0.003237	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band4	3MHz	QPSK	20175	15RB#0	NV	-30	6.31	0.003642	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-20	4.18	0.002413	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	0	7.17	0.004139	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	10	5.34	0.003082	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	20	7.90	0.004560	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-30	7.54	0.004300	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-20	4.82	0.002749	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	0	5.65	0.003222	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	10	4.35	0.002481	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	20	4.02	0.002293	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-30	5.05	0.002951	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-20	5.74	0.003354	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	0	6.54	0.003821	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	10	6.78	0.003961	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	20	7.20	0.004207	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-30	5.65	0.003261	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-20	9.48	0.005472	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	0	8.24	0.004756	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	10	7.47	0.004312	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	20	5.68	0.003278	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-30	5.15	0.002937	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-20	6.28	0.003581	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	0	5.24	0.002988	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	10	3.02	0.001722	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	20	3.39	0.001933	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-30	7.07	0.004128	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-20	6.67	0.003895	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	0	5.46	0.003188	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	10	7.18	0.004193	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	20	5.87	0.003428	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-30	4.18	0.002413	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-20	5.55	0.003203	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	0	4.22	0.002436	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	10	5.79	0.003342	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	20	3.72	0.002147	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-30	-3.98	-0.002271	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-20	-2.45	-0.001398	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	0	-3.58	-0.002043	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	10	2.43	0.001387	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	20	4.02	0.002294	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-30	4.55	0.002657	±2.5	PASS



Band4	5MHz	16QAM	19975	25RB#0	NV	-20	5.32	0.003107	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	0	4.59	0.002680	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	10	5.56	0.003247	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	20	6.82	0.003982	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-30	4.98	0.002874	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-20	3.39	0.001957	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	0	8.17	0.004716	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	10	2.76	0.001593	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	20	6.04	0.003486	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-30	2.96	0.001689	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-20	-2.79	-0.001592	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	0	2.03	0.001158	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	10	-3.53	-0.002014	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	20	-4.02	-0.002294	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-30	-5.09	-0.002968	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-20	-2.46	-0.001434	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	0	-7.01	-0.004087	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	10	-3.93	-0.002292	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	20	-2.99	-0.001743	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-30	5.31	0.003065	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-20	4.91	0.002834	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	0	3.02	0.001743	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	10	4.72	0.002724	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	20	4.66	0.002690	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-30	5.72	0.003269	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-20	6.37	0.003640	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	0	3.79	0.002166	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	10	7.30	0.004171	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	20	3.66	0.002091	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-30	-4.72	-0.002752	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-20	-5.02	-0.002927	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	0	-2.39	-0.001394	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	10	-5.58	-0.003254	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	20	-2.49	-0.001452	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-30	5.99	0.003457	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-20	4.25	0.002453	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	0	4.49	0.002592	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	10	3.65	0.002107	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	20	2.10	0.001212	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-30	5.59	0.003194	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-20	5.34	0.003051	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band4	10MHz	16QAM	20350	50RB#0	NV	0	6.15	0.003514	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	10	4.92	0.002811	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	20	4.89	0.002794	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-30	3.88	0.002259	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-20	4.45	0.002591	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	0	3.46	0.002015	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	10	4.49	0.002614	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	20	4.41	0.002568	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-30	4.46	0.002574	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-20	4.72	0.002724	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	0	-3.30	-0.001905	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	10	6.15	0.003550	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	20	-1.59	-0.000918	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-30	3.62	0.002072	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-20	6.01	0.003439	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	0	2.62	0.001499	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	10	-2.53	-0.001448	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	20	4.02	0.002300	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-30	-3.62	-0.002108	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-20	3.13	0.001822	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	0	-2.57	-0.001496	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	10	4.85	0.002824	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	20	4.06	0.002364	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-30	3.95	0.002280	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-20	3.16	0.001824	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	0	3.91	0.002257	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	10	3.03	0.001749	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	20	4.91	0.002834	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-30	2.65	0.001516	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-20	-2.16	-0.001236	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	0	3.66	0.002094	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	10	4.33	0.002478	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	20	4.09	0.002340	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-30	4.29	0.002494	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-20	5.19	0.003017	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	0	5.61	0.003262	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	10	4.35	0.002529	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	20	5.89	0.003424	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-30	3.43	0.001980	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-20	2.98	0.001720	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	0	2.20	0.001270	±2.5	PASS



Band4	20MHz	QPSK	20175	100RB#0	NV	10	3.78	0.002182	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	20	5.82	0.003359	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-30	-4.73	-0.002711	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-20	-4.41	-0.002527	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	0	-2.80	-0.001605	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	10	-4.61	-0.002642	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	20	-5.72	-0.003278	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-30	3.68	0.002140	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-20	6.09	0.003541	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	0	4.23	0.002459	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	10	5.04	0.002930	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	20	5.84	0.003395	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-30	5.55	0.003203	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-20	-4.16	-0.002401	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	0	2.20	0.001270	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	10	3.58	0.002066	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	20	2.86	0.001651	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-30	-5.04	-0.002888	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-20	-6.08	-0.003484	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	0	-5.72	-0.003278	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	10	-3.13	-0.001794	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	20	-4.46	-0.002556	±2.5	PASS

---END---

