

## Appendix A3: Min emission bandwidth

### Test Result B4

| Test Mode  | Antenna | Frequency[MHz] | 6db EBW [MHz] | FL[MHz]  | FH[MHz]  | Limit[MHz] | Verdict |
|------------|---------|----------------|---------------|----------|----------|------------|---------|
| 11A        | Ant1    | 5745           | 15.120        | 5737.440 | 5752.560 | 0.5        | PASS    |
|            | Ant2    | 5745           | 15.080        | 5737.440 | 5752.520 | 0.5        | PASS    |
|            | Ant1    | 5785           | 15.080        | 5777.440 | 5792.520 | 0.5        | PASS    |
|            | Ant2    | 5785           | 15.120        | 5777.440 | 5792.560 | 0.5        | PASS    |
|            | Ant1    | 5825           | 15.120        | 5817.440 | 5832.560 | 0.5        | PASS    |
|            | Ant2    | 5825           | 15.120        | 5817.440 | 5832.560 | 0.5        | PASS    |
| 11N20SISO  | Ant1    | 5745           | 15.120        | 5737.440 | 5752.560 | 0.5        | PASS    |
|            | Ant2    | 5745           | 15.080        | 5737.440 | 5752.520 | 0.5        | PASS    |
|            | Ant1    | 5785           | 15.080        | 5777.440 | 5792.520 | 0.5        | PASS    |
|            | Ant2    | 5785           | 15.120        | 5777.440 | 5792.560 | 0.5        | PASS    |
|            | Ant1    | 5825           | 15.120        | 5817.440 | 5832.560 | 0.5        | PASS    |
|            | Ant2    | 5825           | 15.120        | 5817.440 | 5832.560 | 0.5        | PASS    |
| 11N40SISO  | Ant1    | 5755           | 35.040        | 5737.480 | 5772.520 | 0.5        | PASS    |
|            | Ant2    | 5755           | 35.120        | 5737.400 | 5772.520 | 0.5        | PASS    |
|            | Ant1    | 5795           | 35.120        | 5777.400 | 5812.520 | 0.5        | PASS    |
|            | Ant2    | 5795           | 35.040        | 5777.480 | 5812.520 | 0.5        | PASS    |
| 11AC20SISO | Ant1    | 5745           | 15.120        | 5737.440 | 5752.560 | 0.5        | PASS    |
|            | Ant2    | 5745           | 15.120        | 5737.440 | 5752.560 | 0.5        | PASS    |
|            | Ant1    | 5785           | 15.040        | 5777.440 | 5792.480 | 0.5        | PASS    |
|            | Ant2    | 5785           | 15.120        | 5777.440 | 5792.560 | 0.5        | PASS    |
|            | Ant1    | 5825           | 15.120        | 5817.440 | 5832.560 | 0.5        | PASS    |
|            | Ant2    | 5825           | 15.120        | 5817.440 | 5832.560 | 0.5        | PASS    |
| 11AC40SISO | Ant1    | 5755           | 35.120        | 5737.400 | 5772.520 | 0.5        | PASS    |
|            | Ant2    | 5755           | 33.920        | 5737.400 | 5771.320 | 0.5        | PASS    |
|            | Ant1    | 5795           | 35.120        | 5777.400 | 5812.520 | 0.5        | PASS    |
|            | Ant2    | 5795           | 35.120        | 5777.400 | 5812.520 | 0.5        | PASS    |
| 11AC80SISO | Ant1    | 5775           | 75.040        | 5737.400 | 5812.440 | 0.5        | PASS    |
|            | Ant2    | 5775           | 75.200        | 5737.400 | 5812.600 | 0.5        | PASS    |



## Test Graphs B4



## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotech.com



Hotline  
400-003-0500  
anbotek.com.cn



11A\_Ant2\_5825



11N20SISO\_Ant1\_5745



11N20SISO\_Ant2\_5745

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





11N20SISO\_Ant1\_5785



11N20SISO\_Ant2\_5785



## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



## 11N20SISO\_Ant1\_5825



## 11N20SISO\_Ant2\_5825



## 11N40SISO\_Ant1\_5755

### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





11N40SISO\_Ant2\_5755



11N40SISO\_Ant1\_5795



## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



11N40SISO\_Ant2\_5795



11AC20SISO\_Ant1\_5745



11AC20SISO\_Ant2\_5745

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





11AC20SISO\_Ant1\_5785



11AC20SISO\_Ant2\_5785



## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn



11AC20SISO\_Ant1\_5825



11AC20SISO\_Ant2\_5825

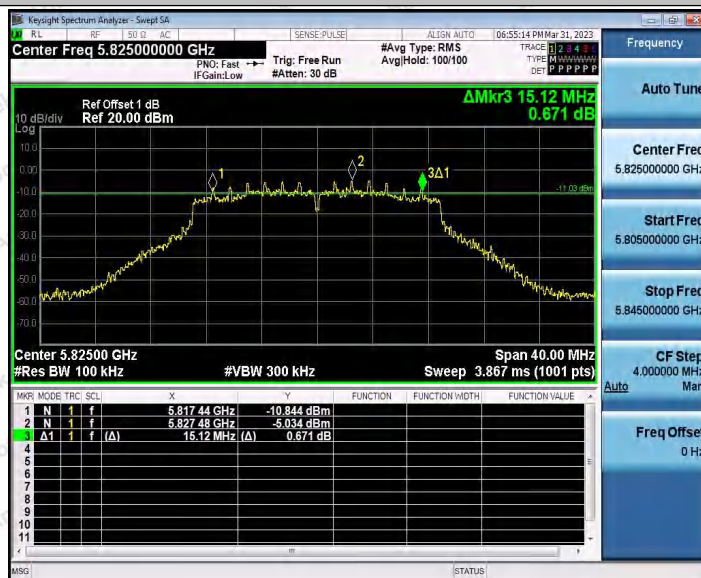

11AC40SISO\_Ant1\_5755

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





11AC40SISO\_Ant2\_5755



11AC40SISO\_Ant1\_5795



## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn



11AC40SISO\_Ant2\_5795



11AC80SISO\_Ant1\_5775

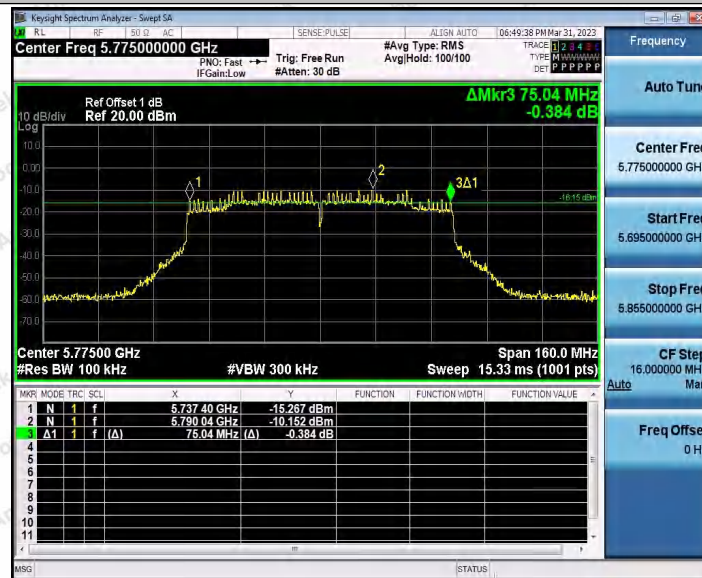

11AC80SISO\_Ant2\_5775


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



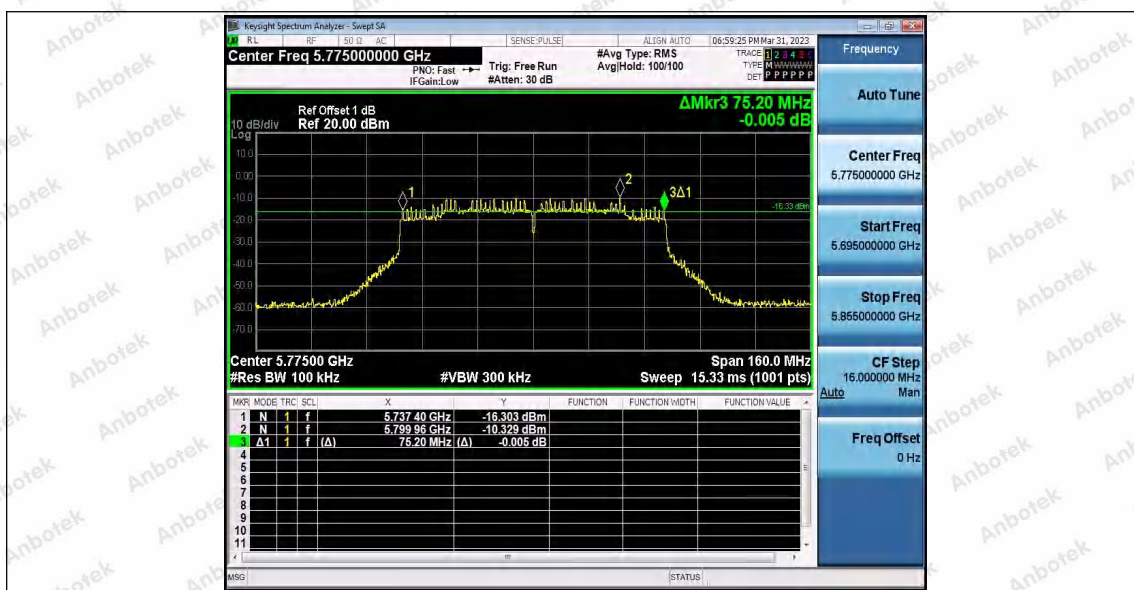

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



## Appendix B: Duty Cycle

### Test Result

| Test Mode  | Antenna | Frequency[MHz] | Transmission Duration [ms] | Transmission Period [ms] | Duty Cycle [%] |
|------------|---------|----------------|----------------------------|--------------------------|----------------|
| 11A        | Ant1    | 5180           | 0.15                       | 0.20                     | 75.00          |
|            | Ant2    | 5180           | 0.15                       | 0.20                     | 75.00          |
|            | Ant1    | 5200           | 0.15                       | 0.20                     | 75.00          |
|            | Ant2    | 5200           | 0.15                       | 0.20                     | 75.00          |
|            | Ant1    | 5240           | 0.14                       | 0.19                     | 73.68          |
|            | Ant2    | 5240           | 0.14                       | 0.19                     | 73.68          |
|            | Ant1    | 5745           | 0.14                       | 0.19                     | 73.68          |
|            | Ant2    | 5745           | 0.14                       | 0.19                     | 73.68          |
|            | Ant1    | 5785           | 0.15                       | 0.19                     | 78.95          |
|            | Ant2    | 5785           | 0.15                       | 0.19                     | 78.95          |
|            | Ant1    | 5825           | 0.15                       | 0.20                     | 75.00          |
|            | Ant2    | 5825           | 0.15                       | 0.19                     | 78.95          |
| 11N20SISO  | Ant1    | 5180           | 0.18                       | 0.23                     | 78.26          |
|            | Ant2    | 5180           | 0.18                       | 0.23                     | 78.26          |
|            | Ant1    | 5200           | 0.17                       | 0.22                     | 77.27          |
|            | Ant2    | 5200           | 0.17                       | 0.22                     | 77.27          |
|            | Ant1    | 5240           | 0.18                       | 0.23                     | 78.26          |
|            | Ant2    | 5240           | 0.17                       | 0.22                     | 77.27          |
|            | Ant1    | 5745           | 0.17                       | 0.22                     | 77.27          |
|            | Ant2    | 5745           | 0.17                       | 0.22                     | 77.27          |
|            | Ant1    | 5785           | 0.17                       | 0.22                     | 77.27          |
|            | Ant2    | 5785           | 0.17                       | 0.22                     | 77.27          |
|            | Ant1    | 5825           | 0.18                       | 0.23                     | 78.26          |
|            | Ant2    | 5825           | 0.17                       | 0.22                     | 77.27          |
| 11N40SISO  | Ant1    | 5190           | 0.18                       | 0.23                     | 78.26          |
|            | Ant2    | 5190           | 0.18                       | 0.22                     | 81.82          |
|            | Ant1    | 5230           | 0.18                       | 0.23                     | 78.26          |
|            | Ant2    | 5230           | 0.18                       | 0.22                     | 81.82          |
|            | Ant1    | 5755           | 0.18                       | 0.22                     | 81.82          |
|            | Ant2    | 5755           | 0.18                       | 0.23                     | 78.26          |
|            | Ant1    | 5795           | 0.18                       | 0.22                     | 81.82          |
|            | Ant2    | 5795           | 0.18                       | 0.23                     | 78.26          |
| 11AC20SISO | Ant1    | 5180           | 0.16                       | 0.21                     | 76.19          |
|            | Ant2    | 5180           | 0.17                       | 0.22                     | 77.27          |
|            | Ant1    | 5200           | 0.17                       | 0.22                     | 77.27          |
|            | Ant2    | 5200           | 0.16                       | 0.21                     | 76.19          |
|            | Ant1    | 5240           | 0.16                       | 0.21                     | 76.19          |

### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



|            |      |      |      |      |       |
|------------|------|------|------|------|-------|
|            | Ant2 | 5240 | 0.16 | 0.21 | 76.19 |
|            | Ant1 | 5745 | 0.17 | 0.22 | 77.27 |
|            | Ant2 | 5745 | 0.16 | 0.21 | 76.19 |
|            | Ant1 | 5785 | 0.16 | 0.21 | 76.19 |
|            | Ant2 | 5785 | 0.16 | 0.21 | 76.19 |
|            | Ant1 | 5825 | 0.16 | 0.21 | 76.19 |
|            | Ant2 | 5825 | 0.16 | 0.21 | 76.19 |
| 11AC40SISO | Ant1 | 5190 | 0.15 | 0.20 | 75.00 |
|            | Ant2 | 5190 | 0.15 | 0.20 | 75.00 |
|            | Ant1 | 5230 | 0.15 | 0.20 | 75.00 |
|            | Ant2 | 5230 | 0.16 | 0.21 | 76.19 |
|            | Ant1 | 5755 | 0.15 | 0.20 | 75.00 |
|            | Ant2 | 5755 | 0.15 | 0.20 | 75.00 |
|            | Ant1 | 5795 | 0.16 | 0.21 | 76.19 |
| 11AC80SISO | Ant2 | 5795 | 0.16 | 0.21 | 76.19 |
|            | Ant1 | 5210 | 0.16 | 0.21 | 76.19 |
|            | Ant2 | 5210 | 0.17 | 0.22 | 77.27 |
|            | Ant1 | 5775 | 0.16 | 0.21 | 76.19 |
|            | Ant2 | 5775 | 0.16 | 0.21 | 76.19 |

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
[www.anbotek.com.cn](http://www.anbotek.com.cn)



## Test Graphs

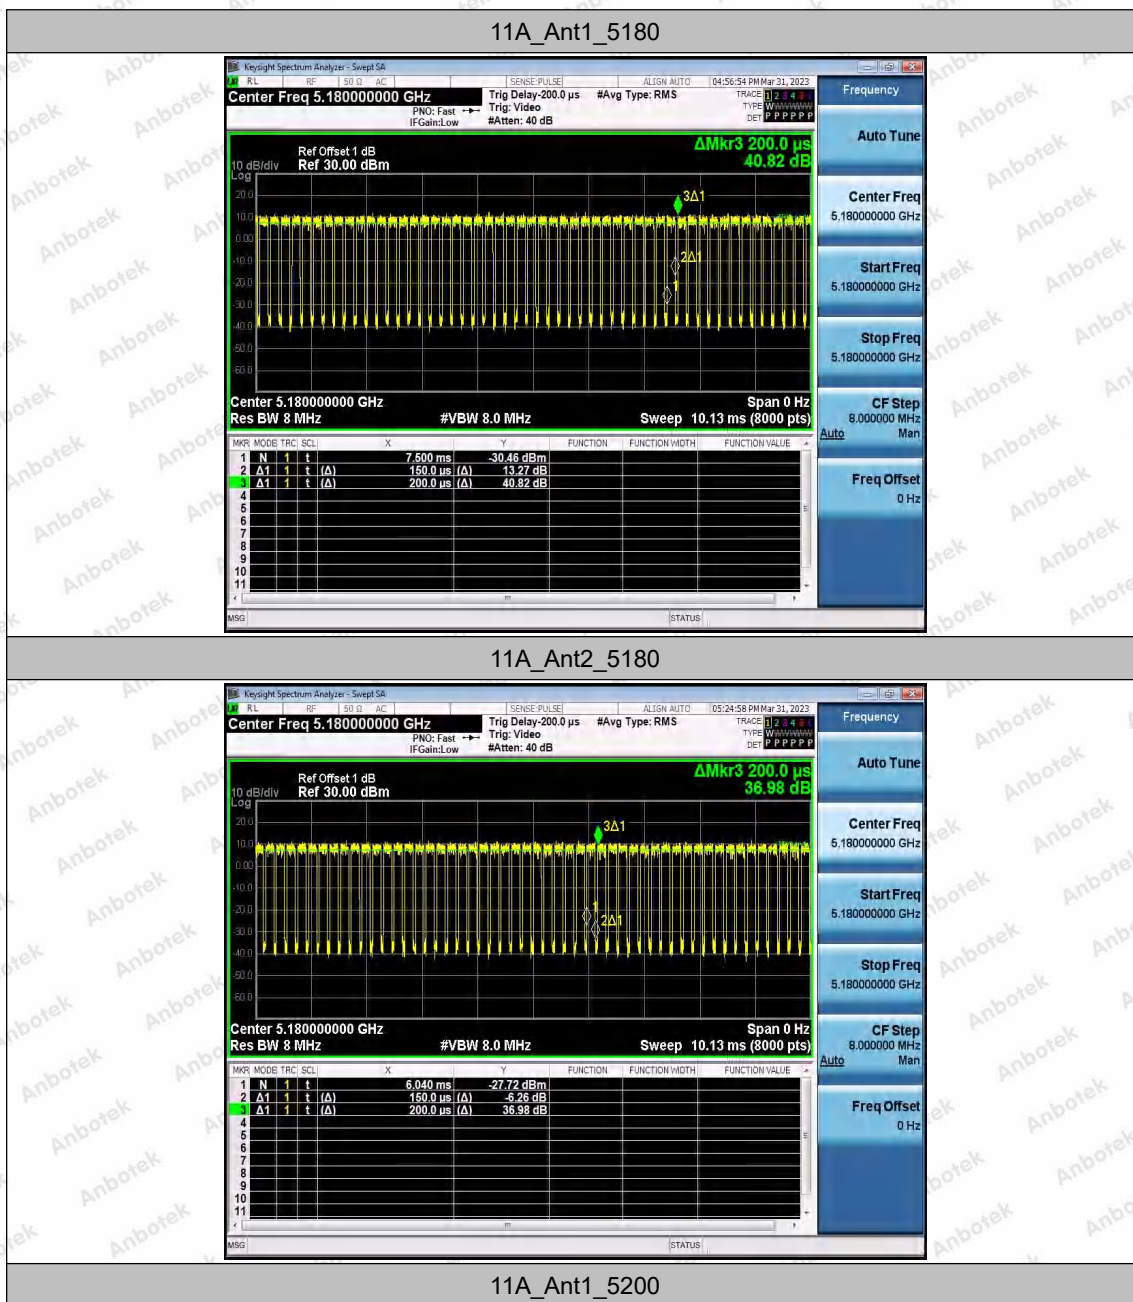


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




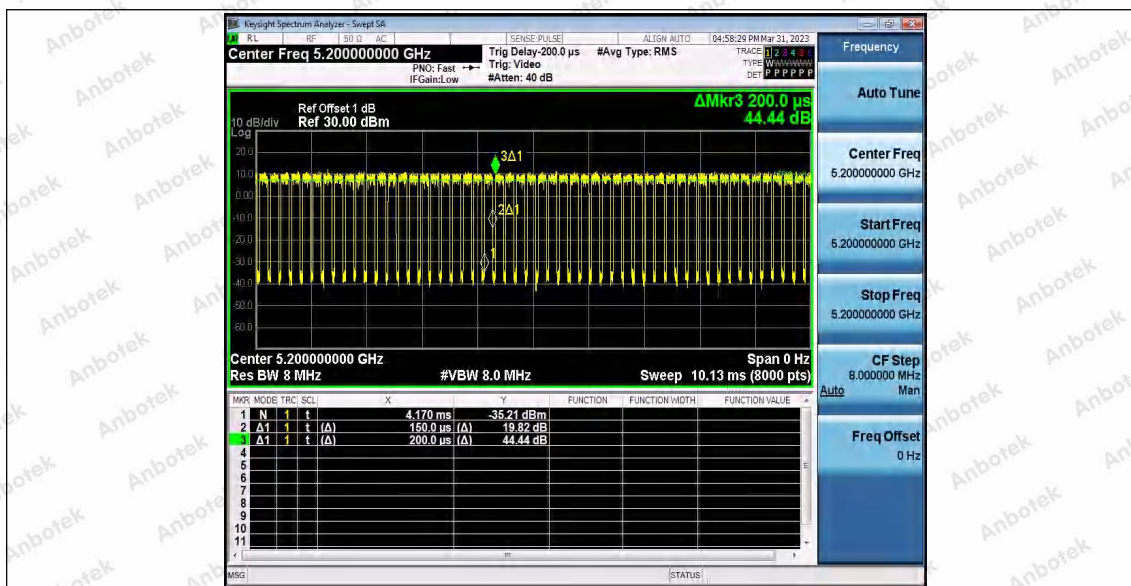

11A\_Ant2\_5200

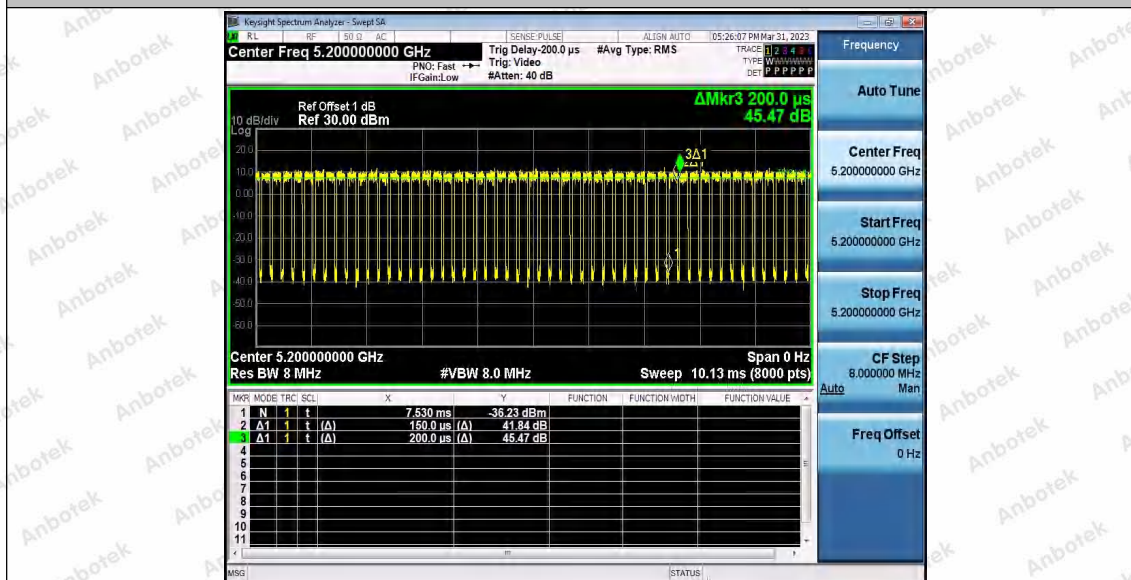

11A\_Ant1\_5240

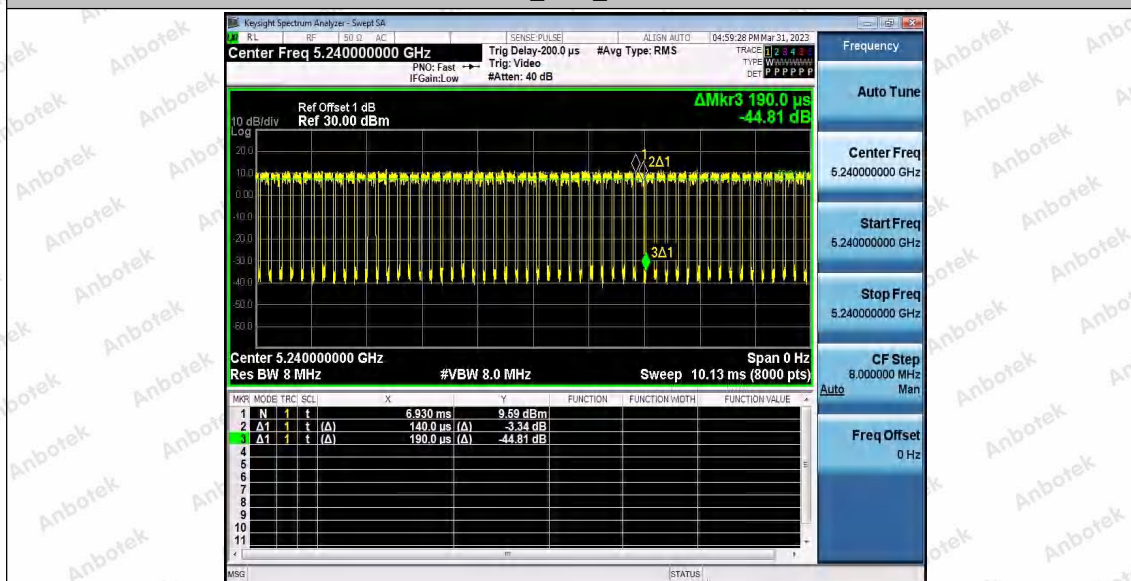

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn



11A\_Ant2\_5240

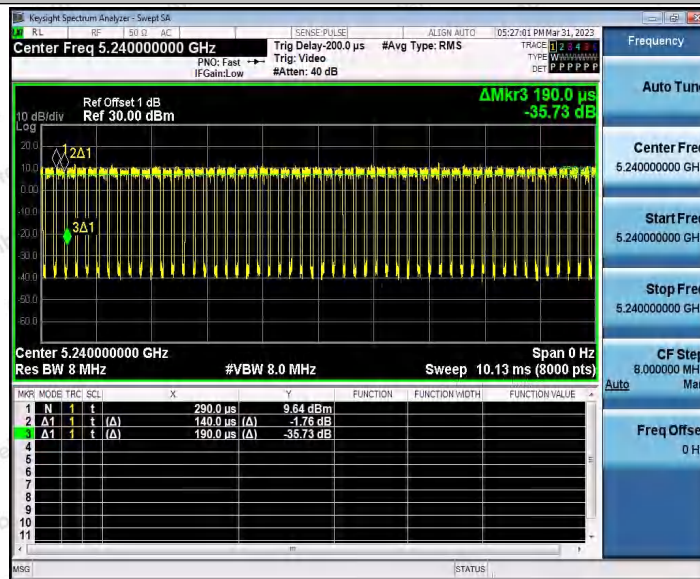

11A\_Ant1\_5745

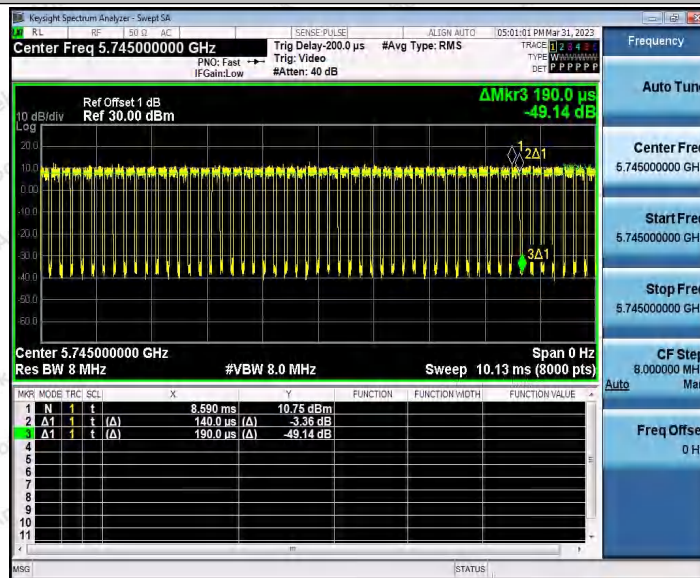

11A\_Ant2\_5745


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




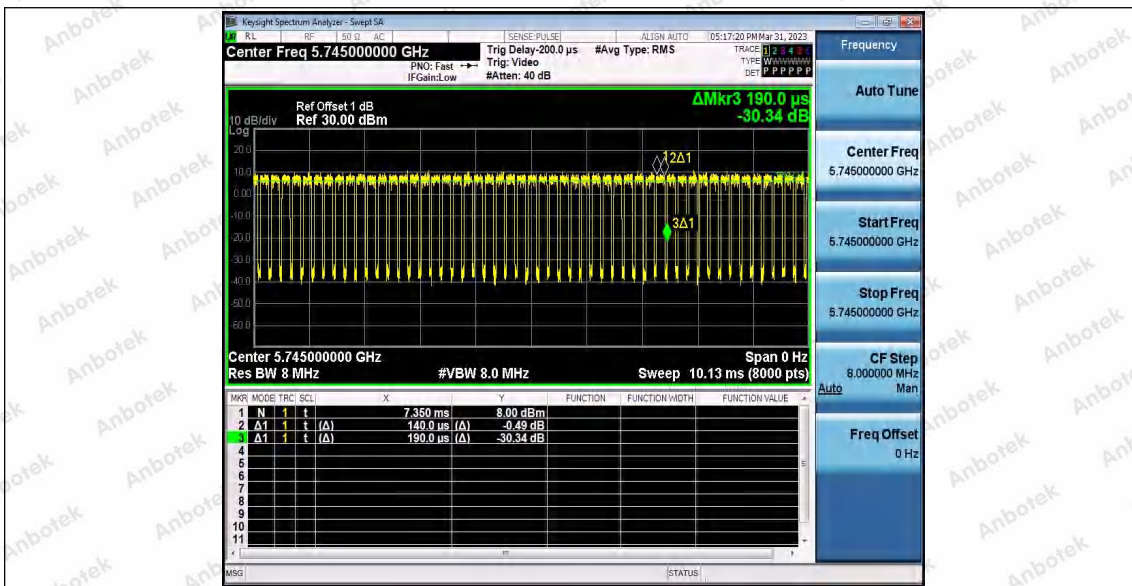

11A\_Ant1\_5785

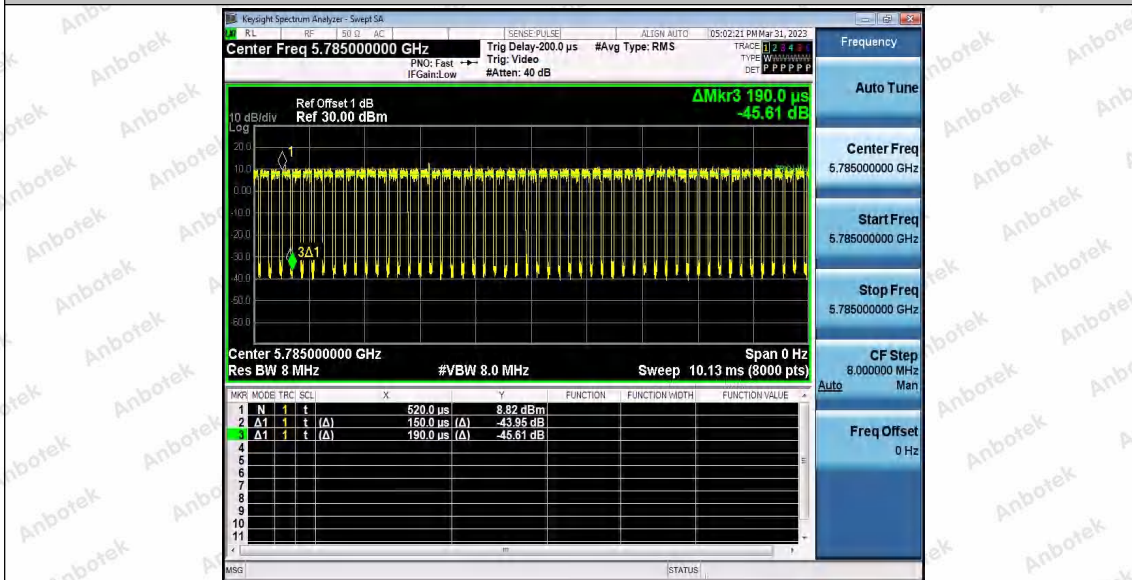

11A\_Ant2\_5785

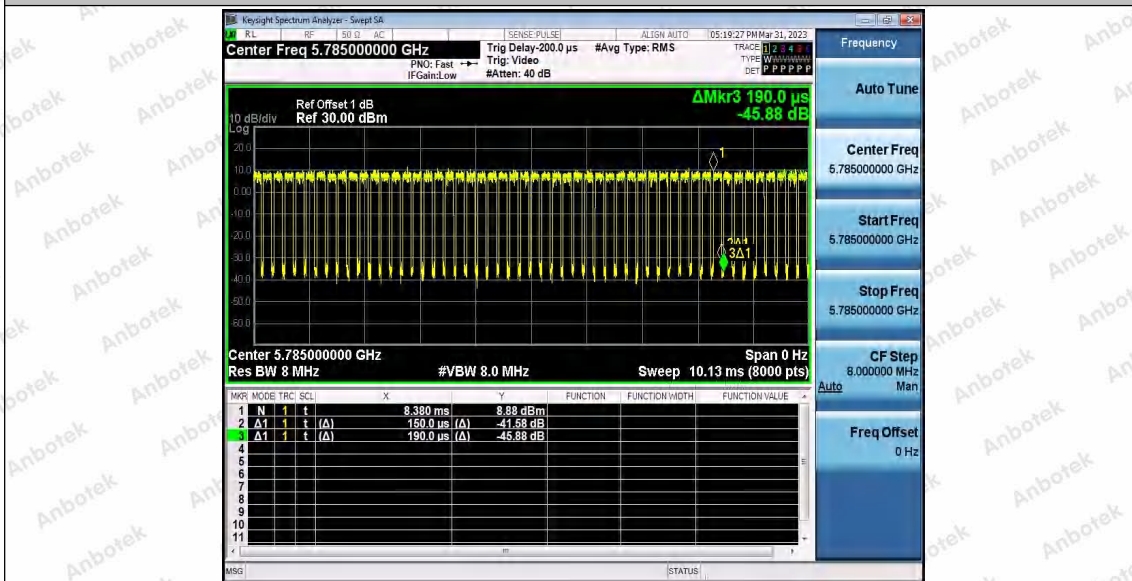

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn



11A\_Ant1\_5825

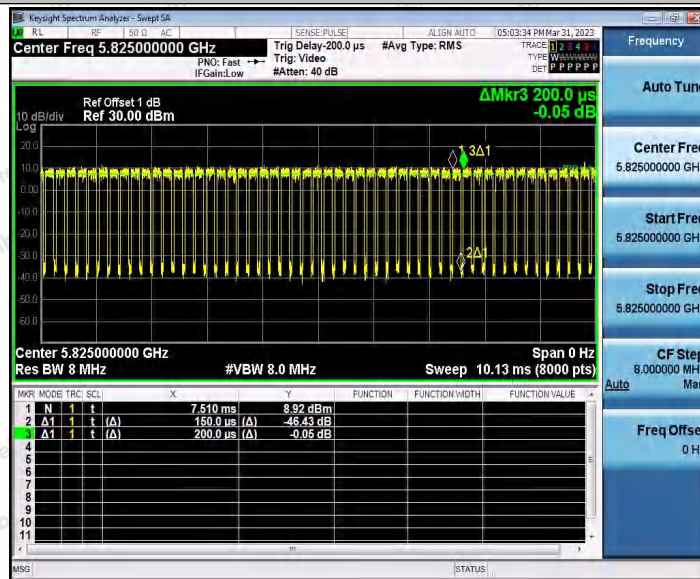

11A\_Ant2\_5825

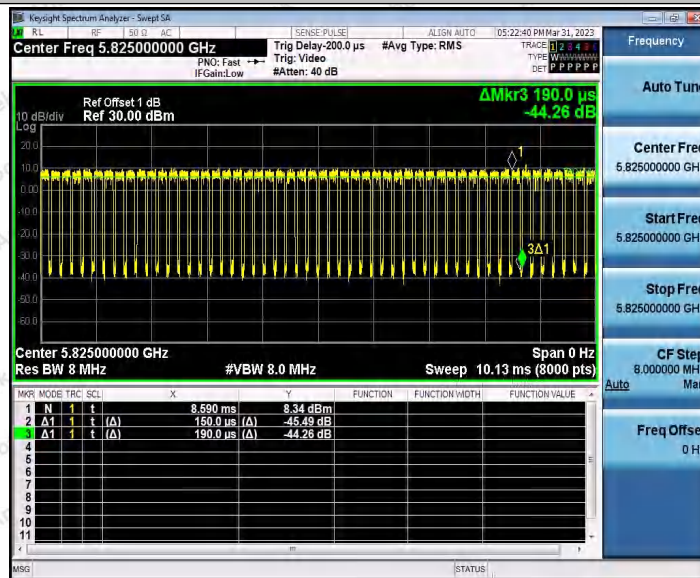

11N20SISO\_Ant1\_5180


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




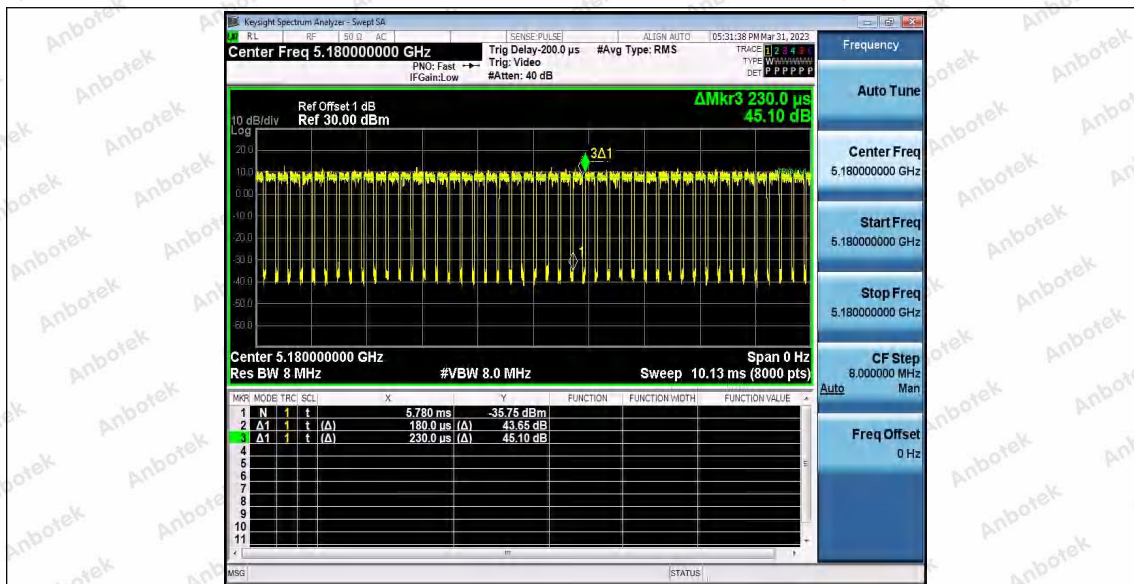

11N20SISO\_Ant2\_5180

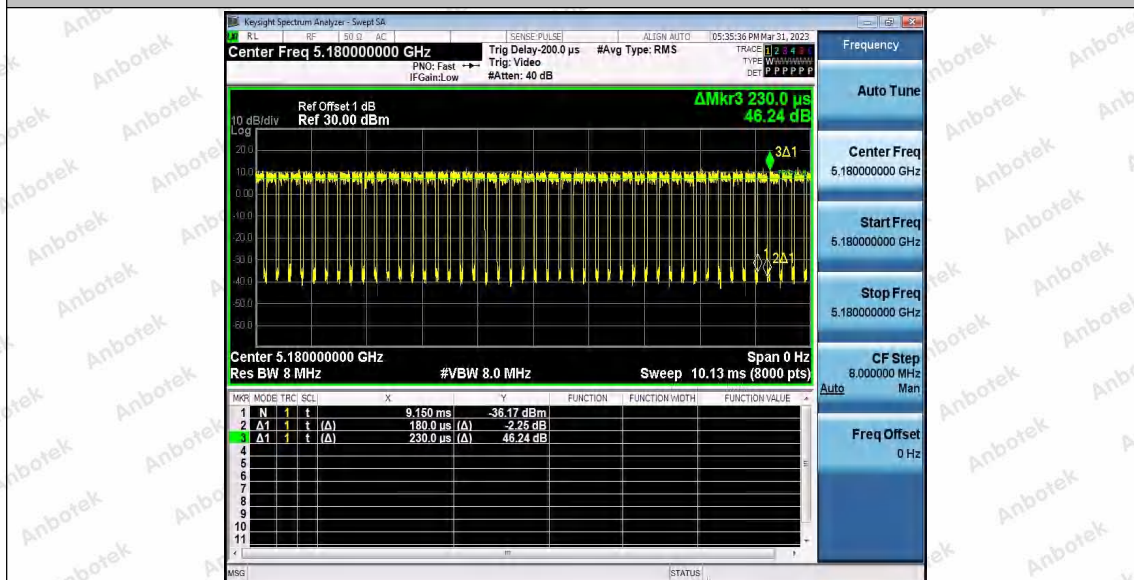

11N20SISO\_Ant1\_5200

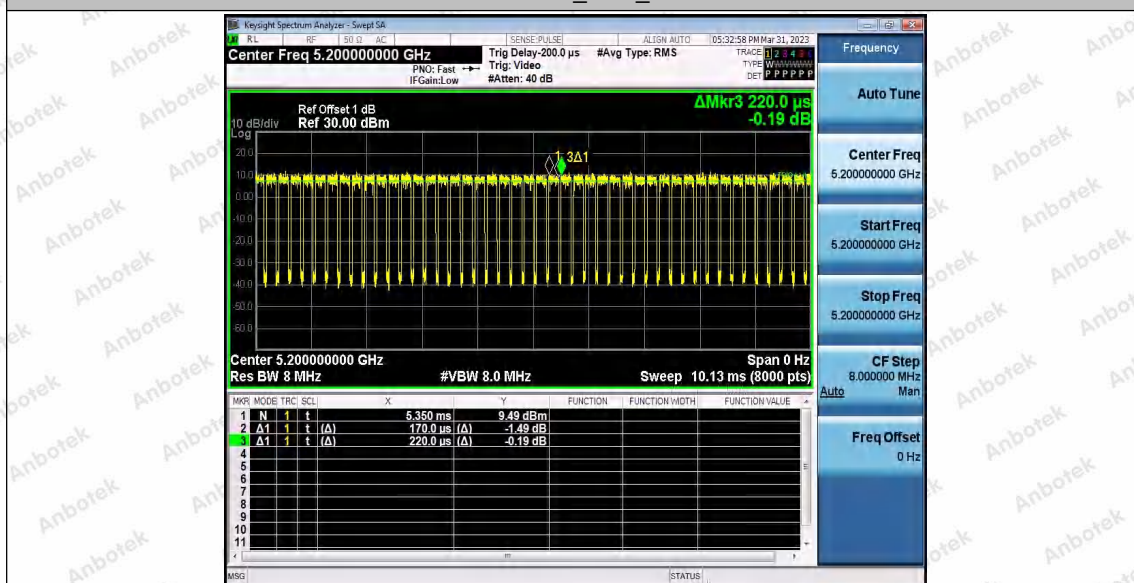


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline 400-003-0500  
www.anbotek.com.cn



11N20SISO\_Ant2\_5200

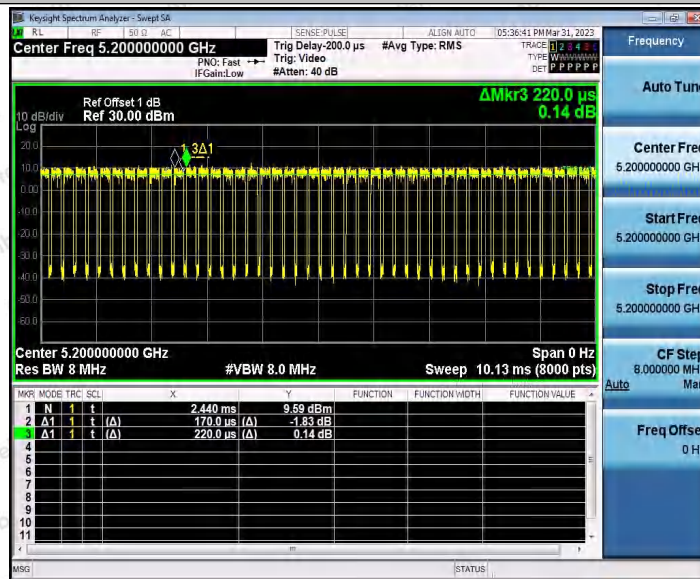

11N20SISO\_Ant1\_5240

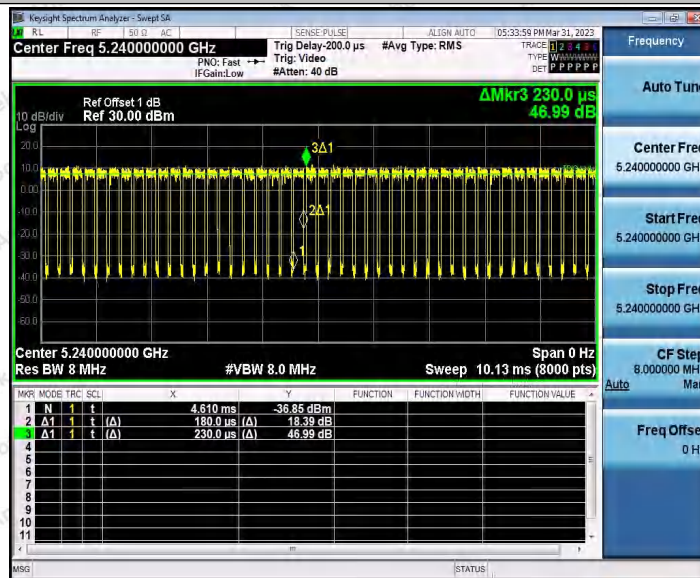

11N20SISO\_Ant2\_5240


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



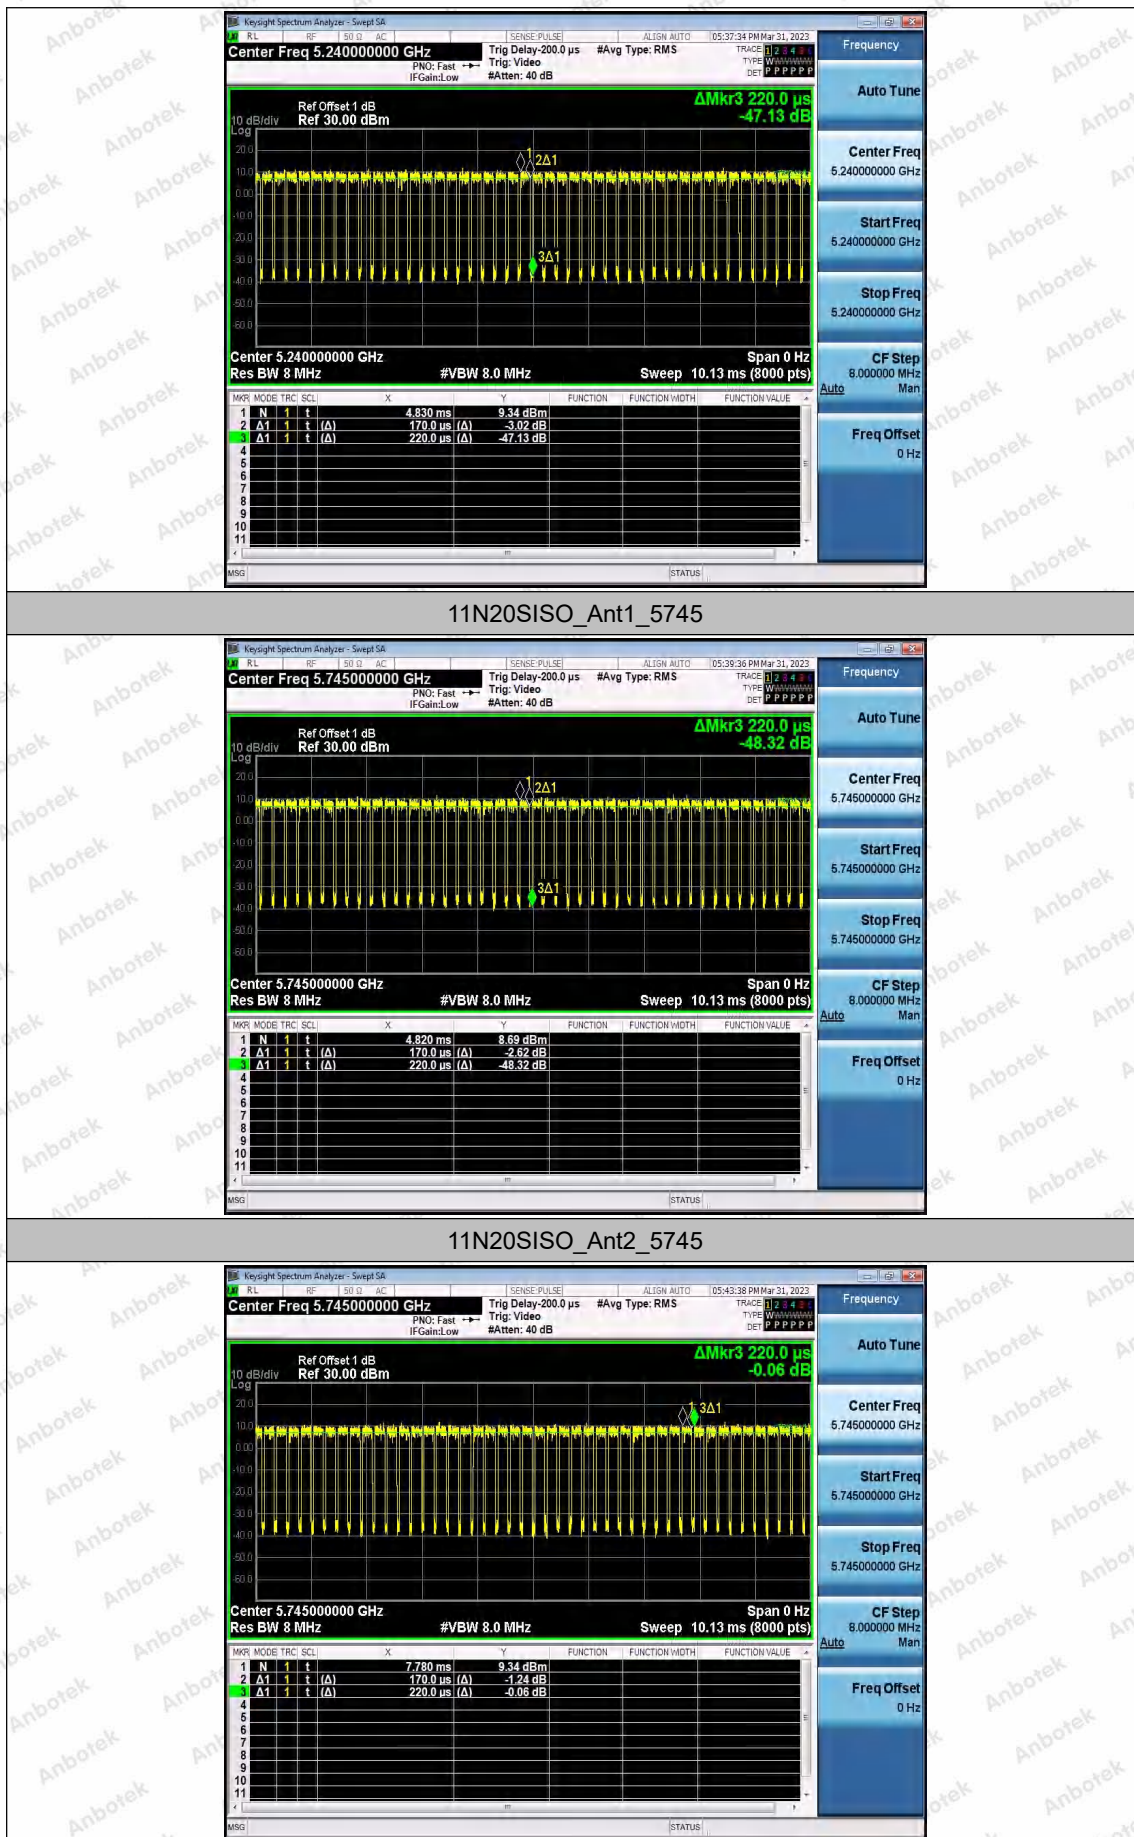

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn



11N20SISO\_Ant1\_5785

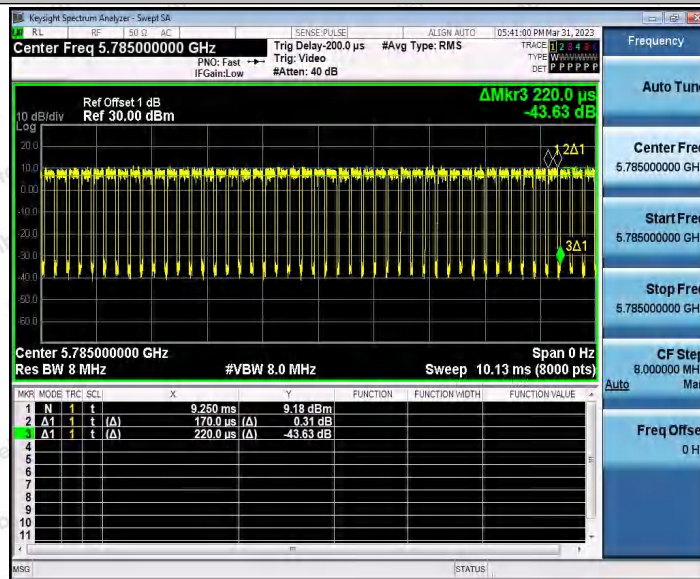

11N20SISO\_Ant2\_5785

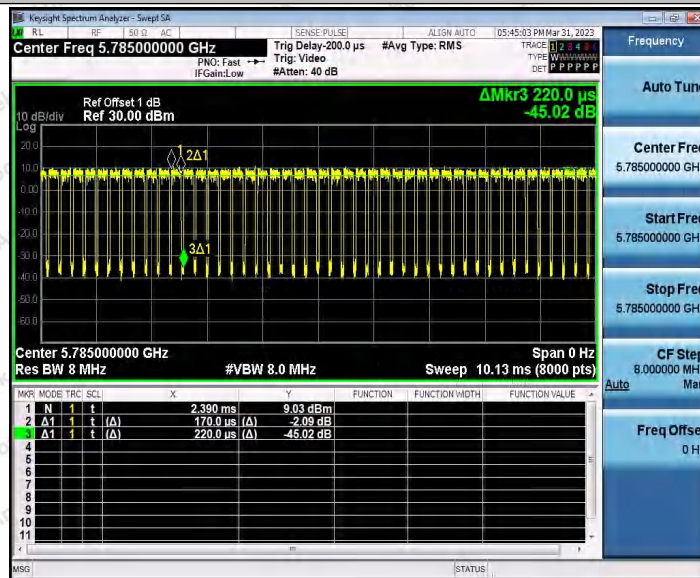

11N20SISO\_Ant1\_5825


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



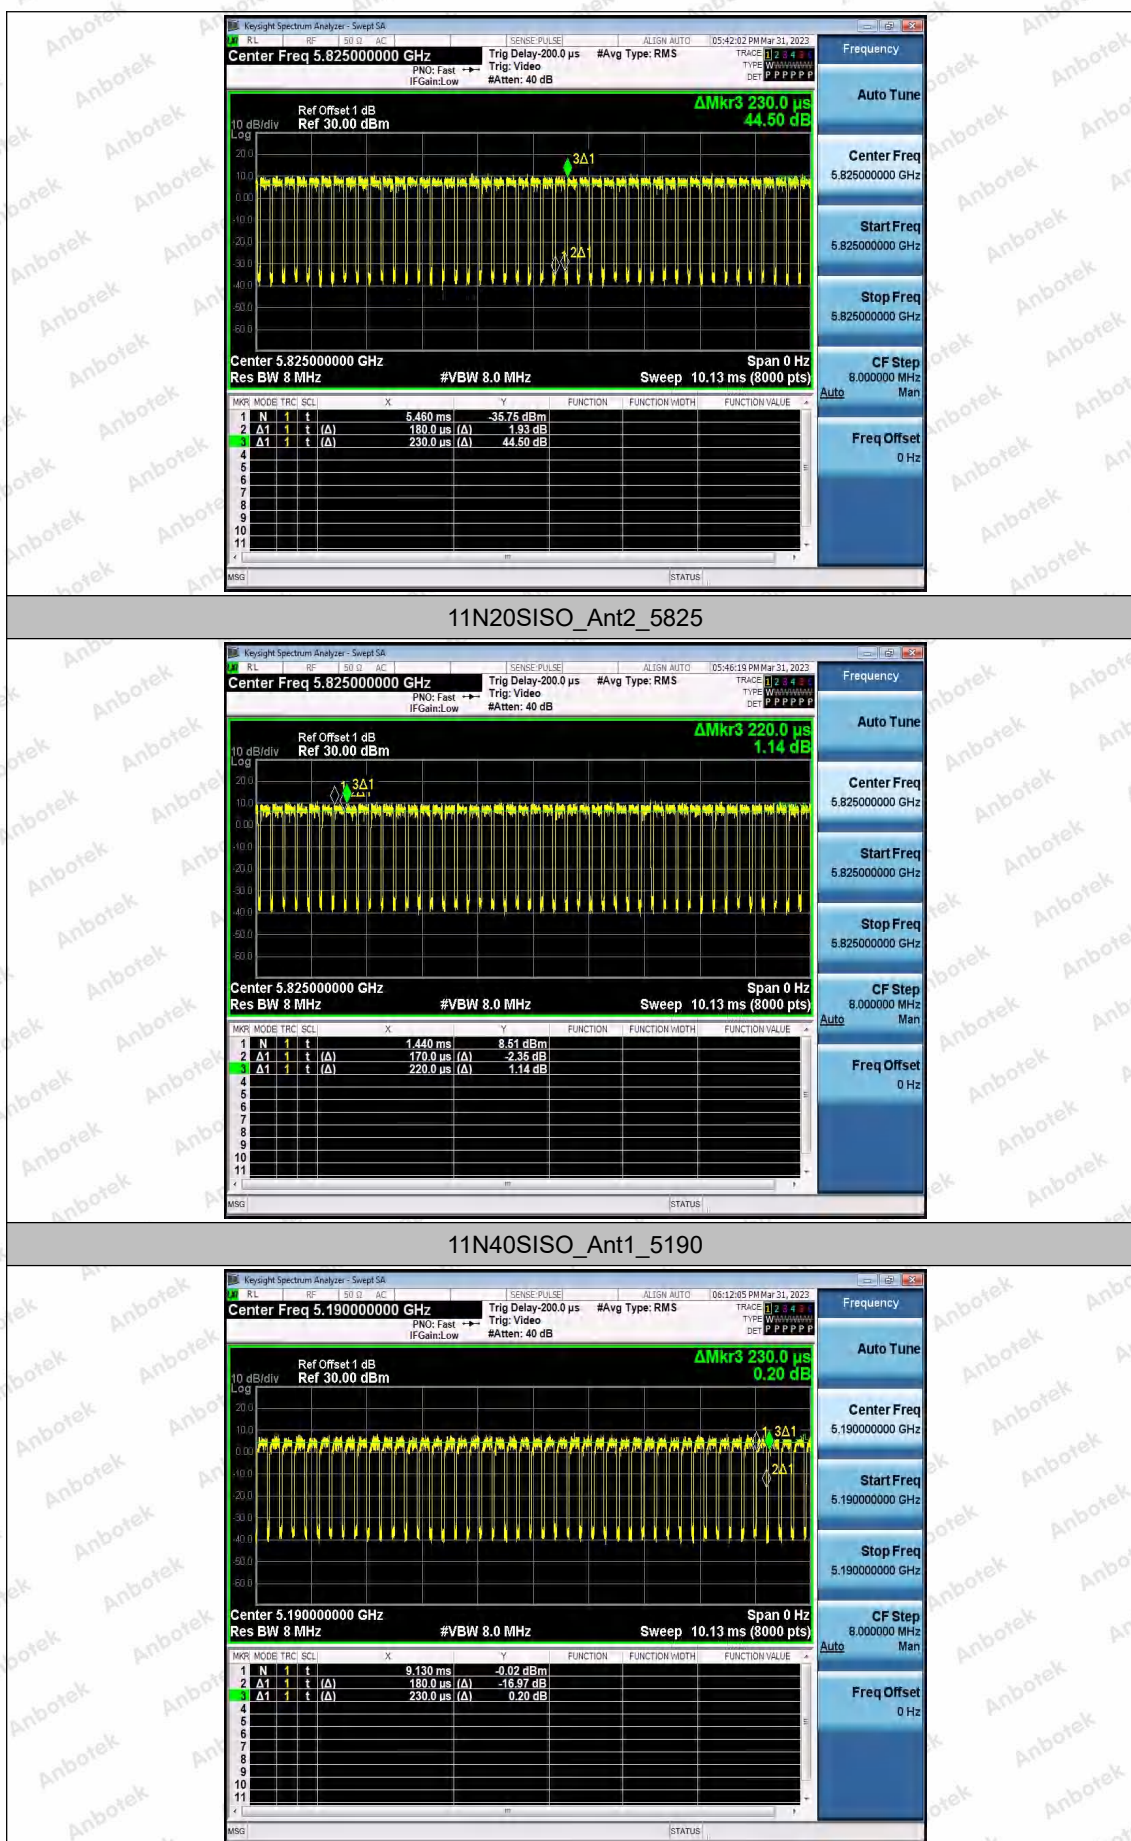

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn



11N40SISO\_Ant2\_5190

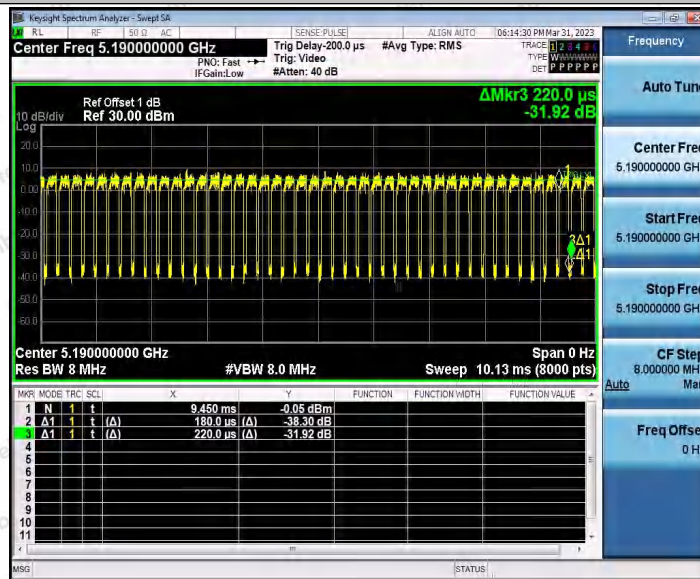

11N40SISO\_Ant1\_5230

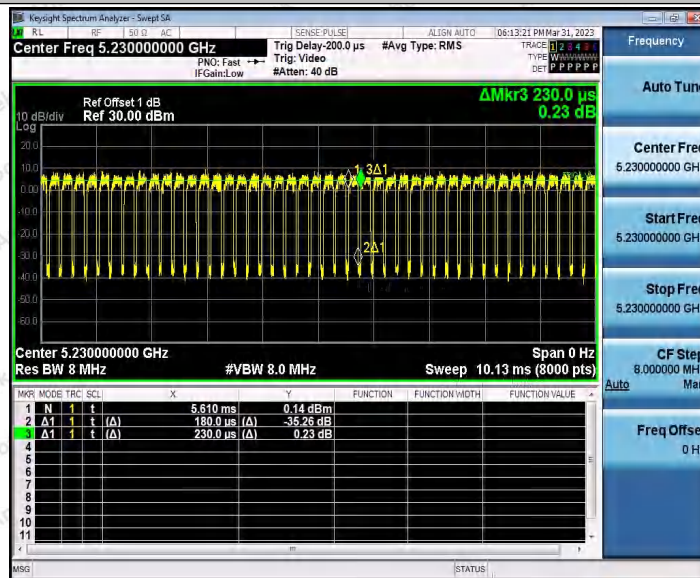

11N40SISO\_Ant2\_5230


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




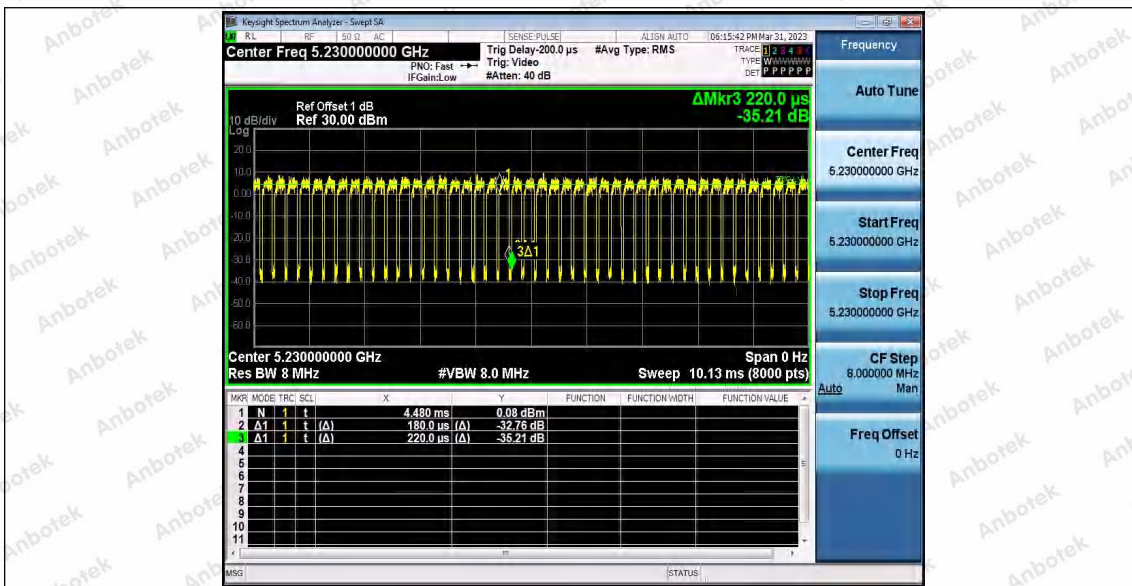

11N40SISO\_Ant1\_5755

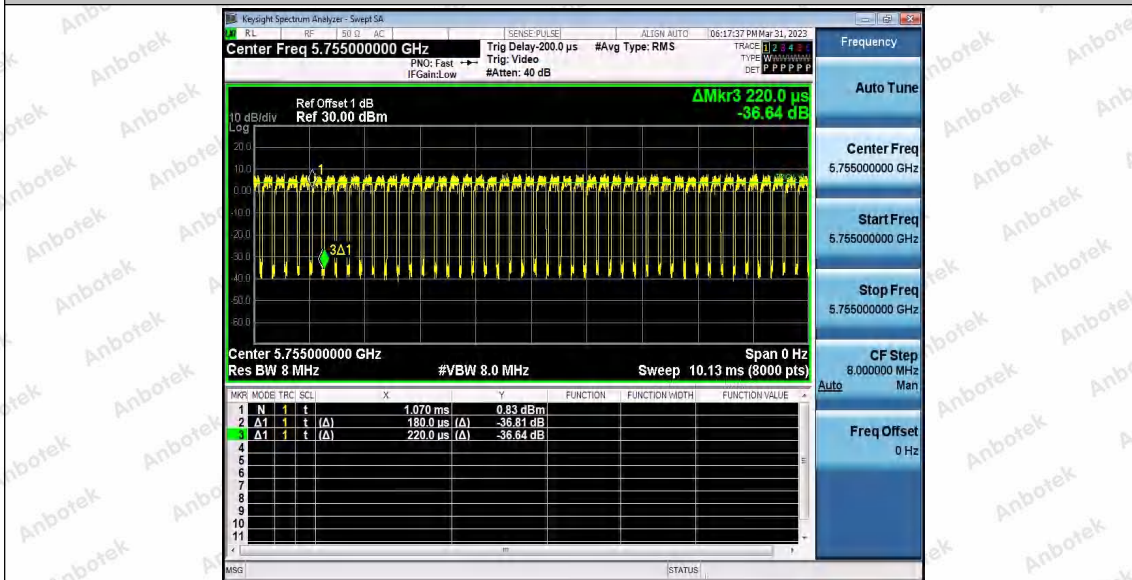

11N40SISO\_Ant2\_5755

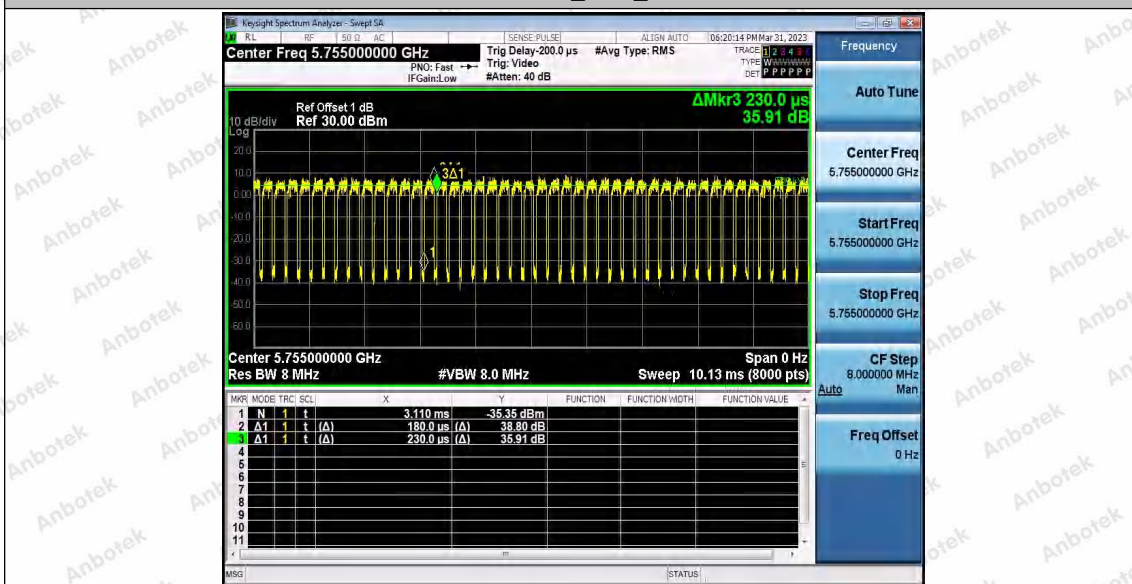

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn



## 11N40SISO\_Ant1\_5795

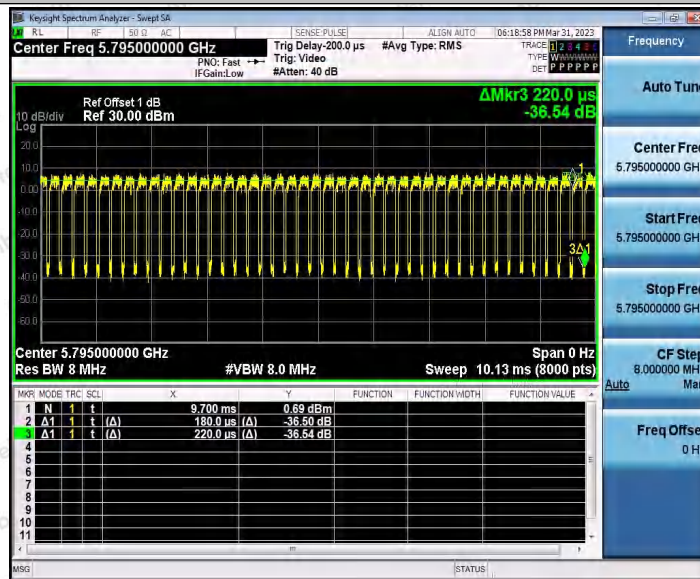

## 11N40SISO\_Ant2\_5795

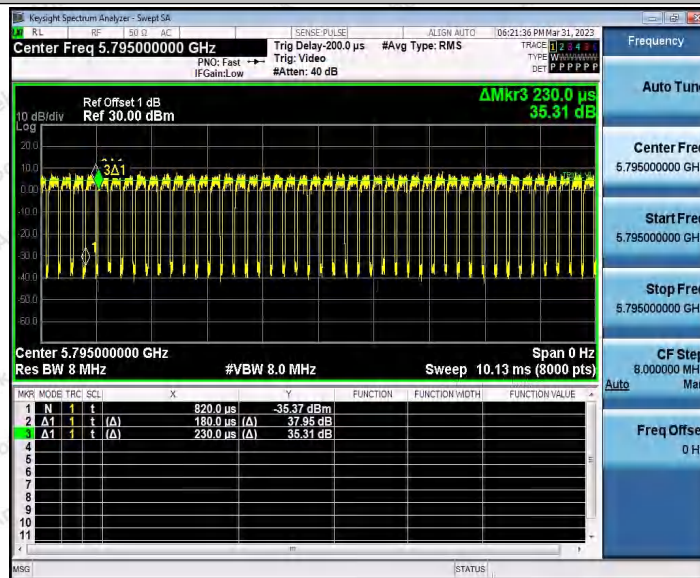

## 11AC20SISO\_Ant1\_5180


### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



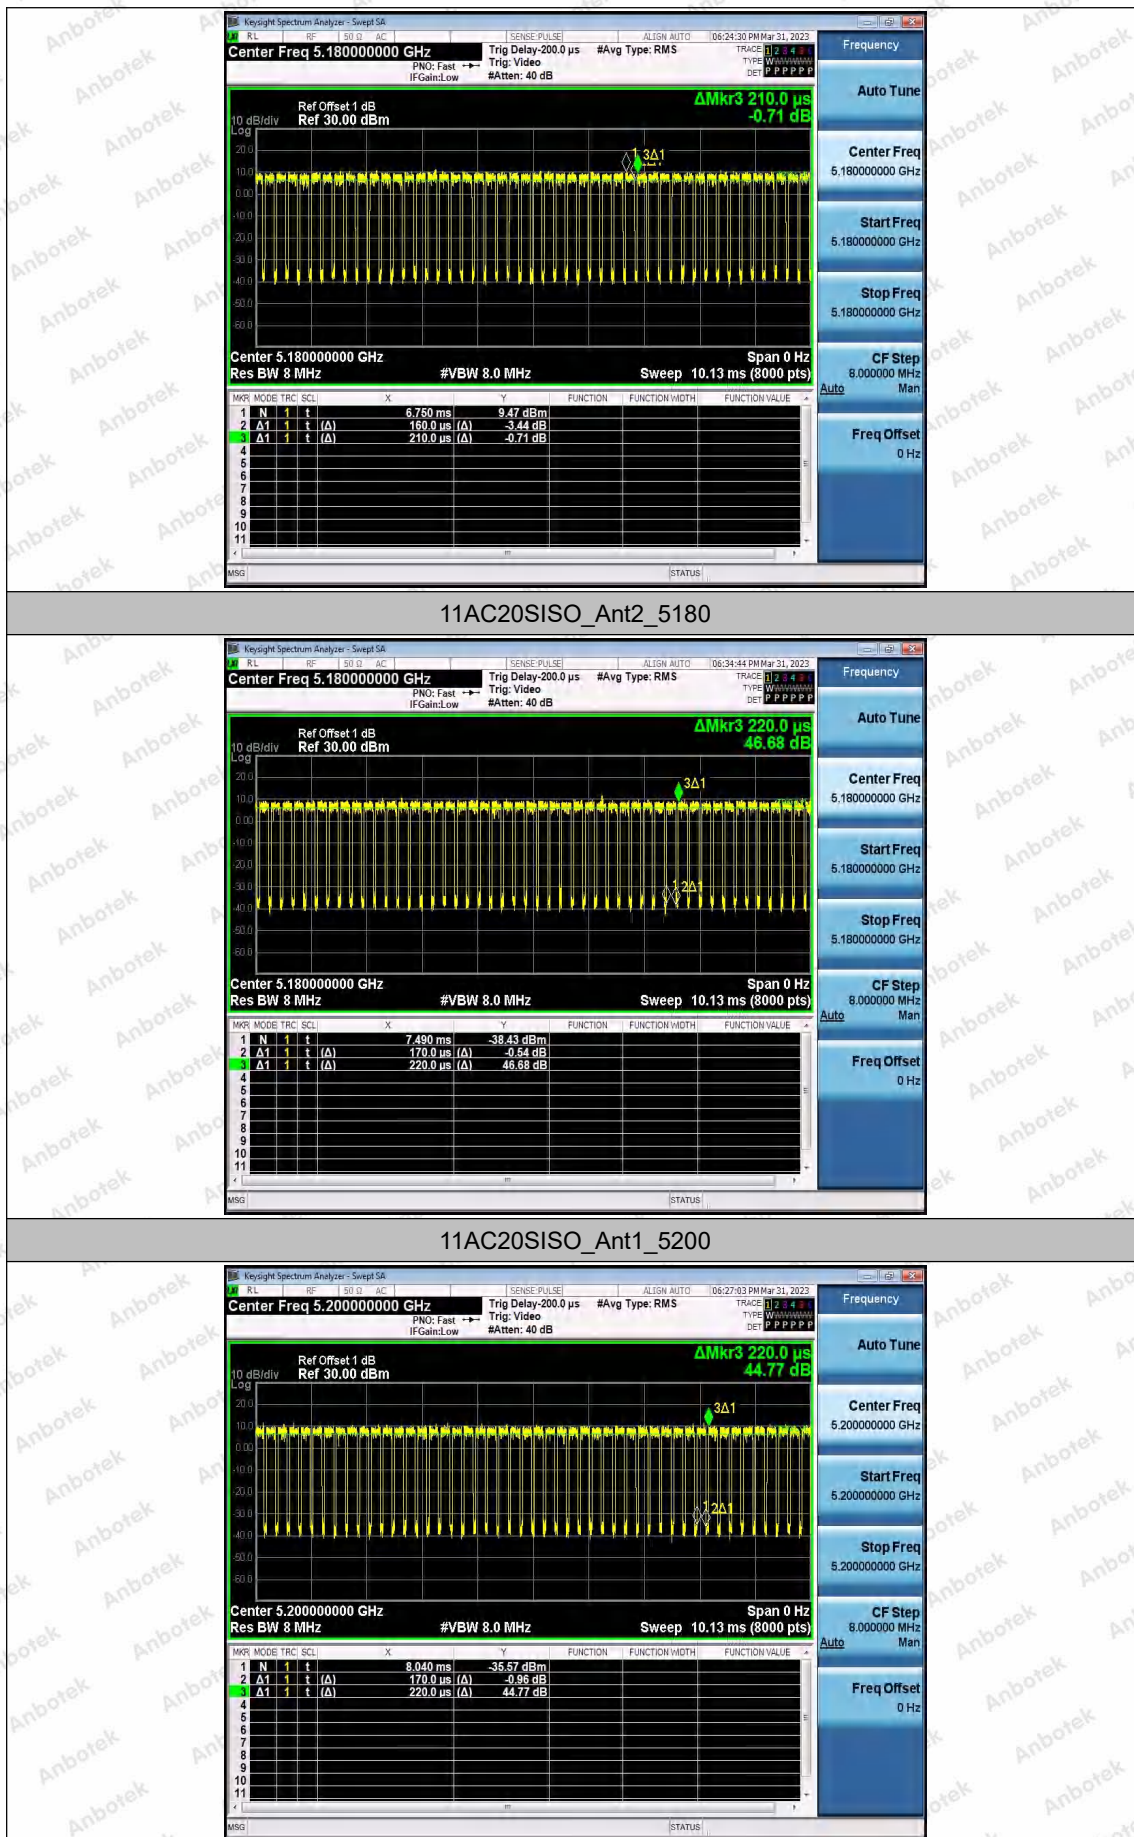

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn



11AC20SISO\_Ant2\_5200

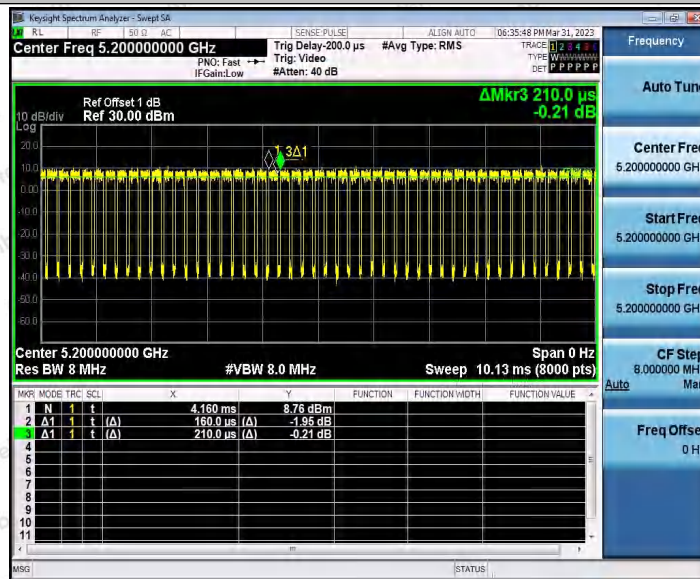

11AC20SISO\_Ant1\_5240

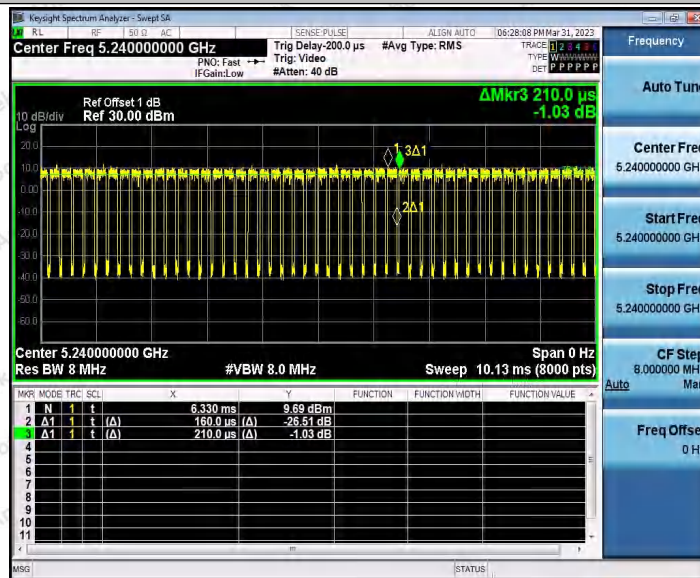

11AC20SISO\_Ant2\_5240


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



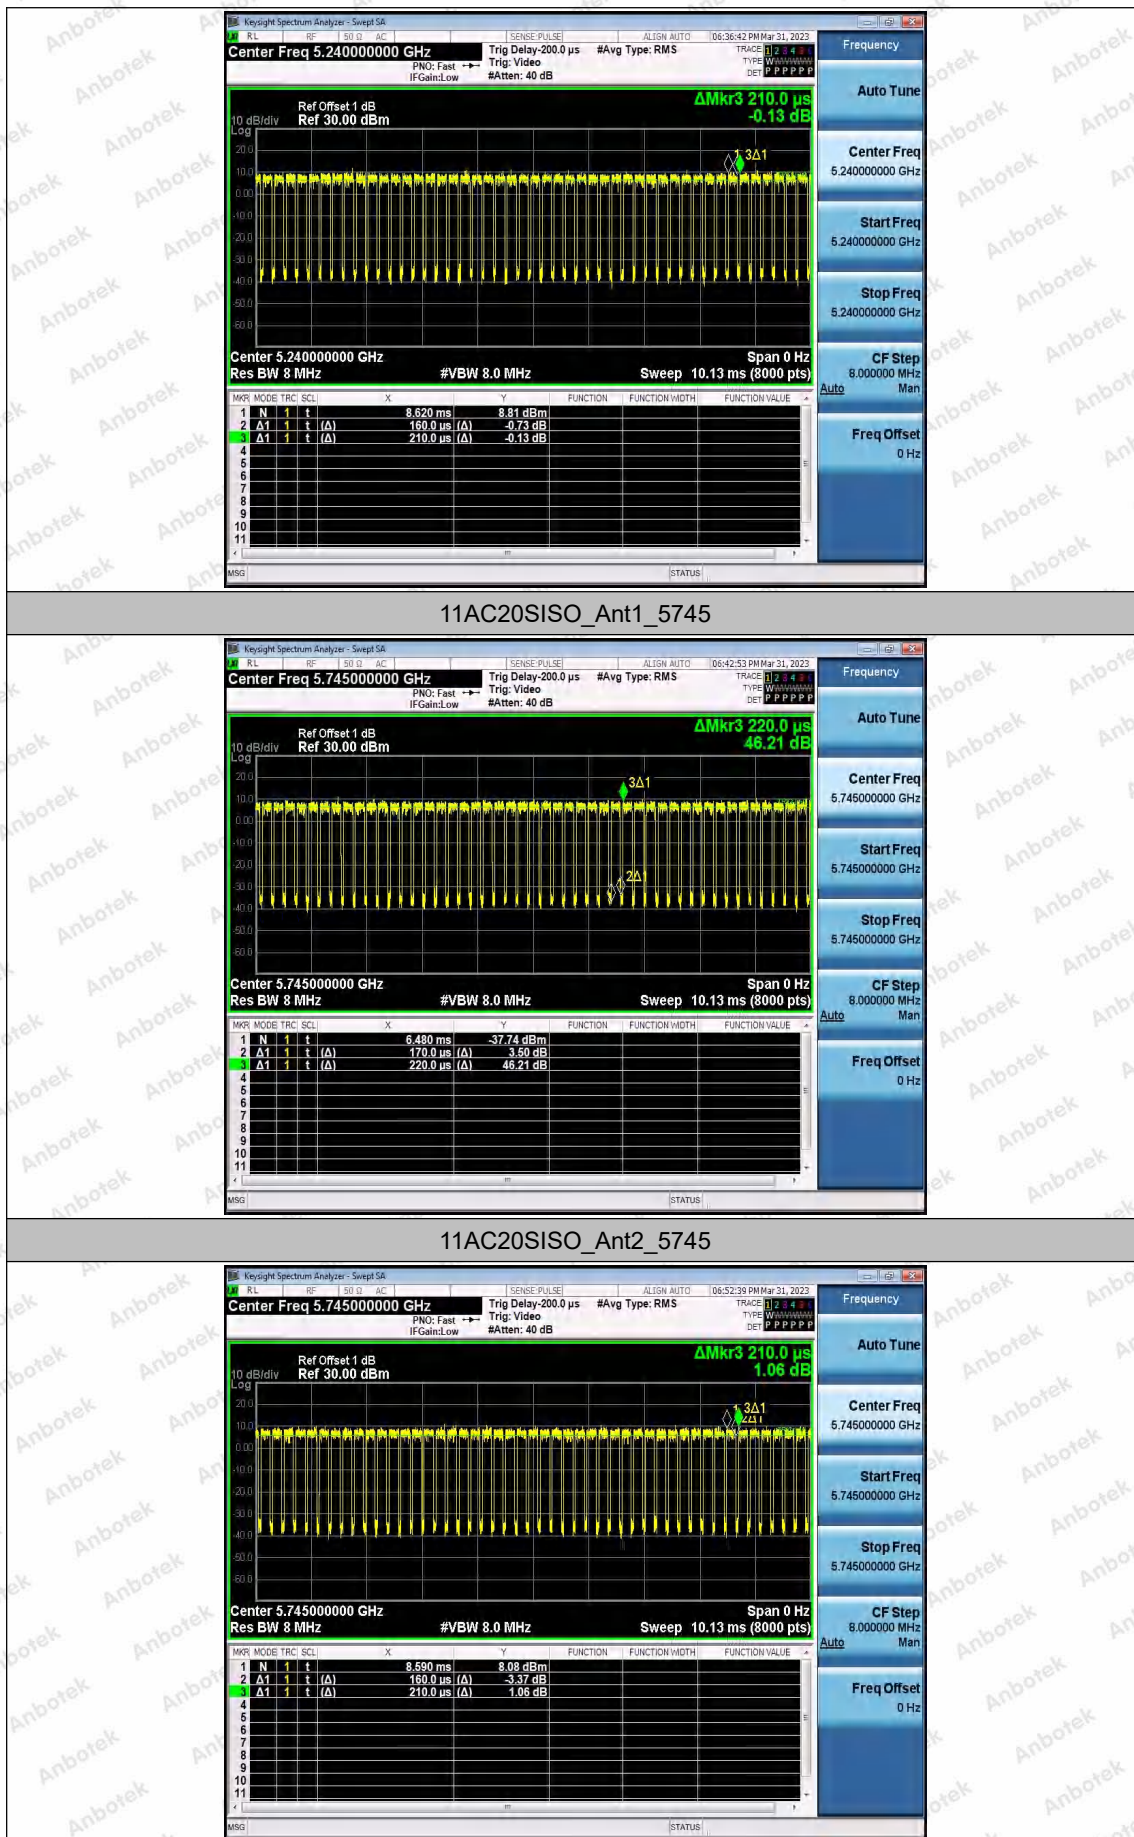

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn



11AC20SISO\_Ant1\_5785

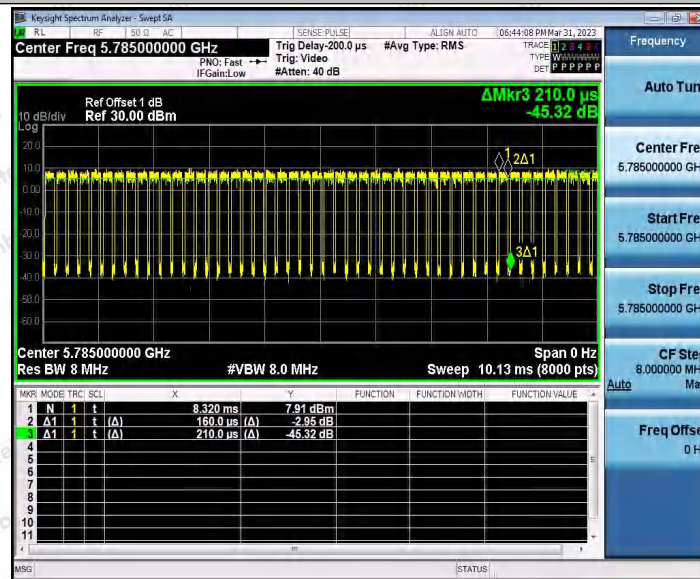

11AC20SISO\_Ant2\_5785

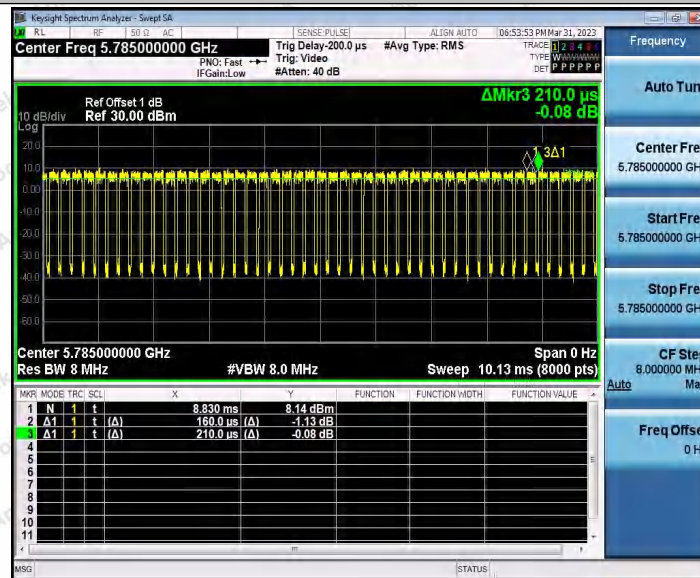

11AC20SISO\_Ant1\_5825


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




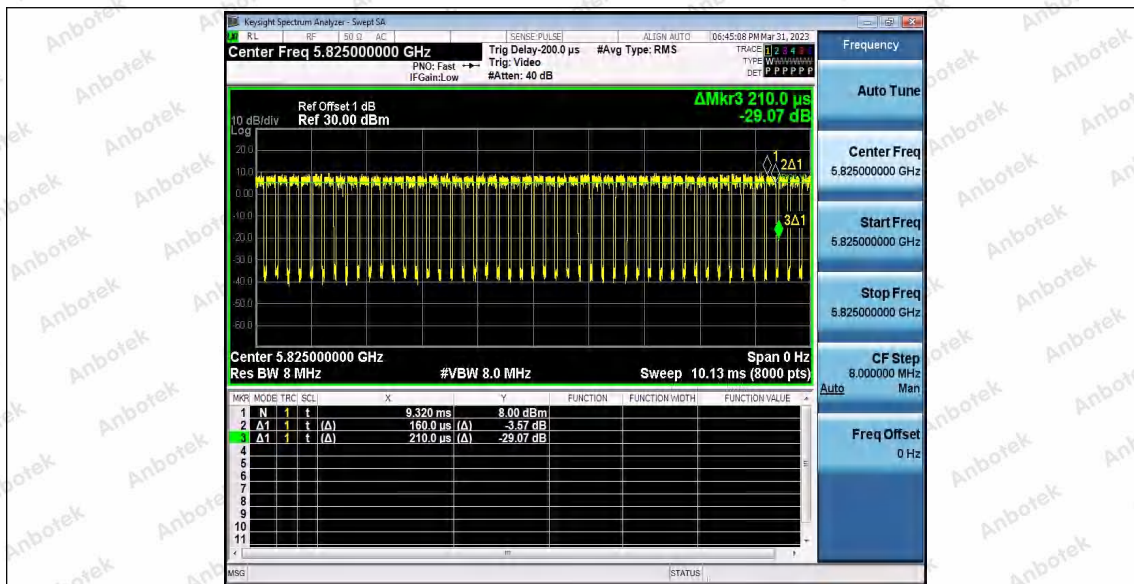

11AC20SISO\_Ant2\_5825

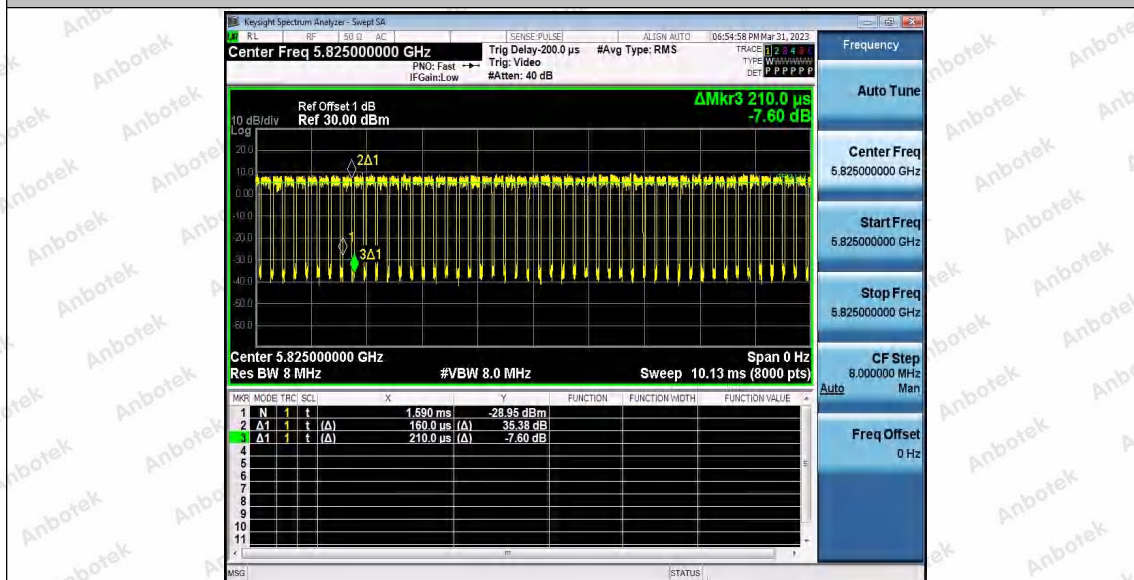

11AC40SISO\_Ant1\_5190

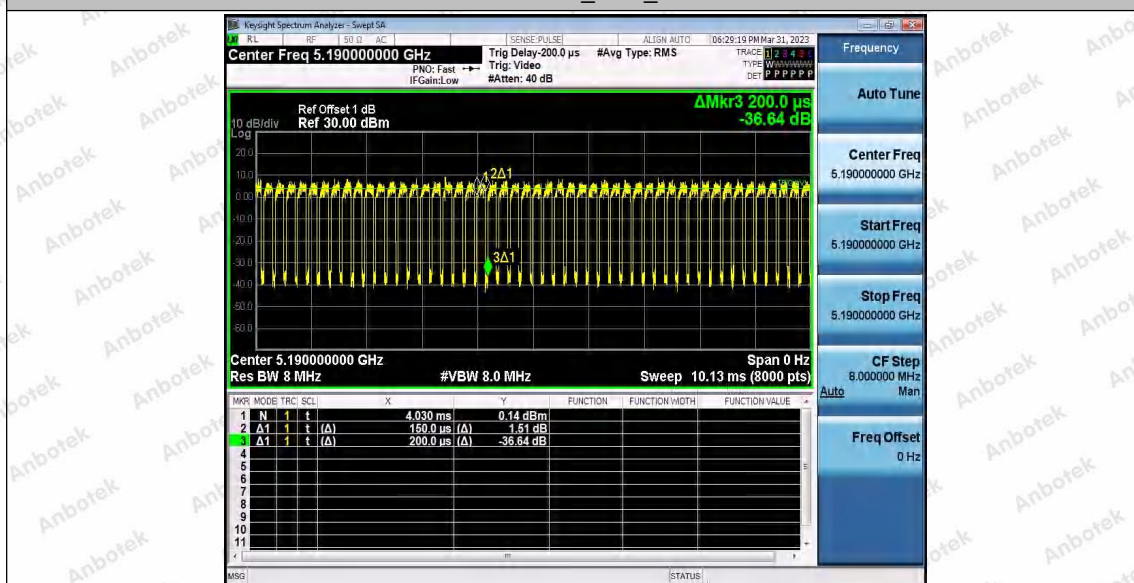

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn



11AC40SISO\_Ant2\_5190

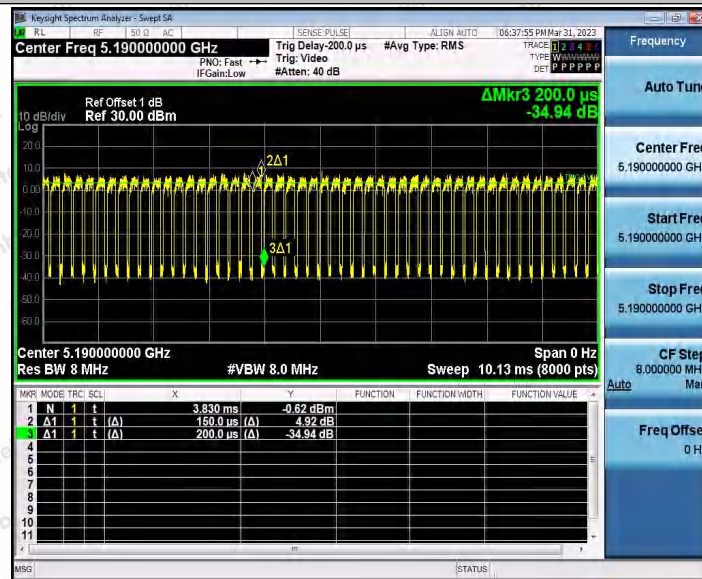

11AC40SISO\_Ant1\_5230

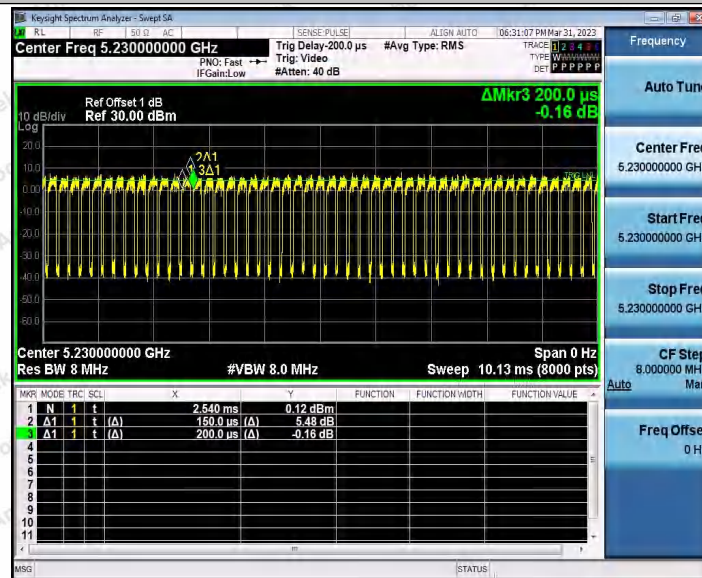

11AC40SISO\_Ant2\_5230


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




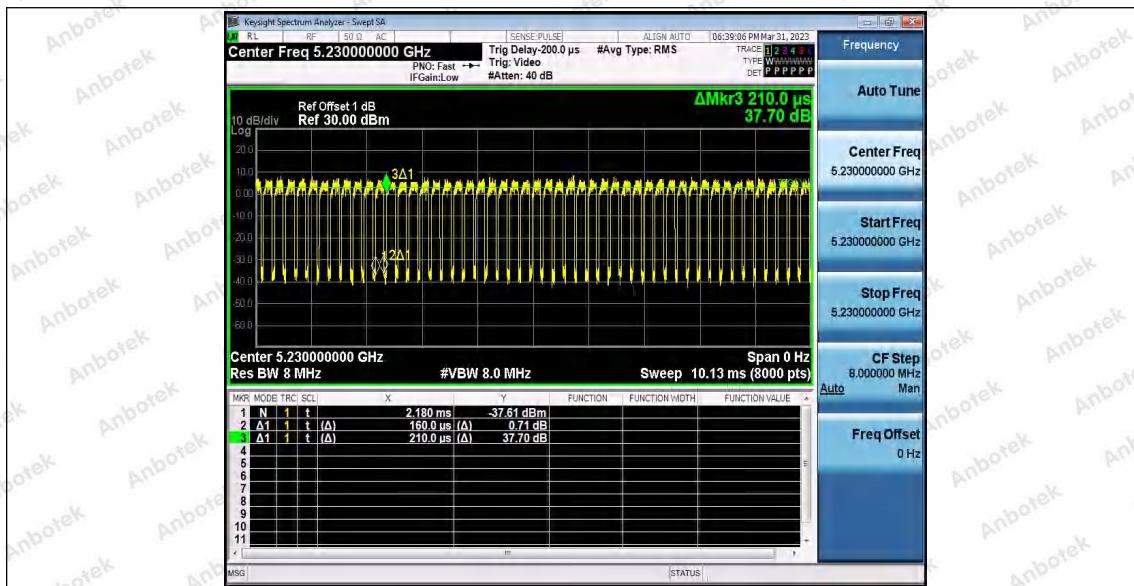

11AC40SISO\_Ant1\_5755

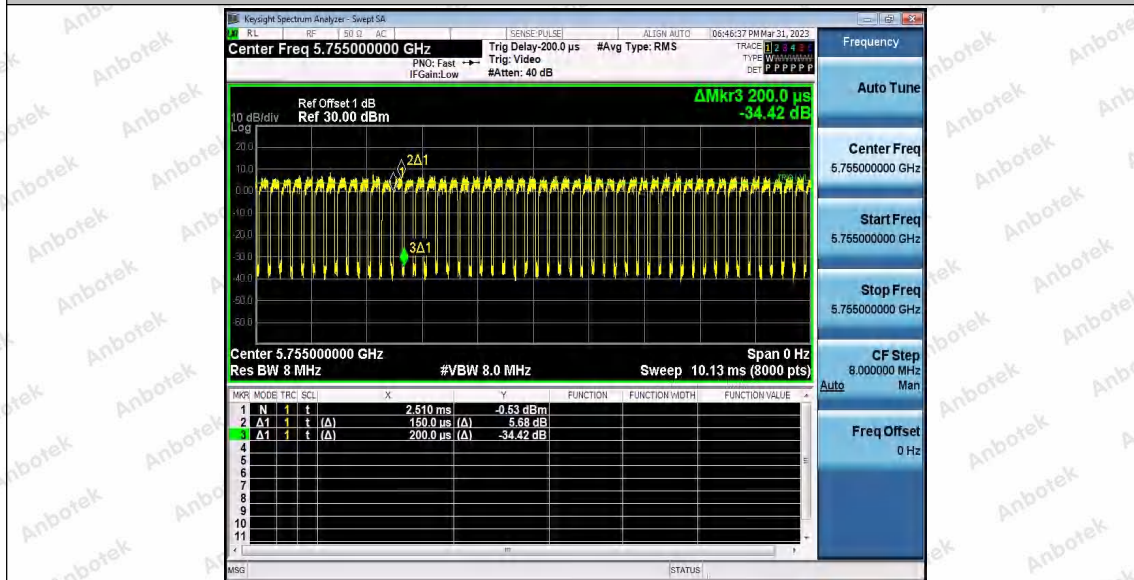

11AC40SISO\_Ant2\_5755

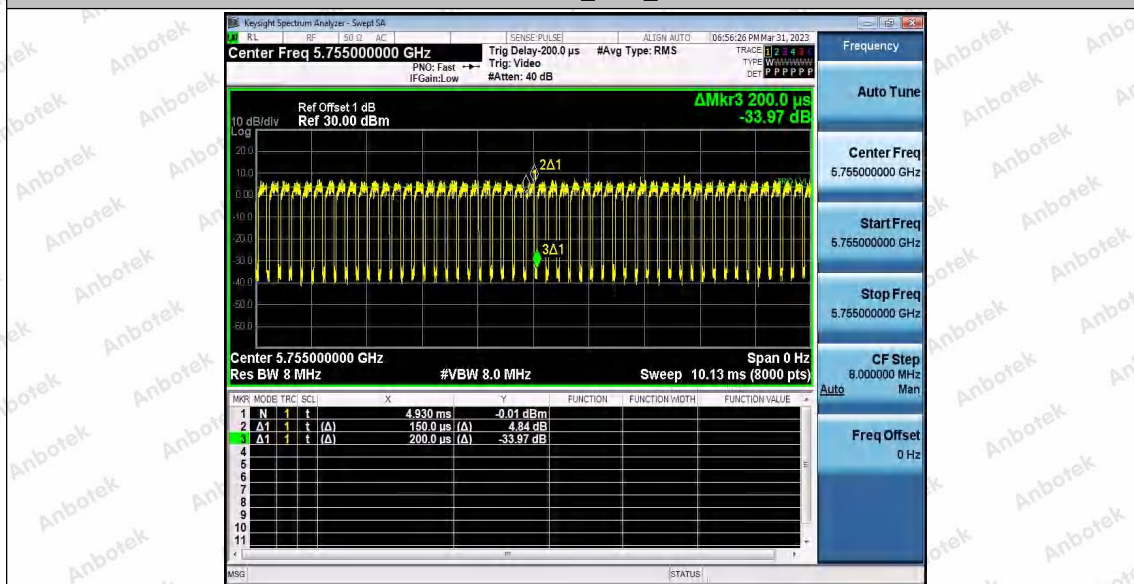

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn



## 11AC40SISO\_Ant1\_5795

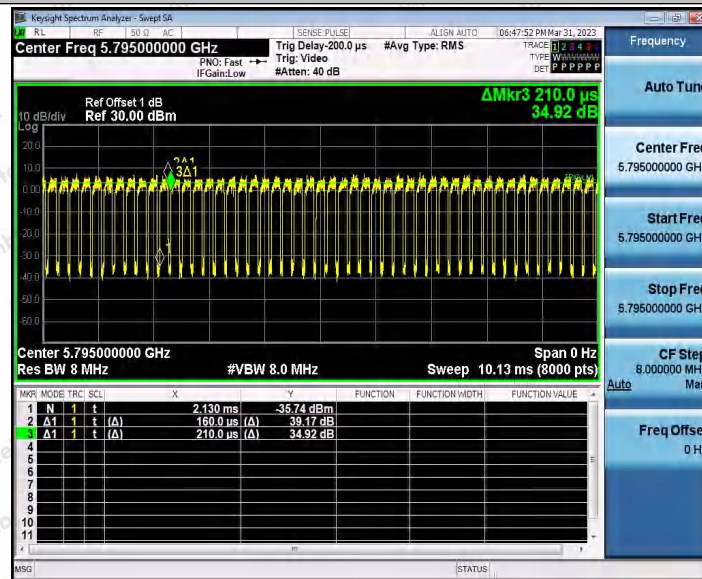

## 11AC40SISO\_Ant2\_5795

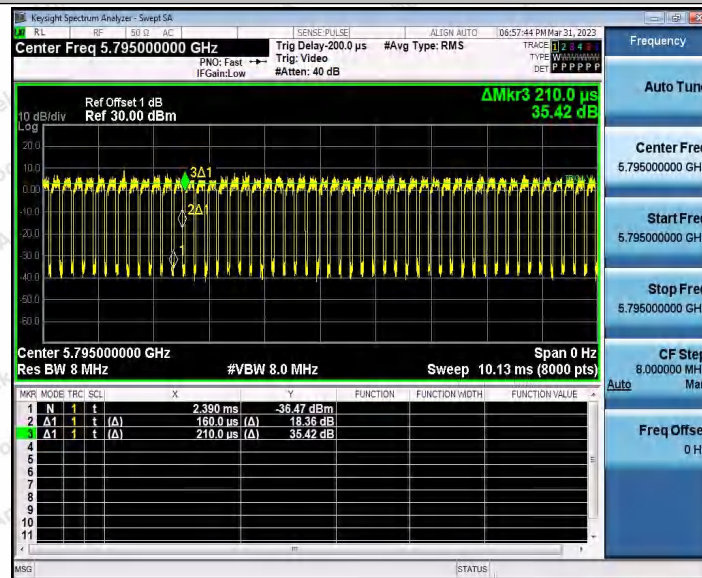

## 11AC80SISO\_Ant1\_5210


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



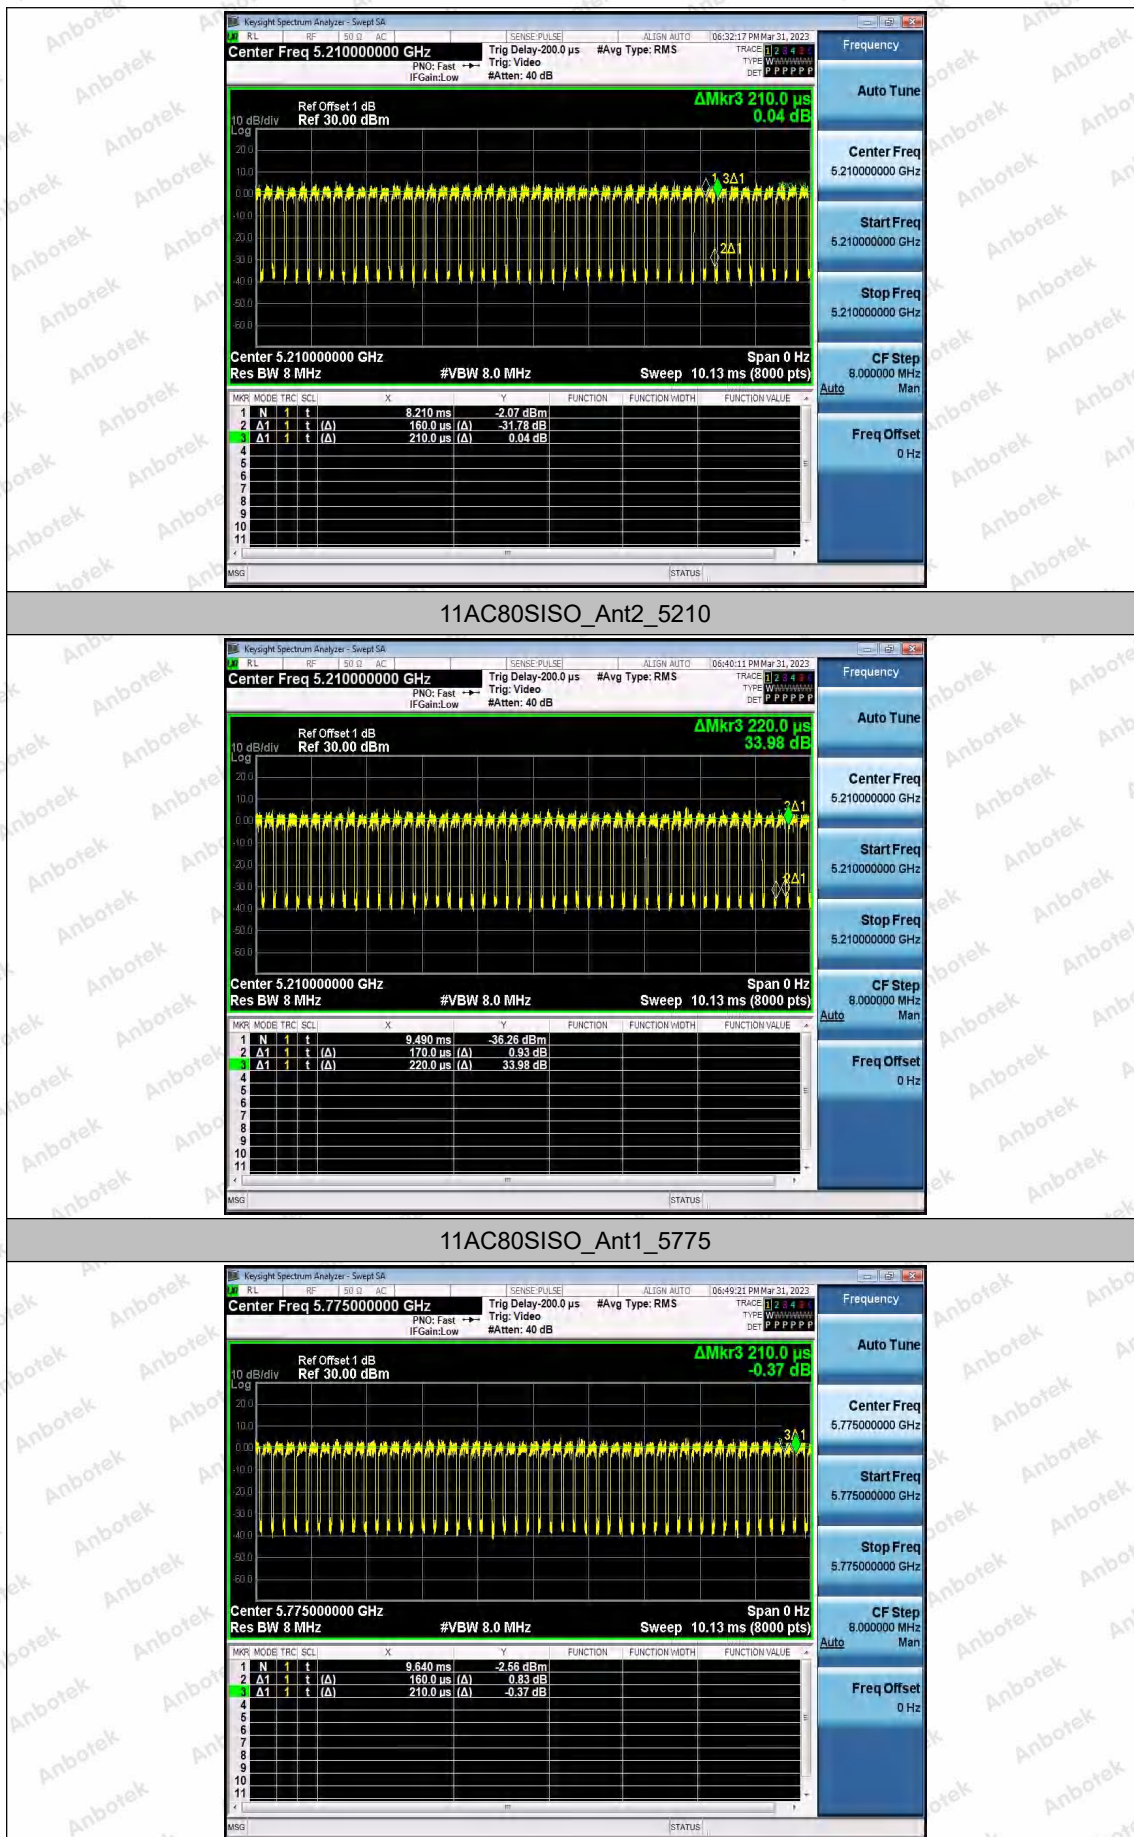


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn

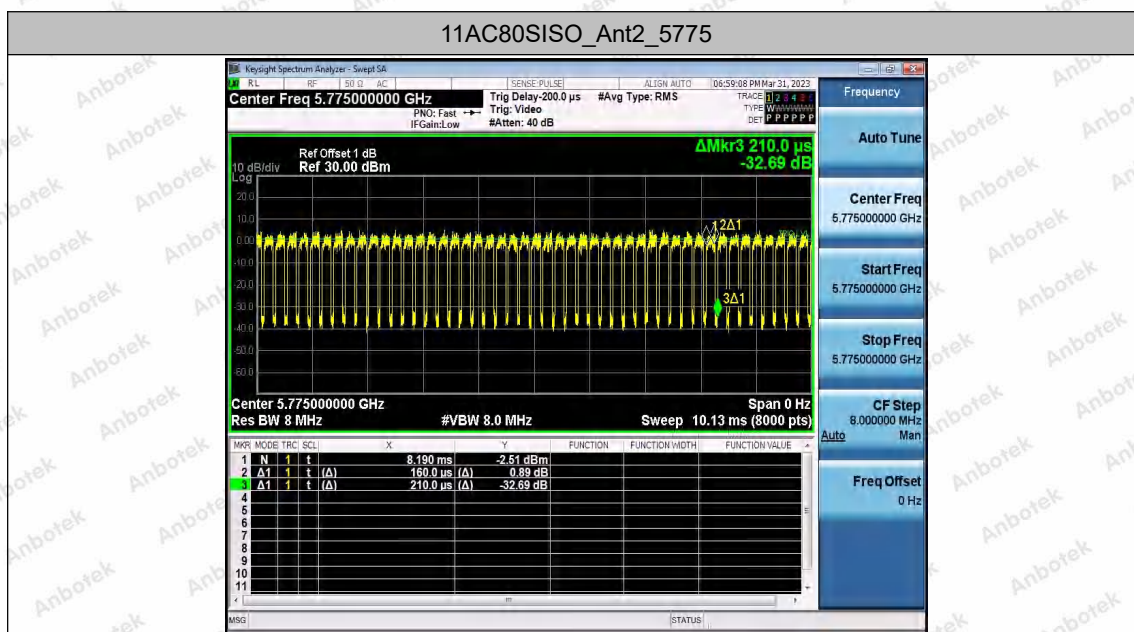

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



## Appendix C: Maximum conducted output power

### Test Result Channel Power

| Test Mode   | Antenna | Frequency [MHz] | Set Power | Channel Power [dBm] | Duty Cycle [%] | DC Factor [dBm] | Result [dBm] | Limit [dBm] |
|-------------|---------|-----------------|-----------|---------------------|----------------|-----------------|--------------|-------------|
| 11A         | Ant1    | 5180            | ---       | 11.40               | 75.00          | 1.25            | 12.65        | ≤23.98      |
|             | Ant2    | 5180            | ---       | 11.08               | 75.00          | 1.25            | 12.33        | ≤23.98      |
|             | Ant1    | 5200            | ---       | 11.24               | 75.00          | 1.25            | 12.49        | ≤23.98      |
|             | Ant2    | 5200            | ---       | 11.14               | 75.00          | 1.25            | 12.39        | ≤23.98      |
|             | Ant1    | 5240            | ---       | 11.16               | 73.68          | 1.33            | 12.49        | ≤23.98      |
|             | Ant2    | 5240            | ---       | 11.08               | 73.68          | 1.33            | 12.41        | ≤23.98      |
|             | Ant1    | 5745            | ---       | 11.42               | 73.68          | 1.33            | 12.75        | ≤30.00      |
|             | Ant2    | 5745            | ---       | 10.33               | 73.68          | 1.33            | 11.66        | ≤30.00      |
|             | Ant1    | 5785            | ---       | 11.26               | 78.95          | 1.03            | 12.29        | ≤30.00      |
|             | Ant2    | 5785            | ---       | 10.48               | 78.95          | 1.03            | 11.51        | ≤30.00      |
|             | Ant1    | 5825            | ---       | 11.09               | 75.00          | 1.25            | 12.34        | ≤30.00      |
|             | Ant2    | 5825            | ---       | 10.47               | 78.95          | 1.03            | 11.50        | ≤30.00      |
| 11N20 SISO  | Ant1    | 5180            | ---       | 11.24               | 78.26          | 1.06            | 12.30        | ≤23.98      |
|             | Ant2    | 5180            | ---       | 11.09               | 78.26          | 1.06            | 12.15        | ≤23.98      |
|             | Ant1    | 5200            | ---       | 11.04               | 77.27          | 1.12            | 12.16        | ≤23.98      |
|             | Ant2    | 5200            | ---       | 11.08               | 77.27          | 1.12            | 12.20        | ≤23.98      |
|             | Ant1    | 5240            | ---       | 11.01               | 78.26          | 1.06            | 12.07        | ≤23.98      |
|             | Ant2    | 5240            | ---       | 11.10               | 77.27          | 1.12            | 12.22        | ≤23.98      |
|             | Ant1    | 5745            | ---       | 11.10               | 77.27          | 1.12            | 12.22        | ≤30.00      |
|             | Ant2    | 5745            | ---       | 11.09               | 77.27          | 1.12            | 12.21        | ≤30.00      |
|             | Ant1    | 5785            | ---       | 10.77               | 77.27          | 1.12            | 11.89        | ≤30.00      |
|             | Ant2    | 5785            | ---       | 10.82               | 77.27          | 1.12            | 11.94        | ≤30.00      |
|             | Ant1    | 5825            | ---       | 10.69               | 78.26          | 1.06            | 11.75        | ≤30.00      |
|             | Ant2    | 5825            | ---       | 10.72               | 77.27          | 1.12            | 11.84        | ≤30.00      |
| 11N40 SISO  | Ant1    | 5190            | ---       | 10.98               | 78.26          | 1.06            | 12.04        | ≤23.98      |
|             | Ant2    | 5190            | ---       | 11.04               | 81.82          | 0.87            | 11.91        | ≤23.98      |
|             | Ant1    | 5230            | ---       | 11.05               | 78.26          | 1.06            | 12.11        | ≤23.98      |
|             | Ant2    | 5230            | ---       | 10.98               | 81.82          | 0.87            | 11.85        | ≤23.98      |
|             | Ant1    | 5755            | ---       | 11.22               | 81.82          | 0.87            | 12.09        | ≤30.00      |
|             | Ant2    | 5755            | ---       | 11.22               | 78.26          | 1.06            | 12.28        | ≤30.00      |
|             | Ant1    | 5795            | ---       | 11.04               | 81.82          | 0.87            | 11.91        | ≤30.00      |
|             | Ant2    | 5795            | ---       | 10.99               | 78.26          | 1.06            | 12.05        | ≤30.00      |
| 11AC2 OSISO | Ant1    | 5180            | ---       | 10.84               | 76.19          | 1.18            | 12.02        | ≤23.98      |
|             | Ant2    | 5180            | ---       | 10.08               | 77.27          | 1.12            | 11.20        | ≤23.98      |
|             | Ant1    | 5200            | ---       | 10.81               | 77.27          | 1.12            | 11.93        | ≤23.98      |

#### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



|                |      |      |     |       |       |      |       |        |
|----------------|------|------|-----|-------|-------|------|-------|--------|
|                | Ant2 | 5200 | --- | 10.12 | 76.19 | 1.18 | 11.30 | ≤23.98 |
|                | Ant1 | 5240 | --- | 10.63 | 76.19 | 1.18 | 11.81 | ≤23.98 |
|                | Ant2 | 5240 | --- | 10.07 | 76.19 | 1.18 | 11.25 | ≤23.98 |
|                | Ant1 | 5745 | --- | 9.97  | 77.27 | 1.12 | 11.09 | ≤30.00 |
|                | Ant2 | 5745 | --- | 9.98  | 76.19 | 1.18 | 11.16 | ≤30.00 |
|                | Ant1 | 5785 | --- | 9.83  | 76.19 | 1.18 | 11.01 | ≤30.00 |
|                | Ant2 | 5785 | --- | 9.70  | 76.19 | 1.18 | 10.88 | ≤30.00 |
|                | Ant1 | 5825 | --- | 9.67  | 76.19 | 1.18 | 10.85 | ≤30.00 |
|                | Ant2 | 5825 | --- | 9.63  | 76.19 | 1.18 | 10.81 | ≤30.00 |
| 11AC4<br>OSISO | Ant1 | 5190 | --- | 11.73 | 75.00 | 1.18 | 12.91 | ≤23.98 |
|                | Ant2 | 5190 | --- | 11.72 | 75.00 | 1.18 | 12.90 | ≤23.98 |
|                | Ant1 | 5230 | --- | 10.28 | 75.00 | 1.25 | 11.53 | ≤23.98 |
|                | Ant2 | 5230 | --- | 10.20 | 76.19 | 1.18 | 11.38 | ≤23.98 |
|                | Ant1 | 5755 | --- | 11.55 | 75.00 | 1.18 | 12.73 | ≤30.00 |
|                | Ant2 | 5755 | --- | 11.55 | 75.00 | 1.18 | 12.73 | ≤30.00 |
|                | Ant1 | 5795 | --- | 9.83  | 76.19 | 1.18 | 11.01 | ≤30.00 |
|                | Ant2 | 5795 | --- | 9.78  | 76.19 | 1.18 | 10.96 | ≤30.00 |
| 11AC8<br>OSISO | Ant1 | 5210 | --- | 10.77 | 76.19 | 1.18 | 11.95 | ≤23.98 |
|                | Ant2 | 5210 | --- | 10.84 | 77.27 | 1.12 | 11.96 | ≤23.98 |
|                | Ant1 | 5775 | --- | 10.13 | 76.19 | 1.18 | 11.31 | ≤30.00 |
|                | Ant2 | 5775 | --- | 10.02 | 76.19 | 1.18 | 11.20 | ≤30.00 |

Note: The Duty Cycle Factor is compensated in the graph.



## MIMO:

| Test Mode  | Antenna   | Frequency[MHz] | Result [dBm] | Limit [dBm] |
|------------|-----------|----------------|--------------|-------------|
| 11N20MIMO  | Ant1+ANT2 | 5180           | 15.24        | ≤23.98      |
|            | Ant1+ANT2 | 5200           | 15.19        | ≤23.98      |
|            | Ant1+ANT2 | 5240           | 15.16        | ≤23.98      |
|            | Ant1+ANT2 | 5745           | 15.23        | ≤30.00      |
|            | Ant1+ANT2 | 5785           | 14.93        | ≤30.00      |
|            | Ant1+ANT2 | 5825           | 14.81        | ≤30.00      |
| 11N40MIMO  | Ant1+ANT2 | 5190           | 14.99        | ≤23.98      |
|            | Ant1+ANT2 | 5230           | 14.99        | ≤23.98      |
|            | Ant1+ANT2 | 5755           | 15.20        | ≤30.00      |
|            | Ant1+ANT2 | 5795           | 14.99        | ≤30.00      |
| 11AC20MIMO | Ant1+ANT2 | 5180           | 14.64        | ≤23.98      |
|            | Ant1+ANT2 | 5200           | 14.64        | ≤23.98      |
|            | Ant1+ANT2 | 5240           | 14.55        | ≤23.98      |
|            | Ant1+ANT2 | 5745           | 14.14        | ≤30.00      |
|            | Ant1+ANT2 | 5785           | 13.96        | ≤30.00      |
|            | Ant1+ANT2 | 5825           | 13.84        | ≤30.00      |
| 11AC40MIMO | Ant1+ANT2 | 5190           | <b>15.92</b> | ≤23.98      |
|            | Ant1+ANT2 | 5230           | 14.47        | ≤23.98      |
|            | Ant1+ANT2 | 5755           | 15.74        | ≤30.00      |
|            | Ant1+ANT2 | 5795           | 14.00        | ≤30.00      |
| 11AC80MIMO | Ant1+ANT2 | 5210           | 14.97        | ≤23.98      |
|            | Ant1+ANT2 | 5775           | 14.27        | ≤30.00      |

## Note:

$$1. \text{ Total (dBm)} = 10 \times \log(10^{(\text{ANT1 power(dBm)}/10)} + 10^{(\text{Ant2 power(dBm)}/10)})$$

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



## Appendix D: Maximum power spectral density

### Test Result B1

| TestMode   | Antenna | Frequency[MHz] | Result [dBm/MHz] | Limit[dBm/MHz] | Verdict |
|------------|---------|----------------|------------------|----------------|---------|
| 11A        | Ant1    | 5180           | 3.61             | ≤11.00         | PASS    |
|            | Ant2    | 5180           | 3.25             | ≤11.00         | PASS    |
|            | Ant1    | 5200           | 3.45             | ≤11.00         | PASS    |
|            | Ant2    | 5200           | 3.59             | ≤11.00         | PASS    |
|            | Ant1    | 5240           | 4.05             | ≤11.00         | PASS    |
|            | Ant2    | 5240           | 3.29             | ≤11.00         | PASS    |
| 11N20SISO  | Ant1    | 5180           | 3.22             | ≤11.00         | PASS    |
|            | Ant2    | 5180           | 2.87             | ≤11.00         | PASS    |
|            | Ant1    | 5200           | 3.02             | ≤11.00         | PASS    |
|            | Ant2    | 5200           | 3.34             | ≤11.00         | PASS    |
|            | Ant1    | 5240           | 3.27             | ≤11.00         | PASS    |
|            | Ant2    | 5240           | 2.12             | ≤11.00         | PASS    |
| 11N40SISO  | Ant1    | 5190           | -0.34            | ≤11.00         | PASS    |
|            | Ant2    | 5190           | -0.48            | ≤11.00         | PASS    |
|            | Ant1    | 5230           | -0.12            | ≤11.00         | PASS    |
|            | Ant2    | 5230           | -0.36            | ≤11.00         | PASS    |
| 11AC20SISO | Ant1    | 5180           | 2.94             | ≤11.00         | PASS    |
|            | Ant2    | 5180           | 2.18             | ≤11.00         | PASS    |
|            | Ant1    | 5200           | 2.97             | ≤11.00         | PASS    |
|            | Ant2    | 5200           | 2.61             | ≤11.00         | PASS    |
|            | Ant1    | 5240           | 2.64             | ≤11.00         | PASS    |
|            | Ant2    | 5240           | 2.54             | ≤11.00         | PASS    |
| 11AC40SISO | Ant1    | 5190           | -1.08            | ≤11.00         | PASS    |
|            | Ant2    | 5190           | -0.58            | ≤11.00         | PASS    |
|            | Ant1    | 5230           | -1.21            | ≤11.00         | PASS    |
|            | Ant2    | 5230           | -0.69            | ≤11.00         | PASS    |
| 11AC80SISO | Ant1    | 5210           | -3.04            | ≤11.00         | PASS    |
|            | Ant2    | 5210           | -3.33            | ≤11.00         | PASS    |

Note: 1.The Duty Cycle Factor and RBW Factor is compensated in the graph.

### MIMO:

| TestMode  | Antenna   | Frequency[MHz] | Result [dBm/MHz] | Limit[dBm/MHz] | Verdict |
|-----------|-----------|----------------|------------------|----------------|---------|
| 11N20MIMO | Ant1+ANT2 | 5180           | 6.06             | ≤11.00         | PASS    |
|           | Ant1+ANT2 | 5200           | 6.19             | ≤11.00         | PASS    |
|           | Ant1+ANT2 | 5240           | 5.74             | ≤11.00         | PASS    |
| 11N40MIMO | Ant1+ANT2 | 5190           | 2.60             | ≤11.00         | PASS    |

### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



|            |           |      |       |        |      |
|------------|-----------|------|-------|--------|------|
|            | Ant1+ANT2 | 5230 | 2.77  | ≤11.00 | PASS |
| 11AC20MIMO | Ant1+ANT2 | 5180 | 5.59  | ≤11.00 | PASS |
|            | Ant1+ANT2 | 5200 | 5.80  | ≤11.00 | PASS |
|            | Ant1+ANT2 | 5240 | 5.60  | ≤11.00 | PASS |
| 11AC40MIMO | Ant1+ANT2 | 5190 | 2.19  | ≤11.00 | PASS |
|            | Ant1+ANT2 | 5230 | 2.07  | ≤11.00 | PASS |
| 11AC80MIMO | Ant1+ANT2 | 5210 | -0.17 | ≤11.00 | PASS |

Note:

$$1. \text{Total (dBm)} = 10 \times \log(10^{(\text{ANT1 power(dBm)/10})} + 10^{(\text{Ant2 power(dBm)/10})})$$

## Test Result B4

| TestMode   | Antenna | Frequency[MHz] | Result [dBm/500KHz] | Limit[dBm/500KHz] | Verdict |
|------------|---------|----------------|---------------------|-------------------|---------|
| 11A        | Ant1    | 5745           | -0.67               | ≤30.00            | PASS    |
|            | Ant2    | 5745           | -1.8                | ≤30.00            | PASS    |
|            | Ant1    | 5785           | -0.06               | ≤30.00            | PASS    |
|            | Ant2    | 5785           | -1.68               | ≤30.00            | PASS    |
|            | Ant1    | 5825           | -1.18               | ≤30.00            | PASS    |
|            | Ant2    | 5825           | -1.6                | ≤30.00            | PASS    |
| 11N20SISO  | Ant1    | 5745           | -1.25               | ≤30.00            | PASS    |
|            | Ant2    | 5745           | -0.75               | ≤30.00            | PASS    |
|            | Ant1    | 5785           | -1.49               | ≤30.00            | PASS    |
|            | Ant2    | 5785           | -1.63               | ≤30.00            | PASS    |
|            | Ant1    | 5825           | -1.23               | ≤30.00            | PASS    |
|            | Ant2    | 5825           | -1.47               | ≤30.00            | PASS    |
| 11N40SISO  | Ant1    | 5755           | -3.83               | ≤30.00            | PASS    |
|            | Ant2    | 5755           | -4.56               | ≤30.00            | PASS    |
|            | Ant1    | 5795           | -4.22               | ≤30.00            | PASS    |
|            | Ant2    | 5795           | -4.18               | ≤30.00            | PASS    |
| 11AC20SISO | Ant1    | 5745           | -2.17               | ≤30.00            | PASS    |
|            | Ant2    | 5745           | -1.64               | ≤30.00            | PASS    |
|            | Ant1    | 5785           | -2.64               | ≤30.00            | PASS    |
|            | Ant2    | 5785           | -2.61               | ≤30.00            | PASS    |
|            | Ant1    | 5825           | -1.87               | ≤30.00            | PASS    |
|            | Ant2    | 5825           | -2.42               | ≤30.00            | PASS    |
| 11AC40SISO | Ant1    | 5755           | -5.65               | ≤30.00            | PASS    |
|            | Ant2    | 5755           | -5.56               | ≤30.00            | PASS    |
|            | Ant1    | 5795           | -4.98               | ≤30.00            | PASS    |
|            | Ant2    | 5795           | -5.28               | ≤30.00            | PASS    |
| 11AC80SISO | Ant1    | 5775           | -8.6                | ≤30.00            | PASS    |
|            | Ant2    | 5775           | -7.94               | ≤30.00            | PASS    |

Note: 1.The Duty Cycle Factor and RBW Factor is compensated in the graph.

### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



## MIMO:


| Test Mode  | Antenna   | Frequency[MHz] | Result<br>[dBm/500KHz] | Limit<br>[dBm/500KHz] | Verdict |
|------------|-----------|----------------|------------------------|-----------------------|---------|
| 11N20MIMO  | Ant1+ANT2 | 5745           | 2.02                   | ≤30.00                | PASS    |
|            | Ant1+ANT2 | 5785           | 1.45                   | ≤30.00                | PASS    |
|            | Ant1+ANT2 | 5825           | 1.66                   | ≤30.00                | PASS    |
| 11N40MIMO  | Ant1+ANT2 | 5755           | -1.17                  | ≤30.00                | PASS    |
|            | Ant1+ANT2 | 5795           | -1.19                  | ≤30.00                | PASS    |
| 11AC20MIMO | Ant1+ANT2 | 5745           | 1.11                   | ≤30.00                | PASS    |
|            | Ant1+ANT2 | 5785           | 0.39                   | ≤30.00                | PASS    |
|            | Ant1+ANT2 | 5825           | 0.87                   | ≤30.00                | PASS    |
| 11AC40MIMO | Ant1+ANT2 | 5755           | -2.59                  | ≤30.00                | PASS    |
|            | Ant1+ANT2 | 5795           | -2.12                  | ≤30.00                | PASS    |
| 11AC80MIMO | Ant1+ANT2 | 5775           | -5.25                  | ≤30.00                | PASS    |

Note:

$$1. \text{Total (dBm)} = 10 \times \log(10^{(\text{Ant1 power(dBm)/10})} + 10^{(\text{Ant2 power(dBm)/10})})$$



## Test Graphs B1

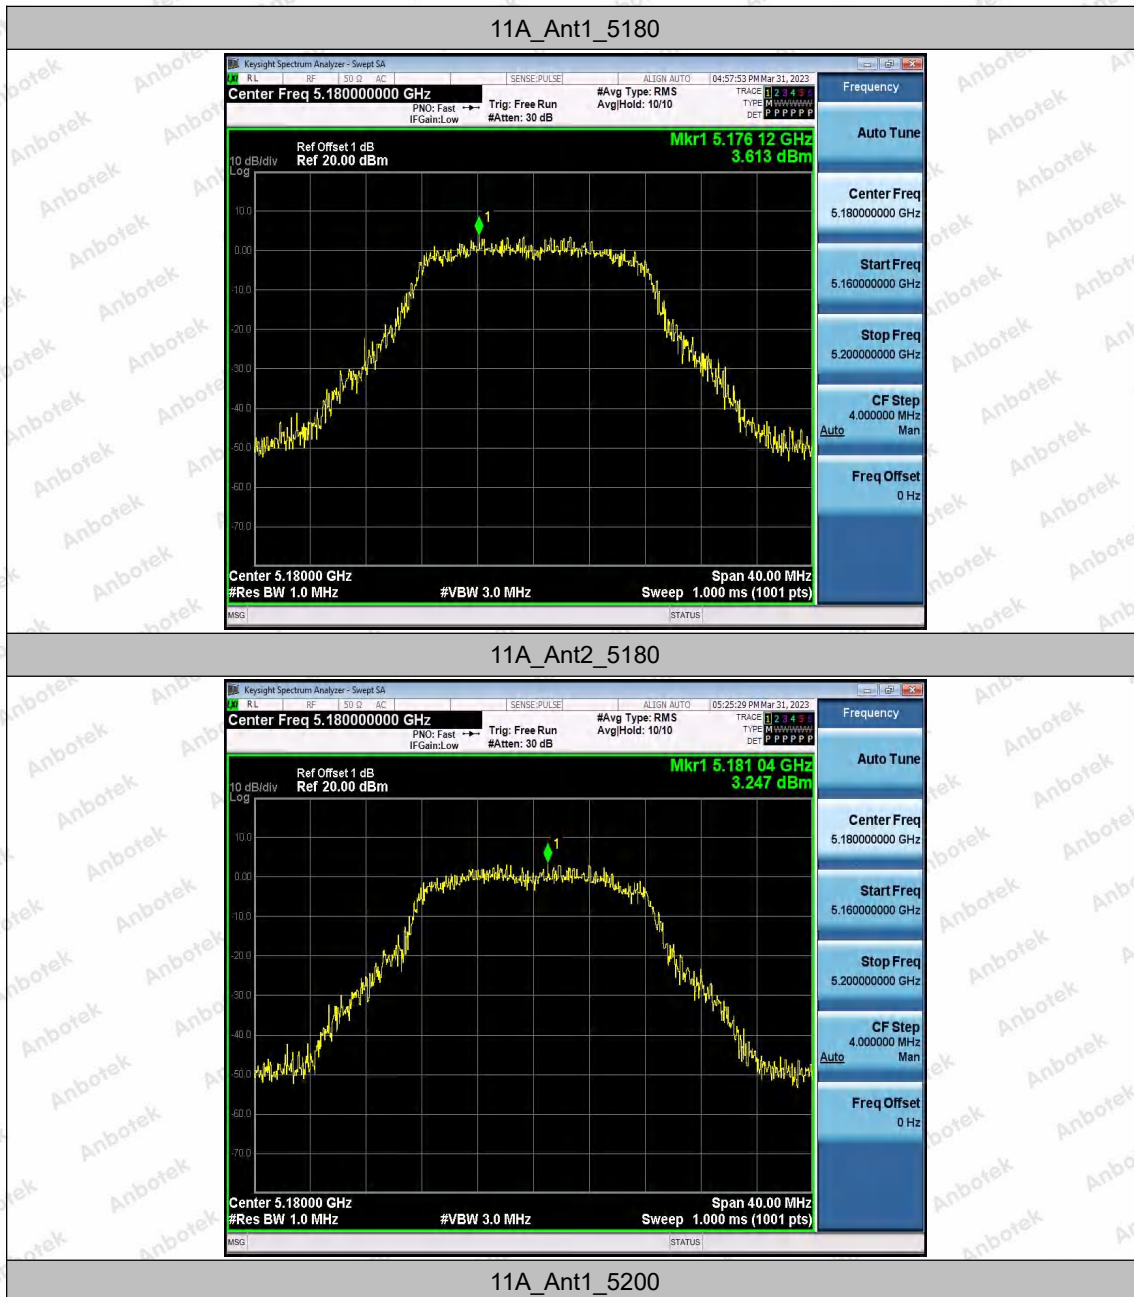

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





11A\_Ant2\_5200



11A\_Ant1\_5240



## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



11A\_Ant2\_5240



11N20SISO\_Ant1\_5180



11N20SISO\_Ant2\_5180

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



11N20SISO\_Ant1\_5240



11N20SISO\_Ant2\_5240



11N40SISO\_Ant1\_5190

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





11N40SISO\_Ant2\_5190



11N40SISO\_Ant1\_5230



## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn

