






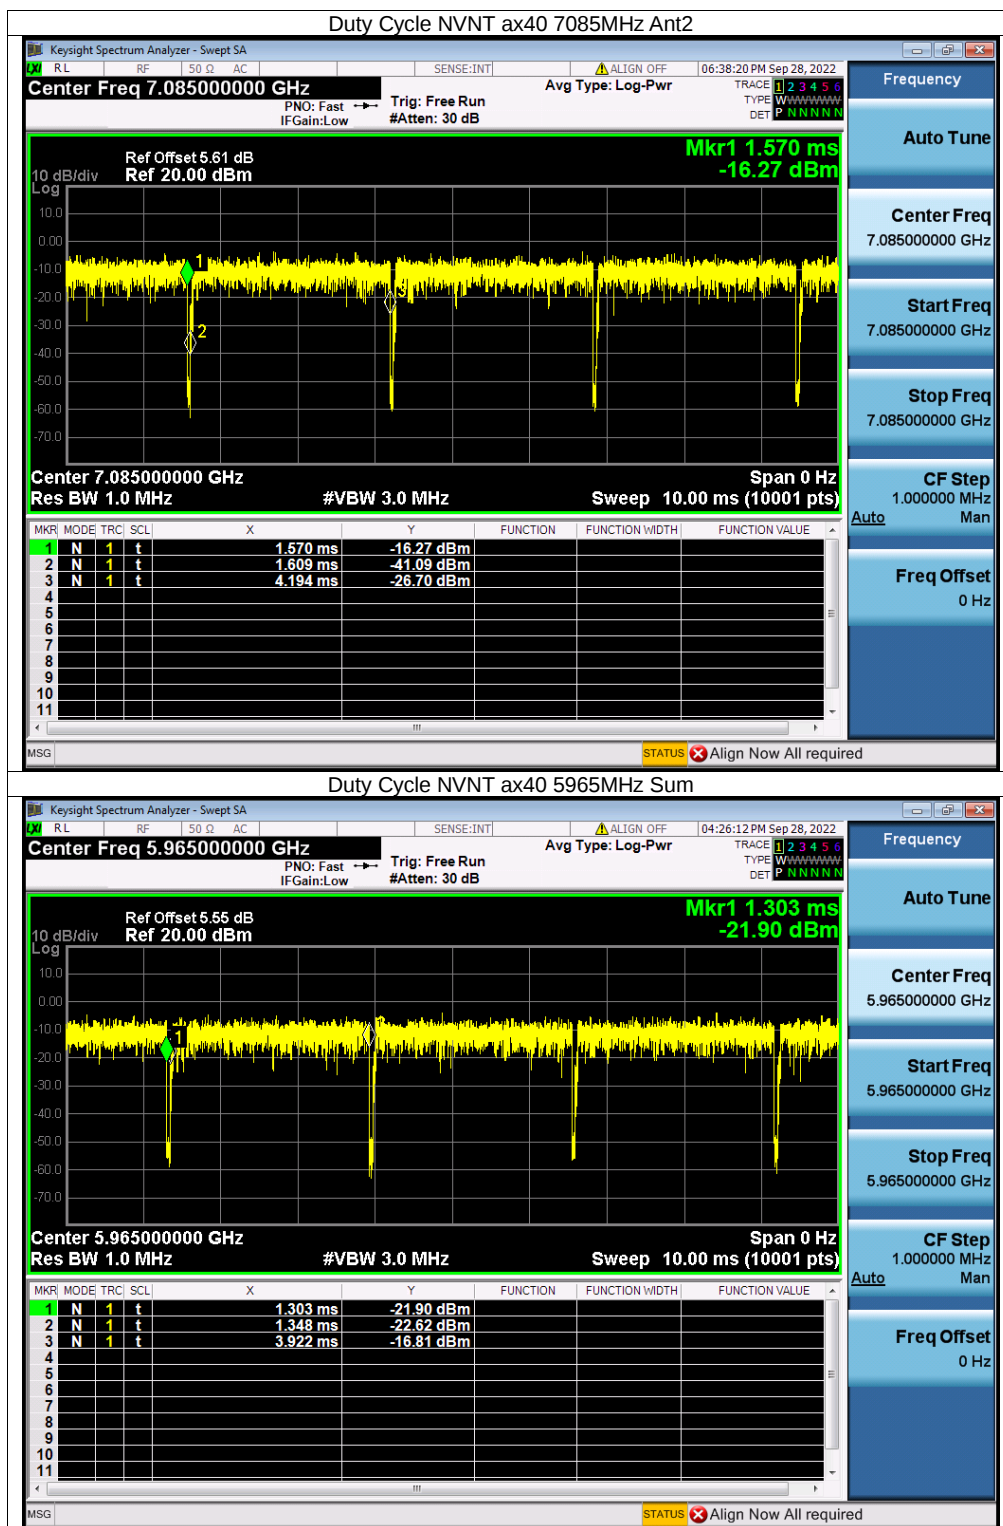


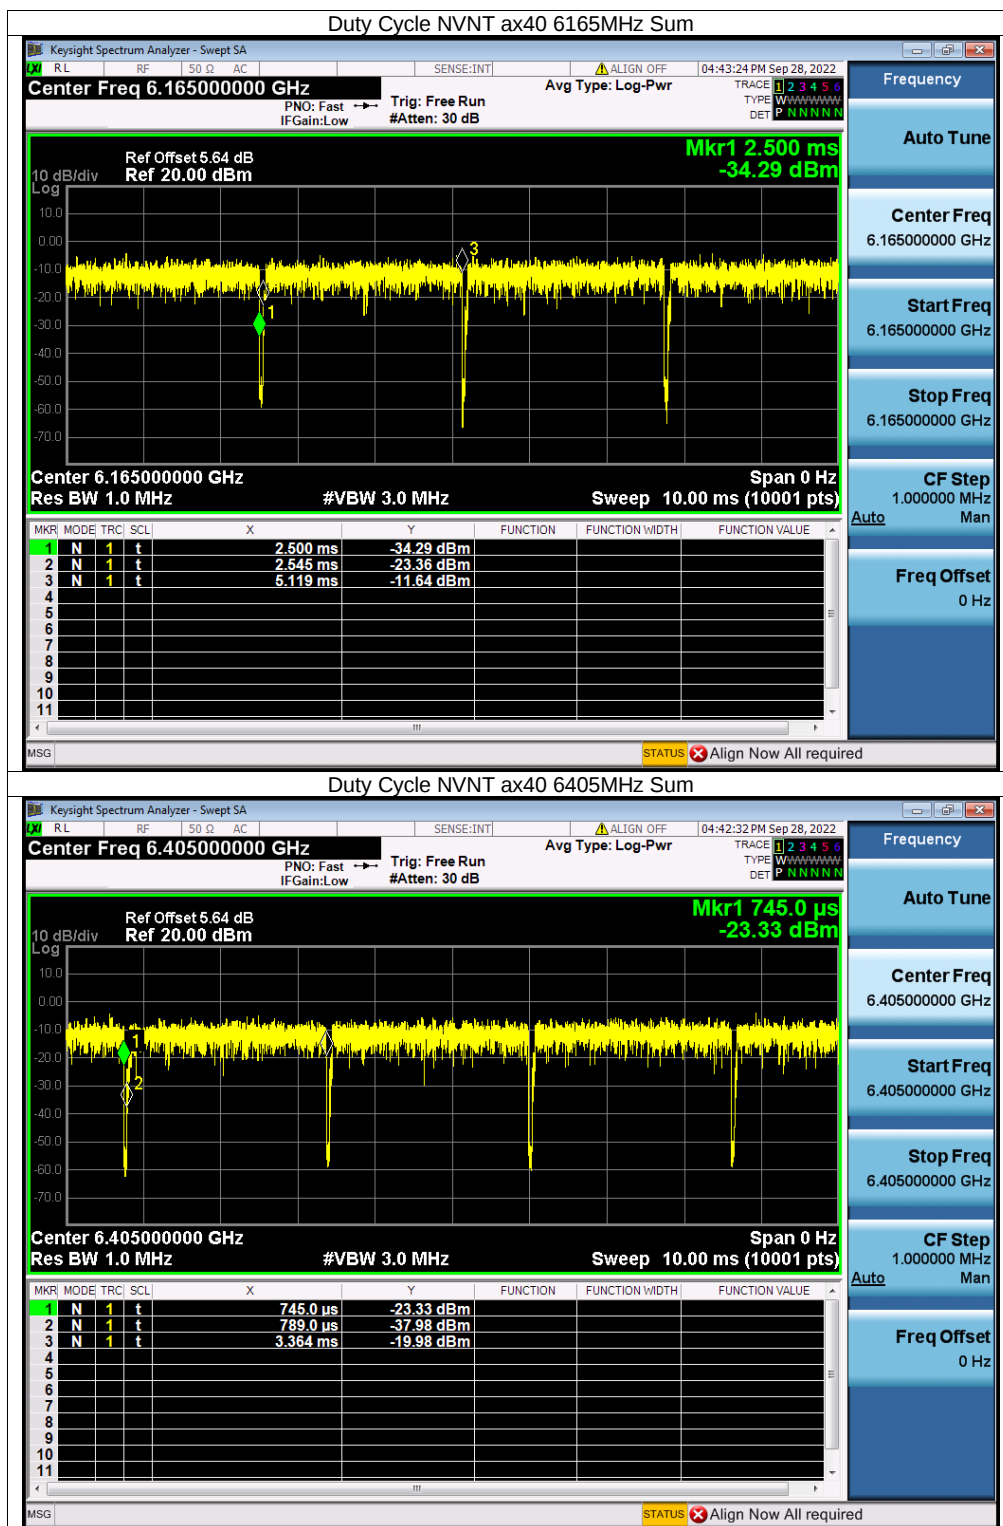


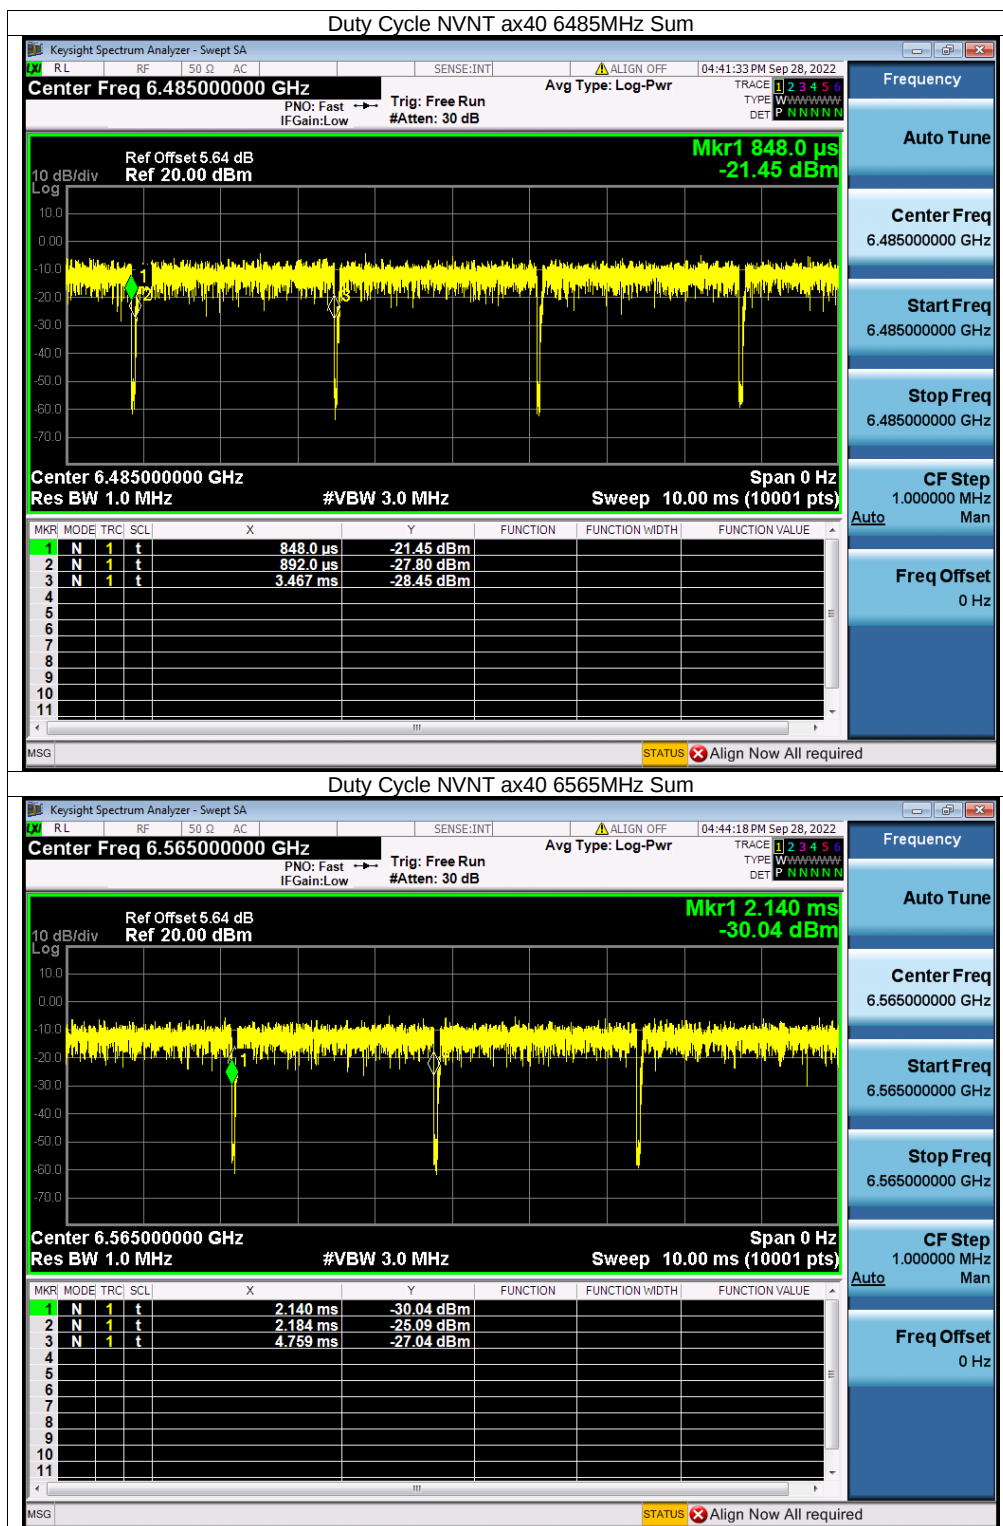


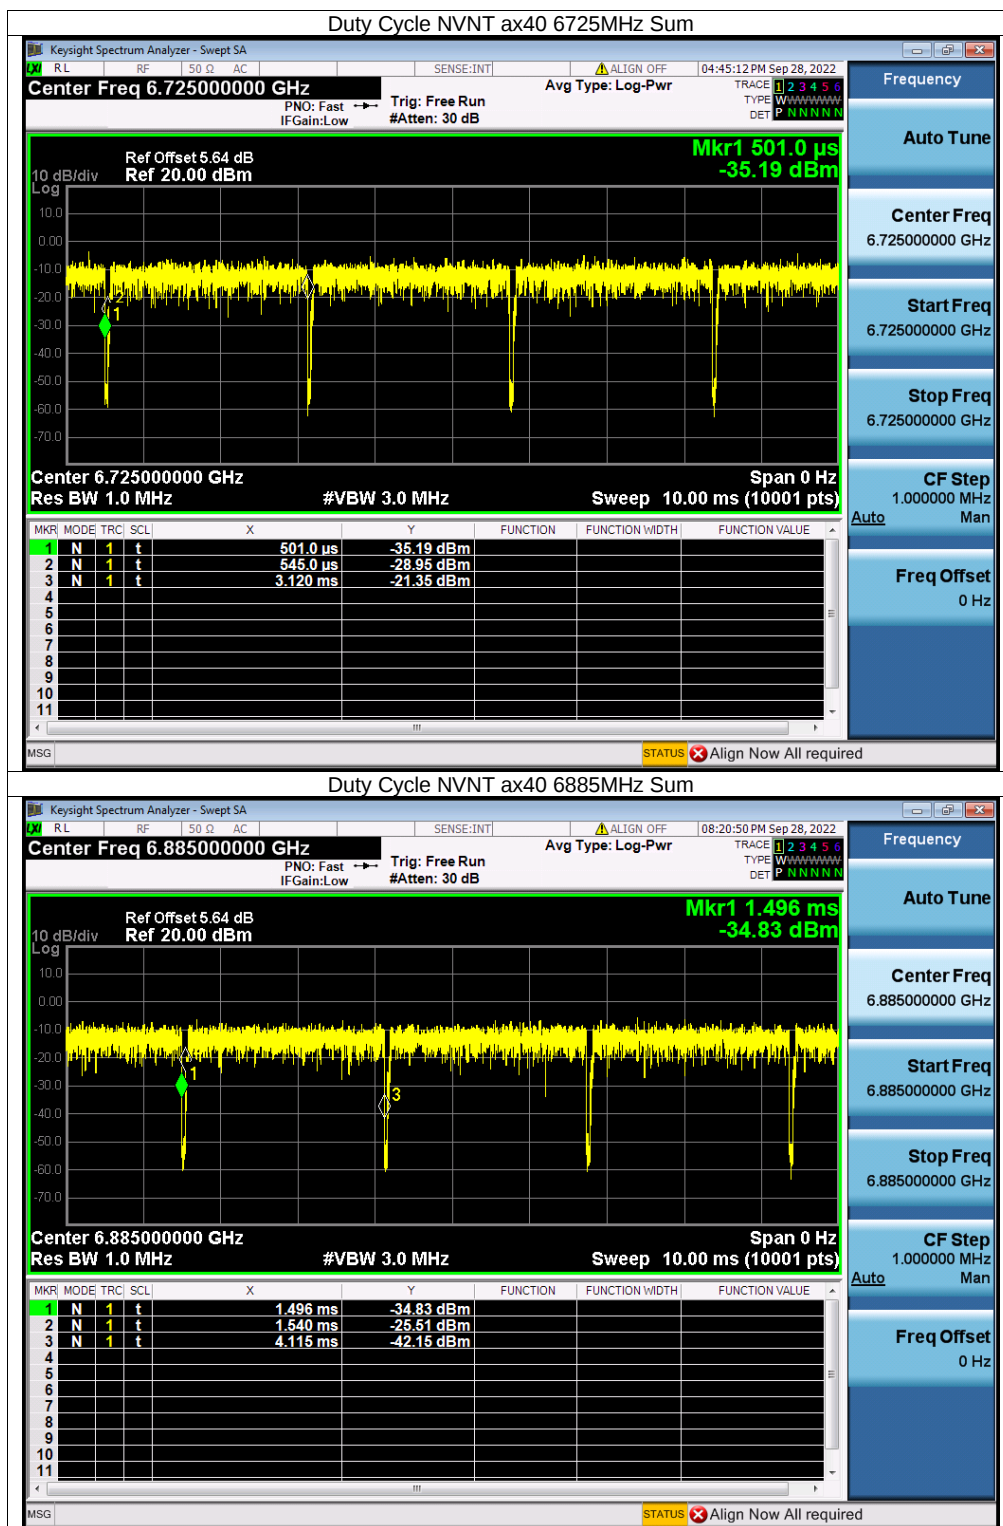



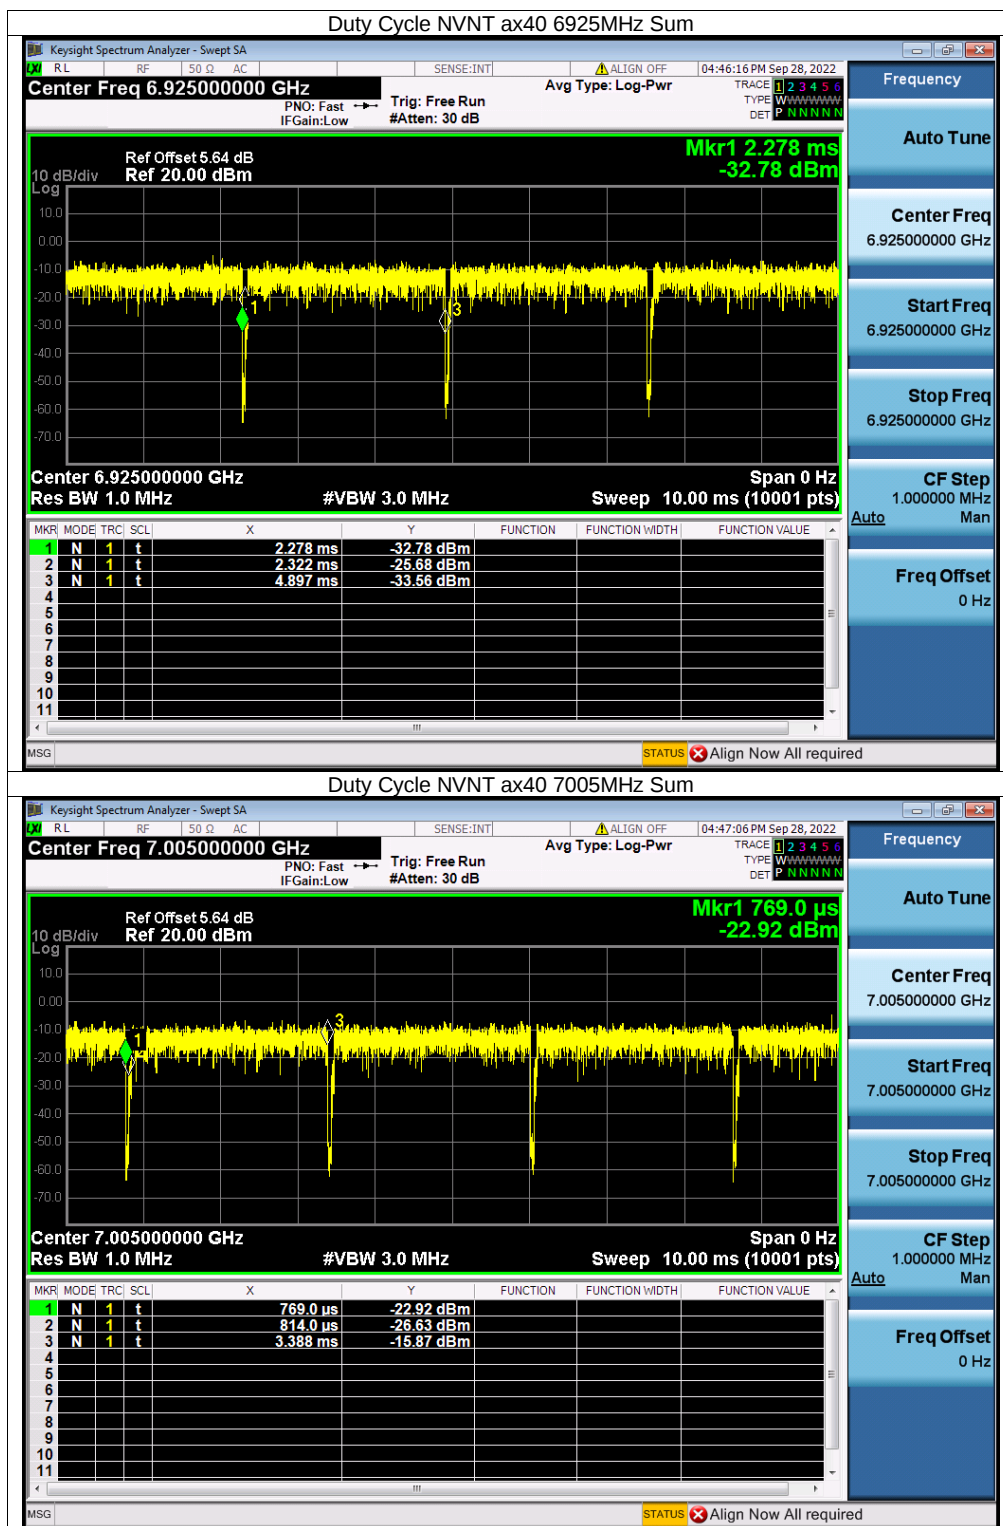


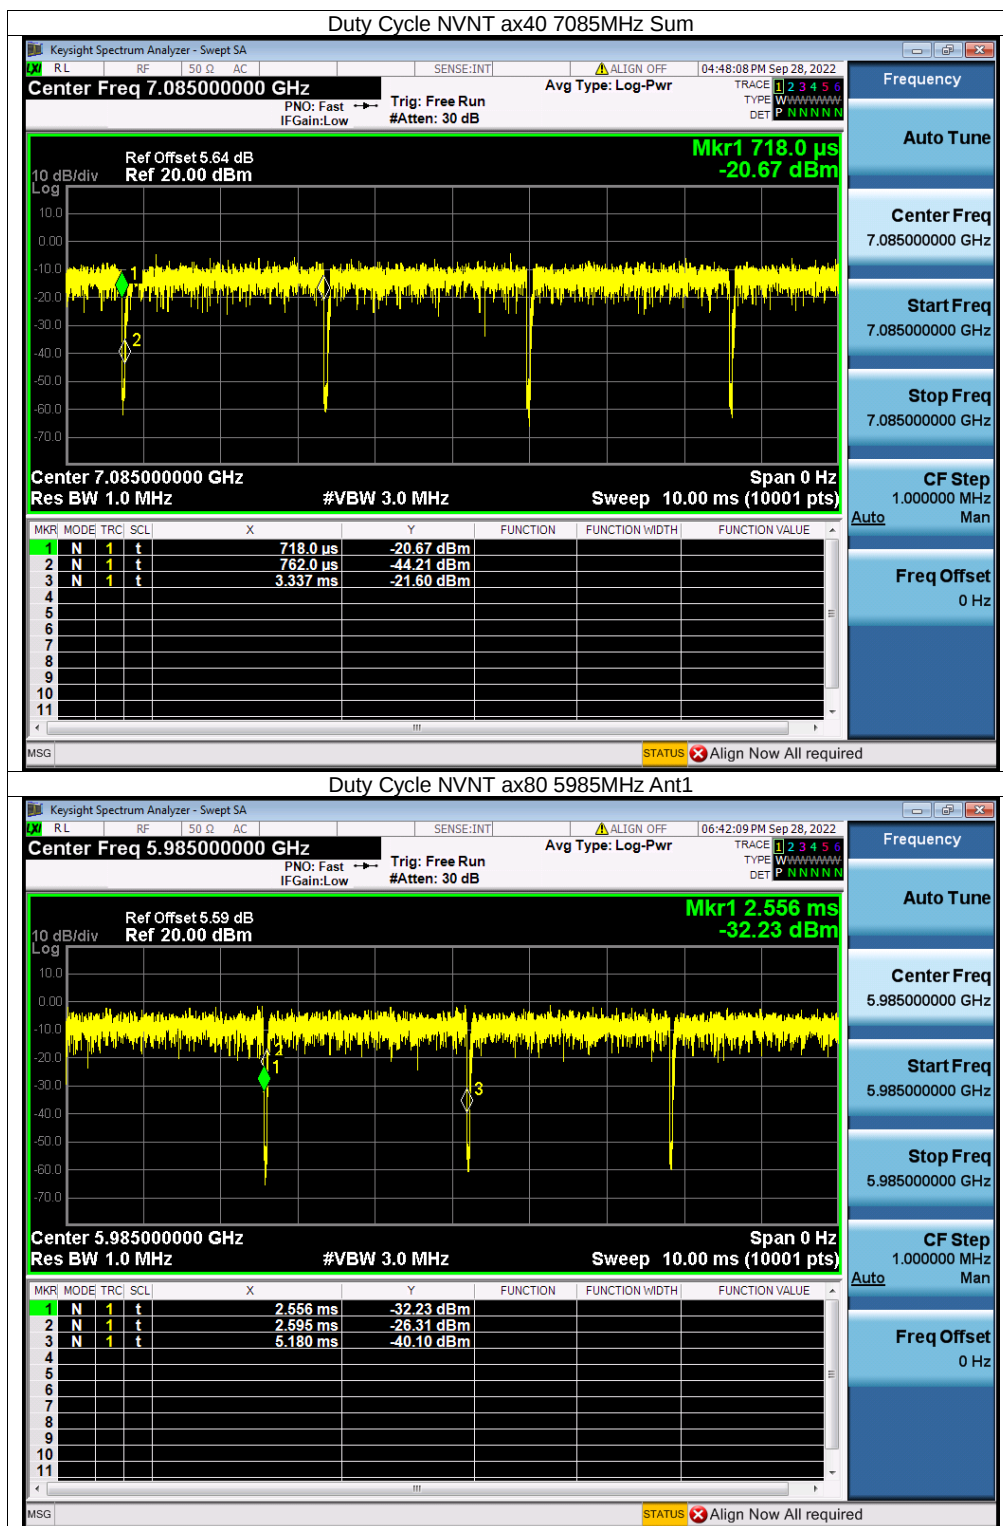


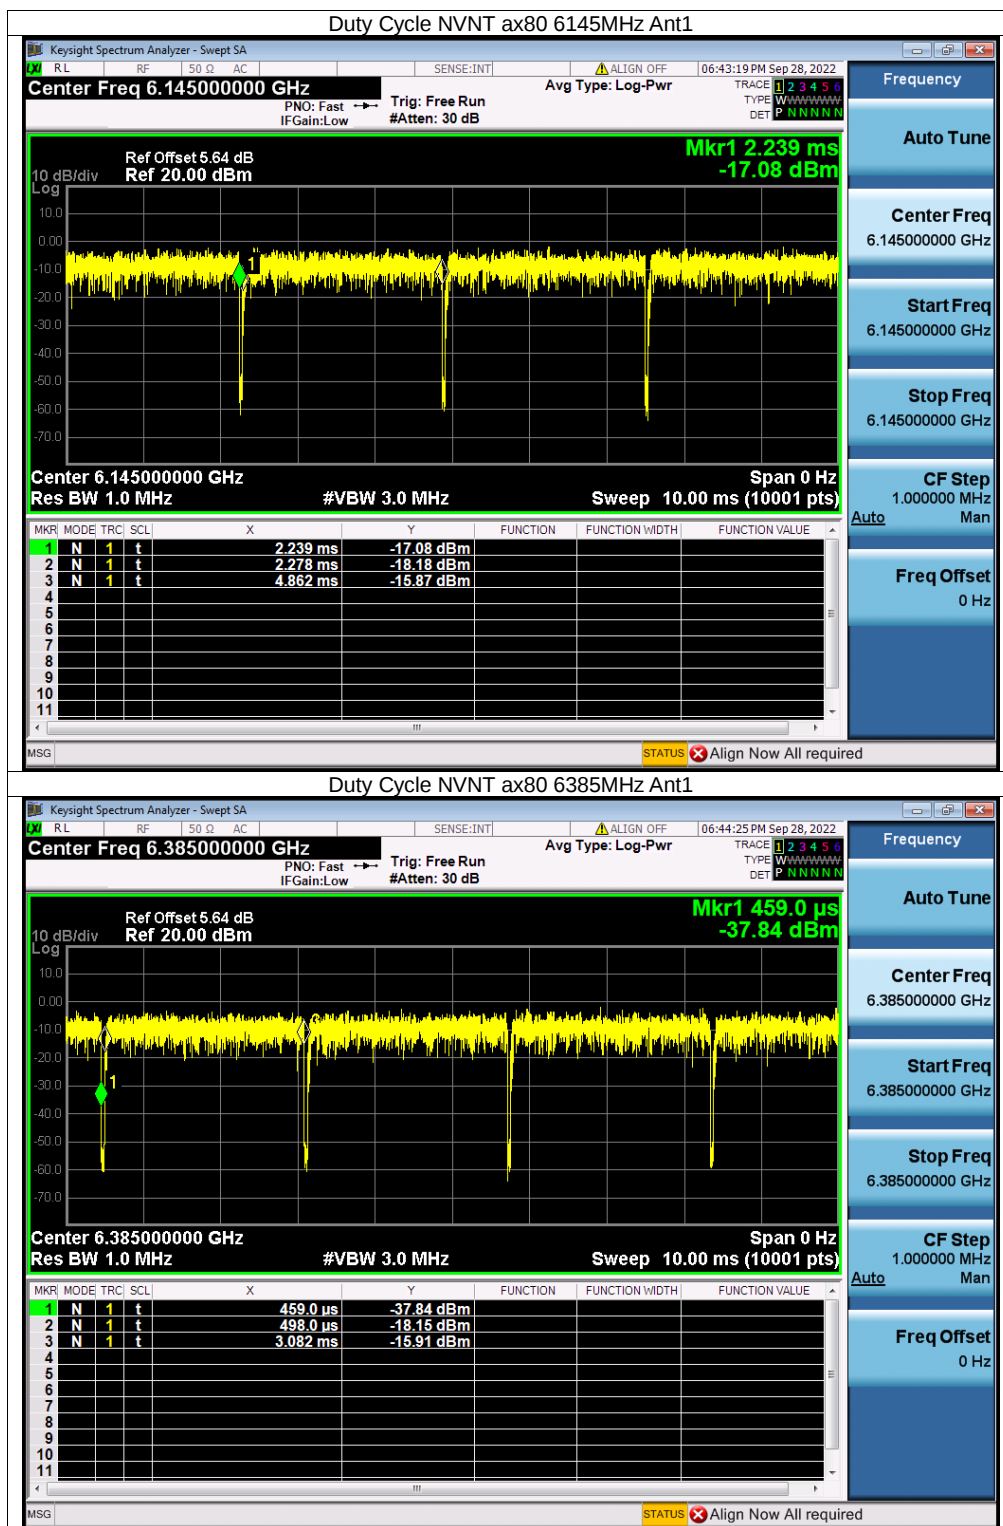


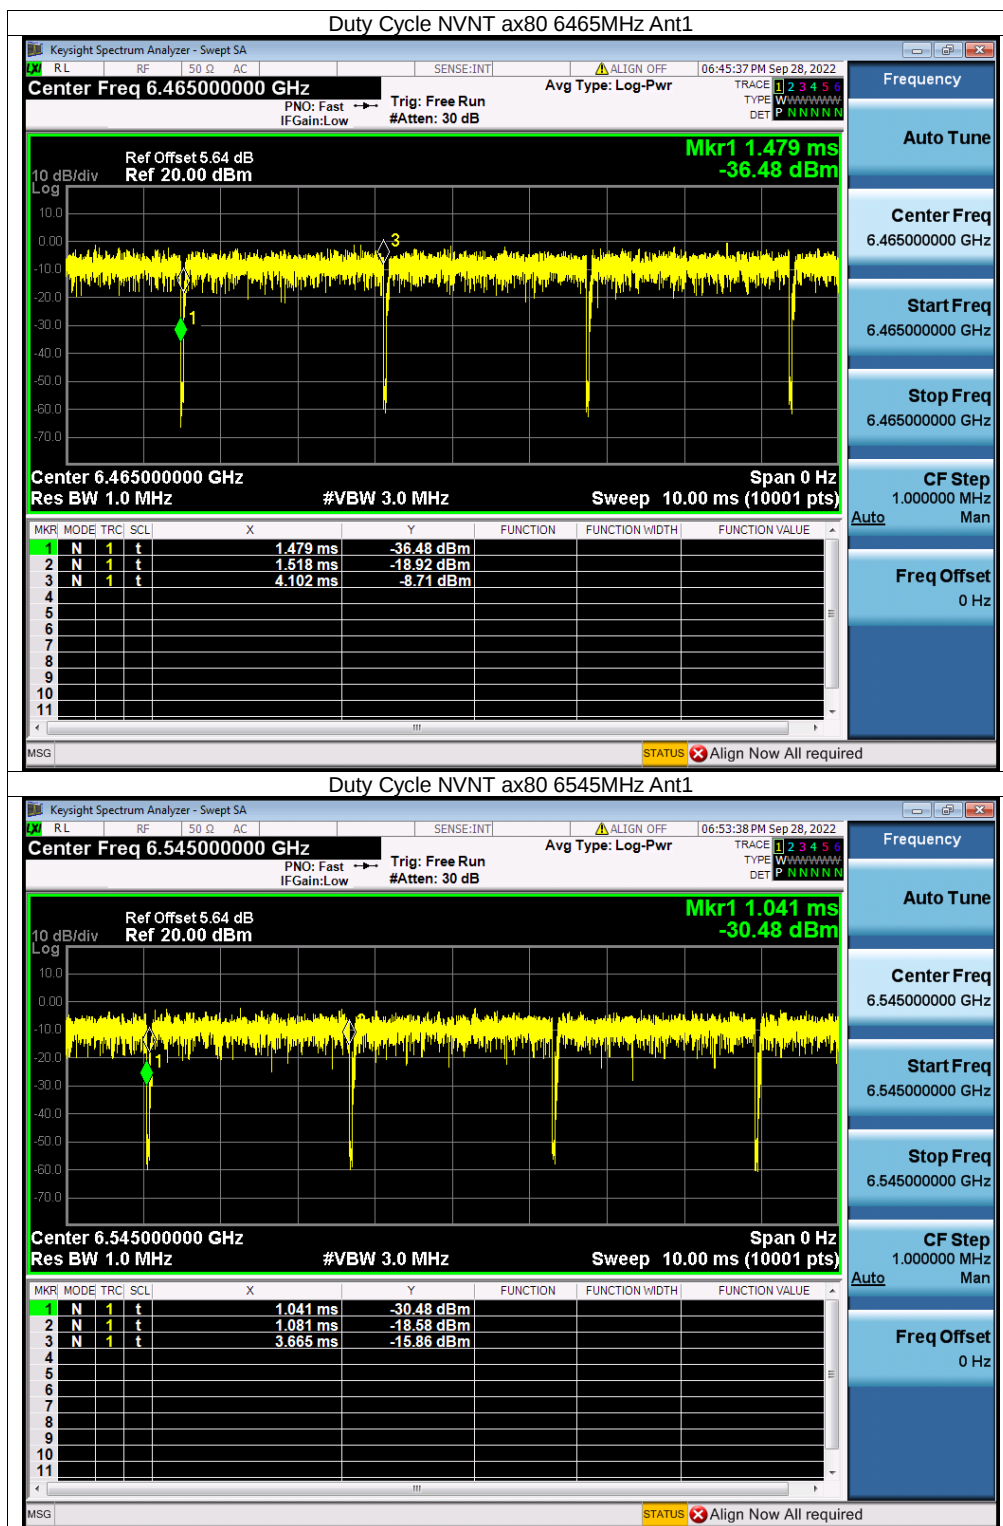


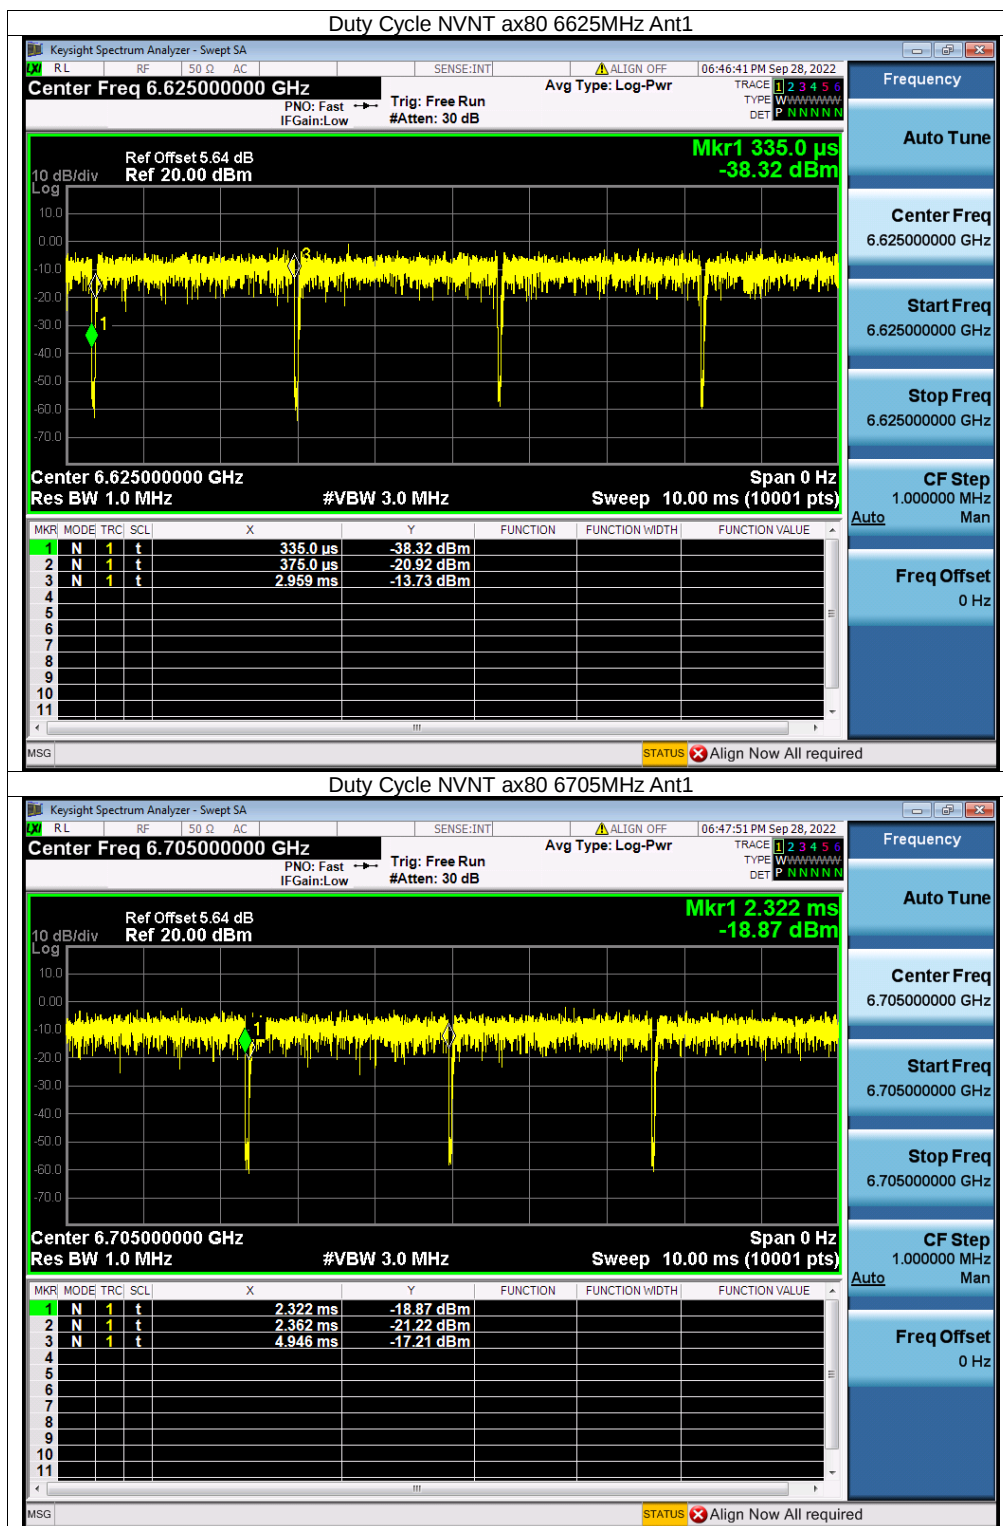


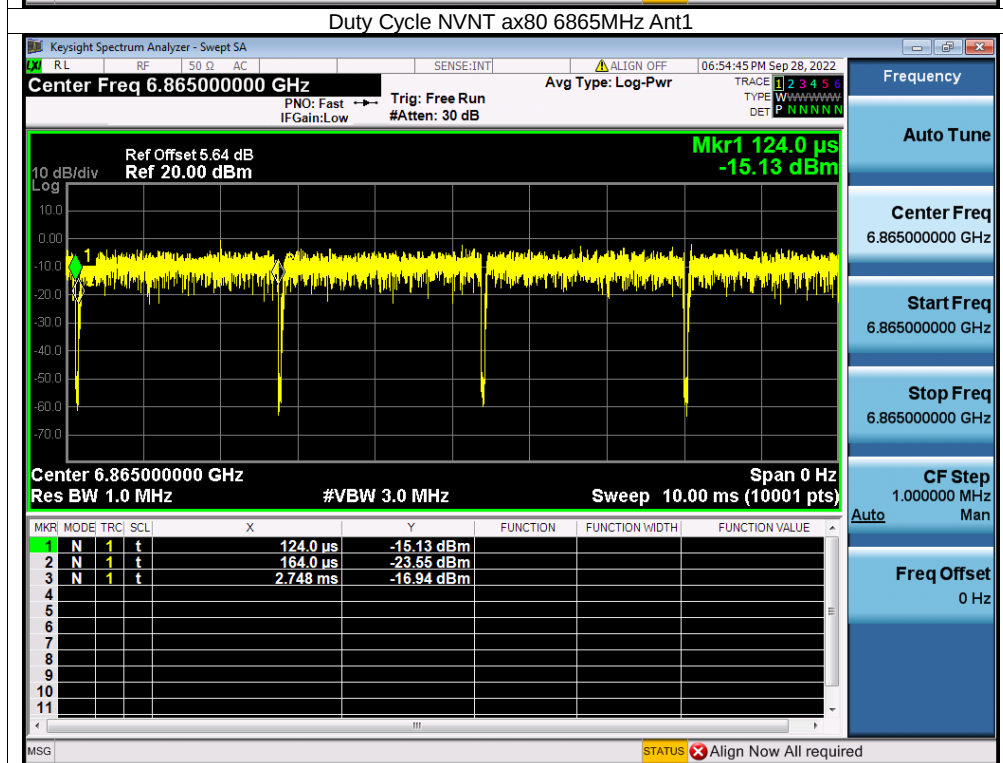
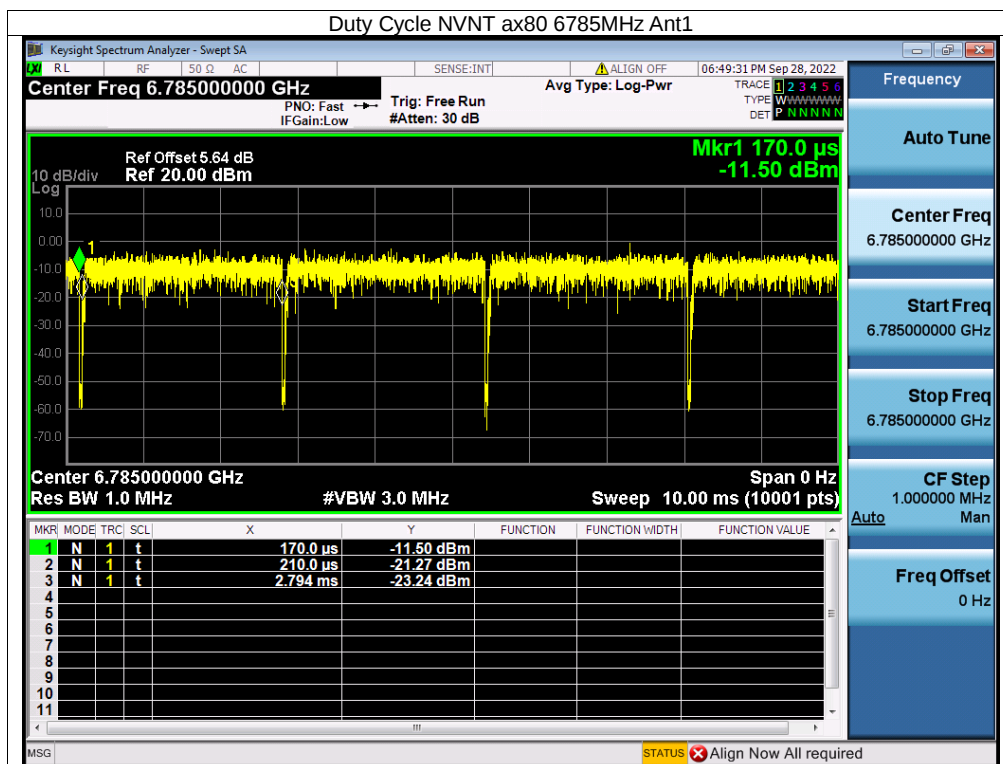


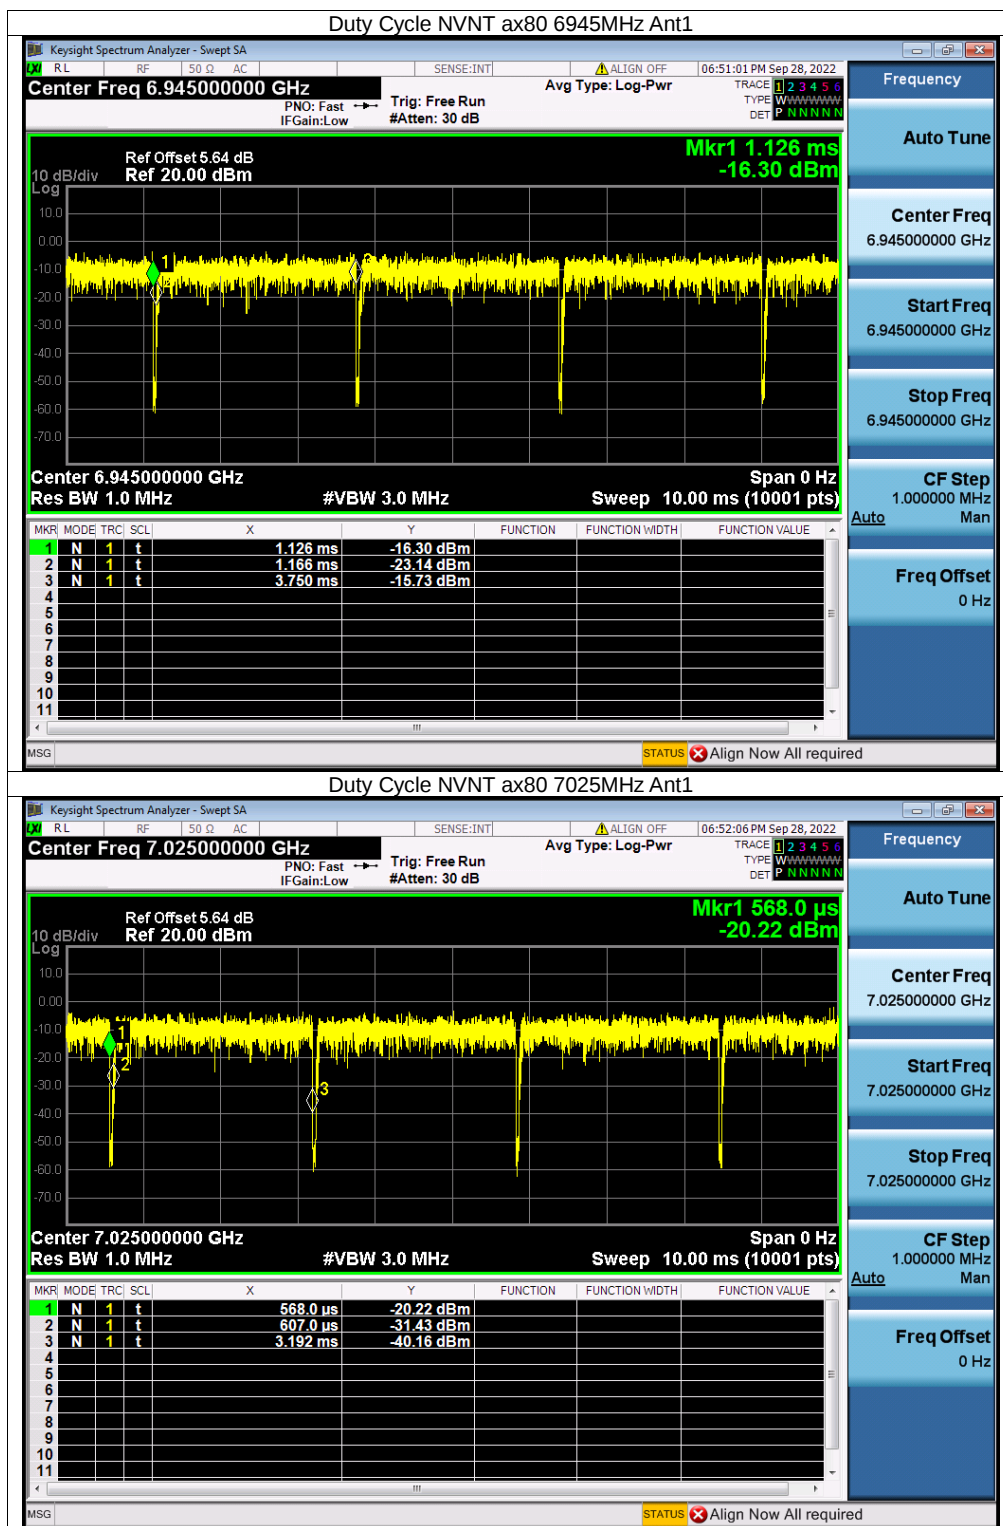



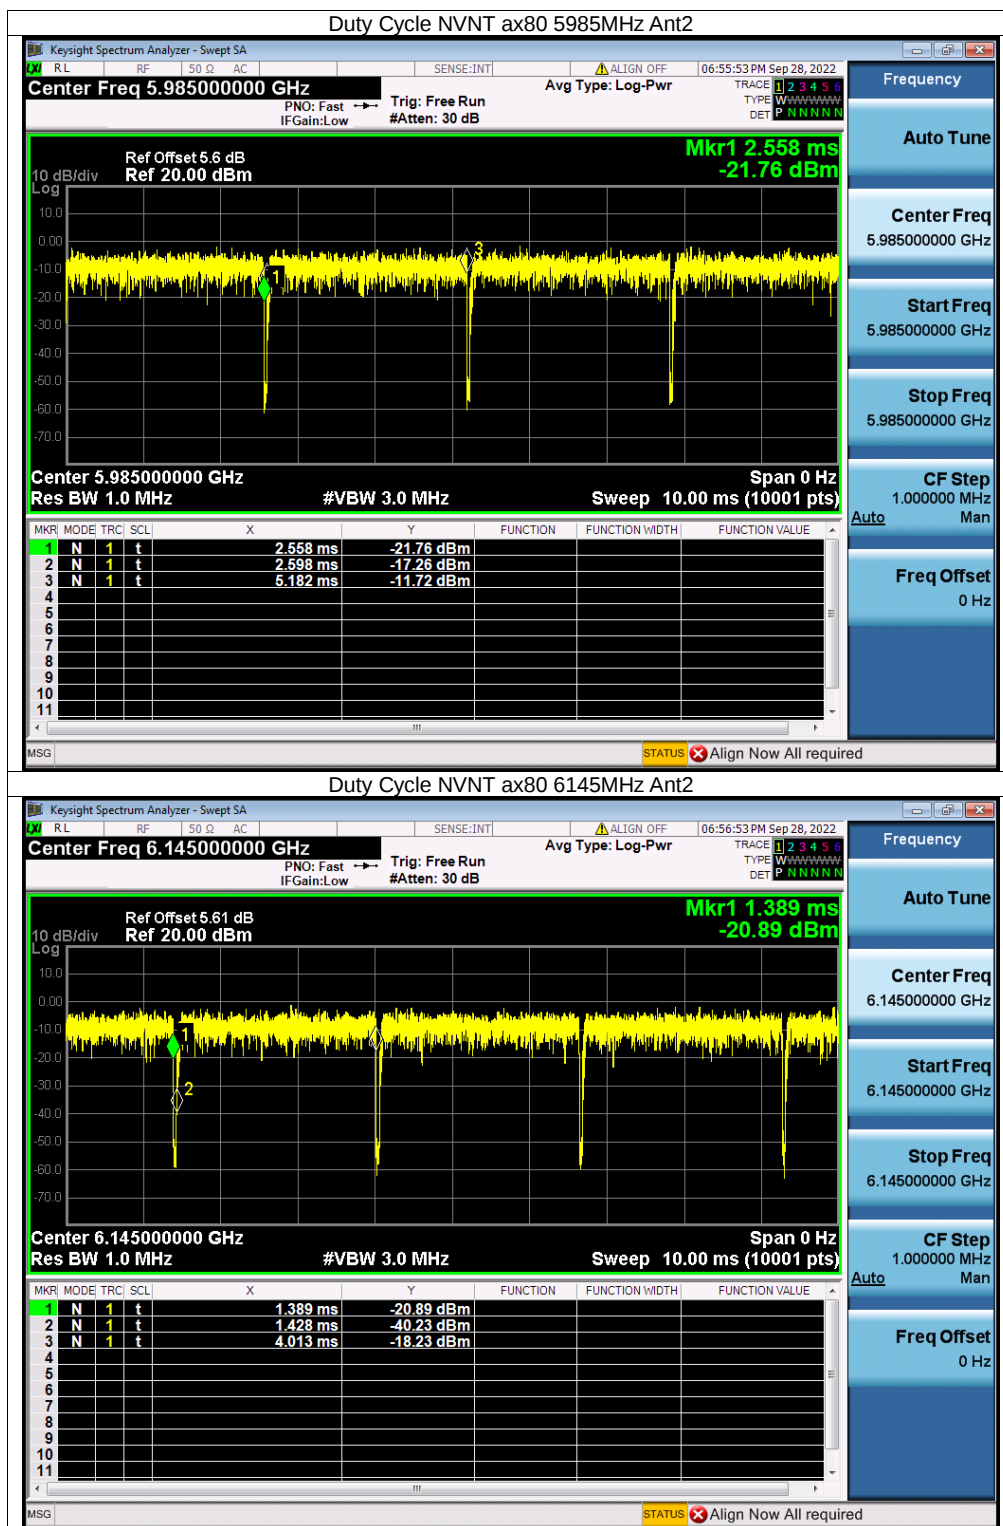



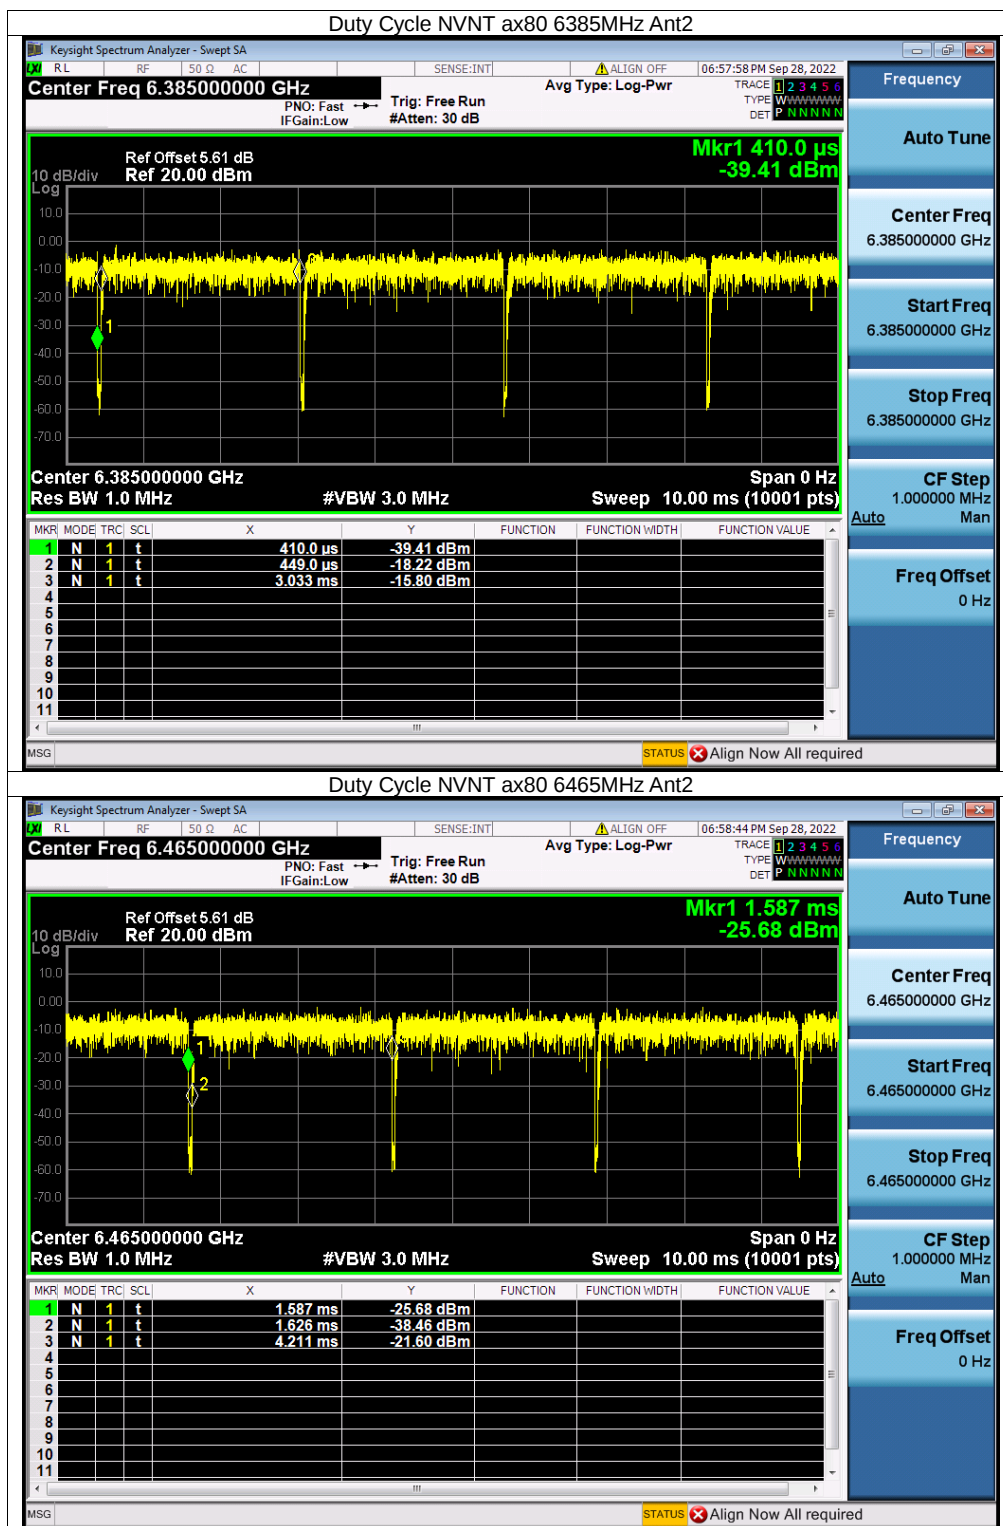



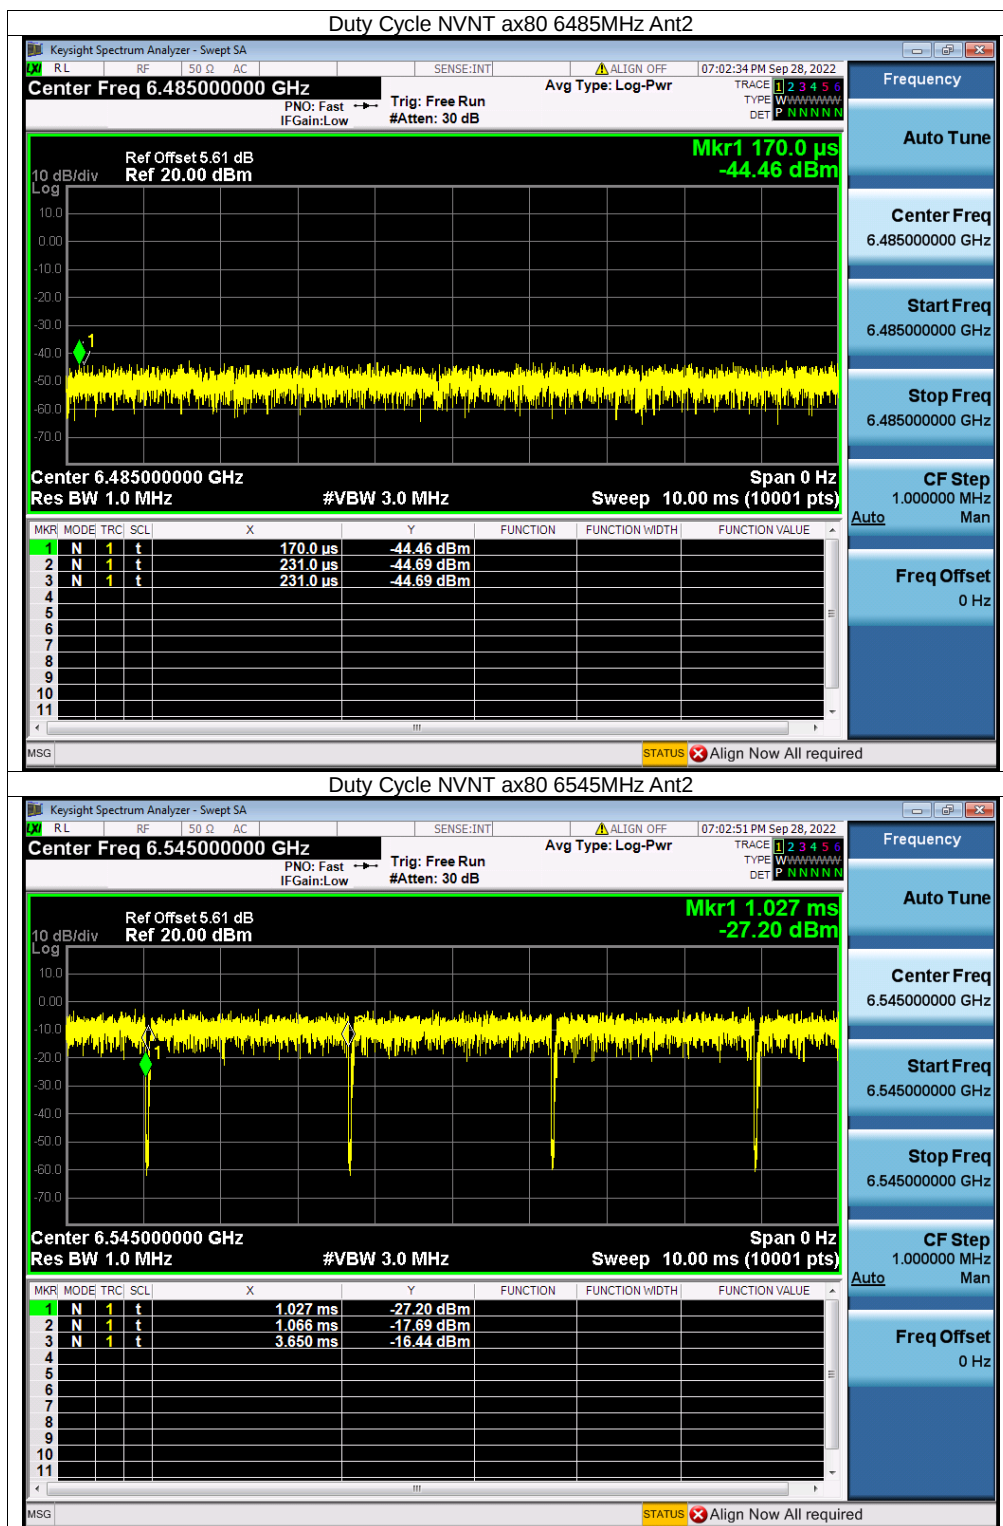


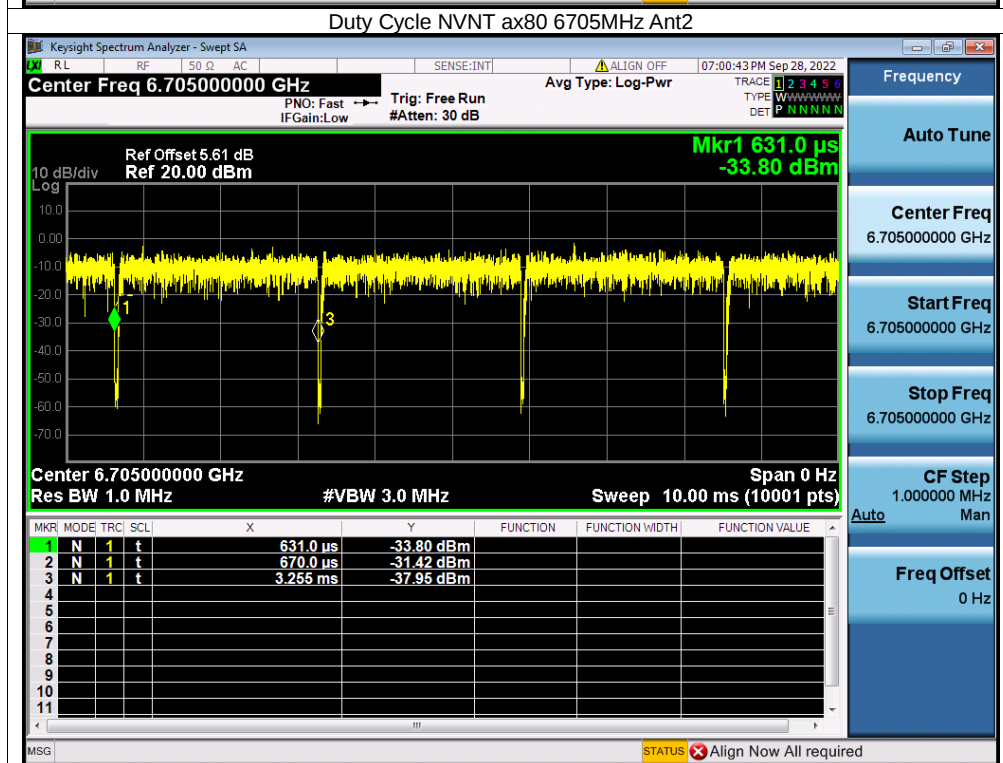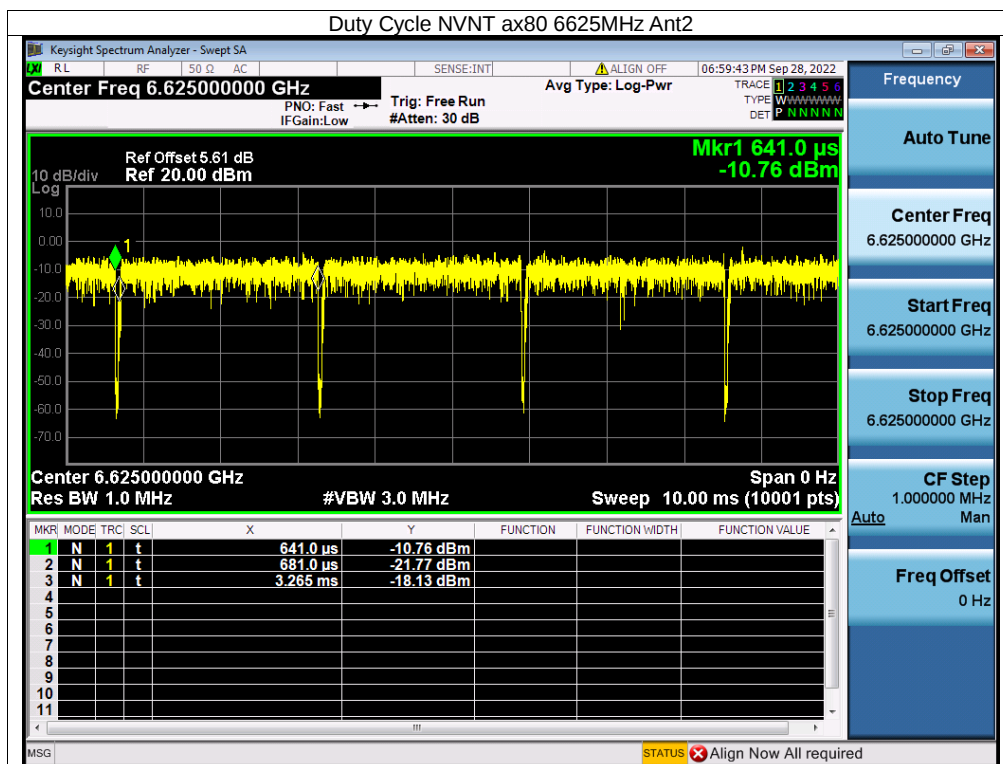


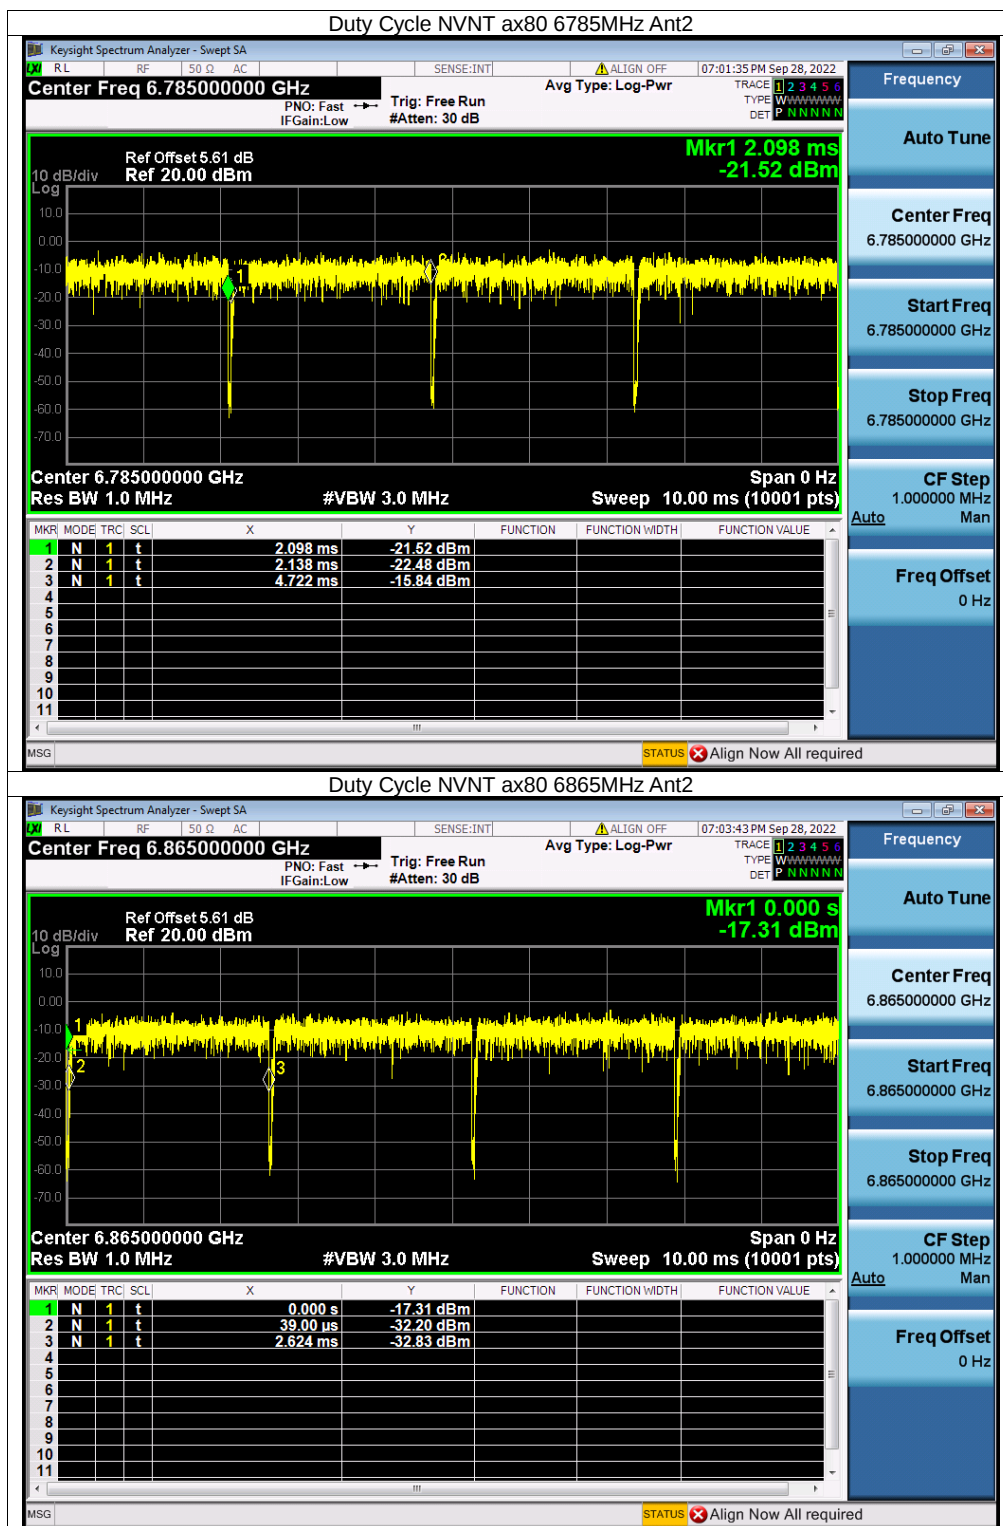


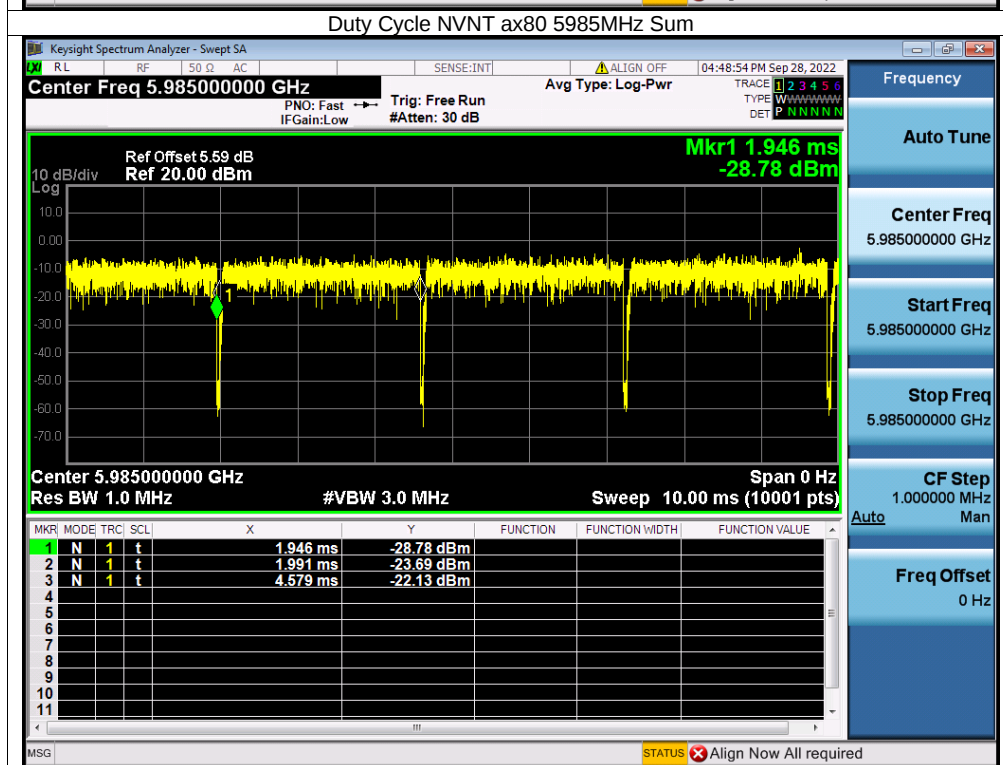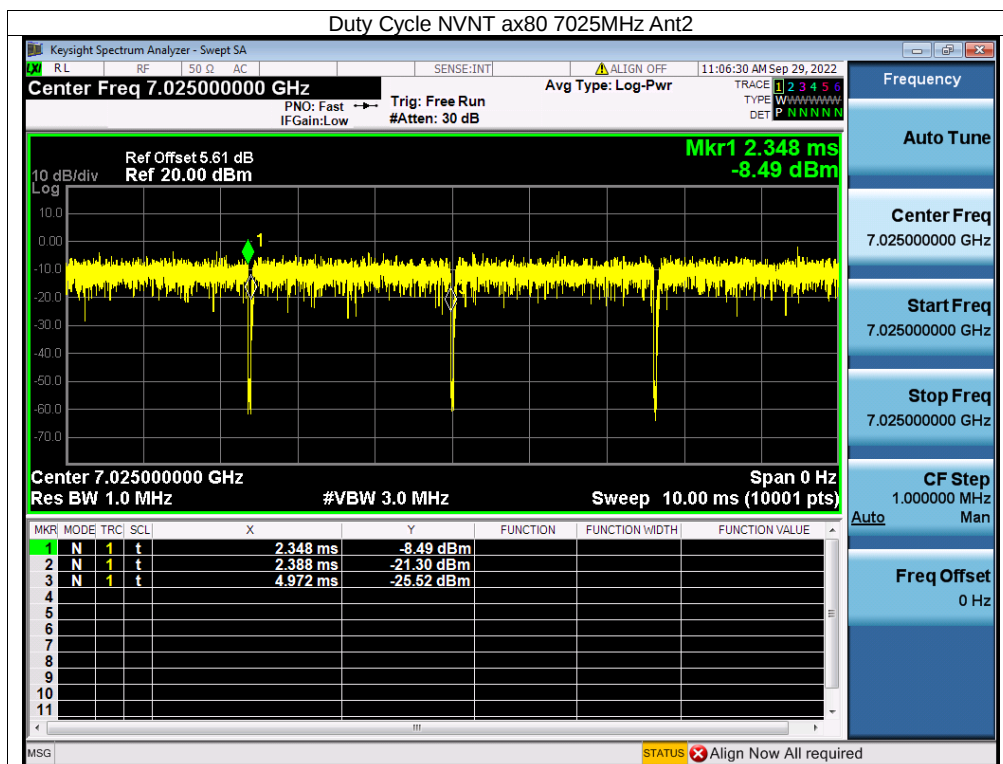


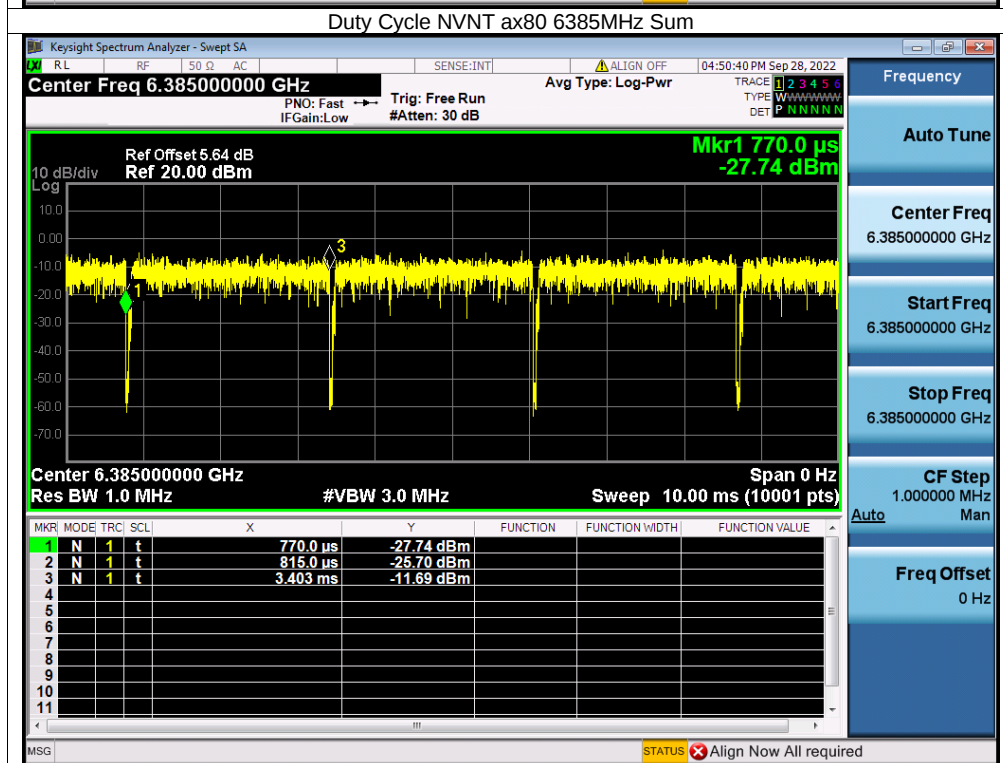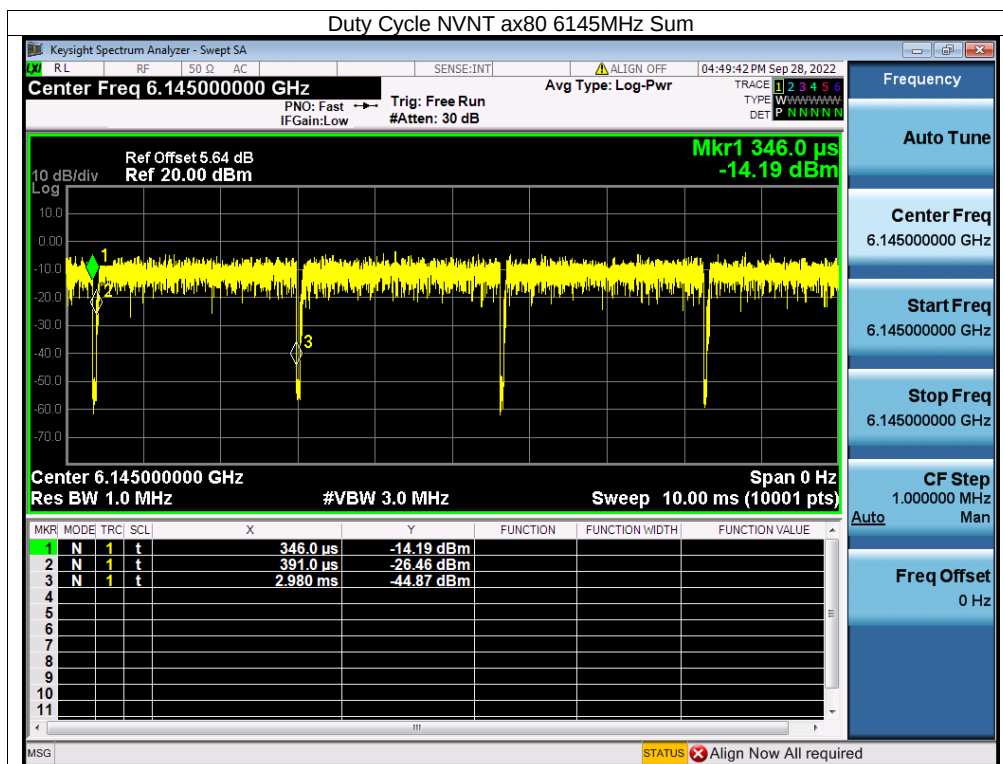

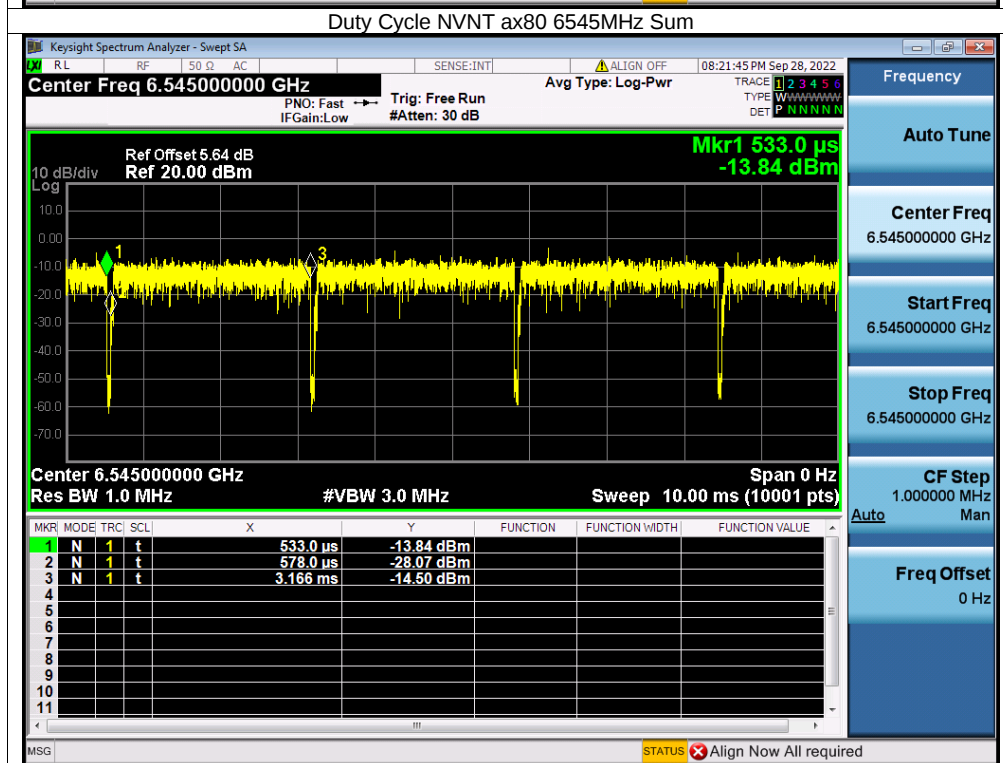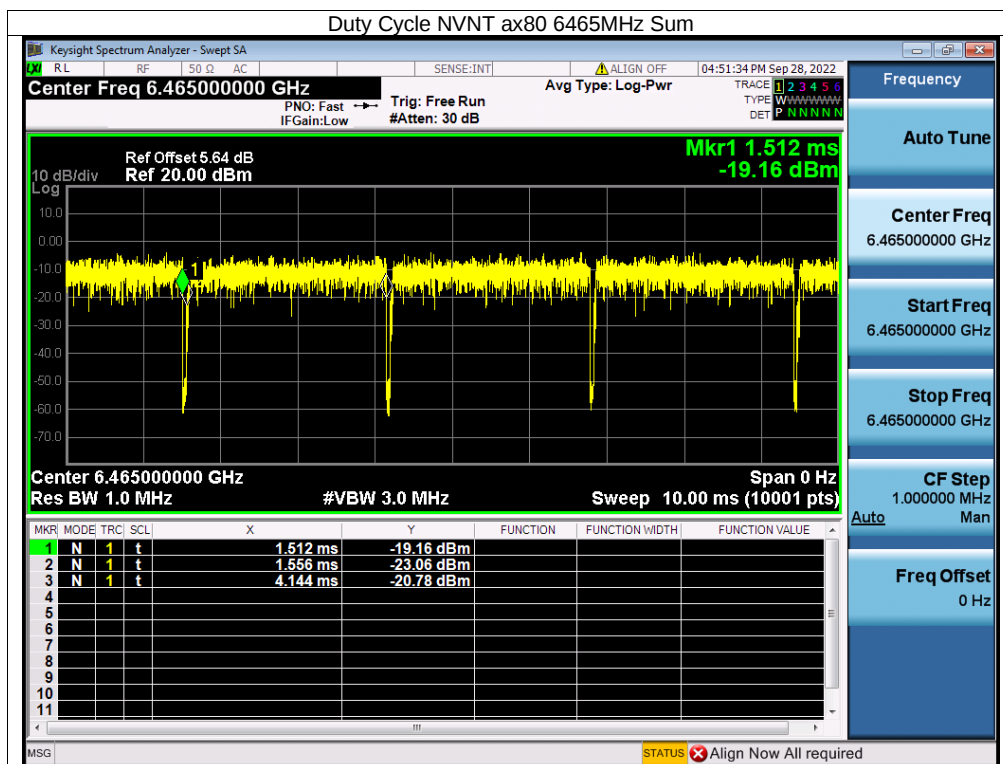

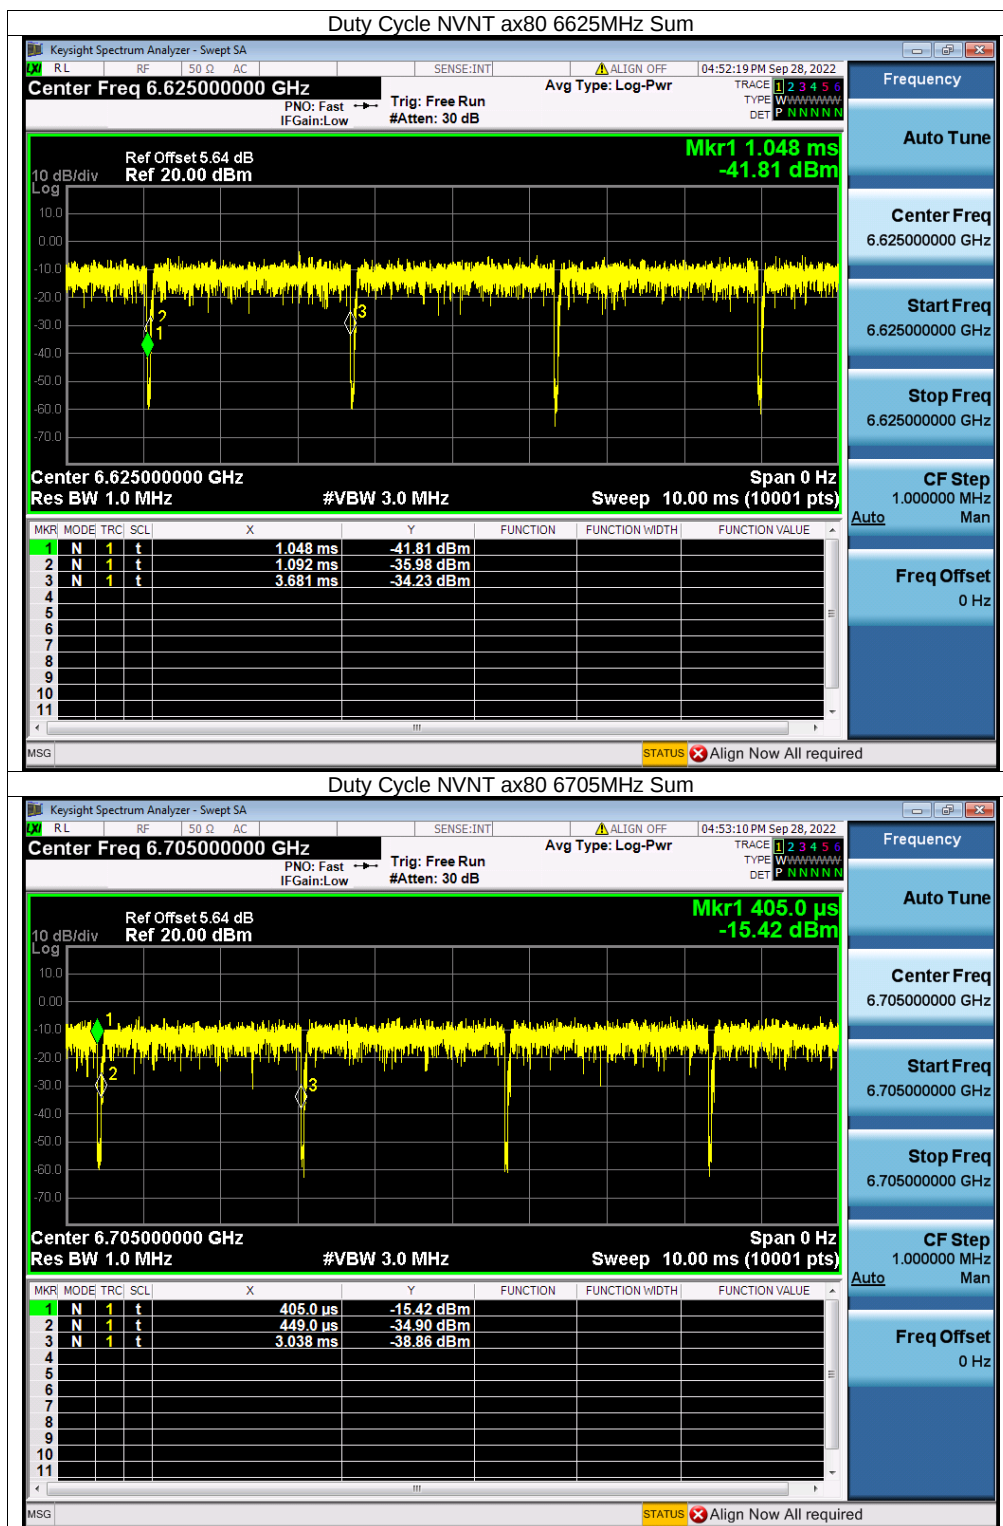

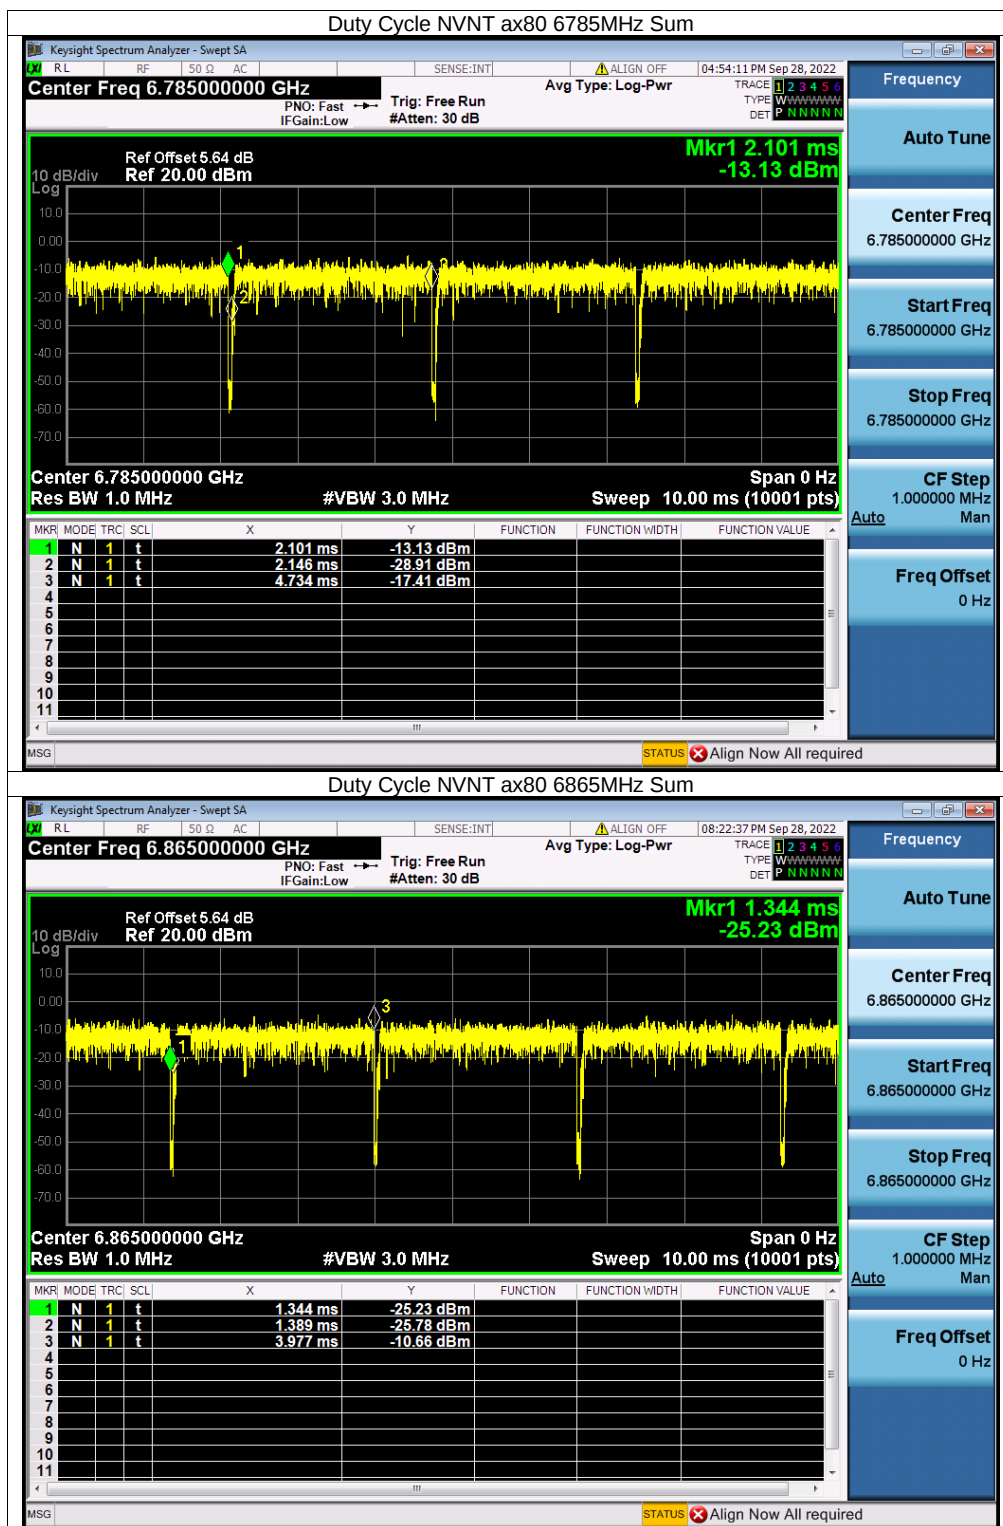

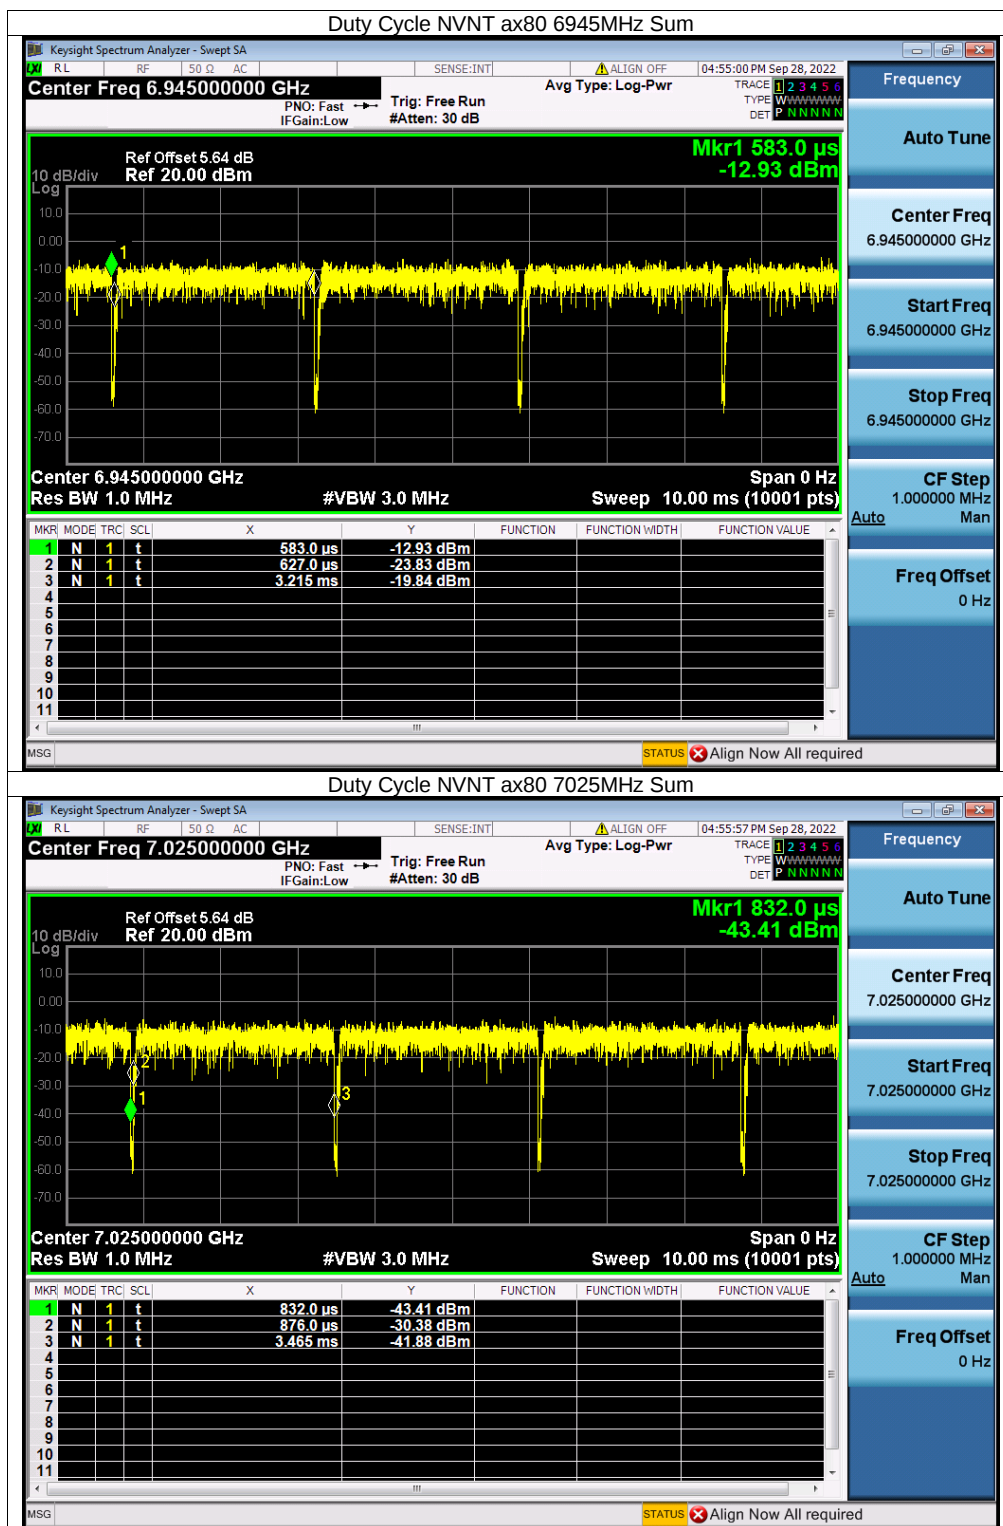



MAXIMUM CONDUCTED OUTPUT POWER

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Gain (dBi)	eirp Power	Limit (dBm)	Verdict
NVNT	ax160	6025	Ant1	11.21	0	11.21	2.22	13.43	24	Pass
NVNT	ax160	6185	Ant1	11.91	0	11.91	2.22	14.13	24	Pass
NVNT	ax160	6345	Ant1	11.49	0	11.49	2.22	13.71	24	Pass
NVNT	ax160	6505	Ant1	11.37	0	11.37	2.22	13.59	24	Pass
NVNT	ax160	6665	Ant1	10.53	0	10.53	2.22	12.75	24	Pass
NVNT	ax160	6825	Ant1	10.51	0	10.51	2.22	12.73	24	Pass
NVNT	ax160	6985	Ant1	10.13	0	10.13	2.22	12.35	24	Pass
NVNT	ax160	6025	Ant2	11.13	0	11.13	2.22	13.35	24	Pass
NVNT	ax160	6185	Ant2	11.5	0	11.5	2.22	13.72	24	Pass
NVNT	ax160	6345	Ant2	10.8	0	10.8	2.22	13.02	24	Pass
NVNT	ax160	6505	Ant2	10.75	0	10.75	2.22	12.97	24	Pass
NVNT	ax160	6665	Ant2	9.93	0	9.93	2.22	12.15	24	Pass
NVNT	ax160	6825	Ant2	10.3	0	10.3	2.22	12.52	24	Pass
NVNT	ax160	6985	Ant2	9.49	0	9.49	2.22	11.71	24	Pass
NVNT	ax160	6025	Ant1	8.4	0	8.4	2.22	10.62	24	Pass
NVNT	ax160	6025	Ant2	7.79	0	7.79	2.22	10.01	24	Pass
NVNT	ax160	6025	Sum					13.34	24	Pass
NVNT	ax160	6185	Ant1	8.95	0	8.95	2.22	11.17	24	Pass
NVNT	ax160	6185	Ant2	8.14	0	8.14	2.22	10.36	24	Pass
NVNT	ax160	6185	Sum					13.79	24	Pass
NVNT	ax160	6345	Ant1	8.61	0	8.61	2.22	10.83	24	Pass
NVNT	ax160	6345	Ant2	7.5	0	7.5	2.22	9.72	24	Pass
NVNT	ax160	6345	Sum					13.32	24	Pass
NVNT	ax160	6665	Ant1	7.73	0	7.73	2.22	9.95	24	Pass
NVNT	ax160	6665	Ant2	6.73	0	6.73	2.22	8.95	24	Pass
NVNT	ax160	6665	Sum					12.49	24	Pass
NVNT	ax160	6985	Ant1	7.25	0	7.25	2.22	9.47	24	Pass
NVNT	ax160	6985	Ant2	6.39	0	6.39	2.22	8.61	24	Pass
NVNT	ax160	6985	Sum					12.07	24	Pass
NVNT	ax20	5955	Ant1	2.13	0	2.13	2.22	4.35	24	Pass
NVNT	ax20	6175	Ant1	2.68	0	2.68	2.22	4.9	24	Pass
NVNT	ax20	6415	Ant1	1.84	0	1.84	2.22	4.06	24	Pass
NVNT	ax20	6435	Ant1	1.76	0	1.76	2.22	3.98	24	Pass
NVNT	ax20	6475	Ant1	2.07	0	2.07	2.22	4.29	24	Pass
NVNT	ax20	6515	Ant1	2.07	0	2.07	2.22	4.29	24	Pass
NVNT	ax20	6535	Ant1	1.32	0	1.32	2.22	3.54	24	Pass
NVNT	ax20	6695	Ant1	1.65	0	1.65	2.22	3.87	24	Pass
NVNT	ax20	6855	Ant1	1.27	0	1.27	2.22	3.49	24	Pass
NVNT	ax20	6895	Ant1	1.11	0	1.11	2.22	3.33	24	Pass
NVNT	ax20	7115	Ant1	-4.9	0.51	-4.39	2.22	-2.17	24	Pass
NVNT	ax20	5955	Ant2	1.63	0	1.63	2.22	3.85	24	Pass
NVNT	ax20	6175	Ant2	1.94	0	1.94	2.22	4.16	24	Pass
NVNT	ax20	6415	Ant2	1.07	0	1.07	2.22	3.29	24	Pass
NVNT	ax20	6435	Ant2	1	0.19	1.19	2.22	3.41	24	Pass
NVNT	ax20	6475	Ant2	1.27	0.1	1.37	2.22	3.59	24	Pass
NVNT	ax20	6515	Ant2	1.1	0	1.1	2.22	3.32	24	Pass
NVNT	ax20	6535	Ant2	0.1	0	0.1	2.22	2.32	24	Pass
NVNT	ax20	6695	Ant2	0.67	0	0.67	2.22	2.89	24	Pass
NVNT	ax20	6855	Ant2	0.6	0	0.6	2.22	2.82	24	Pass
NVNT	ax20	6895	Ant2	0.36	0	0.36	2.22	2.58	24	Pass
NVNT	ax20	7115	Ant2	-5.62	0	-5.62	2.22	-3.4	24	Pass
NVNT	ax20	5955	Ant1	-0.79	0	-0.79	2.22	1.43	24	Pass
NVNT	ax20	5955	Ant2	-1.38	0	-1.38	2.22	0.84	24	Pass
NVNT	ax20	5955	Sum					4.16	24	Pass
NVNT	ax20	6175	Ant1	-0.17	0	-0.17	2.22	2.05	24	Pass
NVNT	ax20	6175	Ant2	-1.14	0	-1.14	2.22	1.08	24	Pass
NVNT	ax20	6175	Sum					4.6	24	Pass
NVNT	ax20	6415	Ant1	-1.08	0	-1.08	2.22	1.14	24	Pass
NVNT	ax20	6415	Ant2	-1.98	0	-1.98	2.22	0.24	24	Pass
NVNT	ax20	6415	Sum					3.72	24	Pass
NVNT	ax20	6435	Ant1	-1.2	0	-1.2	2.22	1.02	24	Pass
NVNT	ax20	6435	Ant2	-1.95	0	-1.95	2.22	0.27	24	Pass
NVNT	ax20	6435	Sum					3.67	24	Pass
NVNT	ax20	6475	Ant1	-0.8	0	-0.8	2.22	1.42	24	Pass
NVNT	ax20	6475	Ant2	-1.83	0	-1.83	2.22	0.39	24	Pass
NVNT	ax20	6475	Sum					3.95	24	Pass
NVNT	ax20	6515	Ant1	-0.94	0	-0.94	2.22	1.28	24	Pass
NVNT	ax20	6515	Ant2	-1.99	0	-1.99	2.22	0.23	24	Pass
NVNT	ax20	6515	Sum					3.8	24	Pass



NVNT	ax20	6535	Ant1	-3.9	0	-3.9	2.22	-1.68	24	Pass
NVNT	ax20	6535	Ant2	-3.72	0	-3.72	2.22	-1.5	24	Pass
NVNT	ax20	6535	Sum					1.42	24	Pass
NVNT	ax20	6715	Ant1	-3.07	0	-3.07	2.22	-0.85	24	Pass
NVNT	ax20	6715	Ant2	-5.09	0	-5.09	2.22	-2.87	24	Pass
NVNT	ax20	6715	Sum					1.27	24	Pass
NVNT	ax20	6855	Ant1	-1.89	0	-1.89	2.22	0.33	24	Pass
NVNT	ax20	6855	Ant2	-4.21	0	-4.21	2.22	-1.99	24	Pass
NVNT	ax20	6855	Sum					2.33	24	Pass
NVNT	ax20	6875	Ant1	-2.41	0	-2.41	2.22	-0.19	24	Pass
NVNT	ax20	6875	Ant2	-4.7	0	-4.7	2.22	-2.48	24	Pass
NVNT	ax20	6875	Sum					1.82	24	Pass
NVNT	ax20	6895	Ant1	-2.42	0	-2.42	2.22	-0.2	24	Pass
NVNT	ax20	6895	Ant2	-4.66	0	-4.66	2.22	-2.44	24	Pass
NVNT	ax20	6895	Sum					1.83	24	Pass
NVNT	ax20	7015	Ant1	-3.27	0	-3.27	2.22	-1.05	24	Pass
NVNT	ax20	7015	Ant2	-5.32	0	-5.32	2.22	-3.1	24	Pass
NVNT	ax20	7015	Sum					1.06	24	Pass
NVNT	ax20	7095	Ant1	-2.83	0	-2.83	2.22	-0.61	24	Pass
NVNT	ax20	7095	Ant2	-4.13	0	-4.13	2.22	-1.91	24	Pass
NVNT	ax20	7095	Sum					1.8	24	Pass
NVNT	ax20	7115	Ant1	-8.25	0	-8.25	2.22	-6.03	24	Pass
NVNT	ax20	7115	Ant2	-8.85	0	-8.85	2.22	-6.63	24	Pass
NVNT	ax20	7115	Sum					-3.31	24	Pass
NVNT	ax40	5965	Ant1	5.56	0	5.56	2.22	7.78	24	Pass
NVNT	ax40	6165	Ant1	6.24	0	6.24	2.22	8.46	24	Pass
NVNT	ax40	6405	Ant1	5.5	0	5.5	2.22	7.72	24	Pass
NVNT	ax40	6445	Ant1	5.55	0	5.55	2.22	7.77	24	Pass
NVNT	ax40	6485	Ant1	5.75	0	5.75	2.22	7.97	24	Pass
NVNT	ax40	6525	Ant1	5.69	0	5.69	2.22	7.91	24	Pass
NVNT	ax40	6565	Ant1	4.89	0	4.89	2.22	7.11	24	Pass
NVNT	ax40	6685	Ant1	5.07	0	5.07	2.22	7.29	24	Pass
NVNT	ax40	6845	Ant1	4.84	0	4.84	2.22	7.06	24	Pass
NVNT	ax40	6885	Ant1	4.77	0	4.77	2.22	6.99	24	Pass
NVNT	ax40	6925	Ant1	4.36	0	4.36	2.22	6.58	24	Pass
NVNT	ax40	7085	Ant1	4.6	0	4.6	2.22	6.82	24	Pass
NVNT	ax40	5965	Ant2	5.43	0	5.43	2.22	7.65	24	Pass
NVNT	ax40	6165	Ant2	5.65	0	5.65	2.22	7.87	24	Pass
NVNT	ax40	6405	Ant2	4.83	0	4.83	2.22	7.05	24	Pass
NVNT	ax40	6445	Ant2	4.88	0	4.88	2.22	7.1	24	Pass
NVNT	ax40	6485	Ant2	4.95	0	4.95	2.22	7.17	24	Pass
NVNT	ax40	6525	Ant2	4.77	0	4.77	2.22	6.99	24	Pass
NVNT	ax40	6565	Ant2	3.98	0	3.98	2.22	6.2	24	Pass
NVNT	ax40	6685	Ant2	4.25	0	4.25	2.22	6.47	24	Pass
NVNT	ax40	6845	Ant2	4.39	0	4.39	2.22	6.61	24	Pass
NVNT	ax40	6885	Ant2	4.14	0	4.14	2.22	6.36	24	Pass
NVNT	ax40	6925	Ant2	3.68	0	3.68	2.22	5.9	24	Pass
NVNT	ax40	7085	Ant2	3.83	0	3.83	2.22	6.05	24	Pass
NVNT	ax40	5965	Ant1	3	0	3	2.22	5.22	24	Pass
NVNT	ax40	5965	Ant2	2.33	0	2.33	2.22	4.55	24	Pass
NVNT	ax40	5965	Sum					7.91	24	Pass
NVNT	ax40	6165	Ant1	3.51	0	3.51	2.22	5.73	24	Pass
NVNT	ax40	6165	Ant2	2.54	0	2.54	2.22	4.76	24	Pass
NVNT	ax40	6165	Sum					8.28	24	Pass
NVNT	ax40	6405	Ant1	2.89	0	2.89	2.22	5.11	24	Pass
NVNT	ax40	6405	Ant2	1.74	0	1.74	2.22	3.96	24	Pass
NVNT	ax40	6405	Sum					7.58	24	Pass
NVNT	ax40	6485	Ant1	2.91	0	2.91	2.22	5.13	24	Pass
NVNT	ax40	6485	Ant2	1.86	0	1.86	2.22	4.08	24	Pass
NVNT	ax40	6485	Sum					7.65	24	Pass
NVNT	ax40	6565	Ant1	2.12	0	2.12	2.22	4.34	24	Pass
NVNT	ax40	6565	Ant2	0.96	0	0.96	2.22	3.18	24	Pass
NVNT	ax40	6565	Sum					6.81	24	Pass
NVNT	ax40	6725	Ant1	2.27	0	2.27	2.22	4.49	24	Pass
NVNT	ax40	6725	Ant2	1.22	0	1.22	2.22	3.44	24	Pass
NVNT	ax40	6725	Sum					7.01	24	Pass
NVNT	ax40	6885	Ant1	1.65	0	1.65	2.22	3.87	24	Pass
NVNT	ax40	6885	Ant2	0.9	0	0.9	2.22	3.12	24	Pass
NVNT	ax40	6885	Sum					6.52	24	Pass
NVNT	ax40	6925	Ant1	1.76	0	1.76	2.22	3.98	24	Pass
NVNT	ax40	6925	Ant2	0.69	0	0.69	2.22	2.91	24	Pass



NVNT	ax40	6925	Sum					6.49	24	Pass
NVNT	ax40	7005	Ant1	1.76	0	1.76	2.22	3.98	24	Pass
NVNT	ax40	7005	Ant2	0.61	0	0.61	2.22	2.83	24	Pass
NVNT	ax40	7005	Sum					6.45	24	Pass
NVNT	ax40	7085	Ant1	1.77	0	1.77	2.22	3.99	24	Pass
NVNT	ax40	7085	Ant2	0.7	0	0.7	2.22	2.92	24	Pass
NVNT	ax40	7085	Sum					6.5	24	Pass
NVNT	ax80	5985	Ant1	8.22	0	8.22	2.22	10.44	24	Pass
NVNT	ax80	6145	Ant1	8.67	0	8.67	2.22	10.89	24	Pass
NVNT	ax80	6385	Ant1	8.36	0	8.36	2.22	10.58	24	Pass
NVNT	ax80	6465	Ant1	8.19	0	8.19	2.22	10.41	24	Pass
NVNT	ax80	6545	Ant1	8.29	0	8.29	2.22	10.51	24	Pass
NVNT	ax80	6625	Ant1	7.43	0	7.43	2.22	9.65	24	Pass
NVNT	ax80	6705	Ant1	7.64	0	7.64	2.22	9.86	24	Pass
NVNT	ax80	6785	Ant1	7.44	0	7.44	2.22	9.66	24	Pass
NVNT	ax80	6865	Ant1	7.49	0	7.49	2.22	9.71	24	Pass
NVNT	ax80	6945	Ant1	7.18	0	7.18	2.22	9.4	24	Pass
NVNT	ax80	7025	Ant1	7.19	0	7.19	2.22	9.41	24	Pass
NVNT	ax80	5985	Ant2	6.54	0	6.54	2.22	8.76	24	Pass
NVNT	ax80	6145	Ant2	8.26	0	8.26	2.22	10.48	24	Pass
NVNT	ax80	6385	Ant2	7.77	0	7.77	2.22	9.99	24	Pass
NVNT	ax80	6465	Ant2	7.79	0	7.79	2.22	10.01	24	Pass
NVNT	ax80	6545	Ant2	7.46	0	7.46	2.22	9.68	24	Pass
NVNT	ax80	6625	Ant2	4.87	0	4.87	2.22	7.09	24	Pass
NVNT	ax80	6705	Ant2	6.83	0	6.83	2.22	9.05	24	Pass
NVNT	ax80	6785	Ant2	5.26	0	5.26	2.22	7.48	24	Pass
NVNT	ax80	6865	Ant2	7.06	0	7.06	2.22	9.28	24	Pass
NVNT	ax80	7025	Ant2	6.13	0	6.13	2.22	8.35	24	Pass
NVNT	ax80	5985	Ant1	5.89	0	5.89	2.22	8.11	24	Pass
NVNT	ax80	5985	Ant2	5.02	0	5.02	2.22	7.24	24	Pass
NVNT	ax80	5985	Sum					10.71	24	Pass
NVNT	ax80	6145	Ant1	6.18	0	6.18	2.22	8.4	24	Pass
NVNT	ax80	6145	Ant2	5.25	0	5.25	2.22	7.47	24	Pass
NVNT	ax80	6145	Sum					10.97	24	Pass
NVNT	ax80	6385	Ant1	5.88	0	5.88	2.22	8.1	24	Pass
NVNT	ax80	6385	Ant2	4.79	0	4.79	2.22	7.01	24	Pass
NVNT	ax80	6385	Sum					10.6	24	Pass
NVNT	ax80	6465	Ant1	5.72	0	5.72	2.22	7.94	24	Pass
NVNT	ax80	6465	Ant2	4.82	0	4.82	2.22	7.04	24	Pass
NVNT	ax80	6465	Sum					10.52	24	Pass
NVNT	ax80	6545	Ant1	5.32	0	5.32	2.22	7.54	24	Pass
NVNT	ax80	6545	Ant2	4.37	0	4.37	2.22	6.59	24	Pass
NVNT	ax80	6545	Sum					10.1	24	Pass
NVNT	ax80	6625	Ant1	4.88	0	4.88	2.22	7.1	24	Pass
NVNT	ax80	6625	Ant2	3.57	0	3.57	2.22	5.79	24	Pass
NVNT	ax80	6625	Sum					9.5	24	Pass
NVNT	ax80	6705	Ant1	5.04	0	5.04	2.22	7.26	24	Pass
NVNT	ax80	6705	Ant2	3.92	0	3.92	2.22	6.14	24	Pass
NVNT	ax80	6705	Sum					9.75	24	Pass
NVNT	ax80	6785	Ant1	4.92	0	4.92	2.22	7.14	24	Pass
NVNT	ax80	6785	Ant2	3.94	0	3.94	2.22	6.16	24	Pass
NVNT	ax80	6785	Sum					9.69	24	Pass
NVNT	ax80	6865	Ant1	4.58	0	4.58	2.22	6.8	24	Pass
NVNT	ax80	6865	Ant2	4.03	0	4.03	2.22	6.25	24	Pass
NVNT	ax80	6865	Sum					9.54	24	Pass
NVNT	ax80	6945	Ant1	4.67	0	4.67	2.22	6.89	24	Pass
NVNT	ax80	6945	Ant2	3.53	0	3.53	2.22	5.75	24	Pass
NVNT	ax80	6945	Sum					9.37	24	Pass
NVNT	ax80	7025	Ant1	4.66	0	4.66	2.22	6.88	24	Pass
NVNT	ax80	7025	Ant2	3.52	0	3.52	2.22	5.74	24	Pass
NVNT	ax80	7025	Sum					9.36	24	Pass



