


10.5. TEST RESULT OF LINE CONDUCTED EMISSION TEST

LINE CONDUCTED EMISSION TEST-L

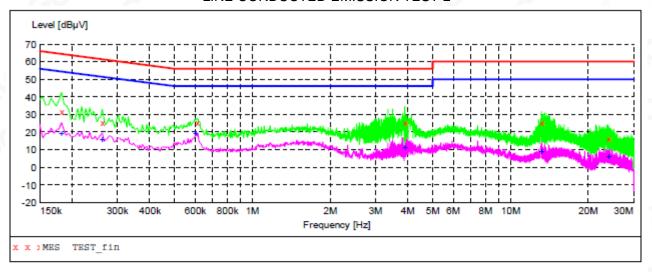

MEASUREMENT RESULT: "TEST fin"

6/12/2019 10:22AM									
	Frequency	Level	Transd	Limit	Margin	Detector	Line	PE	
	MHz	dΒμV	dB	dΒμV	dB				
	0.182000	31.50	10.9	64	32.9	QP	L1	FLO	
	0.262000	25.60	10.9	61	35.8	QP	L1	FLO	
	0.610000	25.40	10.7	56	30.6	QP	L1	FLO	
	3.898000	25.70	11.6	56	30.3	QP	L1	FLO	
	13.198000	25.40	12.1	60	34.6	QP	L1	FLO	
	23.938000	16.20	12.6	60	43.8	QP	L1	FLO	

MEASUREMENT RESULT: "TEST fin2"

6/	12/2019 10: Frequency MHz	22 AM Level dBμV	Transd dB	Limit dBµV	Margin dB	Detector	Line	PE
	0.182000	19.50	10.9	54	34.9	AV	L1	FLO
	0.262000	15.90	10.9	51	35.5	AV	L1	FLO
	0.602000	19.40	10.7	46	26.6	AV	L1	FLO
	3.898000	11.40	11.6	46	34.6	AV	L1	FLO
	13.198000	8.90	12.1	50	41.1	AV	L1	FLO
	23.942000	6.10	12.6	50	43.9	AV	L1	FLO




Attestation of Global Compliance(Shenzhen)Co.,Ltd.

Add: 2/F., Building 2, No.1-4, Chaxi Sanwei Technial Industrial Park, Gushu,



LINE CONDUCTED EMISSION TEST-N

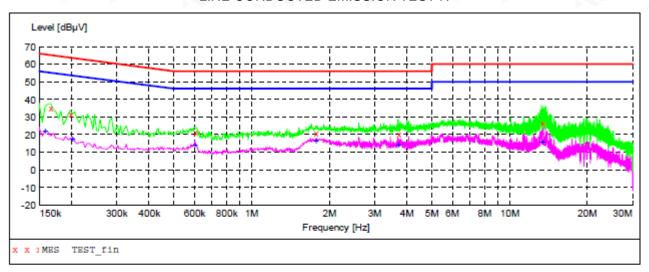

MEASUREMENT RESULT: "TEST_fin"

6/12/2019 11:10AM									
Frequency	Level	Transd	Limit	Margin	Detector	Line	PE		
MHz	dBuV	dB	dBuV	dB					
0.166000	35.30	10.8	65	29.9	QP	N	FLO		
0.198000	31.90	10.9	64	31.8	QP	N	FLO		
0.602000	21.60	10.7	56	34.4	OP	N	FLO		
1.774000	21.30	11.5	56	34.7	QP	N	FLO		
3.698000	20.60	11.6	56	35.4	QP	N	FLO		
13.398000	26.70	12.1	60	33.3	QP	N	FLO		

MEASUREMENT RESULT: "TEST_fin2"

6/12/2019 1 Frequency MHz		Transd dB	Limit dBµV	Margin dB	Detector	Line	PE
0.158000 0.202000 0.602000 1.774000 3.698000 13.398000	17.40 14.00 16.40 14.40	10.8 10.9 10.7 11.5 11.6 12.1	56 54 46 46 46 50	33.6 36.1 32.0 29.6 31.6 33.9	AV AV AV AV AV	N N N N N	FLO FLO FLO FLO FLO


RESULT: PASS

Note: The mode 1 is the worst case, and only the data of the worst case recorded in this test report.



Attestation of Global Compliance(Shenzhen)Co.,Ltd.


Add: 2/F., Building 2, No.1-4, Chaxi Sanwei Technial Industrial Park, Gushu,






APPENDIX A: PHOTOGRAPHS OF TEST SETUP

FCC LINE CONDUCTED EMISSION TEST SETUP

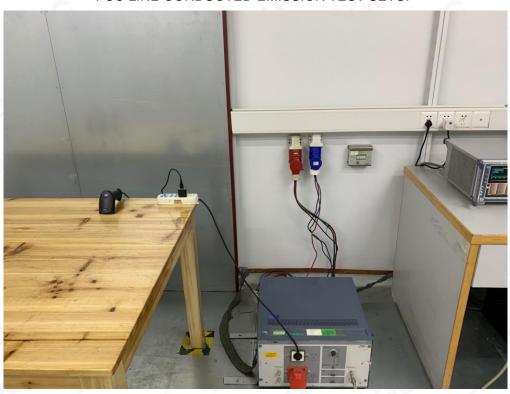

FCC RADIATED EMISSION TEST SETUP BELOW 1GHZ

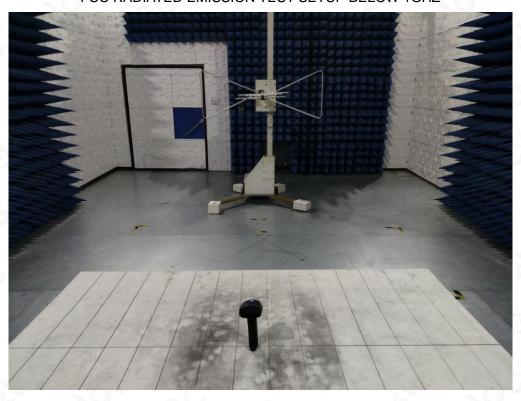



 $Attestation\ of\ Global\ Compliance (Shenzhen) Co., Ltd.$

Add: 2/F., Building 2, No.1-4, Chaxi Sanwei Technial Industrial Park, Gushu,



FCC RADIATED EMISSION TEST SETUP ABOVE 1GHZ





 $Attestation\ of\ Global\ Compliance (Shenzhen) Co., Ltd.$





APPENDIX B: PHOTOGRAPH OF EUT

ALL VIEW OF EUT



TOP VIEW OF EUT





 $Attestation\ of\ Global\ Compliance (Shenzhen) Co., Ltd.$

Add: 2/F., Building 2, No.1-4, Chaxi Sanwei Technial Industrial Park, Gushu,



BOTTOM VIEW OF EUT



FRONT VIEW OF EUT





 $Attestation\ of\ Global\ Compliance (Shenzhen) Co., Ltd.$

Add: 2/F., Building 2, No.1-4, Chaxi Sanwei Technial Industrial Park, Gushu,



BACK VIEW OF EUT



LEFT VIEW OF EUT





 $Attestation\ of\ Global\ Compliance (Shenzhen) Co., Ltd.$

Add: 2/F., Building 2, No.1-4, Chaxi Sanwei Technial Industrial Park, Gushu,



RIGHT VIEW OF EUT



OPEN VIEW-1 OF EUT






 $Attestation\ of\ Global\ Compliance (Shenzhen) Co., Ltd.$



OPEN VIEW-2 OF EUT



VIEW OF BATTERY

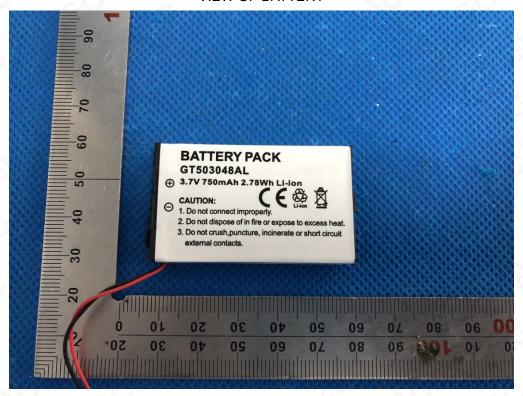





 $Attestation\ of\ Global\ Compliance (Shenzhen) Co., Ltd.$

Add: 2/F., Building 2, No.1-4, Chaxi Sanwei Technial Industrial Park, Gushu,



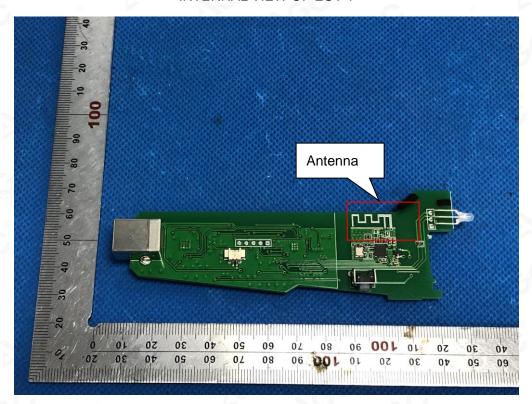

INTERNAL VIEW OF EUT-2

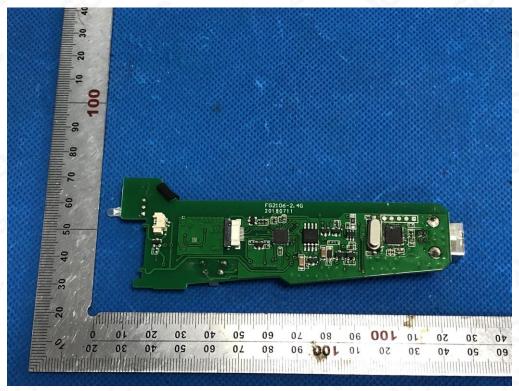




Attestation of Global Compliance(Shenzhen)Co.,Ltd.


Add: 2/F., Building 2, No.1-4, Chaxi Sanwei Technial Industrial Park, Gushu,

Xixiang, Bao'an District, Shenzhen, Guangdong, China Tel: +86-755 2523 4088 E-mail:agc@agc-cert.com



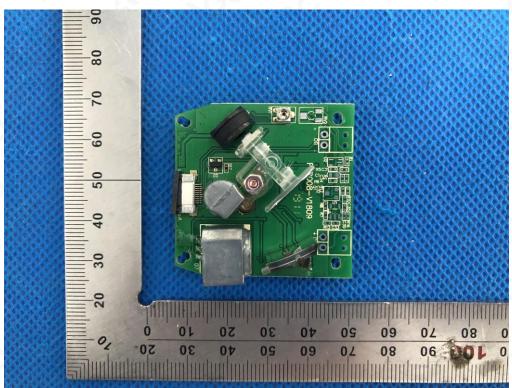


INTERNAL VIEW OF EUT-4

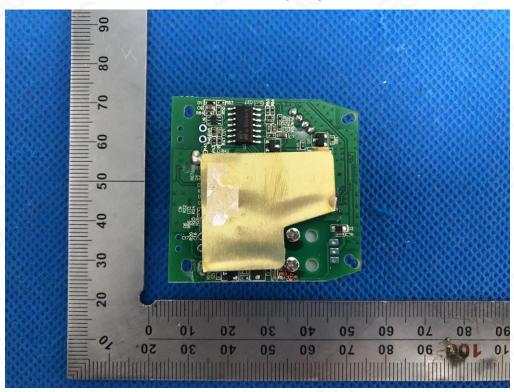




 $Attestation\ of\ Global\ Compliance (Shenzhen) Co., Ltd.$


Add: 2/F., Building 2, No.1-4, Chaxi Sanwei Technial Industrial Park, Gushu,





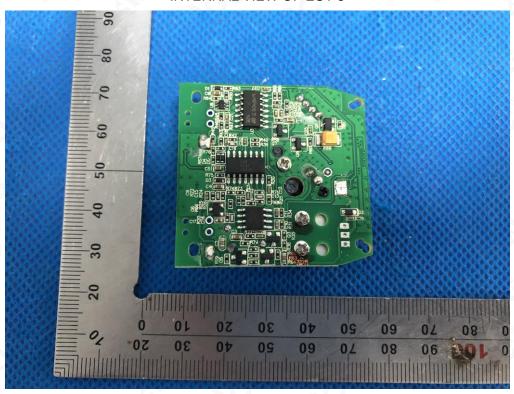

INTERNAL VIEW OF EUT-6

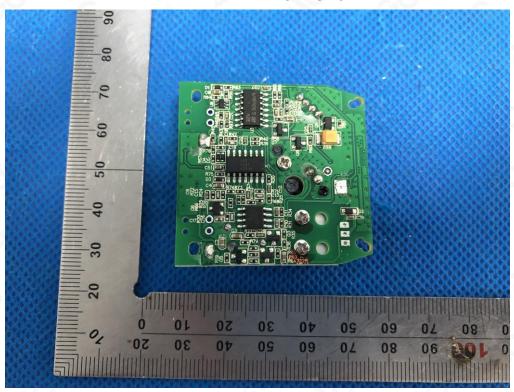





 $Attestation\ of\ Global\ Compliance (Shenzhen) Co., Ltd.$

Add: 2/F., Building 2, No.1-4, Chaxi Sanwei Technial Industrial Park, Gushu,



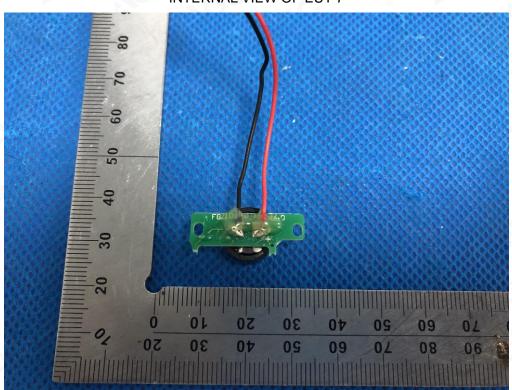

INTERNAL VIEW OF EUT-8

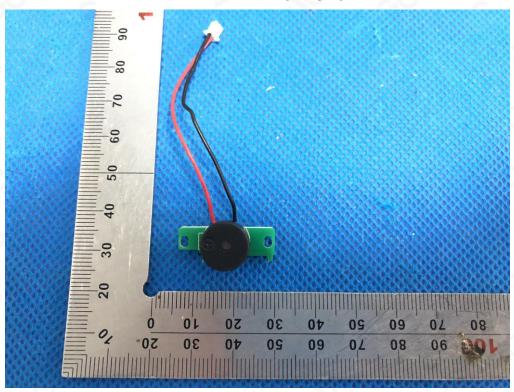




 $Attestation\ of\ Global\ Compliance (Shenzhen) Co., Ltd.$

Add: 2/F., Building 2, No.1-4, Chaxi Sanwei Technial Industrial Park, Gushu,






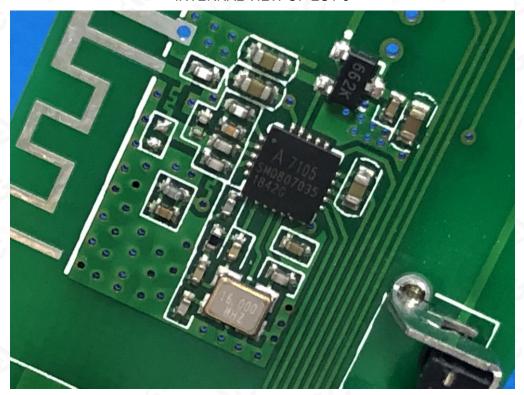

----END OF REPORT----



 $Attestation\ of\ Global\ Compliance (Shenzhen) Co., Ltd.$





Statement

- 1. This report is invalid without the special seal for report of AGC and the signatures of approver.
- 2. This report is invalid if it is blotted out and deleted.
- 3. If the applicant has any questions about results, shall submit to AGC within 15 days.
- 4. This report is responsible for the sample provided by the client only.
- 5. This report shall not be reproduced except in full, or extracted without the written approval of AGC.
- 6. This report photocopy is invalid without the red chop.



Attestation of Global Compliance(Shenzhen)Co.,Ltd.

Add: 2/F., Building 2, No.1-4, Chaxi Sanwei Technial Industrial Park, Gushu,

Xixiang, Bao'an District, Shenzhen, Guangdong, China Tel: +86-755 2523 4088 E-mail:agc@agc-cert.com